Report No.: HK19101306

Equipment Photographs





Report No.: HK19101306


Equipment Photographs






Report No.: HK19101306


Equipment Photographs

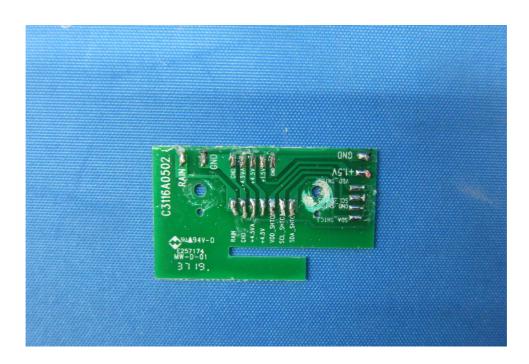


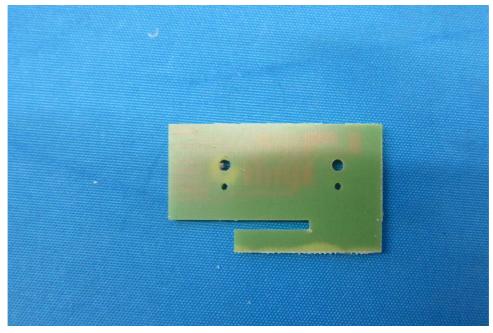

Report No.: HK19101306


Equipment Photographs

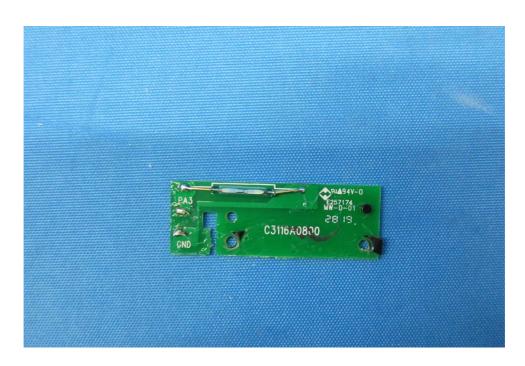


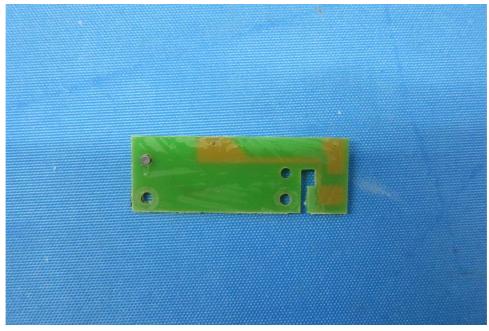

Report No.: HK19101306


Equipment Photographs

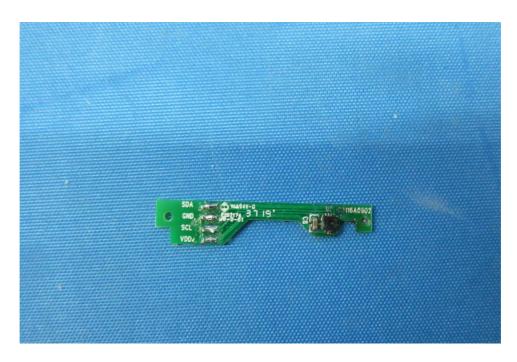


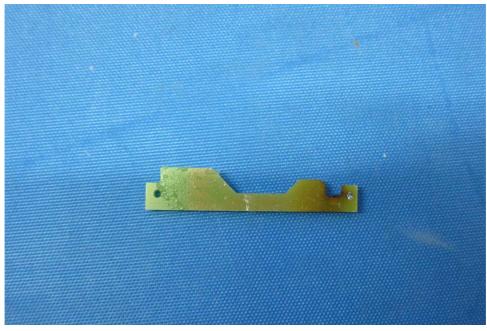

Report No.: HK19101306

Equipment Photographs

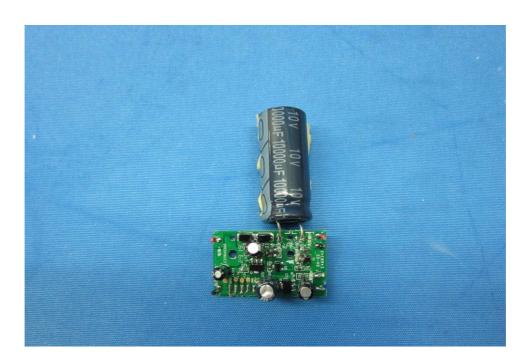


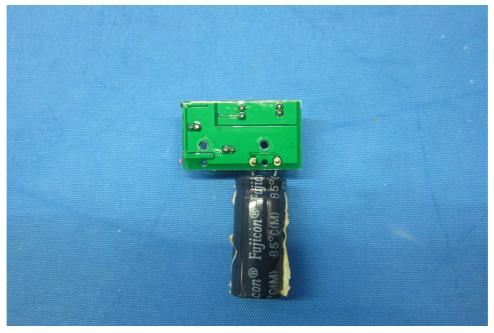

Report No.: HK19101306

Equipment Photographs




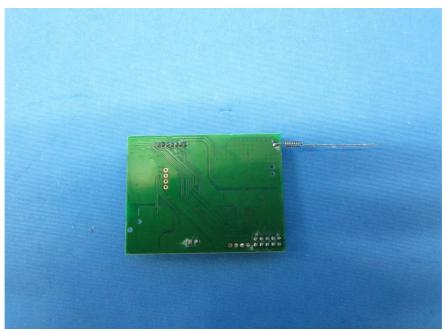

Report No.: HK19101306


Equipment Photographs



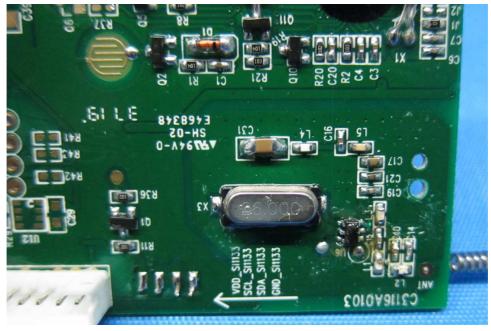

Report No.: HK19101306


Equipment Photographs

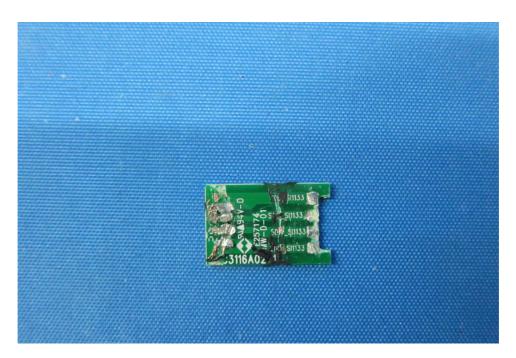




Report No.: HK19101306

Equipment Photographs

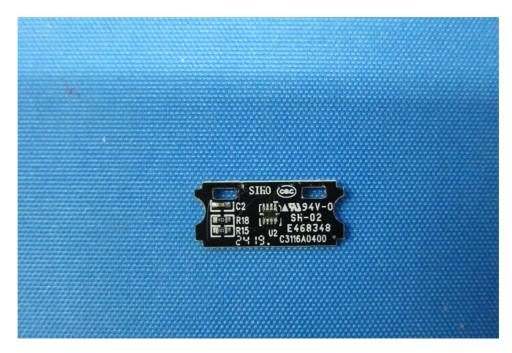


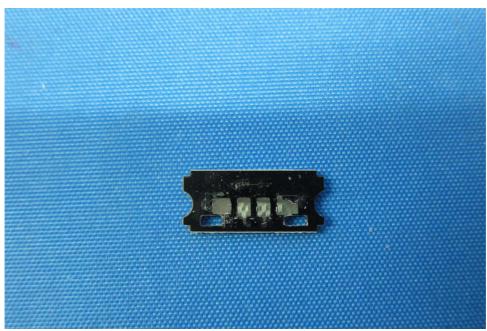

Report No.: HK19101306

Equipment Photographs



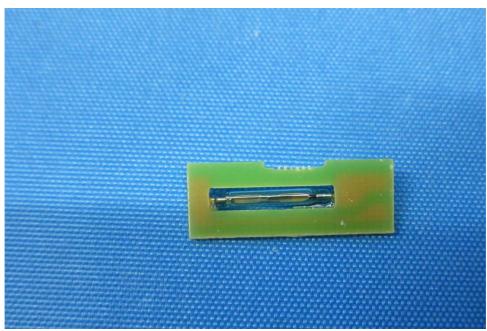

Report No.: HK19101306

Equipment Photographs

