Report No.: HK19101304

Equipment Photographs






Report No.: HK19101304


Equipment Photographs




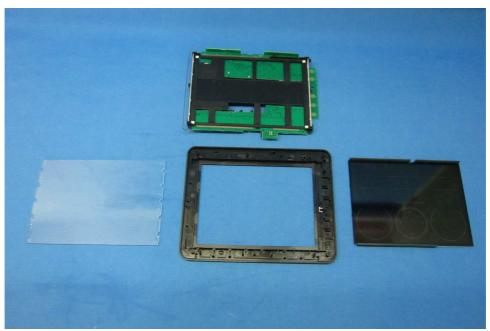

Report No.: HK19101304


Equipment Photographs

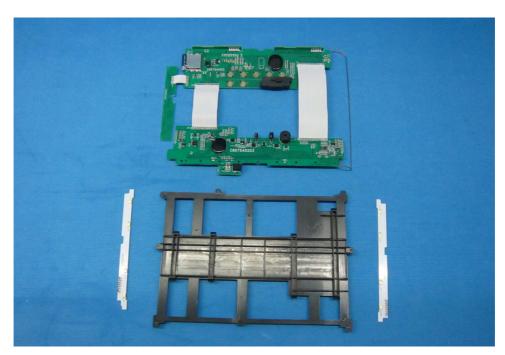


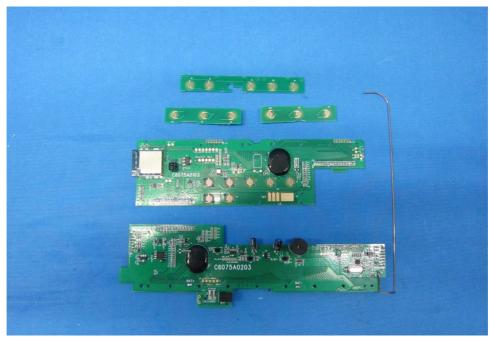

Report No.: HK19101304


Equipment Photographs

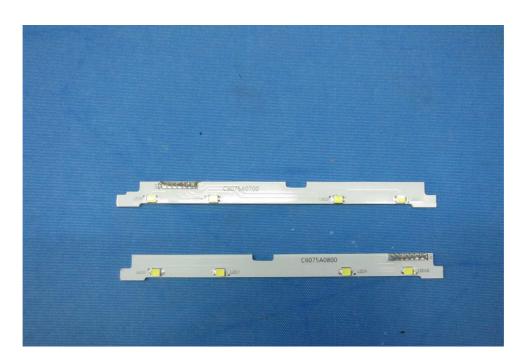

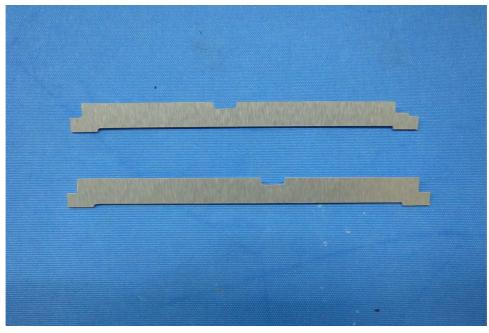

Report No.: HK19101304


Equipment Photographs

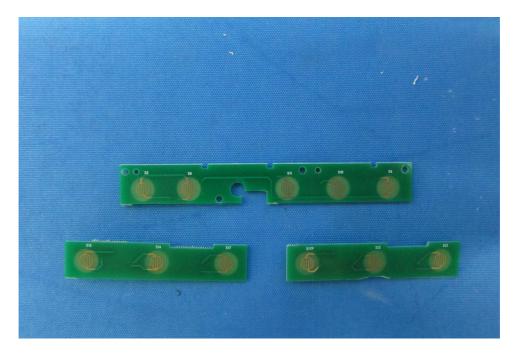



Report No.: HK19101304


Equipment Photographs

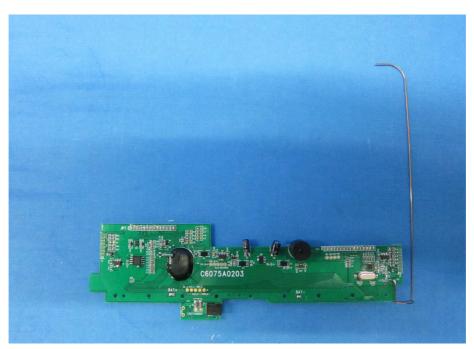




Report No.: HK19101304

Equipment Photographs

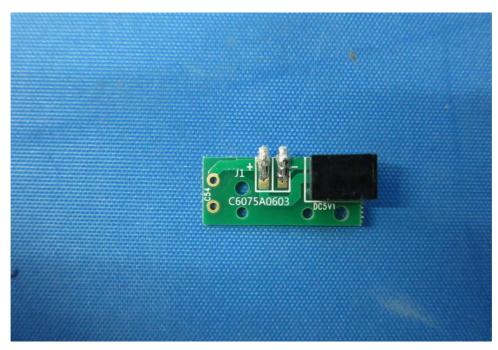


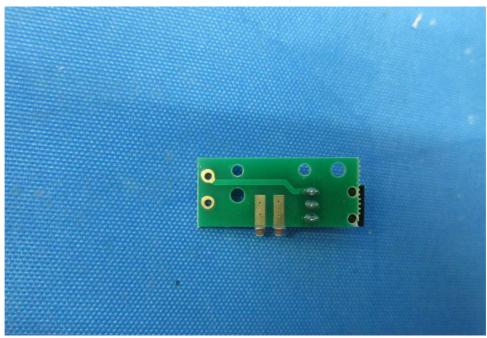

Report No.: HK19101304


Equipment Photographs



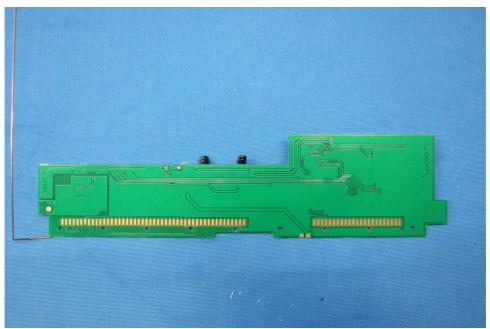

Report No.: HK19101304


Equipment Photographs

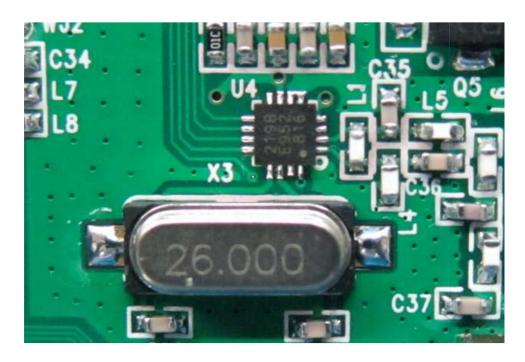




Report No.: HK19101304


Equipment Photographs

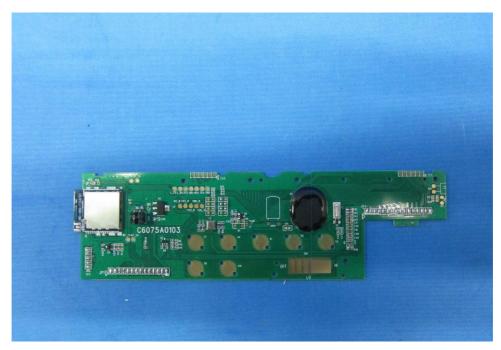


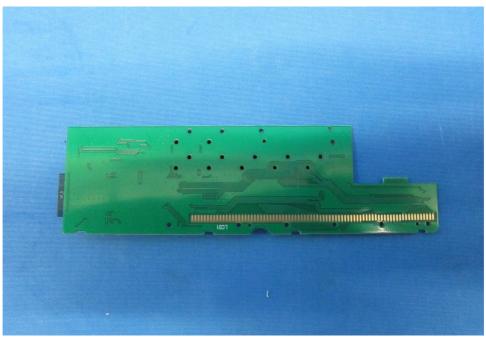

Report No.: HK19101304

Equipment Photographs

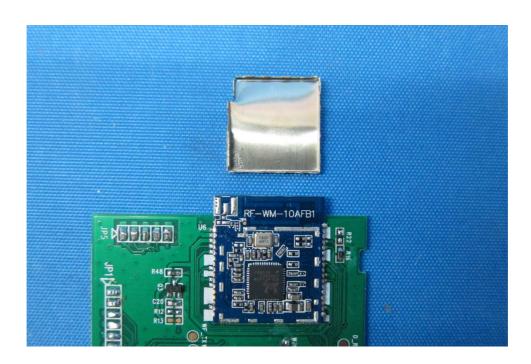

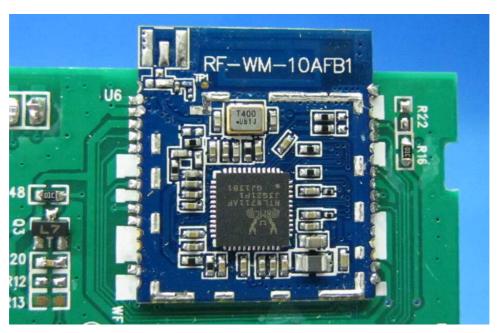

Report No.: HK19101304

Equipment Photographs

