Xlite V3 Wireless Gaming Mouse

Model No.:PXV311
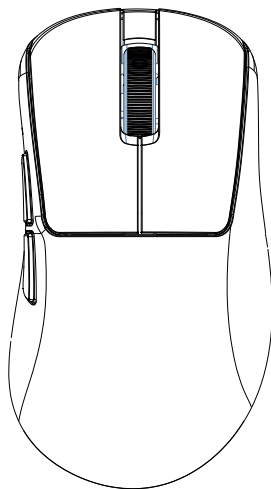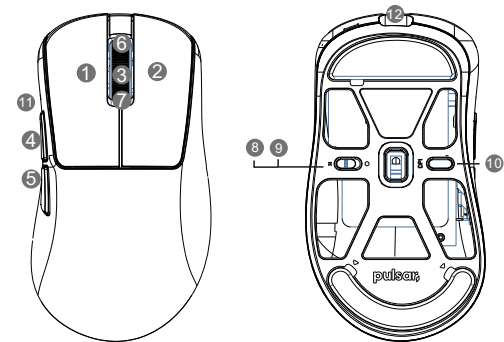
Function layout

①	Left click	⑦	Scroll down
②	Right click	⑧	Power off
③	Middle click	⑨	Power On
④	Forward	⑩	DPI button
⑤	Backward	⑪	Indicator
⑥	Scroll up	⑫	Type-c connector

Instruction

Mouse instruction:
1.Take out the wireless USB Nano receiver from package.
2.Plug the receiver into your computer USB port or use extension adaptor.
3.Turn on the mouse power by switching the power switch on the bottom of the mouse.
4.Waiting for computer installation finished.

DPI setting and indication:
1.DPI level: 400-800-1600-3200,total 4 levels DPI.
2.Press DPI button on bottom to change DPI.

3. The indicator color will indicate the DPI level as below:
   400DPI:cyan color blink. 800DPI:blue color. 1600DPI:purple color.
   3200DPI:white color.

   Note:
   1).DPI can be set by software , MAX DPI is 26000dpi
   2).DPI led effects can be set by software and can turn off the DPI led to save power

Polling rate:
125-250-500-1000Hz can be set by software, default polling rate is 1000Hz

Wired and wireless function:
1.Wired and wireless mode switch automatically, when you plug the receiver into
   computer without cable connection, it will work as wireless mode.

2.If you connect the cable from computer to the mouse, it will switch to wired mode
   automatically and work as wired mode.

Low power and charging indication
1.Low power indication: when mouse battery power is low, the indicator led will blink
   Red color , then you need charge the mouse battery by connection type-c cable.

2.During charging the yellow color led in the wheel will flash, after the battery
   charging full, the indicator will back to previous color mode.

Pairing
1.If your mouse lose connection, you need to use pairing tool to pair the mouse
   and receiver again

Note: If you need customize function, pls download the software from website

⚠ CAUTION

1.Keep the battery dry.
2.Avoid locating the battery terminals near metallic object.
3.Do not short-circuits and avoid metallic or water come into mouse to cause battery short
4.Use computer USB and specified cable to charge the mouse
5.There is a risk of explosion if the battery is replaced with the wrong model.Please Dispose
   of used batteries according to the instructions

Main Specification

Size:	122x66.8x42.8mm
Weight:	55g
Switch	Optical switch
Sensor	PAW3395
Max DPI	26000
Default DPI:	400-800-1600-3200DPI
IPS	650ips
Acceleration	50g(Max)
Polling rate	125-250-500-1000Hz
Interface	USB 2.0
Battery type	Li-ion Polymer Battery
Battery capacity	300mAh
Rating	5V═300mA

pulsar