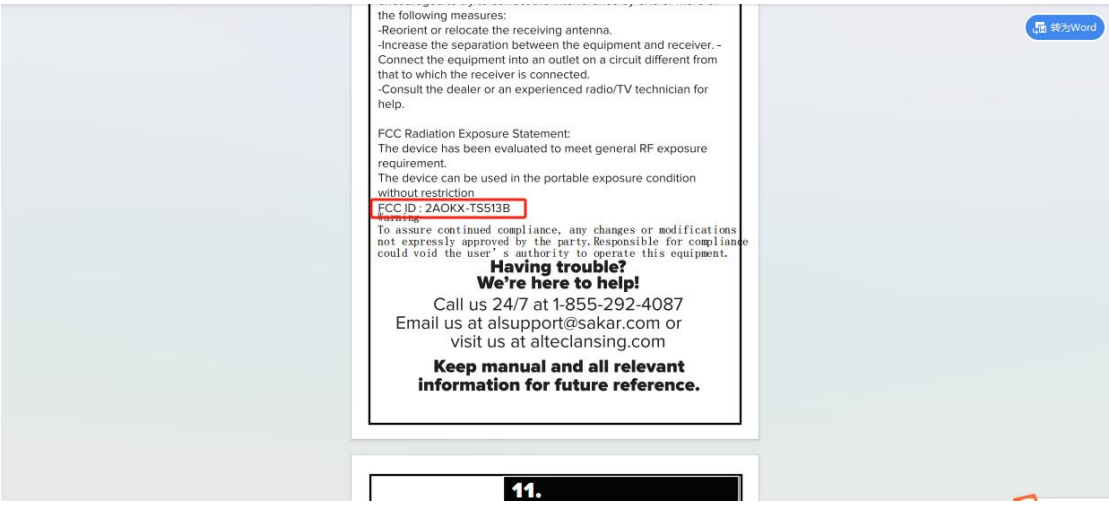

the following measures:
-Reorient or relocate the receiving antenna.
-Increase the separation between the equipment and receiver. -Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
-Consult the dealer or an experienced radio/TV technician for help.

FCC Radiation Exposure Statement:
The device has been evaluated to meet general RF exposure requirement.
The device can be used in the portable exposure condition without restriction

FCC ID : 2AOKX-TS513B

Warning
To assure continued compliance, any changes or modifications not expressly approved by the party. Responsible for compliance could void the user' s authority to operate this equipment.

Having trouble?
We're here to help!
Call us 24/7 at 1-855-292-4087
Email us at alsupport@sakar.com or visit us at alteclansing.com

Keep manual and all relevant information for future reference.

11.

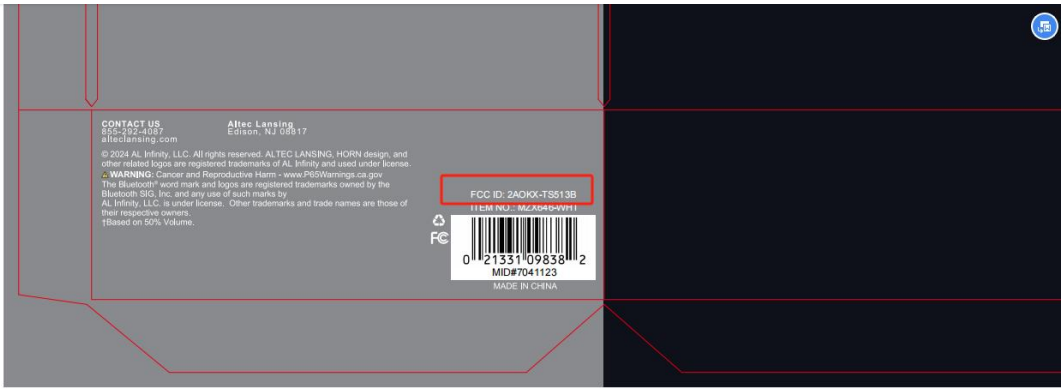

CONTACT US
855-292-4087
alteclansing.com

Altec Lansing
Edison, NJ 08817

© 2024 AL Infinity, LLC. All rights reserved. ALTEC LANSING, HORN design, and other related logos are registered trademarks of AL Infinity and used under license.
⚠ **WARNING:** Cancer and Reproductive Harm - www.P65Warnings.ca.gov
The Bluetooth® word mark and logos are registered trademarks owned by the Bluetooth SIG, Inc. and any use of such marks by AL Infinity, LLC. is under license. Other trademarks and trade names are those of their respective owners.
†Based on 50% Volume.

FCC ID: 2AOKX-TS513B
ITEM NO.: MZX646-WH1
0 21331 09838 2
MID#7041123
MADE IN CHINA

As the product is too small to print the FCC ID on the product, according to the regulations, the FCC ID is printed on the instruction manual and the outer packaging color box.