



Test report No. : 4789482589-US-R0-V0
Page : 1 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

RADIO TEST REPORT

Product : 802.11ac/b/g/n WiFi + Bluetooth M.2 Card
Model Name : WNFT-237ACN(BT)
FCC ID : RYK-WNFT237ACNBT
Test Regulation : FCC 47 CFR Part 15 Subpart C (Section 15.247)
Received Date : May 13, 2020
Test Date : May 18, 2020 ~ Jul. 13, 2020
Issued Date : Jul. 16, 2020

Applicant : SparkLAN Communications, Inc.
8F., No.257, Sec. 2, Tiding Blvd., Neihu District, Taipei City
11493, Taiwan (R.O.C.)

Issued By : Underwriters Laboratories Taiwan Co., Ltd.
Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd.,
Zhudong Township, Hsinchu County, Taiwan



The results reported herein have been performed in accordance with the laboratory's terms of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory. The results in this report are responsible of the test sample(s) provided by the client only and are not to be used to indicate applicability to other similar products.


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0

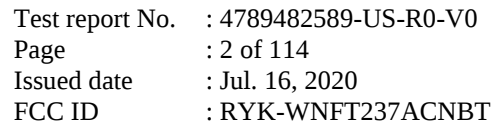

Original Test Report No.: 4789482589-US-R0-V0

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Table Of Contents

1. Attestation of Test Results	4
2. Summary of Test Results	5
3. Test Methodology and Reference Procedures.....	6
4. Facilities and Accreditation	6
5. Measurement Uncertainty	7
6. Equipment under Test	8
6.1. Description of EUT	8
6.2. Channel List	10
6.3. Test Condition	11
6.4. Description Of Available Antennas	11
6.5. Test Mode Applicability and Tested Channel Detail	12
6.6. Duty cycle	13
7. Test Equipment.....	14
8. Description of Test Setup	16
9. Test Results	17
9.1. 6dB Bandwidth	17
9.2. Conducted output power	21
9.3. Power Spectral Density	26
9.4. Conducted Out of Band Emission.....	32
9.5. Radiated Spurious Emission	57
9.6. AC Power Line Conducted Emission	85
Appendix I Radiated Band Edge Measurement	91
Appendix II Radiated Spurious Emission Measurement	107



Test report No. : 4789482589-US-R0-V0
Page : 4 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

1. Attestation of Test Results

APPLICANT: SparkLAN Communications, Inc.
8F., No.257, Sec. 2, Tiding Blvd., Neihu District, Taipei City 11493,
Taiwan (R.O.C.)

MANUFACTURER: SparkLAN Communications, Inc.
8F., No.257, Sec. 2, Tiding Blvd., Neihu District, Taipei City 11493,
Taiwan (R.O.C.)

EUT DESCRIPTION: 802.11ac/b/g/n WiFi + Bluetooth M.2 Card

MODEL: WNFT-237ACN(BT)

SAMPLE STAGE: Identical Prototype

DATE of TESTED: May 18, 2020 ~ Jul. 13, 2020

APPLICABLE STANDARDS	
STANDARD	Test Results
FCC 47 CFR PART 15 Subpart C (Section 15.247)	PASS

Underwriters Laboratories Taiwan Co., Ltd. tested the above equipment in accordance with the requirements set forth in the above standards. All indications of Pass/Fail in this report are opinions expressed by Underwriters Laboratories Taiwan Co., Ltd. based on interpretations and/or observations of test results. The test results show that the equipment tested is capable of demonstrating compliance with the requirements as documented in this report.

Note: The results documented in this report apply only to the tested sample, under the conditions and modes of operation as described herein. This document may not be altered or revised in any way unless done so by Underwriters Laboratories Taiwan Co., Ltd. and all revisions are duly noted in the revisions section. Any alteration of this document not carried out by Underwriters Laboratories Taiwan Co., Ltd. will constitute fraud and shall nullify the document. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, any agency of the Federal Government, or any agency of any government.

Prepared By:

Cindy Hsin
Project Handler

Date : Jul. 16, 2020

Approved and Authorized By:

Howard Kao
Project Engineer

Date : Jul. 16, 2020

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



2. Summary of Test Results

Summary of Test Results		
FCC Clause	Test Items	Result
15.247(a)(2)	6dB Bandwidth	PASS
15.247(b)	Conducted Output Power	PASS
15.247(e)	Power Spectral Density	PASS
15.247(d)	Antenna Port Emission	PASS
15.205 / 15.209 / 15.247(d)	Radiated Emissions and Band Edge Measurement	PASS
15.207	AC Power Conducted Emission	PASS
15.203	Antenna Requirement	PASS

Note:

1. For the Radiated Band Edge test plots were recorded in Appendix I, the Radiated Emissions test plots were recorded in Appendix II.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



3. Test Methodology and Reference Procedures

The tests documented in this report were performed in accordance with 47 CFR FCC Part 2, KDB558074 D01 Meas Guidance v05r02, KDB414788 D01 Radiated Test Site v01r01, ANSI C63.10-2013 and KDB 662911 D01 Multiple Transmitter Output v02r01.

4. Facilities and Accreditation

Test Location	Underwriters Laboratories Taiwan Co., Ltd.
Address	Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Accreditation Certificate	Underwriters Laboratories Taiwan Co., Ltd. is accredited by TAF, Laboratory Code 3398. The full scope of accreditation can be viewed at http://accreditation.taftw.org.tw/taf/public/basic/viewApplyItems.action?unitNo=3398

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



5. Measurement Uncertainty

For statement of conformity, accuracy method (Section 8.2.4 and 8.2.5 of ISO Guide 98-4) was applied as decision rule for measurement in this test report.

The following uncertainties have been calculated to provide a confidence level of 95 % using a coverage factor $k=2$.

Test Item	Measurement Frequency Range	K	U(dB)
Conducted disturbance at mains terminals ports	0.15MHz ~ 30MHz	2	1.7
RF Conducted	9 kHz - 40GHz	2	1.0
Radiated disturbance below 30MHz	9 kHz - 30 MHz	2	2.2
Radiated disturbance below 1 GHz	30MHz ~ 1GHz	2	5.3
Radiated disturbance above 1GHz	1GHz ~ 40GHz	2	4.8

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



6. Equipment under Test

6.1. Description of EUT

Product	802.11ac/b/g/n WiFi + Bluetooth M.2 Card
Model Name	WNFT-237ACN(BT)
Operating Frequency	2412MHz ~ 2472MHz
Modulation	CCK, DQPSK, DBPSK for DSSS 64QAM, 16QAM, QPSK, BPSK for OFDM
Transfer Rate	802.11b: up to 11 Mbps 802.11g: up to 54 Mbps 802.11n: up to MCS15
Number of Channel	13 for 802.11b, 802.11g, 802.11n (HT20) 9 for 802.11n (HT40)
Maximum Output Power	802.11b: 25.99 dBm 802.11g: 29.99 dBm 802.11n (HT20): 29.98 dBm 802.11n (HT40): 25.67 dBm
Normal Voltage	3.3 Vdc
S/N	19662E2008976
Hardware Version	WNFT-237ACN(BT)
Software Version	N/A

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Note:

1. The EUT incorporates a MIMO function. Physically, the EUT provides two completed transmitters and two receivers.

Modulation Mode	Tx,Rx Function
802.11b	2TX,2RX
802.11g	2TX,2RX
802.11n (HT20)	2TX,2RX
802.11n (HT40)	2TX,2RX

2. The EUT contains following accessory devices

Product	Brand	Model	Description
Antenna	Nissei Limited	FML2.4W45A-160-MHF4L	N/A

3. The above EUT information is declared by manufacturer and for more detailed features description, please refer the manufacturer's or user's manual.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



6.2. Channel List

13 channels are provided for 802.11b, 802.11g and 802.11n (HT20):

Channel	Frequency	Channel	Frequency
1	2412MHz	8	2447MHz
2	2417MHz	9	2452MHz
3	2422MHz	10	2457MHz
4	2427MHz	11	2462MHz
5	2432MHz	12	2467MHz
6	2437MHz	13	2472MHz
7	2442MHz	-	-

9 channels are provided for 802.11n (HT40):

Channel	Frequency	Channel	Frequency
3	2422MHz	8	2447MHz
4	2427MHz	9	2452MHz
5	2432MHz	10	2457MHz
6	2437MHz	11	2462MHz
7	2442MHz	-	-

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



6.3. Test Condition

Test Item	Test Site No.	Environmental Condition	Input Power	Test Date	Tested by
Antenna Port Conducted Measurement	SR4	23~26°C / 63~68%RH	120Vac / 60 Hz	May 18, 2020 ~ Jul. 13, 2020	Patrick Kuan
Radiated Spurious Emission	966-2	22~26°C / 62~68%RH	120Vac / 60 Hz	May 19, 2020 ~ Jun. 10, 2020	Mike Cai
AC power Line Conducted Emission	SR1	23~25°C / 63~68%RH	120Vac / 60 Hz	Jun. 10, 2020	Mike Cai

FCC Test Firm Registration Number: 498077

6.4. Description Of Available Antennas

Antenna	Brand Name	Model Name	Antenna Type	Antenna Gain(dBi)
Ant 0	Nissei Limited	FML2.4W45A-160-MHF4L	PCB	3.13
Ant 1	Nissei Limited	FML2.4W45A-160-MHF4L	PCB	3.13

Note: The above antenna information was provided from customer and for more detailed features description, please refer the manufacturer's specification or user's manual.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



6.5. Test Mode Applicability and Tested Channel Detail

- Pre-Scan has been conducted to determine the worst-case mode from all possible combinations between available modulations, data rates and antenna ports (if EUT with antenna diversity architecture).
- For below 1 GHz radiated emission and AC power line conducted emission have performed all modes of operation were investigated and the worst-case emissions are reported.
- For Antenna Port Conducted Measurement, this item includes all test value of each mode, but only includes spectrum plot of worst value of each mode.
- The fundamental of the EUT was investigated in three orthogonal axes X/Y/Z, it was determined that Z axis was worst-case. Therefore, all final radiated testing was performed with the EUT in Z axis.
- For below 30MHz testing, investigation was done on three antenna orientations (parallel, perpendicular, and ground-parallel), parallel and perpendicular are the worst orientations, therefore testing was performed on these two orientations only.
- For AC power line conducted emissions, the pre-scan has been determined by AC power 120Vac/60Hz (worst case)

Test item	Mode	Modulation Technology	Modulation Type	Available Channel	Test Channel	Data Rate
Radiated Emissions (Above 1GHz)	802.11b	DSSS	DBPSK	1 to 13	1,6,11,12,13	1.0
	802.11g	OFDM	BPSK	1 to 13	1,6,11,12,13	6.0
	802.11n(HT20)	OFDM	BPSK	1 to 13	1,6,11,12,13	MCS0
	802.11n(HT40)	OFDM	BPSK	3 to 11	3,6,9,10,11	MCS0
Radiated Emissions (Below 1GHz)	802.11g	OFDM	BPSK	1 to 13	6	MCS0
AC Power Line Conducted Emission	802.11g	OFDM	BPSK	1 to 13	6	MCS0
Antenna Port Conducted Measurement	802.11b	DSSS	DBPSK	1 to 13	1,6,11,12,13	1.0
	802.11g	OFDM	BPSK	1 to 13	1,6,11,12,13	6.0
	802.11n(HT20)	OFDM	BPSK	1 to 13	1,6,11,12,13	MCS0
	802.11n(HT40)	OFDM	BPSK	3 to 11	3,6,9,10,11	MCS0

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0




6.6. Duty cycle

802.11b: Duty cycle = $8.2 / 8.7 = 0.943$, Duty factor = $10 * \log(1/0.943) = 0.26$

802.11g: Duty cycle = $1.35 / 1.865 = 0.724$, Duty factor = $10 * \log(1/0.724) = 1.40$

802.11n (HT20): Duty cycle = $1.255 / 1.775 = 0.707$, Duty factor = $10 * \log(1/0.707) = 1.51$

802.11n (HT40): Duty cycle = $0.59 / 1.135 = 0.52$, Duty factor = $10 * \log(1/0.52) = 2.84$

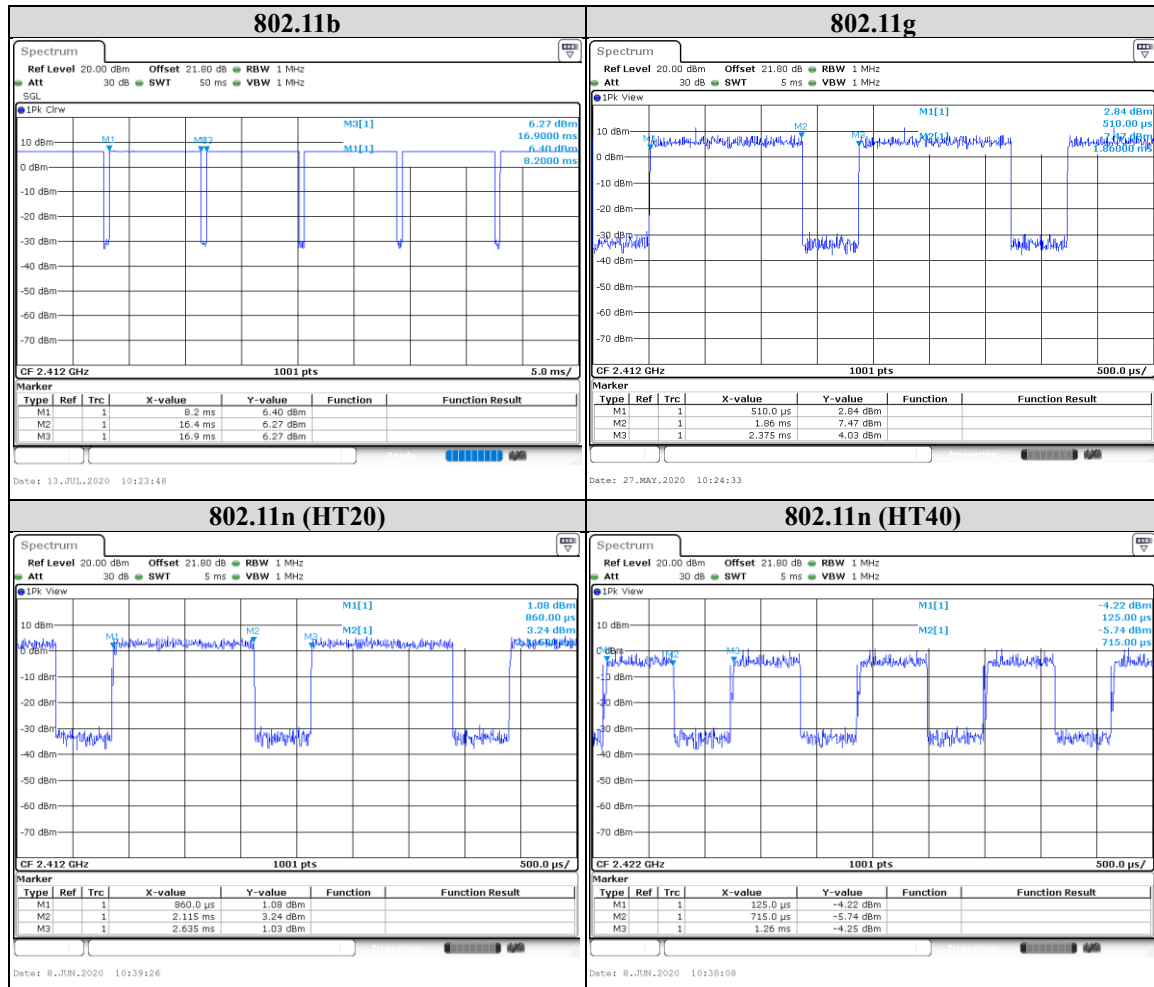

Note: $T_{on} = \text{Mark2} - \text{Mark1}$, $T_{on} + T_{off} = \text{Mark3} - \text{Mark1}$.



7. Test Equipment

Test Equipment List					
Equipment	Manufacturer	Model No.	Serial No.	Cal. Date	Cal. Interval
Radiated Spurious Emission					
Spectrum Analyzer	Keysight	N9010A	MY56070827	Nov. 13, 2019	1 year
EMI Test Receiver	Rohde & Schwarz	ESR7	101754	Dec. 17, 2019	1 year
Loop Antenna	ETS lindgren	6502	00213440	Dec. 19, 2019	1 year
Trilog-Broadband Antenna with 5dB Attenuator	Schwarzbeck & EMCI	VULB 9168 & N-6-05	774 & AT-N0538	Jan. 3, 2020	1 year
Horn Antenna (1-18 GHz)	Schwarzbeck	BBHA 9120 D	01690	Jan. 3, 2020	1 year
Horn Antenna (18-40 GHz)	Schwarzbeck	BBHA 9170	781	Dec. 27, 2019	1 year
Preamplifier (30-1000 MHz)	EMCI	EMC330E	980405	Feb. 4, 2020	1 year
Preamplifier (1-18 GHz)	EMCI	EMC051835BE	980406	Feb. 4, 2020	1 year
Preamplifier (18-40GHz)	EMCI	EMC184040SEE	980426	May 19, 2020	1 year
Cables	Hanyitek	K1K50-UP0264-K1K50-2500	170214-4 & 170425-2	Jan. 8, 2020	1 year
Cables	Hanyitek	K1K50-UP0264-K1K50-2500	170214-1 & 170214-2	Jan. 8, 2020	1 year

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 15 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

Test Equipment List					
Equipment	Manufacturer	Model No.	Serial No.	Cal. Date	Cal. Interval
Antenna Port Conducted Measurement					
Spectrum Analyzer	Keysight	N9010A	MY56070834	Nov. 6, 2019	1 year
FSV40 Signal Analyzer	Rohde & Schwarz	FSV40	101490	Sep. 24, 2019	1 year
Pulse Power Sensor	Anrisu	MA2411B	1531202	Dec. 23, 2019	1 year
Power Meter	Anrisu	ML2495A	1645002	Dec. 23, 2019	1 year
AC power Line Conducted Emission					
EMI Test Receiver	Rohde & Schwarz	ESR7	101753	Nov. 19, 2019	1 year
Two-Line V-Network	Rohde & Schwarz	ENV216	102136	Aug. 8, 2019	1 year
Impuls-Begrenzer Pulse Limiter	Rohde & Schwarz	ESH3-Z2	102219-Qt	Aug. 6, 2019	1 year
Cables	HARBOUR INDUSTRIES	LL142	170205-5000-1	Feb. 5, 2020	1 year

UL Software		
Description	Name	Version
Radiated measurement	E3	6.0
AC power Line Conducted Emission	EZ_EMC	1.1.4.2

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



8. Description of Test Setup


Support Equipment

Equipment	Brand Name	Model Name	S/N	Remark
Notebook	Lenovo	T430	PBE38AK	N/A
Mini PCI-E to ExpressCard board	N/A	N/A	N/A	N/A

Test Setup

Controlled using a bespoke application (MPTool.Ink 1.2.0.5) on a test Notebook. The application was used to enable a continuous transmission mode and to select the test channels, data rates, modulation schemes and power setting as required.

Setup Diagram for Test

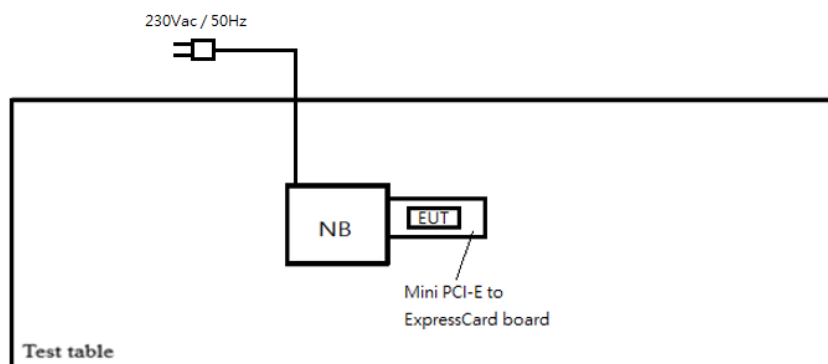

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



9. Test Results

9.1. 6dB Bandwidth


Requirements

The minimum 6 dB bandwidth shall be at least 500 kHz.

Test procedure

- Set resolution bandwidth (RBW) = 100kHz
- Set the video bandwidth (VBW) $\geq 3 \times \text{RBW}$, Detector = Peak.
- Trace mode = max hold.
- Sweep = auto couple.
- Measure the maximum width of the emission that is constrained by the frequencies associated with the two amplitude points (upper and lower) that are attenuated by 6 dB relative to the maximum level measured in the fundamental emission

Test Setup

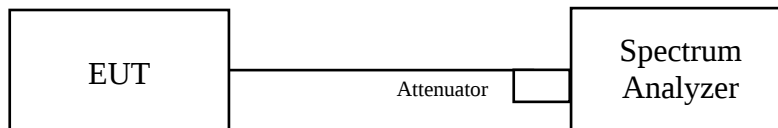

The loss between RF output port of the EUT and the input port of the Spectrum Analyzer has been taken into consideration.



Test Data

802.11b

Channel	Frequency (MHz)	6 dB Bandwidth (MHz)		Minimum Limit (MHz)	Pass / Fail
		Chain 0	Chain 1		
1	2412	10.11	10.07	0.5	Pass
6	2437	10.11	10.11	0.5	Pass
11	2462	10.11	10.07	0.5	Pass
12	2467	10.11	10.11	0.5	Pass
13	2472	10.07	10.07	0.5	Pass

802.11g

Channel	Frequency (MHz)	6 dB Bandwidth (MHz)		Minimum Limit (MHz)	Pass / Fail
		Chain 0	Chain 1		
1	2412	16.30	15.50	0.5	Pass
6	2437	15.70	15.34	0.5	Pass
11	2462	15.90	15.50	0.5	Pass
12	2467	15.86	16.02	0.5	Pass
13	2472	16.30	16.26	0.5	Pass

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11n (HT20)

Channel	Frequency (MHz)	6 dB Bandwidth (MHz)		Minimum Limit (MHz)	Pass / Fail
		Chain 0	Chain 1		
1	2412	16.26	15.90	0.5	Pass
6	2437	15.90	16.26	0.5	Pass
11	2462	16.86	16.26	0.5	Pass
12	2467	15.90	16.26	0.5	Pass
13	2472	17.54	17.54	0.5	Pass

802.11n (HT40)

Channel	Frequency (MHz)	6 dB Bandwidth (MHz)		Minimum Limit (MHz)	Pass / Fail
		Chain 0	Chain 1		
3	2422	35.16	35.16	0.5	Pass
6	2437	35.16	35.16	0.5	Pass
9	2452	35.16	35.16	0.5	Pass
10	2457	35.16	35.16	0.5	Pass
11	2462	35.08	35.08	0.5	Pass

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 20 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

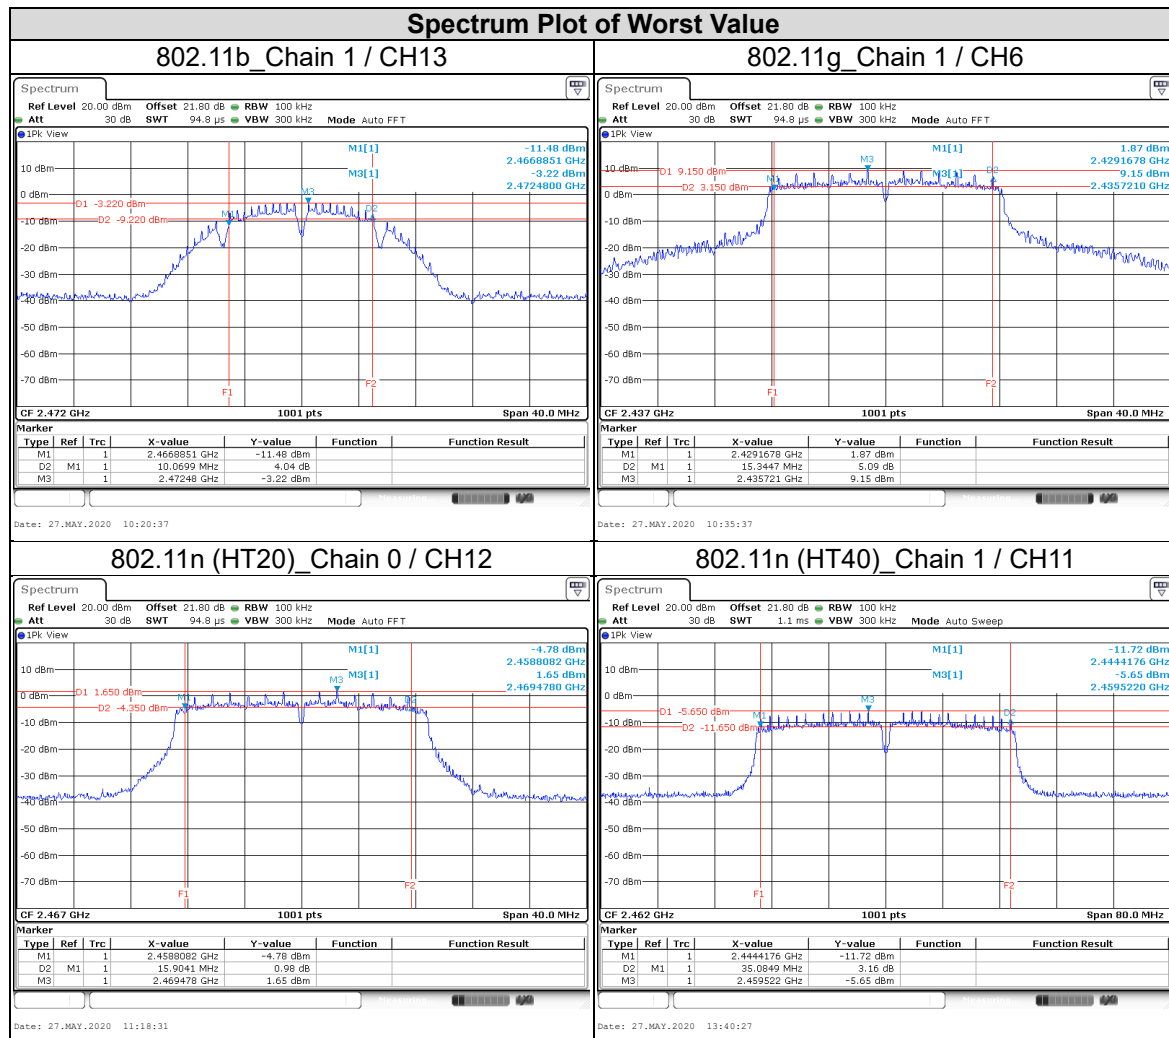

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



9.2. Conducted output power

Requirements

For systems using digital modulation in the 2400-2483.5 MHz bands: 1 Watt.

Per KDB 662911 D01 Multiple Transmitter Output Method of conducted output power measurement on IEEE 802.11 devices,

Array Gain = 0 dB (i.e., no array gain) for $N_{ANT} \leq 4$;

Array Gain = 0 dB (i.e., no array gain) for channel widths ≥ 40 MHz for any N_{ANT} ;


Array Gain = $5 \log(N_{ANT}/N_{SS})$ dB or 3 dB, whichever is less for 20-MHz channel widths with $N_{ANT} \geq 5$.

For power measurements on all other devices: Array Gain = $10 \log(N_{ANT}/N_{SS})$ dB.

Test Procedure

A peak power sensor was used on the output port of the EUT. A power meter was used to read the response of the peak power sensor. Record the power level.

Test Setup



The loss between RF output port of the EUT and the input port of the Power Meter has been taken into consideration.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test Data

Peak Power

802.11b

Channel	Frequency (MHz)	Peak Power (dBm)		Total Power (mW)	Total Power (dBm)	Limit (dBm)	Pass / Fail
		Chain 0	Chain 1				
1	2412	18.03	17.81	123.93	20.93	30	Pass
6	2437	23.1	22.86	397.37	25.99	30	Pass
11	2462	21.05	20.87	249.53	23.97	30	Pass
12	2467	16.45	16.34	87.21	19.41	30	Pass
13	2472	11.89	11.96	31.16	14.94	30	Pass

802.11g

Channel	Frequency (MHz)	Peak Power (dBm)		Total Power (mW)	Total Power (dBm)	Limit (dBm)	Pass / Fail
		Chain 0	Chain 1				
1	2412	23.89	24.34	516.55	27.13	30	Pass
6	2437	27.03	26.93	997.84	29.99	30	Pass
11	2462	23.76	24.72	534.17	27.28	30	Pass
12	2467	21.27	22.01	292.82	24.67	30	Pass
13	2472	18.22	18.91	144.18	21.59	30	Pass

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11n (HT20)

Channel	Frequency (MHz)	Peak Power (dBm)		Total Power (mW)	Total Power (dBm)	Limit (dBm)	Pass / Fail
		Chain 0	Chain 1				
1	2412	23.74	23.75	473.73	26.76	30	Pass
6	2437	27.03	26.91	995.57	29.98	30	Pass
11	2462	21.03	20.68	243.72	23.87	30	Pass
12	2467	20.72	21.36	254.81	24.06	30	Pass
13	2472	17.65	17.69	116.96	20.68	30	Pass

802.11n (HT40)

Channel	Frequency (MHz)	Peak Power (dBm)		Total Power (mW)	Total Power (dBm)	Limit (dBm)	Pass / Fail
		Chain 0	Chain 1				
3	2422	22.76	22.55	368.69	25.67	30	Pass
6	2437	22.08	21.37	298.52	24.75	30	Pass
9	2452	20.31	19.79	202.68	23.07	30	Pass
10	2457	18.63	18.03	136.48	21.35	30	Pass
11	2462	17.26	17.61	110.89	20.45	30	Pass

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Average Power (Reference Only)

802.11b

Channel	Frequency (MHz)	Average Power (dBm)		Total Power (mW)	Total Power (dBm)
		Chain 0	Chain 1		
1	2412	16.37	15.89	82.17	19.15
6	2437	21.15	20.98	255.63	24.08
11	2462	19.05	18.88	157.62	21.98
12	2467	14.47	14.3	54.91	17.40
13	2472	9.91	9.93	19.64	12.93

802.11g

Channel	Frequency (MHz)	Average Power (dBm)		Total Power (mW)	Total Power (dBm)
		Chain 0	Chain 1		
1	2412	13.92	13.88	49.09	16.91
6	2437	20.82	21.05	248.13	23.95
11	2462	13.99	14.08	50.65	17.05
12	2467	11.22	11.33	26.83	14.29
13	2472	8.25	8.36	13.54	11.32

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11n (HT20)

Channel	Frequency (MHz)	Average Power (dBm)		Total Power (mW)	Total Power (dBm)
		Chain 0	Chain 1		
1	2412	14.30	14.27	53.65	17.30
6	2437	20.96	21.04	251.80	24.01
11	2462	12.91	12.45	37.12	15.70
12	2467	11.06	11.23	26.04	14.16
13	2472	8.22	8.26	13.34	11.25

802.11n (HT40)

Channel	Frequency (MHz)	Average Power (dBm)		Total Power (mW)	Total Power (dBm)
		Chain 0	Chain 1		
3	2422	13.02	13.06	40.28	16.05
6	2437	13.43	12.81	41.13	16.14
9	2452	11.39	10.69	25.49	14.06
10	2457	10.02	9.81	19.62	12.93
11	2462	7.62	7.48	11.38	10.56

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



9.3. Power Spectral Density

Requirements

The Maximum of Power Spectral Density Measurement is 8dBm in any 3 kHz (If $G_{TX} > 6$ dBi, then $PSD = 8 - (G_{TX} - 6)$).

Note:

1. PSD = power spectral density that the same method as used to determine the conducted output power shall be used to determine the power spectral density. And power spectral density in dBm/MHz.
2. G_{TX} = the maximum transmitting antenna directional gain in dBi.
3. Directional Gain = $G_{ant} + 10 \log (N_{ant})$ dBi.


Nant: Number of Transmit Antennas

G1, G2,..., Gn: Gain of Individual Antennas (Same for Each Antenna)

Test procedure

- a. Set analyzer center frequency to DTS channel center frequency.
- b. Set the span to 1.5 times the DTS bandwidth.
- c. Set the RBW to: $3 \text{ kHz} \leq \text{RBW} \leq 100 \text{ kHz}$.
- d. Set the VBW $\geq 3 \times \text{RBW}$.
- e. Detector = peak.
- f. Sweep time = auto couple.
- g. Trace mode = max hold.
- h. Allow trace to fully stabilize.
- i. Use the peak marker function to determine the maximum amplitude level within the RBW.

Test Setup

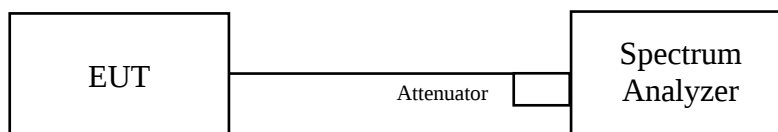

The loss between RF output port of the EUT and the input port of the Spectrum Analyzer has been taken into consideration.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test Data

802.11b

TX Chain	Channel	Freq. (MHz)	PSD (dBm/3 kHz)	10 log (N=2) dB	Total PSD (dBm/3 kHz)	Limit (dBm/3 kHz)	Pass / Fail
0	1	2412	-7.39	3.01	-4.38	7.86	Pass
	6	2437	-4.82	3.01	-1.81	7.86	Pass
	11	2462	-7.55	3.01	-4.54	7.86	Pass
	12	2467	-11.94	3.01	-8.93	7.86	Pass
	13	2472	-16.65	3.01	-13.64	7.86	Pass
1	1	2412	-8.63	3.01	-5.62	7.86	Pass
	6	2437	-5.09	3.01	-2.08	7.86	Pass
	11	2462	-7.20	3.01	-4.19	7.86	Pass
	12	2467	-12.02	3.01	-9.01	7.86	Pass
	13	2472	-16.55	3.01	-13.54	7.86	Pass

NOTE: Directional gain = 6.14 dBi > 6 dBi, so the limit shall be reduced.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11g

TX Chain	Channel	Freq. (MHz)	PSD (dBm/3 kHz)	10 log (N=2) dB	Total PSD (dBm/3 kHz)	Limit (dBm/3 kHz)	Pass / Fail
0	1	2412	-12.65	3.01	-9.64	7.86	Pass
	6	2437	-4.54	3.01	-1.53	7.86	Pass
	11	2462	-10.10	3.01	-7.09	7.86	Pass
	12	2467	-12.14	3.01	-9.13	7.86	Pass
	13	2472	-15.82	3.01	-12.81	7.86	Pass
1	1	2412	-15.29	3.01	-12.28	7.86	Pass
	6	2437	-6.07	3.01	-3.06	7.86	Pass
	11	2462	-12.46	3.01	-9.45	7.86	Pass
	12	2467	-15.17	3.01	-12.16	7.86	Pass
	13	2472	-17.67	3.01	-14.66	7.86	Pass

NOTE: Directional gain = 6.14 dBi > 6 dBi, so the limit shall be reduced.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11n (HT20)

TX Chain	Channel	Freq. (MHz)	PSD (dBm/3 kHz)	10 log (N=2) dB	Total PSD (dBm/3 kHz)	Limit (dBm/3 kHz)	Pass / Fail
0	1	2412	-12.80	3.01	-9.79	7.86	Pass
	6	2437	-4.27	3.01	-1.26	7.86	Pass
	11	2462	-13.13	3.01	-10.12	7.86	Pass
	12	2467	-12.58	3.01	-9.57	7.86	Pass
	13	2472	-16.97	3.01	-13.96	7.86	Pass
1	1	2412	-14.25	3.01	-11.24	7.86	Pass
	6	2437	-5.38	3.01	-2.37	7.86	Pass
	11	2462	-13.17	3.01	-10.16	7.86	Pass
	12	2467	-14.05	3.01	-11.04	7.86	Pass
	13	2472	-17.86	3.01	-14.85	7.86	Pass

NOTE: Directional gain = 6.14 dBi > 6 dBi, so the limit shall be reduced.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11n (HT40)

TX Chain	Channel	Freq. (MHz)	PSD (dBm/3 kHz)	10 log (N=2) dB	Total PSD (dBm/3 kHz)	Limit (dBm/3 kHz)	Pass / Fail
0	3	2422	-16.62	3.01	-13.61	7.86	Pass
	6	2437	-14.40	3.01	-11.39	7.86	Pass
	9	2452	-16.26	3.01	-13.25	7.86	Pass
	10	2457	-17.68	3.01	-14.67	7.86	Pass
	11	2462	-18.32	3.01	-15.31	7.86	Pass
1	3	2422	-17.04	3.01	-14.03	7.86	Pass
	6	2437	-15.53	3.01	-12.52	7.86	Pass
	9	2452	-17.41	3.01	-14.40	7.86	Pass
	10	2457	-19.06	3.01	-16.05	7.86	Pass
	11	2462	-19.70	3.01	-16.69	7.86	Pass

NOTE: Directional gain = 6.14 dBi > 6 dBi, so the limit shall be reduced.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 31 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

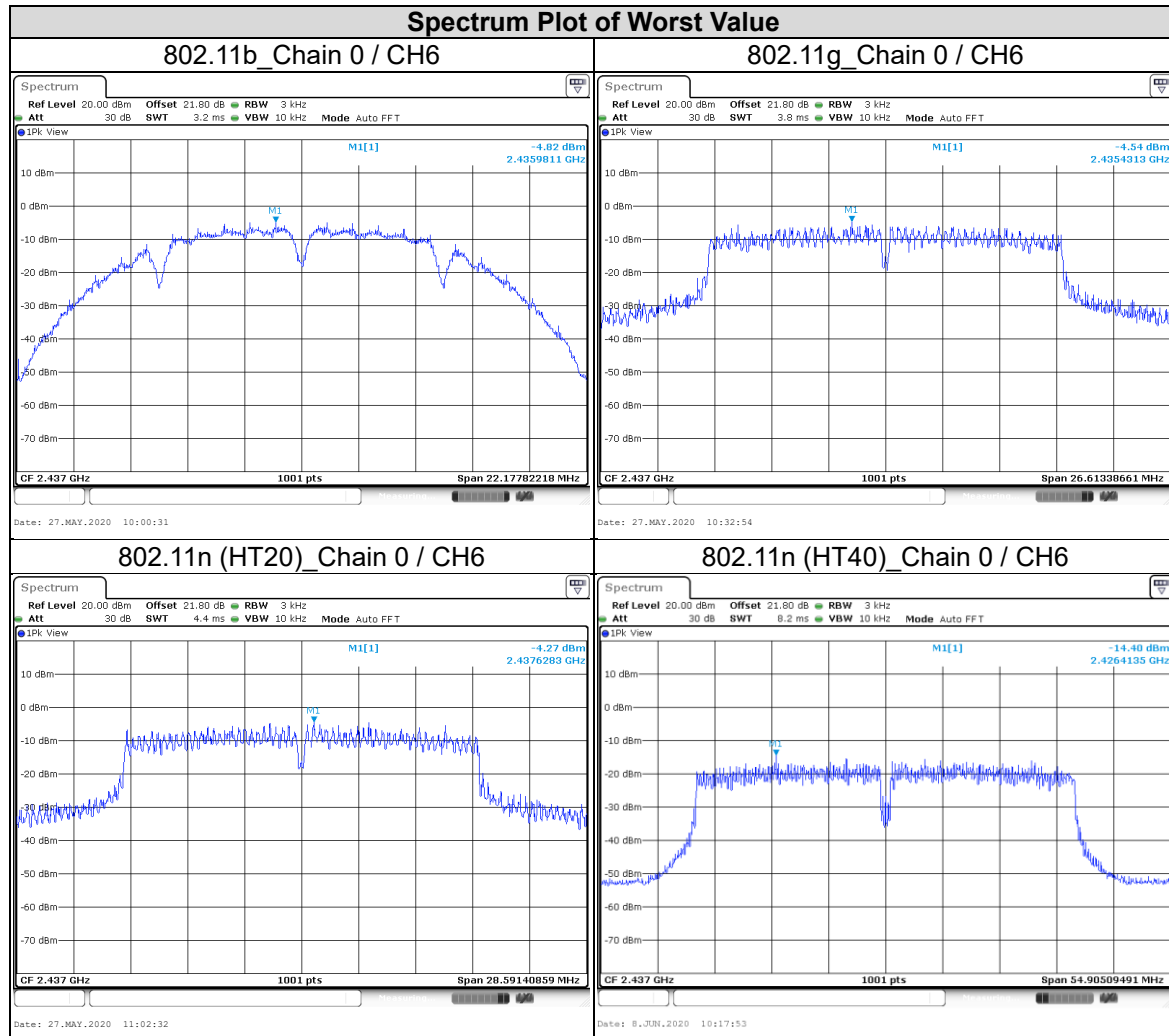

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



9.4. Conducted Out of Band Emission

Requirements

In any 100 kHz bandwidth outside the frequency band in which the spread spectrum or digitally modulated intentional radiator is operating, the radio frequency power that is produced by the intentional radiator shall be at least 20 dB below that in the 100 kHz bandwidth within the band that contains the highest level of the desired power, based on either an RF conducted or a radiated measurement, provided the transmitter demonstrates compliance with the peak conducted power limits. If the transmitter complies with the conducted power limits based on the use of RMS averaging over a time interval, as permitted under paragraph (b) (3) of this section, the attenuation required under this paragraph shall be 30 dB instead of 20 dB. Attenuation below the general limits specified in §15.209 (a) is not required.

Test procedure


Measurement Procedure REF

1. Set the RBW = 100 kHz.
2. Set the VBW $\geq$ 300 kHz.
3. Set the span to 1.5 times the DTS bandwidth.
4. Detector = peak.
5. Sweep time = auto couple.
6. Trace mode = max hold.
7. Allow trace to fully stabilize.
8. Use the peak marker function to determine the maximum power level in any 100 kHz band segment within the fundamental EBW.

Measurement Procedure OOBE

1. Set RBW = 100 kHz.
2. Set VBW $\geq$ 300 kHz.
3. Detector = peak.
4. Sweep = auto couple.
5. Trace Mode = max hold.
6. Allow trace to fully stabilize.
7. Use the peak marker function to determine the maximum amplitude level.

Test Setup

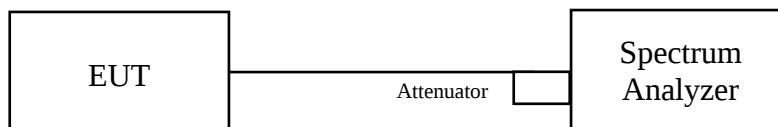

The loss between RF output port of the EUT and the input port of the Spectrum Analyzer has been taken into consideration.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0




Test report No. : 4789482589-US-R0-V0
Page : 33 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

Test Data

802.11b

CHAIN 0

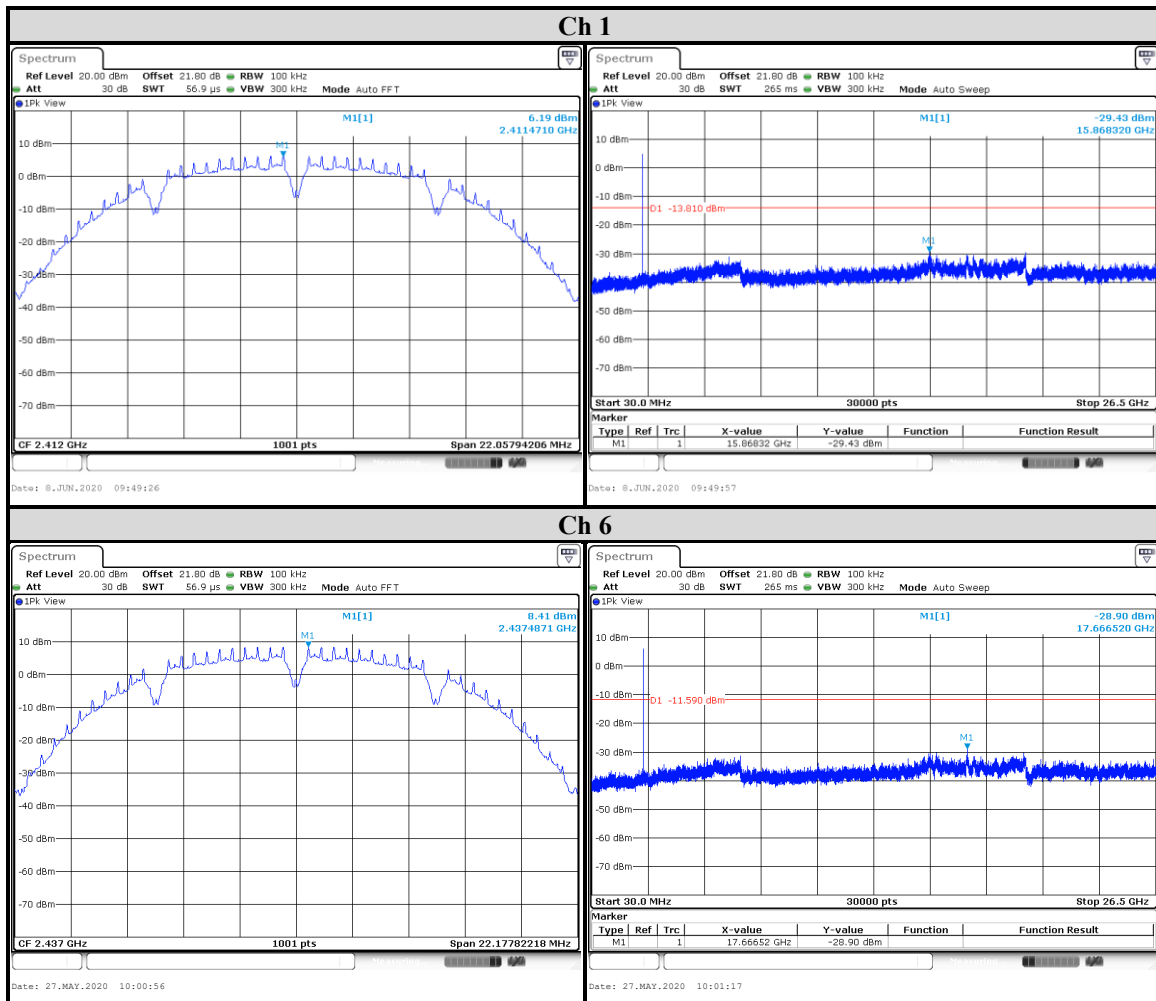

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 34 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

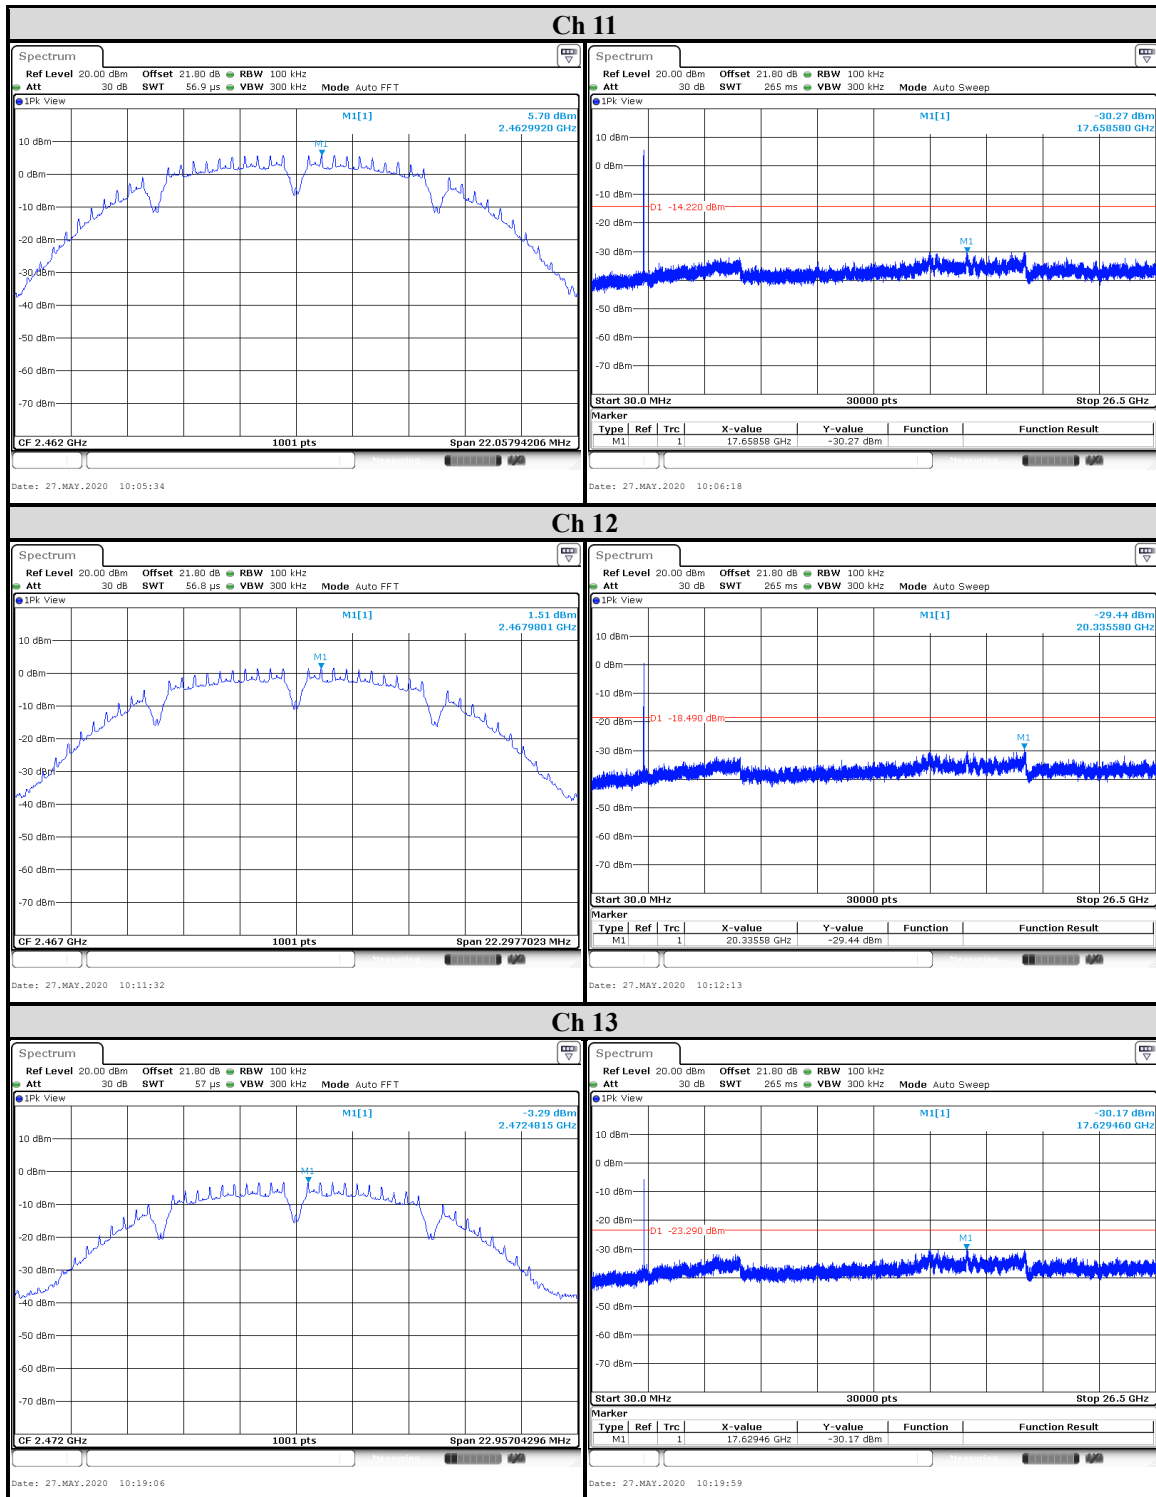

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 35 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

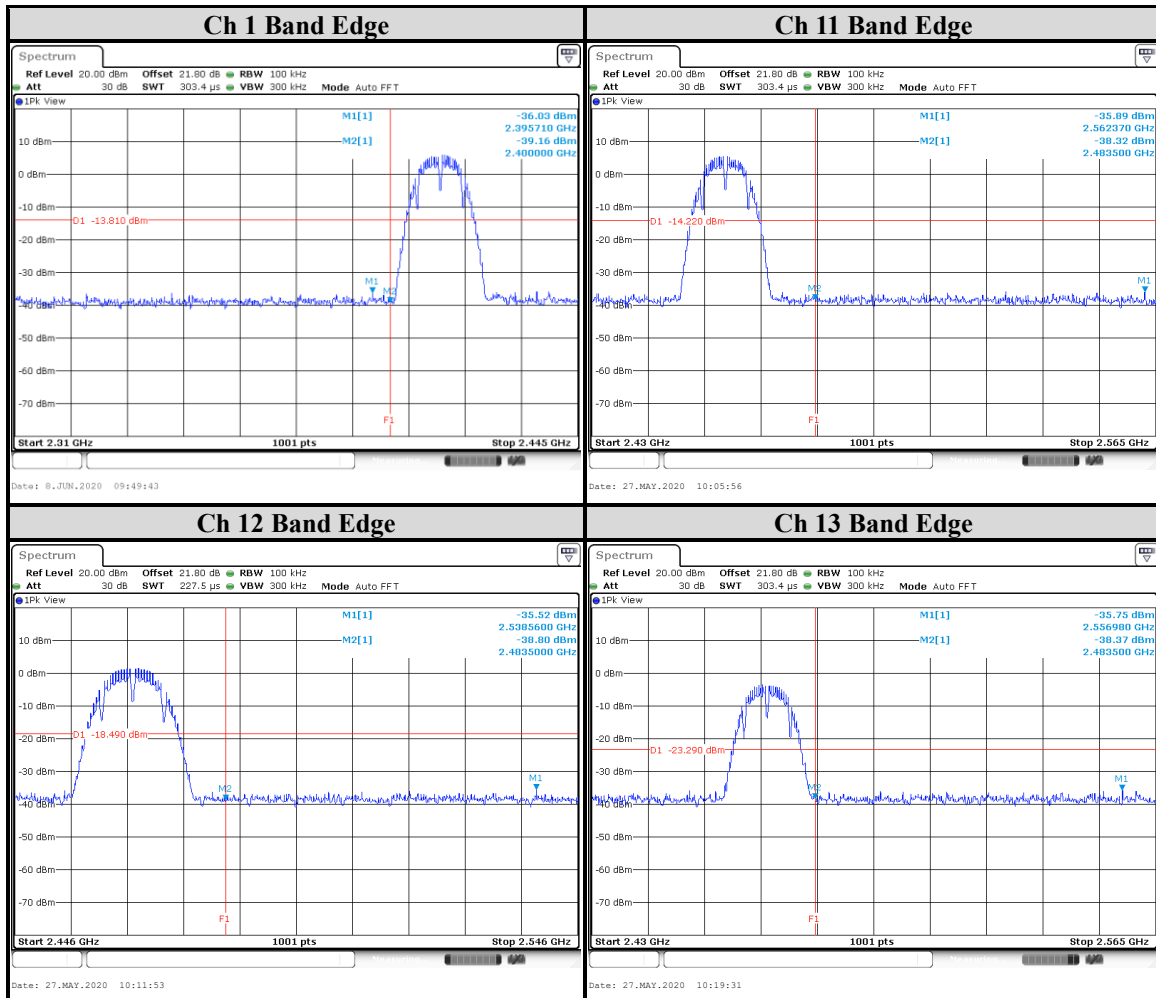

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 36 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

CHAIN 1

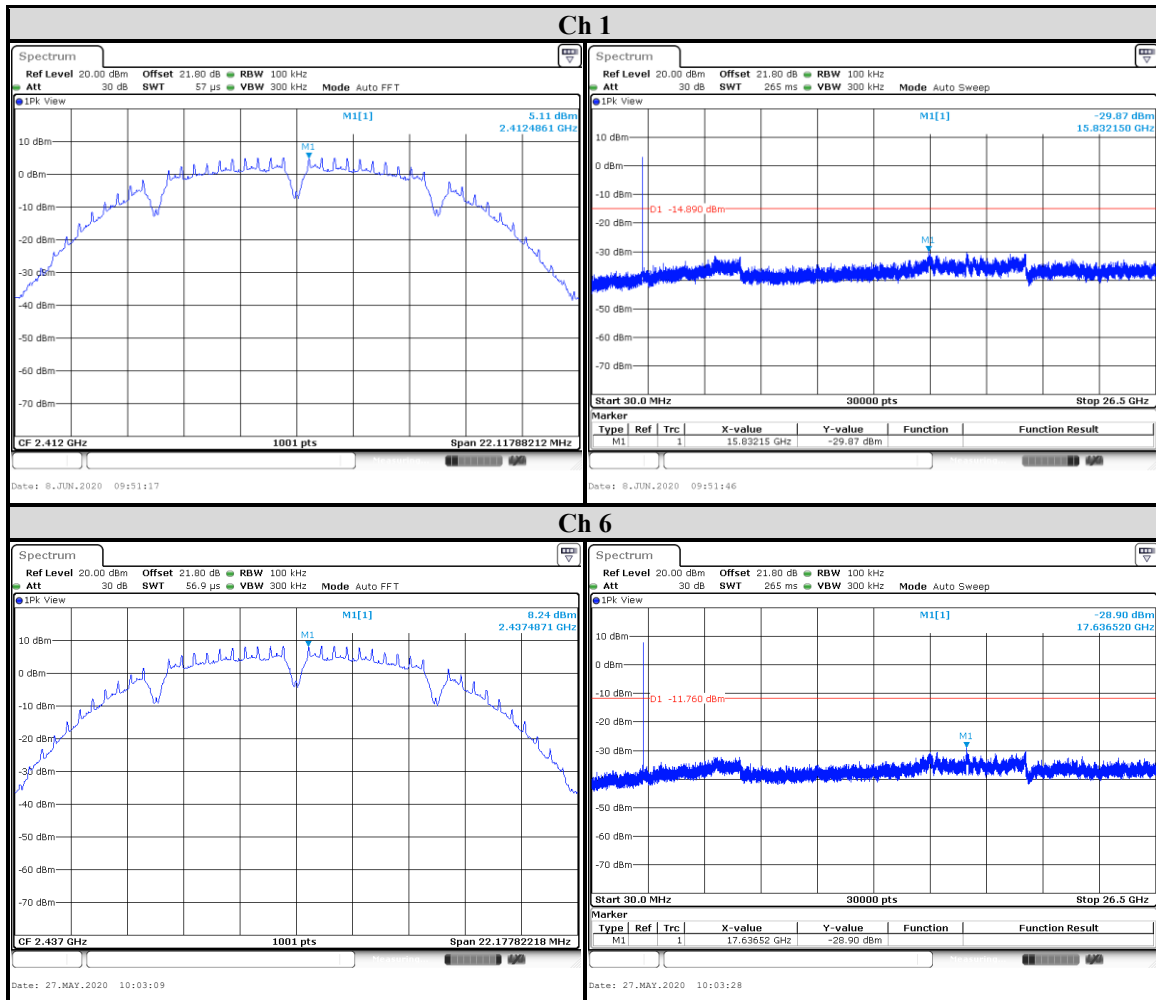

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 37 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

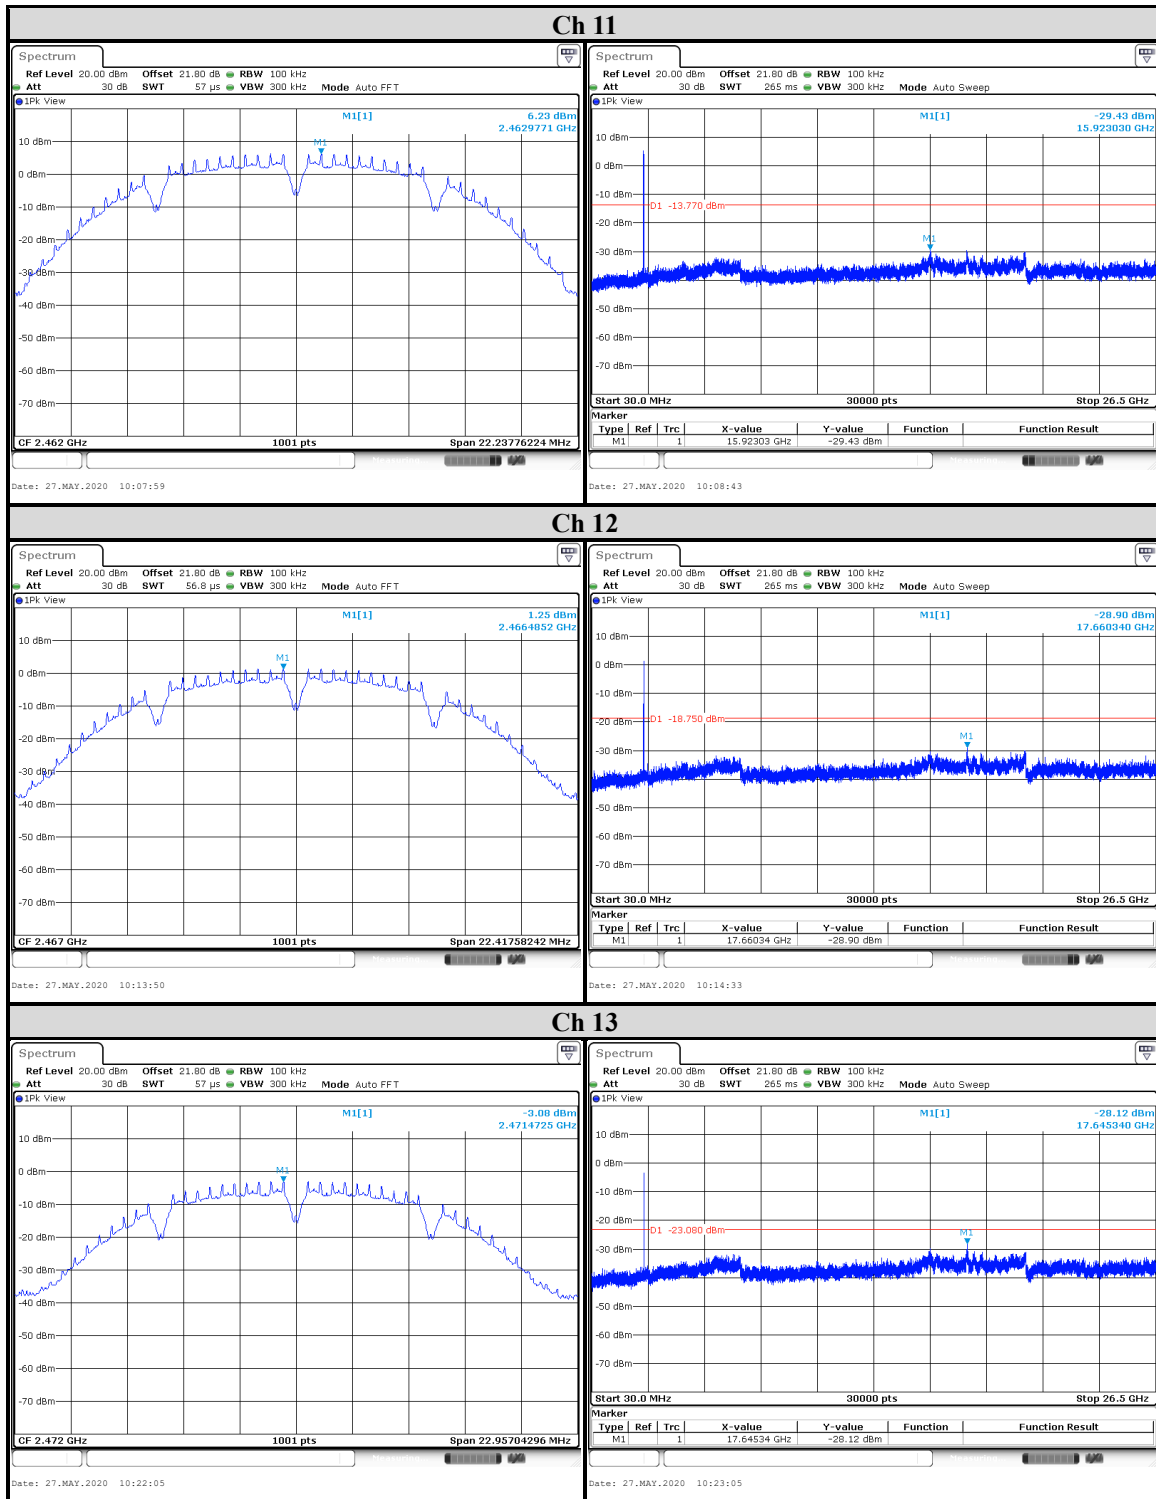

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 38 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

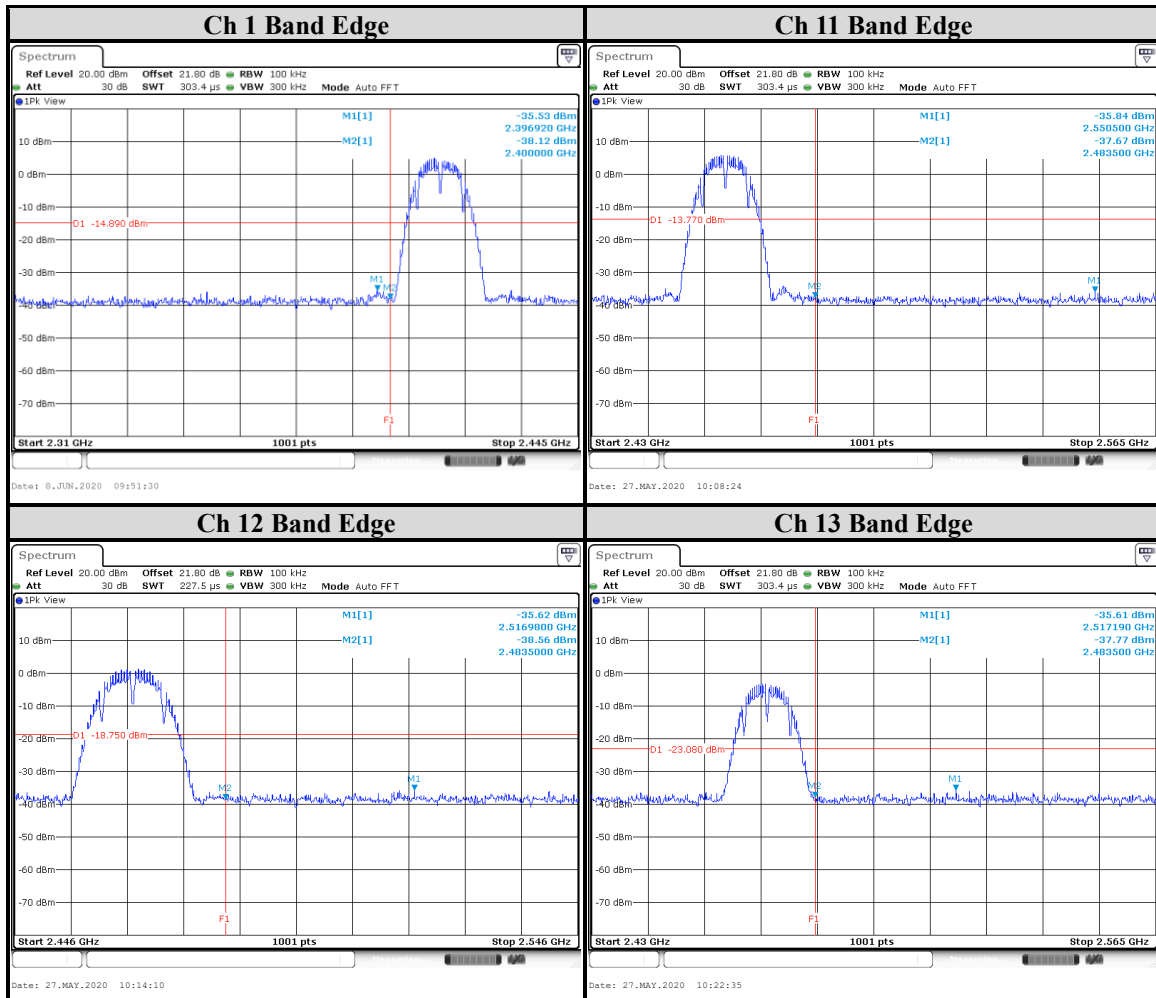

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



802.11g

CHAIN 0

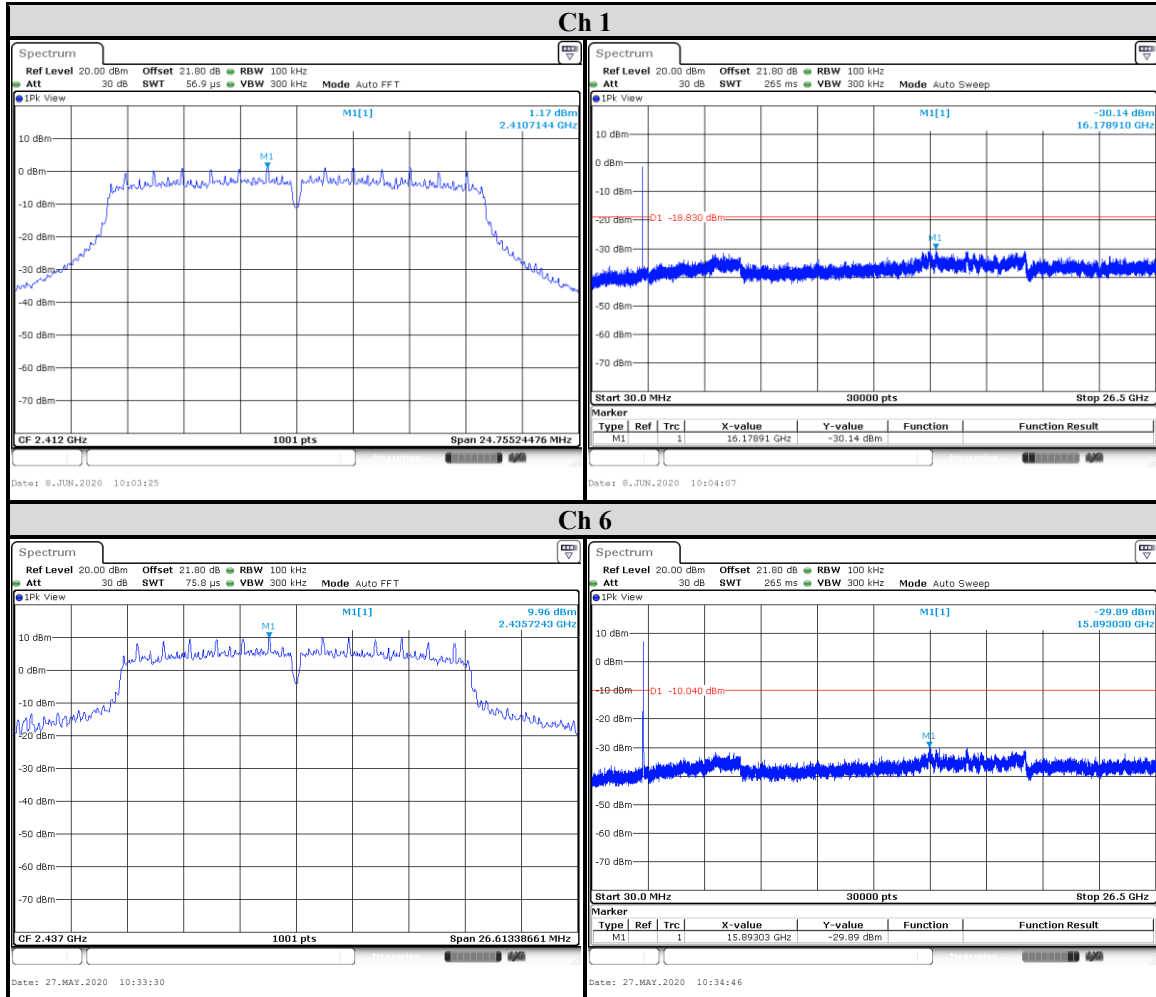

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 40 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

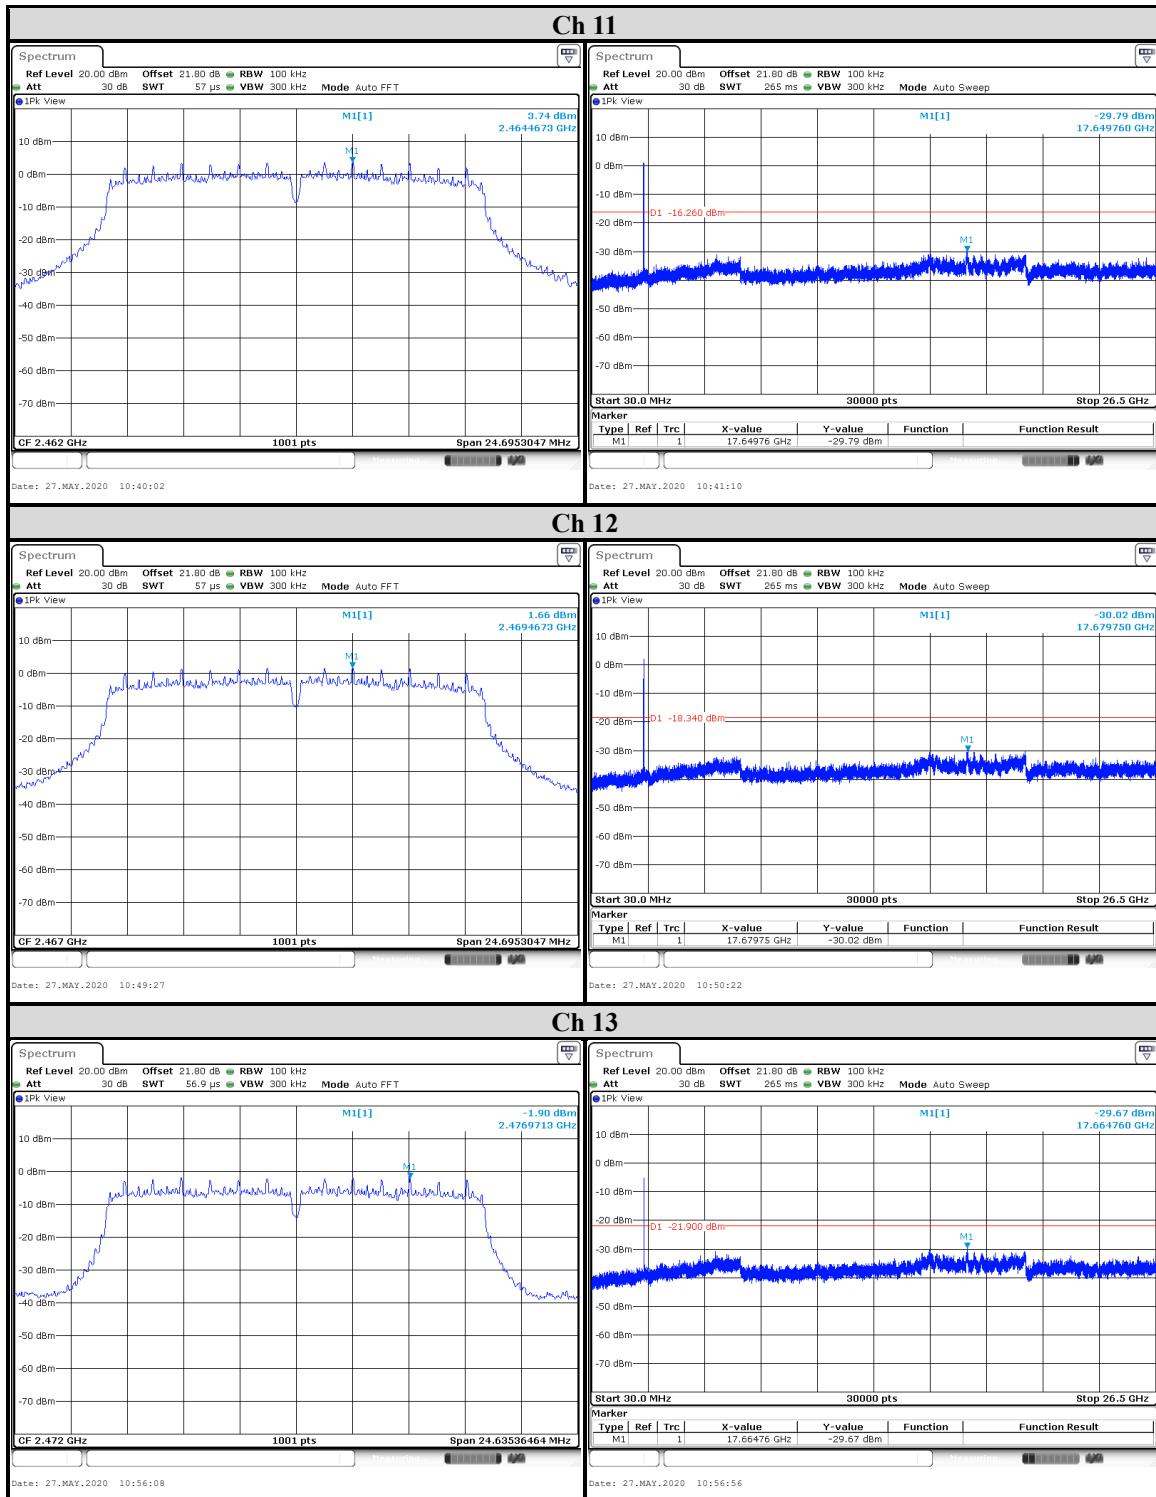

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 41 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

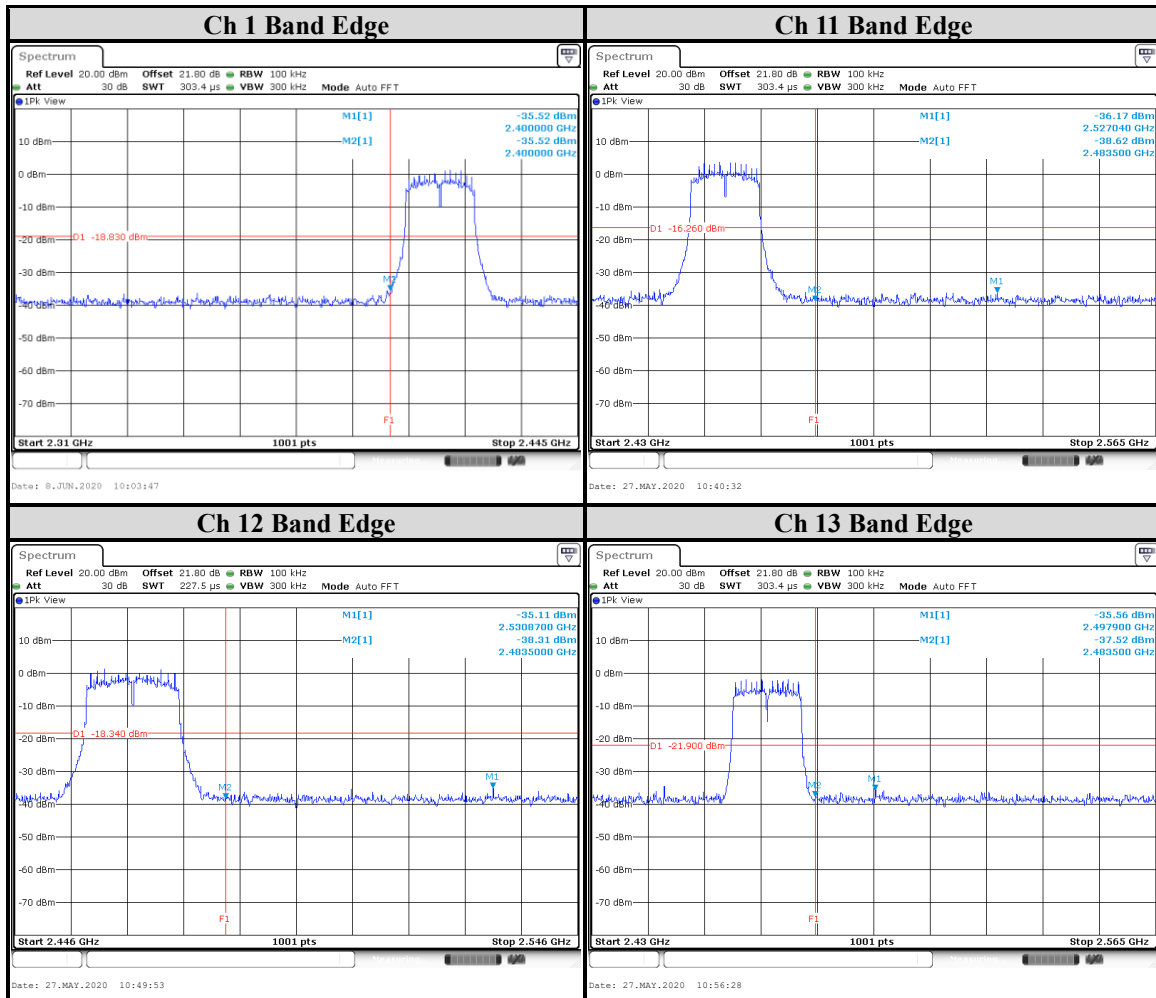

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 42 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

CHAIN 1

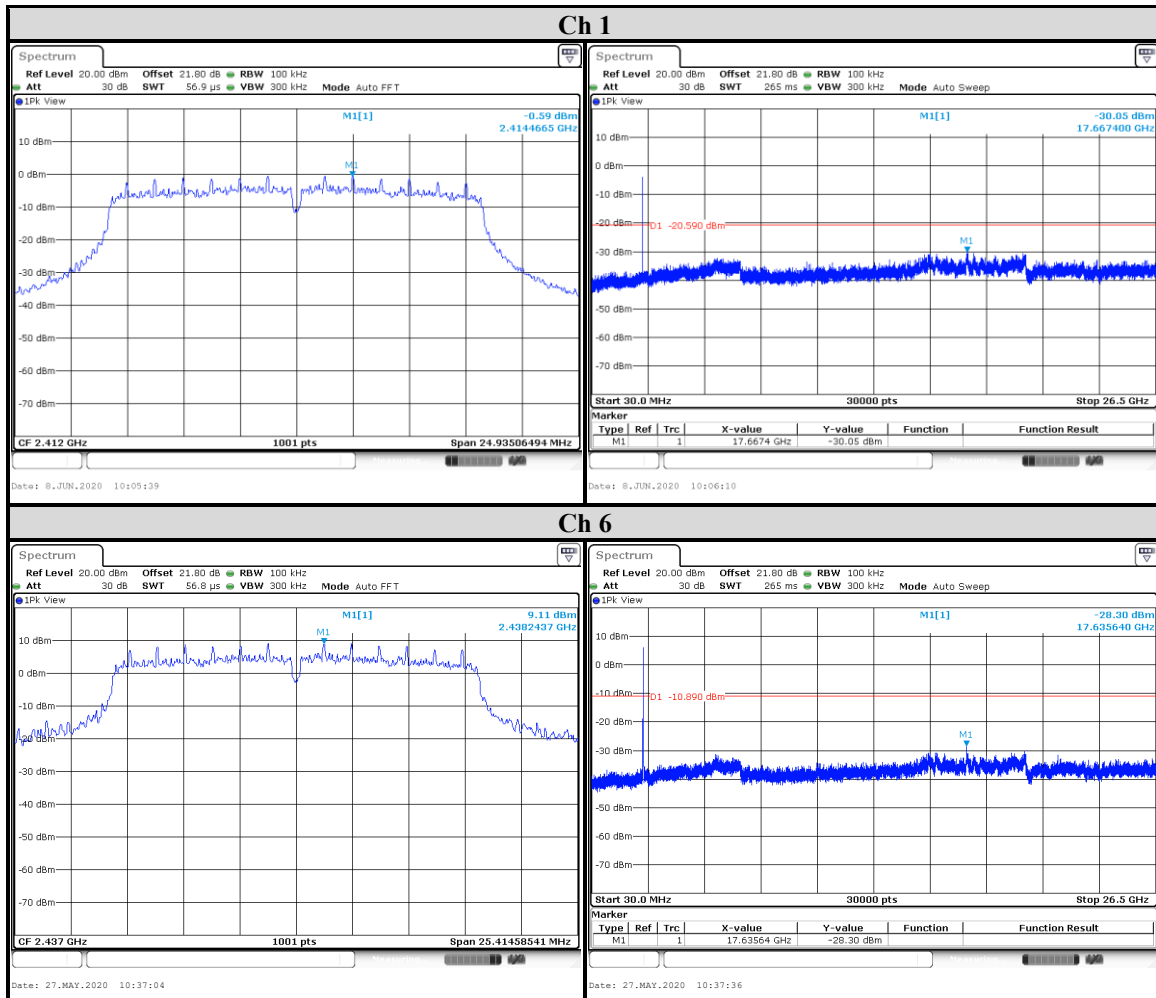

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 43 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

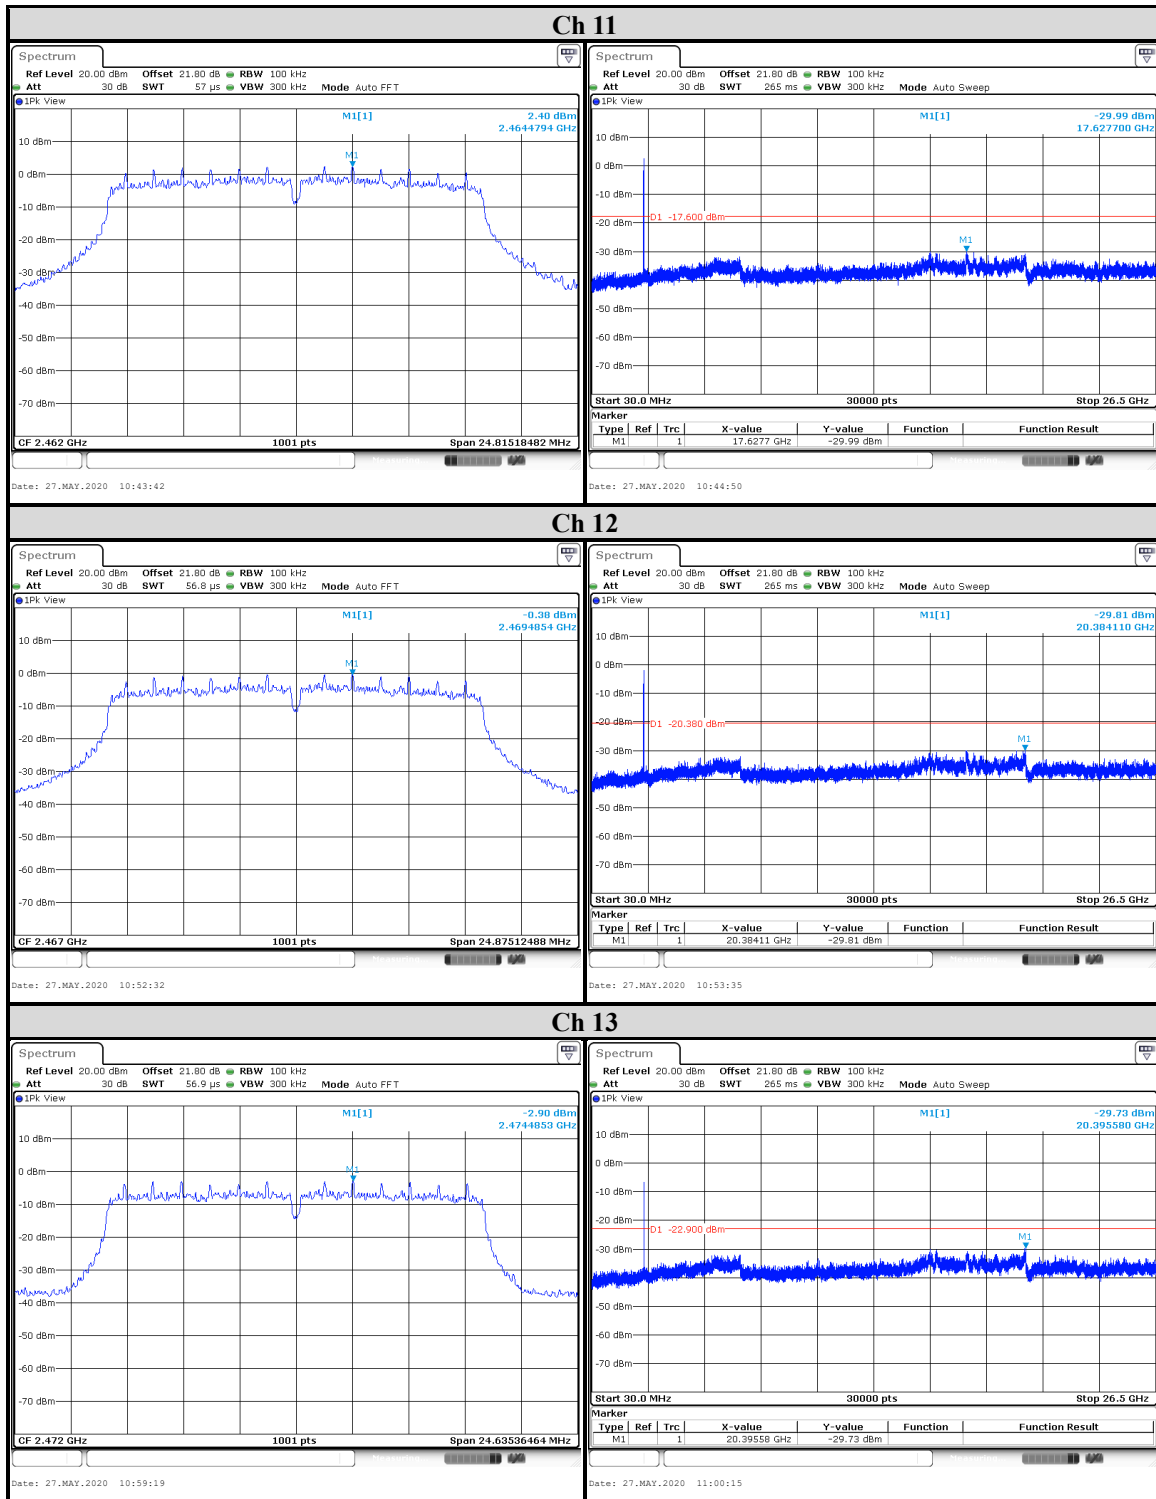

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 44 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

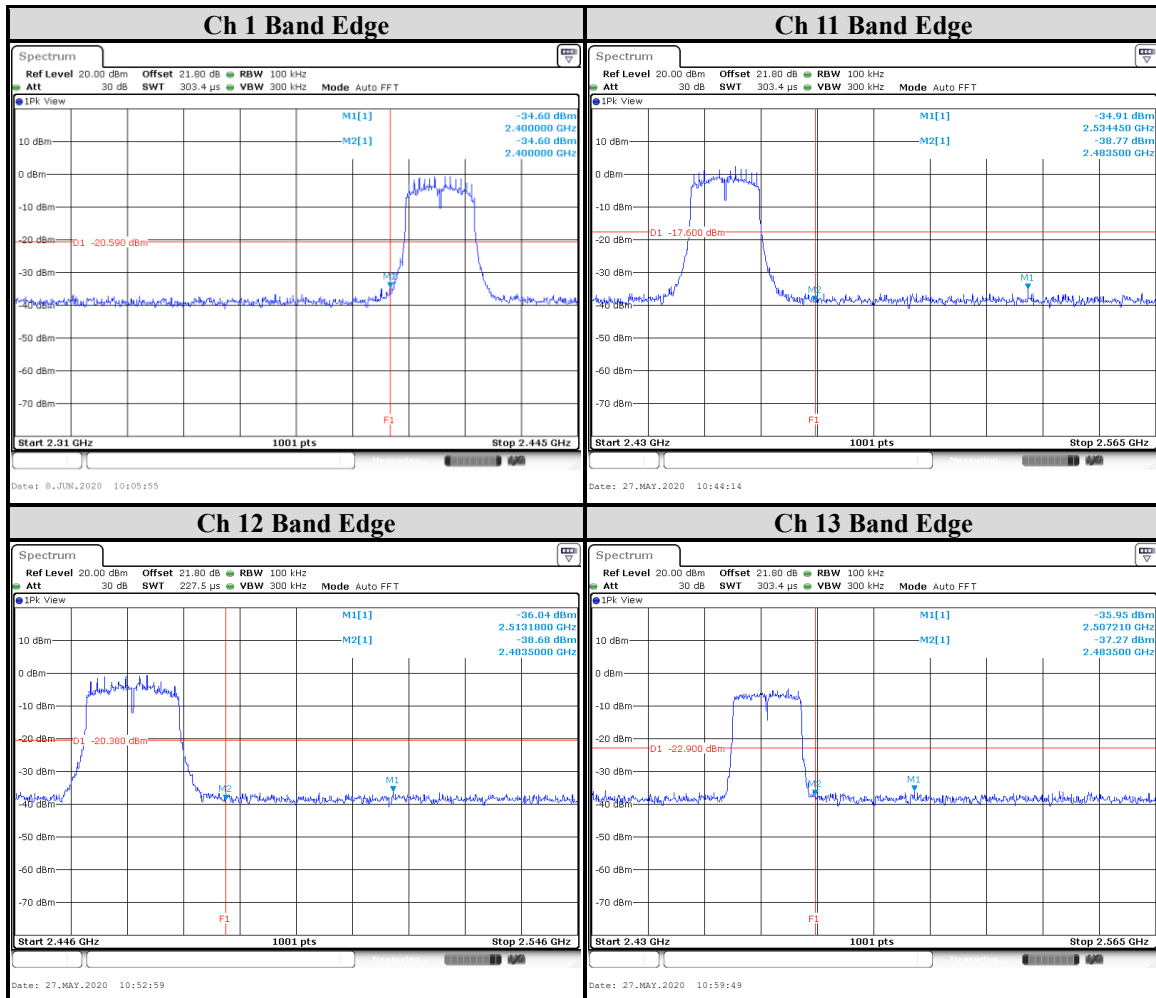

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 45 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

802.11n (HT20)

CHAIN 0

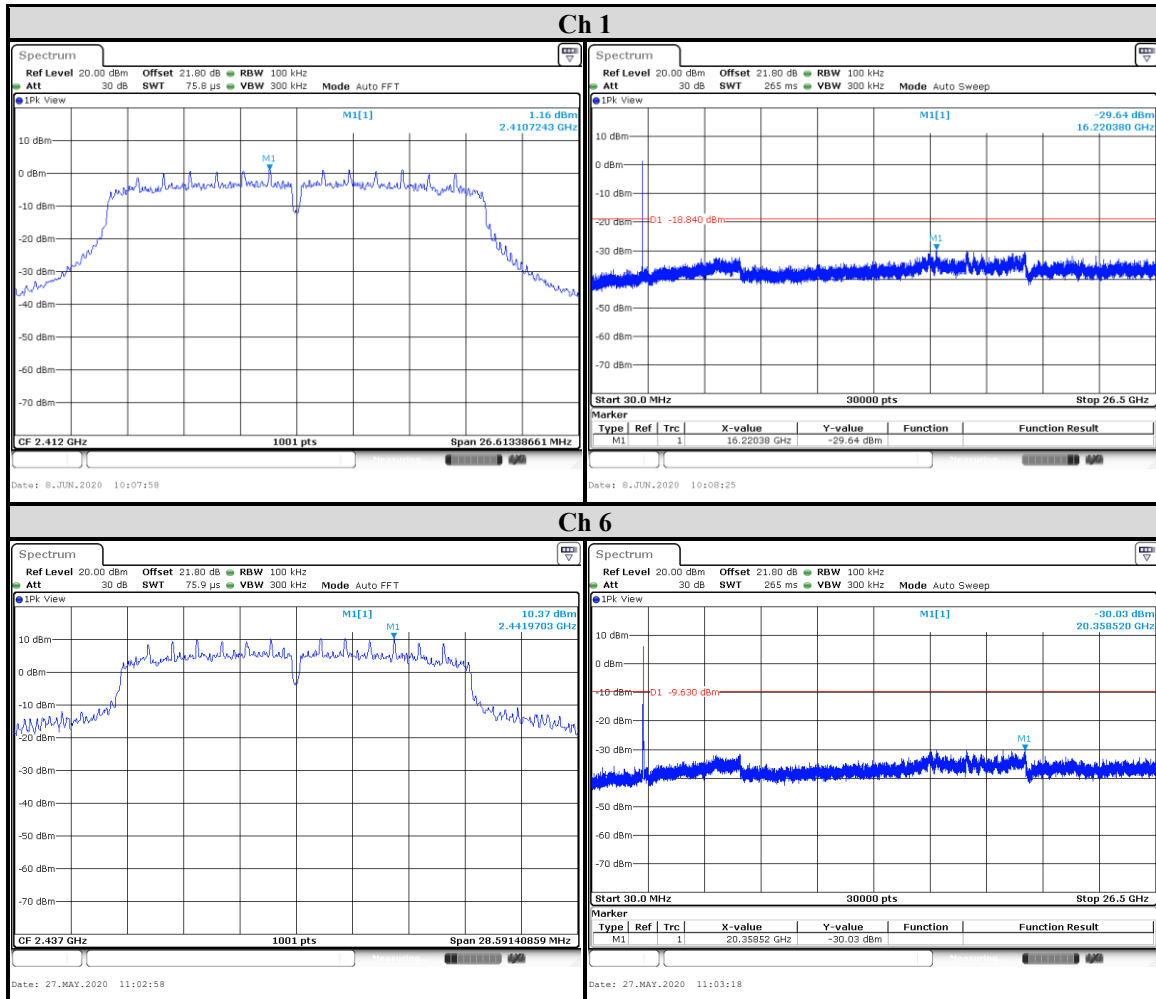

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 46 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

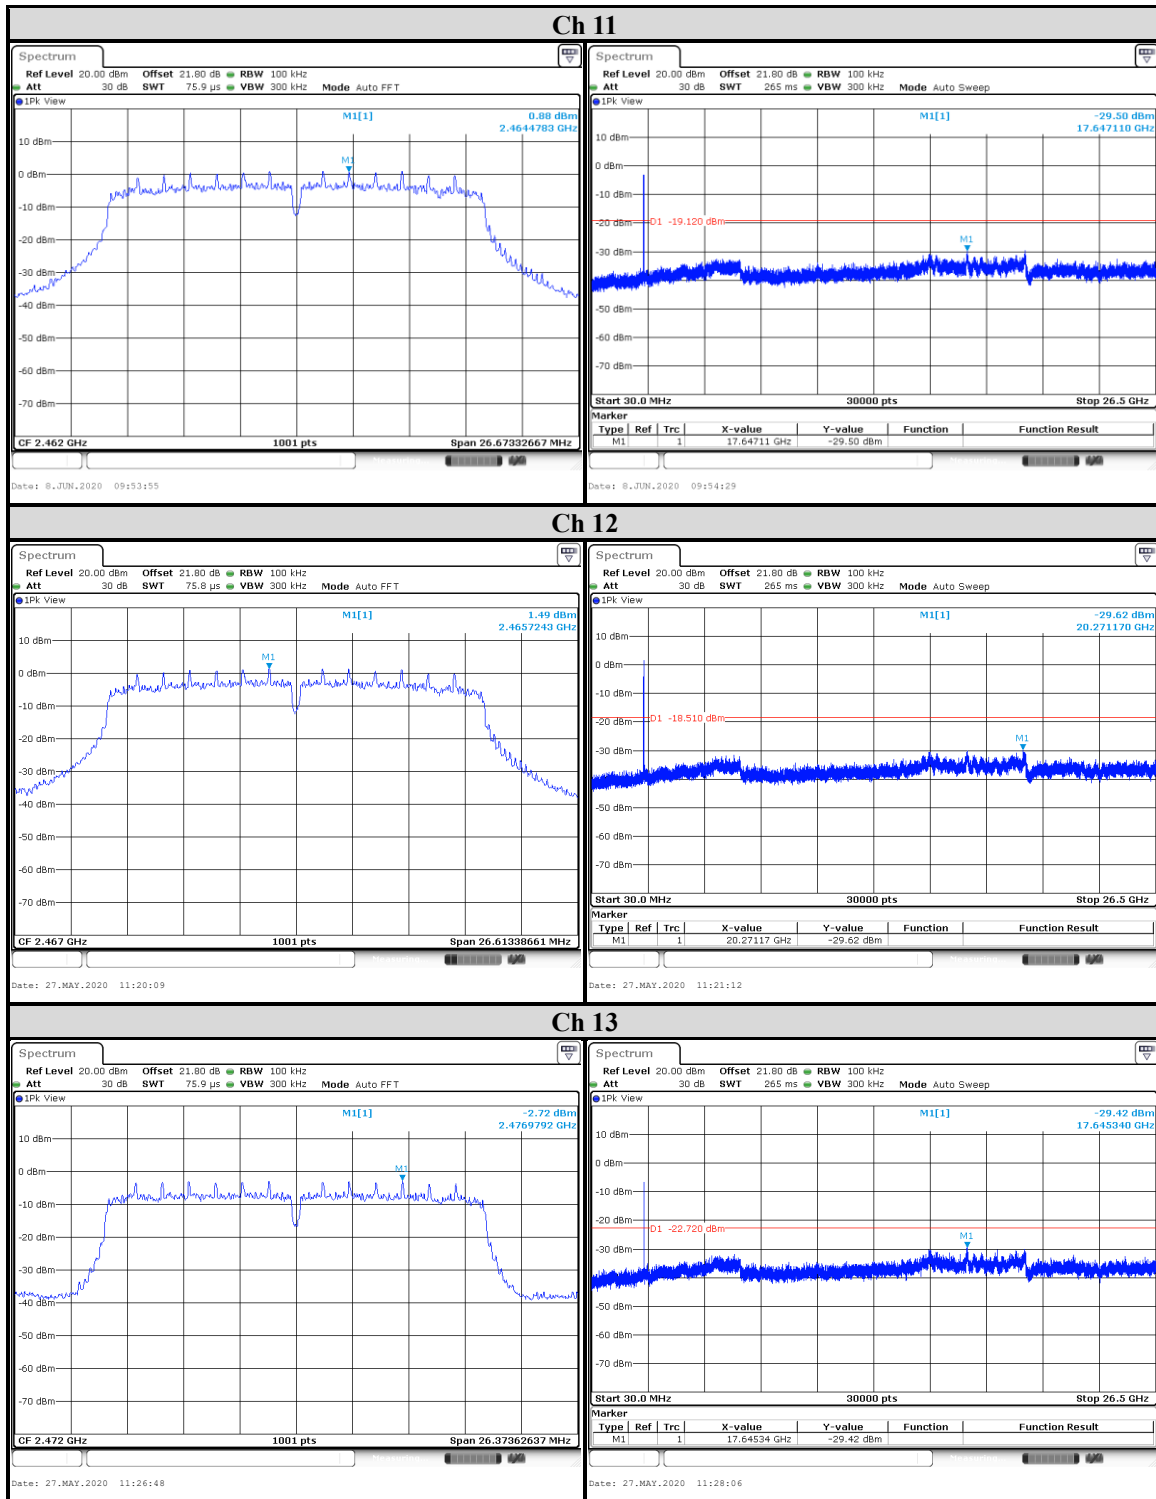

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 47 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

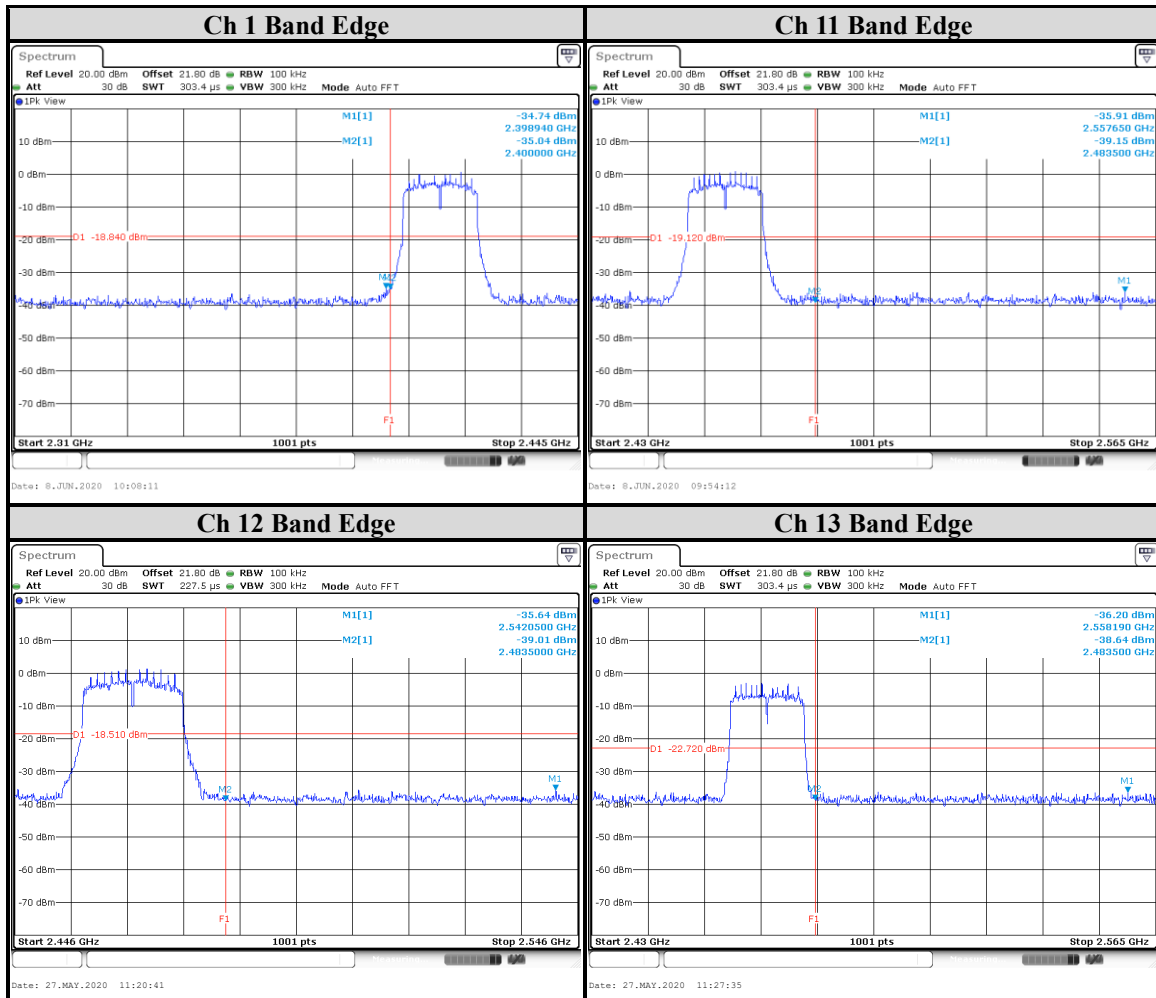

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 48 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

CHAIN 1

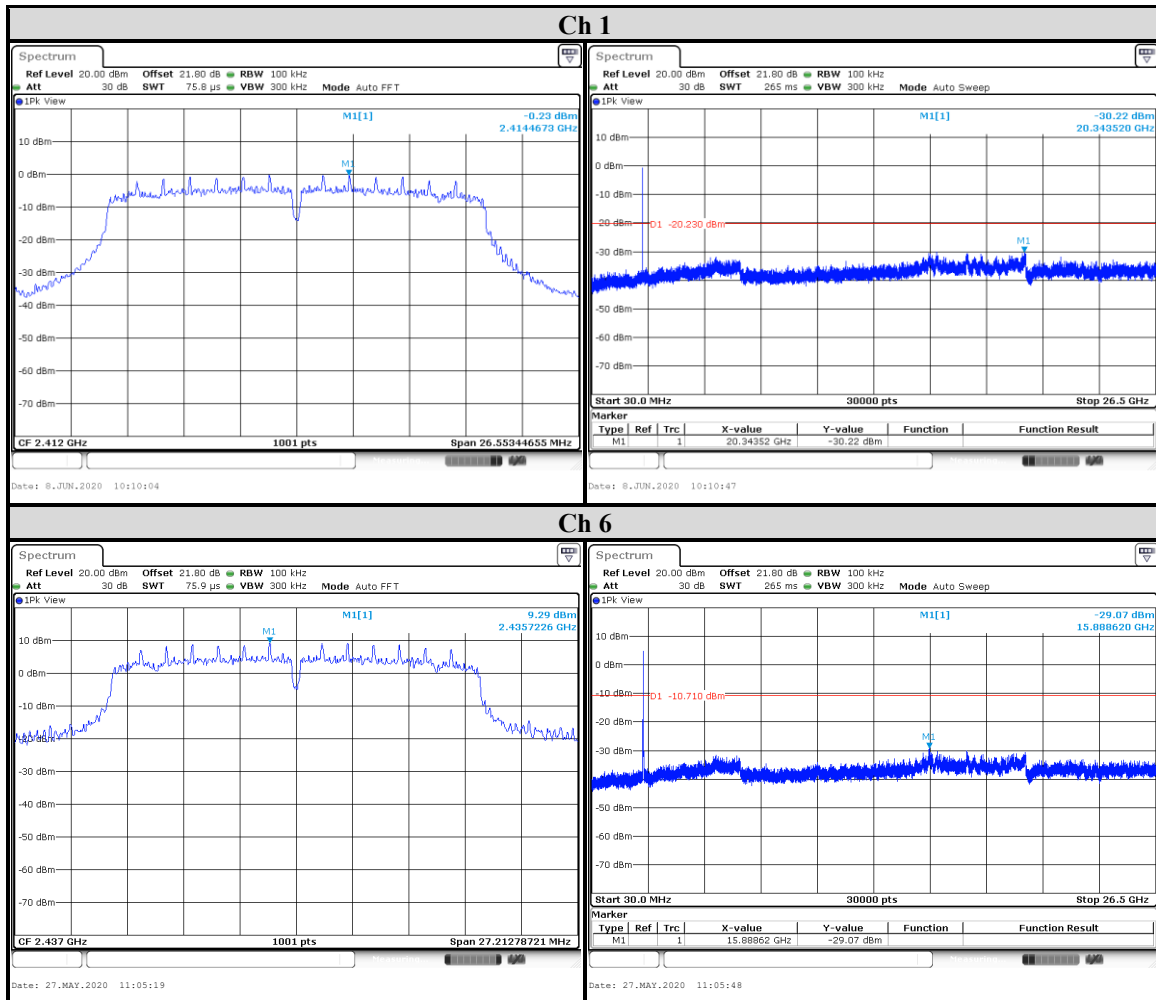

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 49 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

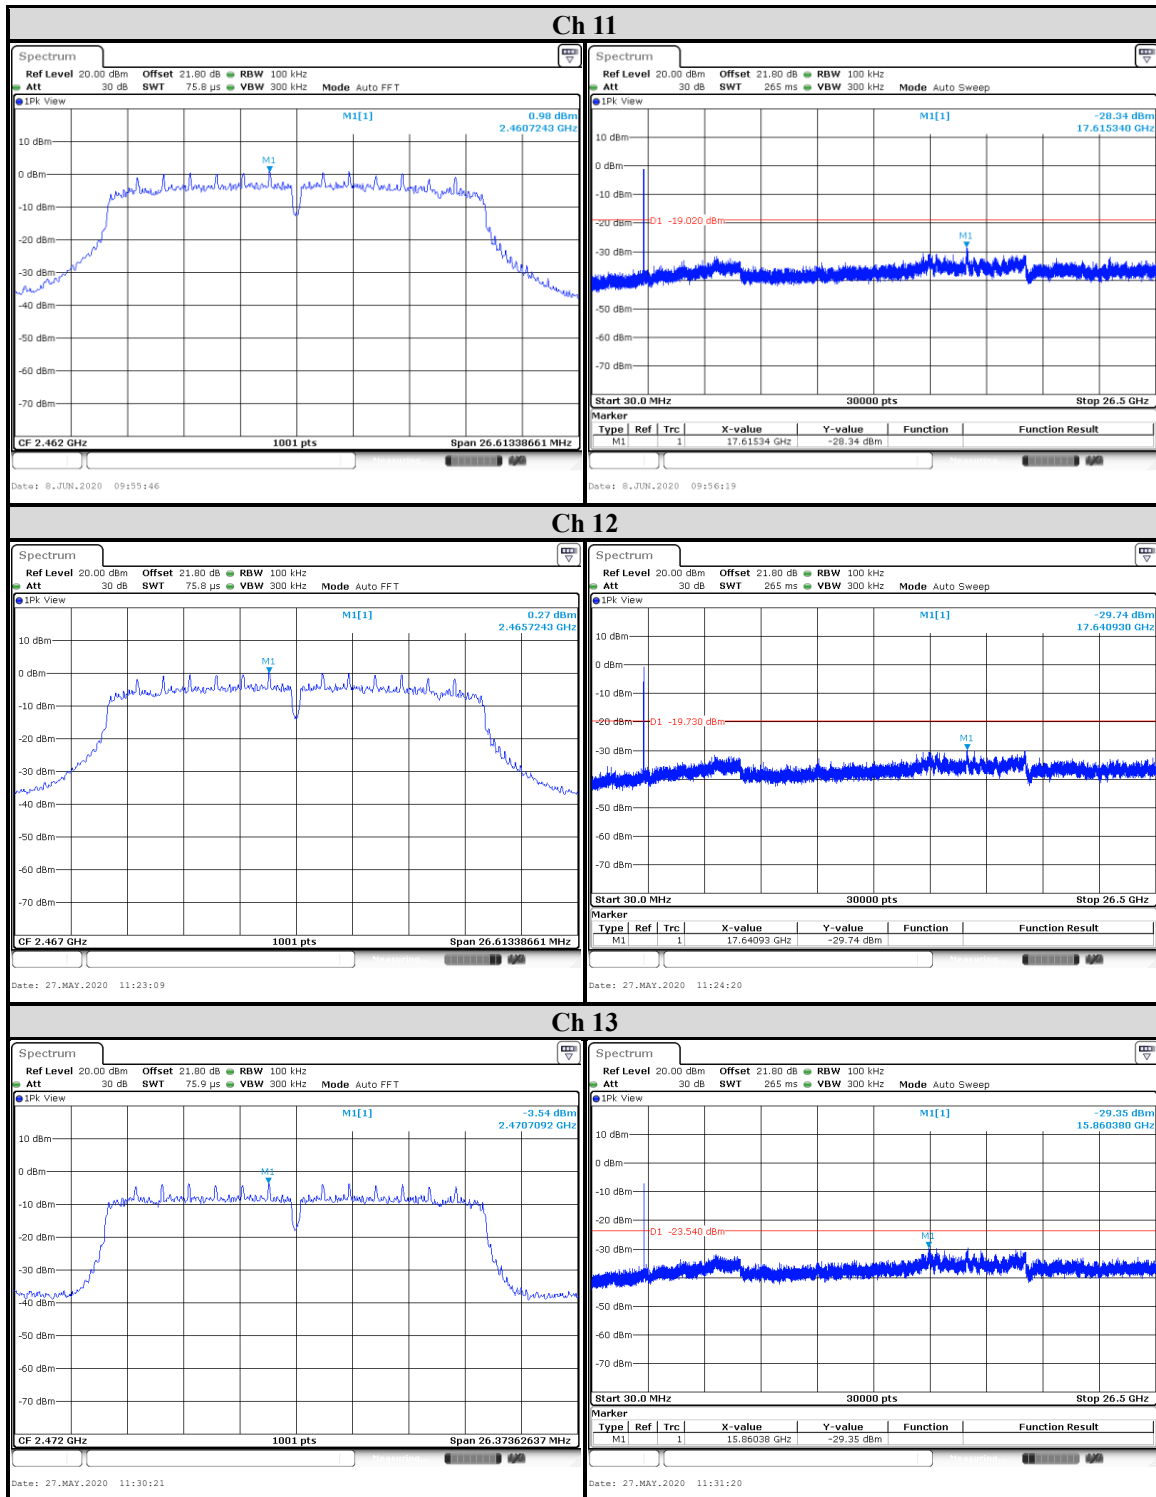

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 50 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

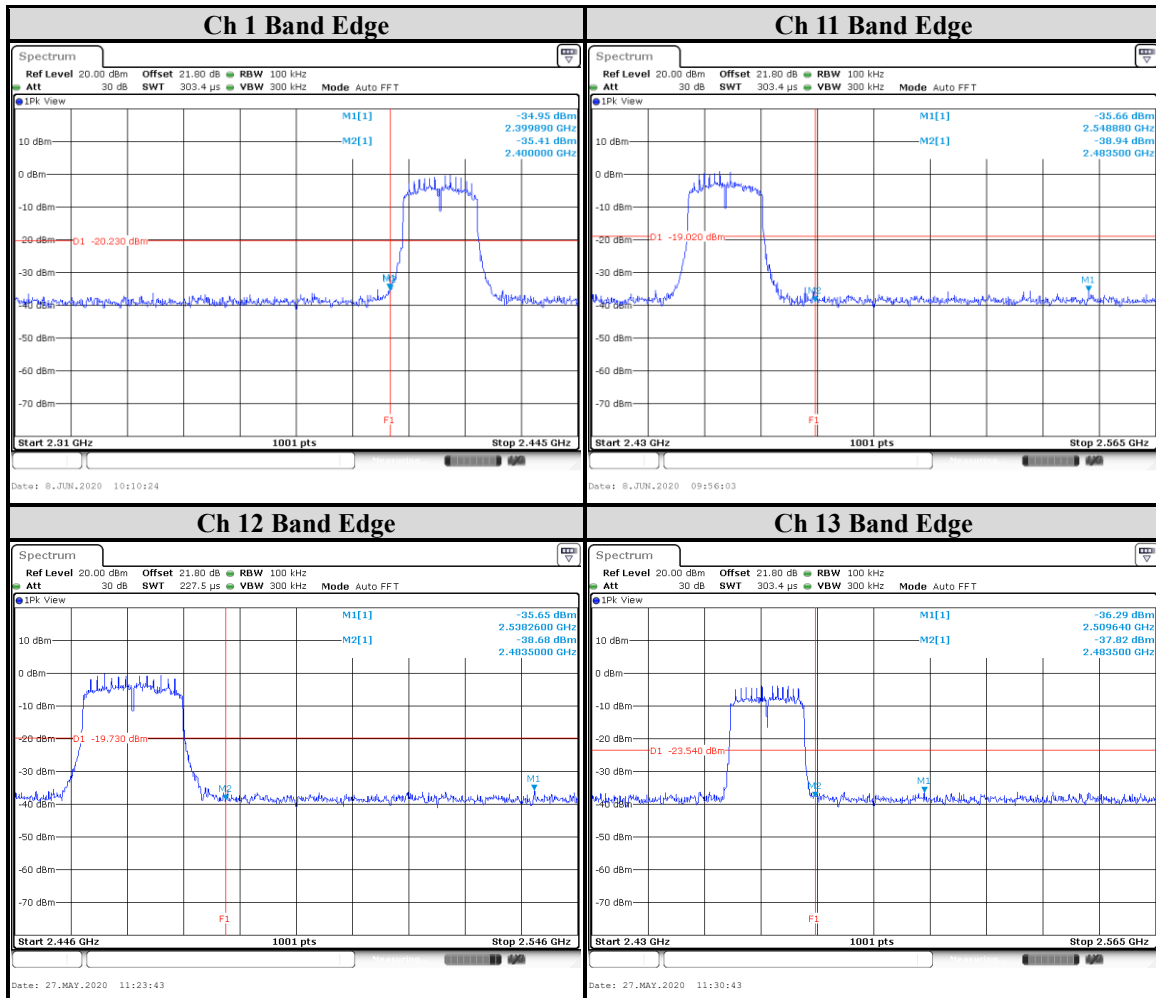

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 51 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

802.11n (HT40)

CHAIN 0

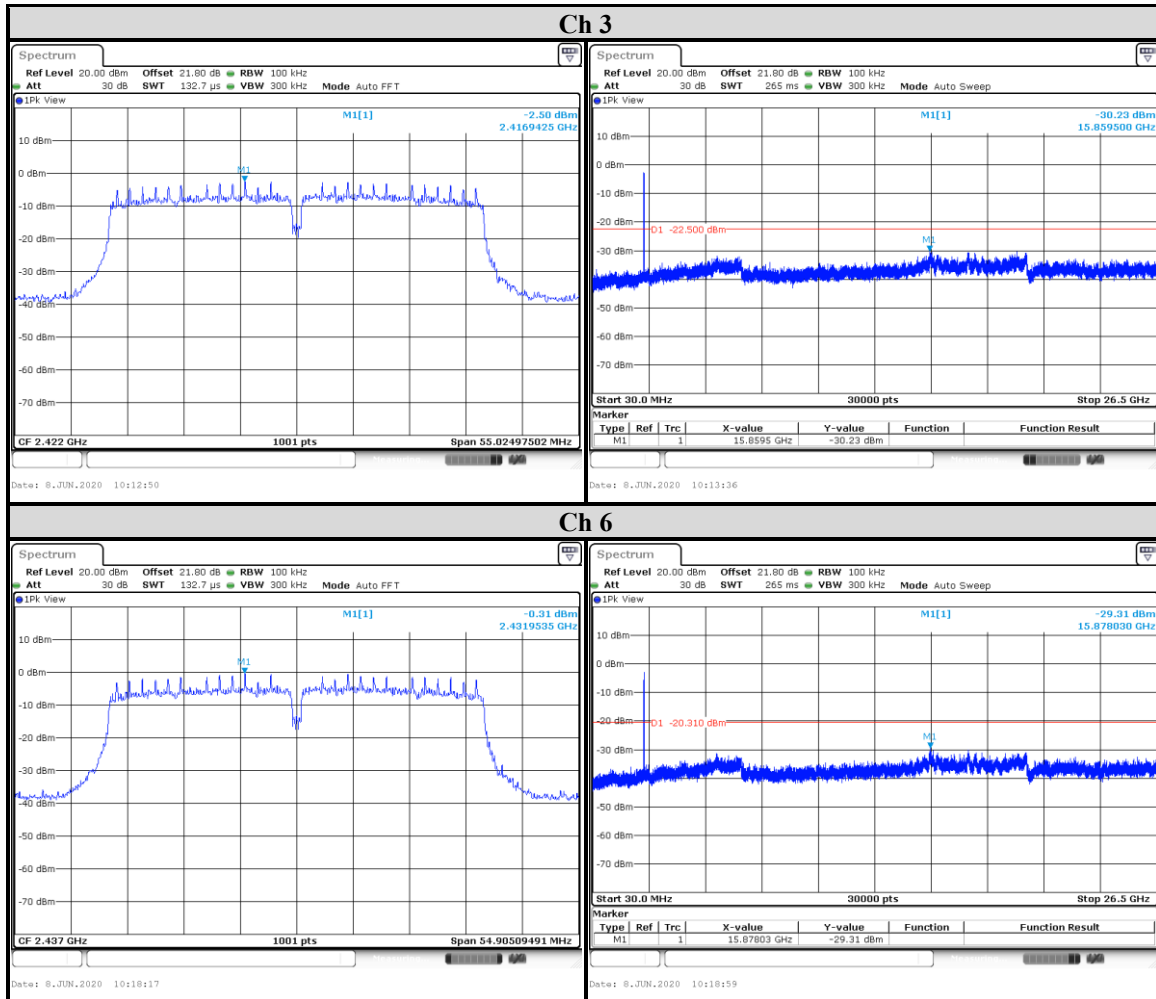

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 52 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

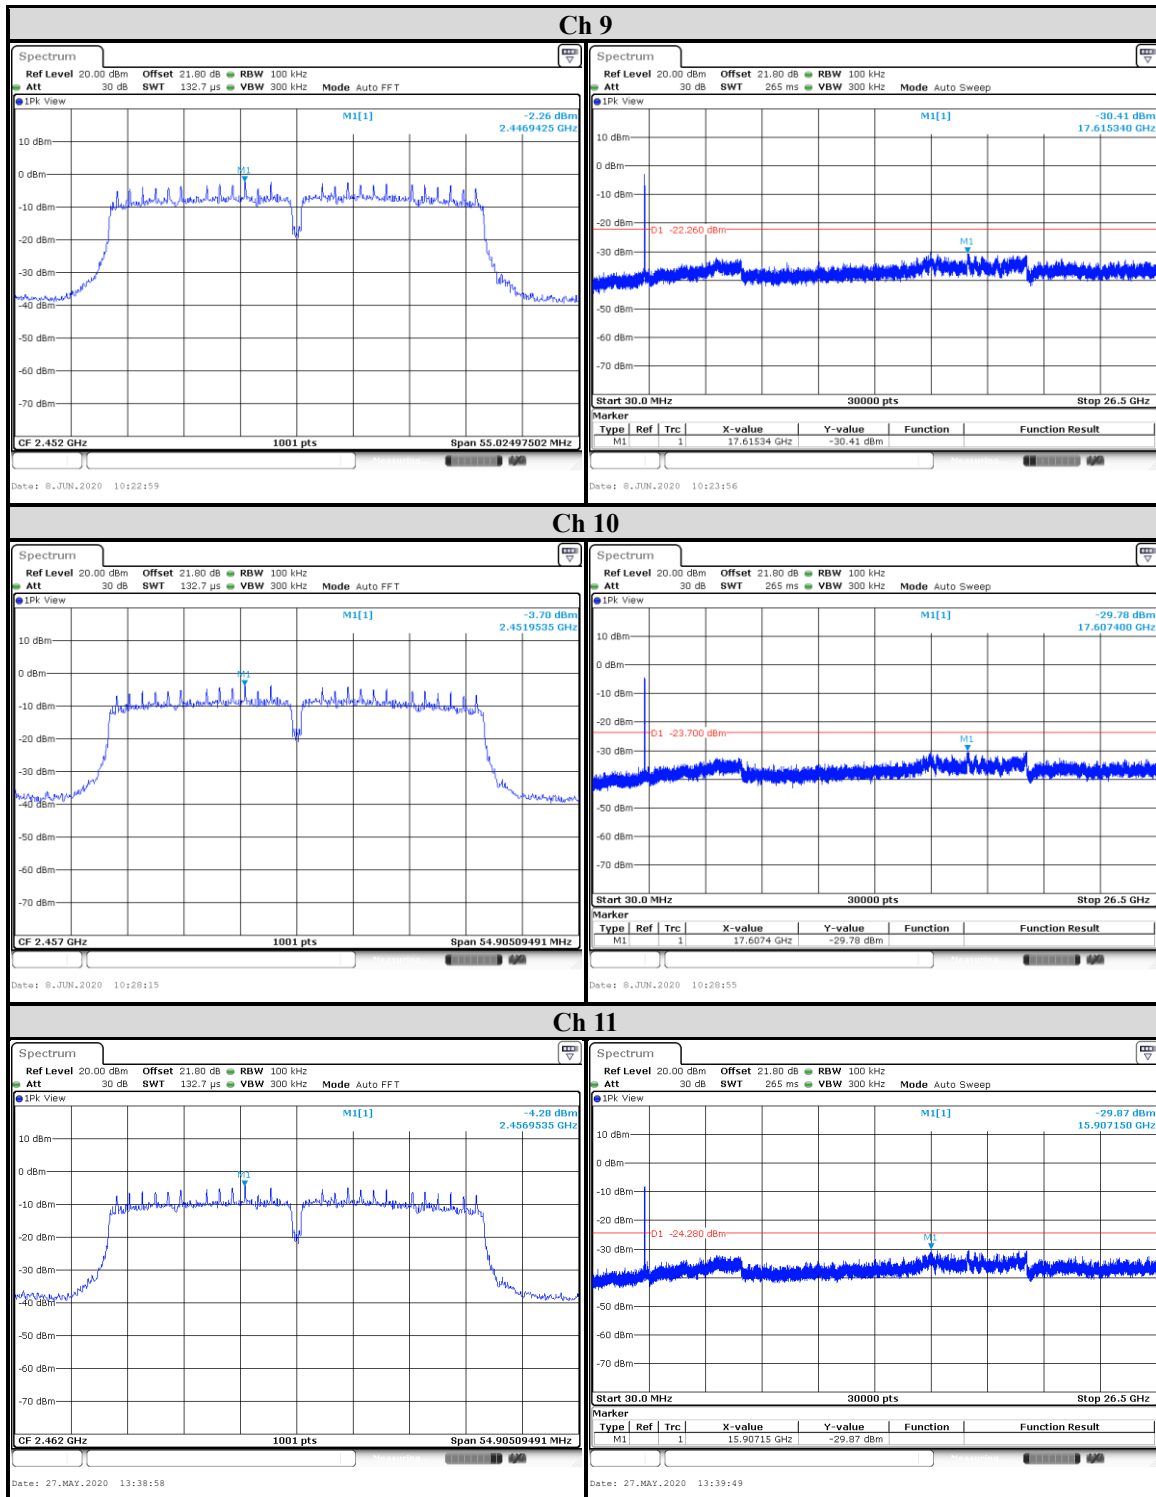

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 53 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

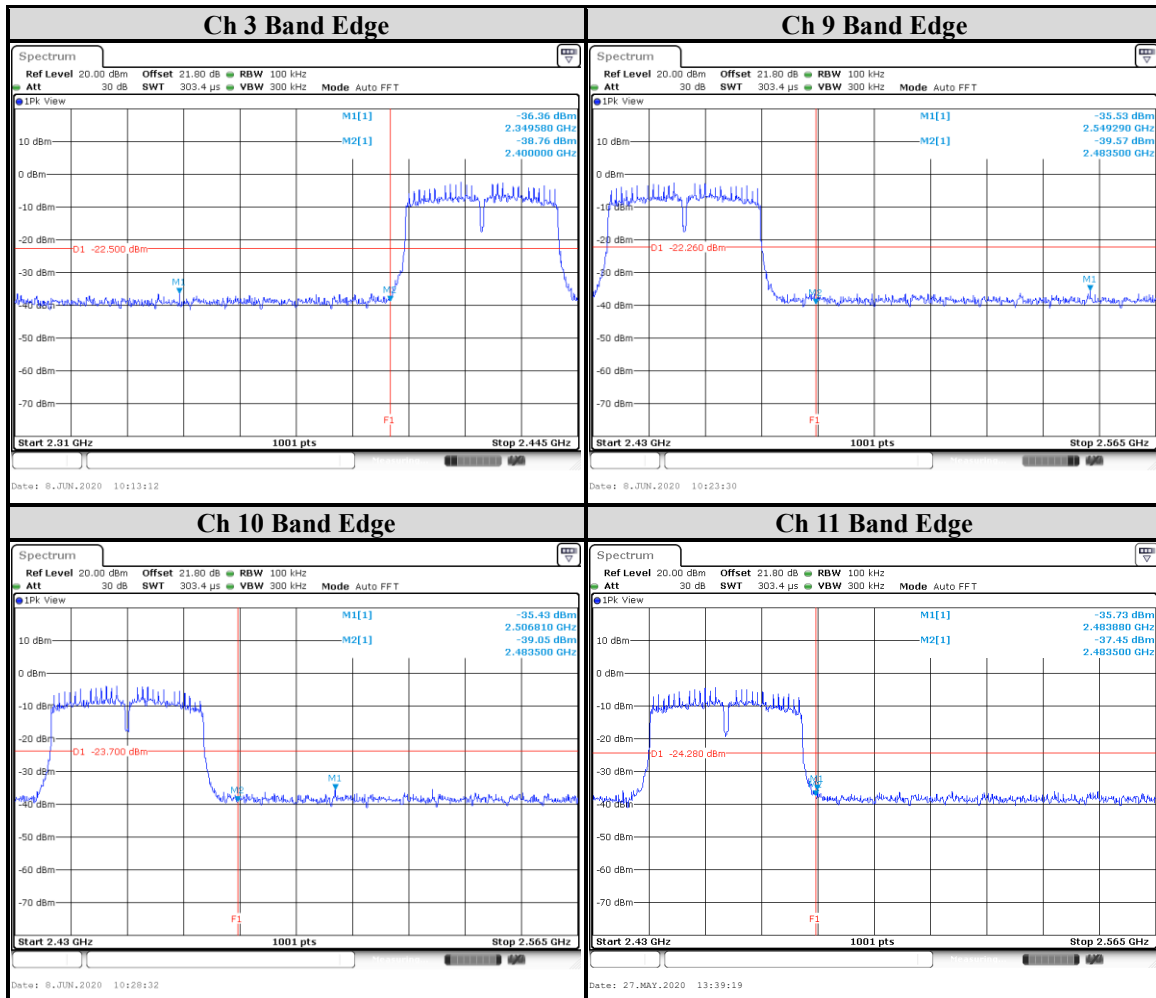

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 54 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

CHAIN 1

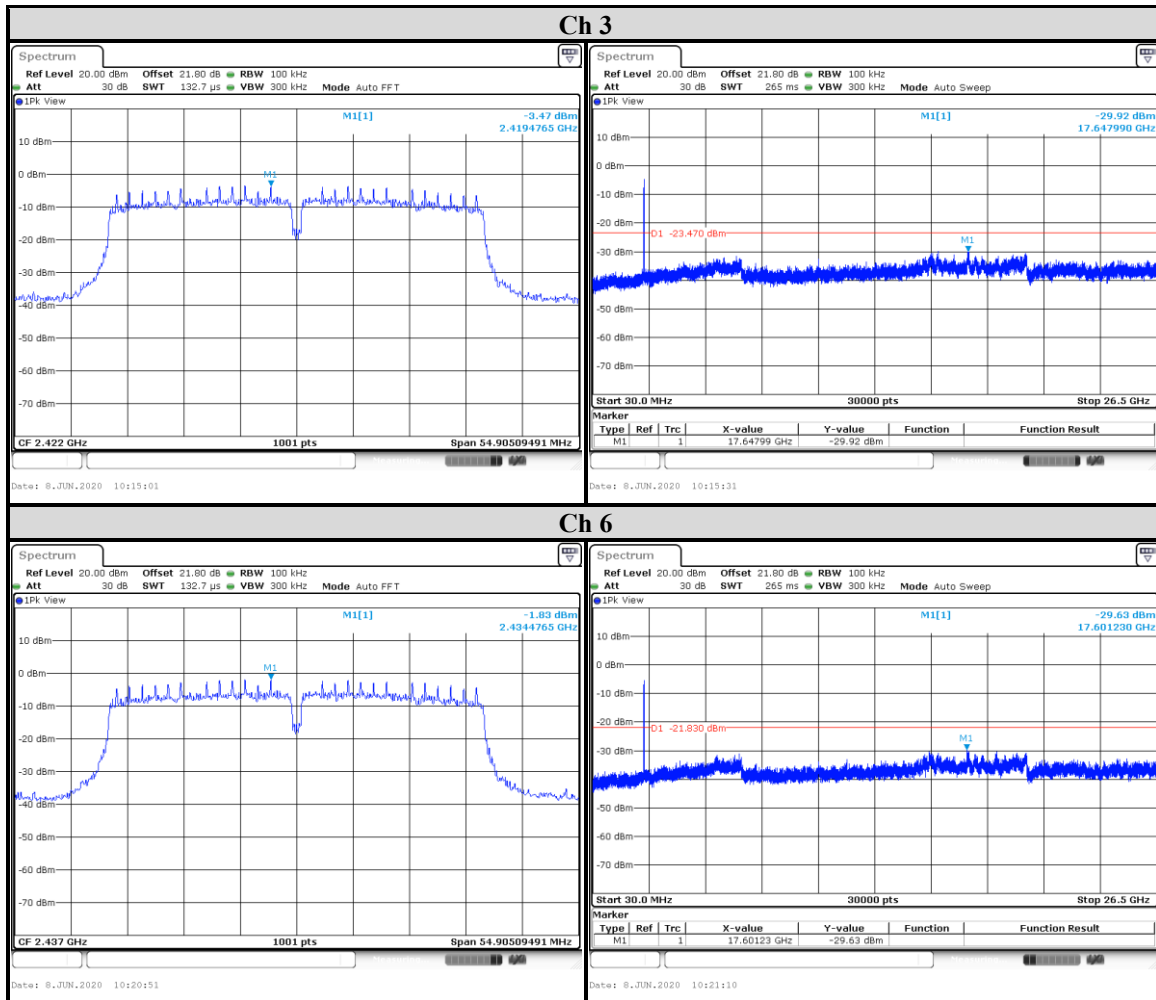

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 55 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

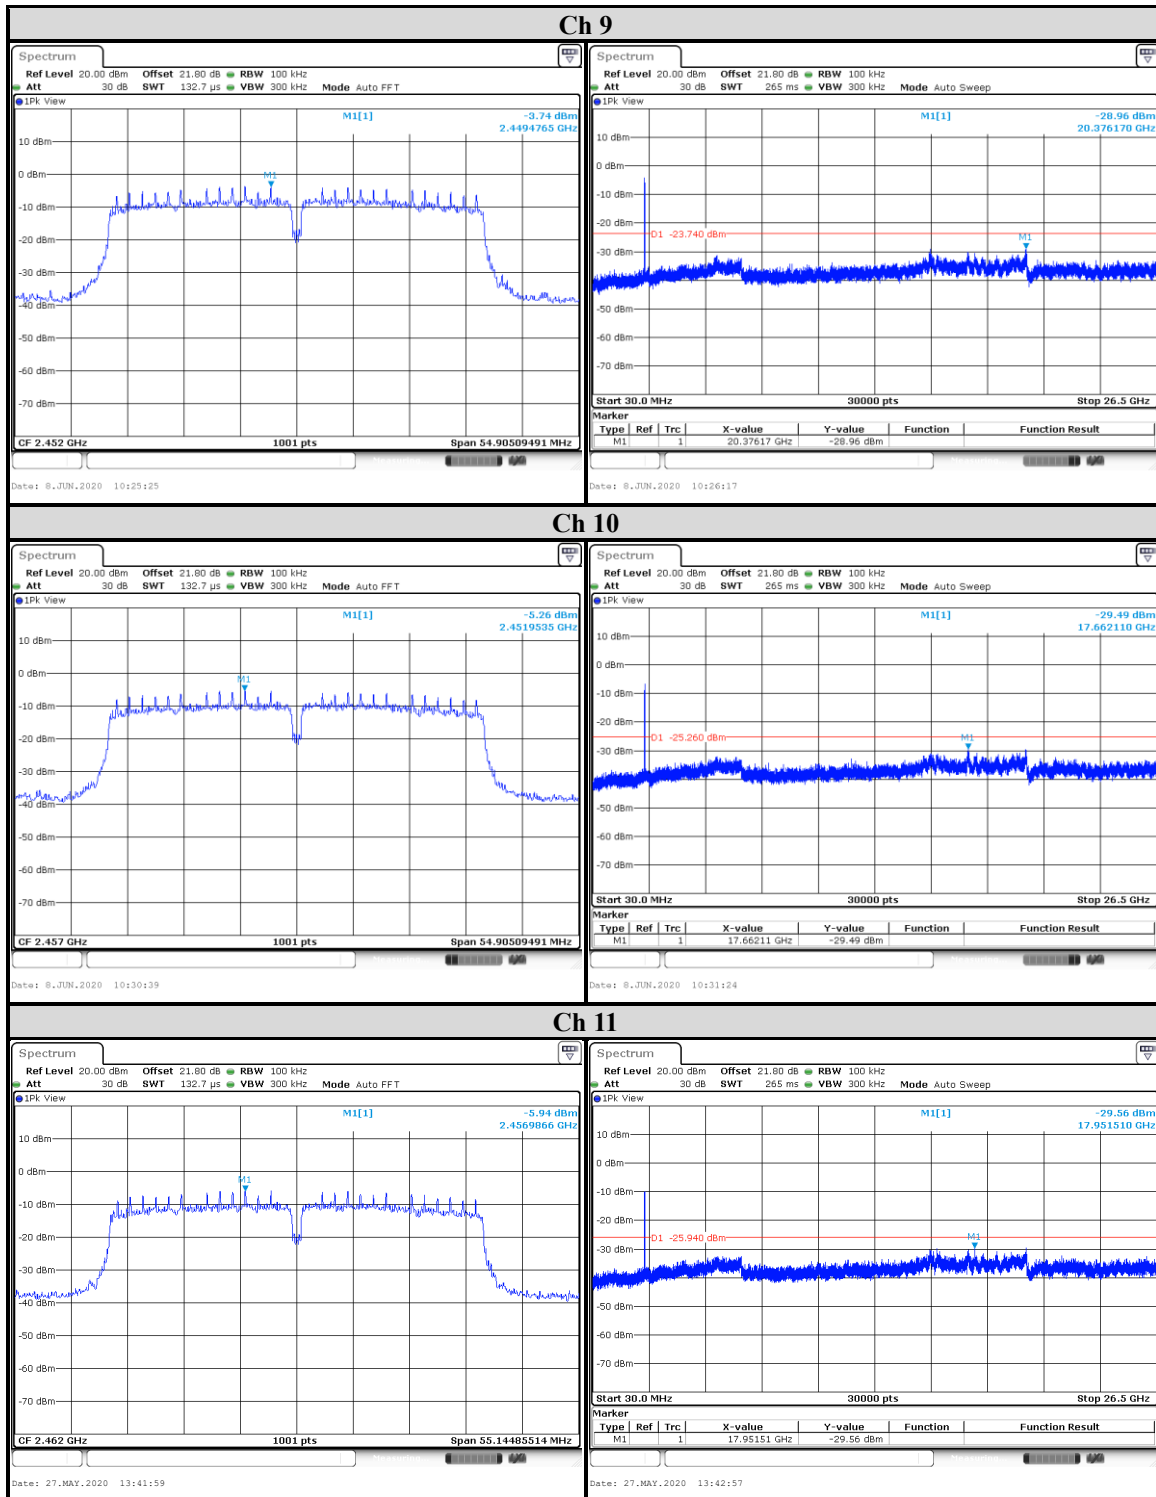

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



Test report No. : 4789482589-US-R0-V0
Page : 56 of 114
Issued date : Jul. 16, 2020
FCC ID : RYK-WNFT237ACNBT

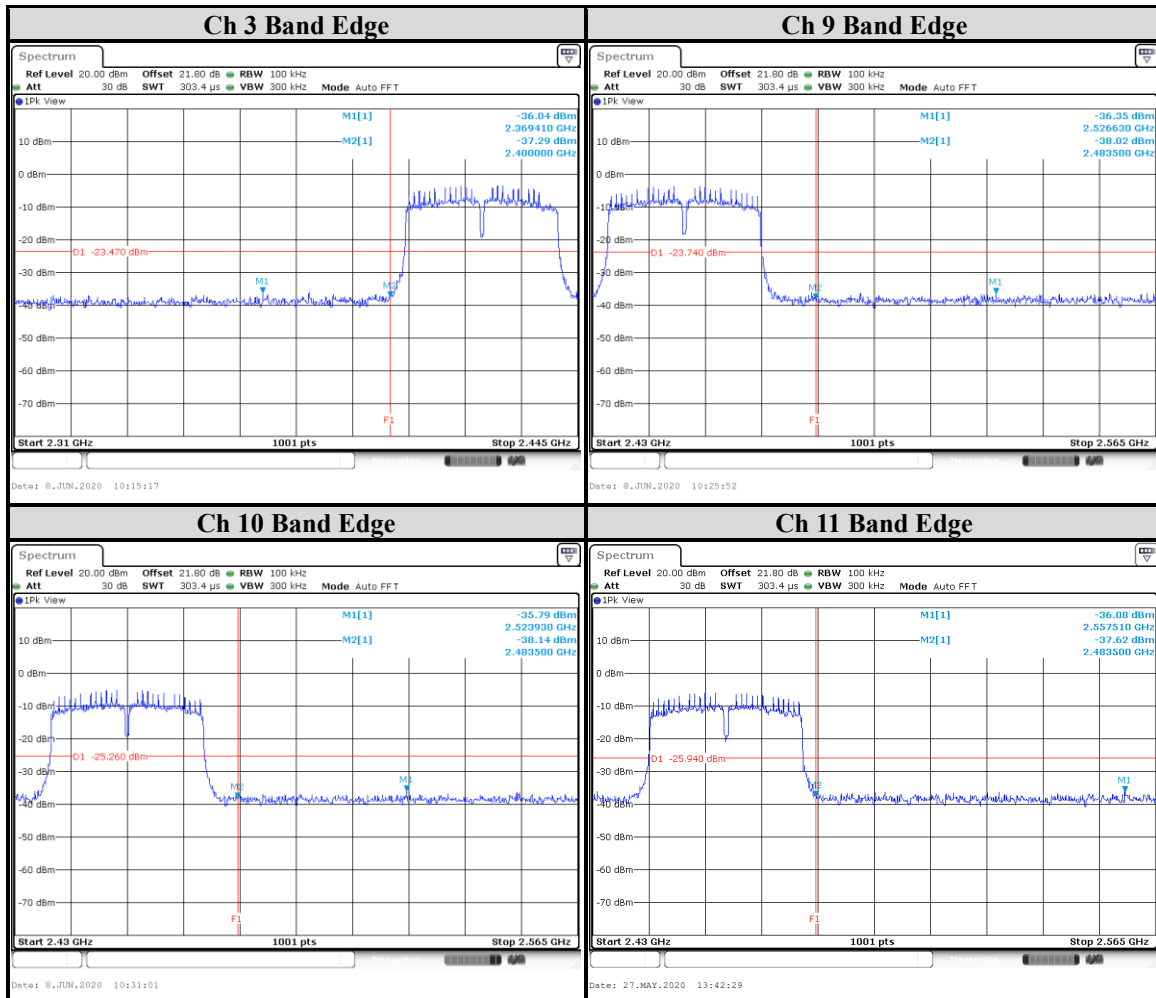

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 5.0



9.5. Radiated Spurious Emission

Requirements

Radiated emissions which fall in the restricted bands must comply with the radiated emission limits specified as below table. Other emissions shall be at least 20dB below the highest level of the desired power:

Frequency(MHz)	Field strength (microvolts/meter)	Measurement distance (meters)
0.009-0.490	2400/F(kHz)	300
0.490-1.705	24000/F(kHz)	30
1.705-30.0	30	30
30-88	100	3
88-216	150	3
216-960	200	3
Above 960	500	3

NOTE:

1. The lower limit shall apply at the transition frequencies.
2. Emission level (dBuV/m) = 20 log Emission level (uV/m).
3. For frequencies above 1000MHz, the field strength limits are based on average detector, however, the peak field strength of any emission shall not exceed the maximum permitted average limits, specified above by more than 20dB under any condition of modulation.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 5.0