








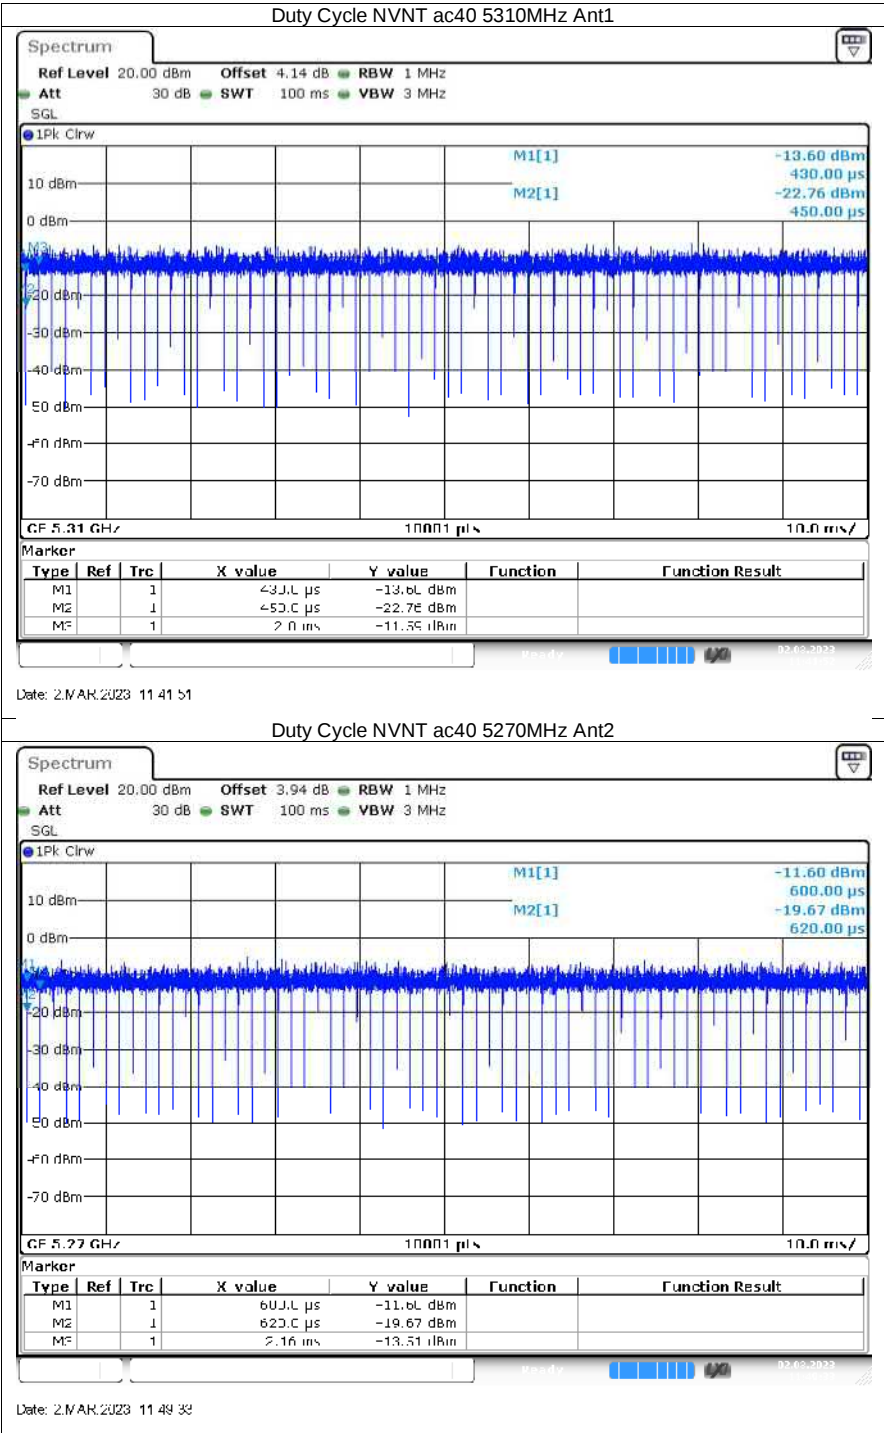


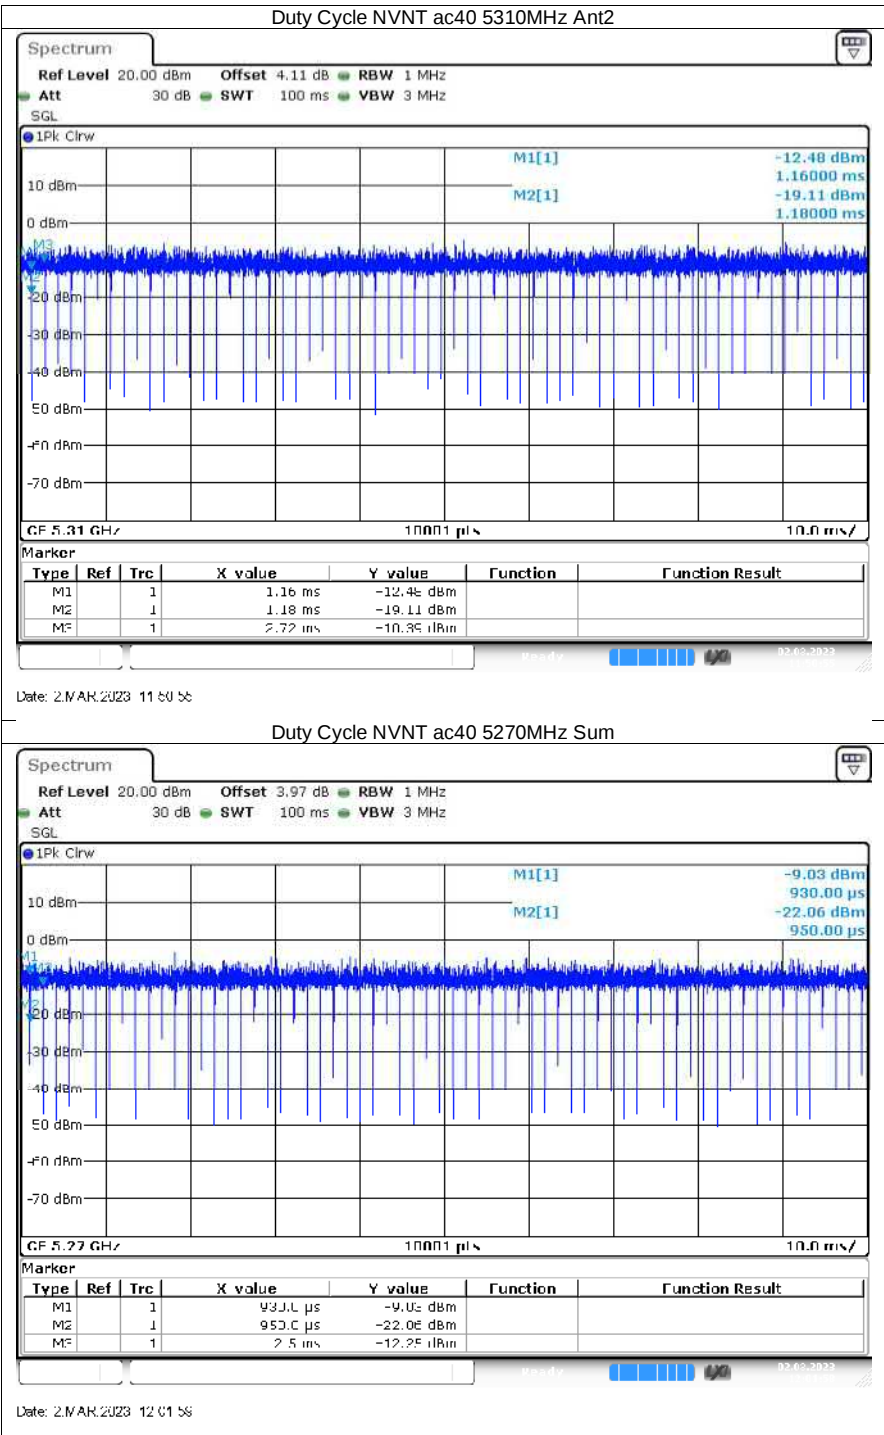


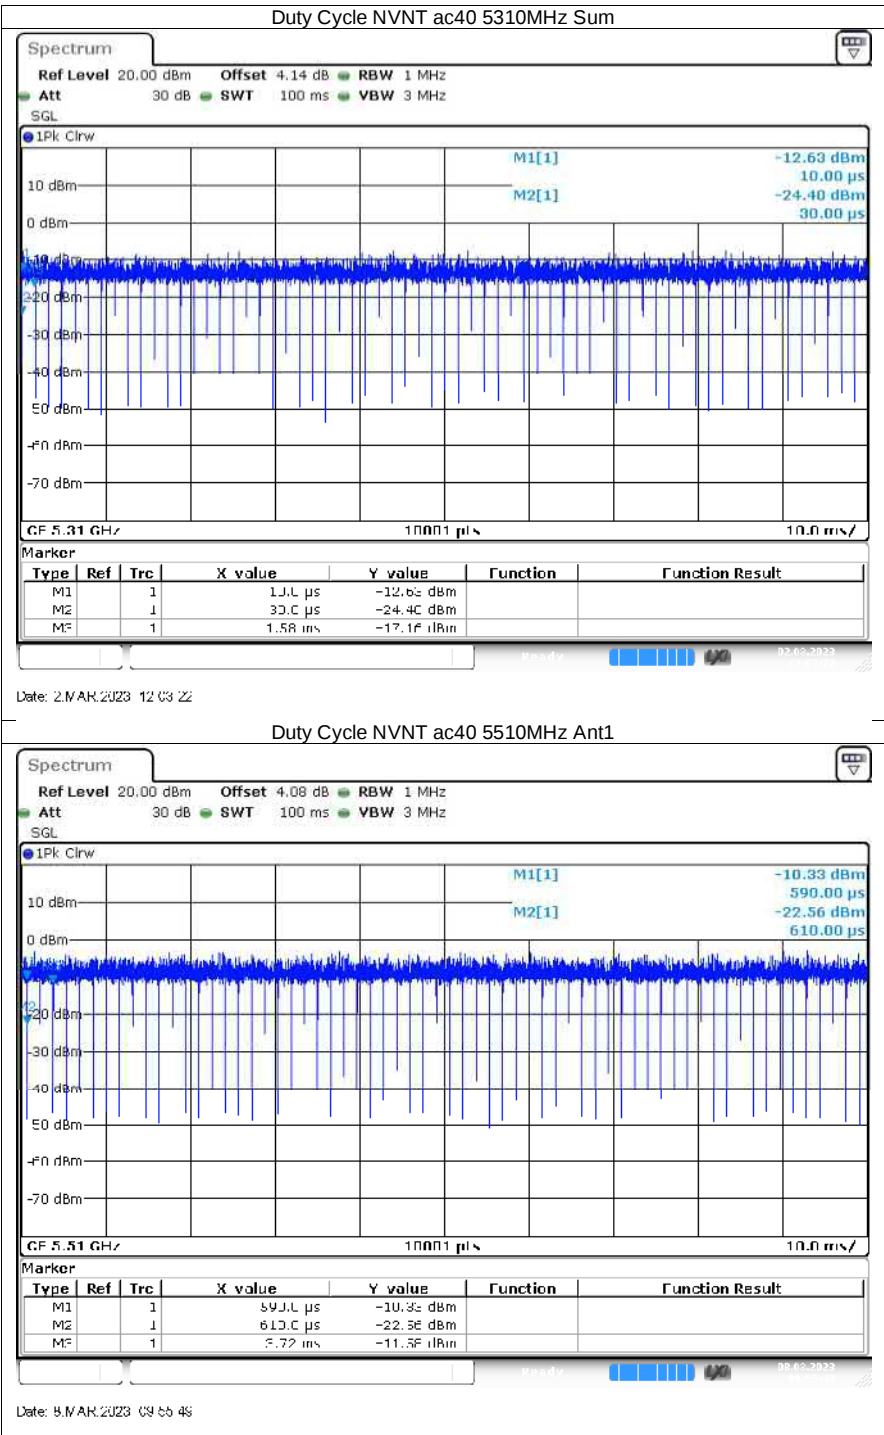



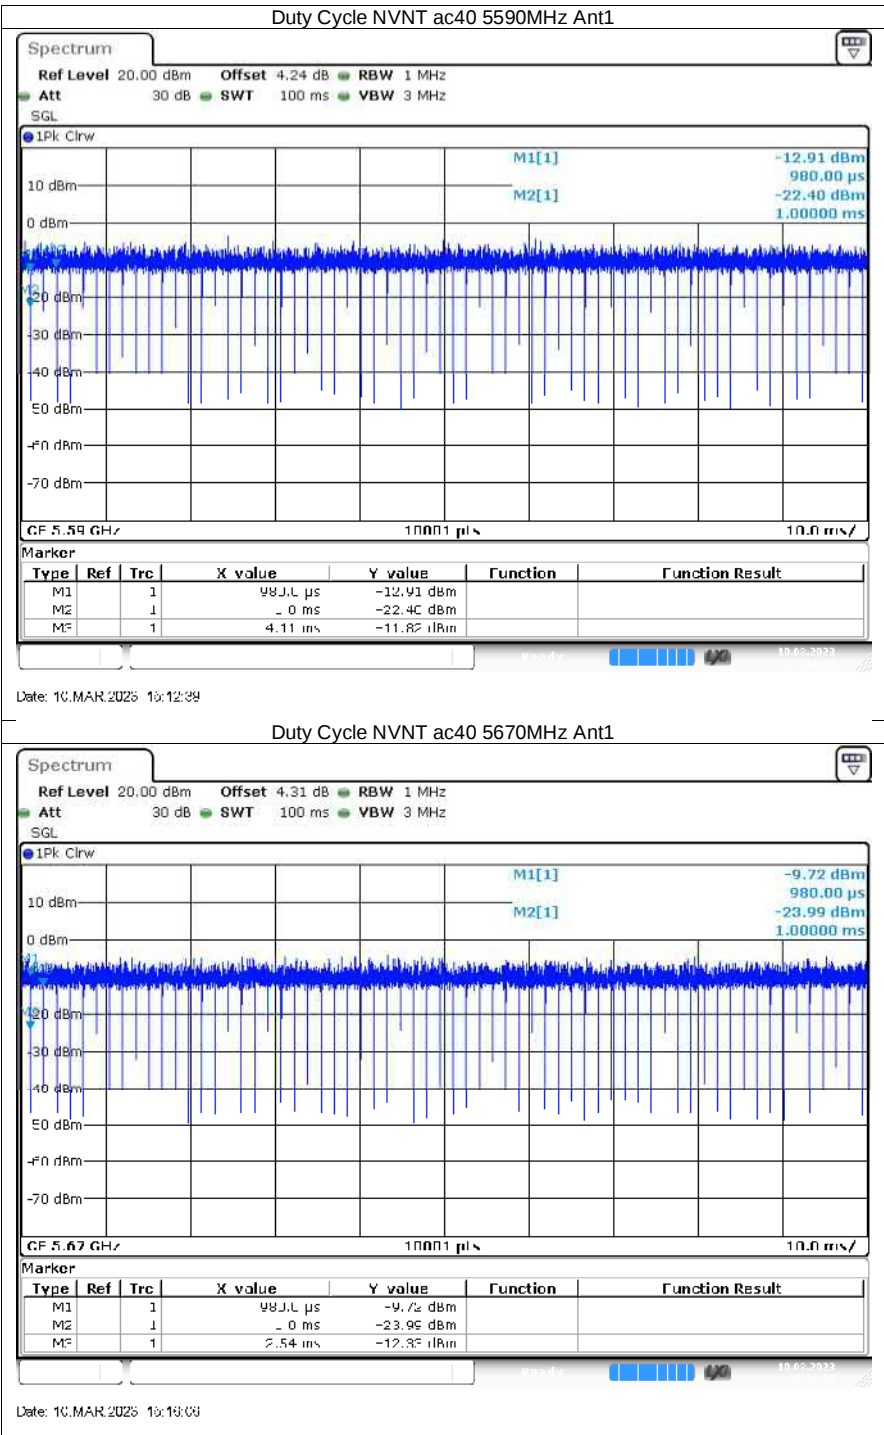



China

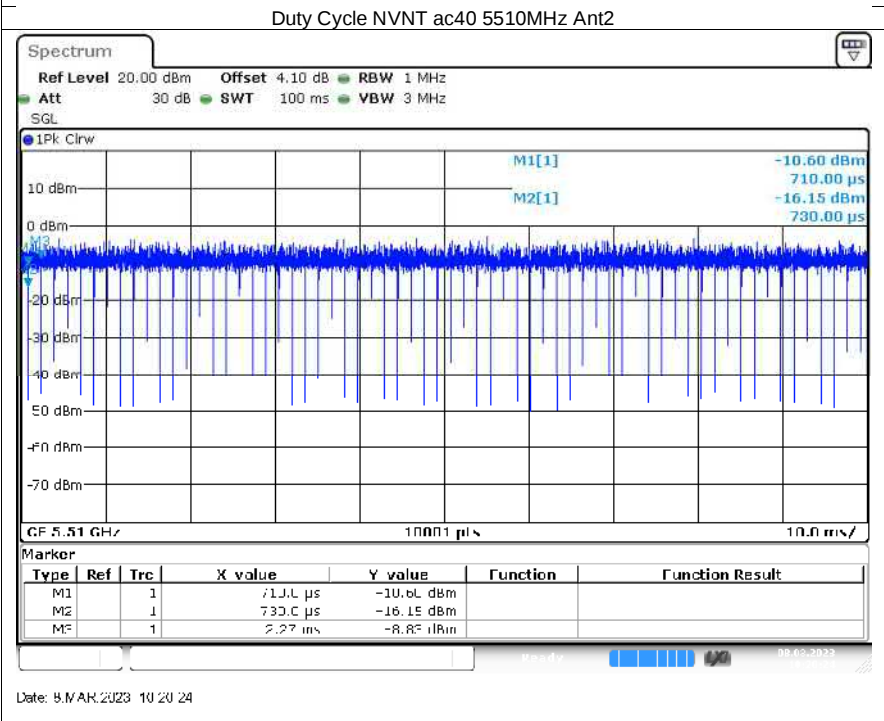
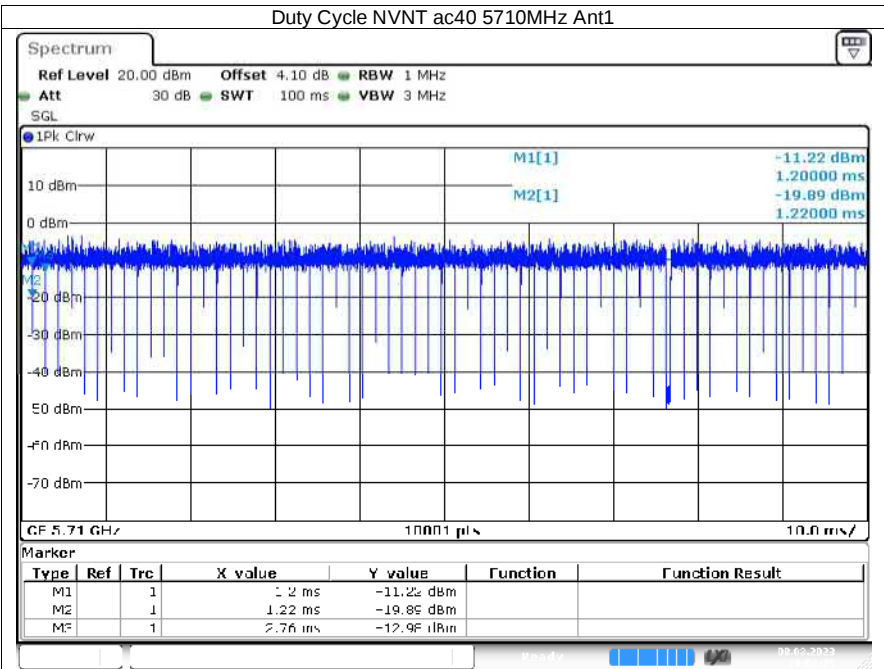


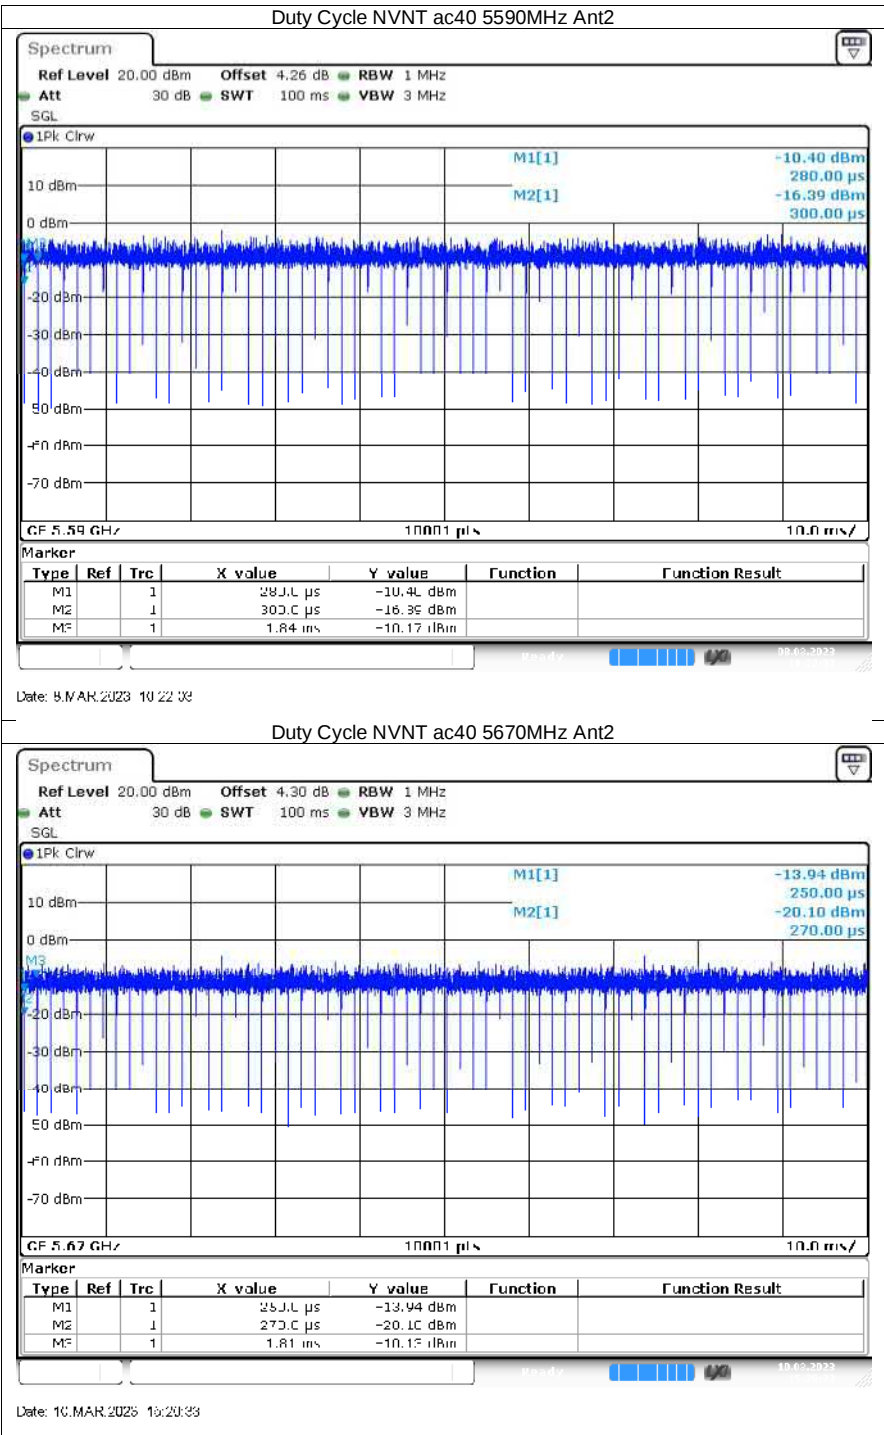


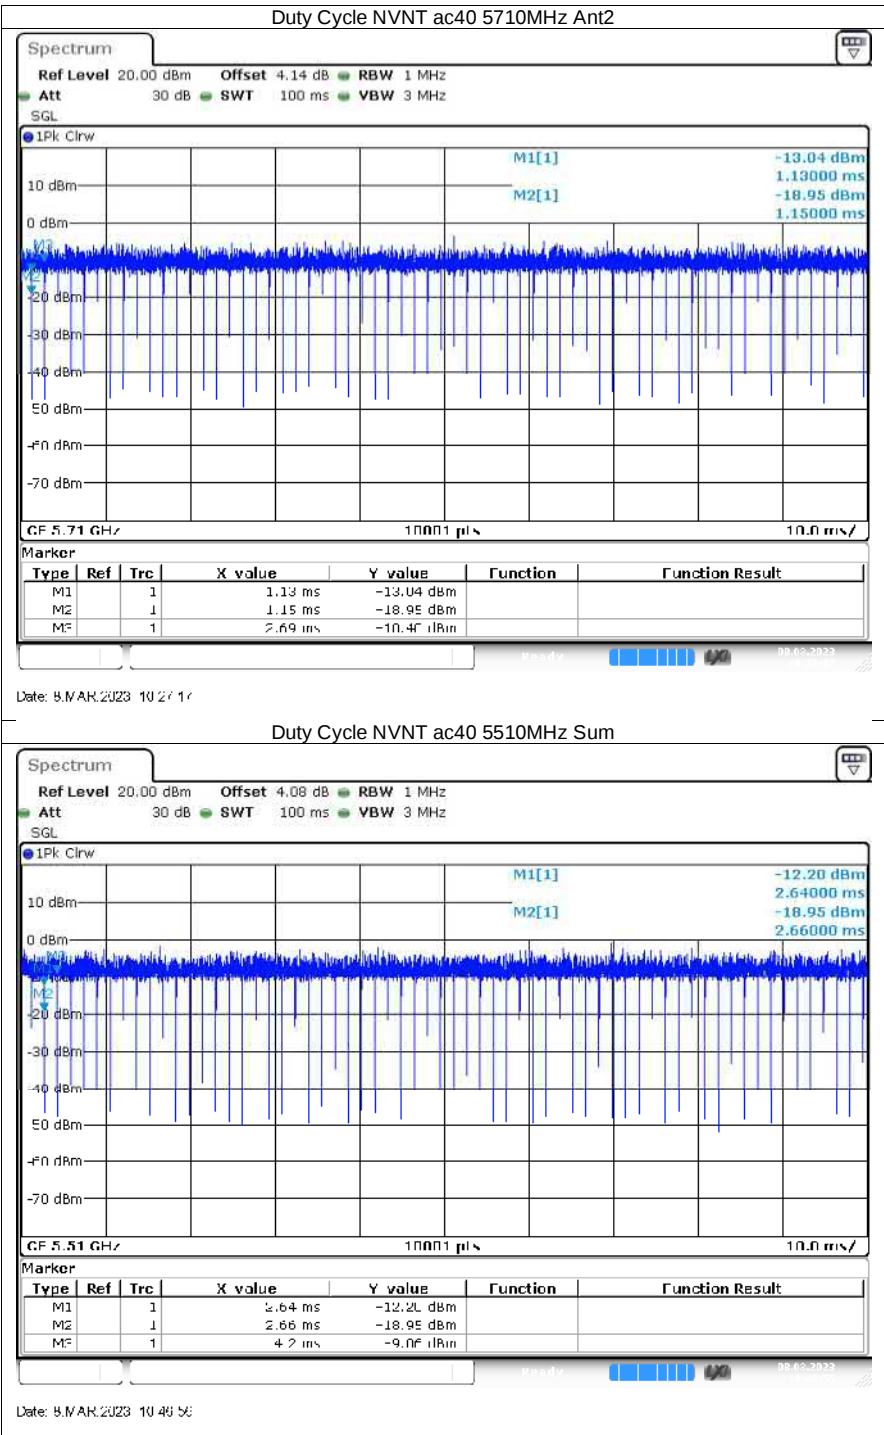


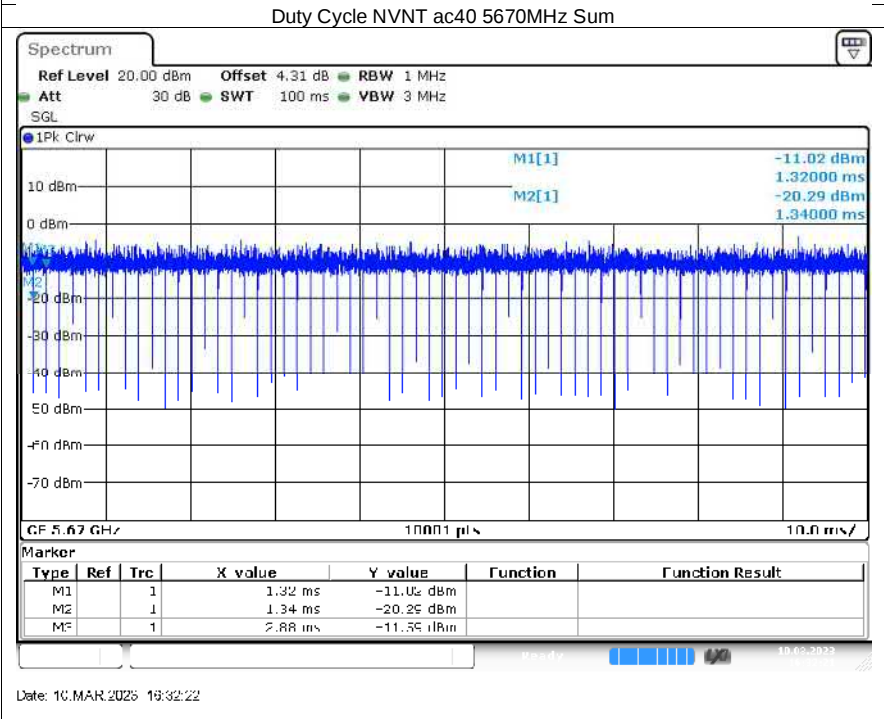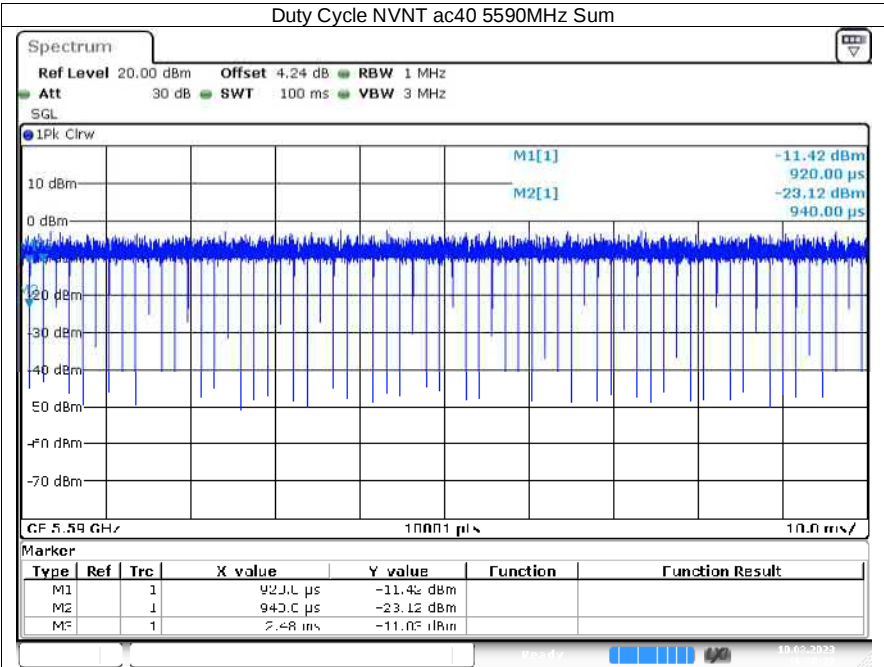


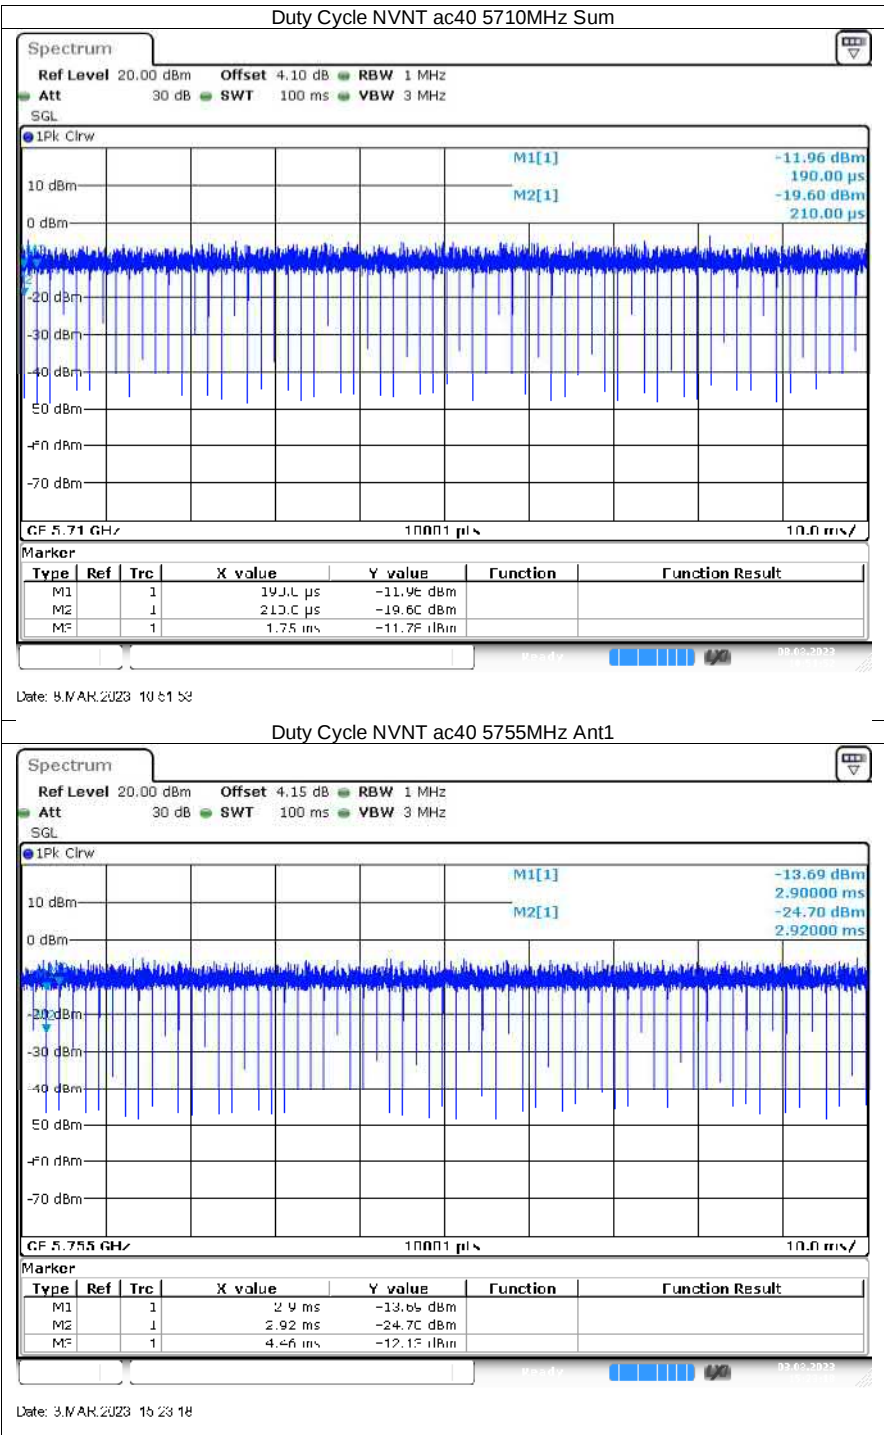

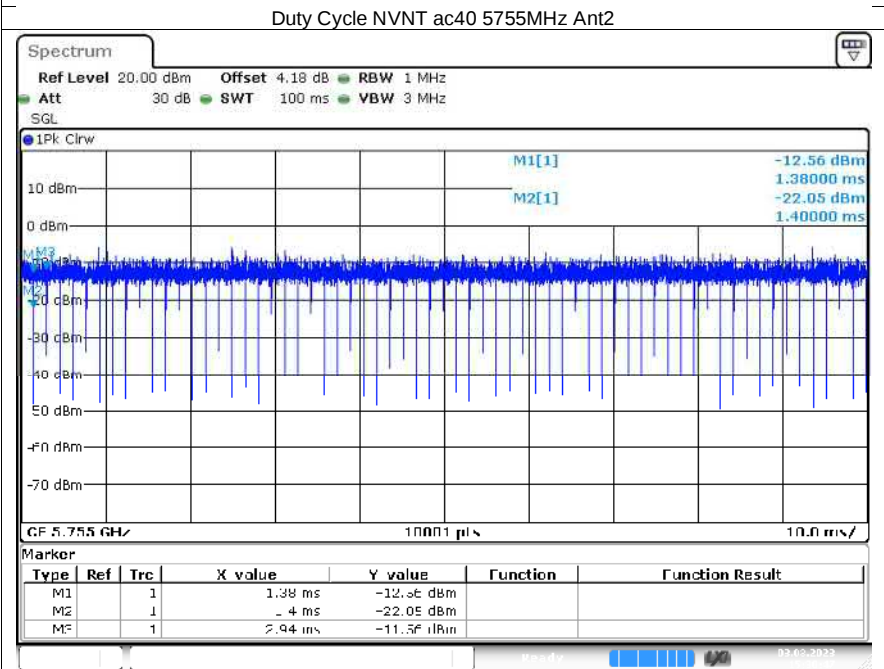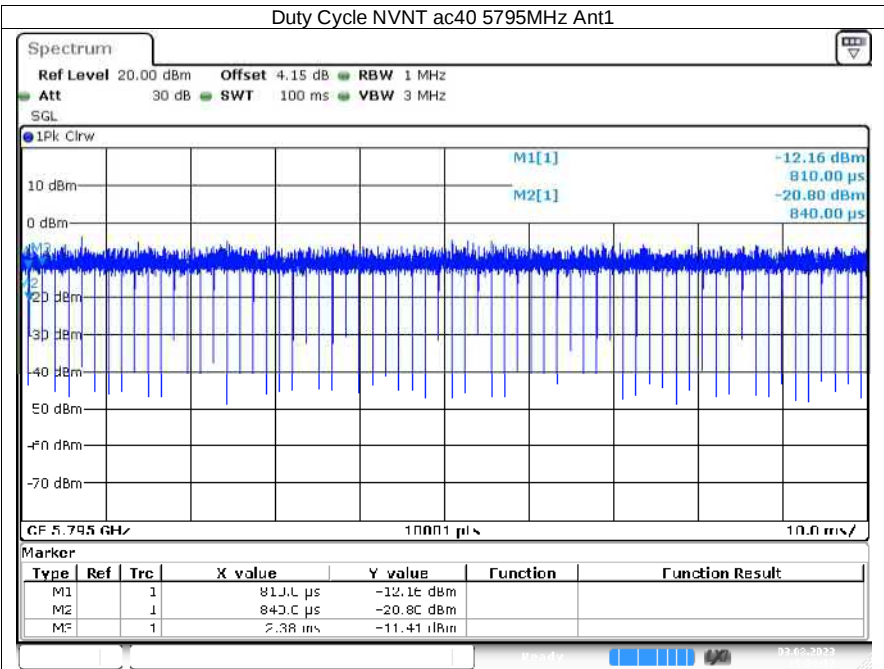

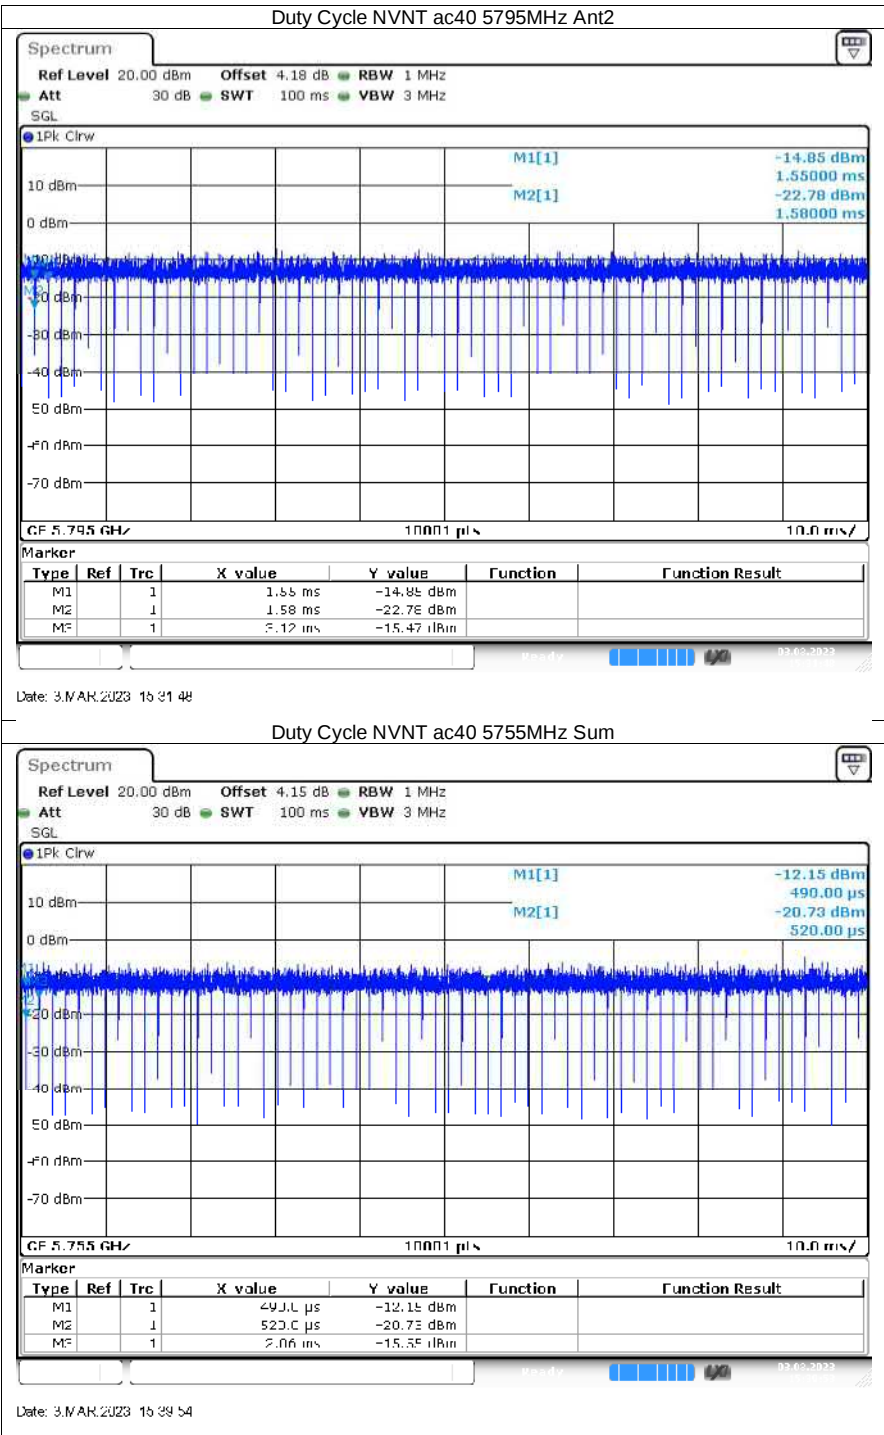



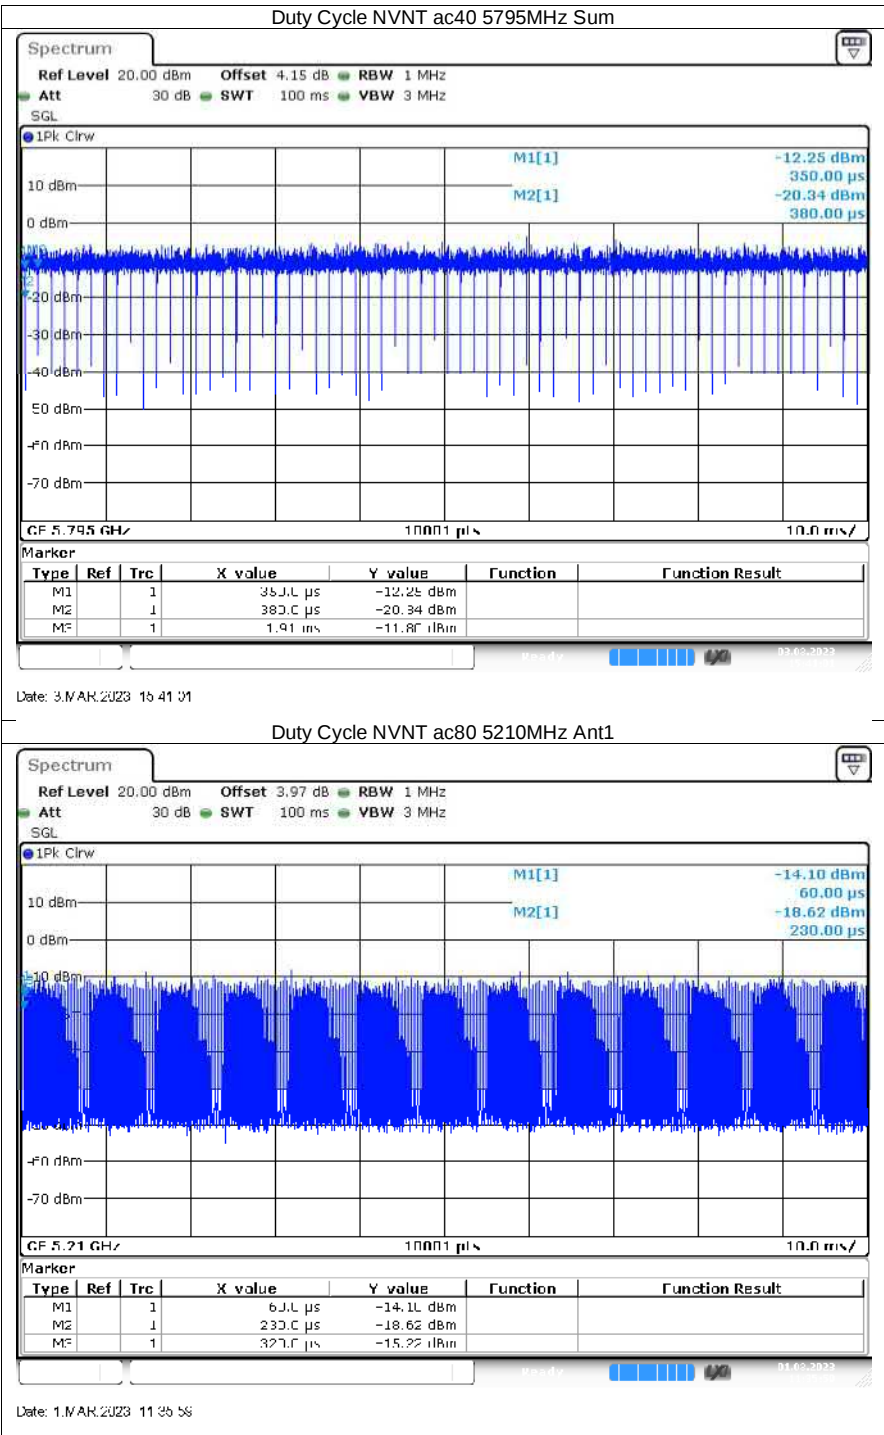


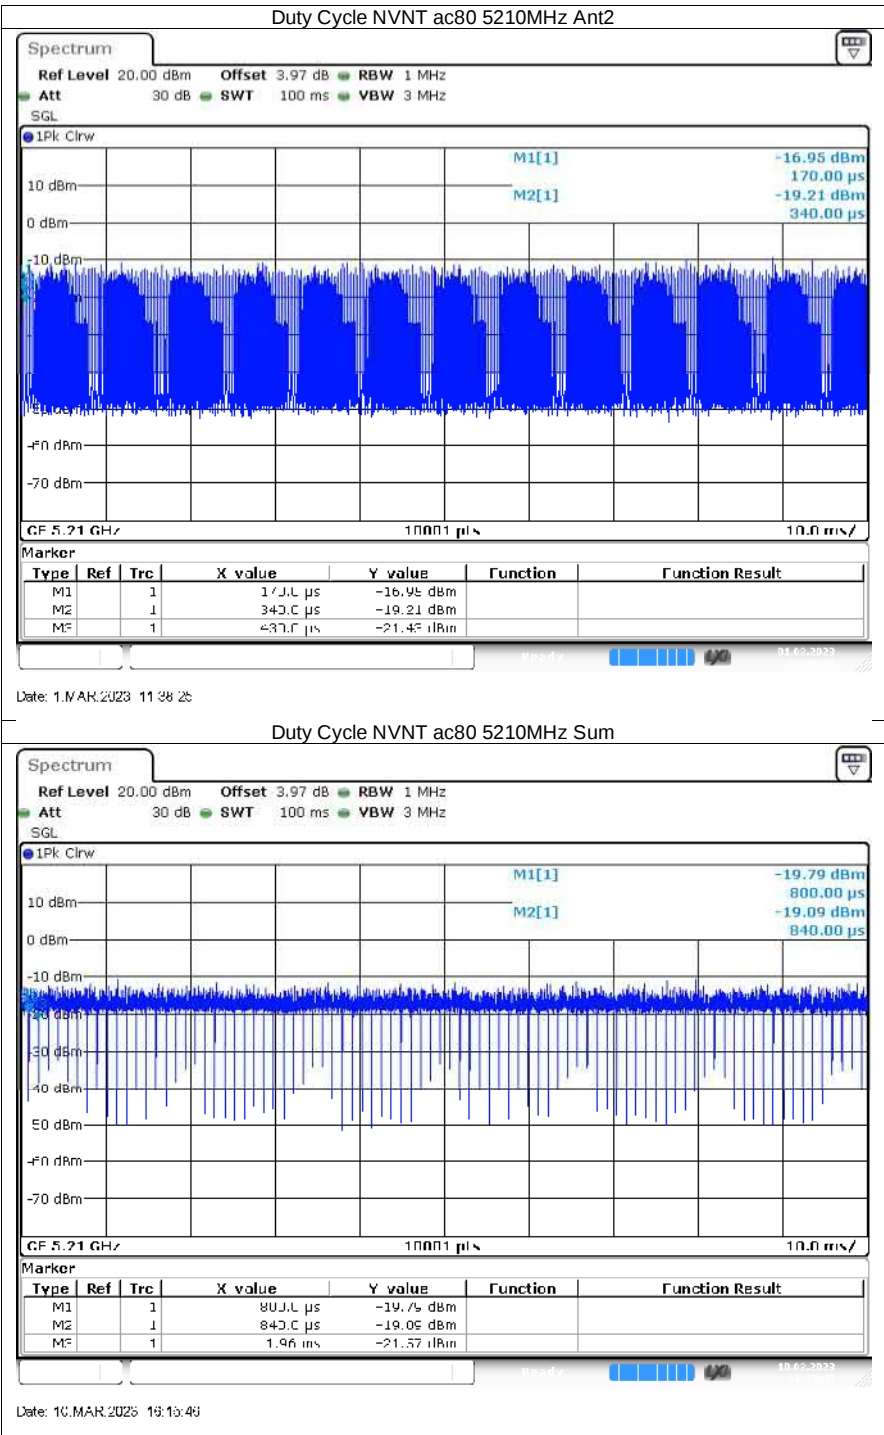




China

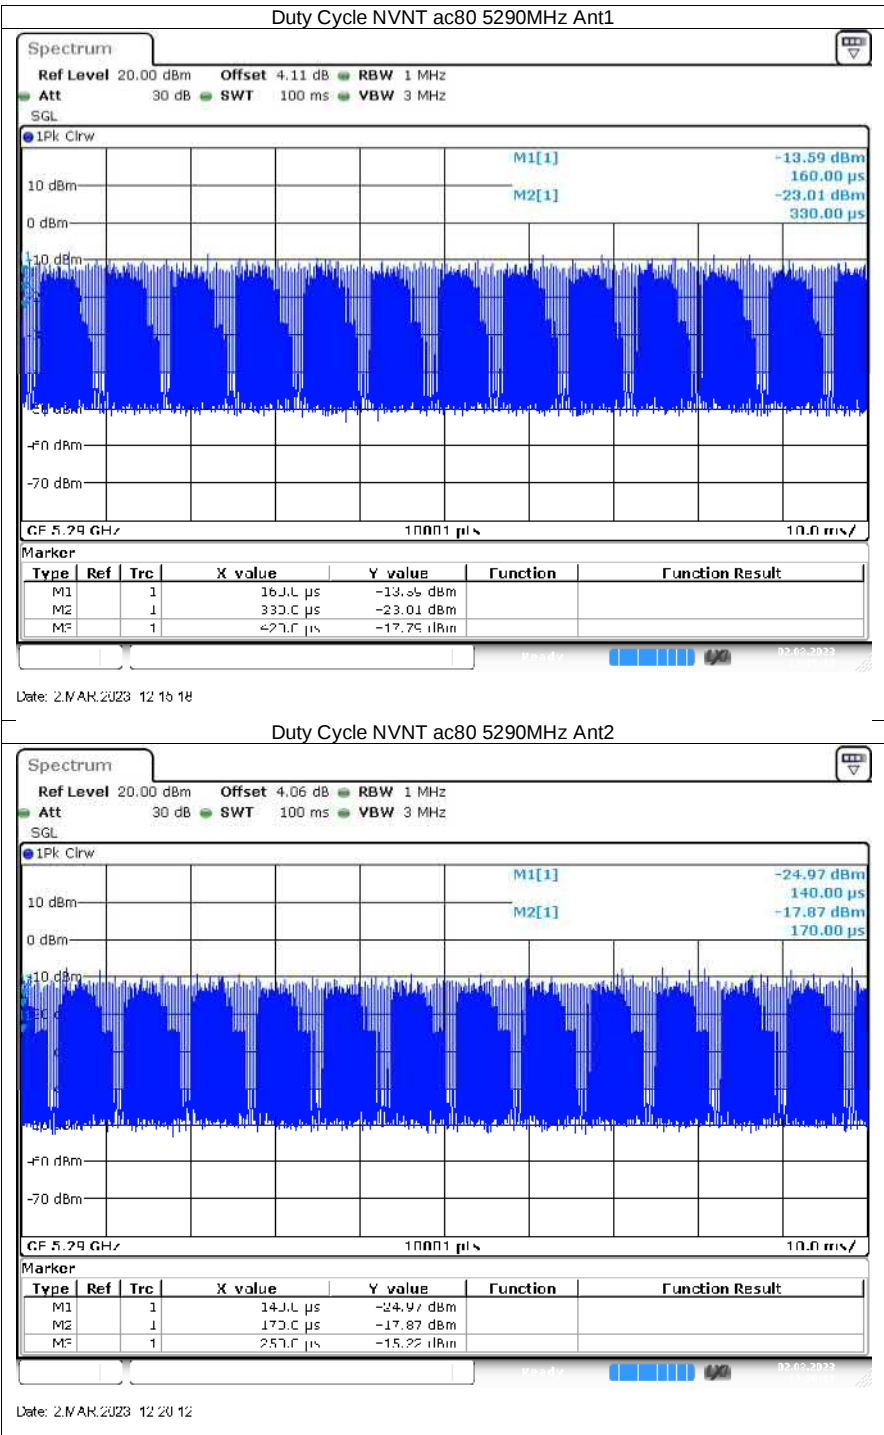

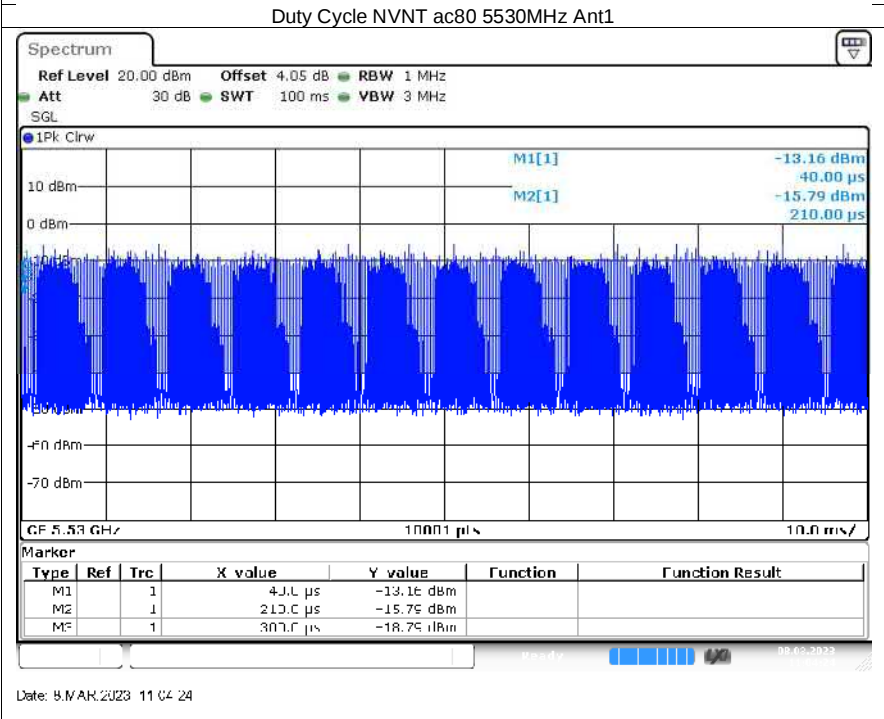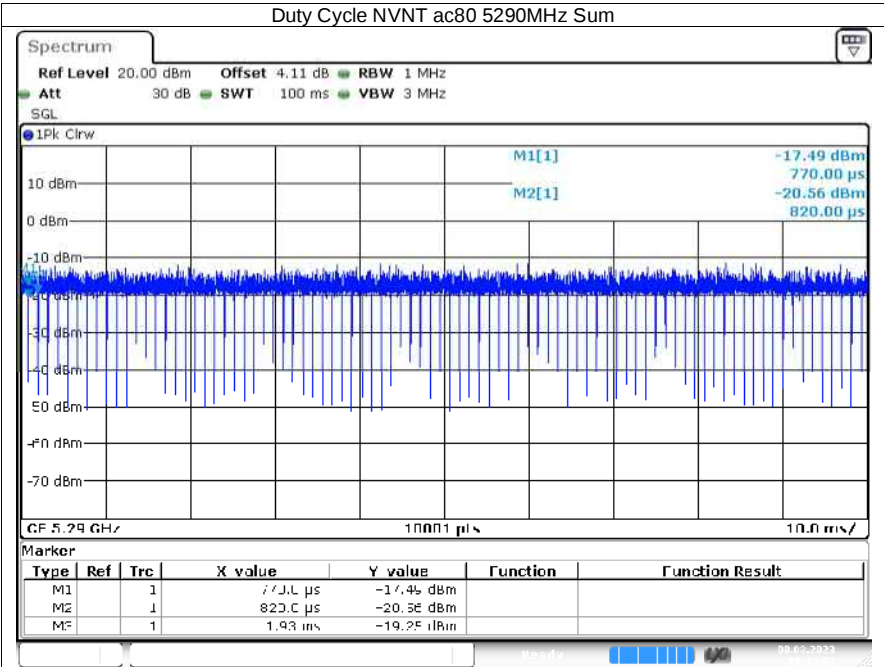





China

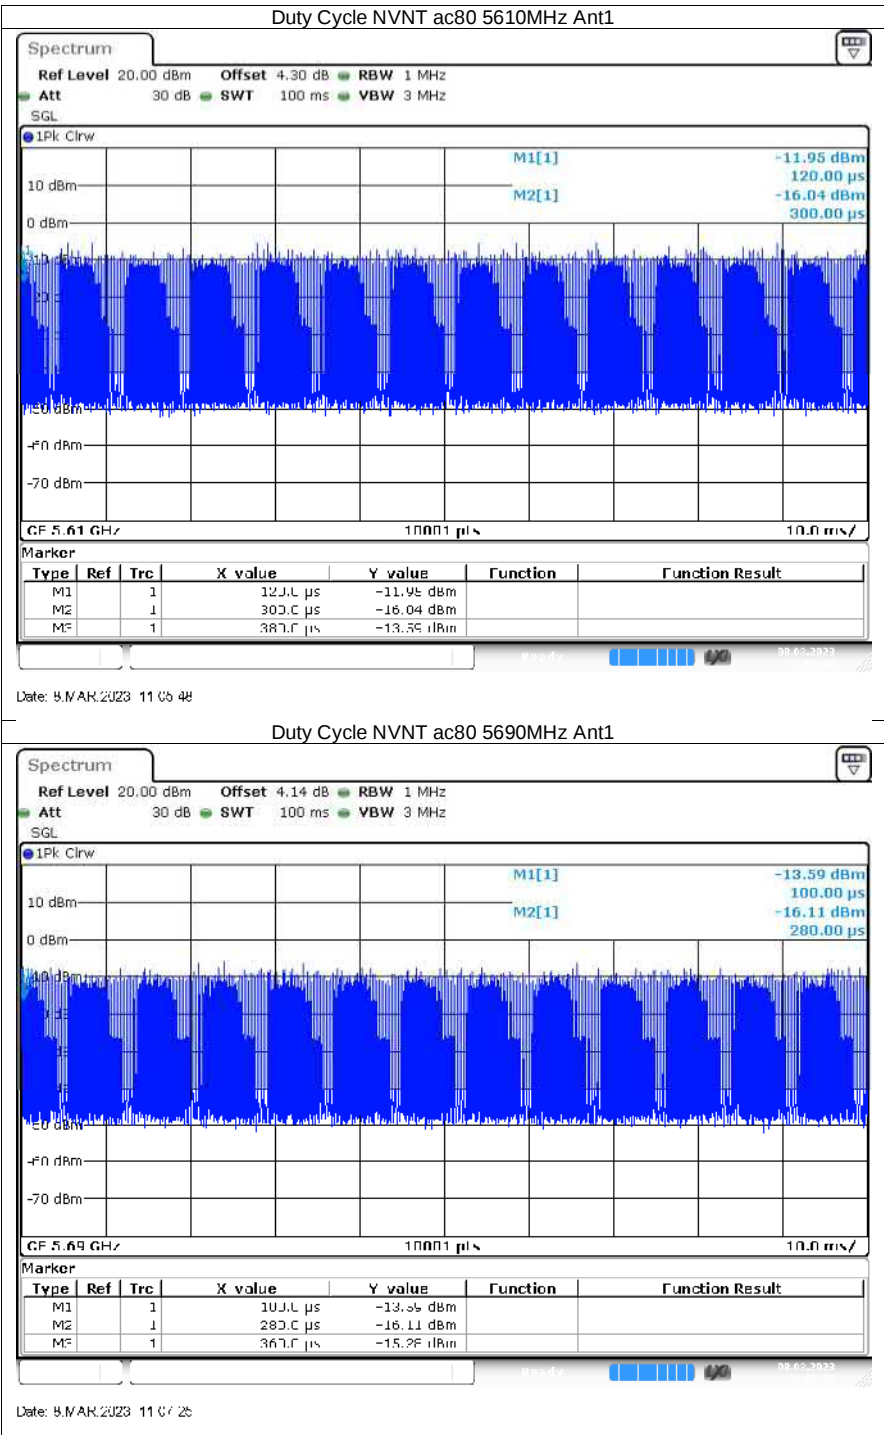




China

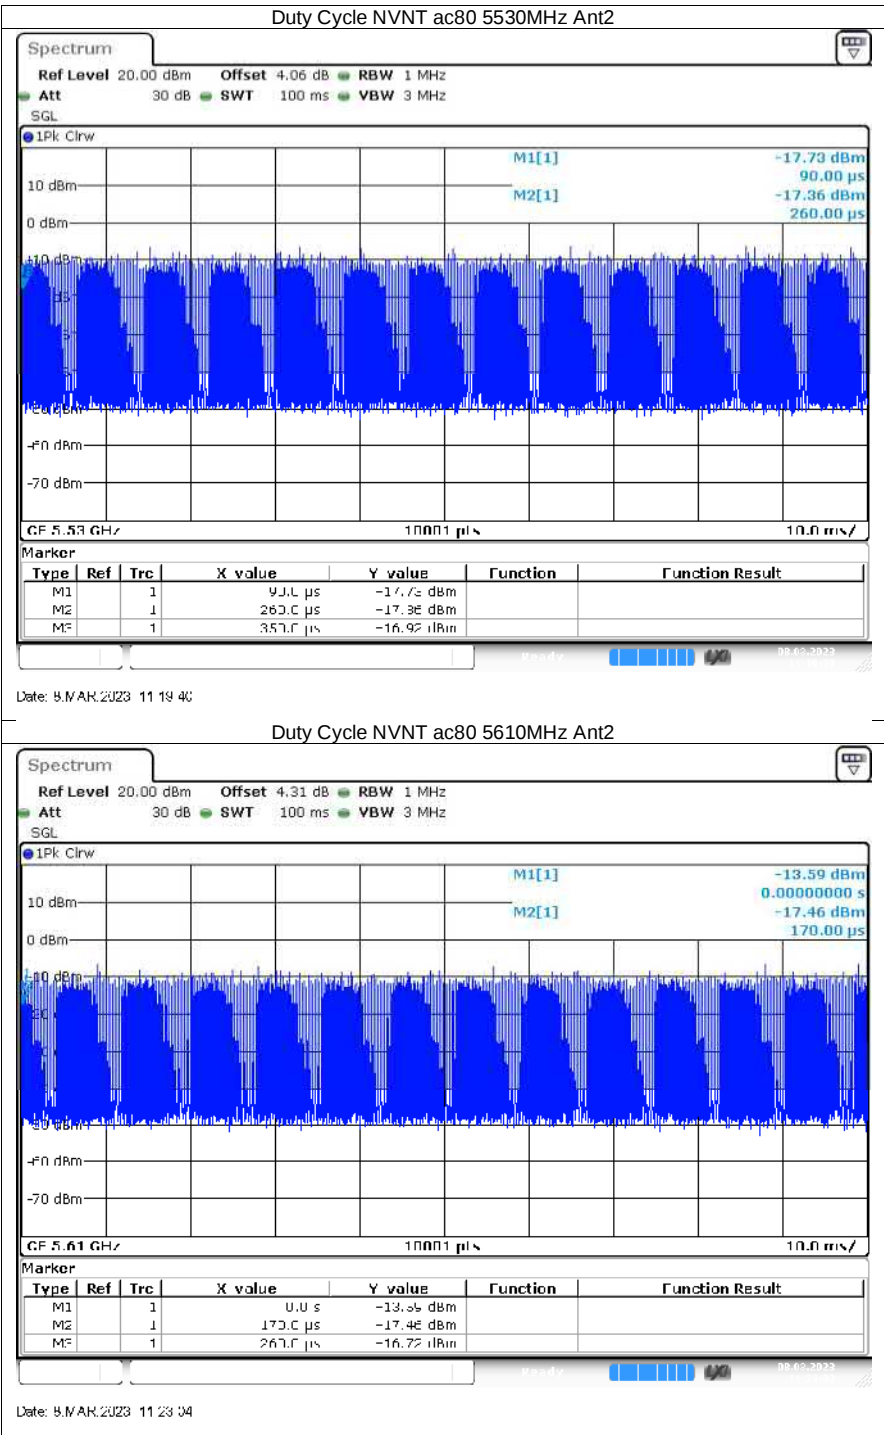


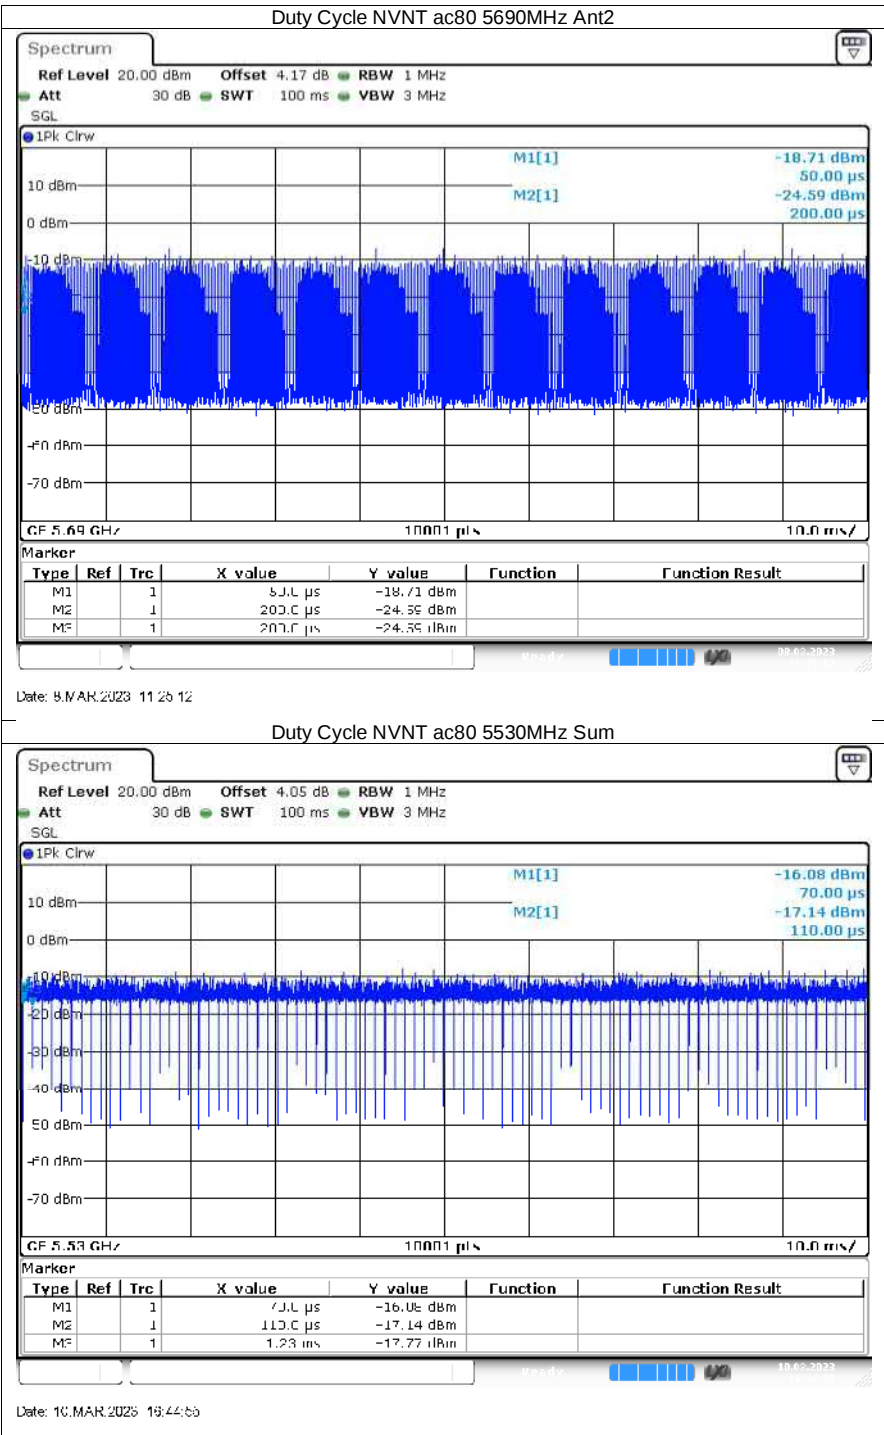







China

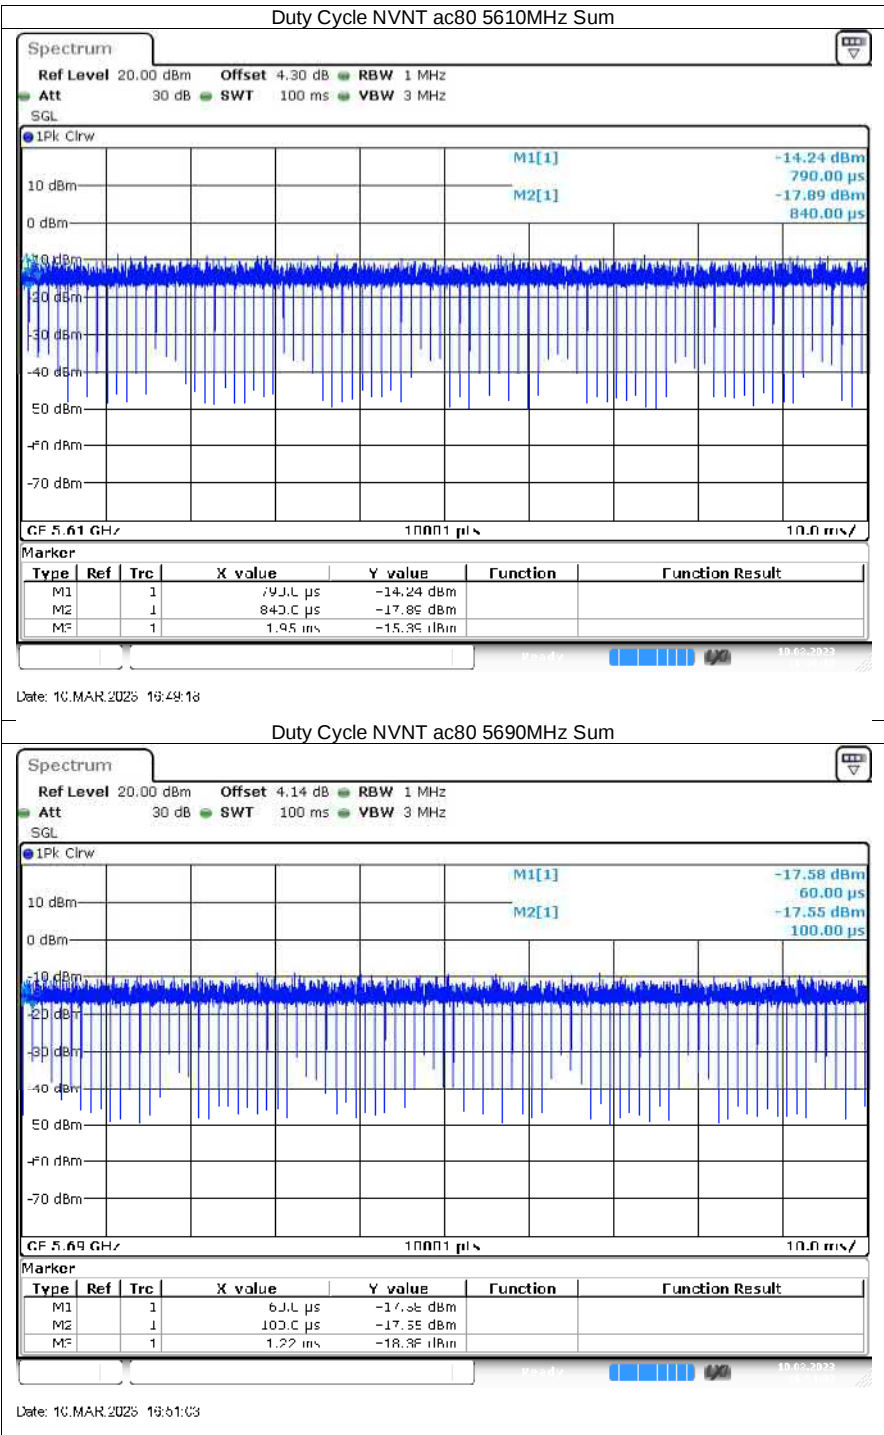

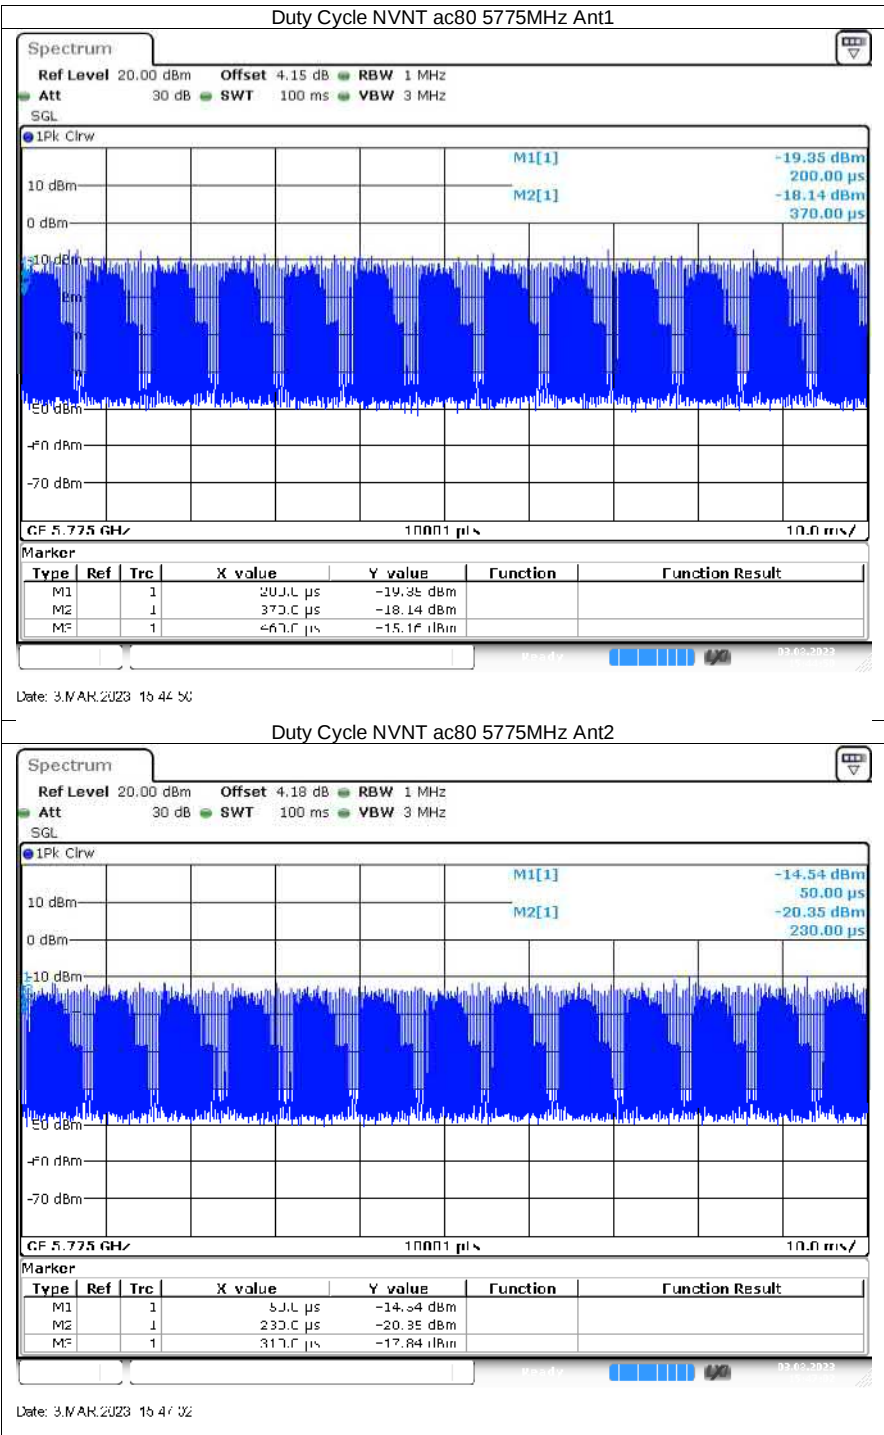

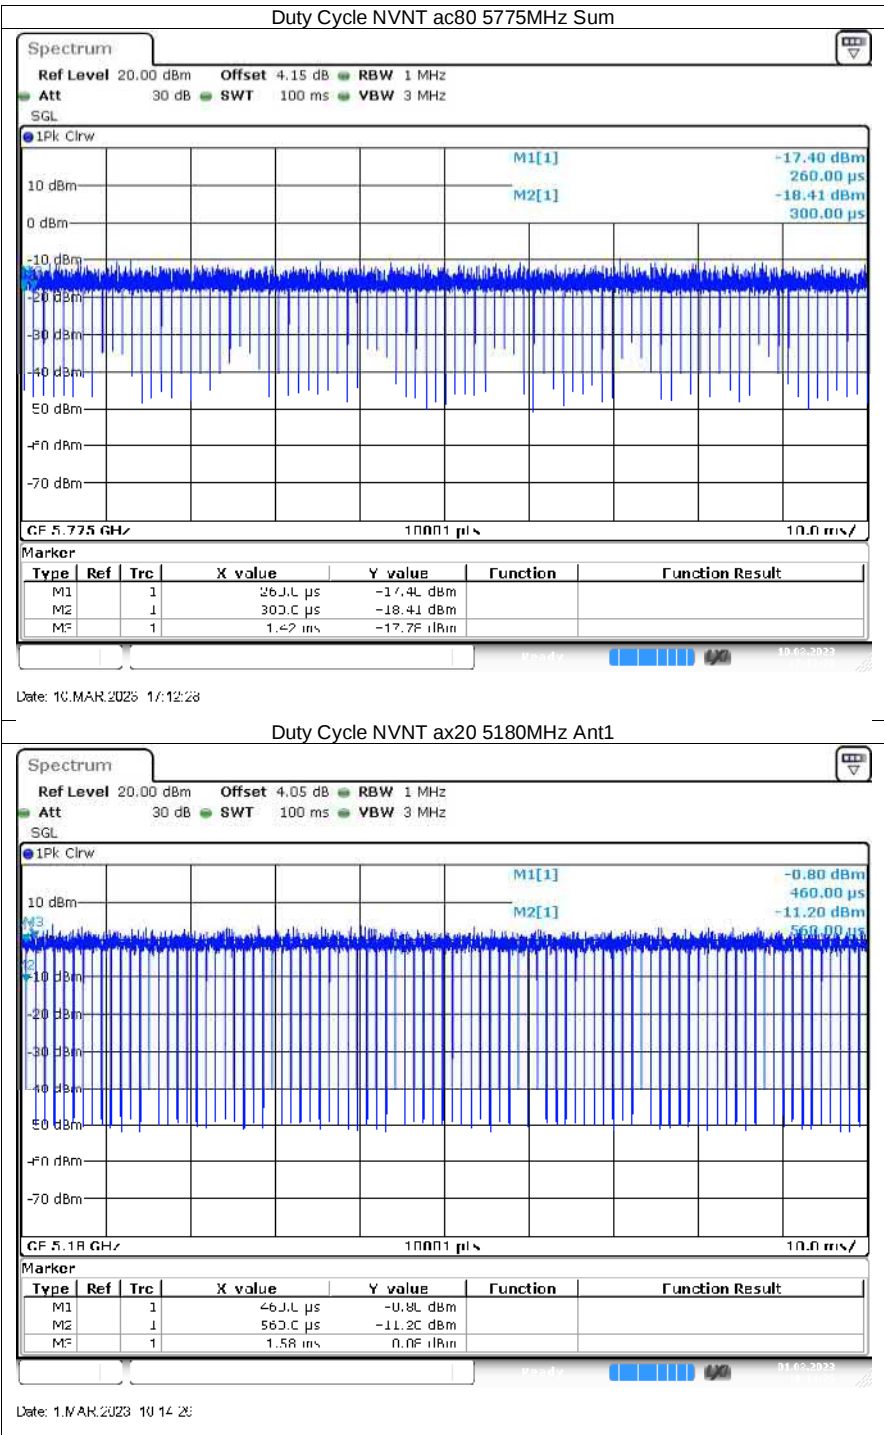


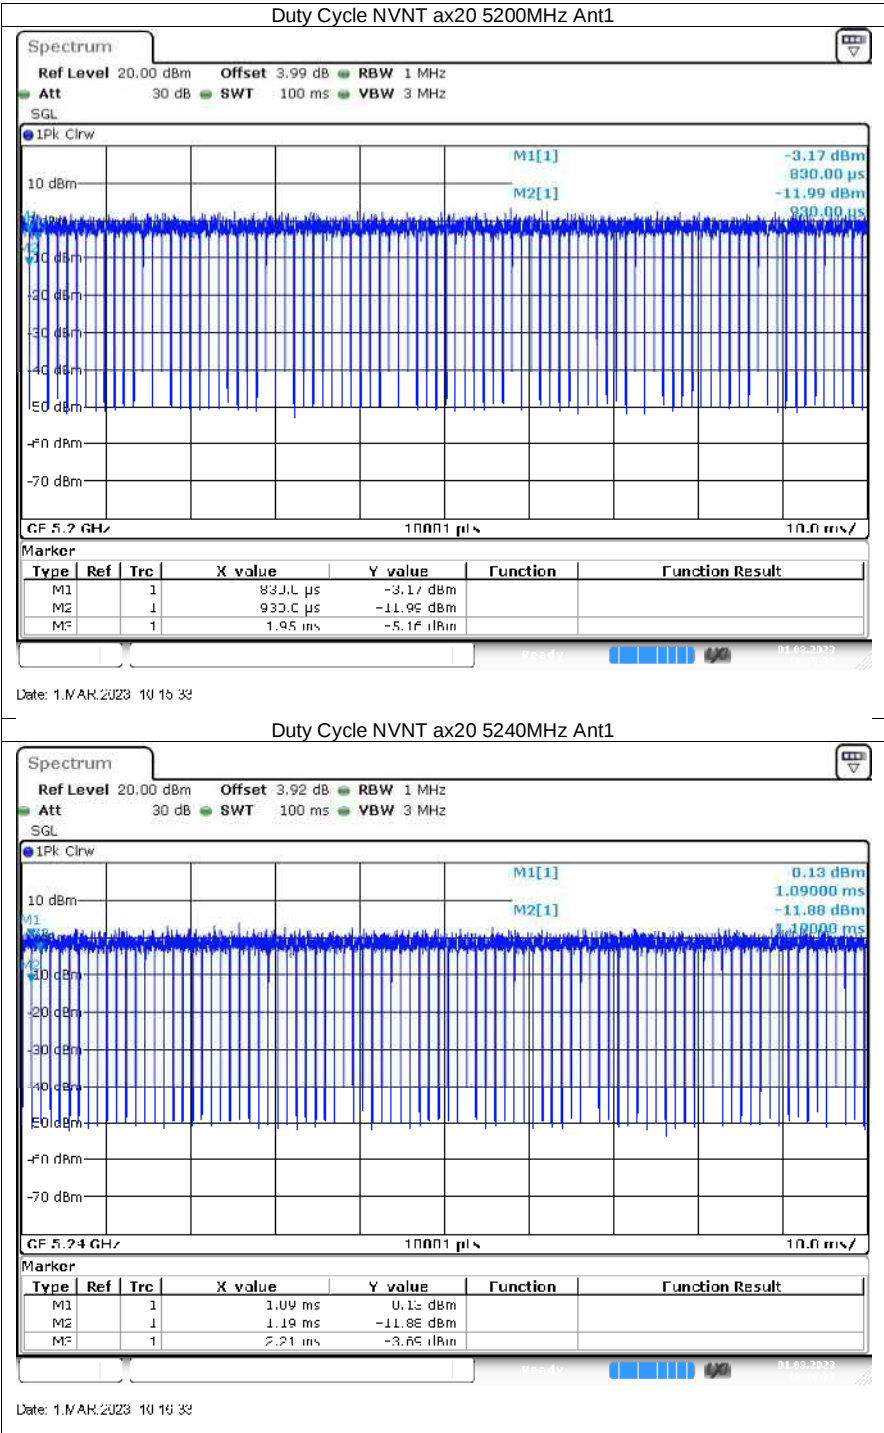


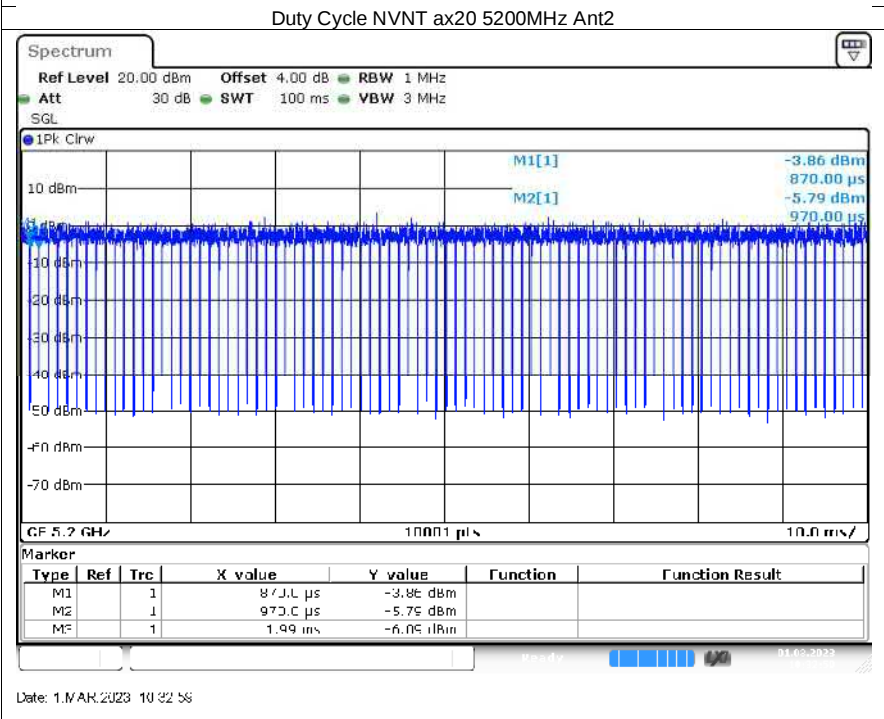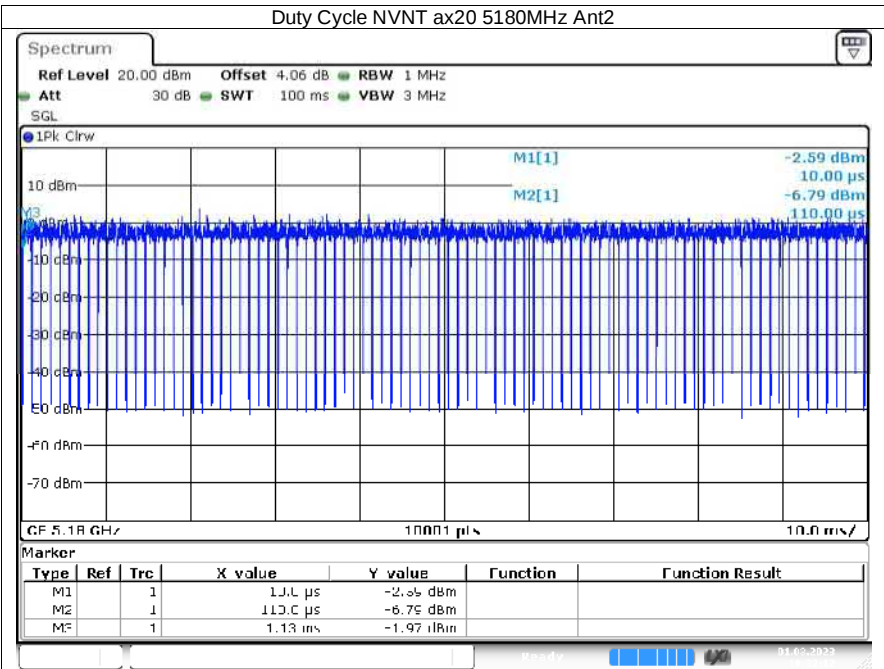




China

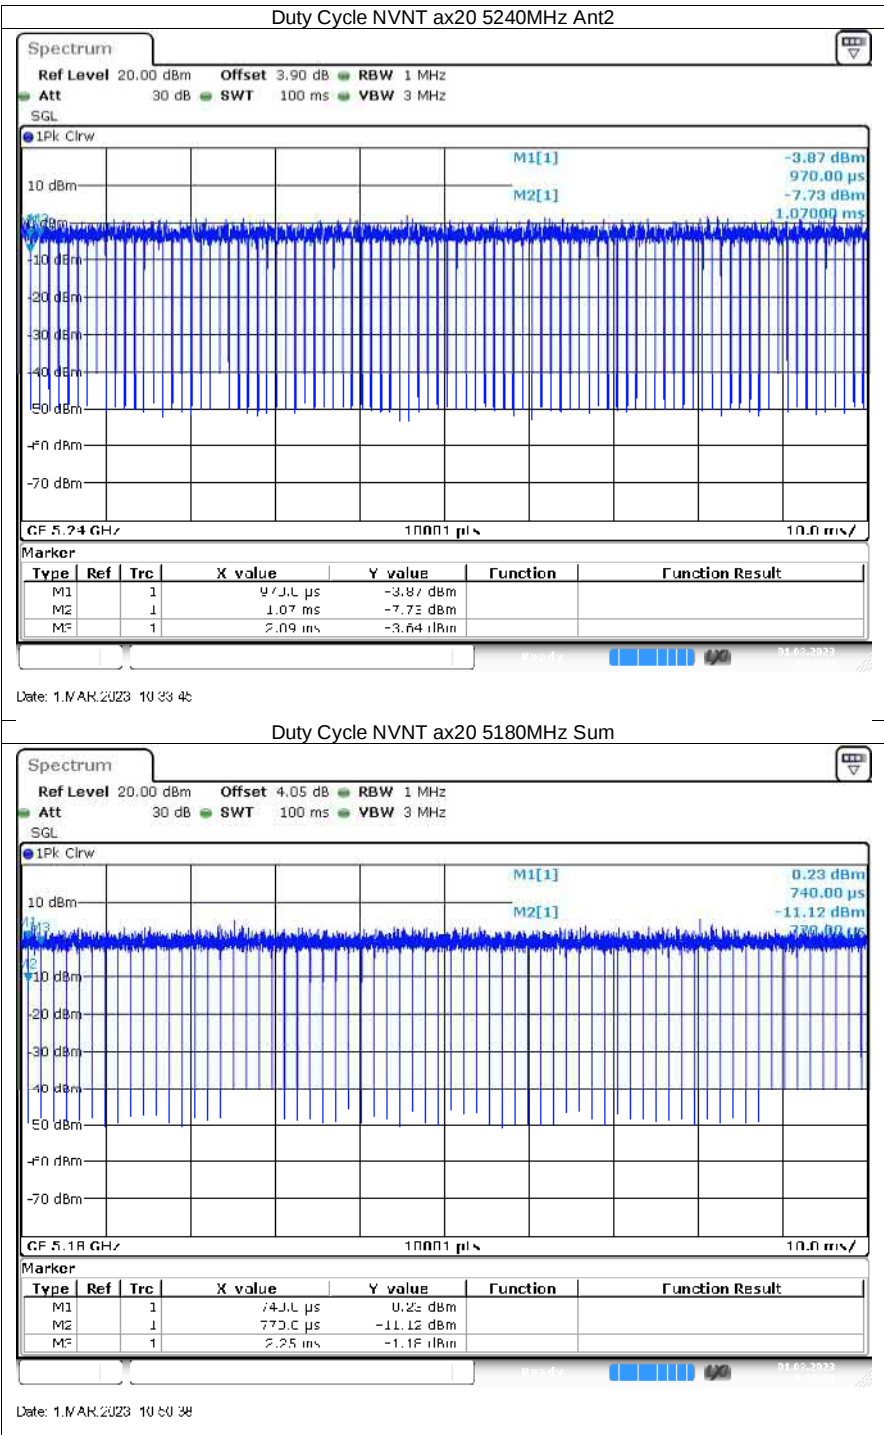


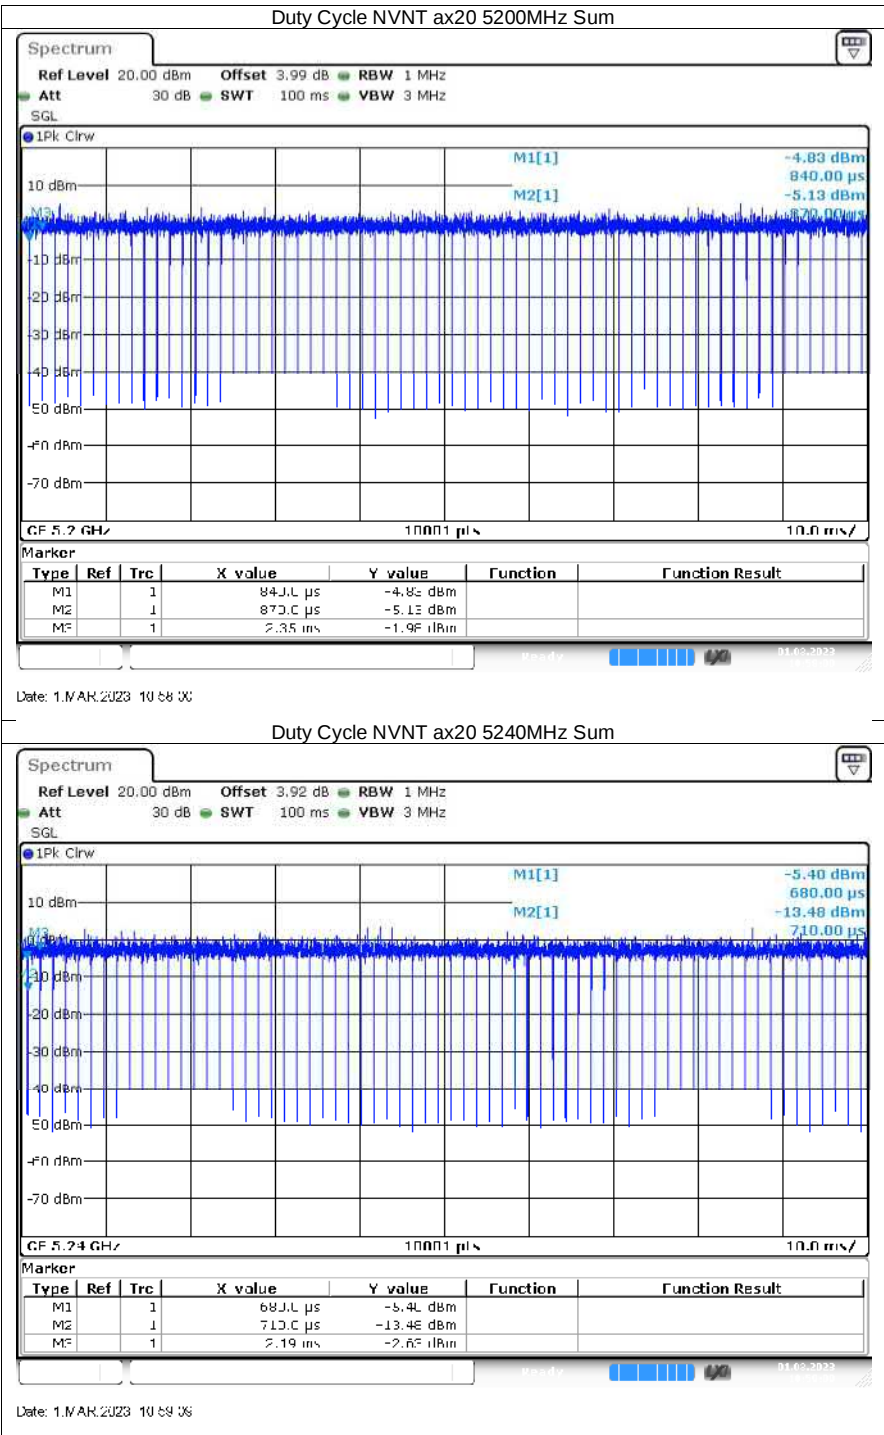


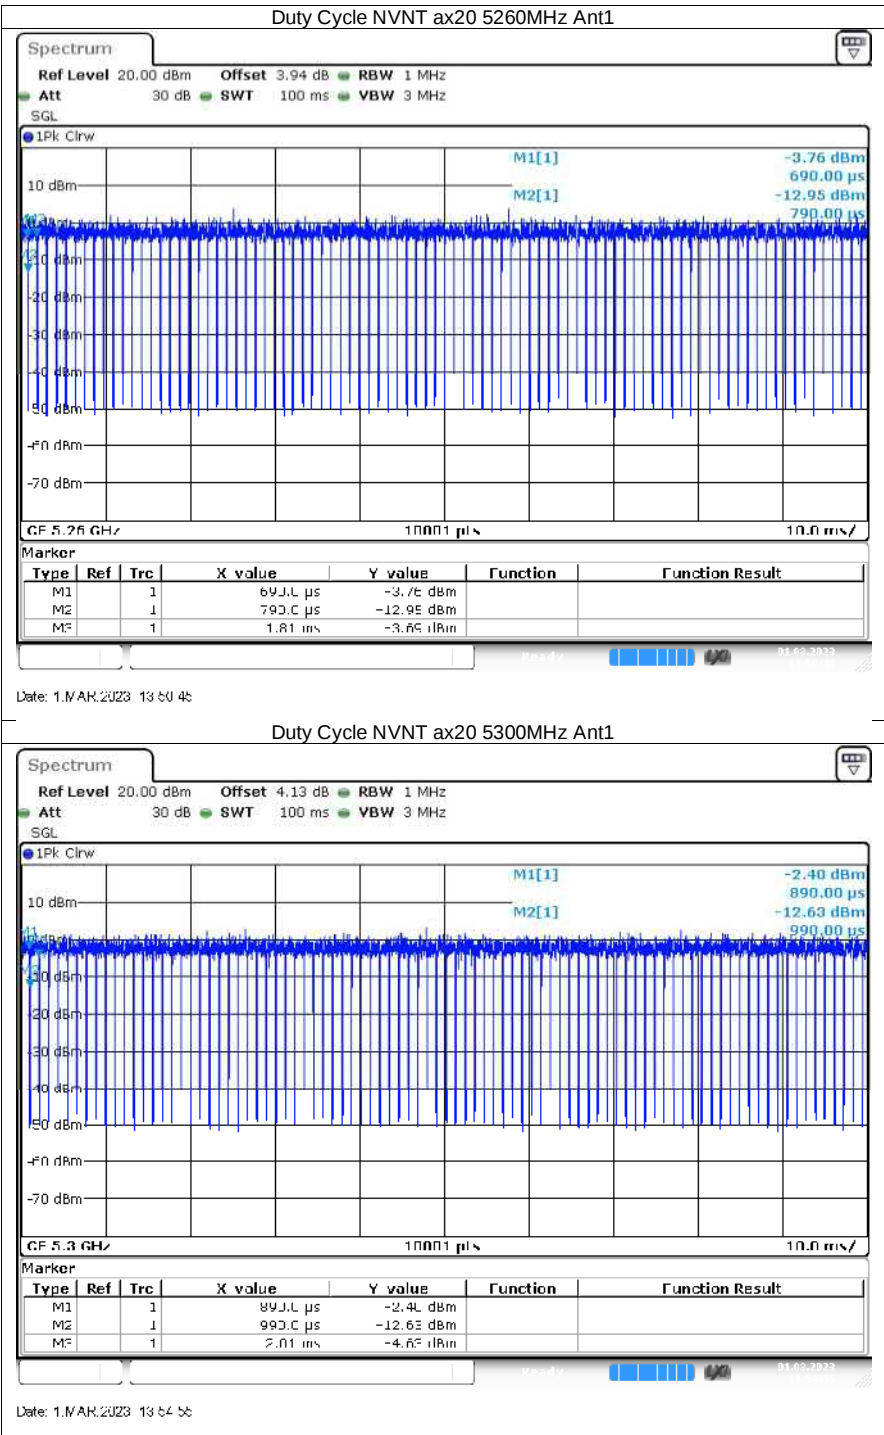




China


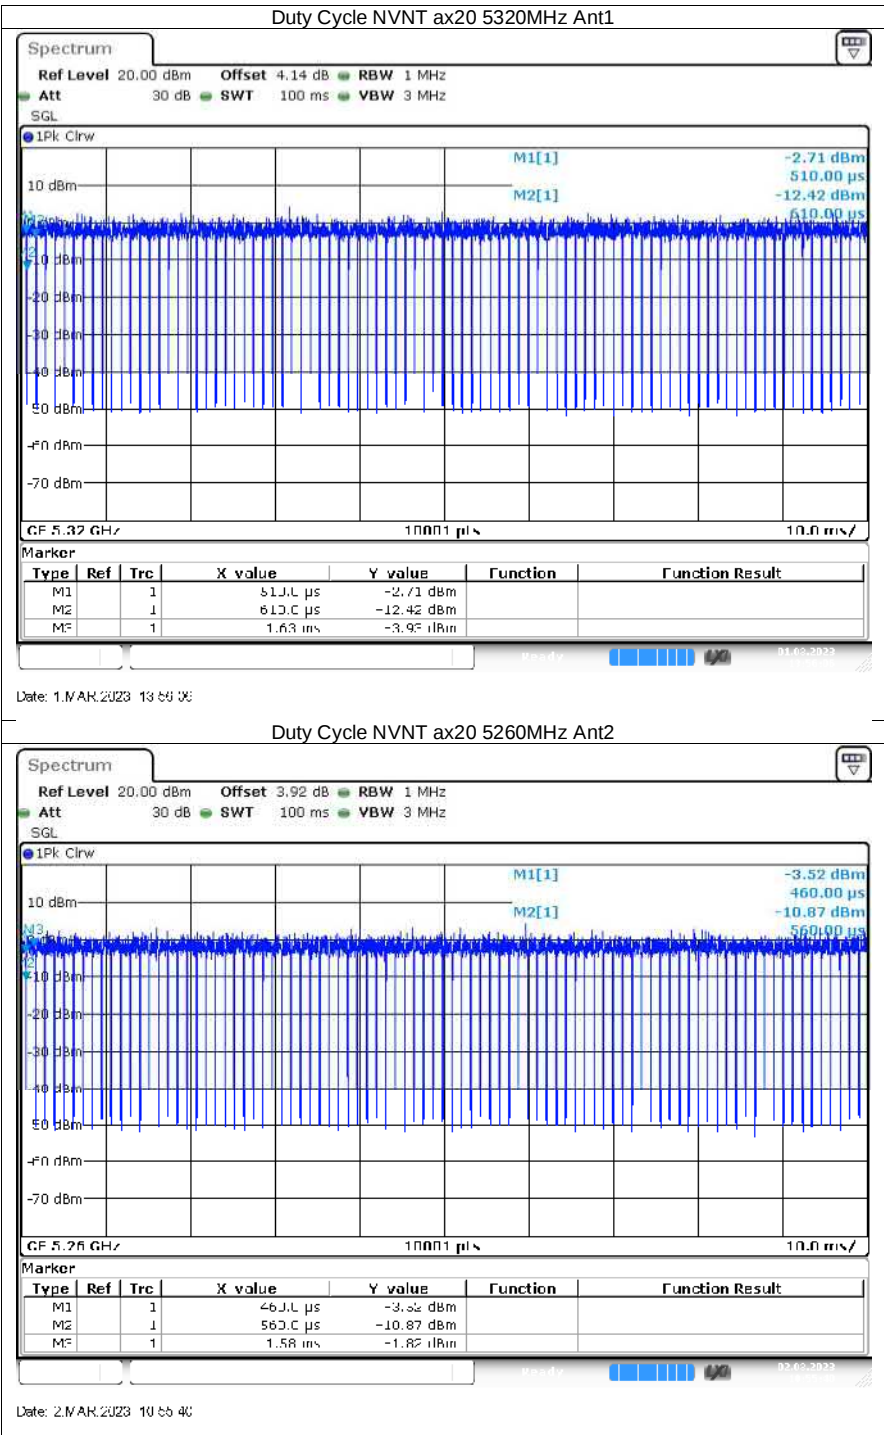


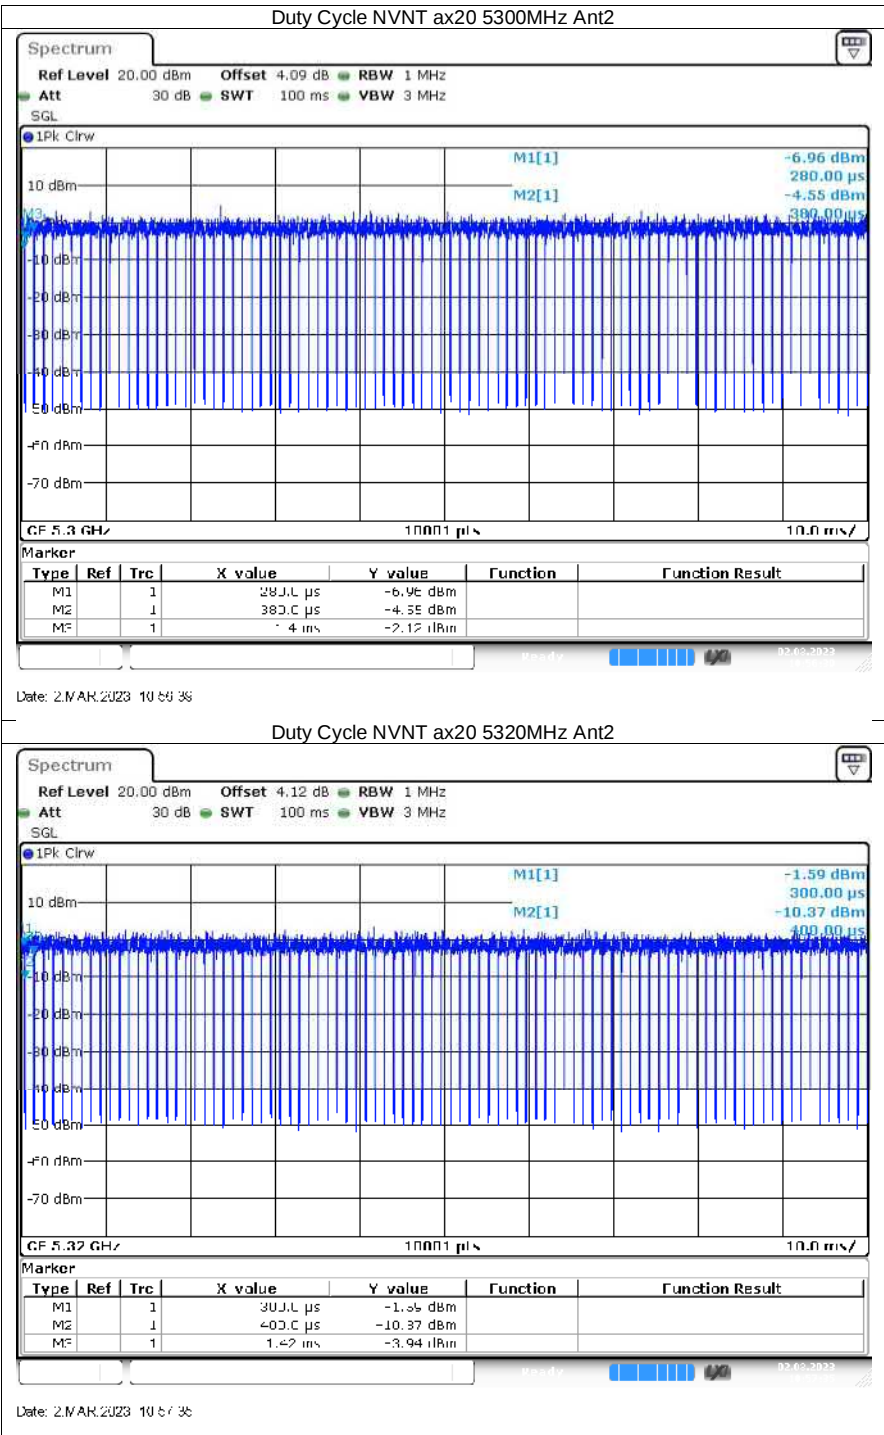

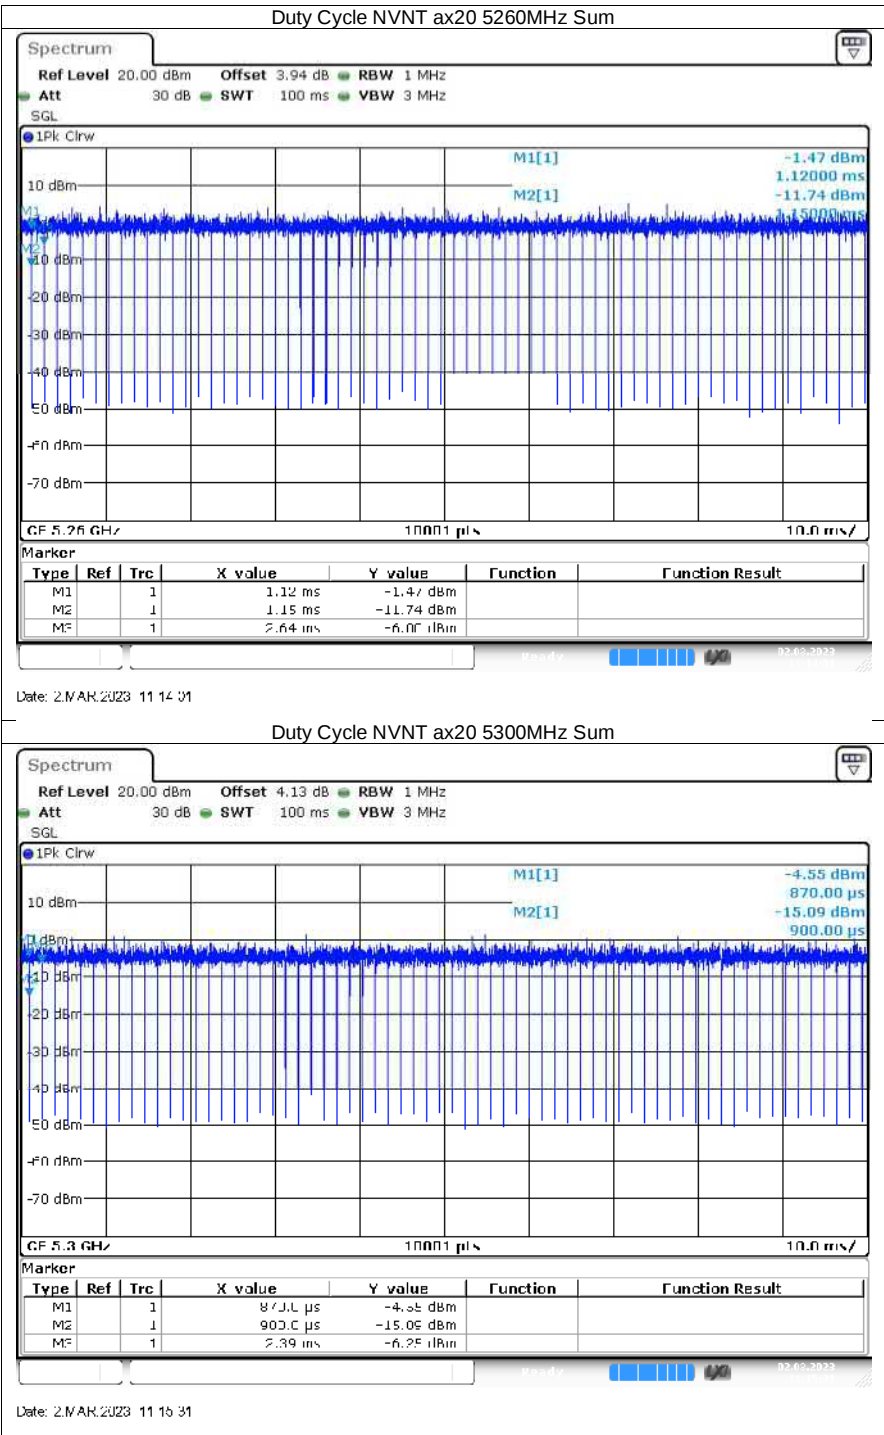





China

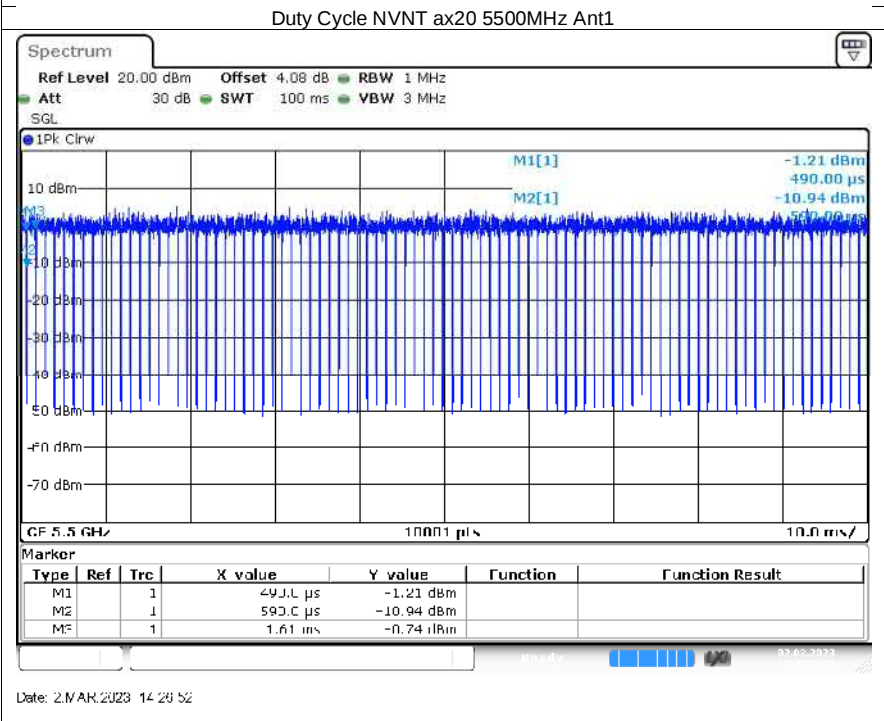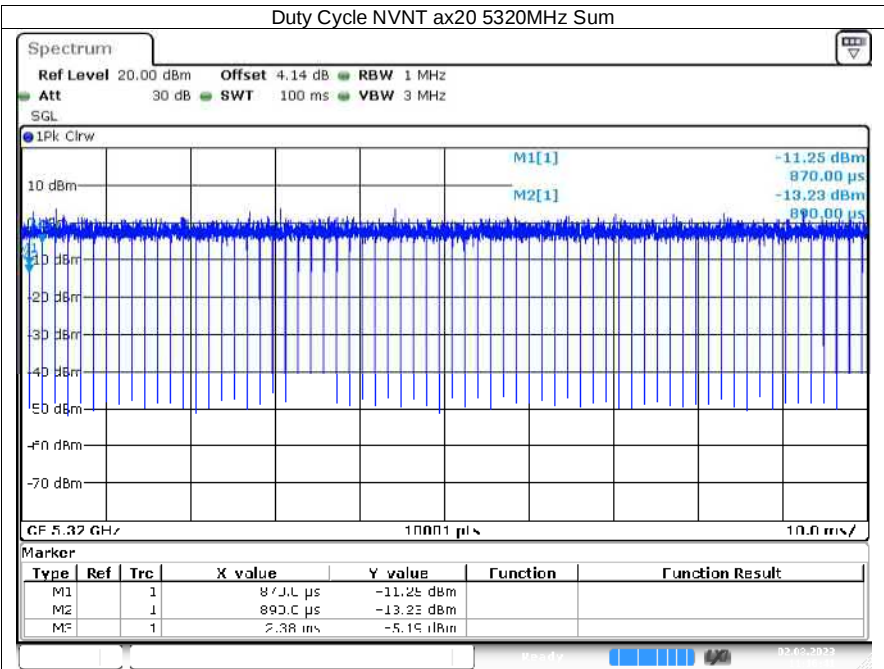







China


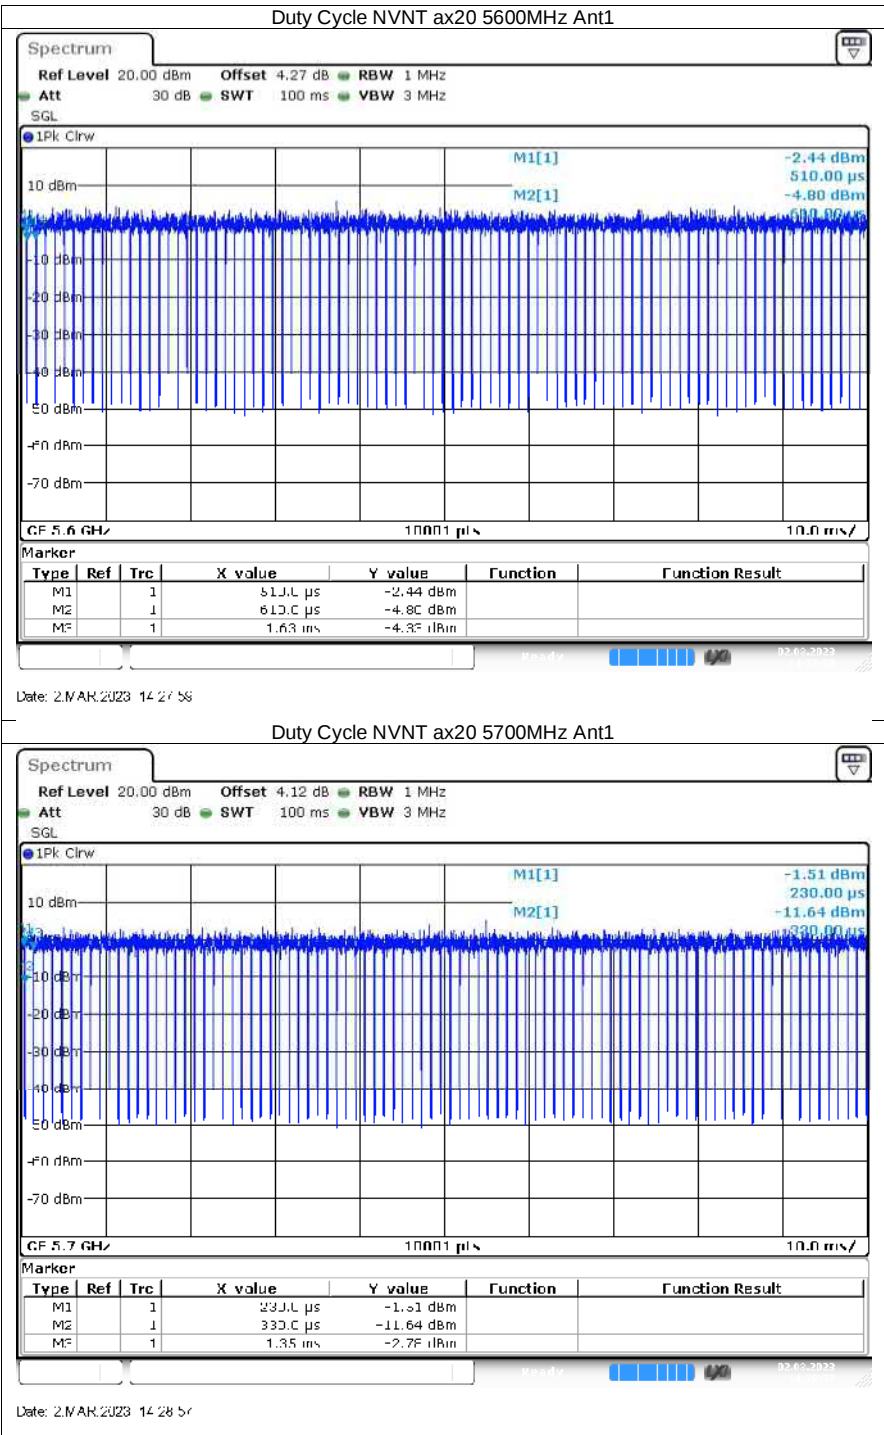


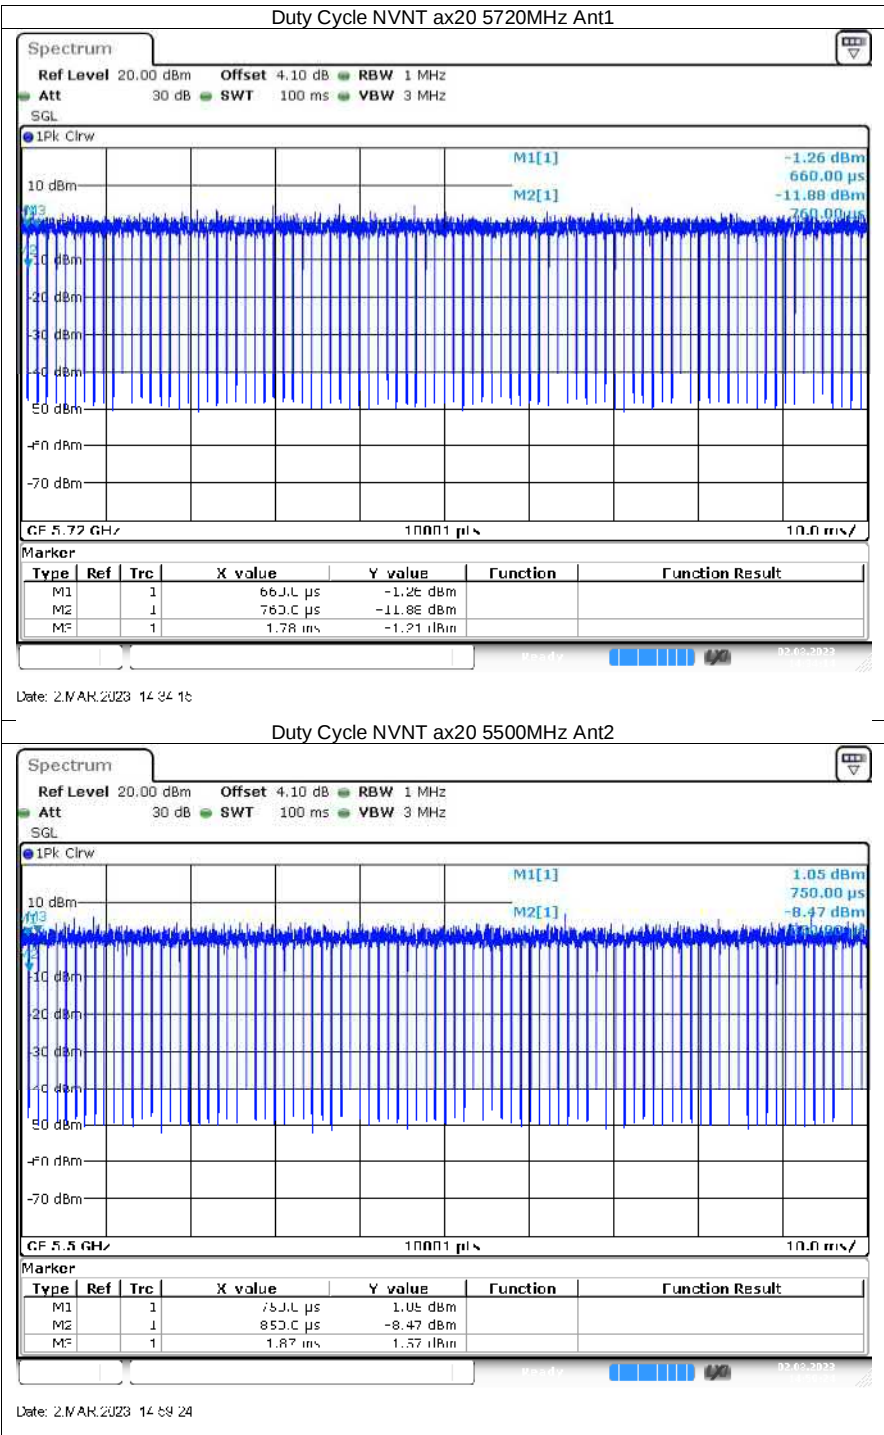


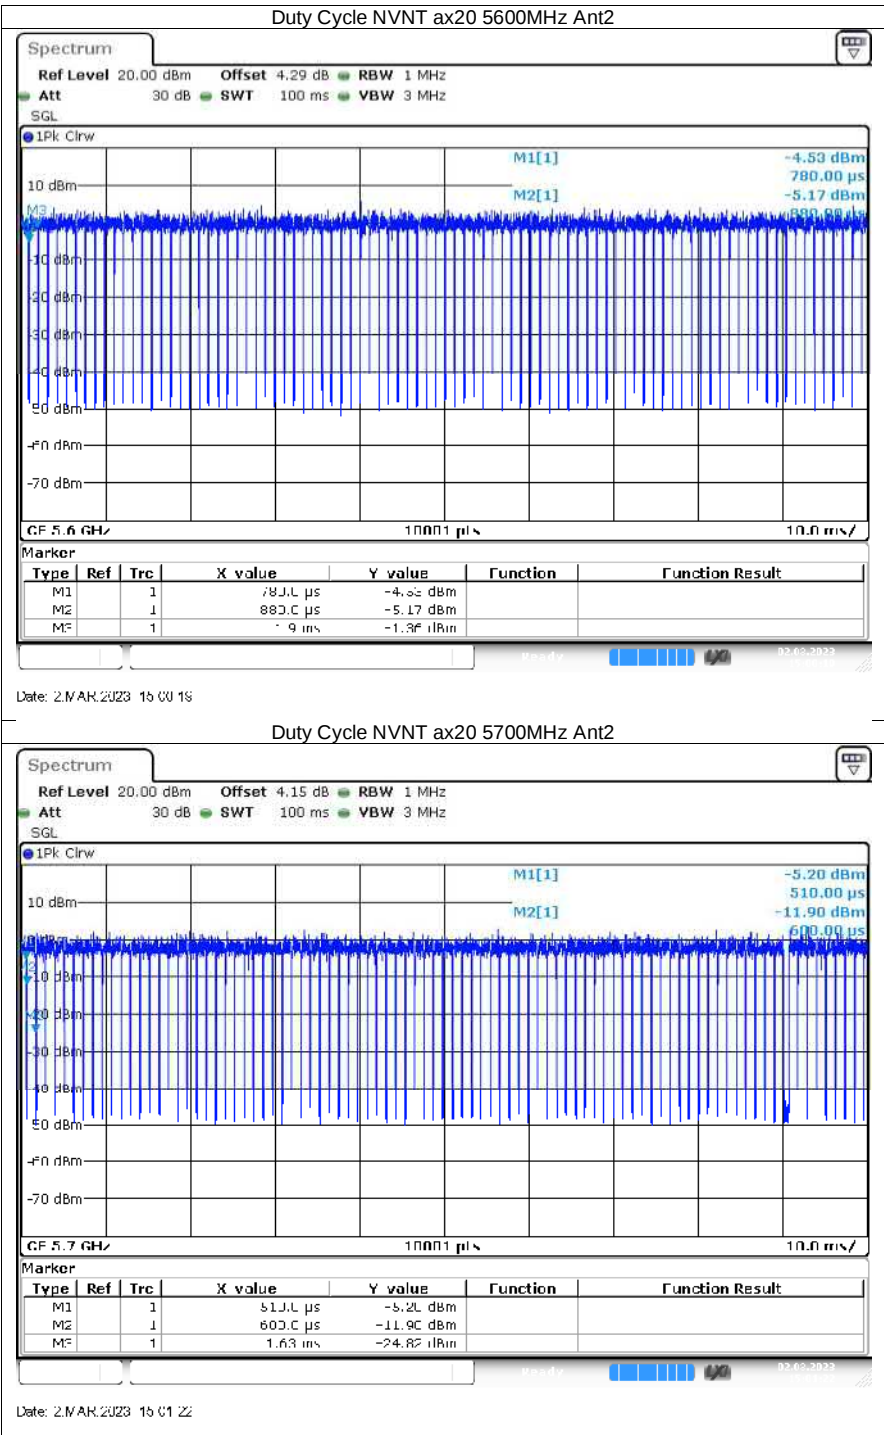

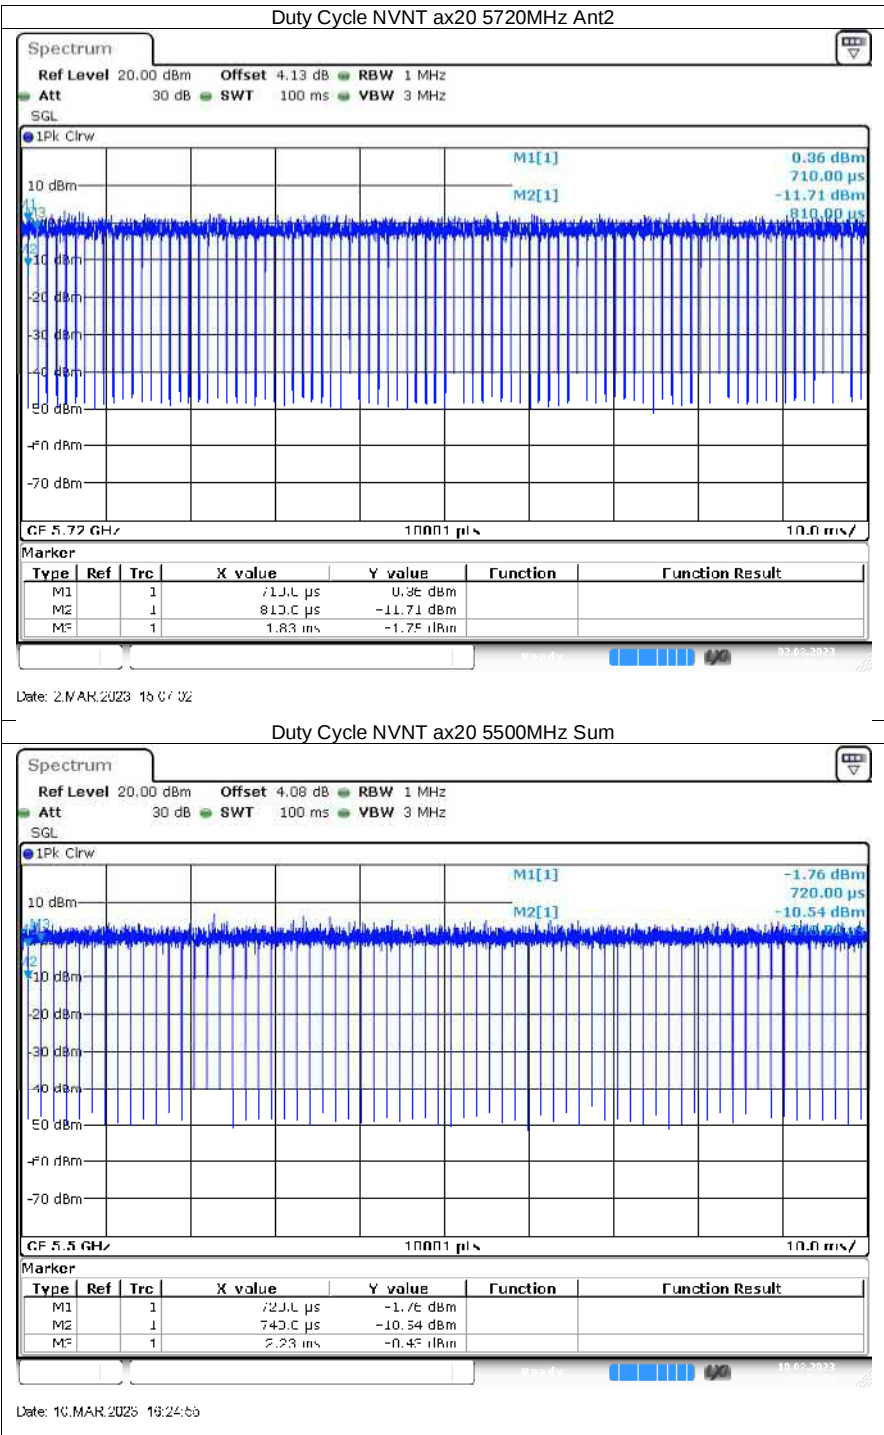

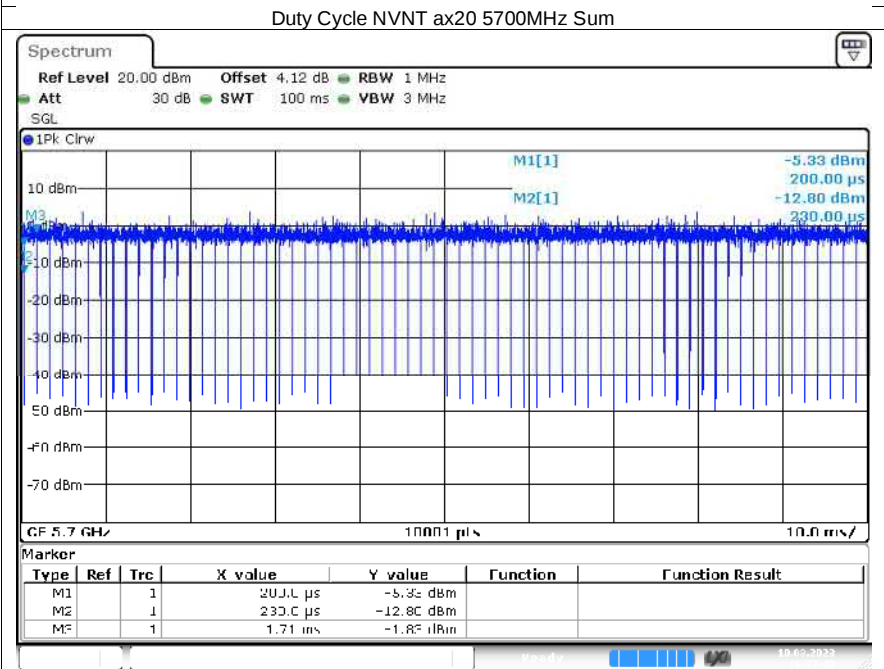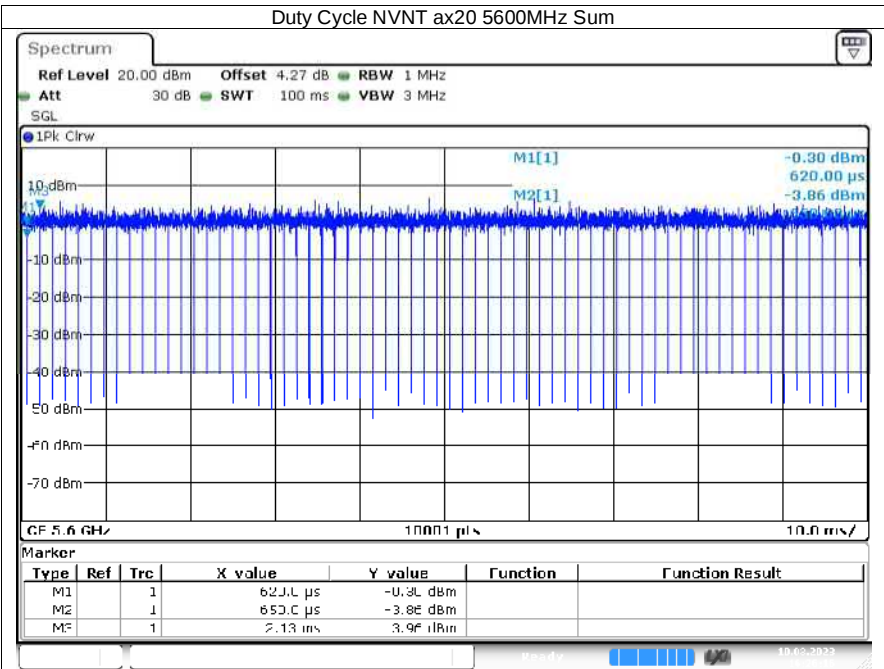


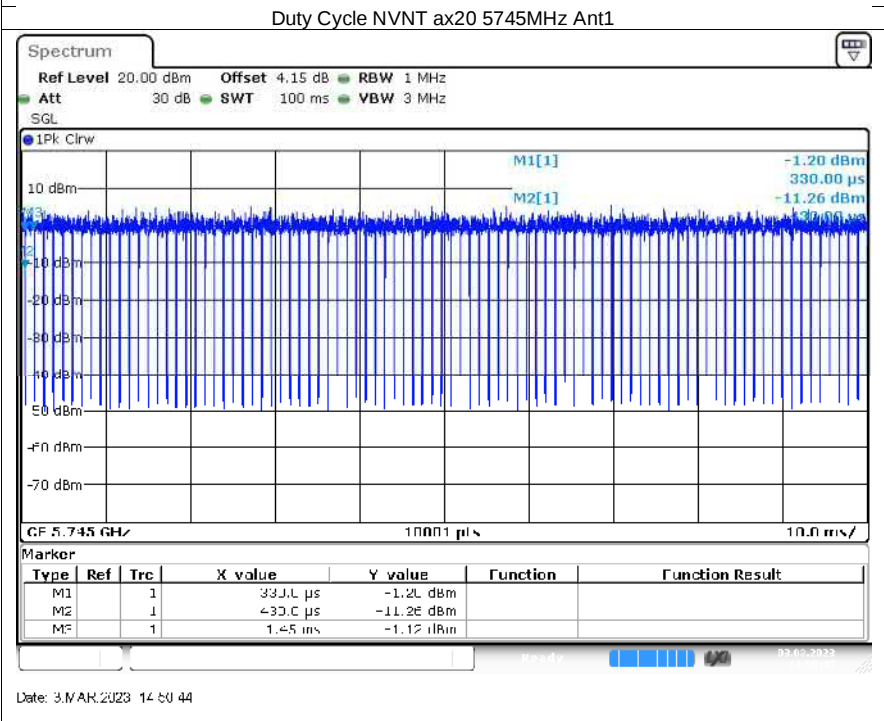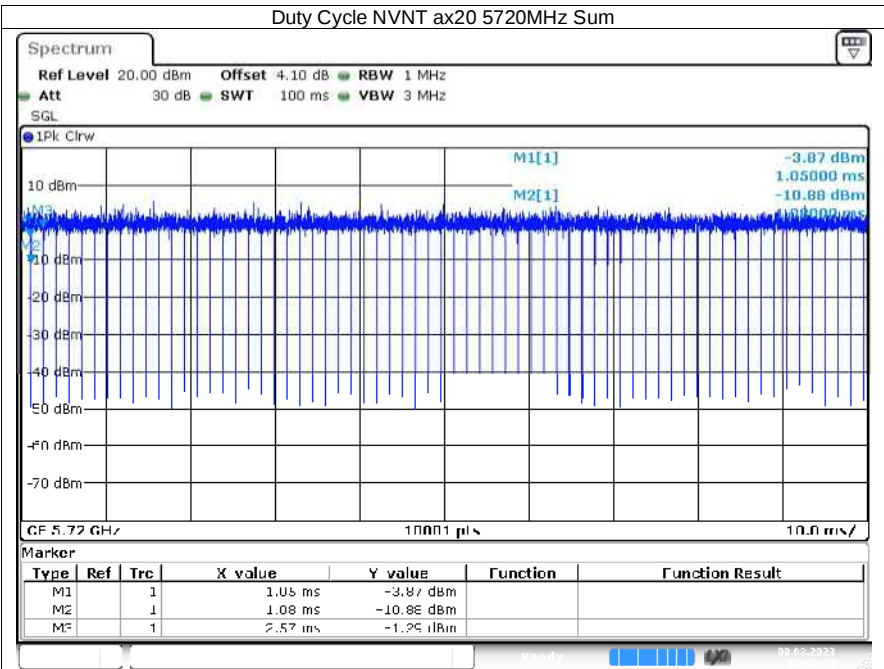


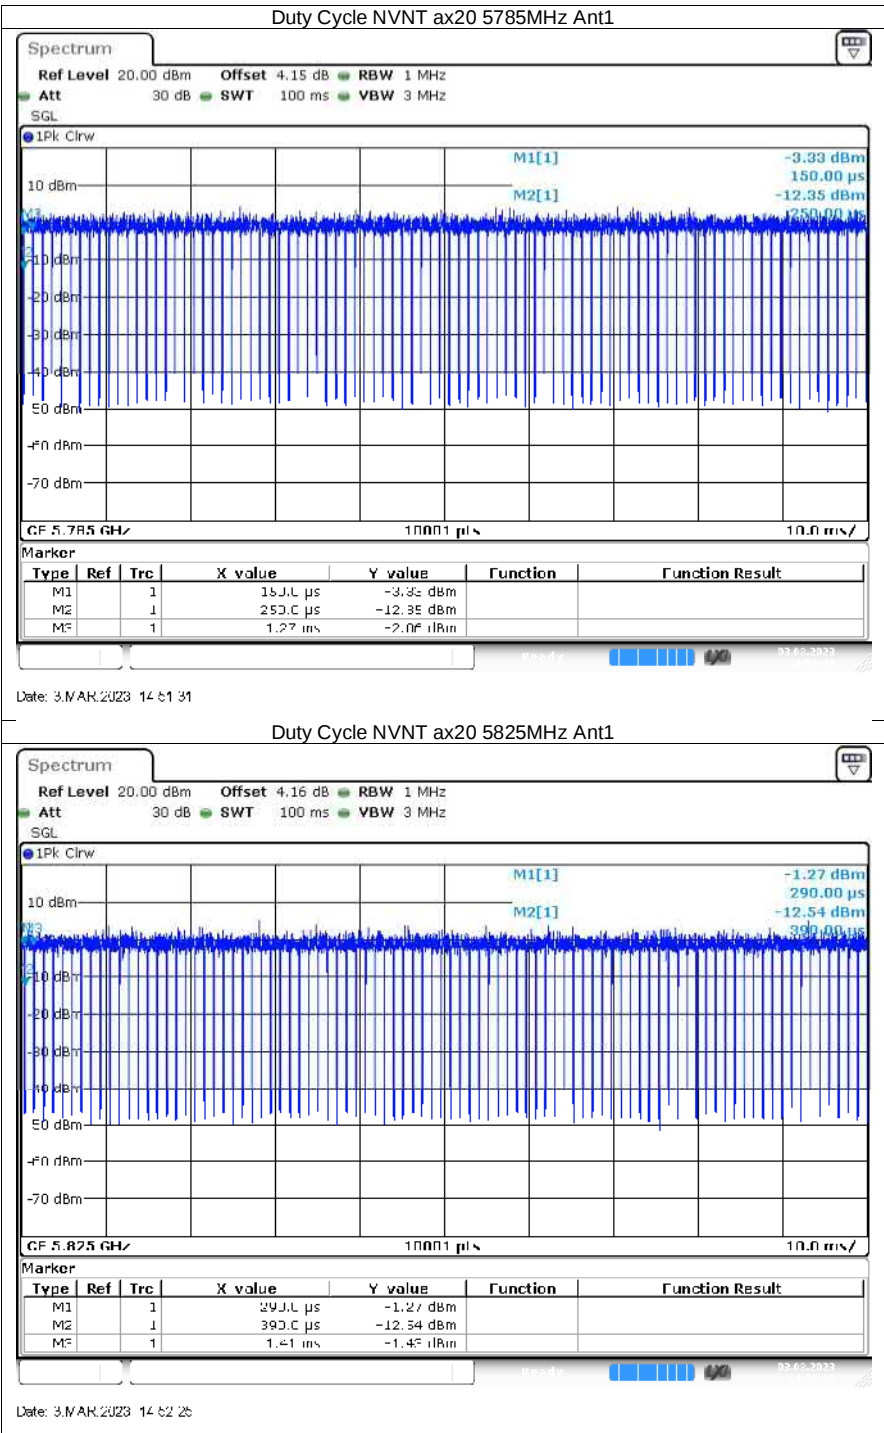




China

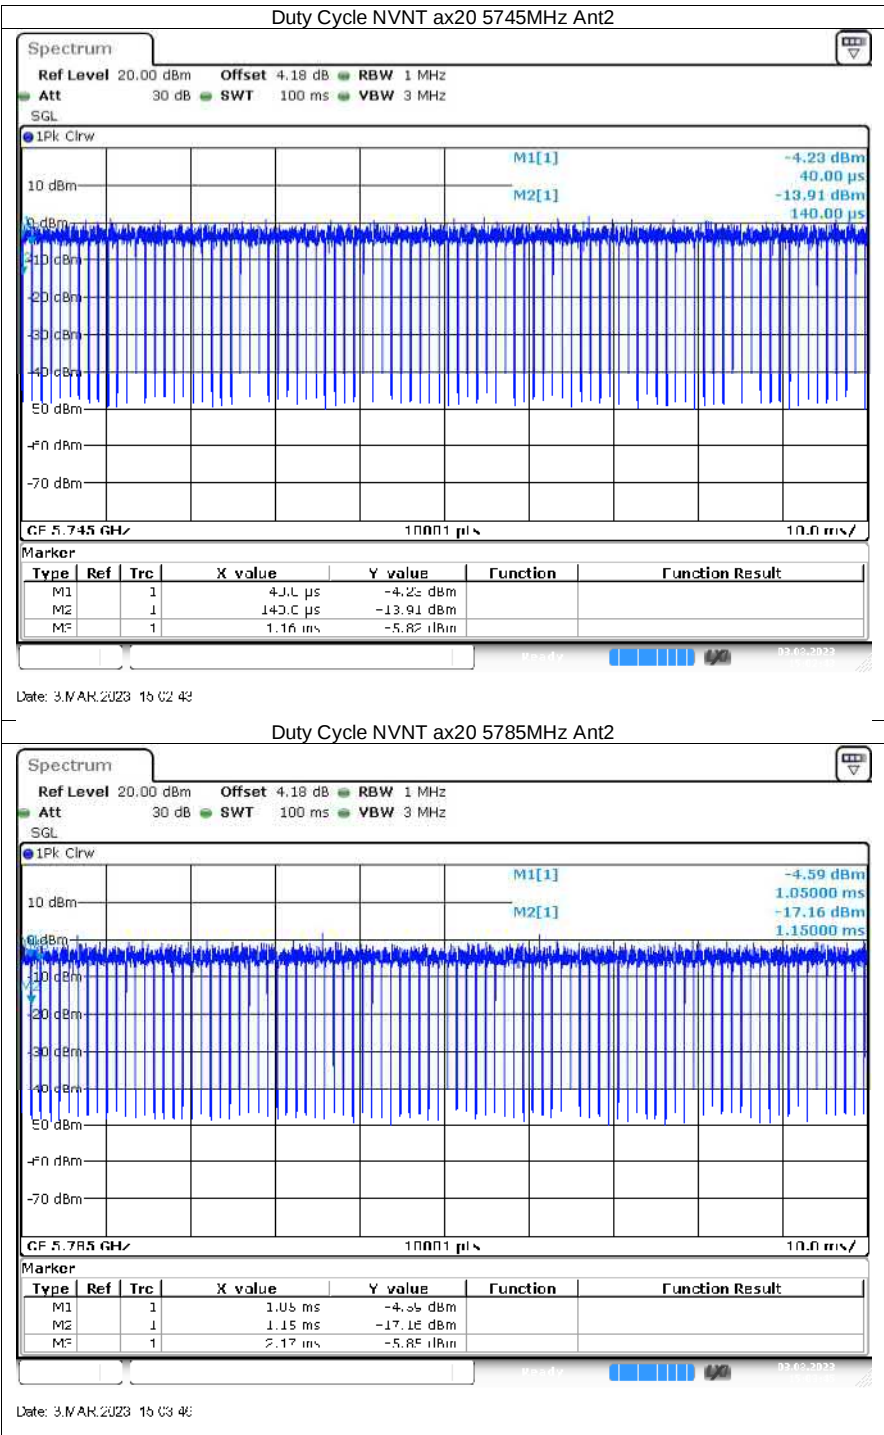



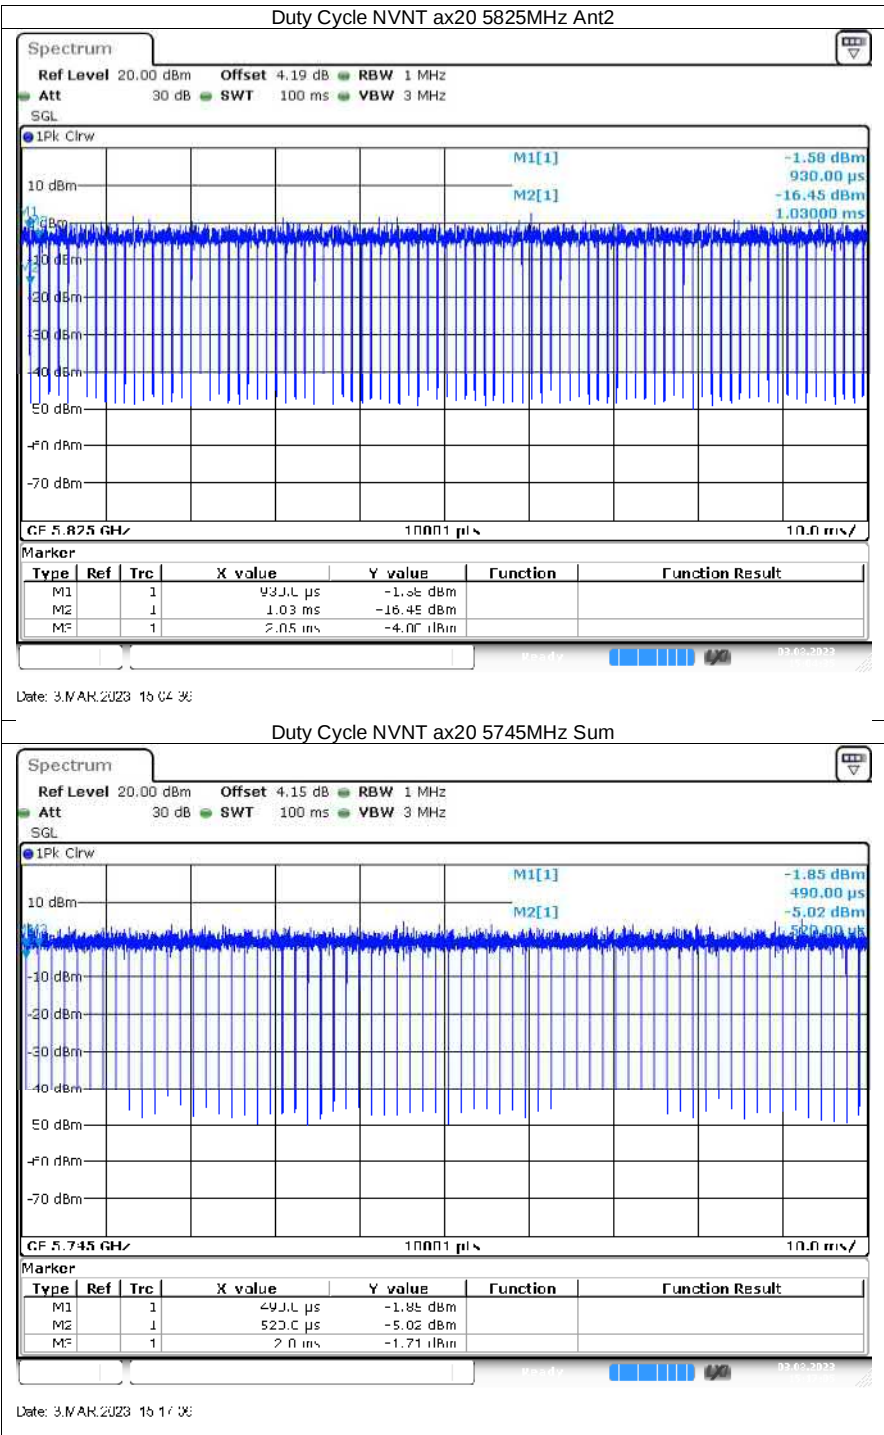





China

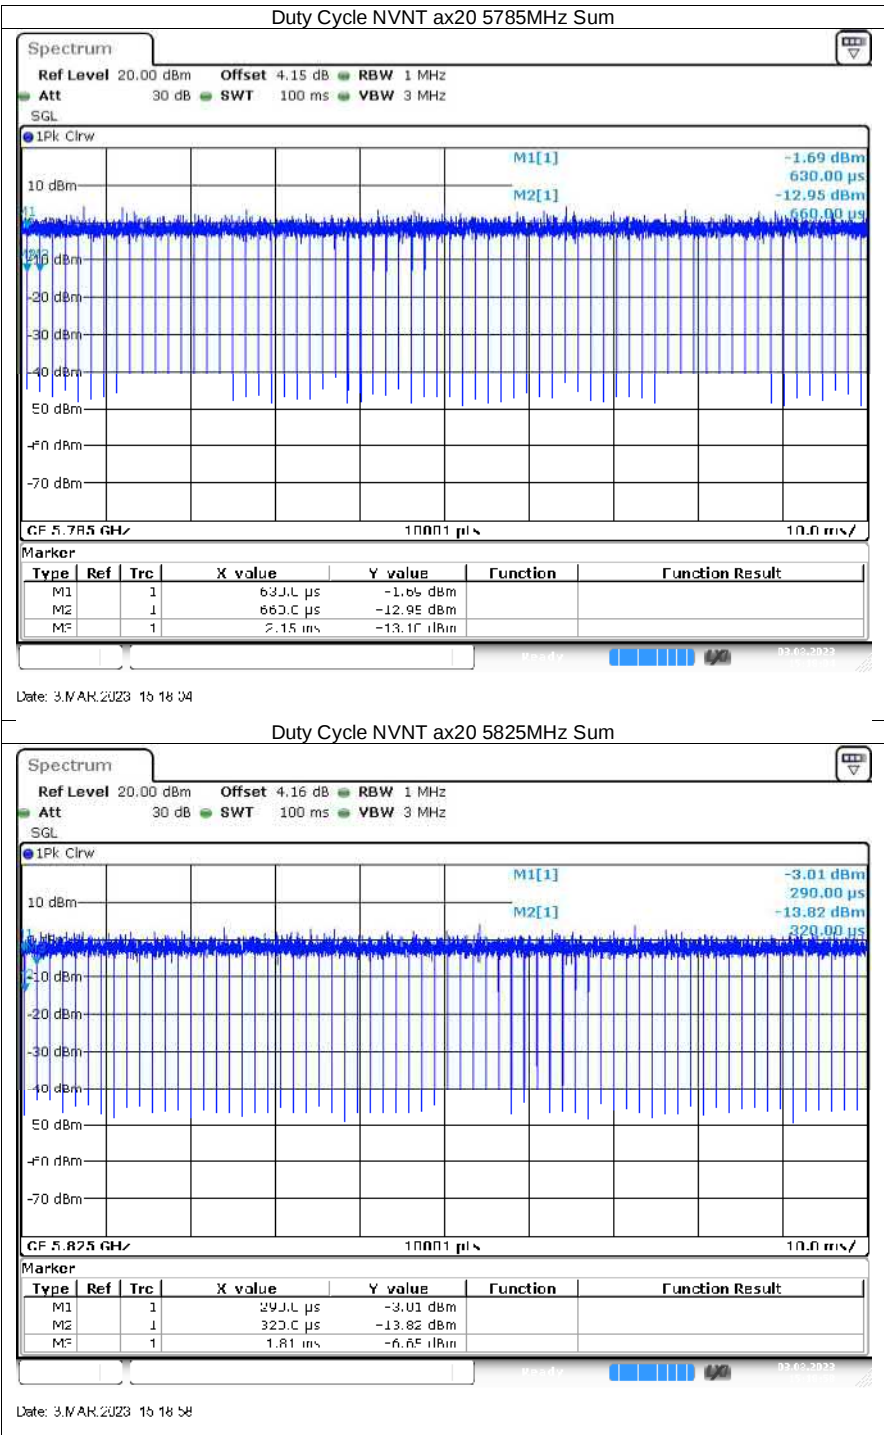

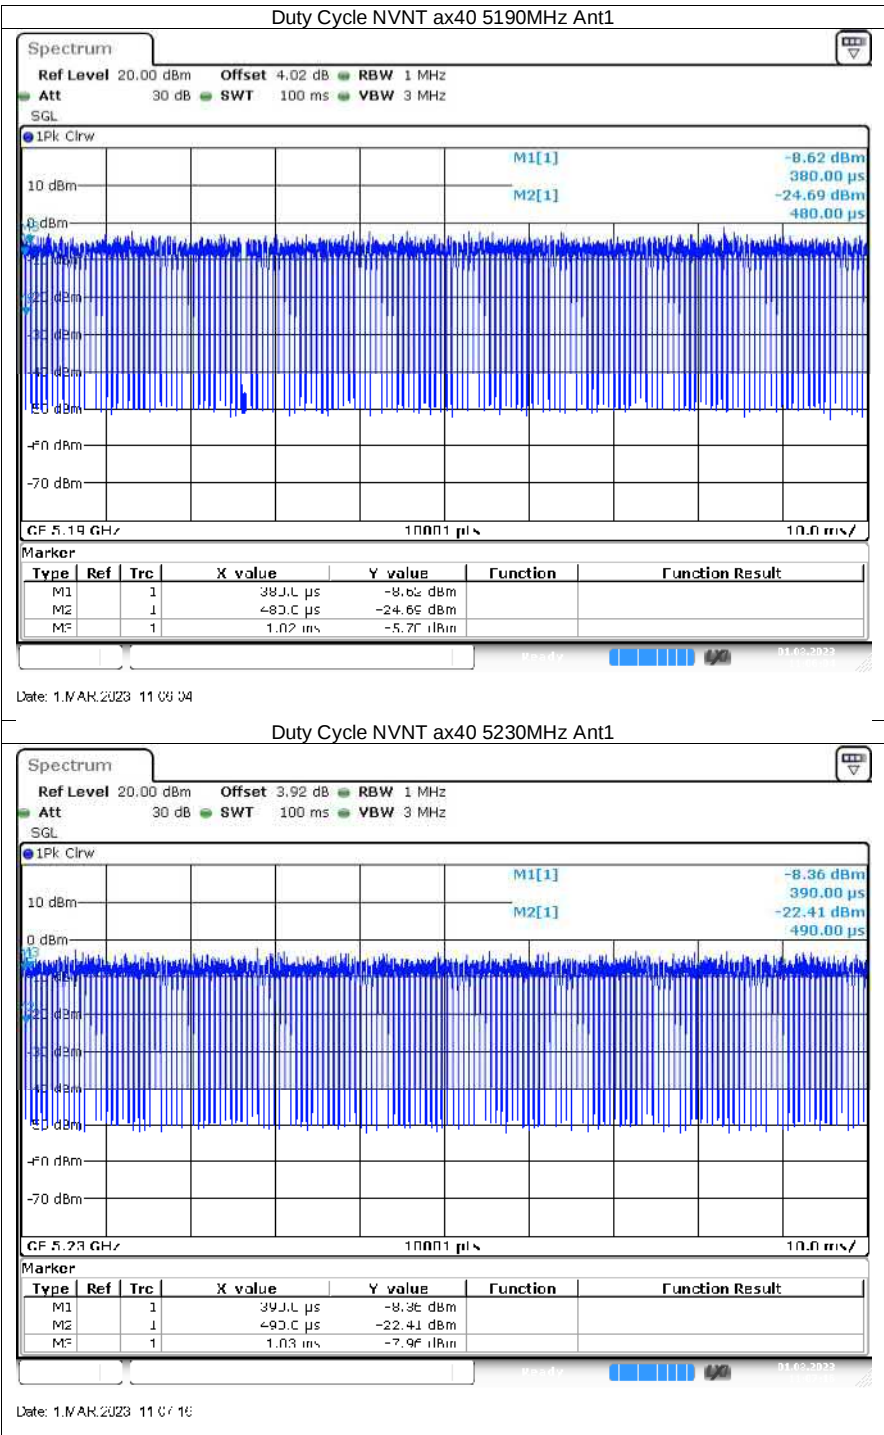


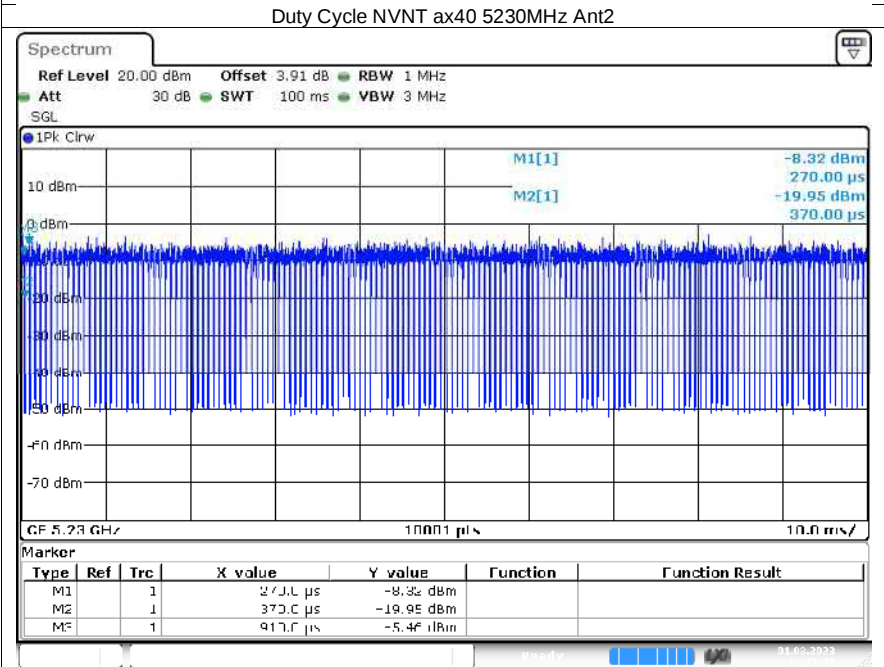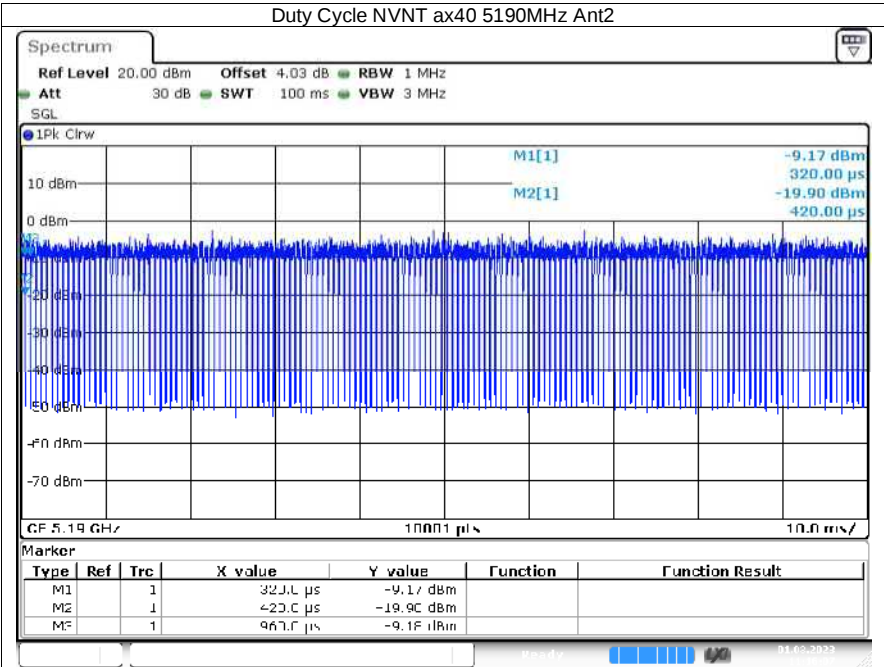


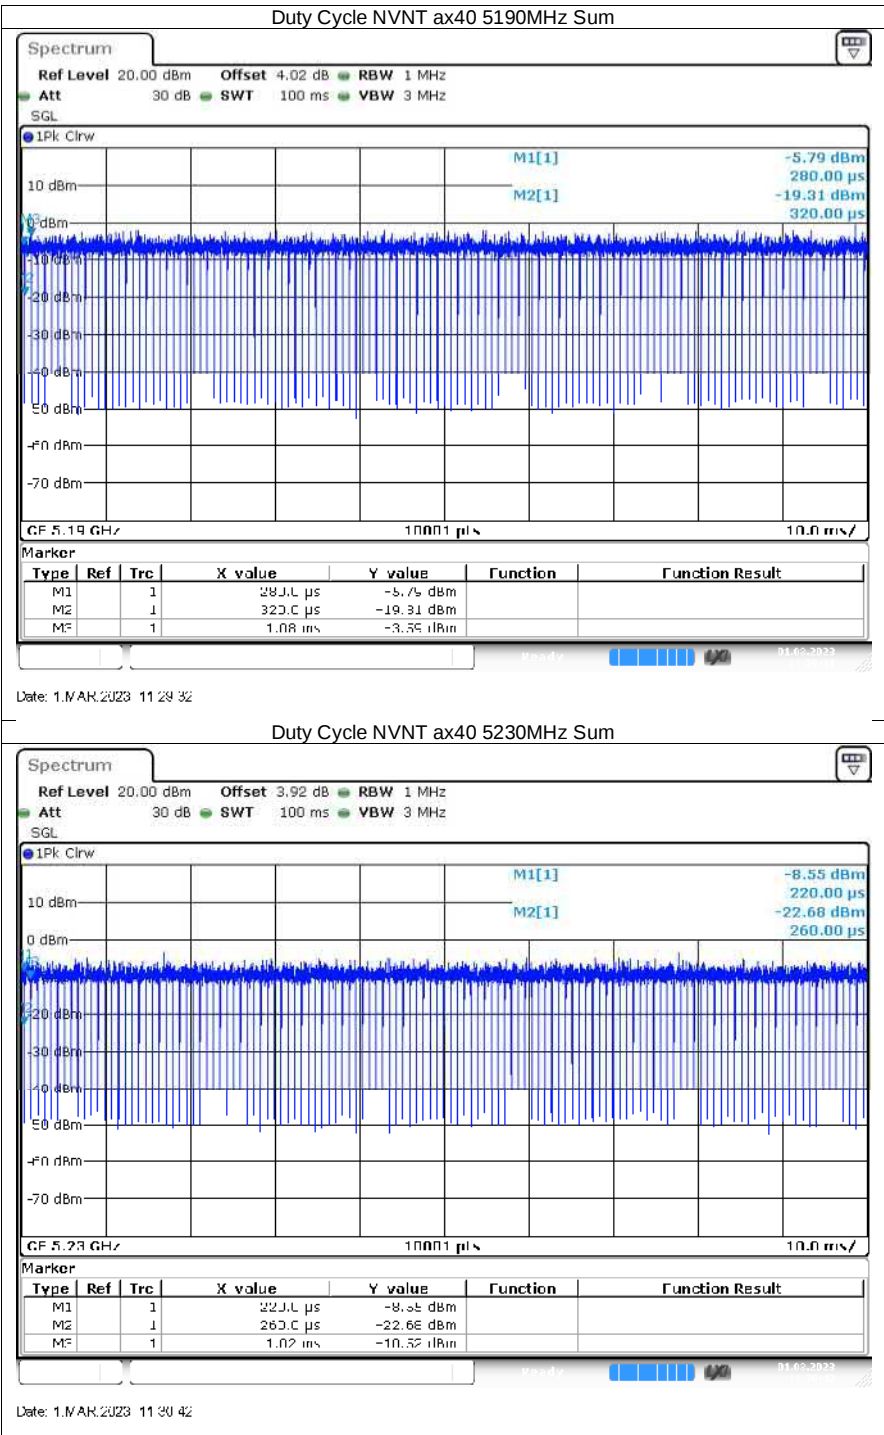




China

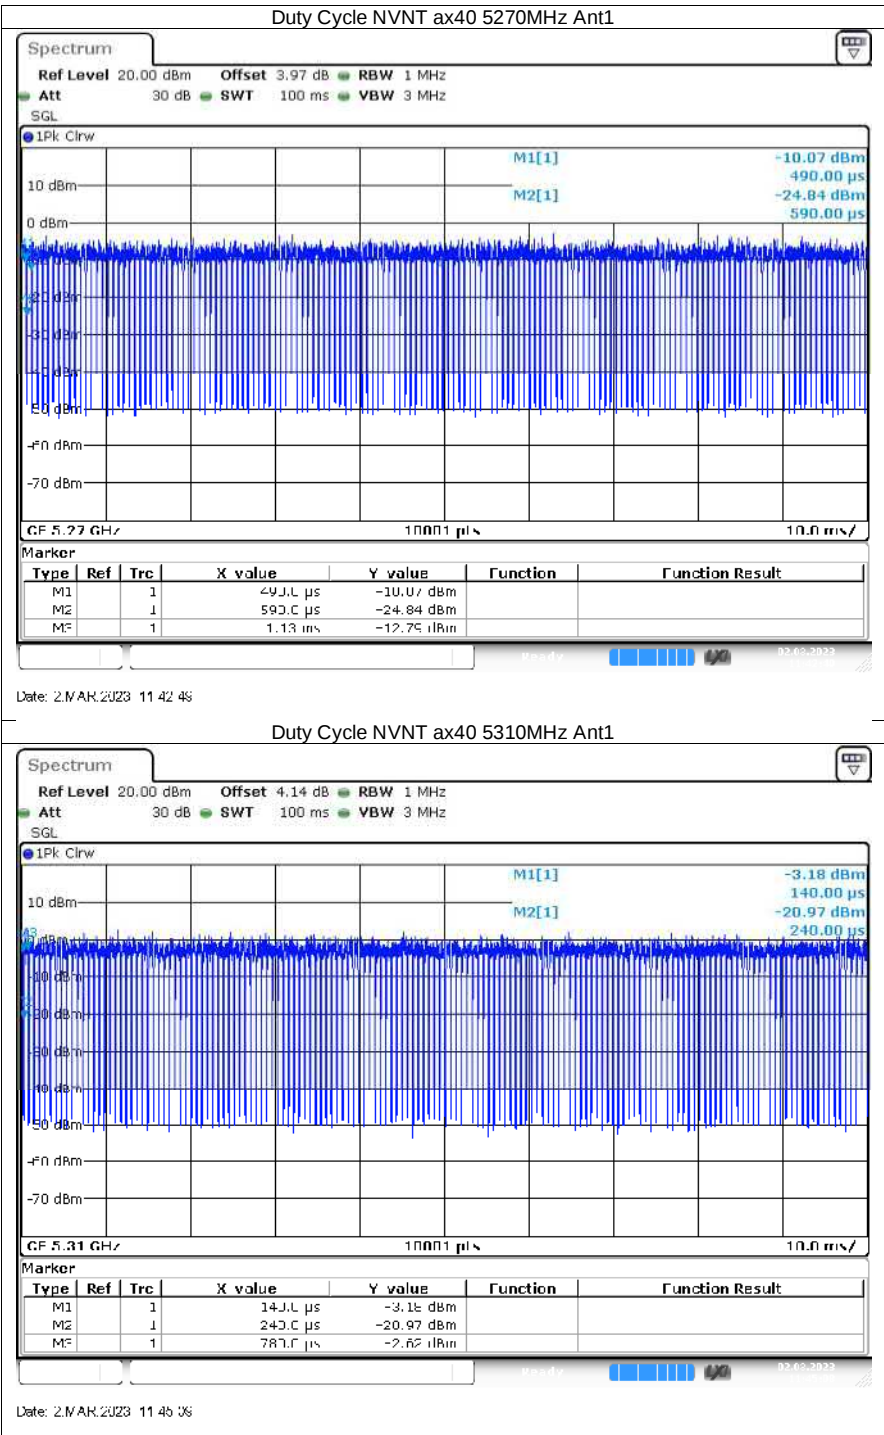

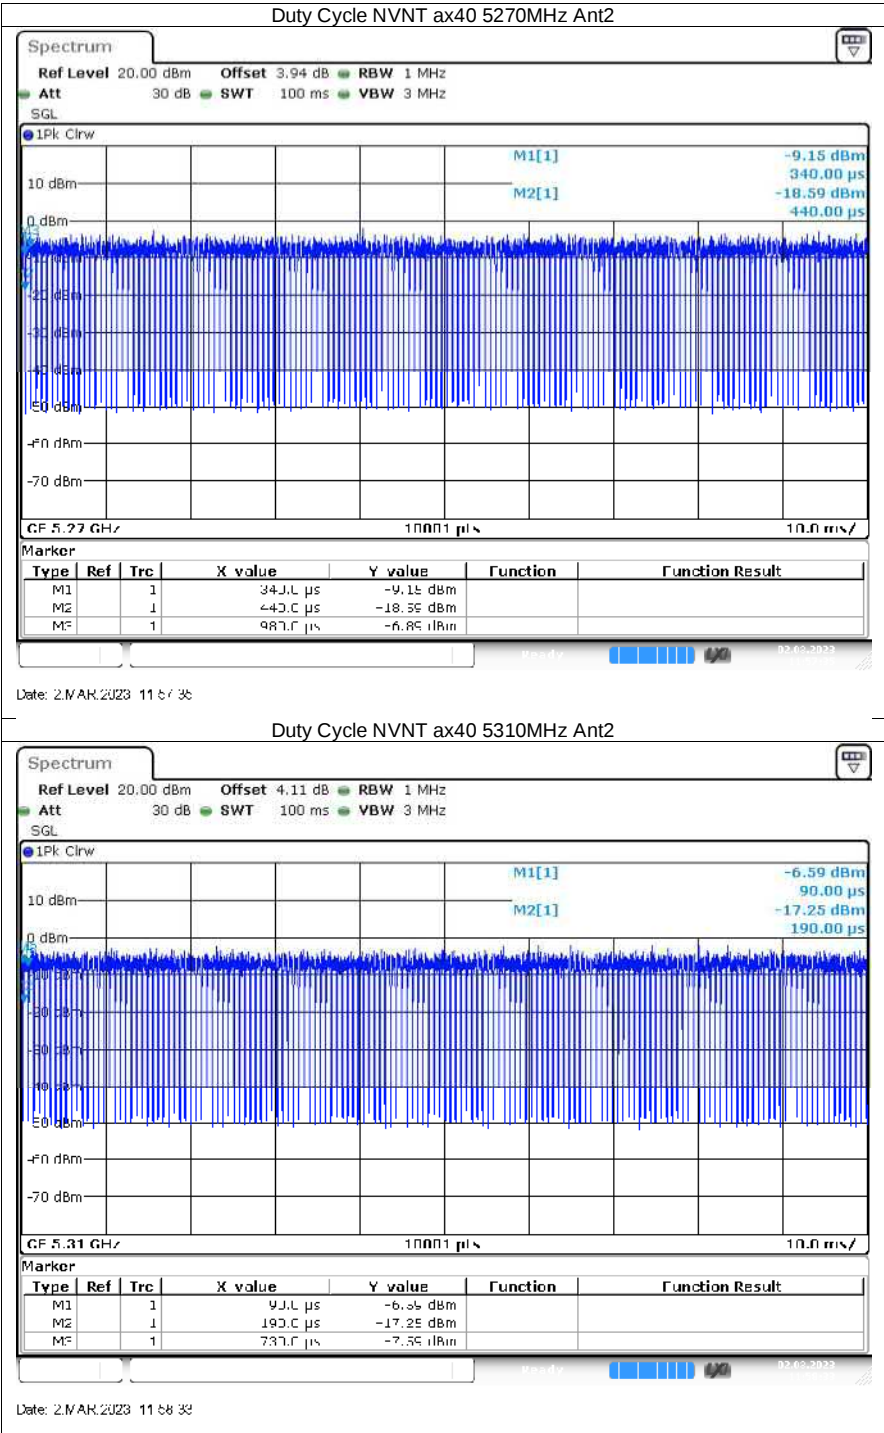





China

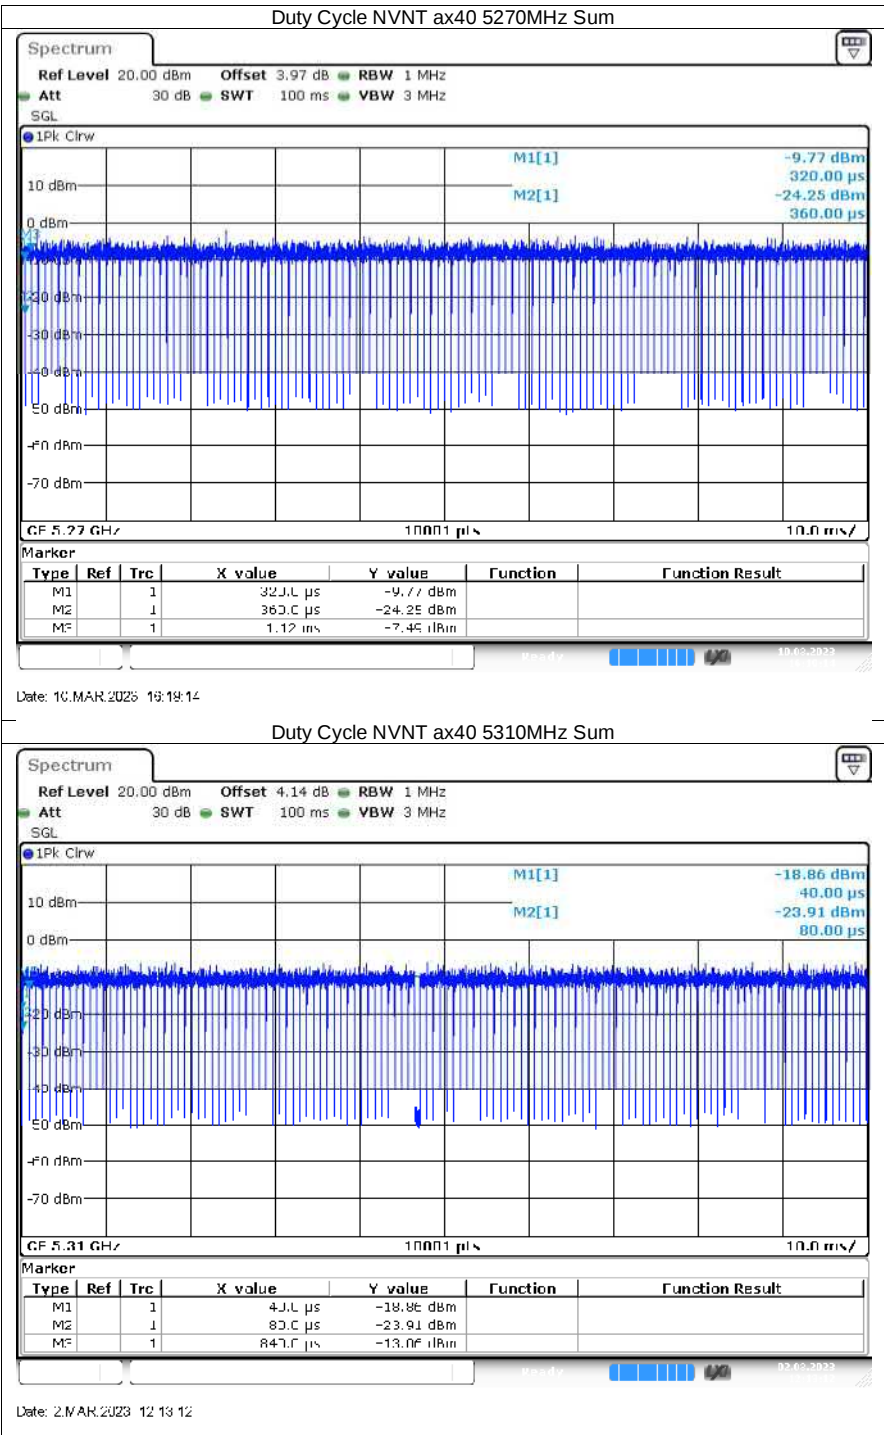






China

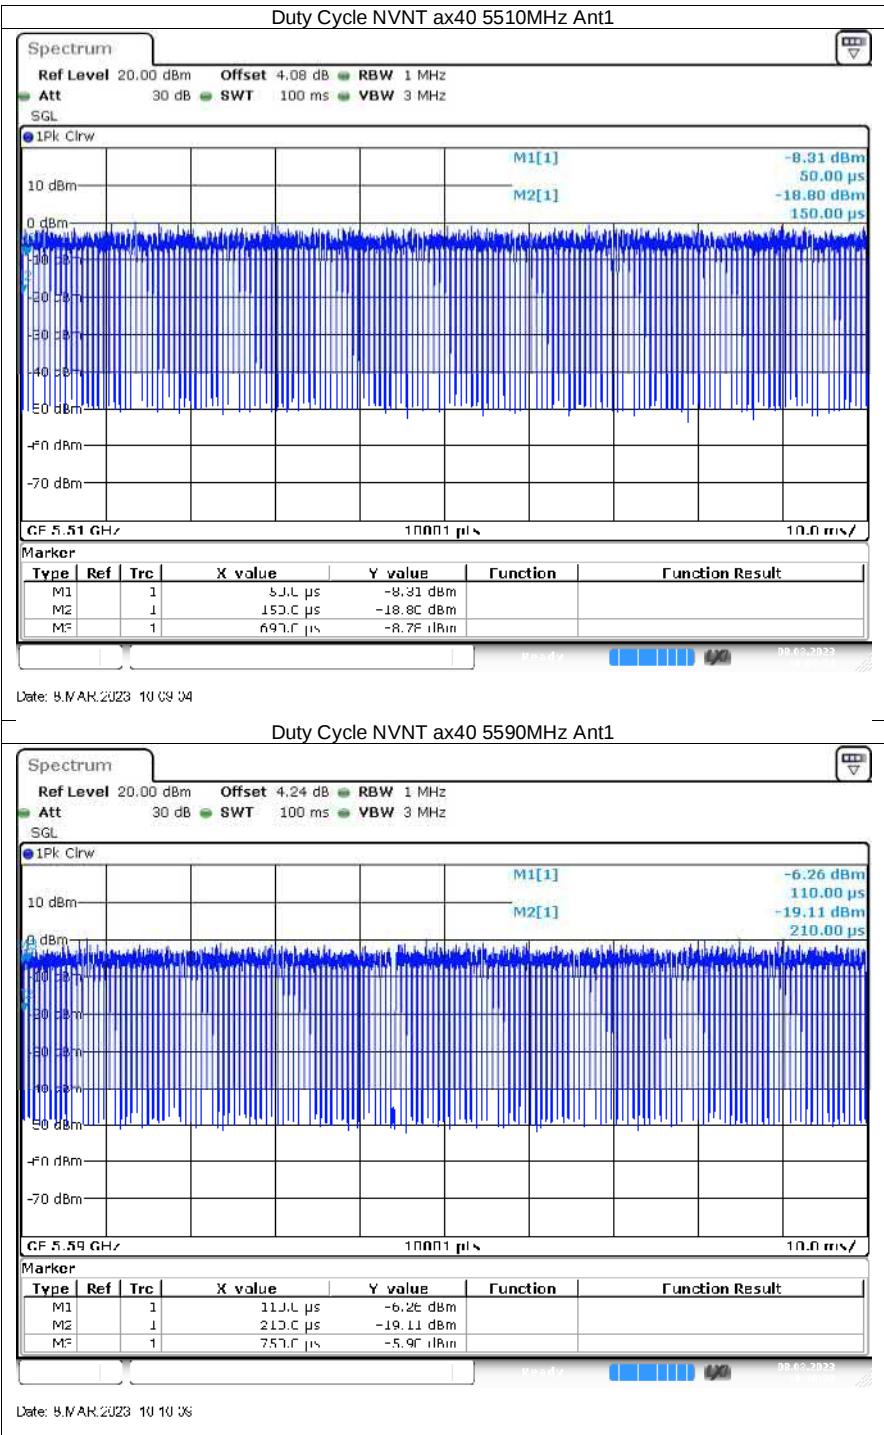


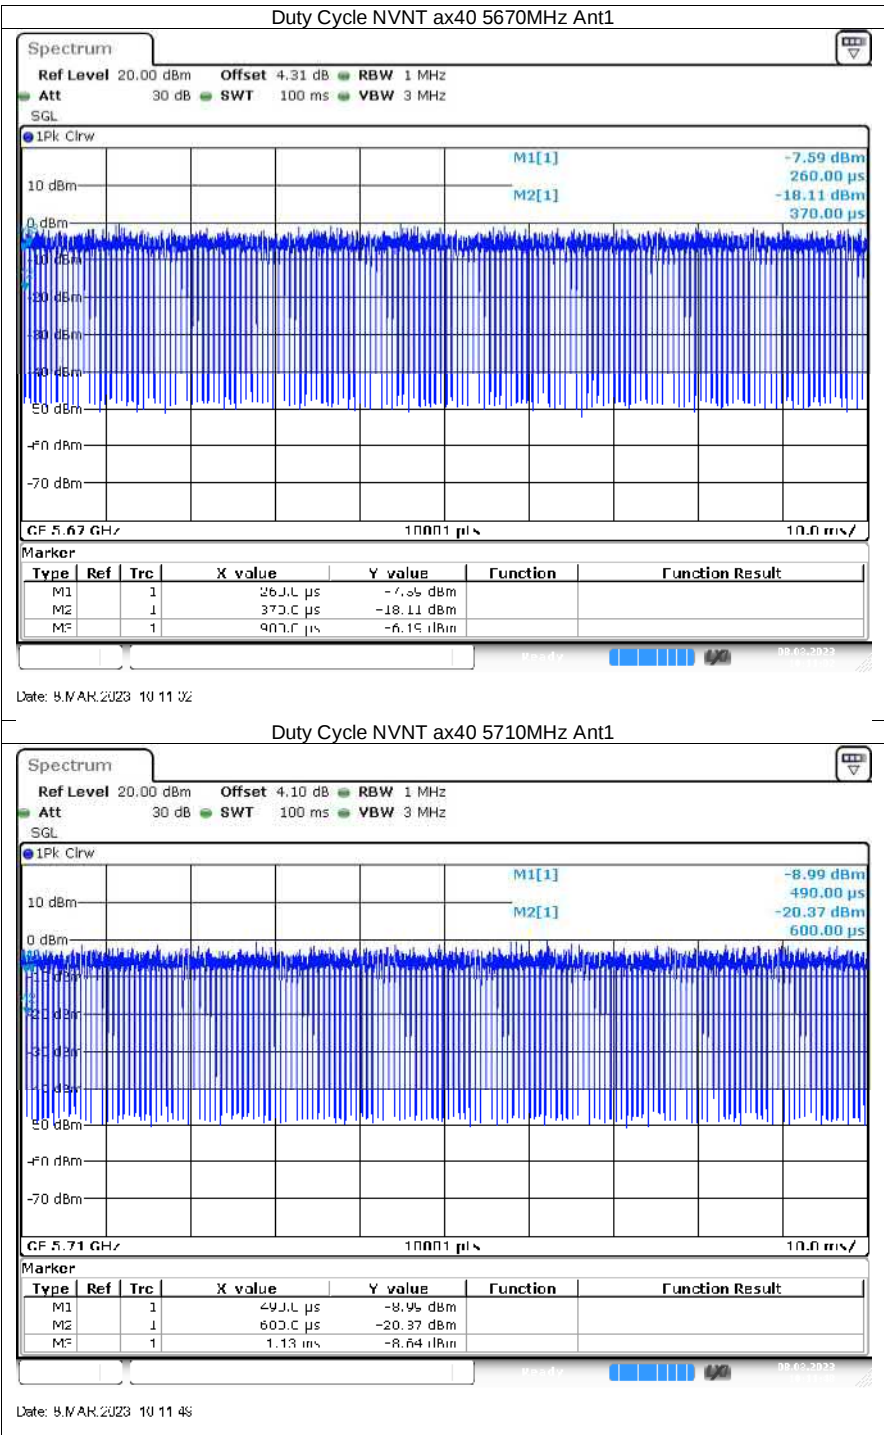

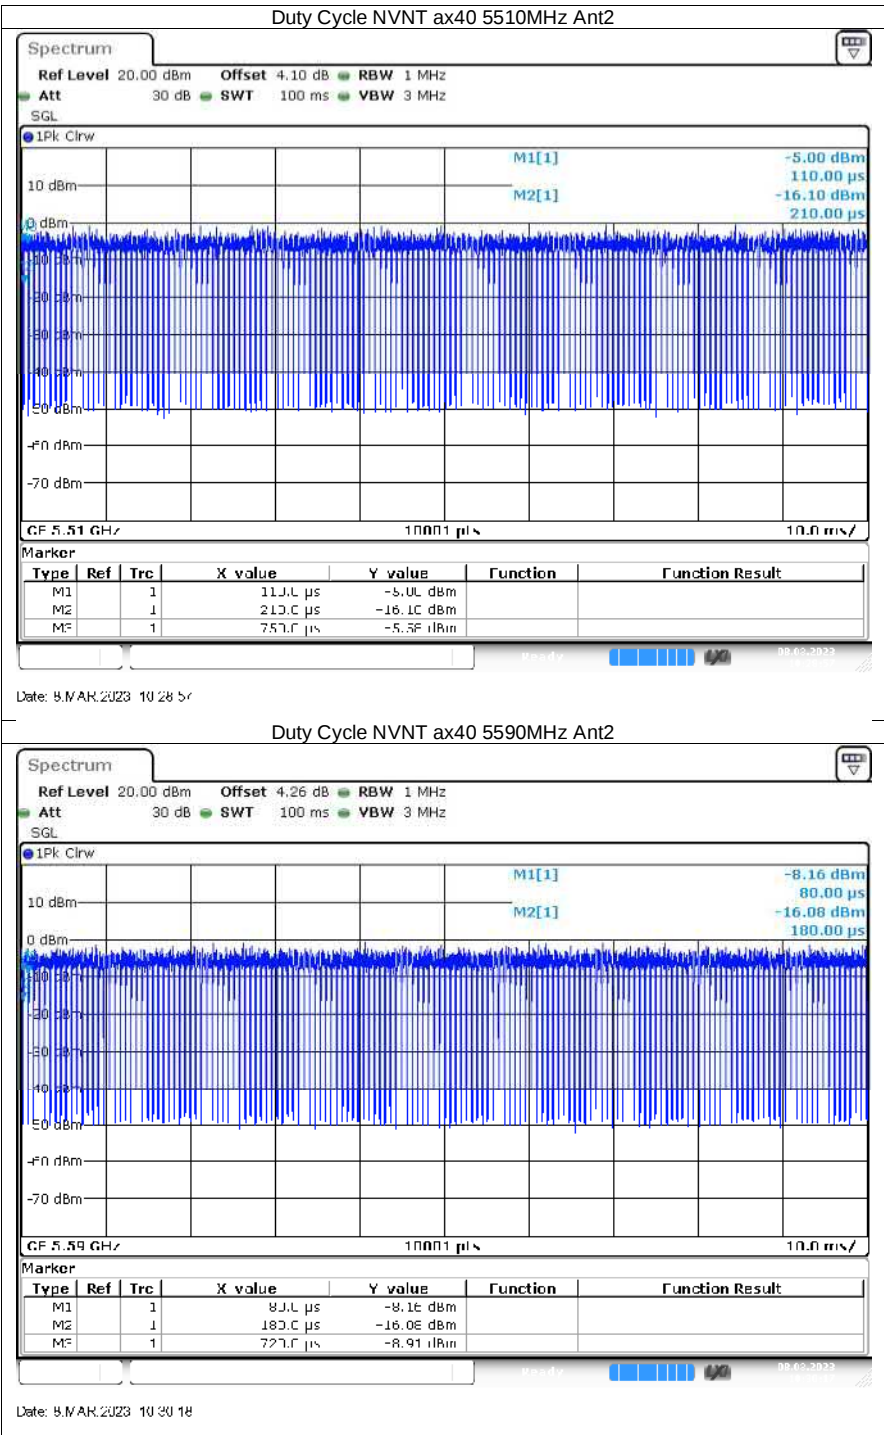

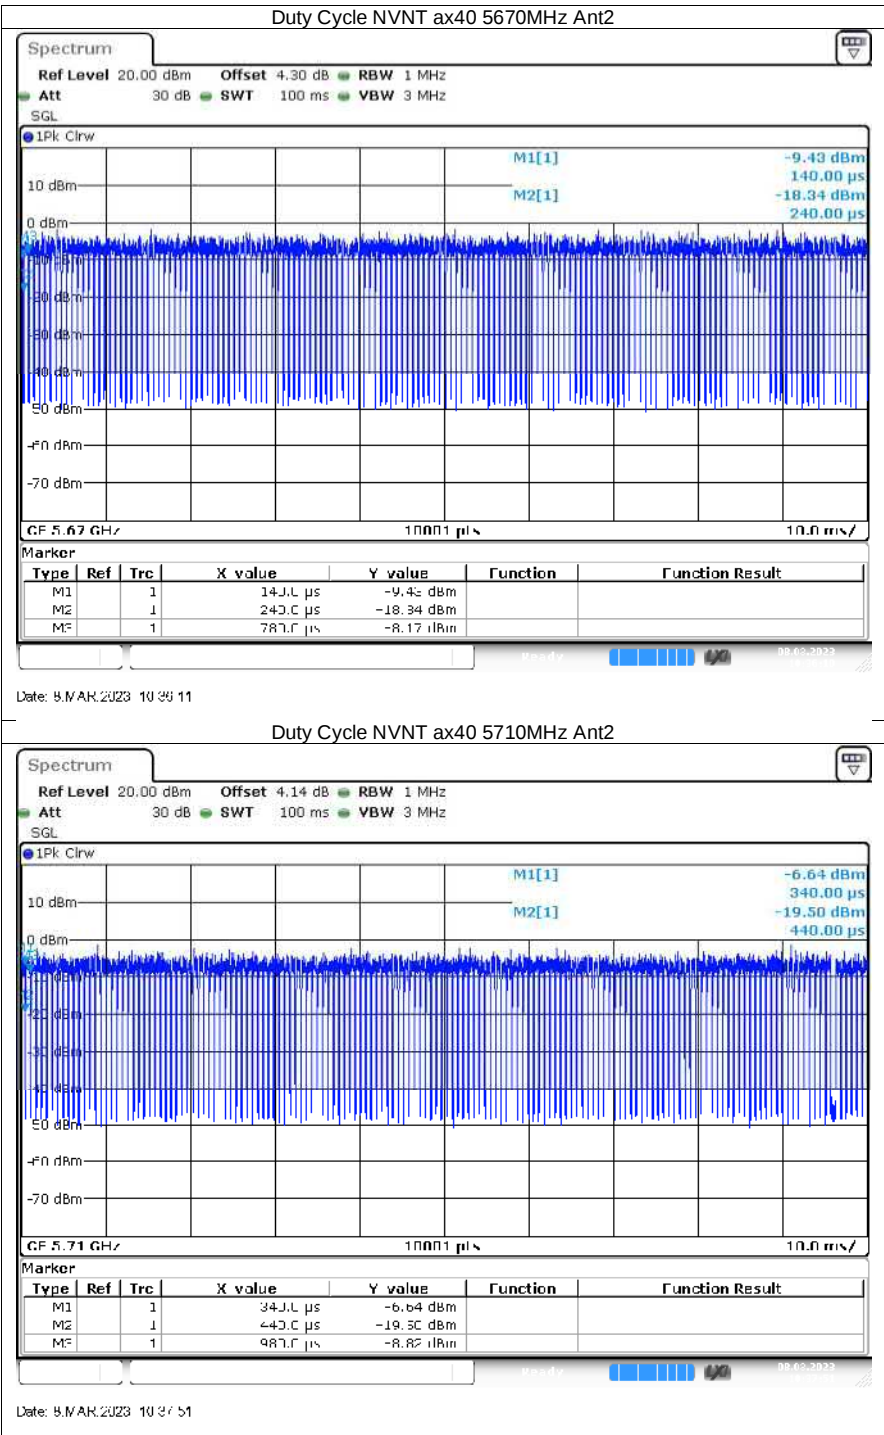


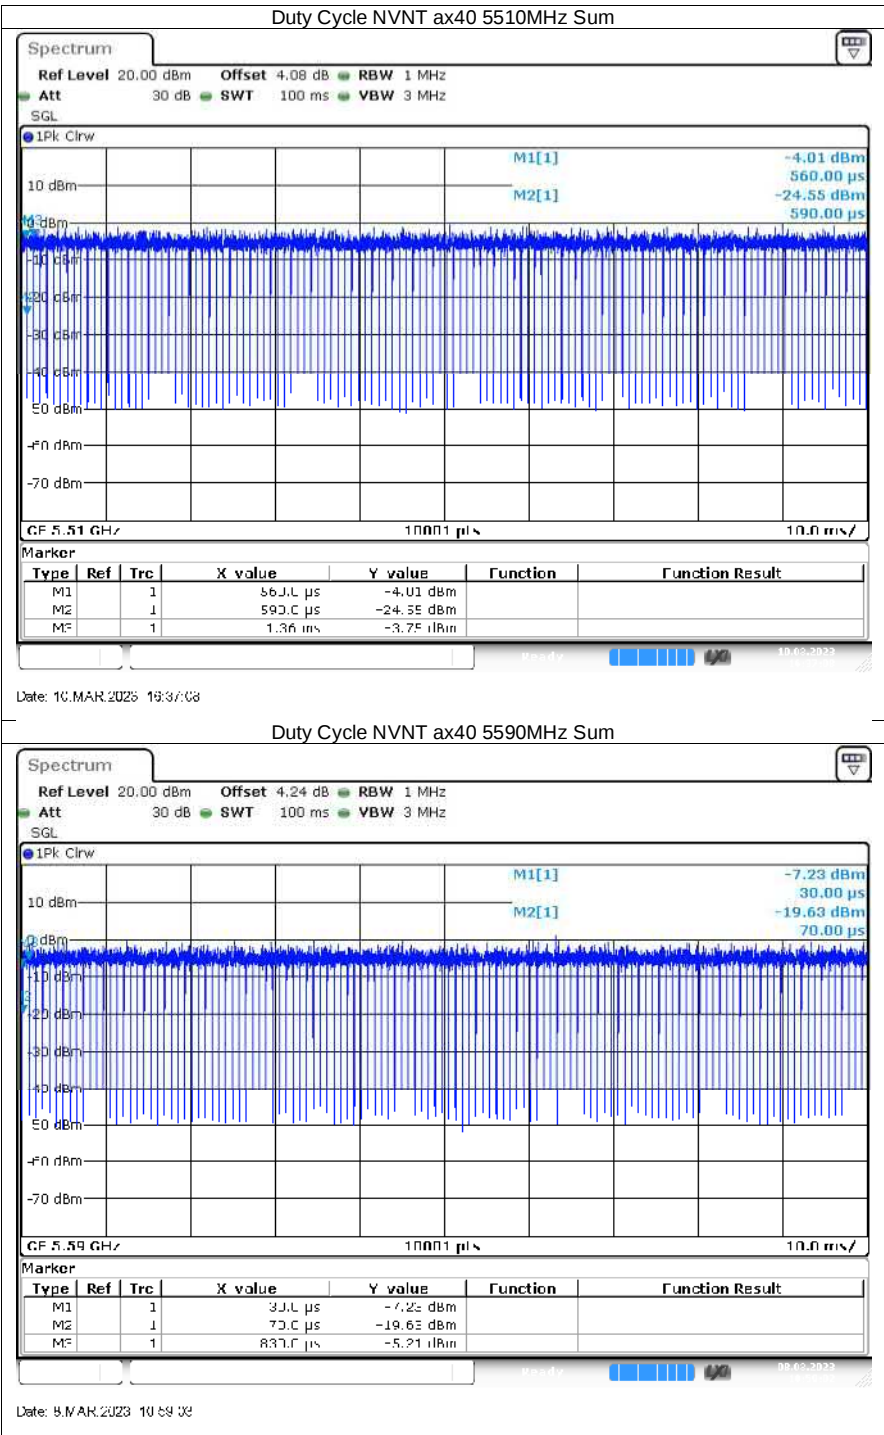


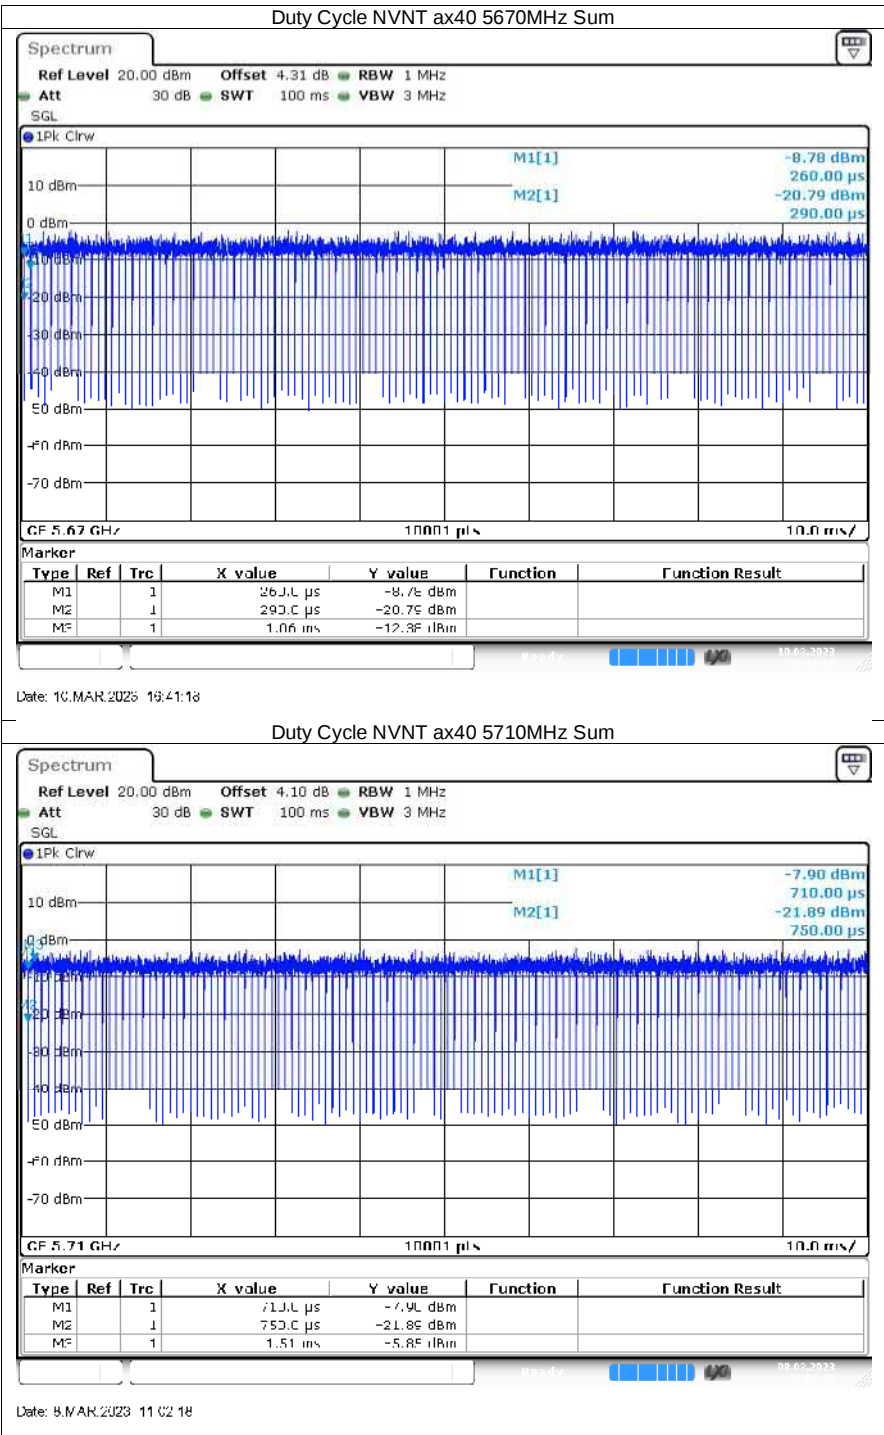






China


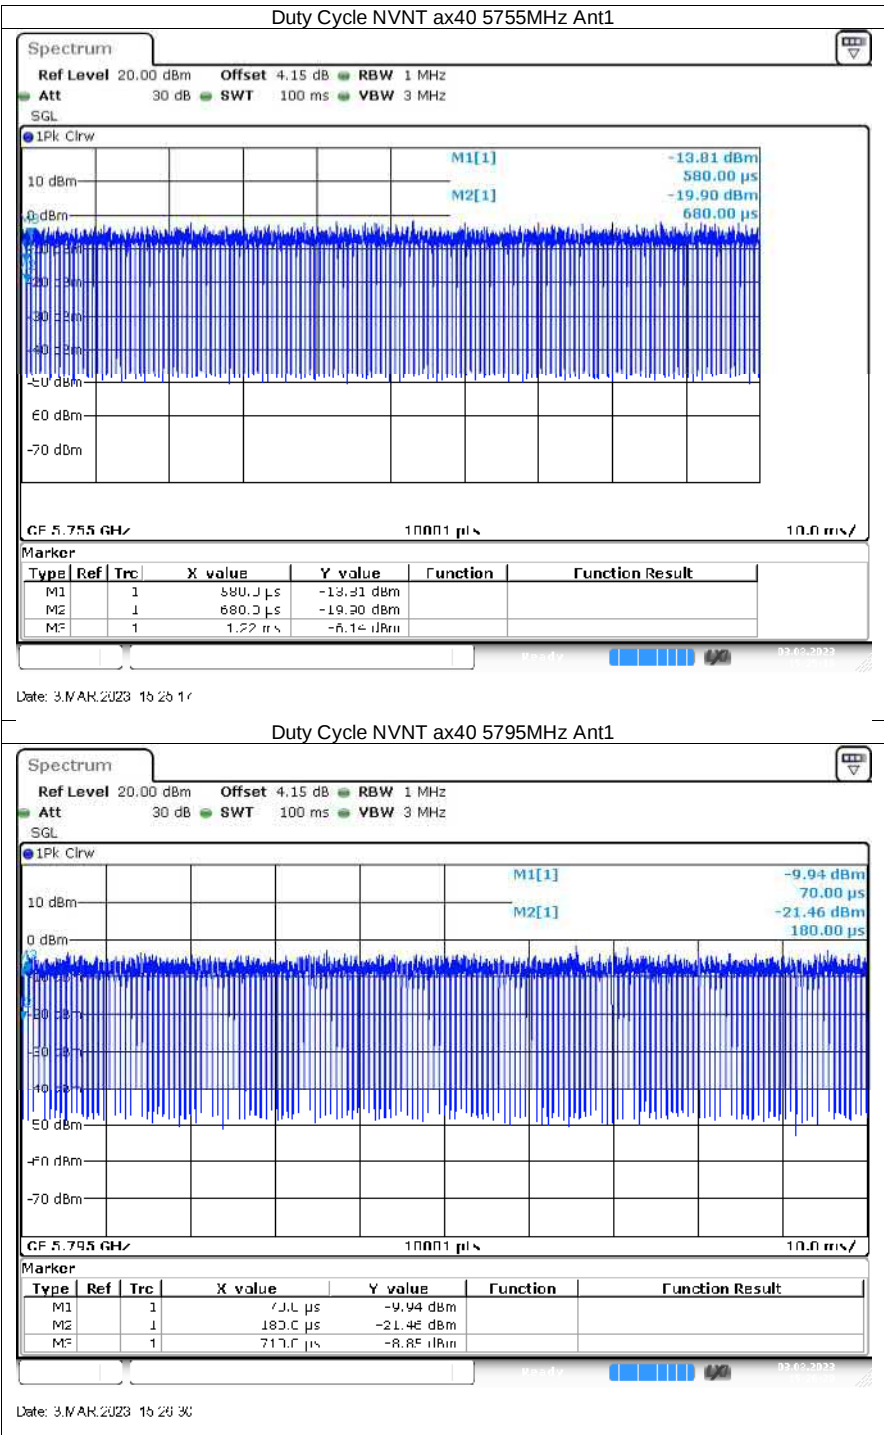


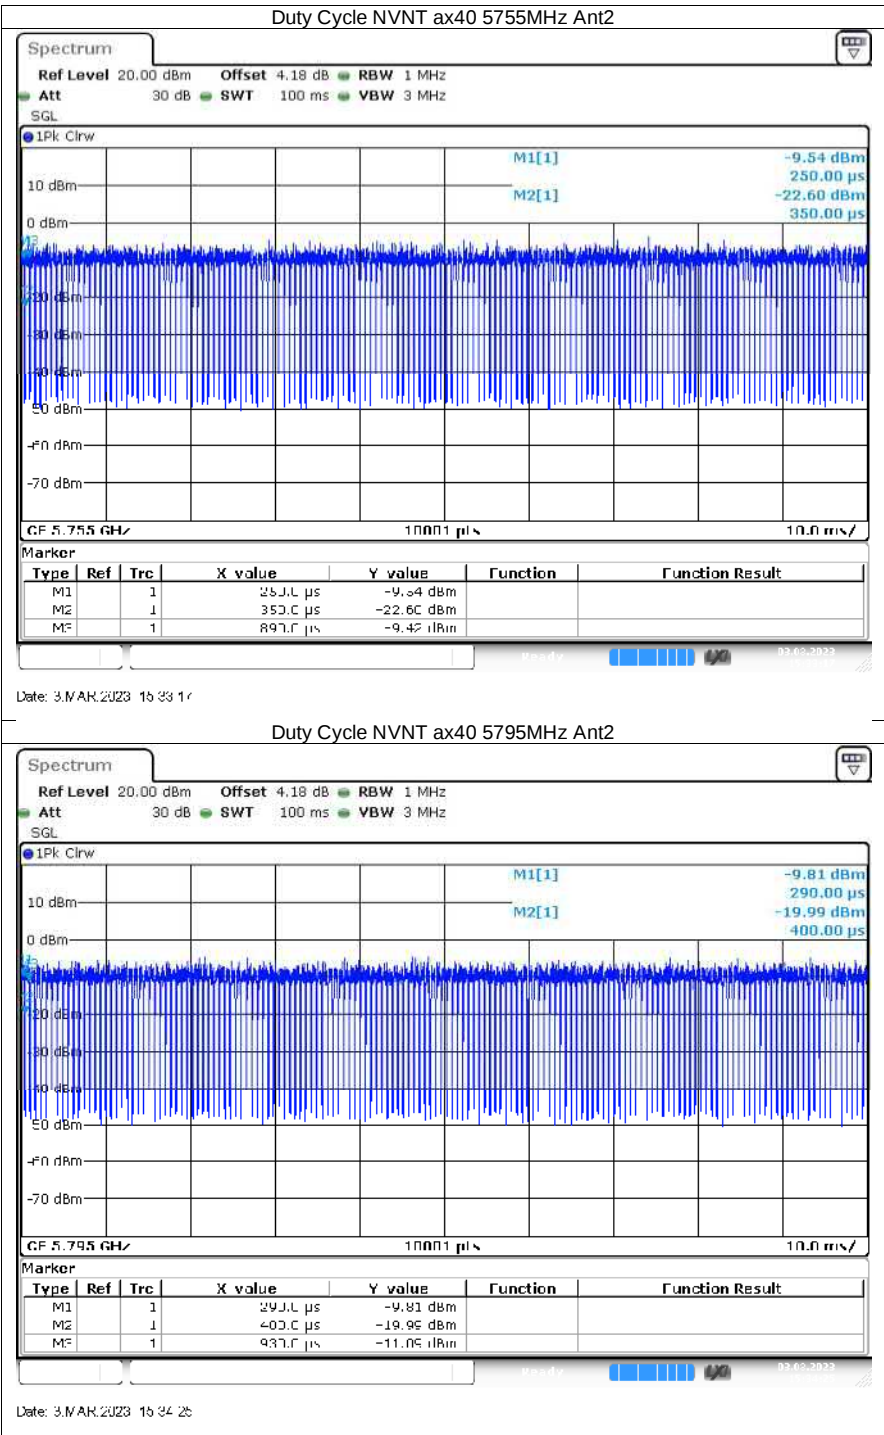


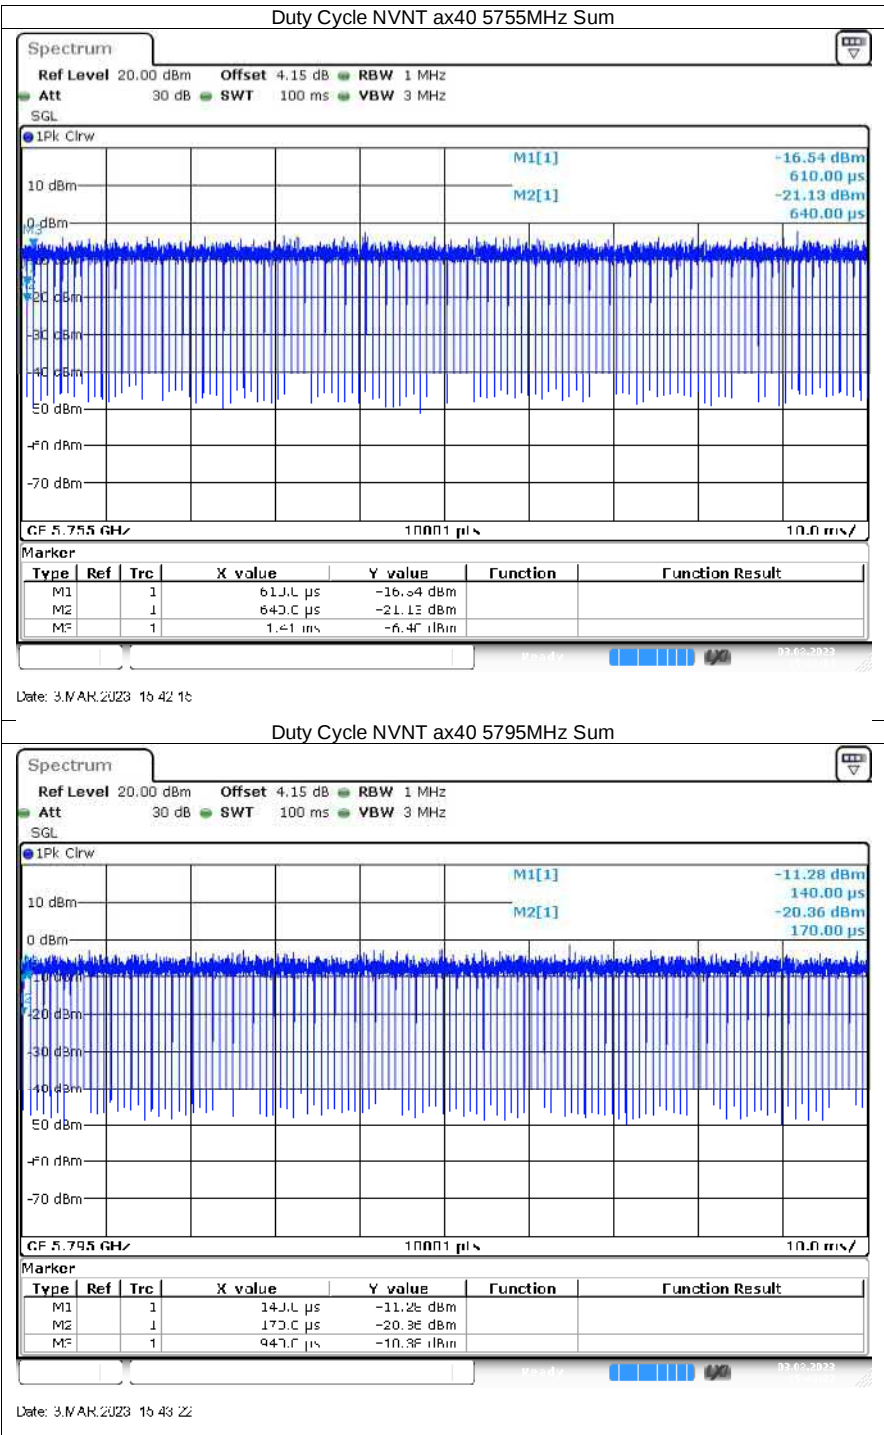


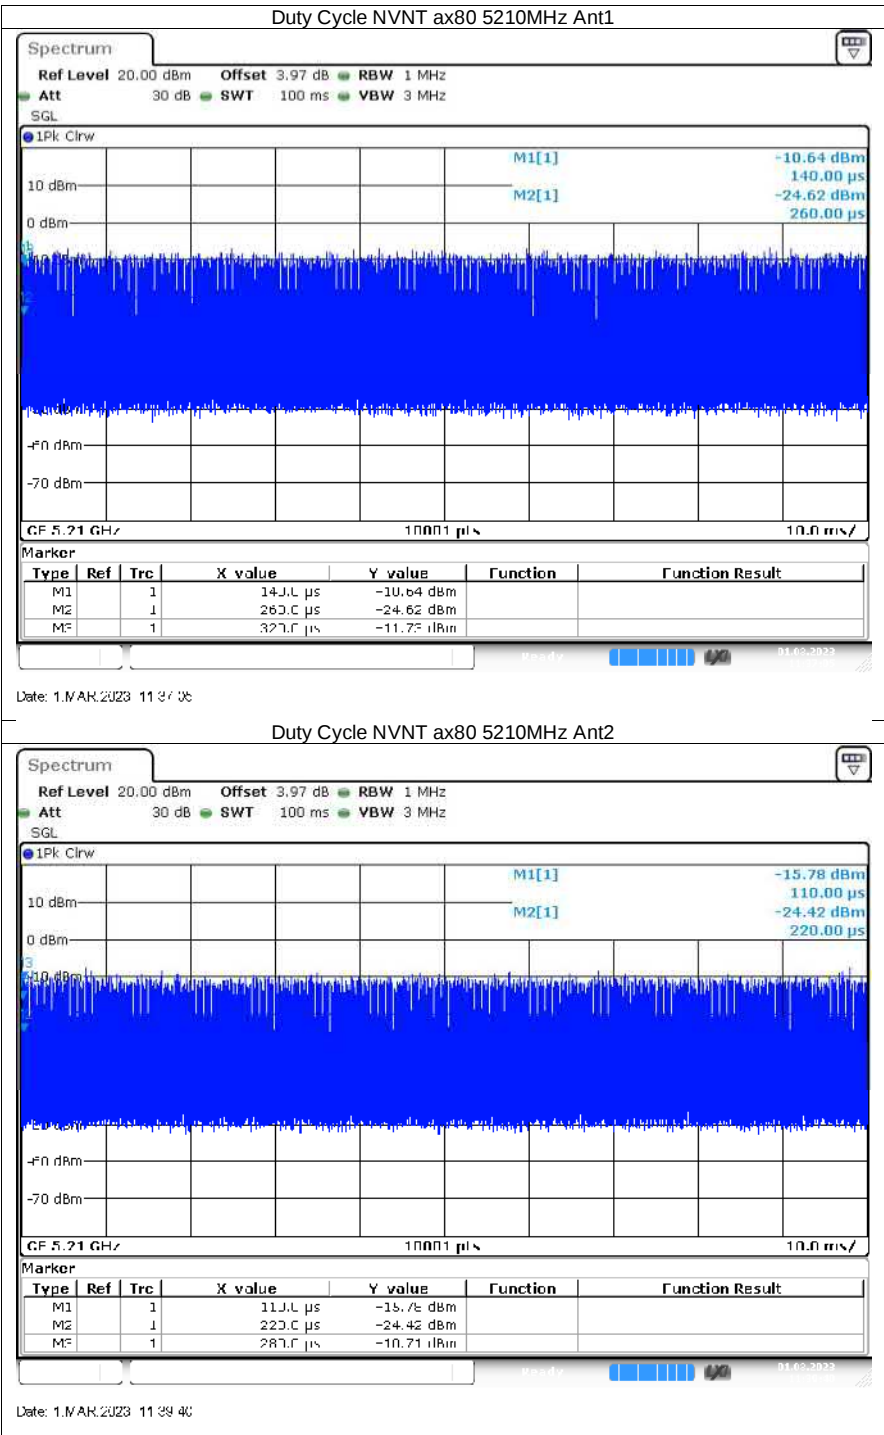



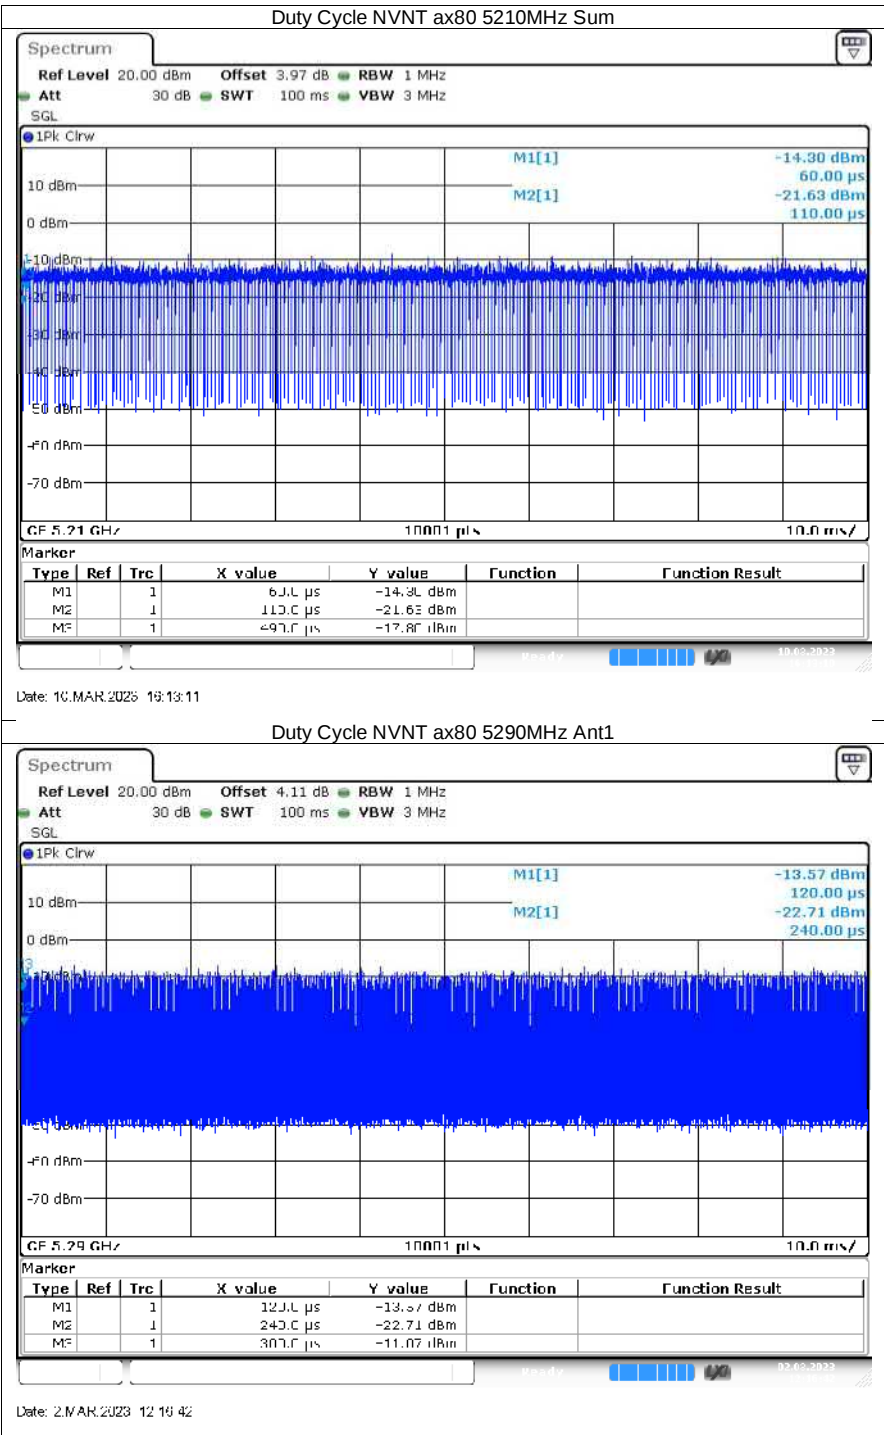


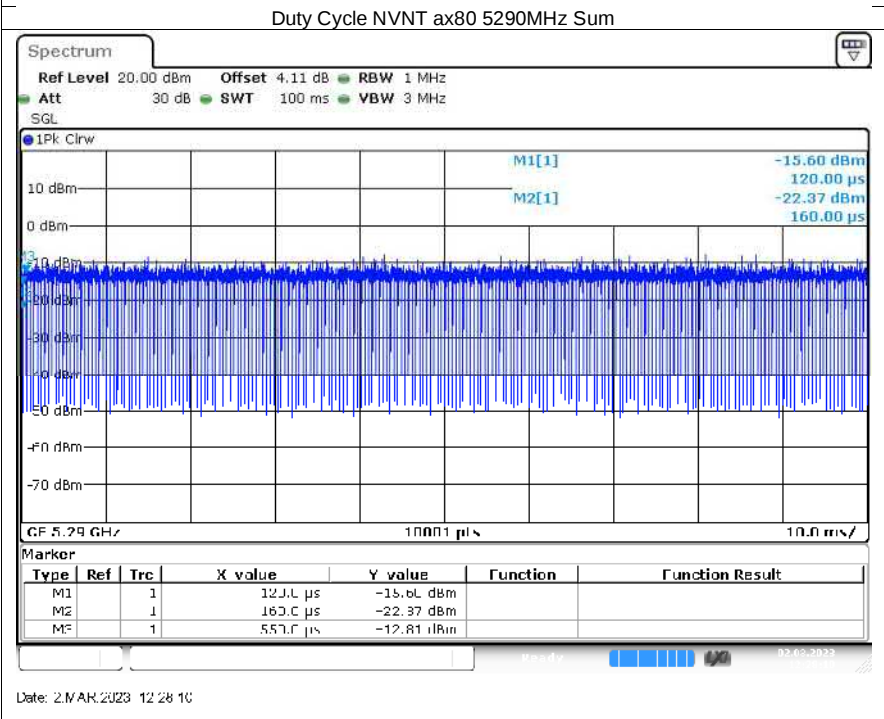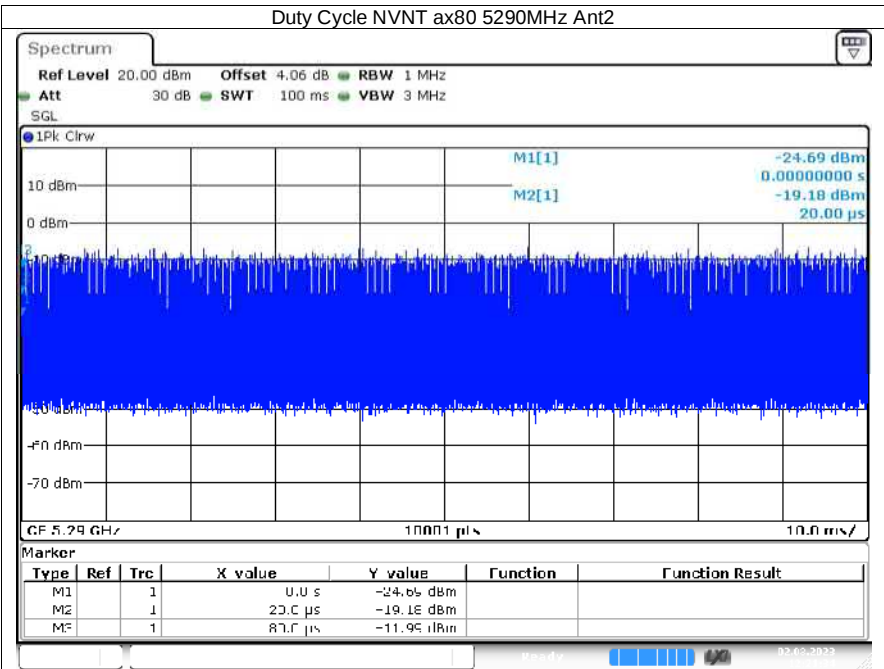

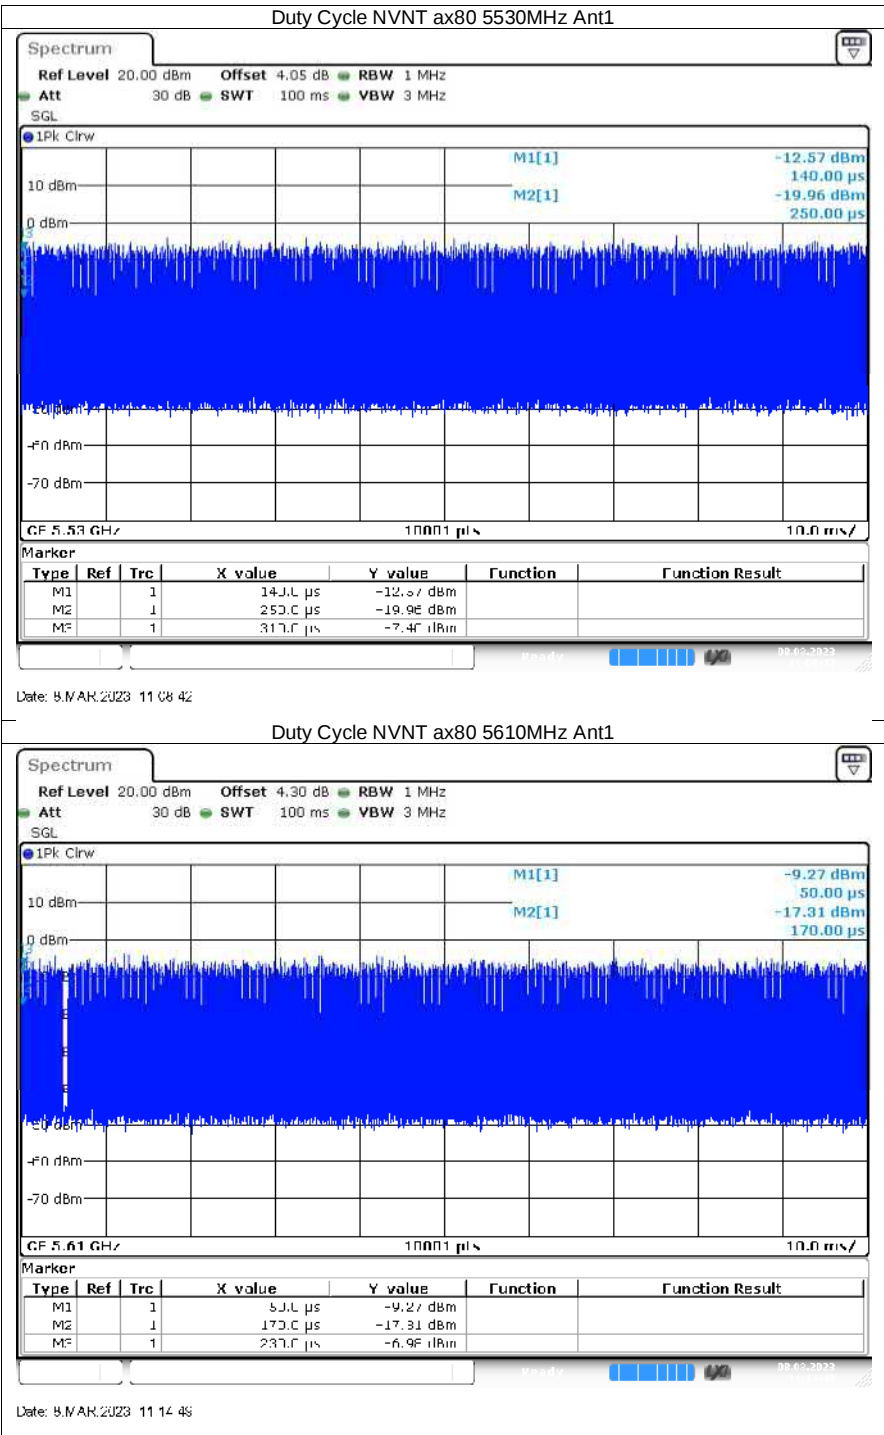

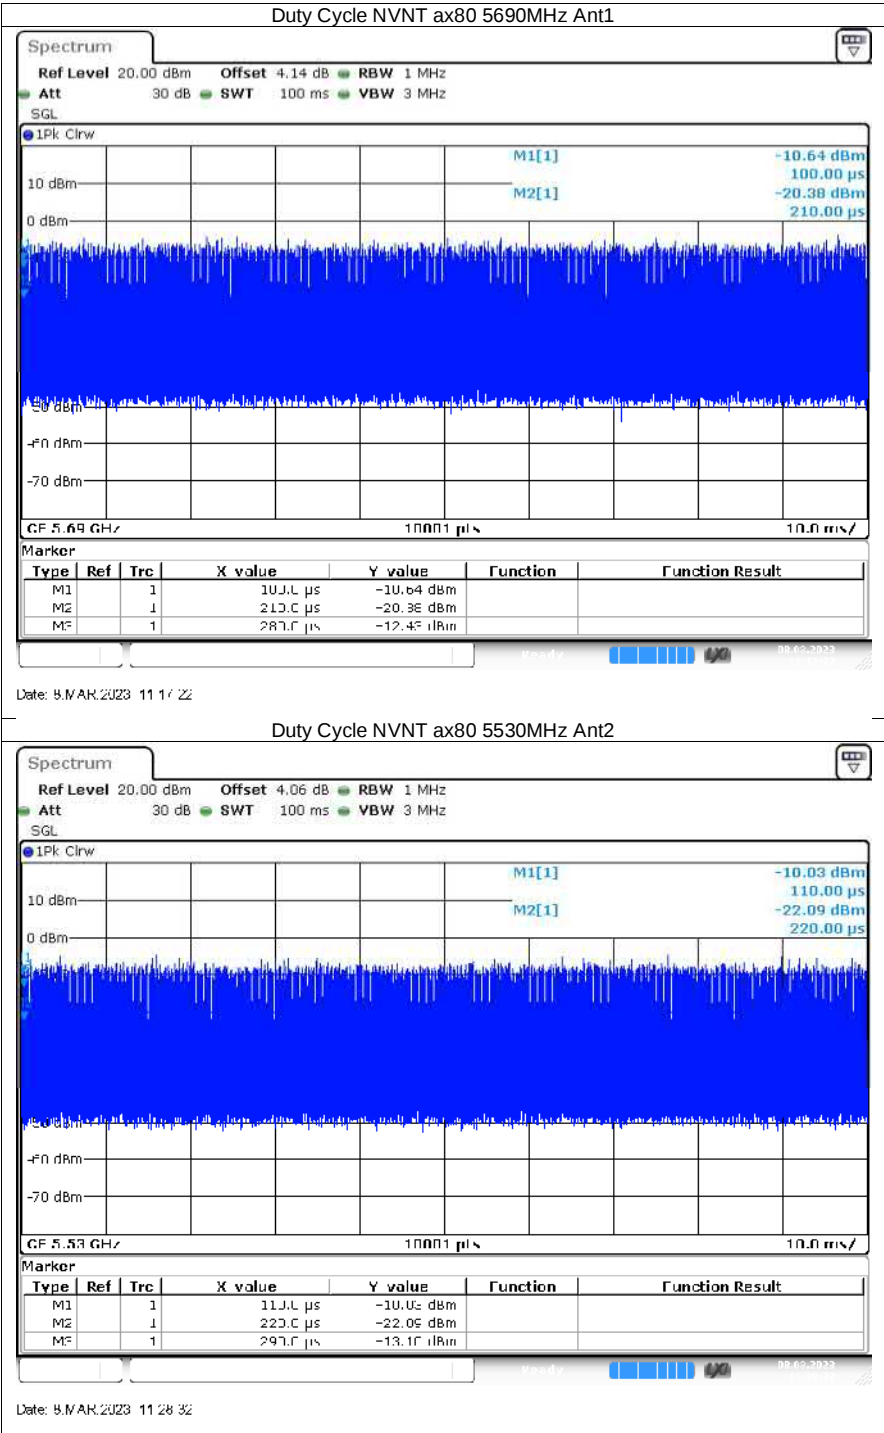


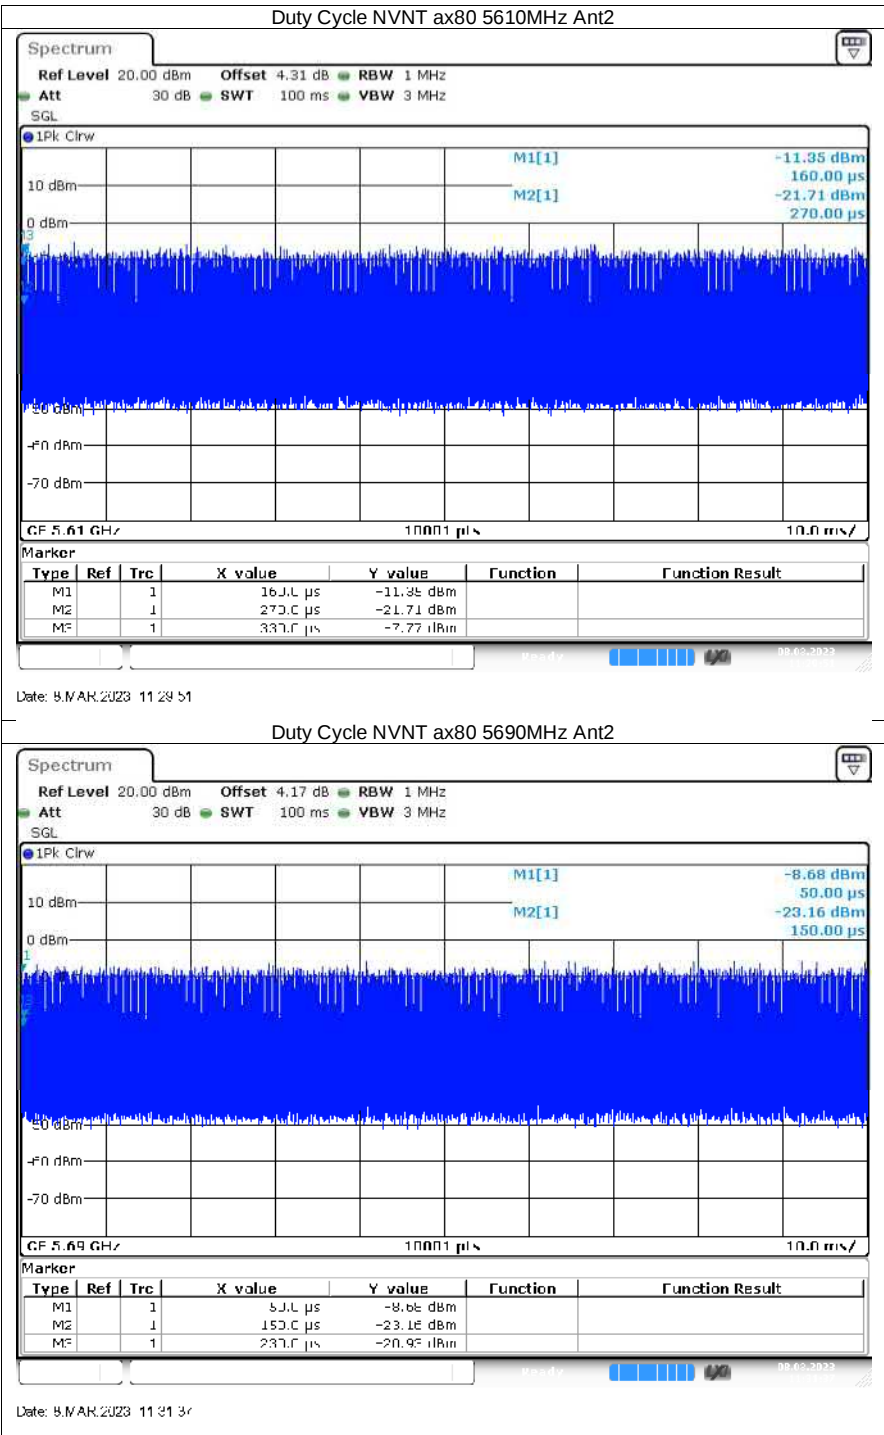


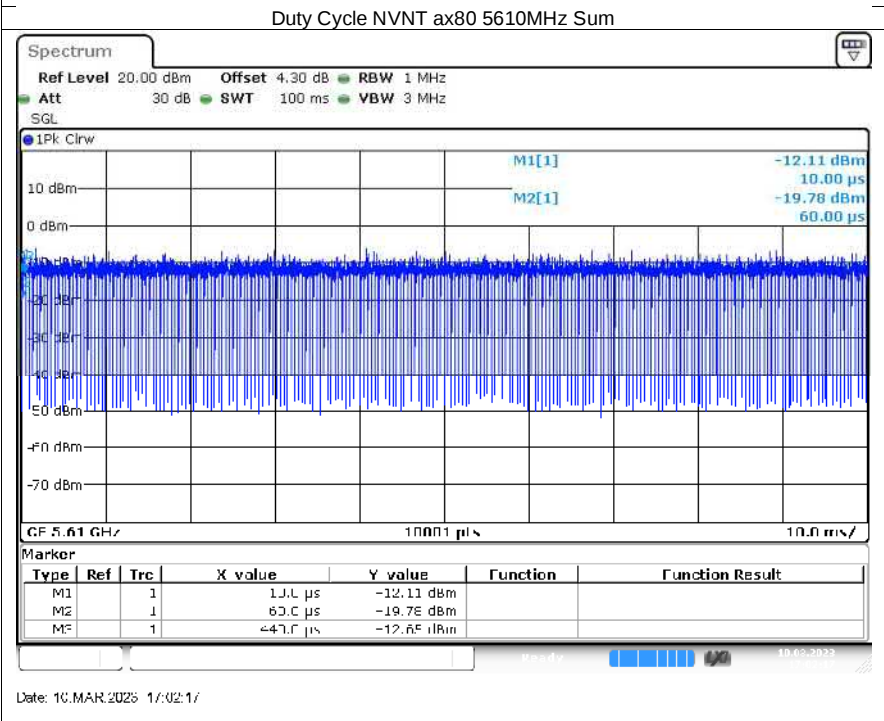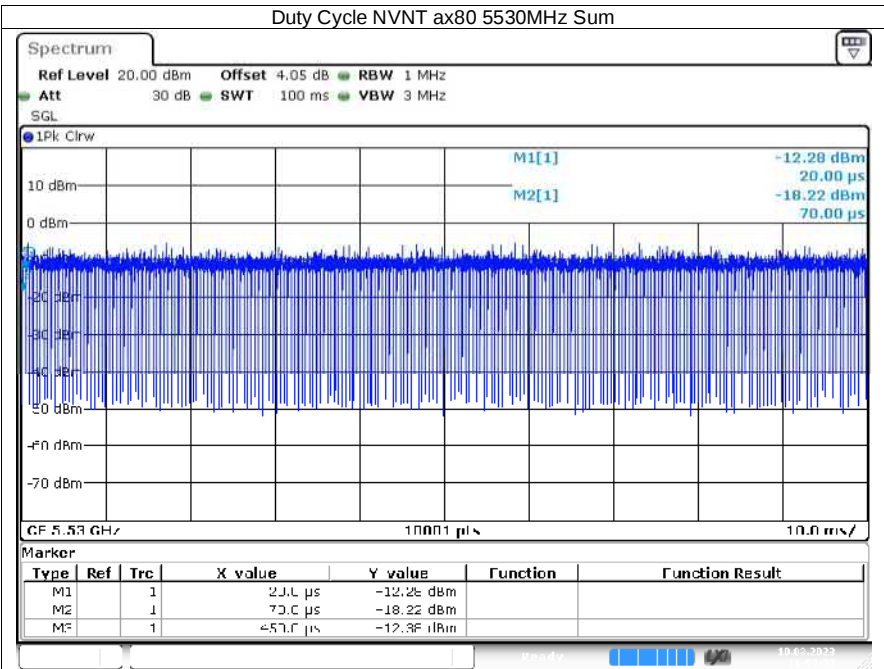



China

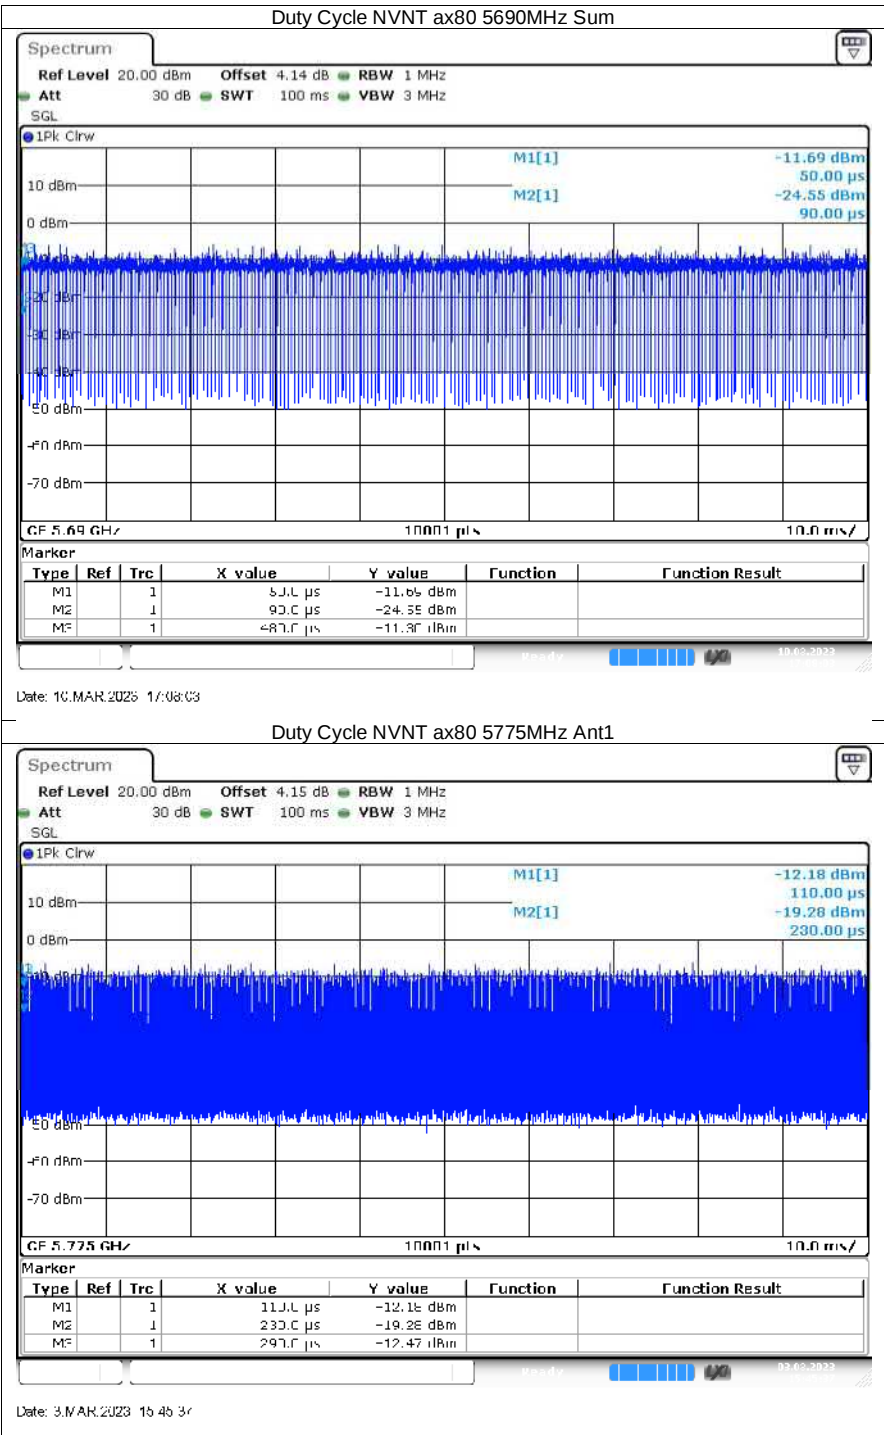

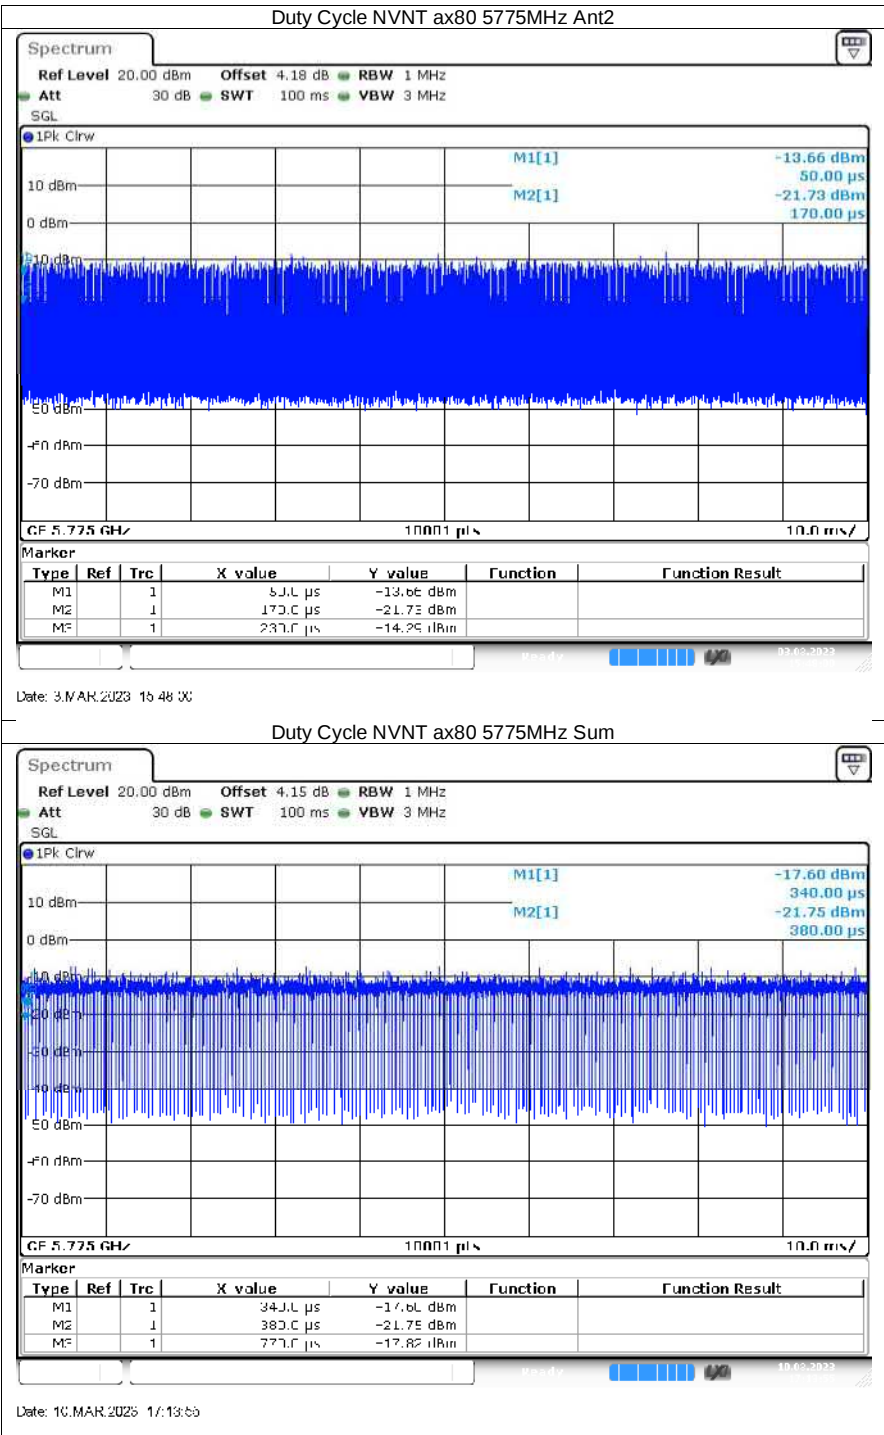

2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	3.99	1.26	5.25	24	Pass
NVNT	a	5200	Ant1	3.4	1.26	4.66	24	Pass
NVNT	a	5240	Ant1	3.41	1.26	4.67	24	Pass
NVNT	a	5180	Ant2	4.1	1.26	5.36	24	Pass
NVNT	a	5200	Ant2	2.21	1.26	3.47	24	Pass
NVNT	a	5240	Ant2	2.17	1.26	3.43	24	Pass
NVNT	a	5180	Ant1	3.9	1.68	5.58	24	Pass
NVNT	a	5180	Ant2	1.75	1.68	3.43	24	Pass
NVNT	a	5180	Sum	5.97	1.68	7.65	24	Pass
NVNT	a	5200	Ant1	4.24	1.68	5.92	24	Pass
NVNT	a	5200	Ant2	1.54	1.68	3.22	24	Pass
NVNT	a	5200	Sum	6.11	1.68	7.79	24	Pass
NVNT	a	5240	Ant1	1.86	1.68	3.54	24	Pass
NVNT	a	5240	Ant2	1.15	1.68	2.83	24	Pass
NVNT	a	5240	Sum	4.53	1.68	6.21	24	Pass
NVNT	a	5260	Ant1	3.56	1.26	4.82	24	Pass
NVNT	a	5300	Ant1	3.73	1.25	4.98	24	Pass
NVNT	a	5320	Ant1	3.66	1.26	4.92	24	Pass
NVNT	a	5260	Ant2	3.44	1.26	4.7	24	Pass
NVNT	a	5300	Ant2	3.32	1.28	4.6	24	Pass
NVNT	a	5320	Ant2	3.37	1.28	4.65	24	Pass
NVNT	a	5260	Ant1	3.68	1.68	5.36	24	Pass
NVNT	a	5260	Ant2	1.9	1.68	3.58	24	Pass
NVNT	a	5260	Sum	5.89	1.68	7.57	24	Pass
NVNT	a	5300	Ant1	1.98	1.68	3.66	24	Pass
NVNT	a	5300	Ant2	0.41	1.68	2.09	24	Pass
NVNT	a	5300	Sum	4.28	1.68	5.96	24	Pass
NVNT	a	5320	Ant1	2.6	1.68	4.28	24	Pass
NVNT	a	5320	Ant2	3.54	1.68	5.22	24	Pass
NVNT	a	5320	Sum	6.11	1.68	7.79	24	Pass
NVNT	a	5500	Ant1	5.62	1.25	6.87	24	Pass
NVNT	a	5600	Ant1	4.44	1.26	5.7	24	Pass
NVNT	a	5700	Ant1	3.72	1.26	4.98	24	Pass
NVNT	a	5720	Ant1	3.67	1.26	4.93	24	Pass
NVNT	a	5500	Ant2	6.92	1.25	8.17	24	Pass
NVNT	a	5600	Ant2	5.44	0.71	6.15	24	Pass
NVNT	a	5700	Ant2	3.61	1.26	4.87	24	Pass
NVNT	a	5720	Ant2	3.49	1.26	4.75	24	Pass
NVNT	a	5500	Ant1	4.73	1.68	6.41	24	Pass
NVNT	a	5500	Ant2	5.84	1.68	7.52	24	Pass
NVNT	a	5500	Sum	8.33	1.68	10.01	24	Pass
NVNT	a	5600	Ant1	5.16	1.68	6.84	24	Pass
NVNT	a	5600	Ant2	2.8	1.68	4.48	24	Pass
NVNT	a	5600	Sum	7.15	1.68	8.83	24	Pass
NVNT	a	5700	Ant1	2.74	0.28	3.02	24	Pass
NVNT	a	5700	Ant2	3	0.28	3.28	24	Pass
NVNT	a	5700	Sum	5.88	0.28	6.16	24	Pass
NVNT	a	5720	Ant1	5.85	0.28	6.13	24	Pass
NVNT	a	5720	Ant2	6.66	0.28	6.94	24	Pass
NVNT	a	5720	Sum	9.28	0.28	9.56	24	Pass
NVNT	a	5745	Ant1	5.1	1.26	6.36	30	Pass



China

NVNT	a	5785	Ant1	4.46	1.26	5.72	30	Pass
NVNT	a	5825	Ant1	4.31	1.26	5.57	30	Pass
NVNT	a	5745	Ant2	1.89	1.26	3.15	30	Pass
NVNT	a	5785	Ant2	0.86	1.26	2.12	30	Pass
NVNT	a	5825	Ant2	1.49	1.26	2.75	30	Pass
NVNT	a	5745	Ant1	4.56	1.26	5.82	30	Pass
NVNT	a	5745	Ant2	1.61	1.26	2.87	30	Pass
NVNT	a	5745	Sum	6.34	1.26	7.6	30	Pass
NVNT	a	5785	Ant1	3.46	1.26	4.72	30	Pass
NVNT	a	5785	Ant2	1.06	1.26	2.32	30	Pass
NVNT	a	5785	Sum	5.43	1.26	6.69	30	Pass
NVNT	a	5825	Ant1	3.05	1.26	4.31	30	Pass
NVNT	a	5825	Ant2	0.76	1.26	2.02	30	Pass
NVNT	a	5825	Sum	5.06	1.26	6.32	30	Pass
NVNT	n20	5180	Ant1	2.61	1.78	4.39	24	Pass
NVNT	n20	5200	Ant1	1.89	1.78	3.67	24	Pass
NVNT	n20	5240	Ant1	2.2	1.78	3.98	24	Pass
NVNT	n20	5180	Ant2	0.99	1.78	2.77	24	Pass
NVNT	n20	5200	Ant2	0.79	1.78	2.57	24	Pass
NVNT	n20	5240	Ant2	3.23	1.77	5	24	Pass
NVNT	n20	5180	Ant1	4.02	0.28	4.3	24	Pass
NVNT	n20	5180	Ant2	2.14	0.28	2.42	24	Pass
NVNT	n20	5180	Sum	6.19	0.28	6.47	24	Pass
NVNT	n20	5200	Ant1	0.14	0.28	0.42	24	Pass
NVNT	n20	5200	Ant2	3.13	0.28	3.41	24	Pass
NVNT	n20	5200	Sum	4.9	0.28	5.18	24	Pass
NVNT	n20	5240	Ant1	2.24	0.28	2.52	24	Pass
NVNT	n20	5240	Ant2	1.52	0.28	1.8	24	Pass
NVNT	n20	5240	Sum	4.91	0.28	5.19	24	Pass
NVNT	n20	5260	Ant1	1.12	1.78	2.9	24	Pass
NVNT	n20	5300	Ant1	1.47	1.78	3.25	24	Pass
NVNT	n20	5320	Ant1	1.53	1.78	3.31	24	Pass
NVNT	n20	5260	Ant2	1.73	1.78	3.51	24	Pass
NVNT	n20	5300	Ant2	2.17	1.78	3.95	24	Pass
NVNT	n20	5320	Ant2	2.14	1.77	3.91	24	Pass
NVNT	n20	5260	Ant1	2.2	0.28	2.48	24	Pass
NVNT	n20	5260	Ant2	2.44	0.28	2.72	24	Pass
NVNT	n20	5260	Sum	5.33	0.28	5.61	24	Pass
NVNT	n20	5300	Ant1	0.5	0.28	0.78	24	Pass
NVNT	n20	5300	Ant2	3.16	0.28	3.44	24	Pass
NVNT	n20	5300	Sum	5.04	0.28	5.32	24	Pass
NVNT	n20	5320	Ant1	2.67	0.28	2.95	24	Pass
NVNT	n20	5320	Ant2	3.12	0.28	3.4	24	Pass
NVNT	n20	5320	Sum	5.91	0.28	6.19	24	Pass
NVNT	n20	5500	Ant1	3.33	1.78	5.11	24	Pass
NVNT	n20	5600	Ant1	3.15	1.78	4.93	24	Pass
NVNT	n20	5700	Ant1	3.81	1.78	5.59	24	Pass
NVNT	n20	5720	Ant1	2.44	1.78	4.22	24	Pass
NVNT	n20	5500	Ant2	4.09	1.77	5.86	24	Pass
NVNT	n20	5600	Ant2	3.31	1.78	5.09	24	Pass
NVNT	n20	5700	Ant2	1.76	1.77	3.53	24	Pass
NVNT	n20	5720	Ant2	1.87	1.77	3.64	24	Pass
NVNT	n20	5500	Ant1	5.64	0.28	5.92	24	Pass
NVNT	n20	5500	Ant2	4.55	0.28	4.83	24	Pass
NVNT	n20	5500	Sum	8.14	0.28	8.42	24	Pass
NVNT	n20	5600	Ant1	4.17	0.28	4.45	24	Pass



China

NVNT	n20	5600	Ant2	4.69	0.28	4.97	24	Pass
NVNT	n20	5600	Sum	7.45	0.28	7.73	24	Pass
NVNT	n20	5700	Ant1	2.64	0.28	2.92	24	Pass
NVNT	n20	5700	Ant2	3.04	0.28	3.32	24	Pass
NVNT	n20	5700	Sum	5.85	0.28	6.13	24	Pass
NVNT	n20	5720	Ant1	4.66	0.28	4.94	24	Pass
NVNT	n20	5720	Ant2	3.05	0.28	3.33	24	Pass
NVNT	n20	5720	Sum	6.94	0.28	7.22	24	Pass
NVNT	n20	5745	Ant1	3.65	1.77	5.42	30	Pass
NVNT	n20	5785	Ant1	2.97	1.77	4.74	30	Pass
NVNT	n20	5825	Ant1	2.53	1.78	4.31	30	Pass
NVNT	n20	5745	Ant2	0.76	1.78	2.54	30	Pass
NVNT	n20	5785	Ant2	-0.55	1.79	1.24	30	Pass
NVNT	n20	5825	Ant2	-0.34	1.78	1.44	30	Pass
NVNT	n20	5745	Ant1	4.51	0.28	4.79	30	Pass
NVNT	n20	5745	Ant2	0.45	0.28	0.73	30	Pass
NVNT	n20	5745	Sum	5.95	0.28	6.23	30	Pass
NVNT	n20	5785	Ant1	3.61	0.28	3.89	30	Pass
NVNT	n20	5785	Ant2	0.39	0.28	0.67	30	Pass
NVNT	n20	5785	Sum	5.3	0.28	5.58	30	Pass
NVNT	n20	5825	Ant1	3.03	0.28	3.31	30	Pass
NVNT	n20	5825	Ant2	1.02	0.28	1.3	30	Pass
NVNT	n20	5825	Sum	5.15	0.28	5.43	30	Pass
NVNT	n40	5190	Ant1	0.87	2.56	3.43	24	Pass
NVNT	n40	5230	Ant1	0.16	2.57	2.73	24	Pass
NVNT	n40	5190	Ant2	-0.09	2.57	2.48	24	Pass
NVNT	n40	5230	Ant2	-0.78	2.59	1.81	24	Pass
NVNT	n40	5190	Ant1	3.13	0.96	4.09	24	Pass
NVNT	n40	5190	Ant2	1.04	0.96	2	24	Pass
NVNT	n40	5190	Sum	5.22	0.96	6.18	24	Pass
NVNT	n40	5230	Ant1	0.64	0.99	1.63	24	Pass
NVNT	n40	5230	Ant2	0.98	0.99	1.97	24	Pass
NVNT	n40	5230	Sum	3.82	0.99	4.81	24	Pass
NVNT	n40	5270	Ant1	1.93	2.57	4.5	24	Pass
NVNT	n40	5310	Ant1	0.31	2.57	2.88	24	Pass
NVNT	n40	5270	Ant2	1.51	2.59	4.1	24	Pass
NVNT	n40	5310	Ant2	0.43	2.57	3	24	Pass
NVNT	n40	5270	Ant1	3.07	0.96	4.03	24	Pass
NVNT	n40	5270	Ant2	1.37	0.96	2.33	24	Pass
NVNT	n40	5270	Sum	5.31	0.96	6.27	24	Pass
NVNT	n40	5310	Ant1	0.23	0.97	1.2	24	Pass
NVNT	n40	5310	Ant2	2.15	0.97	3.12	24	Pass
NVNT	n40	5310	Sum	4.31	0.97	5.28	24	Pass
NVNT	n40	5510	Ant1	2.71	2.56	5.27	24	Pass
NVNT	n40	5590	Ant1	2.66	2.56	5.22	24	Pass
NVNT	n40	5670	Ant1	2.81	2.56	5.37	24	Pass
NVNT	n40	5710	Ant1	2.24	2.56	4.8	24	Pass
NVNT	n40	5510	Ant2	2.44	2.57	5.01	24	Pass
NVNT	n40	5590	Ant2	2.36	2.56	4.92	24	Pass
NVNT	n40	5670	Ant2	1.61	2.56	4.17	24	Pass
NVNT	n40	5710	Ant2	0.93	2.57	3.5	24	Pass
NVNT	n40	5510	Ant1	3.66	0.96	4.62	24	Pass
NVNT	n40	5510	Ant2	2.18	0.96	3.14	24	Pass
NVNT	n40	5510	Sum	5.99	0.96	6.95	24	Pass
NVNT	n40	5590	Ant1	3.42	0.96	4.38	24	Pass
NVNT	n40	5590	Ant2	1.8	0.96	2.76	24	Pass



China

NVNT	n40	5590	Sum	5.7	0.96	6.66	24	Pass
NVNT	n40	5670	Ant1	3.87	0.96	4.83	24	Pass
NVNT	n40	5670	Ant2	1.84	0.96	2.8	24	Pass
NVNT	n40	5670	Sum	5.98	0.96	6.94	24	Pass
NVNT	n40	5710	Ant1	2.7	1.02	3.72	24	Pass
NVNT	n40	5710	Ant2	2.61	1.02	3.63	24	Pass
NVNT	n40	5710	Sum	5.67	1.02	6.69	24	Pass
NVNT	n40	5755	Ant1	0.84	2.6	3.44	30	Pass
NVNT	n40	5795	Ant1	0.27	2.88	3.15	30	Pass
NVNT	n40	5755	Ant2	-1.9	2.6	0.7	30	Pass
NVNT	n40	5795	Ant2	-1.39	2.89	1.5	30	Pass
NVNT	n40	5755	Ant1	1.75	1.06	2.81	30	Pass
NVNT	n40	5755	Ant2	0.36	1.06	1.42	30	Pass
NVNT	n40	5755	Sum	4.12	1.06	5.18	30	Pass
NVNT	n40	5795	Ant1	2.32	1.05	3.37	30	Pass
NVNT	n40	5795	Ant2	-0.38	1.05	0.67	30	Pass
NVNT	n40	5795	Sum	4.19	1.05	5.24	30	Pass
NVNT	ac20	5180	Ant1	4.41	0.02	4.43	24	Pass
NVNT	ac20	5200	Ant1	3.6	0.02	3.62	24	Pass
NVNT	ac20	5240	Ant1	3.87	0.02	3.89	24	Pass
NVNT	ac20	5180	Ant2	2.68	0.28	2.96	24	Pass
NVNT	ac20	5200	Ant2	2.4	0.28	2.68	24	Pass
NVNT	ac20	5240	Ant2	2.33	0.28	2.61	24	Pass
NVNT	ac20	5180	Ant1	4.56	0.02	4.58	24	Pass
NVNT	ac20	5180	Ant2	2.61	0.02	2.63	24	Pass
NVNT	ac20	5180	Sum	6.7	0.02	6.72	24	Pass
NVNT	ac20	5200	Ant1	3.44	0.02	3.46	24	Pass
NVNT	ac20	5200	Ant2	1.53	0.02	1.55	24	Pass
NVNT	ac20	5200	Sum	5.6	0.02	5.62	24	Pass
NVNT	ac20	5240	Ant1	2.58	0.02	2.6	24	Pass
NVNT	ac20	5240	Ant2	1.84	0.02	1.86	24	Pass
NVNT	ac20	5240	Sum	5.24	0.02	5.26	24	Pass
NVNT	ac20	5260	Ant1	2.57	0.02	2.59	24	Pass
NVNT	ac20	5300	Ant1	3.1	0.02	3.12	24	Pass
NVNT	ac20	5320	Ant1	3.24	0.02	3.26	24	Pass
NVNT	ac20	5260	Ant2	3.09	0.28	3.37	24	Pass
NVNT	ac20	5300	Ant2	3.73	0.28	4.01	24	Pass
NVNT	ac20	5320	Ant2	3.2	0.28	3.48	24	Pass
NVNT	ac20	5260	Ant1	4.36	0.02	4.38	24	Pass
NVNT	ac20	5260	Ant2	2.78	0.02	2.8	24	Pass
NVNT	ac20	5260	Sum	6.65	0.02	6.67	24	Pass
NVNT	ac20	5300	Ant1	1.2	0.02	1.22	24	Pass
NVNT	ac20	5300	Ant2	3.22	0.02	3.24	24	Pass
NVNT	ac20	5300	Sum	5.34	0.02	5.36	24	Pass
NVNT	ac20	5320	Ant1	2.79	0.02	2.81	24	Pass
NVNT	ac20	5320	Ant2	3.6	0.02	3.62	24	Pass
NVNT	ac20	5320	Sum	6.22	0.02	6.24	24	Pass
NVNT	ac20	5500	Ant1	5.18	0.02	5.2	24	Pass
NVNT	ac20	5600	Ant1	5.21	0.02	5.23	24	Pass
NVNT	ac20	5700	Ant1	4.15	0.02	4.17	24	Pass
NVNT	ac20	5720	Ant1	4.08	0.02	4.1	24	Pass
NVNT	ac20	5500	Ant2	5.56	0.28	5.84	24	Pass
NVNT	ac20	5600	Ant2	4.91	0.28	5.19	24	Pass
NVNT	ac20	5700	Ant2	3.31	0.28	3.59	24	Pass
NVNT	ac20	5720	Ant2	3.43	0.28	3.71	24	Pass
NVNT	ac20	5500	Ant1	5.76	0.02	5.78	24	Pass



China

NVNT	ac20	5500	Ant2	6.33	0.02	6.35	24	Pass
NVNT	ac20	5500	Sum	9.06	0.02	9.08	24	Pass
NVNT	ac20	5600	Ant1	4.89	0.02	4.91	24	Pass
NVNT	ac20	5600	Ant2	3.18	0.02	3.2	24	Pass
NVNT	ac20	5600	Sum	7.13	0.02	7.15	24	Pass
NVNT	ac20	5700	Ant1	3.32	0.02	3.34	24	Pass
NVNT	ac20	5700	Ant2	4.03	0.02	4.05	24	Pass
NVNT	ac20	5700	Sum	6.7	0.02	6.72	24	Pass
NVNT	ac20	5720	Ant1	5.65	0.02	5.67	24	Pass
NVNT	ac20	5720	Ant2	3.63	0.02	3.65	24	Pass
NVNT	ac20	5720	Sum	7.77	0.02	7.79	24	Pass
NVNT	ac20	5745	Ant1	5.38	0.02	5.4	30	Pass
NVNT	ac20	5785	Ant1	4.62	0.02	4.64	30	Pass
NVNT	ac20	5825	Ant1	4.49	0.02	4.51	30	Pass
NVNT	ac20	5745	Ant2	2.09	0.28	2.37	30	Pass
NVNT	ac20	5785	Ant2	0.94	0.28	1.22	30	Pass
NVNT	ac20	5825	Ant2	1.14	0.28	1.42	30	Pass
NVNT	ac20	5745	Ant1	4.65	0.02	4.67	30	Pass
NVNT	ac20	5745	Ant2	0.57	0.02	0.59	30	Pass
NVNT	ac20	5745	Sum	6.08	0.02	6.1	30	Pass
NVNT	ac20	5785	Ant1	3.86	0.02	3.88	30	Pass
NVNT	ac20	5785	Ant2	0.2	0.02	0.22	30	Pass
NVNT	ac20	5785	Sum	5.41	0.02	5.43	30	Pass
NVNT	ac20	5825	Ant1	3.16	0.02	3.18	30	Pass
NVNT	ac20	5825	Ant2	1.12	0.02	1.14	30	Pass
NVNT	ac20	5825	Sum	5.27	0.02	5.29	30	Pass
NVNT	ac40	5190	Ant1	3.41	0.02	3.43	24	Pass
NVNT	ac40	5230	Ant1	3.19	0.02	3.21	24	Pass
NVNT	ac40	5190	Ant2	2.4	0.02	2.42	24	Pass
NVNT	ac40	5230	Ant2	2.38	0.02	2.4	24	Pass
NVNT	ac40	5190	Ant1	3.72	0.02	3.74	24	Pass
NVNT	ac40	5190	Ant2	1.67	0.02	1.69	24	Pass
NVNT	ac40	5190	Sum	5.83	0.02	5.85	24	Pass
NVNT	ac40	5230	Ant1	3.12	0.05	3.17	24	Pass
NVNT	ac40	5230	Ant2	1	0.05	1.05	24	Pass
NVNT	ac40	5230	Sum	5.2	0.05	5.25	24	Pass
NVNT	ac40	5270	Ant1	2.09	0.02	2.11	24	Pass
NVNT	ac40	5310	Ant1	2.45	0.03	2.48	24	Pass
NVNT	ac40	5270	Ant2	2.71	0.02	2.73	24	Pass
NVNT	ac40	5310	Ant2	3.2	0.03	3.23	24	Pass
NVNT	ac40	5270	Ant1	3.81	0.02	3.83	24	Pass
NVNT	ac40	5270	Ant2	2.56	0.02	2.58	24	Pass
NVNT	ac40	5270	Sum	6.24	0.02	6.26	24	Pass
NVNT	ac40	5310	Ant1	0.85	0.04	0.89	24	Pass
NVNT	ac40	5310	Ant2	3.06	0.04	3.1	24	Pass
NVNT	ac40	5310	Sum	5.1	0.04	5.14	24	Pass
NVNT	ac40	5510	Ant1	5.45	0.02	5.47	24	Pass
NVNT	ac40	5590	Ant1	3.9	0.02	3.92	24	Pass
NVNT	ac40	5670	Ant1	4.16	0.03	4.19	24	Pass
NVNT	ac40	5710	Ant1	4.73	0.05	4.78	24	Pass
NVNT	ac40	5510	Ant2	5.23	0.02	5.25	24	Pass
NVNT	ac40	5590	Ant2	5.12	0.02	5.14	24	Pass
NVNT	ac40	5670	Ant2	3.13	0.03	3.16	24	Pass
NVNT	ac40	5710	Ant2	3.72	0.02	3.74	24	Pass
NVNT	ac40	5510	Ant1	6.25	0.02	6.27	24	Pass
NVNT	ac40	5510	Ant2	4.92	0.02	4.94	24	Pass



China

NVNT	ac40	5510	Sum	8.65	0.02	8.67	24	Pass
NVNT	ac40	5590	Ant1	6.03	0.03	6.06	24	Pass
NVNT	ac40	5590	Ant2	4.68	0.03	4.71	24	Pass
NVNT	ac40	5590	Sum	8.42	0.03	8.45	24	Pass
NVNT	ac40	5670	Ant1	3.87	0.04	3.91	24	Pass
NVNT	ac40	5670	Ant2	1.67	0.04	1.71	24	Pass
NVNT	ac40	5670	Sum	5.92	0.04	5.96	24	Pass
NVNT	ac40	5710	Ant1	3.91	0.03	3.94	24	Pass
NVNT	ac40	5710	Ant2	3.22	0.03	3.25	24	Pass
NVNT	ac40	5710	Sum	6.59	0.03	6.62	24	Pass
NVNT	ac40	5755	Ant1	3.8	0.03	3.83	30	Pass
NVNT	ac40	5795	Ant1	3.37	0.05	3.42	30	Pass
NVNT	ac40	5755	Ant2	1.74	0.02	1.76	30	Pass
NVNT	ac40	5795	Ant2	1.14	0.05	1.19	30	Pass
NVNT	ac40	5755	Ant1	2.89	0.05	2.94	30	Pass
NVNT	ac40	5755	Ant2	0.93	0.05	0.98	30	Pass
NVNT	ac40	5755	Sum	5.03	0.05	5.08	30	Pass
NVNT	ac40	5795	Ant1	3.26	0.05	3.31	30	Pass
NVNT	ac40	5795	Ant2	0.23	0.05	0.28	30	Pass
NVNT	ac40	5795	Sum	5.01	0.05	5.06	30	Pass
NVNT	ac80	5210	Ant1	-0.15	4.36	4.21	24	Pass
NVNT	ac80	5210	Ant2	-1.31	4.36	3.05	24	Pass
NVNT	ac80	5210	Ant1	0	0.13	0.13	24	Pass
NVNT	ac80	5210	Ant2	0.42	0.13	0.55	24	Pass
NVNT	ac80	5210	Sum	3.23	0.13	3.36	24	Pass
NVNT	ac80	5290	Ant1	-0.33	4.36	4.03	24	Pass
NVNT	ac80	5290	Ant2	-0.07	3.96	3.89	24	Pass
NVNT	ac80	5290	Ant1	0.09	0.13	0.22	24	Pass
NVNT	ac80	5290	Ant2	1.92	0.13	2.05	24	Pass
NVNT	ac80	5290	Sum	4.11	0.13	4.24	24	Pass
NVNT	ac80	5530	Ant1	2.34	4.35	6.69	24	Pass
NVNT	ac80	5610	Ant1	2.15	4.22	6.37	24	Pass
NVNT	ac80	5690	Ant1	1.98	4.35	6.33	24	Pass
NVNT	ac80	5530	Ant2	1.51	4.35	5.86	24	Pass
NVNT	ac80	5610	Ant2	1.4	4.36	5.76	24	Pass
NVNT	ac80	5690	Ant2	1.07	3.92	4.99	24	Pass
NVNT	ac80	5530	Ant1	3.33	0.13	3.46	24	Pass
NVNT	ac80	5530	Ant2	2.79	0.13	2.92	24	Pass
NVNT	ac80	5530	Sum	6.08	0.13	6.21	24	Pass
NVNT	ac80	5610	Ant1	2.79	0.13	2.92	24	Pass
NVNT	ac80	5610	Ant2	2.48	0.13	2.61	24	Pass
NVNT	ac80	5610	Sum	5.65	0.13	5.78	24	Pass
NVNT	ac80	5690	Ant1	2.81	0.13	2.94	24	Pass
NVNT	ac80	5690	Ant2	1.43	0.13	1.56	24	Pass
NVNT	ac80	5690	Sum	5.18	0.13	5.31	24	Pass
NVNT	ac80	5775	Ant1	0.7	4.35	5.05	30	Pass
NVNT	ac80	5775	Ant2	-1.66	4.37	2.71	30	Pass
NVNT	ac80	5775	Ant1	1.61	0.13	1.74	30	Pass
NVNT	ac80	5775	Ant2	-1.69	0.13	-1.56	30	Pass
NVNT	ac80	5775	Sum	3.28	0.13	3.41	30	Pass
NVNT	ax20	5180	Ant1	4.31	0.36	4.67	24	Pass
NVNT	ax20	5200	Ant1	3.59	0.36	3.95	24	Pass
NVNT	ax20	5240	Ant1	3.86	0.36	4.22	24	Pass
NVNT	ax20	5180	Ant2	2.69	0.36	3.05	24	Pass
NVNT	ax20	5200	Ant2	2.64	0.35	2.99	24	Pass
NVNT	ax20	5240	Ant2	2.23	0.35	2.58	24	Pass



China

NVNT	ax20	5180	Ant1	4.87	0.05	4.92	24	Pass
NVNT	ax20	5180	Ant2	2.8	0.05	2.85	24	Pass
NVNT	ax20	5180	Sum	6.97	0.05	7.02	24	Pass
NVNT	ax20	5200	Ant1	4.54	0.05	4.59	24	Pass
NVNT	ax20	5200	Ant2	2.05	0.05	2.1	24	Pass
NVNT	ax20	5200	Sum	6.48	0.05	6.53	24	Pass
NVNT	ax20	5240	Ant1	2.78	0.05	2.83	24	Pass
NVNT	ax20	5240	Ant2	2.05	0.05	2.1	24	Pass
NVNT	ax20	5240	Sum	5.44	0.05	5.49	24	Pass
NVNT	ax20	5260	Ant1	2.76	0.36	3.12	24	Pass
NVNT	ax20	5300	Ant1	3	0.36	3.36	24	Pass
NVNT	ax20	5320	Ant1	3.27	0.36	3.63	24	Pass
NVNT	ax20	5260	Ant2	3.4	0.36	3.76	24	Pass
NVNT	ax20	5300	Ant2	3.75	0.36	4.11	24	Pass
NVNT	ax20	5320	Ant2	3.78	0.35	4.13	24	Pass
NVNT	ax20	5260	Ant1	4.49	0.05	4.54	24	Pass
NVNT	ax20	5260	Ant2	3.3	0.05	3.35	24	Pass
NVNT	ax20	5260	Sum	6.95	0.05	7	24	Pass
NVNT	ax20	5300	Ant1	1.04	0.05	1.09	24	Pass
NVNT	ax20	5300	Ant2	3.78	0.05	3.83	24	Pass
NVNT	ax20	5300	Sum	5.63	0.05	5.68	24	Pass
NVNT	ax20	5320	Ant1	3.2	0.05	3.25	24	Pass
NVNT	ax20	5320	Ant2	3.8	0.05	3.85	24	Pass
NVNT	ax20	5320	Sum	6.52	0.05	6.57	24	Pass
NVNT	ax20	5500	Ant1	5.17	0.36	5.53	24	Pass
NVNT	ax20	5600	Ant1	4.92	0.35	5.27	24	Pass
NVNT	ax20	5700	Ant1	4.32	0.36	4.68	24	Pass
NVNT	ax20	5720	Ant1	4	0.35	4.35	24	Pass
NVNT	ax20	5500	Ant2	5.78	0.35	6.13	24	Pass
NVNT	ax20	5600	Ant2	5.01	0.35	5.36	24	Pass
NVNT	ax20	5700	Ant2	3.17	0.38	3.55	24	Pass
NVNT	ax20	5720	Ant2	3.48	0.36	3.84	24	Pass
NVNT	ax20	5500	Ant1	6.16	0.05	6.21	24	Pass
NVNT	ax20	5500	Ant2	5.07	0.05	5.12	24	Pass
NVNT	ax20	5500	Sum	8.66	0.05	8.71	24	Pass
NVNT	ax20	5600	Ant1	6.04	0.05	6.09	24	Pass
NVNT	ax20	5600	Ant2	4.27	0.05	4.32	24	Pass
NVNT	ax20	5600	Sum	8.25	0.05	8.3	24	Pass
NVNT	ax20	5700	Ant1	3.15	0.05	3.2	24	Pass
NVNT	ax20	5700	Ant2	2.56	0.05	2.61	24	Pass
NVNT	ax20	5700	Sum	5.88	0.05	5.93	24	Pass
NVNT	ax20	5720	Ant1	5.16	0.05	5.21	24	Pass
NVNT	ax20	5720	Ant2	6.34	0.05	6.39	24	Pass
NVNT	ax20	5720	Sum	8.8	0.05	8.85	24	Pass
NVNT	ax20	5745	Ant1	5.22	0.36	5.58	30	Pass
NVNT	ax20	5785	Ant1	4.54	0.36	4.9	30	Pass
NVNT	ax20	5825	Ant1	4.11	0.36	4.47	30	Pass
NVNT	ax20	5745	Ant2	1.77	0.36	2.13	30	Pass
NVNT	ax20	5785	Ant2	0.72	0.36	1.08	30	Pass
NVNT	ax20	5825	Ant2	1.41	0.36	1.77	30	Pass
NVNT	ax20	5745	Ant1	4.89	0.05	4.94	30	Pass
NVNT	ax20	5745	Ant2	1.46	0.05	1.51	30	Pass
NVNT	ax20	5745	Sum	6.52	0.05	6.57	30	Pass
NVNT	ax20	5785	Ant1	3.89	0.05	3.94	30	Pass
NVNT	ax20	5785	Ant2	0.59	0.05	0.64	30	Pass
NVNT	ax20	5785	Sum	5.56	0.05	5.61	30	Pass





China


NVNT	ax20	5825	Ant1	3.26	0.05	3.31	30	Pass
NVNT	ax20	5825	Ant2	0.86	0.05	0.91	30	Pass
NVNT	ax20	5825	Sum	5.23	0.05	5.28	30	Pass
NVNT	ax40	5190	Ant1	3.32	0.7	4.02	24	Pass
NVNT	ax40	5230	Ant1	2.91	0.69	3.6	24	Pass
NVNT	ax40	5190	Ant2	2.18	0.66	2.84	24	Pass
NVNT	ax40	5230	Ant2	1.96	0.65	2.61	24	Pass
NVNT	ax40	5190	Ant1	4.39	0.12	4.51	24	Pass
NVNT	ax40	5190	Ant2	2.22	0.12	2.34	24	Pass
NVNT	ax40	5190	Sum	6.45	0.12	6.57	24	Pass
NVNT	ax40	5230	Ant1	1.84	0.15	1.99	24	Pass
NVNT	ax40	5230	Ant2	1.96	0.15	2.11	24	Pass
NVNT	ax40	5230	Sum	4.91	0.15	5.06	24	Pass
NVNT	ax40	5270	Ant1	2.38	0.71	3.09	24	Pass
NVNT	ax40	5310	Ant1	2.55	0.65	3.2	24	Pass
NVNT	ax40	5270	Ant2	2.96	0.66	3.62	24	Pass
NVNT	ax40	5310	Ant2	3.33	0.65	3.98	24	Pass
NVNT	ax40	5270	Ant1	2.92	0.13	3.05	24	Pass
NVNT	ax40	5270	Ant2	2.31	0.13	2.44	24	Pass
NVNT	ax40	5270	Sum	5.64	0.13	5.77	24	Pass
NVNT	ax40	5310	Ant1	0.37	0.2	0.57	24	Pass
NVNT	ax40	5310	Ant2	2.72	0.2	2.92	24	Pass
NVNT	ax40	5310	Sum	4.71	0.2	4.91	24	Pass
NVNT	ax40	5510	Ant1	5.15	0.66	5.81	24	Pass
NVNT	ax40	5590	Ant1	5.09	0.69	5.78	24	Pass
NVNT	ax40	5670	Ant1	5.13	0.7	5.83	24	Pass
NVNT	ax40	5710	Ant1	4.76	0.71	5.47	24	Pass
NVNT	ax40	5510	Ant2	4.81	0.66	5.47	24	Pass
NVNT	ax40	5590	Ant2	4.61	0.65	5.26	24	Pass
NVNT	ax40	5670	Ant2	3.8	0.66	4.46	24	Pass
NVNT	ax40	5710	Ant2	3.43	0.67	4.1	24	Pass
NVNT	ax40	5510	Ant1	5.54	0.11	5.65	24	Pass
NVNT	ax40	5510	Ant2	4.46	0.11	4.57	24	Pass
NVNT	ax40	5510	Sum	8.04	0.11	8.15	24	Pass
NVNT	ax40	5590	Ant1	5.86	0.11	5.97	24	Pass
NVNT	ax40	5590	Ant2	4.06	0.11	4.17	24	Pass
NVNT	ax40	5590	Sum	8.06	0.11	8.17	24	Pass
NVNT	ax40	5670	Ant1	4.22	0.15	4.37	24	Pass
NVNT	ax40	5670	Ant2	2.05	0.15	2.2	24	Pass
NVNT	ax40	5670	Sum	6.28	0.15	6.43	24	Pass
NVNT	ax40	5710	Ant1	3.91	0.15	4.06	24	Pass
NVNT	ax40	5710	Ant2	3.45	0.15	3.6	24	Pass
NVNT	ax40	5710	Sum	6.7	0.15	6.85	24	Pass
NVNT	ax40	5755	Ant1	3.66	0.66	4.32	30	Pass
NVNT	ax40	5795	Ant1	2.63	0.71	3.34	30	Pass
NVNT	ax40	5755	Ant2	1.13	0.66	1.79	30	Pass
NVNT	ax40	5795	Ant2	0.52	0.71	1.23	30	Pass
NVNT	ax40	5755	Ant1	2.88	0.15	3.03	30	Pass
NVNT	ax40	5755	Ant2	0.94	0.15	1.09	30	Pass
NVNT	ax40	5755	Sum	5.03	0.15	5.18	30	Pass
NVNT	ax40	5795	Ant1	3.24	0.15	3.39	30	Pass
NVNT	ax40	5795	Ant2	0.3	0.15	0.45	30	Pass
NVNT	ax40	5795	Sum	5.02	0.15	5.17	30	Pass
NVNT	ax80	5210	Ant1	0.4	4.2	4.6	24	Pass
NVNT	ax80	5210	Ant2	-1.01	3.91	2.9	24	Pass
NVNT	ax80	5210	Ant1	0	0.39	0.39	24	Pass



China


NVNT	ax80	5210	Ant2	0.65	0.39	1.04	24	Pass
NVNT	ax80	5210	Sum	3.35	0.39	3.74	24	Pass
NVNT	ax80	5290	Ant1	0.02	3.9	3.92	24	Pass
NVNT	ax80	5290	Ant2	0.22	3.35	3.57	24	Pass
NVNT	ax80	5290	Ant1	0.87	0.39	1.26	24	Pass
NVNT	ax80	5290	Ant2	1.59	0.39	1.98	24	Pass
NVNT	ax80	5290	Sum	4.26	0.39	4.65	24	Pass
NVNT	ax80	5530	Ant1	2.73	3.88	6.61	24	Pass
NVNT	ax80	5610	Ant1	2.58	3.9	6.48	24	Pass
NVNT	ax80	5690	Ant1	2.66	3.87	6.53	24	Pass
NVNT	ax80	5530	Ant2	1.9	3.89	5.79	24	Pass
NVNT	ax80	5610	Ant2	1.71	3.89	5.6	24	Pass
NVNT	ax80	5690	Ant2	1.29	3.3	4.59	24	Pass
NVNT	ax80	5530	Ant1	3.28	0.38	3.66	24	Pass
NVNT	ax80	5530	Ant2	2.75	0.38	3.13	24	Pass
NVNT	ax80	5530	Sum	6.03	0.38	6.41	24	Pass
NVNT	ax80	5610	Ant1	2.24	0.37	2.61	24	Pass
NVNT	ax80	5610	Ant2	2.07	0.37	2.44	24	Pass
NVNT	ax80	5610	Sum	5.17	0.37	5.54	24	Pass
NVNT	ax80	5690	Ant1	3.02	0.38	3.4	24	Pass
NVNT	ax80	5690	Ant2	1.41	0.38	1.79	24	Pass
NVNT	ax80	5690	Sum	5.3	0.38	5.68	24	Pass
NVNT	ax80	5775	Ant1	0.76	3.9	4.66	30	Pass
NVNT	ax80	5775	Ant2	-1.32	3.92	2.6	30	Pass
NVNT	ax80	5775	Ant1	1.74	0.38	2.12	30	Pass
NVNT	ax80	5775	Ant2	-1.75	0.38	-1.37	30	Pass
NVNT	ax80	5775	Sum	3.35	0.38	3.73	30	Pass

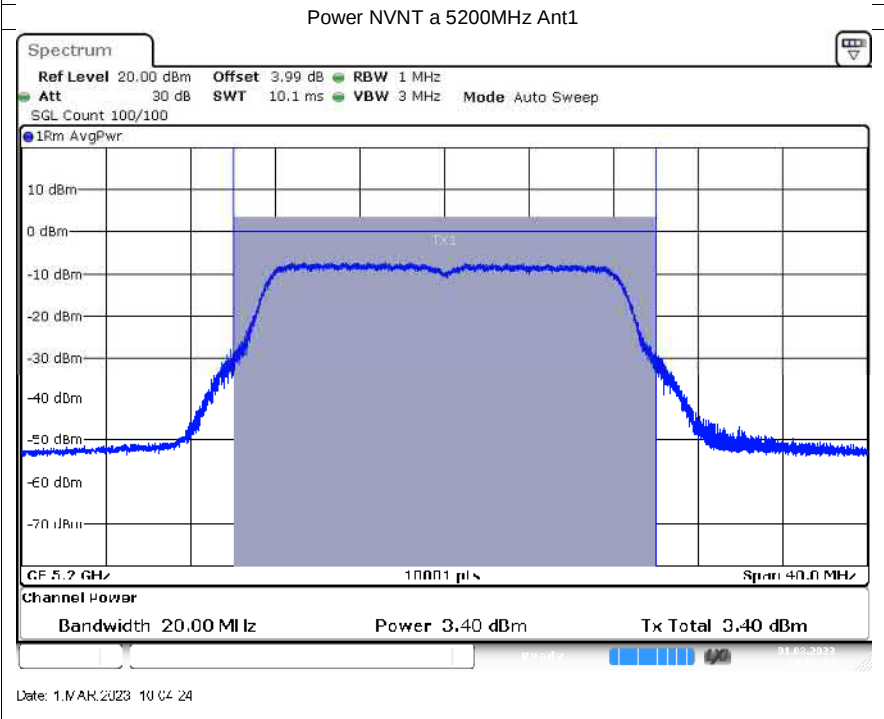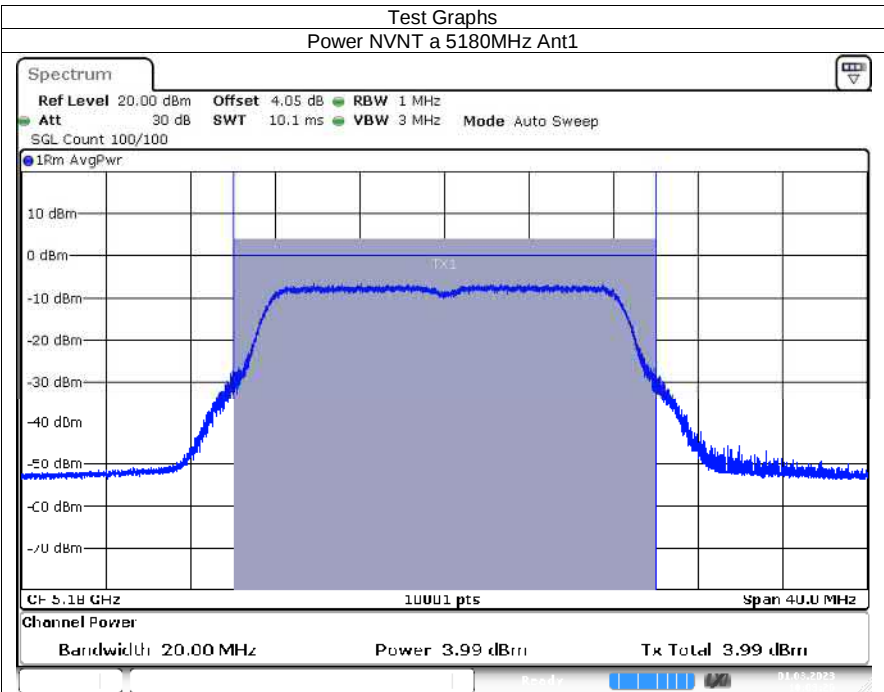

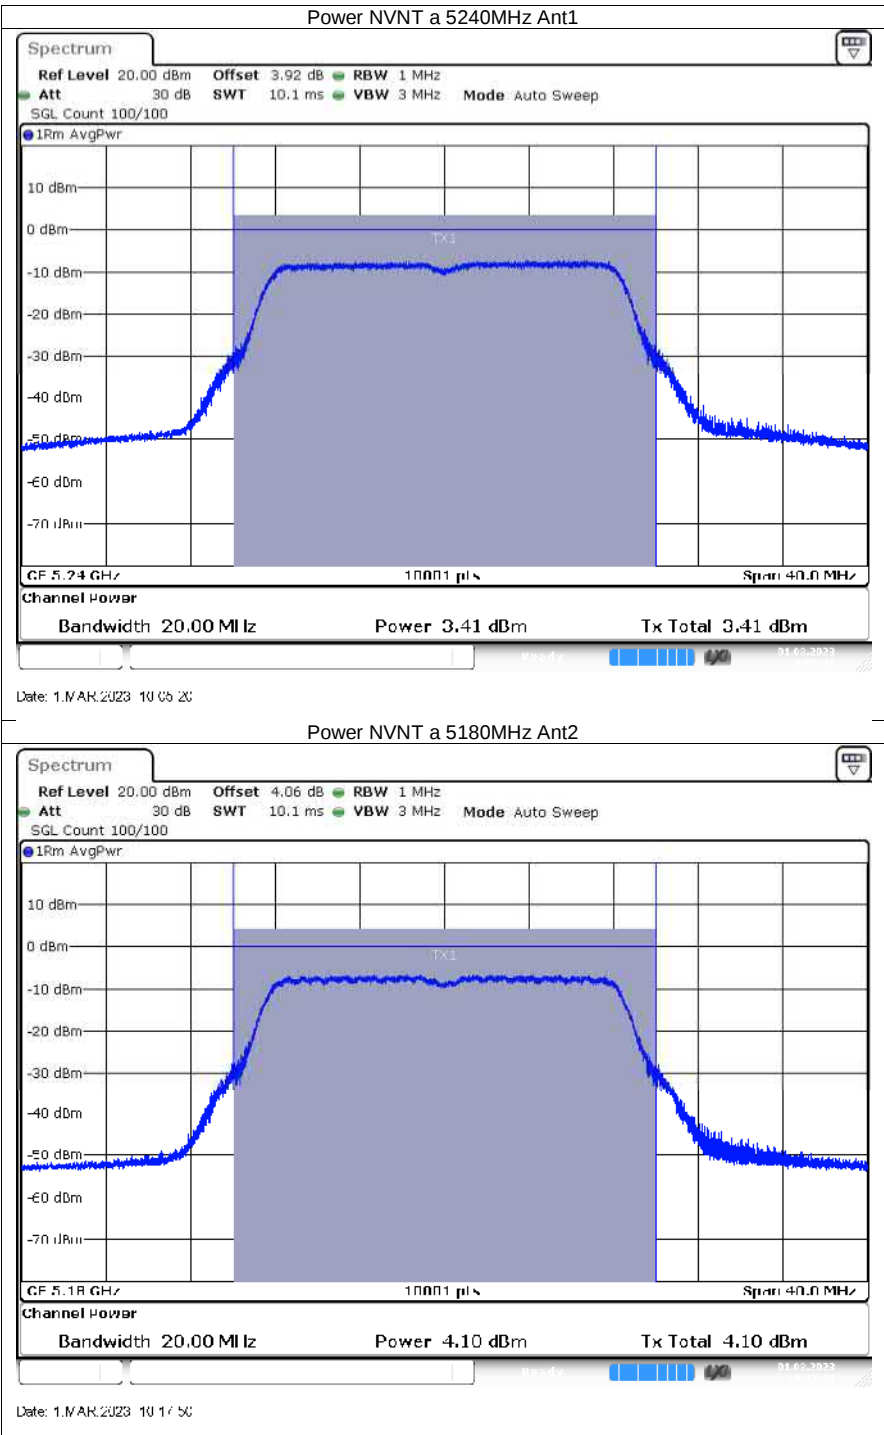



China

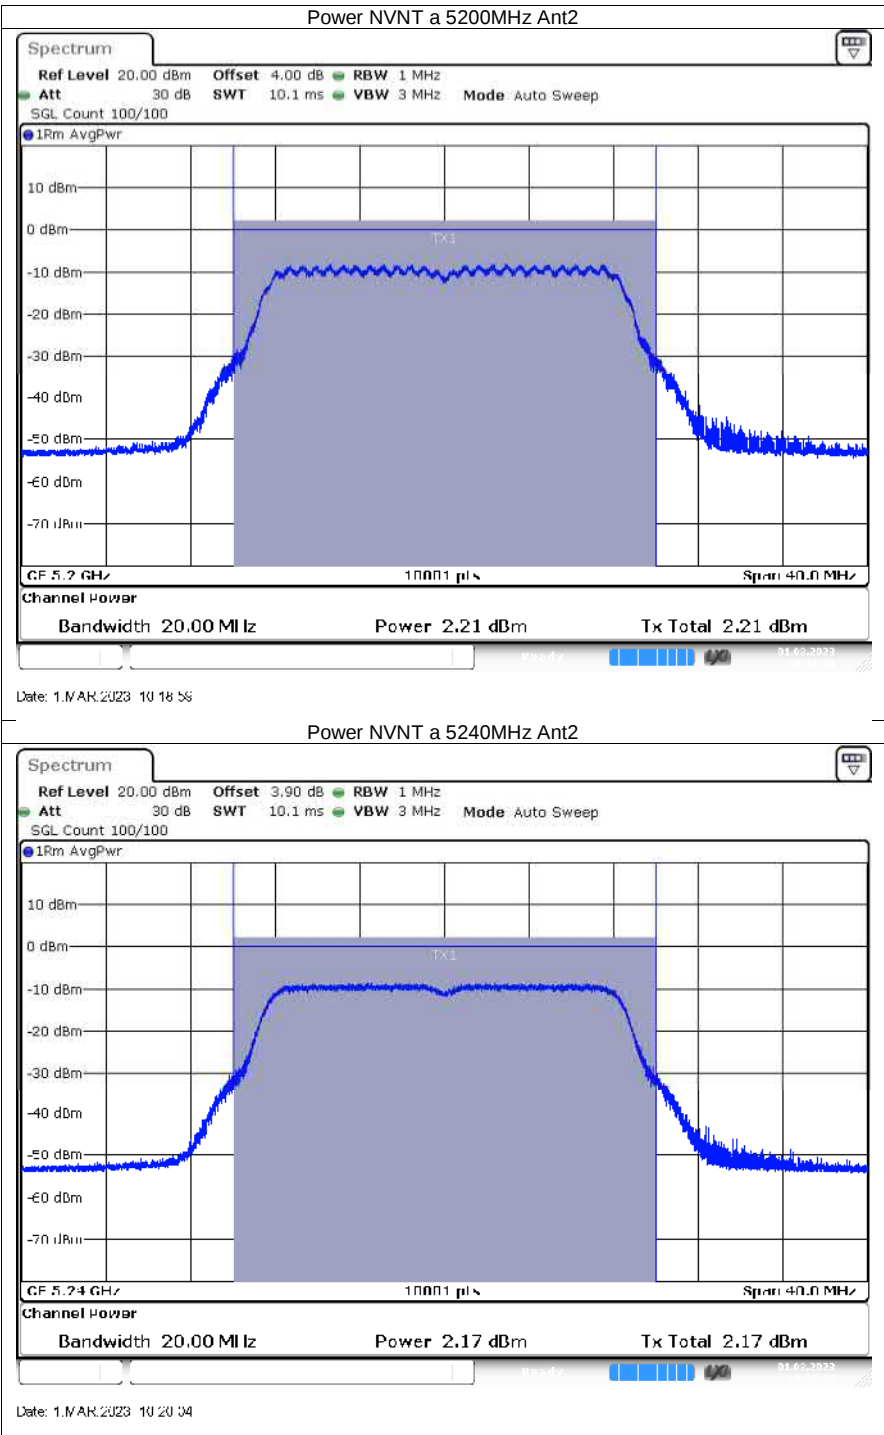



China

