




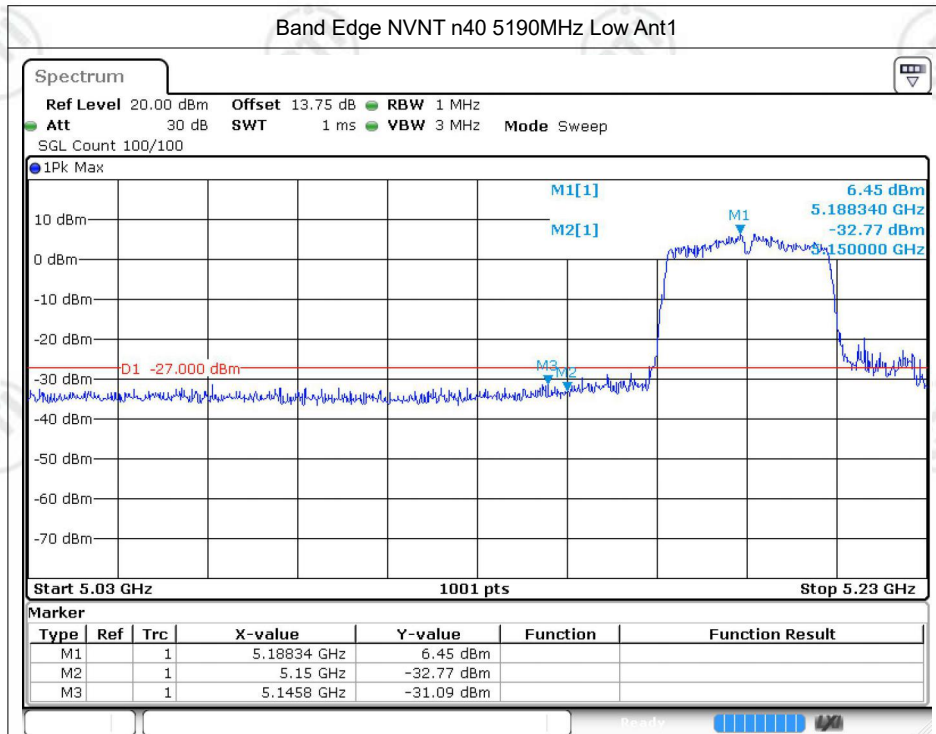


Date: 8.SEP.2022 15:00:22

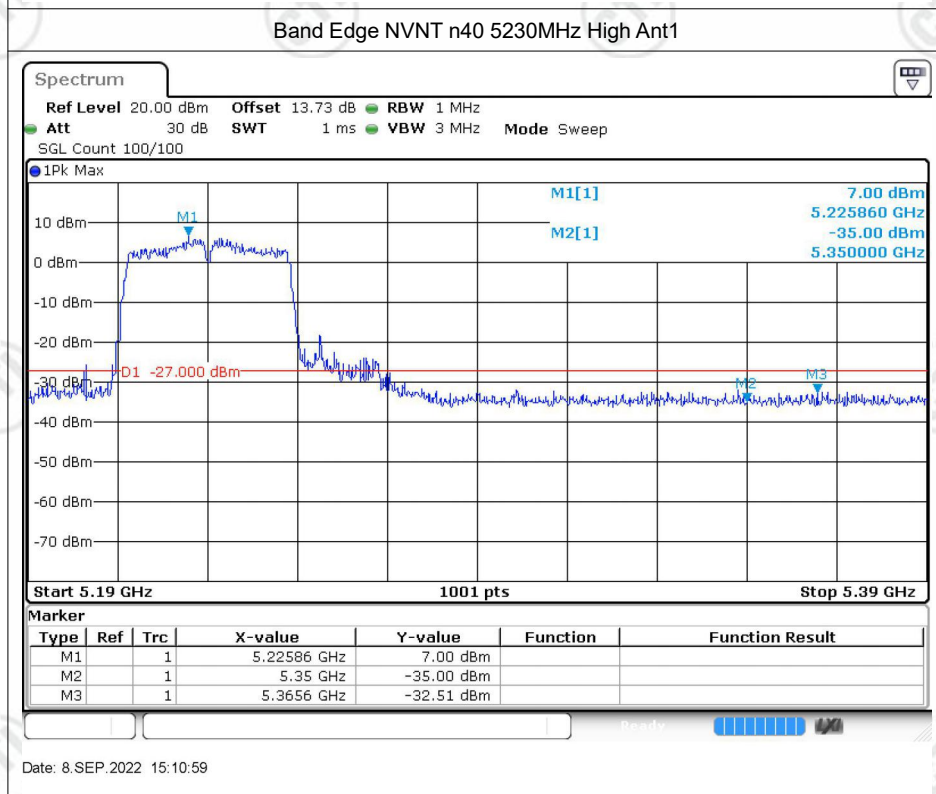


Date: 8.SEP.2022 15:10:59

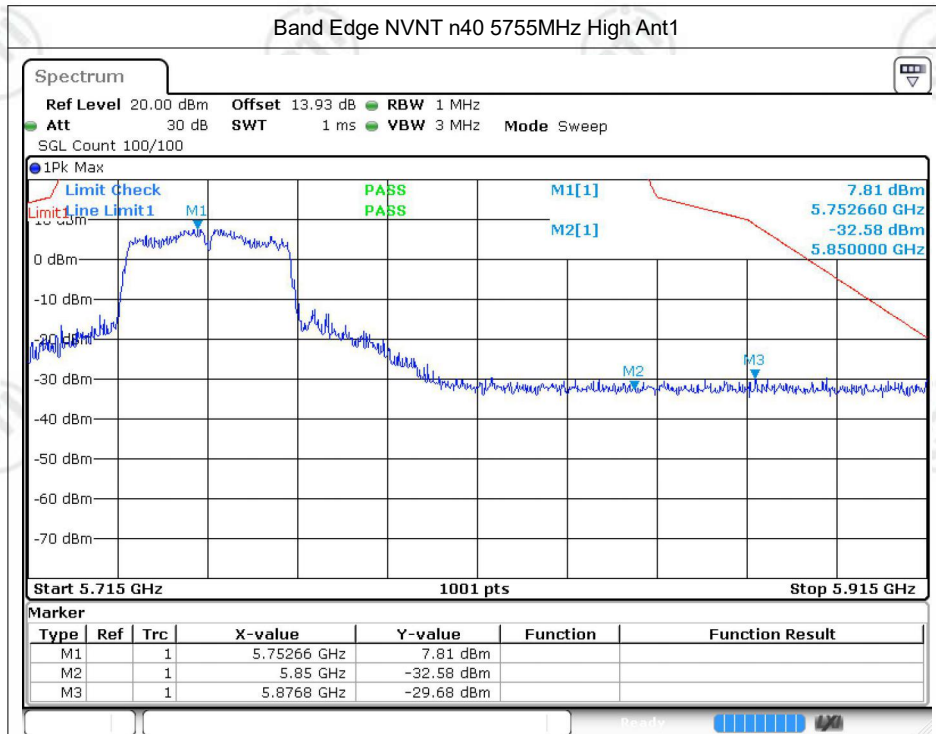


Date: 8.SEP.2022 15:19:03

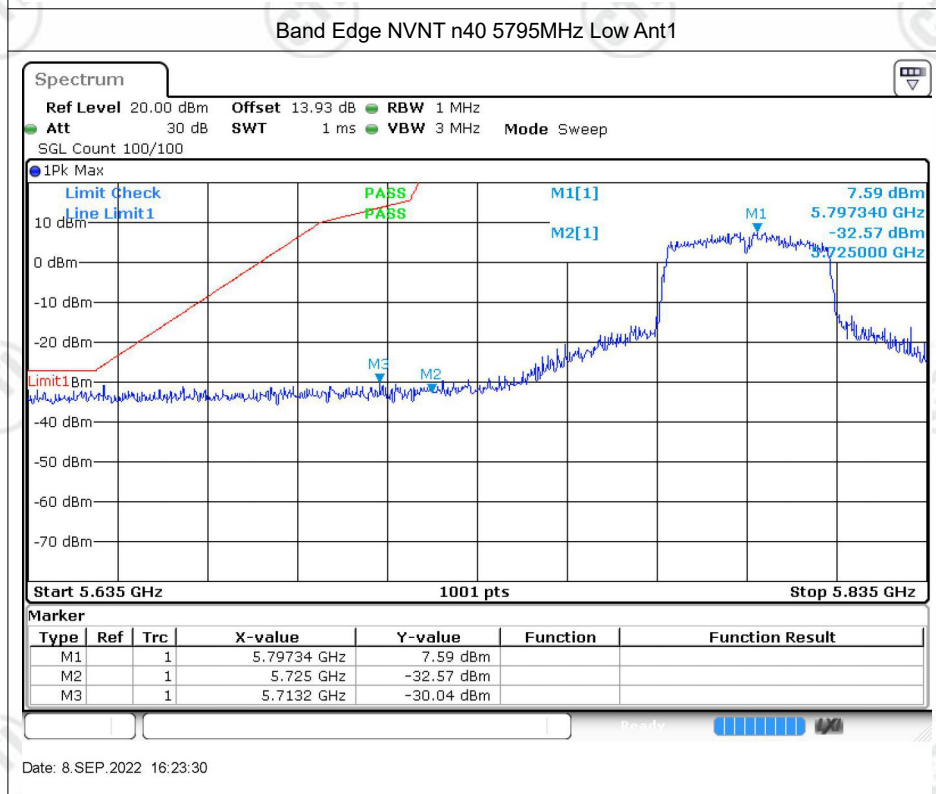


Date: 8.SEP.2022 16:23:30

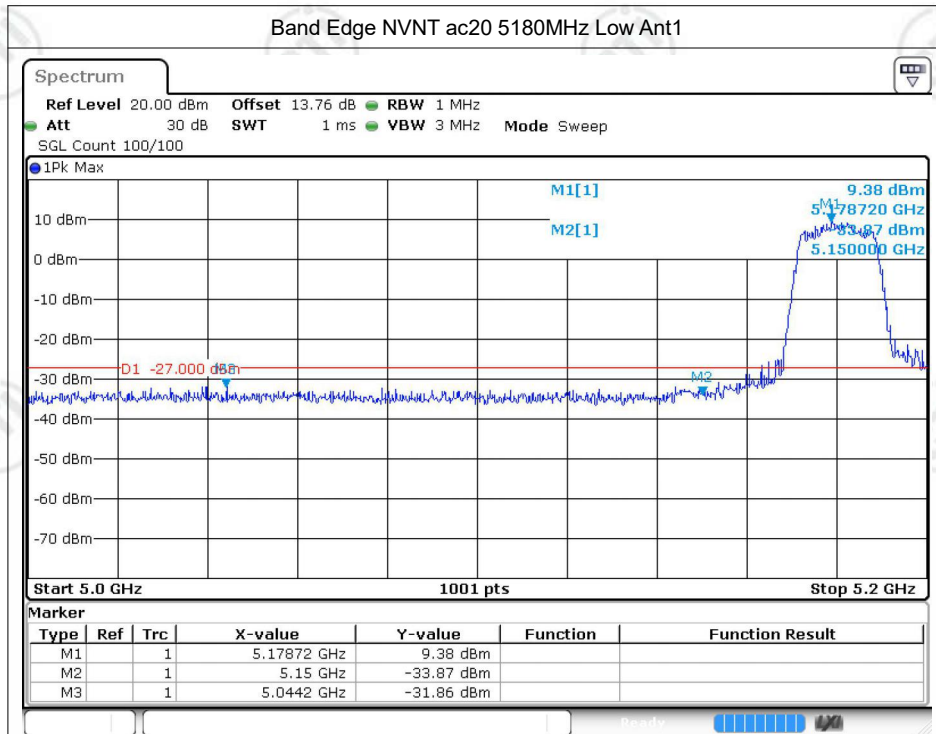


Date: 8.SEP.2022 16:25:51

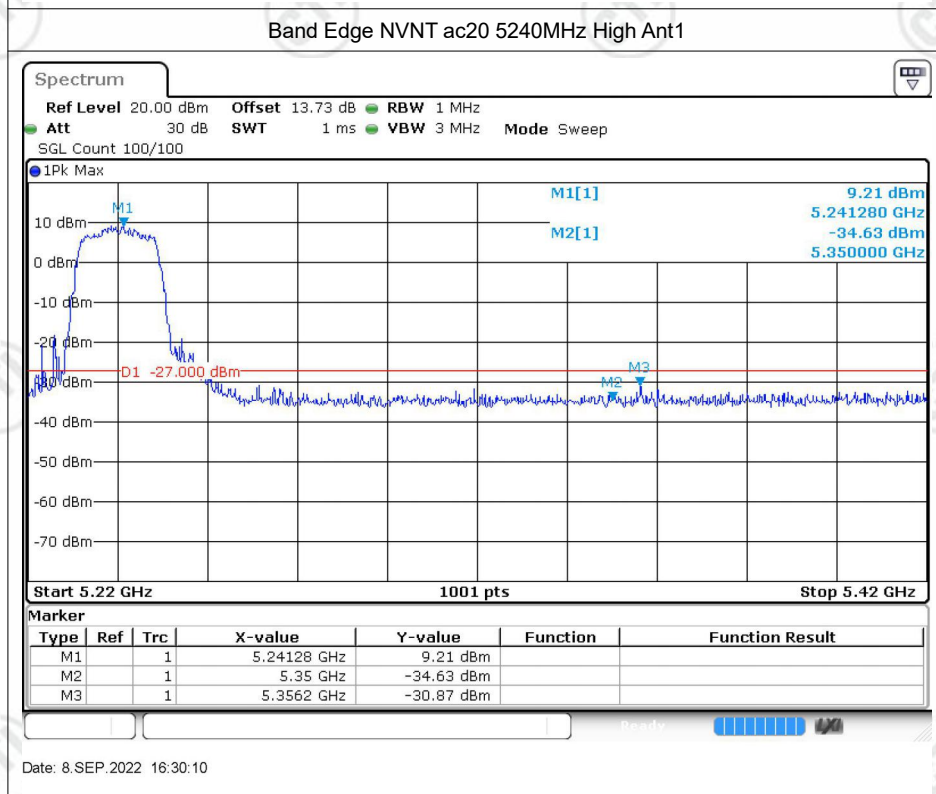


Date: 8.SEP.2022 16:30:10

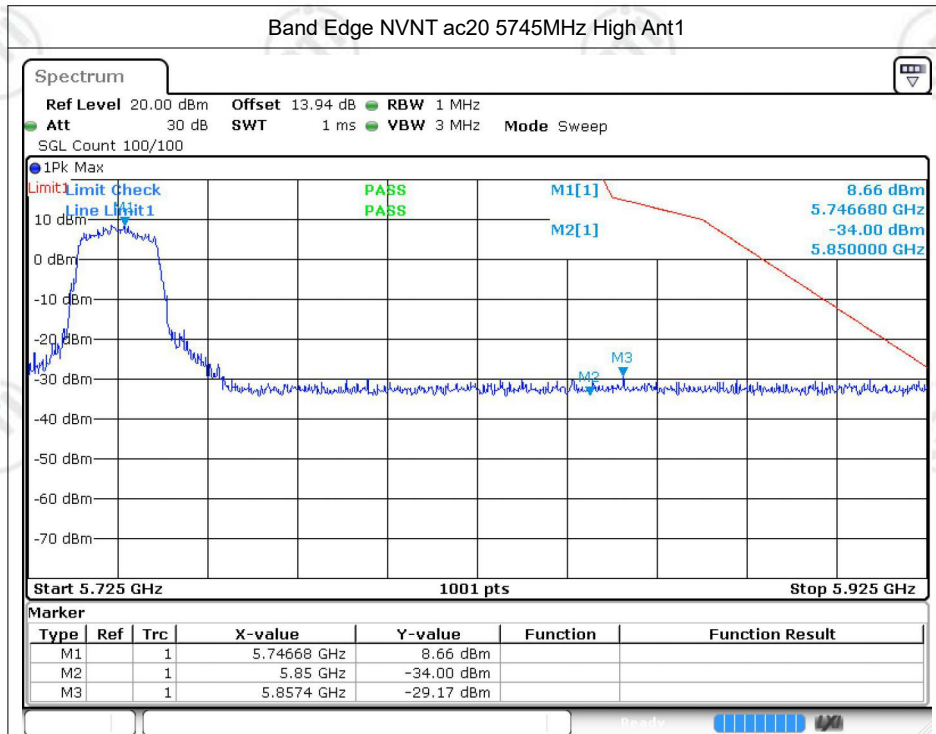


Date: 8.SEP.2022 16:40:28

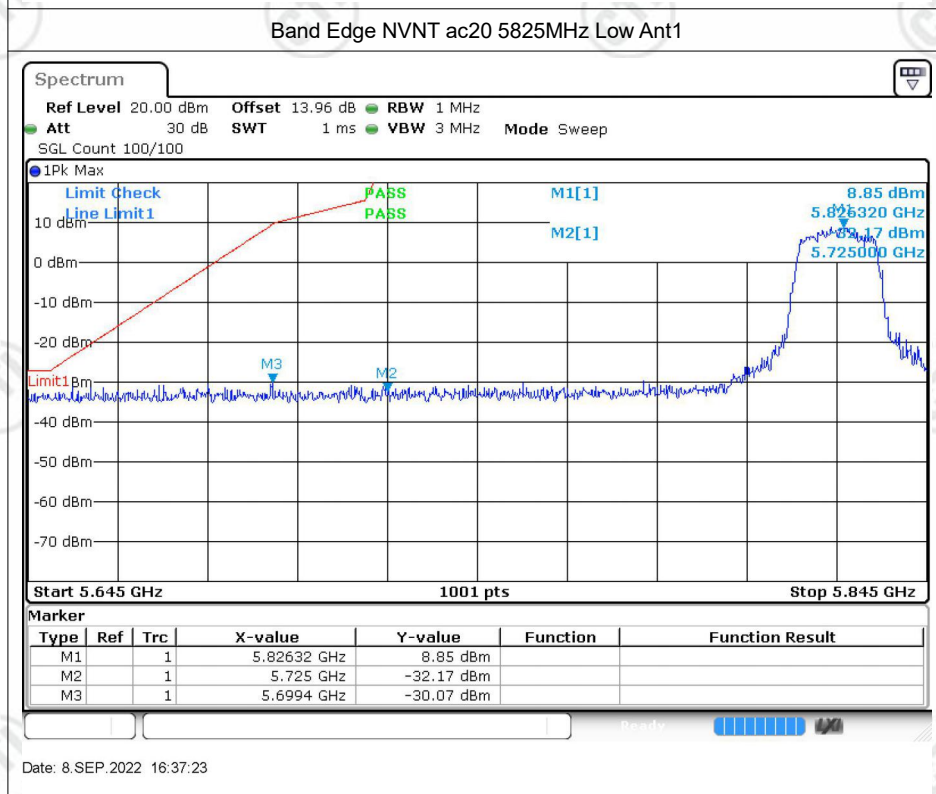


Date: 8.SEP.2022 16:37:23

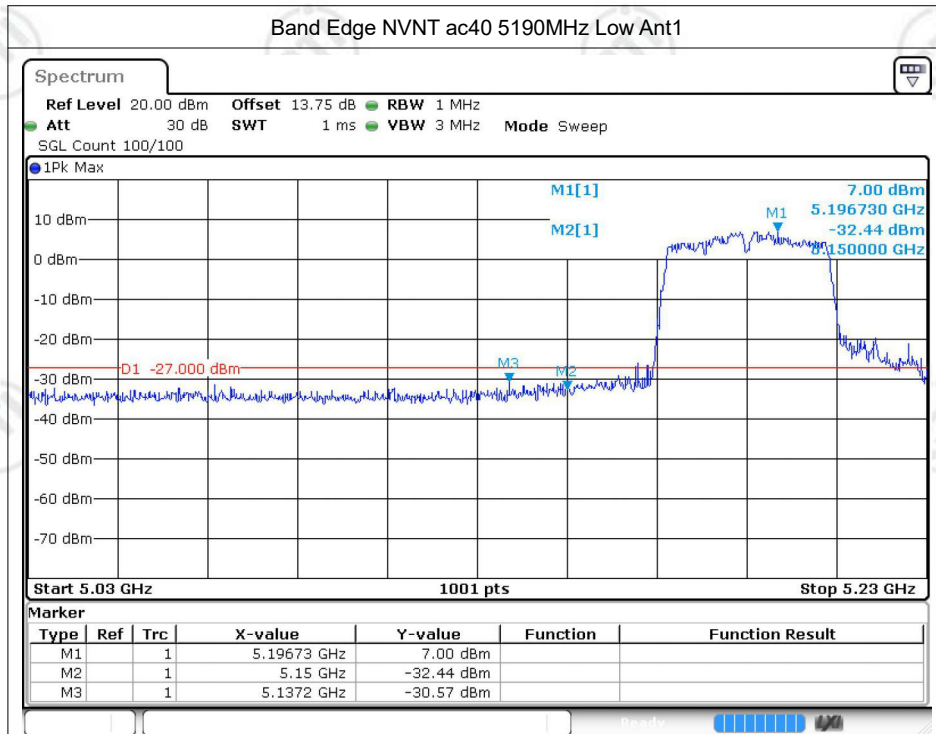


Date: 8.SEP.2022 16:45:46

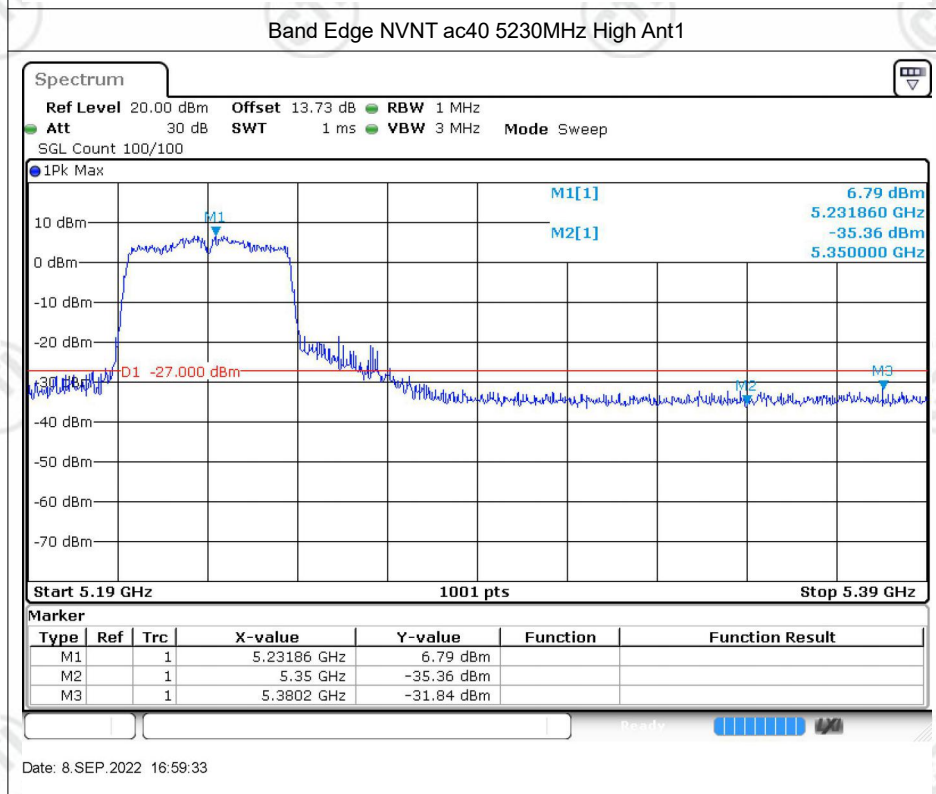


Date: 8.SEP.2022 16:59:33

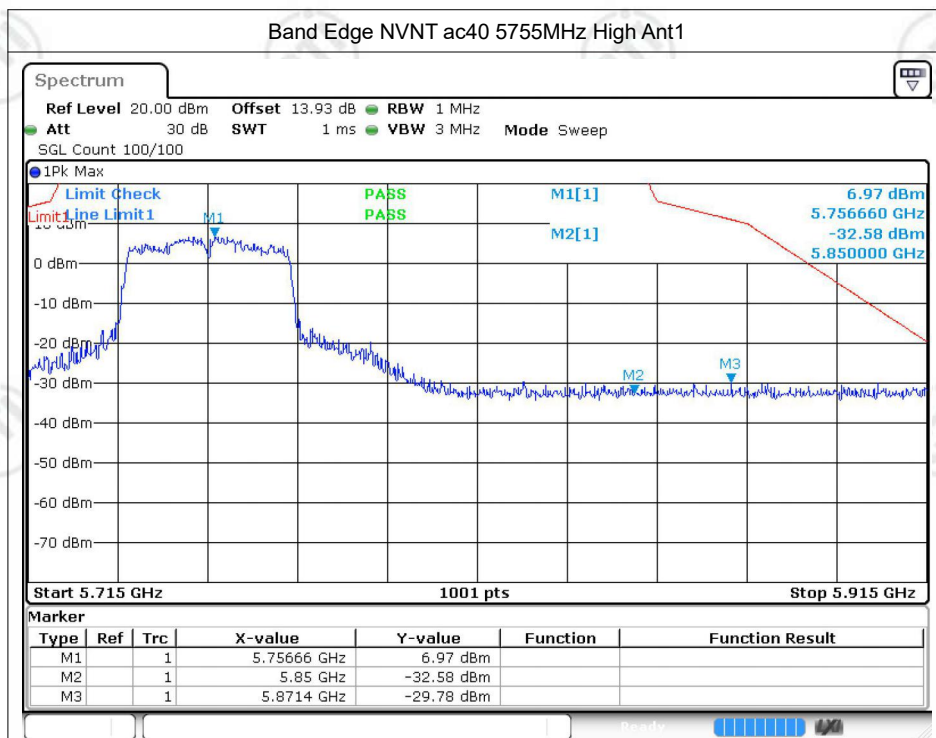


Date: 8.SEP.2022 17:02:38

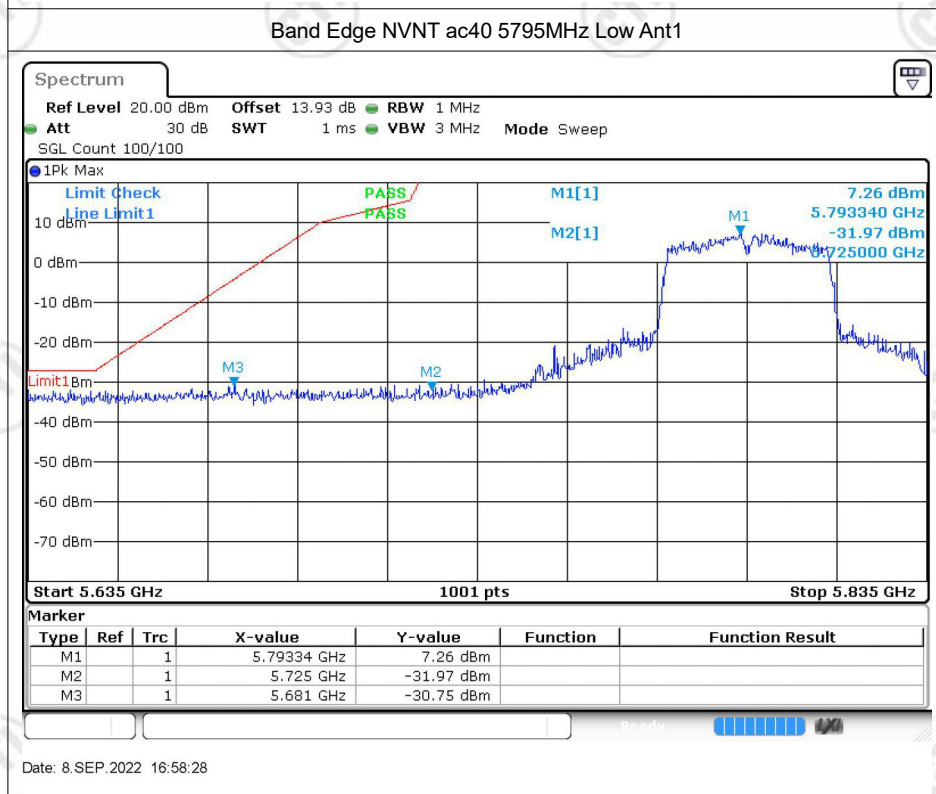

Date: 8.SEP.2022 16:58:28

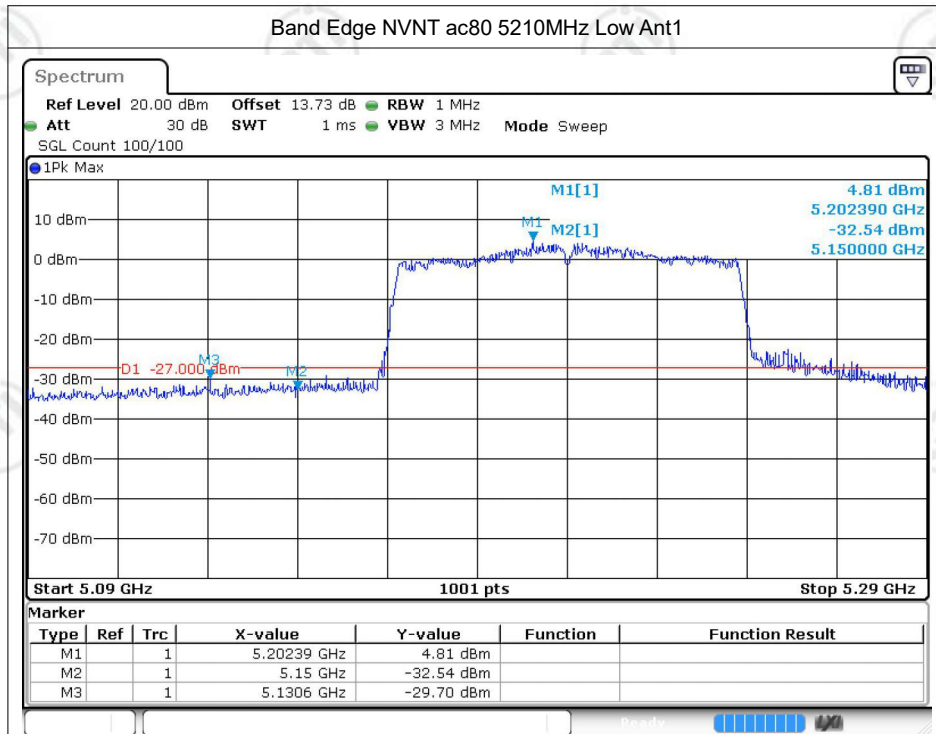

Date: 8.SEP.2022 17:06:54

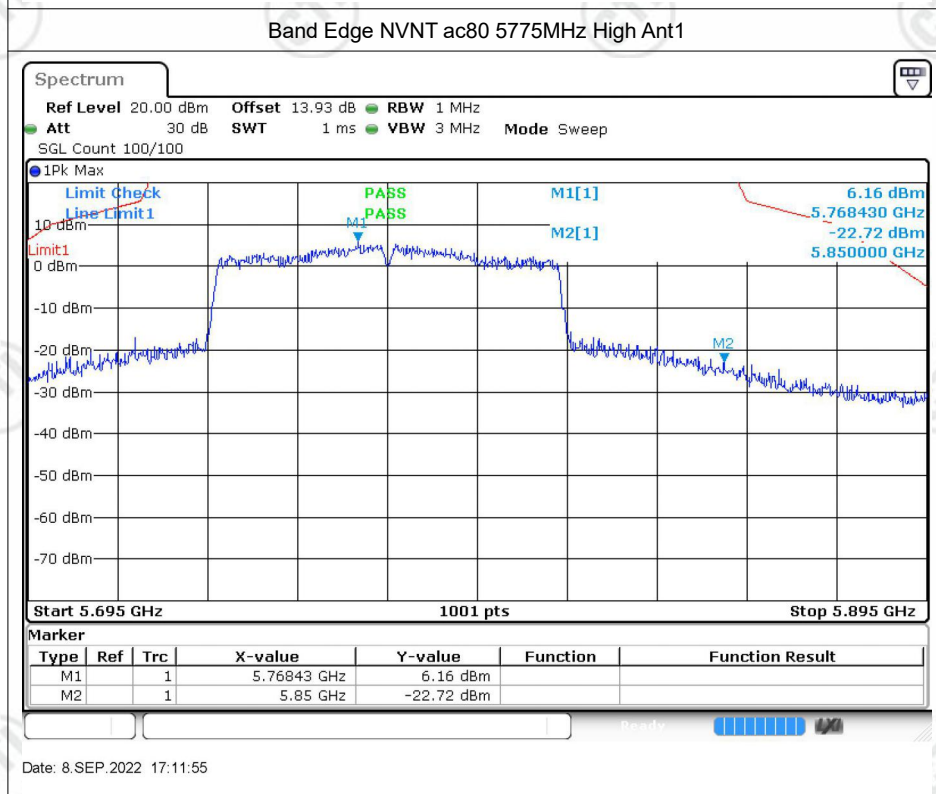

Date: 8.SEP.2022 17:11:55

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 120V	a	5180	Ant1	5180	0	0	25	Pass
20C 138V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
-20C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	a	5180	Ant1	5180	0	0	25	Pass
10C 120V	a	5180	Ant1	5180	0	0	25	Pass
30C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	a	5180	Ant1	5180	0	0	25	Pass
50C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 102V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	a	5240	Ant1	5240	0	0	25	Pass
-20C 120V	a	5240	Ant1	5240	0	0	25	Pass
-10C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
0C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
10C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
40C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
50C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 138V	a	5745	Ant1	5745	0	0	25	Pass
-20C 120V	a	5745	Ant1	5745	0	0	25	Pass
-10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
50C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 102V	a	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 138V	a	5825	Ant1	5825	0	0	25	Pass
-20C 120V	a	5825	Ant1	5825	0	0	25	Pass
-10C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
0C 120V	a	5825	Ant1	5825	0	0	25	Pass
10C 120V	a	5825	Ant1	5825	0	0	25	Pass


30C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
50C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 102V	n20	5180	Ant1	5180	0	0	25	Pass
20C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 138V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	Ant1	5180	0	0	25	Pass
-10C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	n20	5180	Ant1	5180	0	0	25	Pass
10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	n20	5180	Ant1	5180	0	0	25	Pass
40C 120V	n20	5180	Ant1	5180	0	0	25	Pass
50C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 102V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	Ant1	5240	0	0	25	Pass
20C 138V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
-20C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	Ant1	5240	0	0	25	Pass
0C 120V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
10C 120V	n20	5240	Ant1	5240	0	0	25	Pass
30C 120V	n20	5240	Ant1	5240	0	0	25	Pass
40C 120V	n20	5240	Ant1	5240	0	0	25	Pass
50C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	5745	Ant1	5745	0	0	25	Pass
20C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 138V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
-20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
0C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
30C 120V	n20	5745	Ant1	5745	0	0	25	Pass
40C 120V	n20	5745	Ant1	5745	0	0	25	Pass
50C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 102V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 138V	n20	5825	Ant1	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
-10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
0C 120V	n20	5825	Ant1	5825	0	0	25	Pass
10C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass



40C 120V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
50C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 102V	n40	5190	Ant1	5190	0	0	25	Pass
20C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 138V	n40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
0C 120V	n40	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
50C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 102V	n40	5230	Ant1	5230	0	0	25	Pass
20C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 138V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
-10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
0C 120V	n40	5230	Ant1	5230	0	0	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230	0	0	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 102V	n40	5755	Ant1	5755	0	0	25	Pass
20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 138V	n40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
30C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant1	5755	0	0	25	Pass
50C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795	0	0	25	Pass



50C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 102V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 120V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 138V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
-20C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
10C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
40C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
50C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 102V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 138V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
50C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 102V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	ac20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
-10C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
0C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
10C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
30C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
50C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 102V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 138V	ac20	5825	Ant1	5825	0	0	25	Pass
-20C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
0C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
10C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
30C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
50C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass


20C 102V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
-20C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
-10C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
0C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
10C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
40C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 138V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
-20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
40C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
50C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 102V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
40C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass

20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210.32	320000	61.42	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass

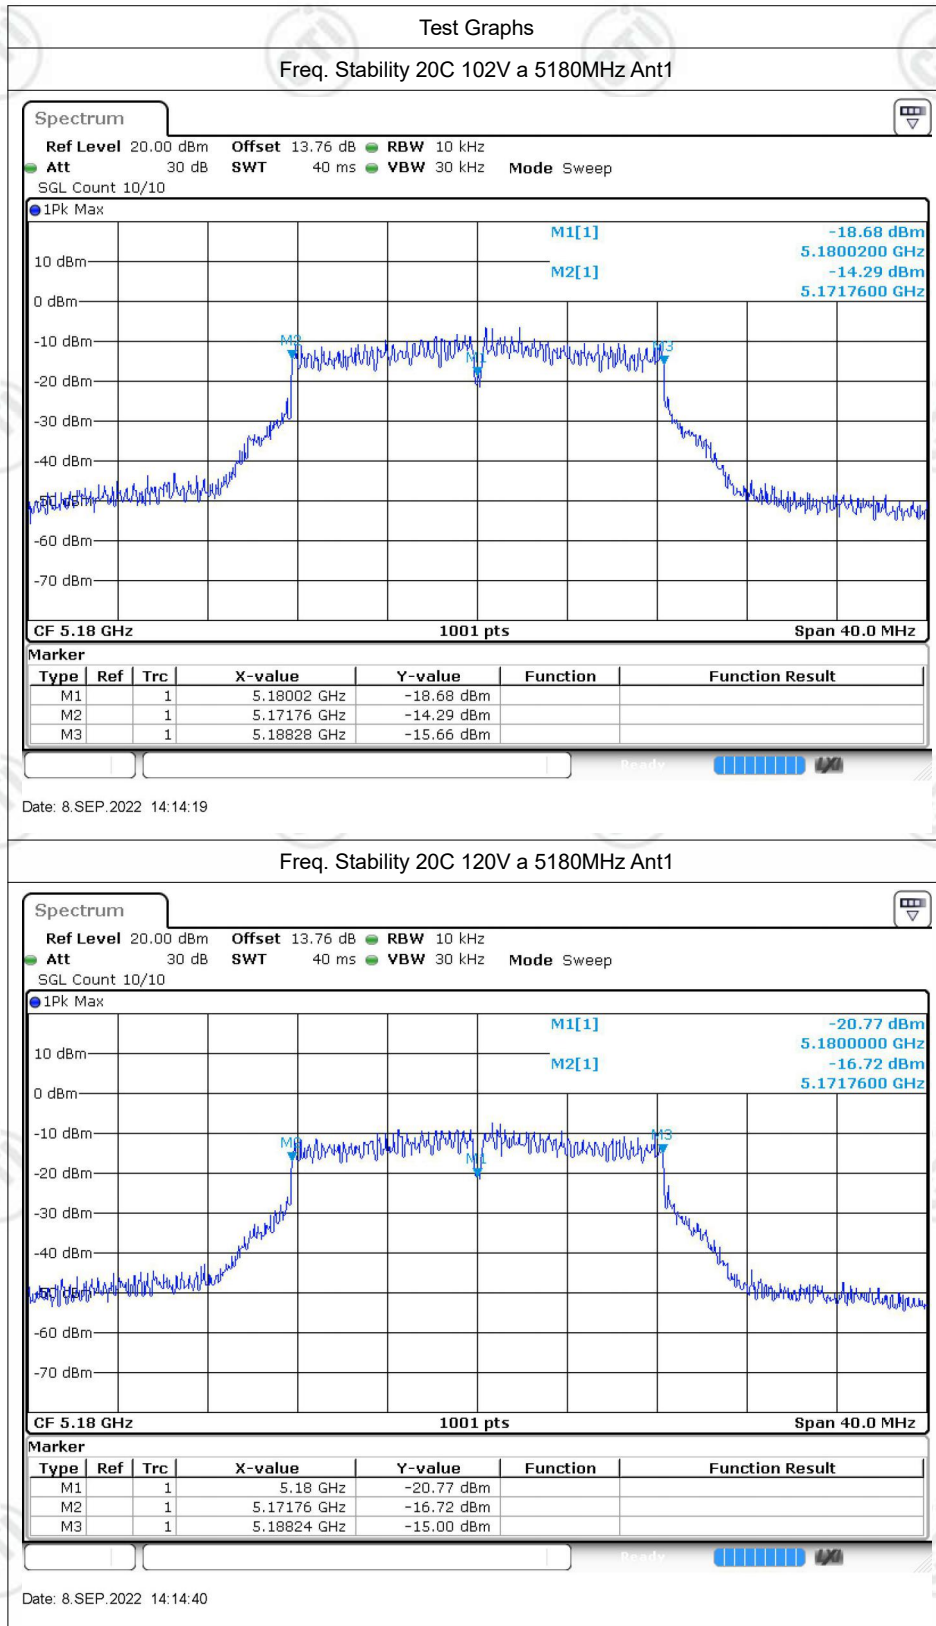


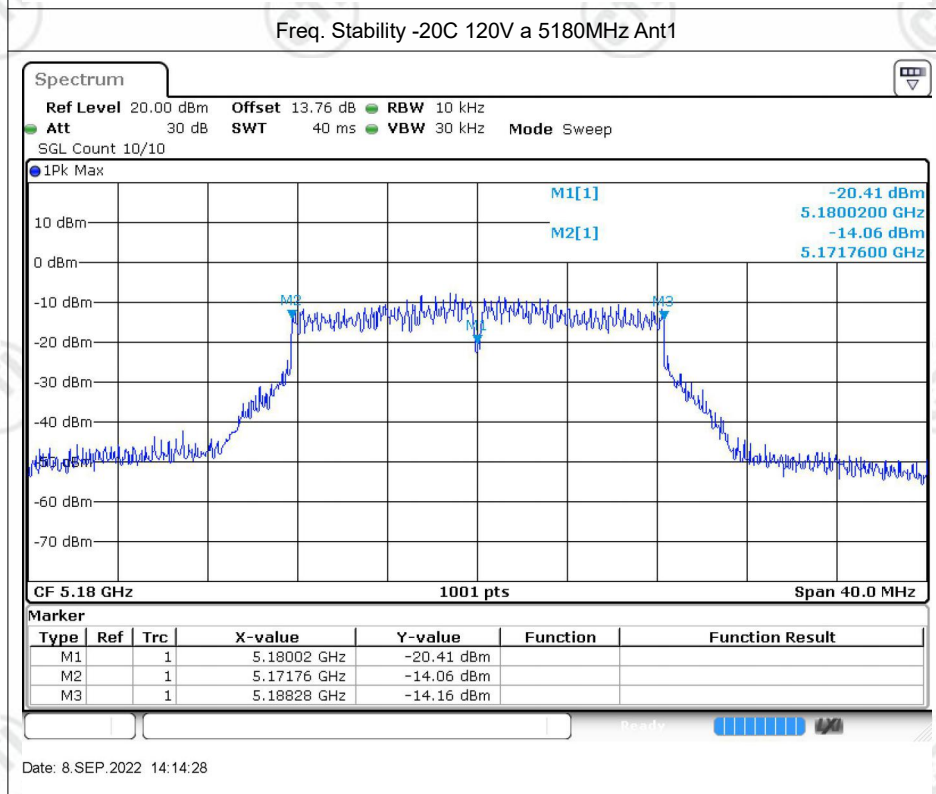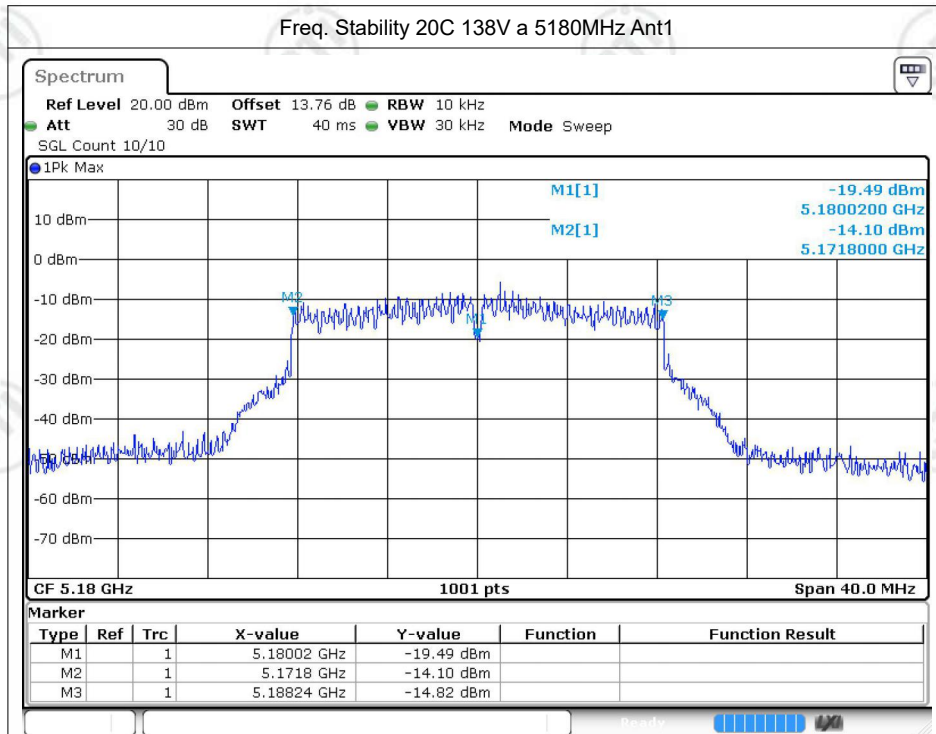

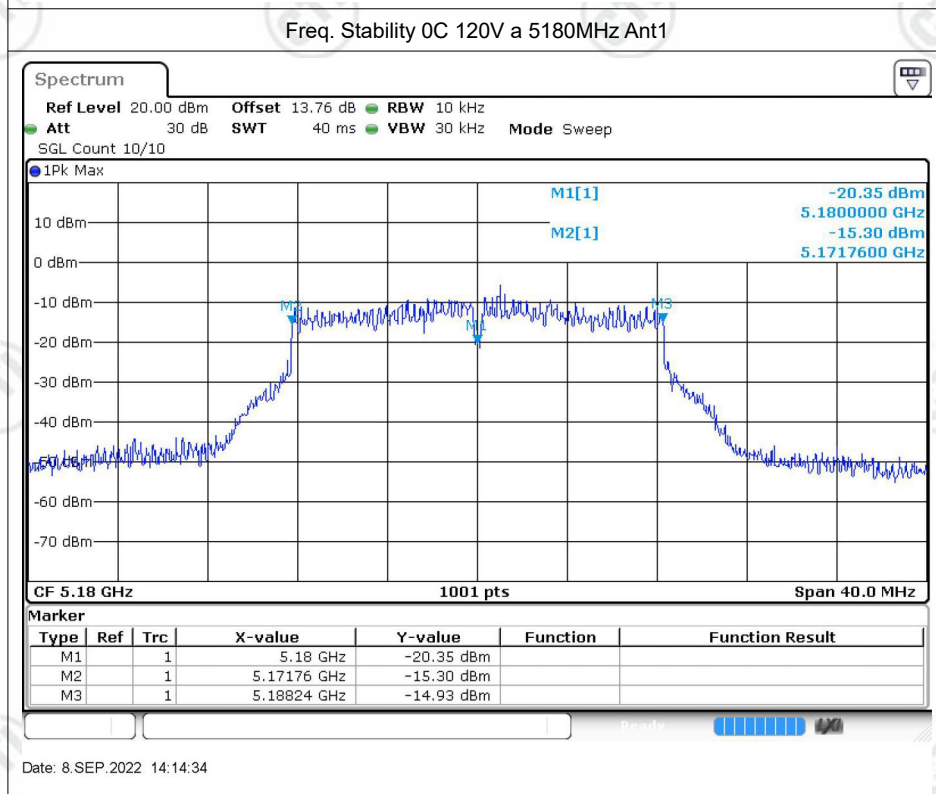
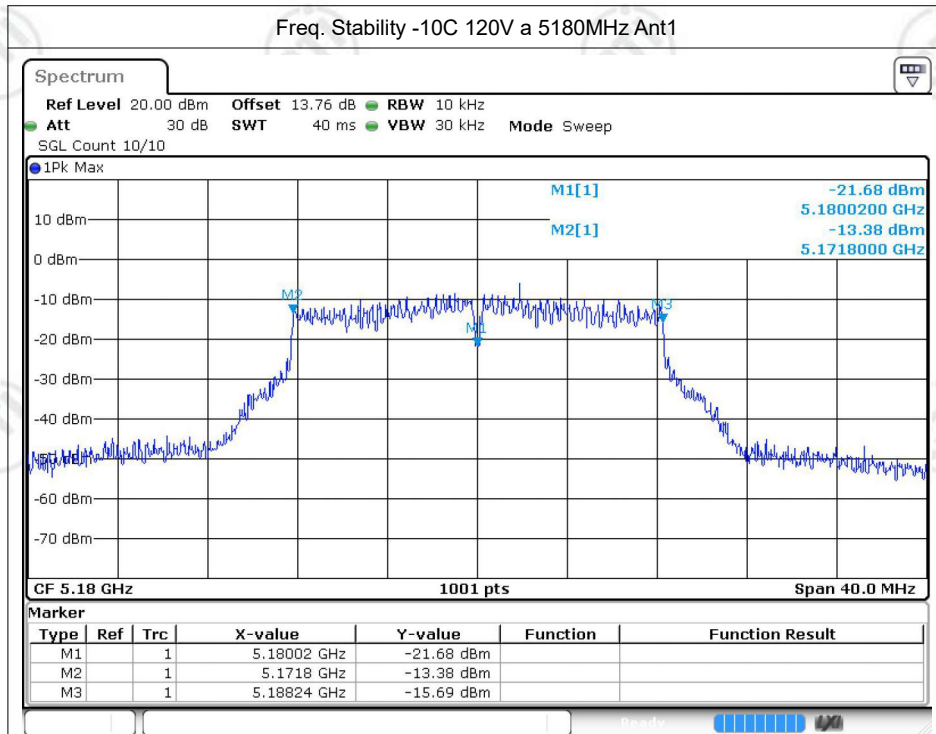



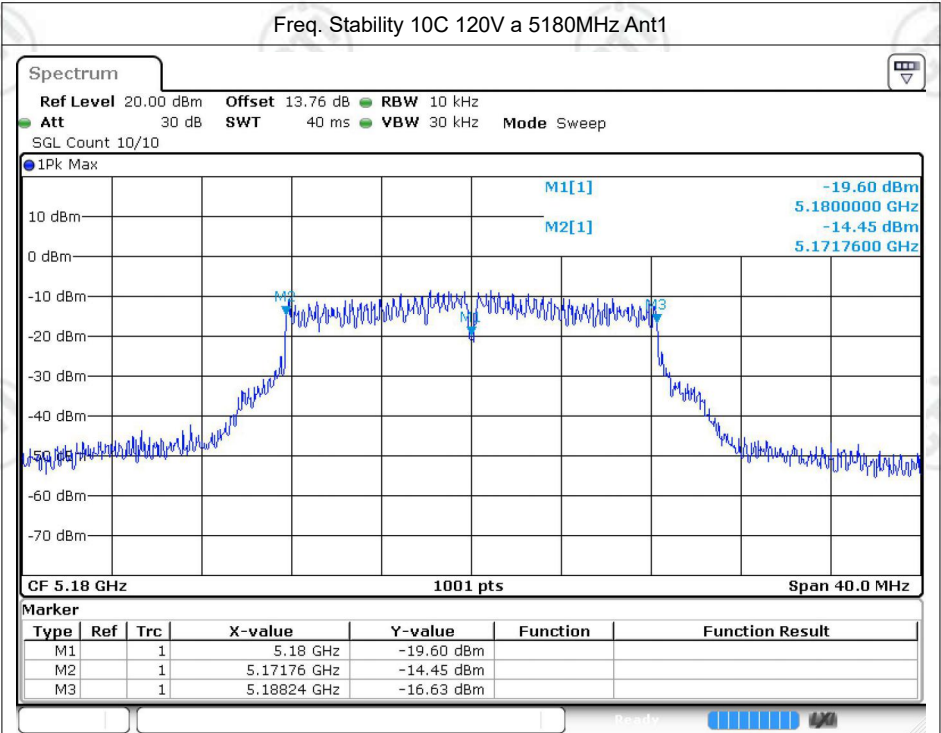




Date: 8.SEP.2022 14:14:37


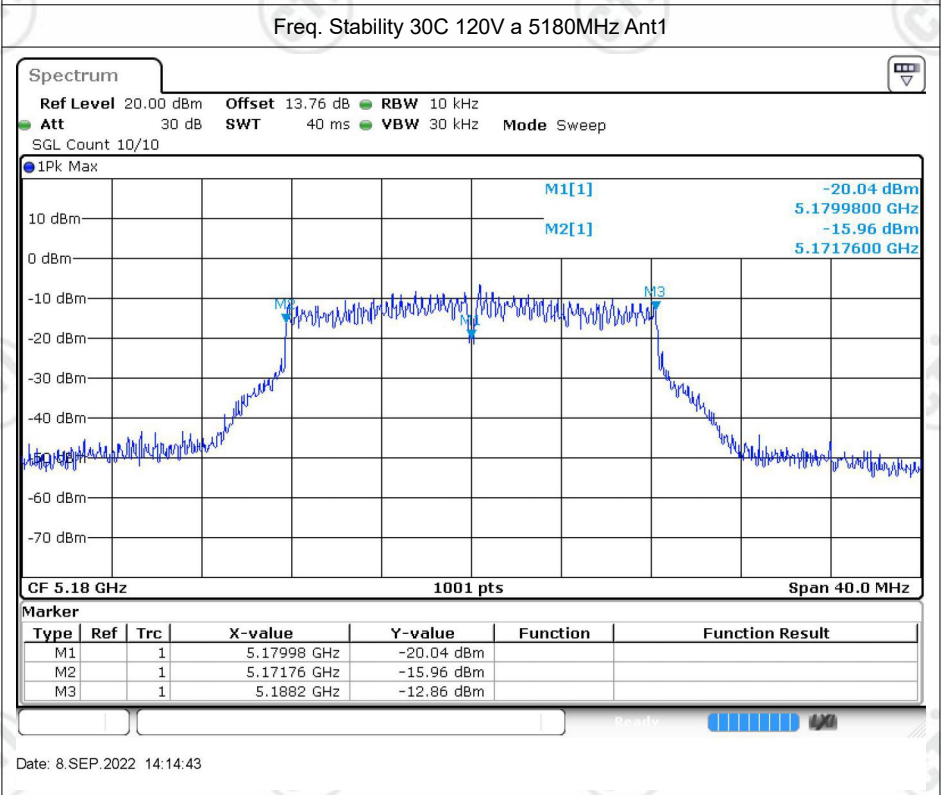



Date: 8.SEP.2022 14:14:43

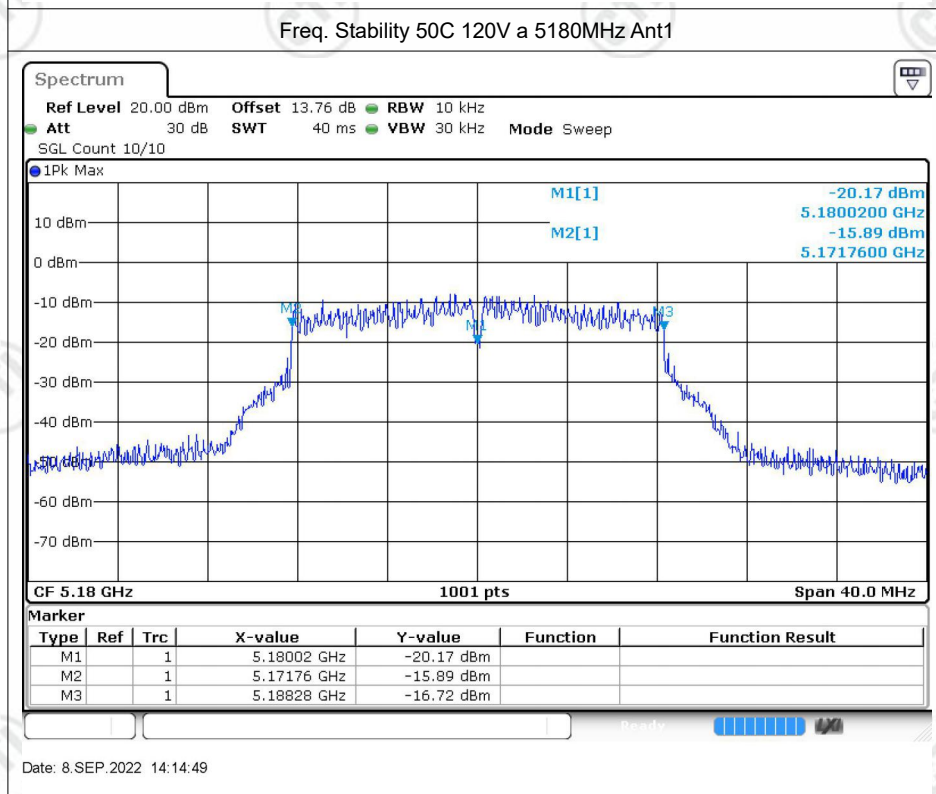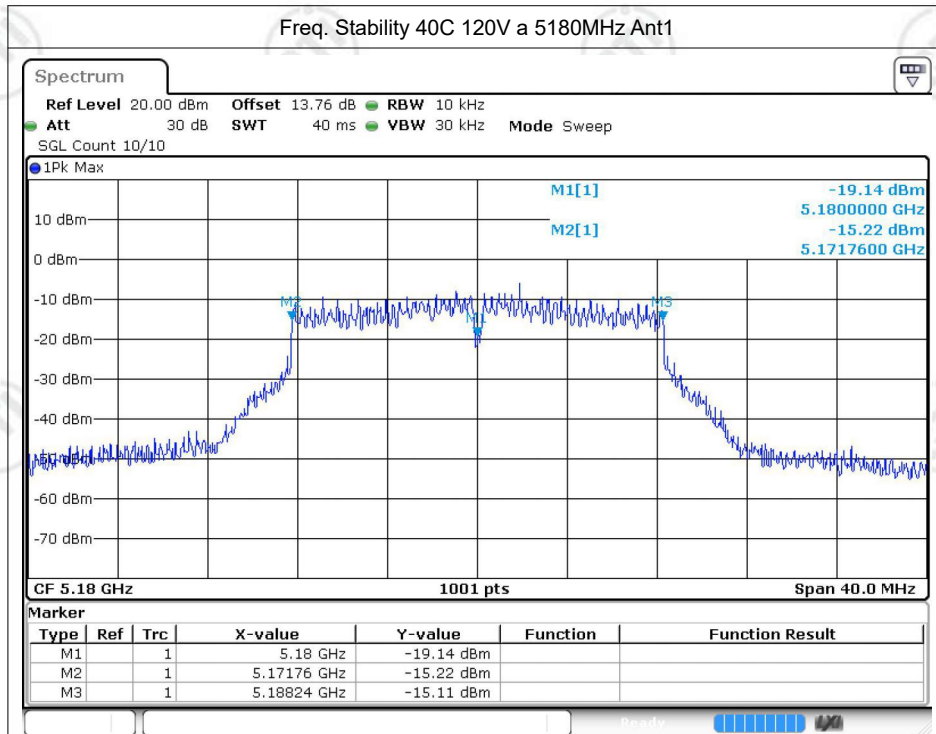

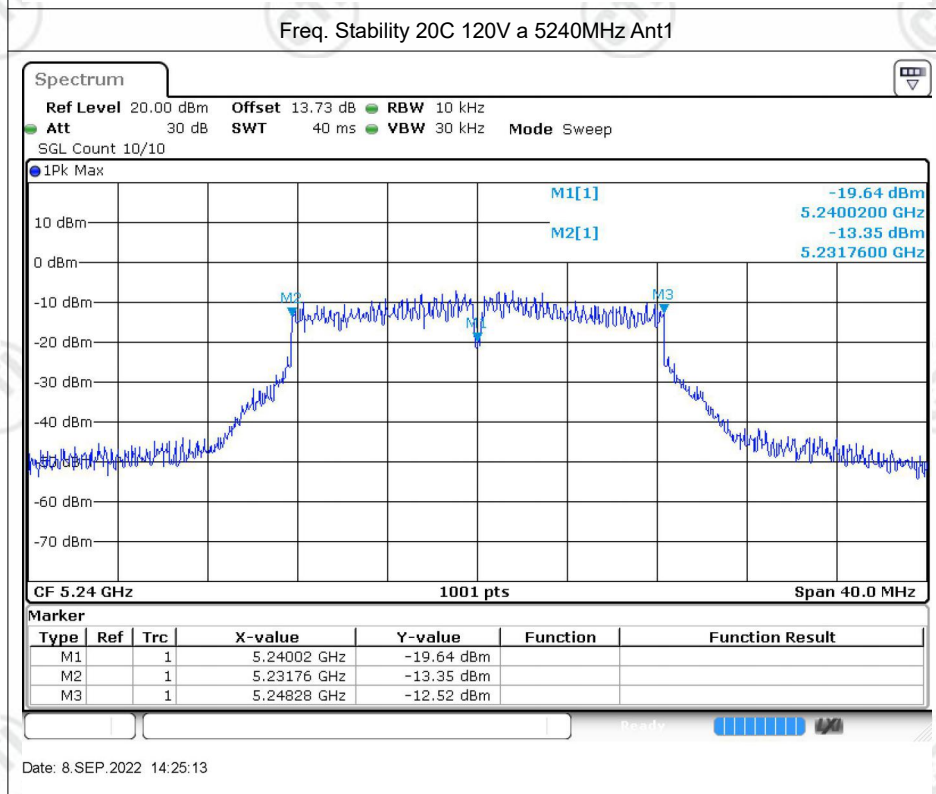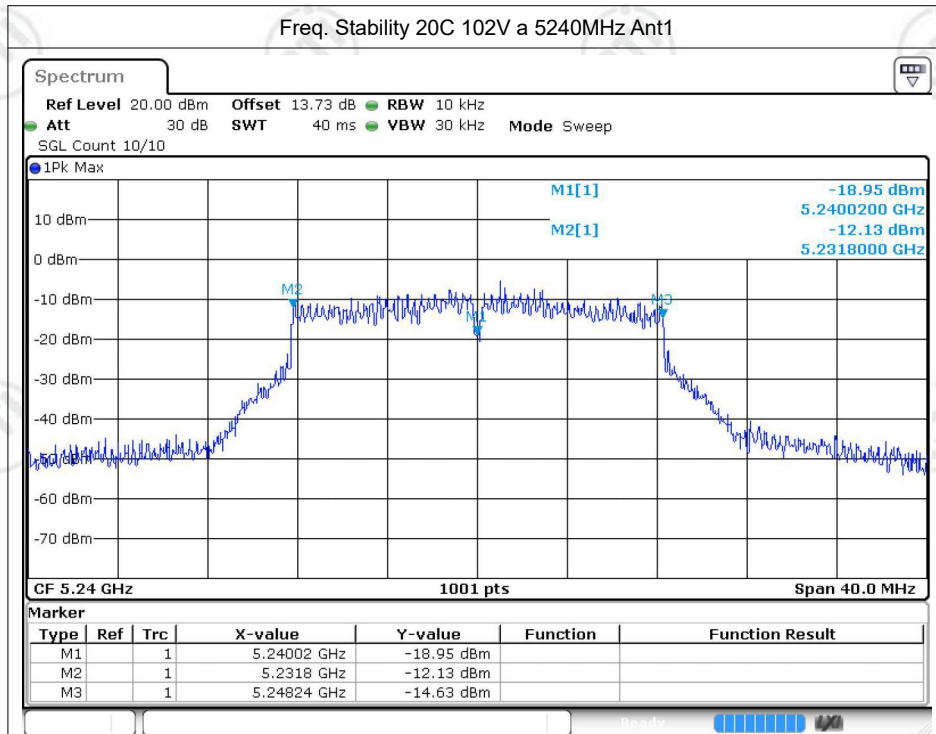


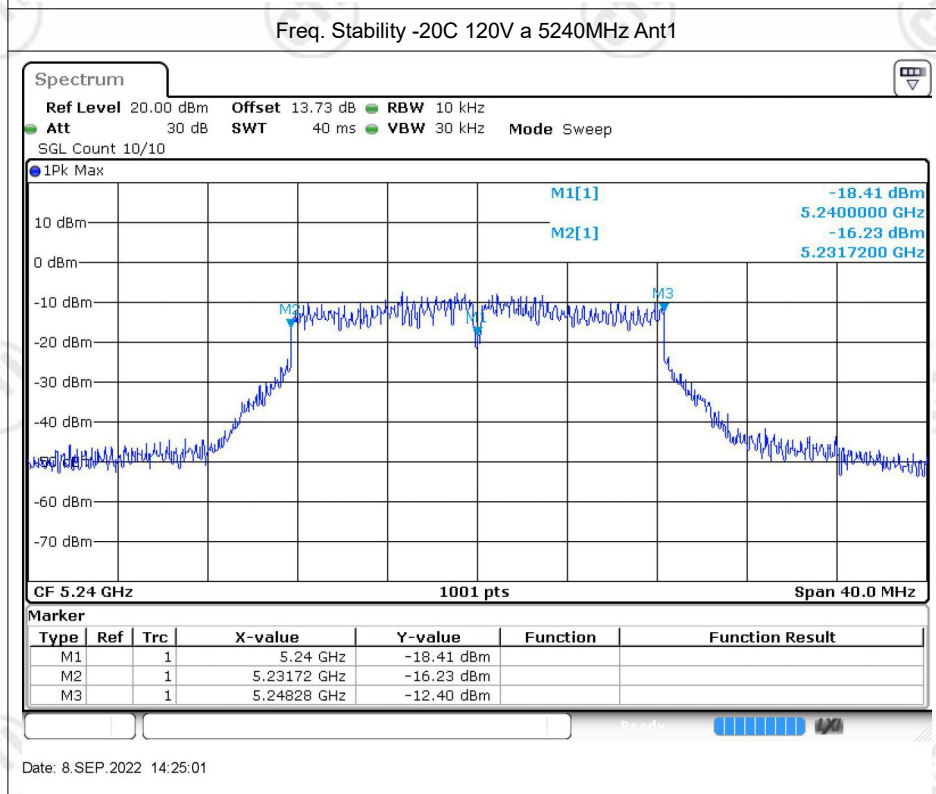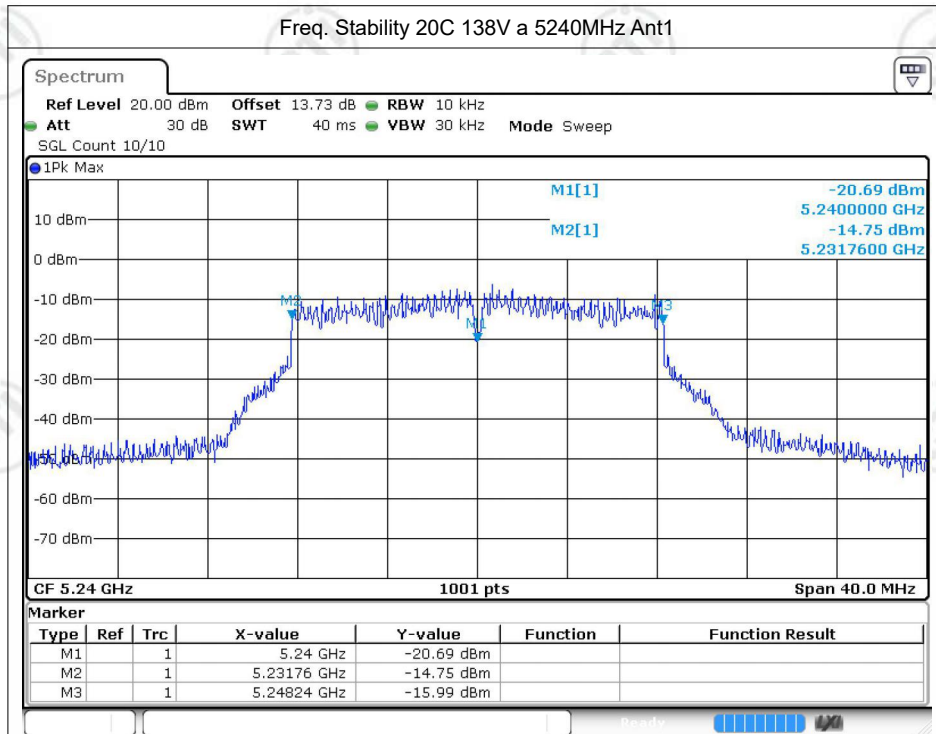

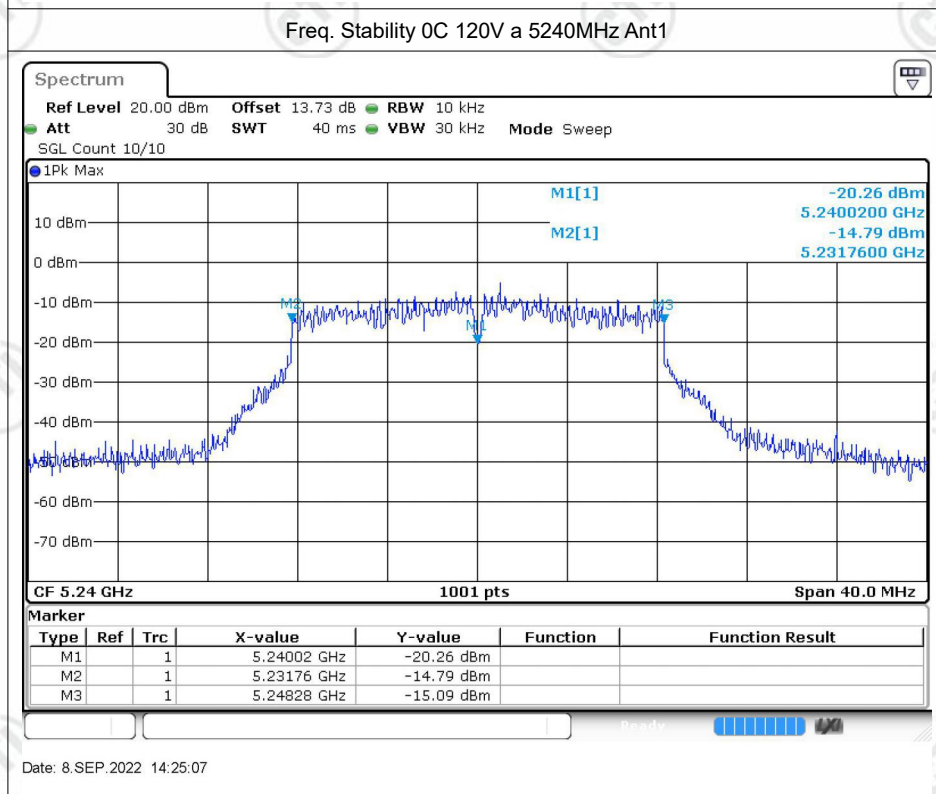
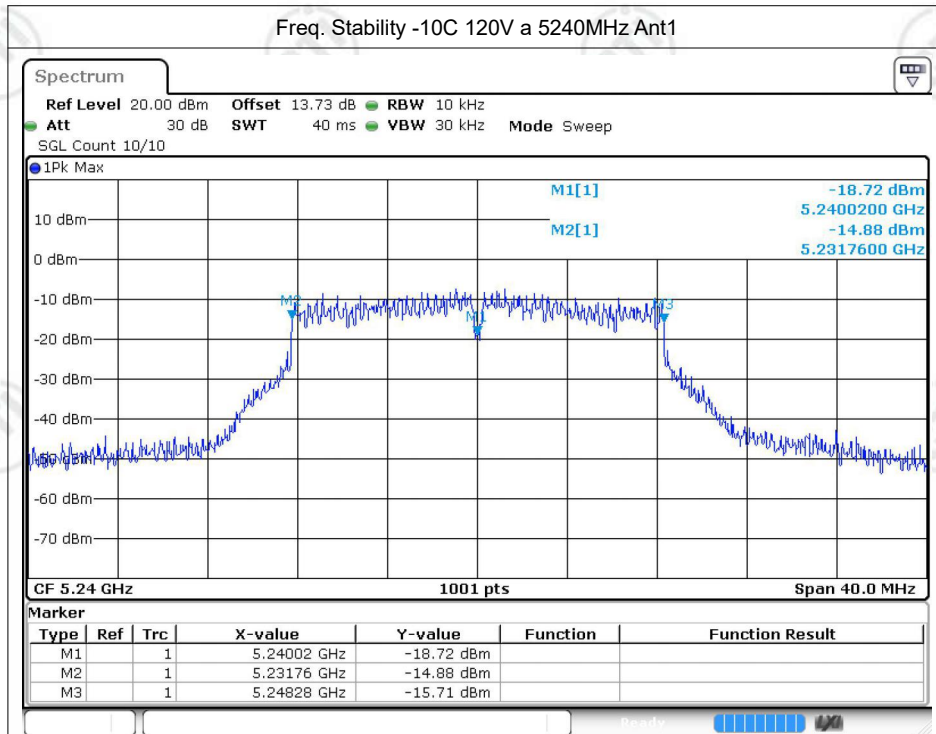



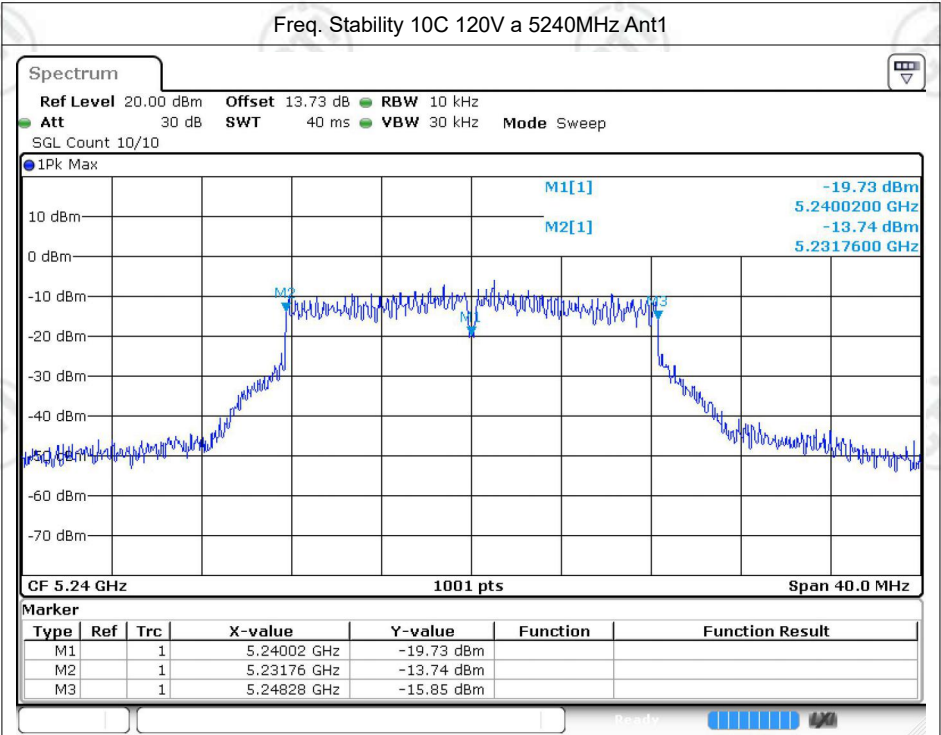



Date: 8.SEP.2022 14:25:10

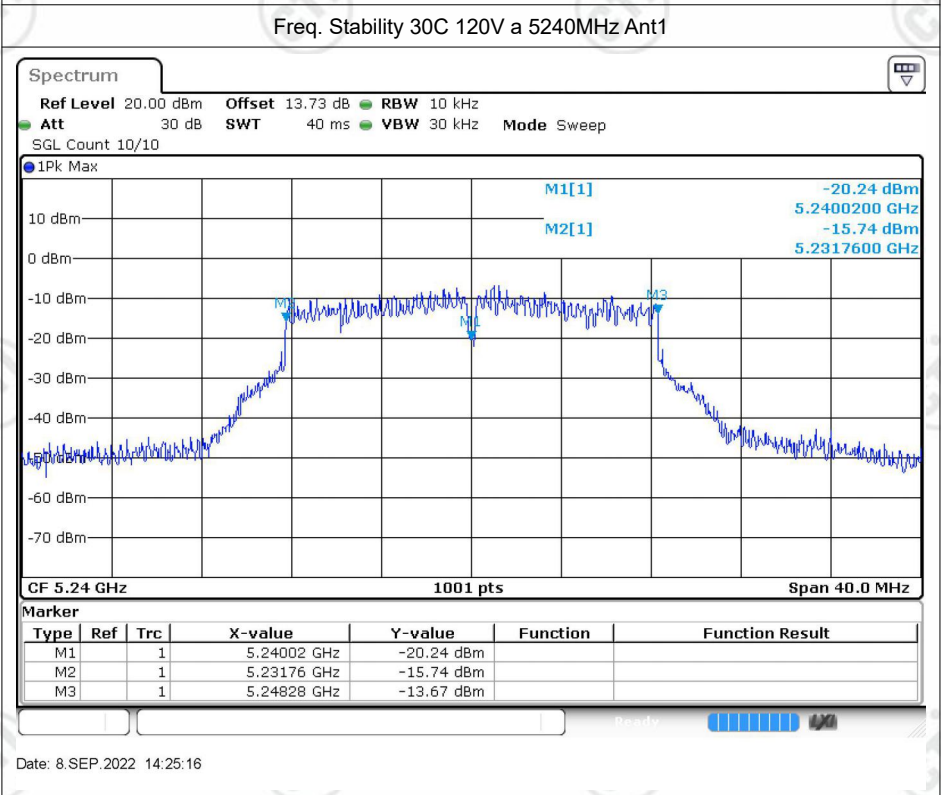


Date: 8.SEP.2022 14:25:16

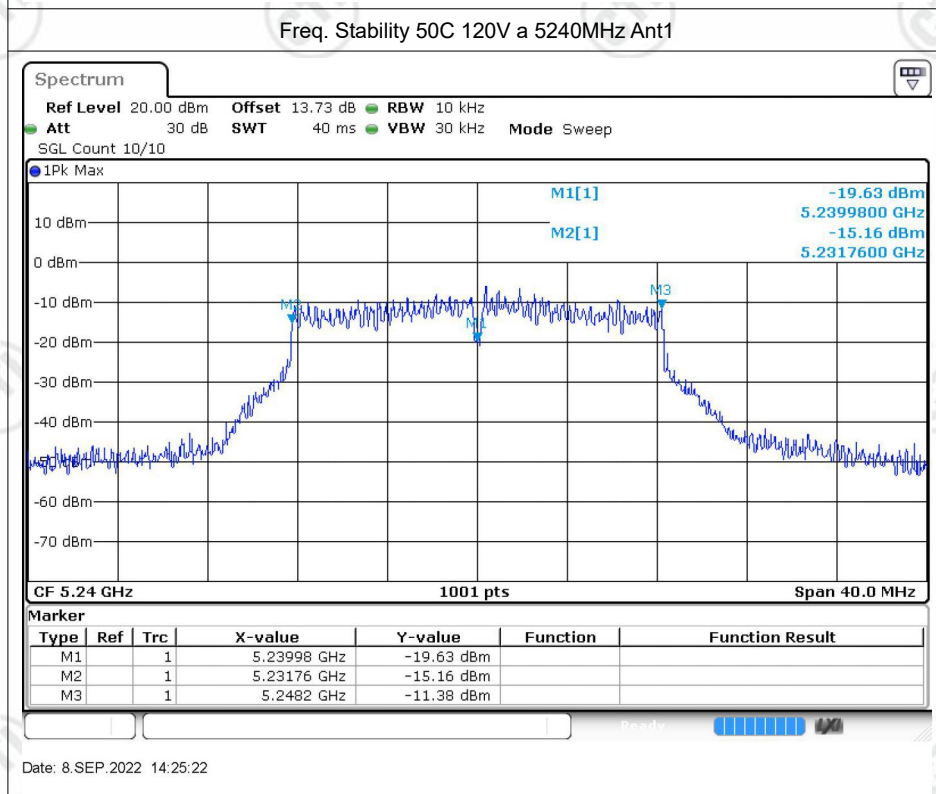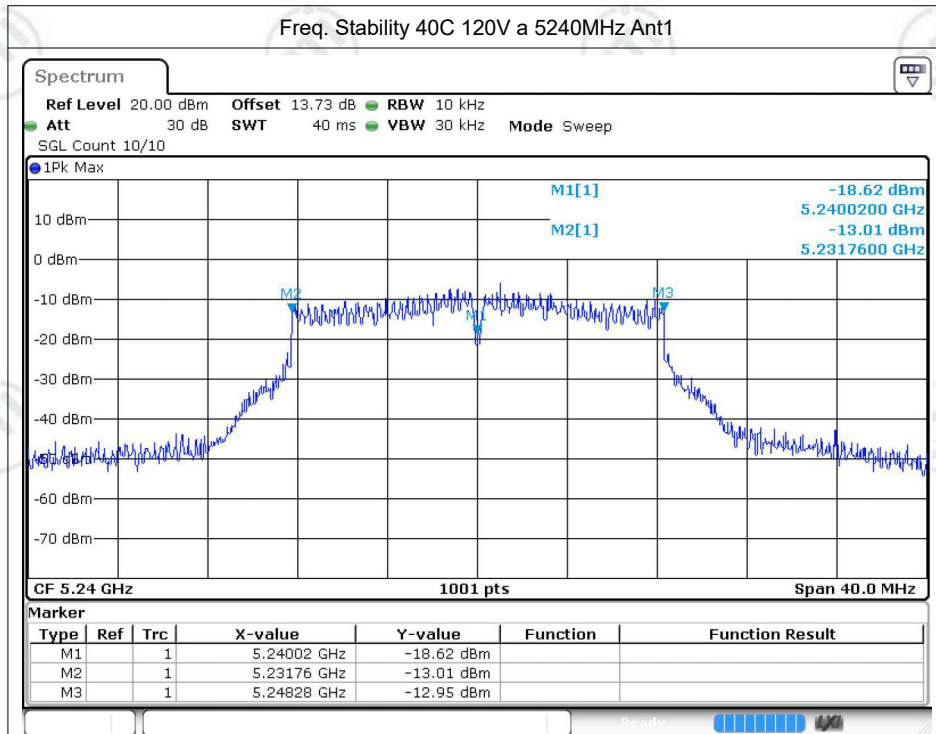

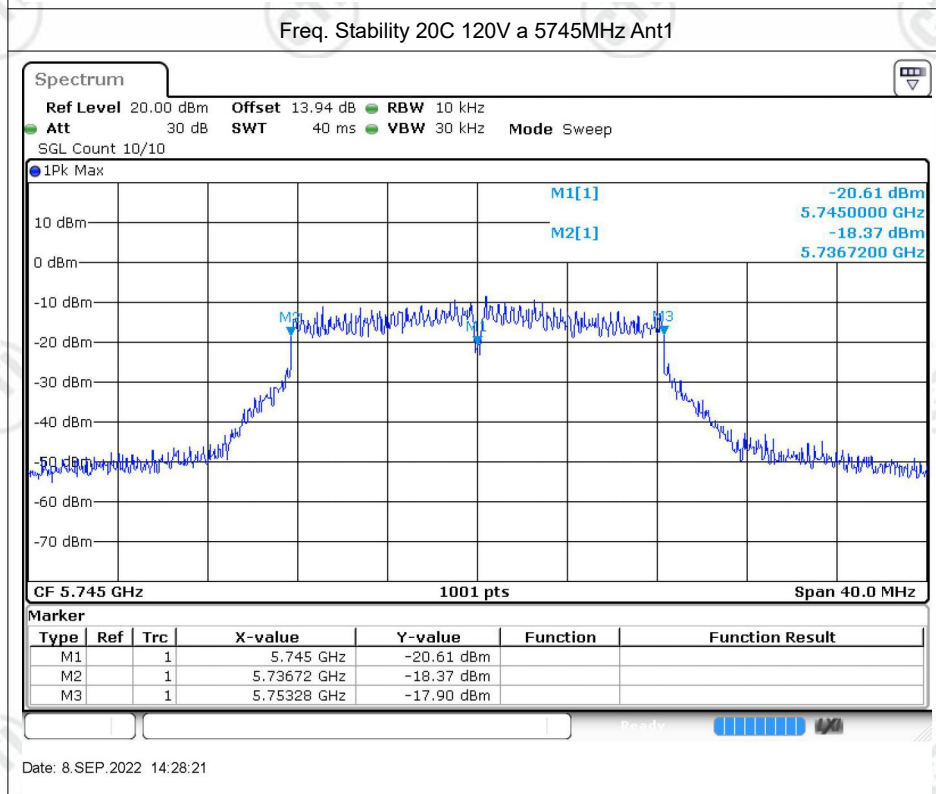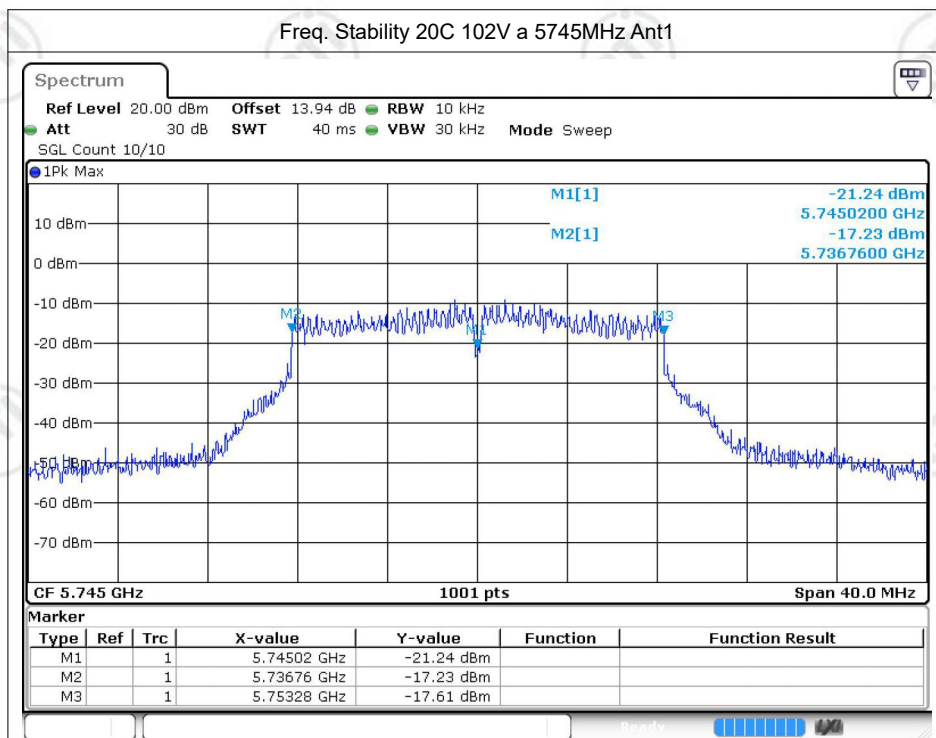

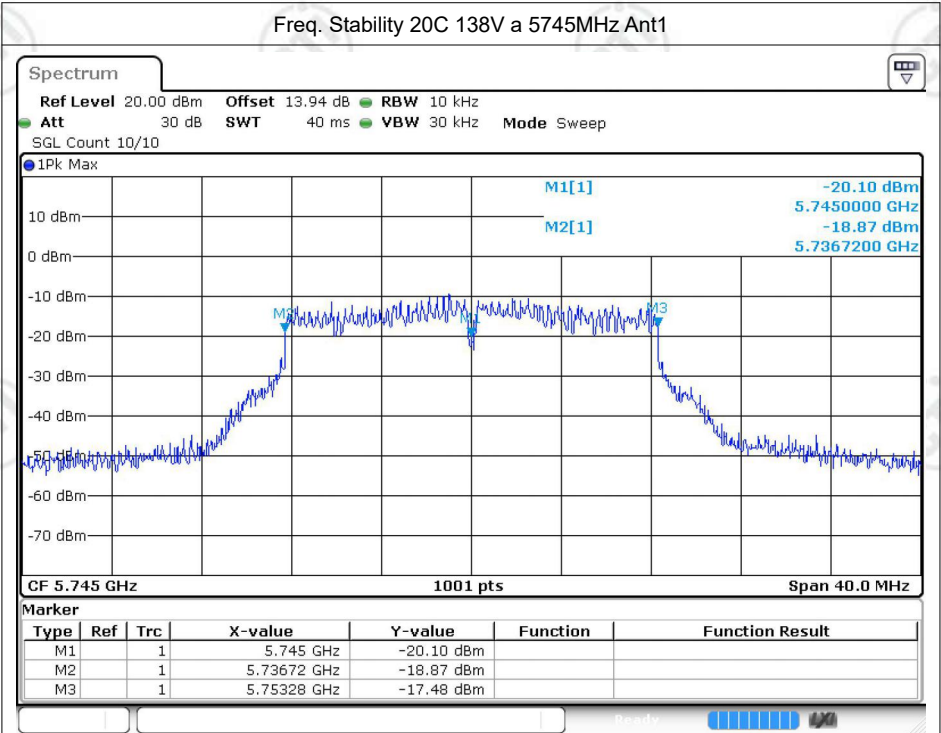

Date: 8.SEP.2022 14:28:06

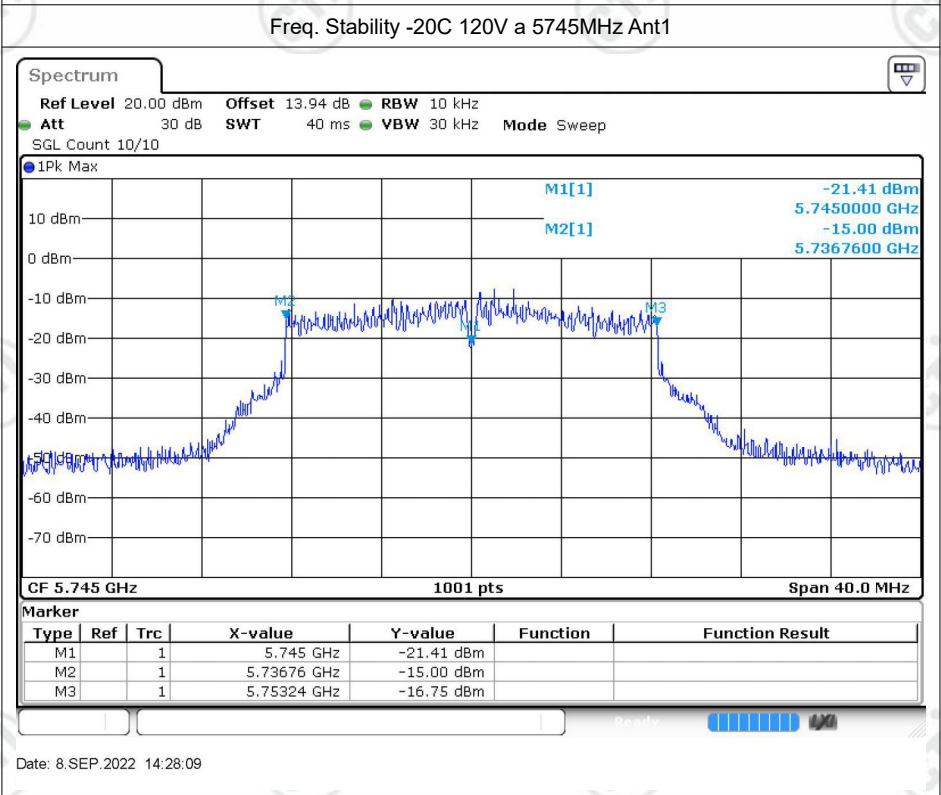

Date: 8.SEP.2022 14:28:09