



NVNT	n40	5755	Ant7	5725	-45.82	2	2.6	-41.22	Average	27	Pass
NVNT	n40	5795	Ant7	5850	-46.05	2	-	-44.05	Peak	27	Pass
NVNT	n40	5795	Ant7	5850	-55.08	2	2.61	-50.47	Average	27	Pass
NVNT	n40	5795	Ant7	5855	-47.28	2	-	-45.28	Peak	15.6	Pass
NVNT	n40	5795	Ant7	5855	-55.36	2	2.61	-50.75	Average	15.6	Pass
NVNT	n40	5795	Ant7	5875	-48.25	2	-	-46.25	Peak	10	Pass
NVNT	n40	5795	Ant7	5875	-56.62	2	2.61	-52.01	Average	10	Pass
NVNT	n40	5795	Ant7	5925	-49.76	2	-	-47.76	Peak	-27	Pass
NVNT	n40	5795	Ant7	5925	-57.02	2	2.61	-52.41	Average	-27	Pass
NVNT	ac20	5745	Ant7	5650	-48.44	2	-	-46.44	Peak	-27	Pass
NVNT	ac20	5745	Ant7	5650	-56.23	2	2.58	-51.65	Average	-27	Pass
NVNT	ac20	5745	Ant7	5700	-45.58	2	-	-43.58	Peak	10	Pass
NVNT	ac20	5745	Ant7	5700	-55.13	2	2.58	-50.55	Average	10	Pass
NVNT	ac20	5745	Ant7	5720	-33.4	2	-	-31.4	Peak	15.6	Pass
NVNT	ac20	5745	Ant7	5720	-48.96	2	2.58	-44.38	Average	15.6	Pass
NVNT	ac20	5745	Ant7	5725	-36.64	2	-	-34.64	Peak	27	Pass
NVNT	ac20	5745	Ant7	5725	-47.13	2	2.58	-42.55	Average	27	Pass
NVNT	ac20	5825	Ant7	5850	-39.86	2	-	-37.86	Peak	27	Pass
NVNT	ac20	5825	Ant7	5850	-51.68	2	2.45	-47.23	Average	27	Pass
NVNT	ac20	5825	Ant7	5855	-43.23	2	-	-41.23	Peak	15.6	Pass
NVNT	ac20	5825	Ant7	5855	-53.57	2	2.45	-49.12	Average	15.6	Pass
NVNT	ac20	5825	Ant7	5875	-48.81	2	-	-46.81	Peak	10	Pass
NVNT	ac20	5825	Ant7	5875	-56.76	2	2.45	-52.31	Average	10	Pass
NVNT	ac20	5825	Ant7	5925	-49.78	2	-	-47.78	Peak	-27	Pass
NVNT	ac20	5825	Ant7	5925	-56.65	2	2.45	-52.2	Average	-27	Pass
NVNT	ac40	5755	Ant7	5650	-46.56	2	-	-44.56	Peak	-27	Pass
NVNT	ac40	5755	Ant7	5650	-56.18	2	2.71	-51.47	Average	-27	Pass
NVNT	ac40	5755	Ant7	5700	-42.58	2	-	-40.58	Peak	10	Pass
NVNT	ac40	5755	Ant7	5700	-54	2	2.71	-49.29	Average	10	Pass
NVNT	ac40	5755	Ant7	5720	-36.37	2	-	-34.37	Peak	15.6	Pass
NVNT	ac40	5755	Ant7	5720	-48.01	2	2.71	-43.3	Average	15.6	Pass
NVNT	ac40	5755	Ant7	5725	-30.41	2	-	-28.41	Peak	27	Pass
NVNT	ac40	5755	Ant7	5725	-46.73	2	2.71	-42.02	Average	27	Pass
NVNT	ac40	5795	Ant7	5850	-46.22	2	-	-44.22	Peak	27	Pass
NVNT	ac40	5795	Ant7	5850	-55.78	2	2.5	-51.28	Average	27	Pass
NVNT	ac40	5795	Ant7	5855	-47.64	2	-	-45.64	Peak	15.6	Pass
NVNT	ac40	5795	Ant7	5855	-55.69	2	2.5	-51.19	Average	15.6	Pass
NVNT	ac40	5795	Ant7	5875	-46.69	2	-	-44.69	Peak	10	Pass
NVNT	ac40	5795	Ant7	5875	-56.66	2	2.5	-52.16	Average	10	Pass
NVNT	ac40	5795	Ant7	5925	-47.91	2	-	-45.91	Peak	-27	Pass
NVNT	ac40	5795	Ant7	5925	-57.21	2	2.5	-52.71	Average	-27	Pass
NVNT	ac80	5775	Ant7	5850	-38.6	2	-	-36.6	Peak	27	Pass
NVNT	ac80	5775	Ant7	5850	-49.13	2	2.86	-44.27	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant7	5855	-39.78	2	-	-37.78	Peak	15.6	Pass
NVNT	ac80	5775	Ant7	5855	-50.16	2	2.86	-45.3	Average	15.6	Pass
NVNT	ac80	5775	Ant7	5875	-42.98	2	-	-40.98	Peak	10	Pass
NVNT	ac80	5775	Ant7	5875	-55.4	2	2.86	-50.54	Average	10	Pass
NVNT	ac80	5775	Ant7	5925	-48.57	2	-	-46.57	Peak	-27	Pass
NVNT	ac80	5775	Ant7	5925	-56.72	2	2.86	-51.86	Average	-27	Pass
NVNT	ac80	5775	Ant7	5650	-47.95	2	-	-45.95	Peak	-27	Pass
NVNT	ac80	5775	Ant7	5650	-55.02	2	2.86	-50.16	Average	-27	Pass
NVNT	ac80	5775	Ant7	5700	-36.59	2	-	-34.59	Peak	10	Pass
NVNT	ac80	5775	Ant7	5700	-47.78	2	2.86	-42.92	Average	10	Pass
NVNT	ac80	5775	Ant7	5720	-35.53	2	-	-33.53	Peak	15.6	Pass
NVNT	ac80	5775	Ant7	5720	-46.15	2	2.86	-41.29	Average	15.6	Pass
NVNT	ac80	5775	Ant7	5725	-34.63	2	-	-32.63	Peak	27	Pass
NVNT	ac80	5775	Ant7	5725	-46.07	2	2.86	-41.21	Average	27	Pass
NVNT	ax20	5745	Ant7	5650	-49.31	2	-	-47.31	Peak	-27	Pass
NVNT	ax20	5745	Ant7	5650	-57.04	2	2.95	-52.09	Average	-27	Pass
NVNT	ax20	5745	Ant7	5700	-48.31	2	-	-46.31	Peak	10	Pass
NVNT	ax20	5745	Ant7	5700	-55.47	2	2.95	-50.52	Average	10	Pass
NVNT	ax20	5745	Ant7	5720	-45.14	2	-	-43.14	Peak	15.6	Pass
NVNT	ax20	5745	Ant7	5720	-53.41	2	2.95	-48.46	Average	15.6	Pass
NVNT	ax20	5745	Ant7	5725	-40.13	2	-	-38.13	Peak	27	Pass
NVNT	ax20	5745	Ant7	5725	-50.8	2	2.95	-45.85	Average	27	Pass
NVNT	ax20	5825	Ant7	5850	-34.55	2	-	-32.55	Peak	27	Pass
NVNT	ax20	5825	Ant7	5850	-52.29	2	2.95	-47.34	Average	27	Pass
NVNT	ax20	5825	Ant7	5855	-39.81	2	-	-37.81	Peak	15.6	Pass
NVNT	ax20	5825	Ant7	5855	-54.15	2	2.95	-49.2	Average	15.6	Pass
NVNT	ax20	5825	Ant7	5875	-49.11	2	-	-47.11	Peak	10	Pass
NVNT	ax20	5825	Ant7	5875	-56.41	2	2.95	-51.46	Average	10	Pass
NVNT	ax20	5825	Ant7	5925	-48.61	2	-	-46.61	Peak	-27	Pass
NVNT	ax20	5825	Ant7	5925	-56.87	2	2.95	-51.92	Average	-27	Pass
NVNT	ax40	5755	Ant7	5650	-47.85	2	-	-45.85	Peak	-27	Pass
NVNT	ax40	5755	Ant7	5650	-56.31	2	3.02	-51.29	Average	-27	Pass
NVNT	ax40	5755	Ant7	5700	-44.76	2	-	-42.76	Peak	10	Pass
NVNT	ax40	5755	Ant7	5700	-55.75	2	3.02	-50.73	Average	10	Pass
NVNT	ax40	5755	Ant7	5720	-44.24	2	-	-42.24	Peak	15.6	Pass
NVNT	ax40	5755	Ant7	5720	-53.61	2	3.02	-48.59	Average	15.6	Pass
NVNT	ax40	5755	Ant7	5725	-40.31	2	-	-38.31	Peak	27	Pass
NVNT	ax40	5755	Ant7	5725	-51.77	2	3.02	-46.75	Average	27	Pass
NVNT	ax40	5795	Ant7	5850	-45.01	2	-	-43.01	Peak	27	Pass
NVNT	ax40	5795	Ant7	5850	-56.57	2	3.1	-51.47	Average	27	Pass
NVNT	ax40	5795	Ant7	5855	-46.69	2	-	-44.69	Peak	15.6	Pass
NVNT	ax40	5795	Ant7	5855	-57.16	2	3.1	-52.06	Average	15.6	Pass
NVNT	ax40	5795	Ant7	5875	-50.01	2	-	-48.01	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax40	5795	Ant7	5875	-57.24	2	3.1	-52.14	Average	10	Pass
NVNT	ax40	5795	Ant7	5925	-48.33	2	-	-46.33	Peak	-27	Pass
NVNT	ax40	5795	Ant7	5925	-56.59	2	3.1	-51.49	Average	-27	Pass
NVNT	ax80	5775	Ant7	5850	-45.19	2	-	-43.19	Peak	27	Pass
NVNT	ax80	5775	Ant7	5850	-54.62	2	3.28	-49.34	Average	27	Pass
NVNT	ax80	5775	Ant7	5855	-42.83	2	-	-40.83	Peak	15.6	Pass
NVNT	ax80	5775	Ant7	5855	-54.29	2	3.28	-49.01	Average	15.6	Pass
NVNT	ax80	5775	Ant7	5875	-45.69	2	-	-43.69	Peak	10	Pass
NVNT	ax80	5775	Ant7	5875	-55.52	2	3.28	-50.24	Average	10	Pass
NVNT	ax80	5775	Ant7	5925	-49.31	2	-	-47.31	Peak	-27	Pass
NVNT	ax80	5775	Ant7	5925	-56.79	2	3.28	-51.51	Average	-27	Pass
NVNT	ax80	5775	Ant7	5650	-48.53	2	-	-46.53	Peak	-27	Pass
NVNT	ax80	5775	Ant7	5650	-56.72	2	3.28	-51.44	Average	-27	Pass
NVNT	ax80	5775	Ant7	5700	-45.81	2	-	-43.81	Peak	10	Pass
NVNT	ax80	5775	Ant7	5700	-54.83	2	3.28	-49.55	Average	10	Pass
NVNT	ax80	5775	Ant7	5720	-43.8	2	-	-41.8	Peak	15.6	Pass
NVNT	ax80	5775	Ant7	5720	-52.79	2	3.28	-47.51	Average	15.6	Pass
NVNT	ax80	5775	Ant7	5725	-41.71	2	-	-39.71	Peak	27	Pass
NVNT	ax80	5775	Ant7	5725	-51.8	2	3.28	-46.52	Average	27	Pass






Test Graphs

Restrict Band NVNT a 5745MHz Ant7 Peak

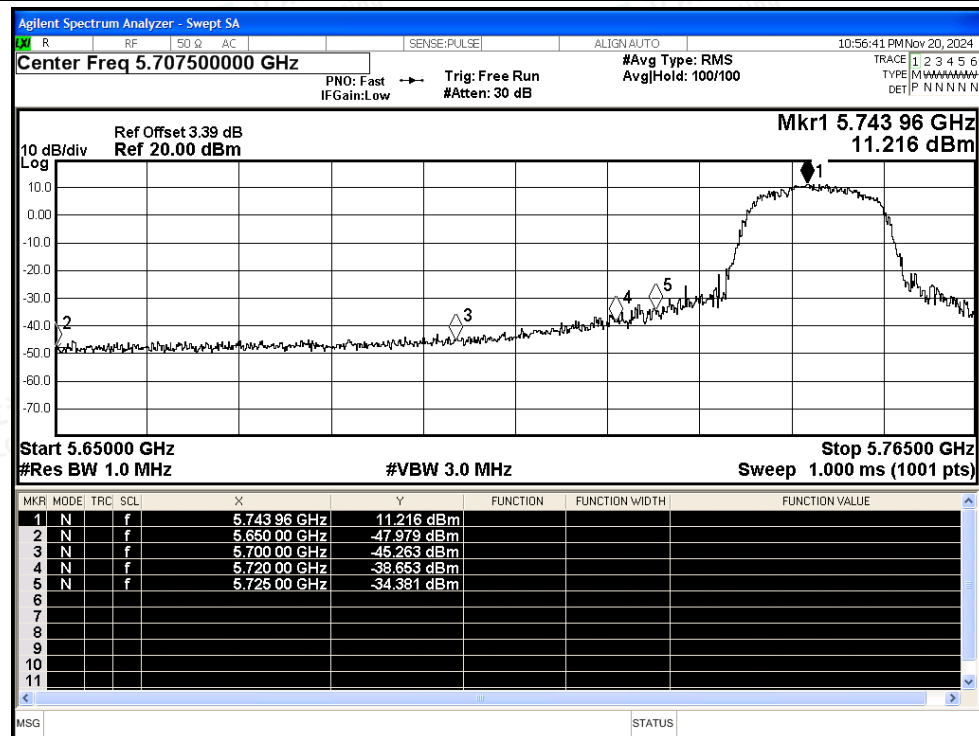

Restrict Band NVNT a 5745MHz Ant7 Average

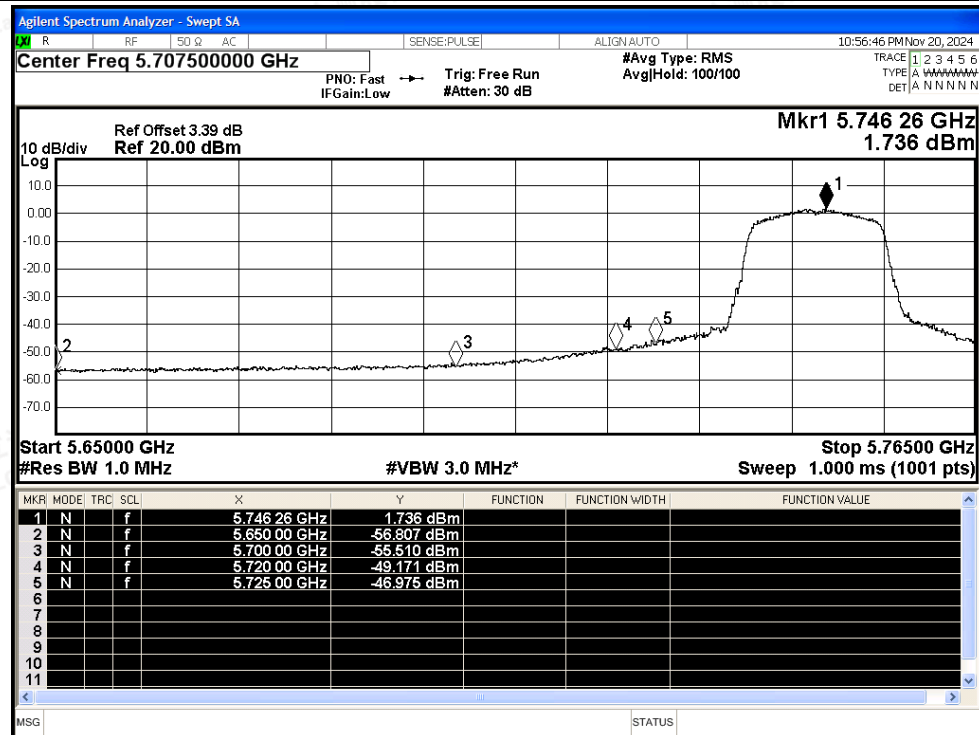

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant7 Peak

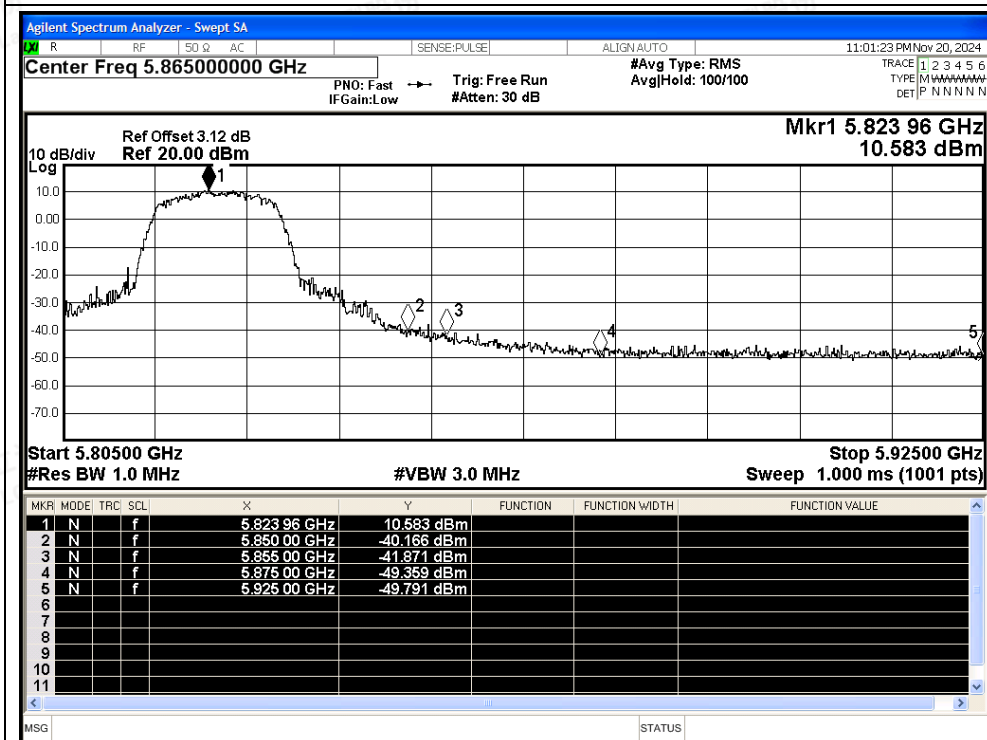

Restrict Band NVNT a 5825MHz Ant7 Average


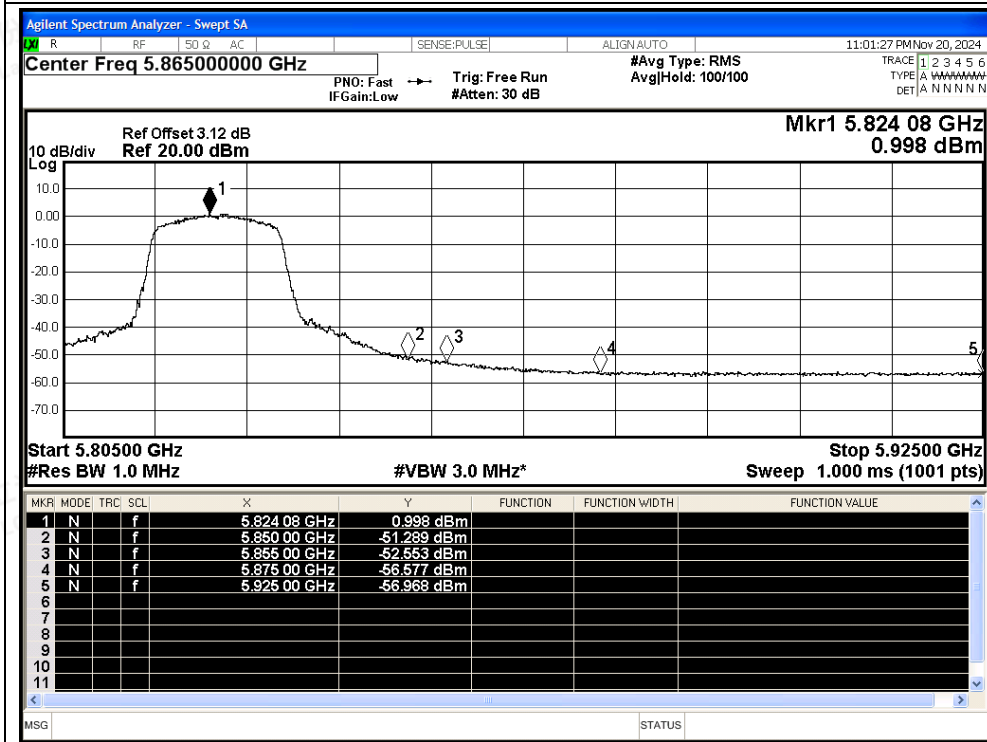


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

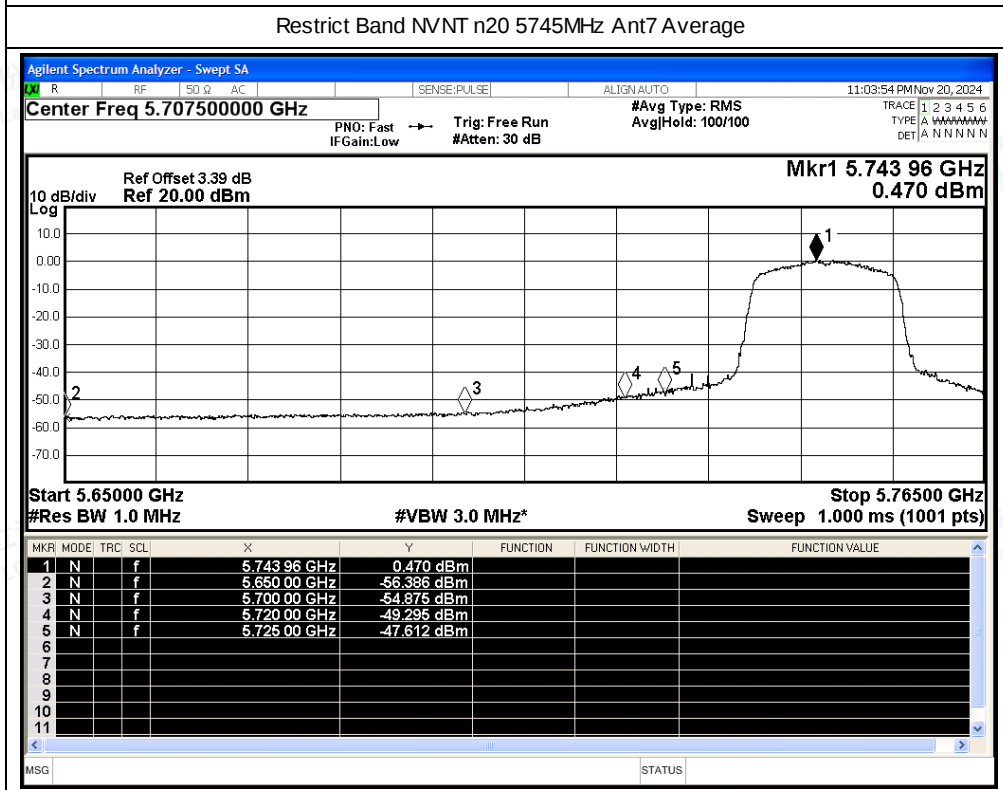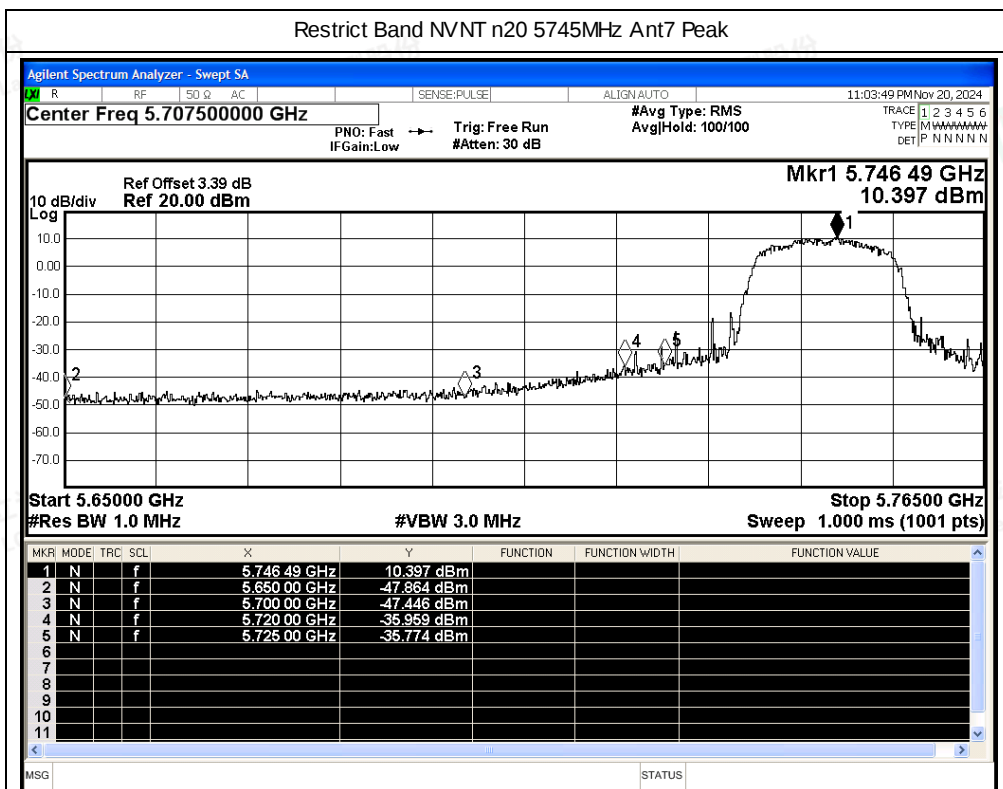

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant7 Peak

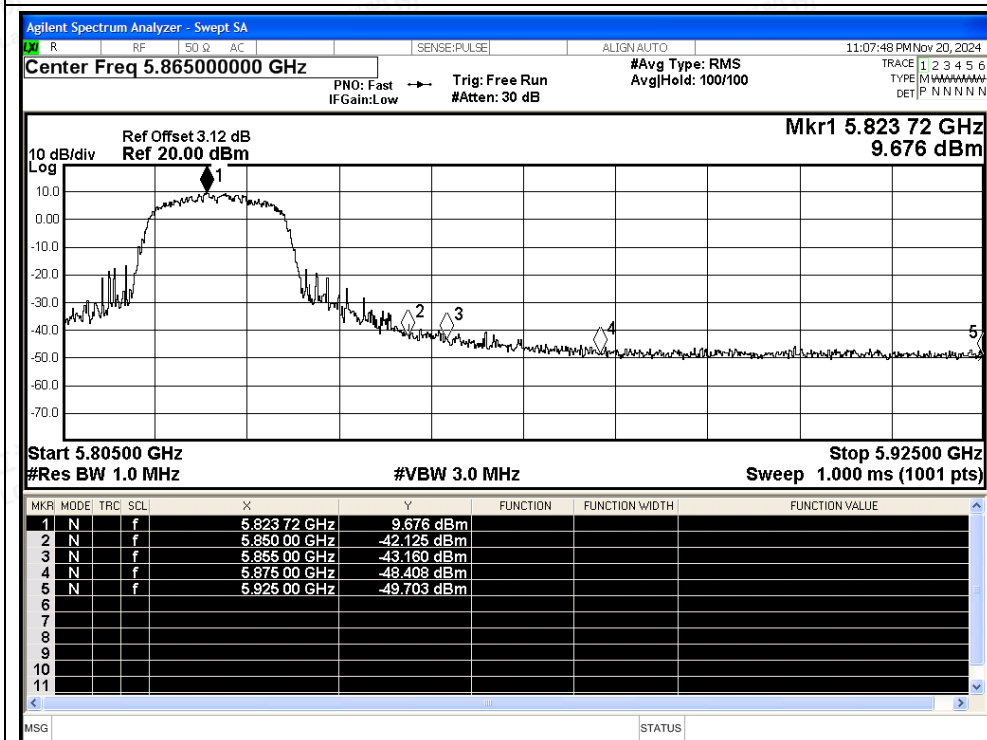

Restrict Band NVNT n20 5825MHz Ant7 Average

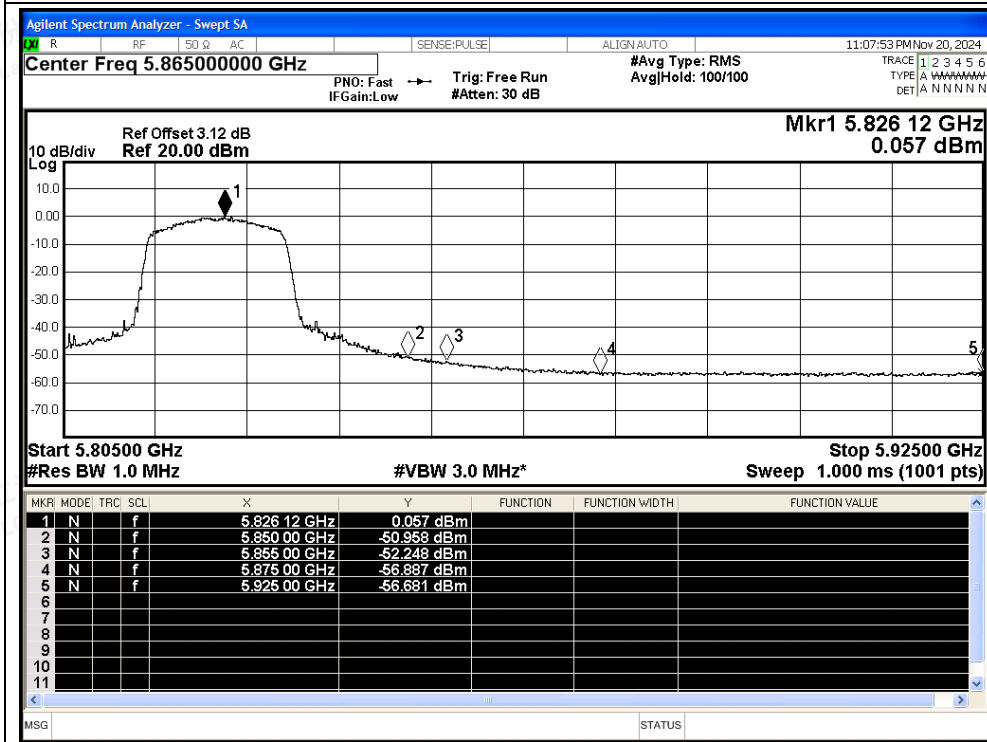

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant7 Peak

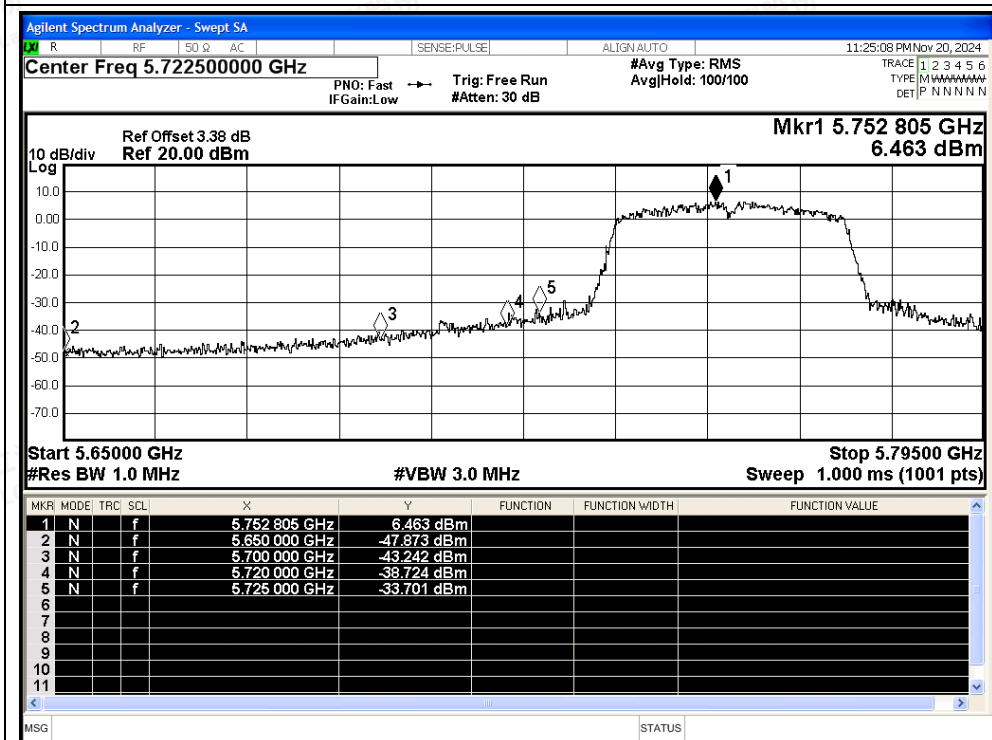

Restrict Band NVNT n40 5755MHz Ant7 Average

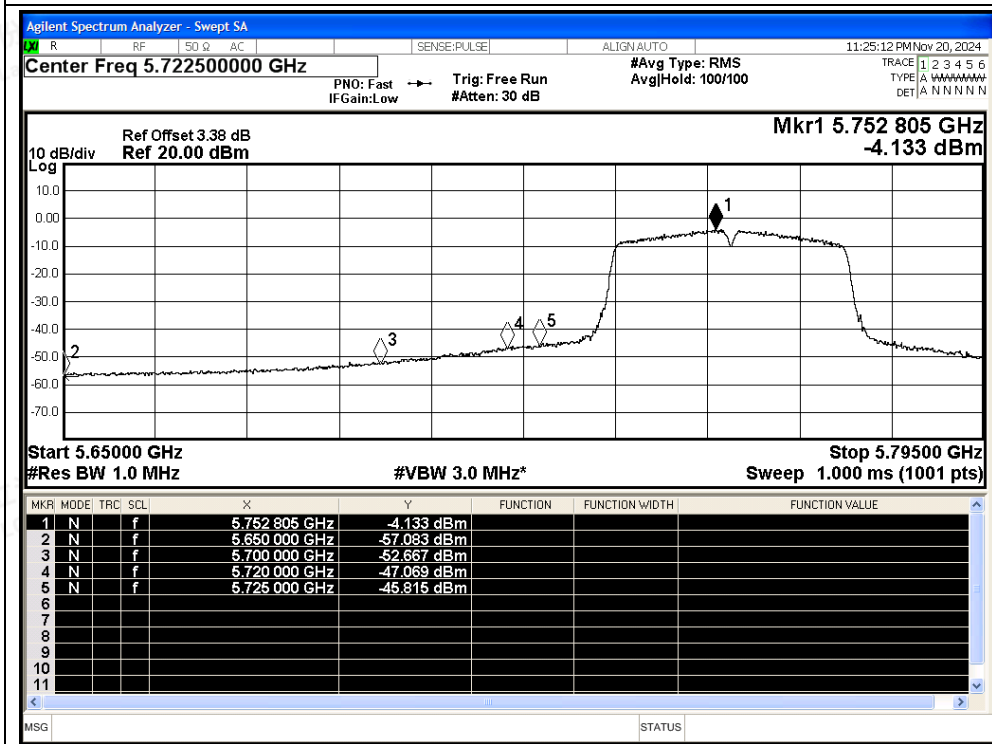

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant7 Peak

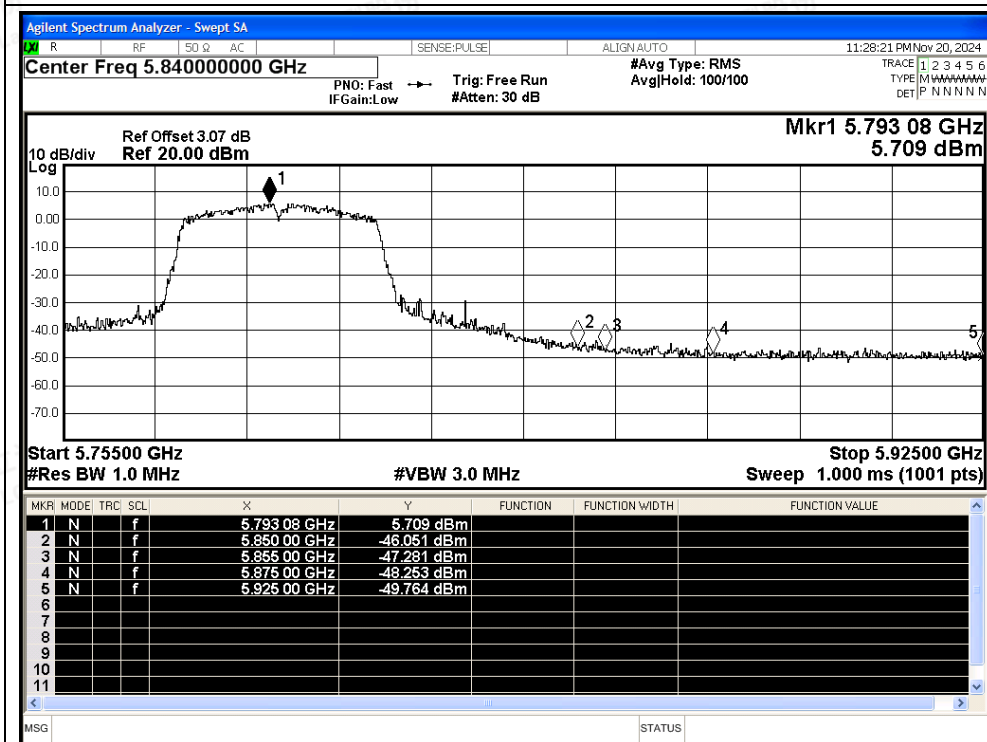

Restrict Band NVNT n40 5795MHz Ant7 Average


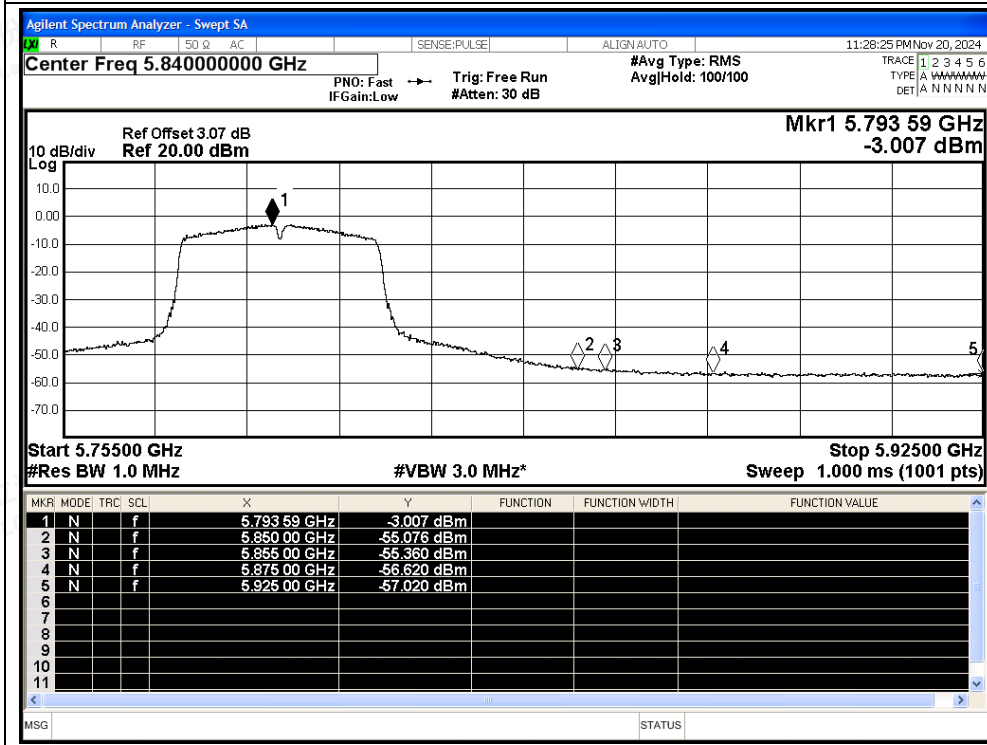


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

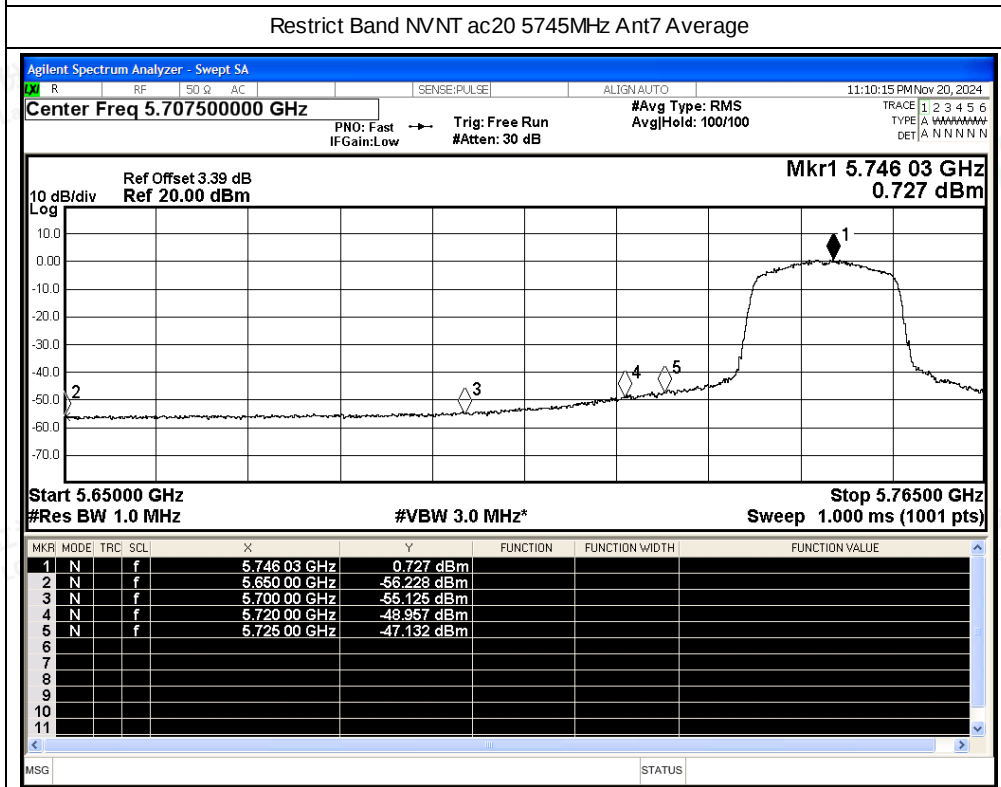
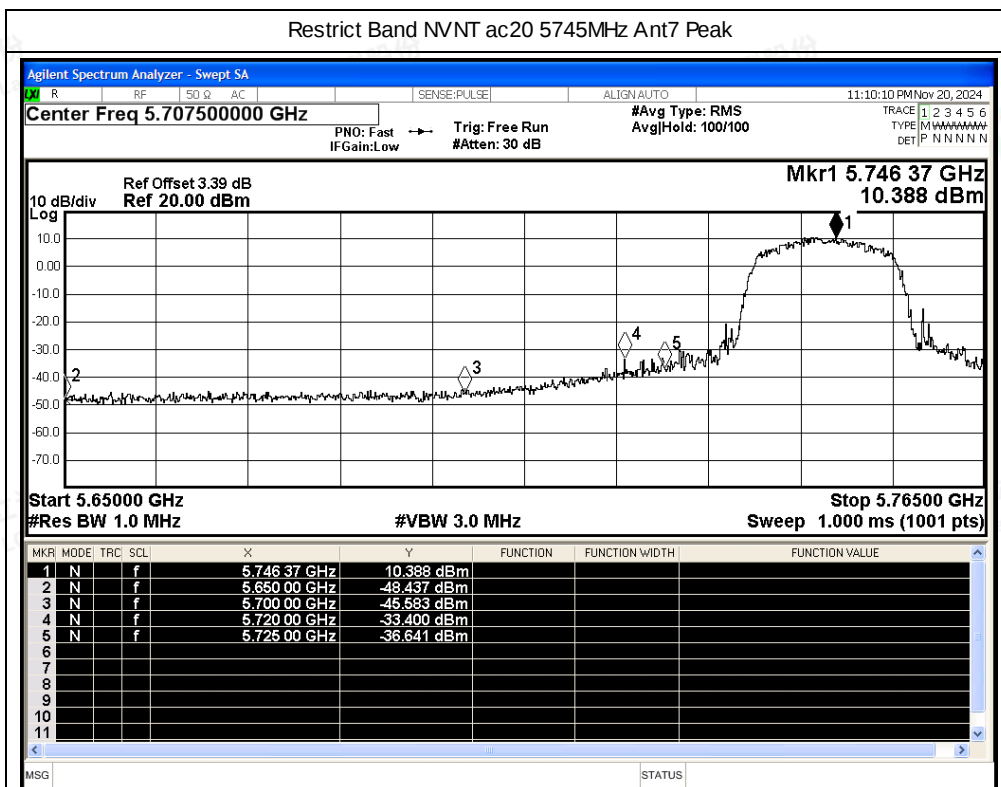


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

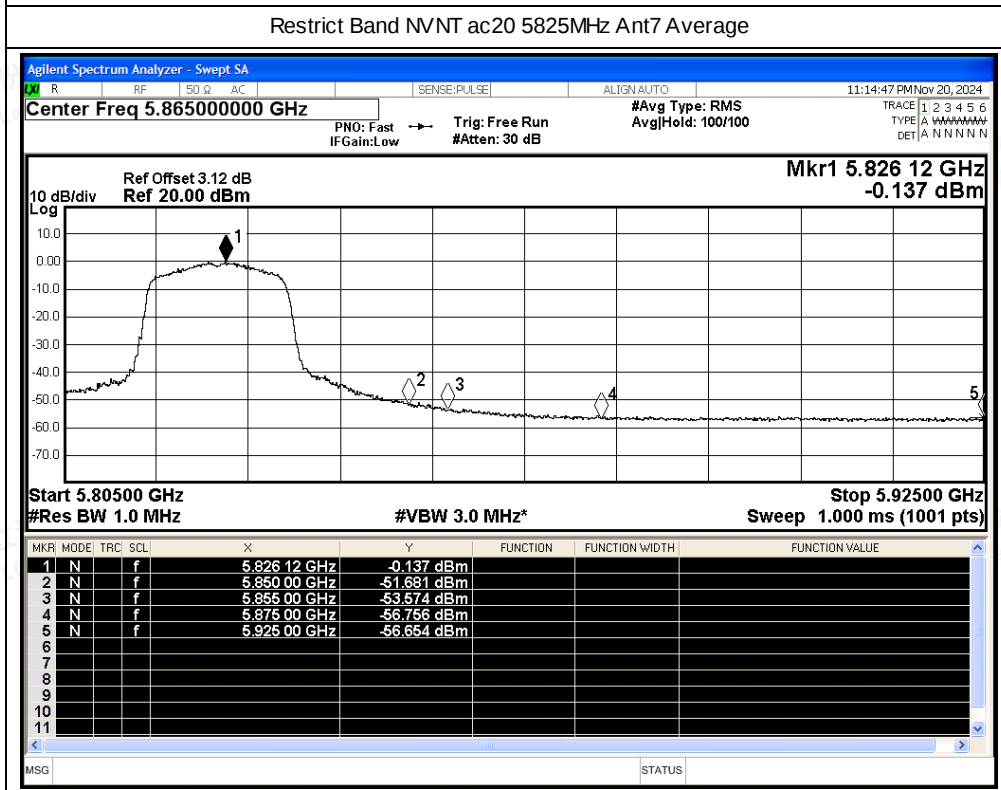
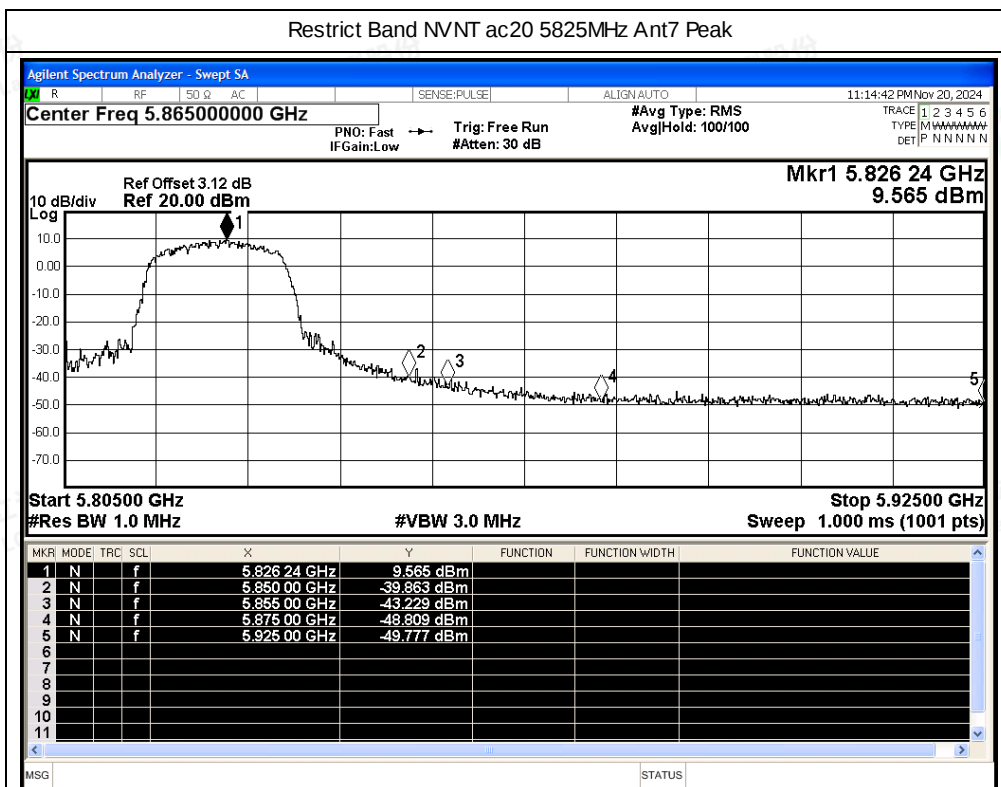


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

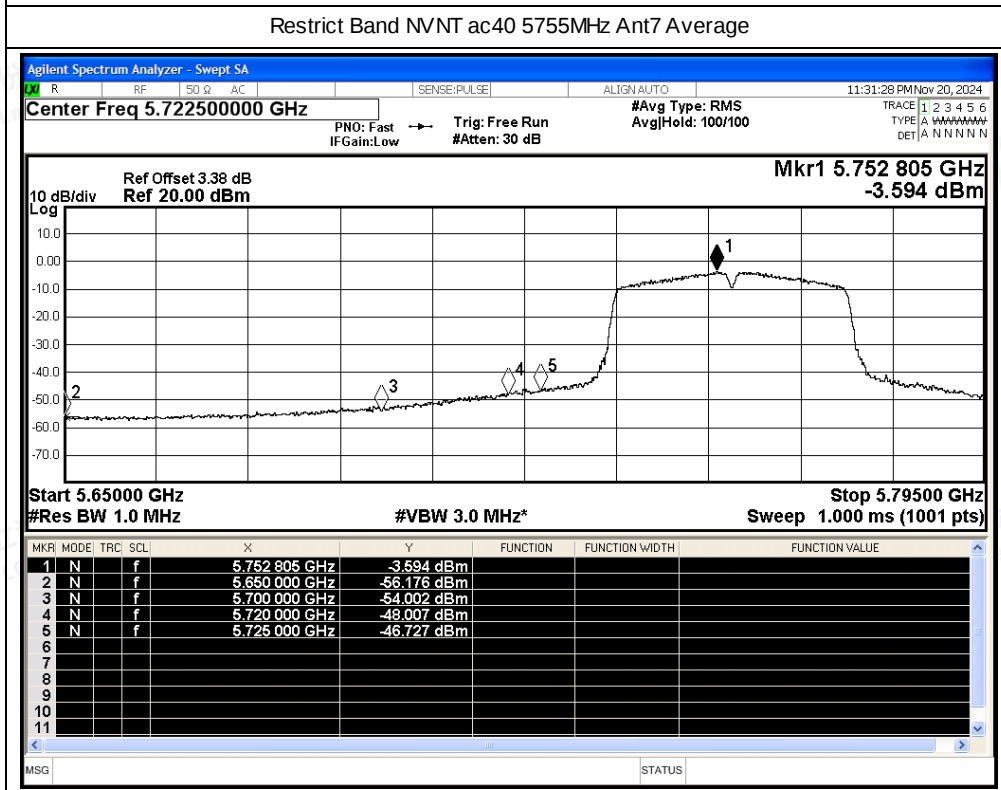
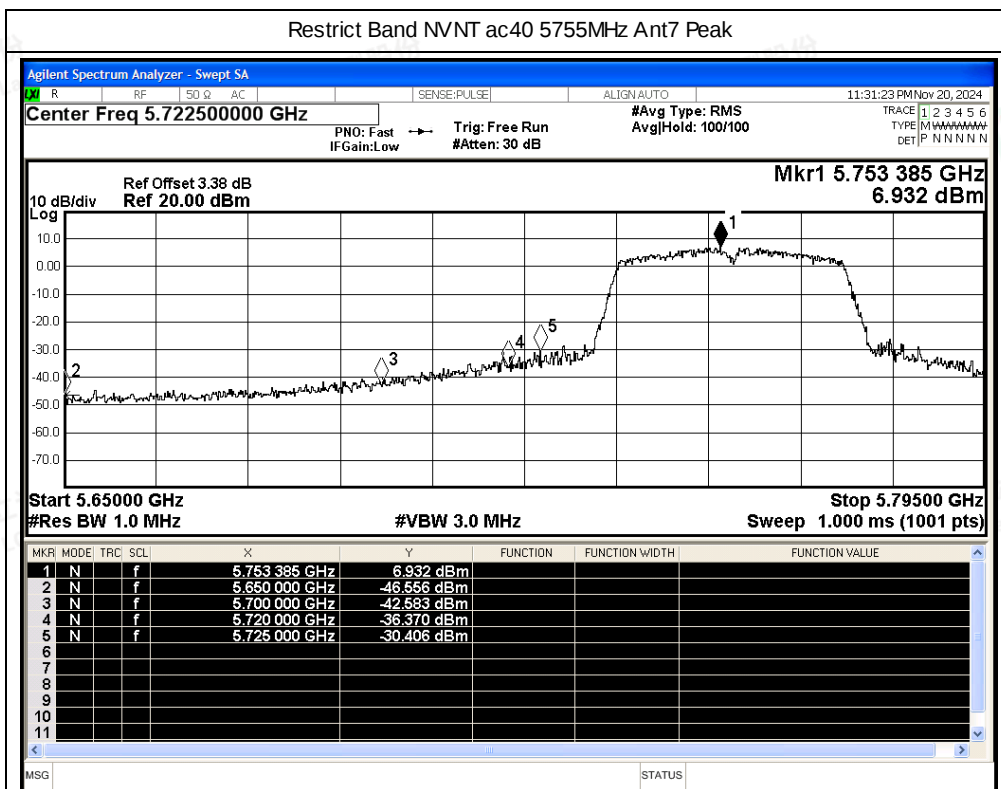




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

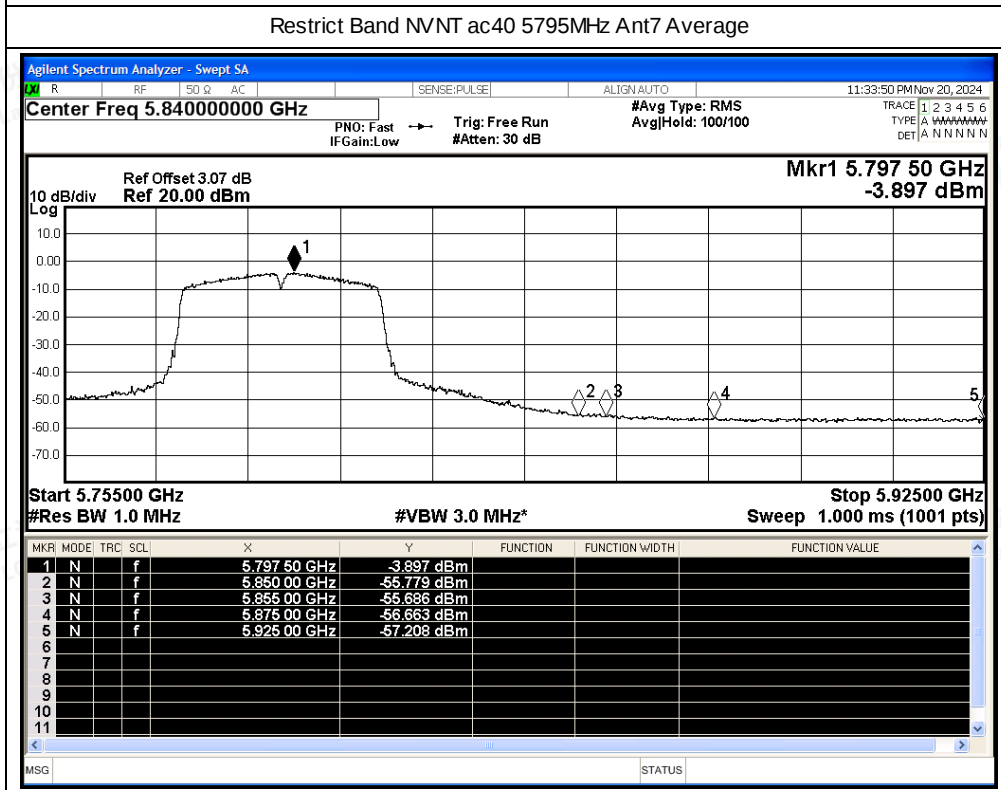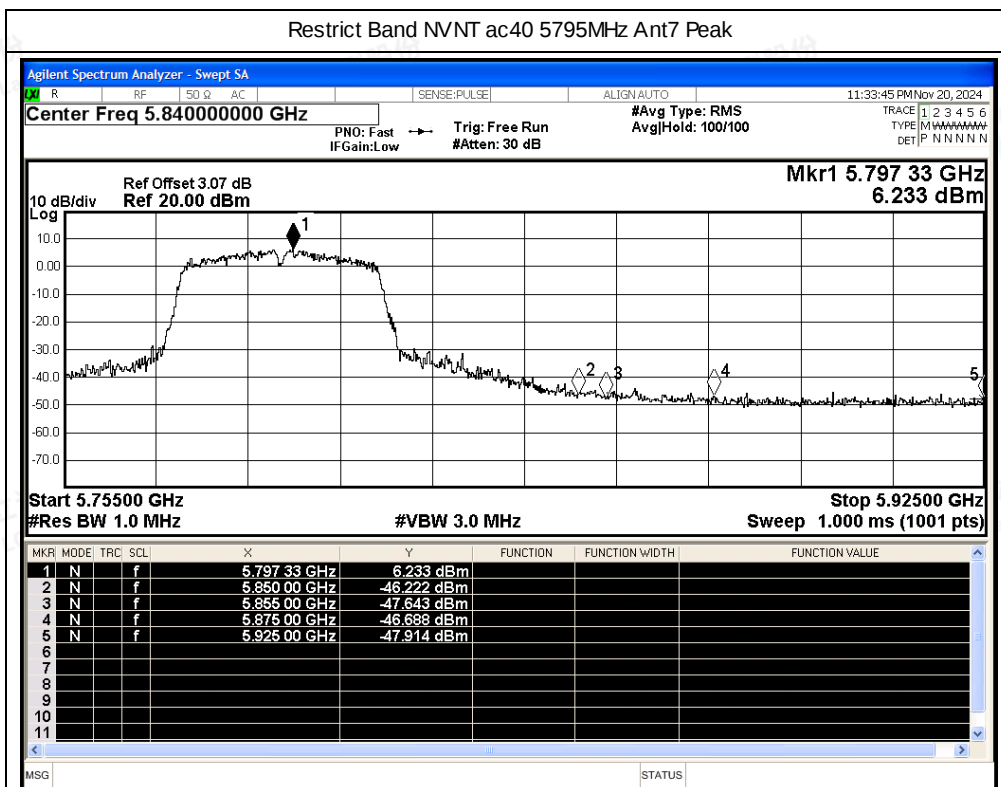

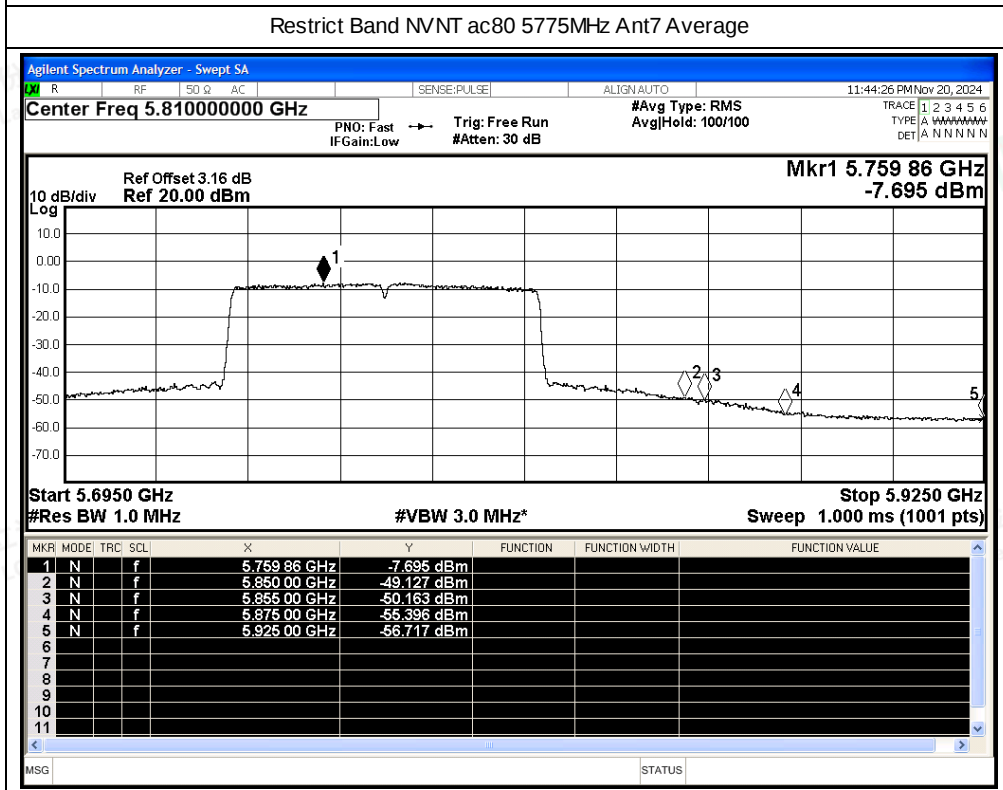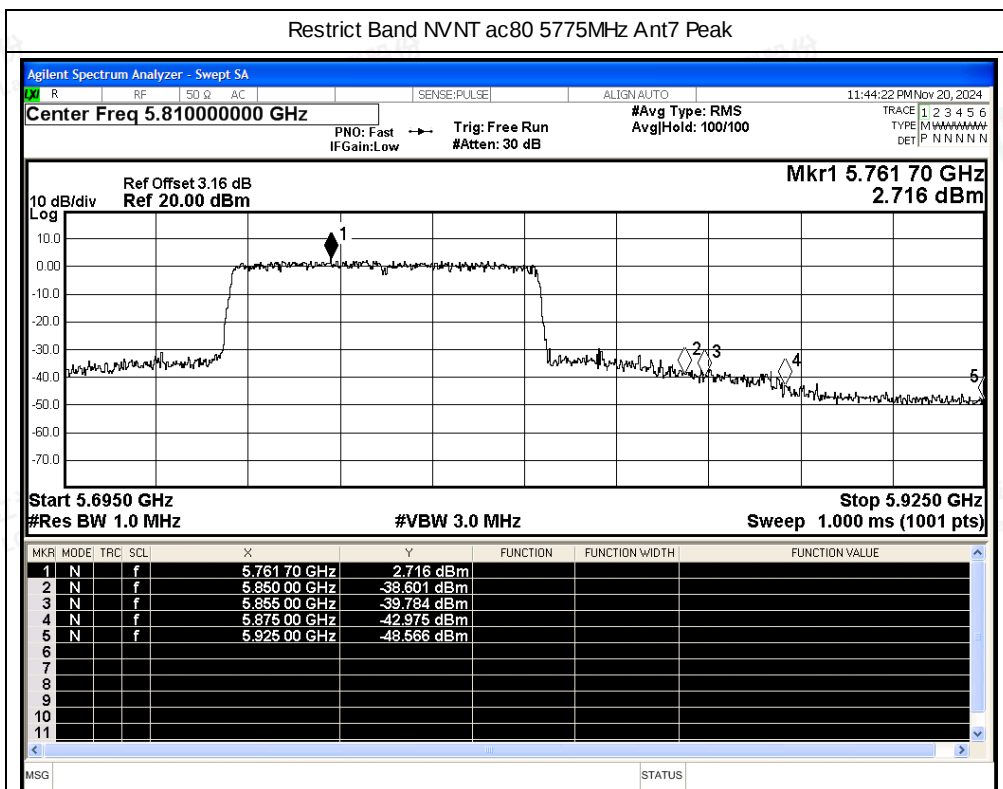

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant7 Peak

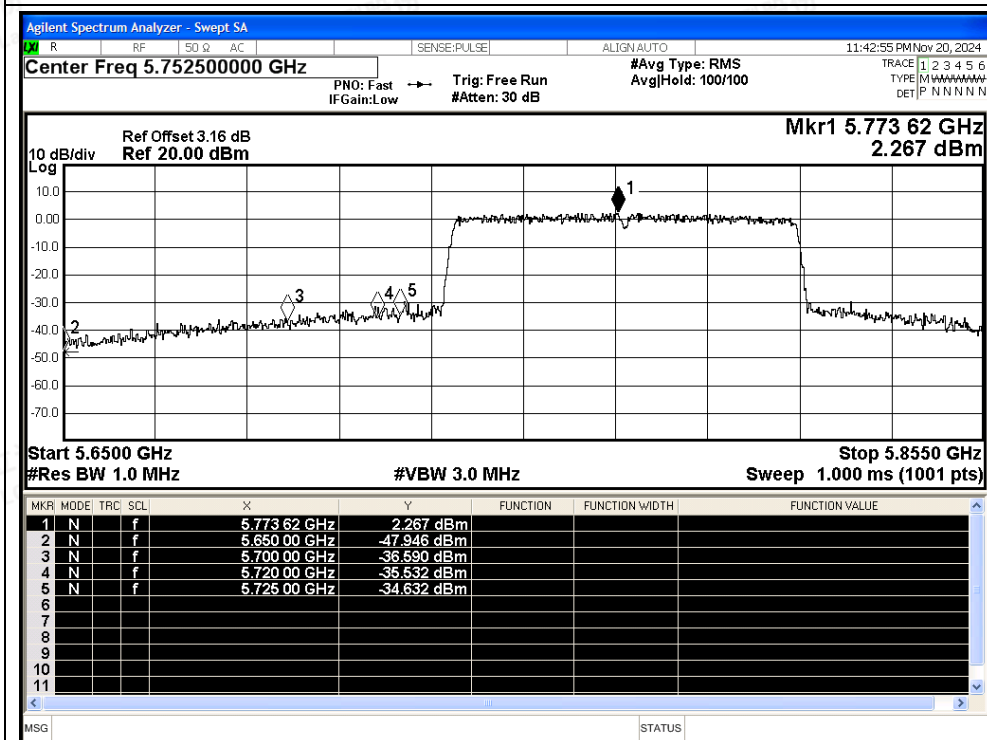

Restrict Band NVNT ac80 5775MHz Ant7 Average


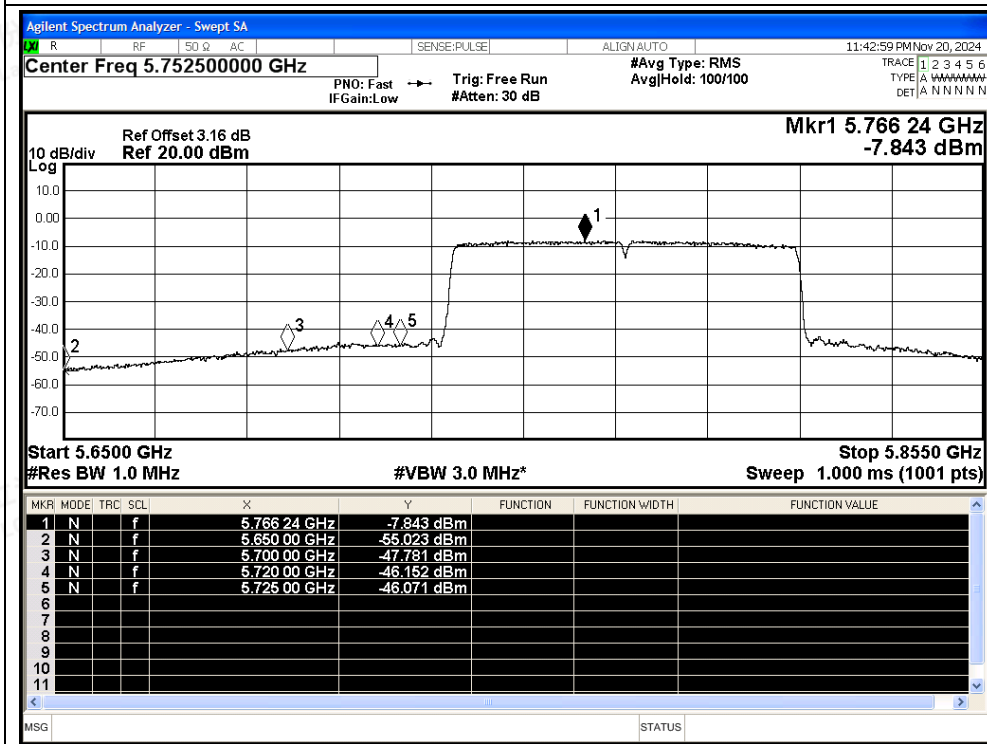




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

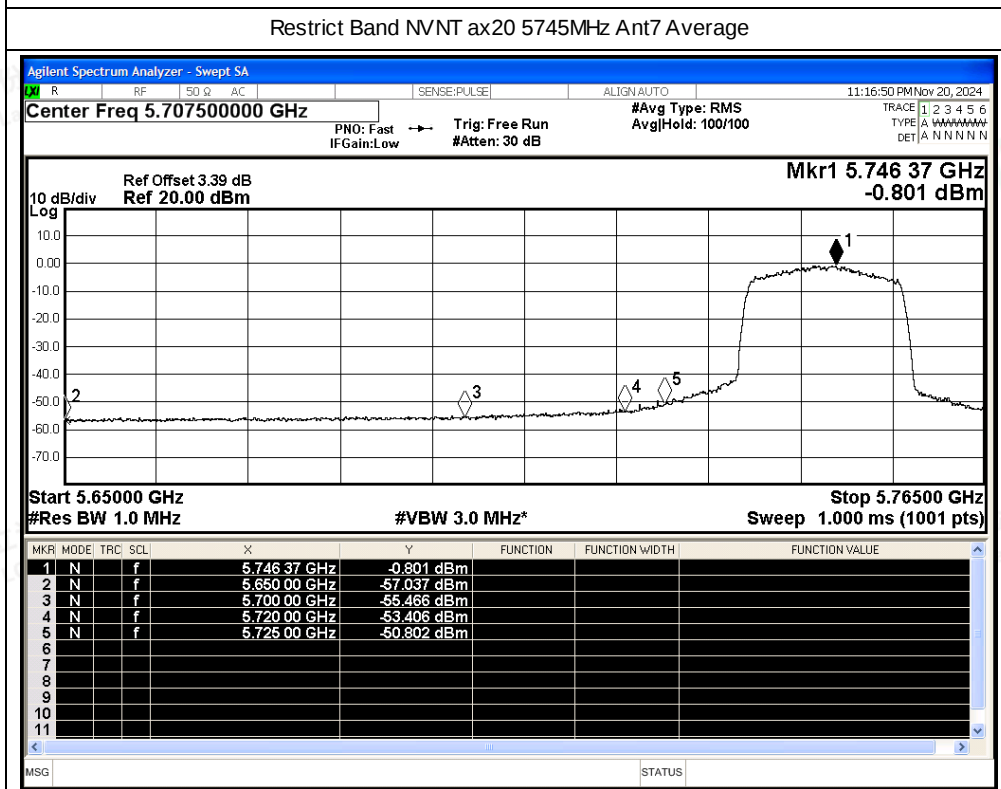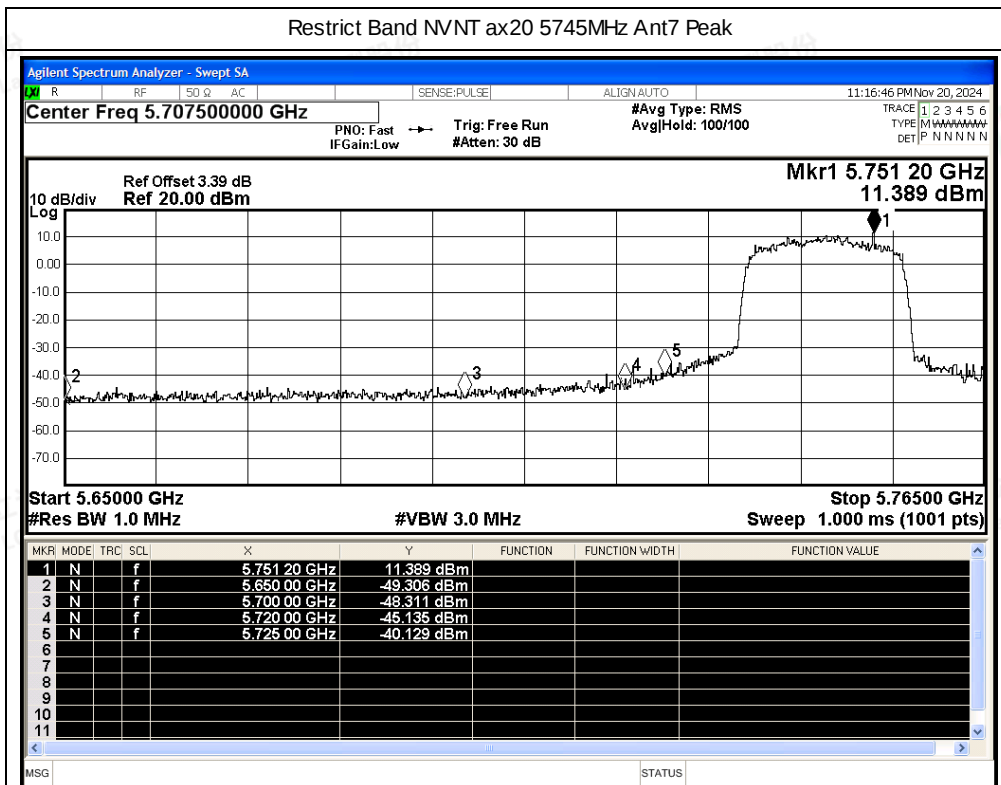

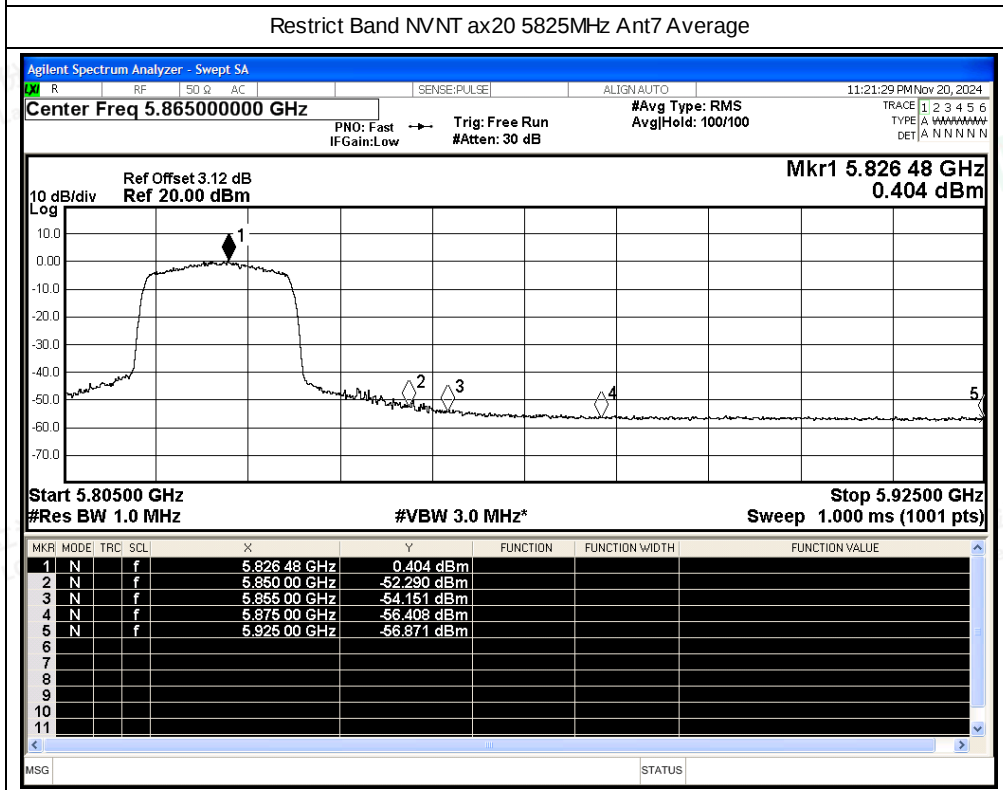
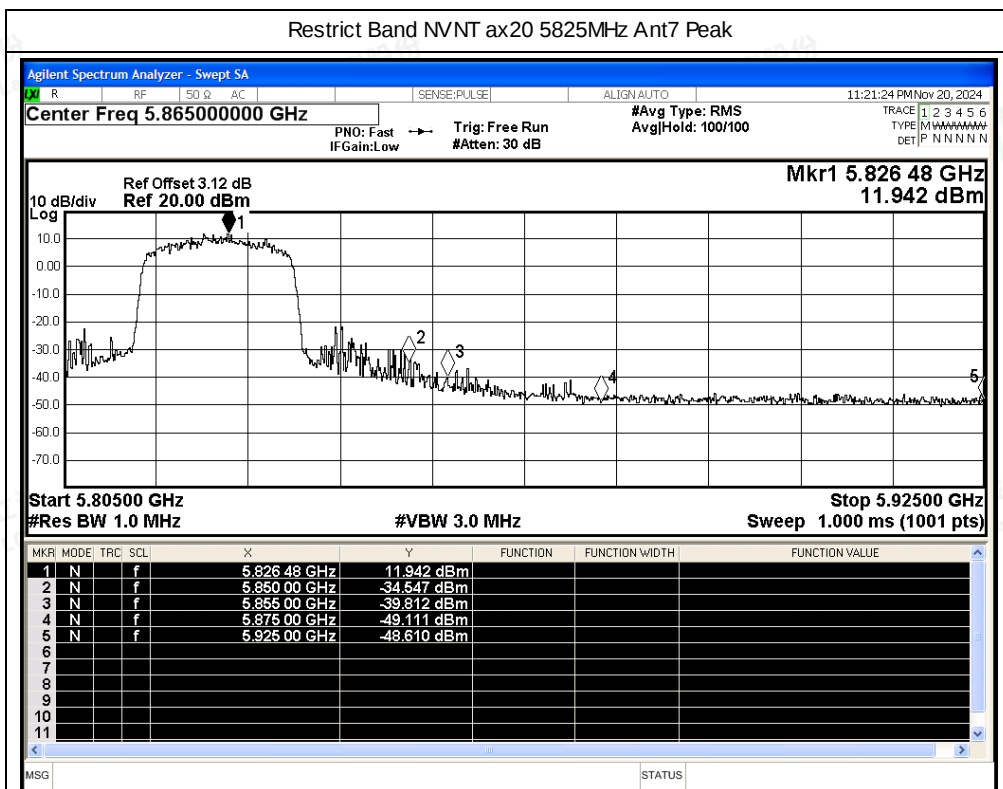


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

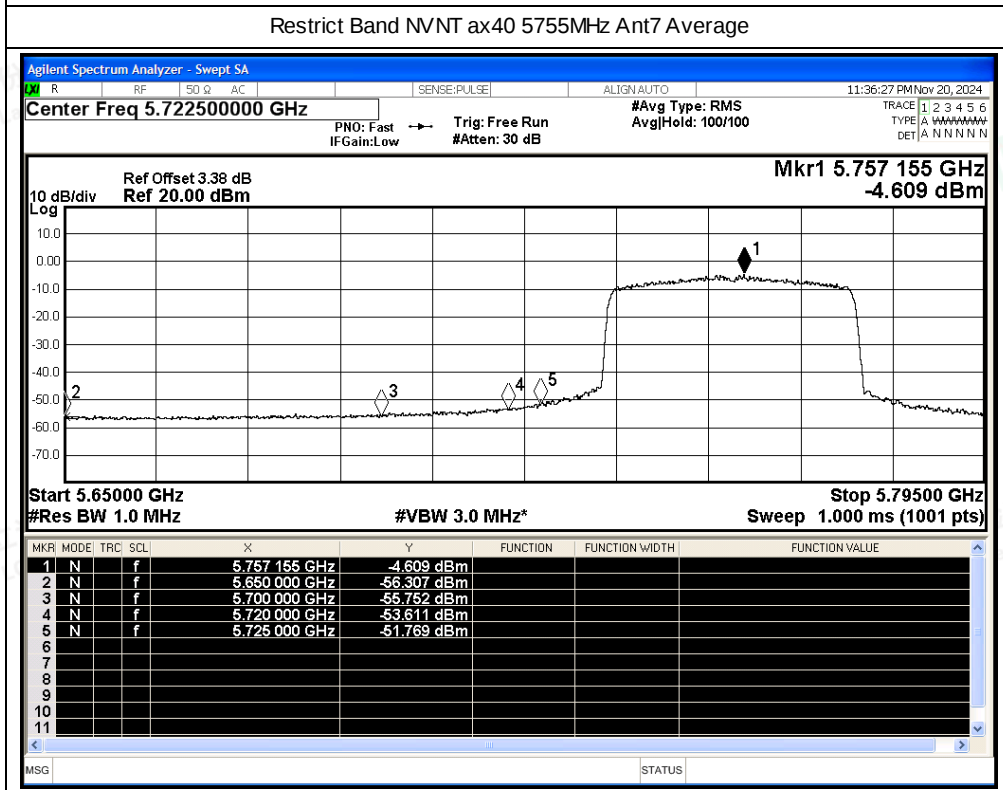
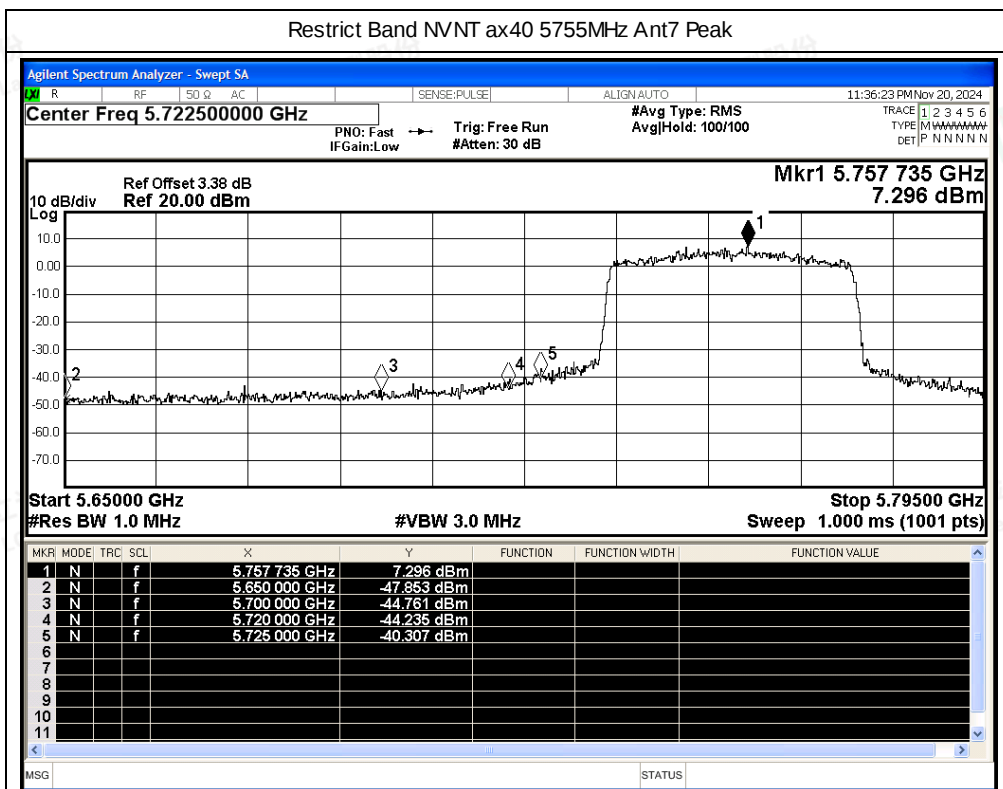


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

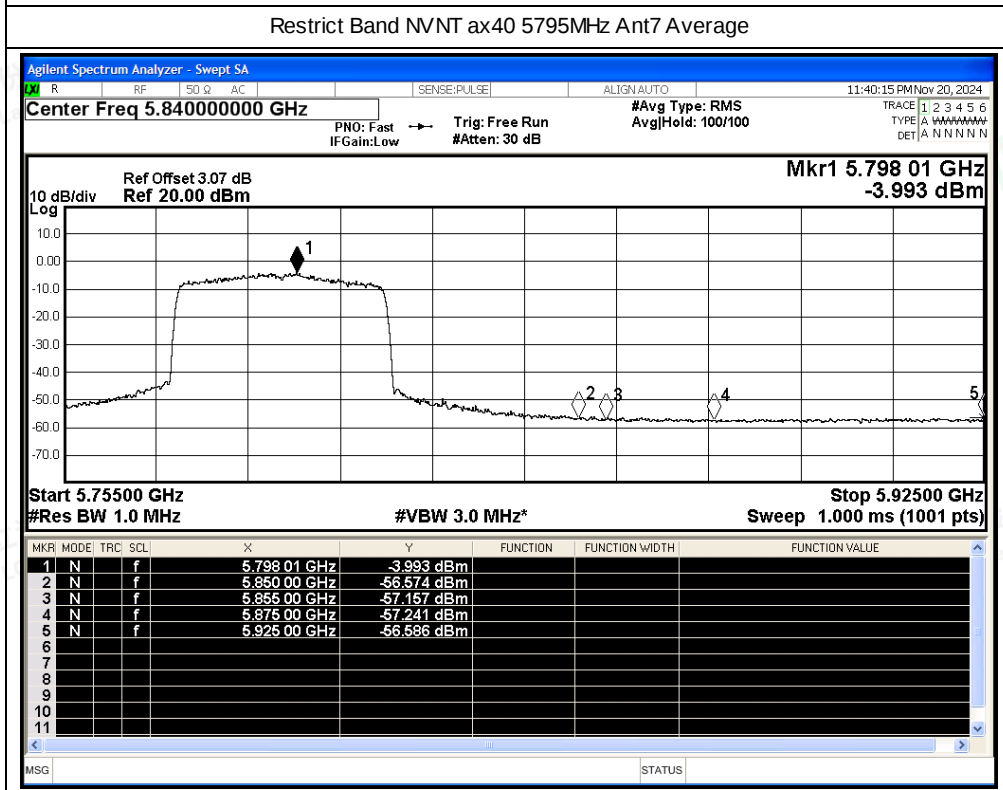
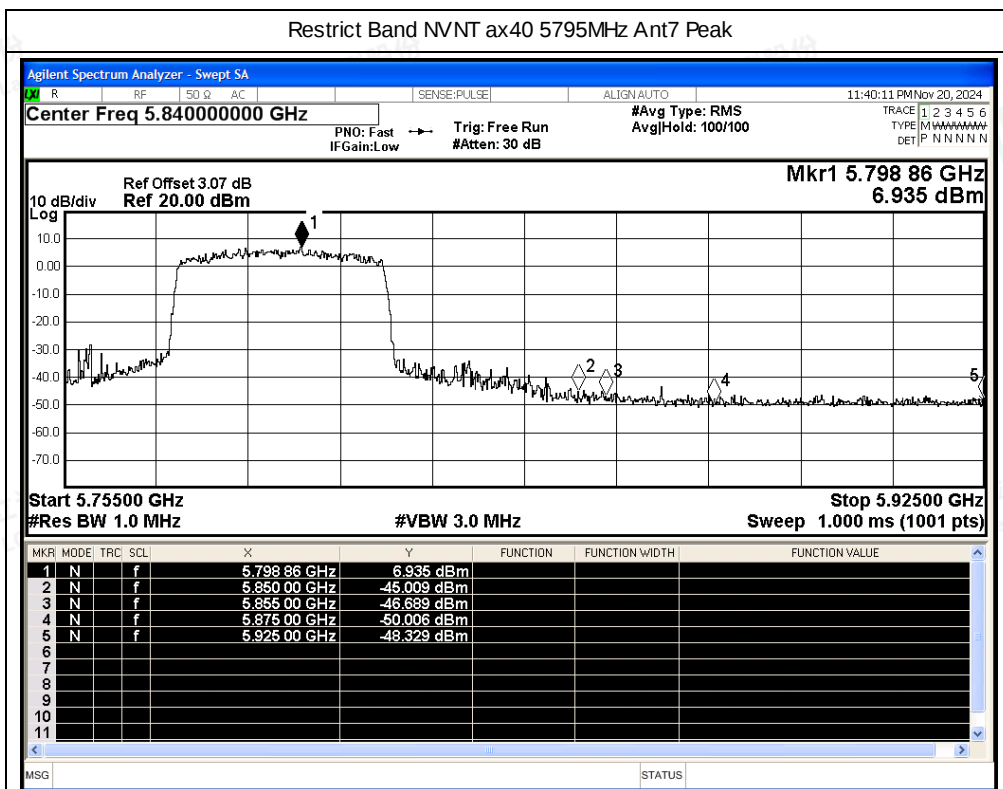


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

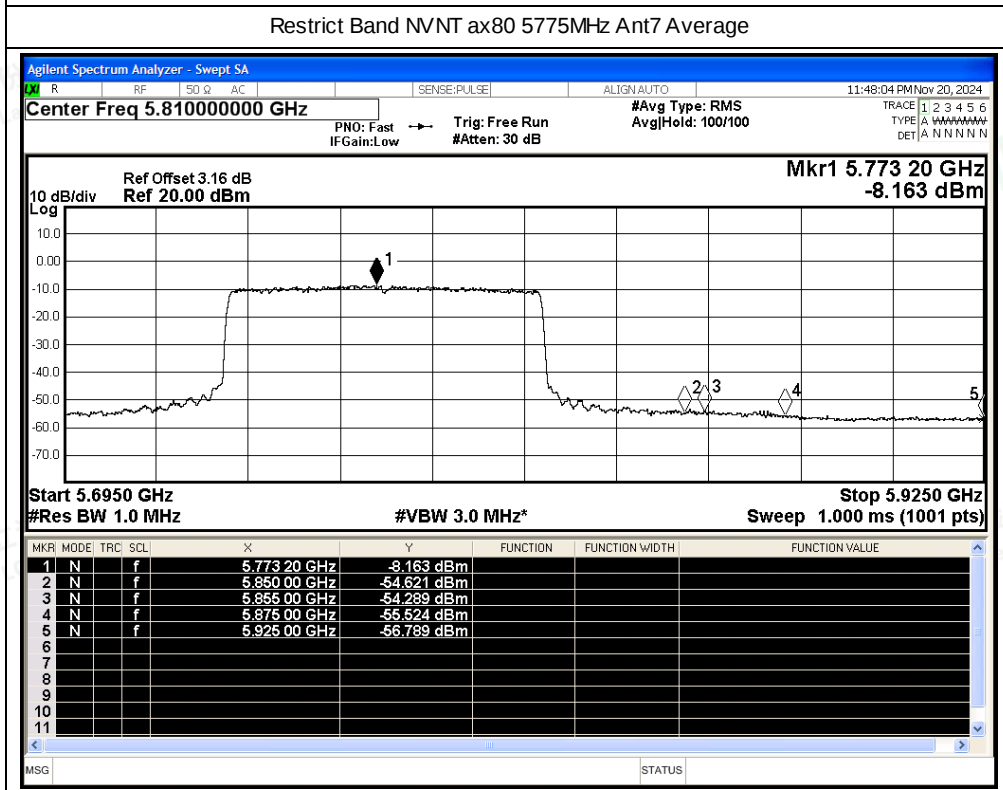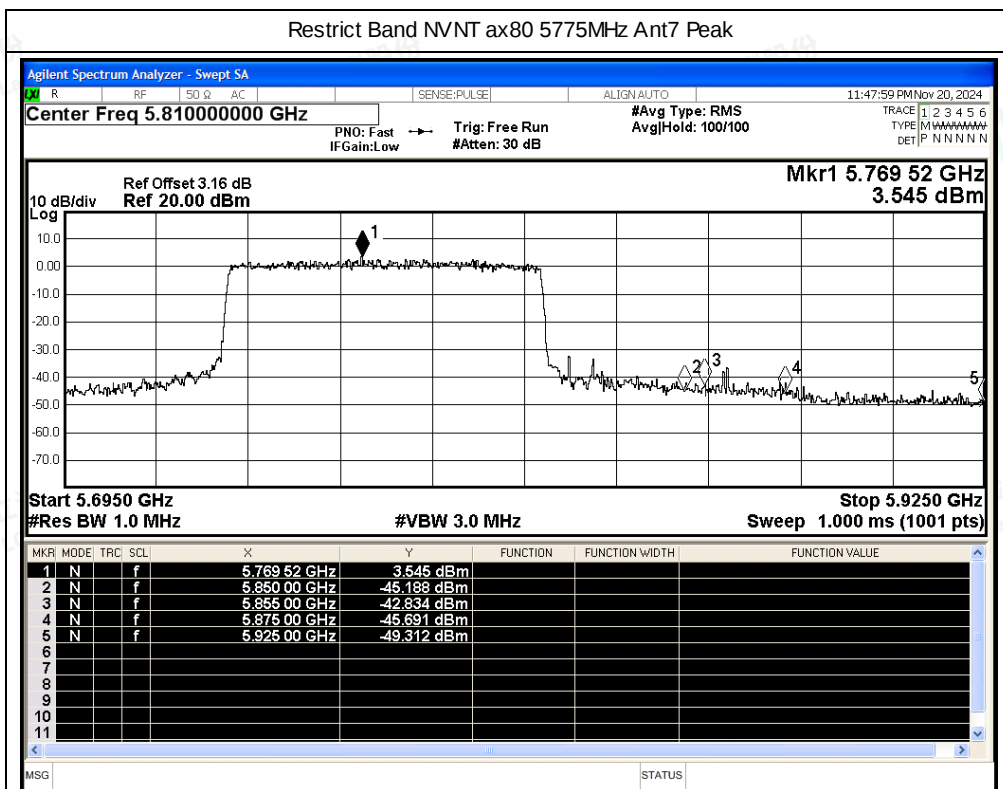

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant7 Peak

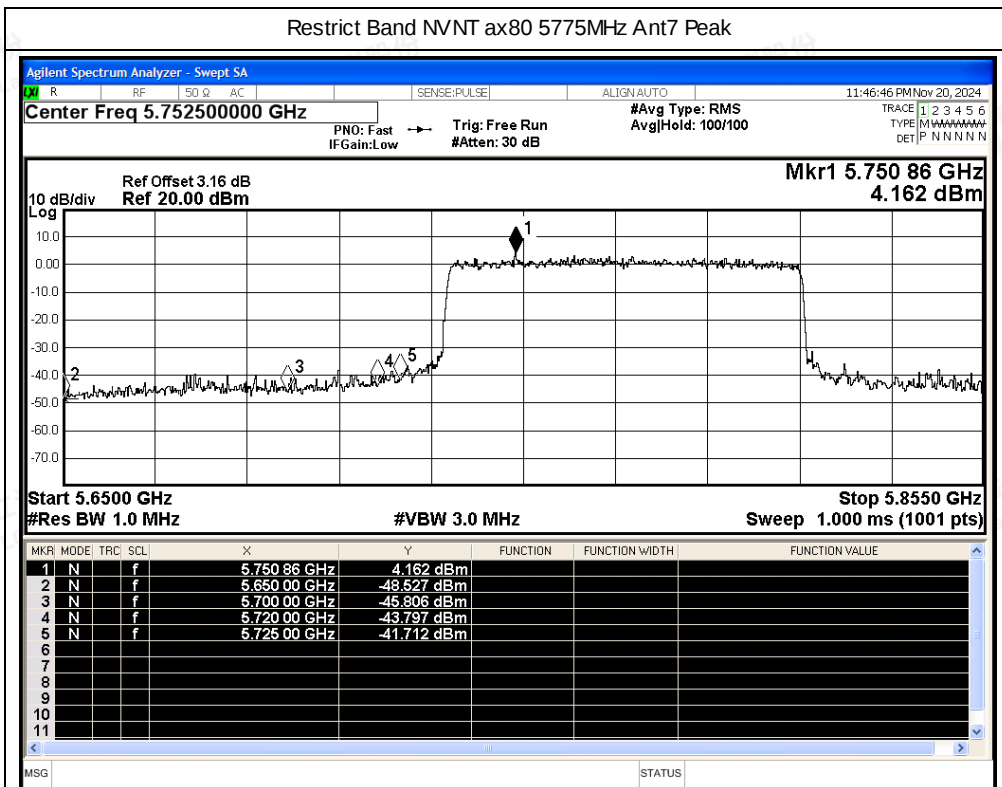

Restrict Band NVNT ax80 5775MHz Ant7 Average

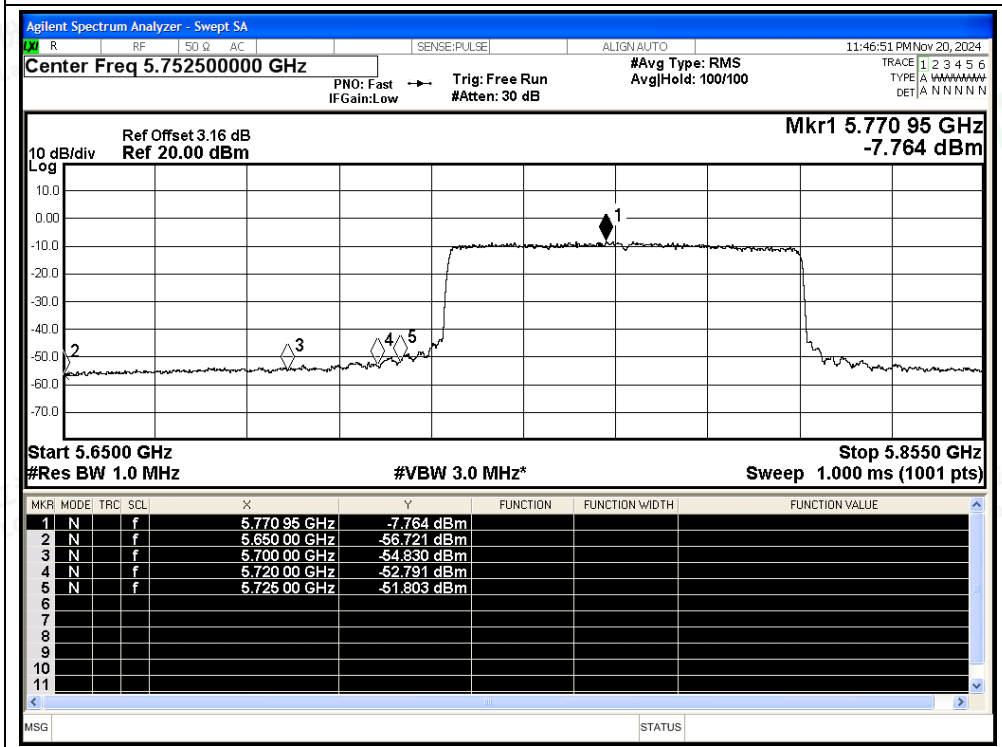

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT6 Power (dBm)	ANT7 Power (dBm)	Gain (dBi)	ERP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	5650	-48.44	-47.86	2.0	-43.13	Peak	-27	Pass
NVNT	n20	5745	5650	-56.68	-56.39	2.0	-51.52	Average	-27	Pass
NVNT	n20	5745	5700	-45.5	-47.45	2.0	-41.36	Peak	10	Pass
NVNT	n20	5745	5700	-54.87	-54.88	2.0	-49.86	Average	10	Pass
NVNT	n20	5745	5720	-37.64	-35.96	2.0	-31.71	Peak	15.6	Pass
NVNT	n20	5745	5720	-48.18	-49.3	2.0	-43.69	Average	15.6	Pass
NVNT	n20	5745	5725	-23.62	-35.77	2.0	-21.36	Peak	27	Pass
NVNT	n20	5745	5725	-46.81	-47.61	2.0	-42.18	Average	27	Pass
NVNT	n20	5825	5850	-39.74	-42.13	2.0	-35.76	Peak	27	Pass
NVNT	n20	5825	5850	-49.73	-50.96	2.0	-45.29	Average	27	Pass
NVNT	n20	5825	5855	-38.94	-43.16	2.0	-35.55	Peak	15.6	Pass
NVNT	n20	5825	5855	-51.97	-52.25	2.0	-47.10	Average	15.6	Pass
NVNT	n20	5825	5875	-45.86	-48.41	2.0	-41.94	Peak	10	Pass
NVNT	n20	5825	5875	-55.73	-56.89	2.0	-51.26	Average	10	Pass
NVNT	n20	5825	5925	-48.93	-49.7	2.0	-44.29	Peak	-27	Pass
NVNT	n20	5825	5925	-56.78	-56.68	2.0	-51.72	Average	-27	Pass
NVNT	n40	5755	5650	-46.61	-47.87	2.0	-42.18	Peak	-27	Pass
NVNT	n40	5755	5650	-55.86	-57.08	2.0	-51.42	Average	-27	Pass
NVNT	n40	5755	5700	-41.2	-43.24	2.0	-37.09	Peak	10	Pass
NVNT	n40	5755	5700	-51.66	-52.67	2.0	-47.13	Average	10	Pass
NVNT	n40	5755	5720	-37.38	-38.72	2.0	-32.99	Peak	15.6	Pass
NVNT	n40	5755	5720	-45.51	-47.07	2.0	-41.21	Average	15.6	Pass
NVNT	n40	5755	5725	-36.02	-33.7	2.0	-29.70	Peak	27	Pass
NVNT	n40	5755	5725	-45.39	-45.82	2.0	-40.59	Average	27	Pass
NVNT	n40	5795	5850	-44.94	-46.05	2.0	-40.45	Peak	27	Pass
NVNT	n40	5795	5850	-54.5	-55.08	2.0	-49.77	Average	27	Pass
NVNT	n40	5795	5855	-47.01	-47.28	2.0	-42.13	Peak	15.6	Pass
NVNT	n40	5795	5855	-55.4	-55.36	2.0	-50.37	Average	15.6	Pass
NVNT	n40	5795	5875	-48.5	-48.25	2.0	-43.36	Peak	10	Pass
NVNT	n40	5795	5875	-57.3	-56.62	2.0	-51.94	Average	10	Pass
NVNT	n40	5795	5925	-48.21	-49.76	2.0	-43.91	Peak	-27	Pass
NVNT	n40	5795	5925	-57.31	-57.02	2.0	-52.15	Average	-27	Pass
NVNT	ac20	5745	5650	-48.68	-48.44	2.0	-43.55	Peak	-27	Pass
NVNT	ac20	5745	5650	-56.61	-56.23	2.0	-51.41	Average	-27	Pass
NVNT	ac20	5745	5700	-45.49	-45.58	2.0	-40.52	Peak	10	Pass
NVNT	ac20	5745	5700	-55.59	-55.13	2.0	-50.34	Average	10	Pass
NVNT	ac20	5745	5720	-35.28	-33.4	2.0	-29.23	Peak	15.6	Pass
NVNT	ac20	5745	5720	-48.36	-48.96	2.0	-43.64	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	5725	-35.71	-36.64	2.0	-31.14	Peak	27	Pass
NVNT	ac20	5745	5725	-46.43	-47.13	2.0	-41.76	Average	27	Pass
NVNT	ac20	5825	5850	-39.24	-39.86	2.0	-34.53	Peak	27	Pass
NVNT	ac20	5825	5850	-49.65	-51.68	2.0	-45.54	Average	27	Pass
NVNT	ac20	5825	5855	-39.46	-43.23	2.0	-35.94	Peak	15.6	Pass
NVNT	ac20	5825	5855	-51.66	-53.57	2.0	-47.50	Average	15.6	Pass
NVNT	ac20	5825	5875	-47.27	-48.81	2.0	-42.96	Peak	10	Pass
NVNT	ac20	5825	5875	-55.52	-56.76	2.0	-51.09	Average	10	Pass
NVNT	ac20	5825	5925	-48.43	-49.78	2.0	-44.04	Peak	-27	Pass
NVNT	ac20	5825	5925	-56.6	-56.65	2.0	-51.61	Average	-27	Pass
NVNT	ac40	5755	5650	-47.45	-46.56	2.0	-41.97	Peak	-27	Pass
NVNT	ac40	5755	5650	-56.99	-56.18	2.0	-51.56	Average	-27	Pass
NVNT	ac40	5755	5700	-42.16	-42.58	2.0	-37.35	Peak	10	Pass
NVNT	ac40	5755	5700	-51.8	-54	2.0	-47.75	Average	10	Pass
NVNT	ac40	5755	5720	-33.55	-36.37	2.0	-29.72	Peak	15.6	Pass
NVNT	ac40	5755	5720	-45.67	-48.01	2.0	-41.67	Average	15.6	Pass
NVNT	ac40	5755	5725	-34.23	-30.41	2.0	-26.90	Peak	27	Pass
NVNT	ac40	5755	5725	-45.27	-46.73	2.0	-40.93	Average	27	Pass
NVNT	ac40	5795	5850	-44.25	-46.22	2.0	-40.11	Peak	27	Pass
NVNT	ac40	5795	5850	-55.22	-55.78	2.0	-50.48	Average	27	Pass
NVNT	ac40	5795	5855	-45.44	-47.64	2.0	-41.39	Peak	15.6	Pass
NVNT	ac40	5795	5855	-55.29	-55.69	2.0	-50.48	Average	15.6	Pass
NVNT	ac40	5795	5875	-47	-46.69	2.0	-41.83	Peak	10	Pass
NVNT	ac40	5795	5875	-56.53	-56.66	2.0	-51.58	Average	10	Pass
NVNT	ac40	5795	5925	-49.97	-47.91	2.0	-43.81	Peak	-27	Pass
NVNT	ac40	5795	5925	-57.23	-57.21	2.0	-52.21	Average	-27	Pass
NVNT	ac80	5775	5850	-36.61	-38.6	2.0	-32.48	Peak	27	Pass
NVNT	ac80	5775	5850	-48.1	-49.13	2.0	-43.57	Average	27	Pass
NVNT	ac80	5775	5855	-36.14	-39.78	2.0	-32.58	Peak	15.6	Pass
NVNT	ac80	5775	5855	-49.54	-50.16	2.0	-44.83	Average	15.6	Pass
NVNT	ac80	5775	5875	-41.77	-42.98	2.0	-37.32	Peak	10	Pass
NVNT	ac80	5775	5875	-54.2	-55.4	2.0	-49.75	Average	10	Pass
NVNT	ac80	5775	5925	-47.94	-48.57	2.0	-43.23	Peak	-27	Pass
NVNT	ac80	5775	5925	-57.28	-56.72	2.0	-51.98	Average	-27	Pass
NVNT	ac80	5775	5650	-44.36	-47.95	2.0	-40.78	Peak	-27	Pass
NVNT	ac80	5775	5650	-54.4	-55.02	2.0	-49.69	Average	-27	Pass
NVNT	ac80	5775	5700	-37	-36.59	2.0	-31.78	Peak	10	Pass
NVNT	ac80	5775	5700	-47.19	-47.78	2.0	-42.46	Average	10	Pass
NVNT	ac80	5775	5720	-32.05	-35.53	2.0	-28.44	Peak	15.6	Pass
NVNT	ac80	5775	5720	-45.93	-46.15	2.0	-41.03	Average	15.6	Pass
NVNT	ac80	5775	5725	-35.31	-34.63	2.0	-29.95	Peak	27	Pass
NVNT	ac80	5775	5725	-44.14	-46.07	2.0	-39.99	Average	27	Pass
NVNT	ax20	5745	5650	-49.76	-49.31	2.0	-44.52	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5745	5650	-56.71	-57.04	2.0	-51.86	Average	-27	Pass
NVNT	ax20	5745	5700	-46.27	-48.31	2.0	-42.16	Peak	10	Pass
NVNT	ax20	5745	5700	-55.92	-55.47	2.0	-50.68	Average	10	Pass
NVNT	ax20	5745	5720	-40.72	-45.14	2.0	-37.38	Peak	15.6	Pass
NVNT	ax20	5745	5720	-53.22	-53.41	2.0	-48.30	Average	15.6	Pass
NVNT	ax20	5745	5725	-36.46	-40.13	2.0	-32.91	Peak	27	Pass
NVNT	ax20	5745	5725	-50.07	-50.8	2.0	-45.41	Average	27	Pass
NVNT	ax20	5825	5850	-39.87	-34.55	2.0	-31.43	Peak	27	Pass
NVNT	ax20	5825	5850	-53.25	-52.29	2.0	-47.73	Average	27	Pass
NVNT	ax20	5825	5855	-36.6	-39.81	2.0	-32.90	Peak	15.6	Pass
NVNT	ax20	5825	5855	-54.55	-54.15	2.0	-49.34	Average	15.6	Pass
NVNT	ax20	5825	5875	-46.65	-49.11	2.0	-42.70	Peak	10	Pass
NVNT	ax20	5825	5875	-56.2	-56.41	2.0	-51.29	Average	10	Pass
NVNT	ax20	5825	5925	-49.03	-48.61	2.0	-43.80	Peak	-27	Pass
NVNT	ax20	5825	5925	-57.25	-56.87	2.0	-52.05	Average	-27	Pass
NVNT	ax40	5755	5650	-47.86	-47.85	2.0	-42.84	Peak	-27	Pass
NVNT	ax40	5755	5650	-57.32	-56.31	2.0	-51.78	Average	-27	Pass
NVNT	ax40	5755	5700	-44.81	-44.76	2.0	-39.77	Peak	10	Pass
NVNT	ax40	5755	5700	-53.93	-55.75	2.0	-49.74	Average	10	Pass
NVNT	ax40	5755	5720	-38.01	-44.24	2.0	-35.08	Peak	15.6	Pass
NVNT	ax40	5755	5720	-50.74	-53.61	2.0	-46.93	Average	15.6	Pass
NVNT	ax40	5755	5725	-33.42	-40.31	2.0	-30.61	Peak	27	Pass
NVNT	ax40	5755	5725	-46.86	-51.77	2.0	-43.64	Average	27	Pass
NVNT	ax40	5795	5850	-47.03	-45.01	2.0	-40.89	Peak	27	Pass
NVNT	ax40	5795	5850	-56.53	-56.57	2.0	-51.54	Average	27	Pass
NVNT	ax40	5795	5855	-49.02	-46.69	2.0	-42.69	Peak	15.6	Pass
NVNT	ax40	5795	5855	-57.12	-57.16	2.0	-52.13	Average	15.6	Pass
NVNT	ax40	5795	5875	-48.93	-50.01	2.0	-44.43	Peak	10	Pass
NVNT	ax40	5795	5875	-57.29	-57.24	2.0	-52.25	Average	10	Pass
NVNT	ax40	5795	5925	-49.65	-48.33	2.0	-43.93	Peak	-27	Pass
NVNT	ax40	5795	5925	-57.41	-56.59	2.0	-51.97	Average	-27	Pass
NVNT	ax80	5775	5850	-40.06	-45.19	2.0	-36.90	Peak	27	Pass
NVNT	ax80	5775	5850	-52.28	-54.62	2.0	-48.28	Average	27	Pass
NVNT	ax80	5775	5855	-39.53	-42.83	2.0	-35.86	Peak	15.6	Pass
NVNT	ax80	5775	5855	-52.36	-54.29	2.0	-48.21	Average	15.6	Pass
NVNT	ax80	5775	5875	-44.66	-45.69	2.0	-40.13	Peak	10	Pass
NVNT	ax80	5775	5875	-54.78	-55.52	2.0	-50.12	Average	10	Pass
NVNT	ax80	5775	5925	-48.15	-49.31	2.0	-43.68	Peak	-27	Pass
NVNT	ax80	5775	5925	-56.78	-56.79	2.0	-51.77	Average	-27	Pass
NVNT	ax80	5775	5650	-45.46	-48.53	2.0	-41.72	Peak	-27	Pass
NVNT	ax80	5775	5650	-55.56	-56.72	2.0	-51.09	Average	-27	Pass
NVNT	ax80	5775	5700	-36.8	-45.81	2.0	-34.29	Peak	10	Pass
NVNT	ax80	5775	5700	-53.14	-54.83	2.0	-48.89	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	5720	-41.13	-43.8	2.0	-37.25	Peak	15.6	Pass
NVNT	ax80	5775	5720	-52.76	-52.79	2.0	-47.76	Average	15.6	Pass
NVNT	ax80	5775	5725	-39.88	-41.71	2.0	-35.69	Peak	27	Pass
NVNT	ax80	5775	5725	-50.78	-51.8	2.0	-46.25	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



G.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant6	5745.02	20000	3.48	25	Pass
NVNT	a	5785	Ant6	5785.02	20000	3.46	25	Pass
NVNT	a	5825	Ant6	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant6	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant6	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant6	5825	0	0	25	Pass
NVNT	n40	5755	Ant6	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant6	5794.96	-40000	-6.9	25	Pass
NVNT	ac20	5745	Ant6	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant6	5785	0	0	25	Pass
NVNT	ac20	5825	Ant6	5825	0	0	25	Pass
NVNT	ac40	5755	Ant6	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant6	5795	0	0	25	Pass
NVNT	ac80	5775	Ant6	5775	0	0	25	Pass
NVNT	ax20	5745	Ant6	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant6	5785	0	0	25	Pass
NVNT	ax20	5825	Ant6	5825	0	0	25	Pass
NVNT	ax40	5755	Ant6	5755	0	0	25	Pass
NVNT	ax40	5795	Ant6	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant6	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant6

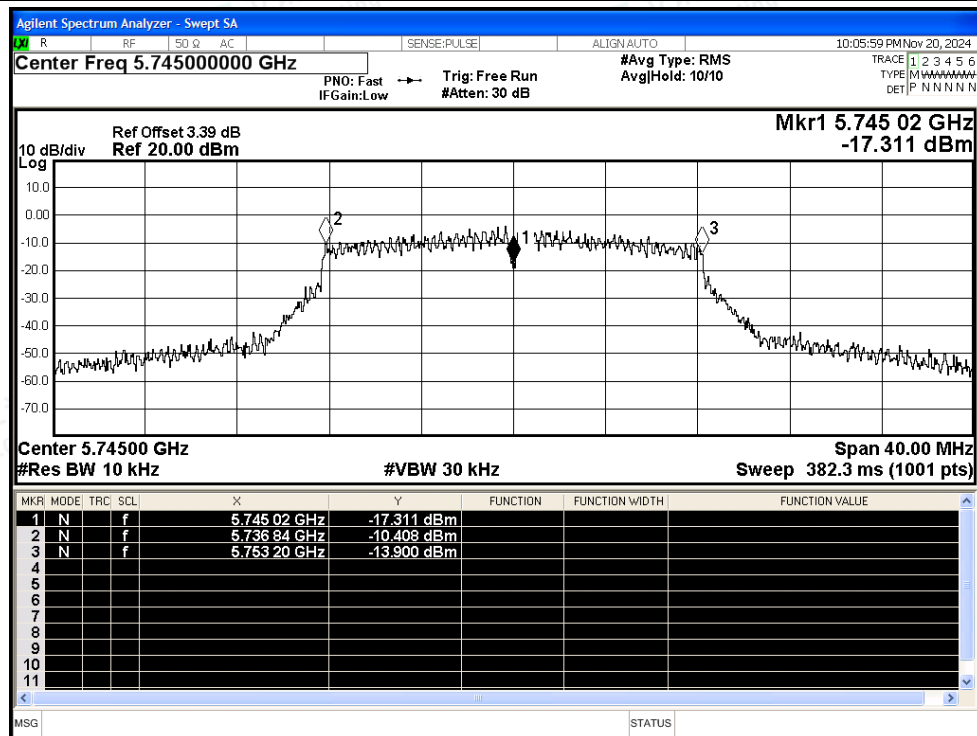

Freq. Stability NVNT a 5785MHz Ant6


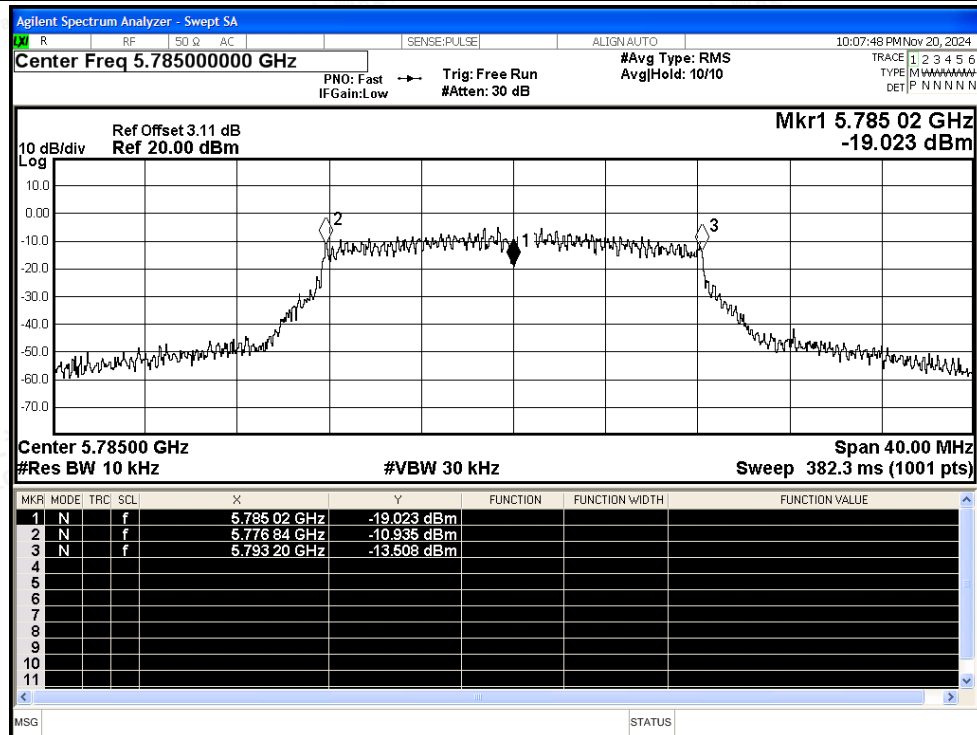


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

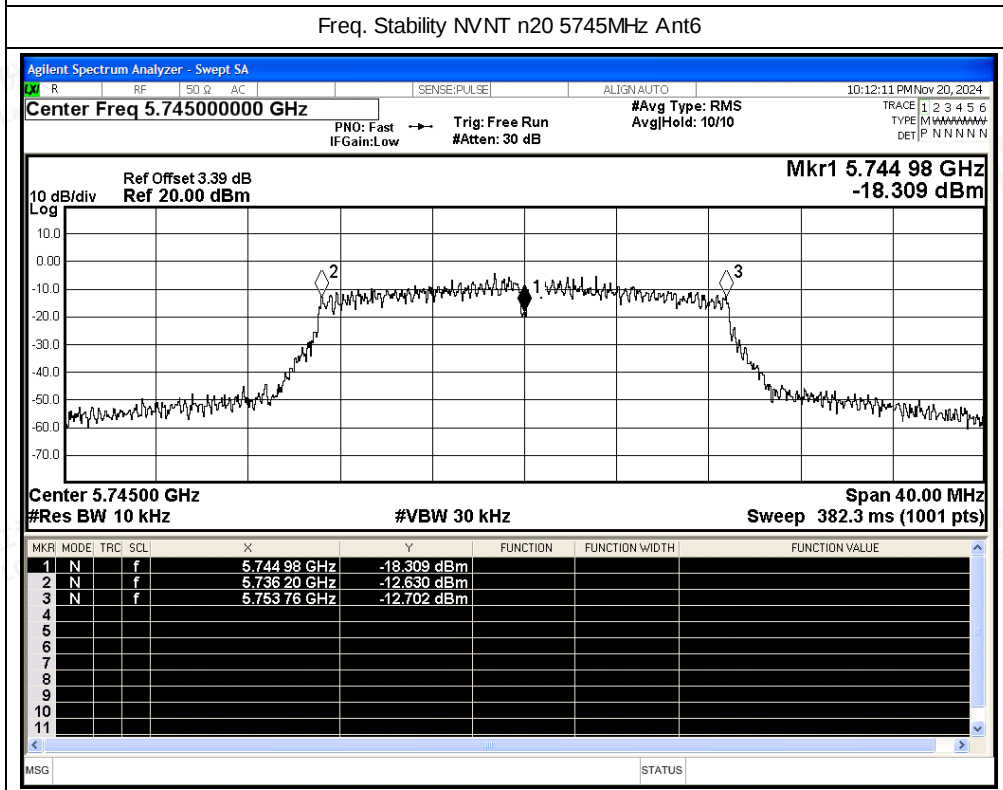
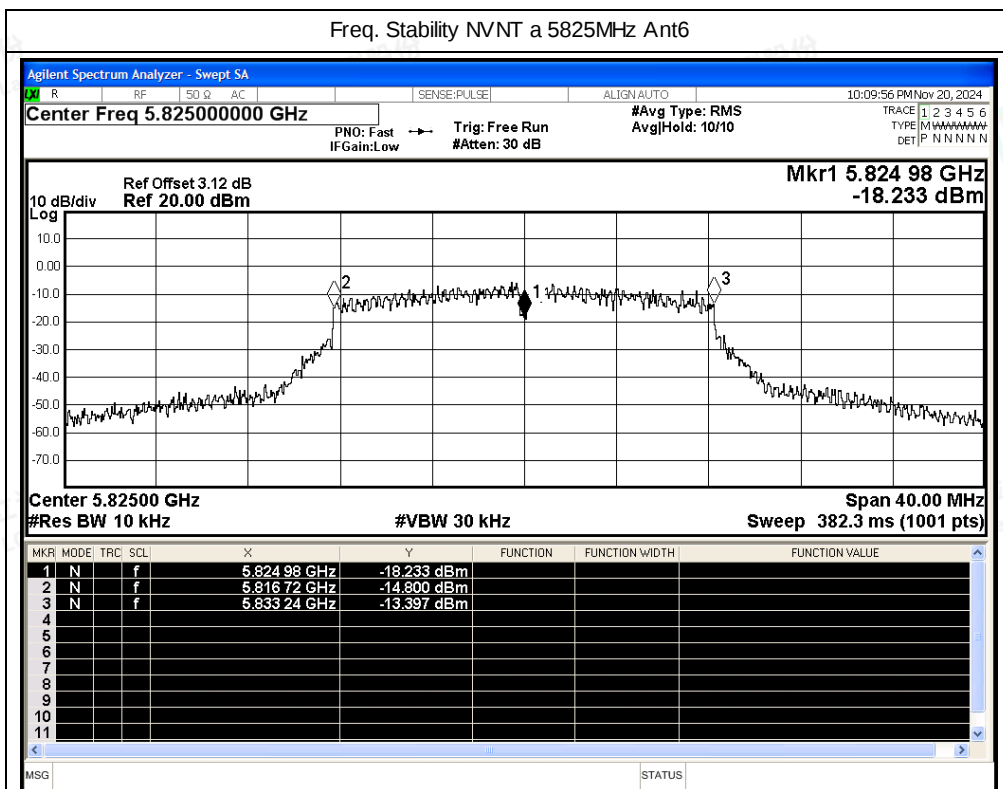


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

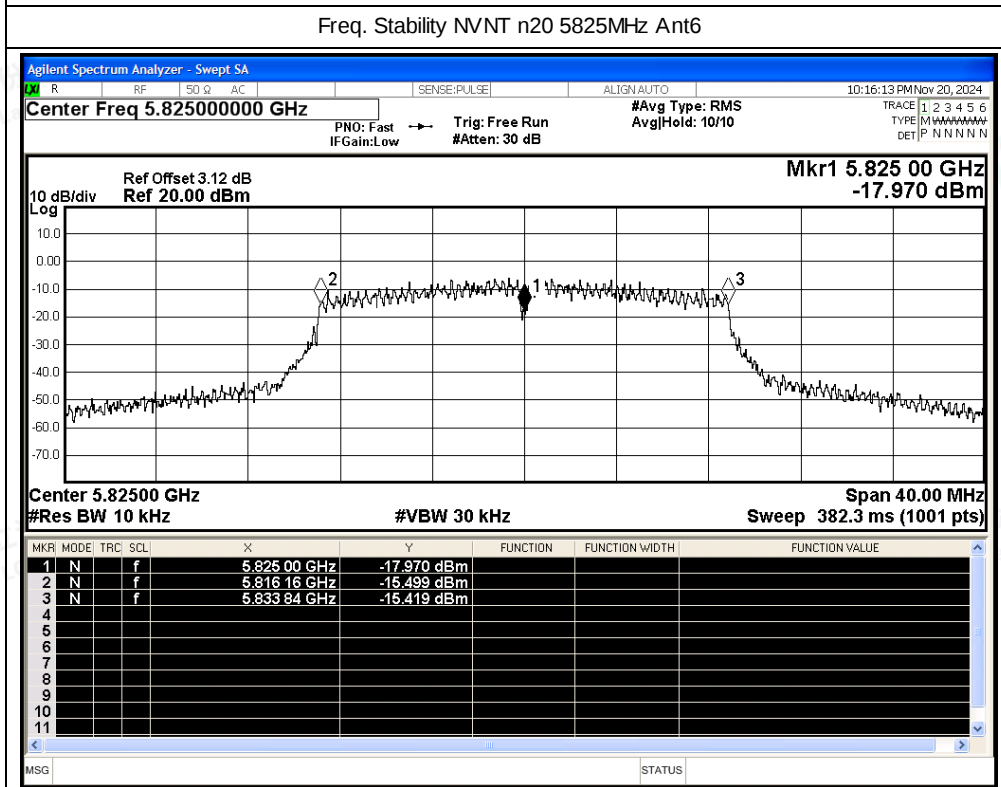
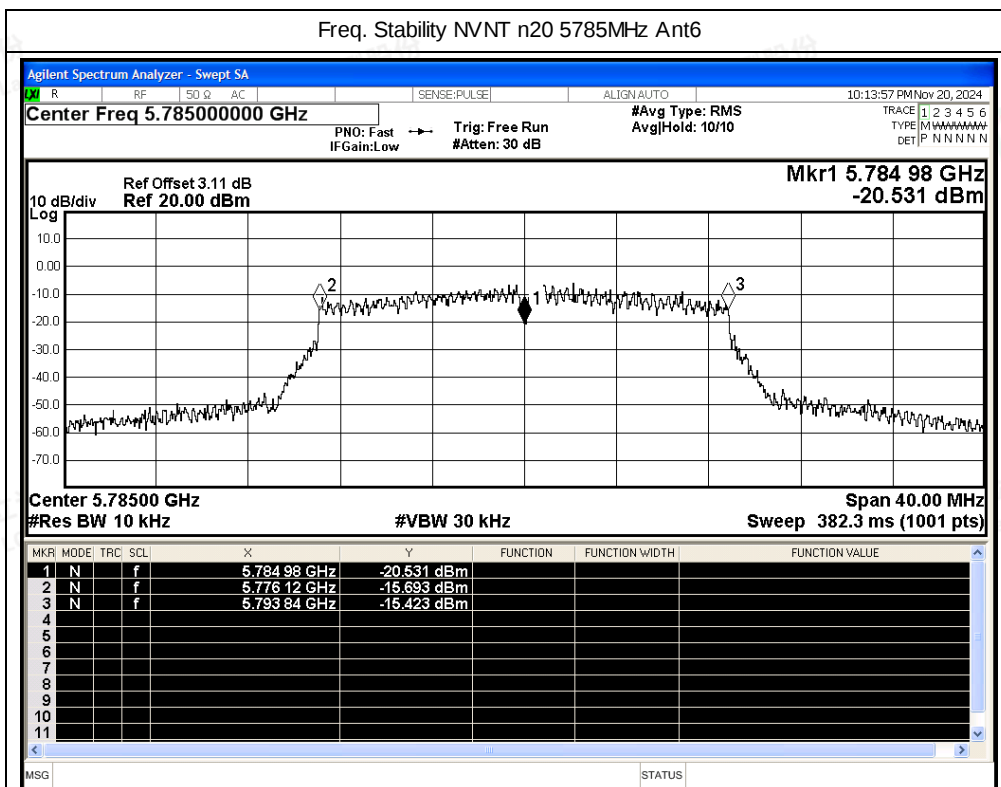




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

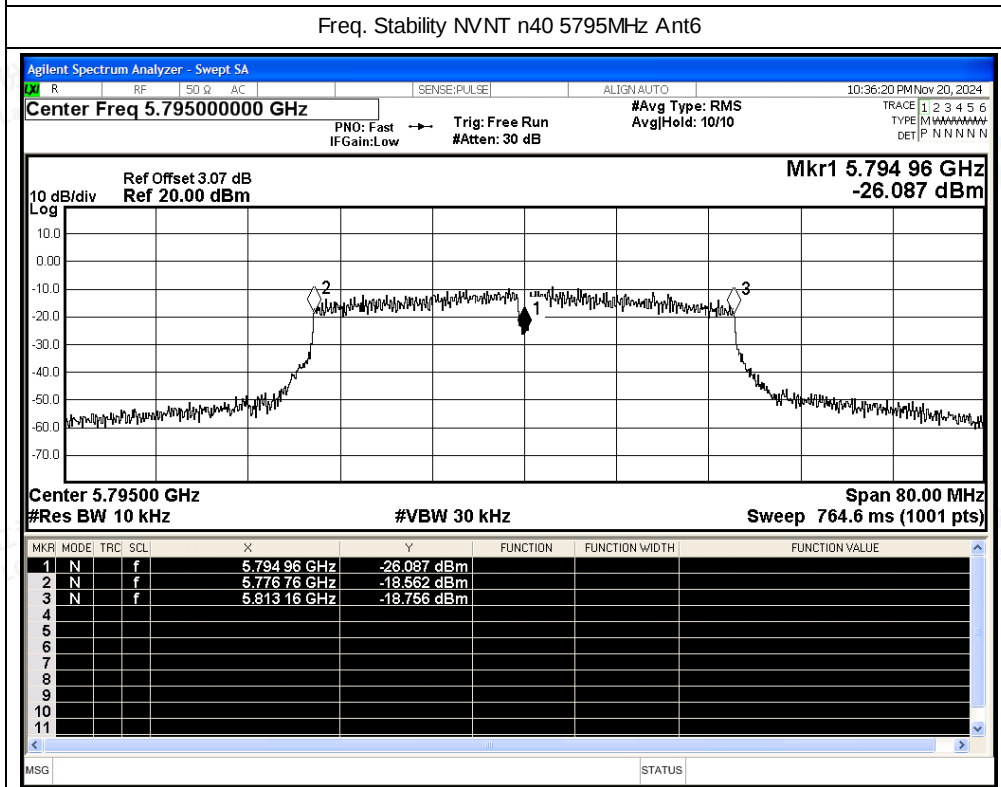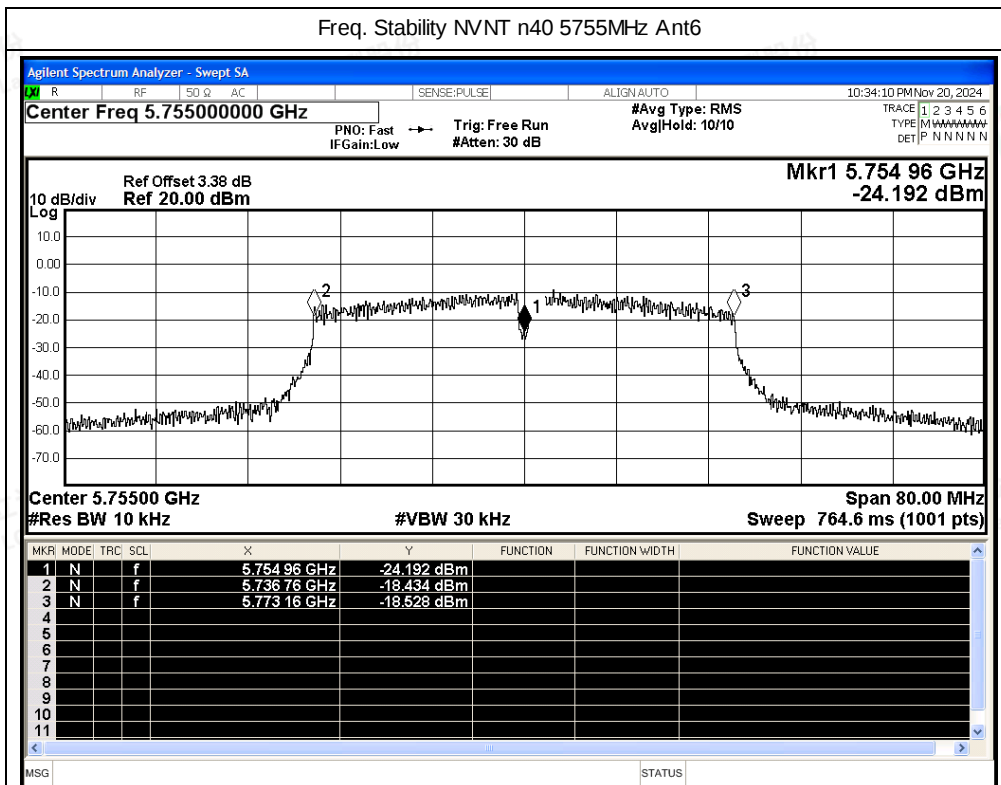

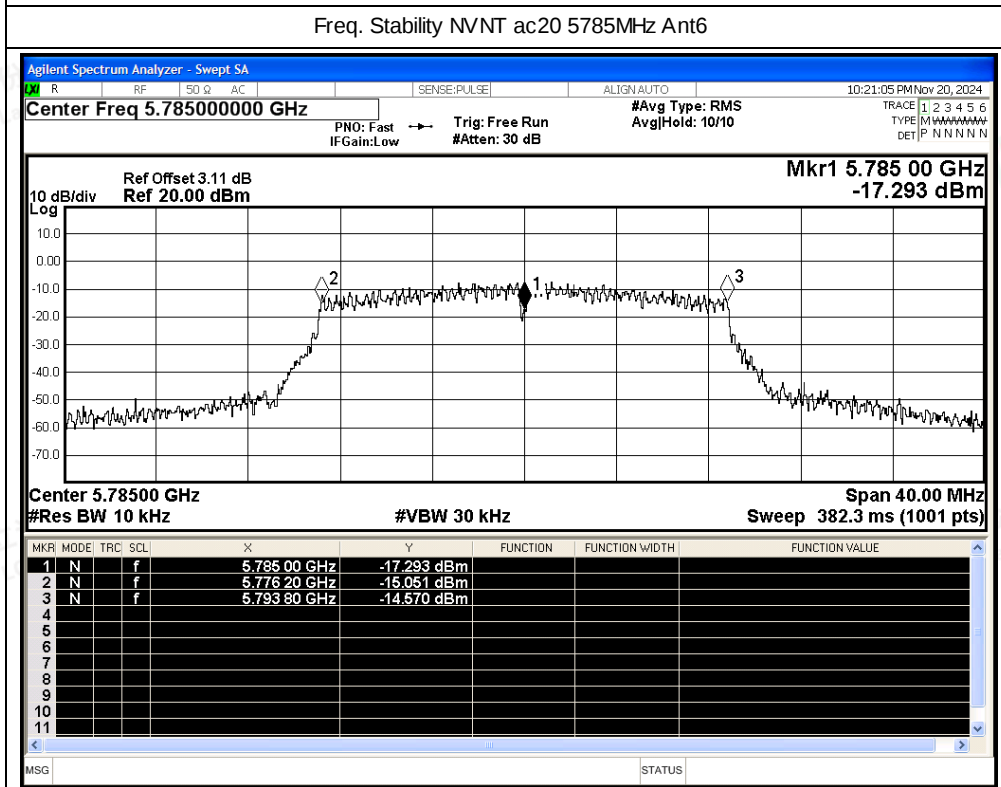
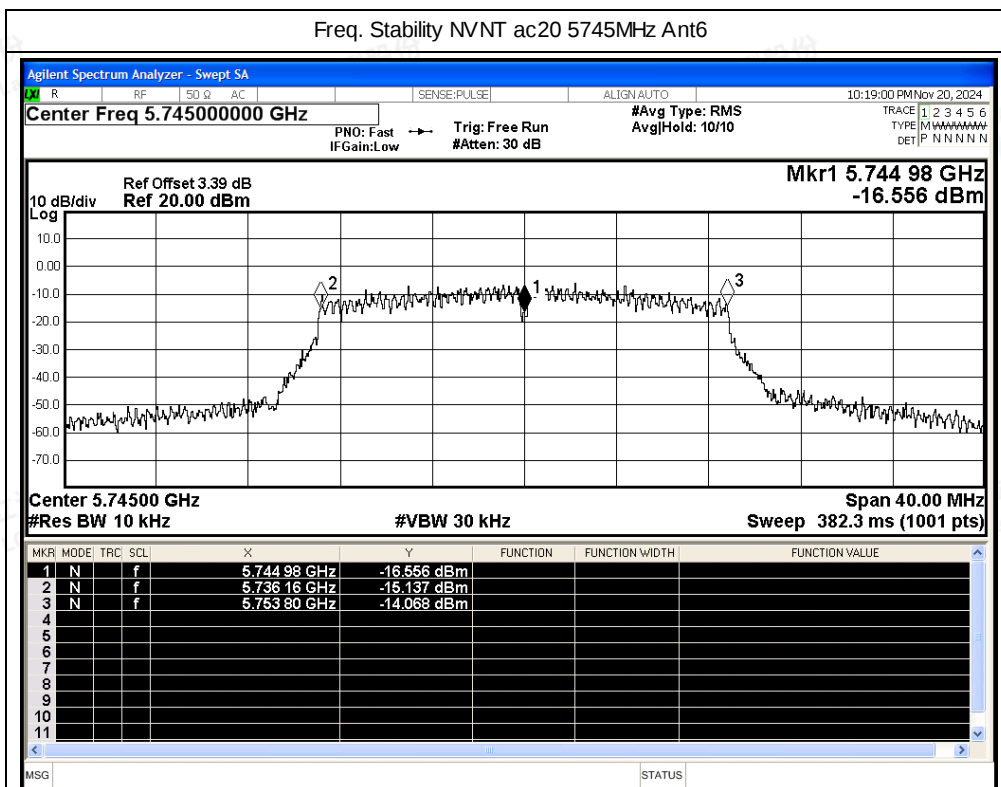


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

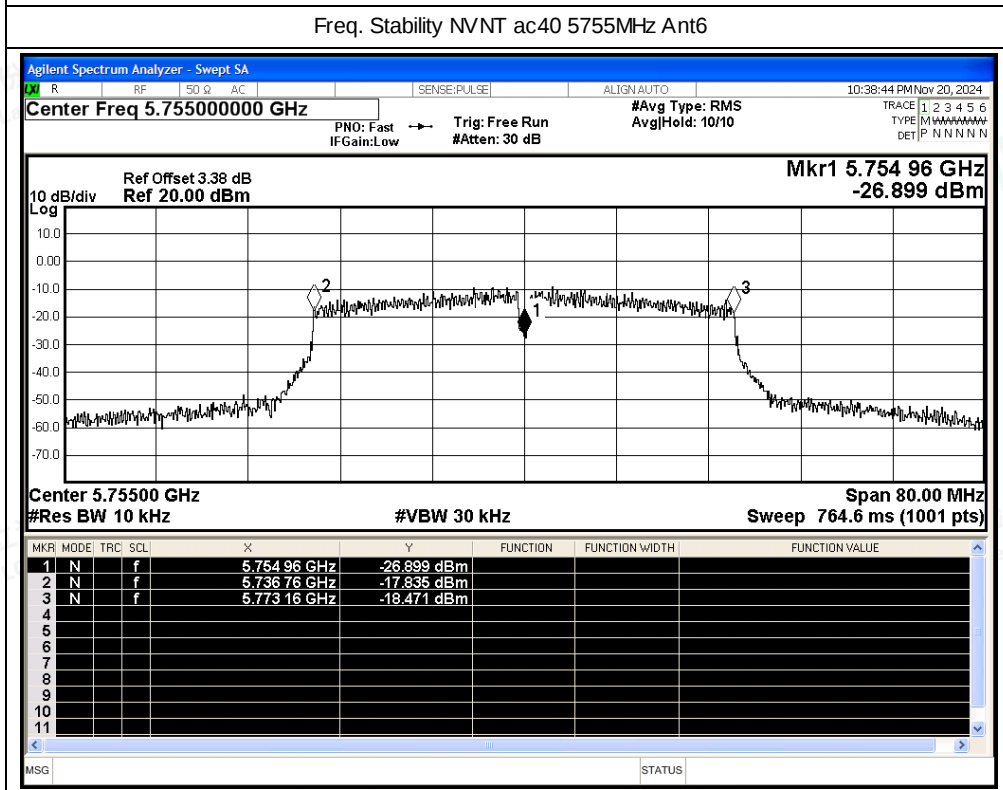
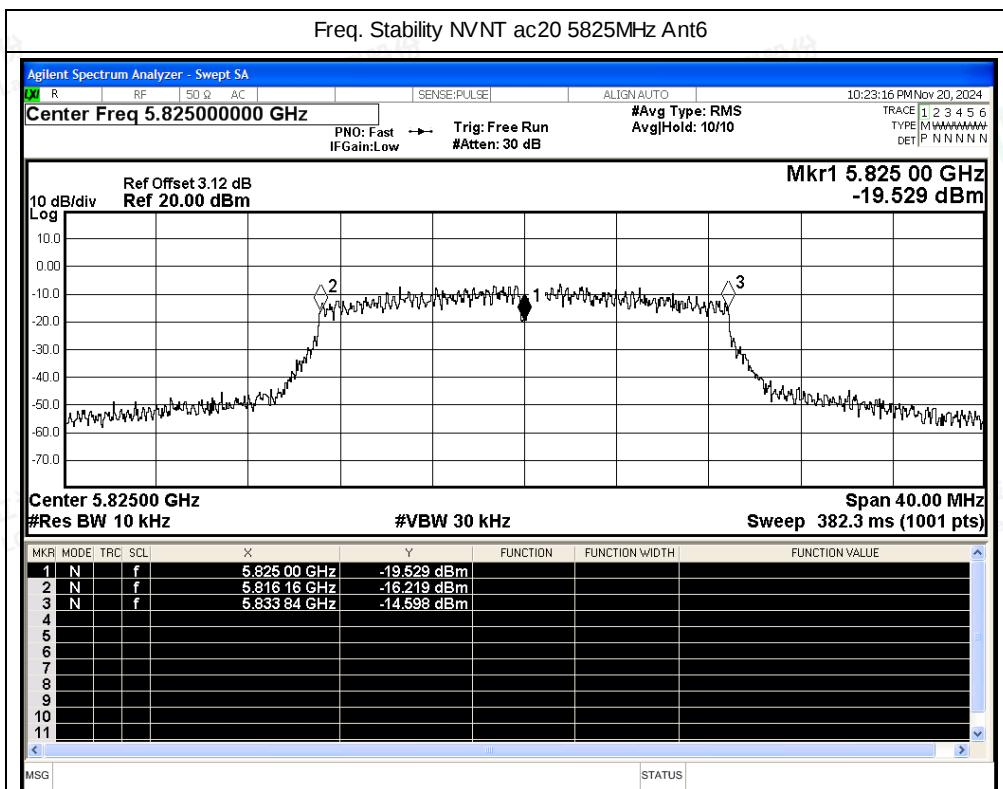


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

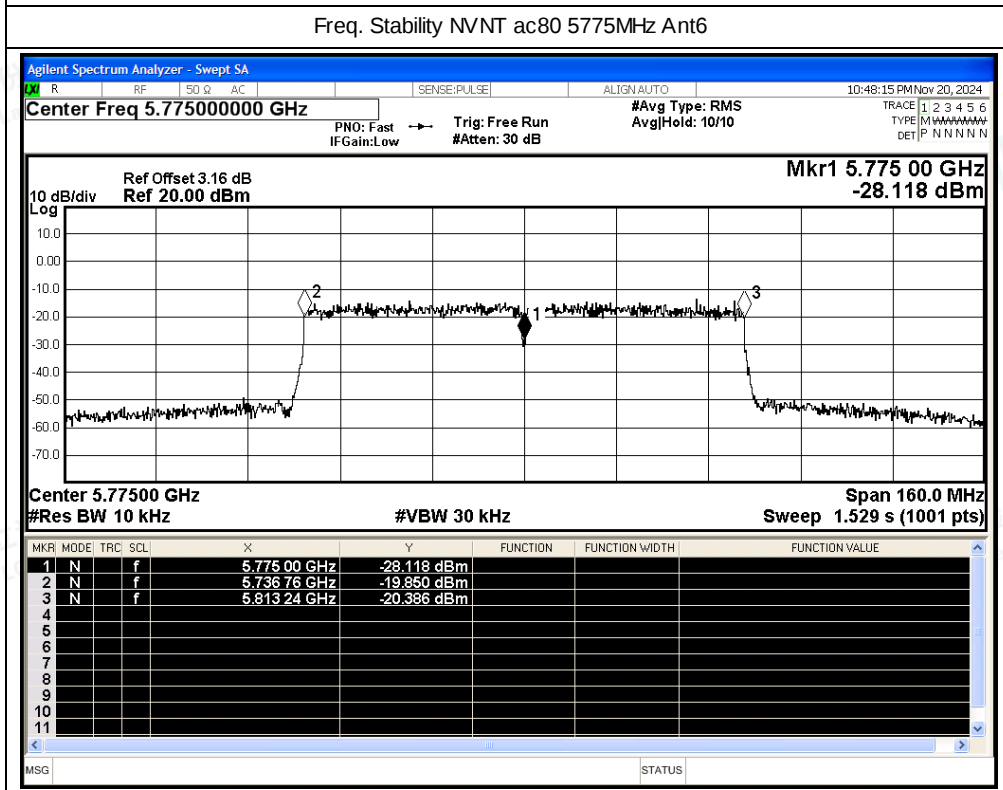
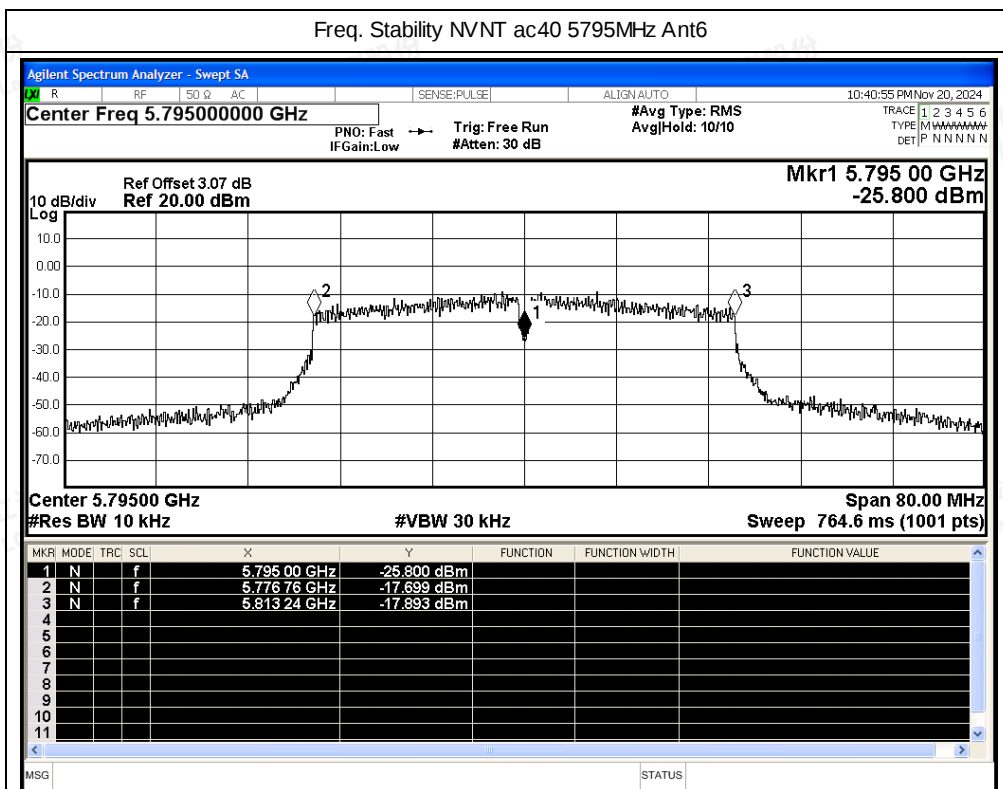


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

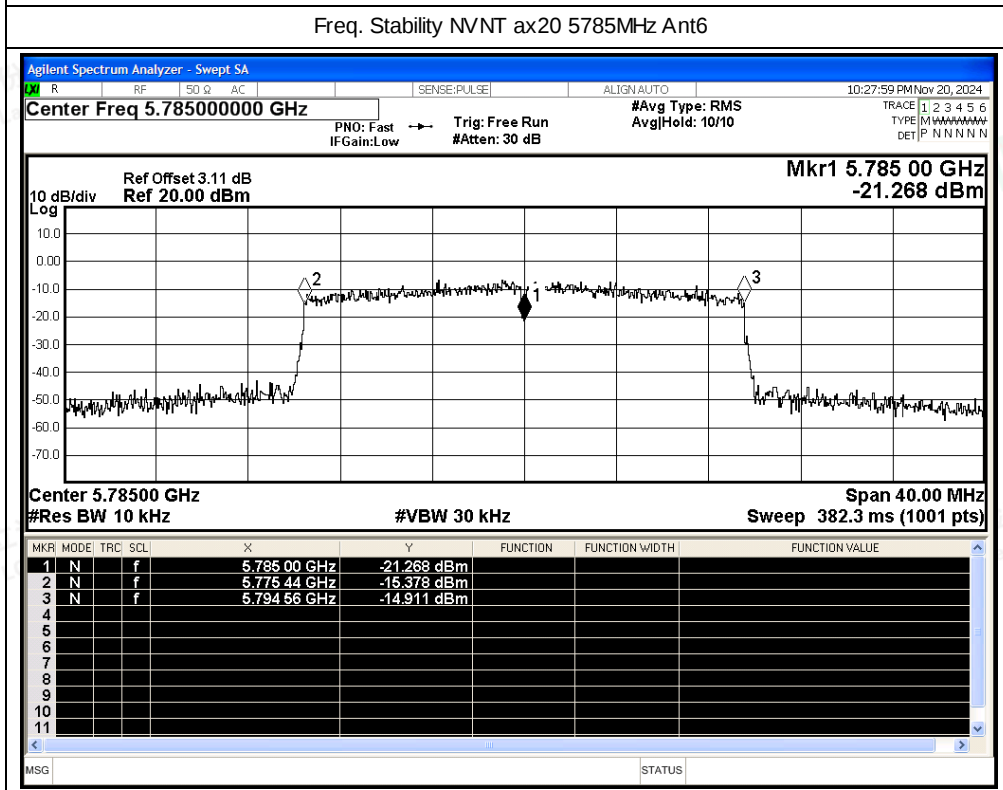
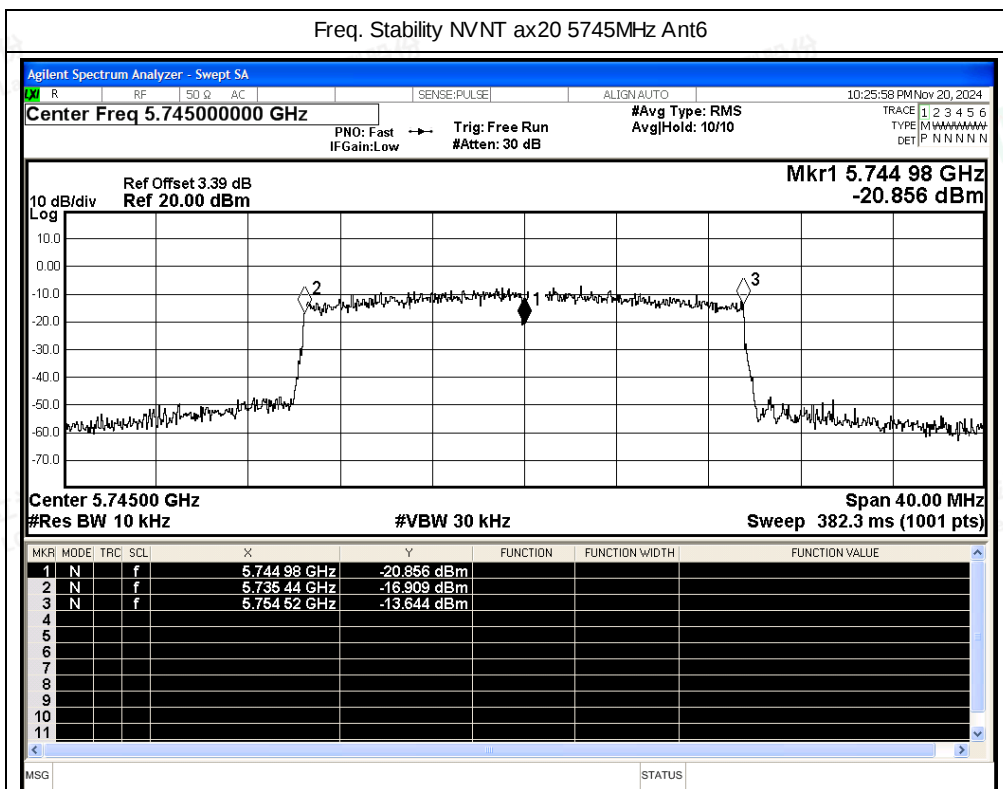


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

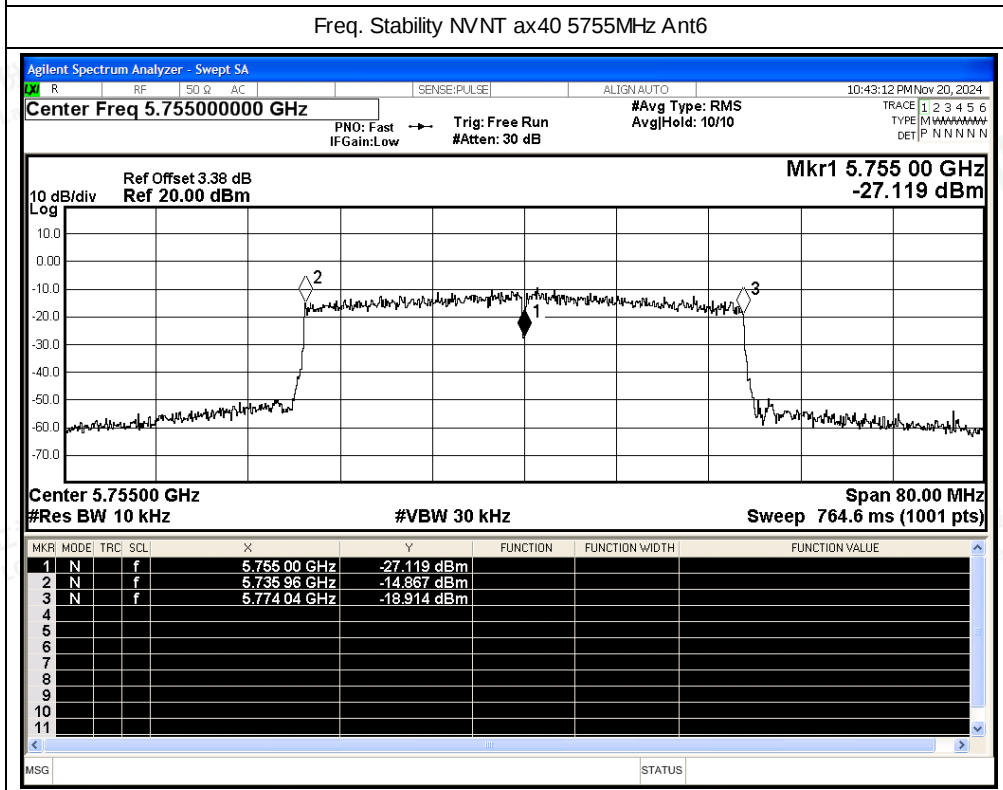
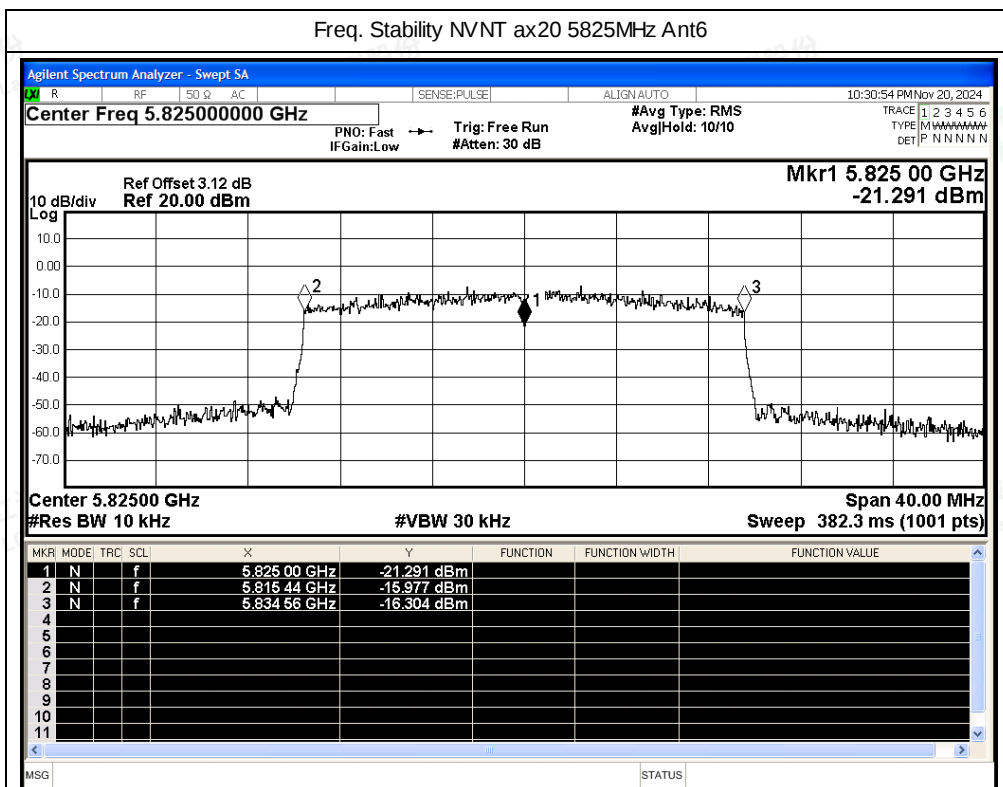


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

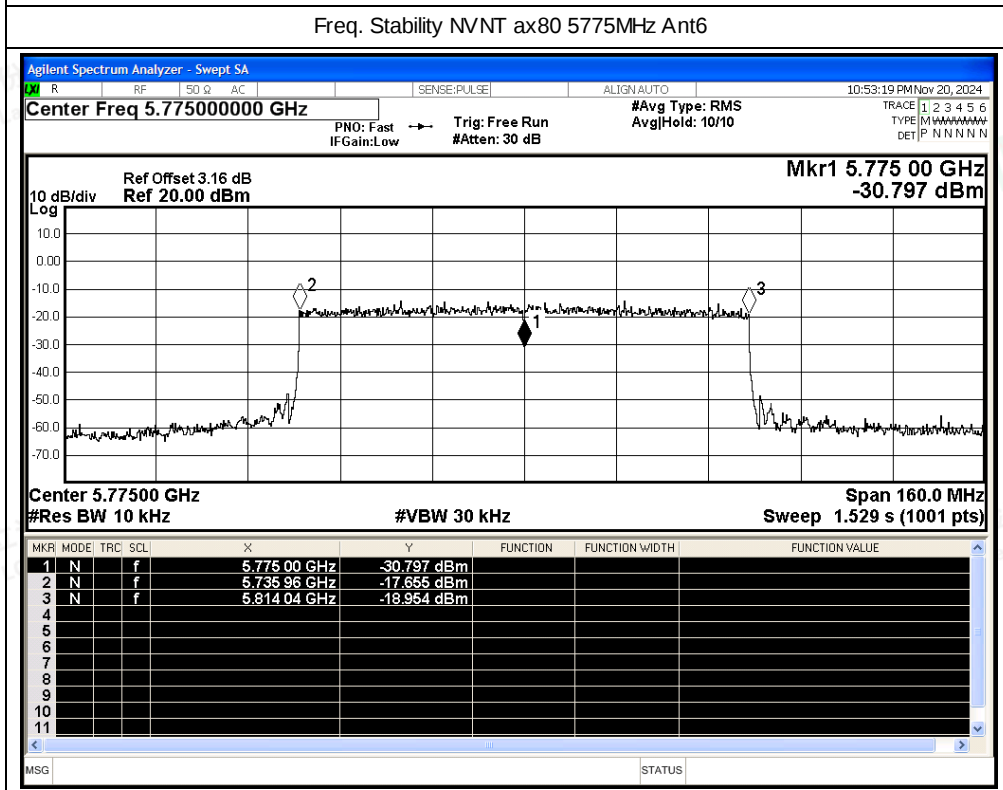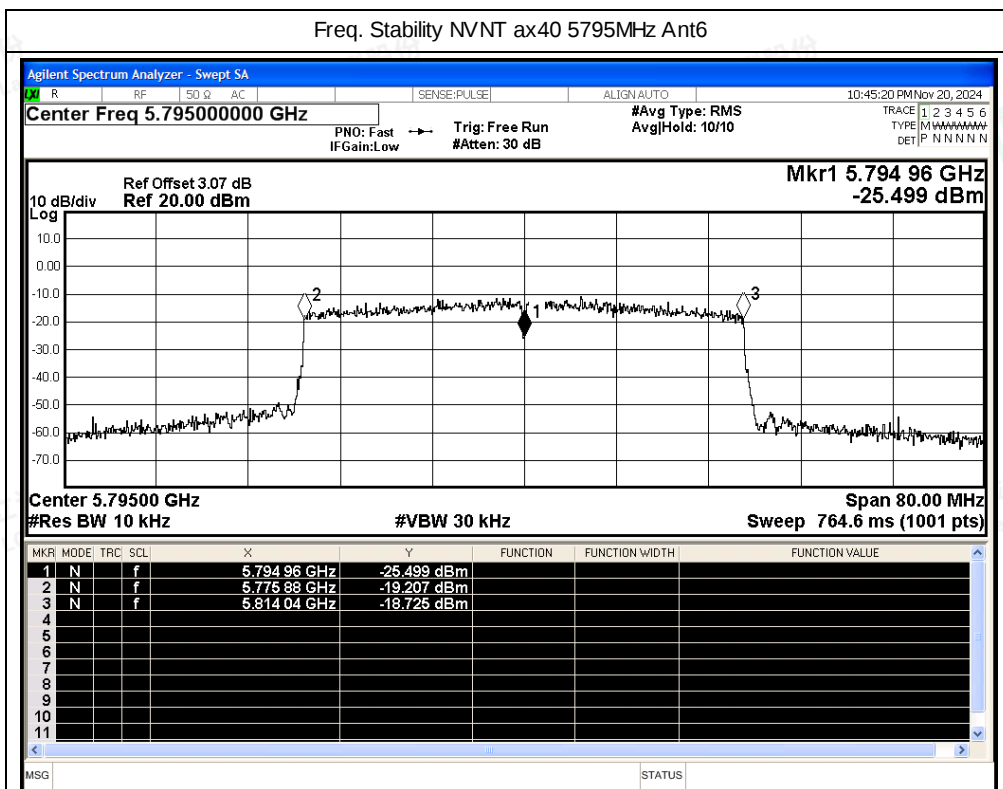

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant7	5745	0	0	25	Pass
NVNT	a	5785	Ant7	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant7	5824.96	-40000	-6.87	25	Pass
NVNT	n20	5745	Ant7	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant7	5784.96	-40000	-6.91	25	Pass
NVNT	n20	5825	Ant7	5825	0	0	25	Pass
NVNT	n40	5755	Ant7	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant7	5795	0	0	25	Pass
NVNT	ac20	5745	Ant7	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant7	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant7	5825	0	0	25	Pass
NVNT	ac40	5755	Ant7	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant7	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant7	5775	0	0	25	Pass
NVNT	ax20	5745	Ant7	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant7	5785	0	0	25	Pass
NVNT	ax20	5825	Ant7	5825	0	0	25	Pass
NVNT	ax40	5755	Ant7	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant7	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant7	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant7

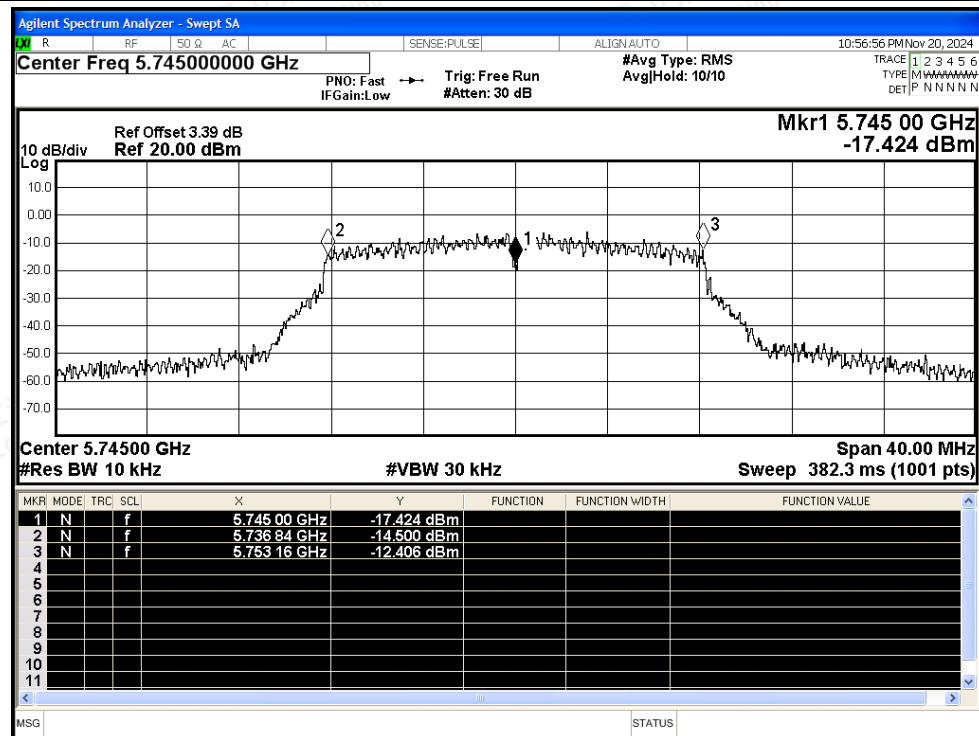

Freq. Stability NVNT a 5785MHz Ant7

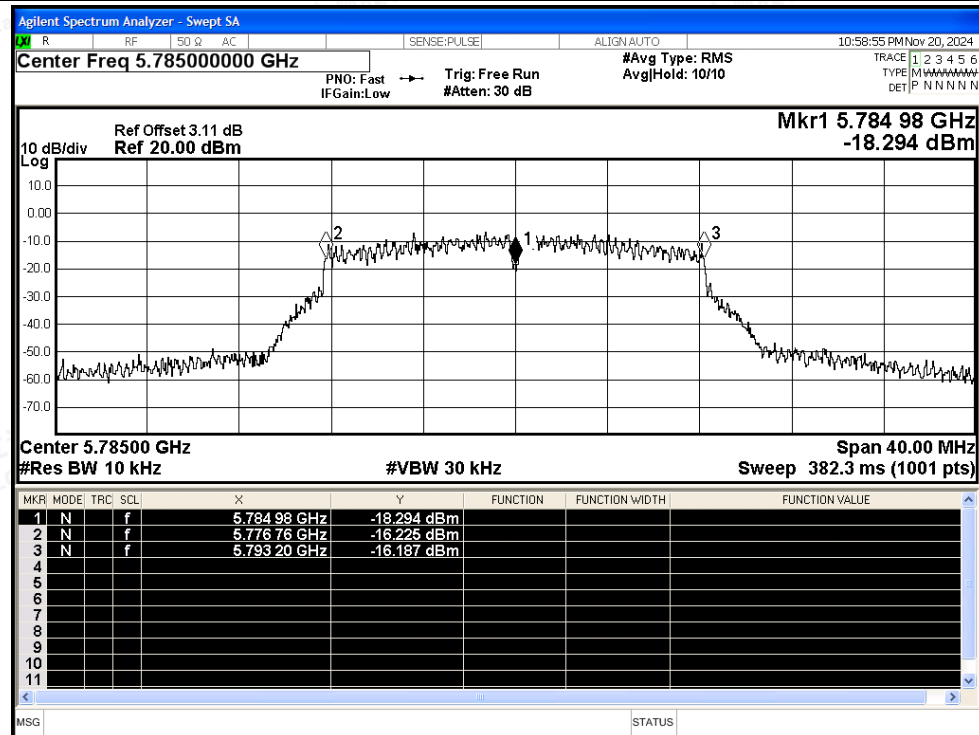

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant7

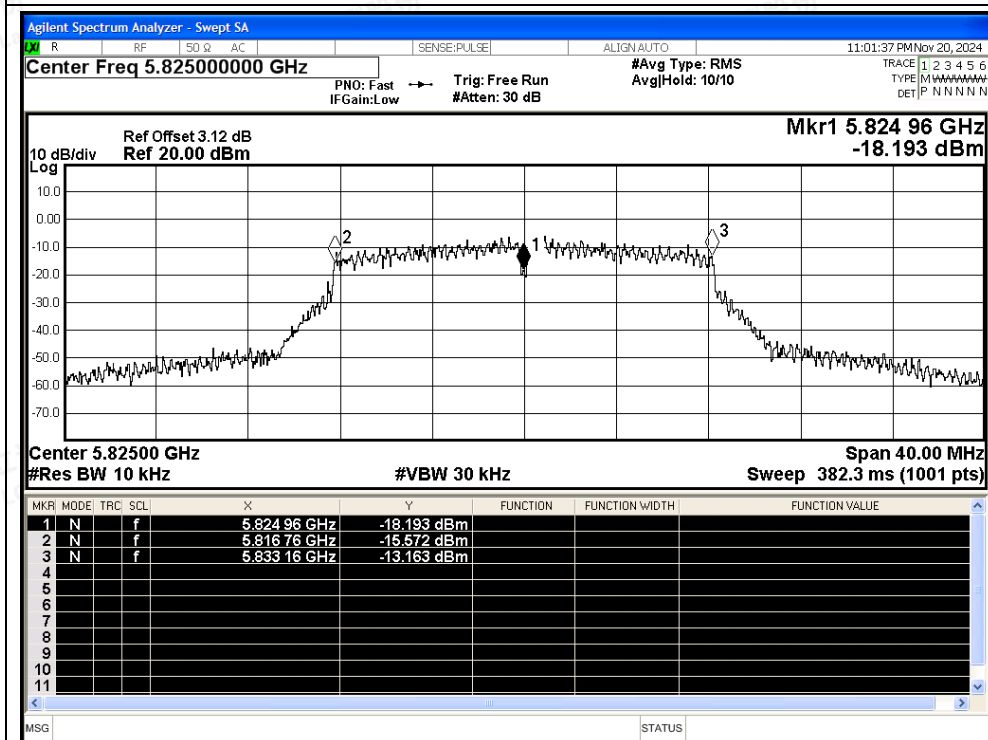

Freq. Stability NVNT n20 5745MHz Ant7

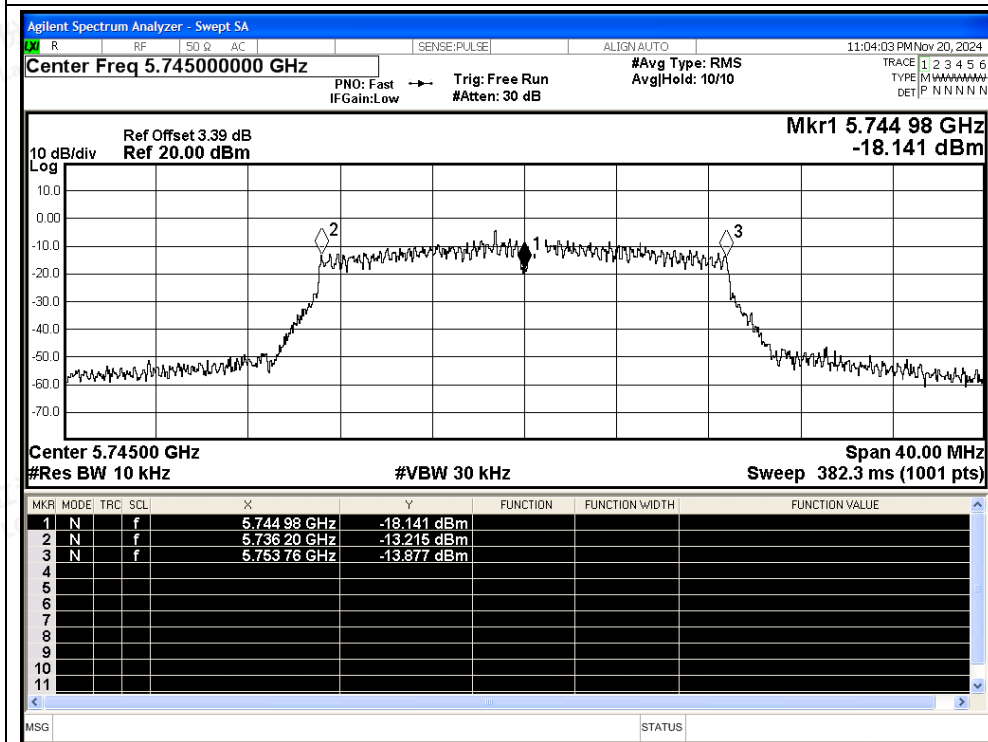

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant7

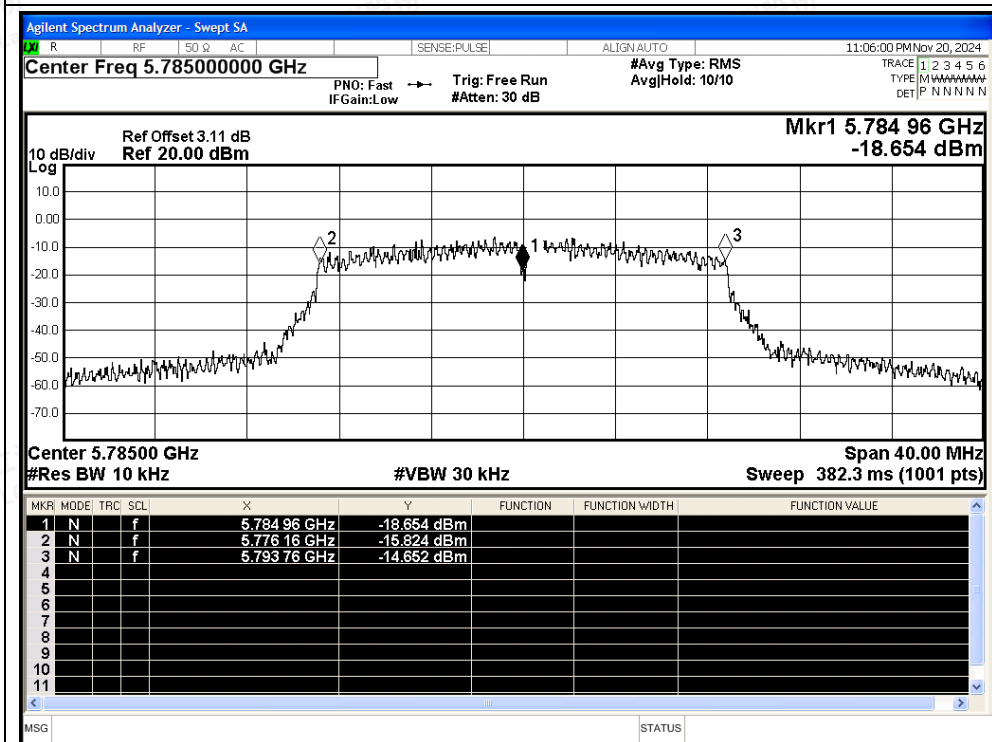

Freq. Stability NVNT n20 5825MHz Ant7


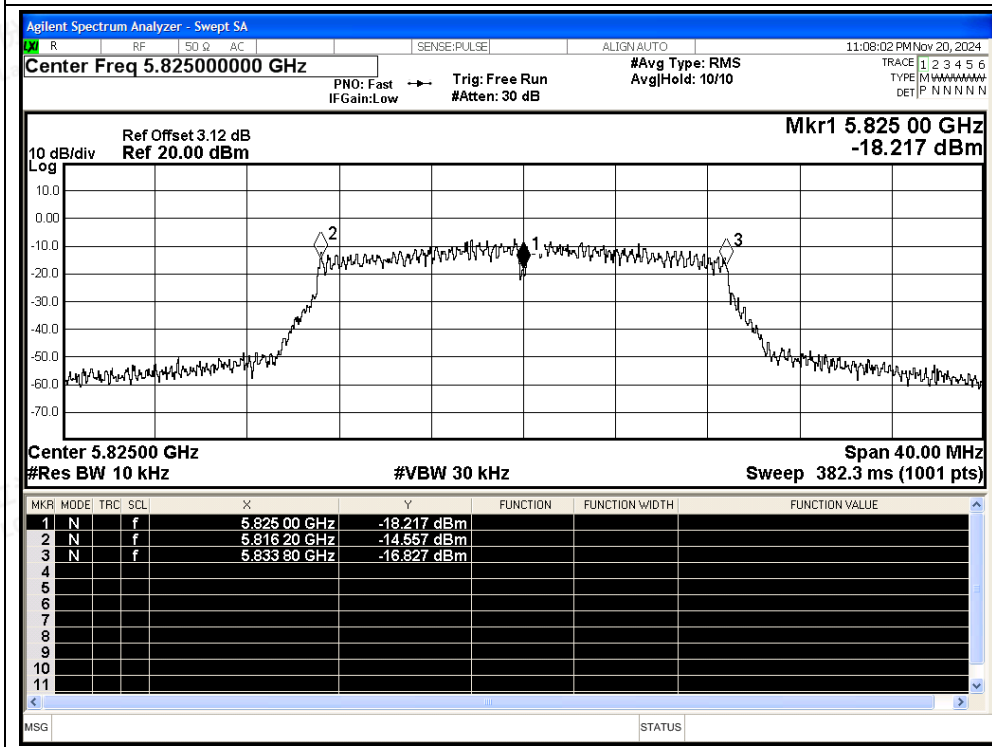


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

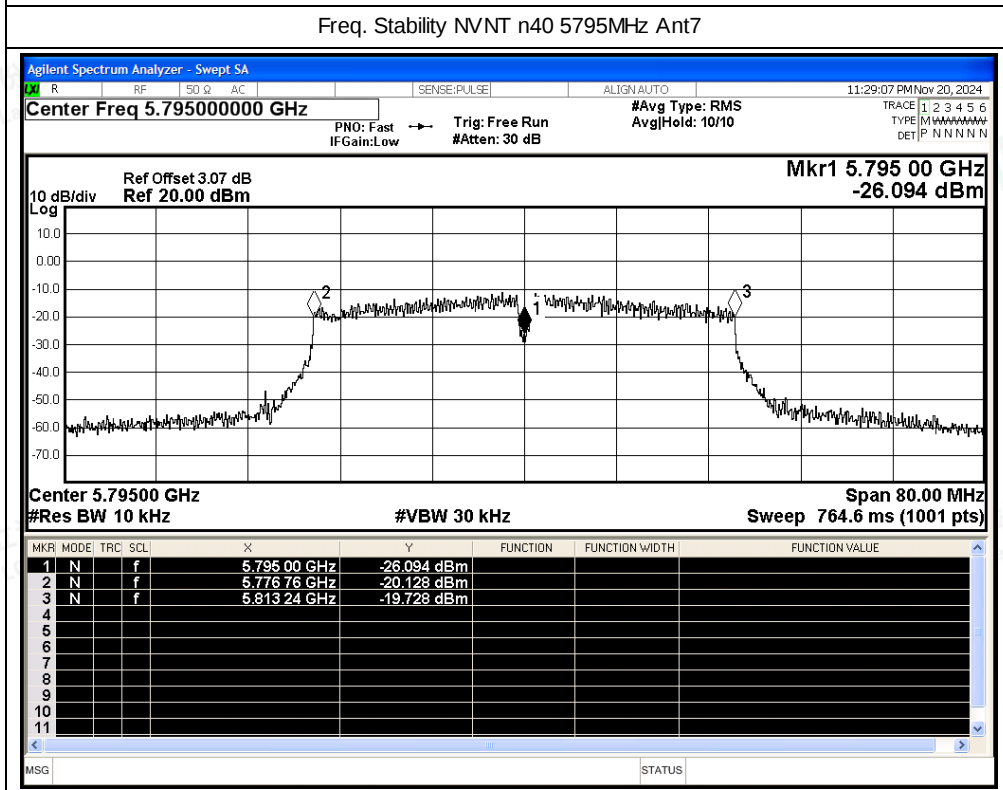
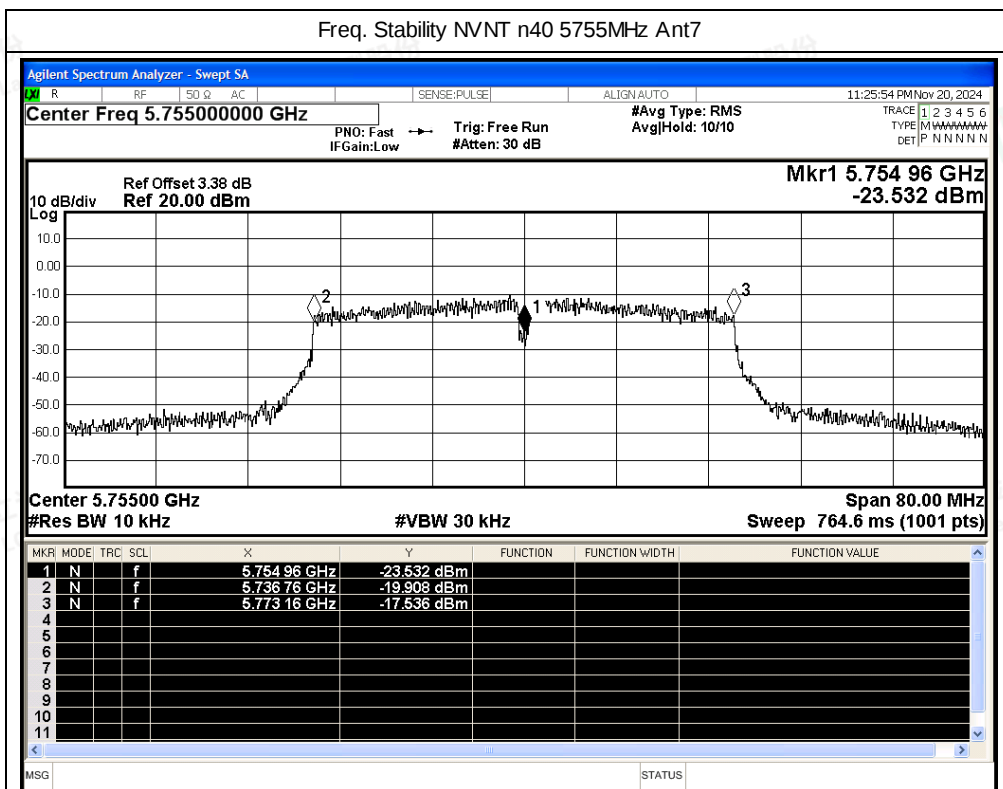


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

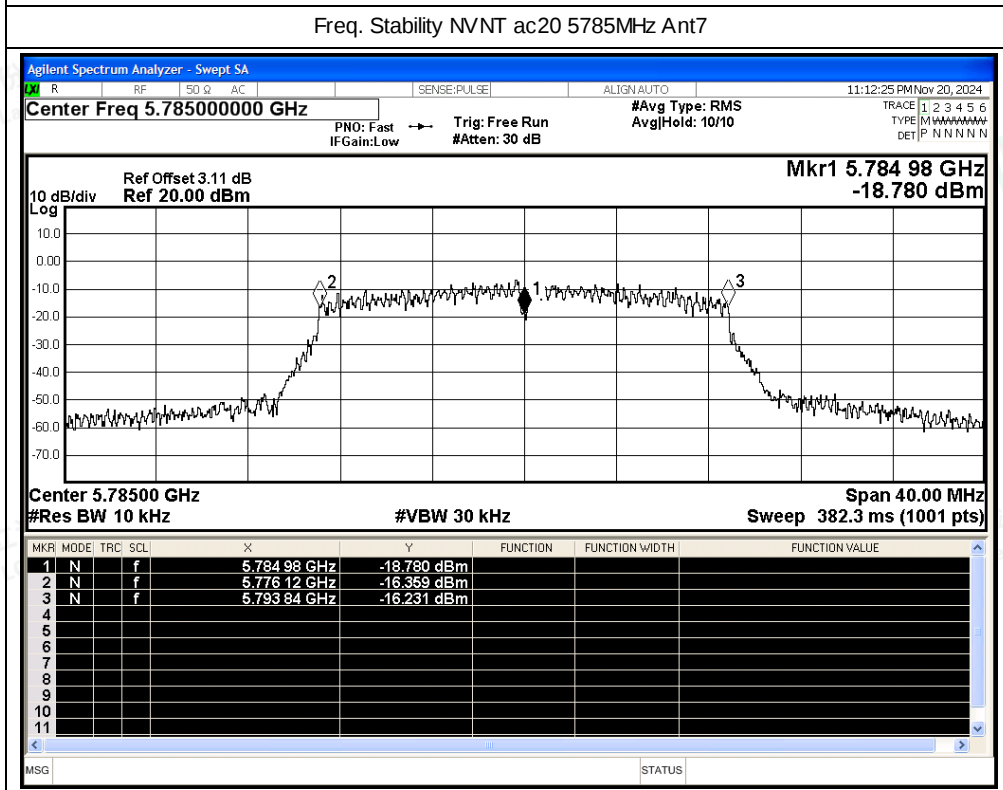
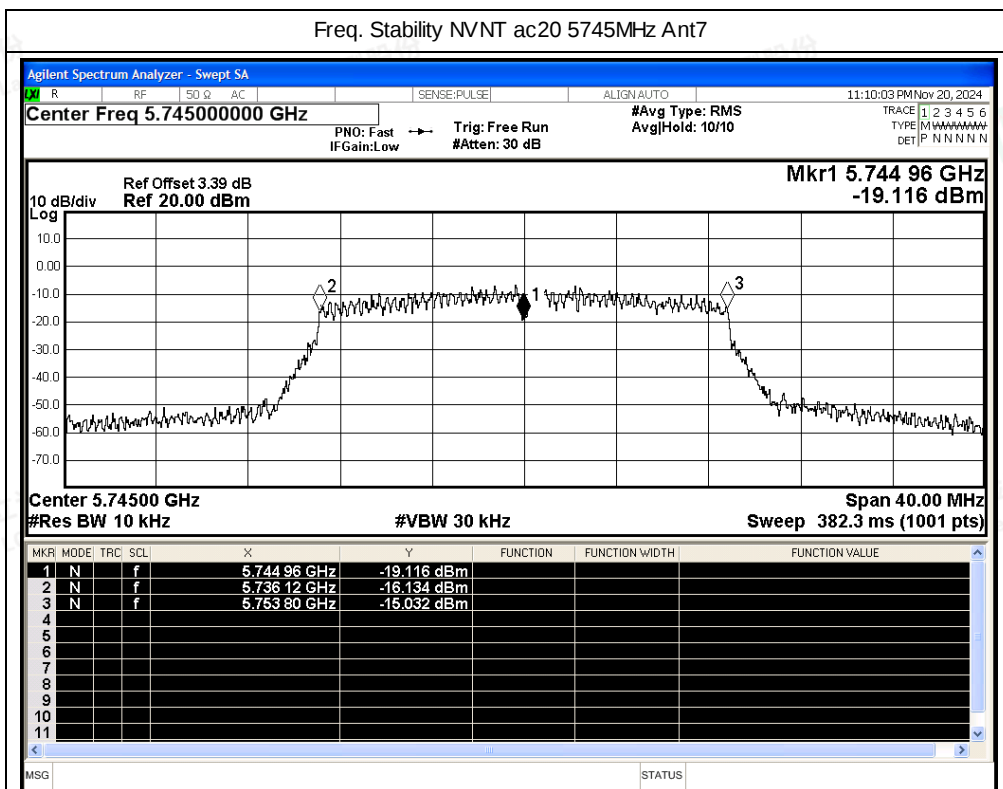


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

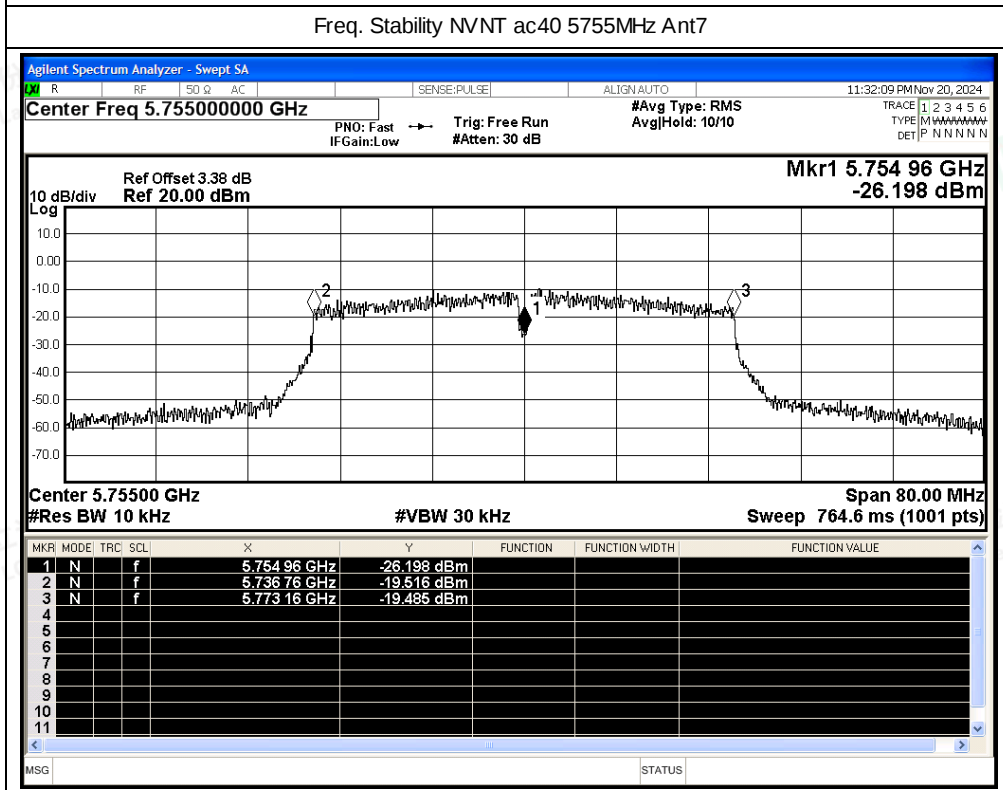
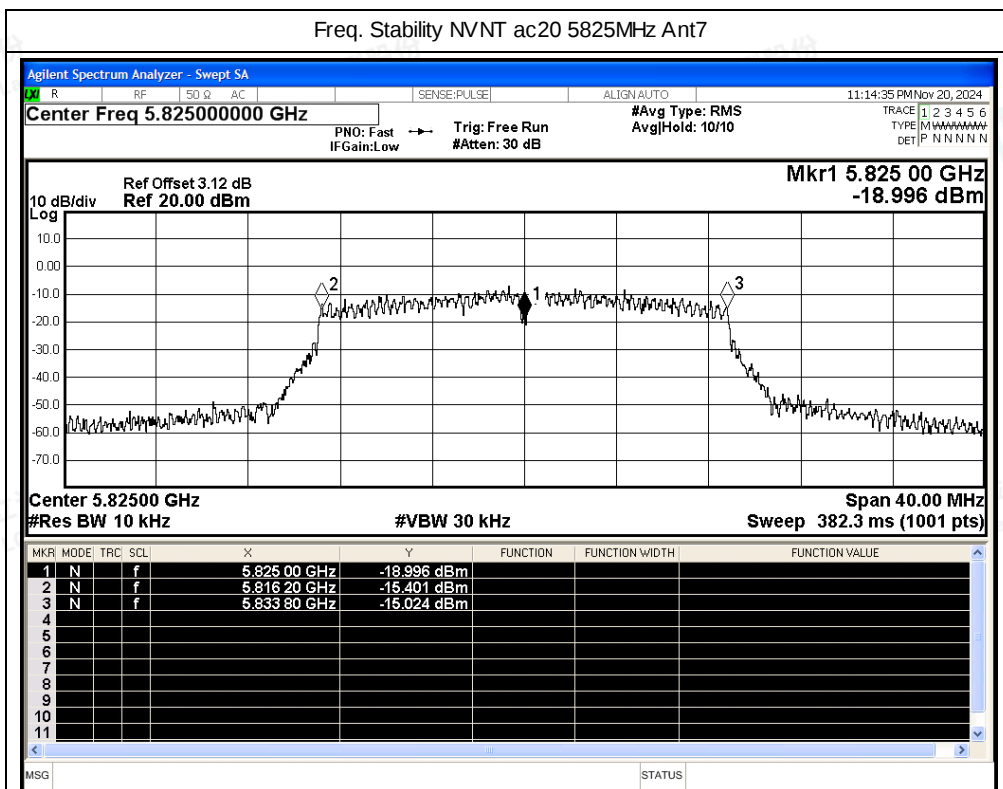


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

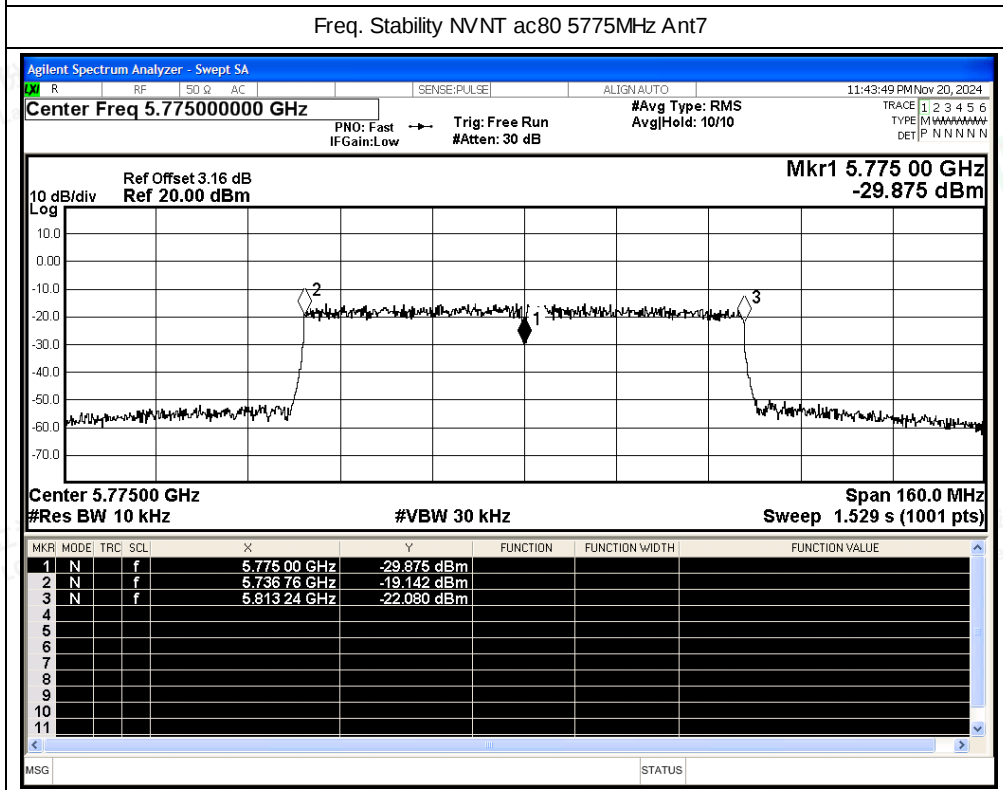
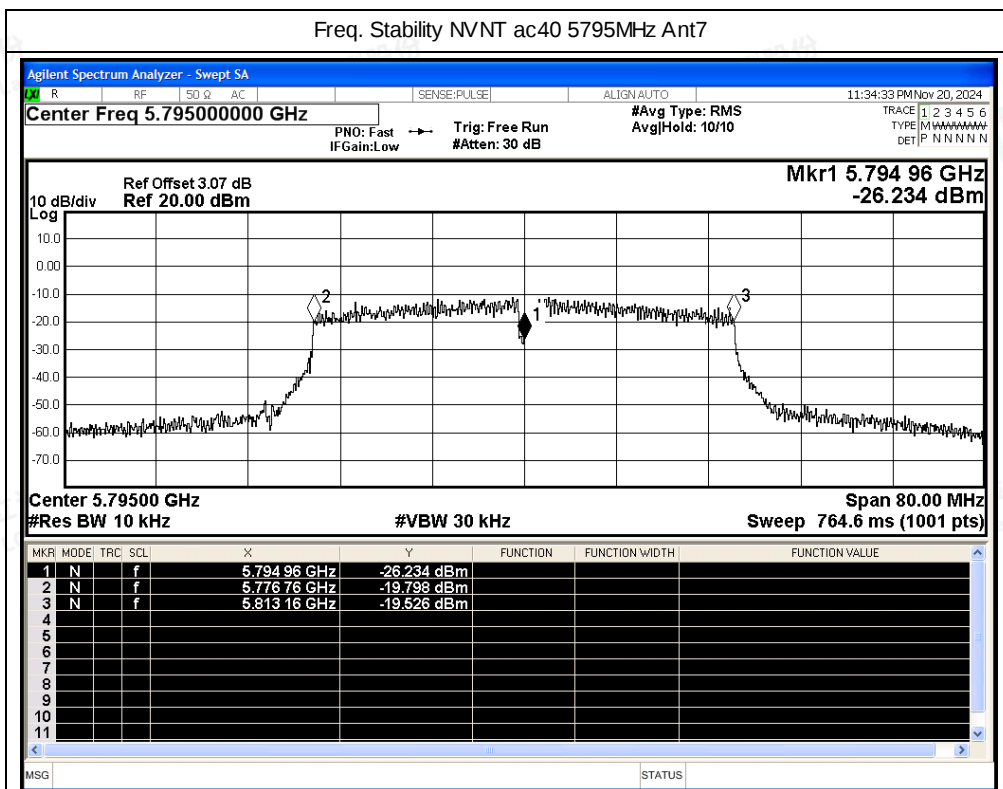


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

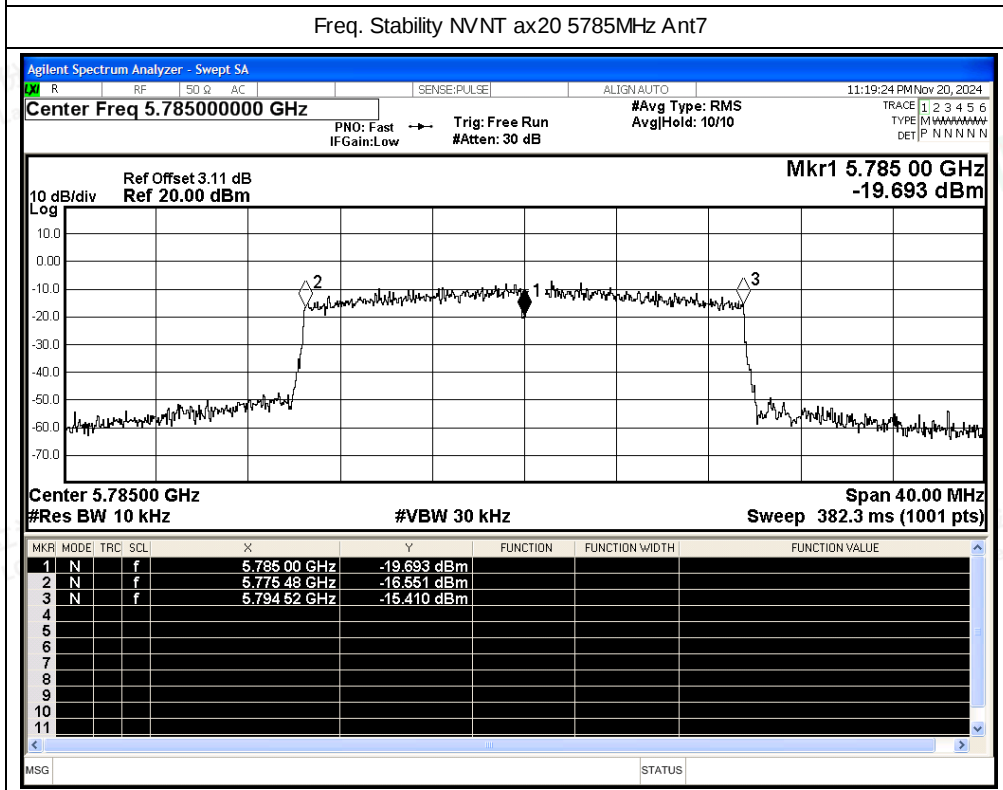
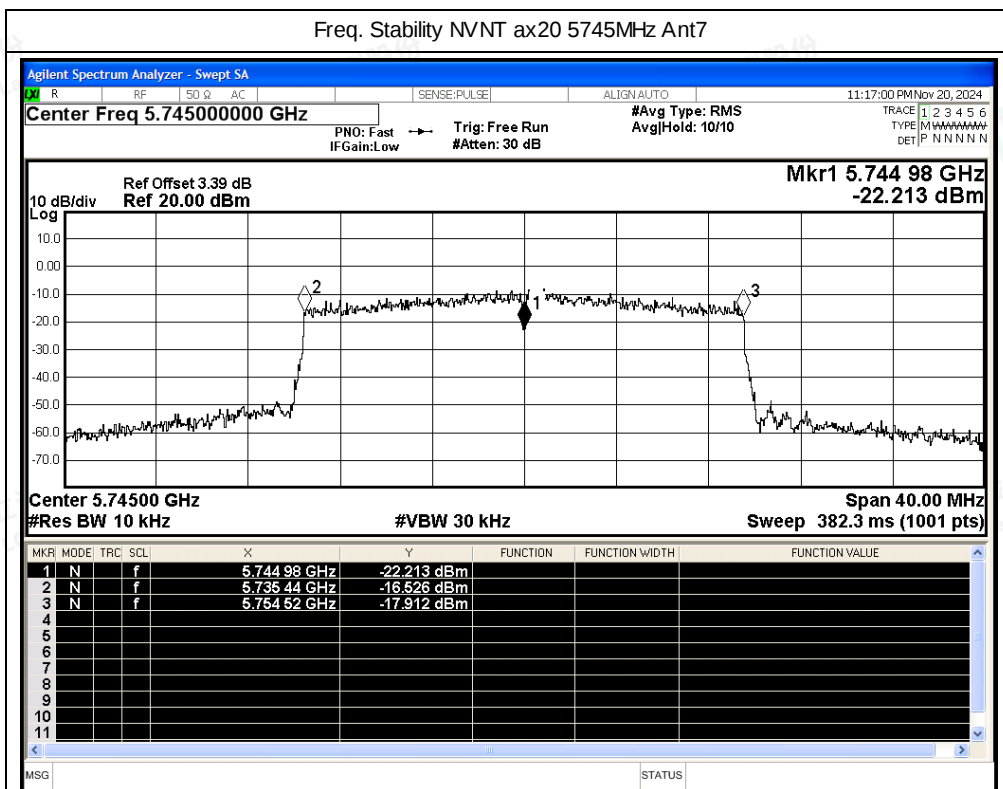


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

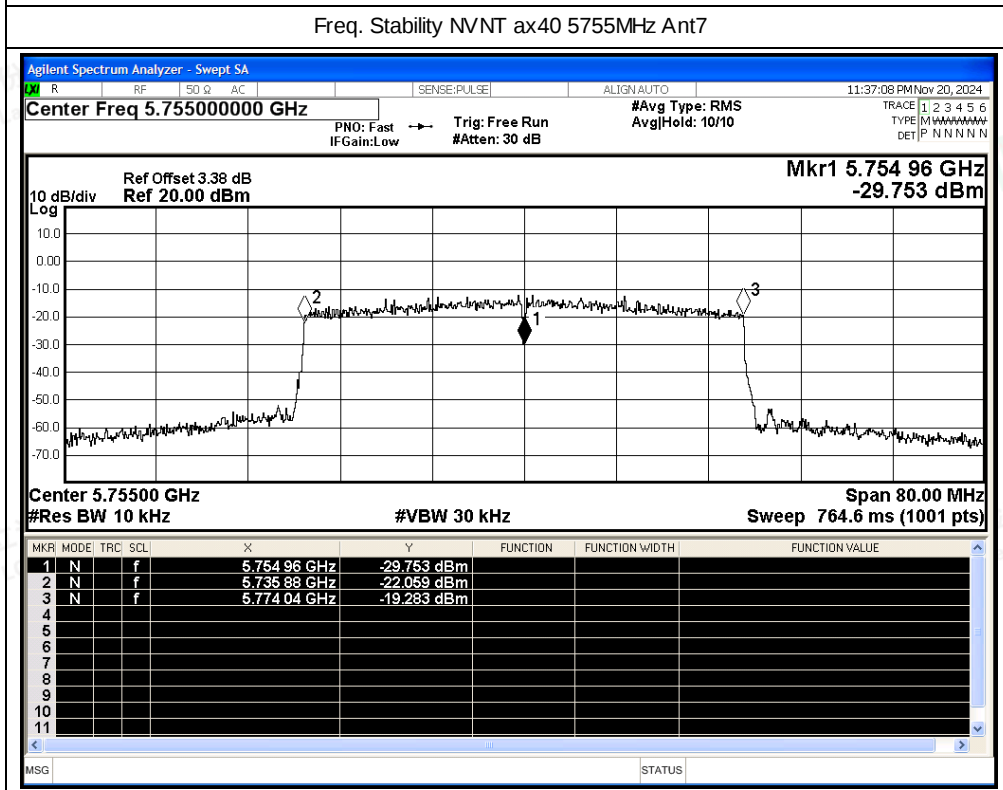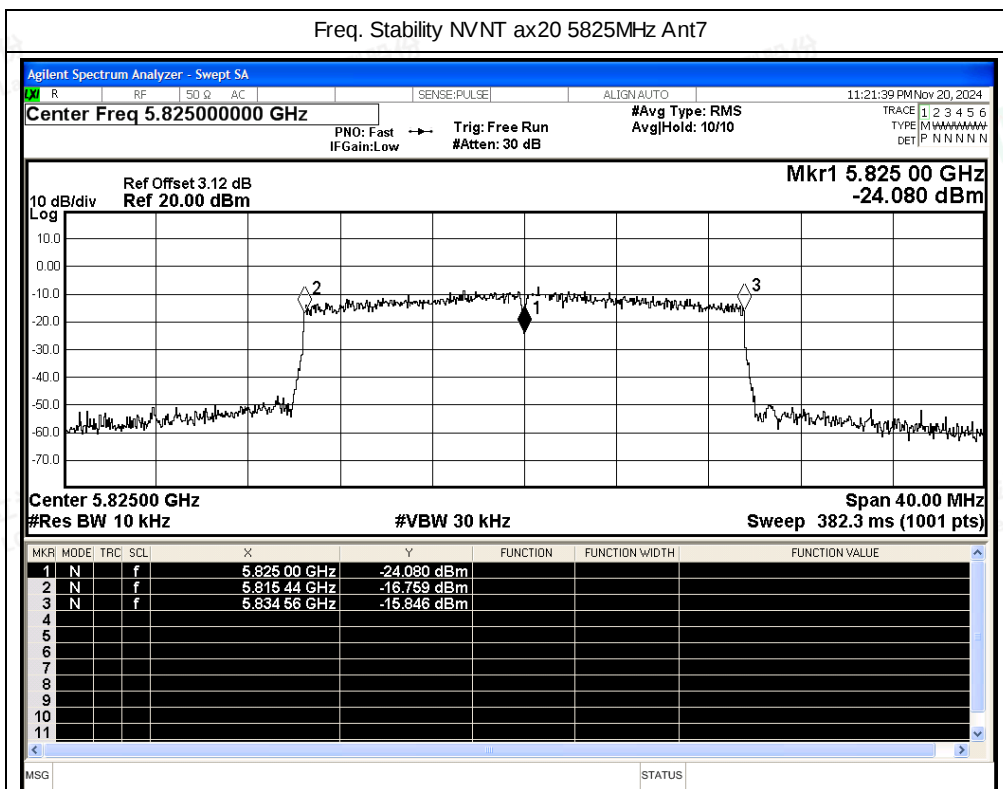

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant7

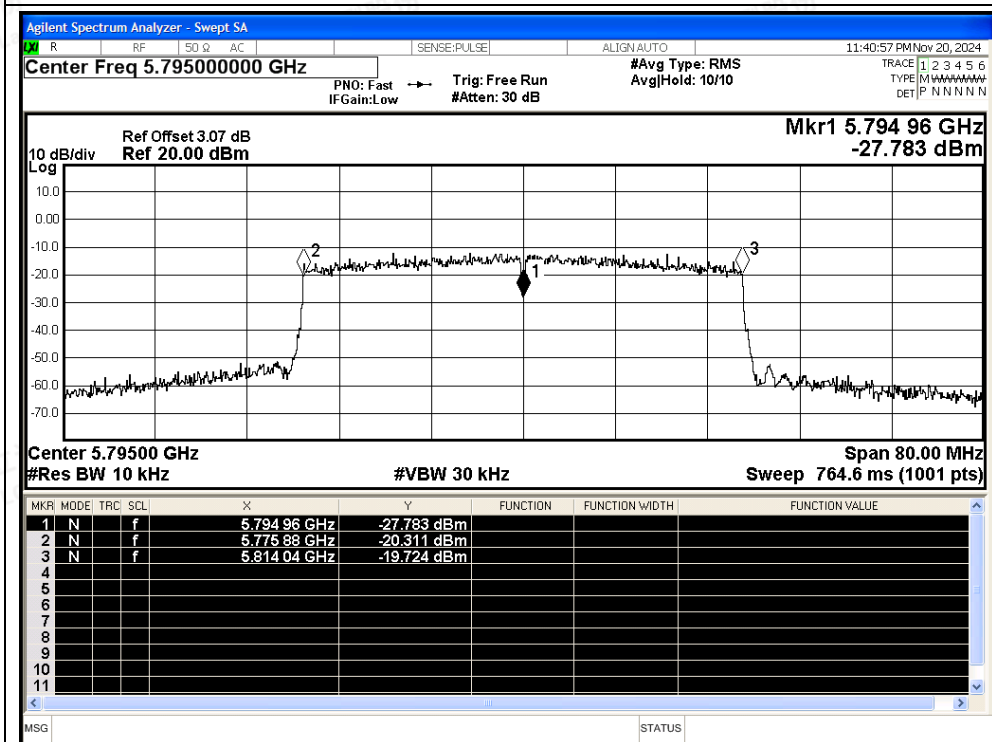

Freq. Stability NVNT ax80 5775MHz Ant7

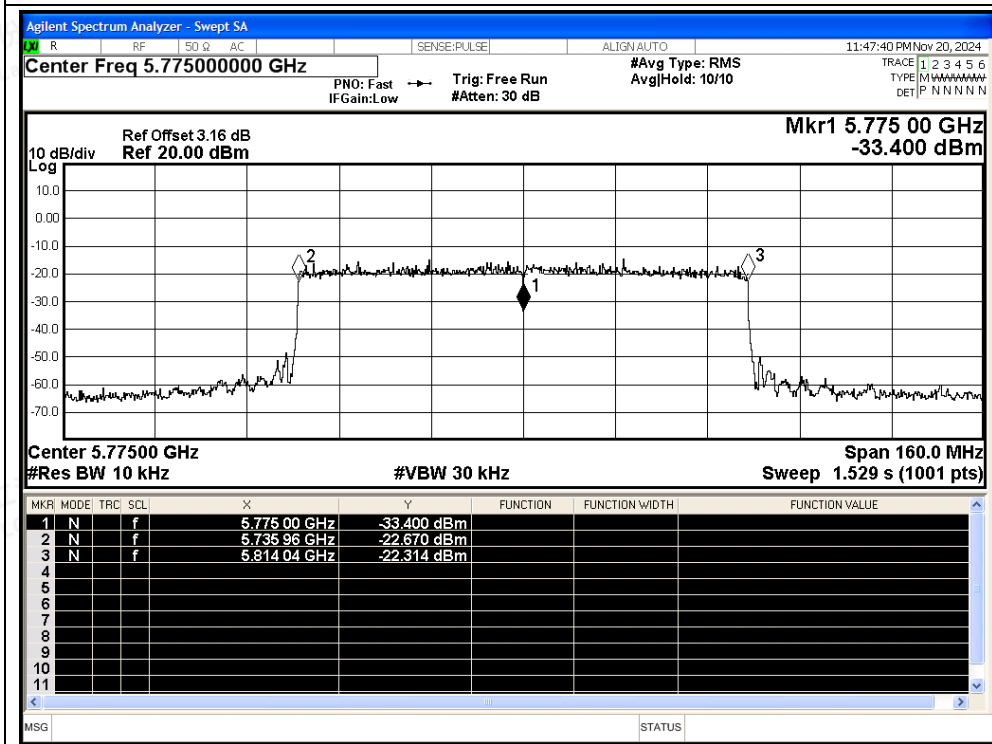

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant6	58.46	2.33	0.72
NVNT	a	5785	Ant6	58.73	2.31	0.72
NVNT	a	5825	Ant6	58.5	2.33	0.72
NVNT	n20	5745	Ant6	56.84	2.45	0.77
NVNT	n20	5785	Ant6	56.79	2.46	0.77
NVNT	n20	5825	Ant6	55.91	2.53	0.77
NVNT	n40	5755	Ant6	54.69	2.62	0.82
NVNT	n40	5795	Ant6	54.86	2.61	0.82
NVNT	ac20	5745	Ant6	56.99	2.44	0.76
NVNT	ac20	5785	Ant6	56.99	2.44	0.76
NVNT	ac20	5825	Ant6	56.99	2.44	0.76
NVNT	ac40	5755	Ant6	55.02	2.59	0.81
NVNT	ac40	5795	Ant6	55.02	2.59	0.81
NVNT	ac80	5775	Ant6	51.78	2.86	0.88
NVNT	ax20	5745	Ant6	50.65	2.95	0.99
NVNT	ax20	5785	Ant6	51.34	2.9	0.99
NVNT	ax20	5825	Ant6	50.67	2.95	0.99
NVNT	ax40	5755	Ant6	49.4	3.06	1.01
NVNT	ax40	5795	Ant6	49.62	3.04	1.01
NVNT	ax80	5775	Ant6	47.16	3.26	1.06



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant6

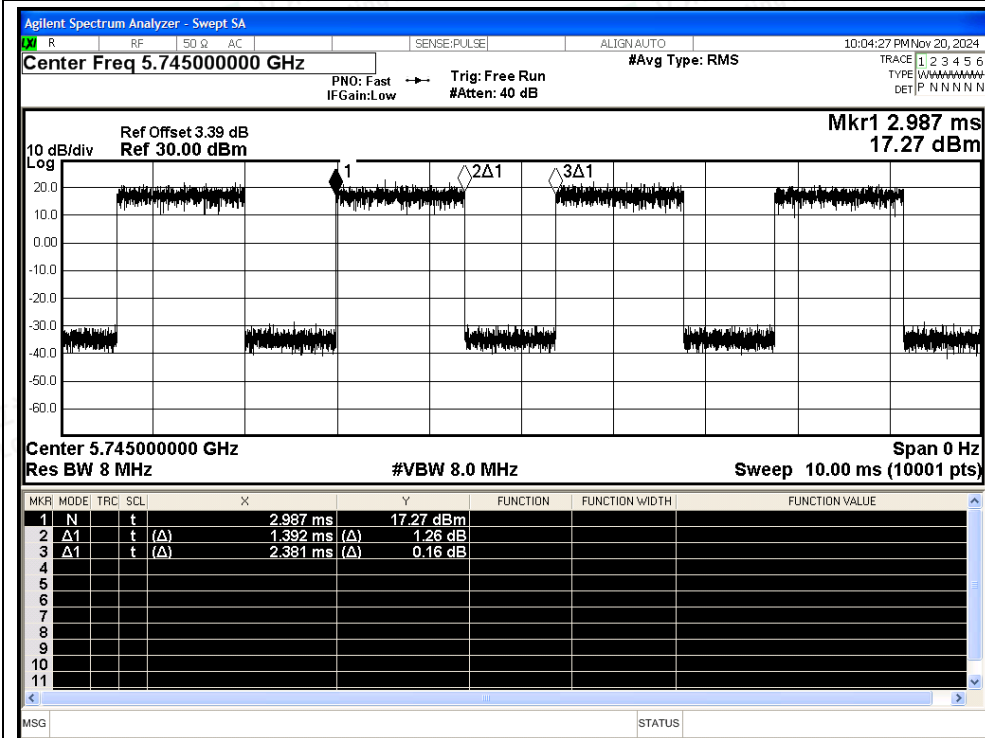

Duty Cycle NVNT a 5785MHz Ant6


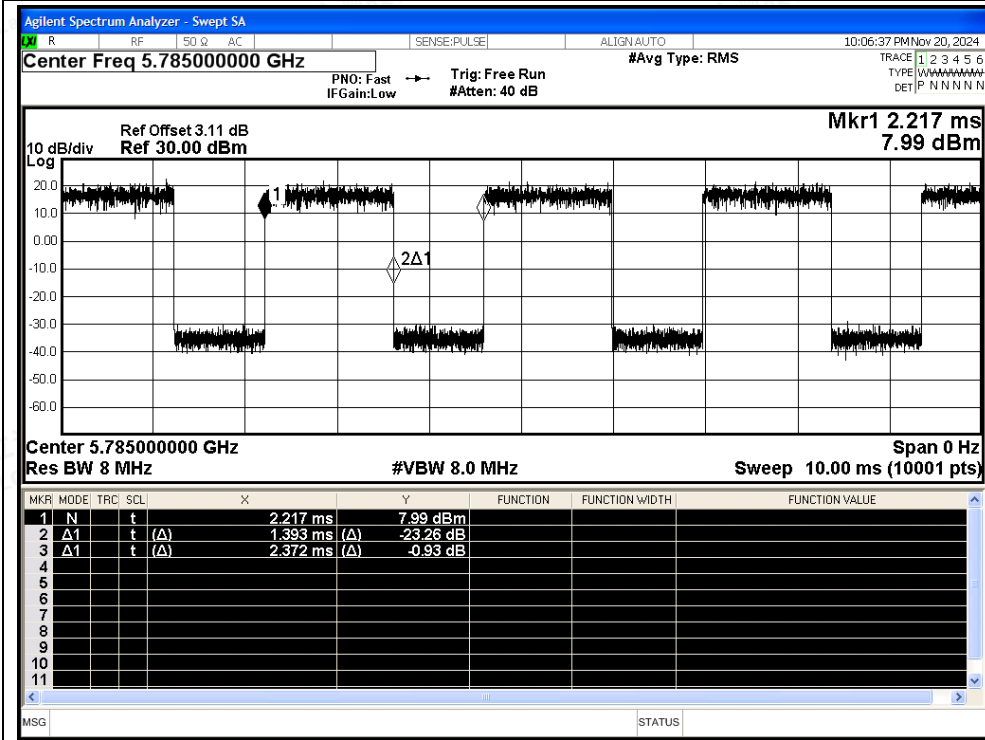


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

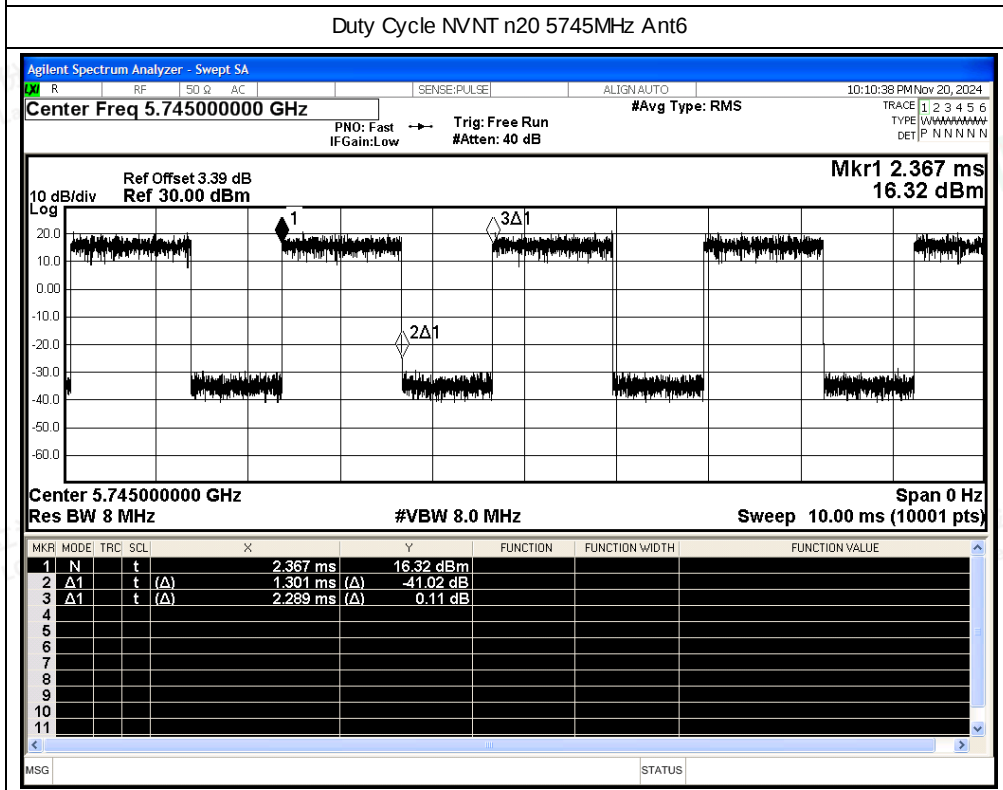
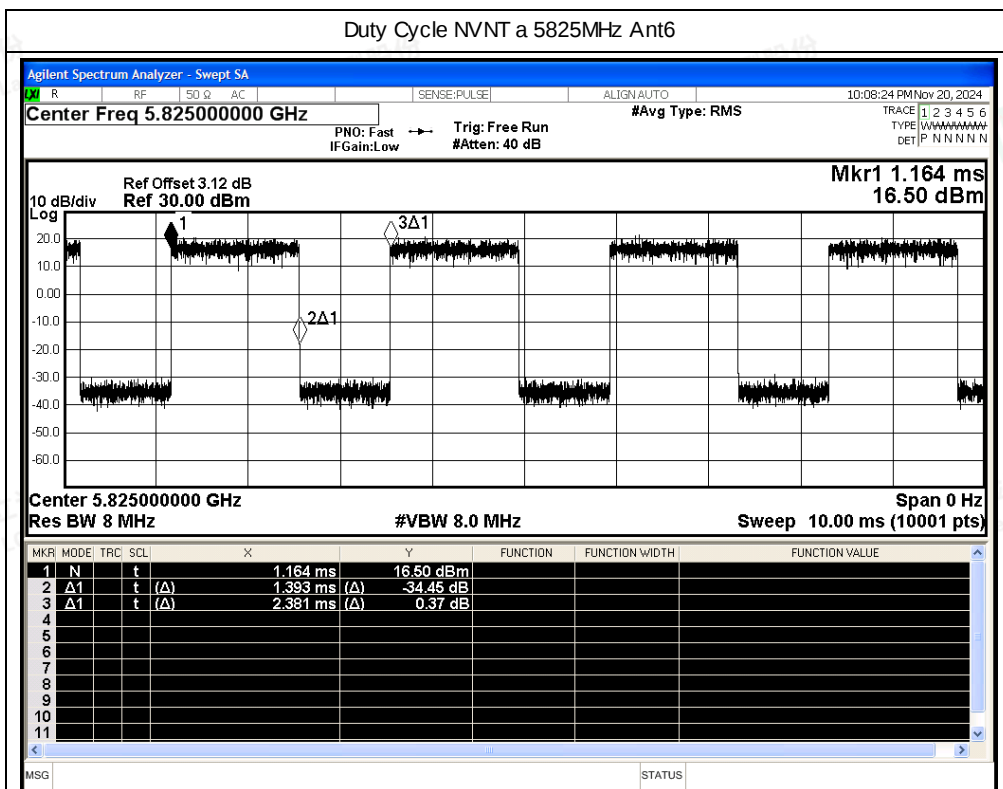


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

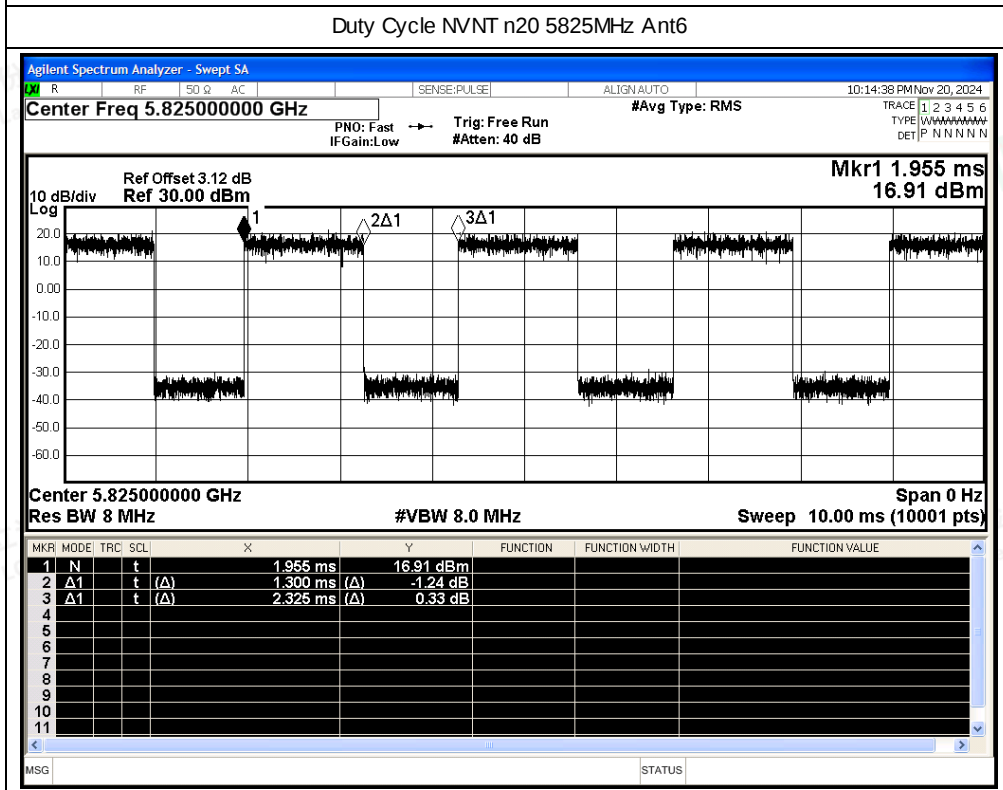
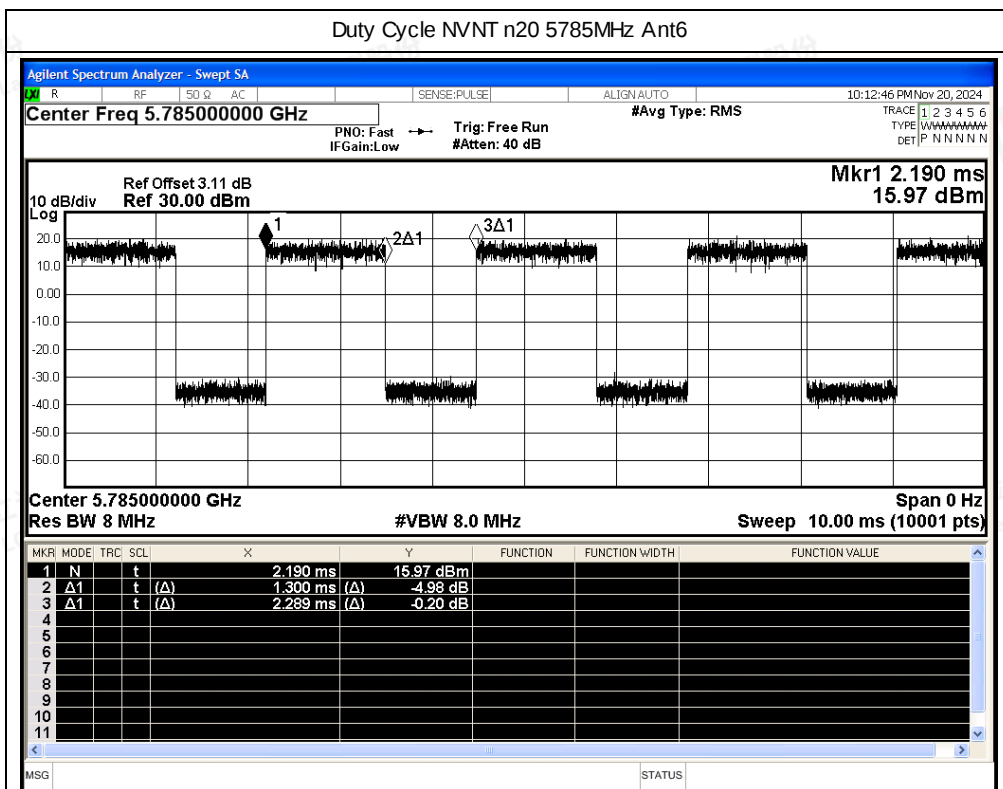


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

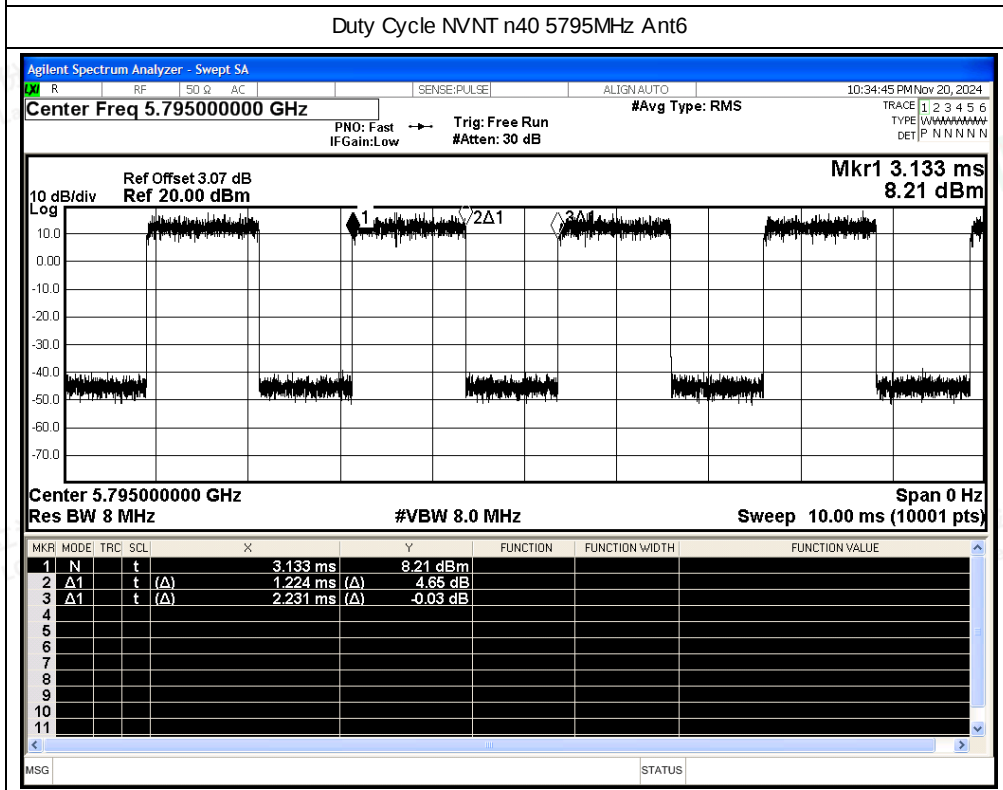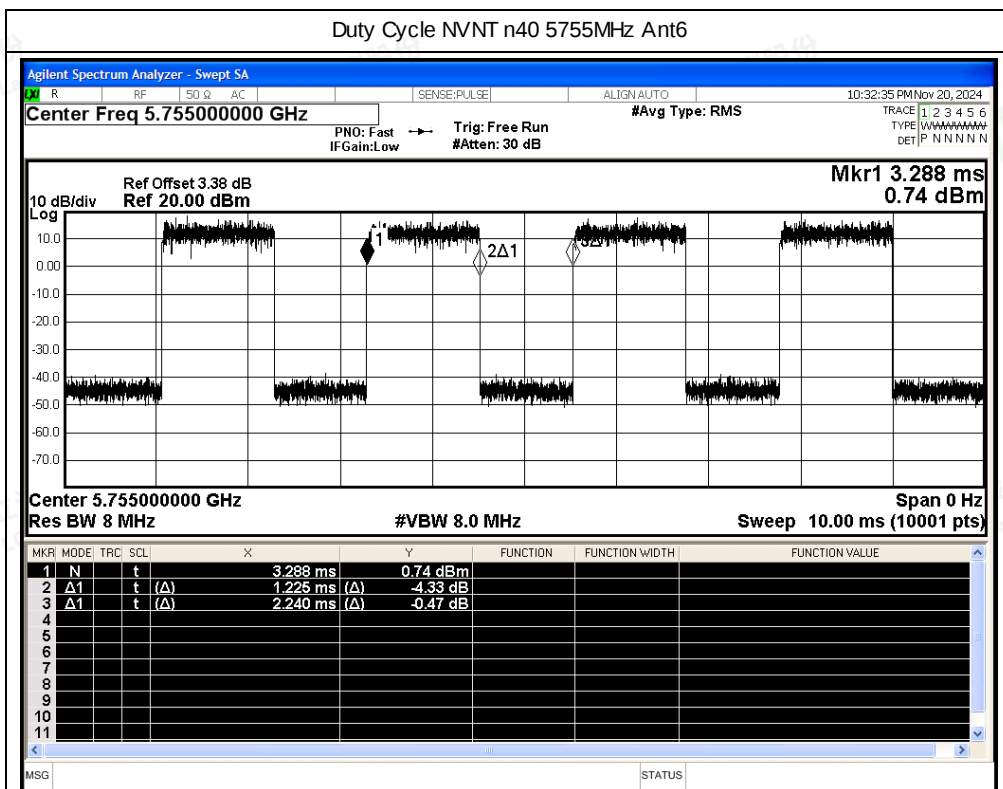

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5745MHz Ant6

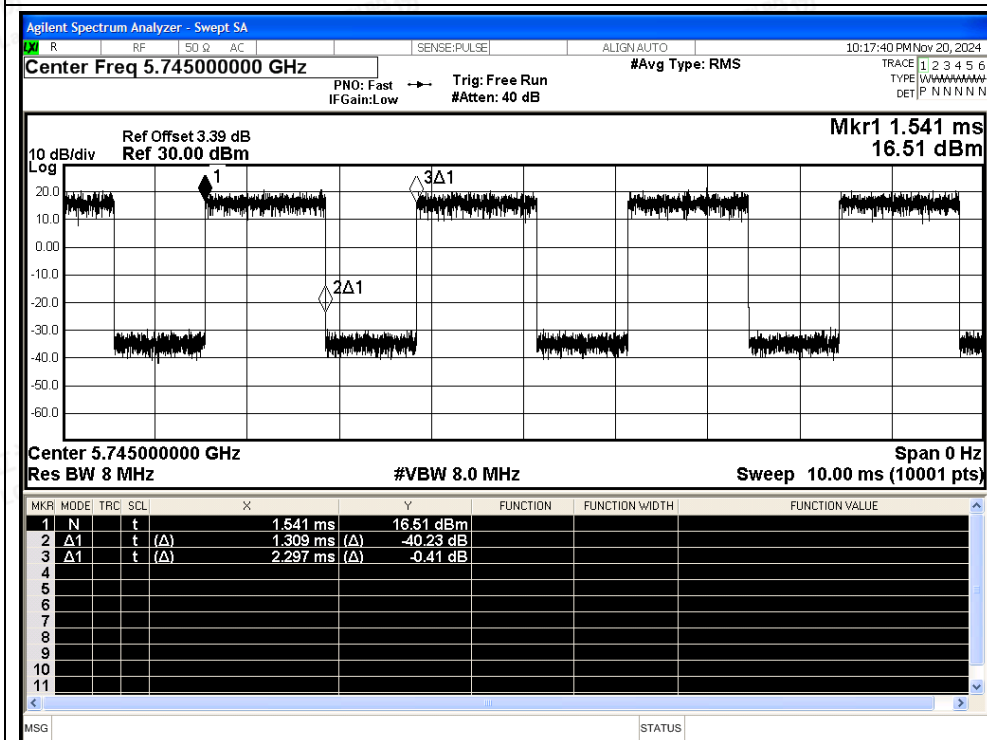

Duty Cycle NVNT ac20 5785MHz Ant6


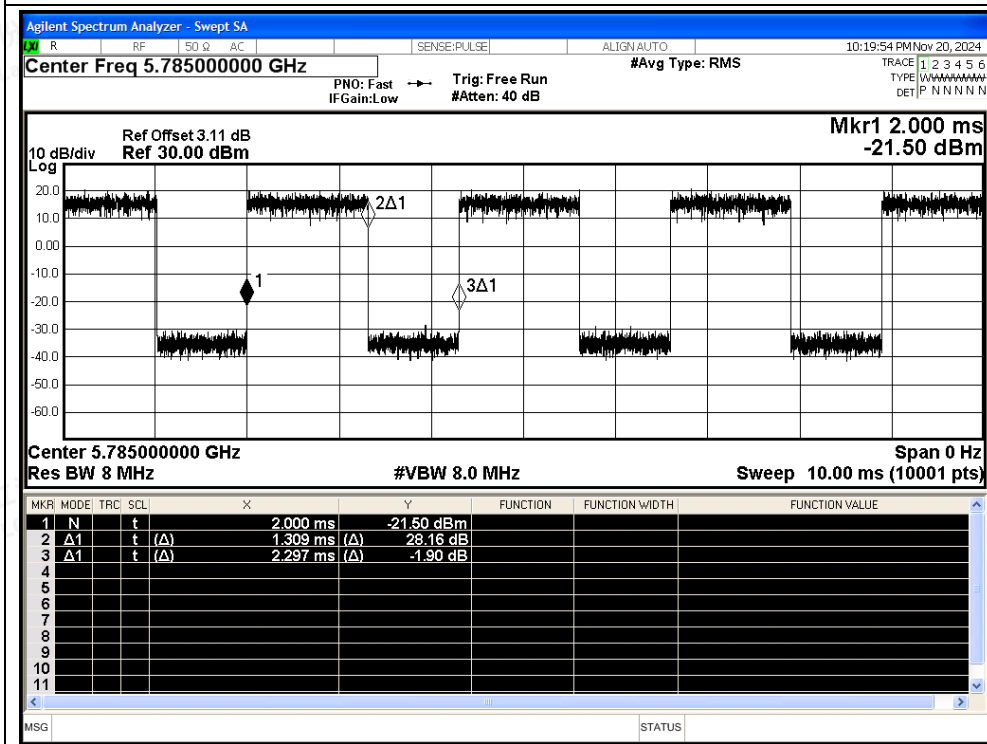


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

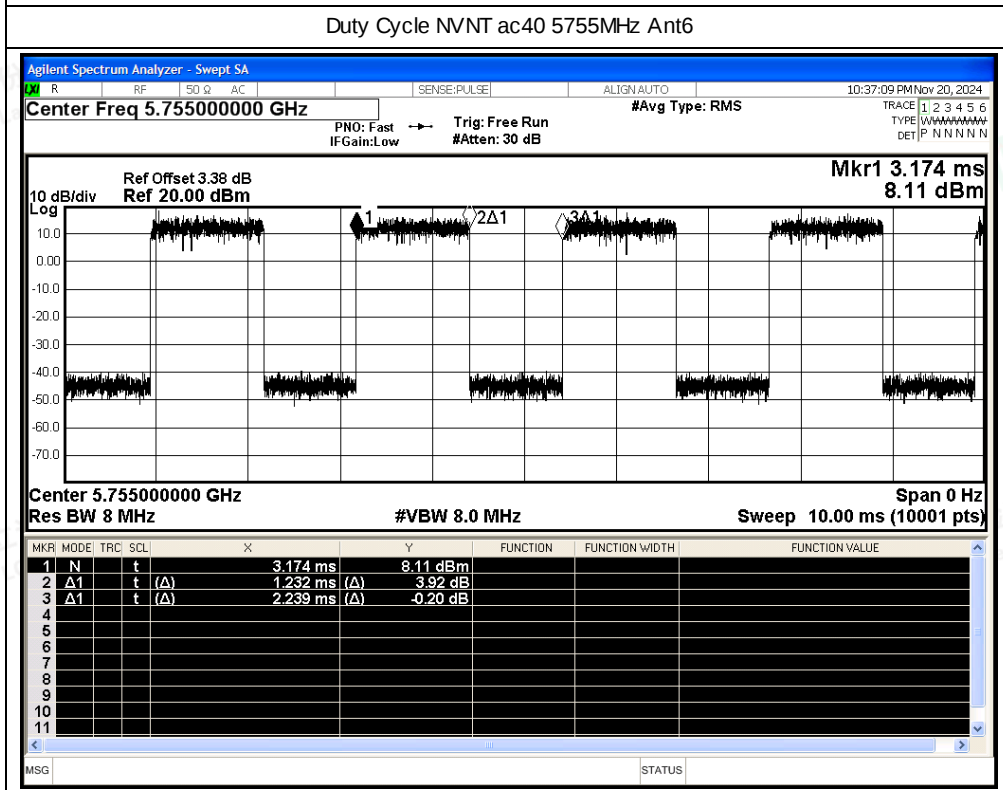
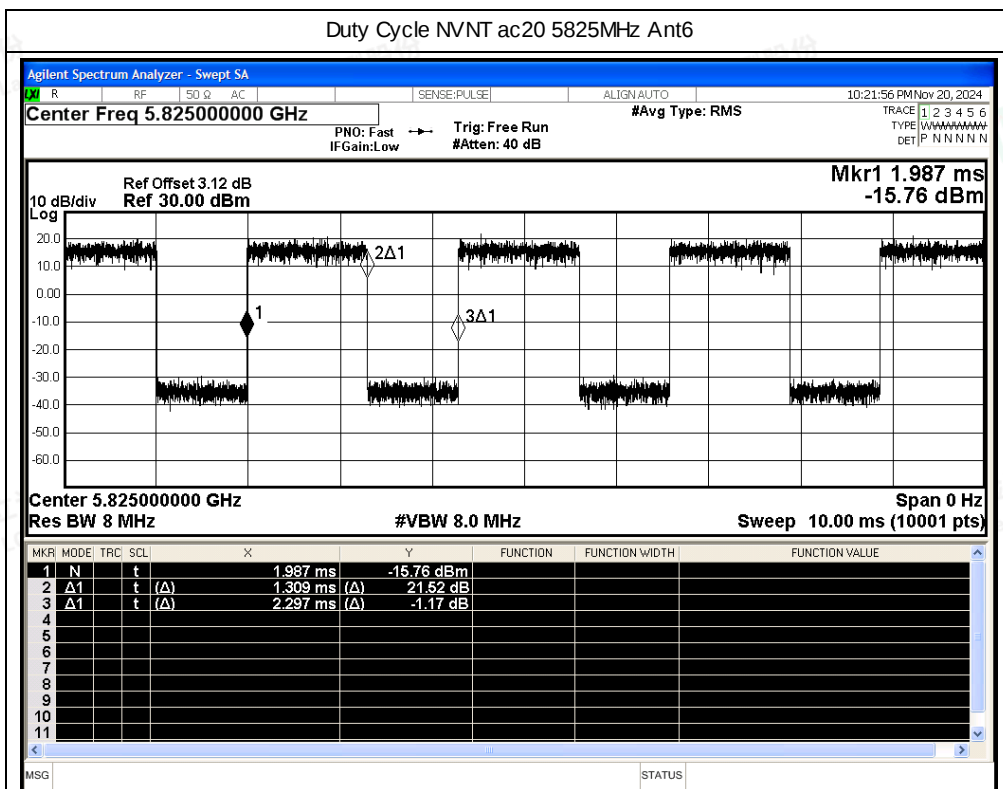


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

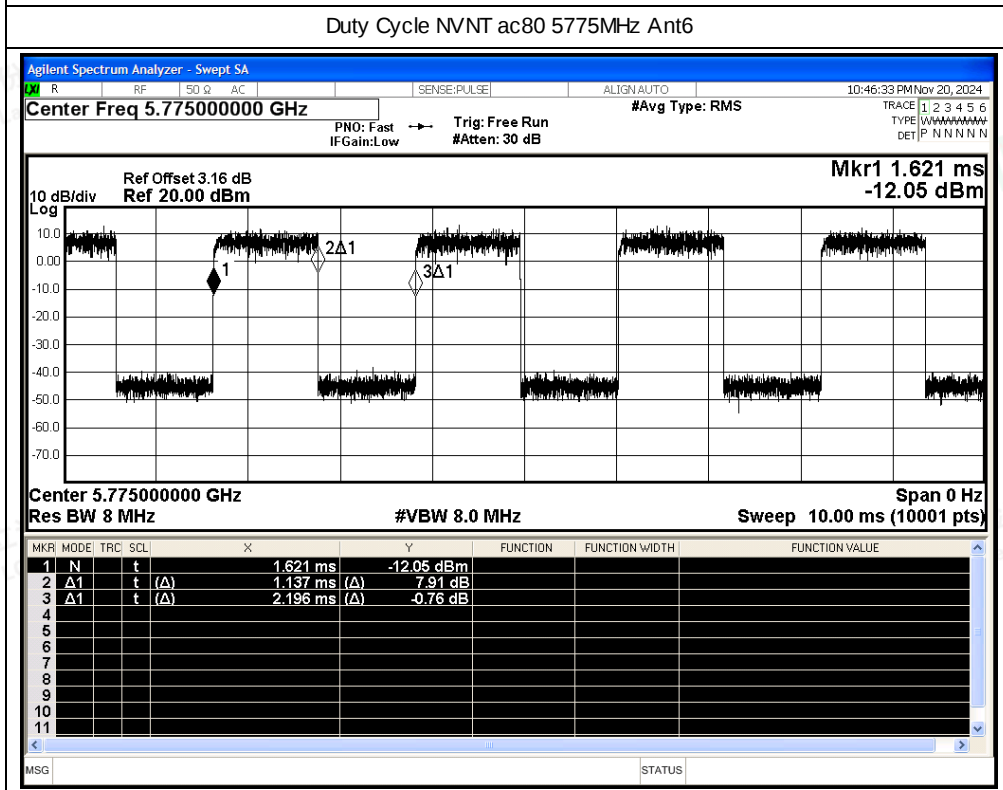
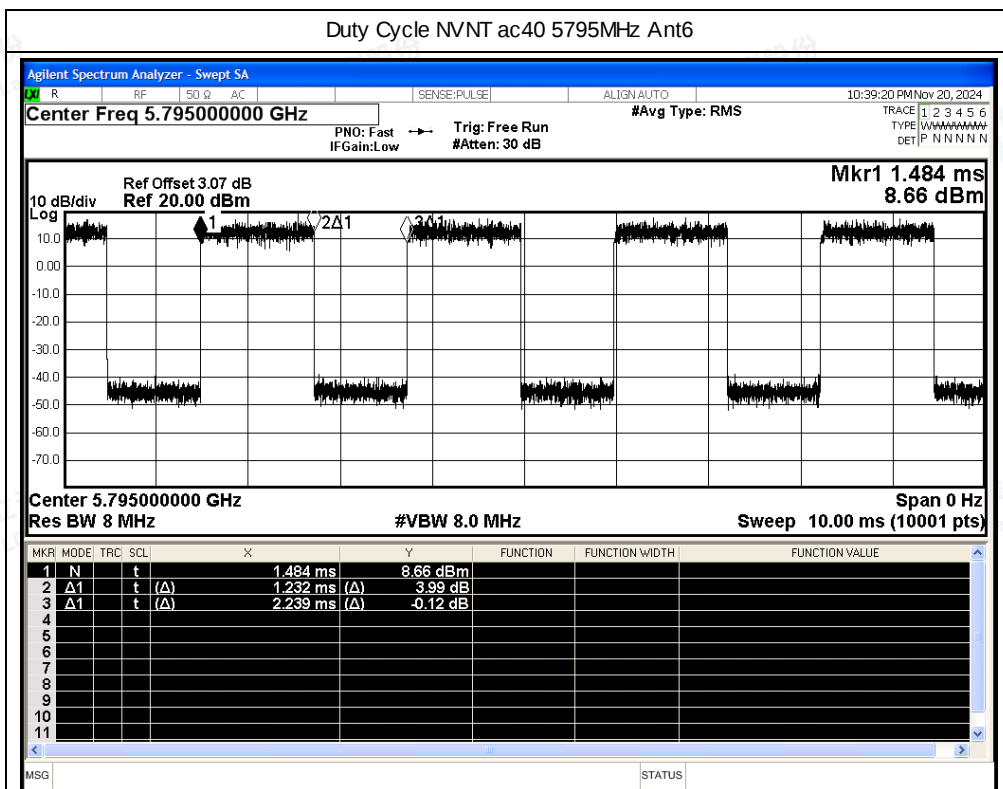


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

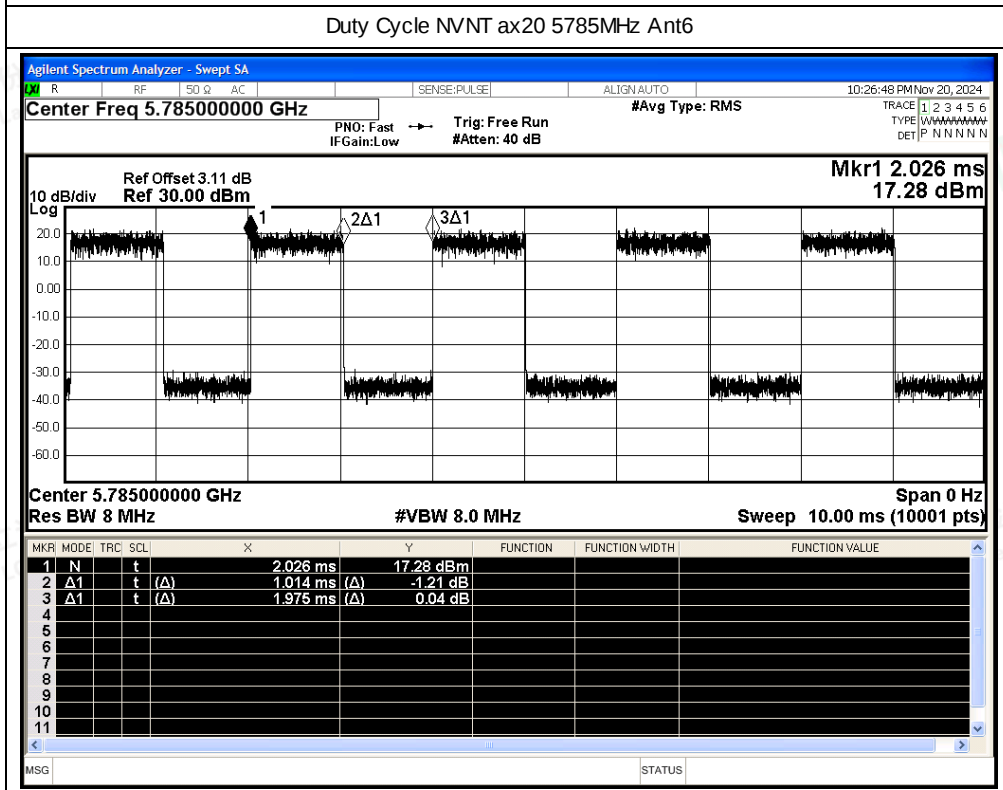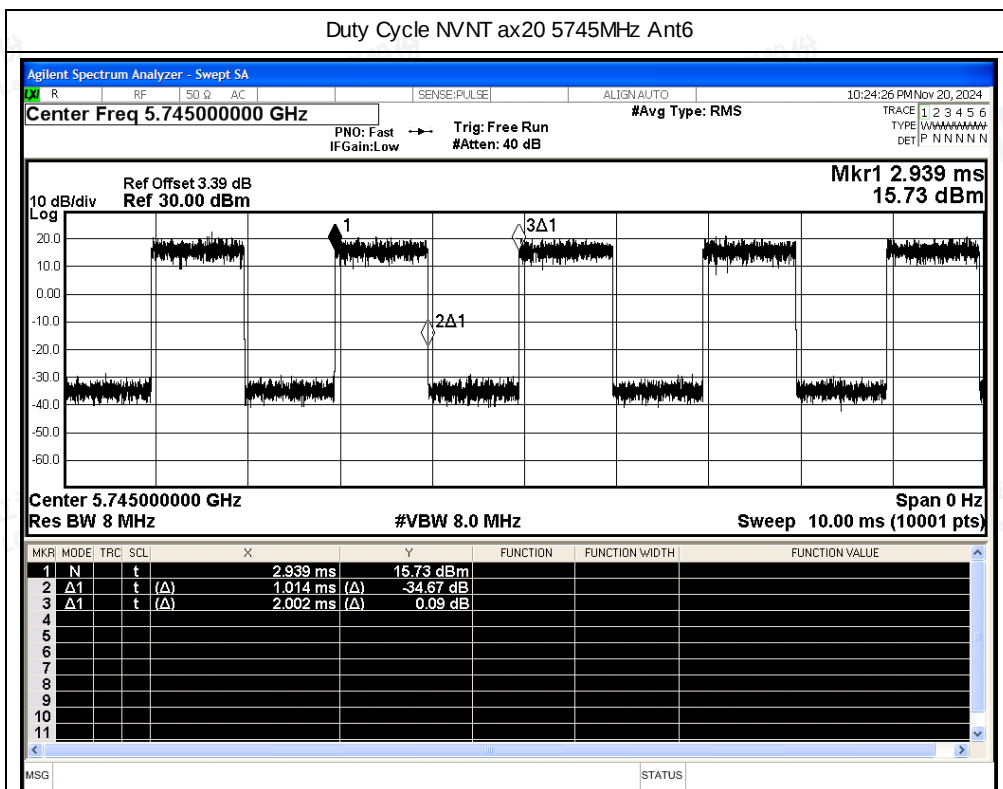

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant6

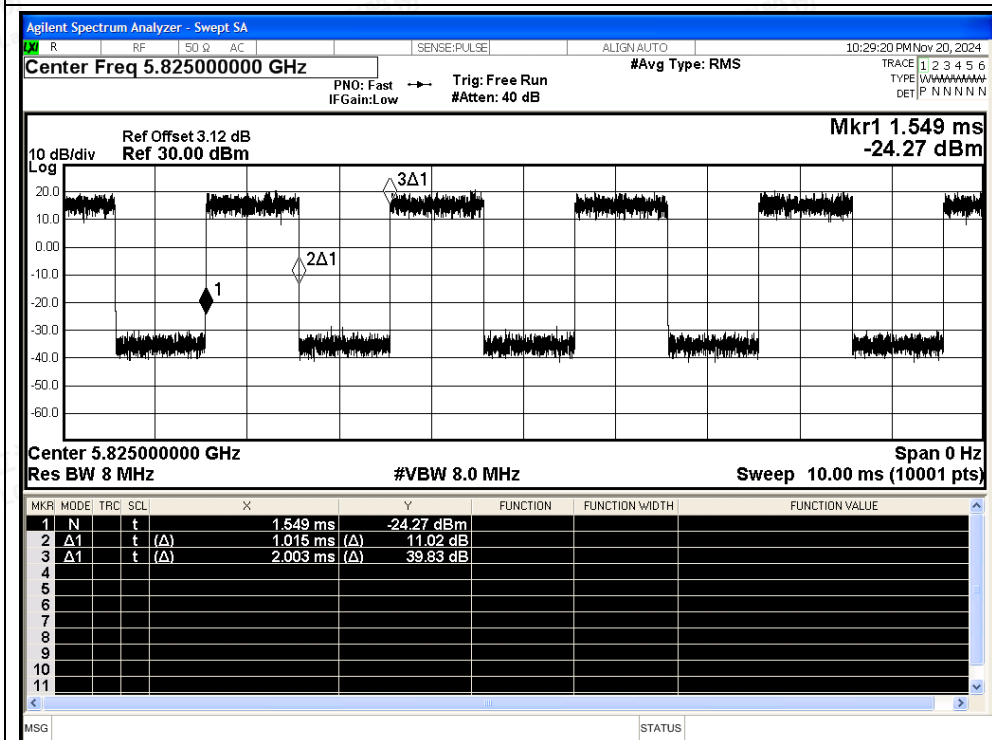

Duty Cycle NVNT ax40 5755MHz Ant6

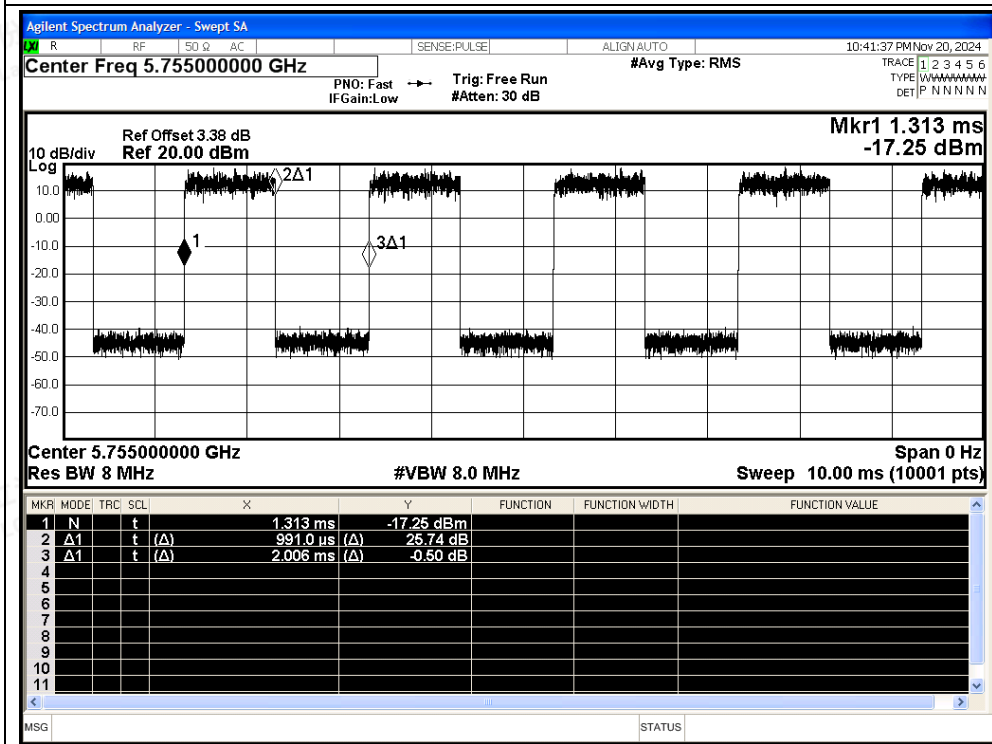

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant6

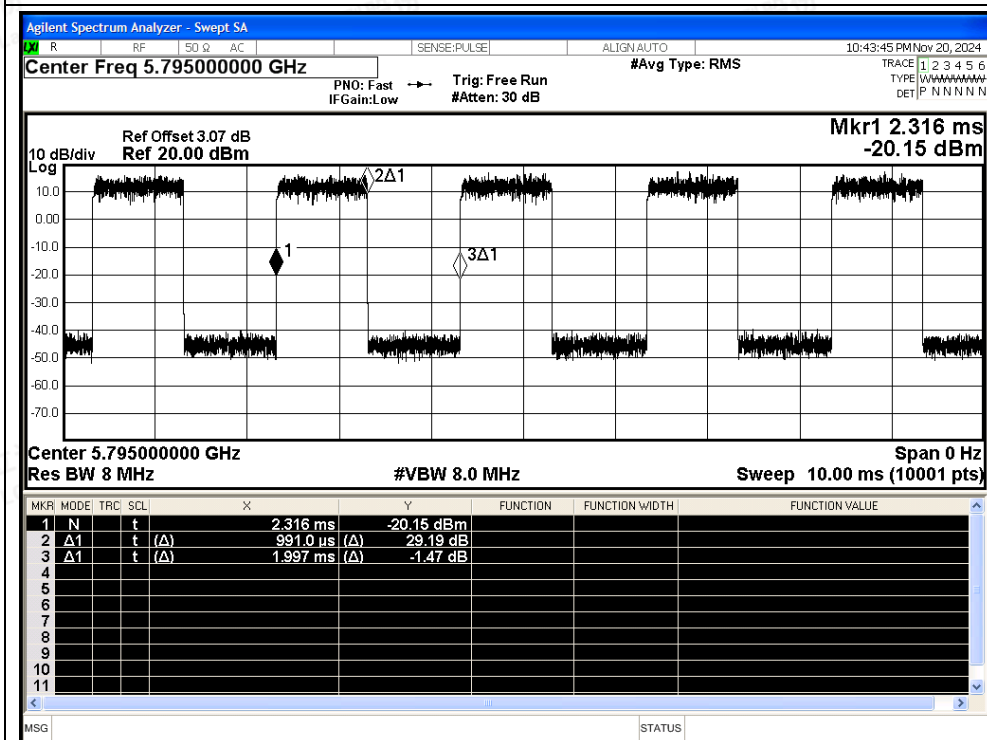

Duty Cycle NVNT ax80 5775MHz Ant6

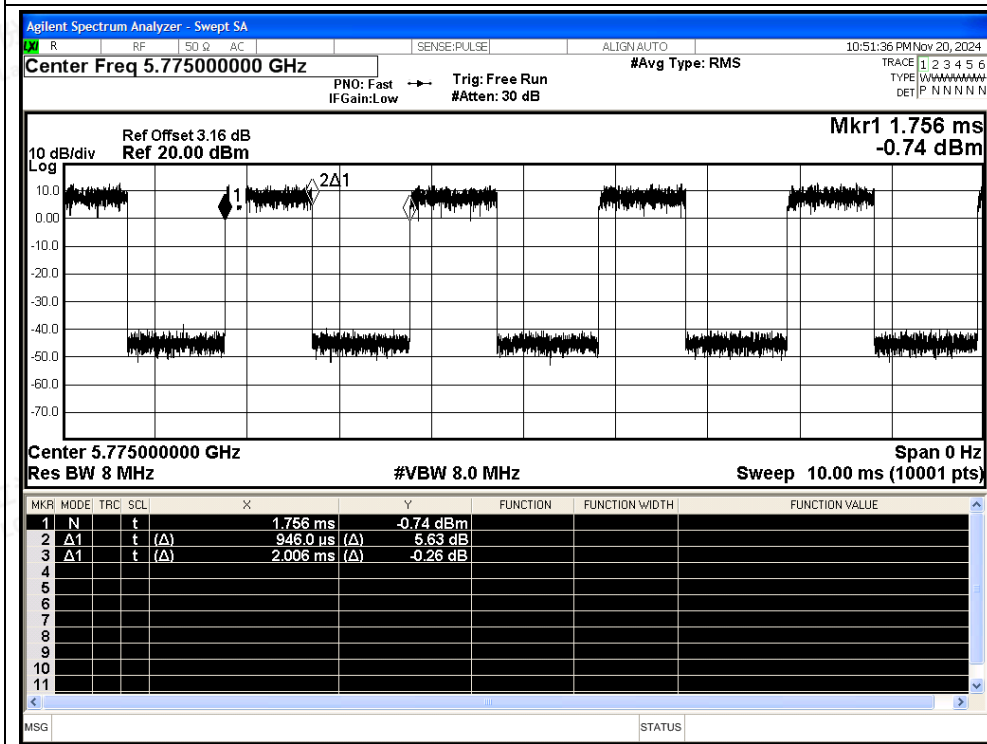

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant7	58.73	2.31	0.72
NVNT	a	5785	Ant7	58.46	2.33	0.72
NVNT	a	5825	Ant7	58.46	2.33	0.72
NVNT	n20	5745	Ant7	57.06	2.44	0.77
NVNT	n20	5785	Ant7	57.02	2.44	0.77
NVNT	n20	5825	Ant7	57.02	2.44	0.77
NVNT	n40	5755	Ant7	54.91	2.6	0.82
NVNT	n40	5795	Ant7	54.86	2.61	0.82
NVNT	ac20	5745	Ant7	55.21	2.58	0.76
NVNT	ac20	5785	Ant7	56.99	2.44	0.76
NVNT	ac20	5825	Ant7	56.94	2.45	0.76
NVNT	ac40	5755	Ant7	53.56	2.71	0.81
NVNT	ac40	5795	Ant7	56.2	2.5	0.81
NVNT	ac80	5775	Ant7	51.73	2.86	0.88
NVNT	ax20	5745	Ant7	50.65	2.95	0.99
NVNT	ax20	5785	Ant7	50.65	2.95	0.99
NVNT	ax20	5825	Ant7	50.7	2.95	0.99
NVNT	ax40	5755	Ant7	49.85	3.02	1.01
NVNT	ax40	5795	Ant7	48.96	3.1	1.01
NVNT	ax80	5775	Ant7	46.95	3.28	1.06






Test Graphs

Duty Cycle NVNT a 5745MHz Ant7

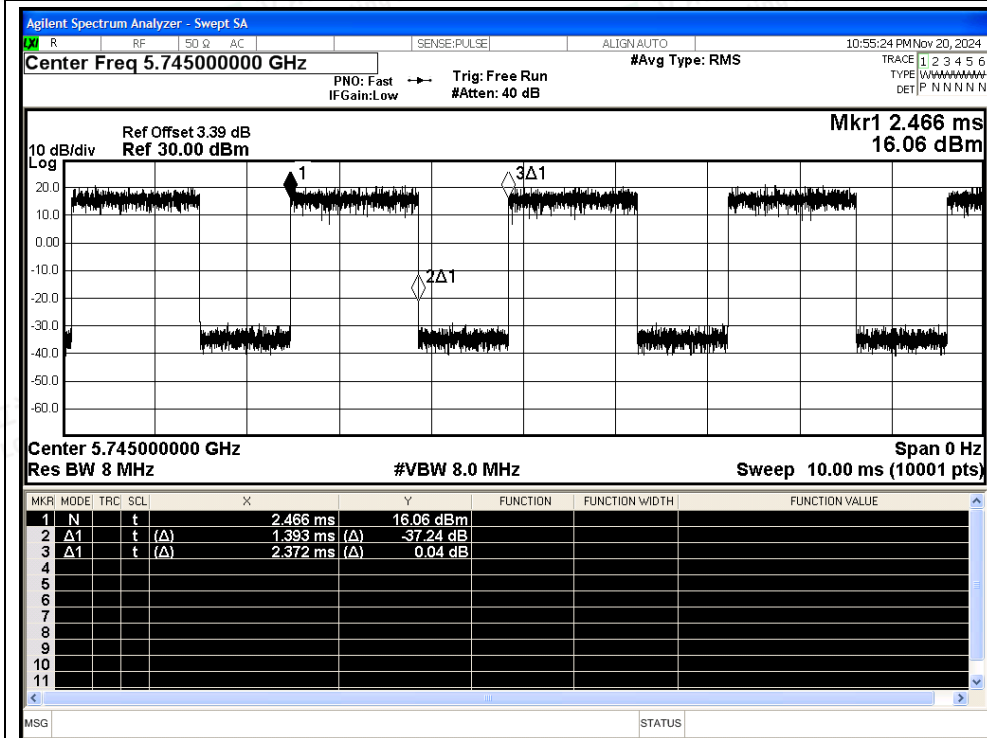

Duty Cycle NVNT a 5785MHz Ant7


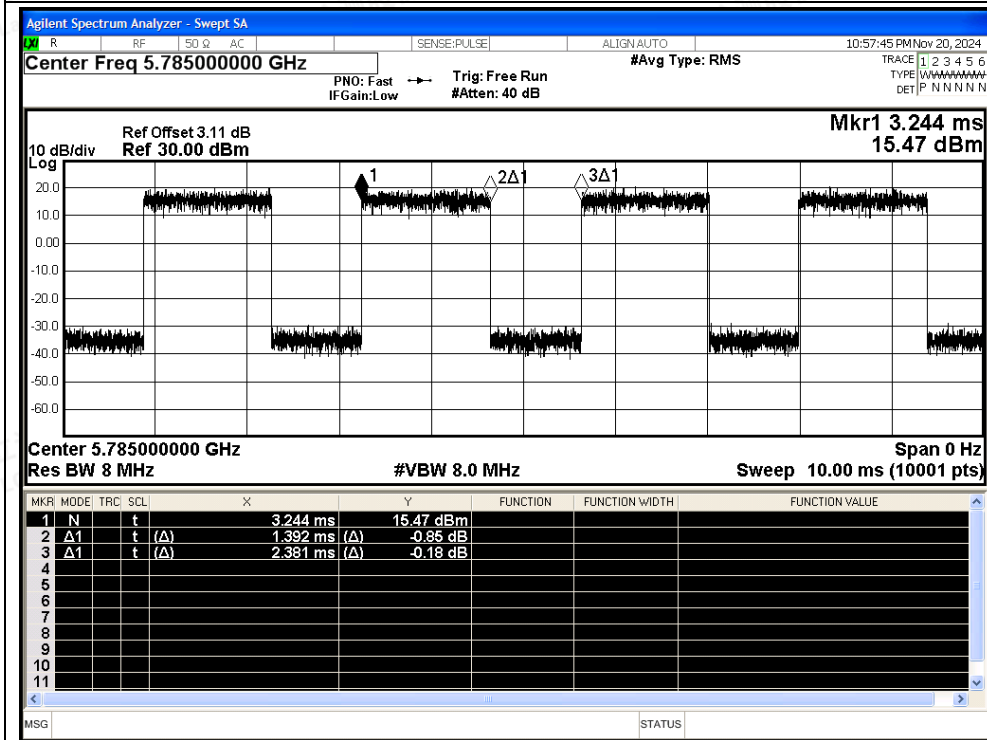


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

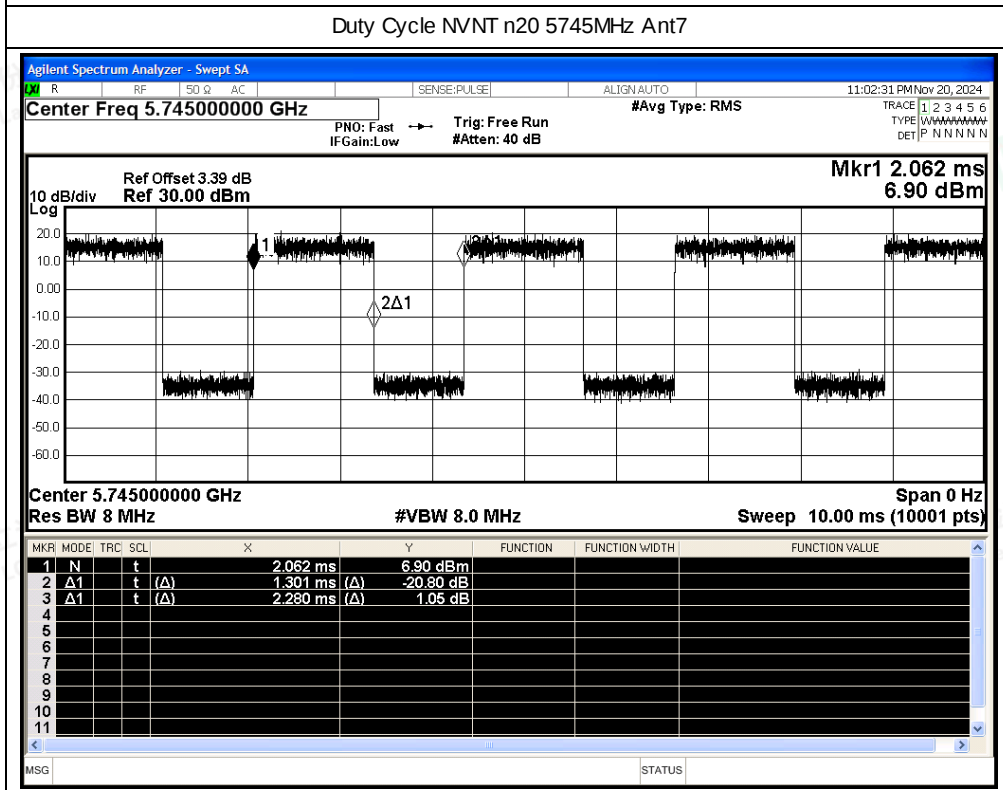
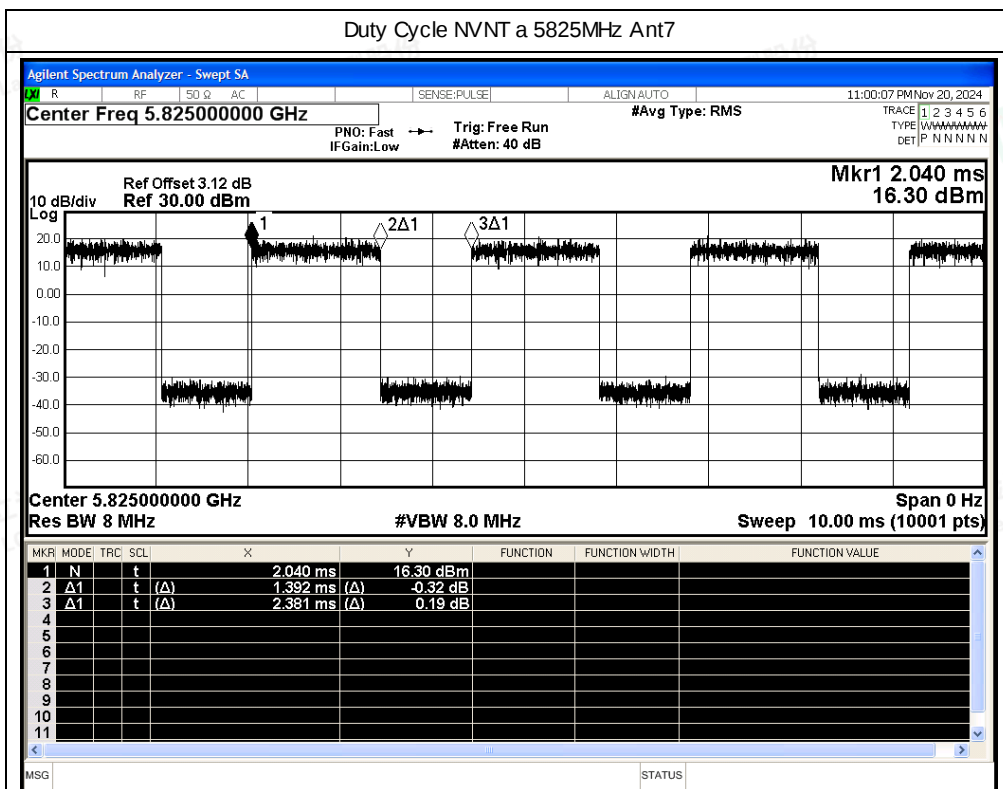


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

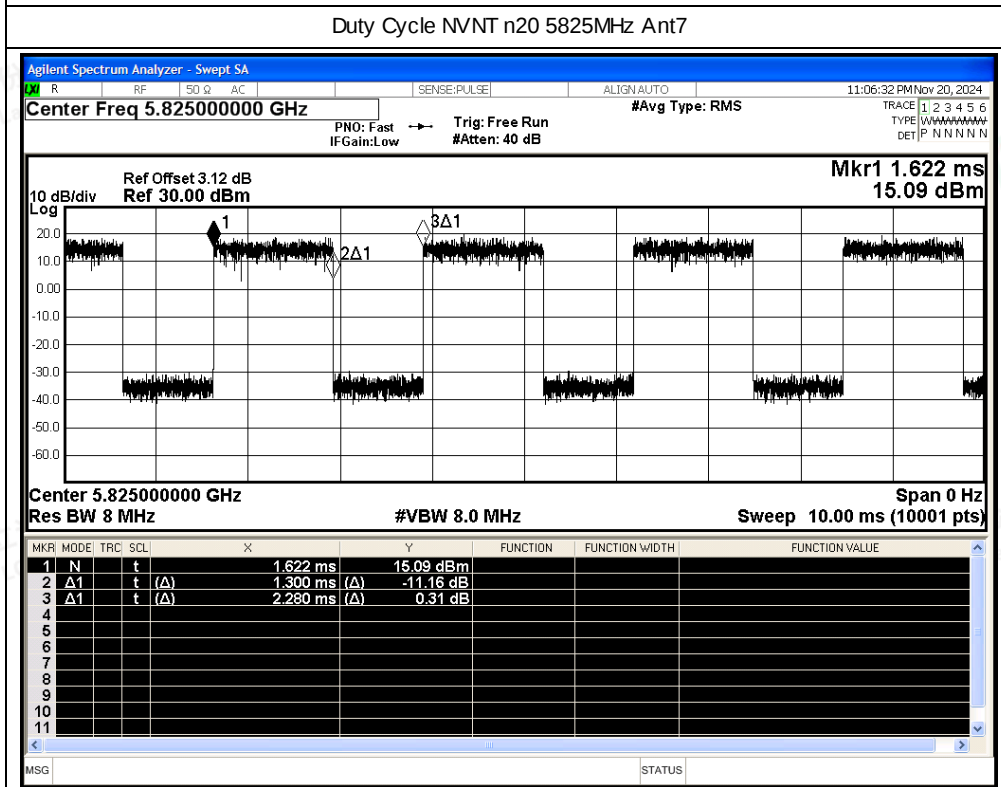
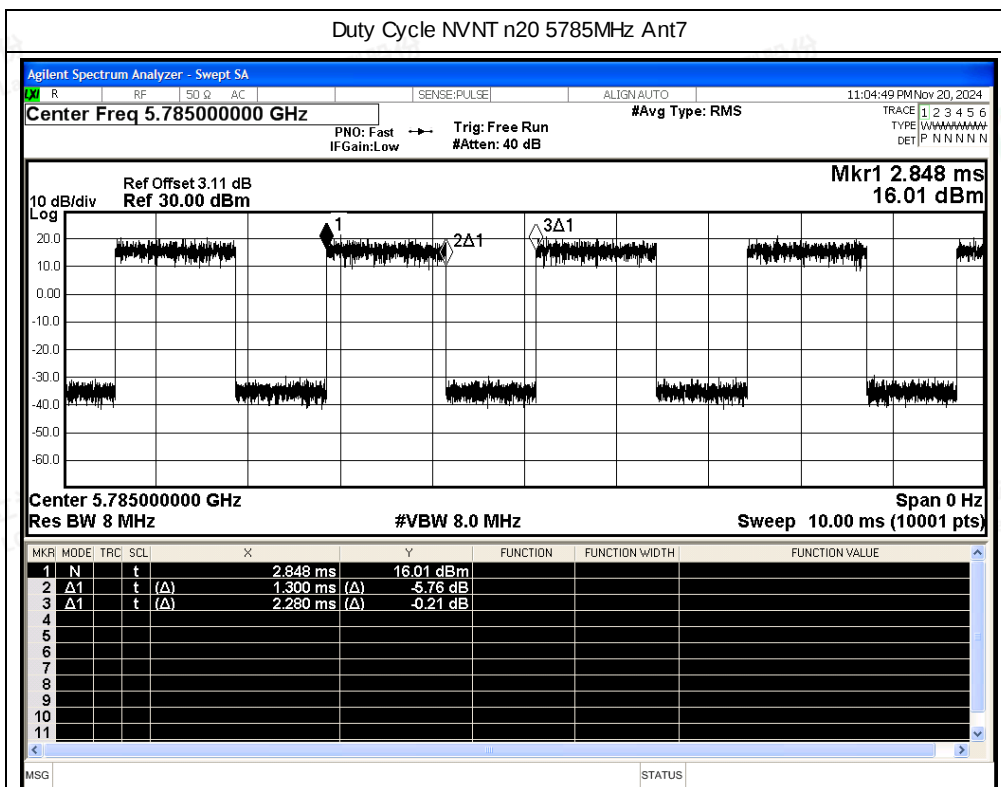


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

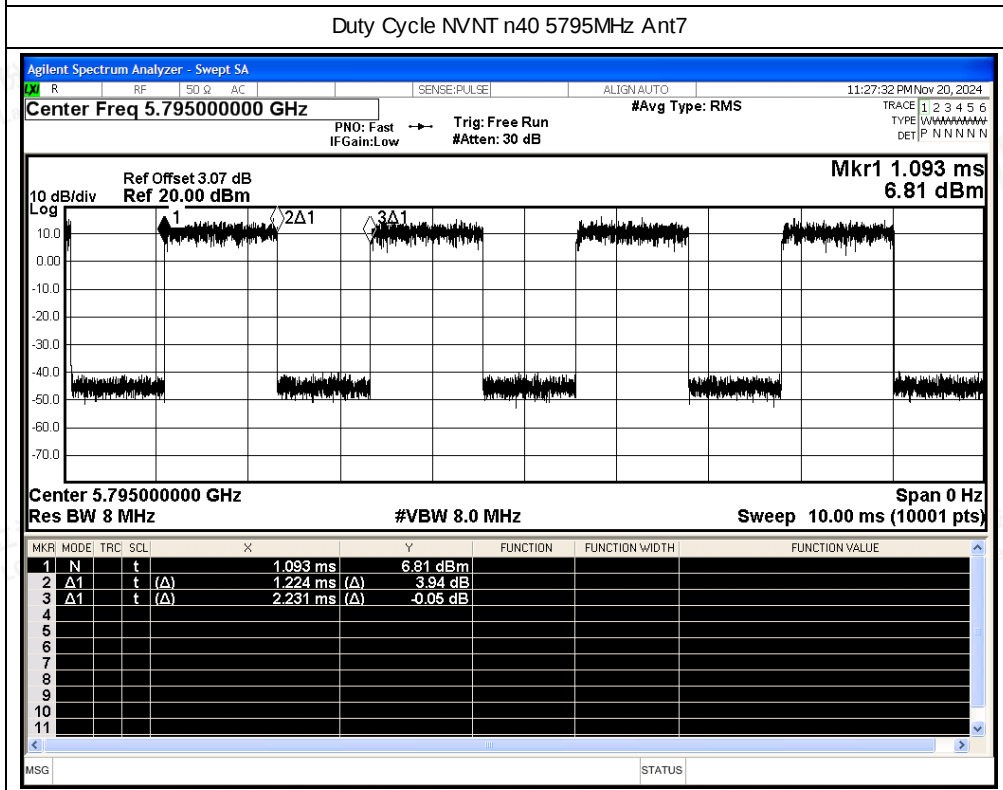
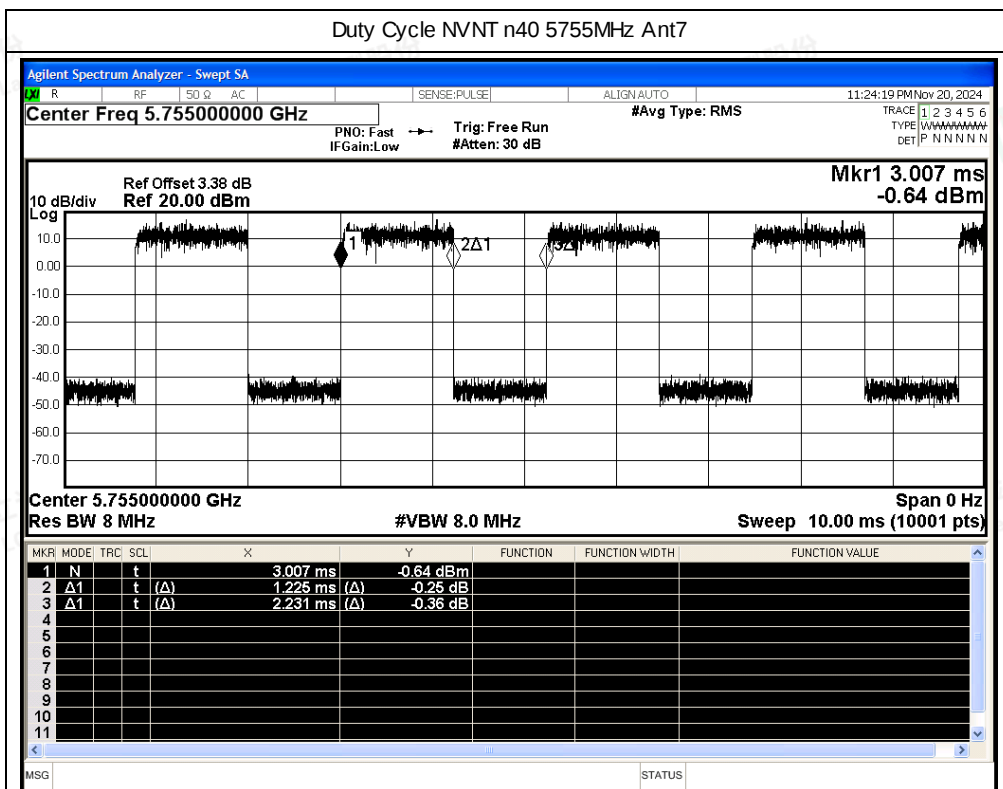


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

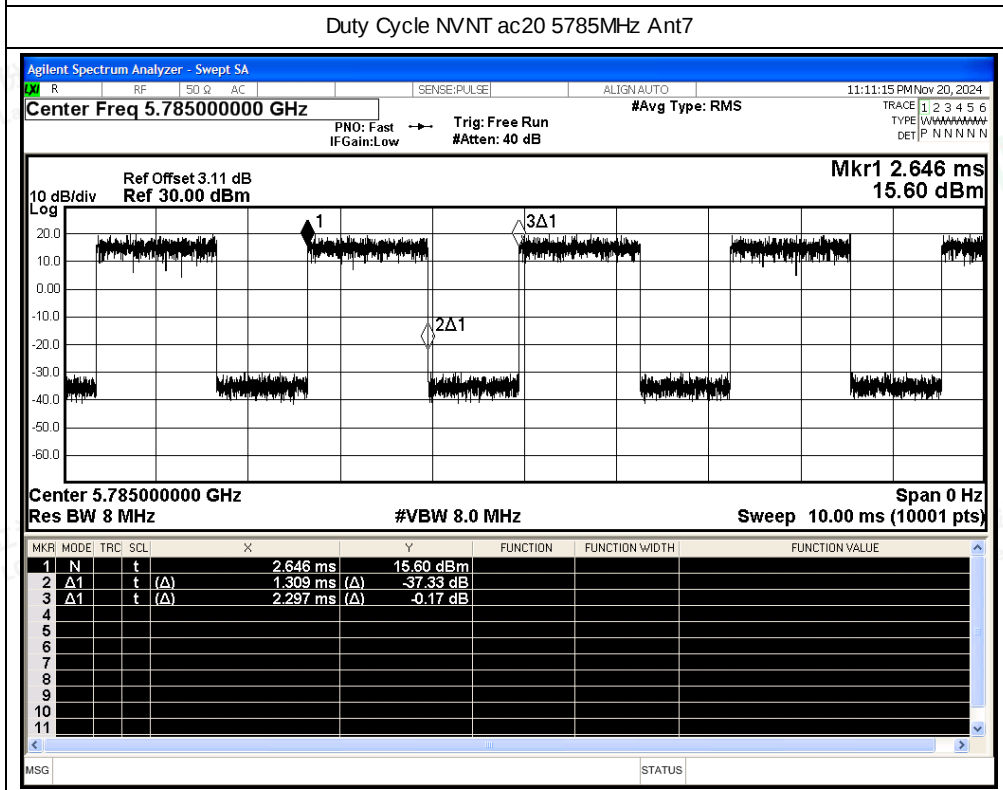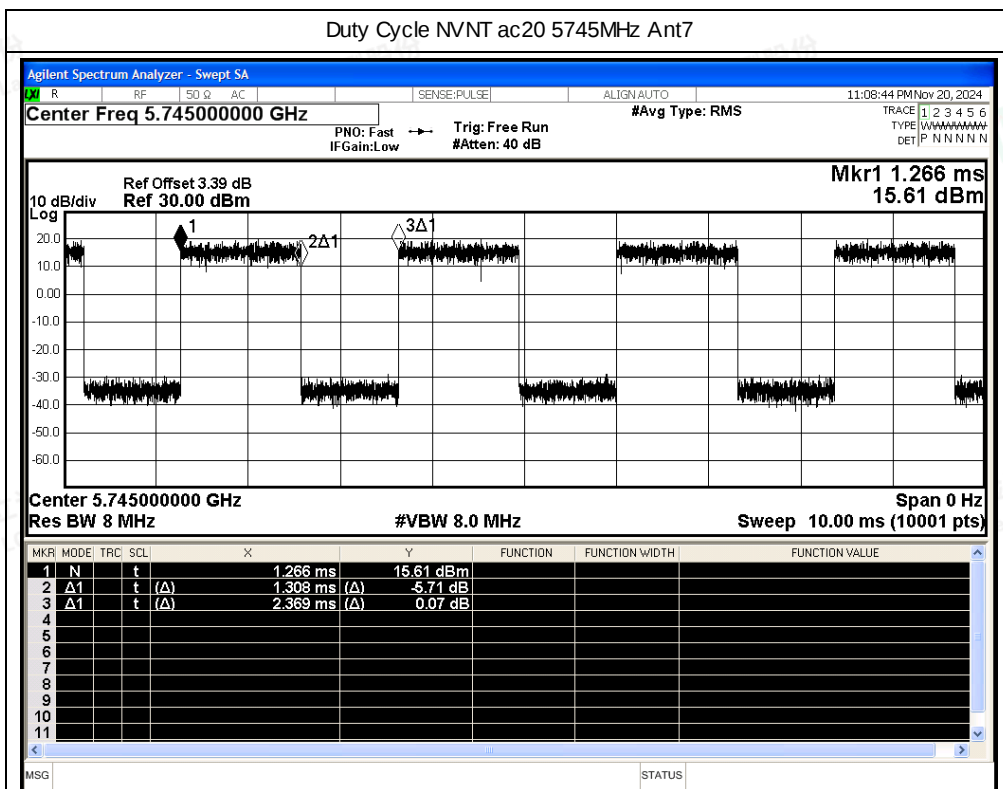

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant7

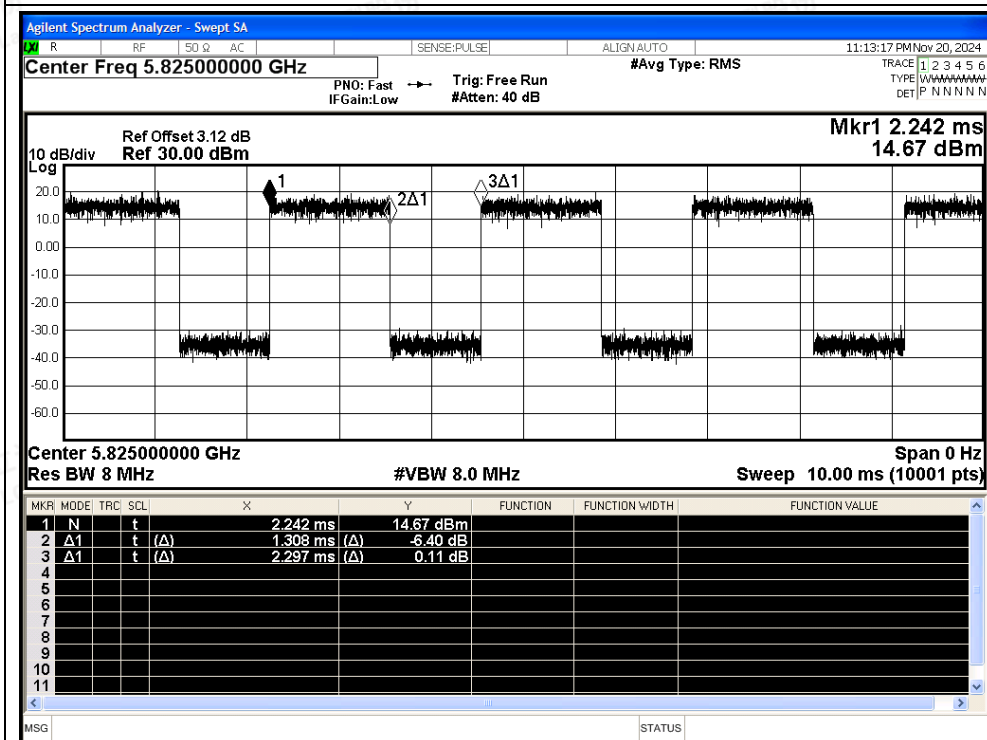

Duty Cycle NVNT ac40 5755MHz Ant7


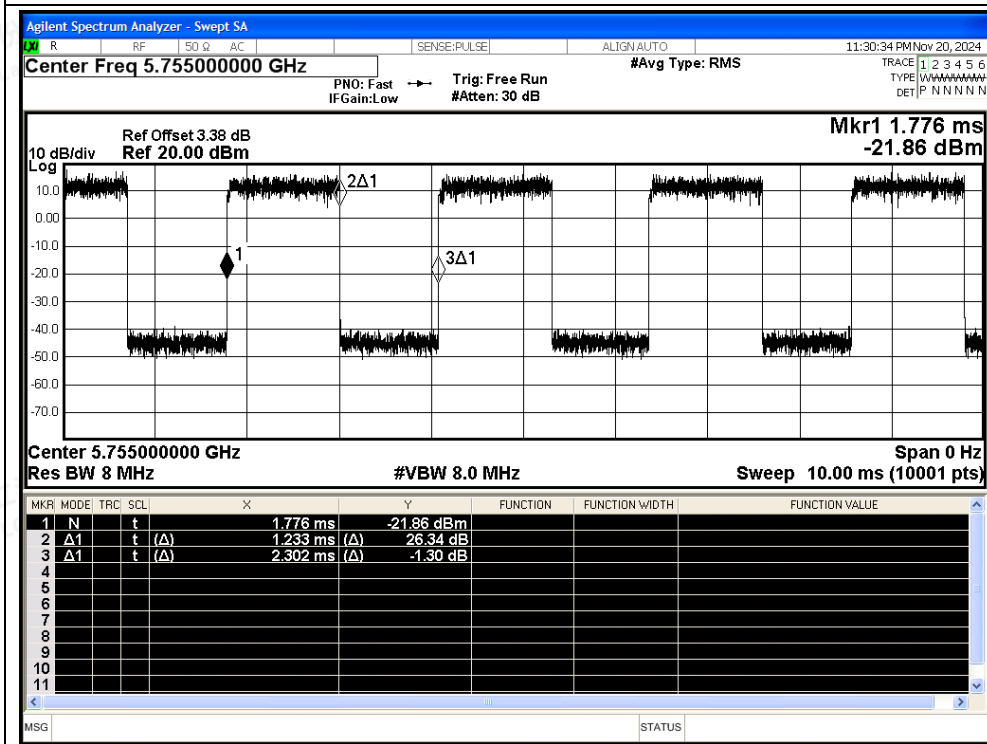


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

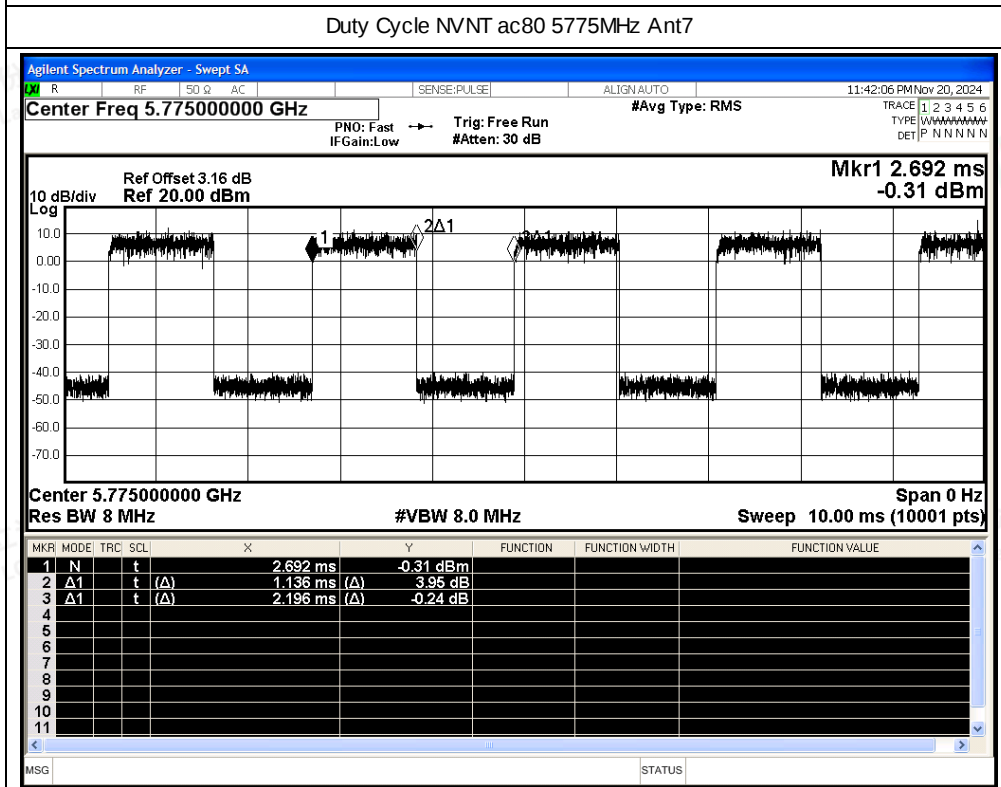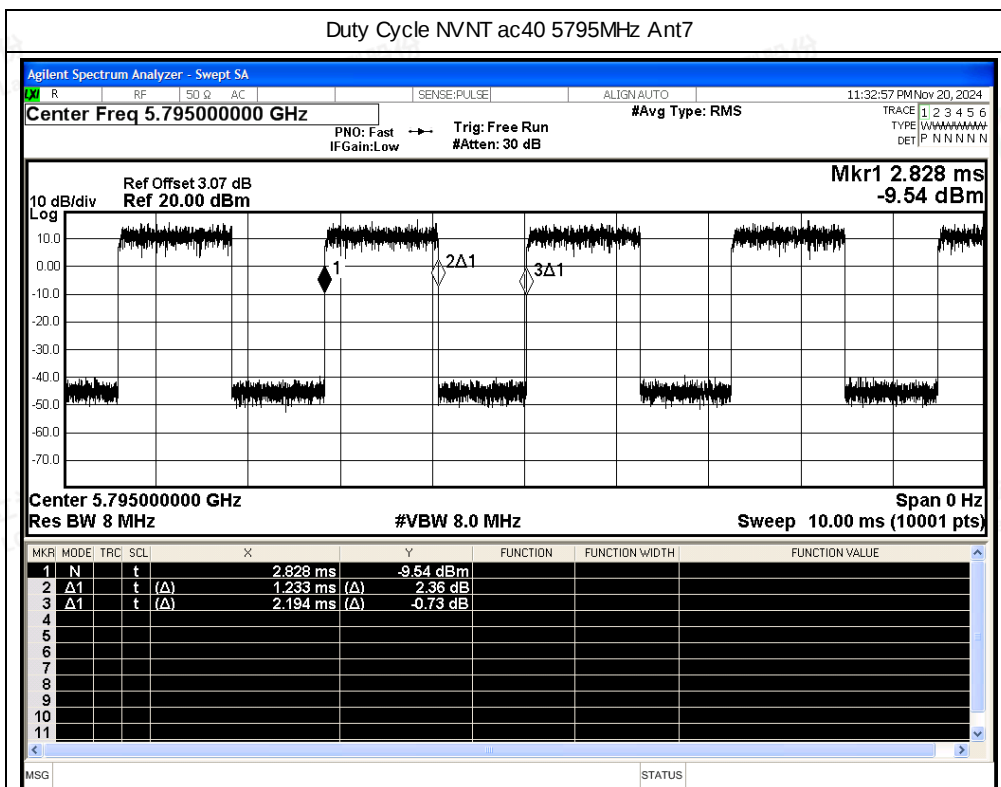

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant7

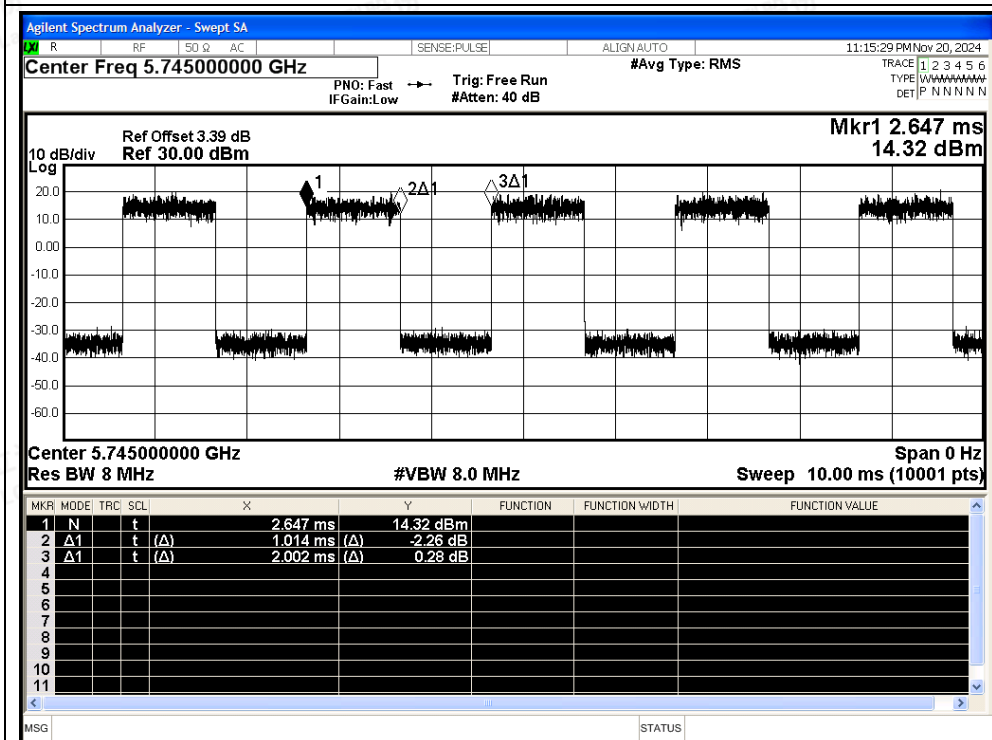

Duty Cycle NVNT ax20 5785MHz Ant7

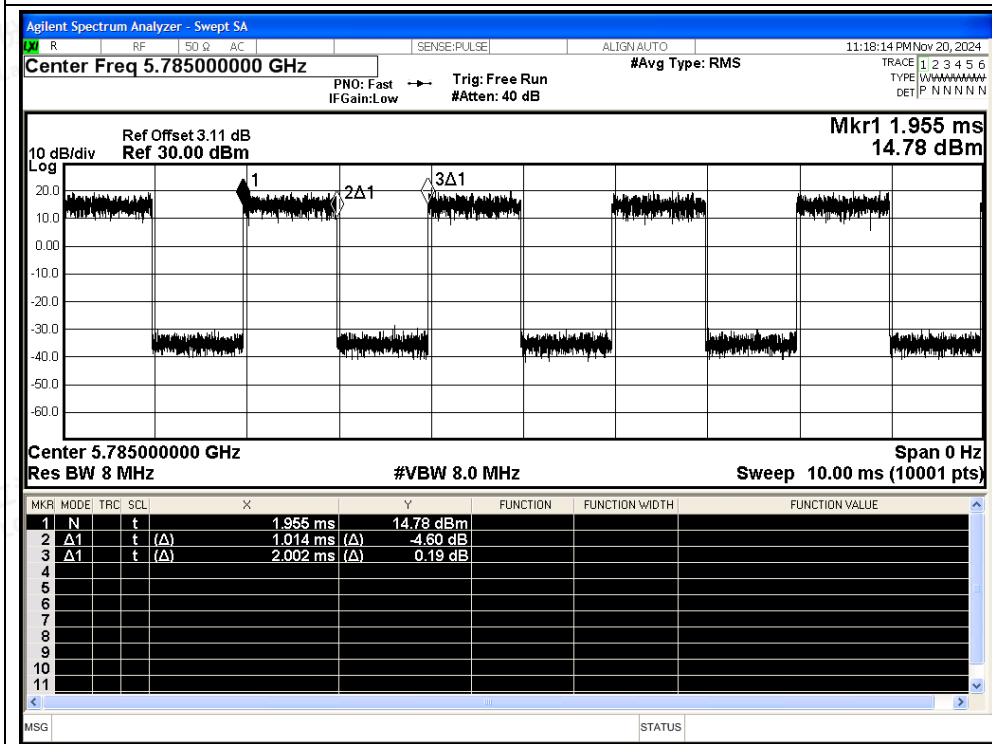

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant7

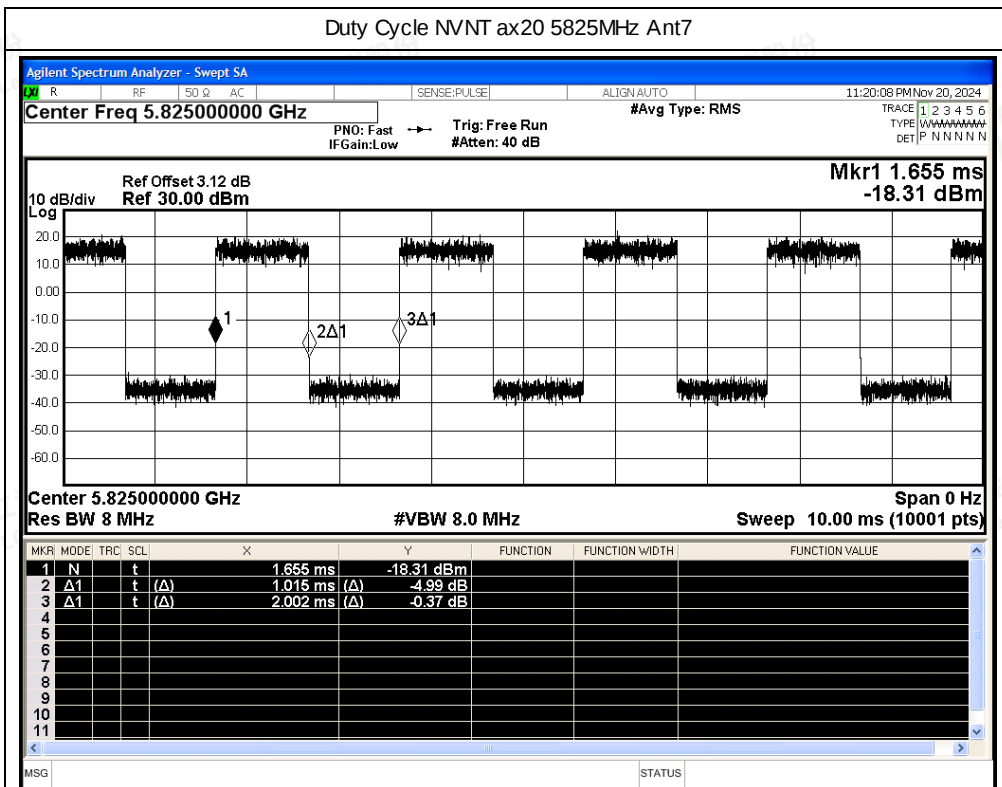

Duty Cycle NVNT ax40 5755MHz Ant7

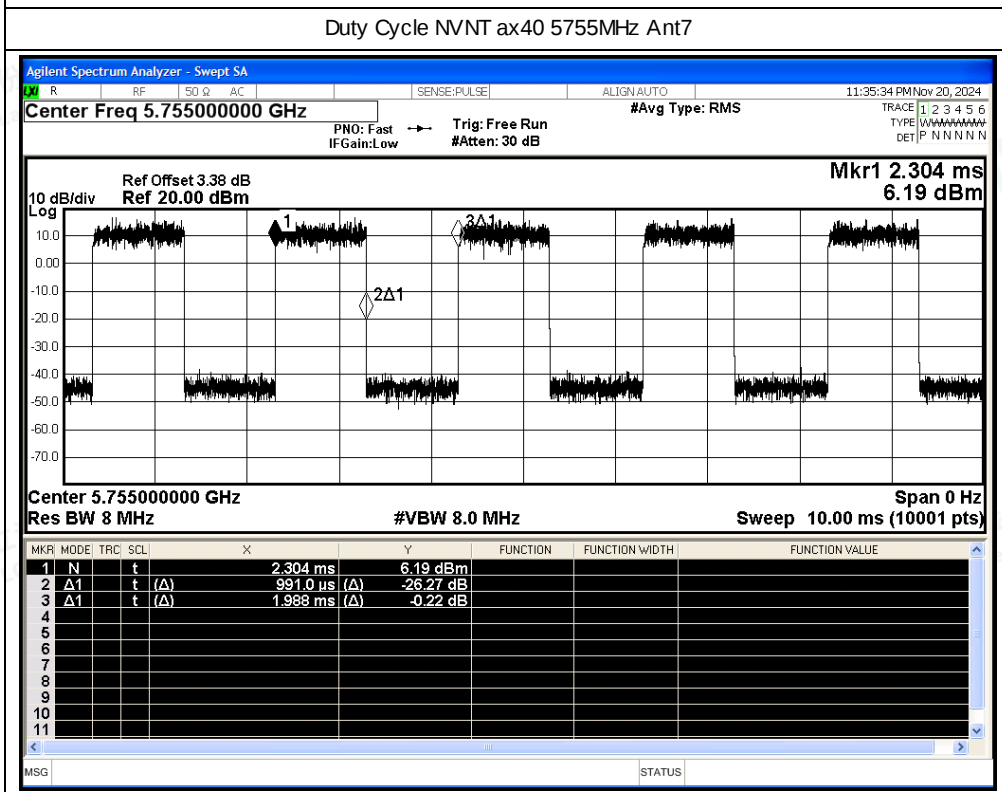

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant7

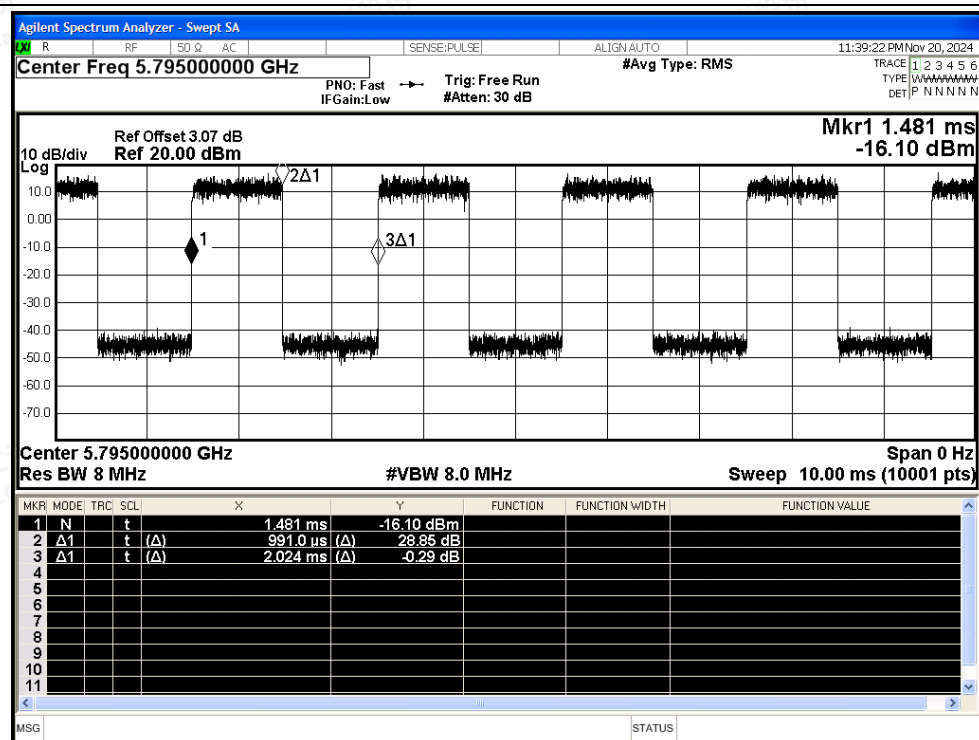

Duty Cycle NVNT ax80 5775MHz Ant7

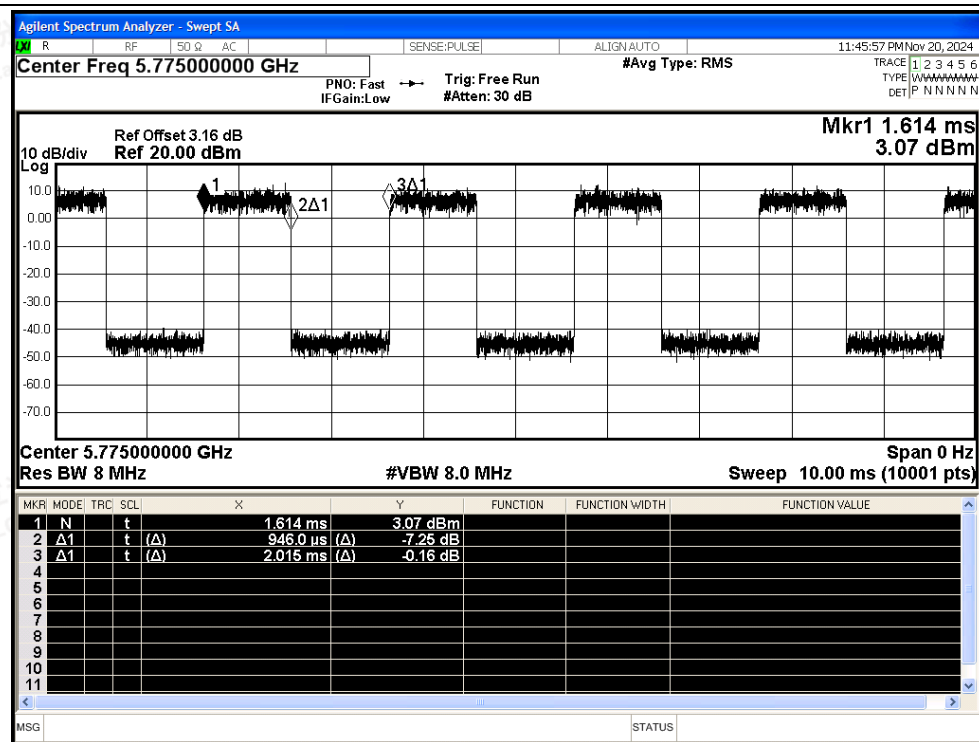

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity