



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-48.99	3.50	-	49.74	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-57.64	3.50	0.24	41.33	Average	54	Pass
NVNT	a	5500	Ant2	5469.8	-44.88	3.50	-	53.85	Peak	68.2	Pass
NVNT	a	5500	Ant2	5468.2	-57.02	3.50	0.24	41.95	Average	54	Pass
NVNT	a	5500	Ant2	5470	-47.04	3.50	-	51.69	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-57.48	3.50	0.24	41.49	Average	54	Pass
NVNT	a	5700	Ant2	5725	-41.82	3.50	-	56.91	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-55.02	3.50	0.24	43.95	Average	54	Pass
NVNT	a	5700	Ant2	5725.2	-38.78	3.50	-	59.95	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725.4	-54.63	3.50	0.24	44.34	Average	54	Pass
NVNT	a	5700	Ant2	5735	-49.53	3.50	-	49.20	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-57.95	3.50	0.24	41.02	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-51.01	3.50	-	47.72	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-58.09	3.50	0.28	40.92	Average	54	Pass
NVNT	n20	5500	Ant2	5469.6	-43.49	3.50	-	55.24	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5469	-56.16	3.50	0.28	42.85	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-45.95	3.50	-	52.78	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-56.31	3.50	0.28	42.70	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-37.66	3.50	-	61.07	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-52.17	3.50	0.28	46.84	Average	54	Pass
NVNT	n20	5700	Ant2	5725.2	-36.8	3.50	-	61.93	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-48.66	3.50	-	50.07	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-57.8	3.50	0.28	41.21	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-49.65	3.50	-	49.08	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.91	3.50	0.24	41.06	Average	54	Pass
NVNT	n40	5510	Ant2	5469.8	-37.77	3.50	-	60.96	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5468.4	-55.27	3.50	0.24	43.70	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-44.48	3.50	-	54.25	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-55.79	3.50	0.24	43.18	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-50.23	3.50	-	48.50	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-58.33	3.50	0.24	40.64	Average	54	Pass
NVNT	n40	5670	Ant2	5730.8	-48.66	3.50	-	50.07	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5731.8	-57.63	3.50	0.24	41.34	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-50.41	3.50	-	48.32	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-58.25	3.50	0.24	40.72	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-49.84	3.50	-	48.89	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-57.77	3.50	0.28	41.24	Average	54	Pass





NVNT	ac20	5500	Ant2	5469.6	-43.2	3.50	-	55.53	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5469.6	-55.78	3.50	0.28	43.23	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-47.83	3.50	-	50.90	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-56.99	3.50	0.28	42.02	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-41.75	3.50	-	56.98	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.87	3.50	0.28	45.14	Average	54	Pass
NVNT	ac20	5700	Ant2	5725.2	-34.22	3.50	-	64.51	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725.8	-53.33	3.50	0.28	45.68	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-44.22	3.50	-	54.51	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.42	3.50	0.28	41.59	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-50.16	3.50	-	48.57	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-57.55	3.50	0.24	41.42	Average	54	Pass
NVNT	ac40	5510	Ant2	5469.6	-39.85	3.50	-	58.88	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5469.8	-54.84	3.50	0.24	44.13	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-44.72	3.50	-	54.01	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-55.31	3.50	0.24	43.66	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-49.45	3.50	-	49.28	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-58.23	3.50	0.24	40.74	Average	54	Pass
NVNT	ac40	5670	Ant2	5727.2	-47.38	3.50	-	51.35	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5727.6	-57.65	3.50	0.24	41.32	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-49.88	3.50	-	48.85	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-58.1	3.50	0.24	40.87	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-48.98	3.50	-	49.75	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-57.94	3.50	0.28	41.07	Average	54	Pass
NVNT	ax20	5500	Ant2	5469	-43.29	3.50	-	55.44	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5469.6	-56.38	3.50	0.28	42.63	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-43.76	3.50	-	54.97	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-57.11	3.50	0.28	41.90	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-43.23	3.50	-	55.50	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-54.49	3.50	0.28	44.52	Average	54	Pass
NVNT	ax20	5700	Ant2	5726	-37.97	3.50	-	60.76	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5726.2	-52.85	3.50	0.28	46.16	Average	54	Pass
NVNT	ax20	5700	Ant2	5735	-47.23	3.50	-	51.50	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-57.44	3.50	0.28	41.57	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-50	3.50	-	48.73	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-57.65	3.50	0.24	41.32	Average	54	Pass
NVNT	ax40	5510	Ant2	5467.8	-42.93	3.50	-	55.80	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469.4	-55.32	3.50	0.24	43.65	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-45.43	3.50	-	53.30	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-55.77	3.50	0.24	43.20	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-49.53	3.50	-	49.20	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax40	5670	Ant2	5725	-58.06	3.50	0.23	40.90	Average	54	Pass
NVNT	ax40	5670	Ant2	5730	-48.18	3.50	-	50.55	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5729.6	-57.48	3.50	0.23	41.48	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-51.03	3.50	-	47.70	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-57.85	3.50	0.23	41.11	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant2 Peak

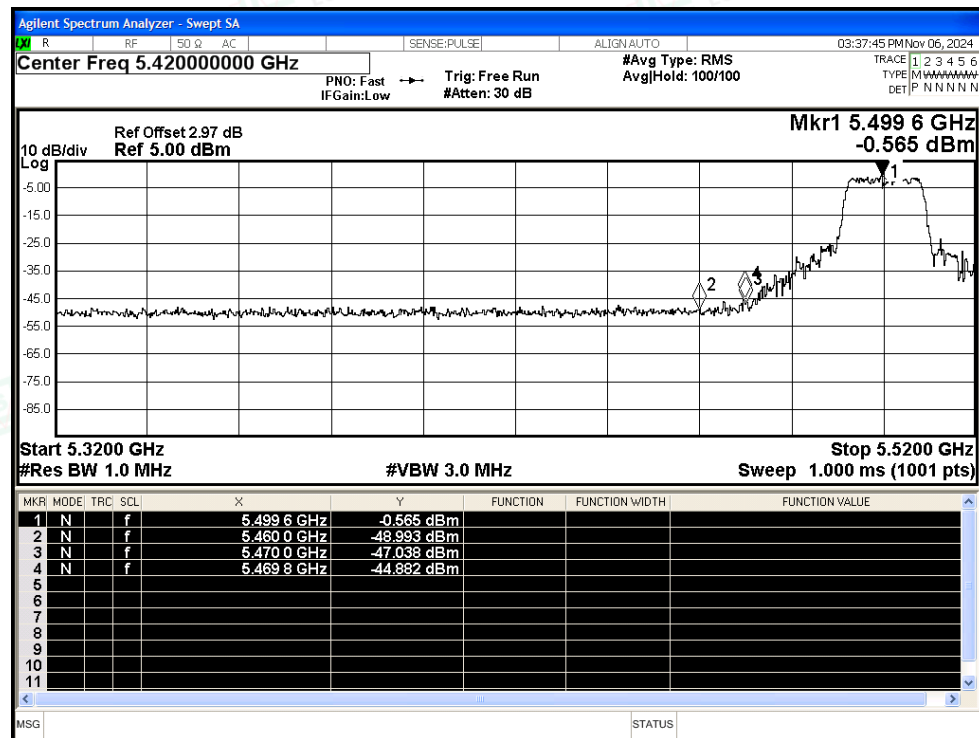

Restrict Band NVNT a 5500MHz Ant2 Average

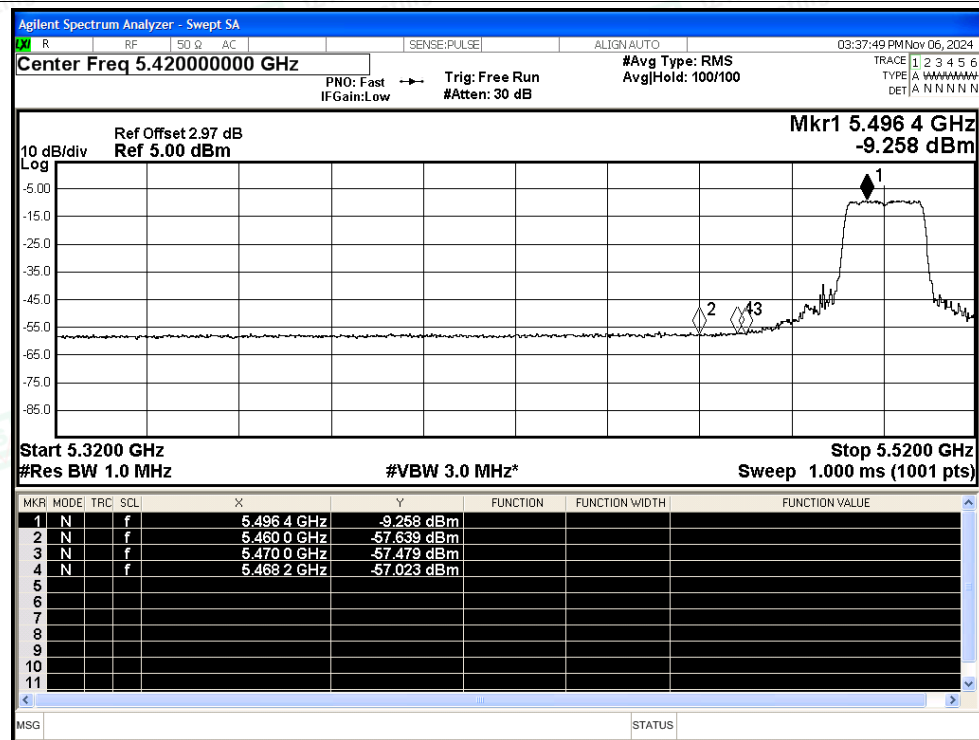

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant2 Peak

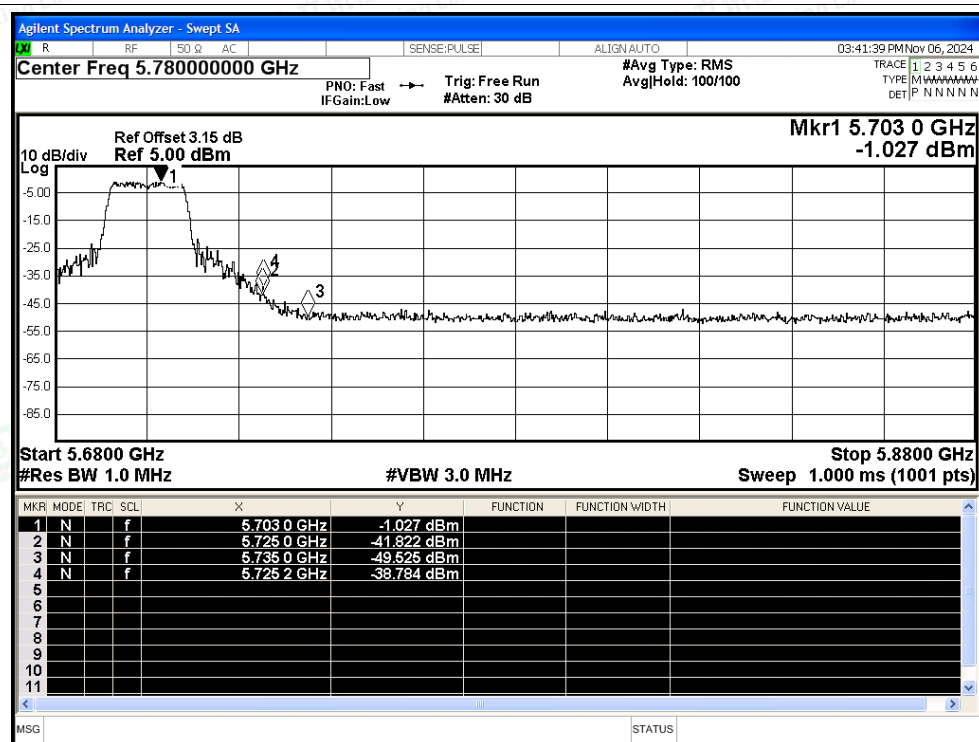

Restrict Band NVNT a 5700MHz Ant2 Average

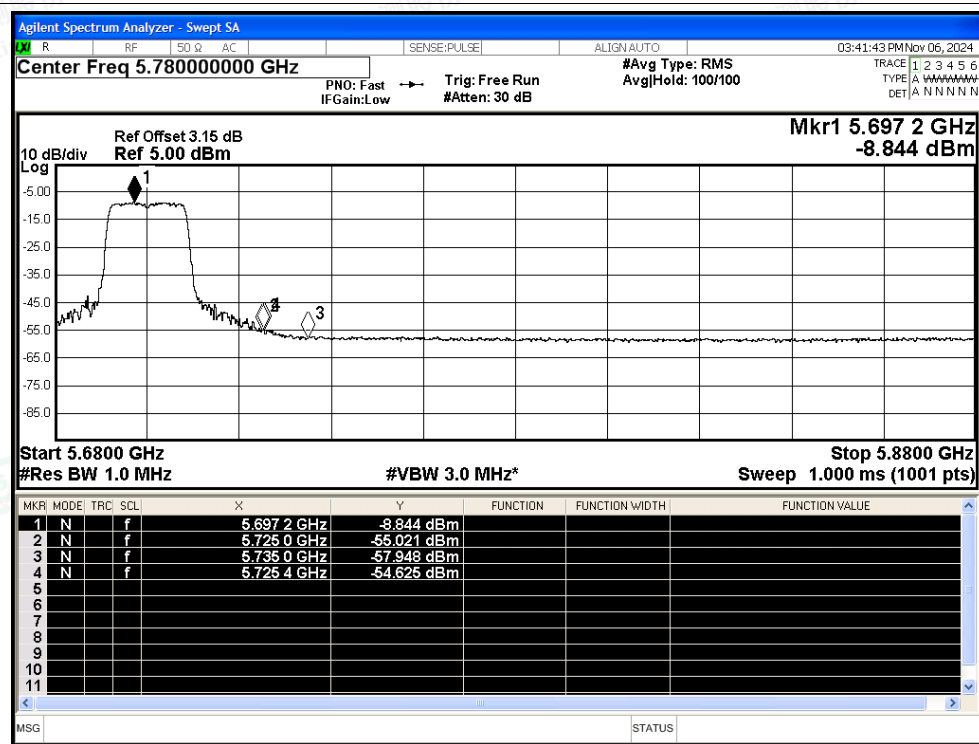

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant2 Peak

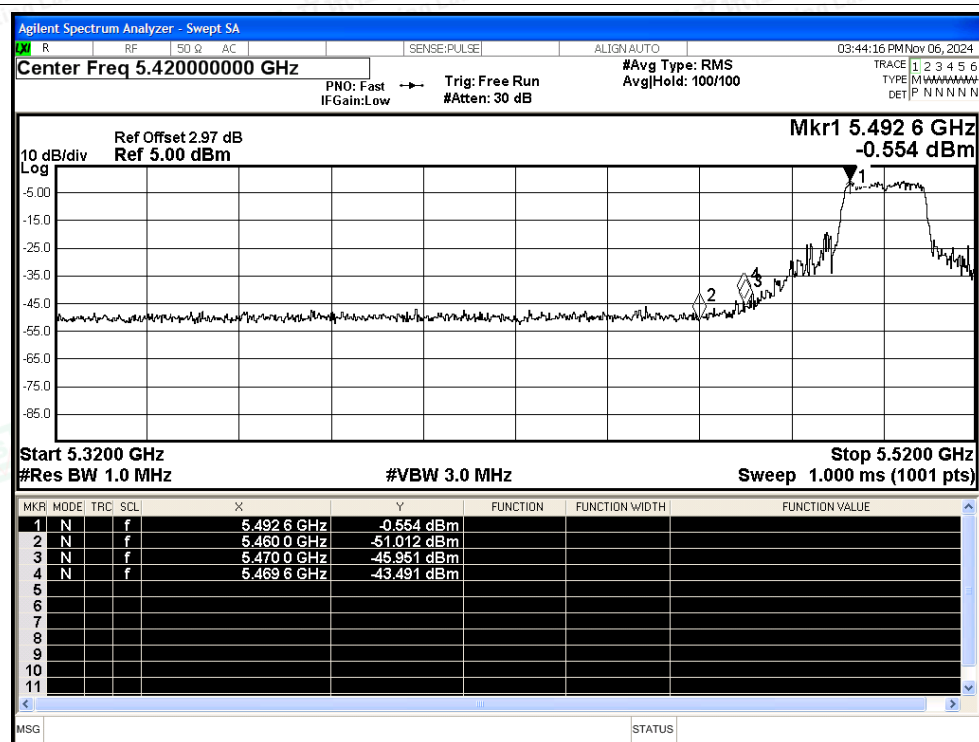

Restrict Band NVNT n20 5500MHz Ant2 Average

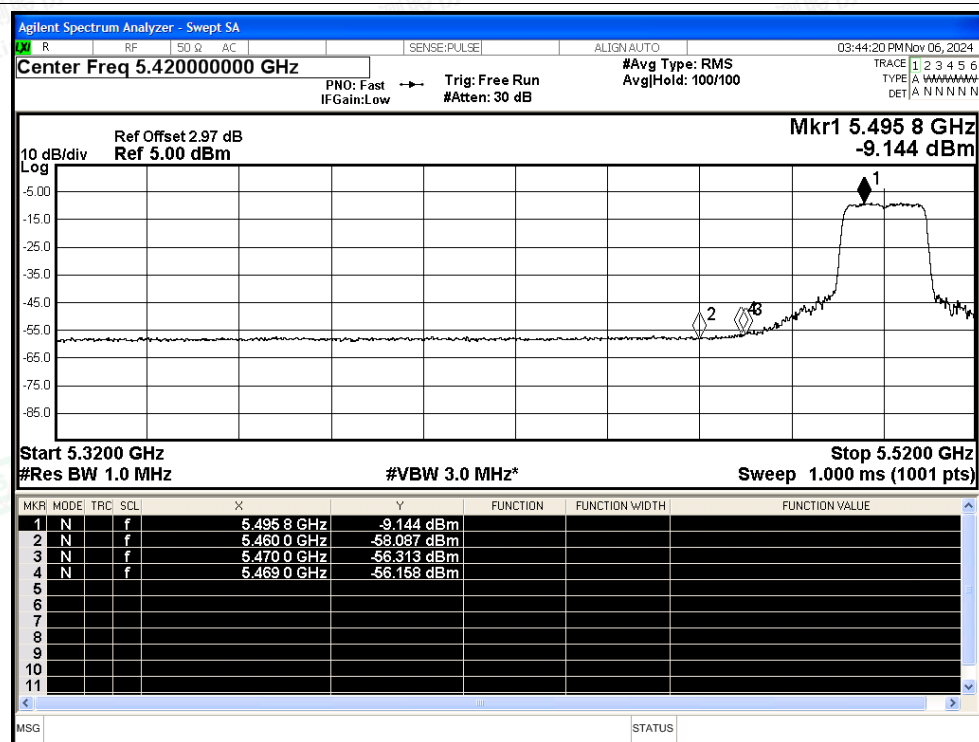

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant2 Peak

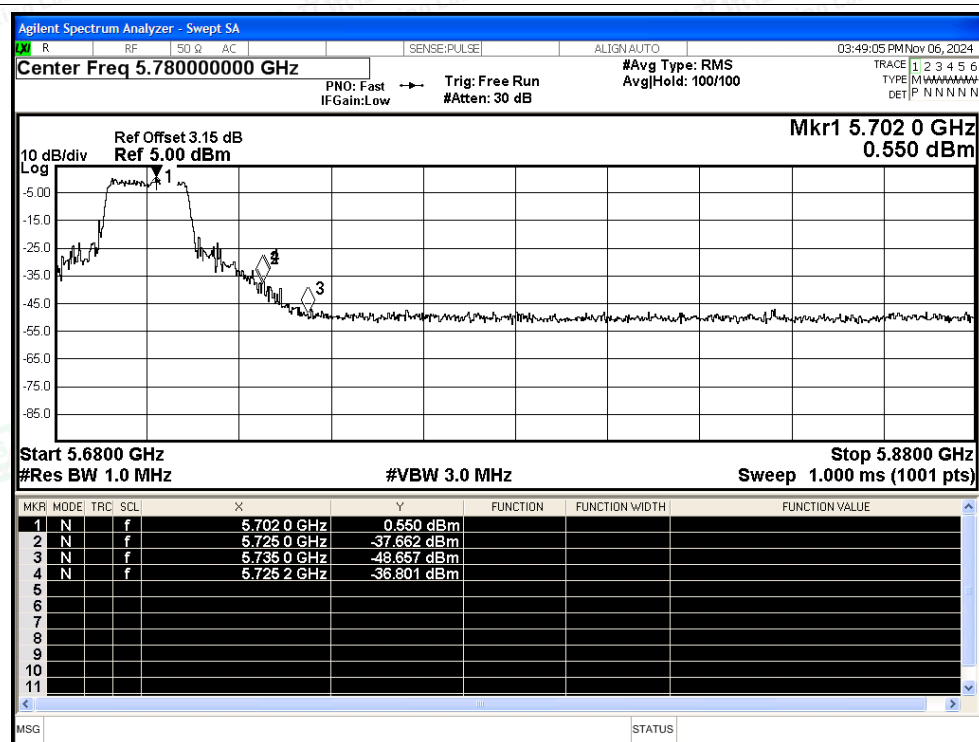

Restrict Band NVNT n20 5700MHz Ant2 Average

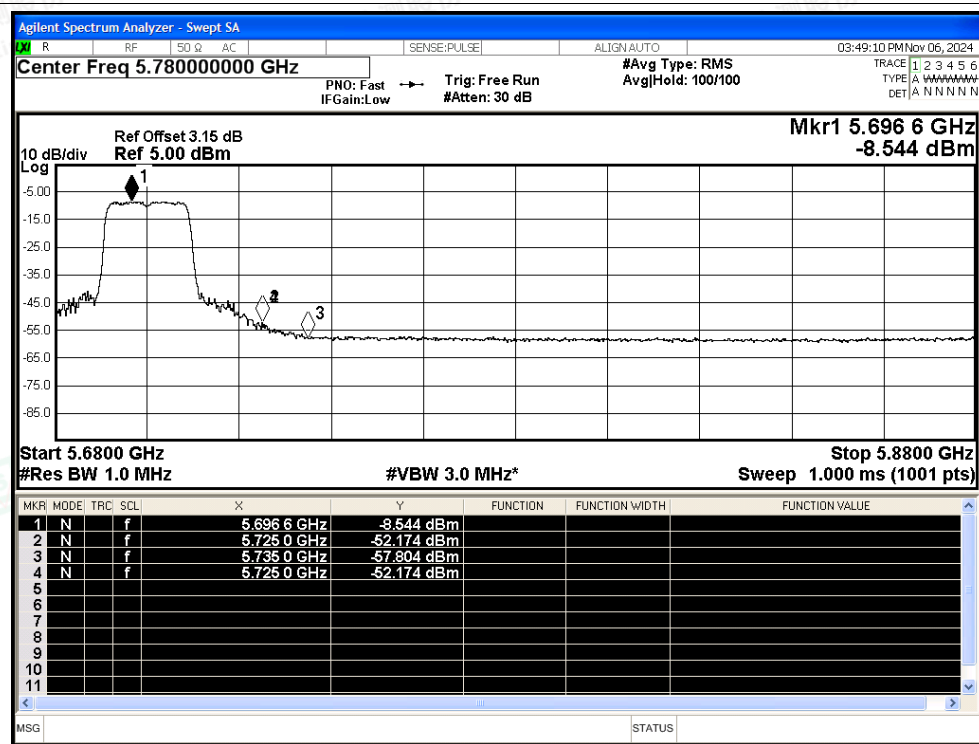

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant2 Peak

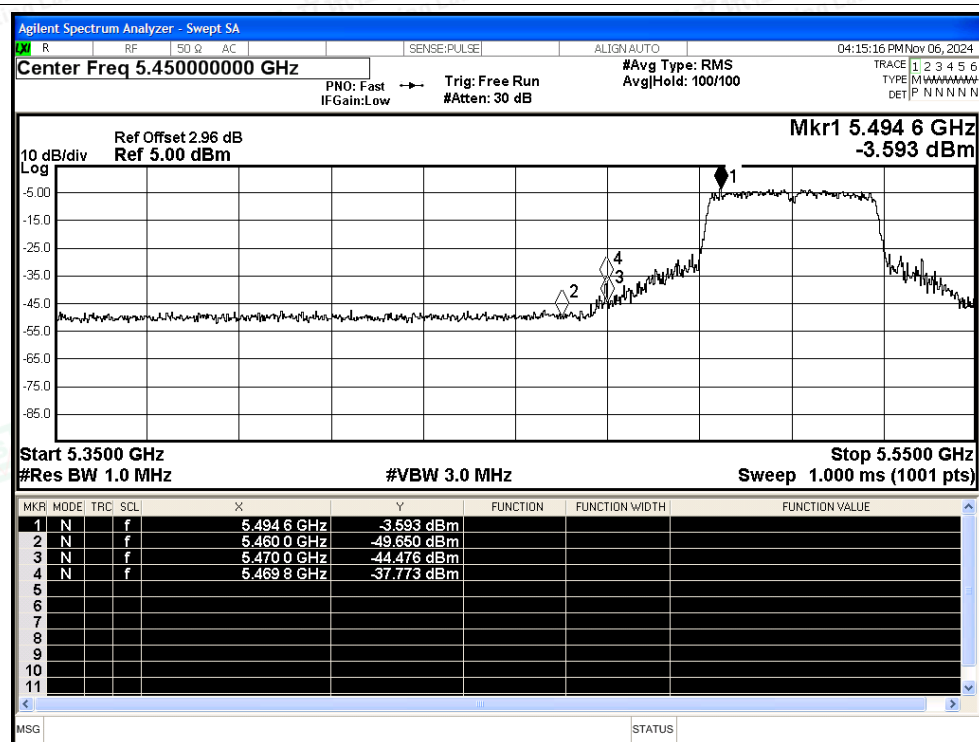

Restrict Band NVNT n40 5510MHz Ant2 Average

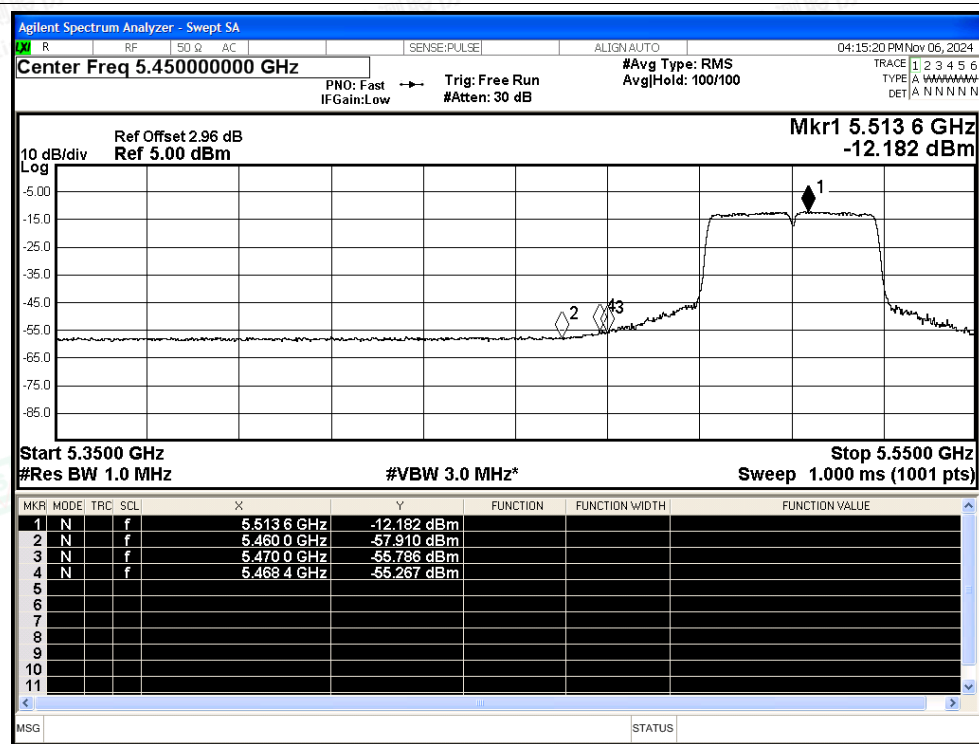

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Peak

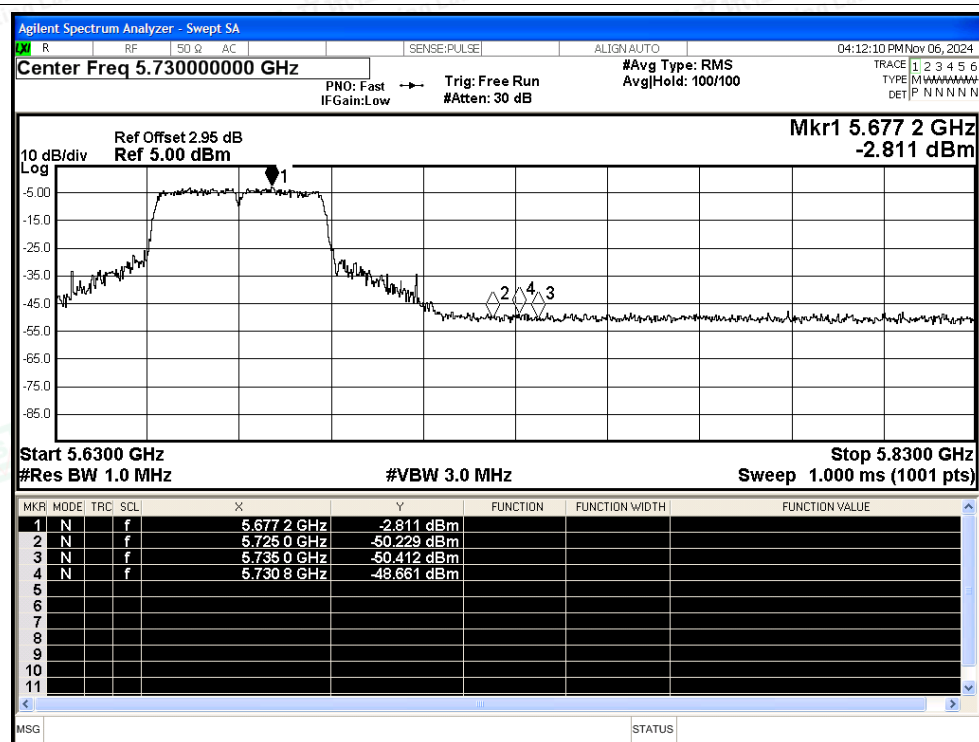


Restrict Band NVNT n40 5670MHz Ant2 Average

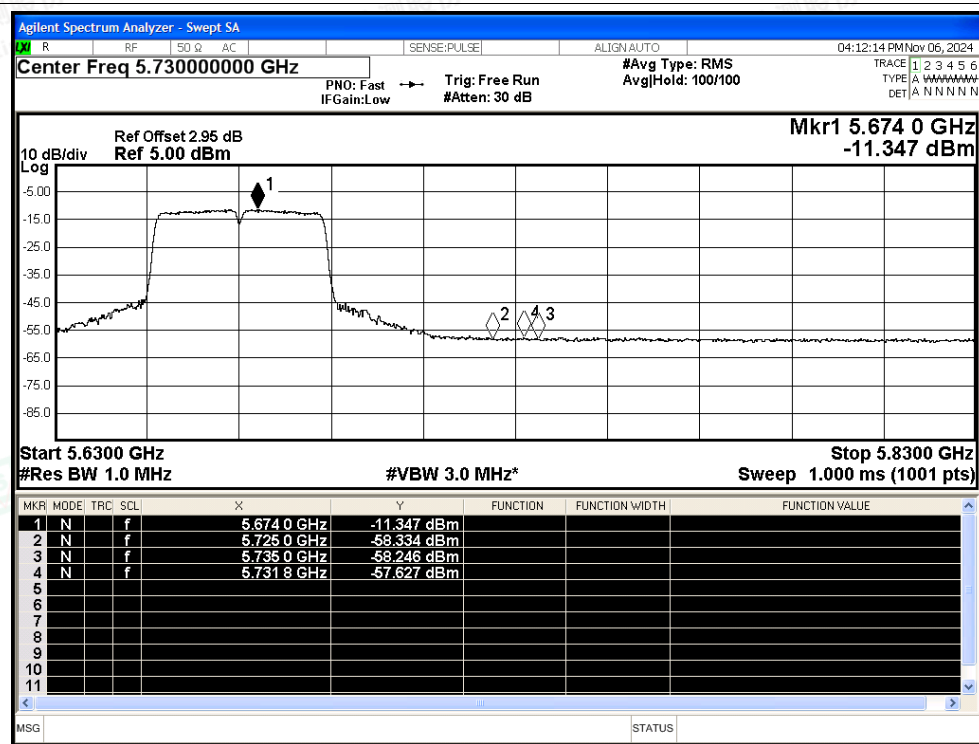




Restrict Band NVNT ac20 5500MHz Ant2 Peak

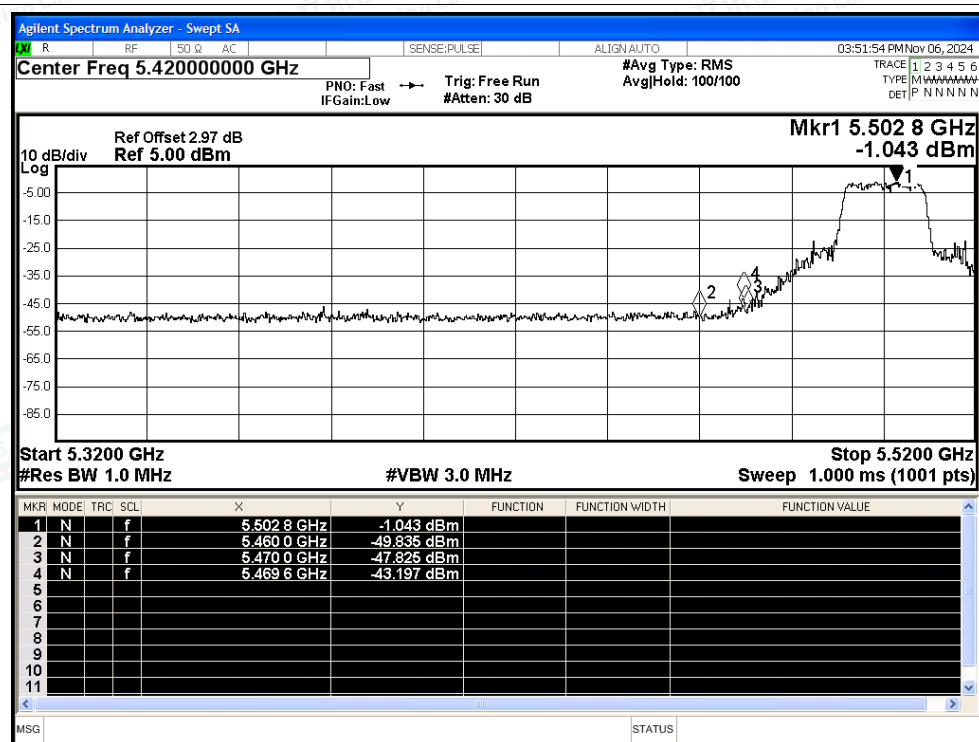

Restrict Band NVNT ac20 5500MHz Ant2 Average

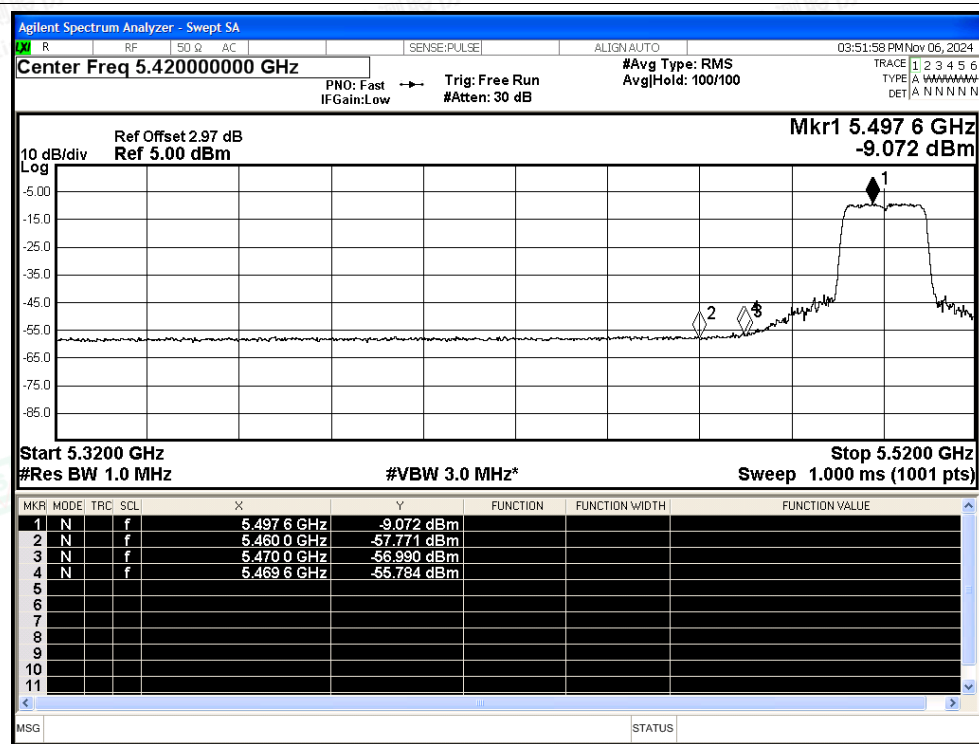

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant2 Peak

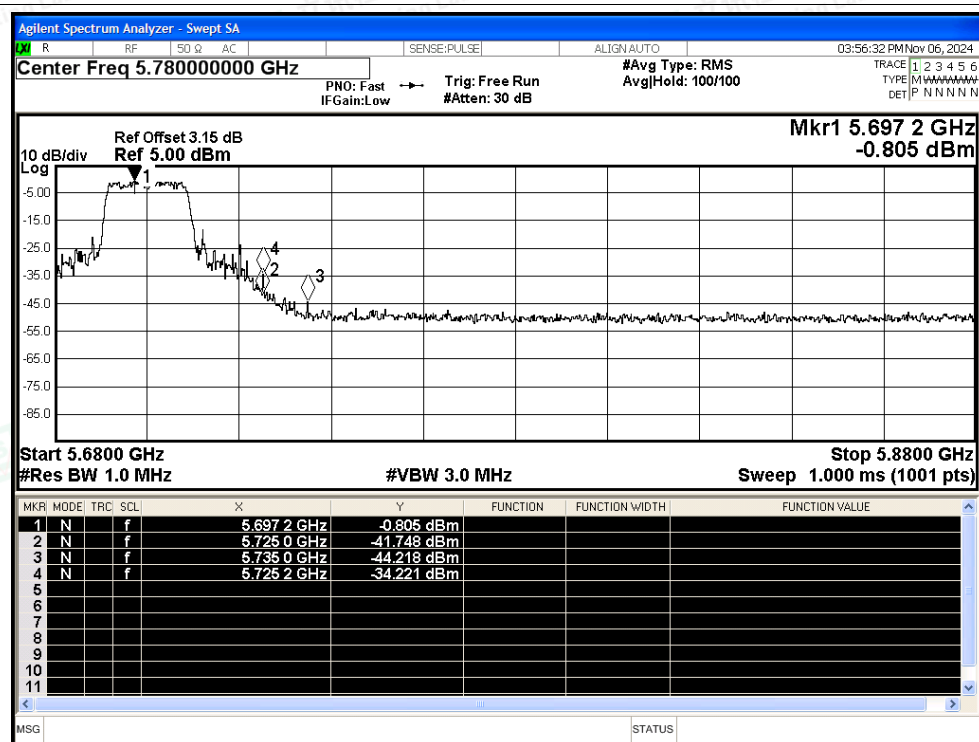

Restrict Band NVNT ac20 5700MHz Ant2 Average

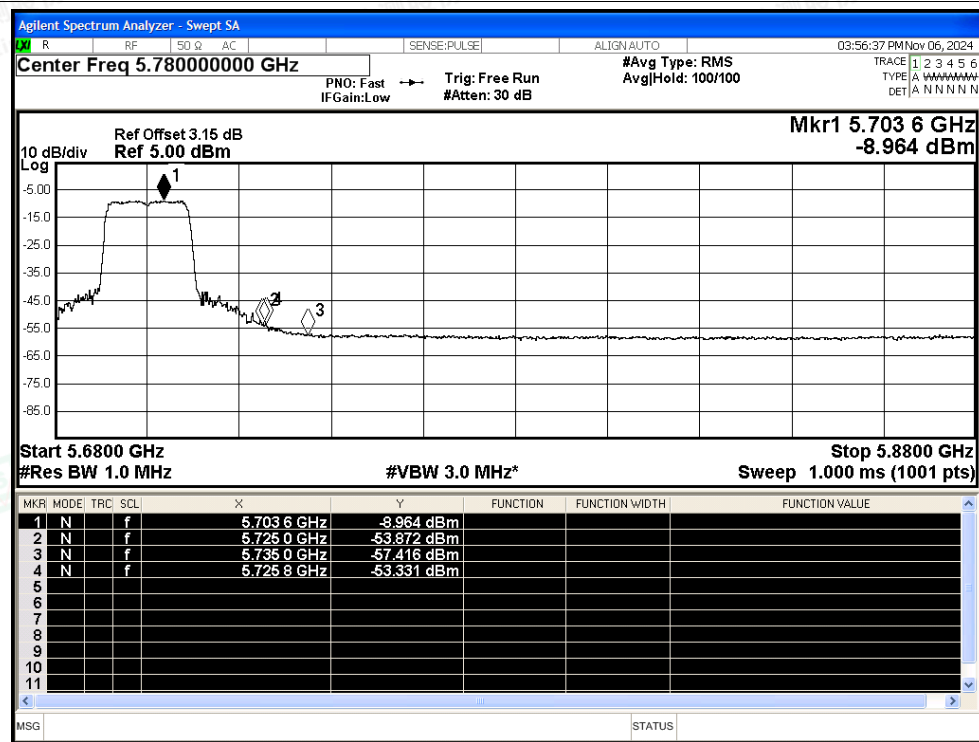

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant2 Peak

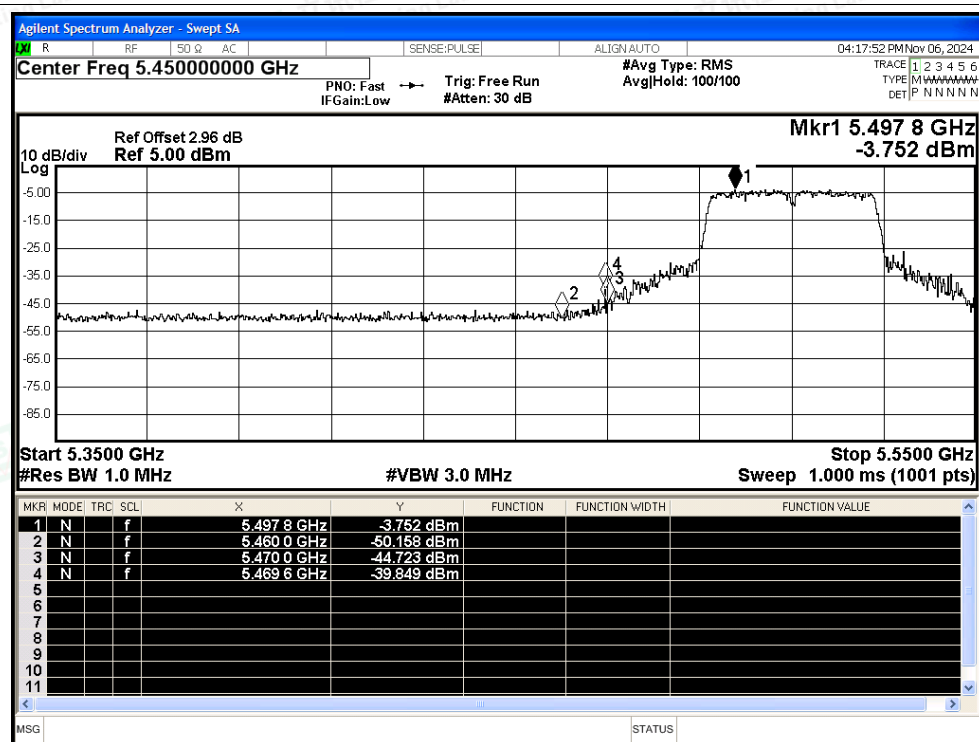

Restrict Band NVNT ac40 5510MHz Ant2 Average

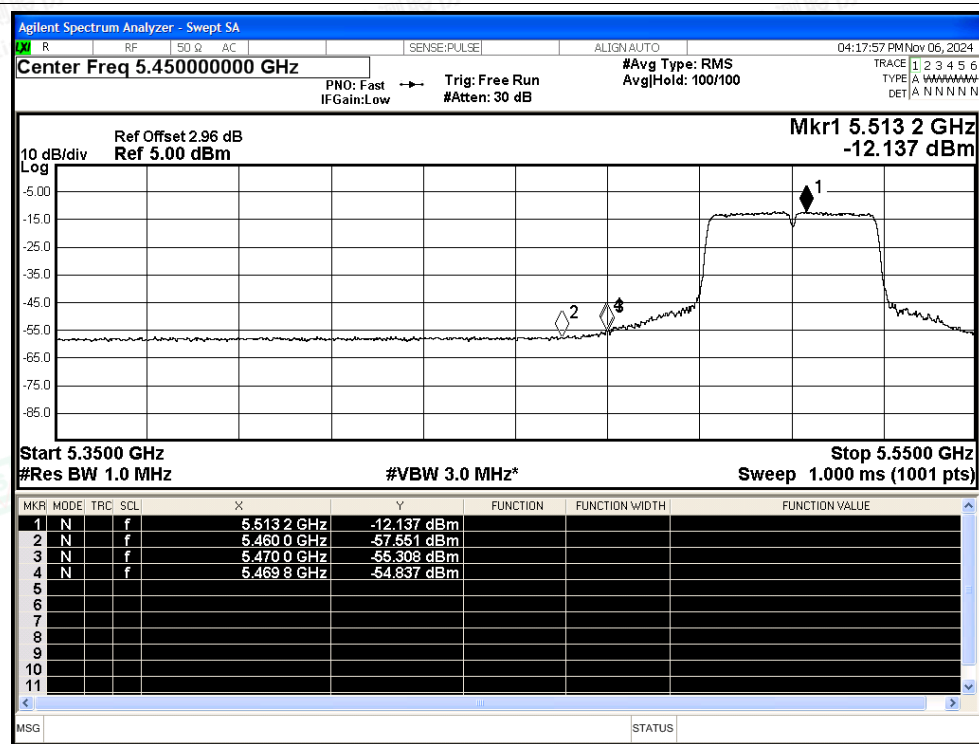

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant2 Peak

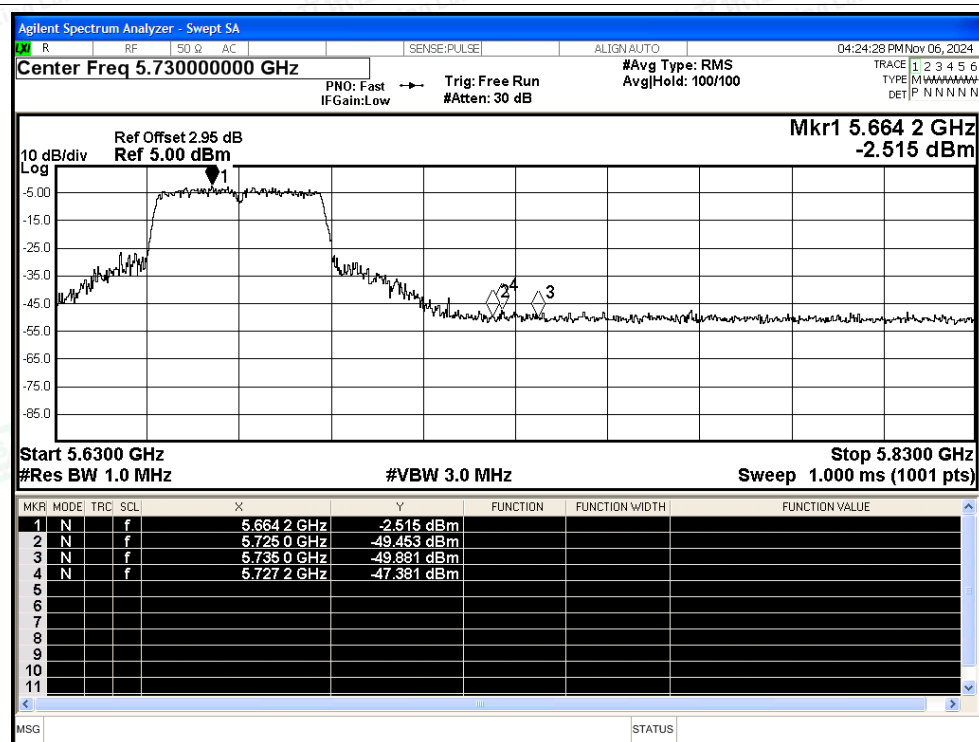

Restrict Band NVNT ac40 5670MHz Ant2 Average

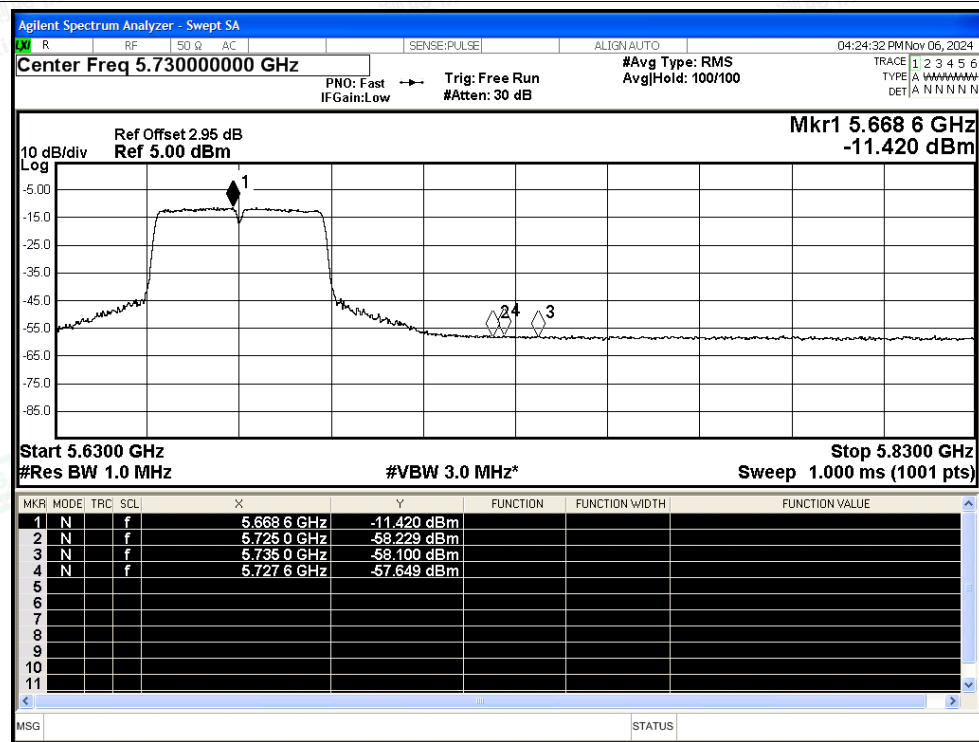

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant2 Peak

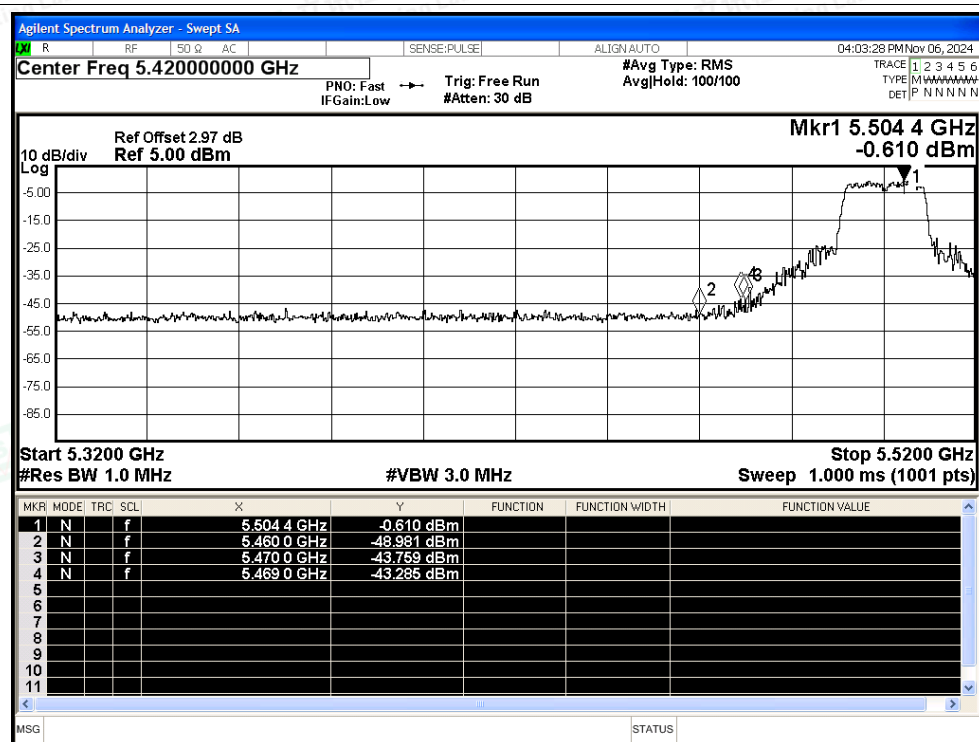

Restrict Band NVNT ax20 5500MHz Ant2 Average

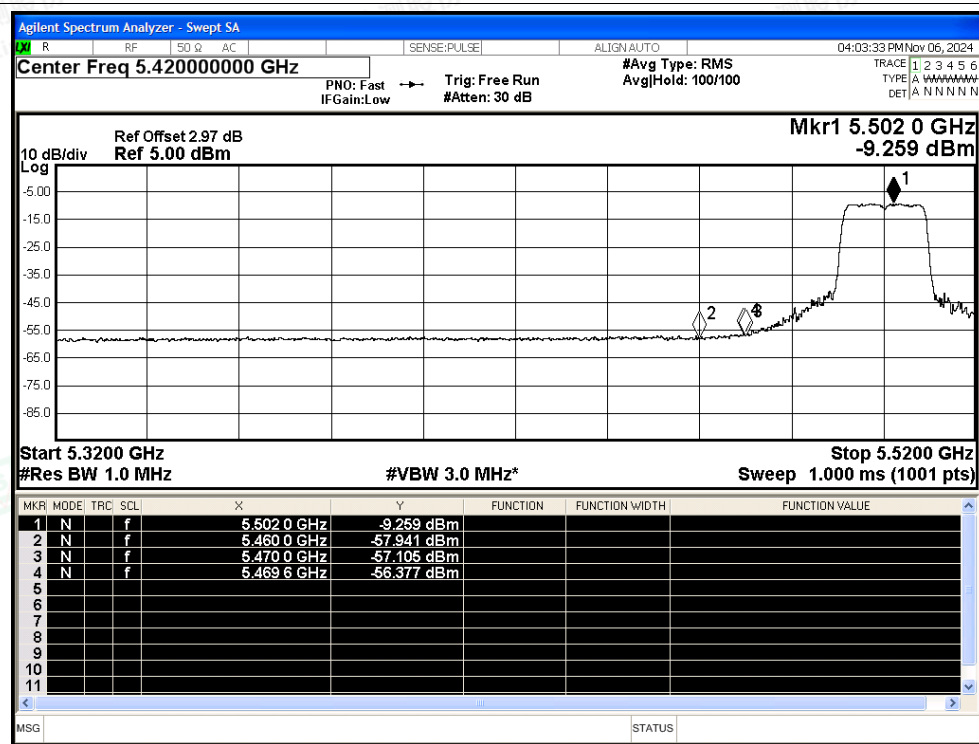

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant2 Peak

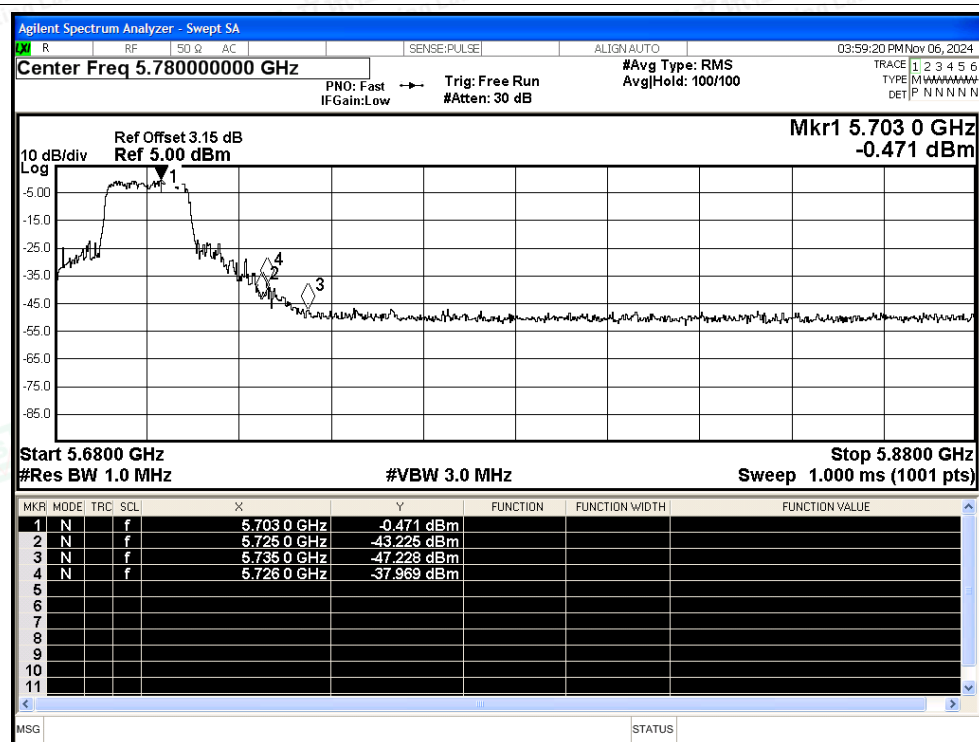

Restrict Band NVNT ax20 5700MHz Ant2 Average

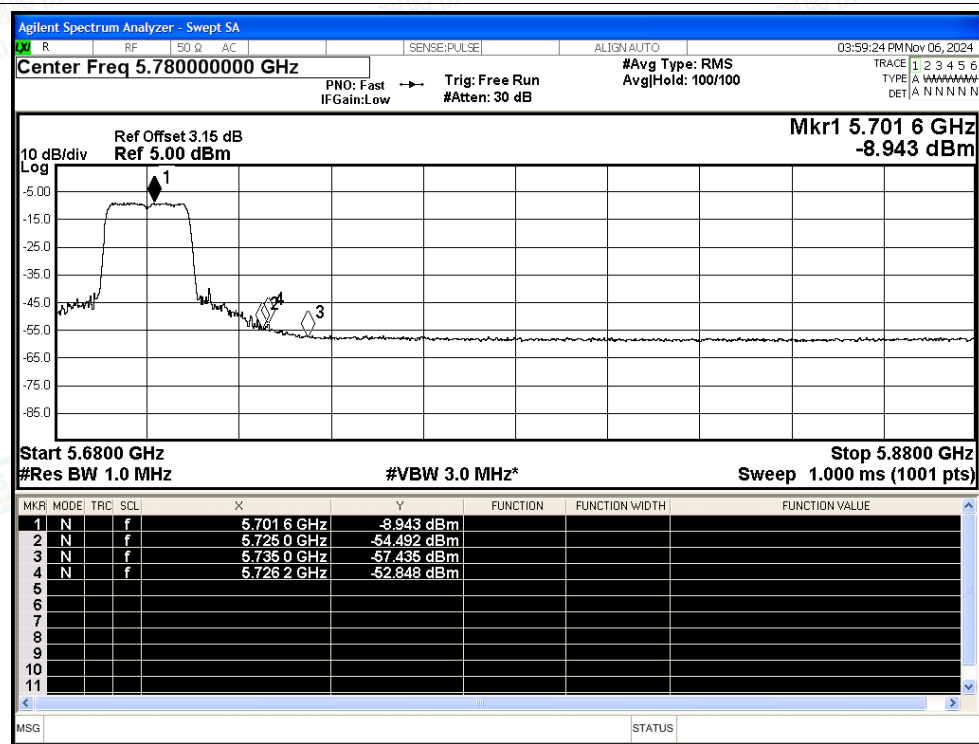

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant2 Peak

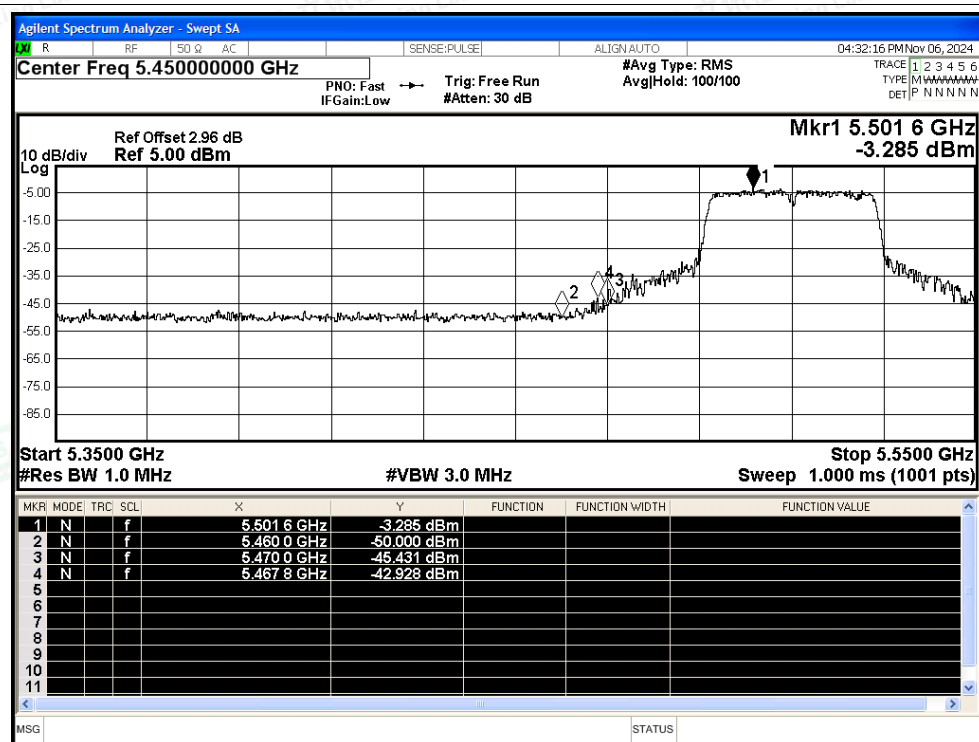


Restrict Band NVNT ax40 5510MHz Ant2 Average

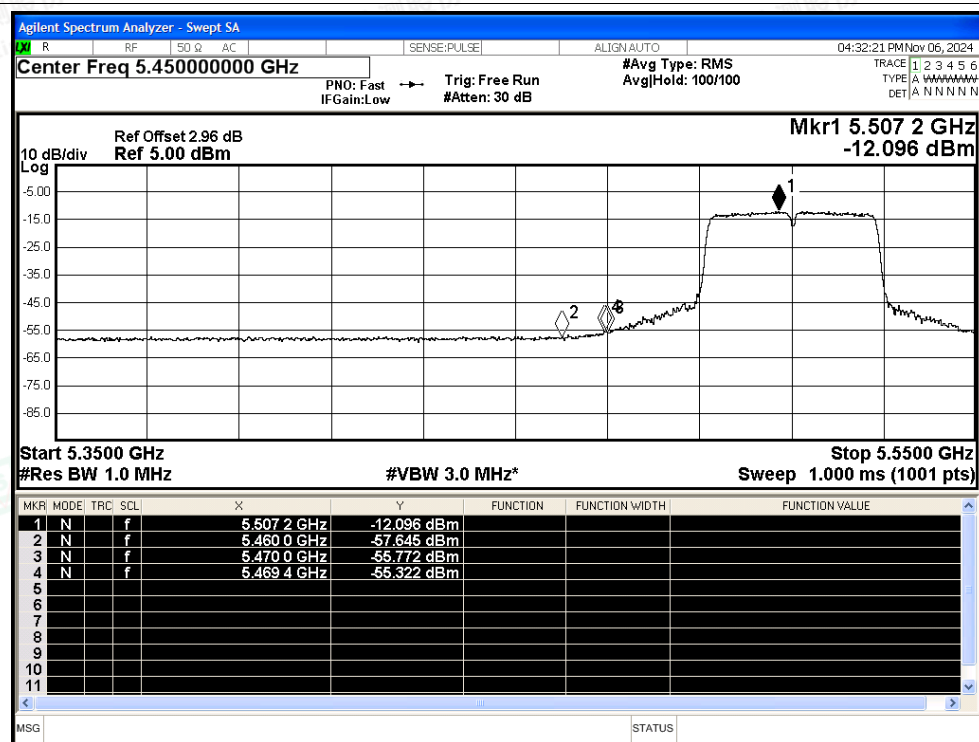




Restrict Band NVNT ax40 5670MHz Ant2 Peak

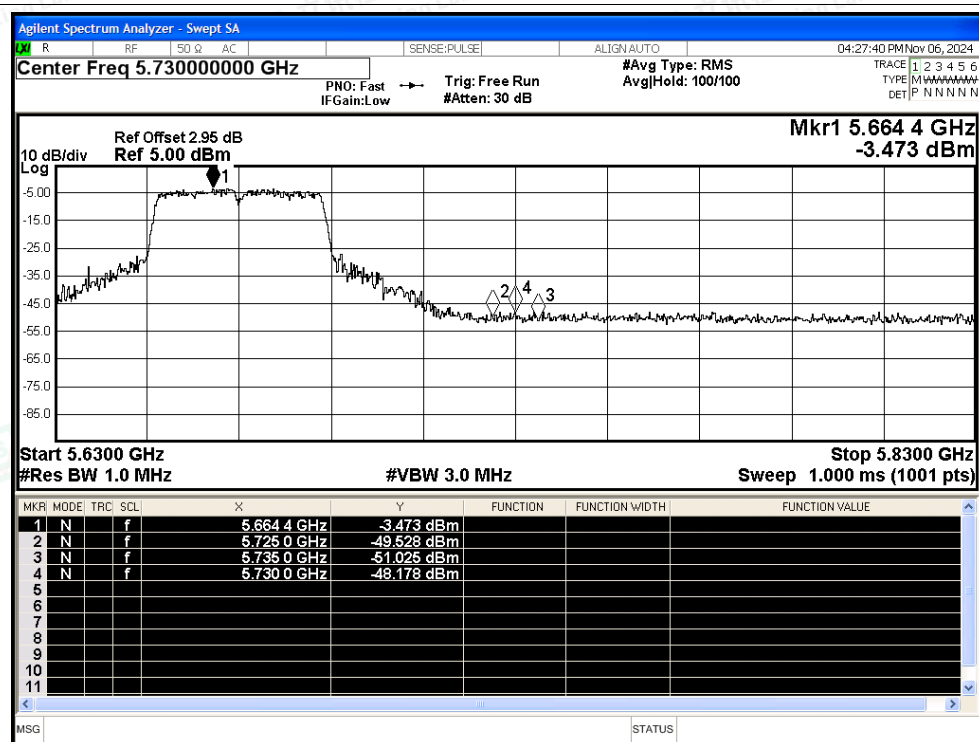

Restrict Band NVNT ax40 5670MHz Ant2 Average

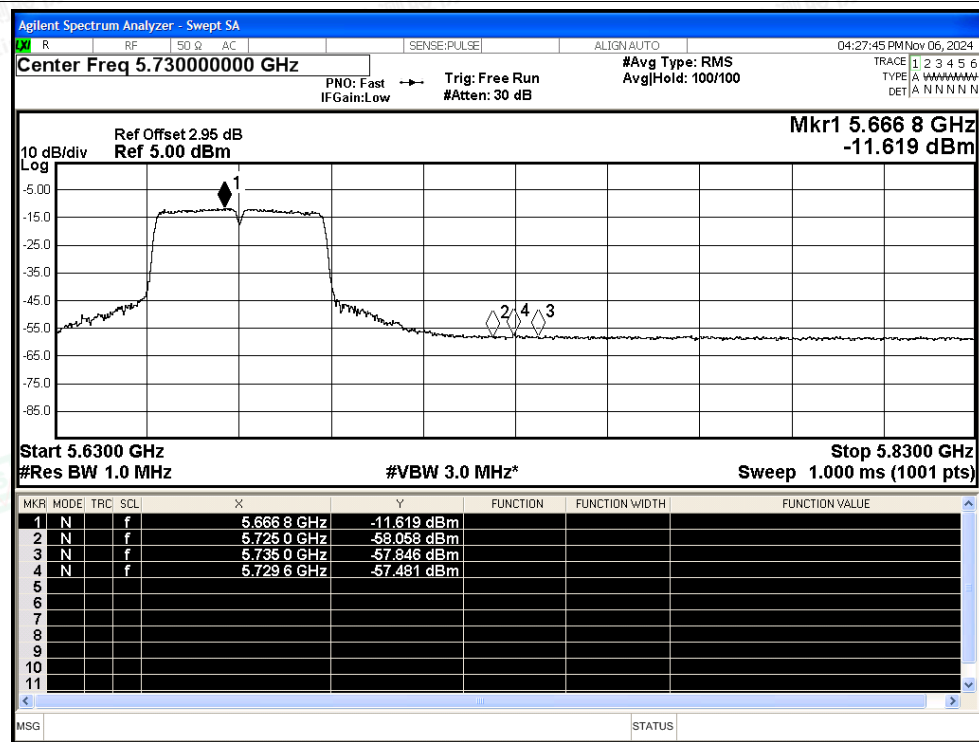

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Ant 1 + Ant 2

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant1	Ant2	Ant1+ Ant2			
NVNT	a	5500	49.25	49.74	55.52	Peak	68.2	Pass
NVNT	a	5500	41.36	41.33	47.37	Average	54	Pass
NVNT	a	5500	54.67	53.85	60.29	Peak	68.2	Pass
NVNT	a	5500	42.59	41.95	48.30	Average	54	Pass
NVNT	a	5500	51.64	51.69	57.69	Peak	68.2	Pass
NVNT	a	5500	42.38	41.49	47.97	Average	54	Pass
NVNT	a	5700	54.58	56.91	61.84	Peak	68.2	Pass
NVNT	a	5700	43.08	43.95	49.55	Average	54	Pass
NVNT	a	5700	57.71	59.95	64.92	Peak	68.2	Pass
NVNT	a	5700	44.52	44.34	50.45	Average	54	Pass
NVNT	a	5700	48.29	49.2	54.78	Peak	68.2	Pass
NVNT	a	5700	41.74	41.02	47.41	Average	54	Pass
NVNT	n20	5500	48.52	47.72	54.15	Peak	68.2	Pass
NVNT	n20	5500	41.09	40.92	47.03	Average	54	Pass
NVNT	n20	5500	56	55.24	61.65	Peak	68.2	Pass
NVNT	n20	5500	43.45	42.85	49.18	Average	54	Pass
NVNT	n20	5500	54.68	52.78	59.80	Peak	68.2	Pass
NVNT	n20	5500	42.19	42.7	48.47	Average	54	Pass
NVNT	n20	5700	55.07	61.07	64.60	Peak	68.2	Pass
NVNT	n20	5700	44.72	46.84	51.87	Average	54	Pass
NVNT	n20	5700	60.23	61.93	67.14	Peak	68.2	Pass
NVNT	n20	5700	46.55	41.21	50.30	Average	54	Pass
NVNT	n40	5510	51.55	49.08	56.42	Peak	68.2	Pass
NVNT	n40	5510	41.97	41.06	47.55	Average	54	Pass
NVNT	n40	5510	51	60.96	63.36	Peak	68.2	Pass
NVNT	n40	5510	41.13	43.7	48.53	Average	54	Pass
NVNT	n40	5510	56.9	54.25	61.70	Peak	68.2	Pass
NVNT	n40	5510	44.13	43.18	49.69	Average	54	Pass
NVNT	n40	5670	52.29	48.5	56.62	Peak	68.2	Pass
NVNT	n40	5670	43.56	40.64	48.24	Average	54	Pass
NVNT	n40	5670	48.56	50.07	55.37	Peak	68.2	Pass
NVNT	n40	5670	41.15	41.34	47.27	Average	54	Pass
NVNT	n40	5670	51.51	48.32	56.08	Peak	68.2	Pass
NVNT	n40	5670	41.69	40.72	47.24	Average	54	Pass
NVNT	ac20	5500	48.37	48.89	54.65	Peak	68.2	Pass
NVNT	ac20	5500	41.45	41.24	47.37	Average	54	Pass
NVNT	ac20	5500	49.55	55.53	59.07	Peak	68.2	Pass
NVNT	ac20	5500	41.71	43.23	48.52	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	54.97	50.9	59.19	Peak	68.2	Pass
NVNT	ac20	5500	43.03	42.02	48.56	Average	54	Pass
NVNT	ac20	5700	54.96	64.51	67.01	Peak	68.2	Pass
NVNT	ac20	5700	42.9	45.68	50.42	Average	54	Pass
NVNT	ac20	5700	59.12	54.51	63.14	Peak	68.2	Pass
NVNT	ac20	5700	47.46	41.59	51.03	Average	54	Pass
NVNT	ac40	5510	59.75	48.57	61.87	Peak	68.2	Pass
NVNT	ac40	5510	41.81	41.42	47.64	Average	54	Pass
NVNT	ac40	5510	50.04	58.88	61.56	Peak	68.2	Pass
NVNT	ac40	5510	41.66	44.13	49.00	Average	54	Pass
NVNT	ac40	5510	55.65	54.01	60.89	Peak	68.2	Pass
NVNT	ac40	5510	44.67	43.66	50.20	Average	54	Pass
NVNT	ac40	5670	53.55	49.28	57.70	Peak	68.2	Pass
NVNT	ac40	5670	41.16	40.74	46.97	Average	54	Pass
NVNT	ac40	5670	51.44	51.35	57.42	Peak	68.2	Pass
NVNT	ac40	5670	41.79	41.32	47.58	Average	54	Pass
NVNT	ac40	5670	48.19	48.85	54.55	Peak	68.2	Pass
NVNT	ac40	5670	41.04	40.87	46.98	Average	54	Pass
NVNT	ax20	5500	50.09	49.75	55.94	Peak	68.2	Pass
NVNT	ax20	5500	41.64	41.07	47.38	Average	54	Pass
NVNT	ax20	5500	54.23	55.44	60.88	Peak	68.2	Pass
NVNT	ax20	5500	43.05	42.63	48.86	Average	54	Pass
NVNT	ax20	5500	53.96	54.97	60.50	Peak	68.2	Pass
NVNT	ax20	5500	42.78	41.9	48.37	Average	54	Pass
NVNT	ax20	5700	56.2	55.5	61.88	Peak	68.2	Pass
NVNT	ax20	5700	45.48	44.52	51.03	Average	54	Pass
NVNT	ax20	5700	59.71	60.76	66.27	Peak	68.2	Pass
NVNT	ax20	5700	45.74	46.16	51.97	Average	54	Pass
NVNT	ax20	5700	49.99	51.5	56.80	Peak	68.2	Pass
NVNT	ax20	5700	41.91	41.57	47.76	Average	54	Pass
NVNT	ax40	5510	49.46	48.73	55.12	Peak	68.2	Pass
NVNT	ax40	5510	41.06	41.32	47.21	Average	54	Pass
NVNT	ax40	5510	58.61	55.8	63.34	Peak	68.2	Pass
NVNT	ax40	5510	43.29	43.65	49.49	Average	54	Pass
NVNT	ax40	5510	56.4	53.3	61.01	Peak	68.2	Pass
NVNT	ax40	5510	43.27	43.2	49.26	Average	54	Pass
NVNT	ax40	5670	48.36	49.2	54.81	Peak	68.2	Pass
NVNT	ax40	5670	40.99	40.9	46.97	Average	54	Pass
NVNT	ax40	5670	52.33	50.55	57.51	Peak	68.2	Pass
NVNT	ax40	5670	41.82	41.48	47.67	Average	54	Pass
NVNT	ax40	5670	48.44	47.7	54.10	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	41.14	41.11	47.15	Average	54	Pass
------	------	------	-------	-------	-------	---------	----	------



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5500	0	0	25	Pass
NVNT	a	5580	Ant1	5580	0	0	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant1	5510	0	0	25	Pass
NVNT	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
NVNT	ac20	5500	Ant1	5500	0	0	25	Pass
NVNT	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ax20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant1	5580	0	0	25	Pass
NVNT	ax20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant1	5510	0	0	25	Pass
NVNT	ax40	5550	Ant1	5550	0	0	25	Pass
NVNT	ax40	5670	Ant1	5670	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5500MHz Ant1

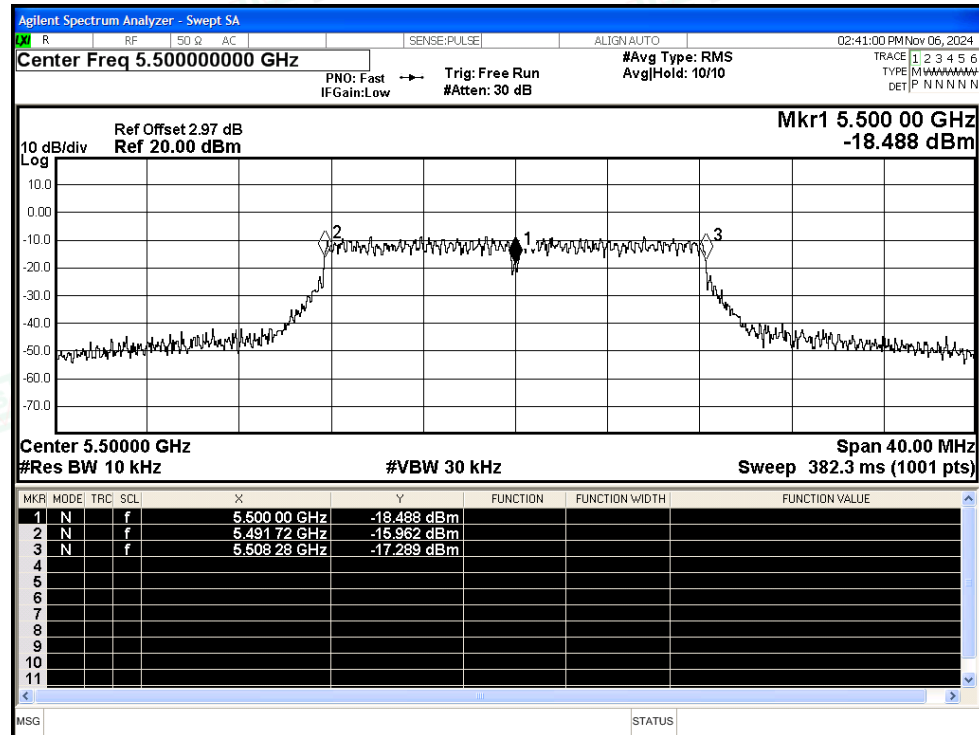

Freq. Stability NVNT a 5580MHz Ant1

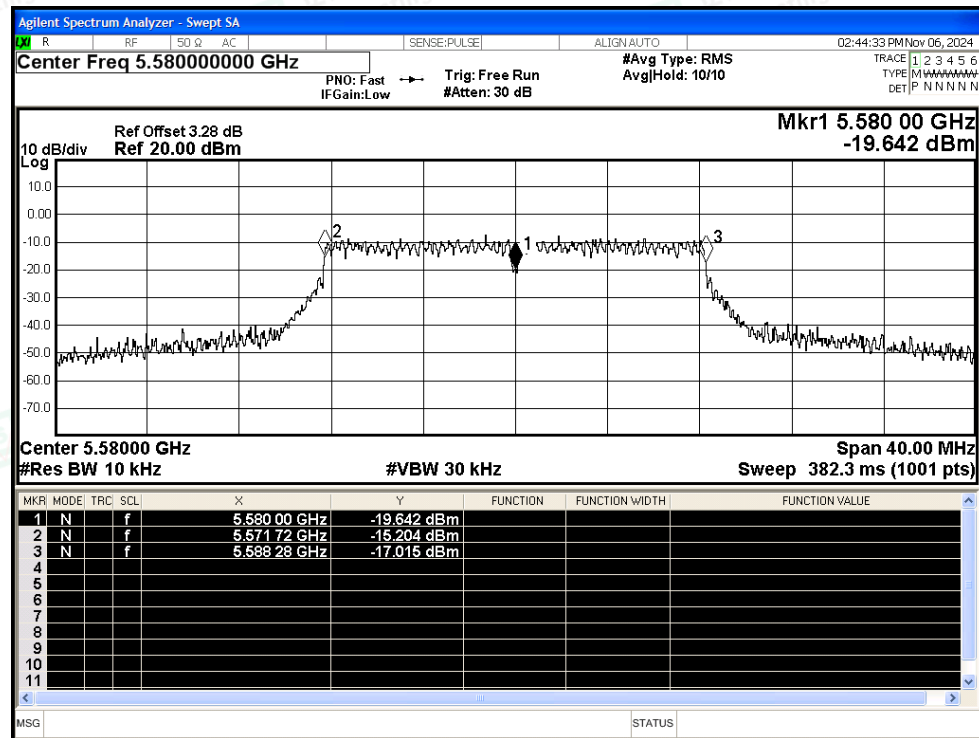

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant1

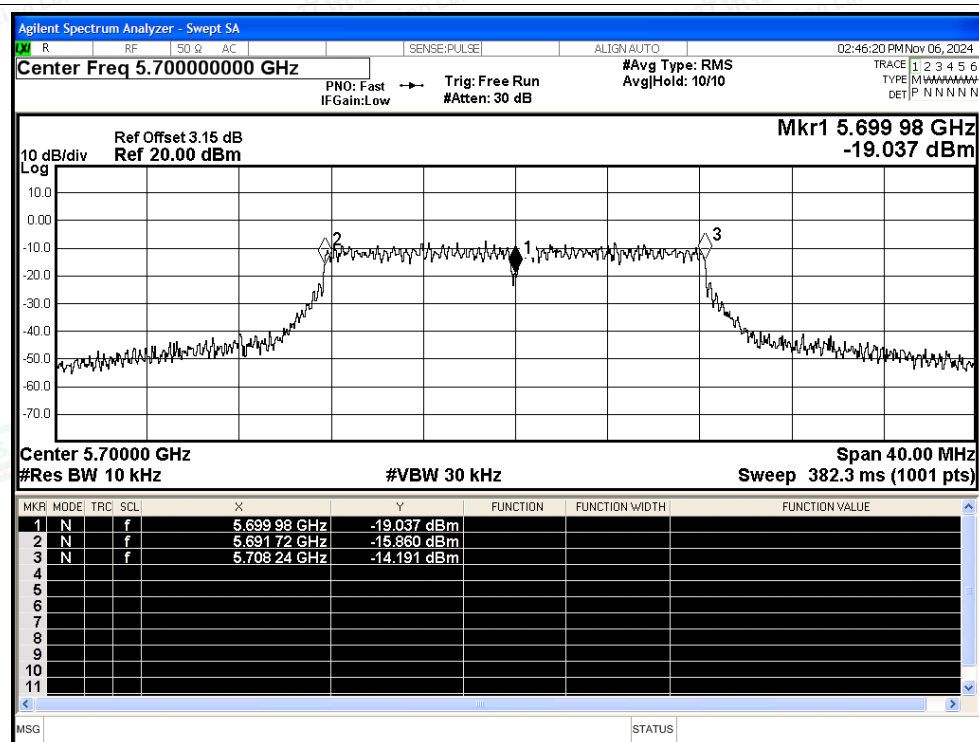


Freq. Stability NVNT n20 5500MHz Ant1

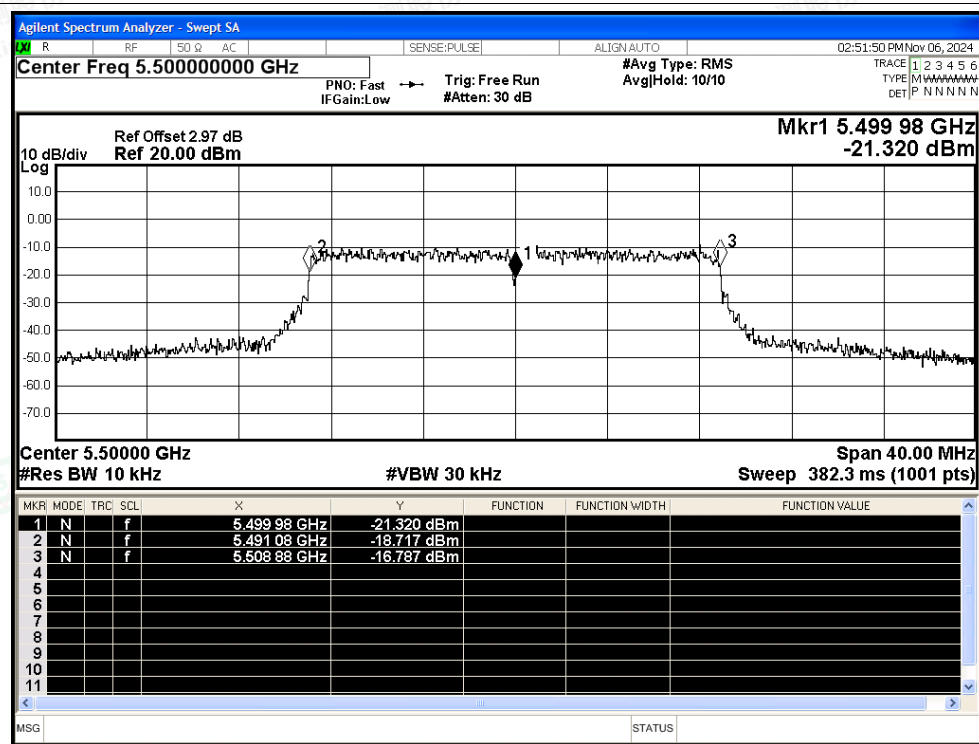




Freq. Stability NVNT n20 5580MHz Ant1

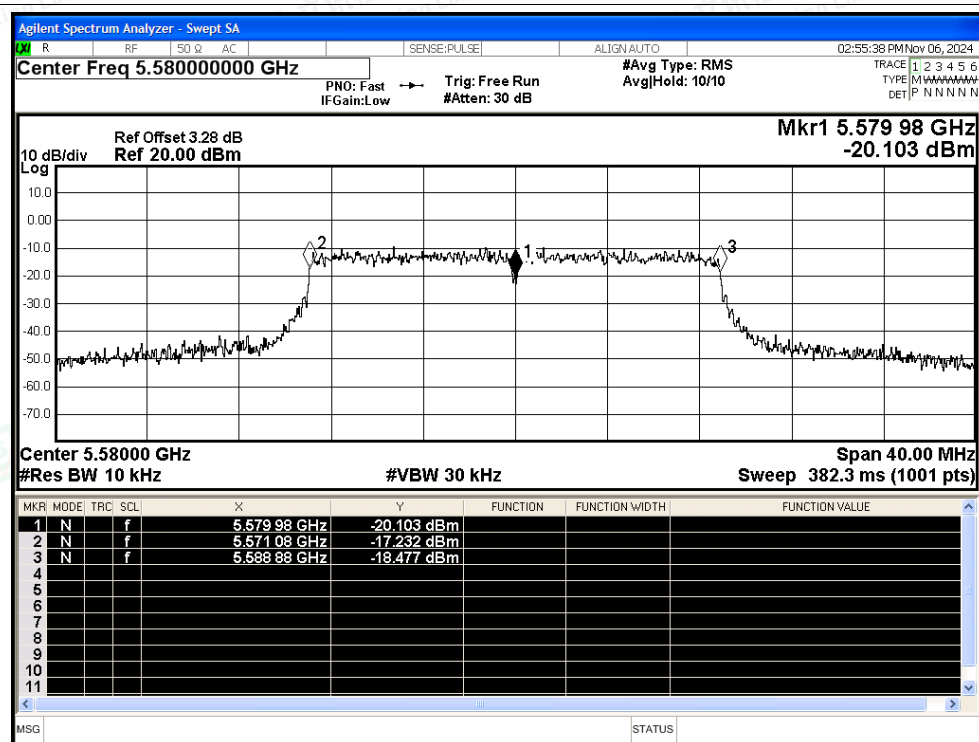

Freq. Stability NVNT n20 5700MHz Ant1

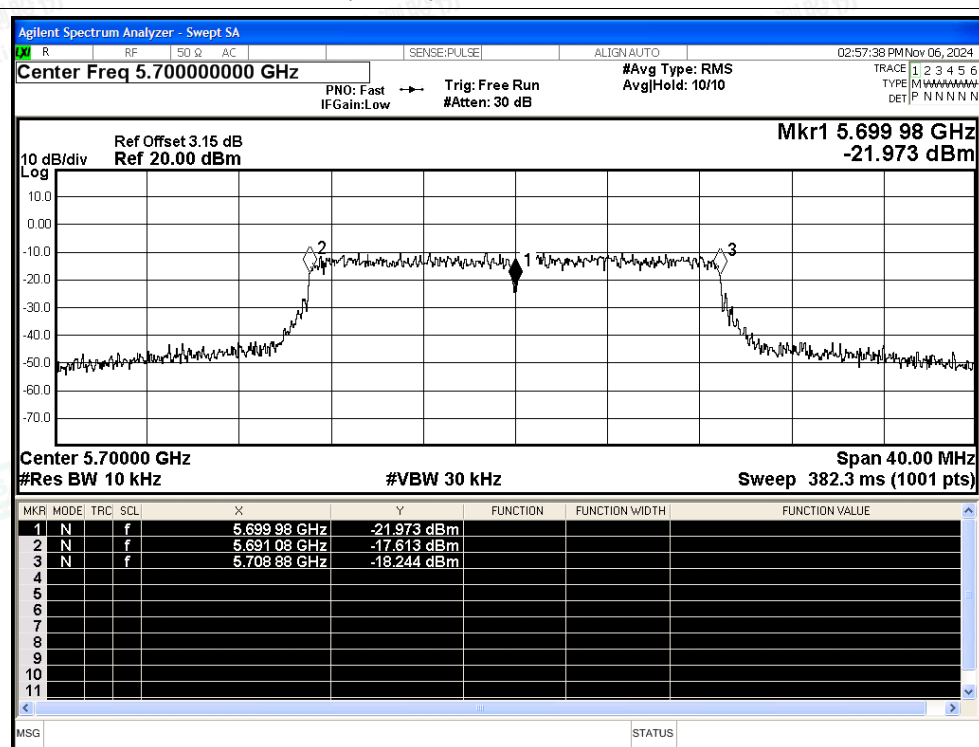

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant1

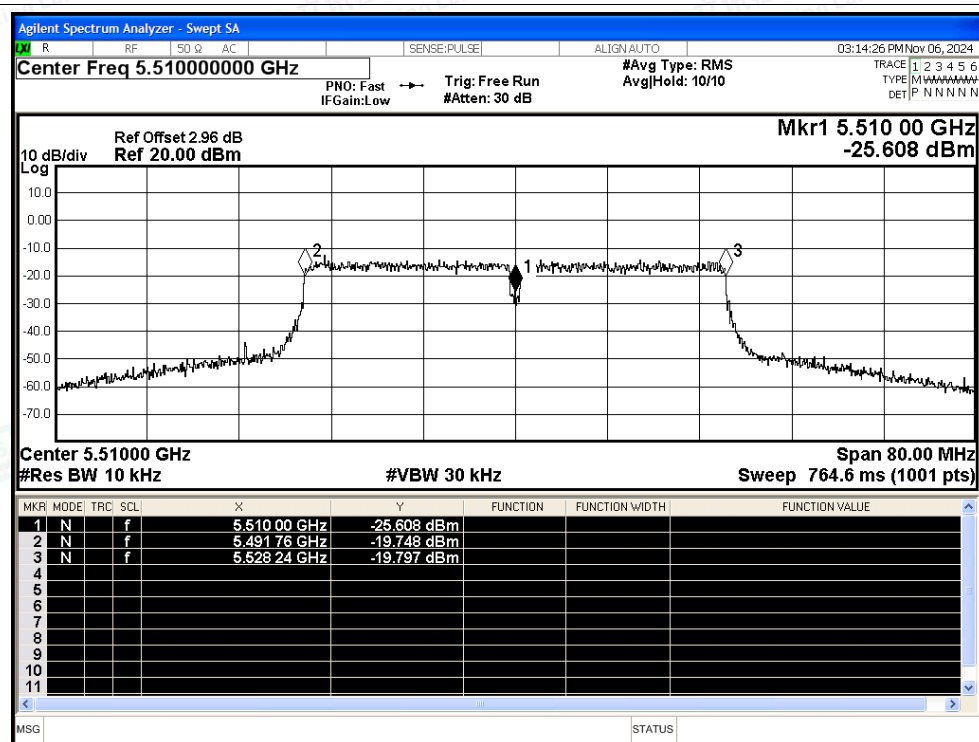

Freq. Stability NVNT n40 5550MHz Ant1

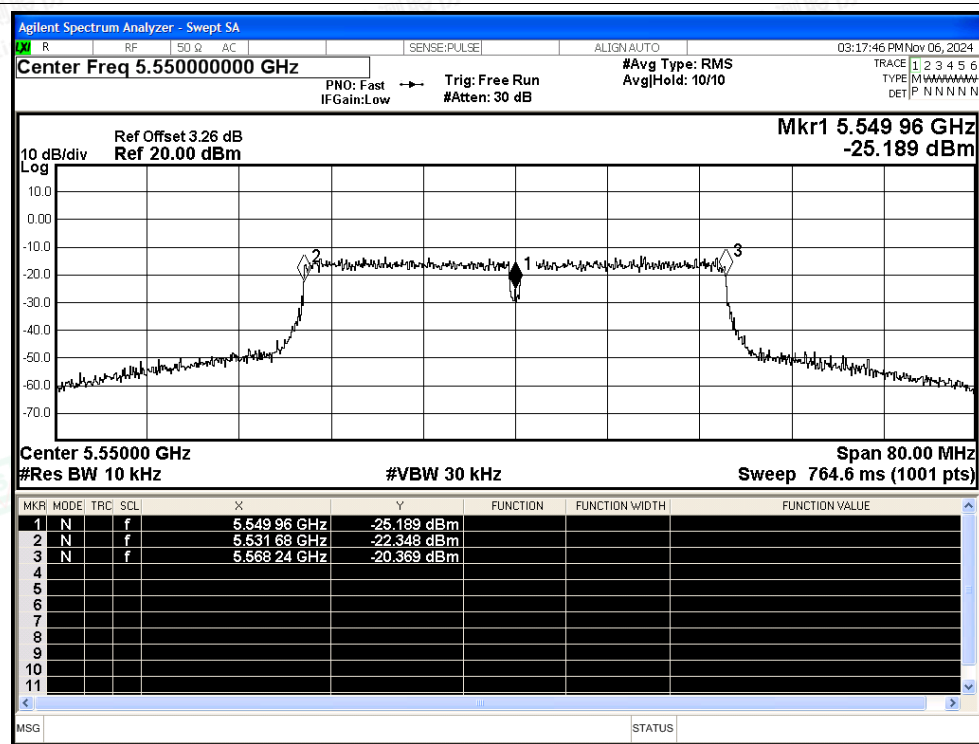

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant1

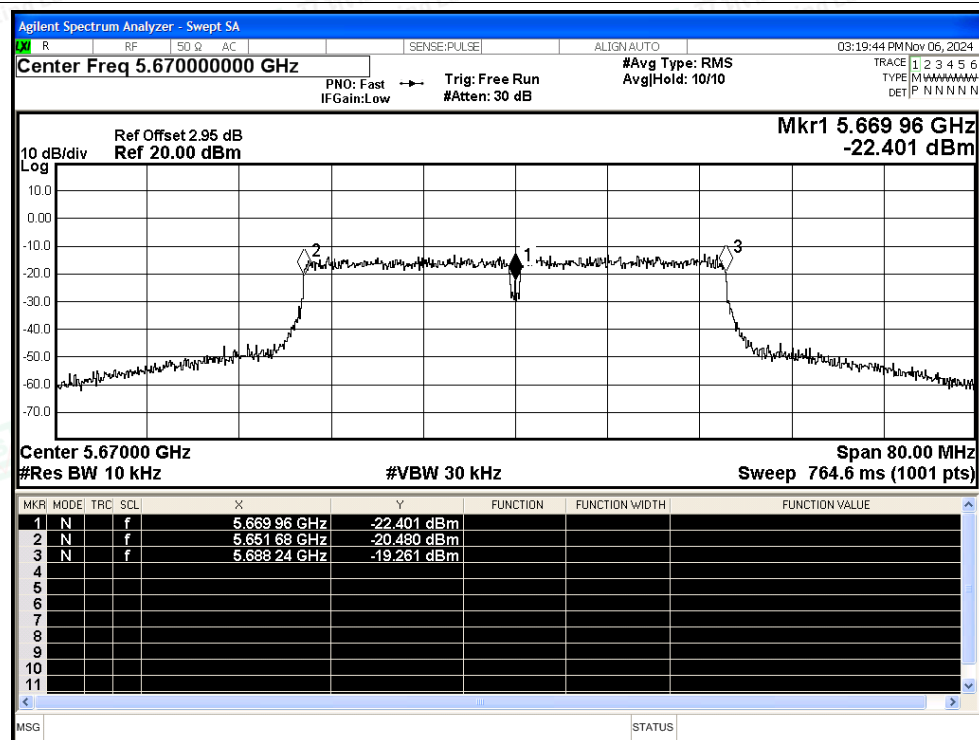

Freq. Stability NVNT ac20 5500MHz Ant1

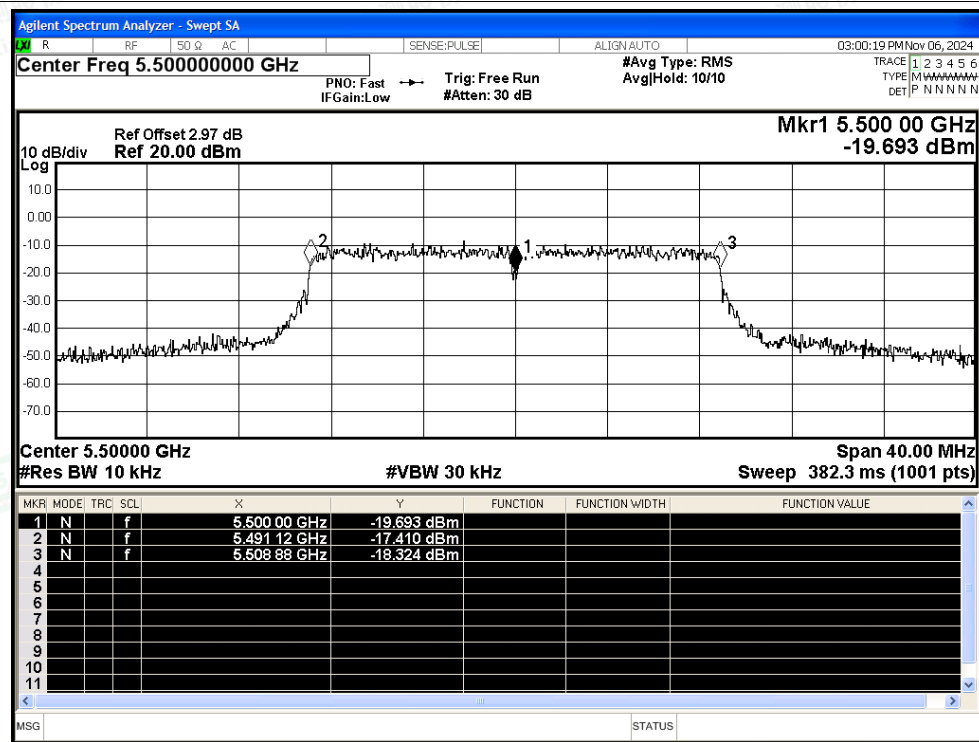

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant1

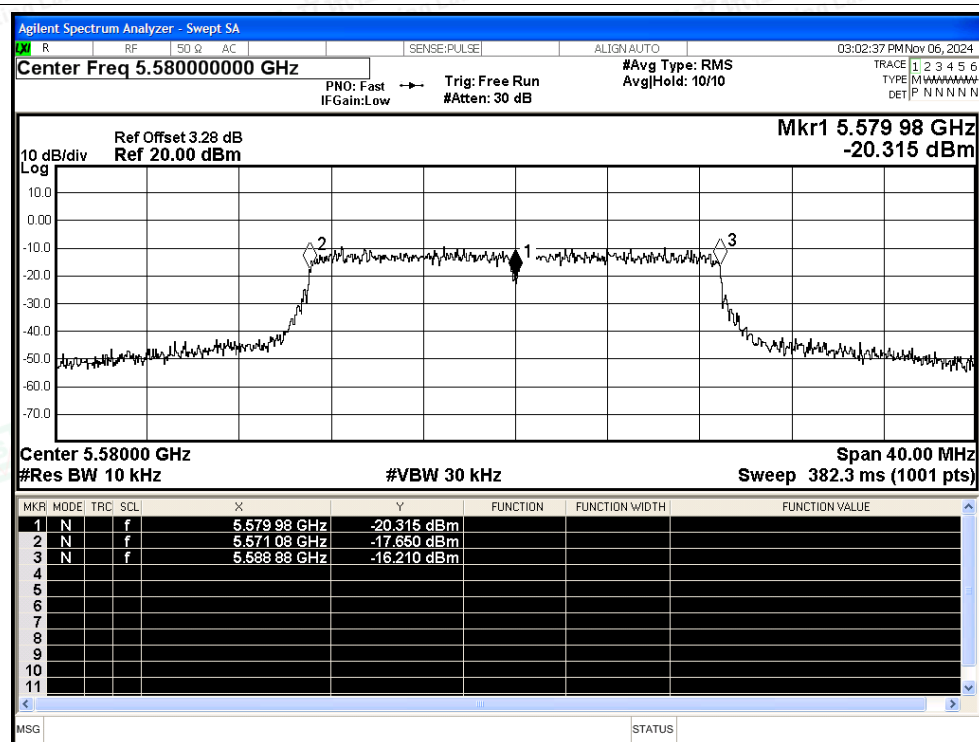

Freq. Stability NVNT ac20 5700MHz Ant1

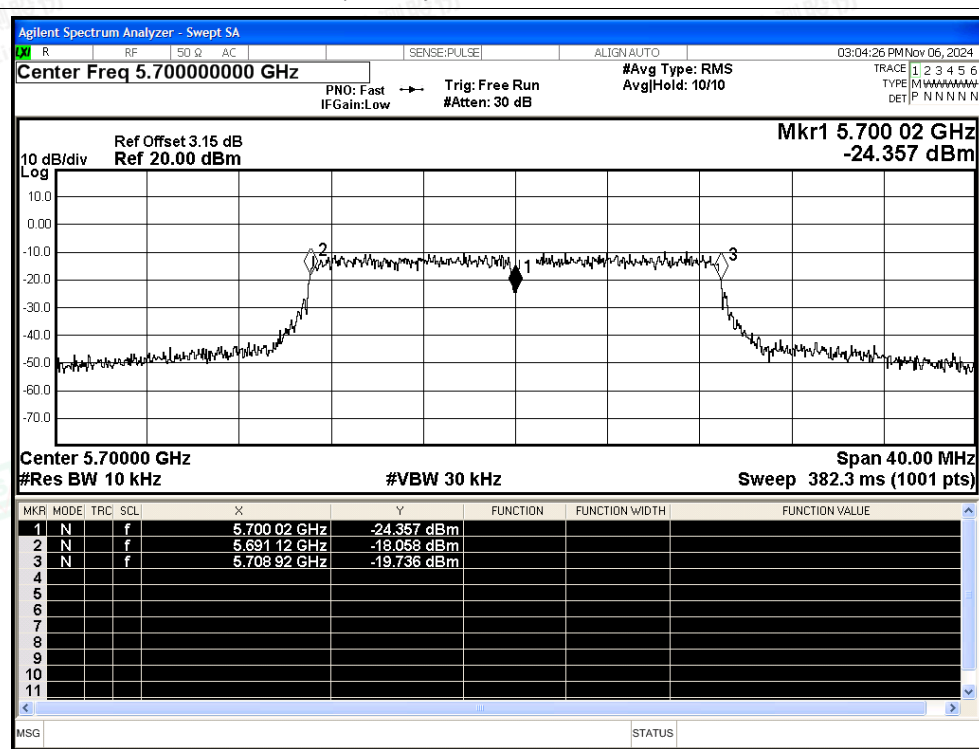

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant1

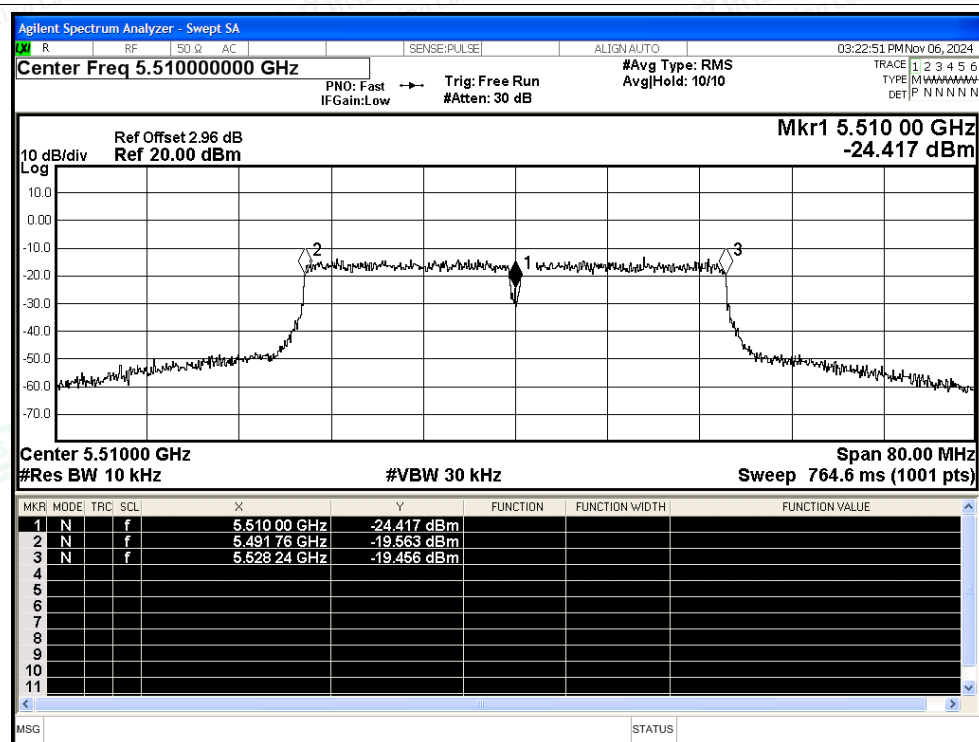

Freq. Stability NVNT ac40 5550MHz Ant1

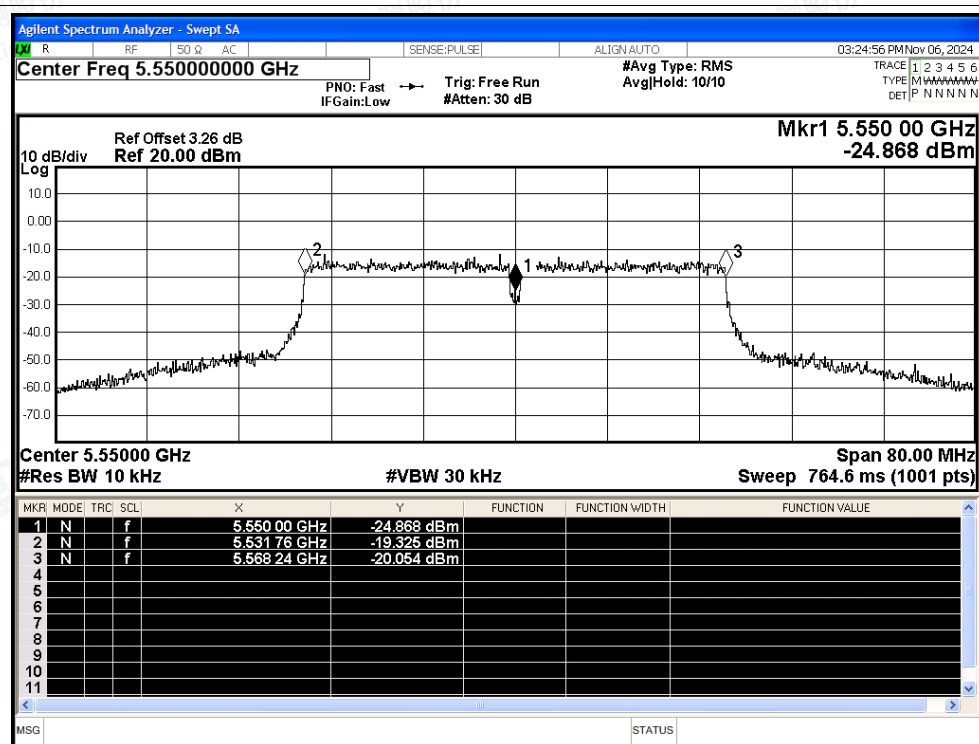

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant1

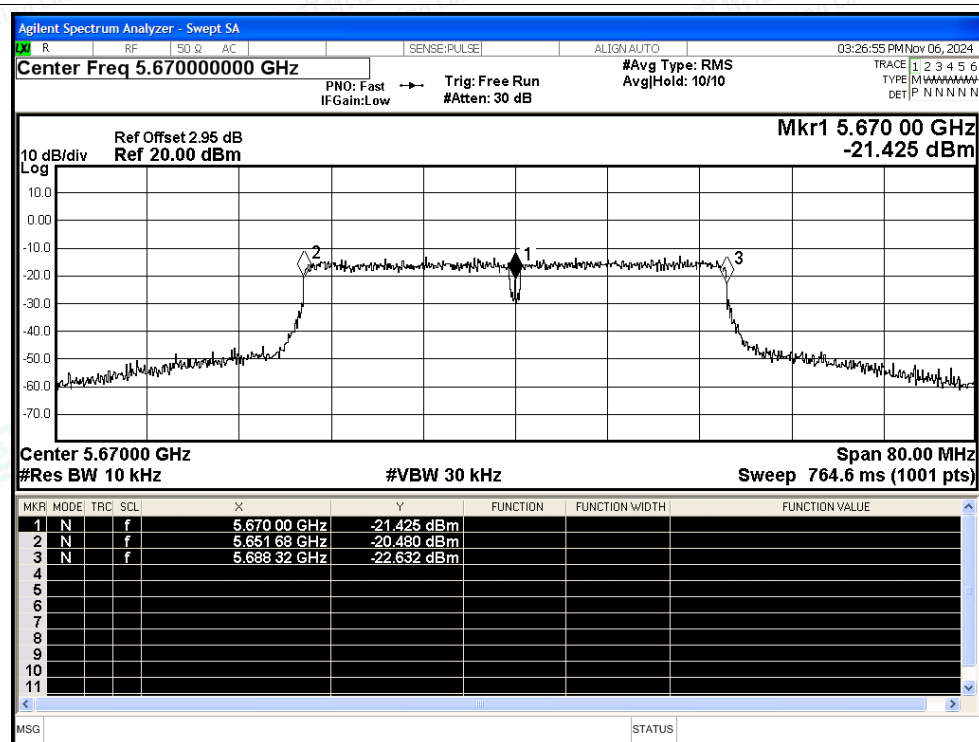

Freq. Stability NVNT ax20 5500MHz Ant1

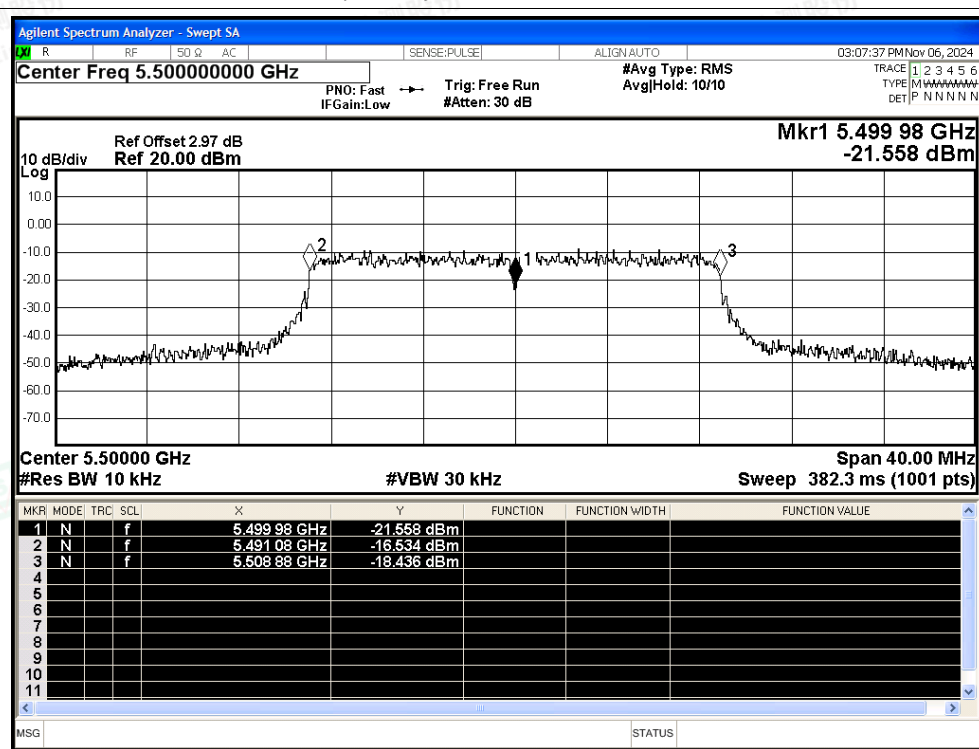

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5580MHz Ant1

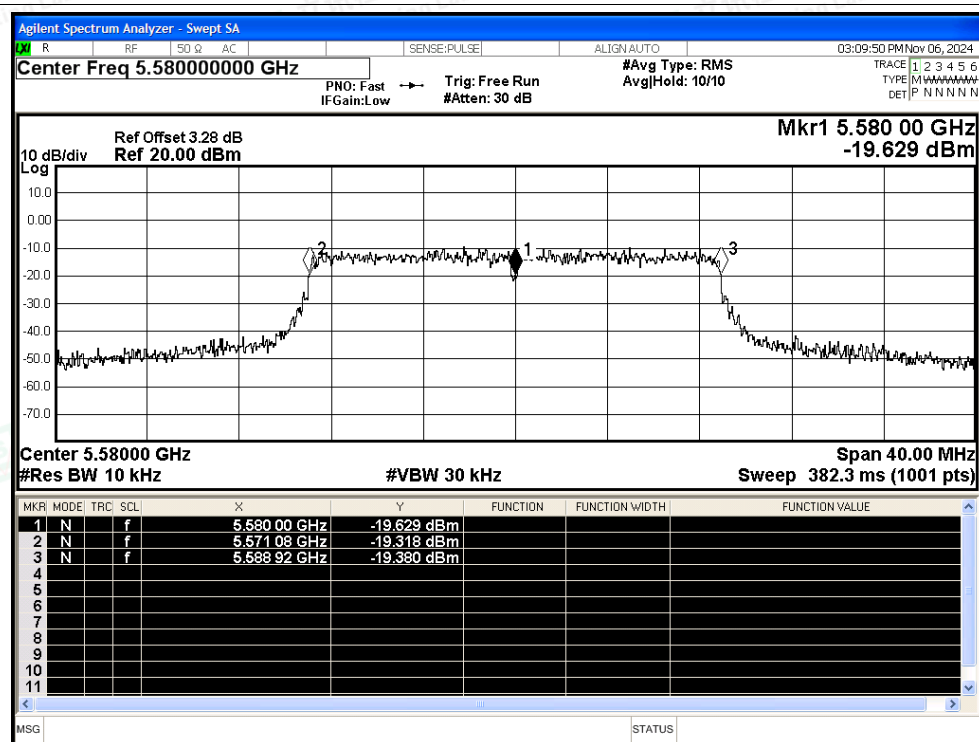

Freq. Stability NVNT ax20 5700MHz Ant1

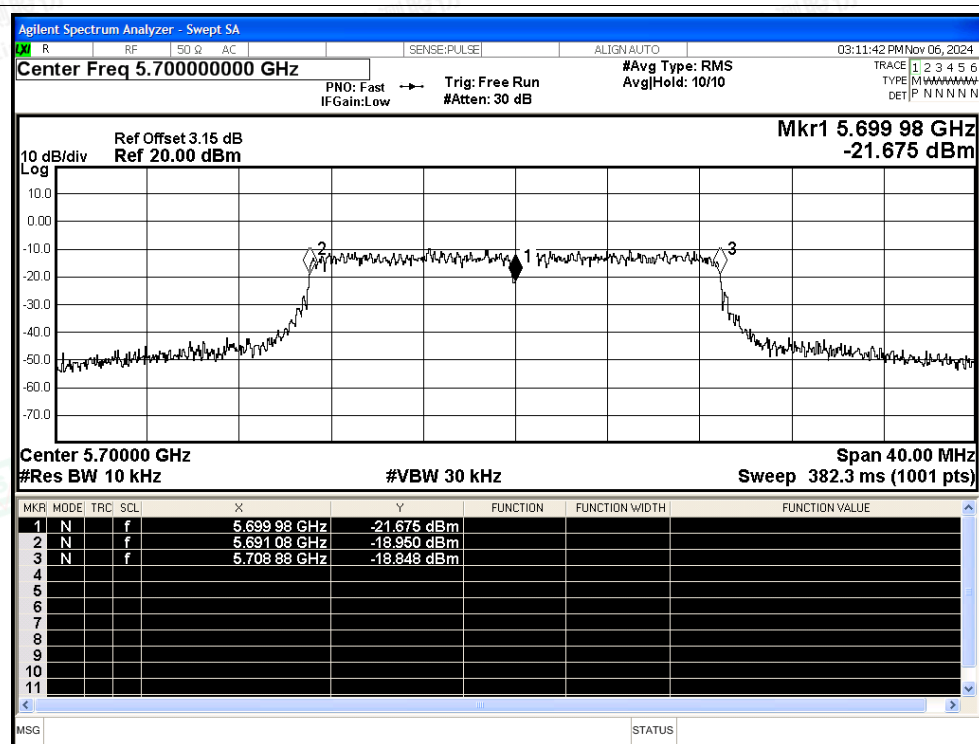

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Freq. Stability NVNT ax40 5510MHz Ant1

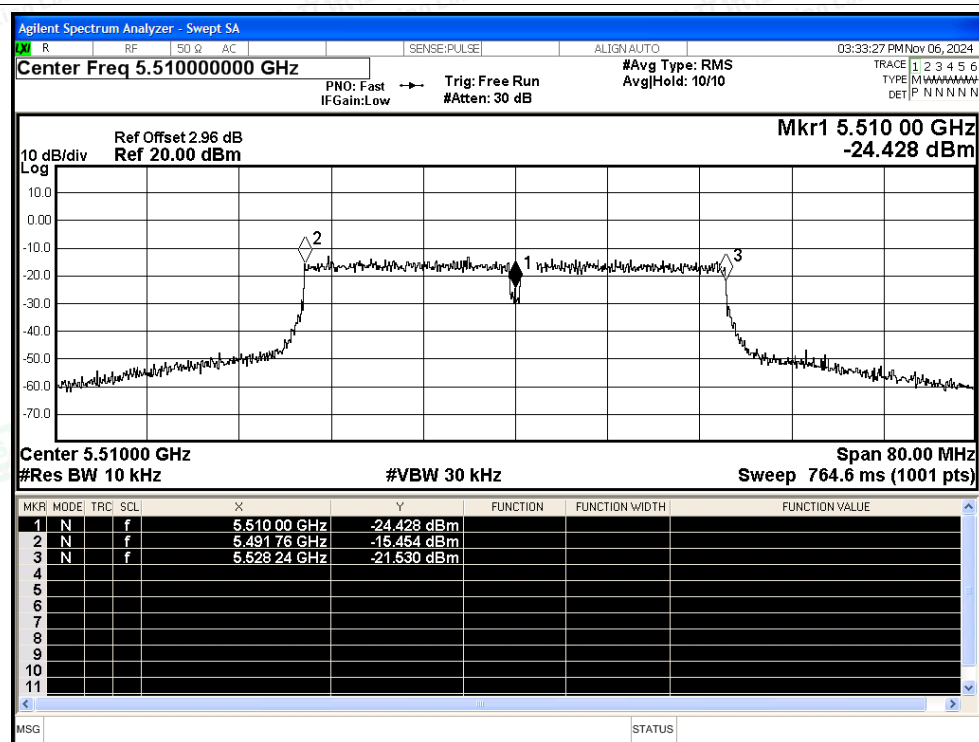

Freq. Stability NVNT ax40 5550MHz Ant1

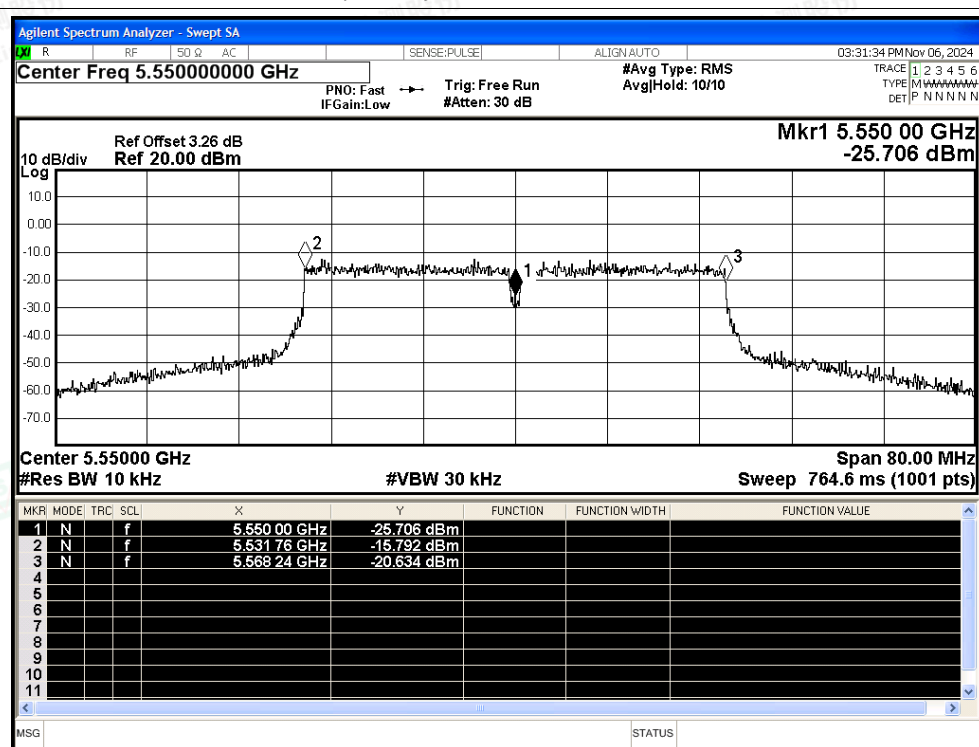

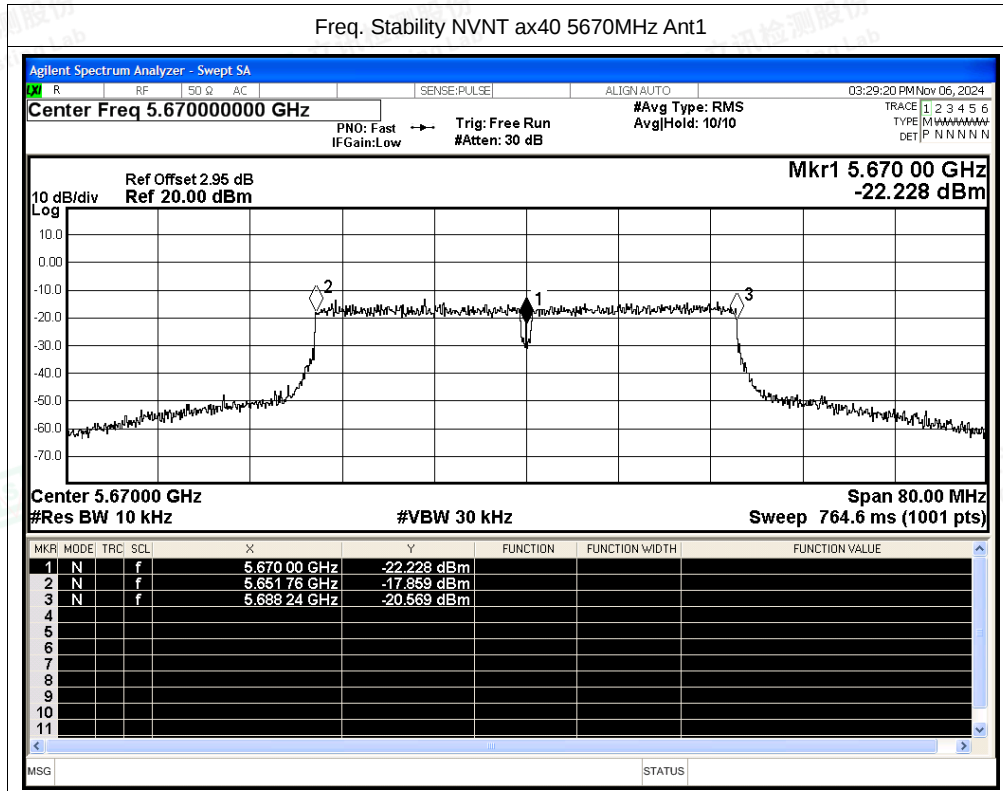




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant2	5700	0	0	25	Pass
NVNT	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant2	5700	0	0	25	Pass
NVNT	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant2	5550	0	0	25	Pass
NVNT	n40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant2	5550	0	0	25	Pass
NVNT	ac40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
NVNT	ax20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant2	5510	0	0	25	Pass
NVNT	ax40	5550	Ant2	5550	0	0	25	Pass
NVNT	ax40	5670	Ant2	5669.96	-40000	-7.05	25	Pass






Test Graphs

Freq. Stability NVNT a 5500MHz Ant2

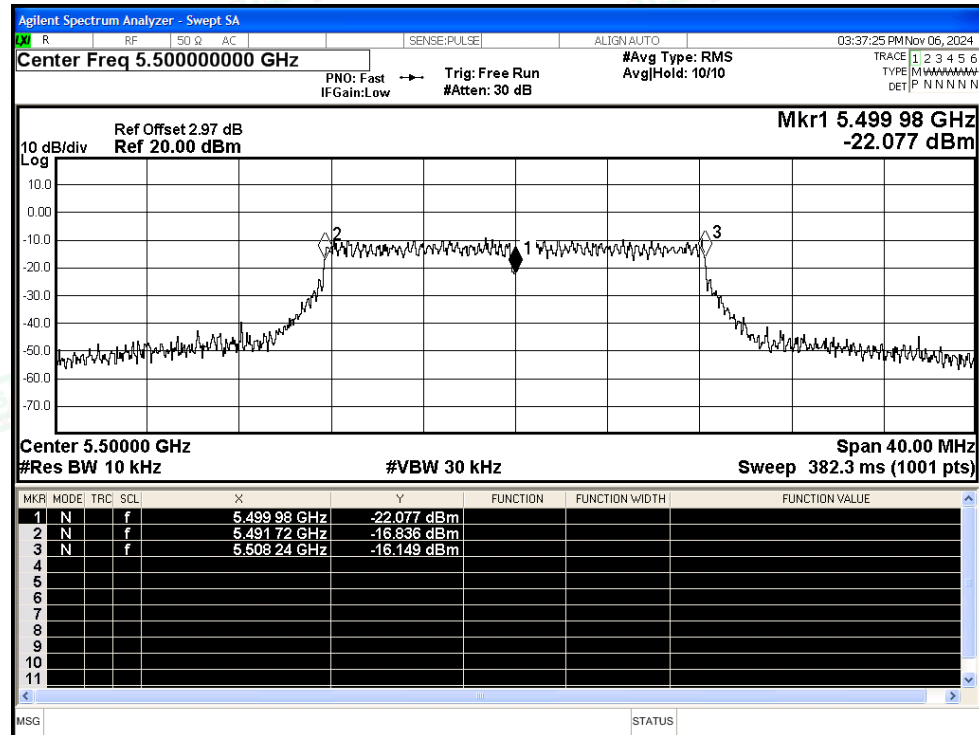


Freq. Stability NVNT a 5580MHz Ant2

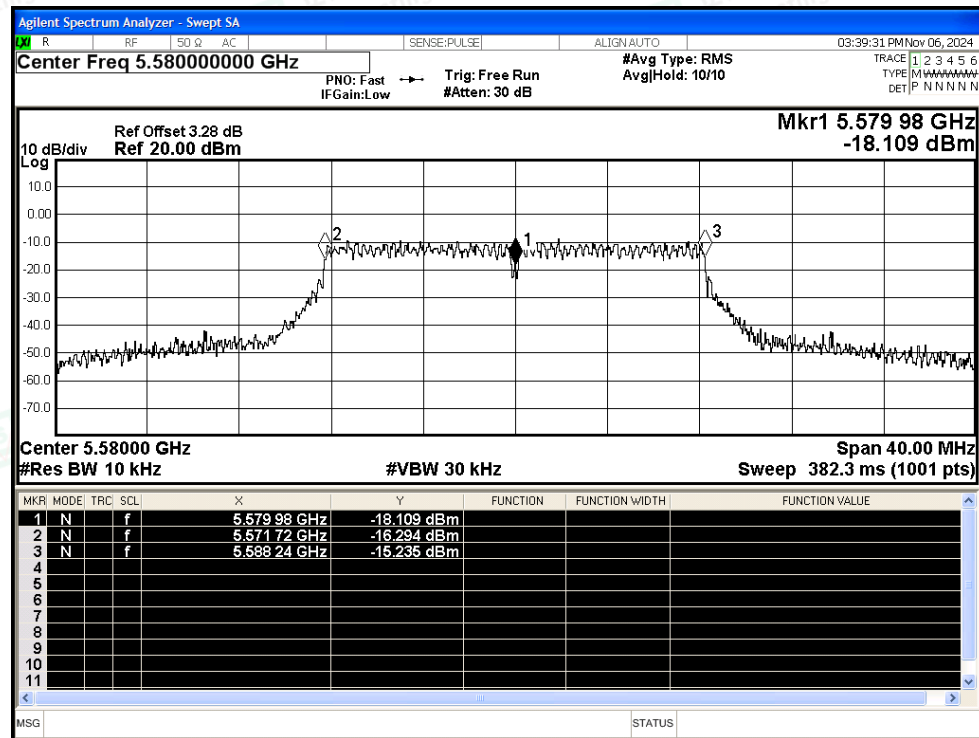




Freq. Stability NVNT a 5700MHz Ant2

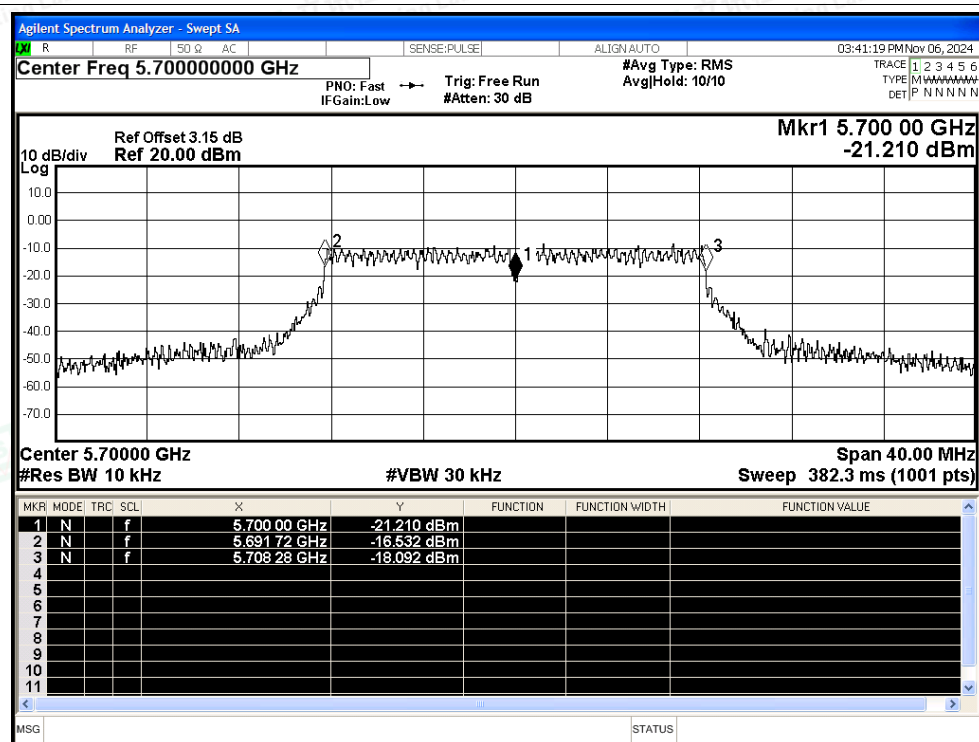


Freq. Stability NVNT n20 5500MHz Ant2

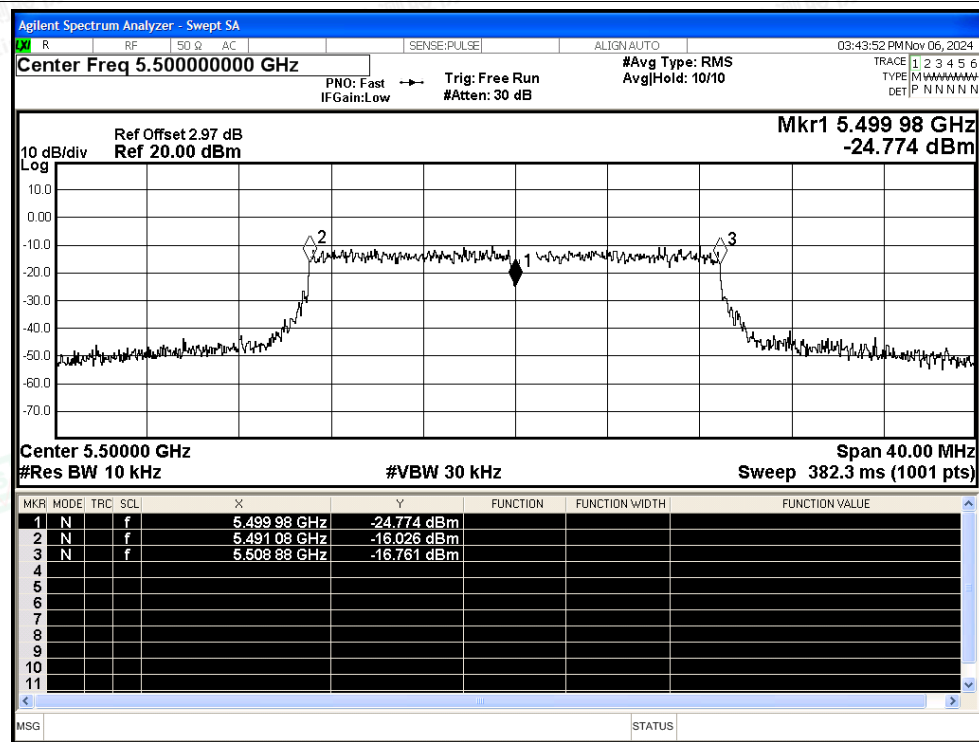




Freq. Stability NVNT n20 5580MHz Ant2

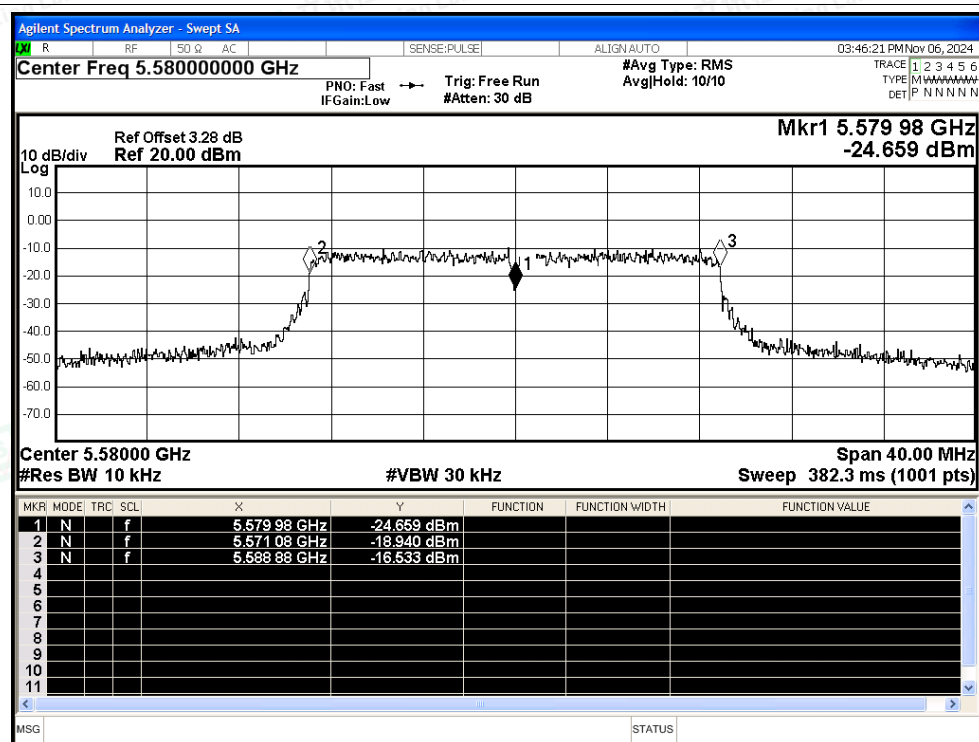

Freq. Stability NVNT n20 5700MHz Ant2

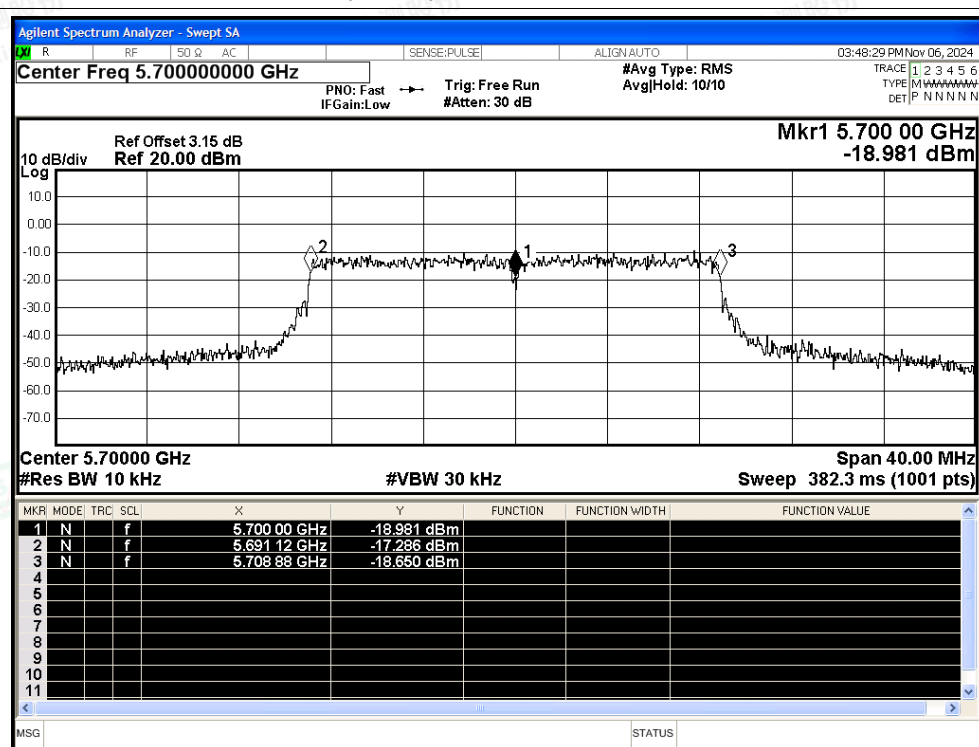

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant2

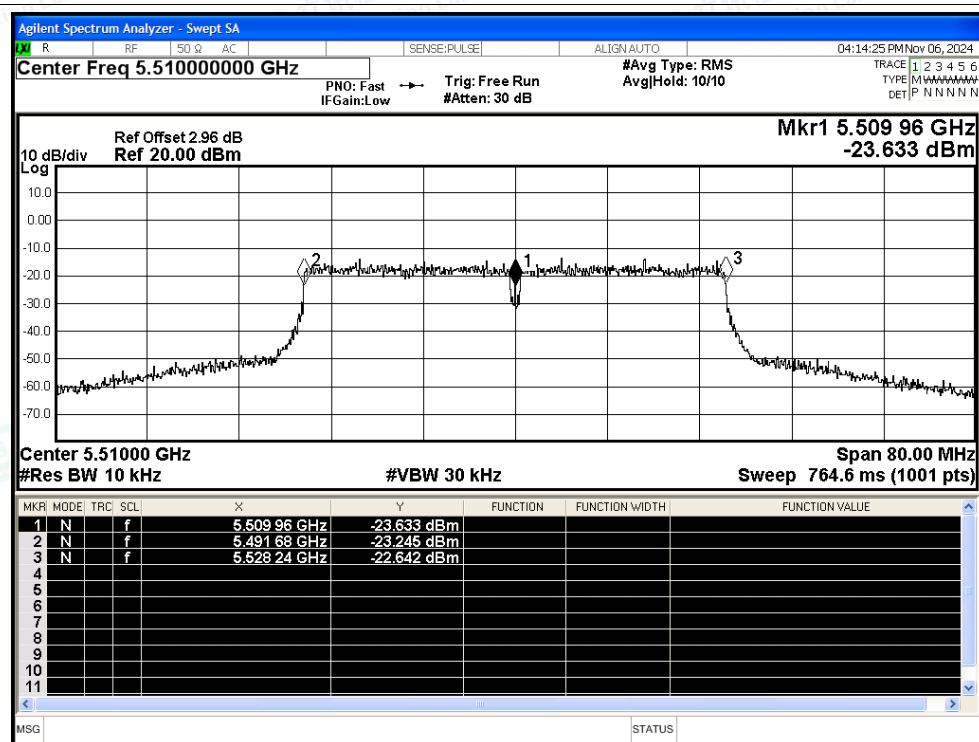


Freq. Stability NVNT n40 5550MHz Ant2

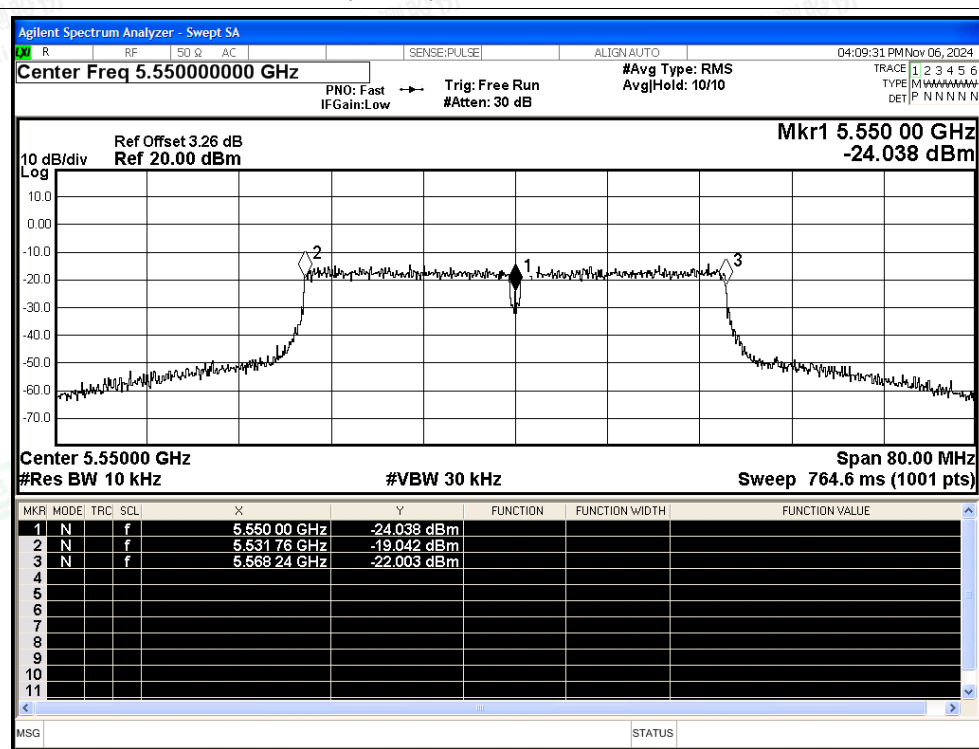




Freq. Stability NVNT n40 5670MHz Ant2

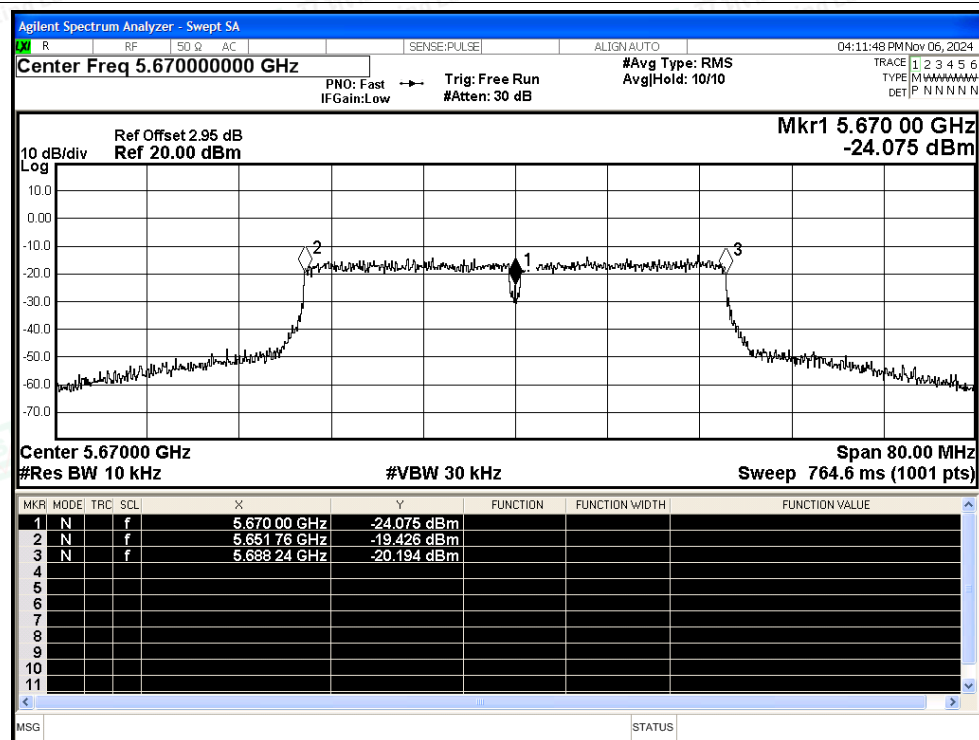

Freq. Stability NVNT ac20 5500MHz Ant2

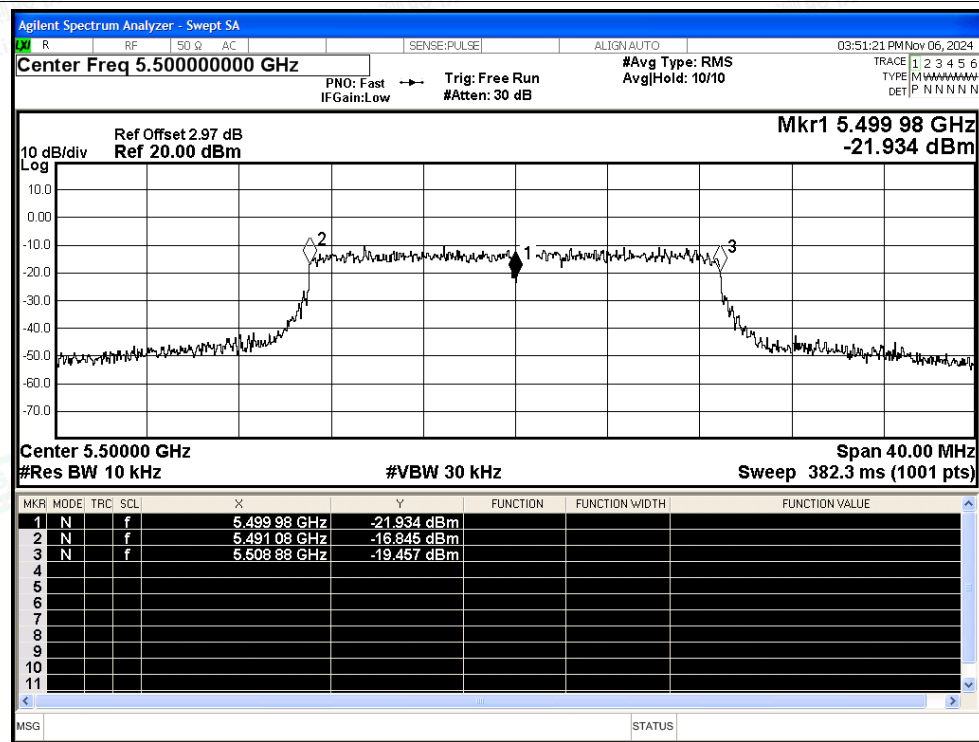

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant2

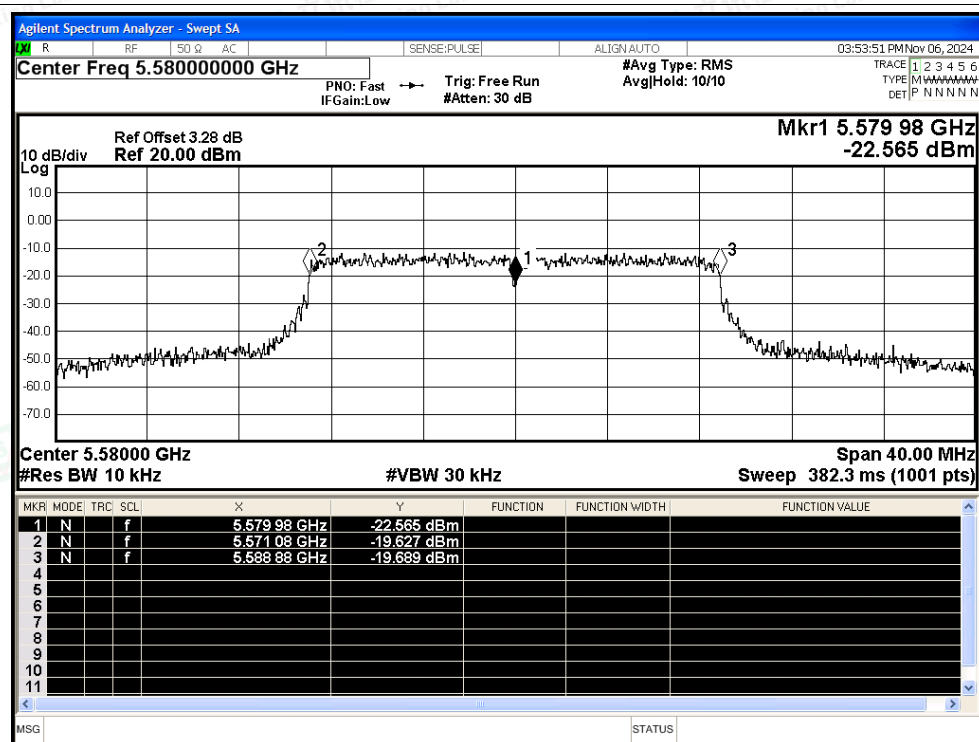


Freq. Stability NVNT ac20 5700MHz Ant2

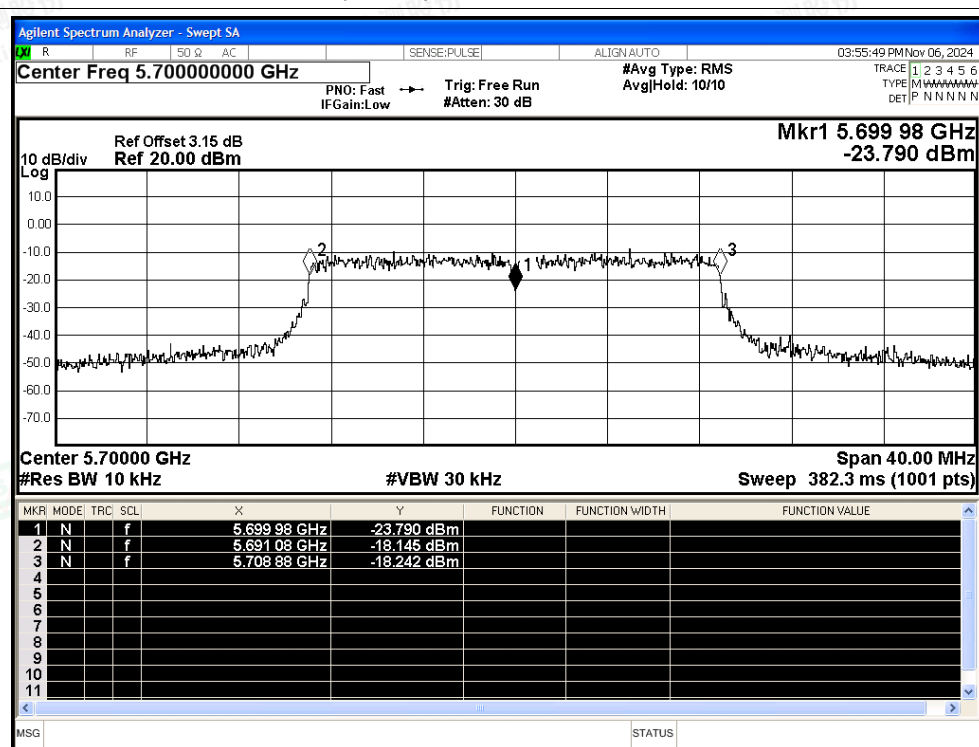




Freq. Stability NVNT ac40 5510MHz Ant2

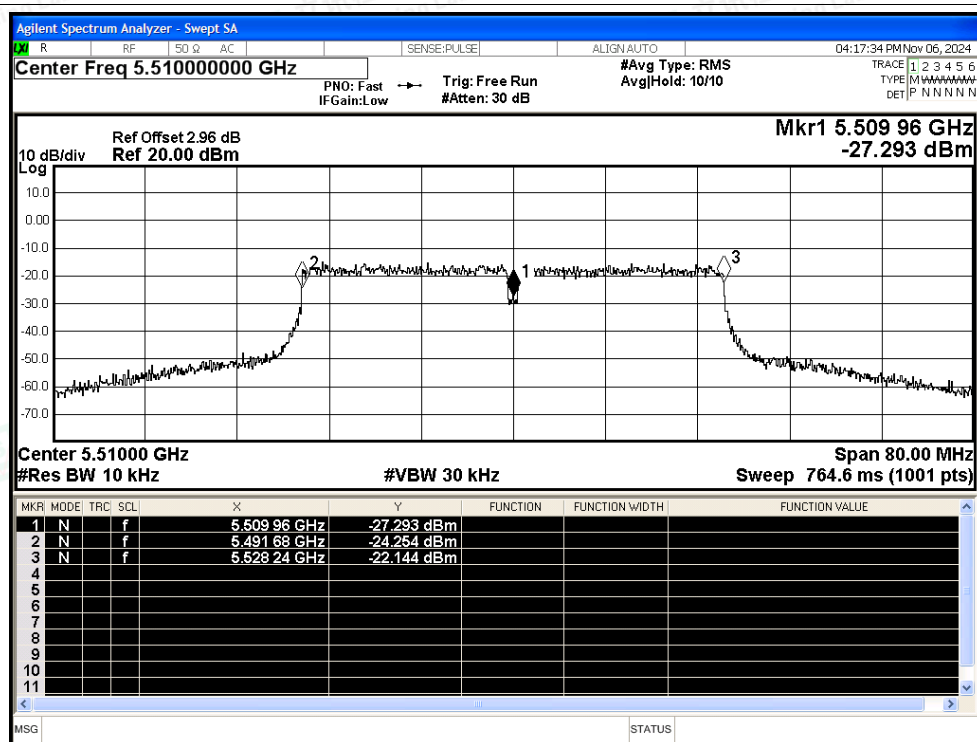

Freq. Stability NVNT ac40 5550MHz Ant2

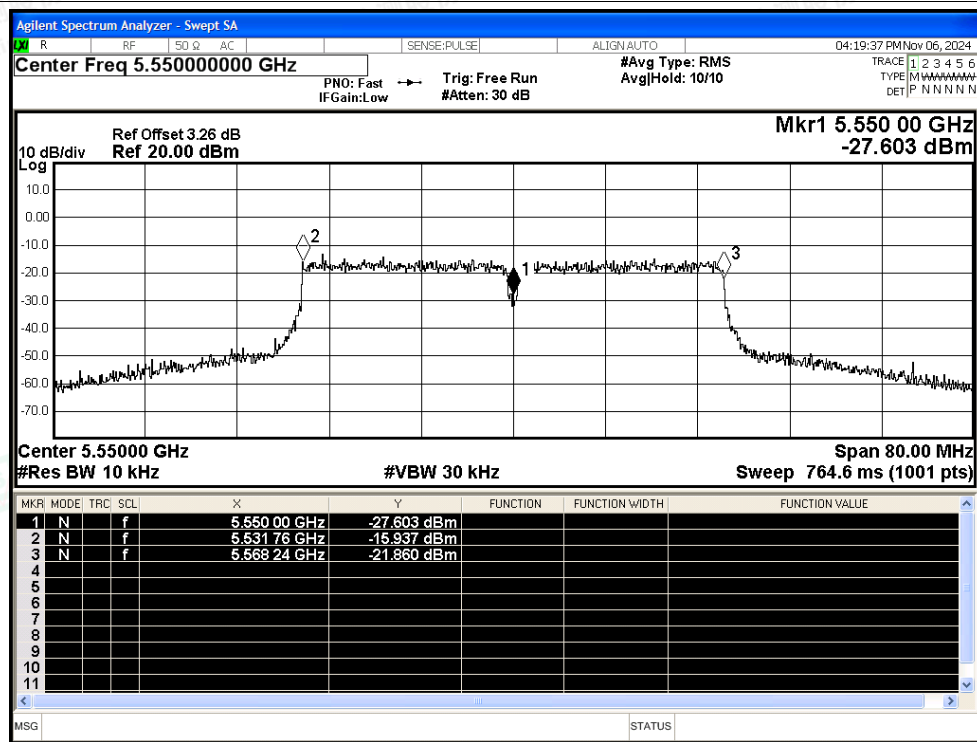

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant2

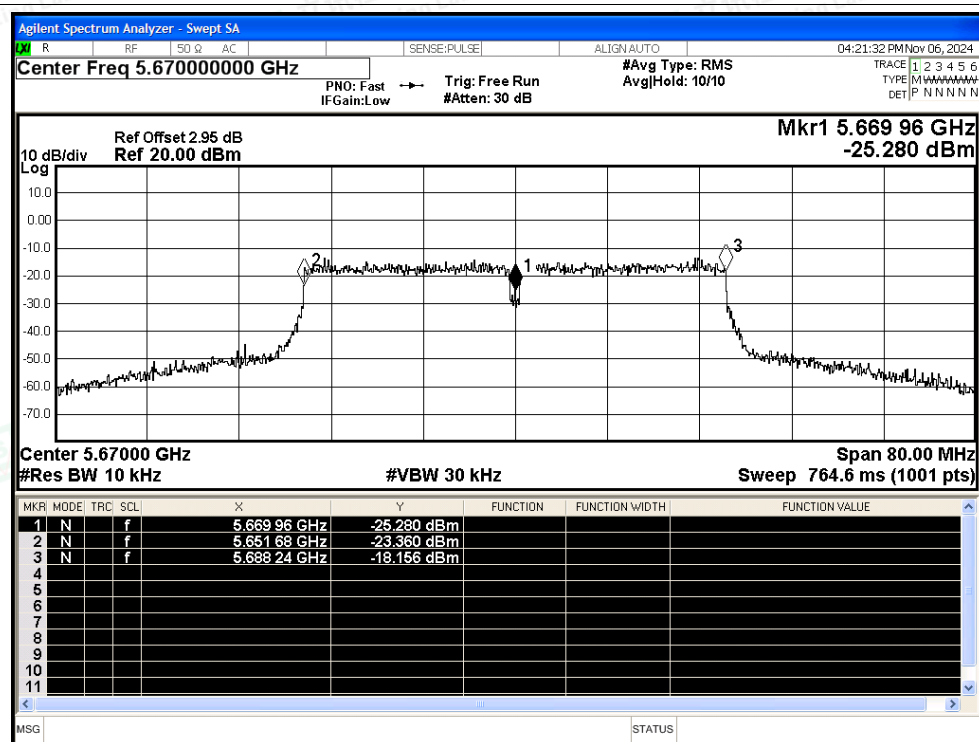


Freq. Stability NVNT ax20 5500MHz Ant2

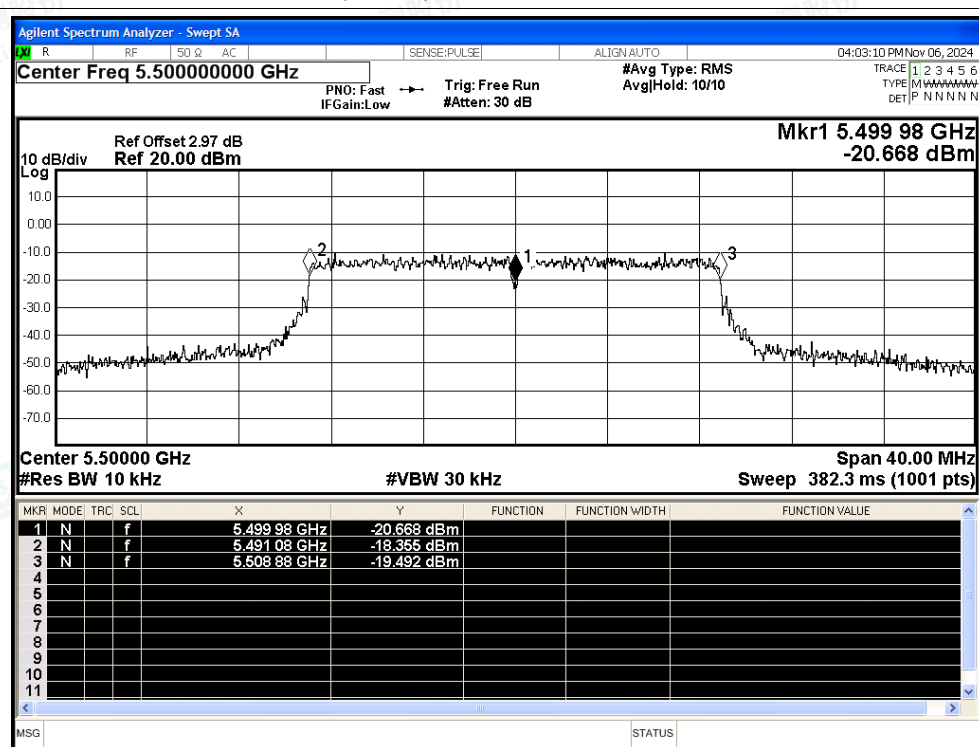




Freq. Stability NVNT ax20 5580MHz Ant2

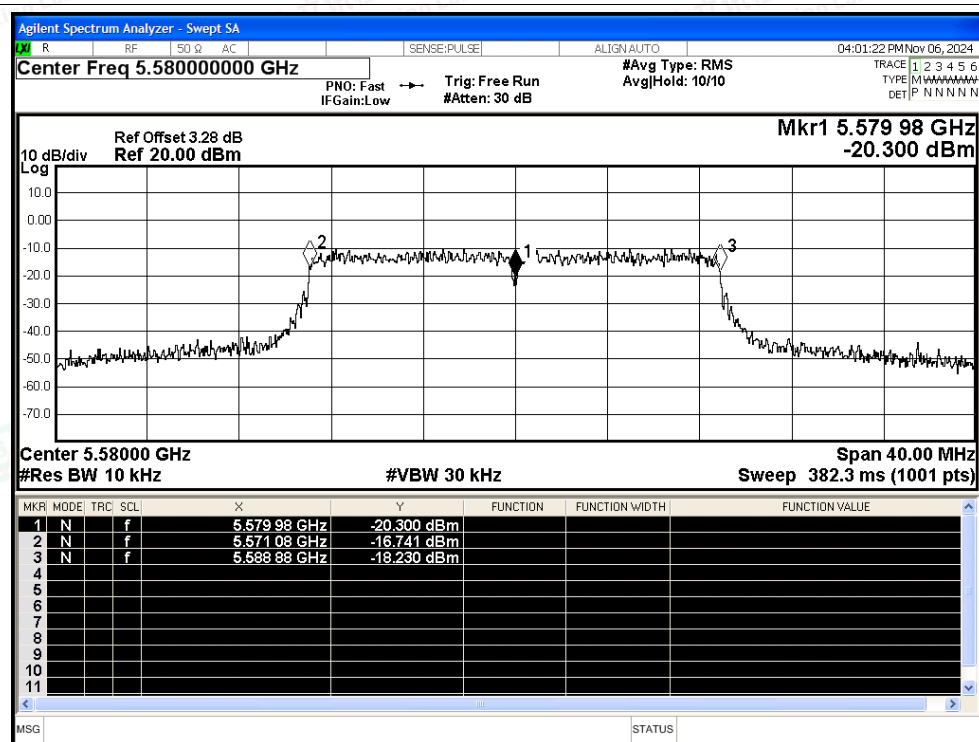

Freq. Stability NVNT ax20 5700MHz Ant2

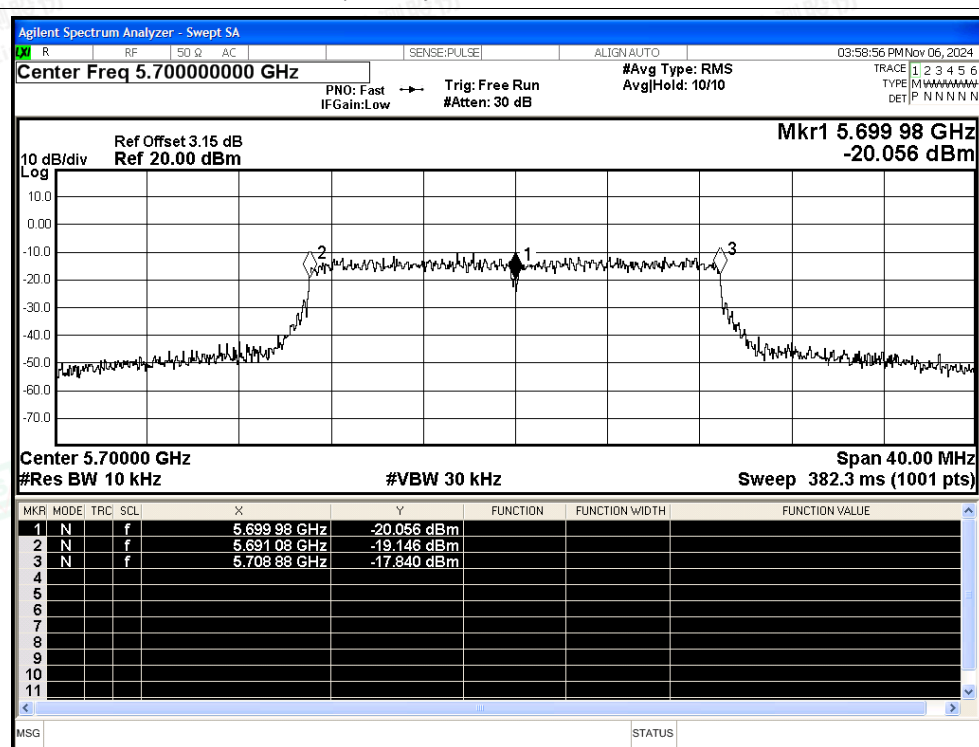

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5510MHz Ant2

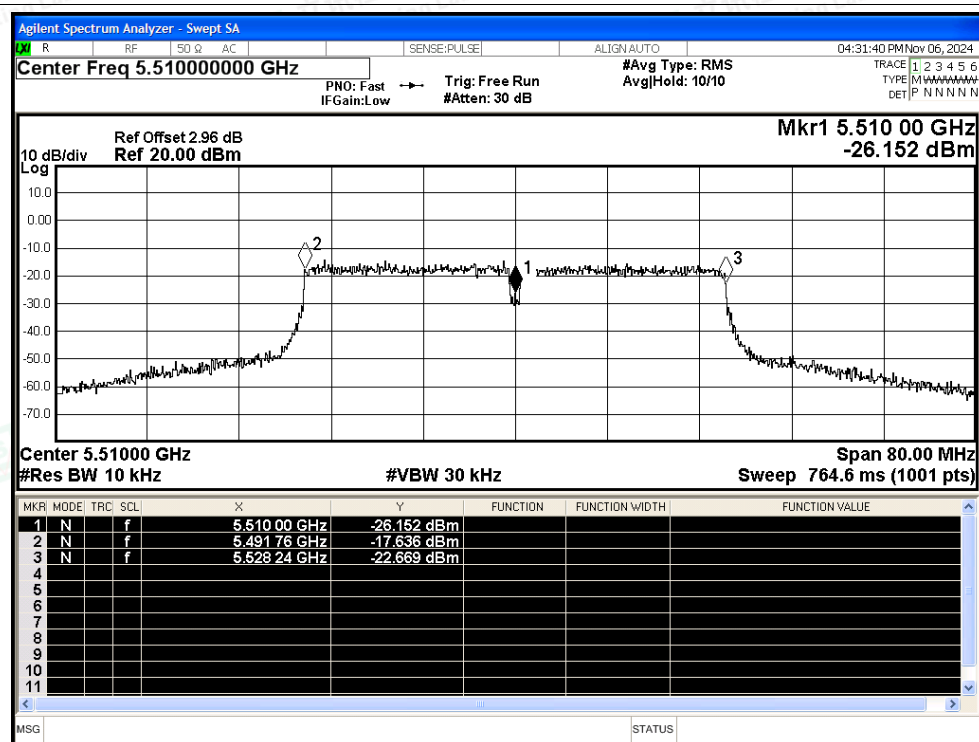

Freq. Stability NVNT ax40 5550MHz Ant2

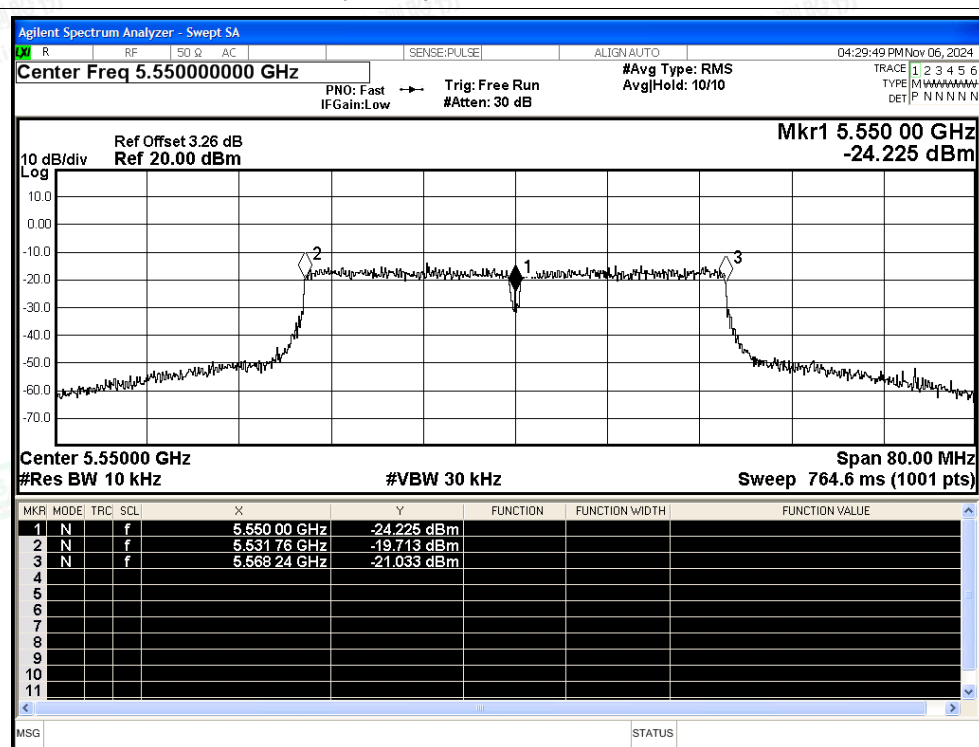


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

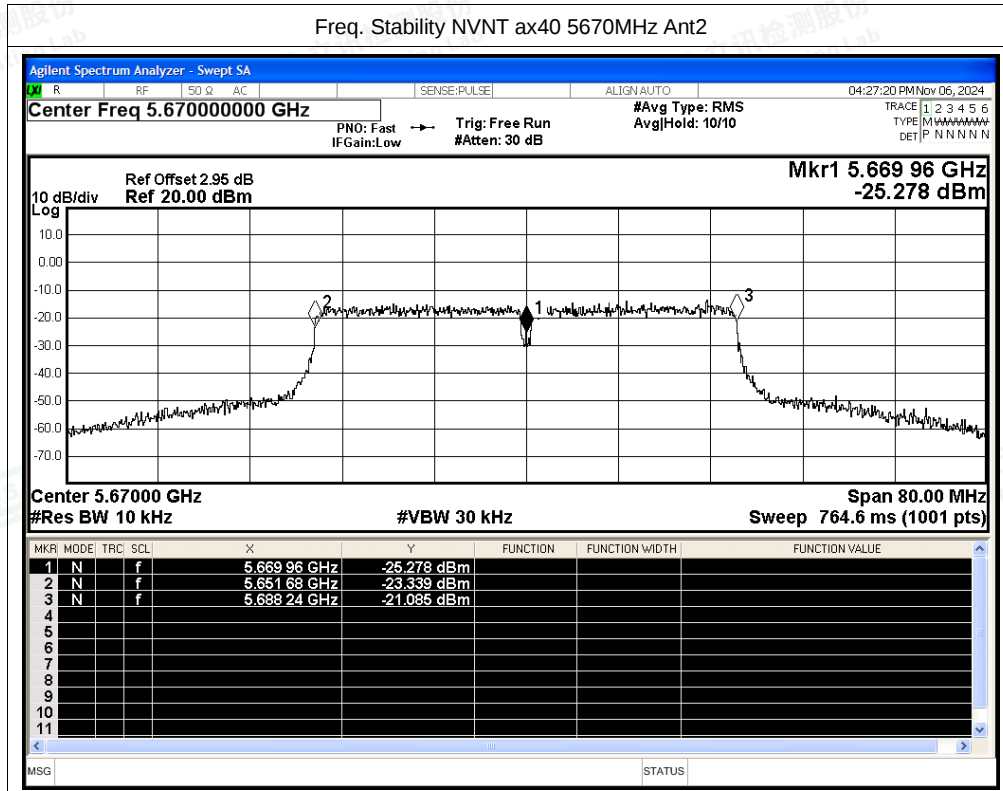



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant1	94.56	0.24	0.91
NVNT	a	5580	Ant1	94.56	0.24	0.91
NVNT	a	5700	Ant1	94.65	0.24	0.91
NVNT	n20	5500	Ant1	93.67	0.28	1.07
NVNT	n20	5580	Ant1	93.77	0.28	1.07
NVNT	n20	5700	Ant1	93.77	0.28	1.07
NVNT	n40	5510	Ant1	94.71	0.24	0.9
NVNT	n40	5550	Ant1	94.71	0.24	0.9
NVNT	n40	5670	Ant1	94.71	0.24	0.9
NVNT	ac20	5500	Ant1	93.72	0.28	1.06
NVNT	ac20	5580	Ant1	93.82	0.28	1.06
NVNT	ac20	5700	Ant1	93.72	0.28	1.06
NVNT	ac40	5510	Ant1	94.72	0.24	0.9
NVNT	ac40	5550	Ant1	94.81	0.23	0.9
NVNT	ac40	5670	Ant1	94.72	0.24	0.9
NVNT	ax20	5500	Ant1	93.72	0.28	1.06
NVNT	ax20	5580	Ant1	93.82	0.28	1.06
NVNT	ax20	5700	Ant1	93.72	0.28	1.06
NVNT	ax40	5510	Ant1	94.72	0.24	0.9
NVNT	ax40	5550	Ant1	94.72	0.24	0.9
NVNT	ax40	5670	Ant1	94.72	0.24	0.9






Test Graphs

Duty Cycle NVNT a 5500MHz Ant1

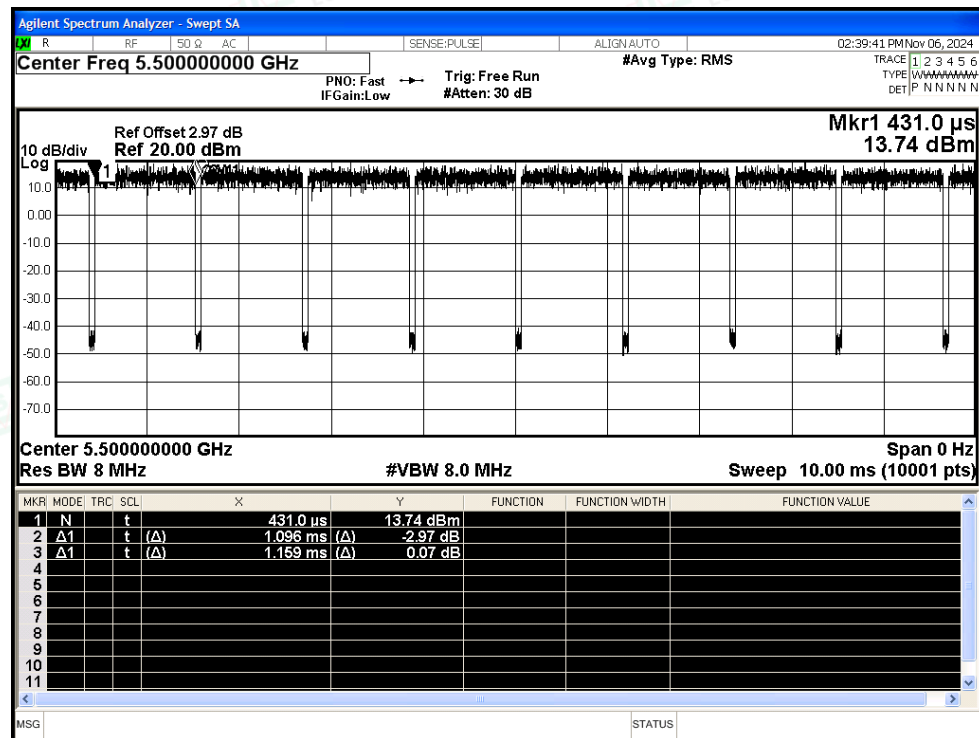

Duty Cycle NVNT a 5580MHz Ant1

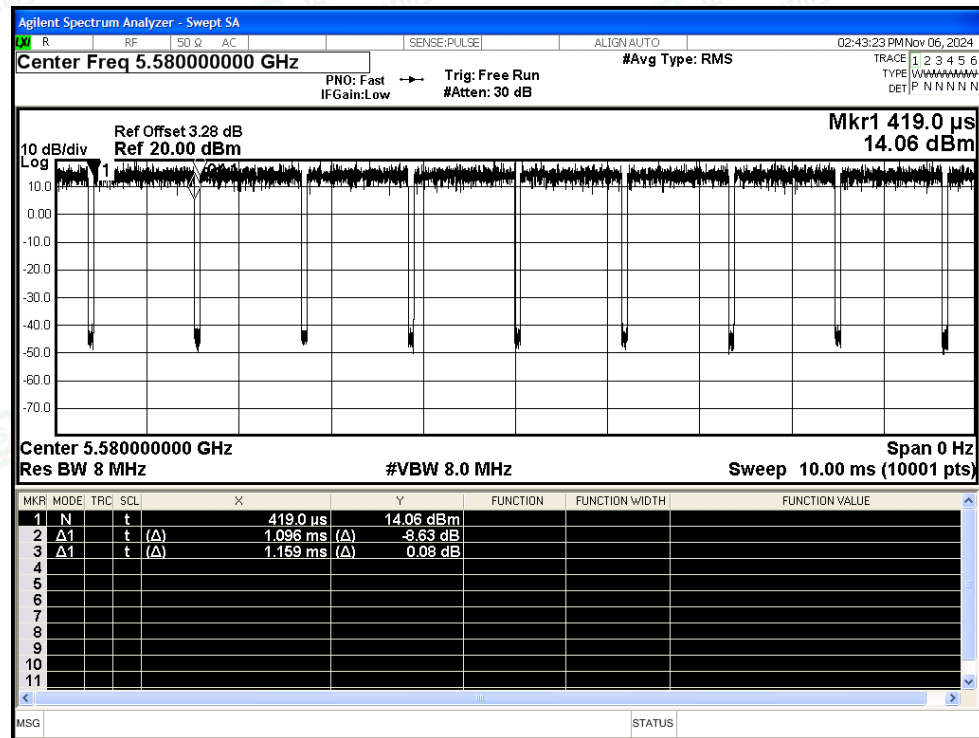

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant1

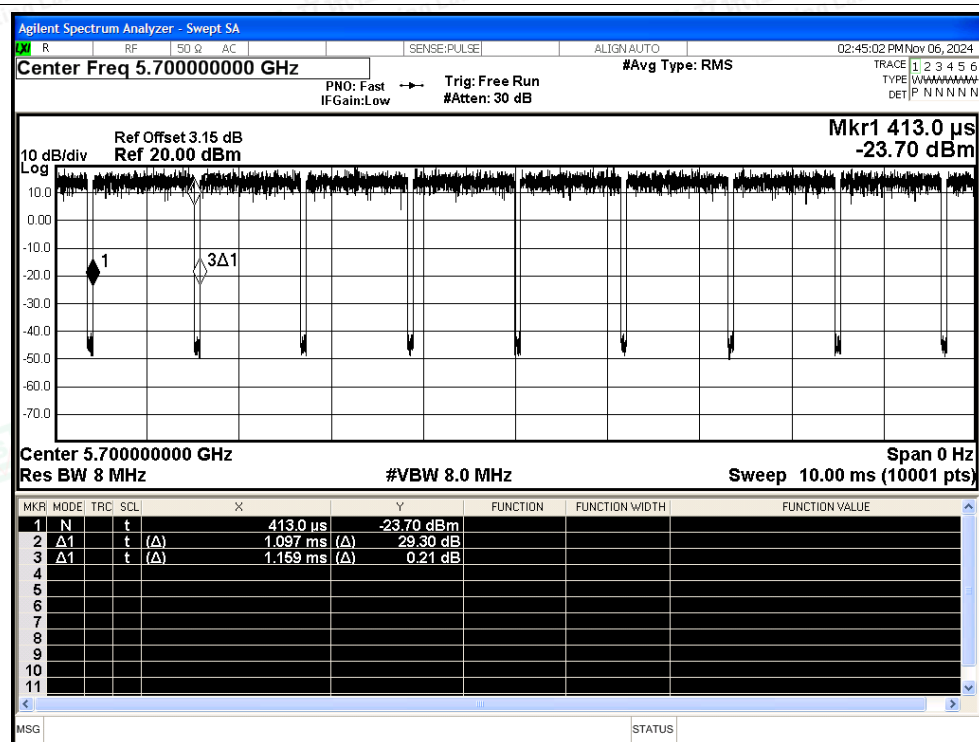

Duty Cycle NVNT n20 5500MHz Ant1

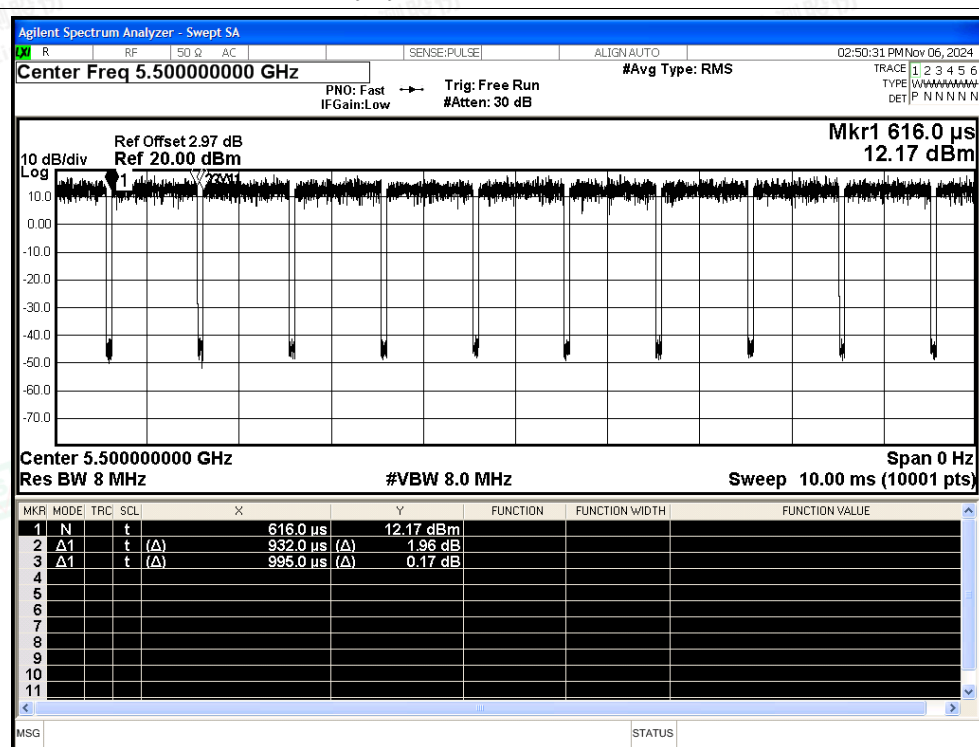

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant1

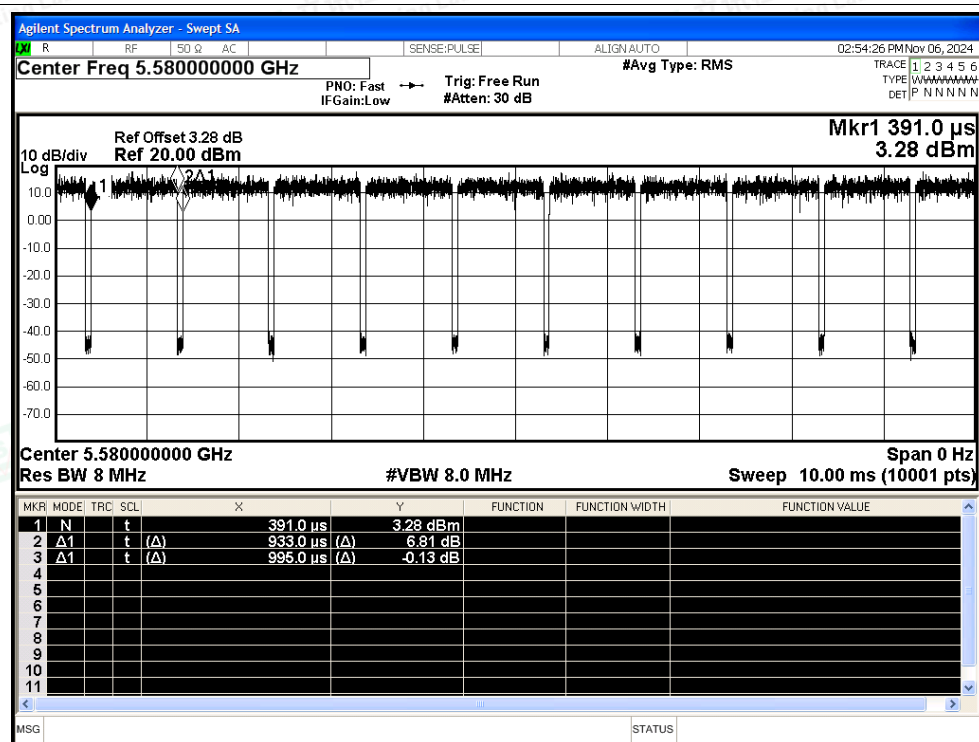

Duty Cycle NVNT n20 5700MHz Ant1

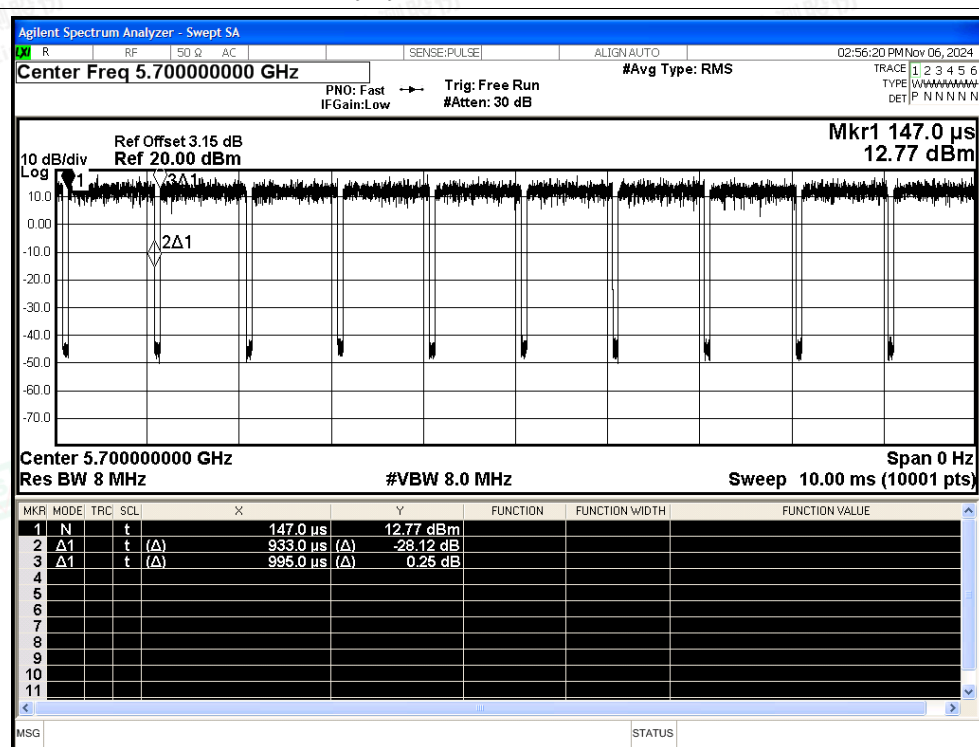

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant1

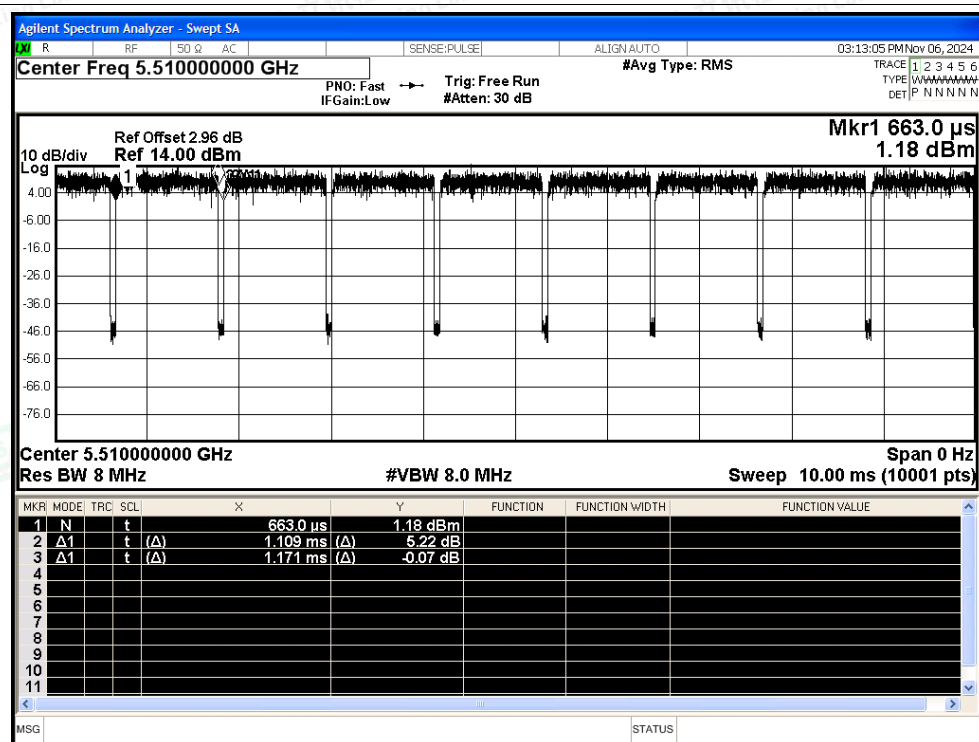

Duty Cycle NVNT n40 5550MHz Ant1

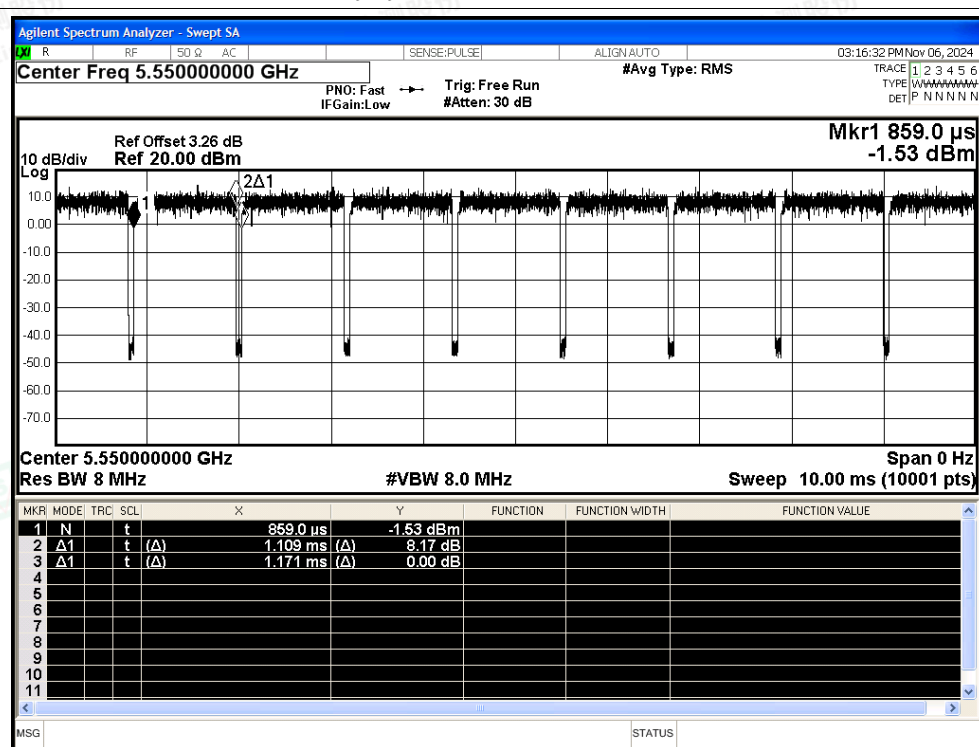

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant1

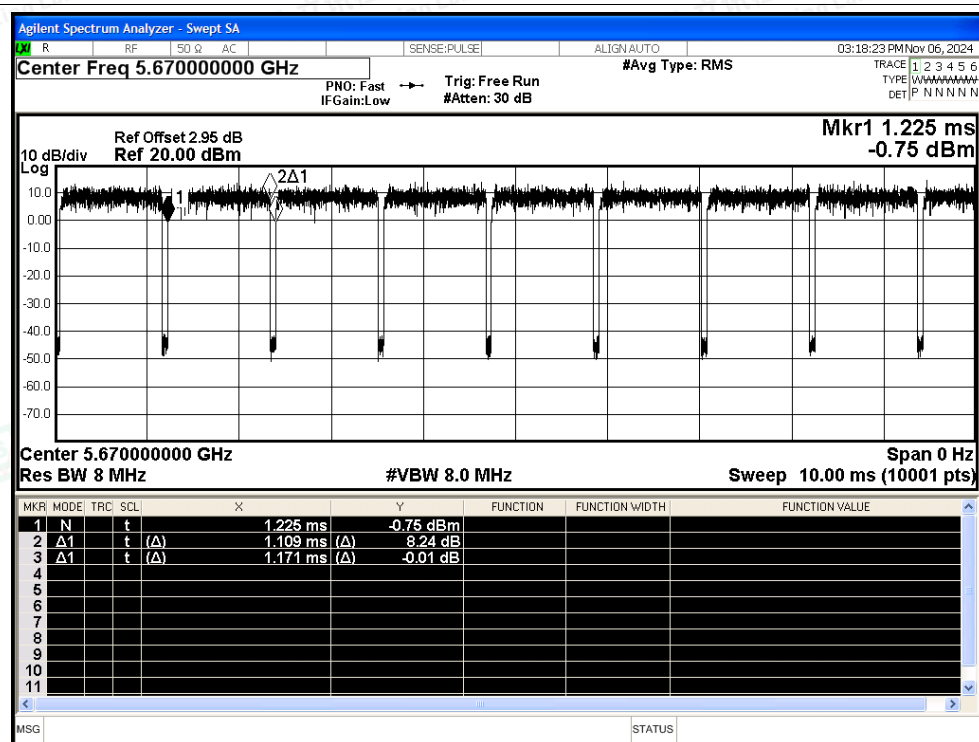


Duty Cycle NVNT ac20 5500MHz Ant1

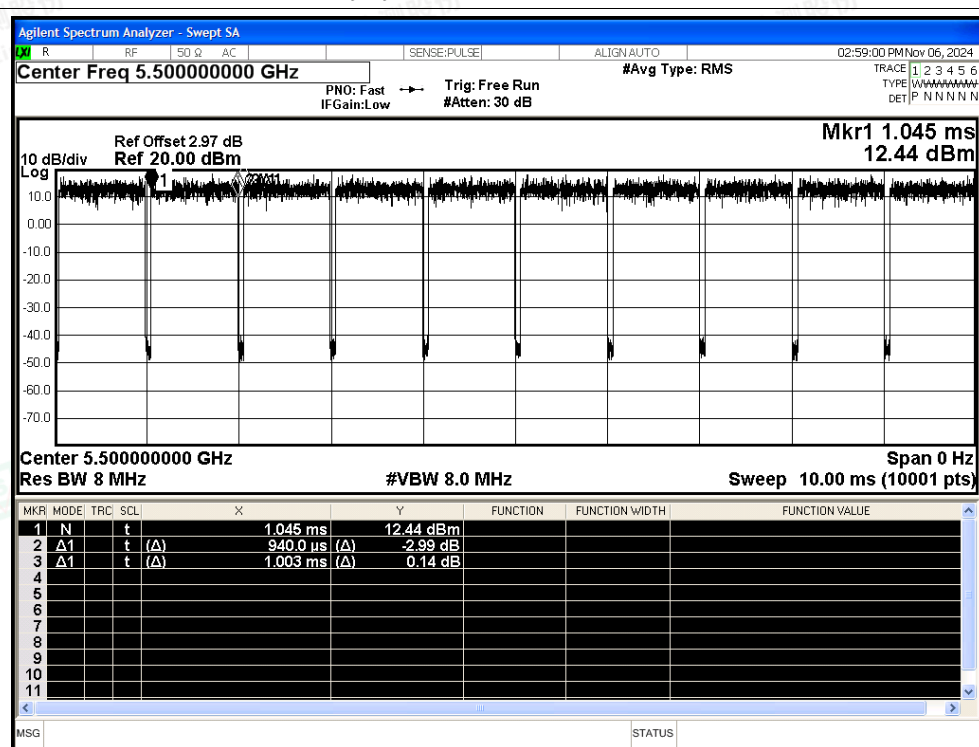




Duty Cycle NVNT ac20 5580MHz Ant1

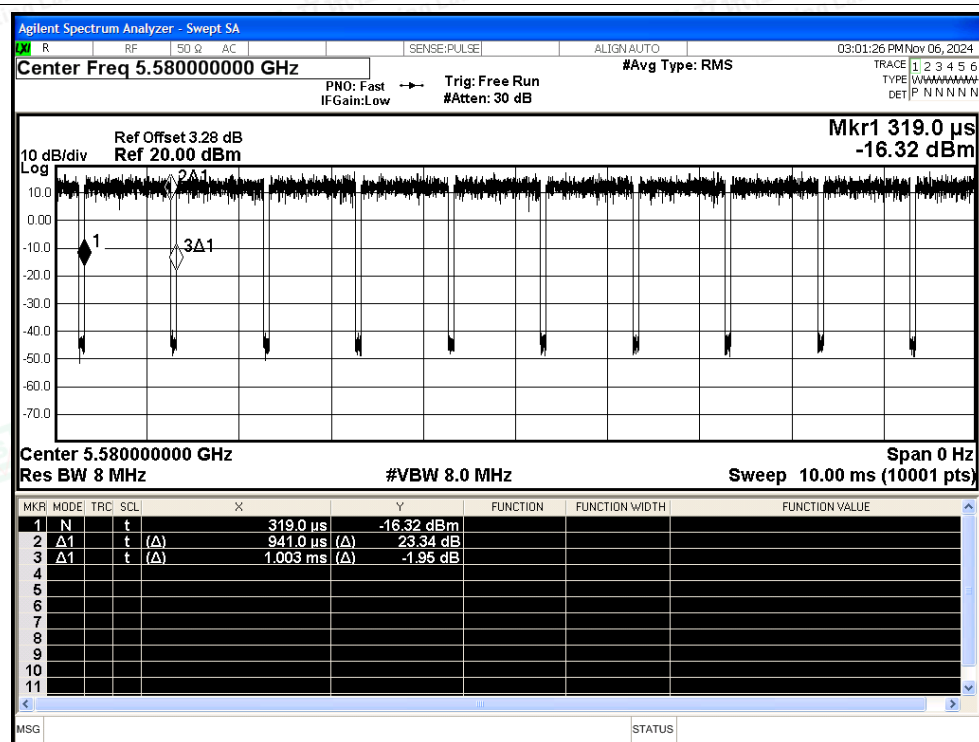


Duty Cycle NVNT ac20 5700MHz Ant1

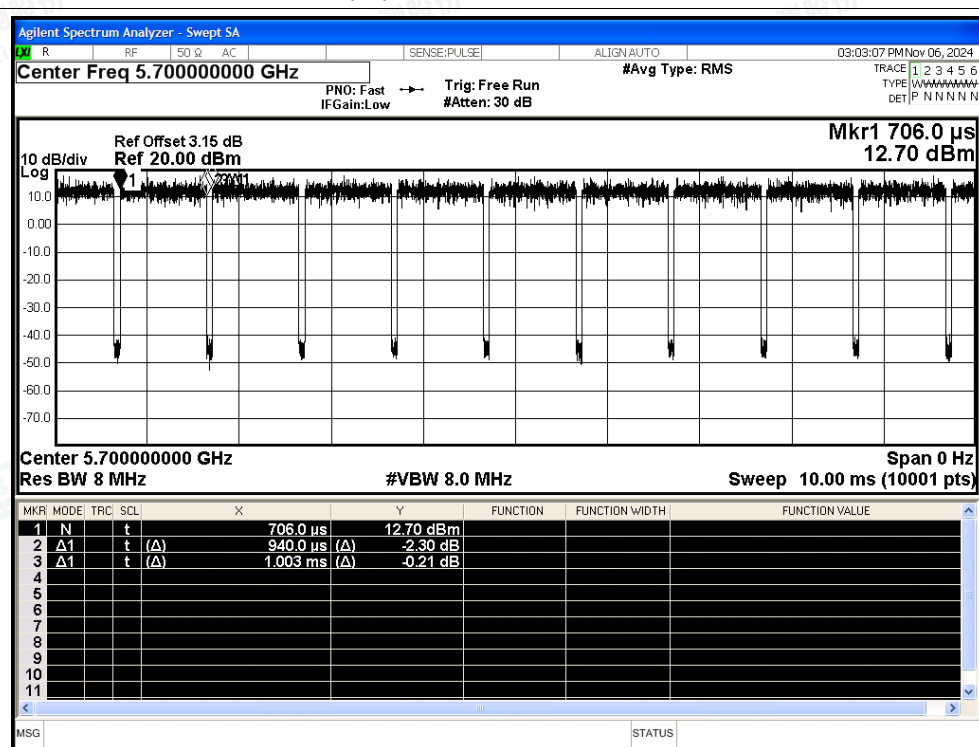




Duty Cycle NVNT ac40 5510MHz Ant1

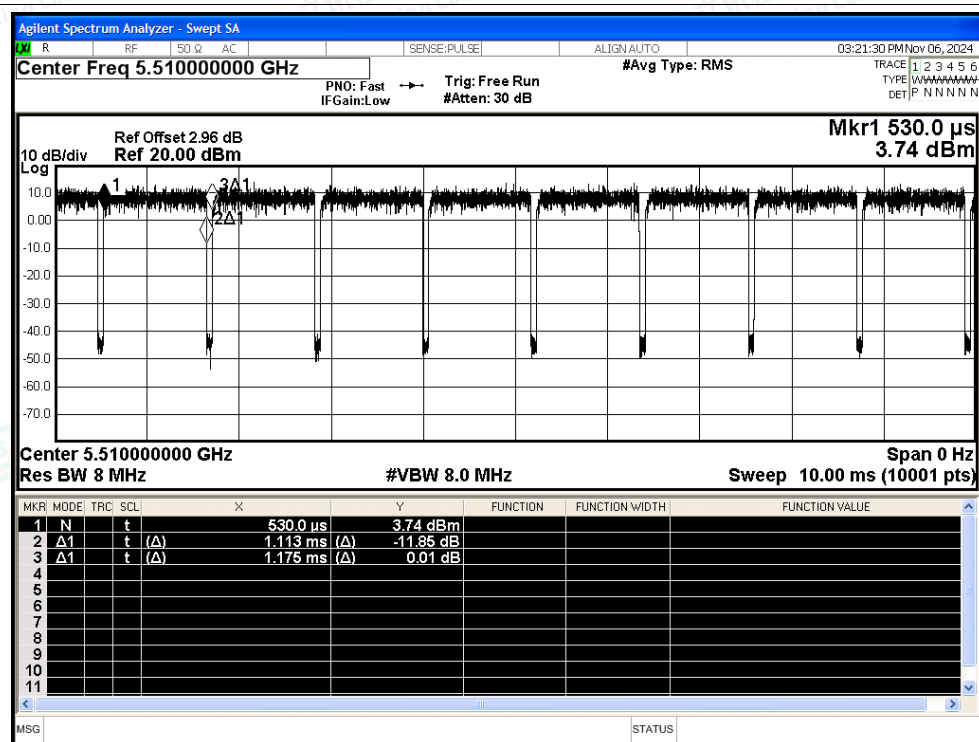


Duty Cycle NVNT ac40 5550MHz Ant1

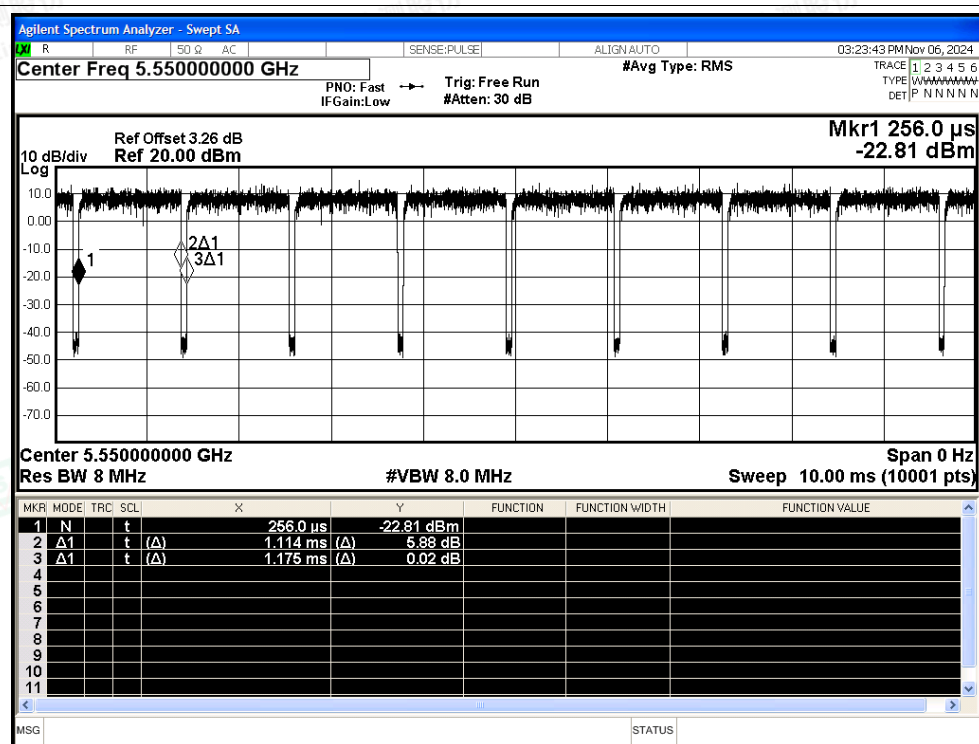




Duty Cycle NVNT ac40 5670MHz Ant1

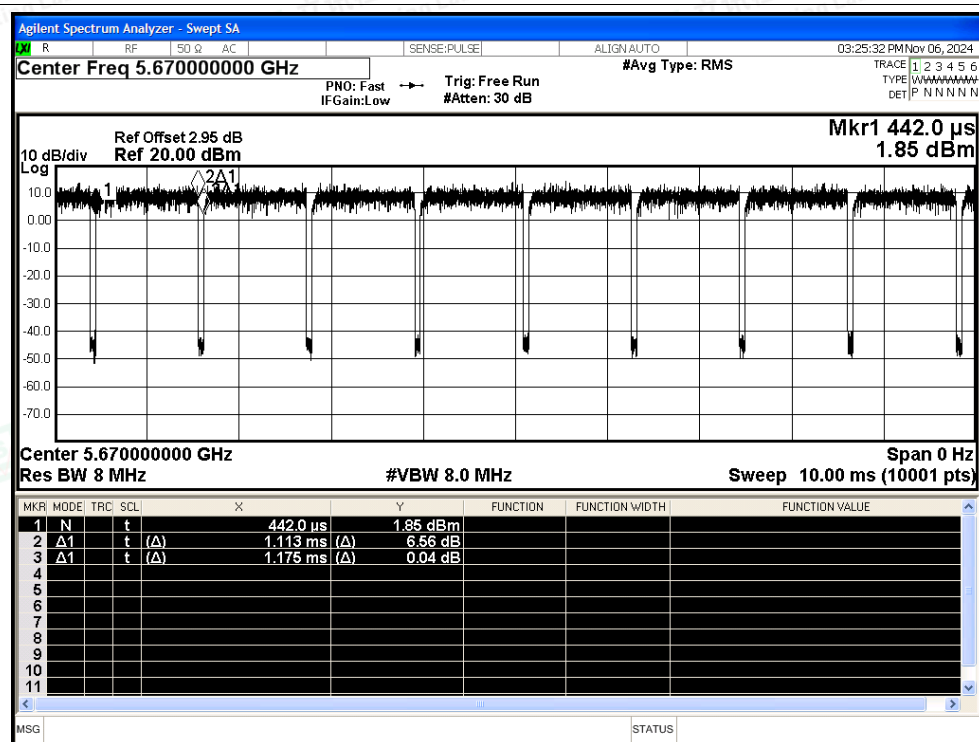


Duty Cycle NVNT ax20 5500MHz Ant1

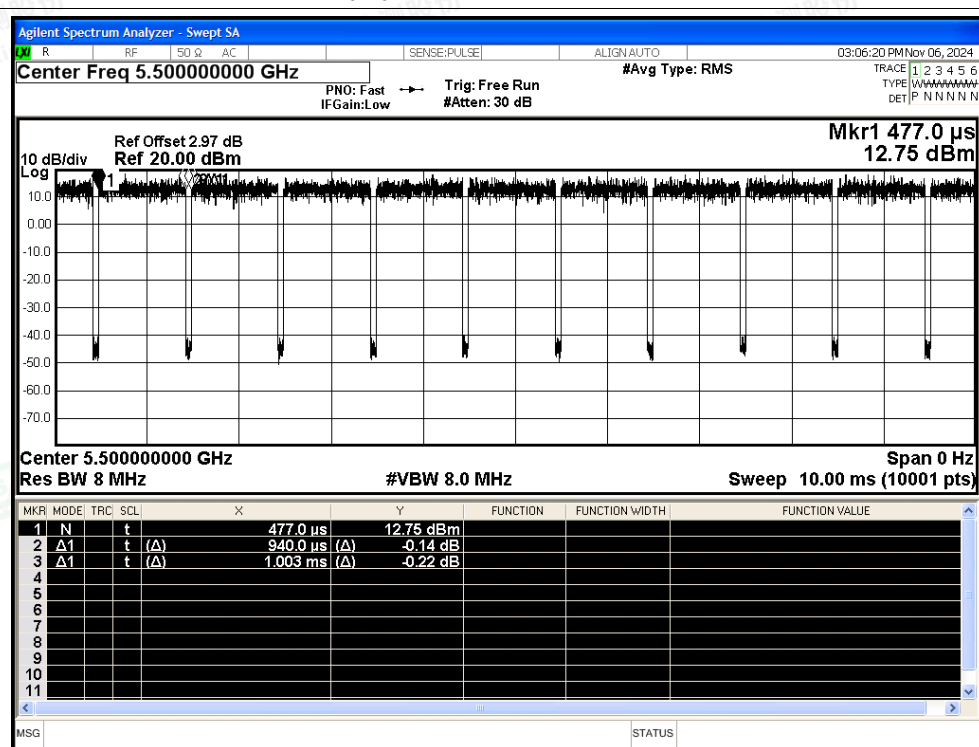




Duty Cycle NVNT ax20 5580MHz Ant1

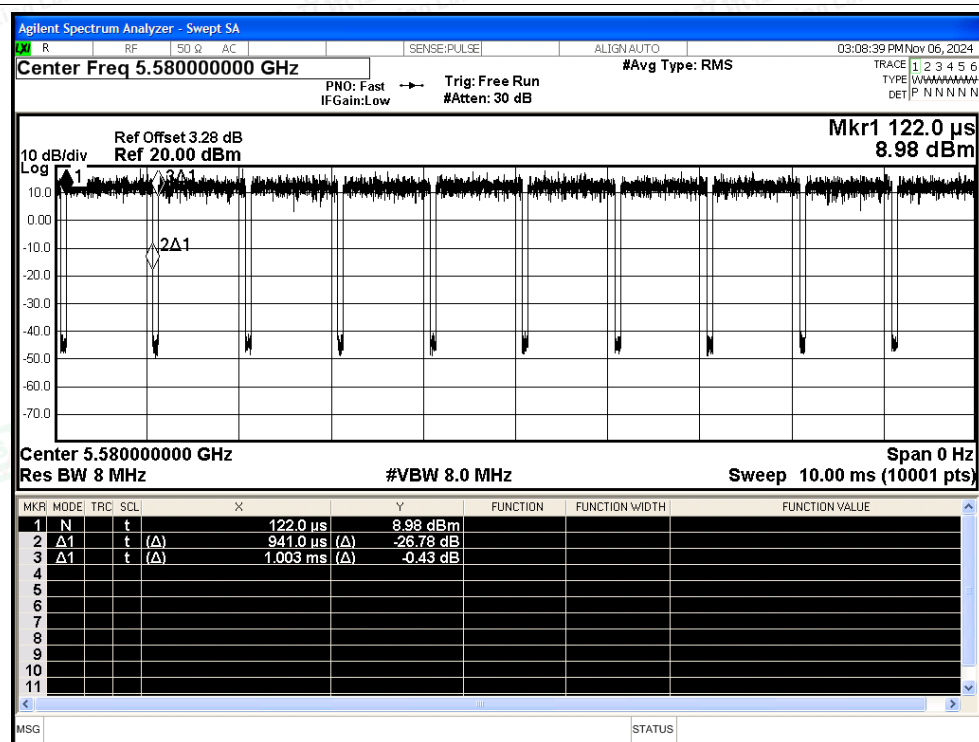

Duty Cycle NVNT ax20 5700MHz Ant1

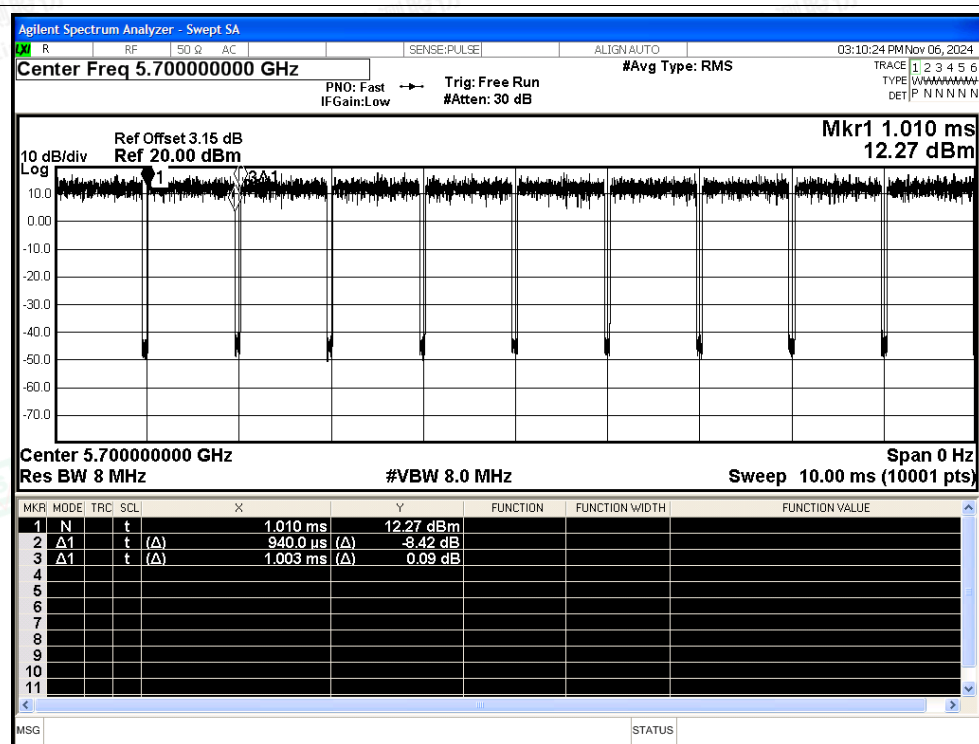

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5510MHz Ant1

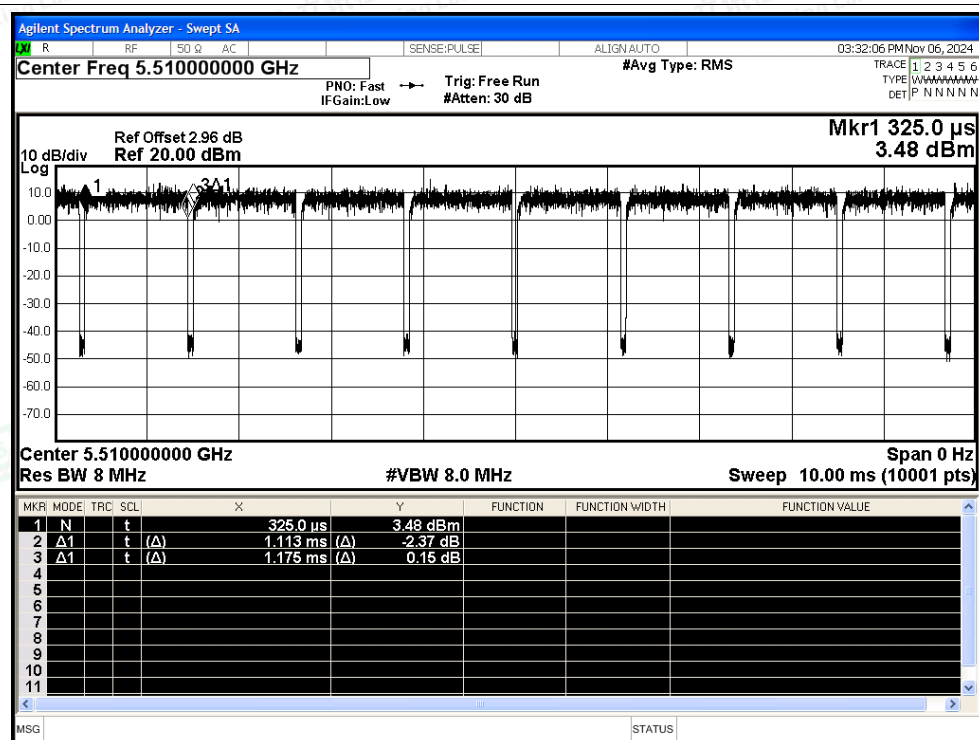

Duty Cycle NVNT ax40 5550MHz Ant1

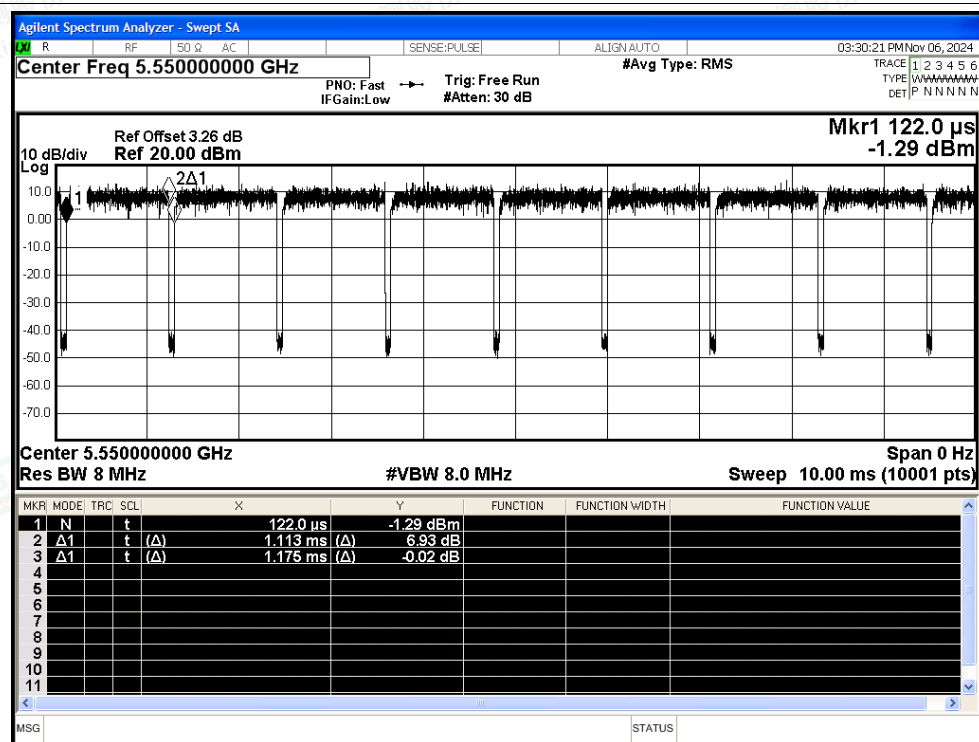


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

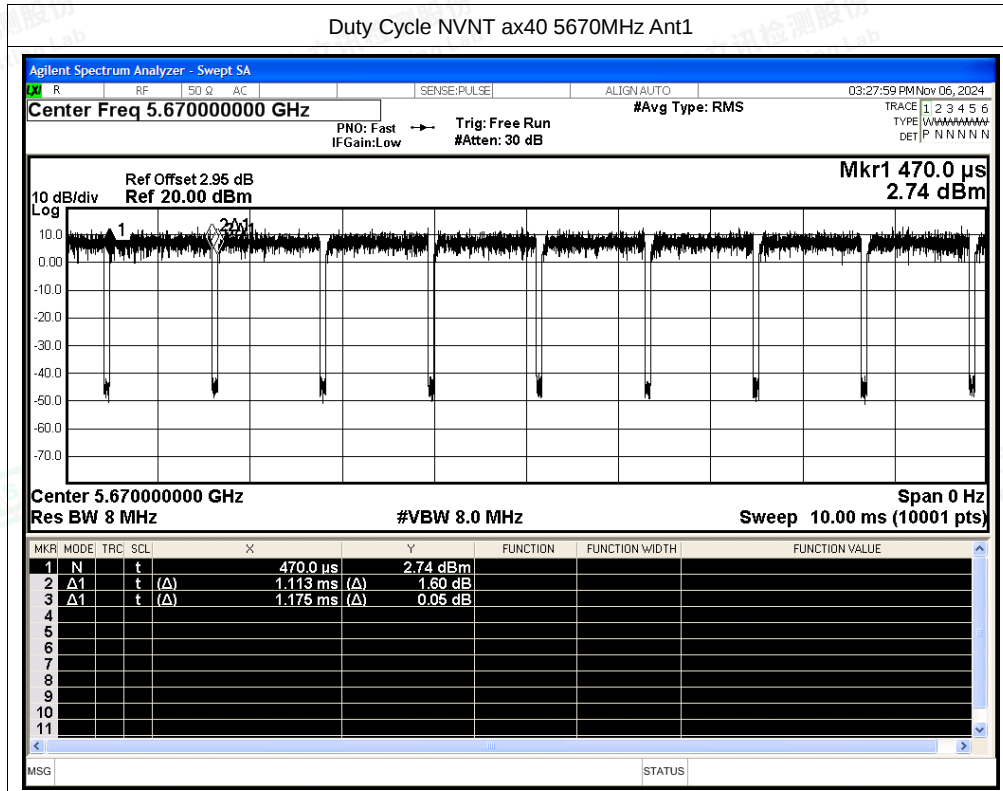



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant2	94.56	0.24	0.91
NVNT	a	5580	Ant2	94.56	0.24	0.91
NVNT	a	5700	Ant2	94.65	0.24	0.91
NVNT	n20	5500	Ant2	93.67	0.28	1.07
NVNT	n20	5580	Ant2	93.77	0.28	1.07
NVNT	n20	5700	Ant2	93.77	0.28	1.07
NVNT	n40	5510	Ant2	94.71	0.24	0.9
NVNT	n40	5550	Ant2	94.72	0.24	0.9
NVNT	n40	5670	Ant2	94.72	0.24	0.9
NVNT	ac20	5500	Ant2	93.72	0.28	1.06
NVNT	ac20	5580	Ant2	93.72	0.28	1.06
NVNT	ac20	5700	Ant2	93.72	0.28	1.06
NVNT	ac40	5510	Ant2	94.72	0.24	0.9
NVNT	ac40	5550	Ant2	94.72	0.24	0.9
NVNT	ac40	5670	Ant2	94.72	0.24	0.9
NVNT	ax20	5500	Ant2	93.72	0.28	1.06
NVNT	ax20	5580	Ant2	93.82	0.28	1.06
NVNT	ax20	5700	Ant2	93.72	0.28	1.06
NVNT	ax40	5510	Ant2	94.72	0.24	0.9
NVNT	ax40	5550	Ant2	94.72	0.24	0.9
NVNT	ax40	5670	Ant2	94.81	0.23	0.9




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5500MHz Ant2

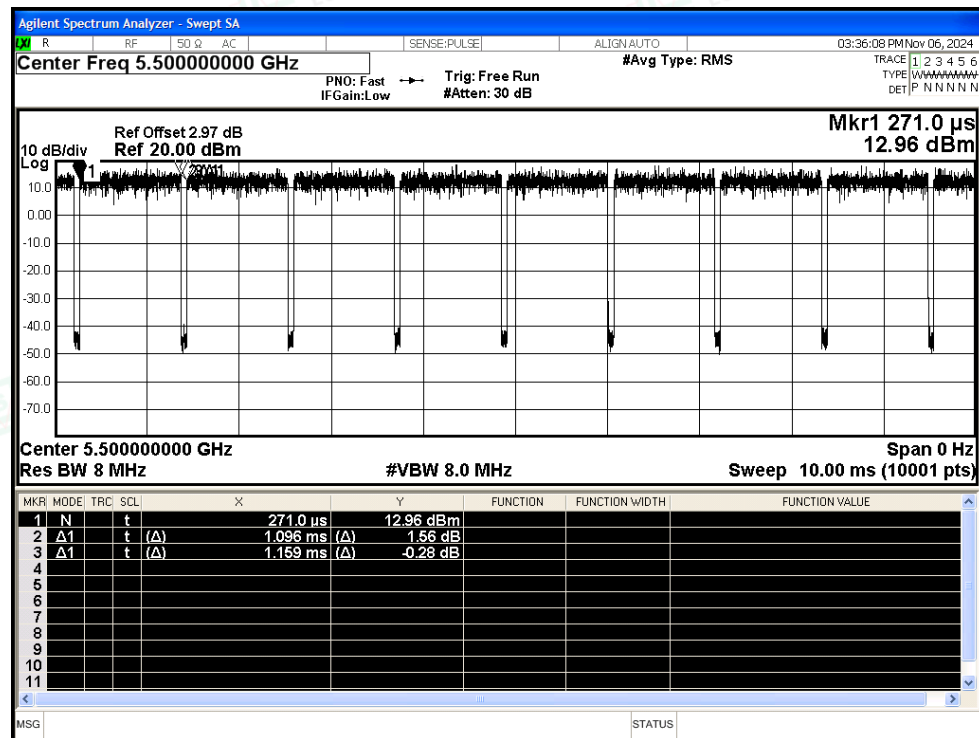

Duty Cycle NVNT a 5580MHz Ant2

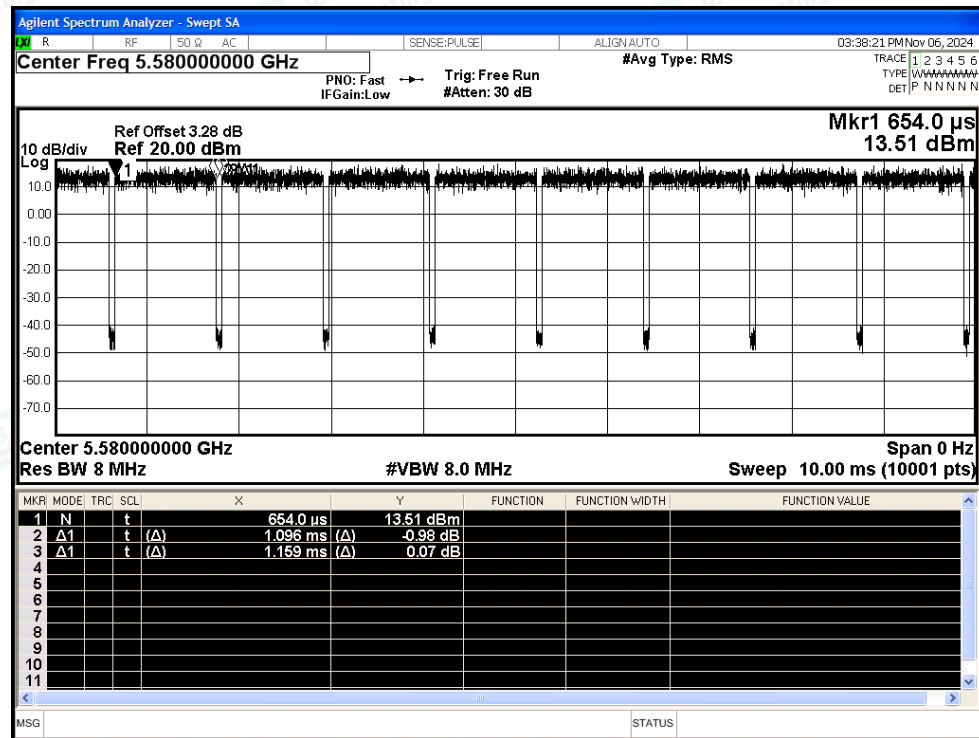

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant2

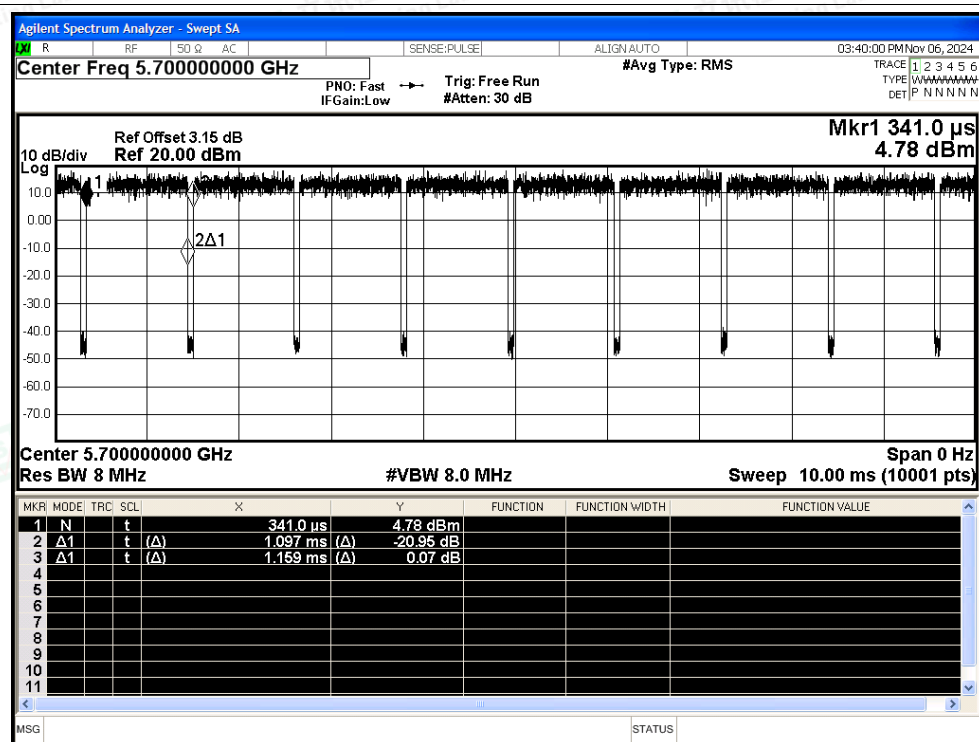

Duty Cycle NVNT n20 5500MHz Ant2

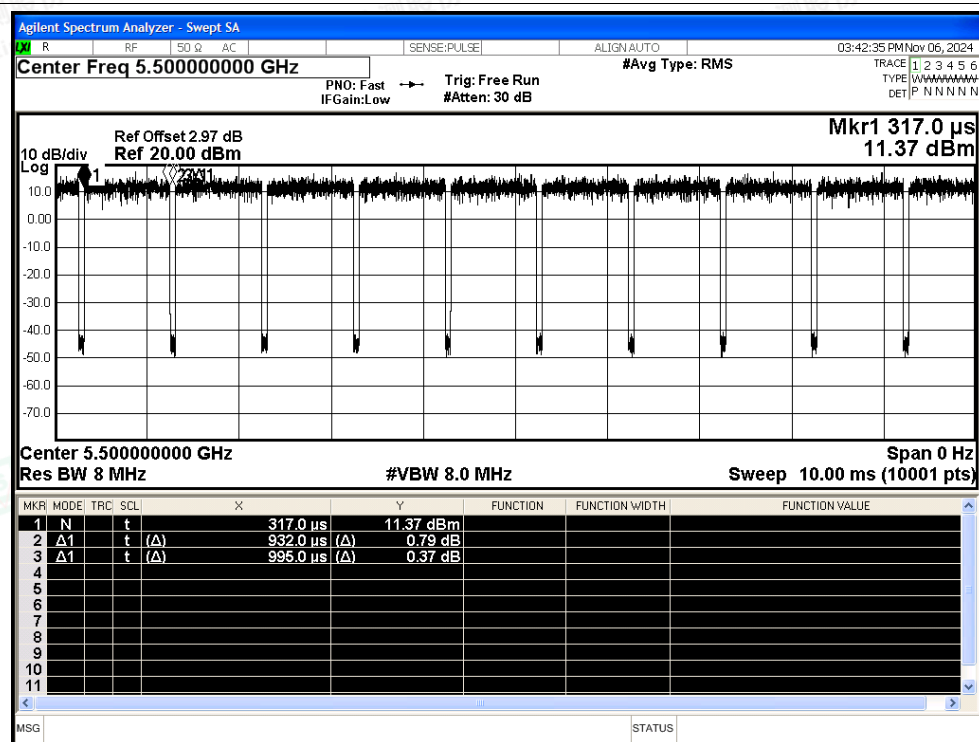

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant2

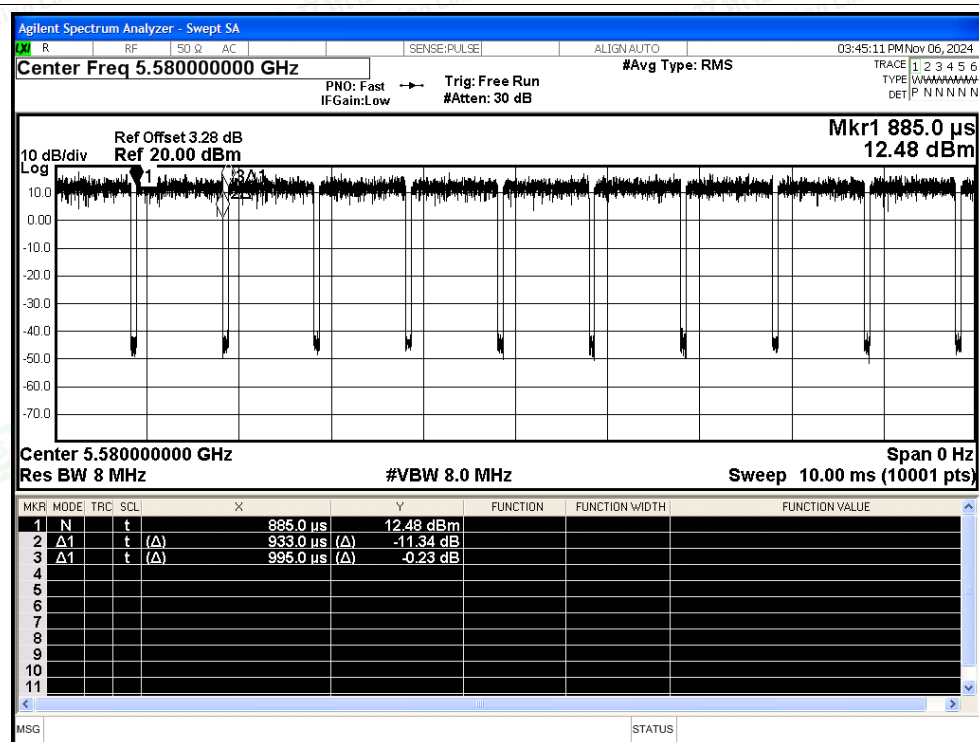


Duty Cycle NVNT n20 5700MHz Ant2

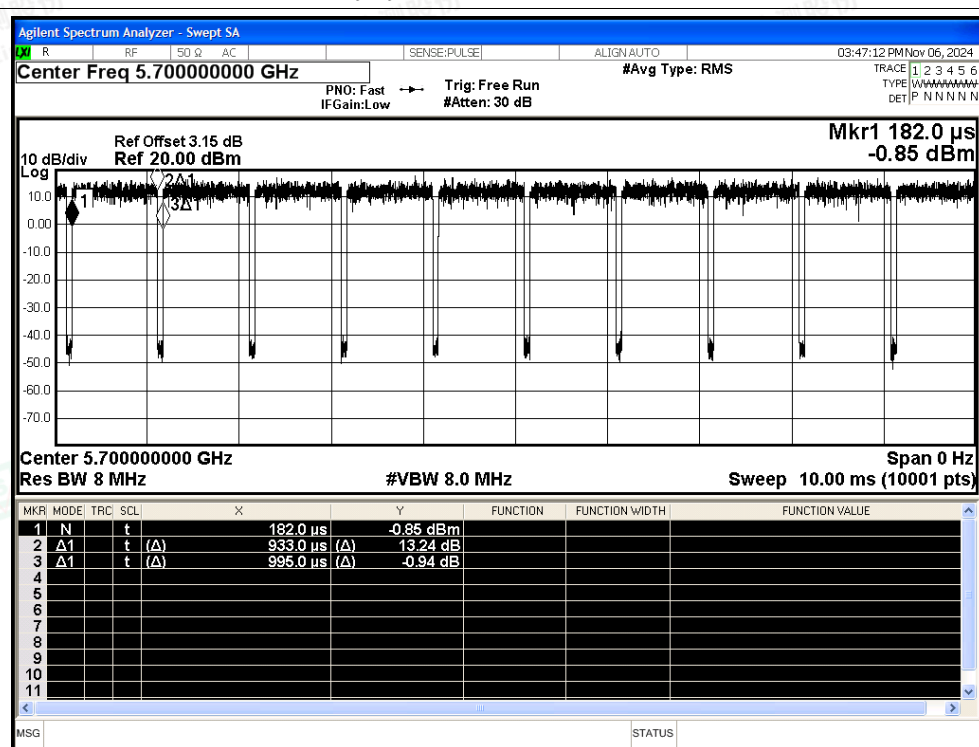




Duty Cycle NVNT n40 5510MHz Ant2

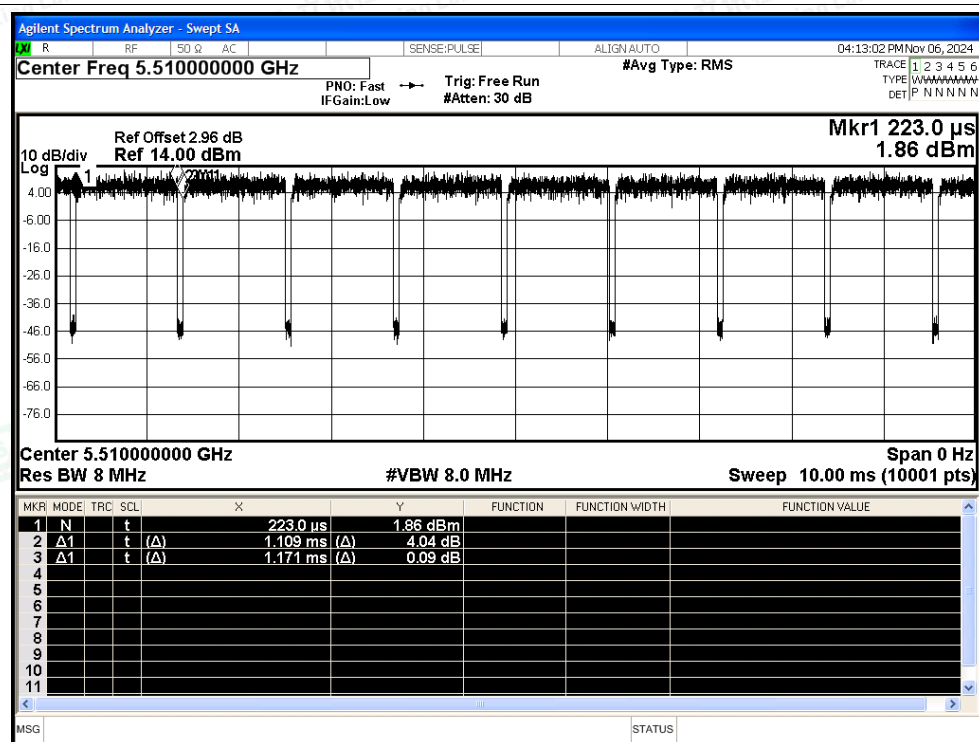


Duty Cycle NVNT n40 5550MHz Ant2

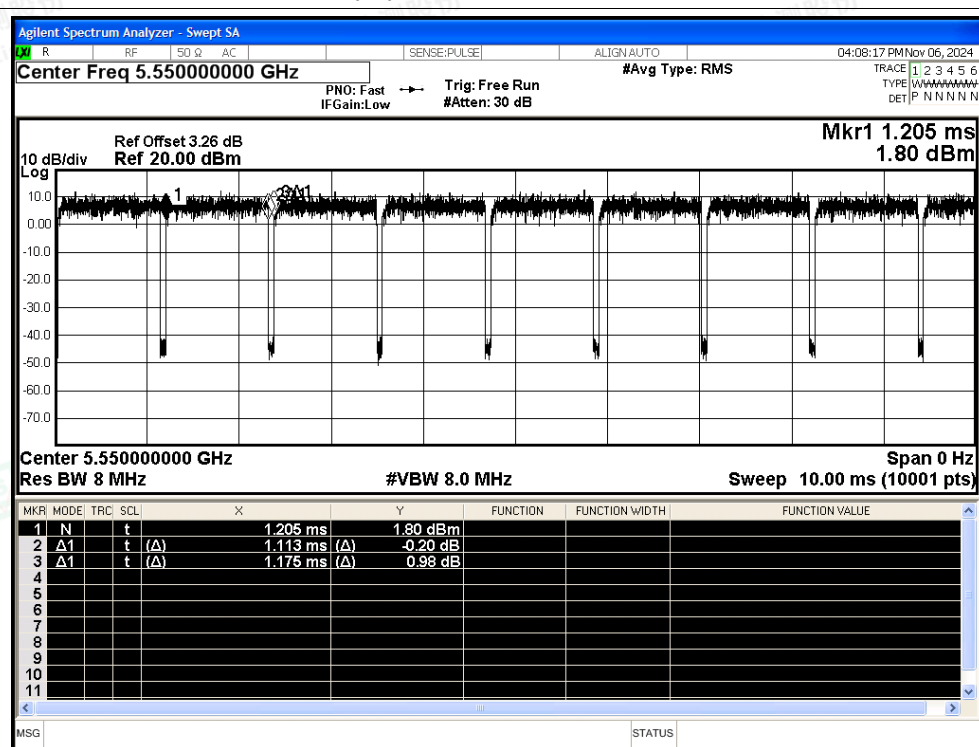




Duty Cycle NVNT n40 5670MHz Ant2

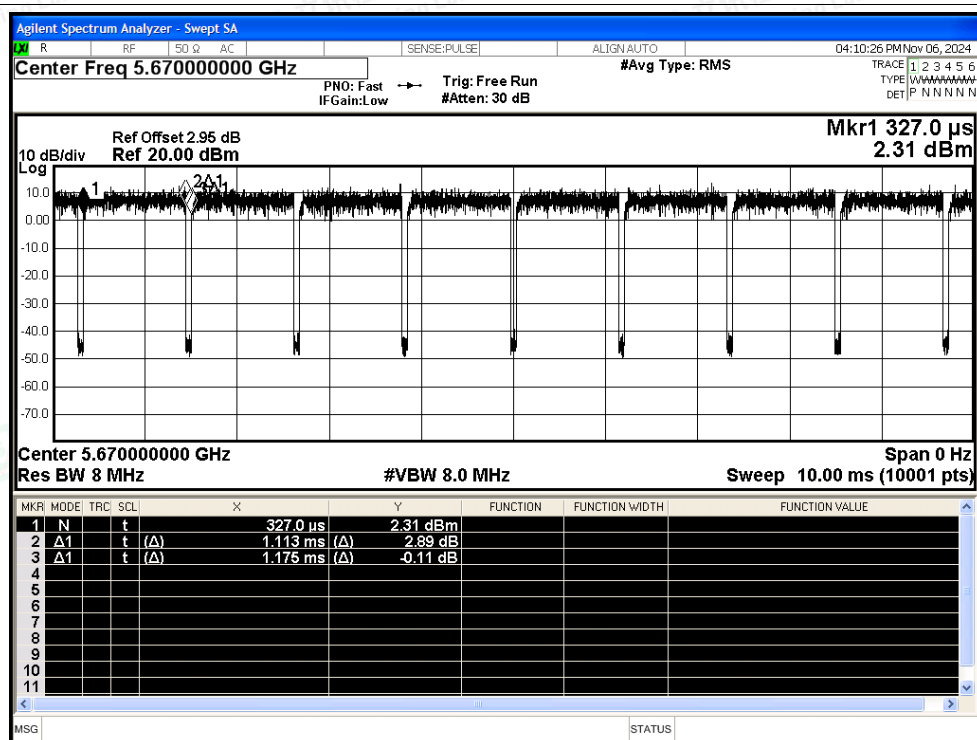

Duty Cycle NVNT ac20 5500MHz Ant2

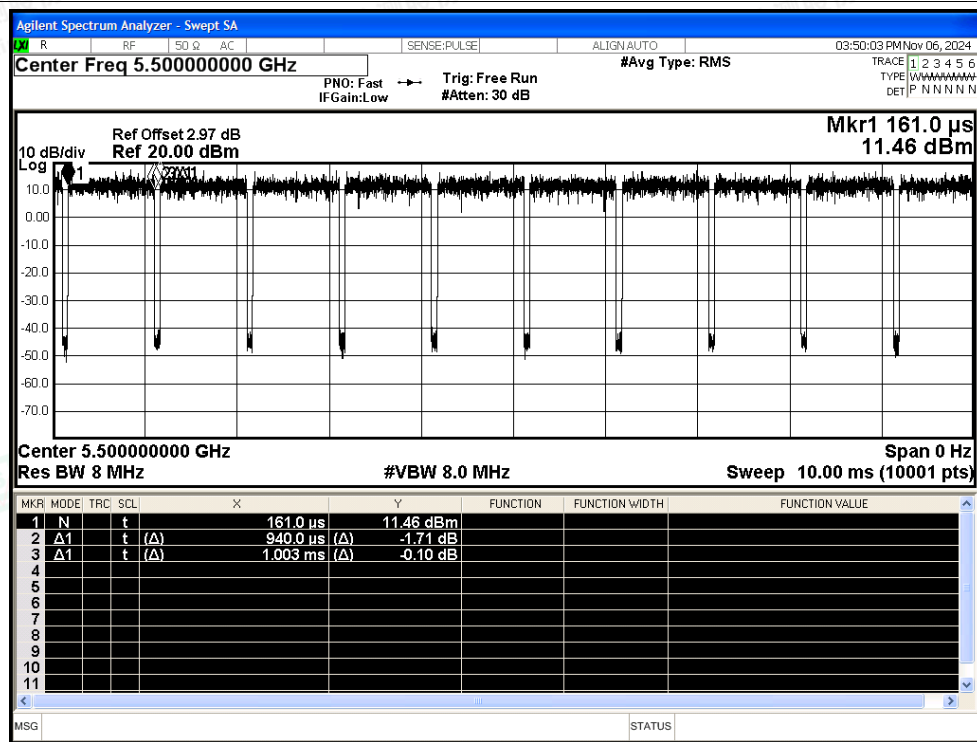

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant2

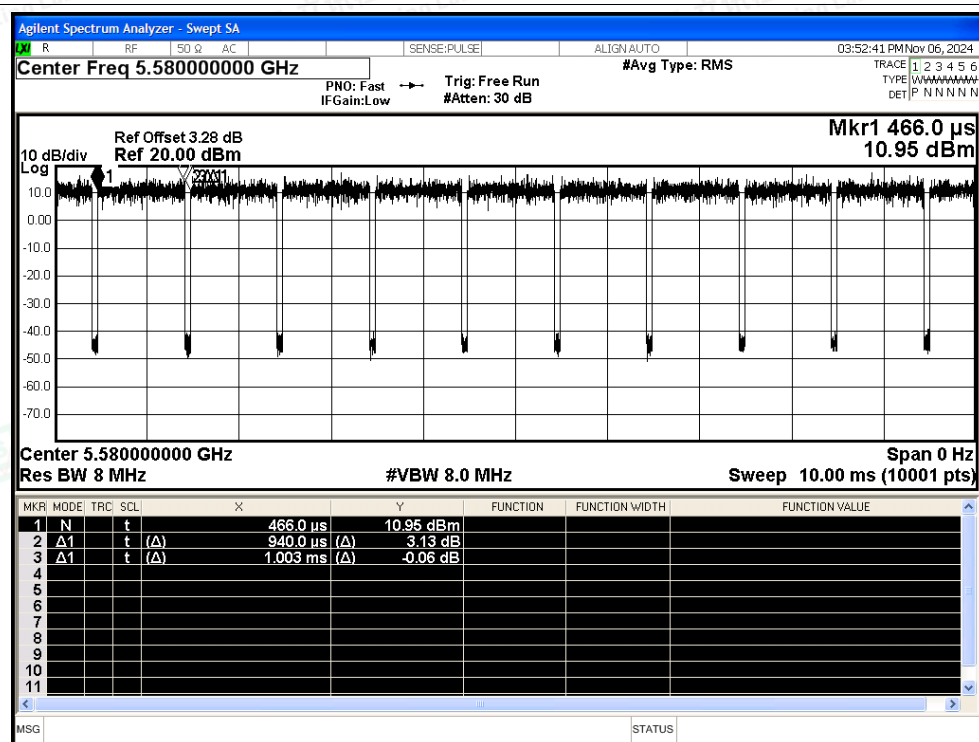

Duty Cycle NVNT ac20 5700MHz Ant2

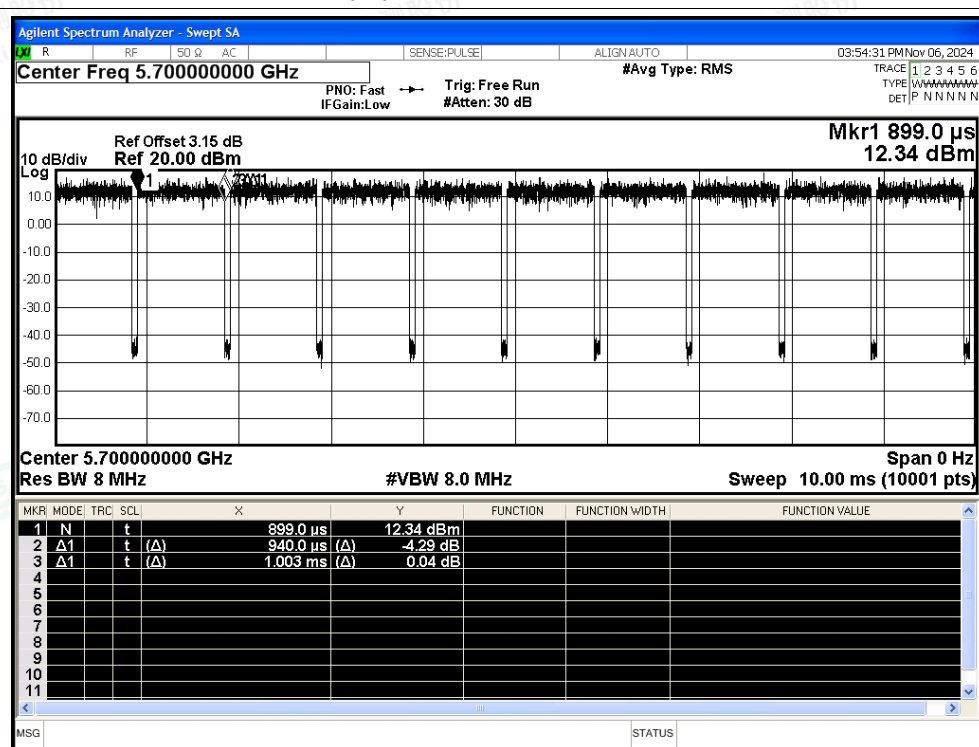

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant2

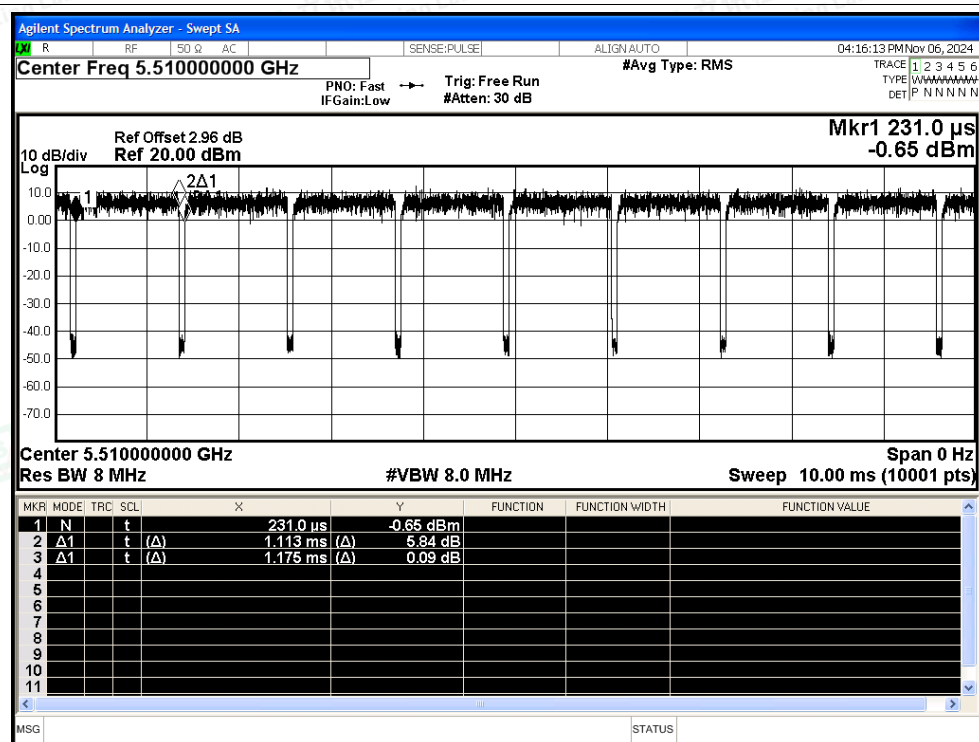


Duty Cycle NVNT ac40 5550MHz Ant2

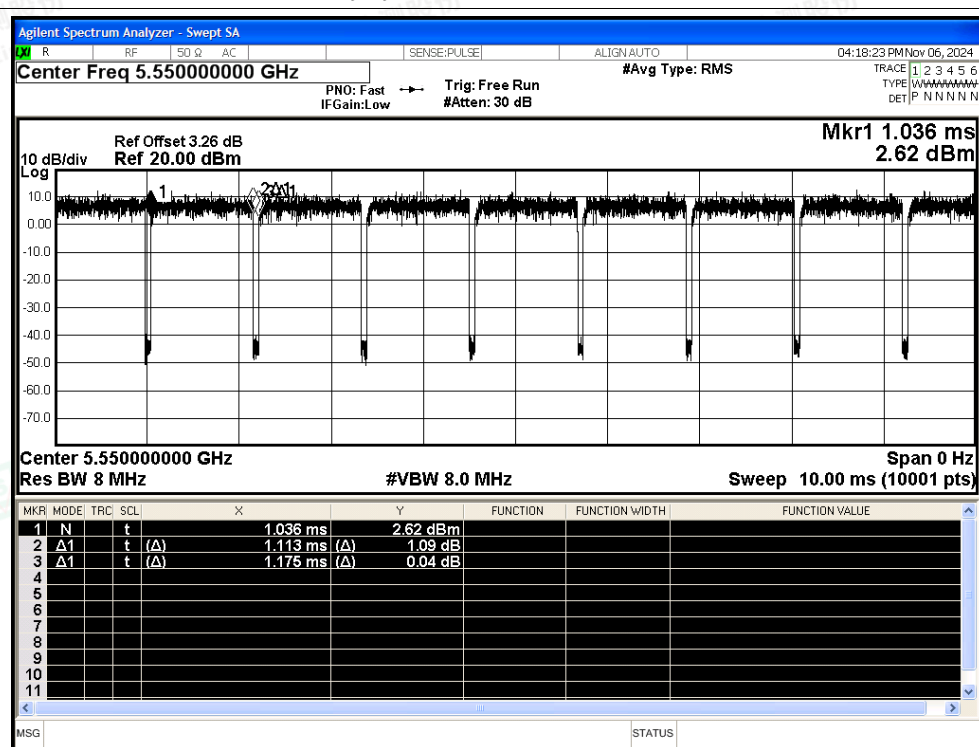




Duty Cycle NVNT ac40 5670MHz Ant2

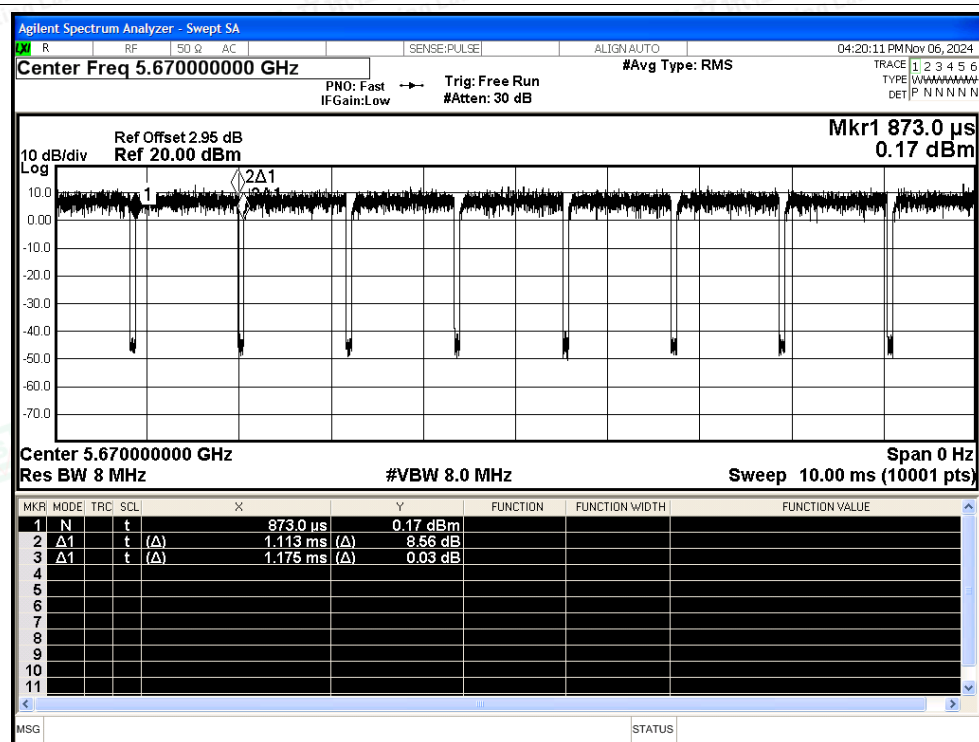


Duty Cycle NVNT ax20 5500MHz Ant2

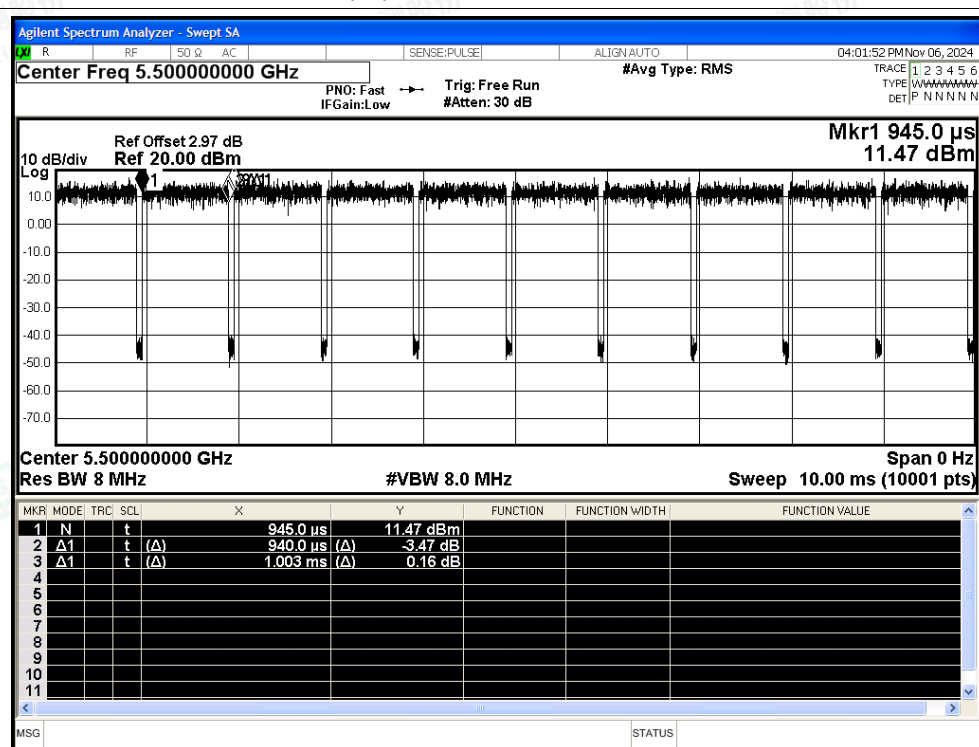




Duty Cycle NVNT ax20 5580MHz Ant2

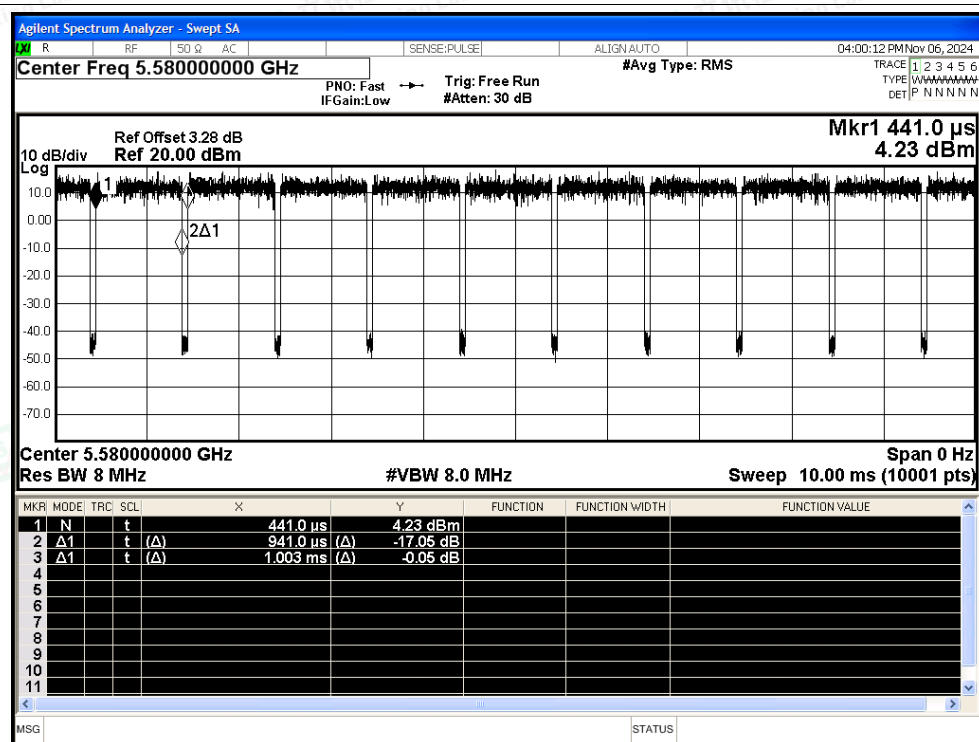


Duty Cycle NVNT ax20 5700MHz Ant2

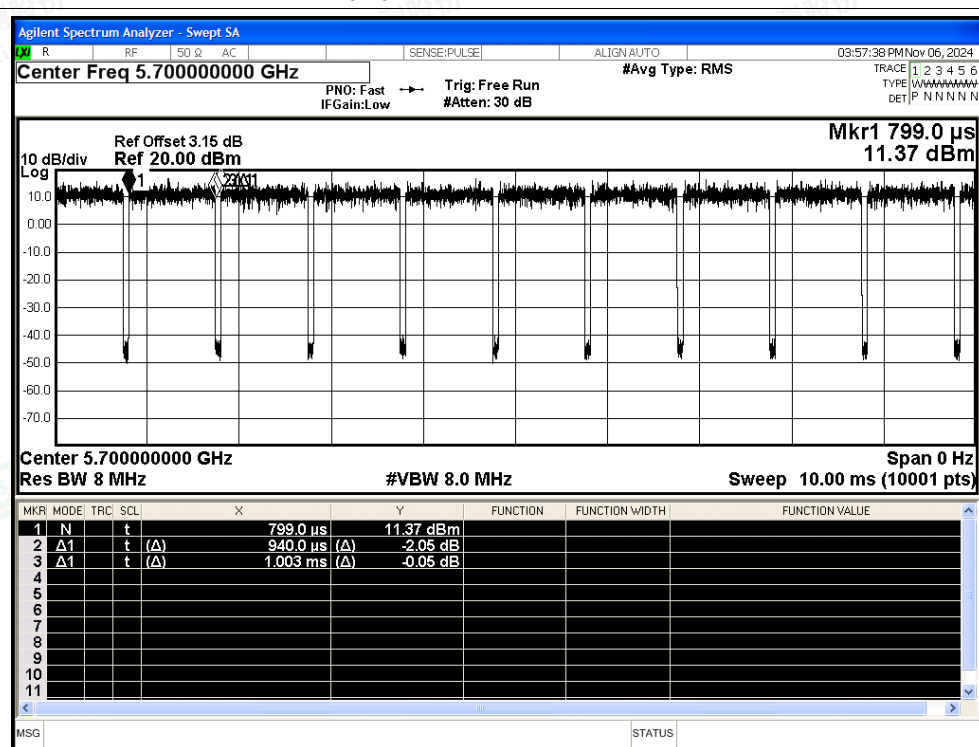



Duty Cycle NVNT ax40 5510MHz Ant2

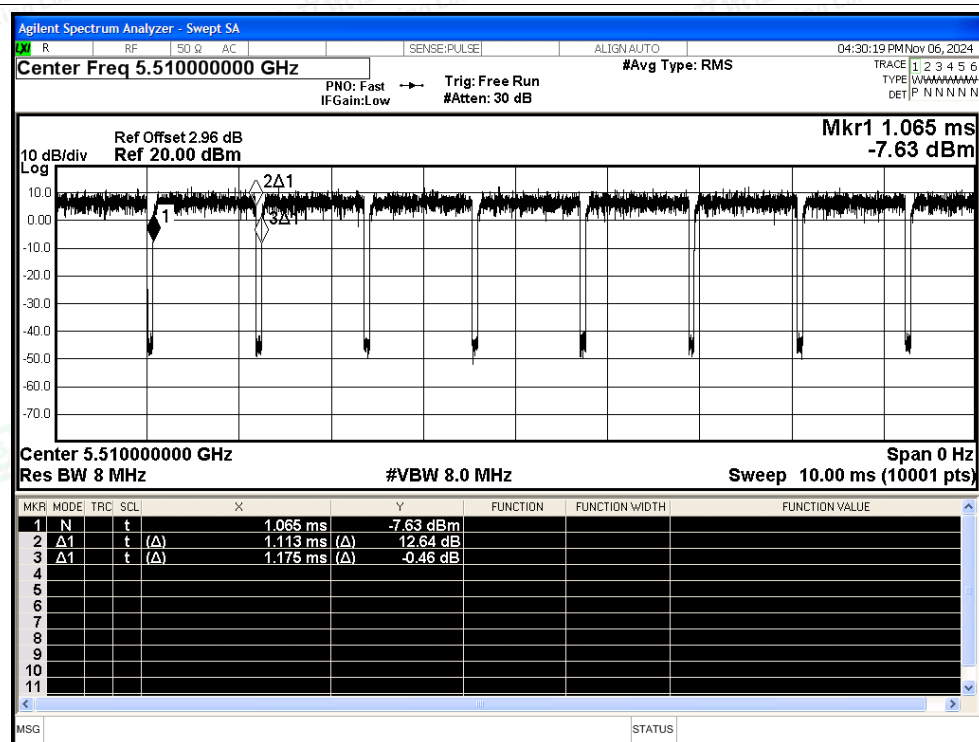

Duty Cycle NVNT ax40 5550MHz Ant2

