




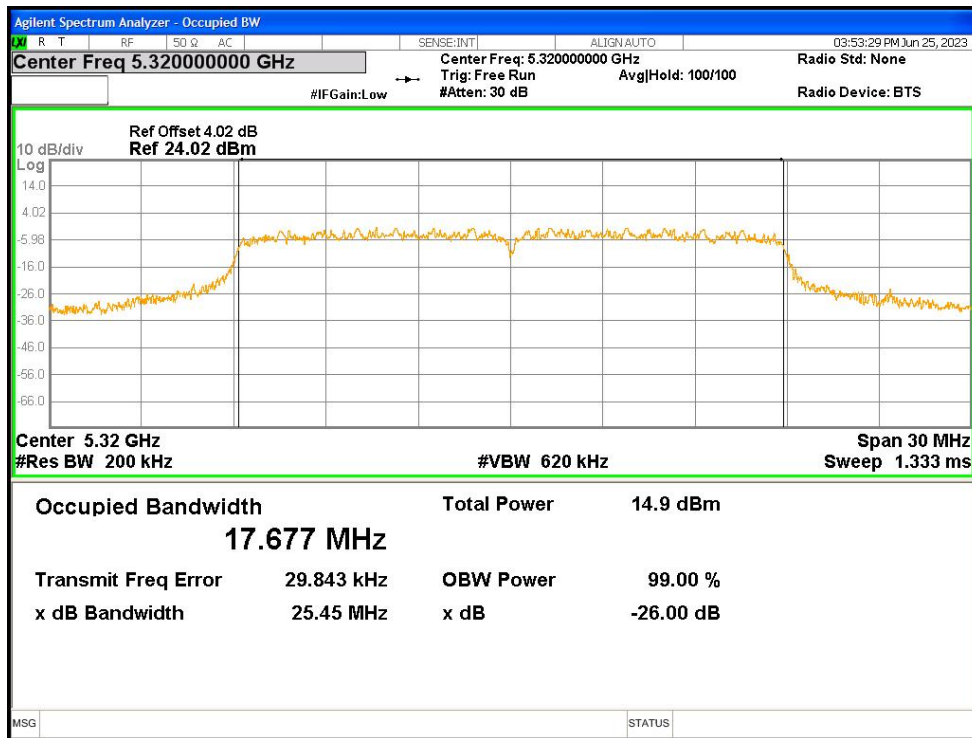


OBW NVNT n20 5320MHz Ant2

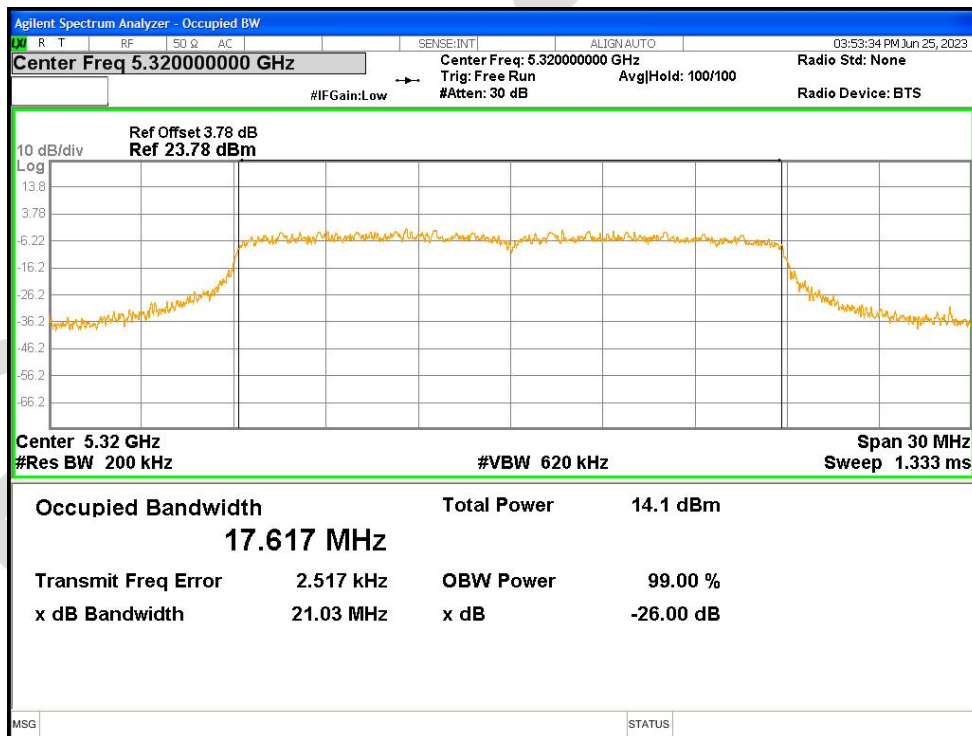


OBW NVNT n20 5500MHz Ant1

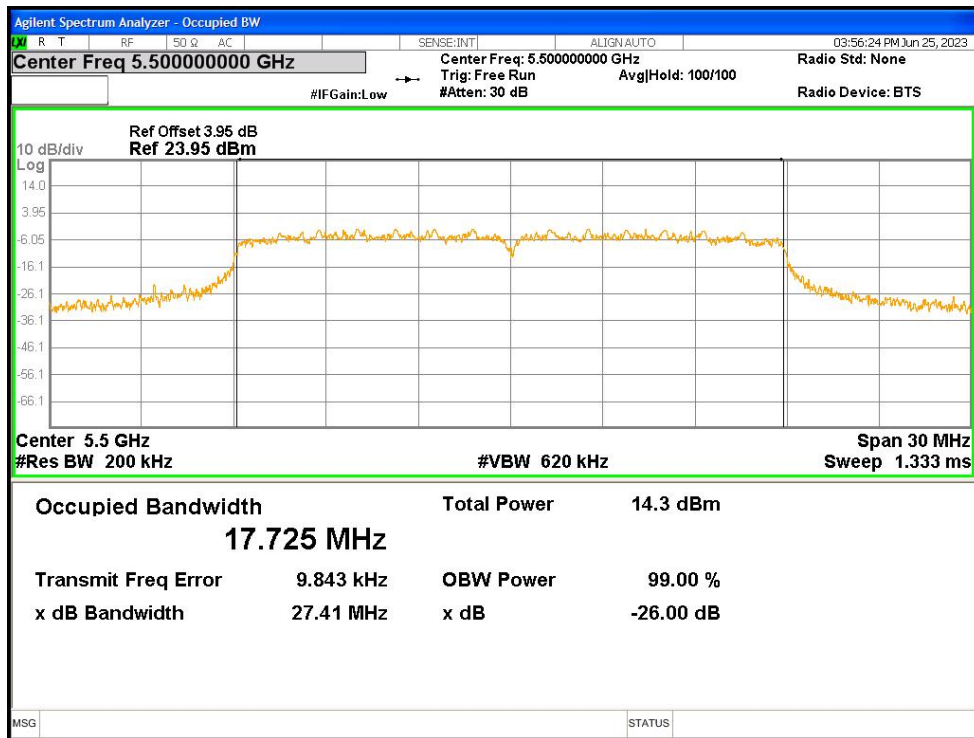


OBW NVNT n20 5500MHz Ant2

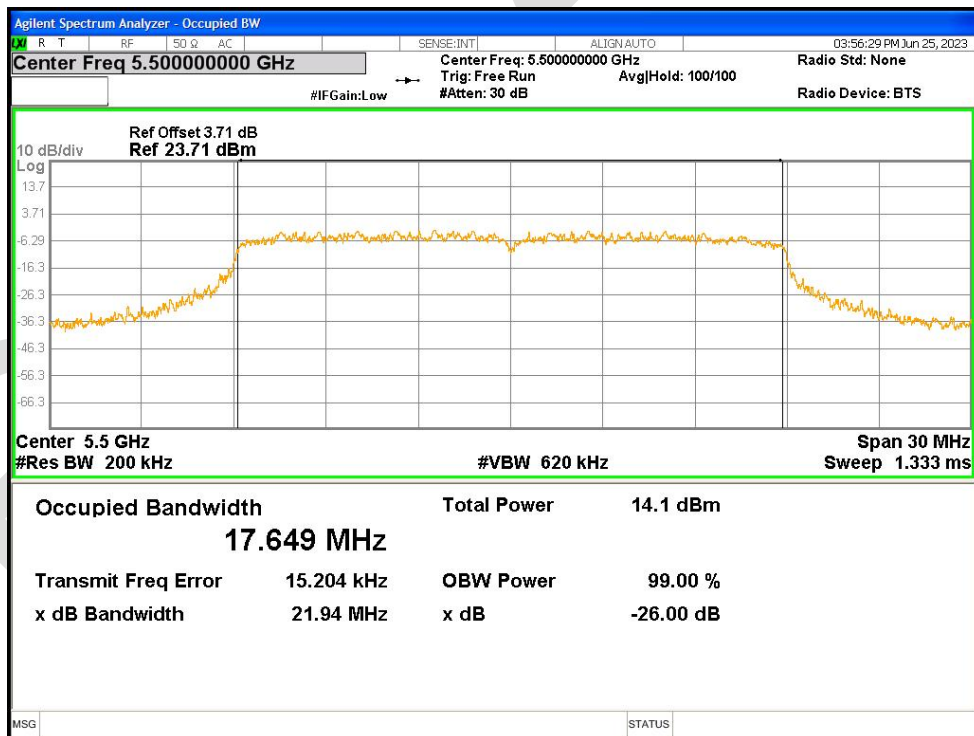


OBW NVNT n20 5600MHz Ant1

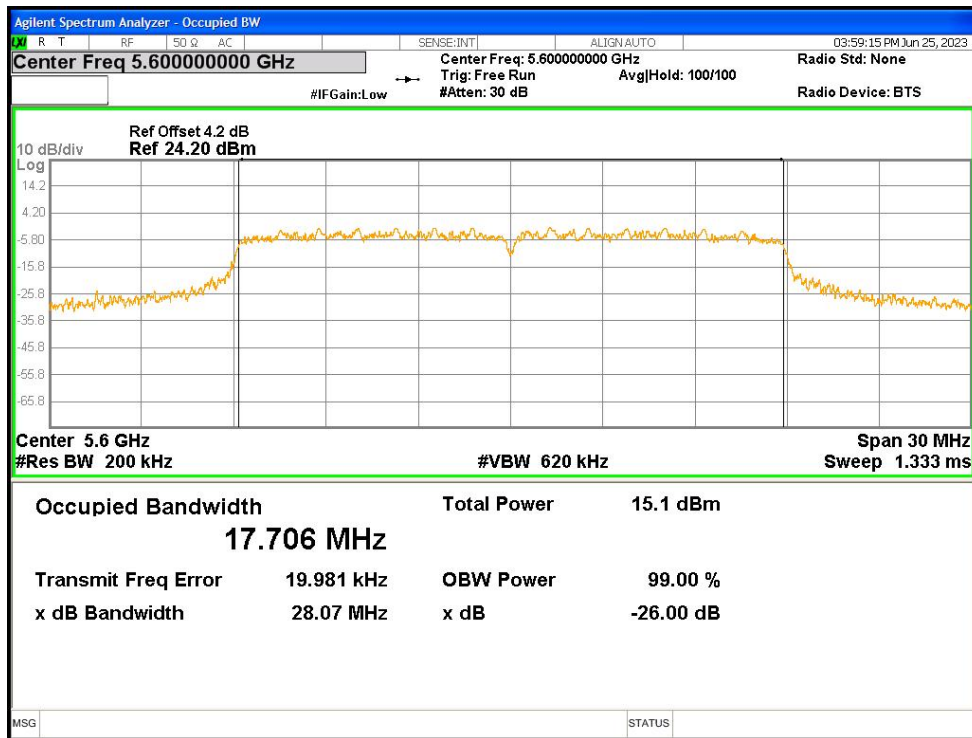


OBW NVNT n20 5600MHz Ant2

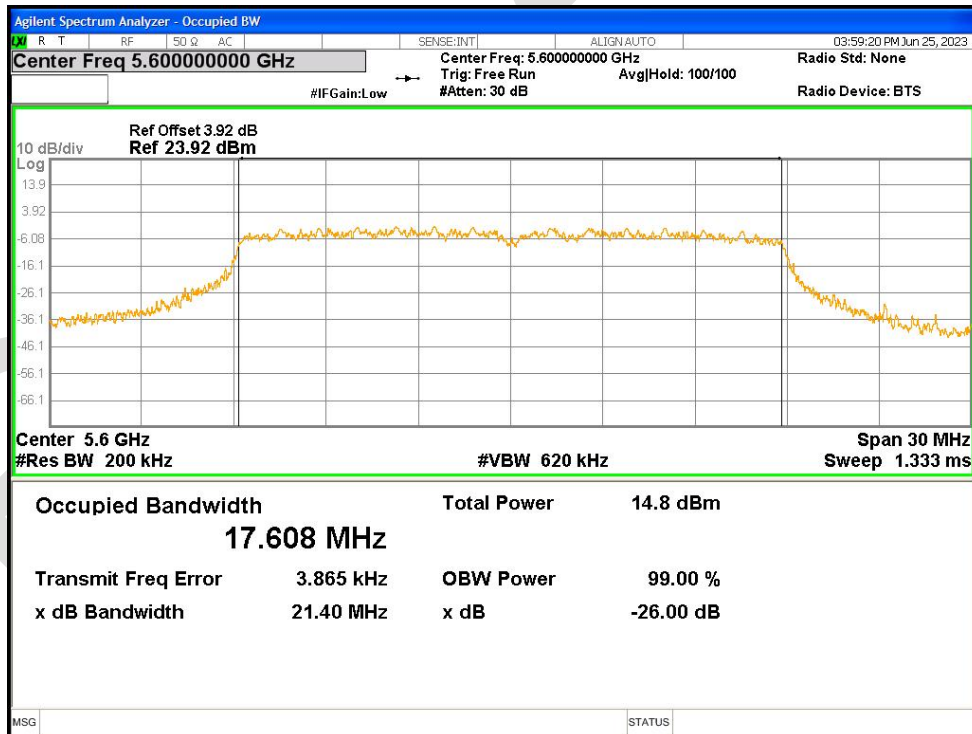


OBW NVNT n20 5700MHz Ant1

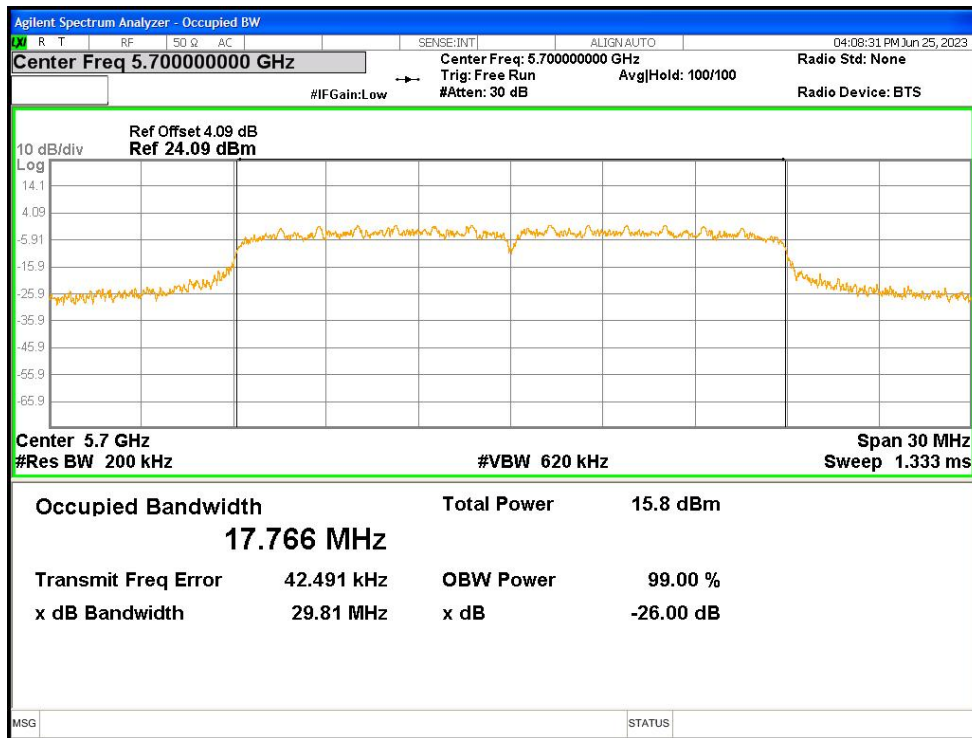


OBW NVNT n20 5700MHz Ant2

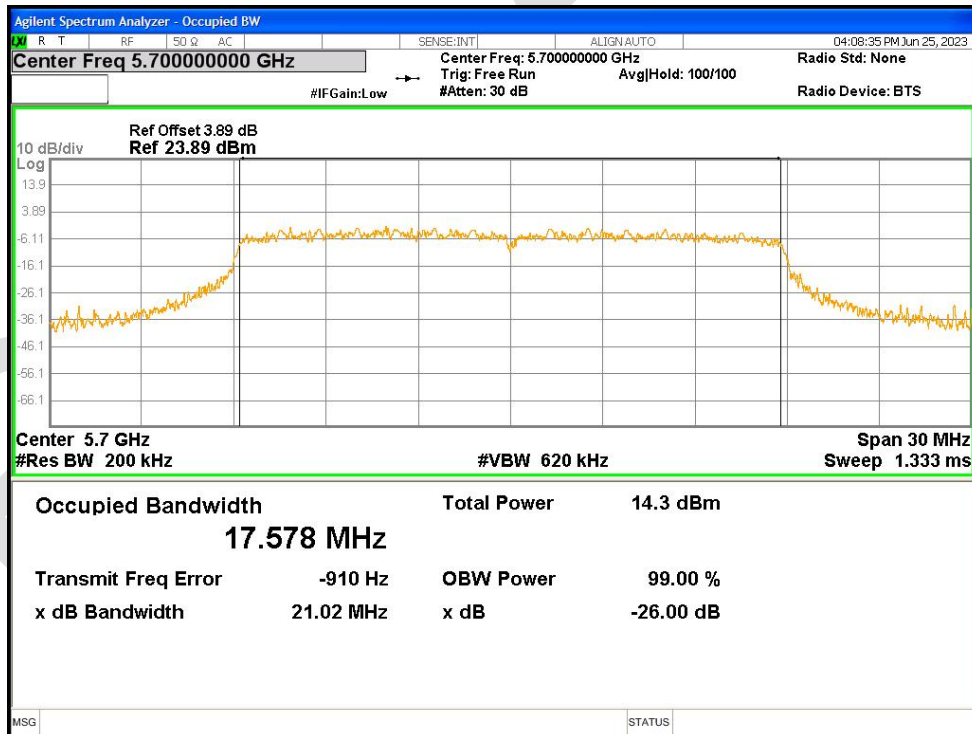


OBW NVNT n20 5745MHz Ant1

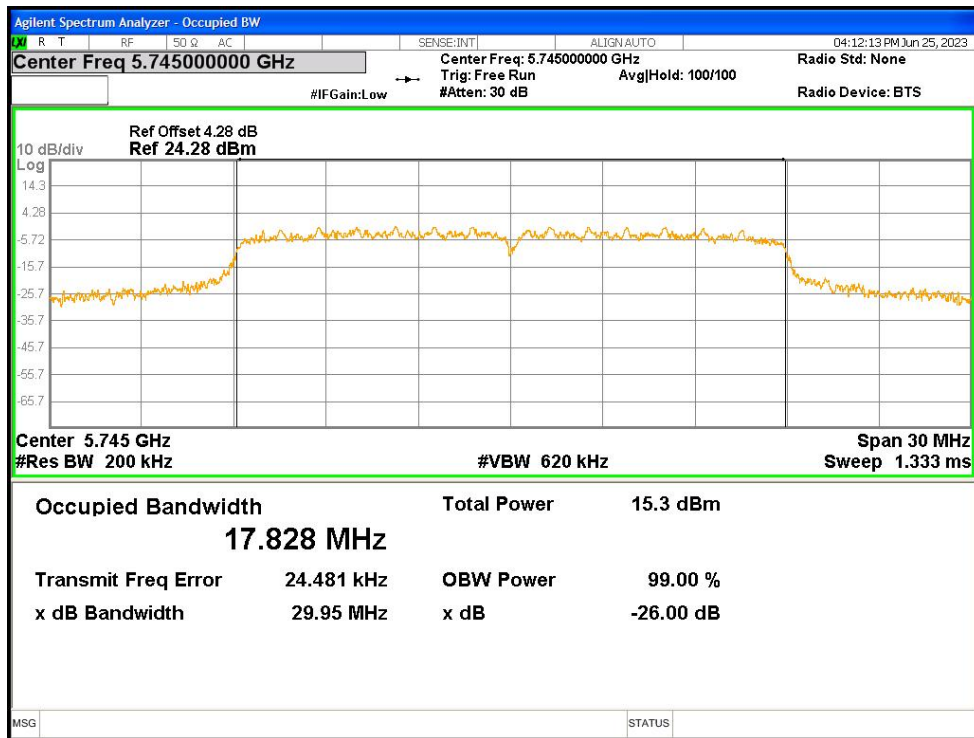


OBW NVNT n20 5745MHz Ant2

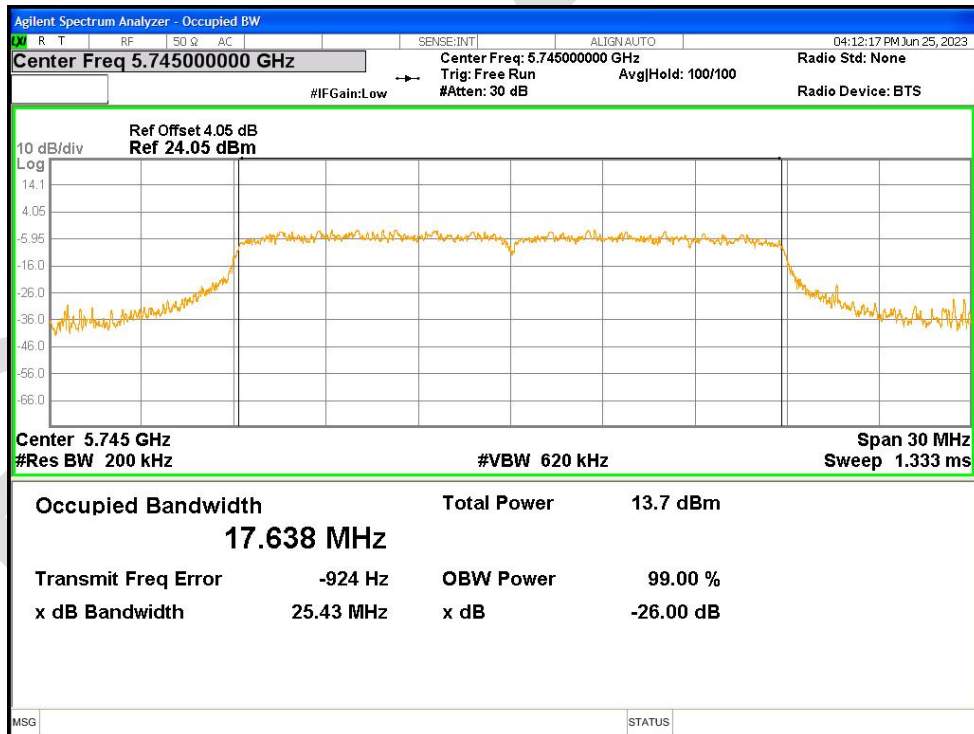


OBW NVNT n20 5785MHz Ant1

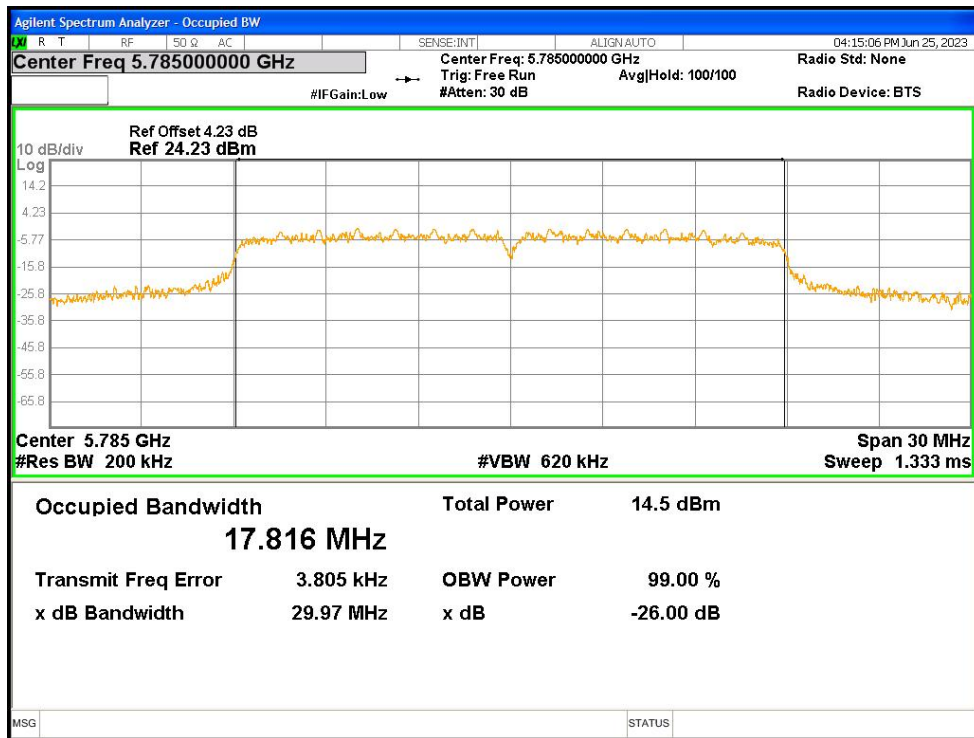


OBW NVNT n20 5785MHz Ant2

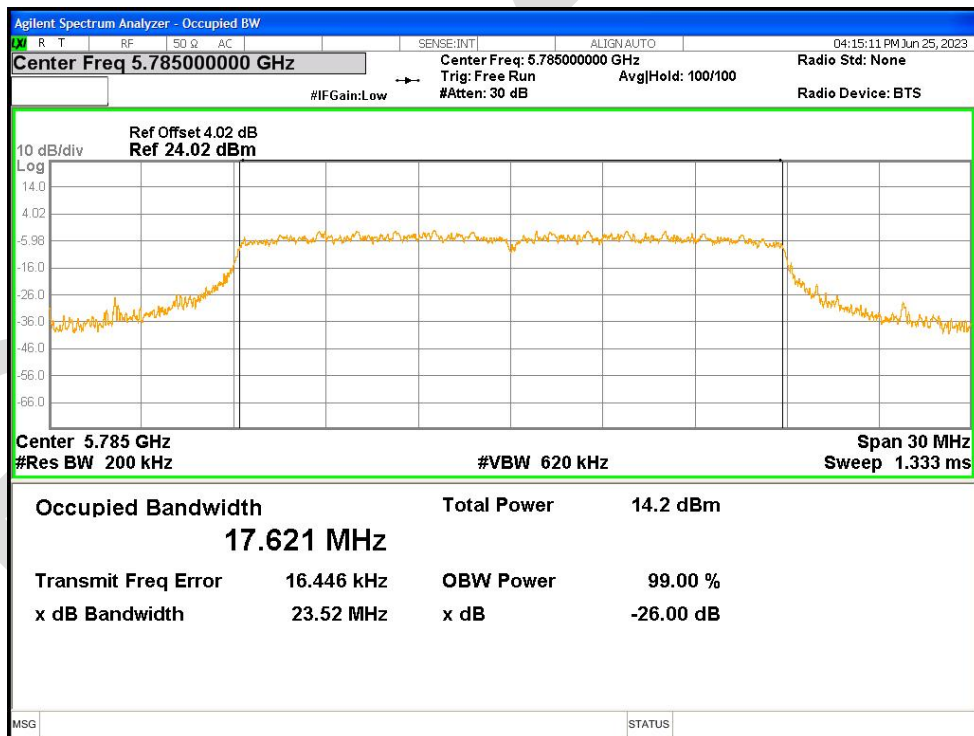


OBW NVNT n20 5825MHz Ant1

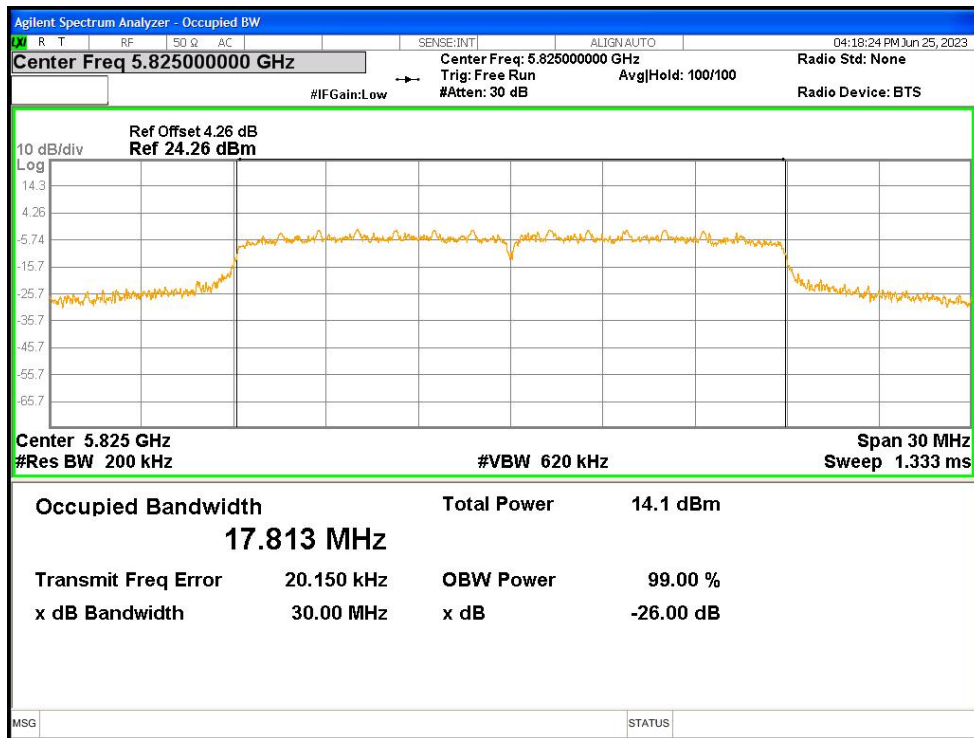


OBW NVNT n20 5825MHz Ant2

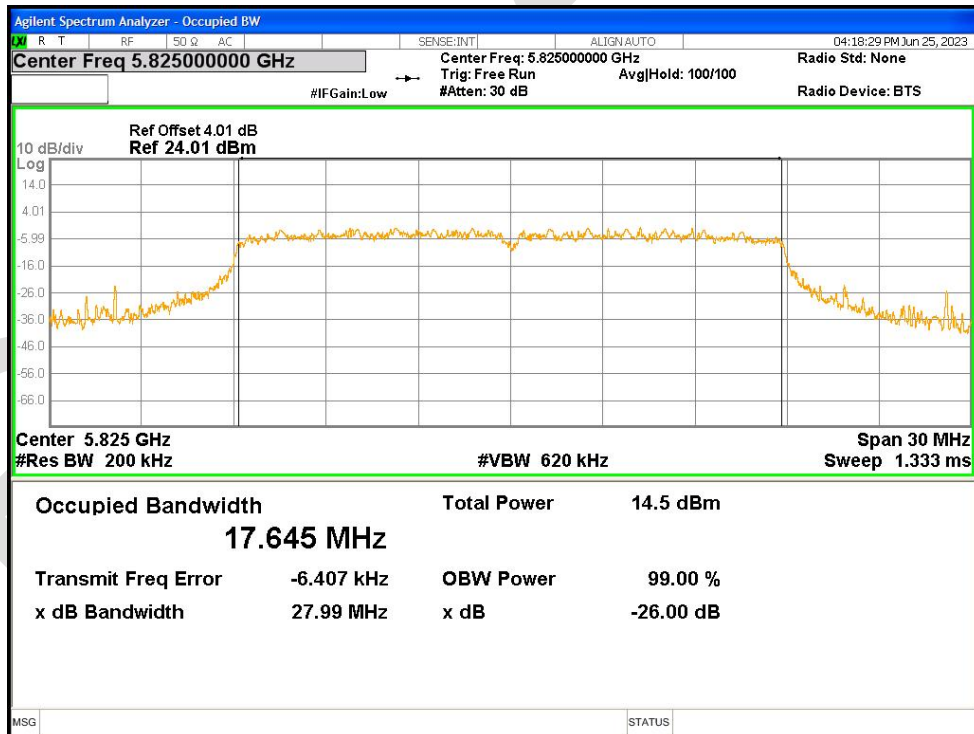


OBW NVNT n40 5190MHz Ant1

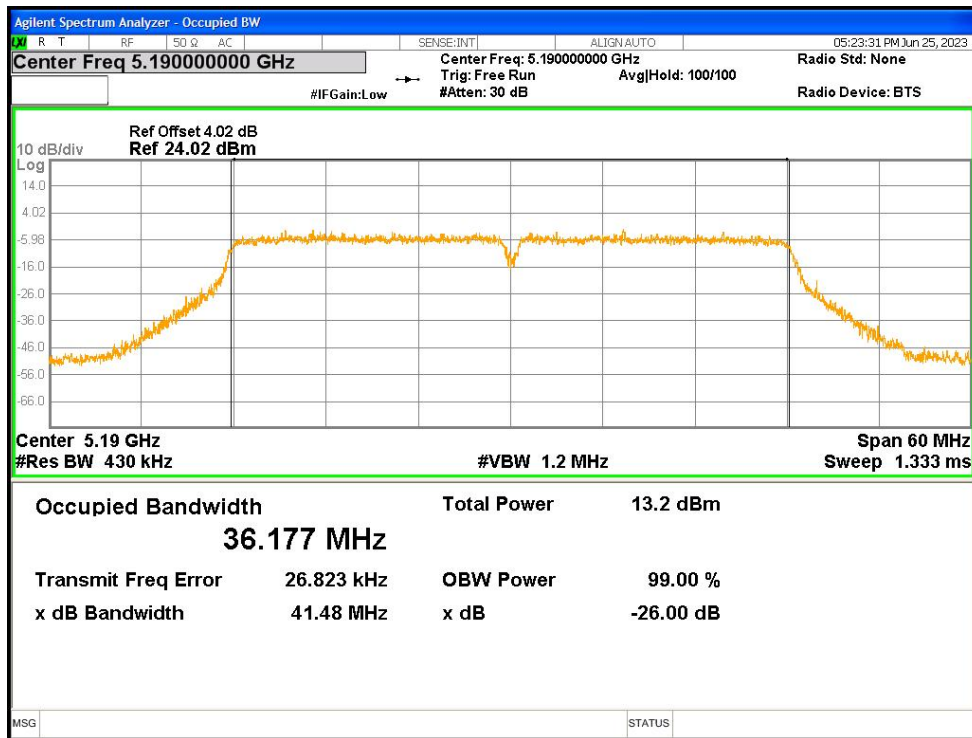


OBW NVNT n40 5190MHz Ant2

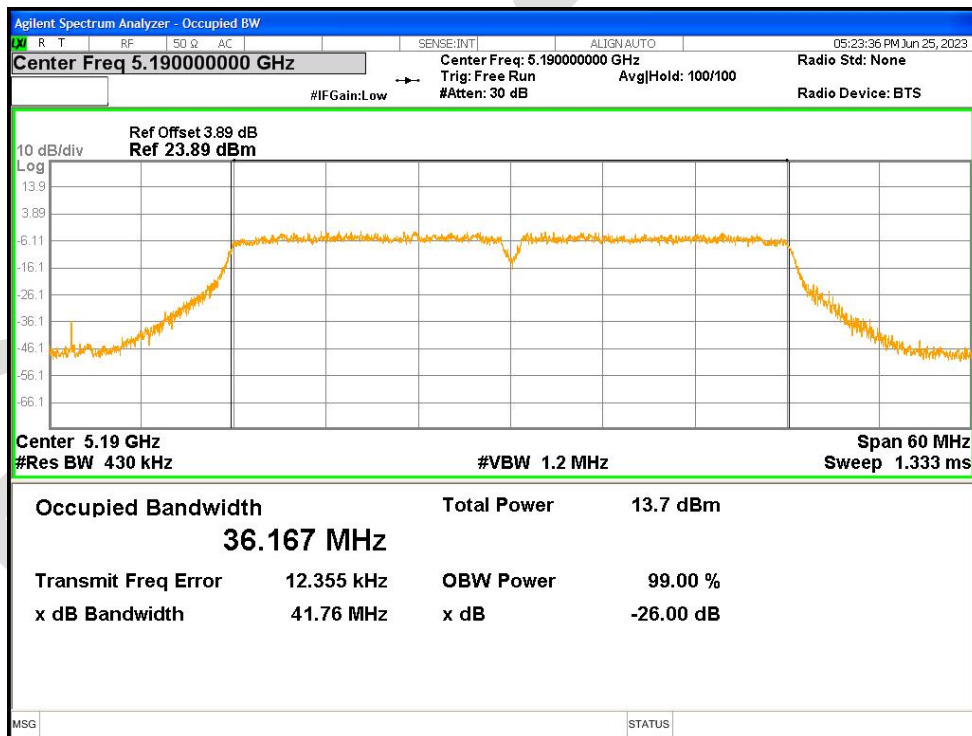


OBW NVNT n40 5230MHz Ant1

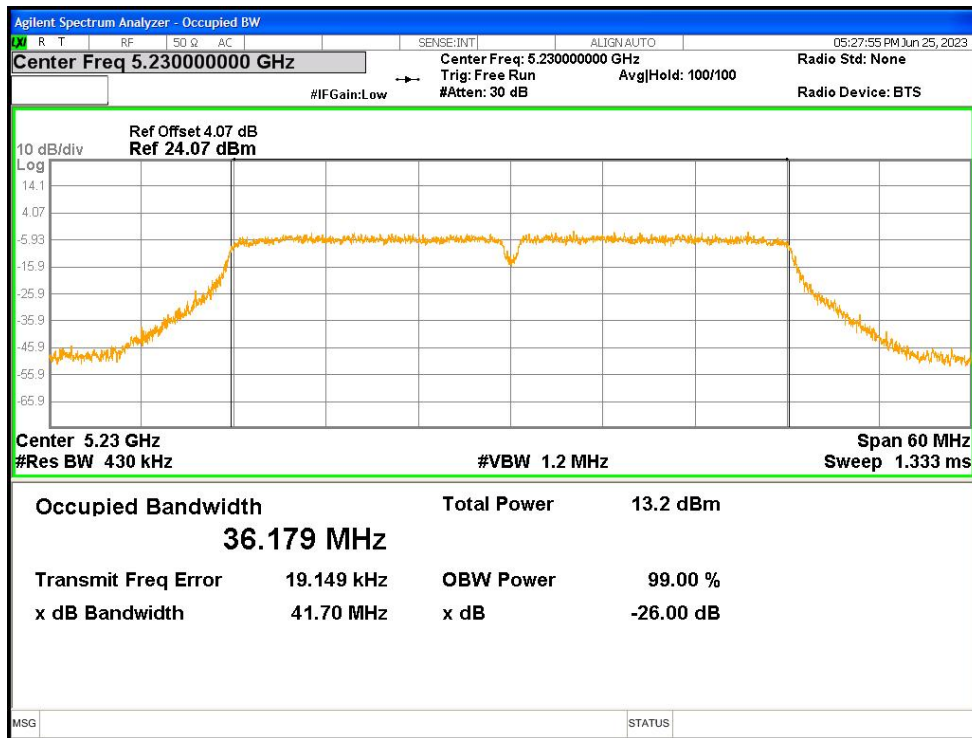


OBW NVNT n40 5230MHz Ant2

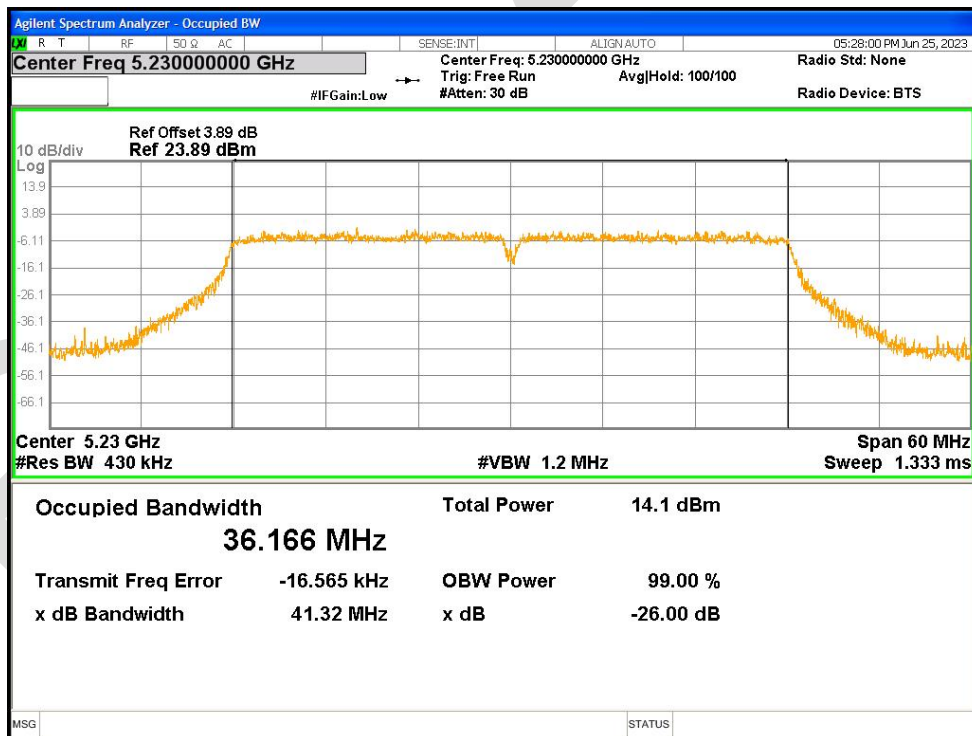


OBW NVNT n40 5270MHz Ant1

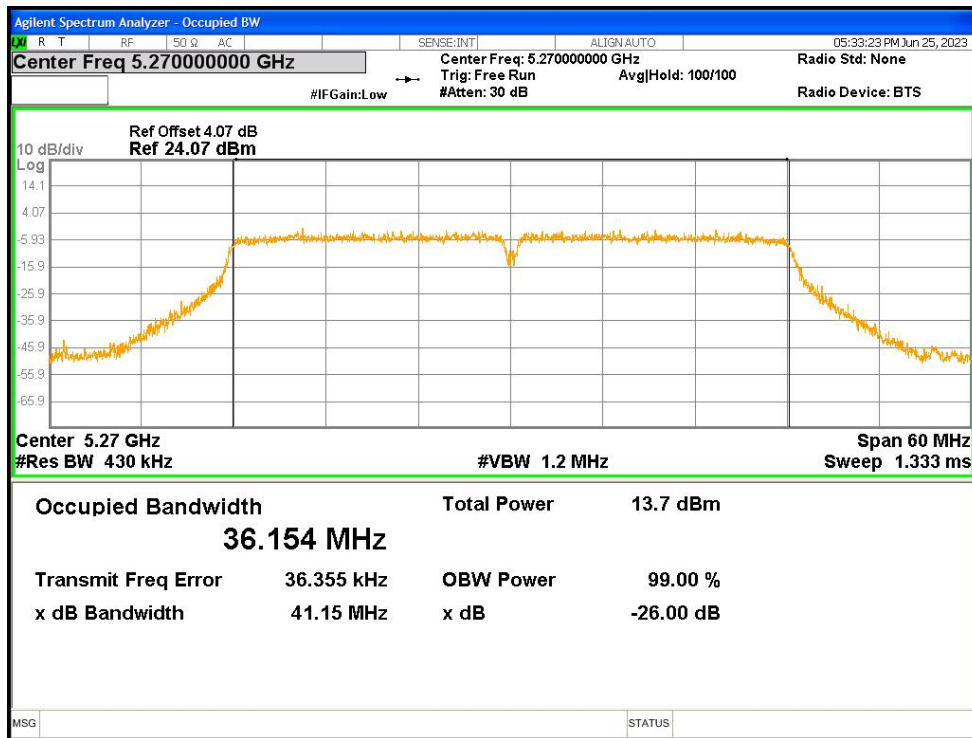


OBW NVNT n40 5270MHz Ant2

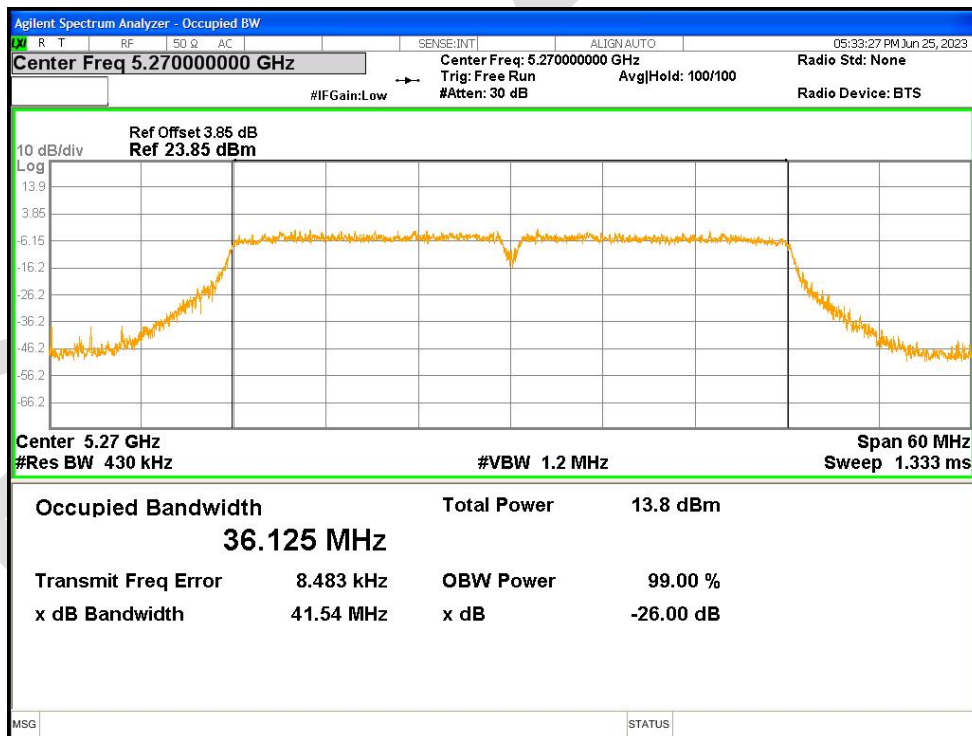


OBW NVNT n40 5310MHz Ant1

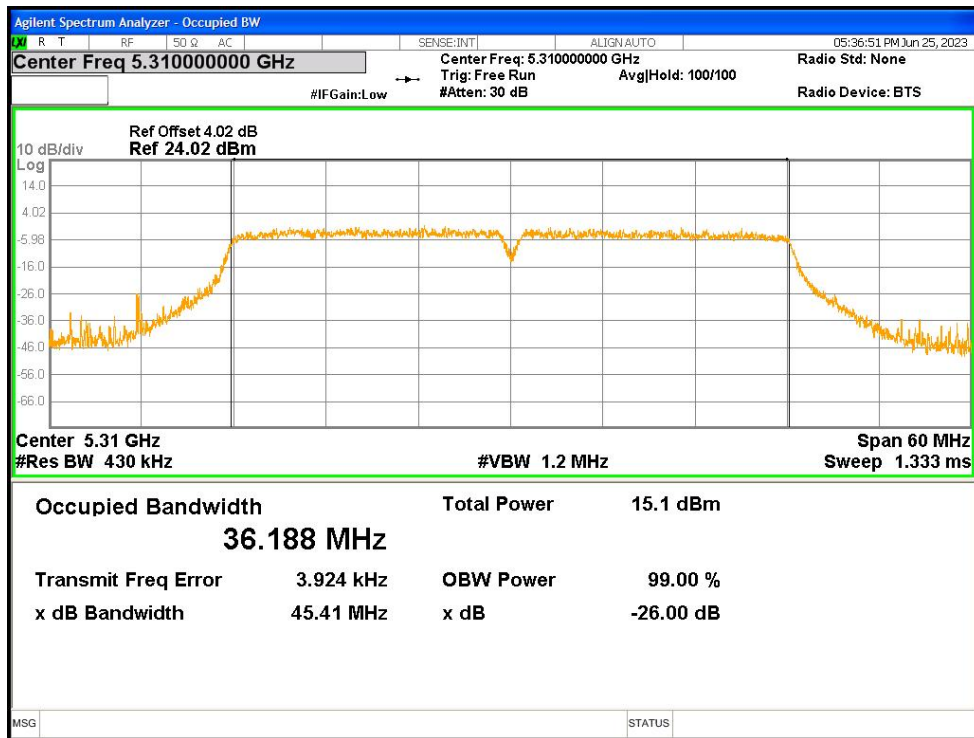


OBW NVNT n40 5310MHz Ant2

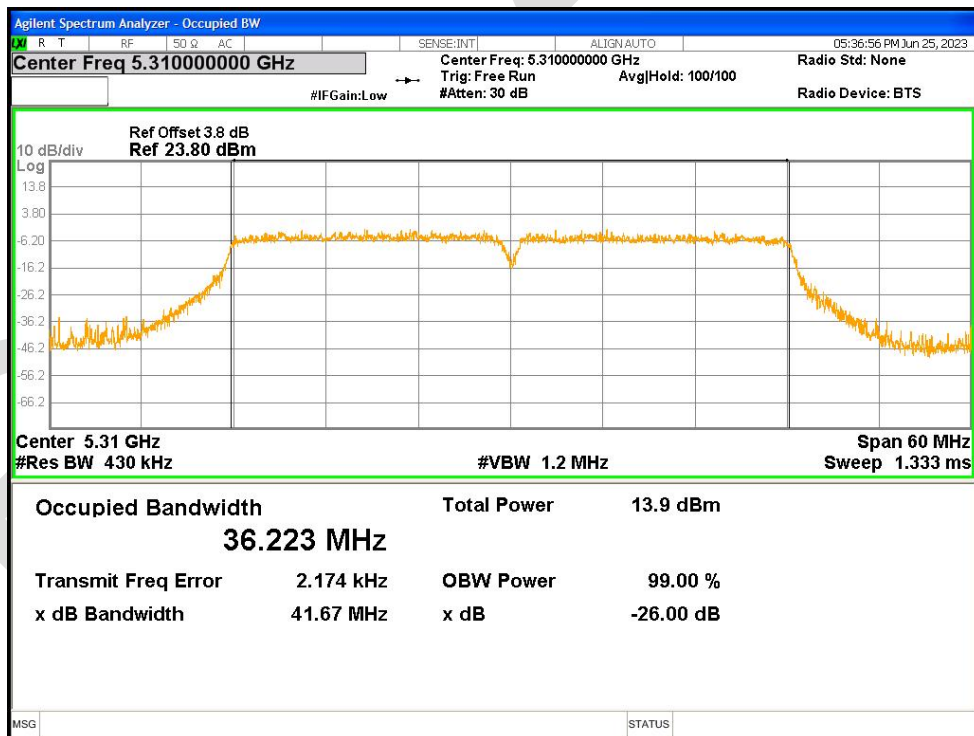


OBW NVNT n40 5510MHz Ant1

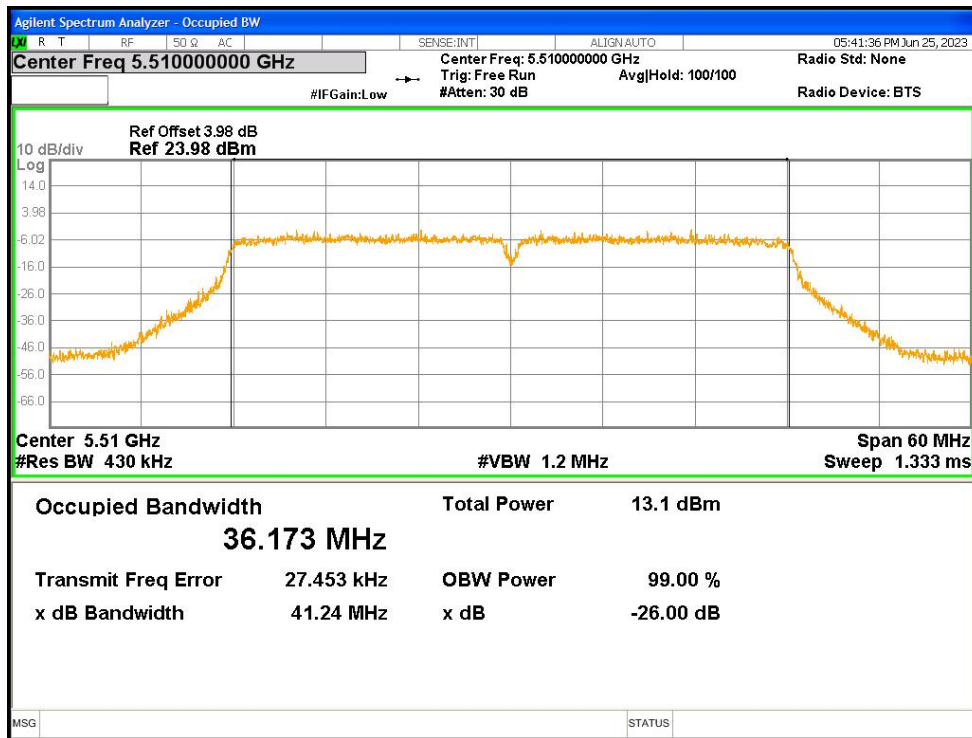


OBW NVNT n40 5510MHz Ant2

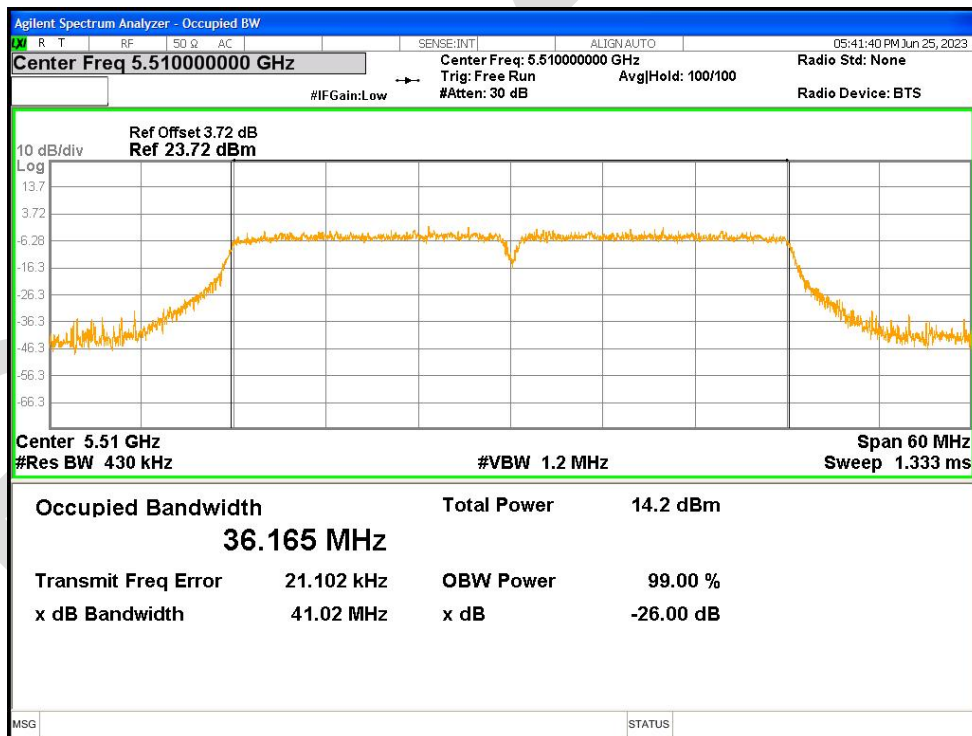


OBW NVNT n40 5570MHz Ant1

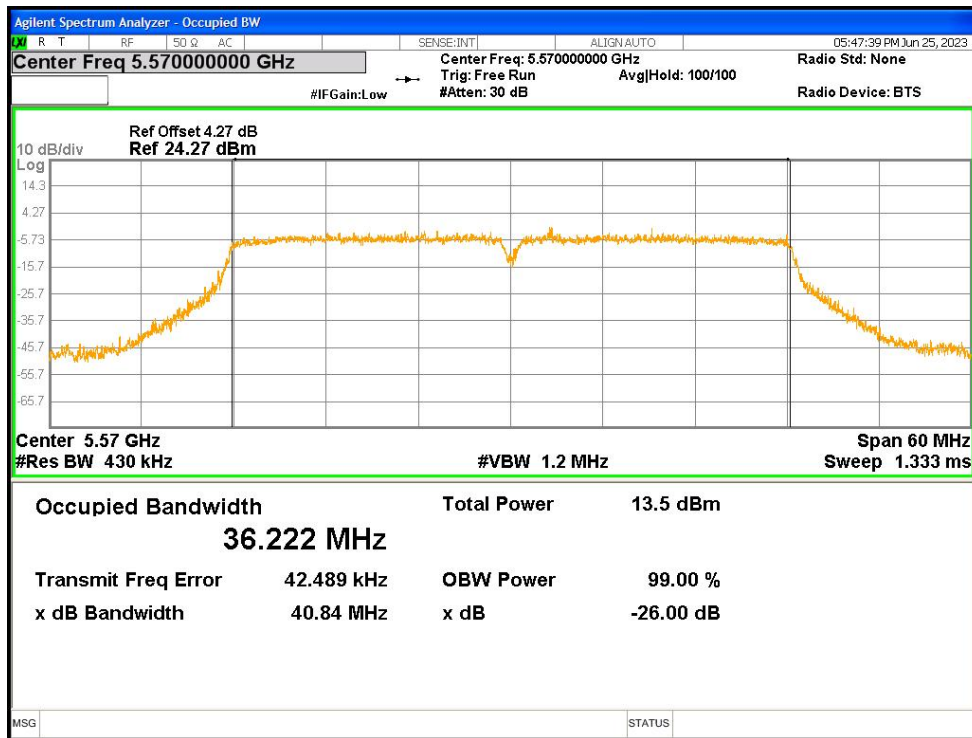


OBW NVNT n40 5570MHz Ant2

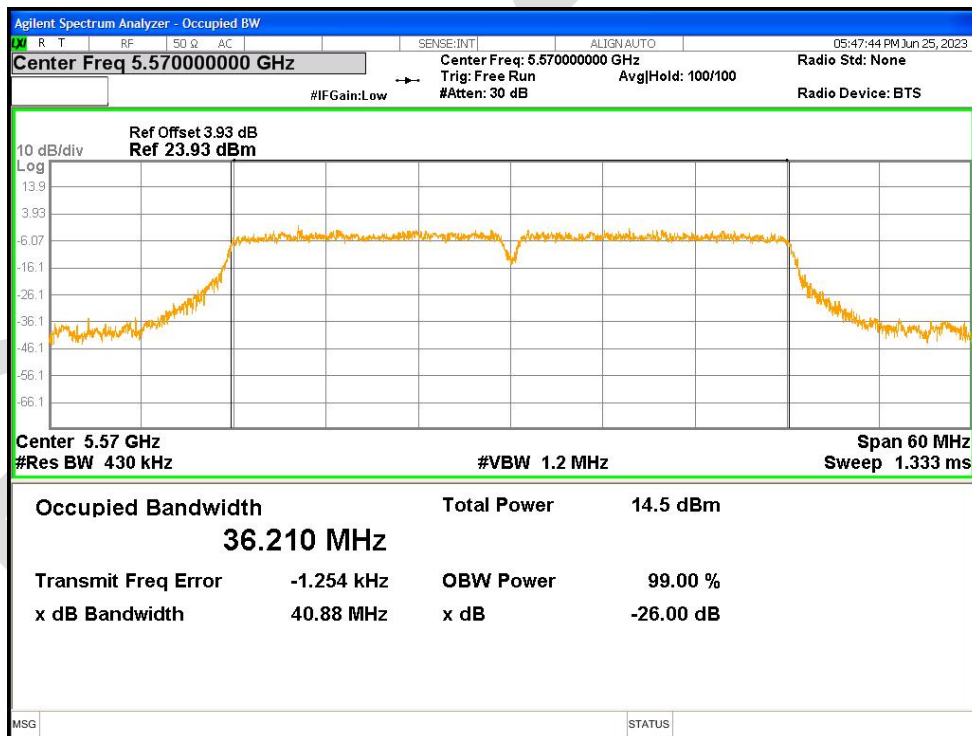


OBW NVNT n40 5670MHz Ant1

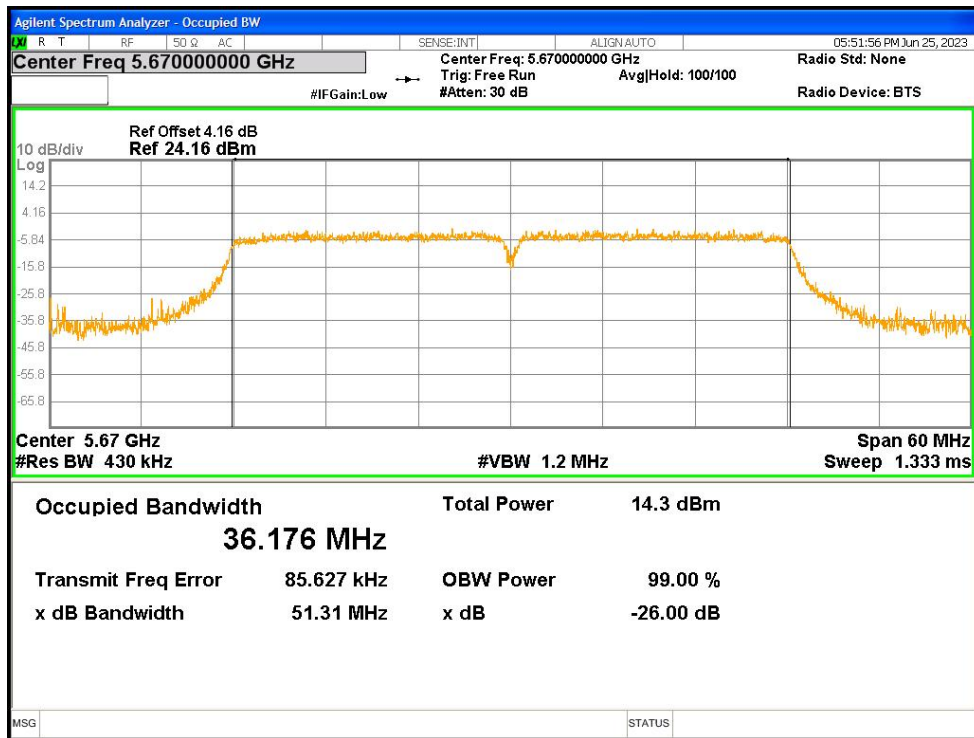


OBW NVNT n40 5670MHz Ant2

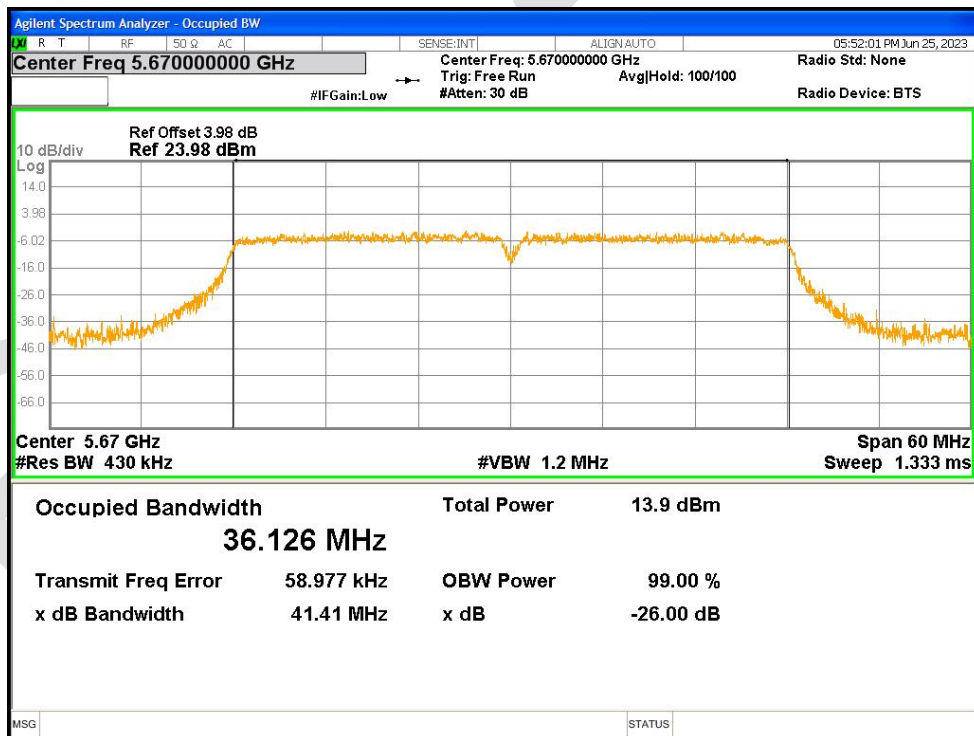


OBW NVNT n40 5755MHz Ant1

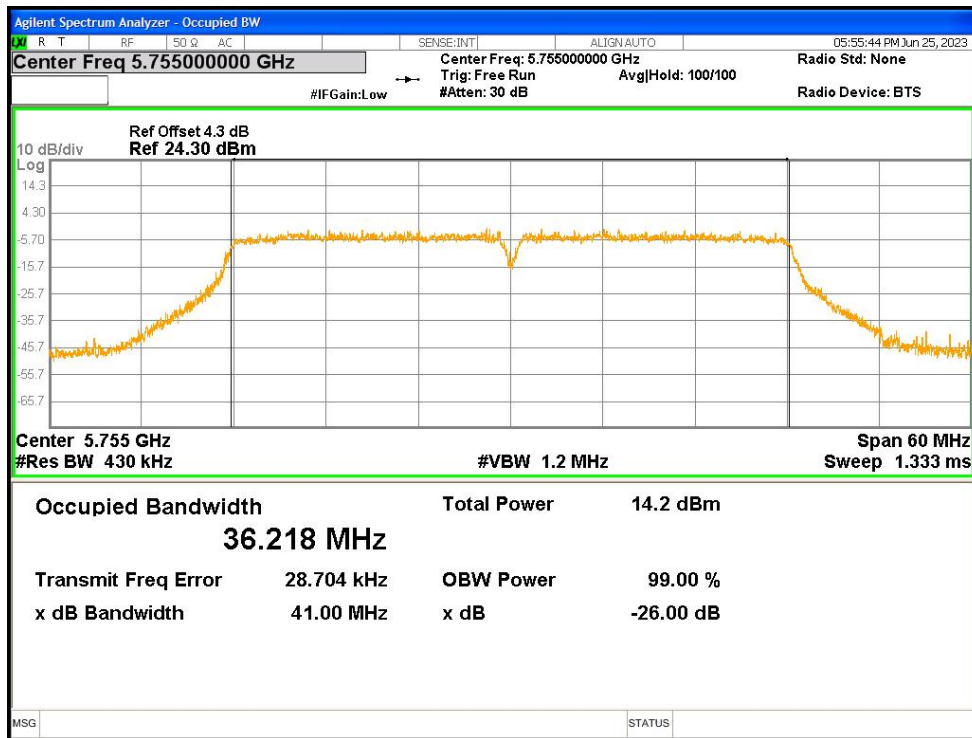


OBW NVNT n40 5755MHz Ant2

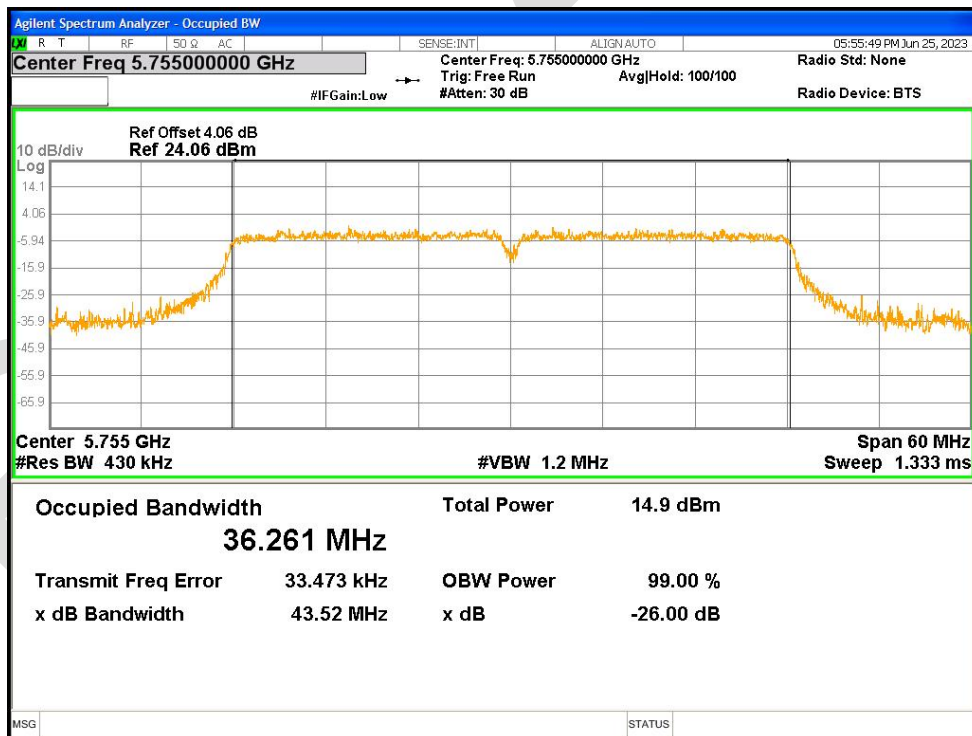

OBW NVNT n40 5795MHz Ant1

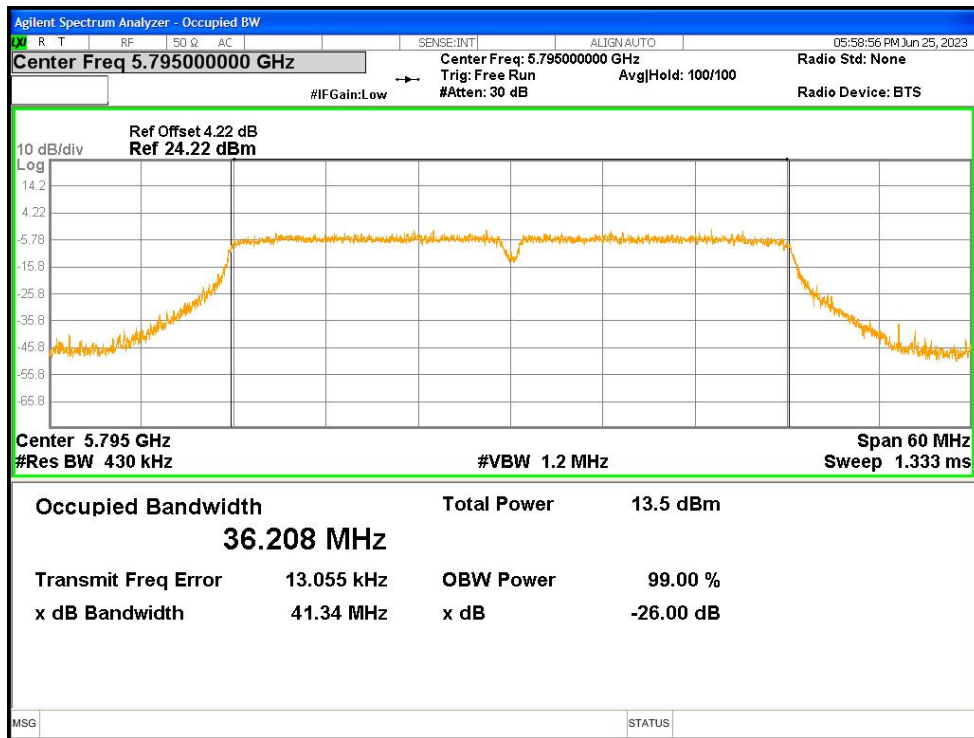

OBW NVNT n40 5795MHz Ant2

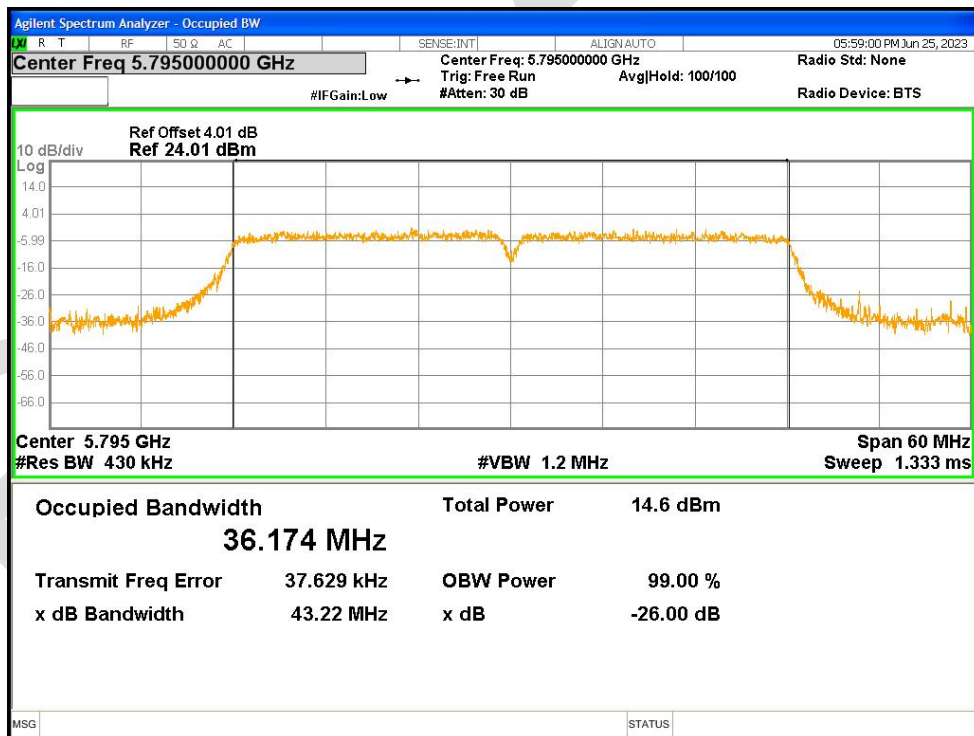

23.1.4 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Max PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	5.442	11	Pass
NVNT	a	5200	Ant1	5.515	11	Pass
NVNT	a	5240	Ant1	4.977	11	Pass
NVNT	a	5260	Ant1	4.864	11	Pass
NVNT	a	5280	Ant1	6	11	Pass
NVNT	a	5320	Ant1	6.529	11	Pass
NVNT	a	5500	Ant1	6.143	11	Pass
NVNT	a	5600	Ant1	5.697	11	Pass
NVNT	a	5700	Ant1	5.18	11	Pass
NVNT	a	5745	Ant1	2.59	30	Pass
NVNT	a	5785	Ant1	2.955	30	Pass
NVNT	a	5825	Ant1	2.108	30	Pass
NVNT	a	5180	Ant2	6.419	11	Pass
NVNT	a	5200	Ant2	5.154	11	Pass
NVNT	a	5240	Ant2	5.372	11	Pass
NVNT	a	5260	Ant2	5.695	11	Pass
NVNT	a	5280	Ant2	5.439	11	Pass
NVNT	a	5320	Ant2	4.947	11	Pass
NVNT	a	5500	Ant2	6.061	11	Pass
NVNT	a	5600	Ant2	7.132	11	Pass
NVNT	a	5700	Ant2	7.307	11	Pass
NVNT	a	5745	Ant2	2.524	30	Pass
NVNT	a	5785	Ant2	4.502	30	Pass
NVNT	a	5825	Ant2	3.624	30	Pass
NVNT	ac20	5180	Ant1	1.242	10.99	Pass
NVNT	ac20	5180	Ant2	1.342	10.99	Pass
NVNT	ac20	5180	Sum	4.303	10.99	Pass
NVNT	ac20	5200	Ant1	0.736	10.99	Pass
NVNT	ac20	5200	Ant2	1.933	10.99	Pass
NVNT	ac20	5200	Sum	4.386	10.99	Pass
NVNT	ac20	5240	Ant1	0.53	10.99	Pass
NVNT	ac20	5240	Ant2	2.152	10.99	Pass
NVNT	ac20	5240	Sum	4.427	10.99	Pass
NVNT	ac20	5260	Ant1	-0.118	10.99	Pass
NVNT	ac20	5260	Ant2	2.127	10.99	Pass
NVNT	ac20	5260	Sum	4.158	10.99	Pass
NVNT	ac20	5280	Ant1	-0.019	10.99	Pass
NVNT	ac20	5280	Ant2	2.115	10.99	Pass
NVNT	ac20	5280	Sum	4.188	10.99	Pass
NVNT	ac20	5320	Ant1	-1.215	10.99	Pass
NVNT	ac20	5320	Ant2	2.216	10.99	Pass
NVNT	ac20	5320	Sum	3.841	10.99	Pass

NVNT	ac20	5500	Ant1	-0.444	10.99	Pass
NVNT	ac20	5500	Ant2	1.802	10.99	Pass
NVNT	ac20	5500	Sum	3.833	10.99	Pass
NVNT	ac20	5600	Ant1	0.451	10.99	Pass
NVNT	ac20	5600	Ant2	2.628	10.99	Pass
NVNT	ac20	5600	Sum	4.685	10.99	Pass
NVNT	ac20	5700	Ant1	-1.554	10.99	Pass
NVNT	ac20	5700	Ant2	1.975	10.99	Pass
NVNT	ac20	5700	Sum	3.57	10.99	Pass
NVNT	ac20	5745	Ant1	-5.293	29.99	Pass
NVNT	ac20	5745	Ant2	0.237	29.99	Pass
NVNT	ac20	5745	Sum	1.309	29.99	Pass
NVNT	ac20	5785	Ant1	-4.126	29.99	Pass
NVNT	ac20	5785	Ant2	-0.457	29.99	Pass
NVNT	ac20	5785	Sum	1.095	29.99	Pass
NVNT	ac20	5825	Ant1	-4.612	29.99	Pass
NVNT	ac20	5825	Ant2	-0.147	29.99	Pass
NVNT	ac20	5825	Sum	1.181	29.99	Pass
NVNT	ac40	5190	Ant1	3.394	10.99	Pass
NVNT	ac40	5190	Ant2	-1.794	10.99	Pass
NVNT	ac40	5190	Sum	4.543	10.99	Pass
NVNT	ac40	5230	Ant1	-1.262	10.99	Pass
NVNT	ac40	5230	Ant2	-1.854	10.99	Pass
NVNT	ac40	5230	Sum	1.462	10.99	Pass
NVNT	ac40	5270	Ant1	-3.042	10.99	Pass
NVNT	ac40	5270	Ant2	-1.464	10.99	Pass
NVNT	ac40	5270	Sum	0.829	10.99	Pass
NVNT	ac40	5310	Ant1	-3.068	10.99	Pass
NVNT	ac40	5310	Ant2	-0.807	10.99	Pass
NVNT	ac40	5310	Sum	1.218	10.99	Pass
NVNT	ac40	5510	Ant1	-1.899	10.99	Pass
NVNT	ac40	5510	Ant2	-1.15	10.99	Pass
NVNT	ac40	5510	Sum	1.502	10.99	Pass
NVNT	ac40	5570	Ant1	-2.285	10.99	Pass
NVNT	ac40	5570	Ant2	-1.445	10.99	Pass
NVNT	ac40	5570	Sum	1.166	10.99	Pass
NVNT	ac40	5670	Ant1	-4.628	10.99	Pass
NVNT	ac40	5670	Ant2	-0.754	10.99	Pass
NVNT	ac40	5670	Sum	0.738	10.99	Pass
NVNT	ac40	5755	Ant1	-6.574	29.99	Pass
NVNT	ac40	5755	Ant2	-3.349	29.99	Pass
NVNT	ac40	5755	Sum	-1.658	29.99	Pass
NVNT	ac40	5795	Ant1	-7.271	29.99	Pass
NVNT	ac40	5795	Ant2	-4.327	29.99	Pass
NVNT	ac40	5795	Sum	-2.544	29.99	Pass
NVNT	ac80	5210	Ant1	-4.934	10.99	Pass
NVNT	ac80	5210	Ant2	-4.84	10.99	Pass

NVNT	ac80	5210	Sum	-1.876	10.99	Pass
NVNT	ac80	5290	Ant1	-6.234	10.99	Pass
NVNT	ac80	5290	Ant2	-3.967	10.99	Pass
NVNT	ac80	5290	Sum	-1.944	10.99	Pass
NVNT	ac80	5530	Ant1	-6.84	10.99	Pass
NVNT	ac80	5530	Ant2	-5.318	10.99	Pass
NVNT	ac80	5530	Sum	-3.002	10.99	Pass
NVNT	ac80	5610	Ant1	-7.218	10.99	Pass
NVNT	ac80	5610	Ant2	-4.483	10.99	Pass
NVNT	ac80	5610	Sum	-2.628	10.99	Pass
NVNT	ac80	5775	Ant1	-10.842	29.99	Pass
NVNT	ac80	5775	Ant2	-7.363	29.99	Pass
NVNT	ac80	5775	Sum	-5.753	29.99	Pass
NVNT	n20	5180	Ant1	1.943	10.99	Pass
NVNT	n20	5180	Ant2	3.082	10.99	Pass
NVNT	n20	5180	Sum	5.56	10.99	Pass
NVNT	n20	5200	Ant1	3.082	10.99	Pass
NVNT	n20	5200	Ant2	2.989	10.99	Pass
NVNT	n20	5200	Sum	6.046	10.99	Pass
NVNT	n20	5240	Ant1	2.877	10.99	Pass
NVNT	n20	5240	Ant2	2.018	10.99	Pass
NVNT	n20	5240	Sum	5.479	10.99	Pass
NVNT	n20	5260	Ant1	2.649	10.99	Pass
NVNT	n20	5260	Ant2	2.2	10.99	Pass
NVNT	n20	5260	Sum	5.441	10.99	Pass
NVNT	n20	5280	Ant1	1.456	10.99	Pass
NVNT	n20	5280	Ant2	1.776	10.99	Pass
NVNT	n20	5280	Sum	4.629	10.99	Pass
NVNT	n20	5320	Ant1	2.329	10.99	Pass
NVNT	n20	5320	Ant2	1.977	10.99	Pass
NVNT	n20	5320	Sum	5.167	10.99	Pass
NVNT	n20	5500	Ant1	2.618	10.99	Pass
NVNT	n20	5500	Ant2	3.476	10.99	Pass
NVNT	n20	5500	Sum	6.078	10.99	Pass
NVNT	n20	5600	Ant1	1.778	10.99	Pass
NVNT	n20	5600	Ant2	3.048	10.99	Pass
NVNT	n20	5600	Sum	5.47	10.99	Pass
NVNT	n20	5700	Ant1	2.933	10.99	Pass
NVNT	n20	5700	Ant2	1.778	10.99	Pass
NVNT	n20	5700	Sum	5.404	10.99	Pass
NVNT	n20	5745	Ant1	-0.673	29.99	Pass
NVNT	n20	5745	Ant2	-1.616	29.99	Pass
NVNT	n20	5745	Sum	1.891	29.99	Pass
NVNT	n20	5785	Ant1	-2.013	29.99	Pass
NVNT	n20	5785	Ant2	-0.408	29.99	Pass
NVNT	n20	5785	Sum	1.874	29.99	Pass
NVNT	n20	5825	Ant1	-2.606	29.99	Pass

NVNT	n20	5825	Ant2	-0.003	29.99	Pass
NVNT	n20	5825	Sum	1.898	29.99	Pass
NVNT	n40	5190	Ant1	-0.069	10.99	Pass
NVNT	n40	5190	Ant2	-0.078	10.99	Pass
NVNT	n40	5190	Sum	2.937	10.99	Pass
NVNT	n40	5230	Ant1	-0.472	10.99	Pass
NVNT	n40	5230	Ant2	-0.584	10.99	Pass
NVNT	n40	5230	Sum	2.483	10.99	Pass
NVNT	n40	5270	Ant1	-0.48	10.99	Pass
NVNT	n40	5270	Ant2	-0.732	10.99	Pass
NVNT	n40	5270	Sum	2.406	10.99	Pass
NVNT	n40	5310	Ant1	-0.447	10.99	Pass
NVNT	n40	5310	Ant2	-1.831	10.99	Pass
NVNT	n40	5310	Sum	1.926	10.99	Pass
NVNT	n40	5510	Ant1	-2.2	10.99	Pass
NVNT	n40	5510	Ant2	-0.246	10.99	Pass
NVNT	n40	5510	Sum	1.896	10.99	Pass
NVNT	n40	5570	Ant1	-1.551	10.99	Pass
NVNT	n40	5570	Ant2	-0.244	10.99	Pass
NVNT	n40	5570	Sum	2.162	10.99	Pass
NVNT	n40	5670	Ant1	-0.622	10.99	Pass
NVNT	n40	5670	Ant2	0.309	10.99	Pass
NVNT	n40	5670	Sum	2.879	10.99	Pass
NVNT	n40	5755	Ant1	-4.985	29.99	Pass
NVNT	n40	5755	Ant2	-4.237	29.99	Pass
NVNT	n40	5755	Sum	-1.585	29.99	Pass
NVNT	n40	5795	Ant1	-4.545	29.99	Pass
NVNT	n40	5795	Ant2	-3.423	29.99	Pass
NVNT	n40	5795	Sum	-0.938	29.99	Pass