

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com



Test Report

Product Name: UHF TRANSCEIVER

FREQUENCY RANGE: 430 - 470 MHz

FCC ID: IV9FNCU-M45

Applicant:

**KANEMATSU USA INC.
543 WEST ALGONQUIN ROAD
ARLINGTON HEIGHTS ILLINOIS 60005
USA**

Date Receipt: AUGUST 9, 2004

Date Tested: AUGUST 20, 2004

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

COVER SHEET

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TABLE OF CONTENTS LIST

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

TEST REPORT:

PAGE 1.....	GENERAL INFORMATION & TECHNICAL DESCRIPTION
PAGE 2.....	TECHNICAL DESCRIPTION CONTINUED
	RF POWER OUTPUT
PAGE 3.....	MODULATION CHARACTERISTICS
	AUDIO FREQUENCY RESPONSE
PAGE 4.....	MODULATION LIMITING PLOT
PAGE 5.....	AUDIO LOW PASS FILTER
PAGE 6-7.....	OCCUPIED BANDWIDTH
PAGE 8.....	SPURIOUS EMISSIONS AT ANTENNA TERMINALS
PAGE 9.....	METHOD OF MEASURING SPURIOUS EMISSIONS AT
	ANTENNA TERMINALS
PAGE 10-12.....	FIELD STRENGTH OF SPURIOUS EMISSIONS
PAGE 13.....	METHOD OF MEASURING RADIATED SPURIOUS EMISSIONS
PAGE 14.....	FREQUENCY STABILITY
PAGE 15-16.....	TRANSIENT FREQUENCY STABILITY
PAGE 17-18.....	TRANSIENT FREQUENCY RESPONSE PLOTS
PAGE 19-22.....	EQUIPMENT LIST

EXHIBITS CONTAINING:

BLOCK DIAGRAM
SCHEMATIC
PARTS LIST
USERS MANUAL
LABEL SAMPLE
LABEL LOCATION
EXTERNAL PHOTOGRAPHS
INTERNAL PHOTOGRAPHS
ALIGNMENT PROCEDURE
OPERATIONAL DESCRIPTION
TEST SET UP PHOTOGRAPH

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

GENERAL INFORMATION REQUIRED FOR TYPE ACCEPTANCE

2.1033(c)(1)(2) KANEMATSU USA INC. will manufacture the
FCCID: IV9FNCU-M45 VHF TRANSCEIVER in
quantity, for use under FCC RULES PART 90.

KANEMATSU USA INC.
543 WEST ALGONQUIN ROAD
ARLINGTON HEIGHTS, ILLINOIS 60005

2.1033(c) TECHNICAL DESCRIPTION

2.1033(c)(3) Instruction book. A draft copy of the instruction
manual is included in the exhibits.

2.1033(c)(4) Type of Emission: 10K8F3E
90.209
 $B_n = 2M + 2DK$
 $M = 3000$
 $D = 2440$
 $B_n = 2(3000) + 2(2440) = 10.88k$

90.217 (b) Authorized Bandwidth 12.5 kHz

2.1033(c)(5) Frequency Range: 430 - 470 MHz
90.209

2.1033(c)(6)(7) Power Output shall not exceed 59 Watts into a 50 ohm
90.205 resistive load. There are no user power controls.

2.1033(c)(8) DC Voltages and Current into Final Amplifier:
POWER INPUT:

FINAL AMPLIFIER ONLY

INPUT POWER - HIGH: $(13.6V)(7.15A) = 97.24 W$
INPUT POWER - LOW: $(13.6V)(2.14A) = 29.10 W$

2.1033(c)(9) Tune-up procedure. The tune-up procedure is included
in the exhibits.

2.1033(c)(10) Complete Circuit Diagrams: The circuit diagram and
block diagram are included in the exhibits.

(11) Function of each electron tube or semiconductor
device or other active circuit device are included in
the exhibits.

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45


Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

- (12) Description of all circuitry and devices provided for determining and stabilizing frequency is included in the circuit description in the instruction manual.
- 2.1033(c)(13) A photograph or drawing of the equipment identification label is shown in the exhibits.
- 2.1033(c)(14) Photographs of the equipment of sufficient clarity to reveal equipment construction and layout and label location are shown in the exhibits.
- 2.1033(c)(15) Digital Modulation is not allowed
- 2.1033(c)(16) The data required for 2.1046 through 2.1057 is submitted below.
- 2.1046(a) **RF POWER OUTPUT**
RF power is measured by connecting a 50-ohm, resistive wattmeter to the RF output connector. With a nominal battery voltage of 13.6 VDC, and the transmitter properly adjusted the RF output measures:

OUTPUT POWER: HIGH - 45 Watts
 LOW - 5 Watts

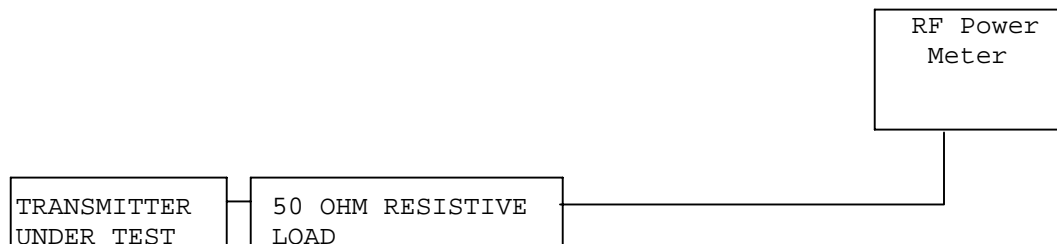

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com


2.1047(a)(b)

Modulation characteristics:

AUDIO FREQUENCY RESPONSE

The audio frequency response was measured in accordance with TIA/EIA Specification 603. The audio frequency response curve is shown below. The audio signal was fed into a dummy microphone circuit and into the microphone connector. The input required to produce 30 percent modulation level was measured.

1263AUT4 Audio Frequency Response

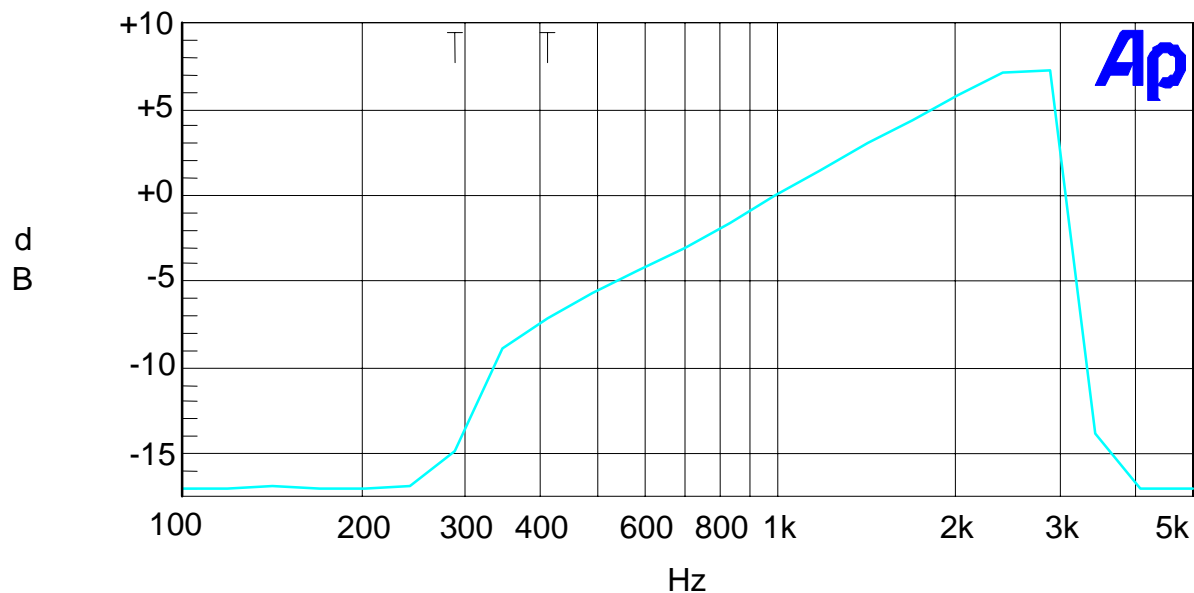

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com


2.1047(b)

Audio input versus modulation

The audio input level needed for a particular percentage of modulation was measured in accordance with TIA/EIA Specification 603. The audio input curves versus modulation are shown below. Curves are provided for audio input frequencies of 300, 1000, and 3000 Hz.

1263AUT4 Modulation Limiting

2.5k blue, 1k green, 300hz yellow

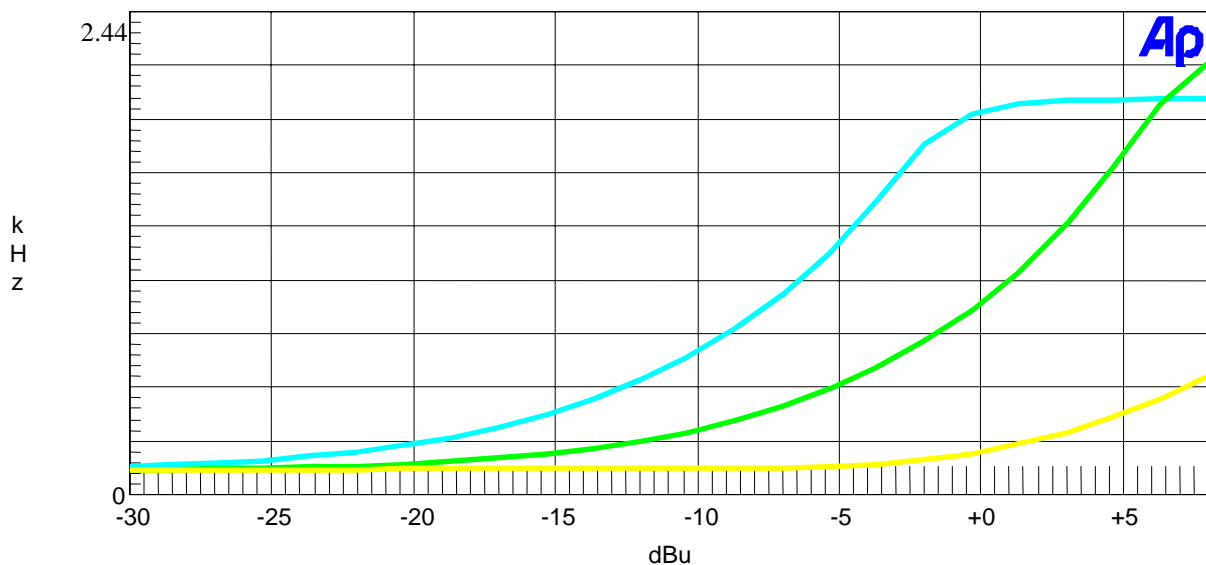

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669


<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Post Limiter Filter

The filter must be between the modulation limiter and the modulated stage. At any frequency between 3 & 20 kHz the filter must have an attenuation of $60\log(f/3)$ greater than the attenuation at 1KHz. See the plot below.

AUDIO LOW PASS FILTER

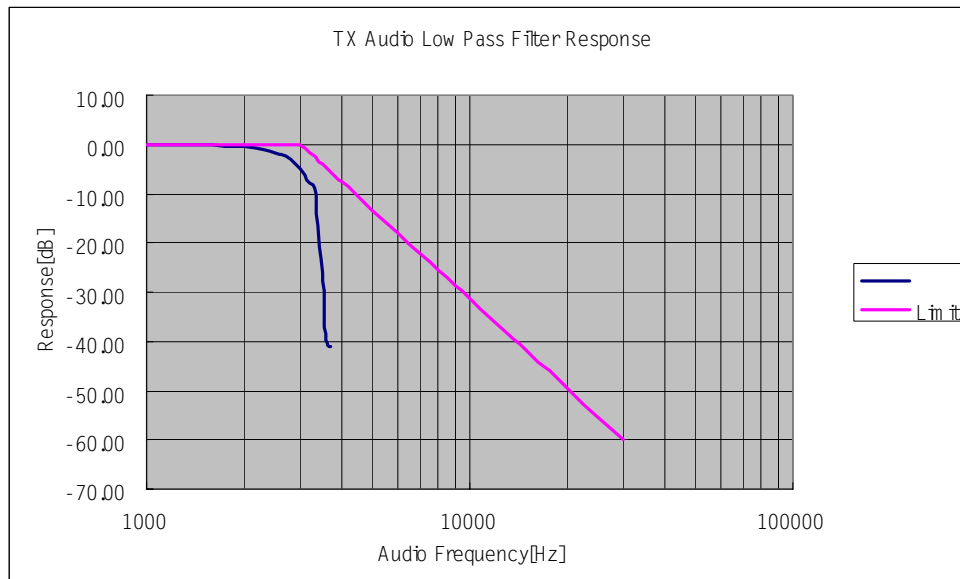

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1049 Occupied bandwidth: 90.210(d)

Emission Mask D - 12.5 kHz channel bandwidth equipment.
For transmitters designed to operate with a 12.5 kHz channel bandwidth, any emission must be attenuated below the power (P) of the highest emission contained within the authorized bandwidth as follows:


- (1) On any frequency from the center of the authorized bandwidth f_0 to 5.625 kHz removed from f_0 : Zero dB.
- (2) On any frequency from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 5.625 kHz but no more than 12.5 kHz: At least $7.27 (f_d - 2.88 \text{ kHz})$ dB.
- (3) On any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 12.5 kHz: At least $50 + 10\log(P)$ dB or 70 dB, whichever is the lesser attenuation.

Radiotelephone Transmitter with Modulation Limiter

Test procedure: TIA/EIA-603 para 2.2.11, with the exception that various tones were used.

Test procedure diagram

OCCUPIED BANDWIDTH MEASUREMENT

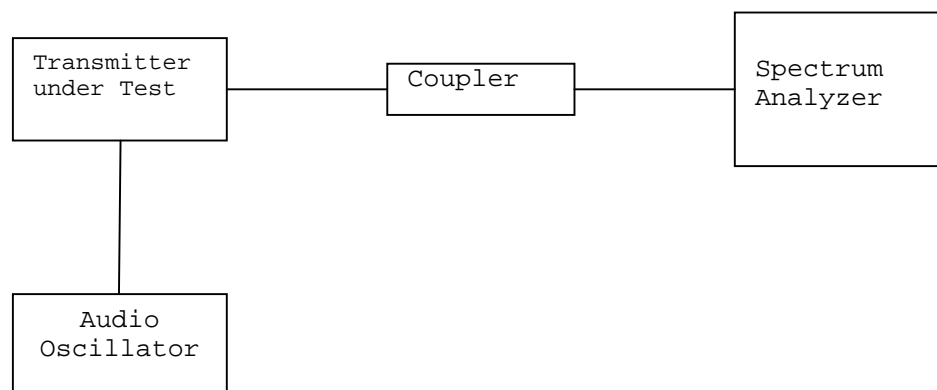

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com


OCCUPIED BANDWIDTH PLOT

NOTES:

KANEMATSU USA INC.

OCCUPIED BANDWIDTH PLOT

FCC 90.210 Mask D

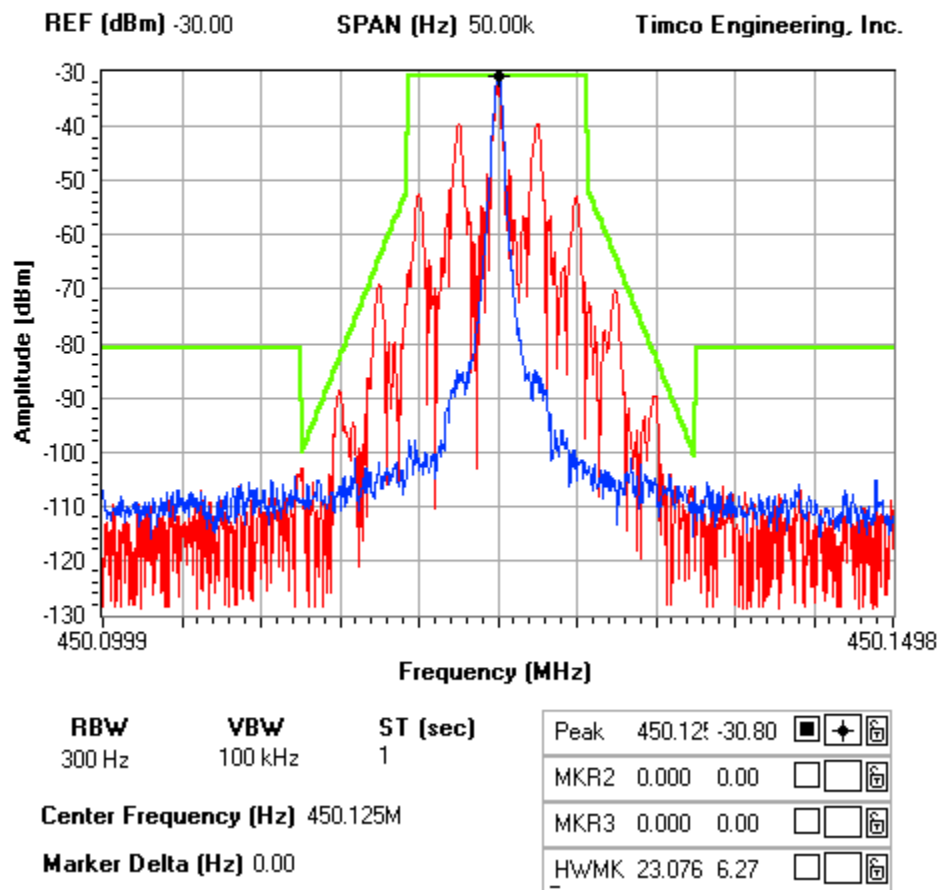

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1051

Spurious emissions at antenna terminals (conducted):

Data below shows the level of conducted spurious responses. The carrier was modulated 100% using a 2500 Hz tone. The spectrum was scanned from 0.4 to at least the 10th harmonic of the fundamental. The measurements were made in accordance with standard TIA/EIA-603.

REQUIREMENTS:

Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

HIGH: $43 + 10\log(45) = 59.53$

LOW : $43 + 10\log(5) = 50.00$

TF LOW POWER	EF	dB below carrier	TF HIGH POWER	EF	dB below carrier
430.13	430.13	0.0	430.13	430.13	0.0
	860.26	100.2		860.26	106.6
	1290.39	80.8		1290.39	93.7
	1720.52	91.0		1720.52	106.8
	2150.65	91.2		2150.65	98.2
	2580.78	101.7		2580.78	108.5
	3010.91	86.9		3010.91	94.1
	3441.04	97.5		3441.04	102.4
	3871.14	98.7		3871.14	79.9
	4301.30	101.0		4301.30	108.3
TF LOW POWER	EF	dB below carrier	TF HIGH POWER	EF	dB below carrier
450.13	450.13	0.0	450.13	450.13	0.0
	900.26	96.6		900.26	105.6
	1350.39	84.3		1350.39	88.2
	1800.52	90.9		1800.52	100.5
	2250.65	96.1		2250.65	97.7
	2700.78	99.8		2700.78	100.1
	3150.91	99.4		3150.91	102.3
	3601.04	90.6		3601.04	91.0
	4051.17	94.3		4051.17	89.3
	4501.30	100.4		4501.30	104.4
TF LOW POWER	EF	dB below carrier	TF HIGH POWER	EF	dB below carrier
469.9	469.9	0.0	469.9	469.9	0.0
	939.8	100.2		939.8	132.3
	1409.7	84.9		1409.7	90.4
	1879.6	91.9		1879.6	96.8
	2346.5	99.9		2346.5	102.5
	2819.4	99.8		2819.4	97.9
	3289.3	96.6		3289.3	89.1
	3759.2	89.5		3759.2	91.2
	4229.1	98.6		4229.1	96.3
	4699.0	95.4		4699.0	89.3

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Method of Measuring Conducted Spurious Emissions

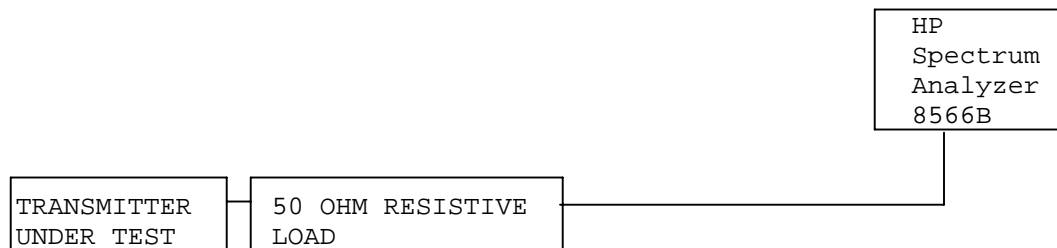

METHOD OF MEASUREMENT: The procedure used was TIA/EIA-603 STANDARD without any exceptions. An audio generator was connected to the UUT through a dummy microphone circuit and the output of the transmitter connected to a standard load and from the standard load through a pre-selector filter of the spectrum analyzer. The spectrum was scanned from 400 kHz to at least the tenth harmonic of the fundamental using a HP model 8566B spectrum analyzer. The measurements were made using the shielded room located at TIMCO ENGINEERING INC. 849 N.W. State Road 45, Newberry, Florida 32669.

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053

Field strength of spurious emissions:

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (430.13 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

HIGH: $43 + 10\log(45) = 59.53$

LOW : $43 + 10\log(5) = 50.00$

TEST DATA (HIGH):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
430.13	V	47.00	0	-0.45	0
860.26	H	-39.80	0	-0.87	87.22
1290.39	V	-39.10	1.06	4.11	82.6
1720.52	H	-45.80	1.14	5.08	88.41
2150.65	V	-47.10	1.23	5.73	89.15
2580.78	V	-47.20	1.31	6.91	88.15
3010.91	H	-49.30	1.35	7.26	89.94
3441.04	V	-43.50	1.39	7.51	83.93
3871.17	V	-50.40	1.44	7.55	90.84
4301.30	H	-54.90	1.48	8.03	94.9

TEST DATA (LOW):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
430.13	V	37.60	0	-0.45	0
860.26	H	-41.70	0	-0.87	79.72
1290.39	H	-41.90	1.06	4.11	76
1720.52	H	-40.20	1.14	5.08	73.41
2150.65	V	-49.30	1.23	5.73	81.95
2580.78	V	-53.70	1.31	6.91	85.25
3010.91	H	-56.70	1.35	7.26	87.94
3441.04	V	-47.60	1.39	7.51	78.63
3871.17	V	-50.80	1.44	7.55	81.84
4301.30	V	-54.70	1.48	8.03	85.3

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053

Field strength of spurious emissions:

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (450.13 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

HIGH: $43 + 10\log(45) = 59.53$

LOW : $43 + 10\log(5) = 50.00$

TEST DATA (HIGH):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
450.13	V	47.00	0	-0.45	0
900.26	H	-33.40	0	-0.55	80.5
1350.39	H	-40.80	1.07	4.35	84.07
1800.52	H	-48.30	1.16	5.13	90.88
2250.65	H	-51.80	1.25	6.05	93.55
2700.78	V	-51.70	1.32	7.01	92.56
3150.91	H	-50.60	1.37	7.34	91.18
3601.04	V	-48.30	1.41	7.55	88.71
4051.17	V	-47.50	1.46	7.63	87.88
4501.30	V	-54.10	1.5	8.25	93.9

TEST DATA (LOW):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
450.13	H	37.40	0	-0.45	0
900.26	H	-38.90	0	-0.55	76.4
1350.39	V	-42.00	1.07	4.35	75.67
1800.52	V	-42.70	1.16	5.13	75.68
2250.65	V	-45.40	1.25	6.05	77.55
2700.78	V	-57.40	1.32	7.01	88.66
3150.91	H	-57.10	1.37	7.34	88.08
3601.04	V	-60.00	1.41	7.55	90.81
4051.17	V	-55.60	1.46	7.63	86.38
4501.30	V	-58.50	1.5	8.25	88.7

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053

Field strength of spurious emissions:

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (469.90 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

HIGH: $43 + 10\log(45) = 59.53$

LOW : $43 + 10\log(5) = 50.00$

TEST DATA (HIGH):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
469.90	H	47.60	0	-1.09	0
939.80	V	-35.10	0	-1.03	82.64
1409.70	V	-41.60	1.08	4.59	84.6
1879.60	H	-28.40	1.18	5.18	70.91
2349.50	H	-47.20	1.27	6.37	88.61
2819.40	V	-47.00	1.33	7.11	87.73
3289.30	V	-42.10	1.38	7.42	82.57
3759.20	H	-56.90	1.43	7.55	97.29
4229.10	H	-47.20	1.47	7.92	87.26
4699.00	V	-45.00	1.54	8.11	84.94

TEST DATA (LOW):

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
469.90	H	38.20	0	-1.09	0
939.80	H	-32.60	0	-1.03	70.74
1409.70	V	-45.00	1.08	4.59	78.6
1879.60	V	-42.40	1.18	5.18	75.51
2349.50	H	-55.90	1.27	6.37	87.91
2819.40	V	-59.30	1.33	7.11	90.63
3289.30	H	-51.80	1.38	7.42	82.87
3759.20	V	-54.80	1.43	7.55	85.79
4229.10	H	-60.90	1.47	7.92	91.56
4699.00	H	-57.70	1.54	8.11	88.24

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Method of Measuring Radiated Spurious Emissions

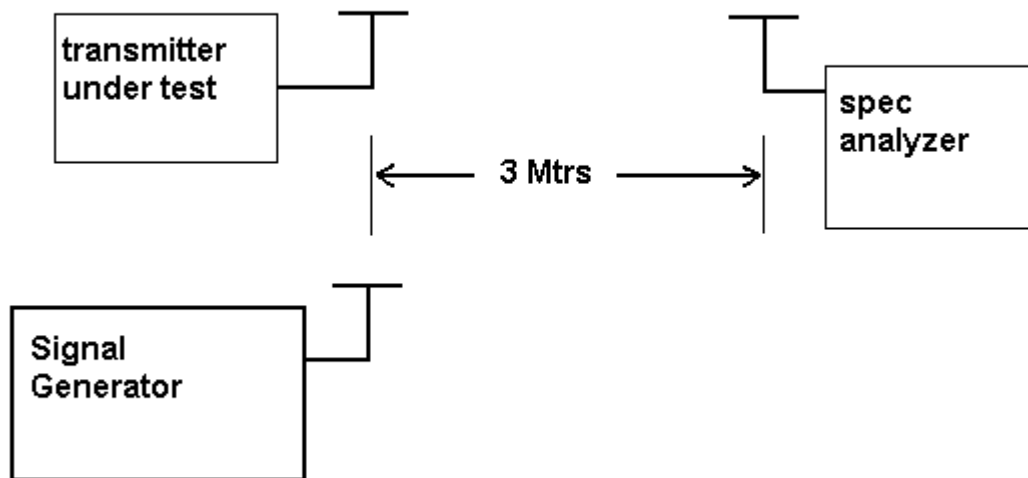

METHOD OF MEASUREMENTS: The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. This test was conducted per TIA/EIA STANDARD 603 using the substitution method. Measurements were made at the open field test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669.

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1055 Frequency stability:

90.213(a)(1)

Temperature and voltage tests were performed to verify that the frequency remains within the .0005%, 05-ppm specification limit. The EUT was placed in the temperature chamber at 25° C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15-second intervals. The worse case number was taken for temperature plotting. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -30° C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15-second intervals. The worst-case number was recorded for temperature plotting. This procedure was repeated in 10 degree increments up to + 50° C.

Readings were also taken at minus 15% of the battery voltage of 13.6 VDC, which we estimate to be the battery endpoint.

MEASUREMENT DATA:

Assigned Frequency (Ref. Frequency): 450.125 242 MHz

<u>TEMPERATURE °C</u>		<u>FREQUENCY MHz</u>	<u>PPM</u>
REFERENCE		450.125 242	00.00
-30		450.125 248	+ 0.01
-20		450.125 306	+ 0.14
-10		450.125 362	+ 0.27
0		450.125 284	+ 0.09
+10		450.125 287	+ 0.10
+20		450.125 242	0.00
+30		450.125 113	- 0.29
+40		450.124 966	- 0.61
+50		450.124 833	- 0.91
<u>BATT</u>		<u>%BATT. DATA</u>	<u>VOLTS</u>
<u>-15%</u>		450.125 232	11.56
			- 0.02

RESULTS OF MEASUREMENTS: The test results indicates that the EUT meets the requirements.

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1055(a)(1) Frequency stability:
90.214 Transient Frequency Behavior

REQUIREMENTS: Transmitters designed to operate in the 150-174 MHz and 421-512 MHz frequency bands must maintain transient frequencies within the maximum transient frequencies within the maximum frequency difference limits during the time intervals indicated:

Time Intervals	Maximum frequency difference	All Equipment	
		150-174 MHz	421-512 MHz

Transient Frequency Behavior for Equipment Designed to Operate on 25 kHz Channels

t_1^4	± 25.0 kHz	5.0 mS	10.0 mS
t_2	± 12.5 kHz	20.0 mS	25.0 mS
t_3^4	± 25.0 kHz	5.0 mS	10.0 mS

Transient Frequency Behavior for Equipment Designed to Operate on 12.5 kHz Channels

t_1^4	± 12.5 kHz	5.0 mS	10.0 mS
t_2	± 6.25 kHz	20.0 mS	25.0 mS
t_3^4	± 12.5 kHz	5.0 mS	10.0 mS

Transient Frequency Behavior for Equipment Designed to Operate on 6.25 kHz Channels

t_1^4	± 6.25 kHz	5.0 mS	10.0 mS
t_2	± 3.125 kHz	20.0 mS	25.0 mS
t_3^4	± 6.25 kHz	5.0 mS	10.0 mS

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45


Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TEST PROCEEDURE: TIA/EIA TS603 PARA 2.2.19, the levels were set as follows;

1. Using the variable attenuator the transmitter level was set to 40 dB below the test receivers maximum input level, then the transmitter was turned off.
2. With the transmitter off the signal generator was set 20dB below the level of the transmitter in the above step, this level will be maintained with the signal generator through-out the test.
3. Reduce the attenuation between the transmitter and the RF detector by 30 dB.
4. With the levels set as above the transient frequency behavior was observed & recorded.

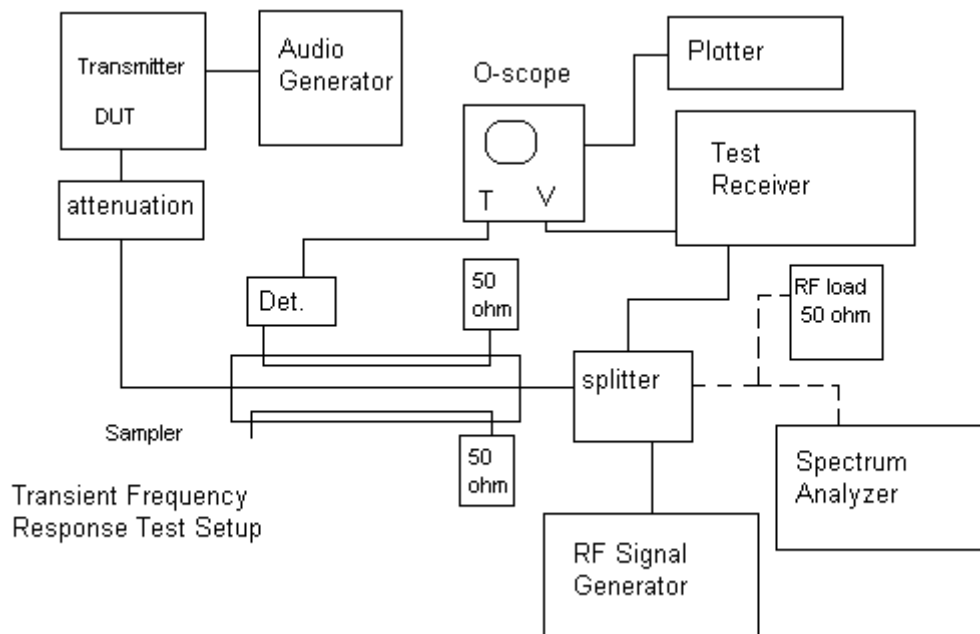

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.



849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TRANSIENT FREQUENCY RESPONSE 12.5 - HIGH POWER

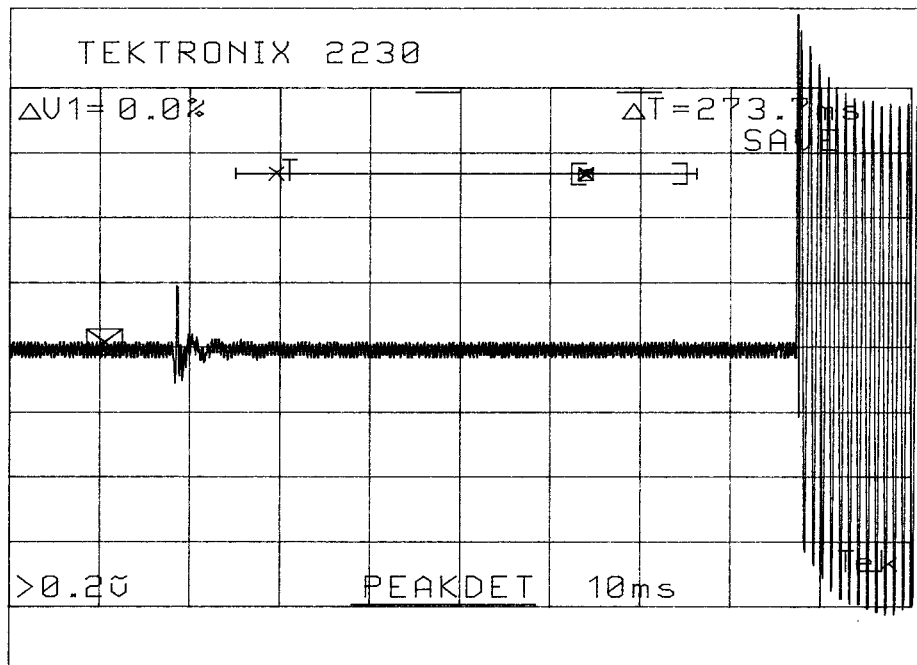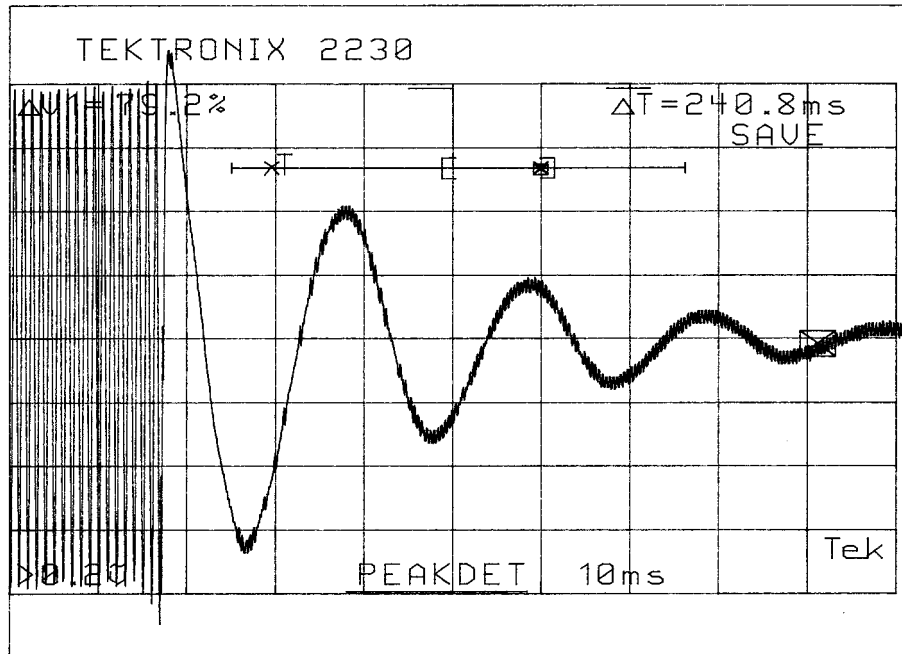

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.



849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TRANSIENT FREQUENCY RESPONSE 12.5 - LOW POWER

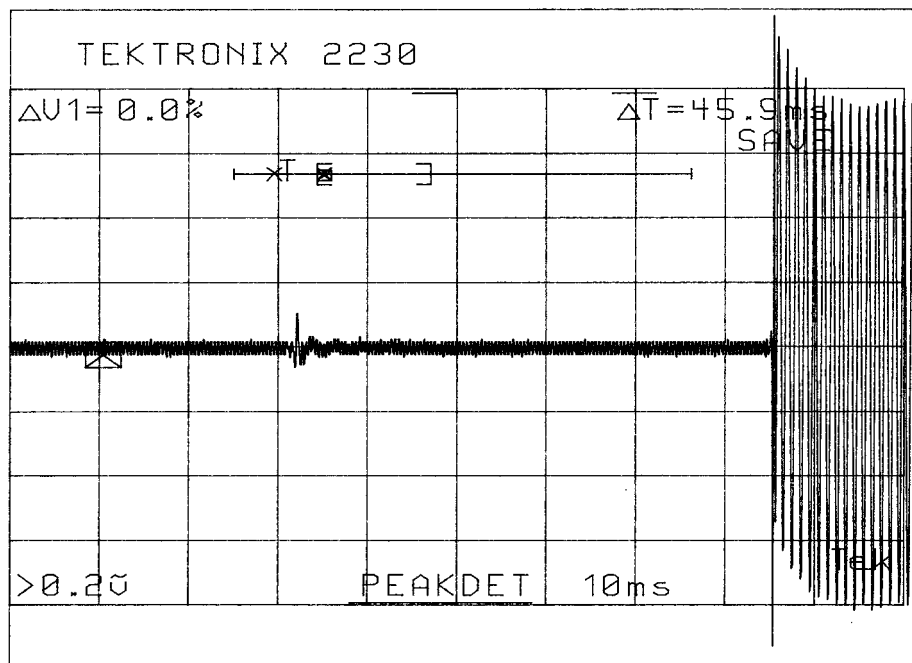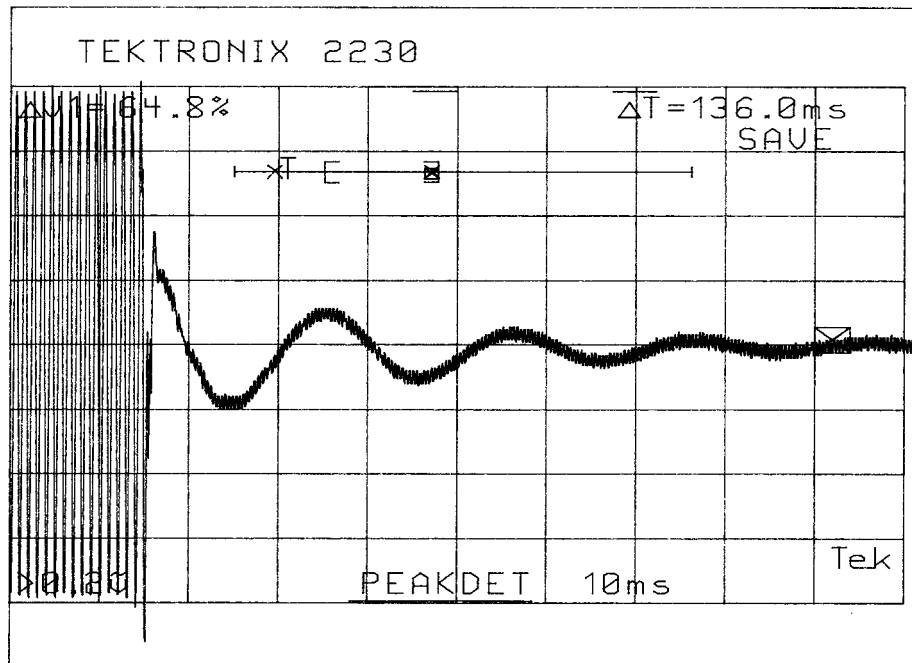

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

EMC Equipment List

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
X	3-Meter OATS	TEI	N/A	N/A	Listed 1/13/03	1/13/06
	3/10-Meter OATS	TEI	N/A	N/A	Listed 3/26/01	3/26/04
	Receiver, Beige Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 8/31/01	8/31/03
	RF Preselector	HP	85685A	3221A01400	CAL 8/31/01	8/31/03
	Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 8/31/01	8/31/03
X	Receiver, Blue Tower Spectrum Analyzer	HP	8568B	2928A04729	CAL	4/15/05
X				2848A18049	4/15/03	
X	RF Preselector	HP	85685A	2926A00983	CAL 4/15/03	4/15/05
X	Quasi-Peak Adapter	HP	85650A	2811A01279	CAL 4/15/03	4/15/05
	Receiver, Silver/Grey Tower Spectrum Analyzer	HP	8566B Opt 462	3552A22064 3638A08608	CAL 10/14/02	10/14/04
	RF Preselector	HP	85685A	2620A00294	CAL 10/14/02	10/14/04
	Quasi-Peak Adapter	HP	85650A	3303A01844	CAL 10/14/02	10/14/04
	Preamplifier	HP	8449B	3008A01075	CHAR 1/28/02	1/28/04
X	Biconnical Antenna	Electro-Metrics	BIA-25	1171	CAL 4/26/01	4/26/03
	Biconnical Antenna	Eaton	94455-1	1096	CAL 10/1/01	10/1/03
	Biconnical Antenna	Eaton	94455-1	1057	CAL 3/18/03	3/18/05
	BiconiLog Antenna	EMCO	3143	9409-1043		
X	Log-Periodic Antenna	Electro-Metrics	LPA-25	1122	CAL 10/2/01	10/2/03
	Log-Periodic Antenna	Electro-Metrics	EM-6950	632	CHAR 10/15/01	10/15/03
	Log-Periodic Antenna	Electro-Metrics	LPA-30	409	CAL 3/4/03	3/4/05

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/21/01	3/21/04
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	153	CAL 9/26/02	9/26/05
	Double-Ridged Horn Antenna	Electro-Metrics	RGA-180	2319	CAL 2/17/03	2/17/05
	Horn Antenna	Electro-Metrics	EM-6961	6246	CAL 3/31/03	3/31/05
	Horn Antenna	ATM	19-443-6R	None	No Cal Required	
	Passive Loop Antenna	EMC Test Systems	EMCO 6512	9706-1211	CHAR 7/10/01	7/10/03
	Line Impedance Stabilization . . .	Electro-Metrics	ANS-25/2	2604	CAL 10/9/01	10/9/03
	Line Impedance Stabilization . . .	Electro-Metrics	EM-7820	2682	CAL 3/12/03	3/12/05
	Termaline Wattmeter	Bird Electronic Corporation	611	16405	CAL 5/25/99	5/25/01
	Termaline Wattmeter	Bird Electronic Corporation	6104	1926	CHAR 12/12/01	12/12/03
	Oscilloscope	Tektronix	2230	300572	CHAR 2/1/01	2/1/03
	System One	Audio Precision	System One	SYS1-45868	CHAR 4/25/02	4/25/04
	Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 1/22/02	1/22/04
	AC Voltmeter	HP	400FL	2213A14499	CAL 10/9/01	10/9/03
	AC Voltmeter	HP	400FL	2213A14261	CHAR 10/15/01	10/15/03
	AC Voltmeter	HP	400FL	2213A14728	CHAR 10/15/01	10/15/03
X	Digital Multimeter	Fluke	77	35053830	CHAR 1/8/02	1/8/04
	Digital Multimeter	Fluke	77	43850817	CHAR 1/8/02	1/8/04
	Digital Multimeter	HP	E2377A	2927J05849	CHAR 1/8/02	1/8/04
	Multimeter	Fluke	FLUKE-77-3	79510405	CHAR 9/26/01	9/26/03
	Peak Power Meter	HP	8900C	2131A00545	CHAR 1/26/01	1/26/03
	Power Meter	HP	432A	1141A07655	CAL 4/15/03	4/15/05

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Power Meter And Sensor	Bird	4421-107 4022	0166 0218	CAL 4/16/03	4/16/05
	Power Sensor	HP	478A	72129	CAL 4/15/03	4/15/05
	Digital Thermometer	Fluke	2166A	42032	CAL 1/16/02	1/16/04
	Thermometer	Traulsen	SK-128		CHAR 1/22/02	1/22/04
	Thermometer	Extech	4028	14871-2	CAL 3/7/03	3/7/05
X	Hygro-Thermometer	Extech	445703	0602	CAL 10/4/02	10/4/04
	Frequency Counter	HP	5352B	2632A00165	CAL 11/28/01	11/28/03
	Frequency Counter	HP	5385A	2730A03025	CAL 3/7/03	3/7/05
	Power Sensor	Agilent Technologies	84811A	2551A02705	CHAR 1/26/01	1/26/03
	Service Monitor	IFR	FM/AM 500A	5182	CAL 11/22/00	11/22/02
	Comm. Serv. Monitor	IFR	FM/AM 1200S	6593	CAL 5/12/02	5/12/04
	Signal Generator	HP	8640B	2308A21464	CAL 2/15/02	2/15/04
	Sweep Generator	Wiltron	6648	101009	CAL 4/15/03	4/15/05
	Sweep Generator	Wiltron	6669M	007005	CAL 3/3/03	3/3/05
	Modulation Analyzer	HP	8901A	3435A06868	CAL 9/5/01	9/5/03
	Modulation Meter	Boonton	8220	10901AB	CAL 4/15/03	4/15/05
	Near Field Probe	HP	HP11940A	2650A02748	CHAR 2/1/01	2/1/03
	BandReject Filter	Lorch Microwave	5BR4-2400/ 60-N	Z1	CHAR 3/2/01	3/2/03
	BandReject Filter	Lorch Microwave	6BR6-2442/ 300-N	Z1	CHAR 3/2/01	3/2/03
	BandReject Filter	Lorch Microwave	5BR4-10525/ 900-S	Z1	CHAR 3/2/01	3/2/03
	High Pass Filter	Microlab	HA-10N		CHAR 10/4/01	10/4/03
	High Pass Filter	Microlab	HA-20N		CHAR 2/7/03	2/7/05

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc

Page 21 of 22

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
	Audio Oscillator	HP	653A	832-00260	CHAR 3/1/01	3/1/03
	Frequency Counter	HP	5382A	1620A03535	CHAR 3/2/01	3/2/03
	Frequency Counter	HP	5385A	3242A07460	CAL 3/7/03	3/7/05
	Preamplifier	HP	8449B-H02	3008A00372	CHAR 3/4/01	3/4/03
	Amplifier	HP	11975A	2738A01969	CHAR 3/1/01	3/1/03
	Egg Timer	Unk			CHAR 8/31/01	8/31/03
	Measuring Tape, 20M	Kraftixx	0631-20		CHAR 2/1/02	2/1/04
	Measuring Tape, 7.5M	Kraftixx	7.5M PROFI		2/1/02	2/1/04
	Coaxial Cable #51	Insulated Wire Inc.	NPS 2251-2880	Timco #51	CHAR 1/23/02	1/23/04
	Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 1/24/02	1/24/04
	Coaxial Cable #65	General Cable Co.	E9917 RG233/U	Timco #65	CHAR 1/23/02	1/23/04
	Coaxial Cable #106	Unknown	Unknown	Timco #106	CHAR 1/23/02	1/23/04

APPLICANT: KANEMATSU USA INC.

FCC ID: IV9FNCU-M45

REPORT #: K\KANEMATSU USA_\1263AUT4\1263AUT4TestReport.doc