



Test Report - FCC PART 90 Booster Class A (B9A)

Prepared For: Fiplex Communications Inc.

Approved for Release By:

Signature: Bruno Clavier

Name & Title: Bruno Clavier, General Manager

Date of Signature 5/12/2022

This test report shall not be reproduced except in full without the written and signed permission of Timco Engineering Inc. (IIA). This test report relates only to the items tested as identified and is not valid for any subsequent changes or modifications made to the equipment under test.



Table of Contents

1.	CUSTOMER INFORMATION.....	6
1.1	TEST RESULT SUMMARY	6
2.	LOCATION OF TESTING	8
2.1	TEST LABORATORY.....	8
2.2	TESTING WAS PERFORMED, REVIEWED BY	8
3.	TEST SAMPLE(S) (EUT/DUT).....	9
3.1	DEFINITIONS	9
3.2	DESCRIPTION OF THE EUT	10
3.3	CONFIGURATION OF EUT	11
3.4	TEST SETUP OF EUT	11
4.	TEST METHODS & APPLICABLE REGULATORY LIMITS.....	12
4.1	TEST METHODS/STANDARDS/GUIDANCE:.....	12
4.2	APPLIED LIMITS AND REGULATORY LIMITS:.....	12
5.	MEASUREMENT UNCERTAINTY.....	12
6.	ENVIRONMENTAL CONDITIONS	12
6.1	TEMPERATURE & HUMIDITY	12
7.	LIST OF TEST EQUIPMENT AND TEST FACILITY.....	13
7.1	LIST OF TEST EQUIPMENT	13
8.	TEST RESULTS	14
8.1	POWER AT THE FINAL AMPLIFIER.....	15
8.2	RF OUTPUT POWER & GAIN.....	16
8.3	OUT-OF-BAND REJECTION.....	18
8.3.1	Uplink, 412 MHz.....	19
8.3.2	Downlink, 412 MHz.....	20
8.3.3	Uplink, 417 MHz.....	21
8.3.4	Downlink, 417 MHz.....	22
8.3.5	Uplink, 427 MHz.....	23
8.3.6	Downlink, 427 MHz	24
8.4	BANDWIDTH & EMISSION	25
8.5	INPUT VS OUTPUT SIGNAL COMPARISON	26
8.5.1	FM, Uplink Mask C, 412 MHz, AGC.....	27
8.5.2	C4FM, Uplink Mask C, 412 MHz, AGC.....	28
8.5.3	H-CPM, Uplink Mask C, 412 MHz, AGC	29
8.5.4	H-DQPSK, Uplink Mask C, 412 MHz, AGC	30
8.5.5	FM, Downlink Mask C, 412 MHz, AGC	31
8.5.6	C4FM, Downlink Mask C, 412 MHz, AGC.....	32
8.5.7	H-CPM, Downlink Mask C, 412 MHz, AGC.....	33
8.5.8	H-DQPSK Downlink Mask C, 412 MHz, AGC.....	34



8.5.9	FM, Uplink Mask C, 412 MHz, AGC +3	35
8.5.10	C4FM, Uplink Mask C, 412 MHz, AGC +3.....	36
8.5.11	H-CPM, Uplink Mask C, 412 MHz, AGC +3.....	37
8.5.12	H-DQPSK, Uplink Mask C, 412 MHz, AGC +3.....	38
8.5.13	FM, Downlink Mask C, 412 MHz, AGC +3	39
8.5.14	C4FM, Downlink Mask C, 412 MHz, AGC +3	40
8.5.15	H-CPM, Downlink Mask C, 412 MHz, AGC +3.....	41
8.5.16	H-DQPSK, Downlink Mask C, 412 MHz, AGC +3.....	42
8.5.17	FM, Uplink Mask C, 417 MHz, AGC.....	43
8.5.18	C4FM, Uplink Mask C, 417 MHz, AGC.....	44
8.5.19	H-CPM, Uplink Mask C, 417 MHz, AGC.....	45
8.5.20	H-DQPSK, Uplink Mask C, 417 MHz, AGC.....	46
8.5.21	FM, Downlink Mask C, 417 MHz, AGC	47
8.5.22	C4FM, Downlink Mask C, 417 MHz, AGC.....	48
8.5.23	H-CPM, Downlink Mask C, 417 MHz, AGC.....	49
8.5.24	H-DQPSK Downlink Mask C, 417 MHz, AGC.....	50
8.5.25	FM, Uplink Mask C, 417 MHz, AGC +3	51
8.5.26	C4FM, Uplink Mask C, 417 MHz, AGC +3.....	52
8.5.27	H-CPM, Uplink Mask C, 417 MHz, AGC +3.....	53
8.5.28	H-DQPSK, Uplink Mask C, 417 MHz, AGC +3.....	54
8.5.29	FM, Downlink Mask C, 417 MHz, AGC +3	55
8.5.30	C4FM, Downlink Mask C, 417 MHz, AGC +3	56
8.5.31	H-CPM, Downlink Mask C, 417 MHz, AGC +3.....	57
8.5.32	H-DQPSK, Downlink Mask C, 417 MHz, AGC +3.....	58
8.5.33	FM, Uplink Mask D, 412 MHz, AGC	59
8.5.34	C4FM, Uplink Mask D, 412 MHz, AGC.....	60
8.5.35	H-CPM, Uplink Mask D, 412 MHz, AGC.....	61
8.5.36	H-DQPSK, Uplink Mask D, 412 MHz, AGC.....	62
8.5.37	FM, Downlink Mask D, 412 MHz, AGC	63
8.5.38	C4FM, Downlink Mask D, 412 MHz, AGC	64
8.5.39	H-CPM, Downlink Mask D, 412 MHz, AGC.....	65
8.5.40	H-DQPSK Downlink Mask D, 412 MHz, AGC.....	66
8.5.41	FM, Uplink Mask D, 412 MHz, AGC +3	67
8.5.42	C4FM, Uplink Mask D, 412 MHz, AGC +3	68
8.5.43	H-CPM, Uplink Mask D, 412 MHz, AGC +3.....	69
8.5.44	H-DQPSK, Uplink Mask D, 412 MHz, AGC +3.....	70
8.5.45	FM, Downlink Mask D, 412 MHz, AGC +3	71
8.5.46	C4FM, Downlink Mask D, 412 MHz, AGC +3	72
8.5.47	H-CPM, Downlink Mask D, 412 MHz, AGC +3.....	73
8.5.48	H-DQPSK, Downlink Mask D, 412MHz, AGC +3.....	74
8.5.49	FM, Uplink Mask D, 417 MHz, AGC	75
8.5.50	C4FM, Uplink Mask D, 417 MHz, AGC.....	76
8.5.51	H-CPM, Uplink Mask D, 417 MHz, AGC.....	77
8.5.52	H-DQPSK, Uplink Mask D, 417 MHz, AGC.....	78
8.5.53	FM, Downlink Mask D, 417 MHz, AGC	79
8.5.54	C4FM, Downlink Mask D, 417 MHz, AGC	80



8.5.55	H-CPM, Downlink Mask D, 417 MHz, AGC.....	81
8.5.56	H-DQPSK Downlink Mask D, 417 MHz, AGC.....	82
8.5.57	FM, Uplink Mask D, 417 MHz, AGC +3	83
8.5.58	C4FM, Uplink Mask D, 417 MHz, AGC +3.....	84
8.5.59	H-CPM, Uplink Mask D, 417 MHz, AGC +3.....	85
8.5.60	H-DQPSK, Uplink Mask D, 417 MHz, AGC +3.....	86
8.5.61	FM, Downlink Mask D, 417 MHz, AGC +3	87
8.5.62	C4FM, Downlink Mask D, 417 MHz, AGC +3	88
8.5.63	H-CPM, Downlink Mask D, 417 MHz, AGC +3.....	89
8.5.64	H-DQPSK, Downlink Mask D, 417 MHz, AGC +3	90
8.5.65	FM Uplink Mask D, 427 MHz AGC	91
8.5.66	C4FM Uplink Mask D, 427 MHz AGC	92
8.5.67	H-CPM Uplink Mask D, 427 MHz AGC.....	93
8.5.68	H-DQPSK Uplink Mask D, 427 MHz AGC.....	94
8.5.69	FM Downlink Mask D, 427 MHz AGC	95
8.5.70	C4FM Downlink Mask D, 427 MHz AGC	96
8.5.71	H-CPM Downlink Mask D, 427 MHz AGC.....	97
8.5.72	H-DQPSK Downlink Mask D, 427 MHz AGC	98
8.5.73	FM Uplink Mask D, 427 MHz AGC+3	99
8.5.74	C4FM Uplink Mask D, 427 MHz AGC+3.....	100
8.5.75	H-CPM Uplink Mask D, 427 MHz AGC+3.....	101
8.5.76	H-DQPSK Uplink Mask D, 427 MHz AGC+3.....	102
8.5.77	FM Downlink Mask D, 427 MHz, AGC +3.....	103
8.5.78	C4FM Downlink Mask D, 427 MHz, AGC +3	104
8.5.79	H-CPM Downlink Mask D, 427 MHz, AGC +3	105
8.5.80	H-DQPSK Downlink Mask D, 427 MHz, AGC +3.....	106
8.6	NOISE FIGURE	107
8.7	OUT-OF-BAND/OUT-OF-BLOCK EMISSIONS (INTERMODULATION PRODUCTS)	108
8.7.1	12.5 kHz, Uplink, 412 MHz AGC.....	109
8.7.2	12.5 kHz, Uplink, 412 MHz AGC +3dB	110
8.7.3	12.5 kHz, Downlink, 412 MHz AGC.....	111
8.7.4	12.5 kHz, Downlink, 412 MHz AGC +3dB	112
8.7.5	12.5 kHz, Uplink, 417 MHz AGC.....	113
8.7.6	12.5 kHz, Uplink, 417 MHz AGC +3.....	114
8.7.7	12.5 kHz, Downlink, 417 MHz AGC.....	115
8.7.8	12.5 kHz, Downlink, 417 MHz AGC +3	116
8.7.9	12.5 kHz, Uplink, 427 MHz AGC.....	117
8.7.10	12.5 kHz, Uplink, 427 MHz AGC+3.....	118
8.7.11	12.5 kHz, Downlink, 427 MHz AGC	119
8.7.12	12.5 kHz, Downlink, 427 MHz AGC +3.....	120
8.8	EMISSION MASK, OUT-OF-BAND.....	121
8.8.1	30 MHz to 1 GHz, Uplink, 412 MHz.....	122
8.8.2	1 GHz to 10 th Harmonic, Uplink, 412 MHz	123
8.8.3	30 MHz to 1 GHz, Downlink, 412 MHz.....	124
8.8.4	1 GHz to 10 th Harmonic, Downlink, 412 MHz	125
8.8.5	30 MHz to 1 GHz, Uplink, 417 MHz	126



8.8.6	1 GHz to 10 th Harmonic, Uplink, 417 MHz	127
8.8.7	30 MHz to 1 GHz, Downlink, 417 MHz.....	128
8.8.8	1 GHz to 10 th Harmonic, Downlink, 417 MHz	129
8.8.9	30 MHz to 1 GHz, Uplink, 427 MHz.....	130
8.8.10	1 GHz to 10 th Harmonic, Uplink, 427 MHz.....	131
8.8.11	30 MHz to 1 GHz, Downlink, 427 MHz.....	132
8.8.12	1 GHz to 10 th Harmonic, Downlink, 427 MHz.....	133
8.9	SPURIOUS RADIATED EMISSIONS	134
8.9.1	Uplink, 412 MHz.....	135
8.9.2	Downlink, 412 MHz.....	136
8.9.3	Uplink, 417 MHz.....	137
8.9.4	Downlink, 417 MHz.....	138
8.9.5	Uplink, 427 MHz.....	139
8.9.6	Downlink, 427 MHz	140
9.	ANNEX-A - PHOTOGRAPHS OF THE EUT.....	141
10.	ANNEX-B – TEST SETUP PHOTOGRAPHS.....	141
11.	HISTORY OF TEST REPORT CHANGES	141



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

1. Customer Information

Applicant: Fiplex Communications Inc.
Address: 2101 NW 79th Ave.
MIAMI FL 33122

1.1 Test Result Summary

The following test procedure and guidance were used for measuring FCC PART 90 (PRIVATE LAND MOBILE RADIO SERVICES) known as Licensed Land Mobile; ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters. Full test results are available in this report.

No additions to the test methods were needed. There were no deviations, or exclusions from the test methods. No test results are from external providers or from the customer. The test results relate only to the items tested. Timco does not offer opinions and interpretations, only a pass/fail statement.

Applicable Clauses from Part 2		
FCC Part 2 Clauses	Description of the requirements	Result: (Pass, Fail, N/A)
2.202	Bandwidth & Emission	Pass
2.1033 (c)(8)	Power at the Final Amplifier	Pass
2.1046 (a)	RF Output Power	Pass
2.1047	Modulation characteristics	n/a
2.1049	Occupied Bandwidth	Pass
2.1051	Spurious emissions at antenna terminals	Pass
2.1053	Field strength of spurious radiation	Pass
2.1055	Frequency stability	n/a

Applicable Clauses from Part 90 Subpart I		
FCC Part 90 Clauses	Description of the requirements	Result: (Pass, Fail, N/A)
90.205	Transmitter Power	Pass
90.207	Types of Emissions	Pass
90.209	Bandwidth limitations	Pass
90.210	Emission masks, In-band	Pass
90.210	Emission masks, Out-of-band	Pass
90.213	Frequency stability	n/a
90.214	Transient Frequency Behavior	n/a
90.219 (d)(6)(i)	ERP of intermodulation products	n/a ¹
90.219 (d)(6)(ii)	ERP of noise within the passband	n/a ¹
90.219 (d)(6)(iii)	ERP of noise on spectrum < 1 MHz outside of the passband	n/a ¹
90.219 (d)(3)(i), (e)(1)	ERP of Radiated Power	n/a ¹
90.219 (e)(2)	Noise figure	Pass
90.219 (e)(3)	Spurious emissions	Pass
90.219 (e)(4)(i)(ii)(iii)	Retransmitted Signals	Pass
90.221	Adjacent channel power limits	N/A

Note 1: Requirements in Part 90.219 (d) apply at deployment of this EUT, therefore are not applicable at certification.

KDB 935210 D05 v01r04		
FCC KDB 935210 D05 Clauses	Description of the requirements	Result: (Pass, Fail, N/A)
4.1	Test Signals for PLMRS (Input Signals)	Pass
4.2	AGC Threshold	Reported
4.3	Out-of-Band Rejection	Reported
4.4	Input-versus-Output Signal Comparison	Pass
4.5	Output Power	Pass
4.5	Amplifier/Booster Gain (optional)	Reported
4.6	Noise Figure	Pass
4.7.2	Out-of-band/Out-of-block Conducted Emissions (Intermodulation Products)	Pass
4.7.3	EUT Spurious Conducted Emissions	Pass
4.8	Frequency Stability	n/a
4.9	Spurious Radiated Emissions	Pass



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

2. Location of Testing

2.1 Test Laboratory

Timco Engineering Inc. is a subsidiary of Industrial Inspection & Analysis, Inc. ("IIA").

Testing was performed at Timco's permanent laboratory located at 849 NW State Road 45, Newberry, Florida 32669

FCC test firm # 578780

FCC Designation # US1070

FCC site registration is under A2LA certificate # 0955.01

ISED Canada test site registration # 2056A

EU Notified Body # 1177

For all designations see A2LA scope # 0955.01

2.2 Testing was performed, reviewed by

Dates of Testing: 4/5/2022 – 5/11/2022

Signature:

Sr. EMC Engineer
EMC-003838-NE



Name & Title:

Tim Royer, EMC Engineer

Date of Signature

5/12/2022

Signature:

Name & Title:

Kristoffer Costa, EMC Technician

Date of Signature

5/12/2022



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

3. Test Sample(s) (EUT/DUT)

The test sample was received: 4/4/2022

3.1 Definitions

Signal booster: A device or system that automatically receives, amplifies, and retransmits signals from wireless stations into and out of building interiors, tunnels, shielded outdoor areas and other locations where these signals would otherwise be too weak for reliable communications. Signal booster systems may contain both Class A and Class B signal boosters as components.

Class A signal booster: A signal booster designed to retransmit signals on one or more specific channels. A signal booster is deemed to be a Class A signal booster if none of its passbands exceed 75 kHz.

Class B signal booster: A signal booster designed to retransmit any signals within a wide frequency band. A signal booster is deemed to be a Class B signal booster if it has a passband that exceeds 75 kHz.



3.2 Description of the EUT

A description as well as unambiguous identification of the EUT(s) tested. Where more than one sample is required for technical reasons (such as the use of connected units for the purpose of conducted output power testing where the product units will have integral antennas), each specific test shall identify which unit was tested.

Identification	
FCC ID:	P3TDH437-3X
Brief Description	Digital Signal Booster
Type of Modular	n/a
Model(s) #	DH437
Firmware version	3.01-00
Software version	1.02
Serial Number	20101178FU

Technical Characteristics	
Technology	Bi-Directional Industrial Signal Booster
Frequency Range	410 – 415 MHz- Uplink/ Downlink 417 – 422 MHz- Uplink/ Downlink 425 - 430 MHz- Uplink/ Downlink
RF O/P Power (Max.)	UL: 23.85 dBm (0.24 W) DL: 37.96 dBm (6.25 W)
Modulation	n/a
Bandwidth & Emission Class	11K3F3E, 8K10F1D, 8K10F1E, 8K10F1W, 9K80F1D, 9K80F1E, 9K80D7W
Number of Channels	Variable
Duty Cycle	100%
Antenna Connector	N Type
Voltage Rating (AC or Batt.)	28 V DC (internally)

Antenna Characteristics				
Antenna Name	Frequency Range	Antenna Type	Dimensions	Antenna Gain
n/a	410 – 430 MHz	n/a	n/a	3 dBi

- Note: Information such as antenna gain, firmware/software numbers are provided by manufacturer and cannot be validated by the test lab.

Note: This EUT does not include antenna(s).



3.3 Configuration of EUT

Test Modes		
Band	Link Direction	Test Frequencies
410 – 415 MHz 417 – 422 MHz 425 – 430 MHz	Uplink/ Downlink	412 MHz 417 MHz 427 MHz

Operating conditions during Testing:

No other modifications of the device under test (including firmware, specific software settings, and input/output signal levels to the EUT) were made.

Peripherals used during Testing:

A laptop was used to control the EUT.

3.4 Test Setup of EUT

Equipment, antenna, and cable arrangement. The setup of the equipment and cable or wire placement on the test site that produces the highest radiated and the highest ac power line conducted emissions shall be shown clearly and described. Information on the orientation of portable equipment during testing shall be included. Drawings or photographs may be used for this purpose.

Test Setups are included in the test report.



4. Test methods & Applicable Regulatory Limits

4.1 Test methods/Standards/Guidance:

Test procedures and guidance for measuring Licensed Part 90 Licensed device:

- 1) ANSI C63.26-2015
- 2) FCC KDB 935210 D05 v01r04 Industrial Signal Boosters

4.2 Applied Limits and Regulatory Limits:

- 1) FCC CFR 47 Part 90 Subpart I, 90.219

5. Measurement Uncertainty

Parameter	Uncertainty (dB)
Conducted Emissions	± 3.14 dB
Radiated Emissions (9kHz – 30 MHz)	± 3.08 dB
Radiated Emissions (30 – 200 MHz)	± 2.16 dB
Radiated Emissions (200 – 1000 MHz)	± 2.15 dB
Radiated Emissions (1 GHz – 18 GHz)	± 2.14 dB
Radiated Emissions (18 GHz – 40 GHz)	± 2.31 dB
Note: The uncertainties provided in this table represent an expanded uncertainty expressed at approximately the 95% confidence level using a coverage factor of K=2.	

6. Environmental Conditions

6.1 Temperature & Humidity

Measurements performed at the test site did not exceed the following:

Parameter	Measurement
Temperature	23 C +/- 5%
Humidity	55% +/- 5%
Barometric Pressure	30.05 in Hg
Note: Specific environmental conditions that are applicable to a specific test are available in the test result section.	



7. List of Test Equipment and Test Facility

The test equipment used identified by type, manufacturer, serial number, or other identification and the date on which the next calibration or service check is due.

Description of the firmware or software used to operate EUT for testing purposes.

A complete list of all test equipment used shall be included with the test report. The manufacturer's model and serial numbers, and date of last calibration, and calibration interval shall be included. Measurement cable loss, measuring instrument bandwidth and detector function, video bandwidth, if appropriate, and antenna factors shall also be included where applicable.

7.1 List of Test Equipment

Test Equipment						
Type	Device	Manufacturer	Model	SN#	Current Cal	Cal Due
Antenna, NSA	Log-Periodic 1243	Eaton	96005	1243	5/4/21	5/3/2024
Antenna	Double-Ridged Horn/ETS Horn 1	ETS-Lindgren	3117	00035923	2/25/20	2/24/2023
CHAMBER	CHAMBER	Panashield	3M	N/A	3/12/19	12/21/2023
Receiver	EMI Test Receiver R&S ESU 40	Rohde & Schwarz	ESU 40	100320	5/27/21	5/26/2024
Signal Generator	Signal Generator HP 8648C	HP	8648C	35537A01679	3/29/19	5/28/2022

Software			
Software	Author	Version	Validation on
ESU Firmware	Rohde & Schwarz	4.43 SP3; BIOS v5.1-24-3	2018
RSCCommander	Rohde & Schwarz	1.6.4	2014
ScopeExplorer	LeCroy	v2.25.0.0	2009
Field Strength	Timco	v4.10.7.0	2016



8. Test Results

The results of the test are usually indicated in the form of tables, spectrum analyzer plots, charts, sample calculations, as appropriate for each test procedure.

A description and/or a block diagram of the test setup is usually provided.

The measurement results, along with the appropriate limits for comparison, may be presented in tabular or graphical form. In addition, any variation in the measurement environment may be reported if applicable (e.g., a significant change of temperature that could affect the cable loss and amplifier response).

Unless noted otherwise in the referenced standard, the measurements of **ac power-line conducted emissions and conducted power output** will be reported in units of dB μ V. Unless noted otherwise in the referenced standard, the measurements of **radiated emissions** will be reported in units of decibels, referenced to one microvolt per meter (dB μ V/m) for electric fields, or to one ampere per meter (dBA/m) for magnetic fields, at the distance specified in the appropriate standards or requirements. The measurements of antenna-conducted power for receivers may be reported in units of dB μ V if the impedance of the measuring instrument is also reported. Otherwise, antenna-conducted power will be reported in units of decibels referenced to one milliwatt (dBm). All formulas for data conversions and conversion factors, if used, will be included in this measurement report.

Example:

Freq (MHz)	Meter Reading	+ ACF	+CL	= FS
33	20 dB μ V	+ 10.36 dB/m	+0.40 dB	=30.36 dB μ V/m @ 3m

$EIRP = P_{cond} \text{ (dBm)} + dBi$



8.1 Power at the Final Amplifier

Limits from FCC Part 2.1033 (c)(8).

No method of measurement is specified. The result has been calculated based on all available information.


Test Results		
EUT Operating Voltage (V)	EUT Current (A)	Power at the Final Amplifier
28 V DC	3.57	100 W



8.2 RF Output Power & Gain

Limits from FCC Parts 2.1046(a), and 90.205 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

Test Setup



Test Results, Power Output


Link Direction	Max Power Output (dBm)	Max Power Output (W)	Tuning Tolerance (dB)
Uplink	23.85	0.24	+/- 2.0
Downlink	37.96	6.25	+/- 2.0



Test Results, Gain					
Link Direction	Tuned Frequency (MHz)	Input Level	Power Input (dBm)	Power Output (dBm)	Gain (dB)
Uplink	412	AGC	-49.2	23.64	72.84
		AGC+3	-46.2	23.81	70.01
		Maximum	0	23.85	23.85
	417	AGC	-52.1	21.4	73.5
		AGC+3	-49.1	21.61	70.71
		Maximum	0	21.57	21.57
	427	AGC	-31.7	23.85	55.55
		AGC+3	-28.7	23.77	52.47
		Maximum	0	23.82	37.85
Downlink	412	AGC	-34.2	37.86	72.06
		AGC+3	-31.2	37.9	69.1
		Maximum	0	37.85	37.85
	417	AGC	-34.4	37.91	72.31
		AGC+3	-31.4	37.96	69.36
		Maximum	0	37.87	37.87
	427	AGC	-35.5	36.92	72.42
		AGC+3	-32.5	36.99	69.42
		Maximum	0	36.94	36.94

8.3 Out-of-band Rejection

Limits and test method from FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

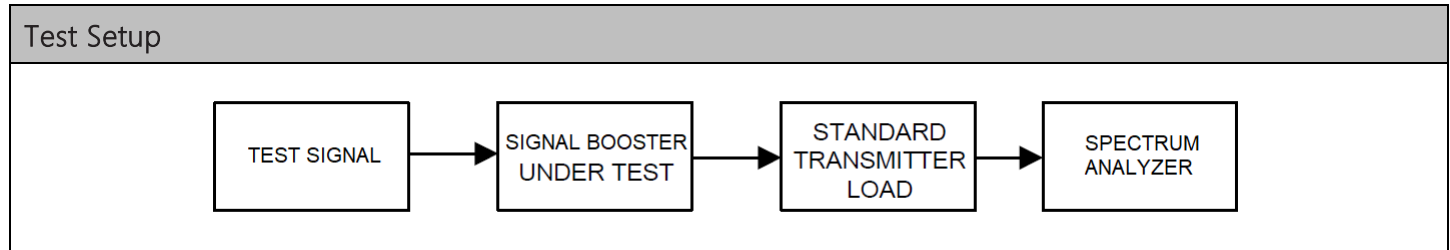


Test Results, Out-of-band Rejection and Class of Operation			
Operating Band	Link Direction	Passband (kHz)	Class of Operation
410 – 415 MHz	Uplink/ Downlink	< 75 kHz	Class A
417 – 422 MHz			
425 -430 MHz			

NOTE: The equipment under test is channelized and will only allow the specified channel(s) to pass.




Out-of-band Rejection, Spectrum Plots

8.3.1 Uplink, 412 MHz

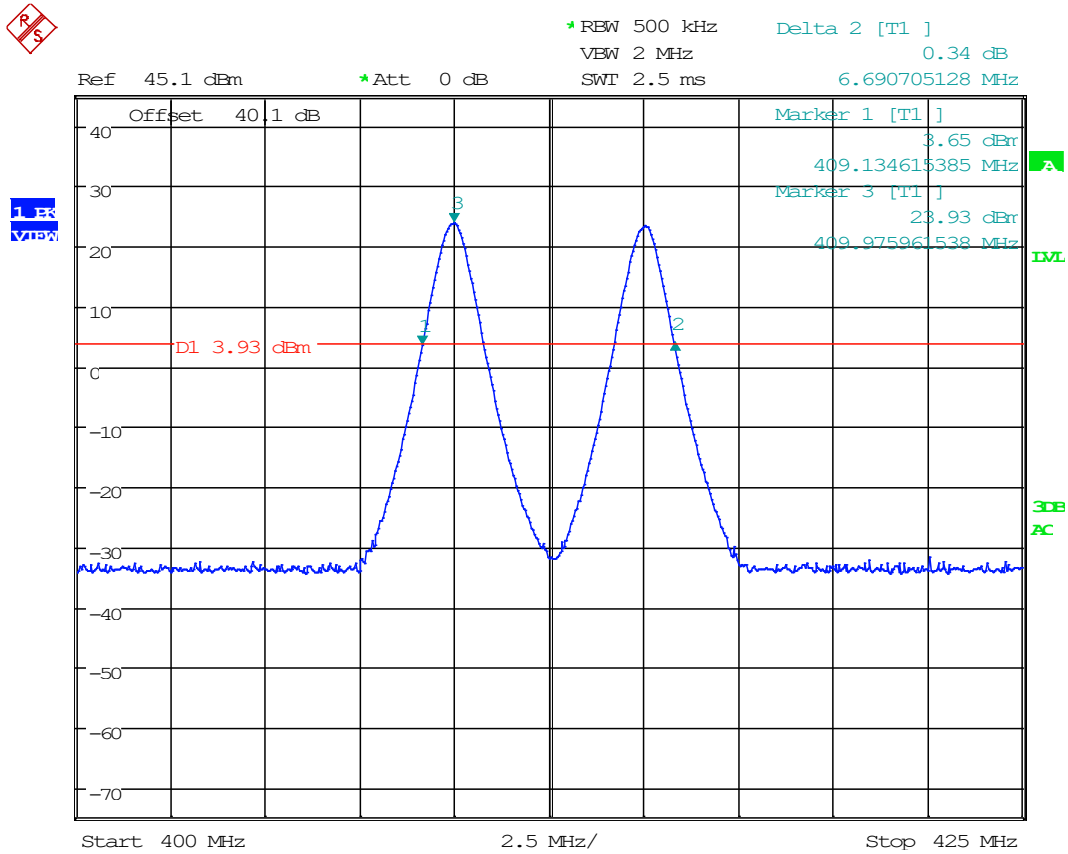


Date: 5.APR.2022 16:32:37

8.3.2 Downlink, 412 MHz

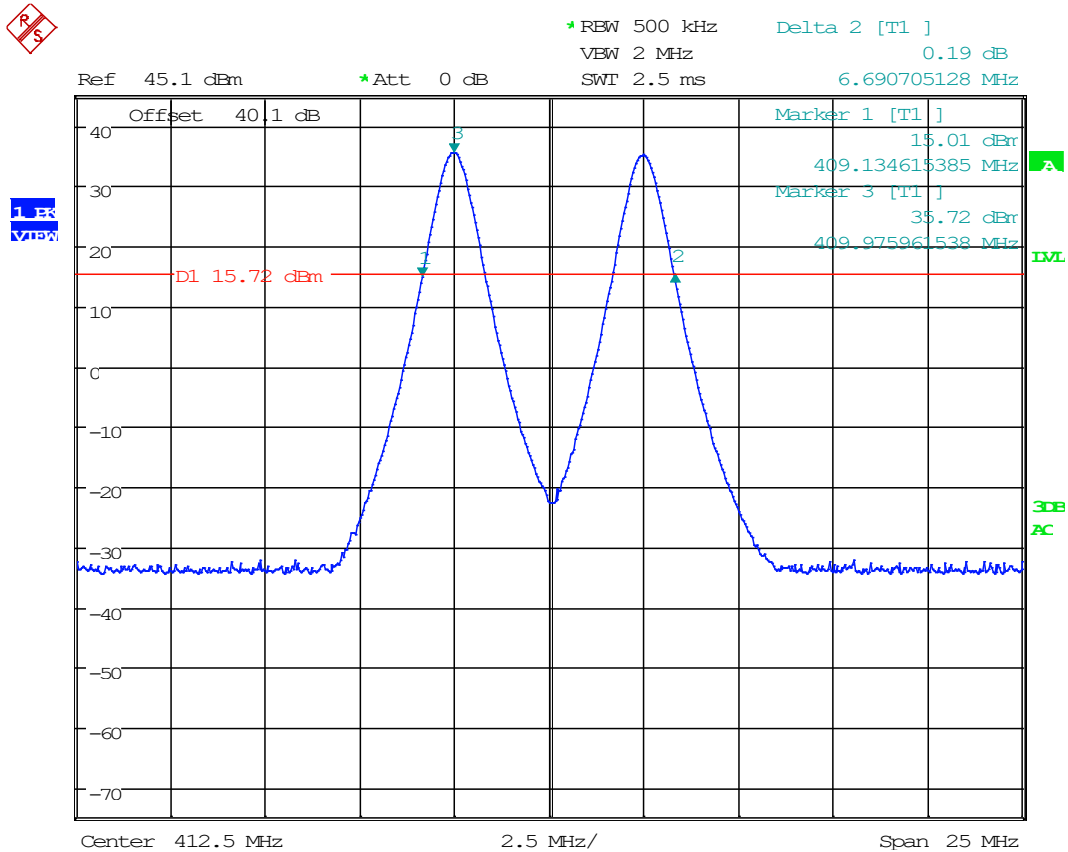

Date: 5.APR.2022 16:44:29


8.3.3 Uplink, 417 MHz

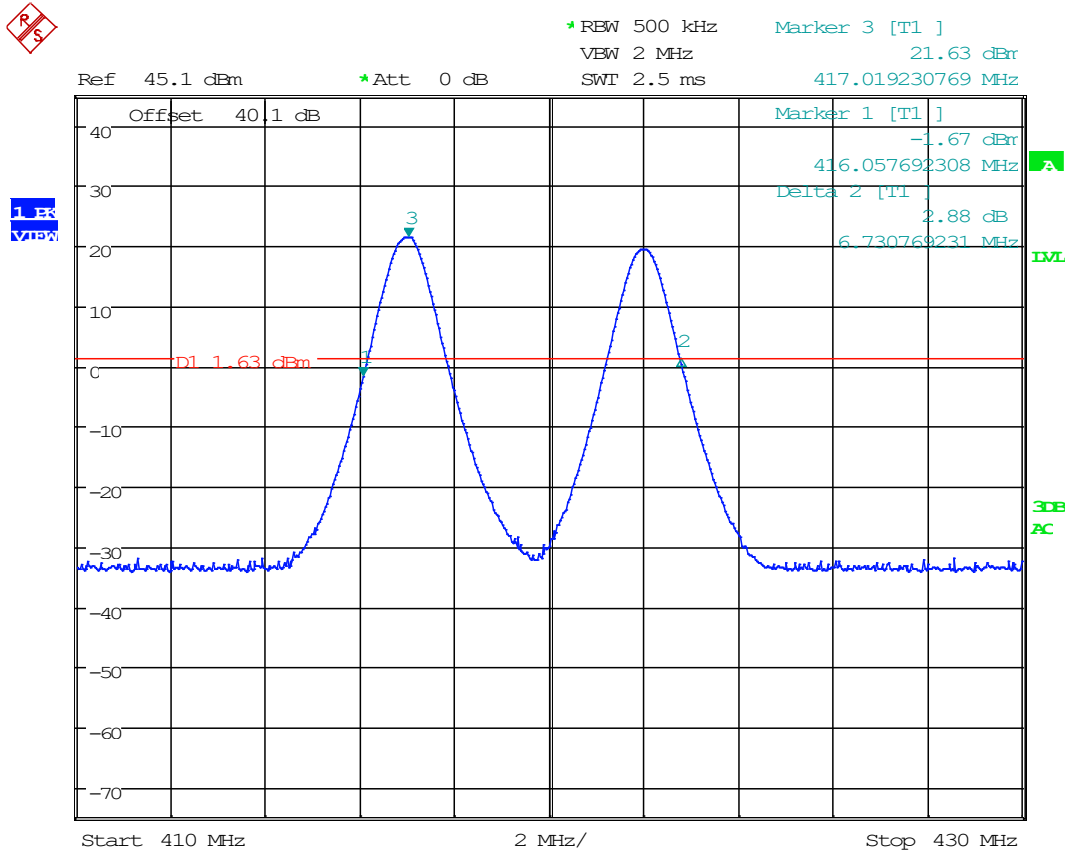

Date: 5.APR.2022 15:33:44




8.3.4 Downlink, 417 MHz

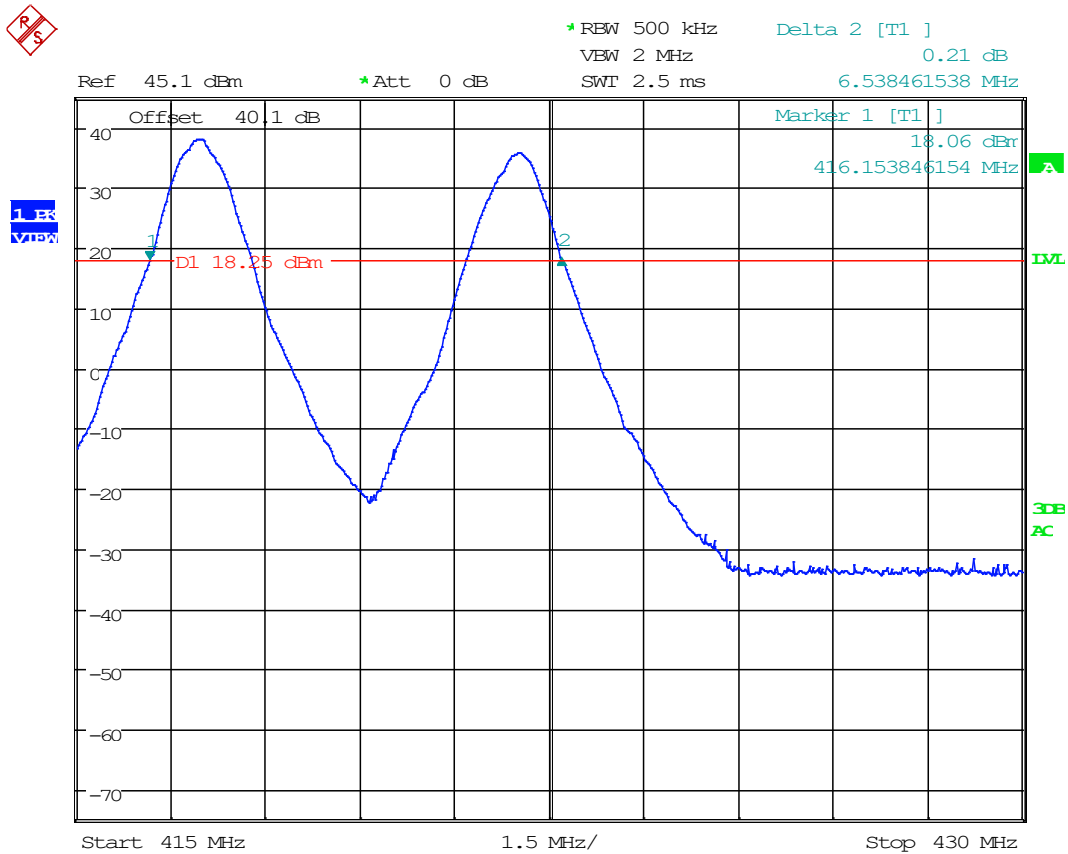

Date: 5.APR.2022 14:18:55




8.3.5 Uplink, 427 MHz

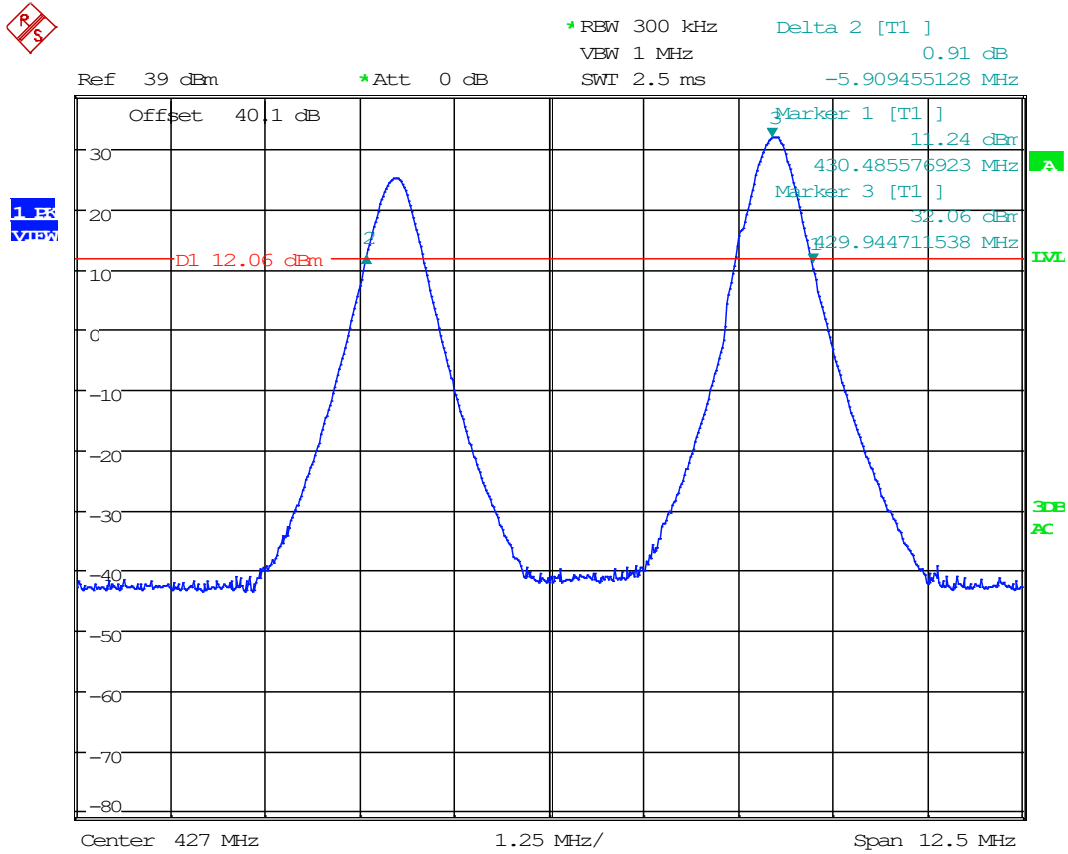

Date: 11.MAY.2022 09:48:58

8.3.6 Downlink, 427 MHz

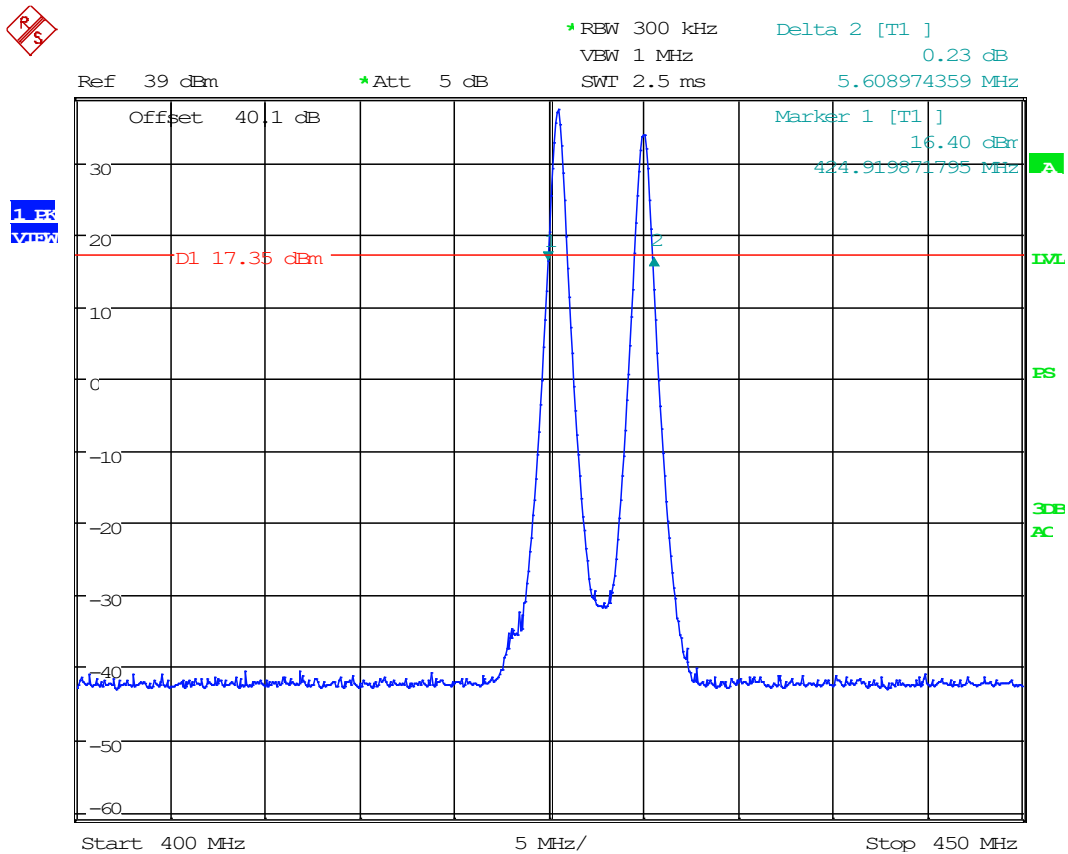

Date: 6.APR.2022 11:54:16



8.4 Bandwidth & Emission

Limits from FCC Parts 90.209 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.


Authorized Bandwidth		
Rule Part	Operating Range	Authorized Bandwidth
Part 90	410 – 415 MHz 417 – 422 MHz 425 – 430 MHz	11.25 kHz

Applicable Input Signals		
Signal	Occupied Bandwidth (kHz)	Representative Emission Designator(s)
CW	n/a	n/a
12.5 kHz FM	11.3	11K3F3E
C4FM (P25 Phase I)	8.1	8K10F1D, 8K10F1E
HCPM (P25 Phase II SU)	8.1	8K10F1W
HDQPSK (P25 Phase II BS)	9.8	9K80F1D, 9K80F1E, 9K80D7W




8.5 Input VS Output Signal Comparison

Limits from FCC Parts 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

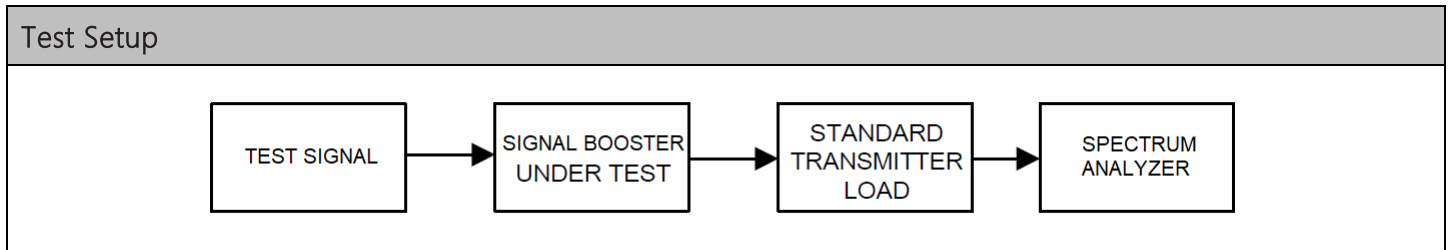


8.5.1 FM, Uplink Mask C, 412 MHz, AGC

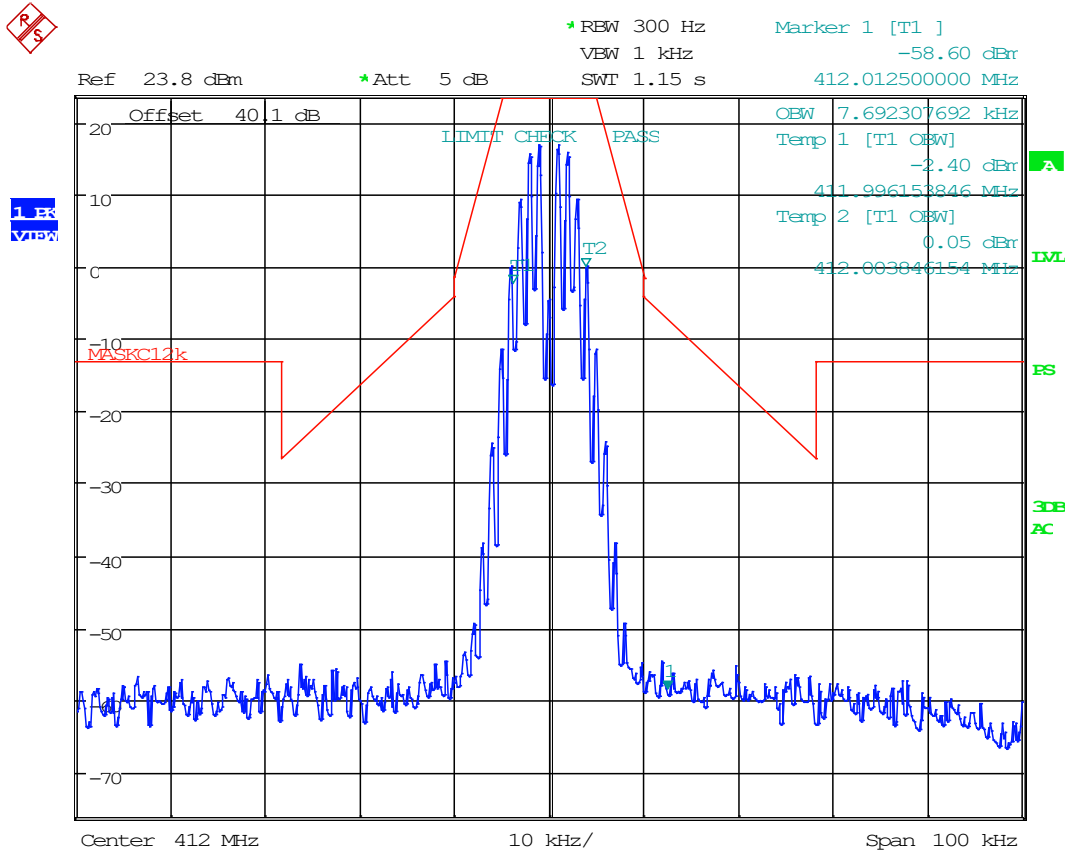


Date: 6.APR.2022 09:57:47

8.5.2 C4FM, Uplink Mask C, 412 MHz, AGC

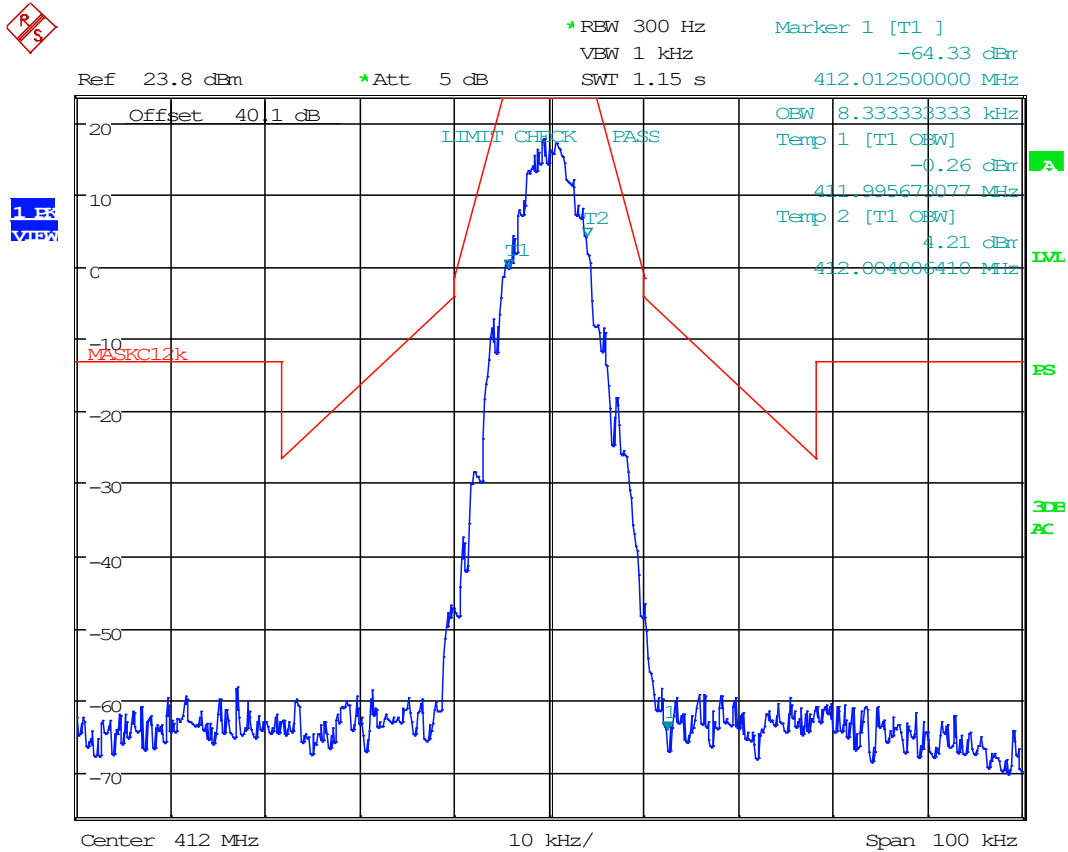


Date: 6.APR.2022 09:59:10

8.5.3 H-CPM, Uplink Mask C, 412 MHz, AGC

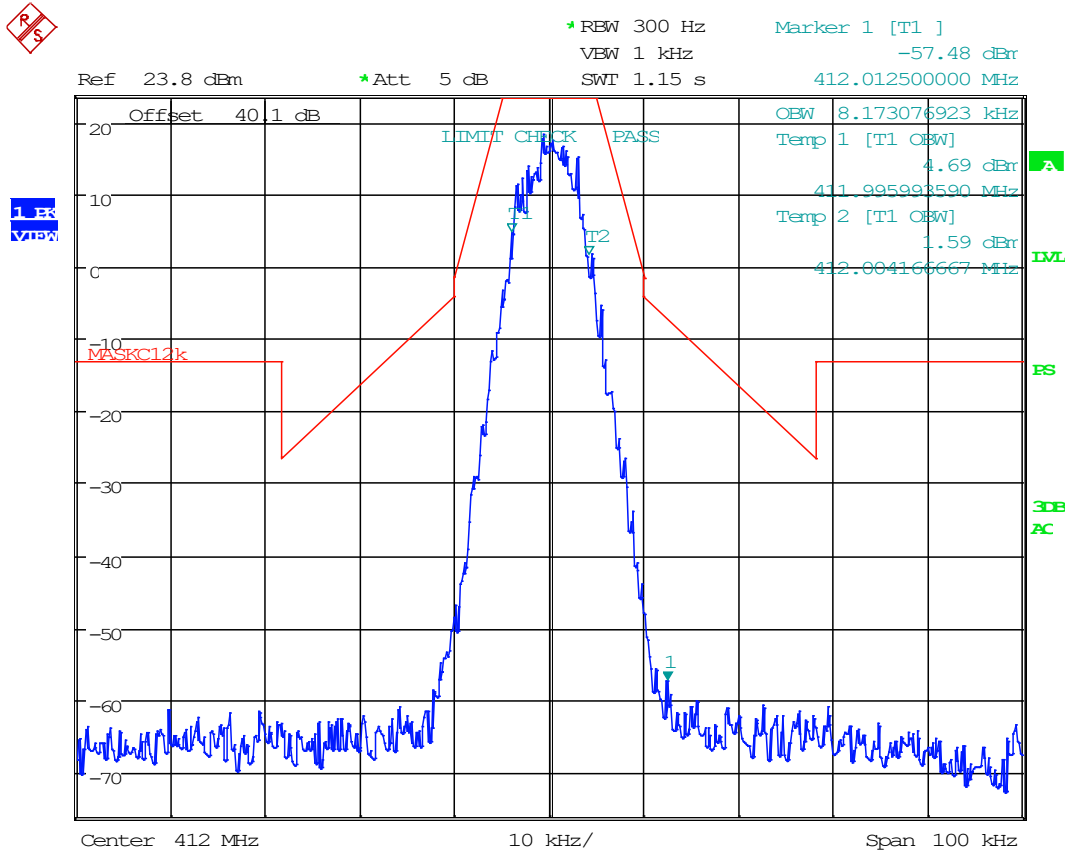


Date: 6.APR.2022 10:01:44

8.5.4 H-DQPSK, Uplink Mask C, 412 MHz, AGC

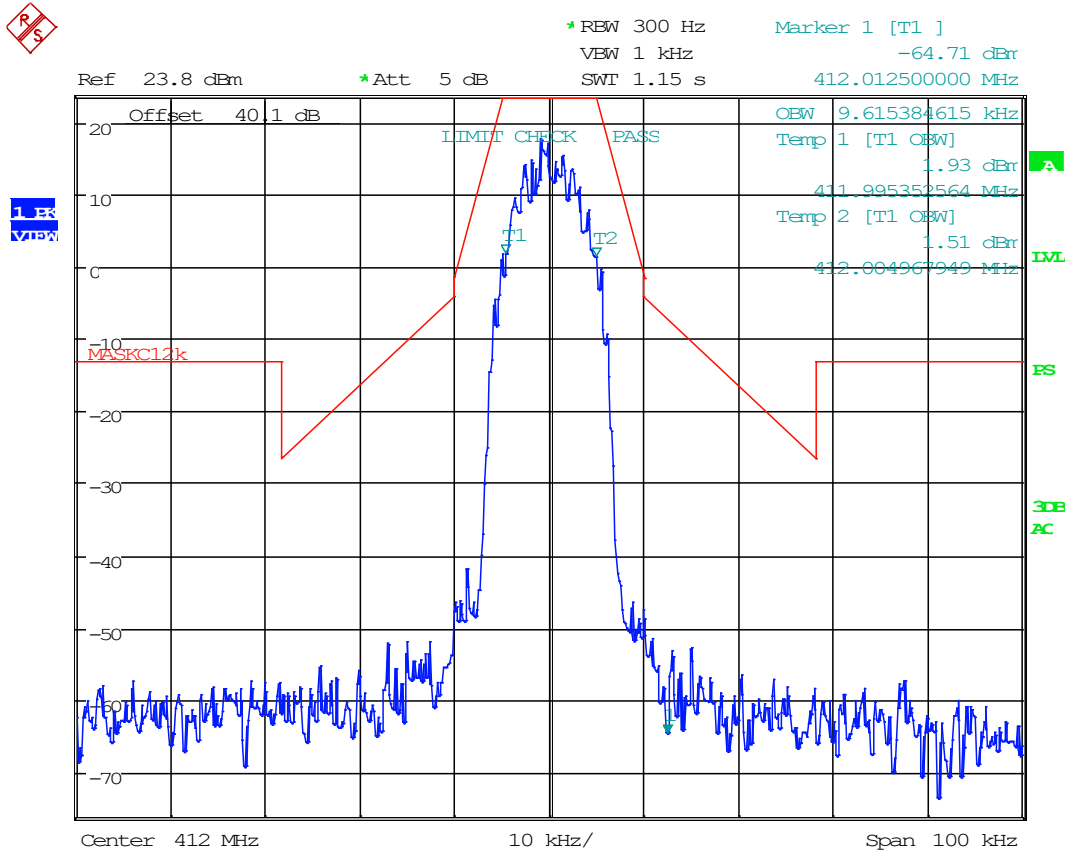


Date: 6.APR.2022 10:05:02

8.5.5 FM, Downlink Mask C, 412 MHz, AGC

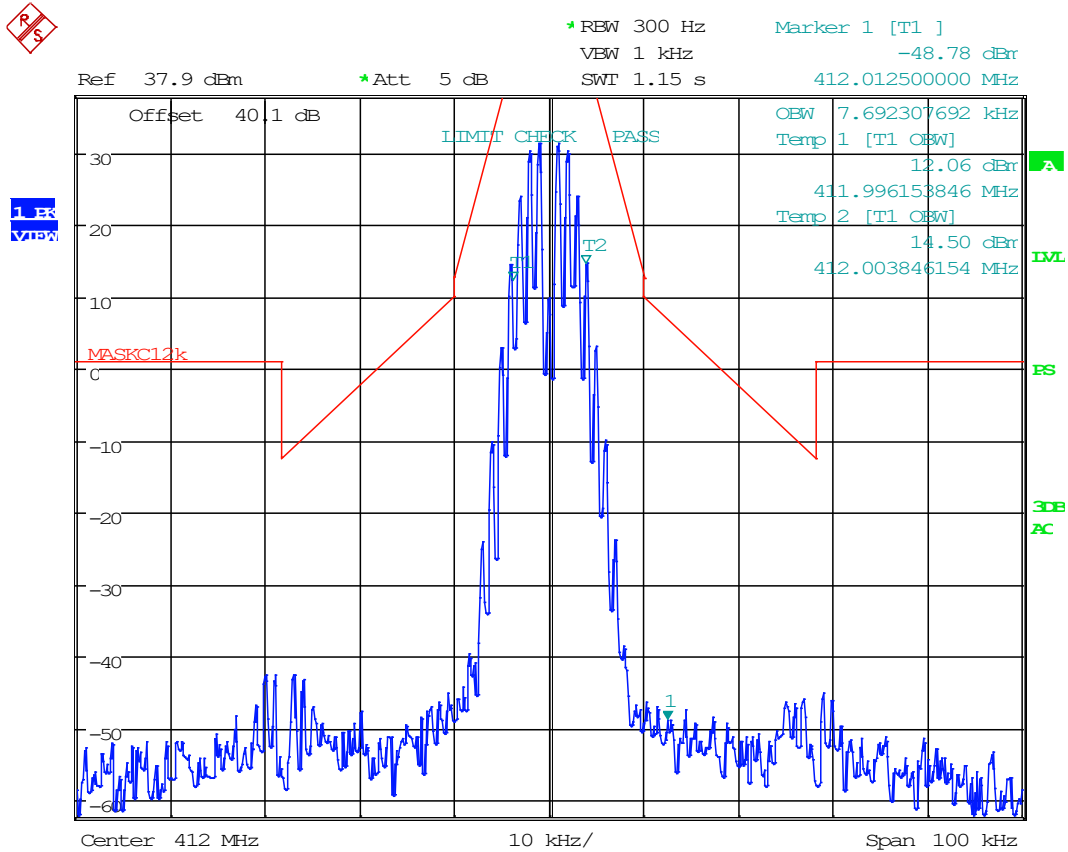


Date: 6.APR.2022 10:07:31

8.5.6 C4FM, Downlink Mask C, 412 MHz, AGC

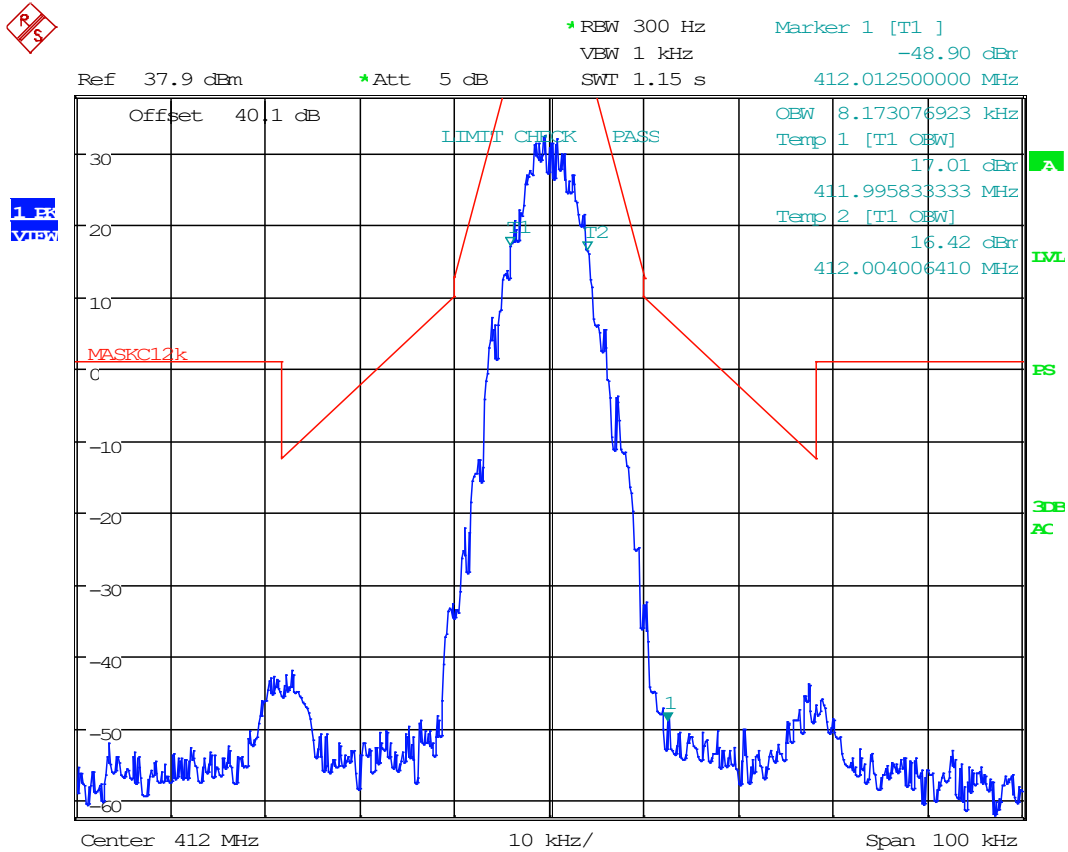


Date: 6.APR.2022 10:09:08

8.5.7 H-CPM, Downlink Mask C, 412 MHz, AGC

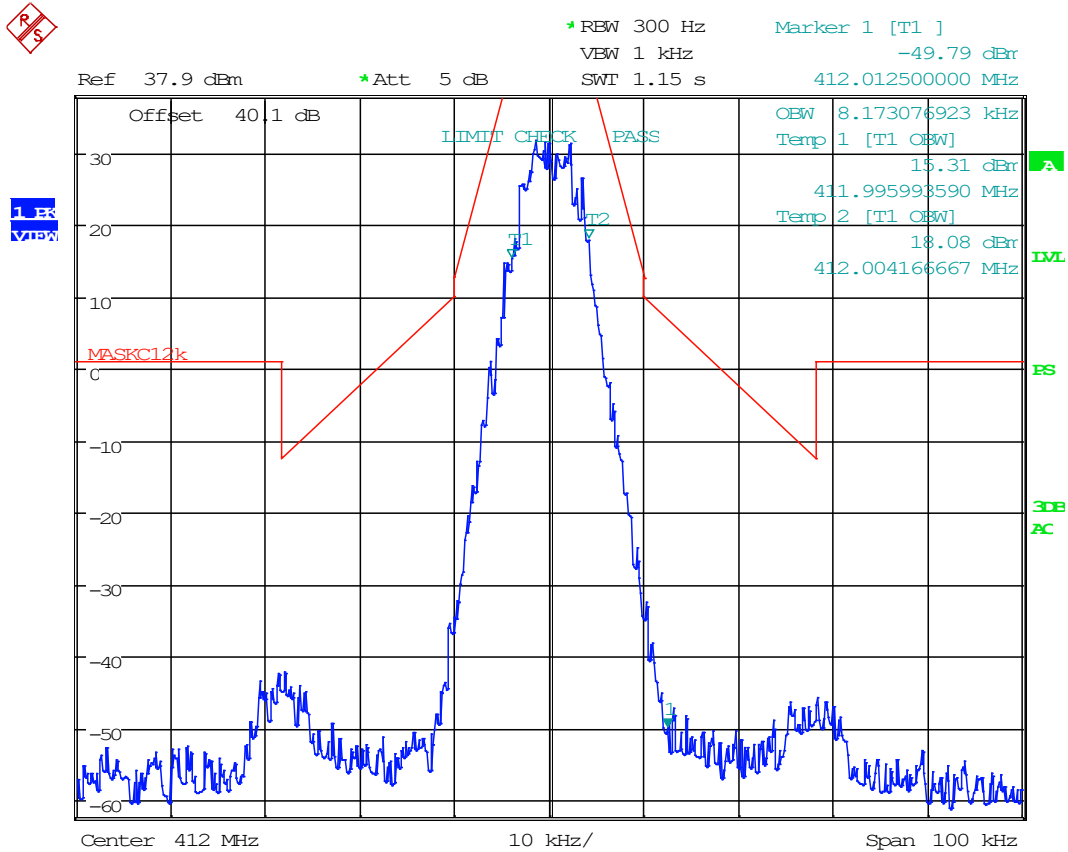


Date: 6.APR.2022 10:11:11

8.5.8 H-DQPSK Downlink Mask C, 412 MHz, AGC

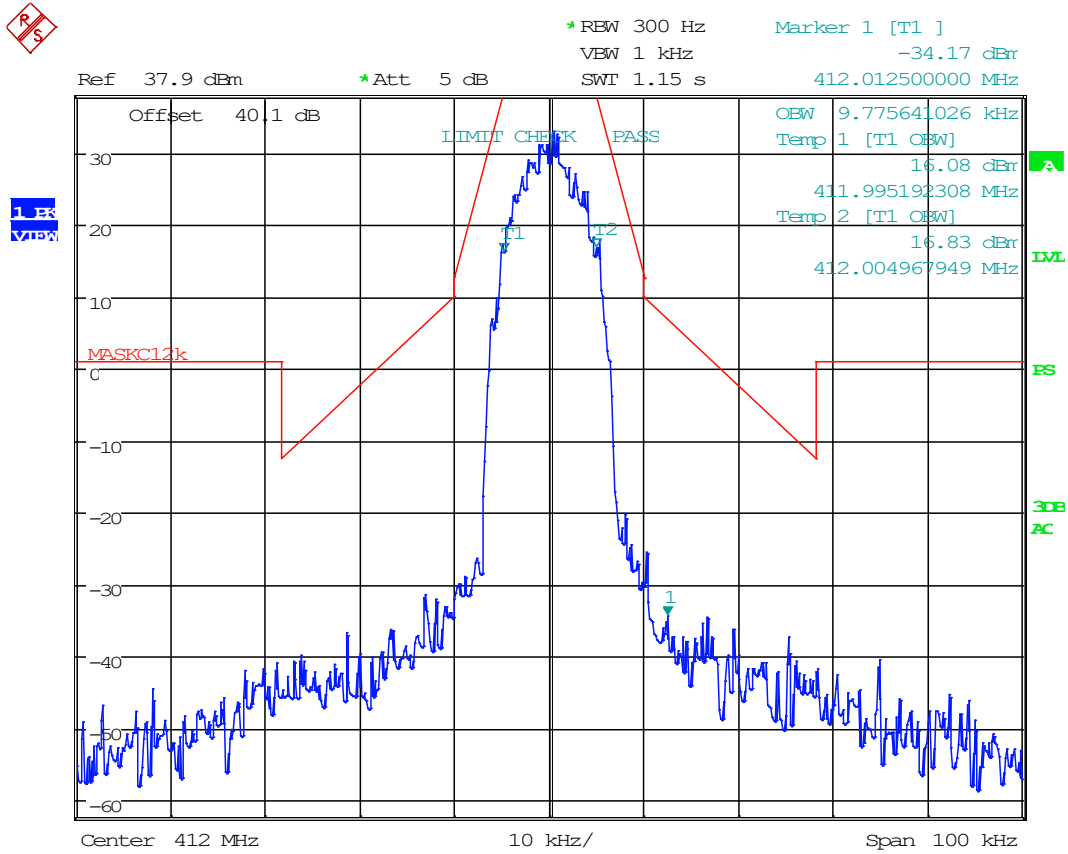


Date: 6.APR.2022 10:11:41

8.5.9 FM, Uplink Mask C, 412 MHz, AGC +3

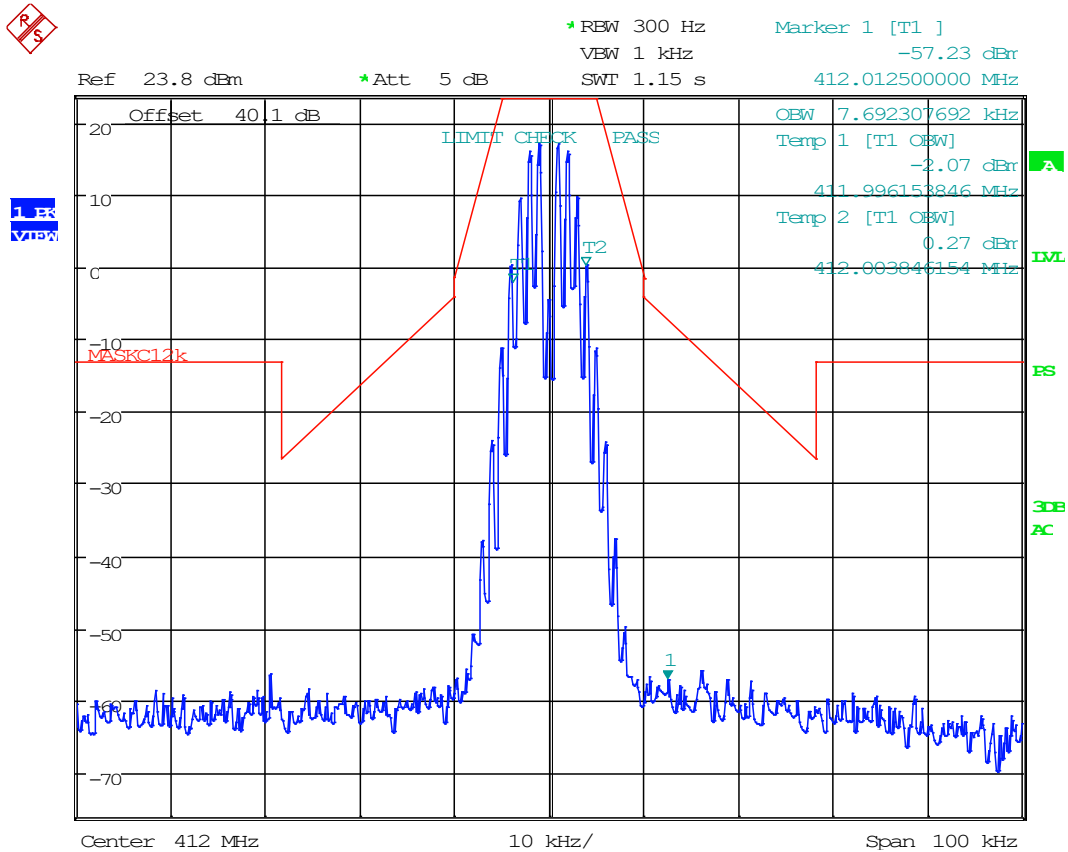


Date: 6.APR.2022 09:58:22

8.5.10 C4FM, Uplink Mask C, 412 MHz, AGC +3

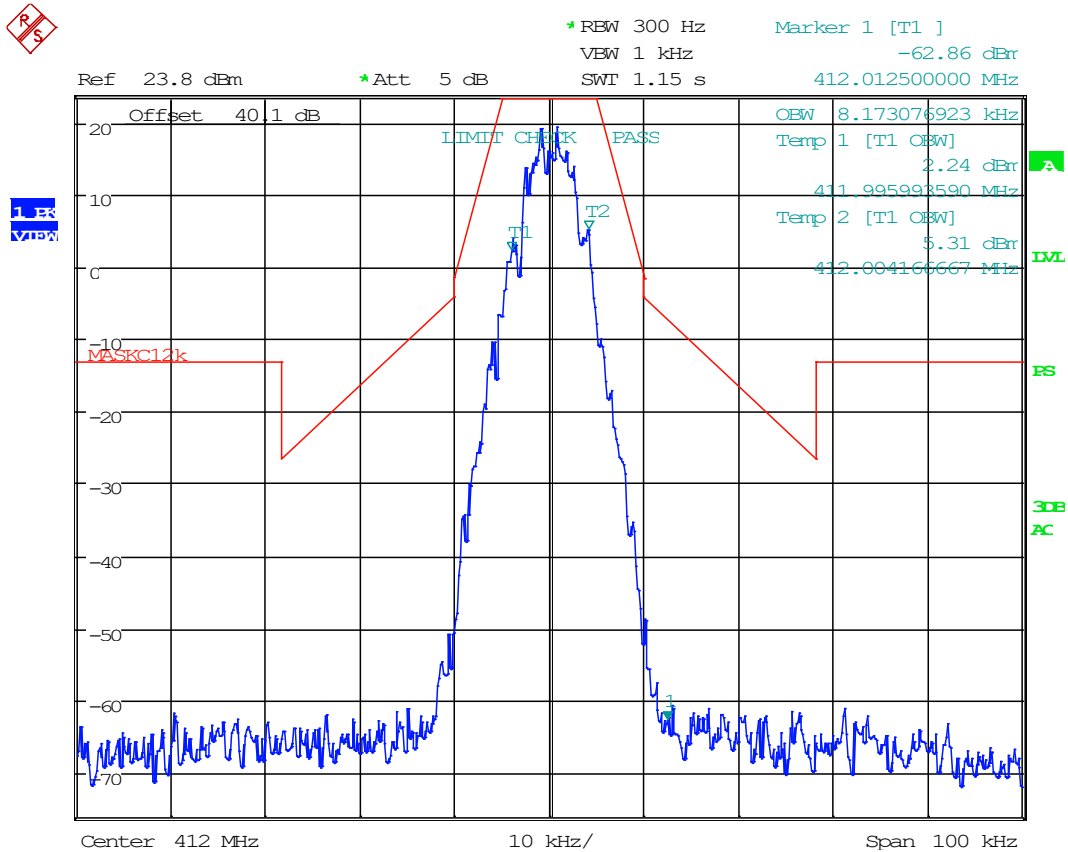


Date: 6.APR.2022 09:59:53

8.5.11 H-CPM, Uplink Mask C, 412 MHz, AGC +3

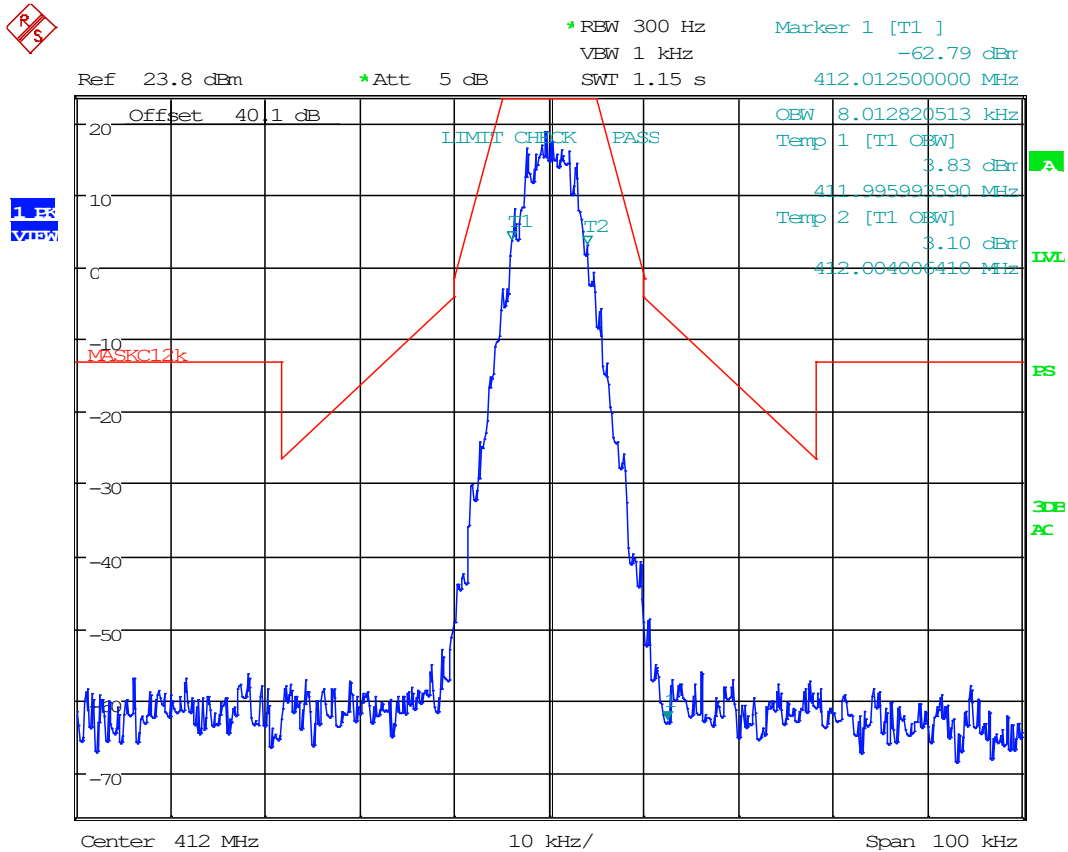


Date: 6.APR.2022 10:03:58

8.5.12 H-DQPSK, Uplink Mask C, 412 MHz, AGC +3

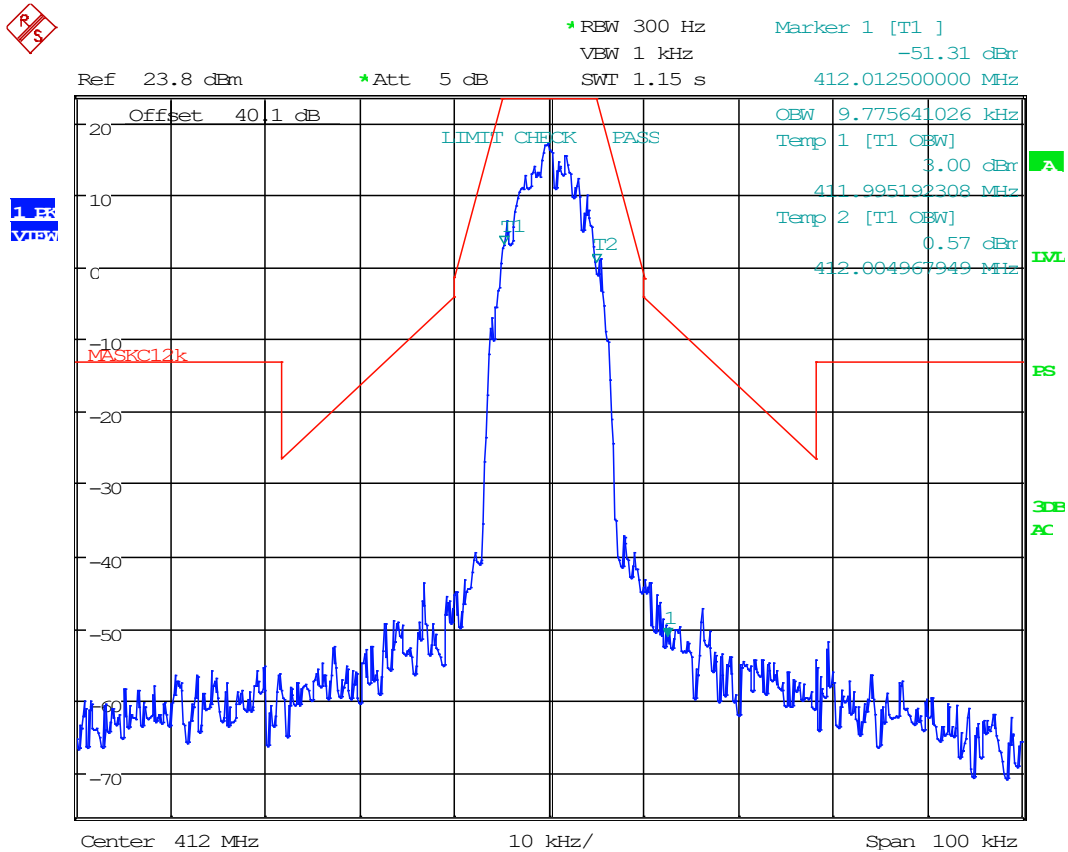


Date: 6.APR.2022 10:05:23

8.5.13 FM, Downlink Mask C, 412 MHz, AGC +3

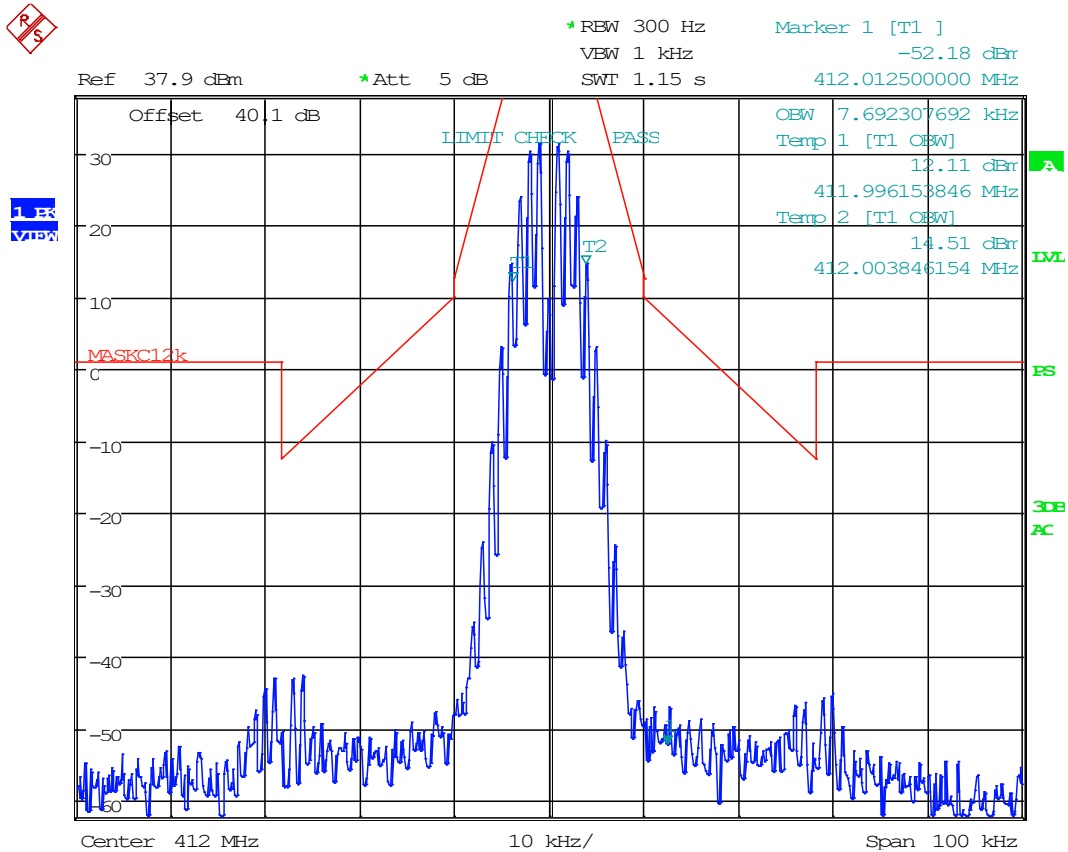


Date: 6.APR.2022 10:08:17

8.5.14 C4FM, Downlink Mask C, 412 MHz, AGC +3

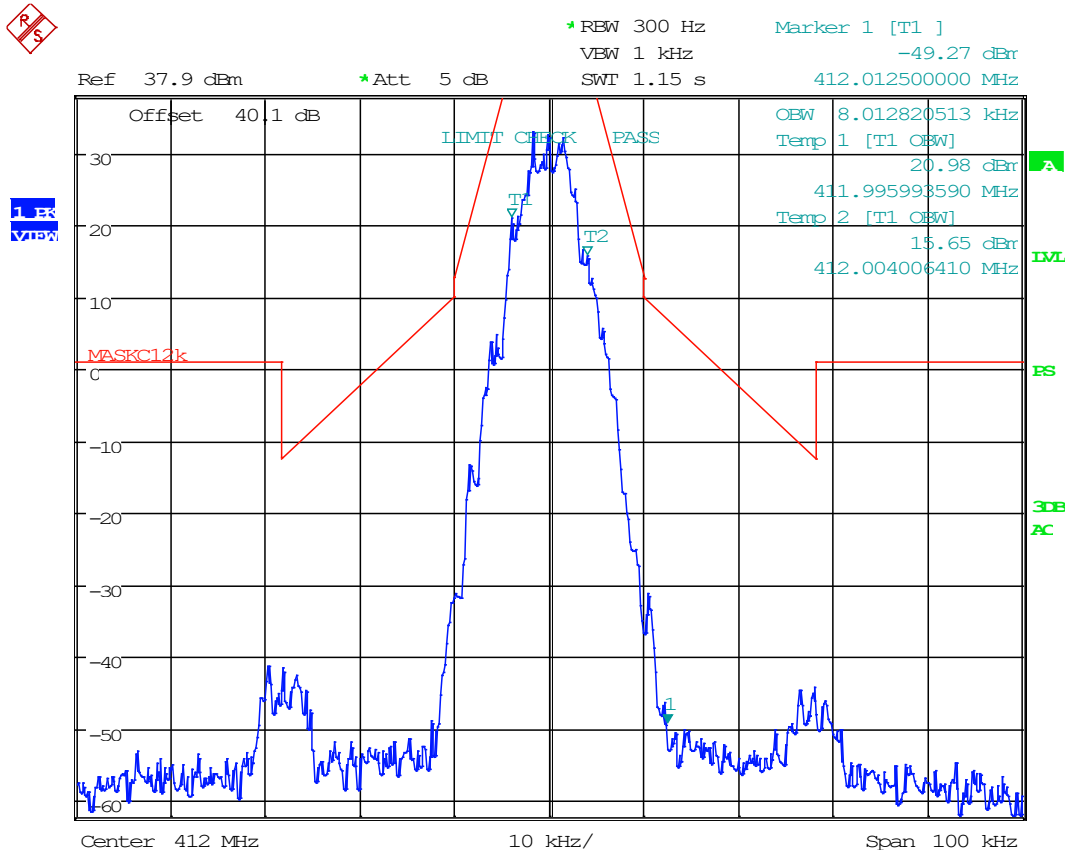


Date: 6.APR.2022 10:09:47

8.5.15 H-CPM, Downlink Mask C, 412 MHz, AGC +3

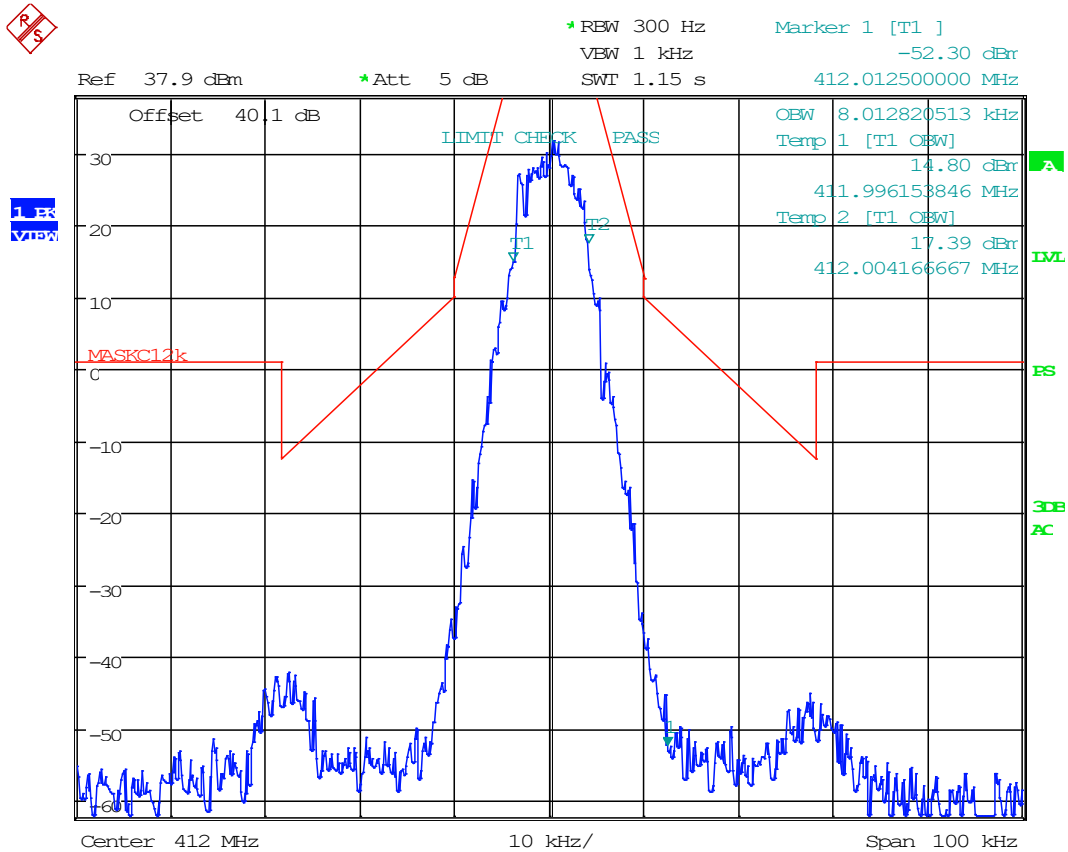


Date: 6.APR.2022 10:10:16

8.5.16 H-DQPSK, Downlink Mask C, 412 MHz, AGC +3

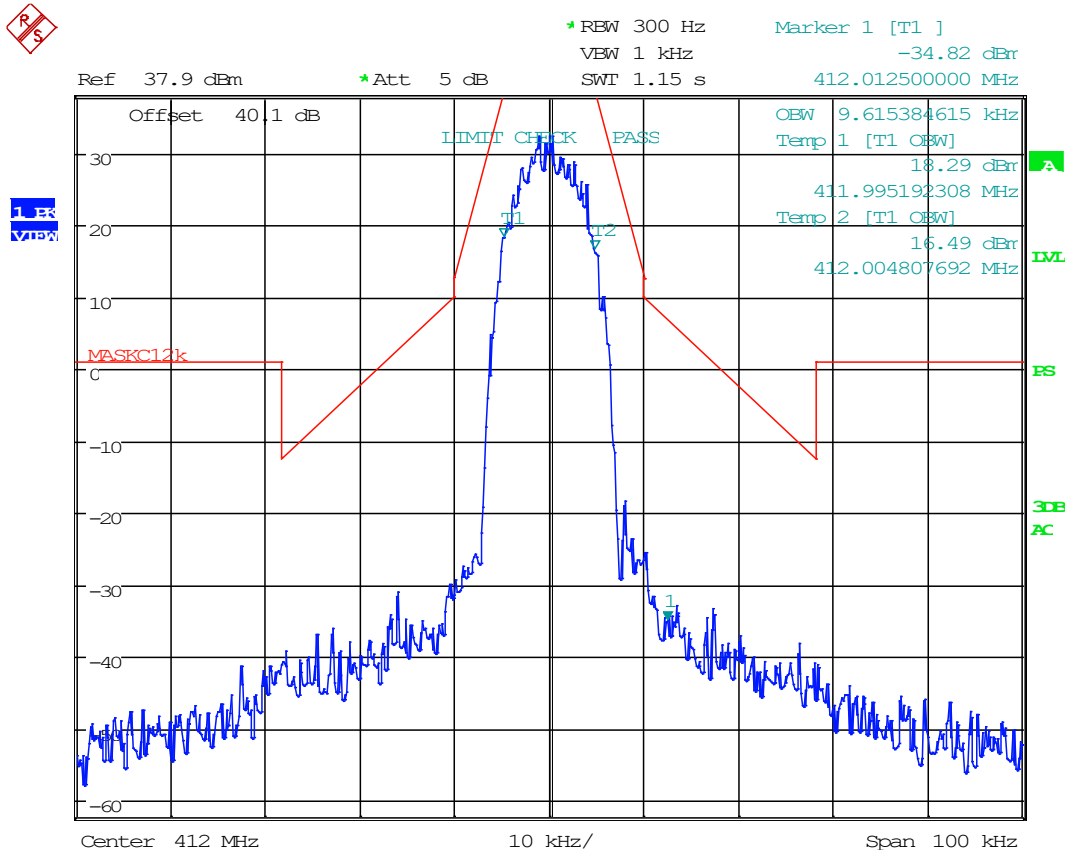


Date: 6.APR.2022 10:12:11

8.5.17 FM, Uplink Mask C, 417 MHz, AGC

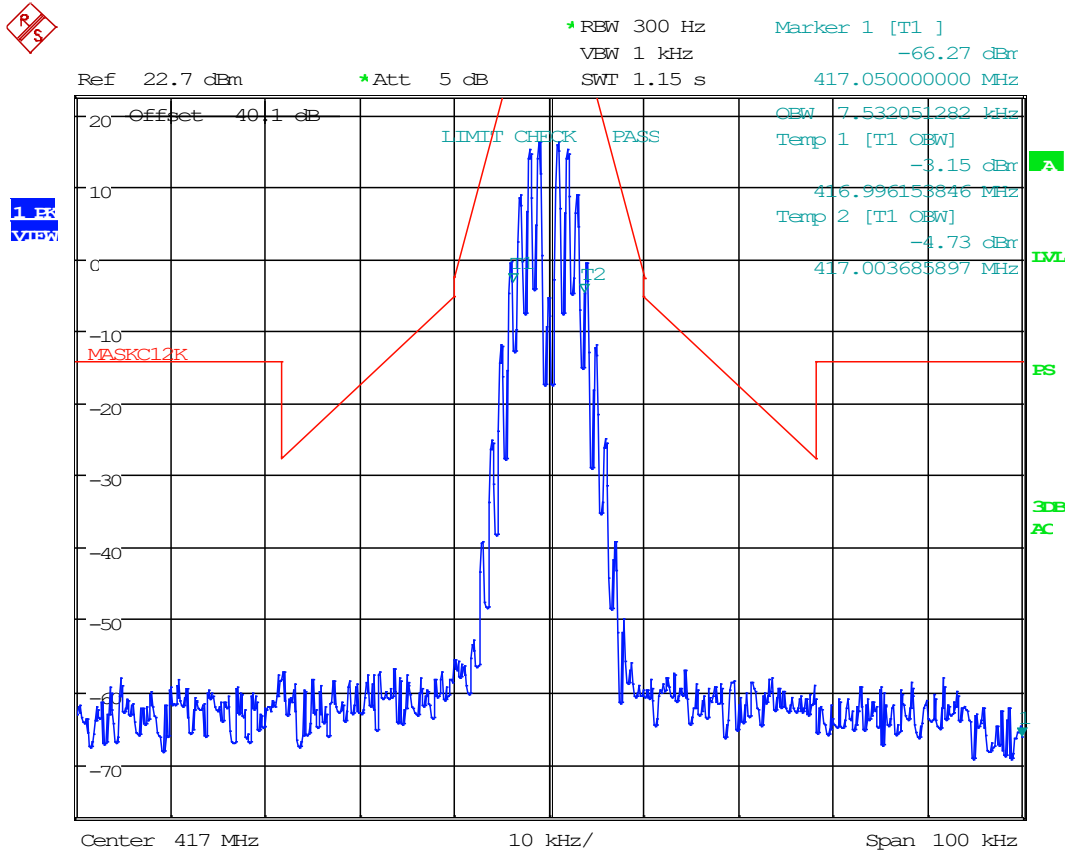


Date: 6.APR.2022 10:57:52

8.5.18 C4FM, Uplink Mask C, 417 MHz, AGC

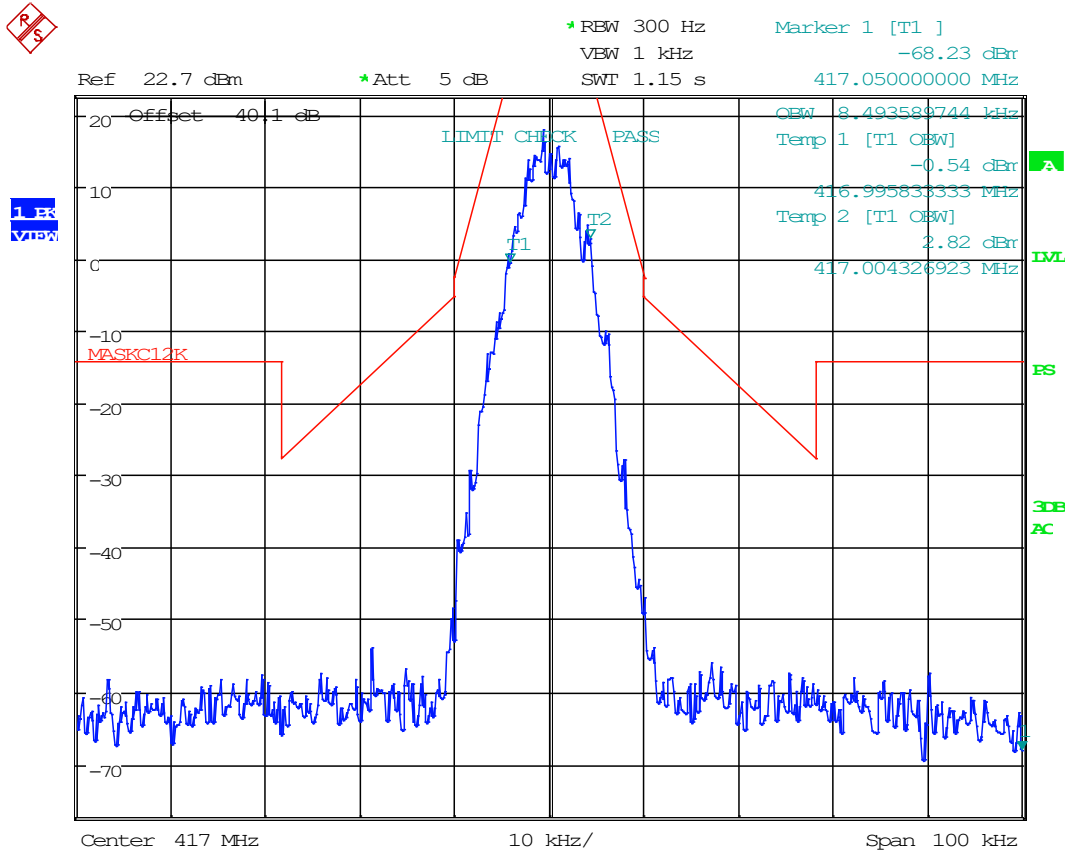


Date: 6.APR.2022 10:59:11

8.5.19 H-CPM, Uplink Mask C, 417 MHz, AGC

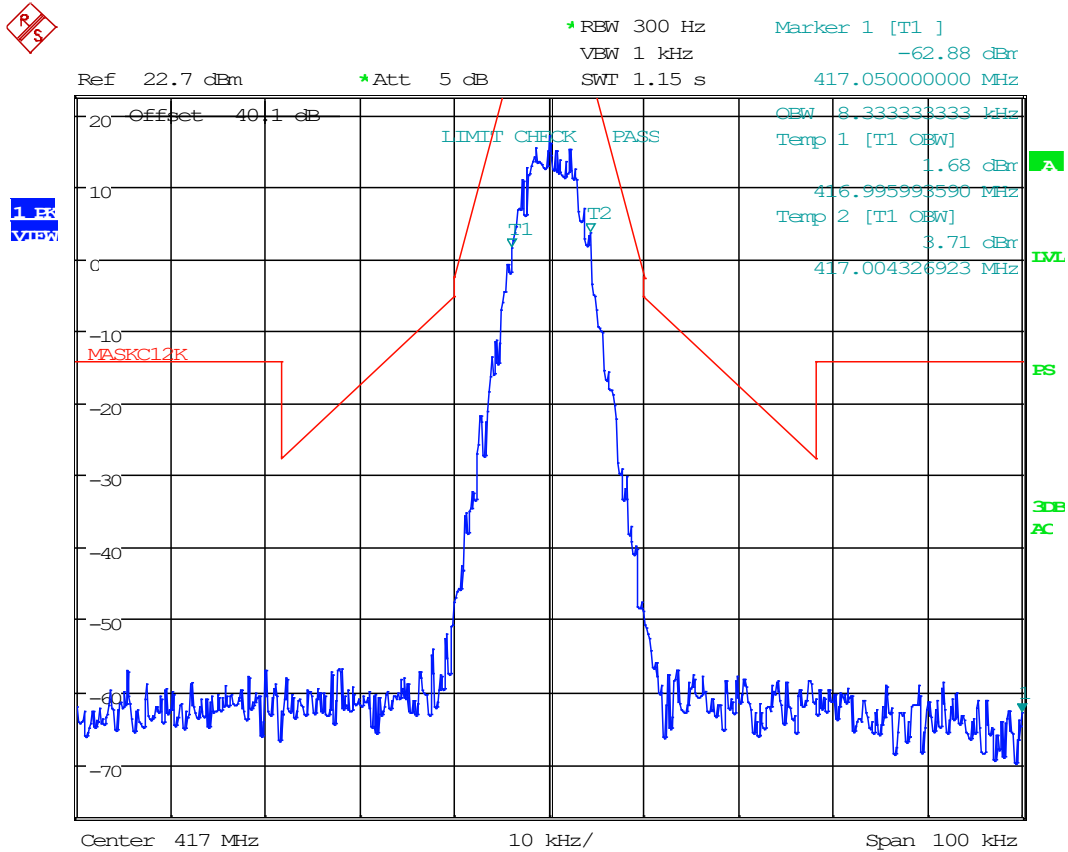


Date: 6.APR.2022 11:00:47

8.5.20 H-DQPSK, Uplink Mask C, 417 MHz, AGC

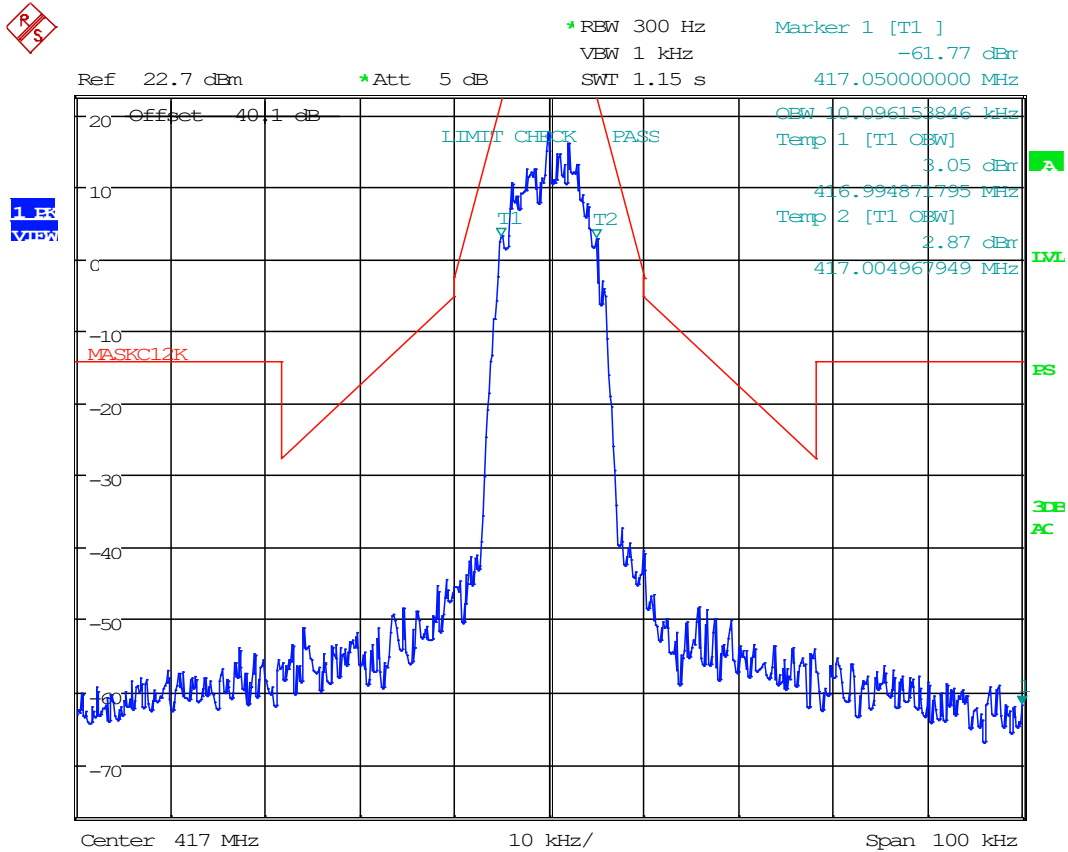


Date: 6.APR.2022 11:01:30

8.5.21 FM, Downlink Mask C, 417 MHz, AGC

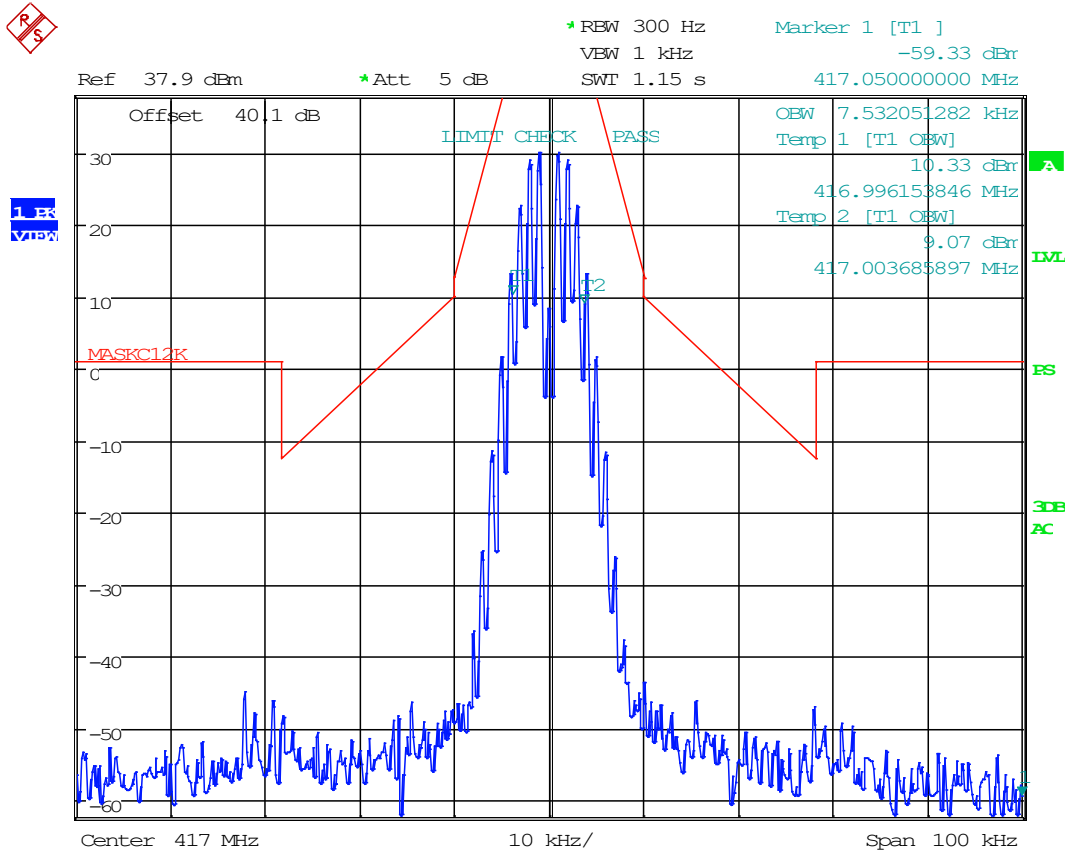


Date: 6.APR.2022 11:05:00

8.5.22 C4FM, Downlink Mask C, 417 MHz, AGC

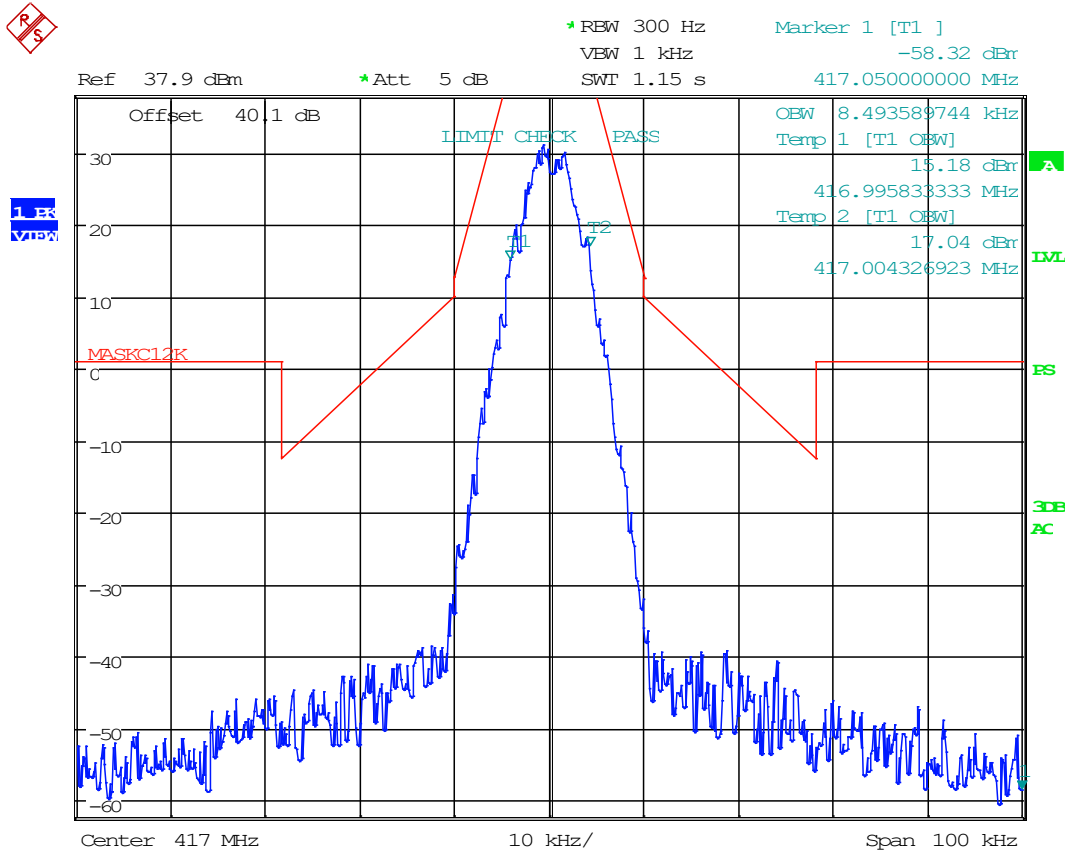


Date: 6.APR.2022 11:15:38

8.5.23 H-CPM, Downlink Mask C, 417 MHz, AGC

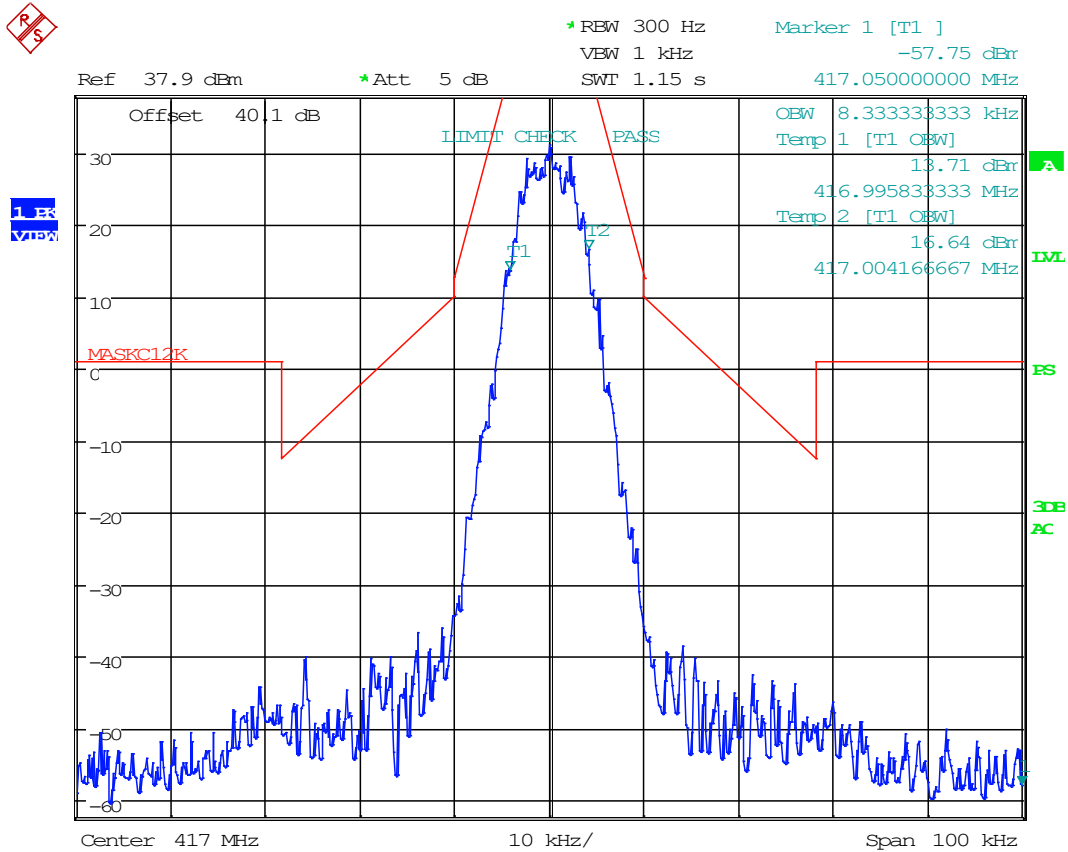


Date: 6.APR.2022 11:12:57

8.5.24 H-DQPSK Downlink Mask C, 417 MHz, AGC

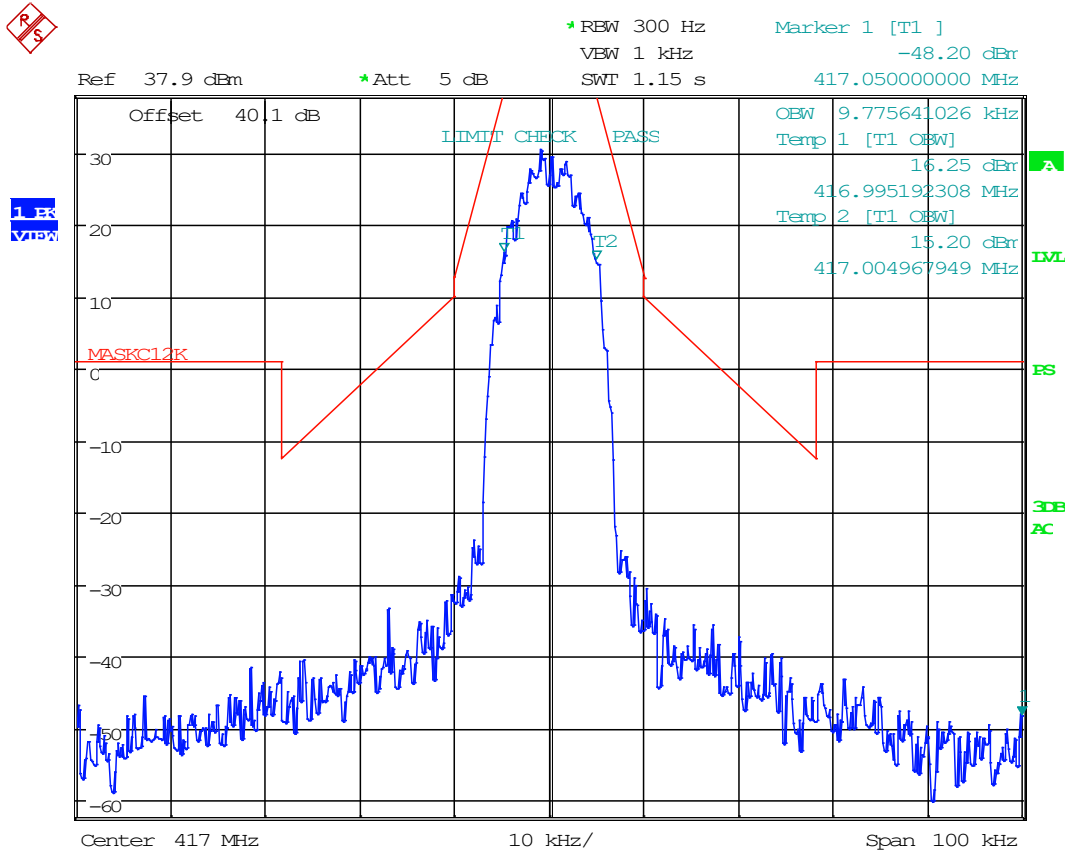


Date: 6.APR.2022 11:13:31

8.5.25 FM, Uplink Mask C, 417 MHz, AGC +3

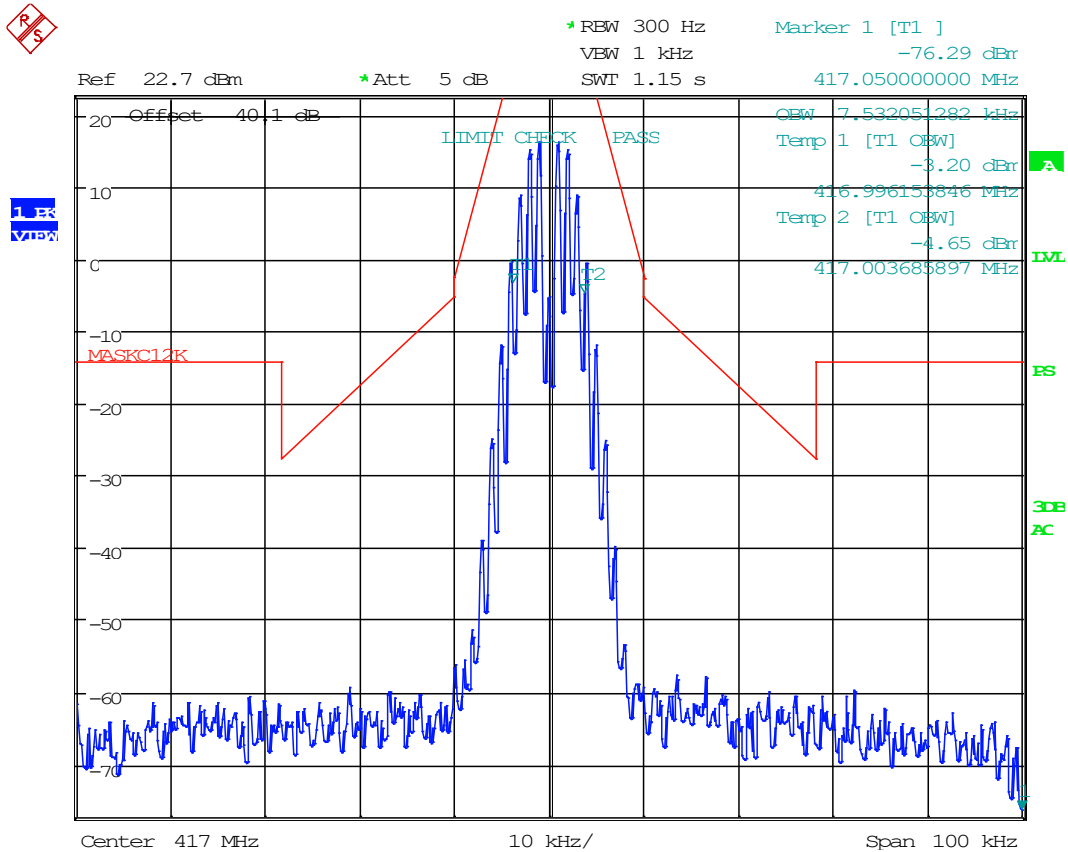


Date: 6.APR.2022 10:58:21

8.5.26 C4FM, Uplink Mask C, 417 MHz, AGC +3

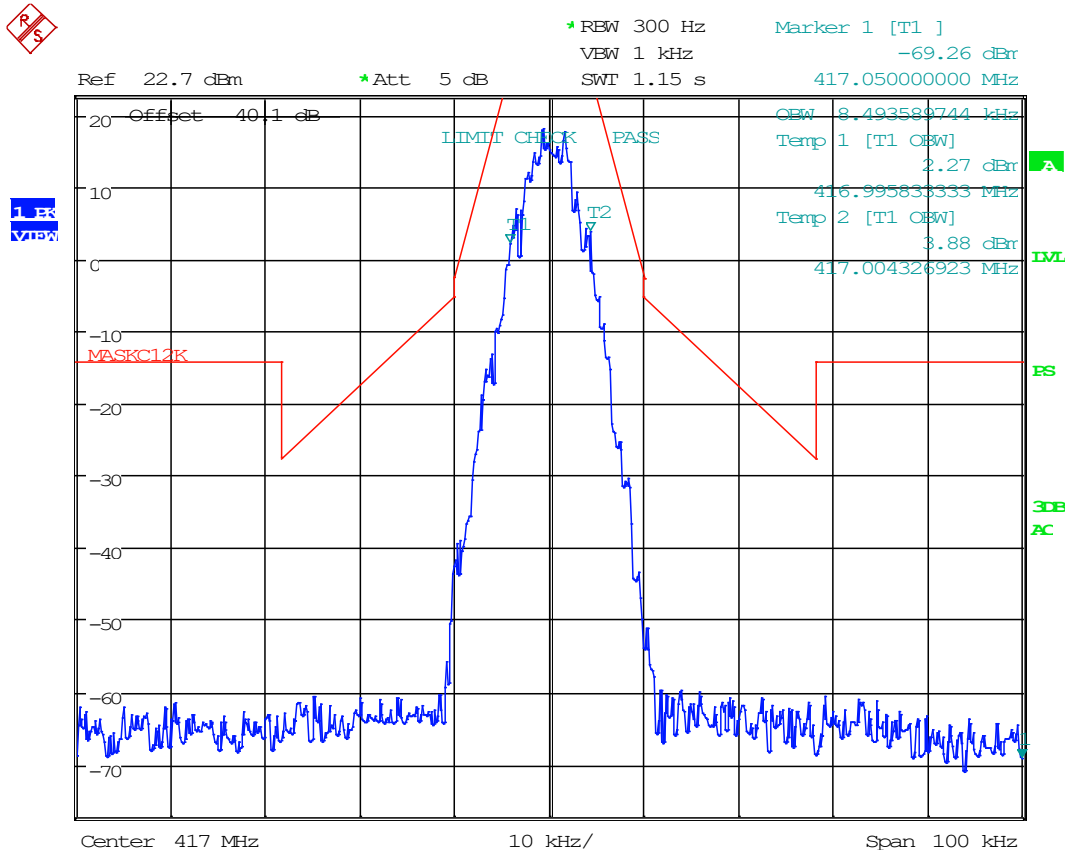


Date: 6.APR.2022 10:59:48

8.5.27 H-CPM, Uplink Mask C, 417 MHz, AGC +3

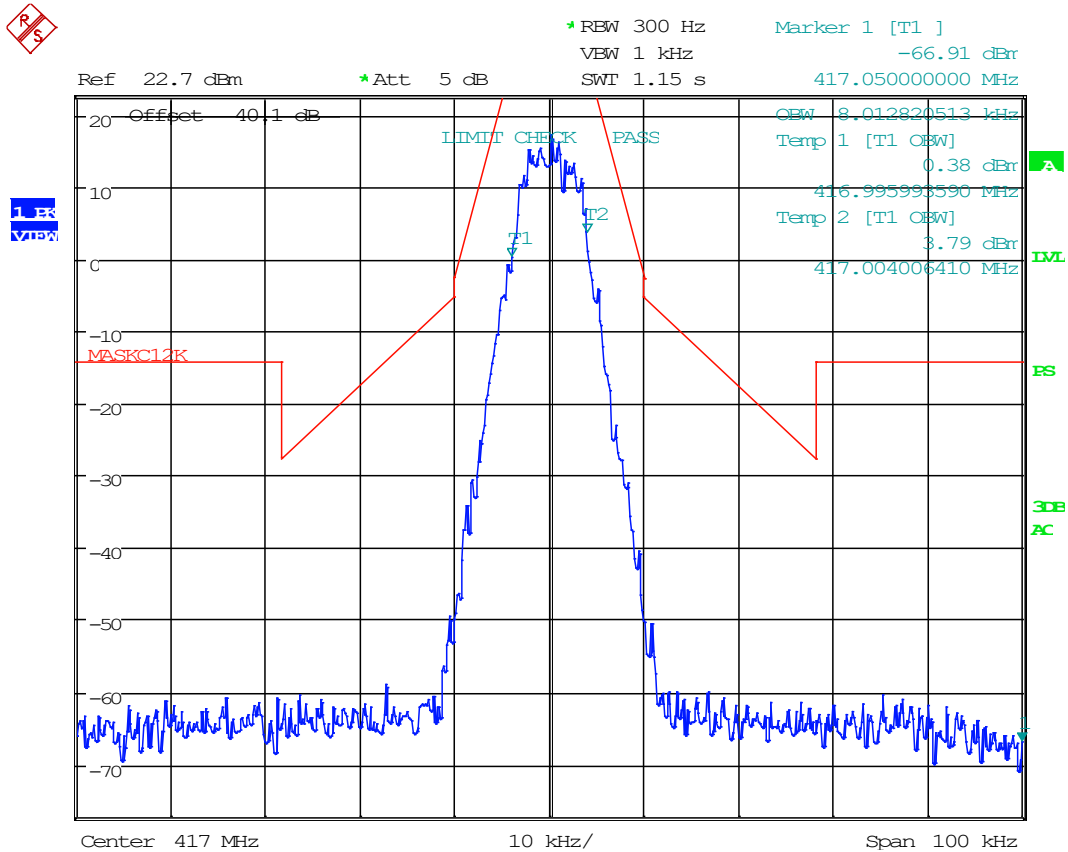


Date: 6.APR.2022 11:00:32

8.5.28 H-DQPSK, Uplink Mask C, 417 MHz, AGC +3

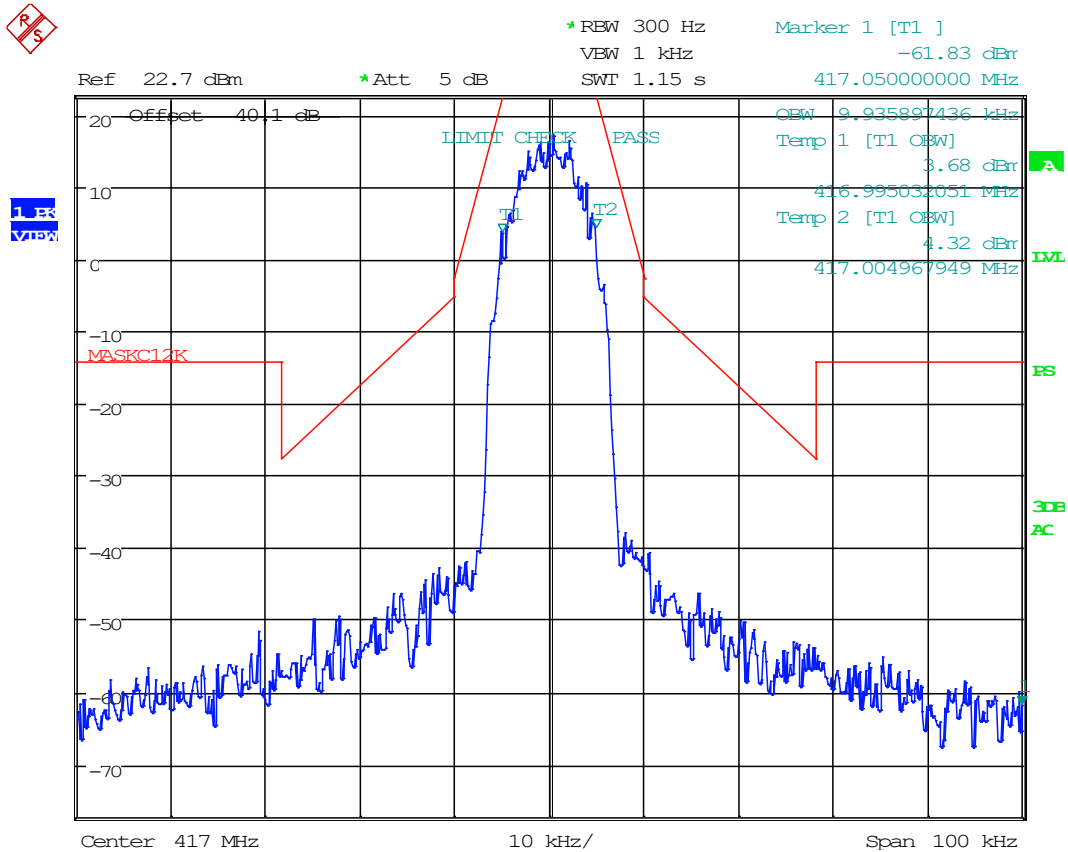


Date: 6.APR.2022 11:01:51

8.5.29 FM, Downlink Mask C, 417 MHz, AGC +3

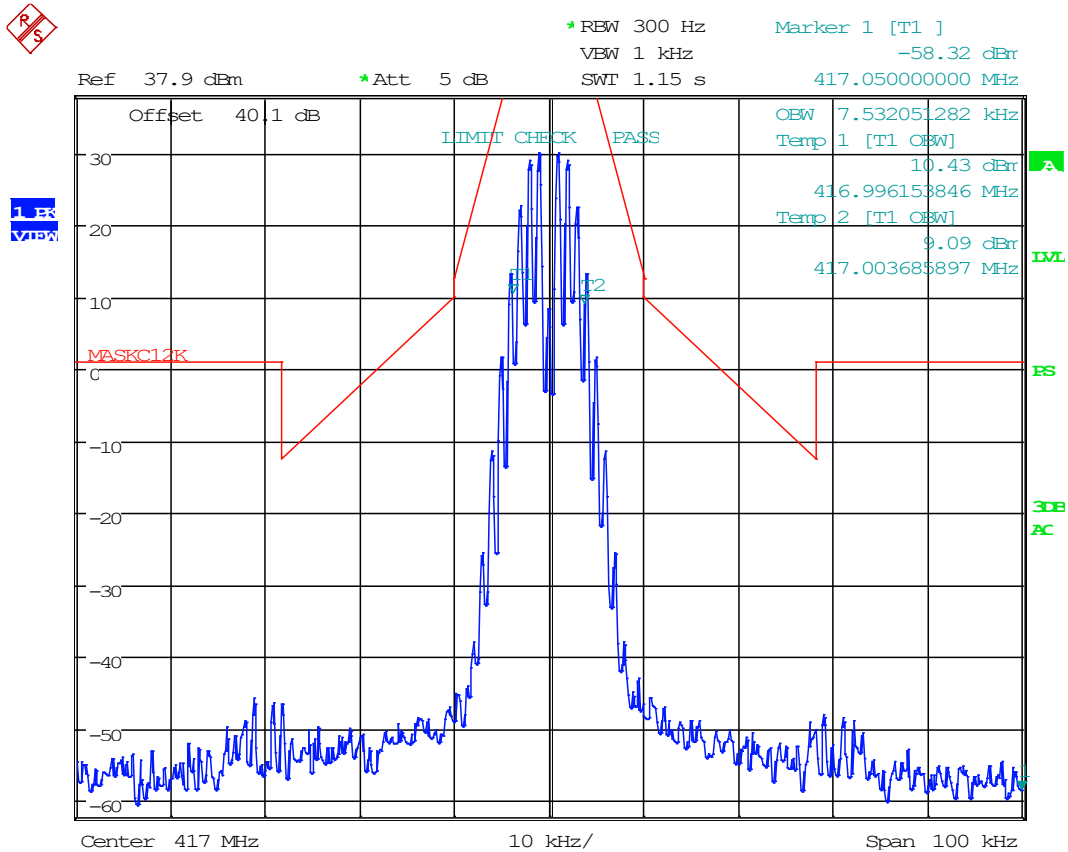


Date: 6.APR.2022 11:05:52

8.5.30 C4FM, Downlink Mask C, 417 MHz, AGC +3

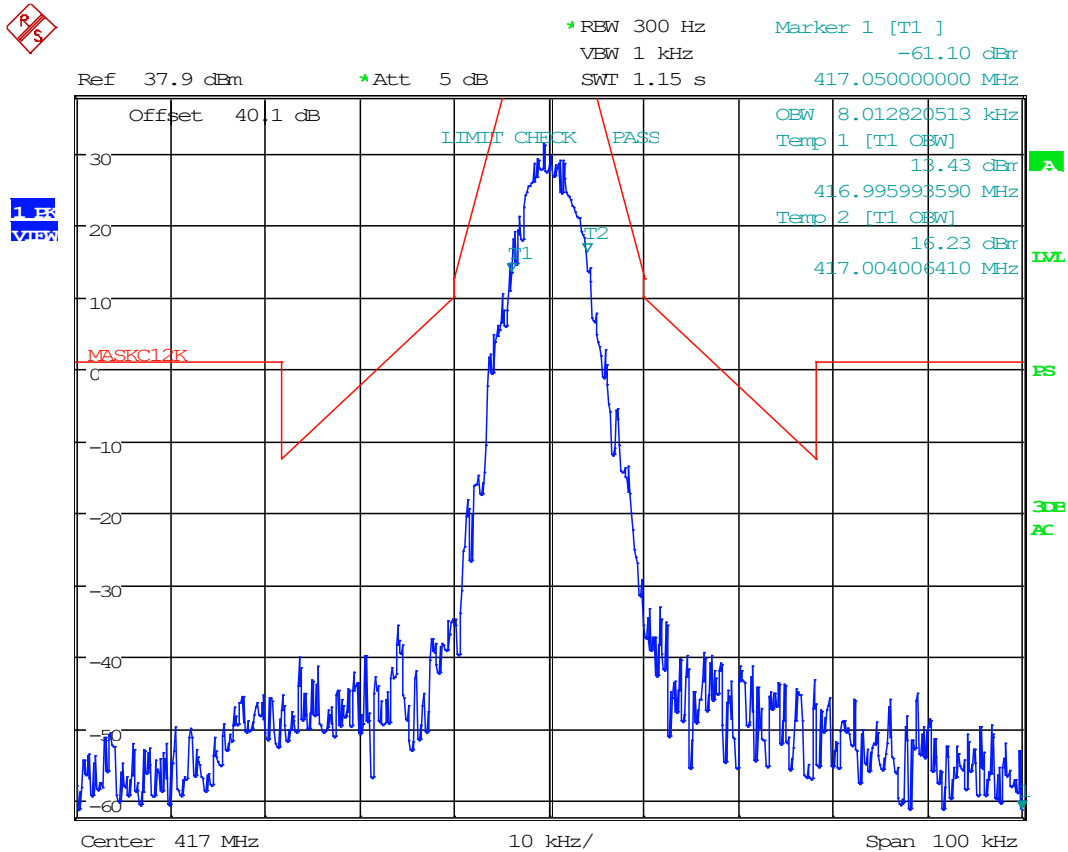


Date: 6.APR.2022 11:15:02

8.5.31 H-CPM, Downlink Mask C, 417 MHz, AGC +3

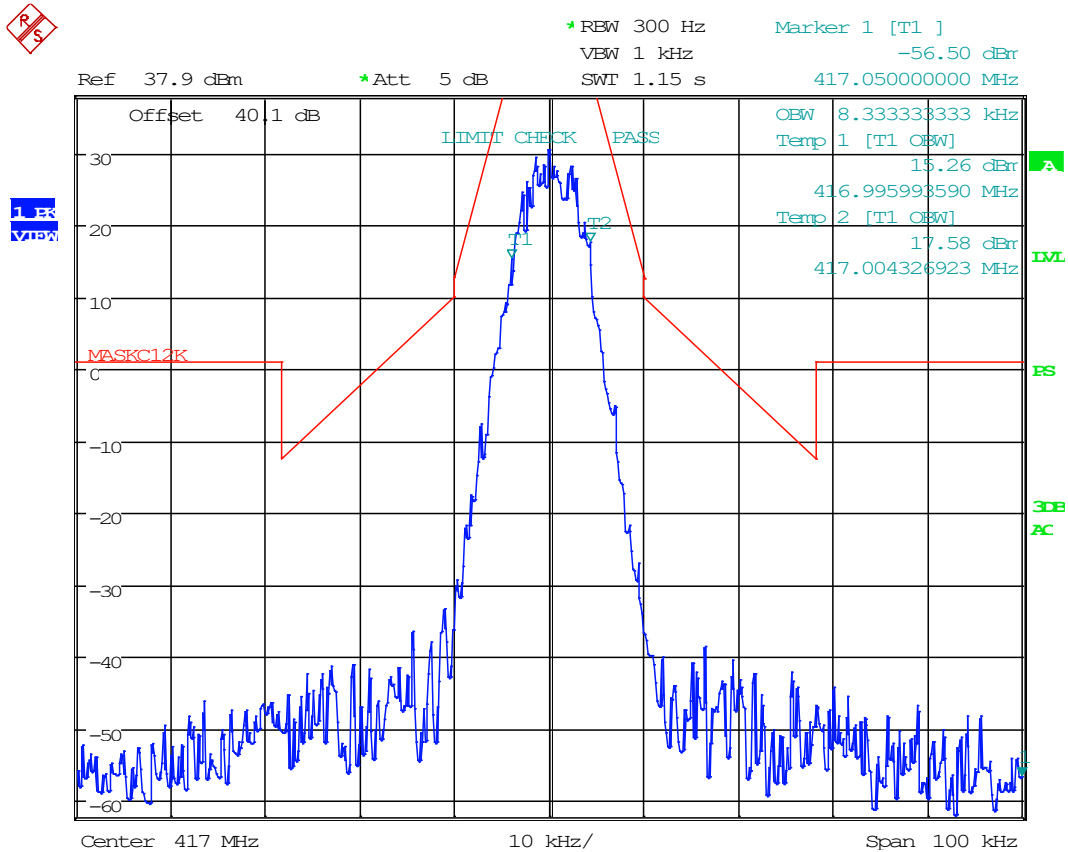


Date: 6.APR.2022 11:12:34

8.5.32 H-DQPSK, Downlink Mask C, 417 MHz, AGC +3

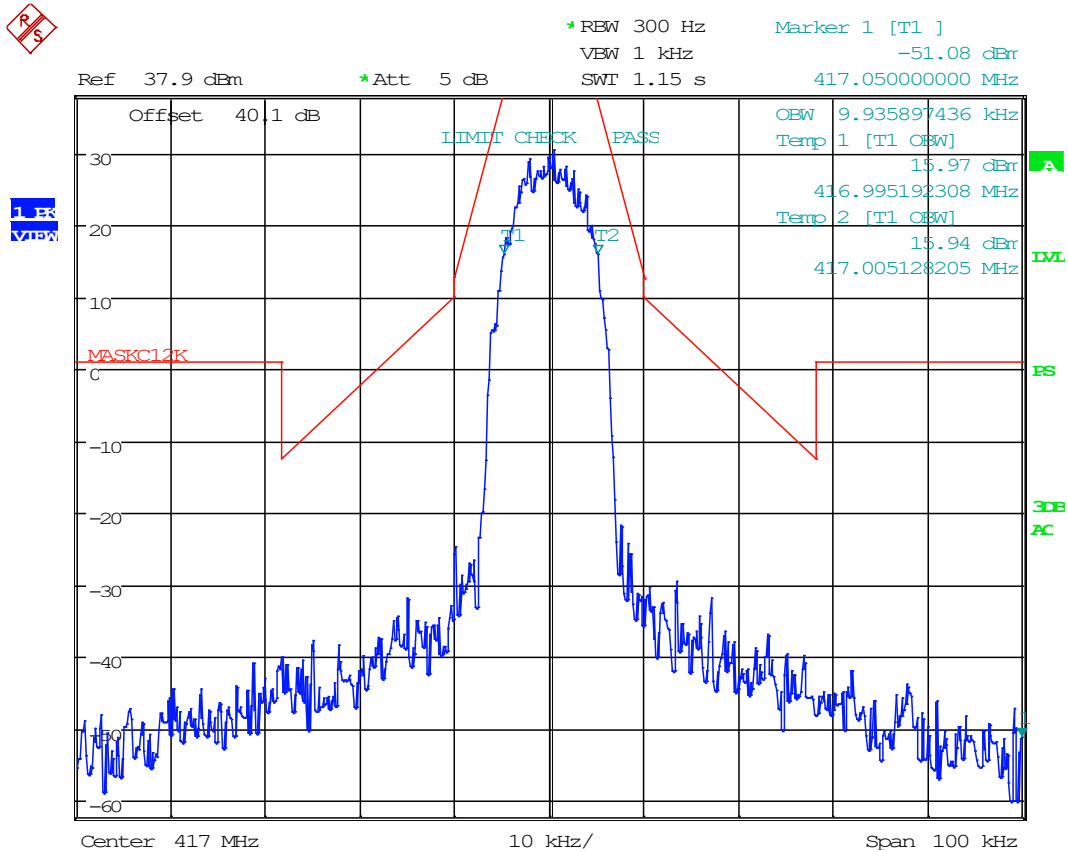


Date: 6.APR.2022 11:13:54

8.5.33 FM, Uplink Mask D, 412 MHz, AGC

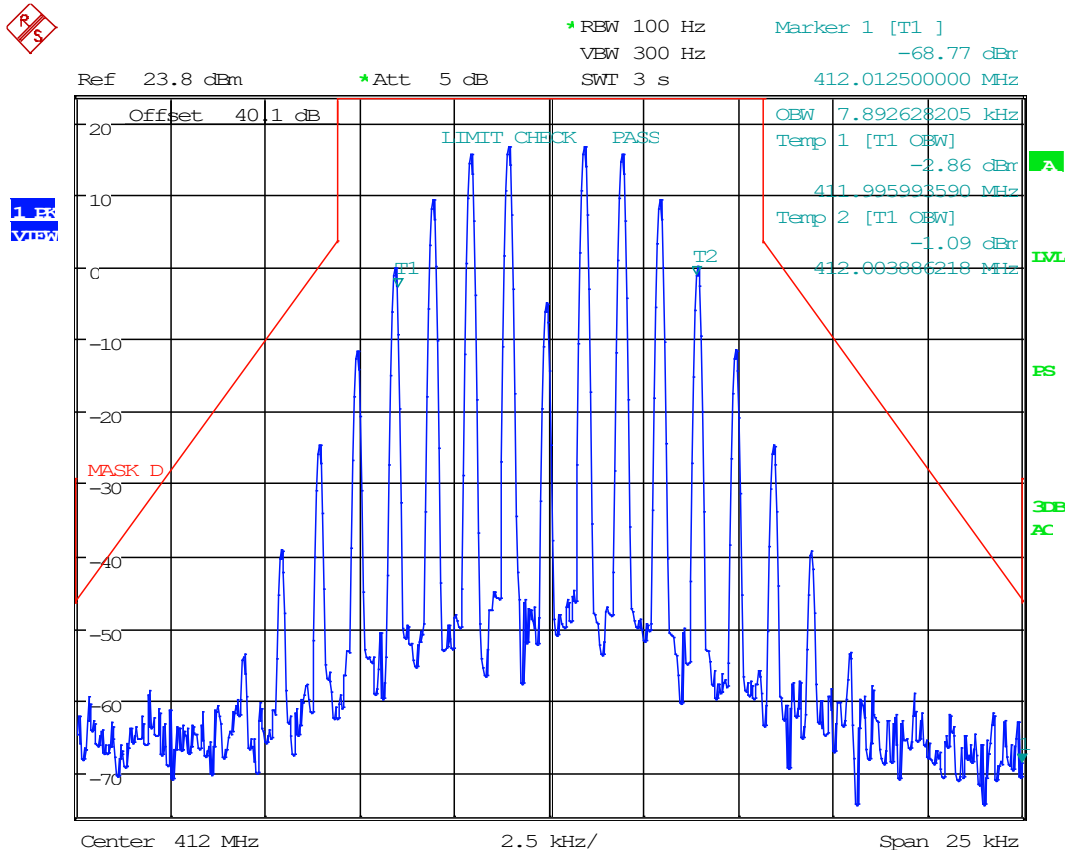


Date: 5.APR.2022 17:03:05

8.5.34 C4FM, Uplink Mask D, 412 MHz, AGC

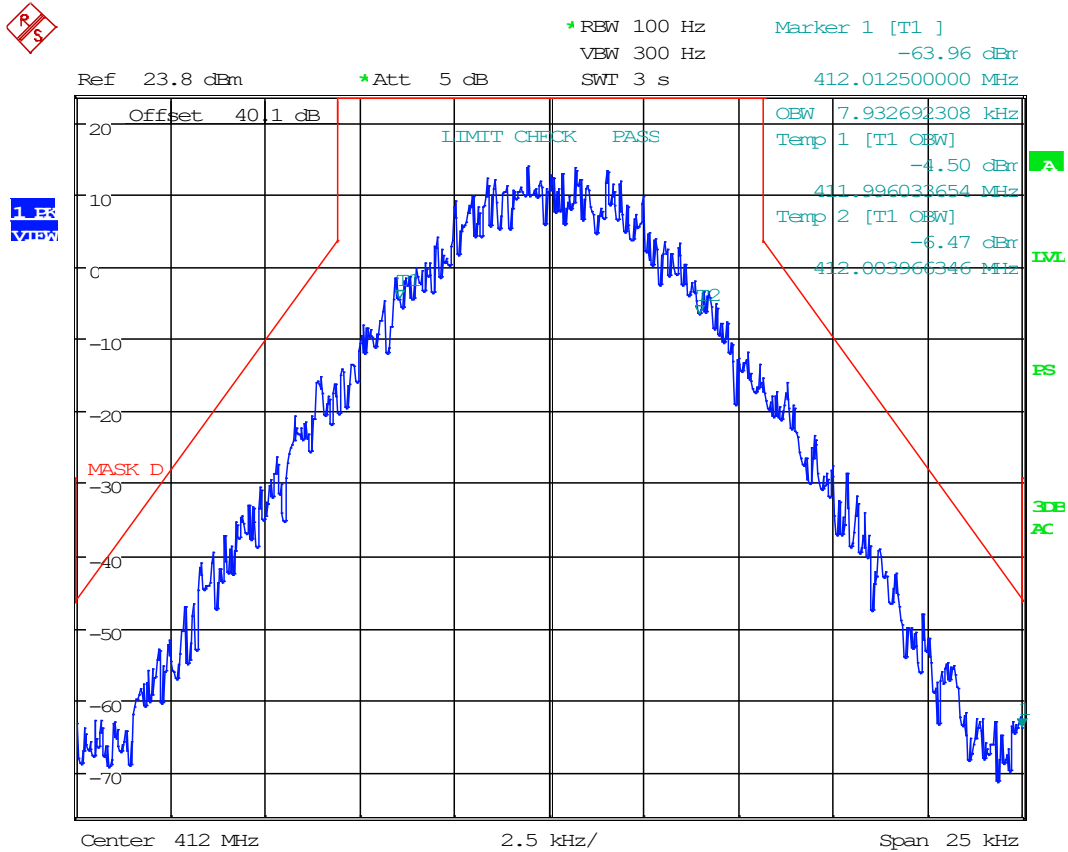


Date: 5.APR.2022 17:04:27

8.5.35 H-CPM, Uplink Mask D, 412 MHz, AGC

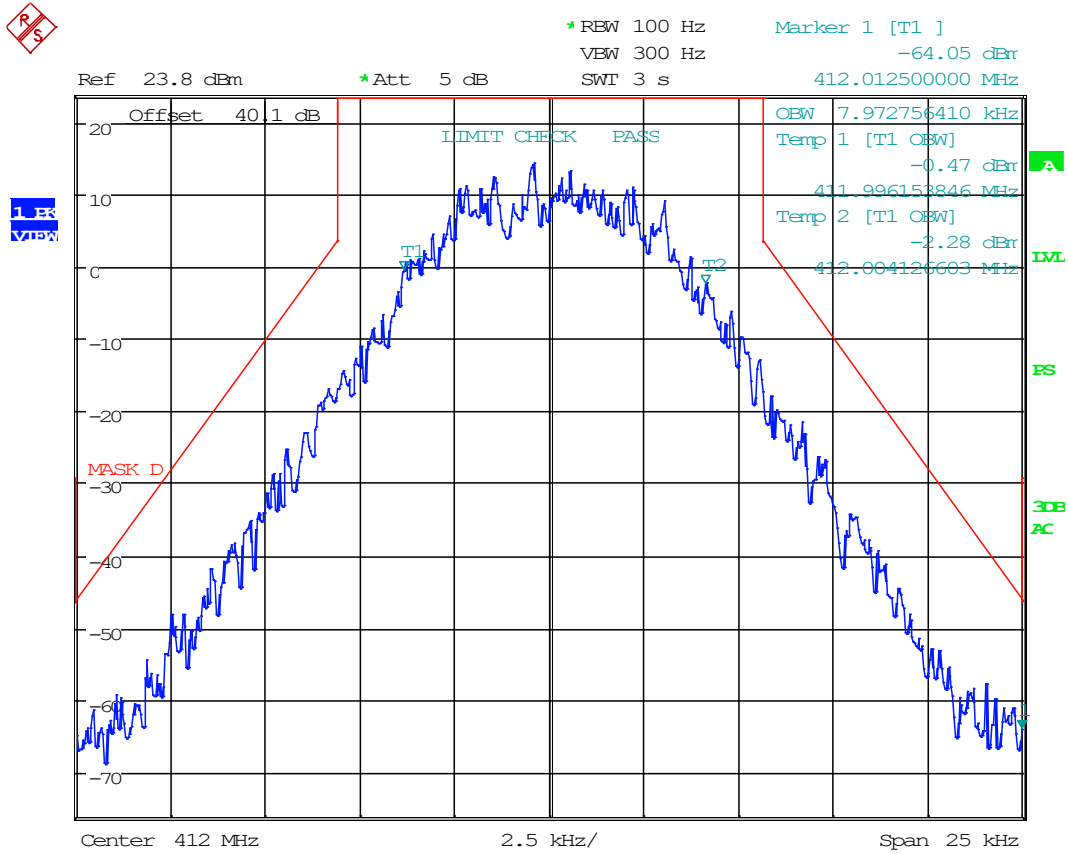

Date: 5.APR.2022 17:05:57


8.5.36 H-DQPSK, Uplink Mask D, 412 MHz, AGC

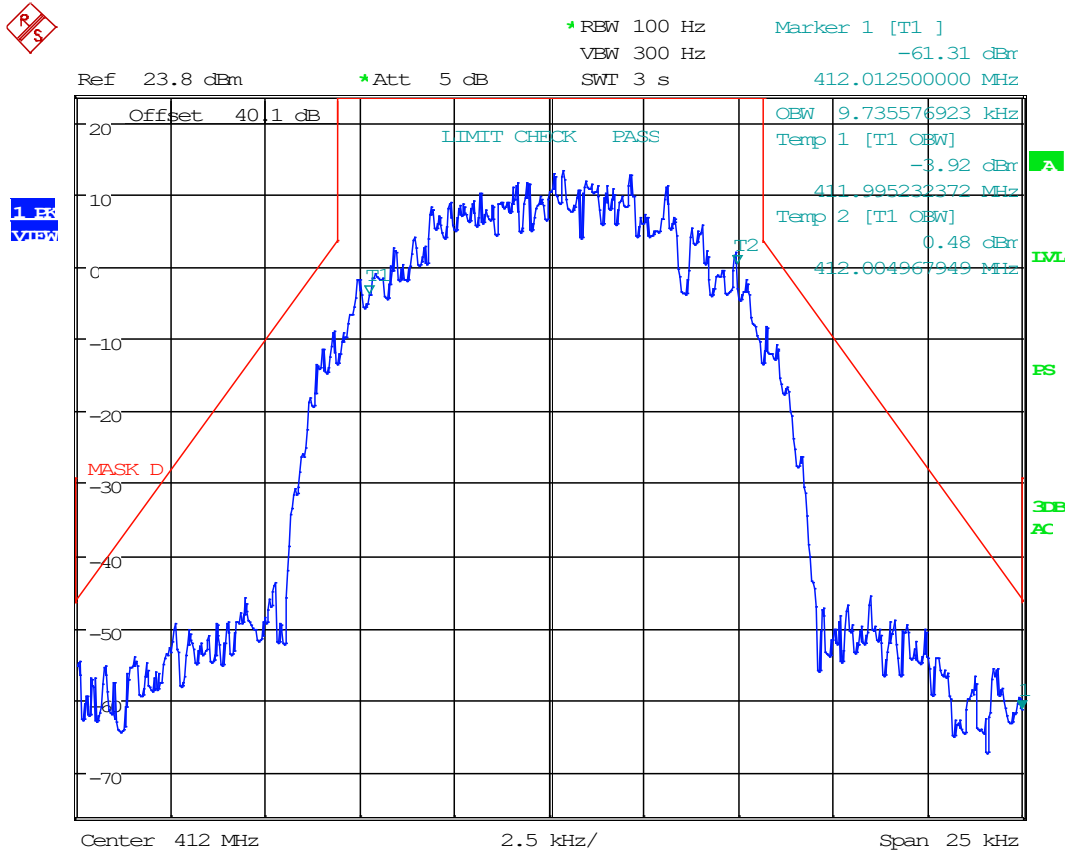

Date: 5.APR.2022 17:07:43




8.5.37 FM, Downlink Mask D, 412 MHz, AGC

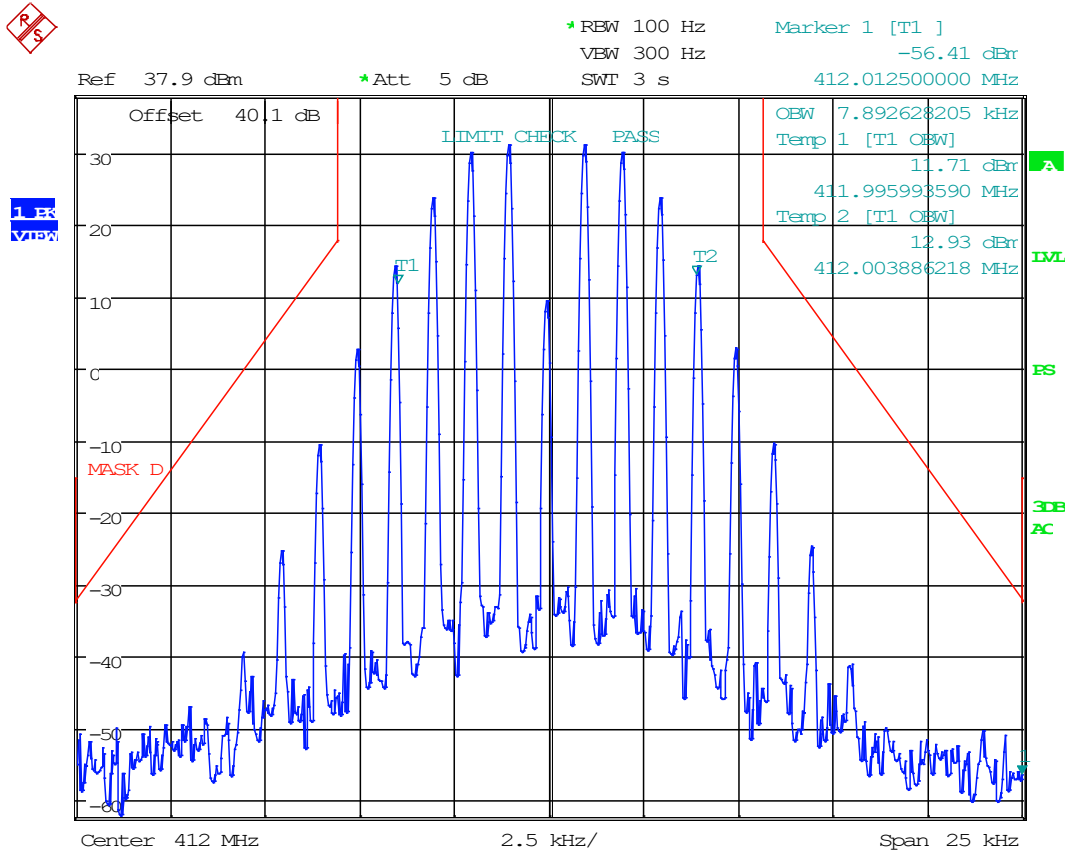

Date: 5.APR.2022 16:54:14




8.5.38 C4FM, Downlink Mask D, 412 MHz, AGC

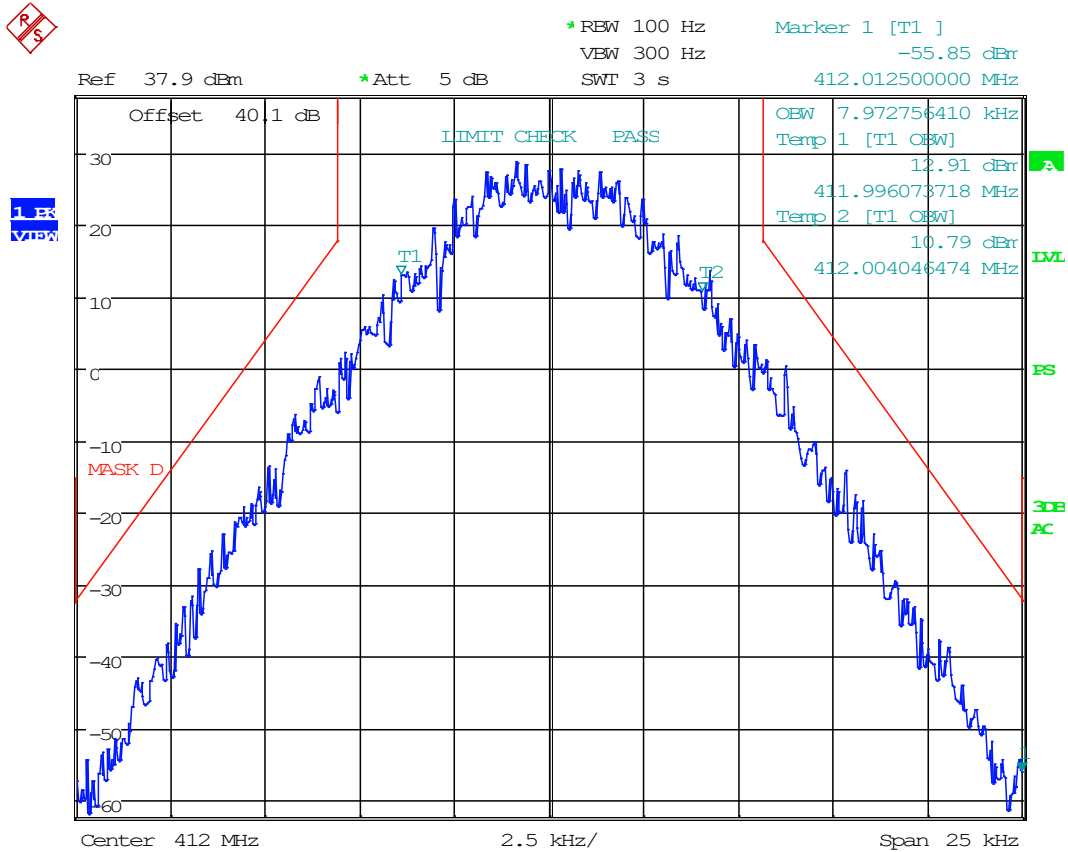

Date: 5.APR.2022 16:57:14




8.5.39 H-CPM, Downlink Mask D, 412 MHz, AGC

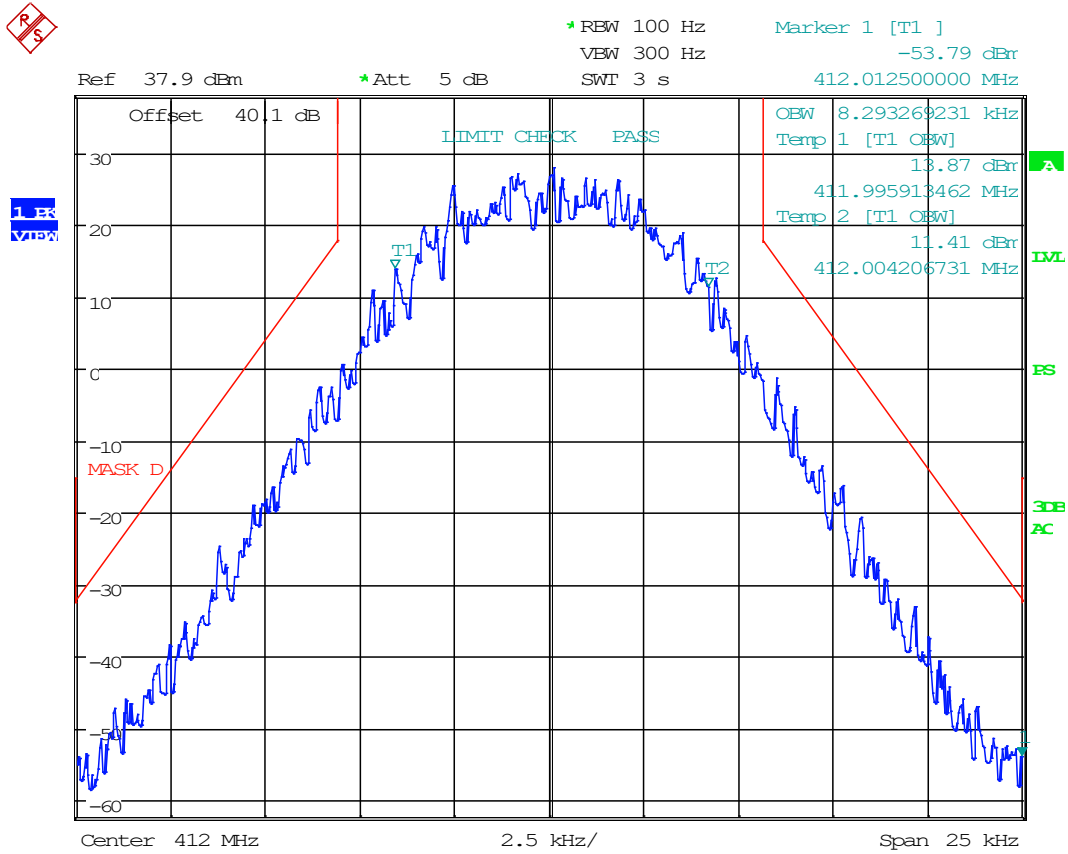


Date: 5.APR.2022 16:59:17

8.5.40 H-DQPSK Downlink Mask D, 412 MHz, AGC

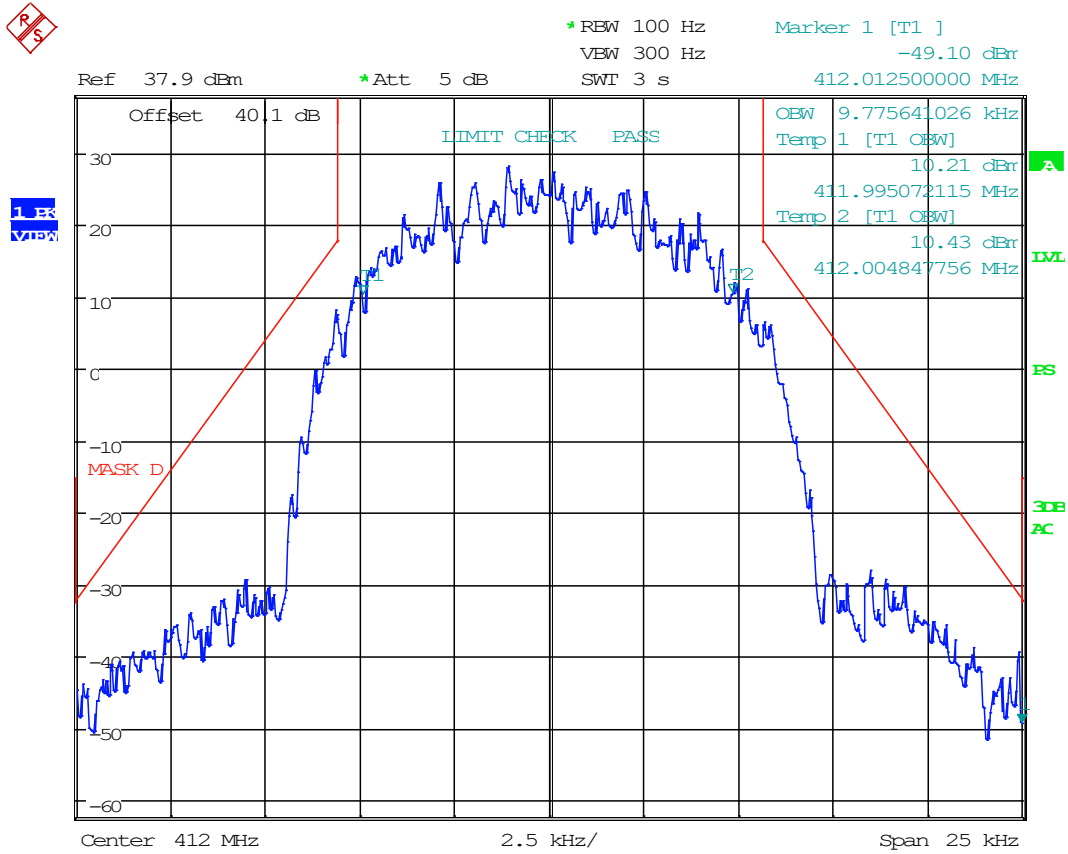


Date: 5.APR.2022 16:59:51

8.5.41 FM, Uplink Mask D, 412 MHz, AGC +3

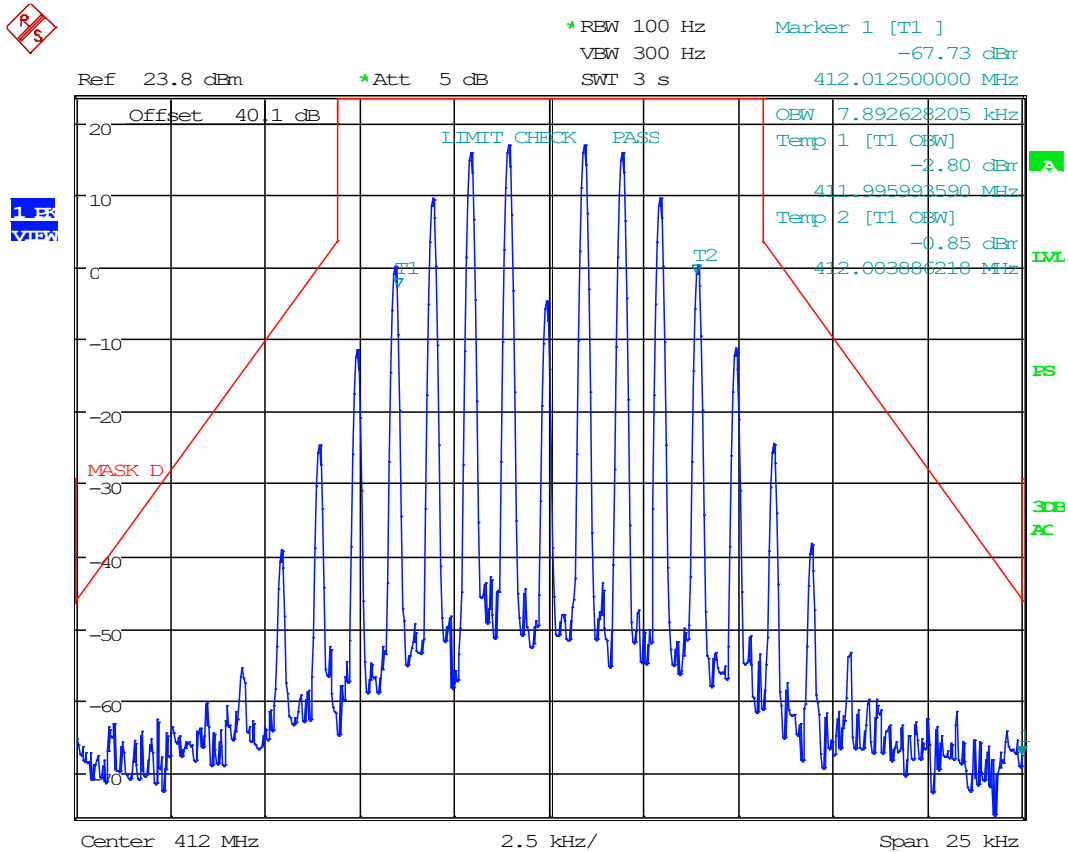


Date: 5.APR.2022 17:03:28

8.5.42 C4FM, Uplink Mask D, 412 MHz, AGC +3

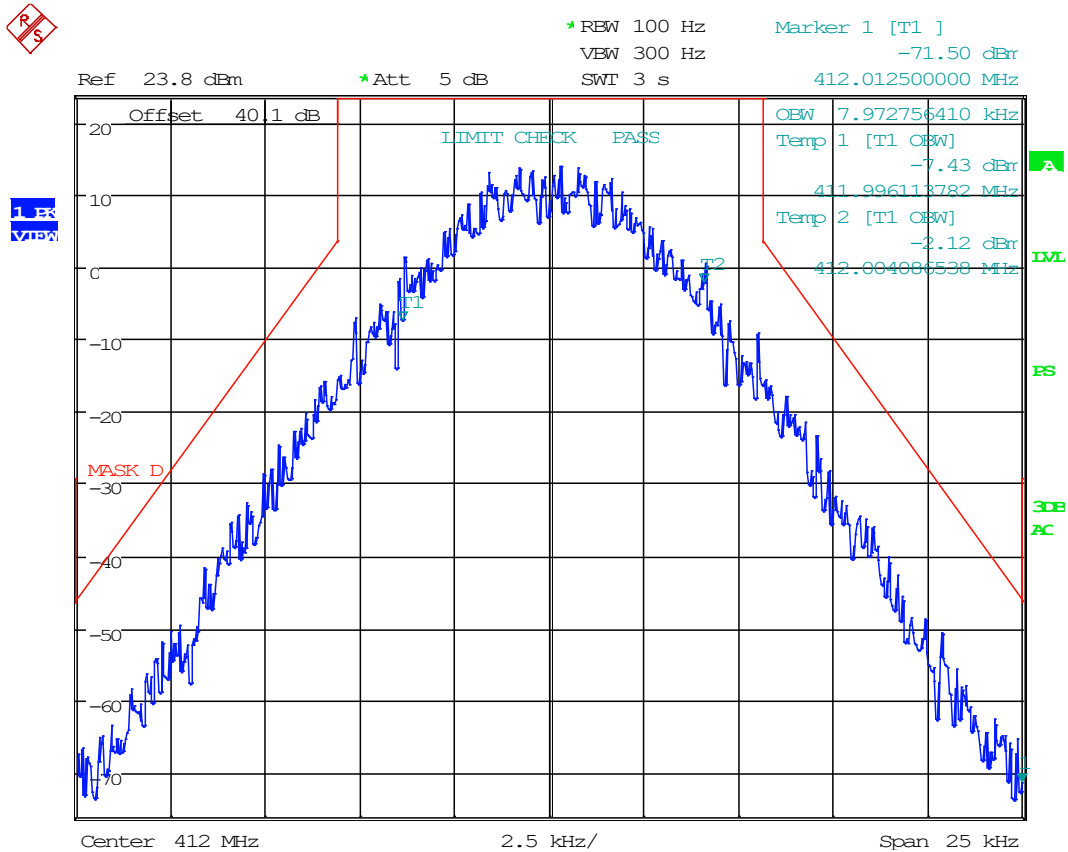


Date: 5.APR.2022 17:05:02

8.5.43 H-CPM, Uplink Mask D, 412 MHz, AGC +3

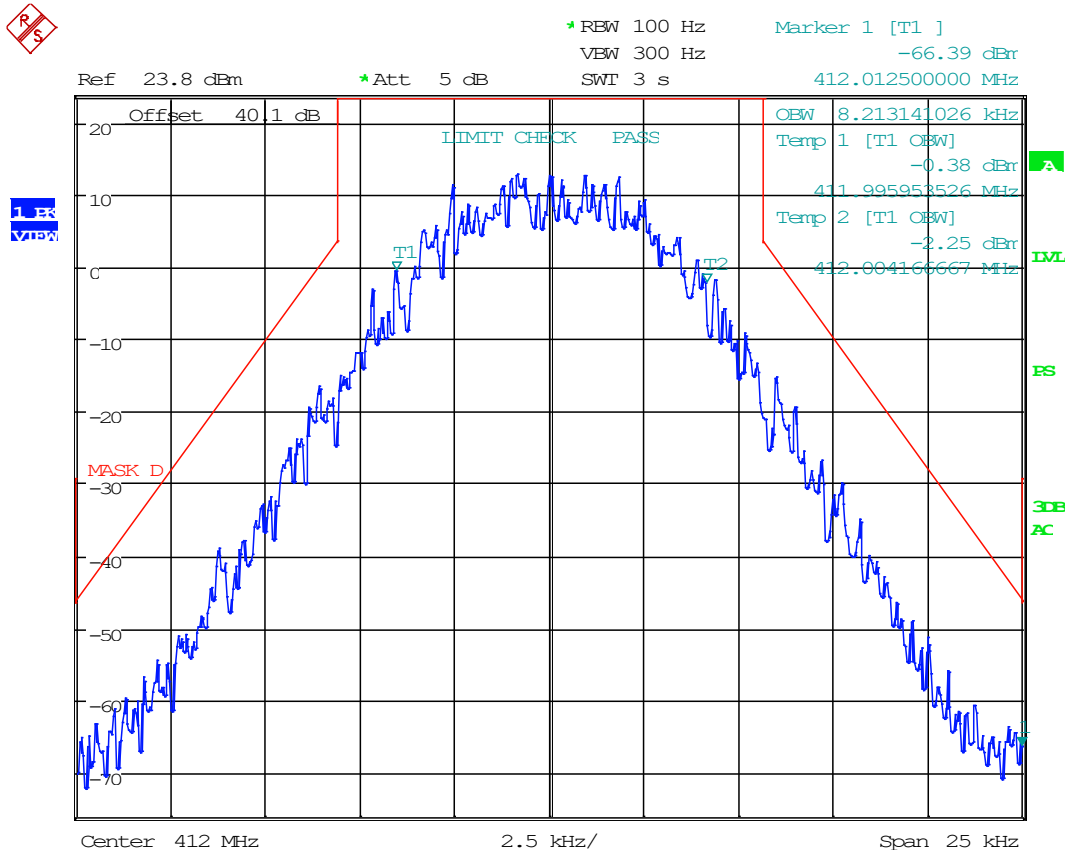


Date: 5.APR.2022 17:05:35

8.5.44 H-DQPSK, Uplink Mask D, 412 MHz, AGC +3

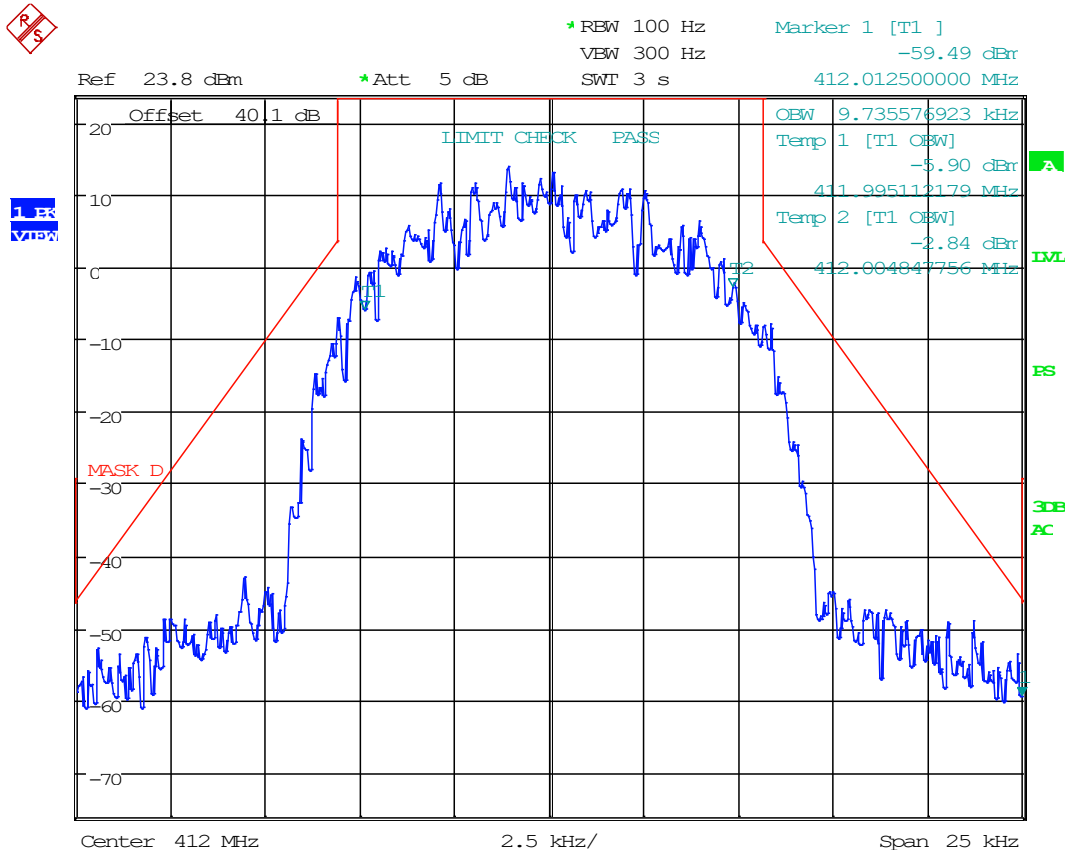


Date: 5.APR.2022 17:08:09

8.5.45 FM, Downlink Mask D, 412 MHz, AGC +3

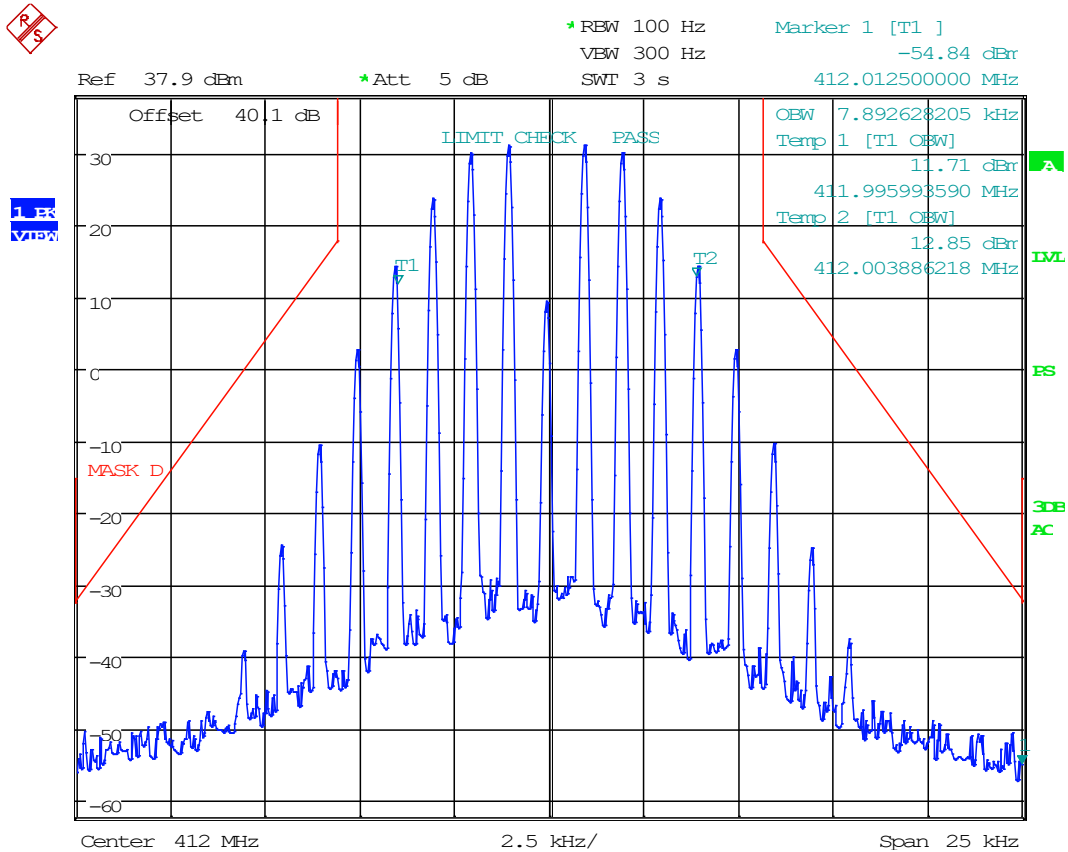


Date: 5.APR.2022 16:55:26

8.5.46 C4FM, Downlink Mask D, 412 MHz, AGC +3

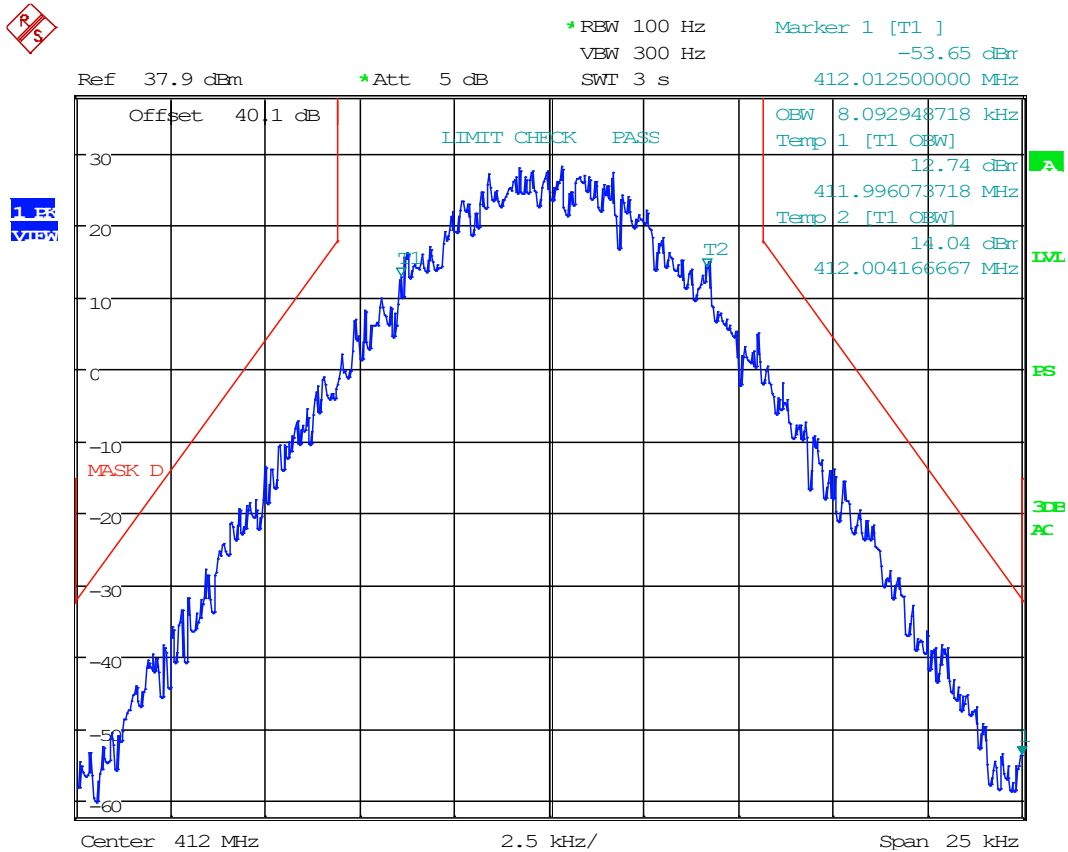


Date: 5.APR.2022 16:57:54

8.5.47 H-CPM, Downlink Mask D, 412 MHz, AGC +3

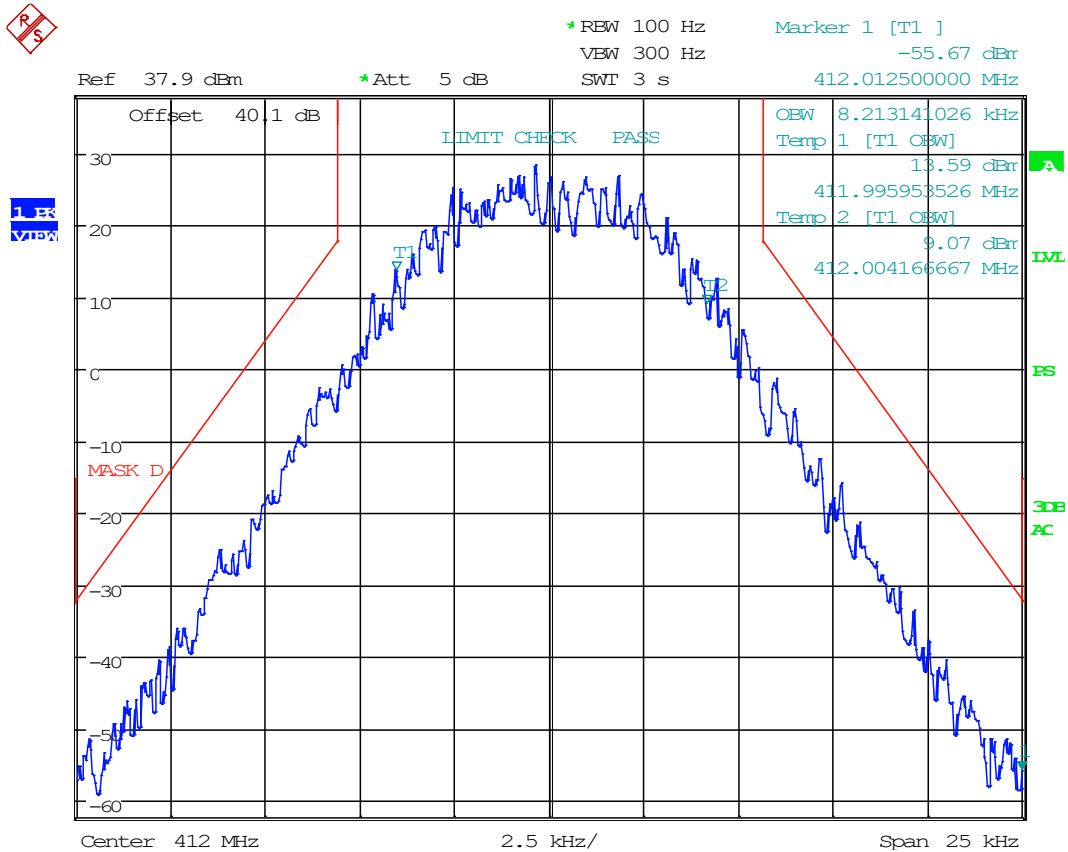

Date: 5.APR.2022 16:58:40


8.5.48 H-DQPSK, Downlink Mask D, 412MHz, AGC +3

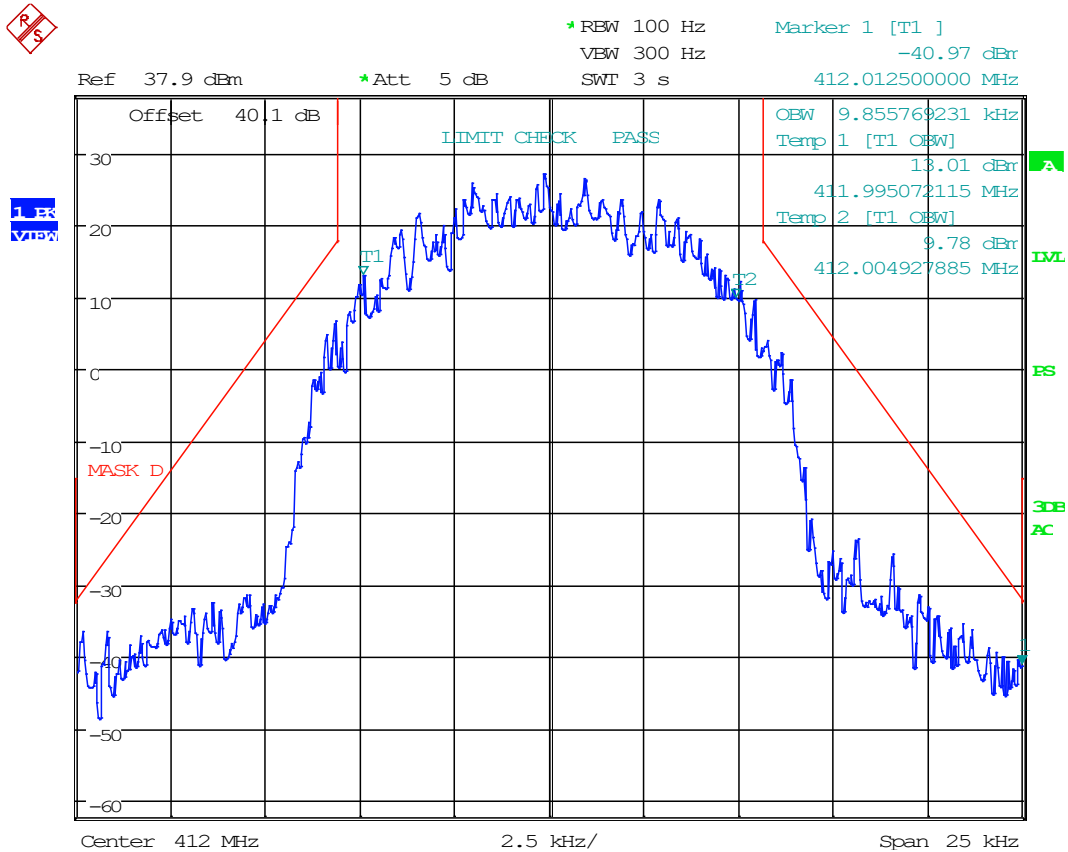

Date: 5.APR.2022 17:00:32




8.5.49 FM, Uplink Mask D, 417 MHz, AGC

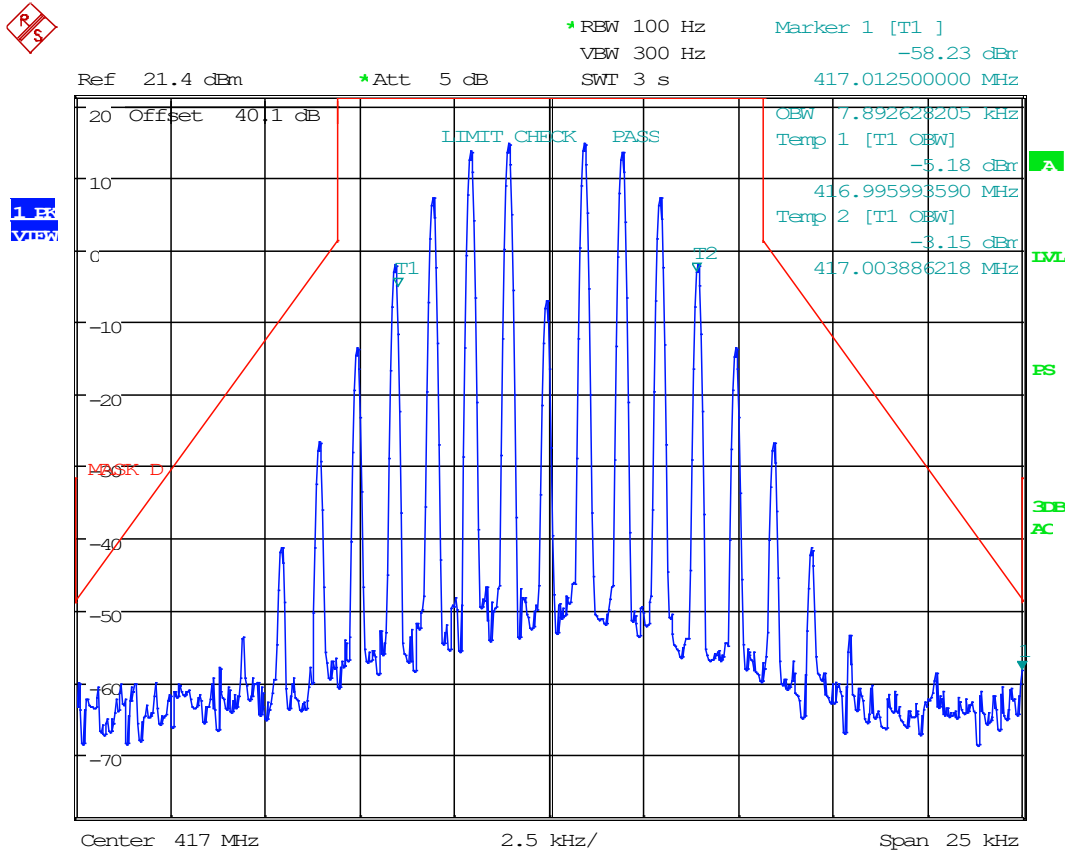

Date: 5.APR.2022 15:43:27




8.5.50 C4FM, Uplink Mask D, 417 MHz, AGC

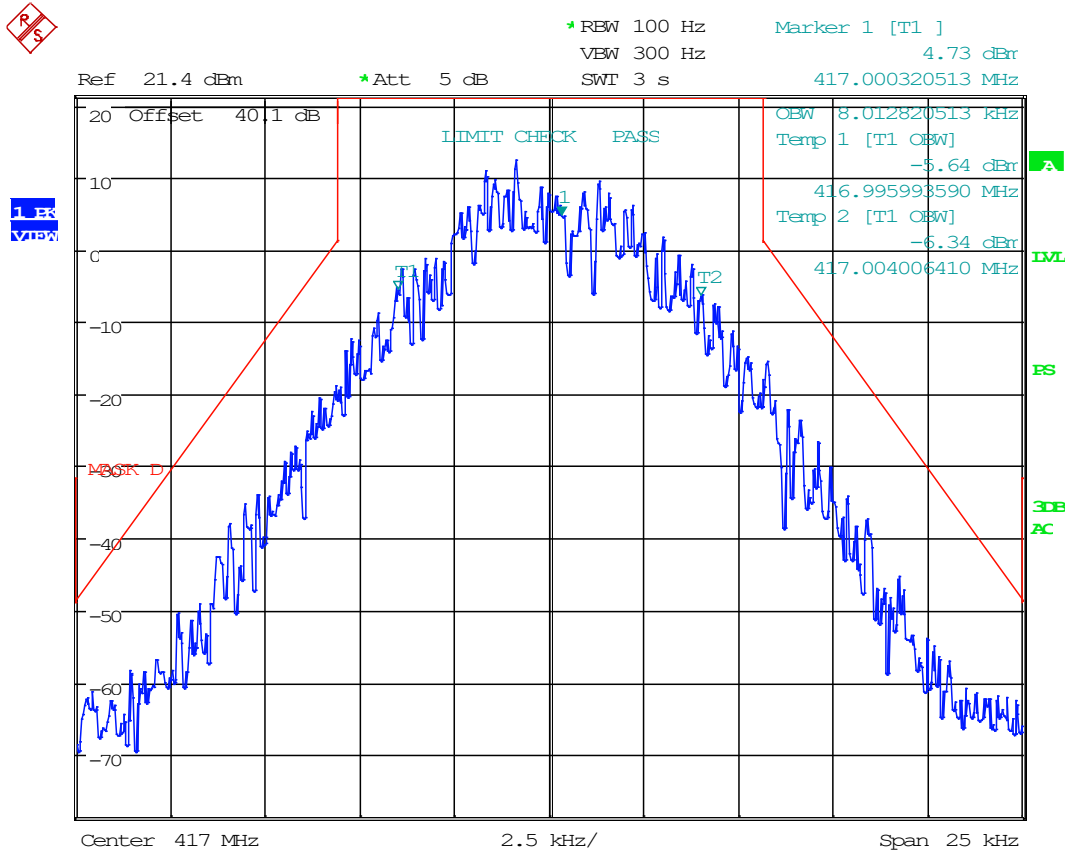

Date: 5.APR.2022 15:45:59




8.5.51 H-CPM, Uplink Mask D, 417 MHz, AGC

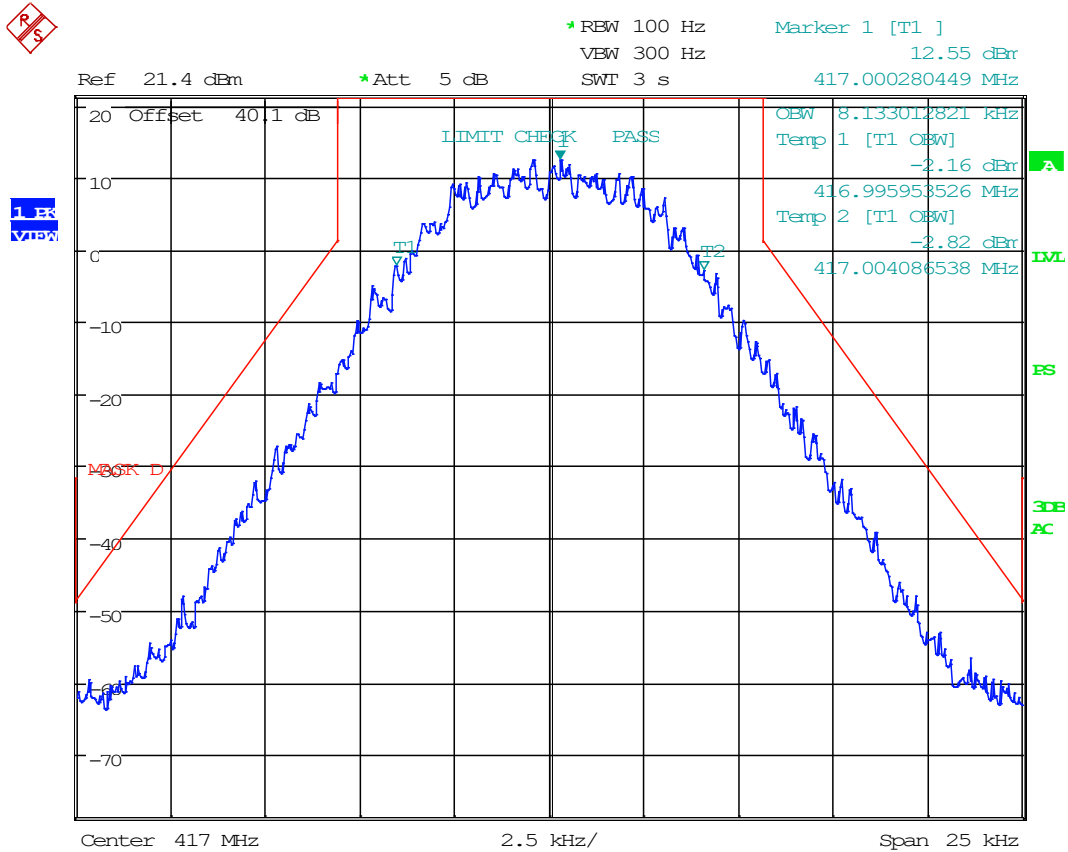

Date: 5.APR.2022 15:51:17




8.5.52 H-DQPSK, Uplink Mask D, 417 MHz, AGC

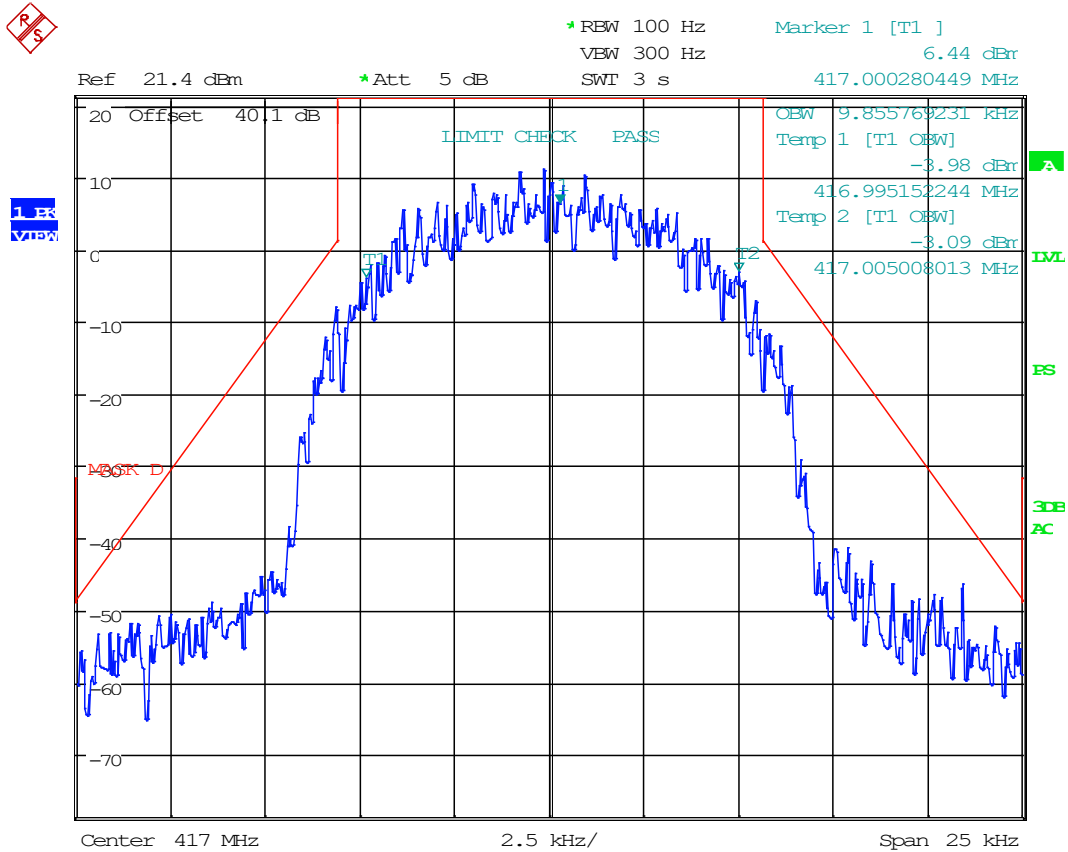

Date: 5.APR.2022 15:53:17




8.5.53 FM, Downlink Mask D, 417 MHz, AGC

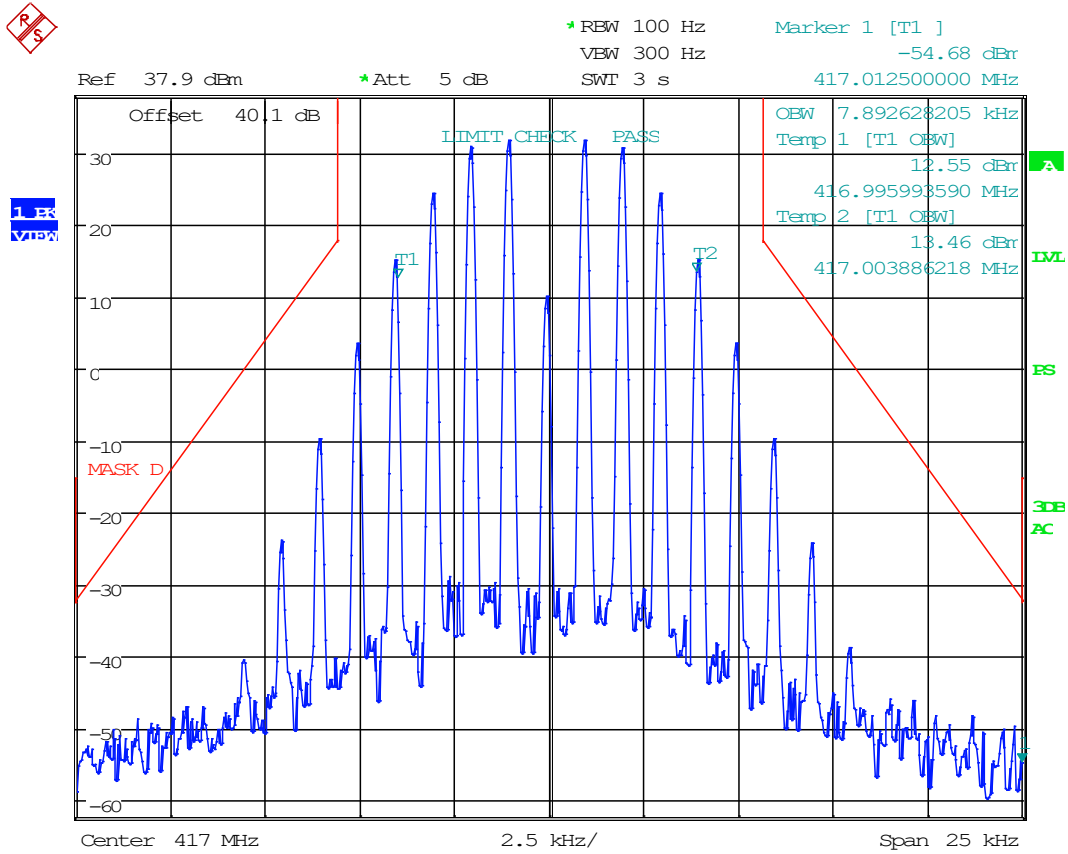

Date: 5.APR.2022 13:55:28




8.5.54 C4FM, Downlink Mask D, 417 MHz, AGC

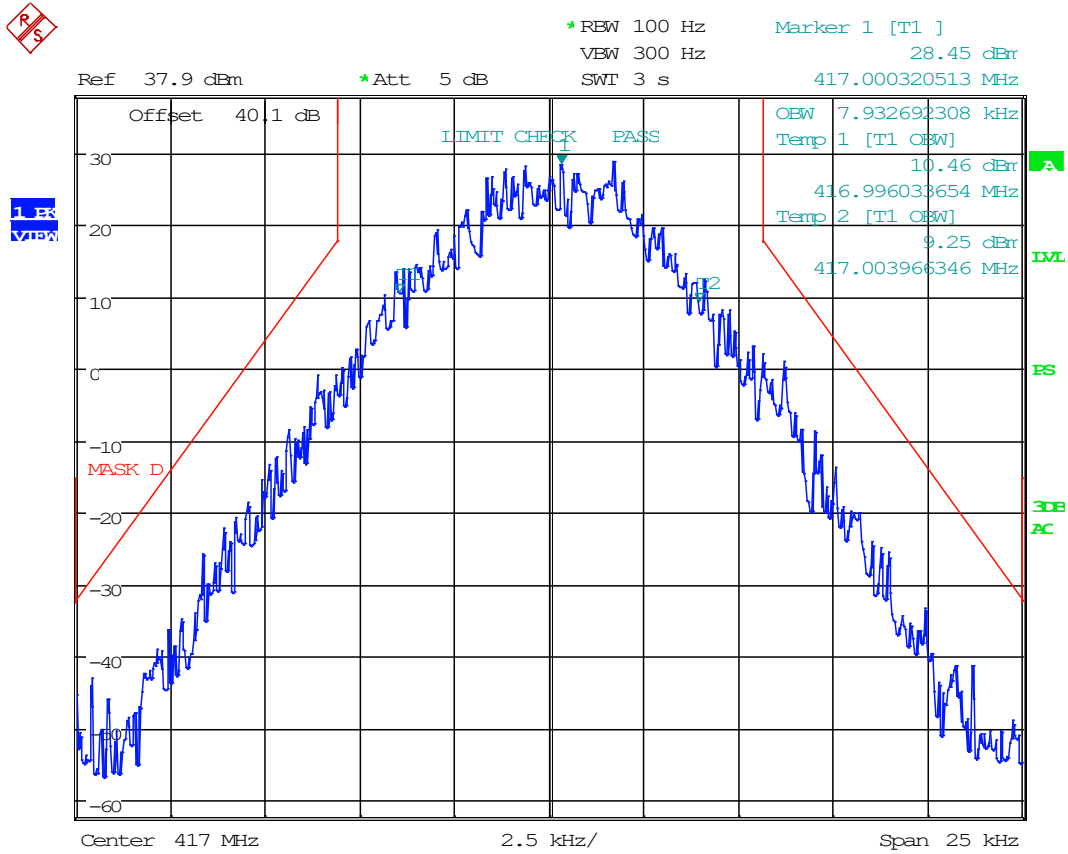

Date: 5.APR.2022 13:58:02




8.5.55 H-CPM, Downlink Mask D, 417 MHz, AGC

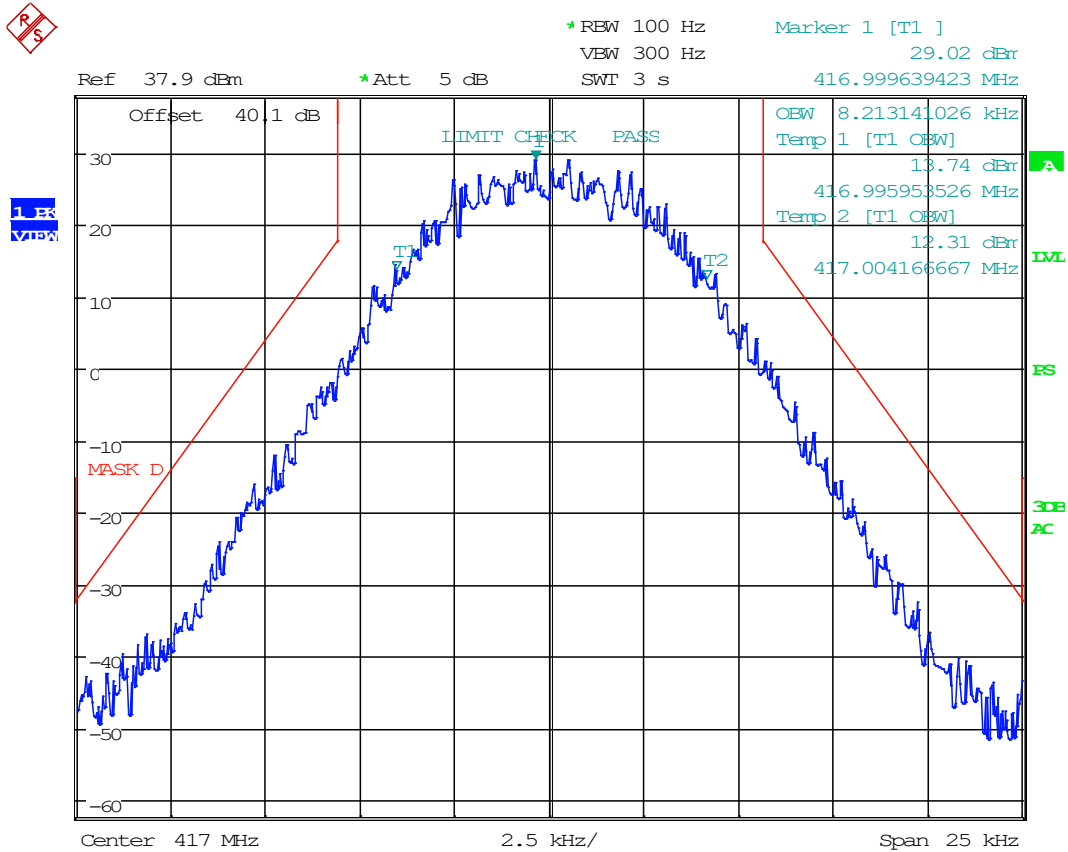


Date: 5.APR.2022 13:59:31

8.5.56 H-DQPSK Downlink Mask D, 417 MHz, AGC

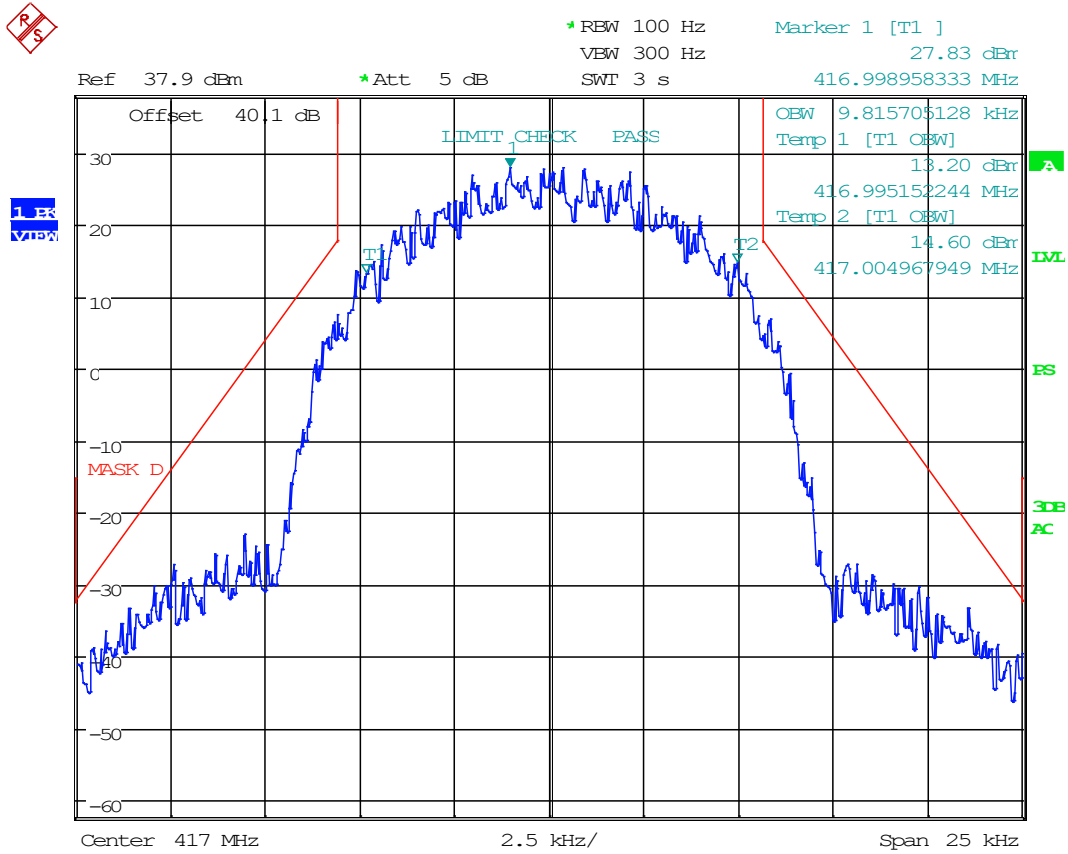


Date: 5.APR.2022 14:01:37

8.5.57 FM, Uplink Mask D, 417 MHz, AGC +3

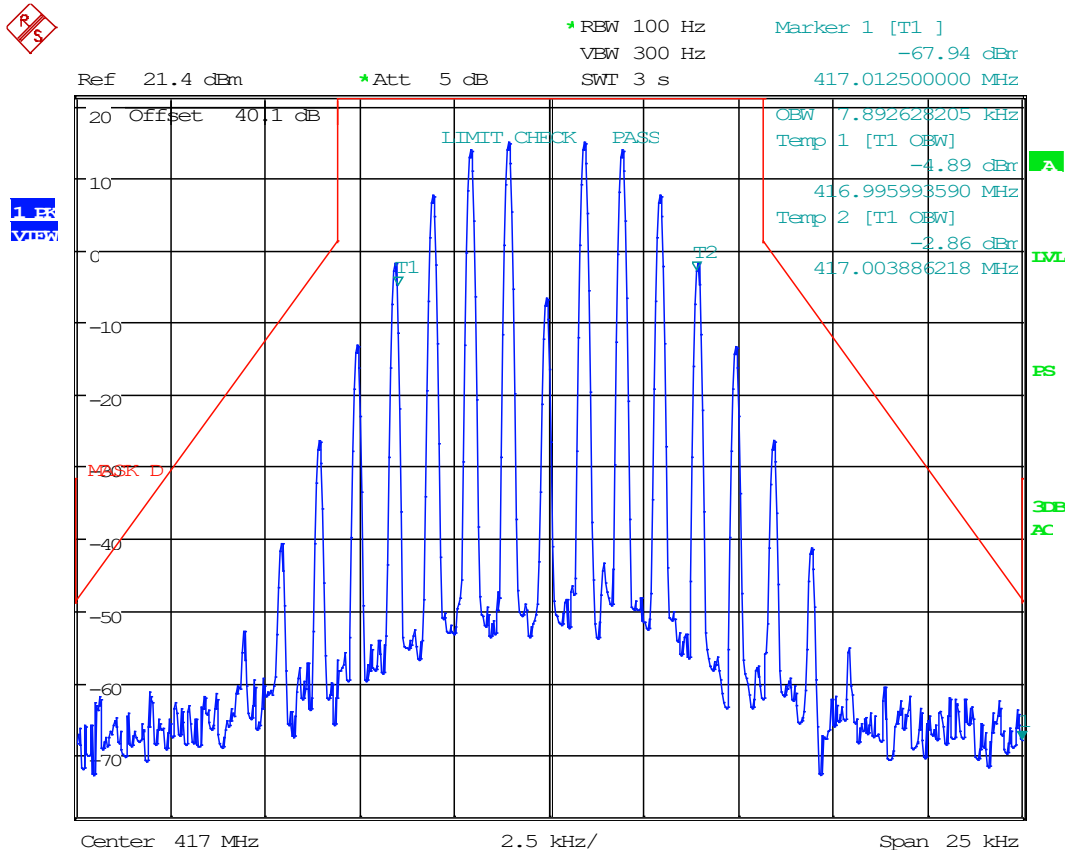


Date: 5.APR.2022 15:44:11

8.5.58 C4FM, Uplink Mask D, 417 MHz, AGC +3

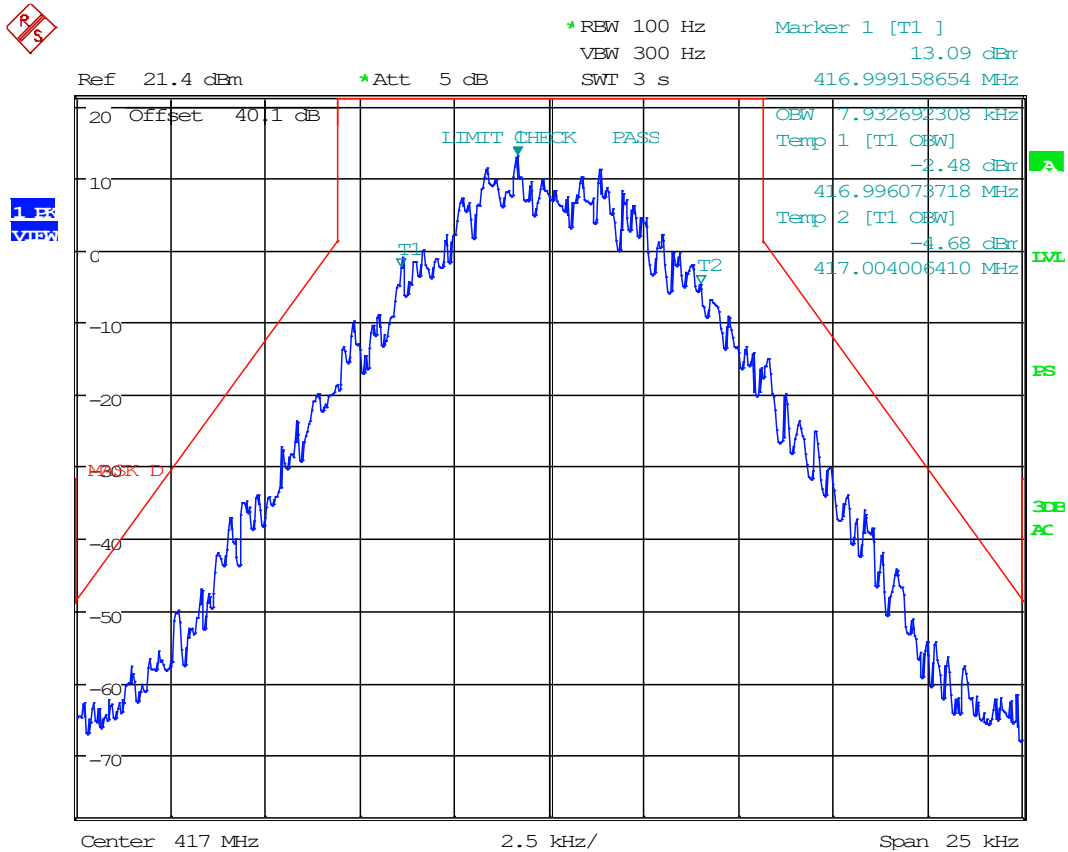


Date: 5.APR.2022 15:47:35

8.5.59 H-CPM, Uplink Mask D, 417 MHz, AGC +3

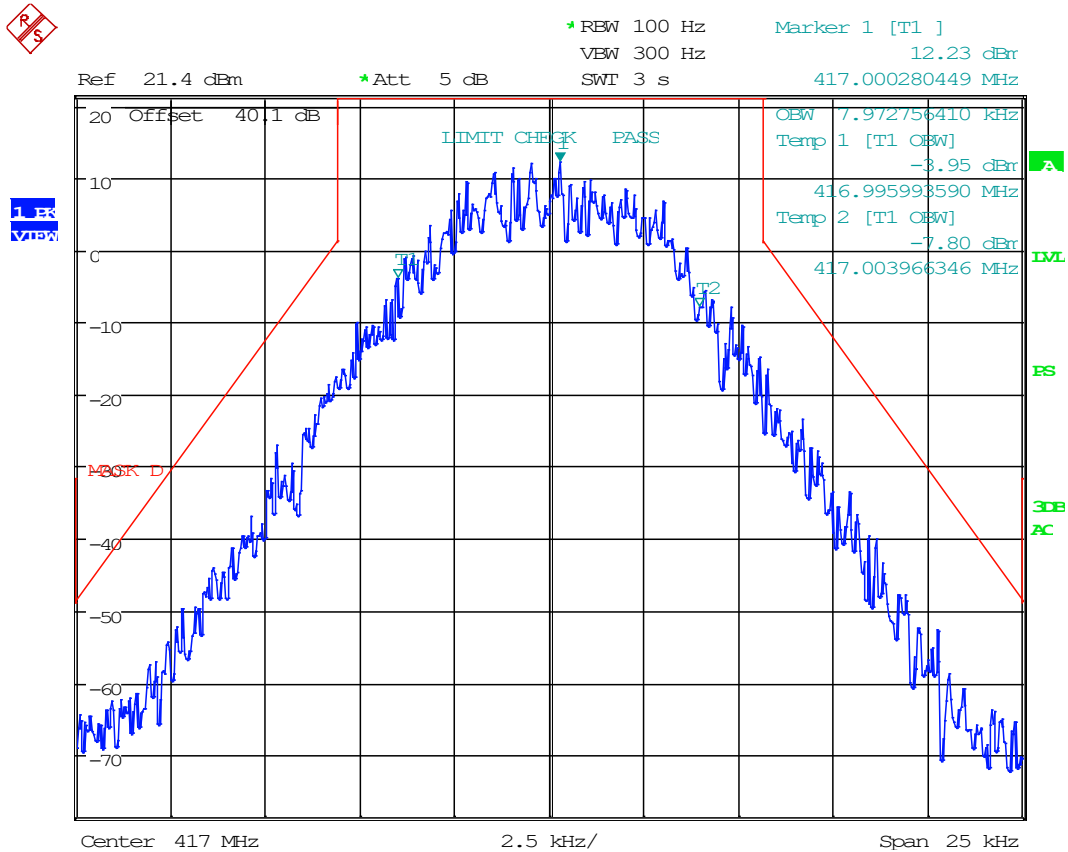


Date: 5.APR.2022 15:49:45

8.5.60 H-DQPSK, Uplink Mask D, 417 MHz, AGC +3

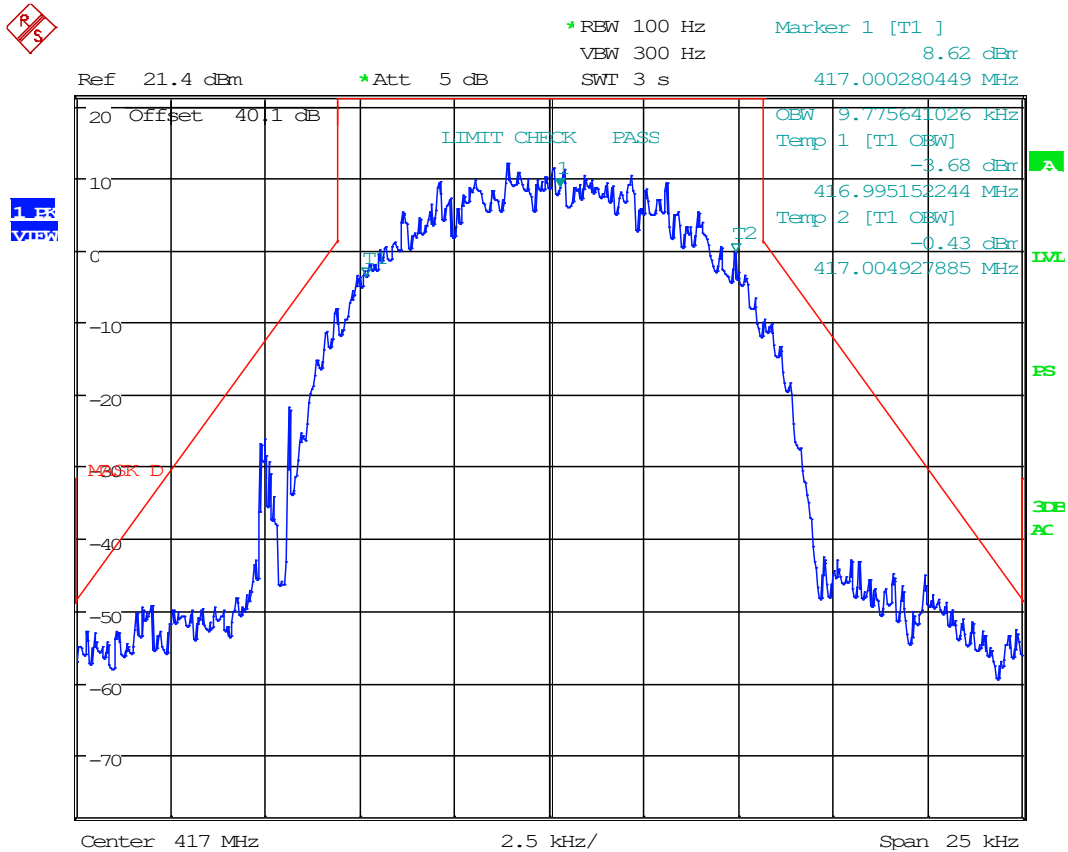


Date: 5.APR.2022 15:54:30

8.5.61 FM, Downlink Mask D, 417 MHz, AGC +3

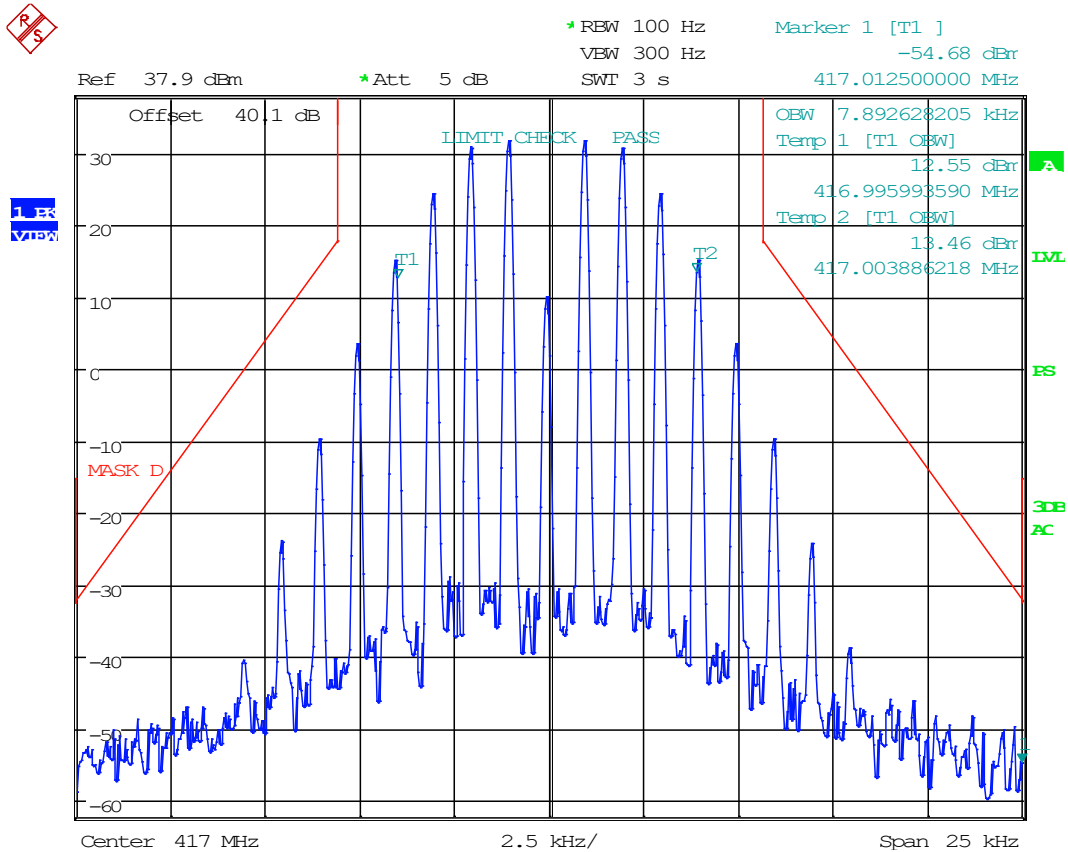


Date: 5.APR.2022 13:55:28

8.5.62 C4FM, Downlink Mask D, 417 MHz, AGC +3

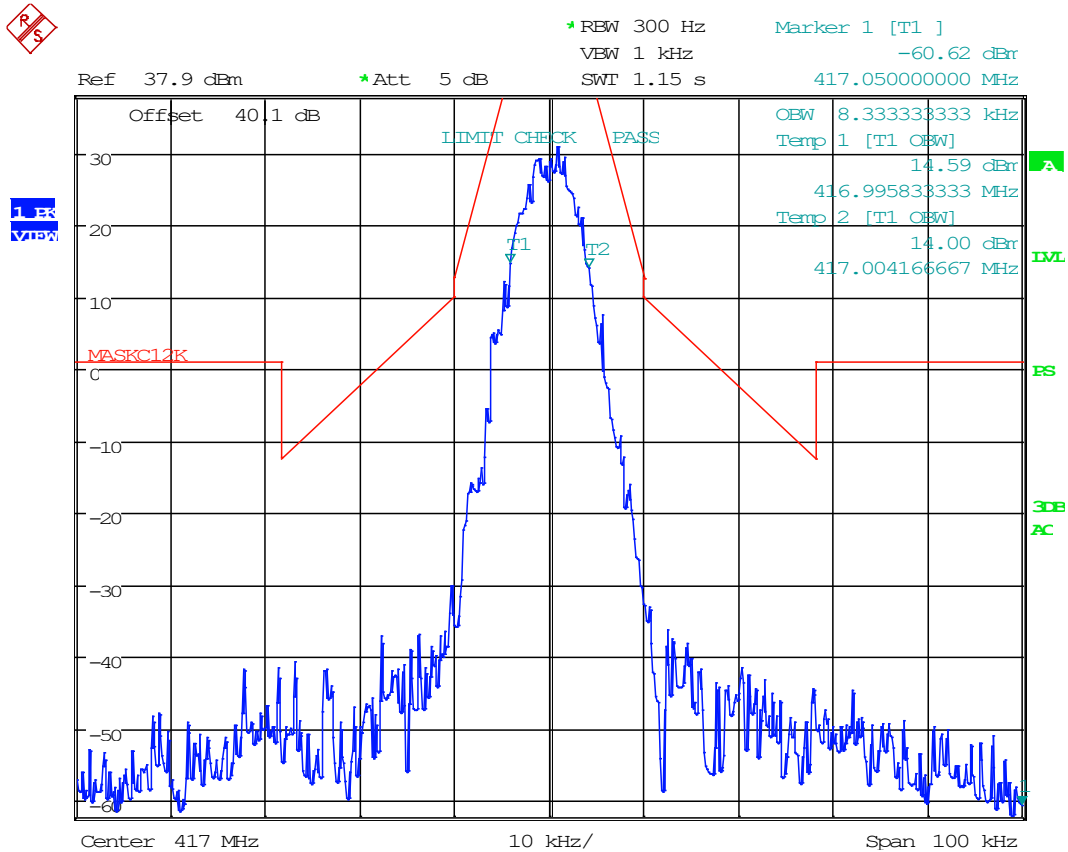


Date: 6.APR.2022 11:12:07

8.5.63 H-CPM, Downlink Mask D, 417 MHz, AGC +3

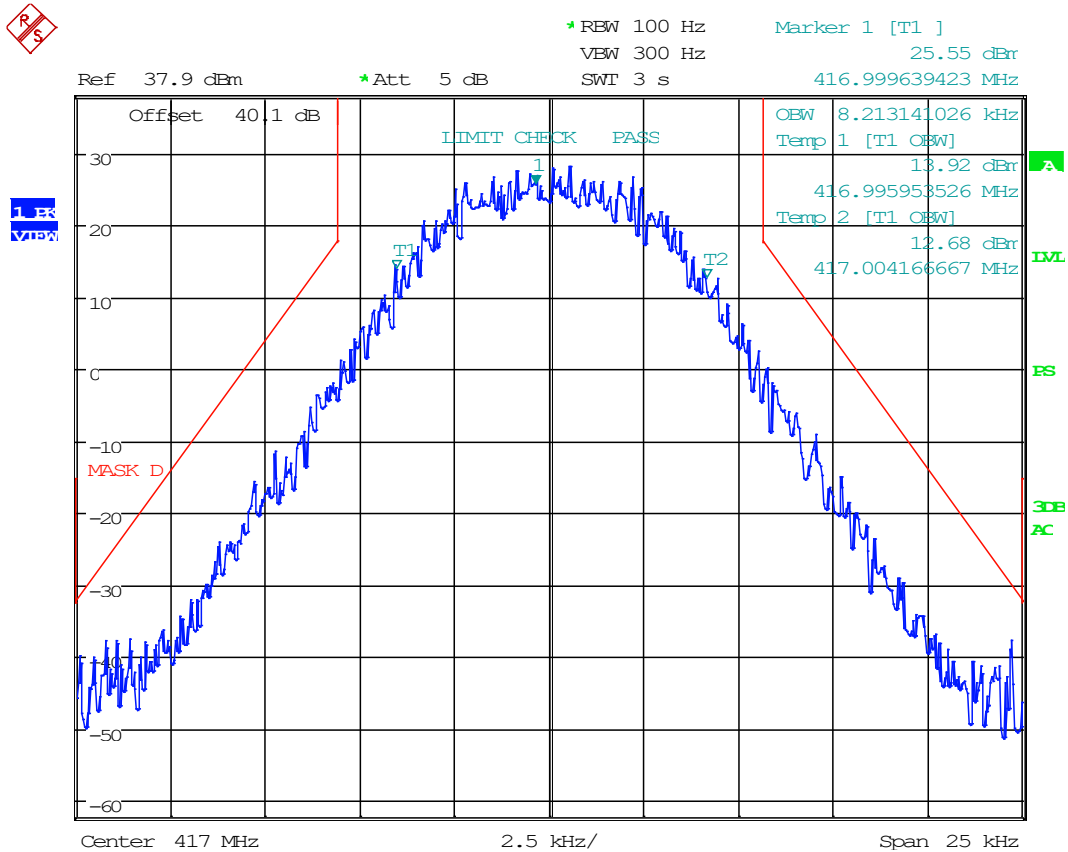

Date: 5.APR.2022 14:00:25


8.5.64 H-DQPSK, Downlink Mask D, 417 MHz, AGC +3

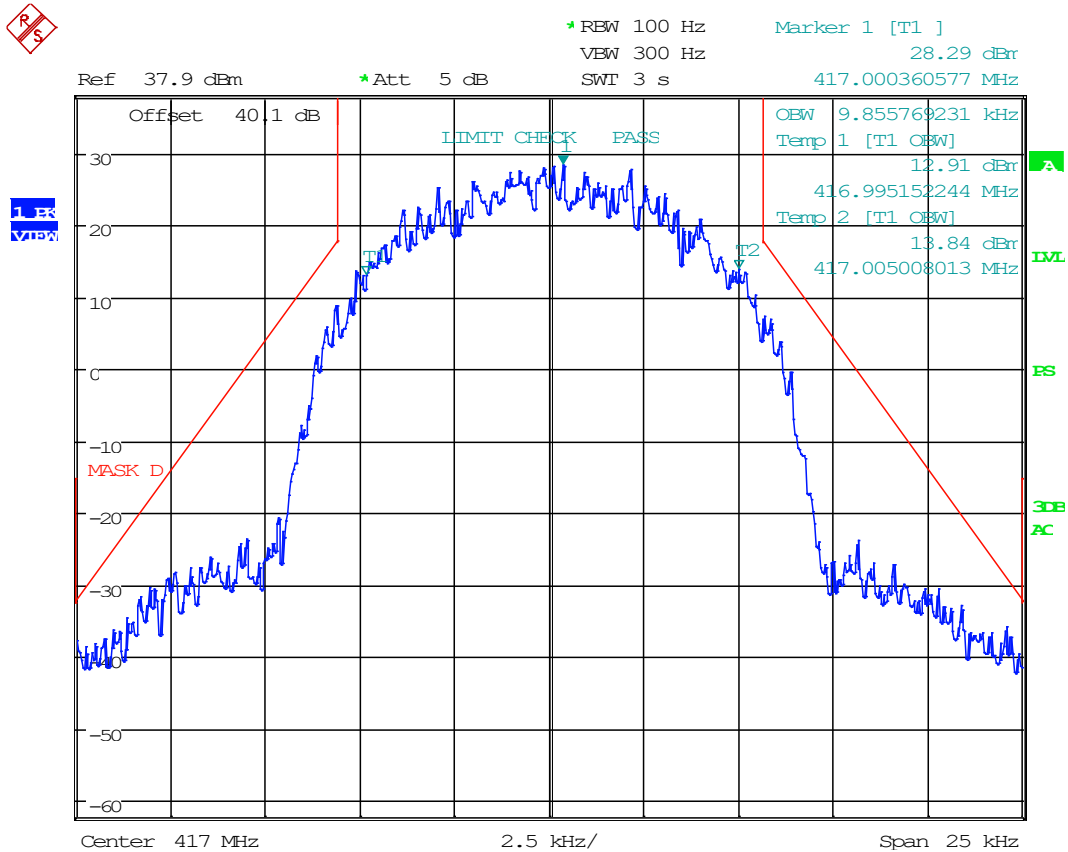

Date: 5.APR.2022 14:02:19




8.5.65 FM Uplink Mask D, 427 MHz AGC

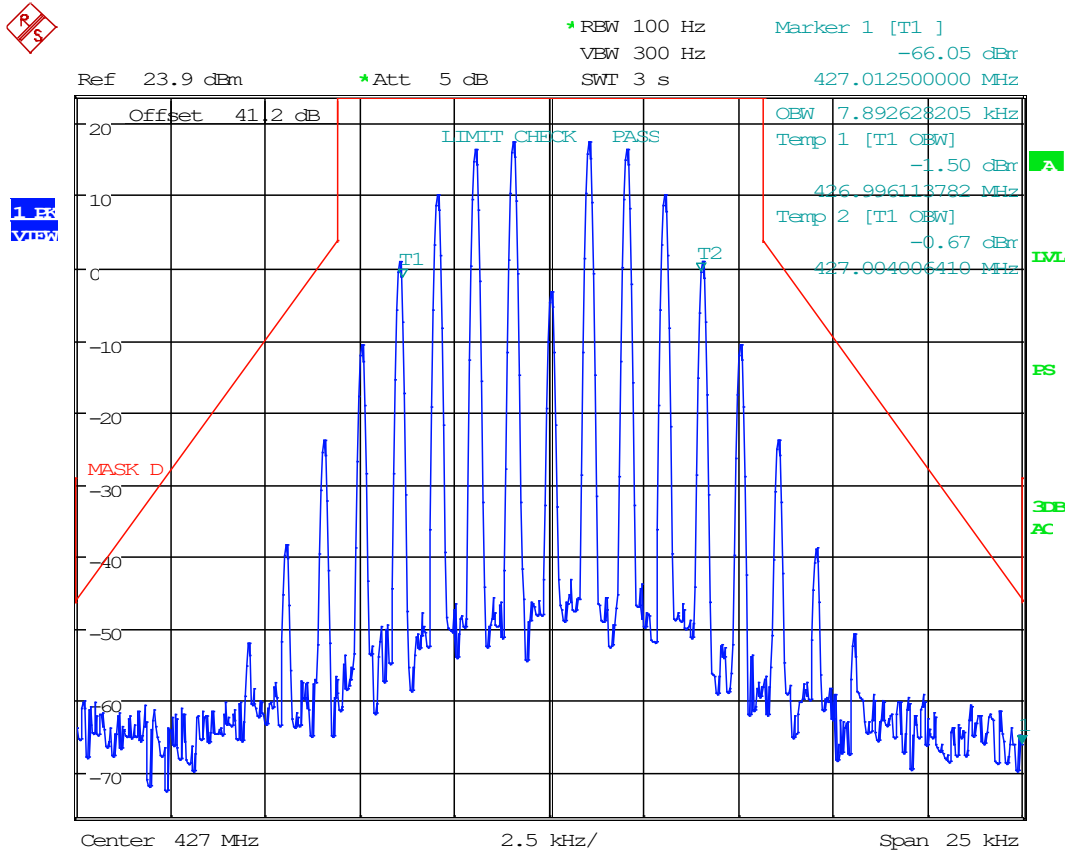

Date: 11.MAY.2022 10:14:43




8.5.66 C4FM Uplink Mask D, 427 MHz AGC

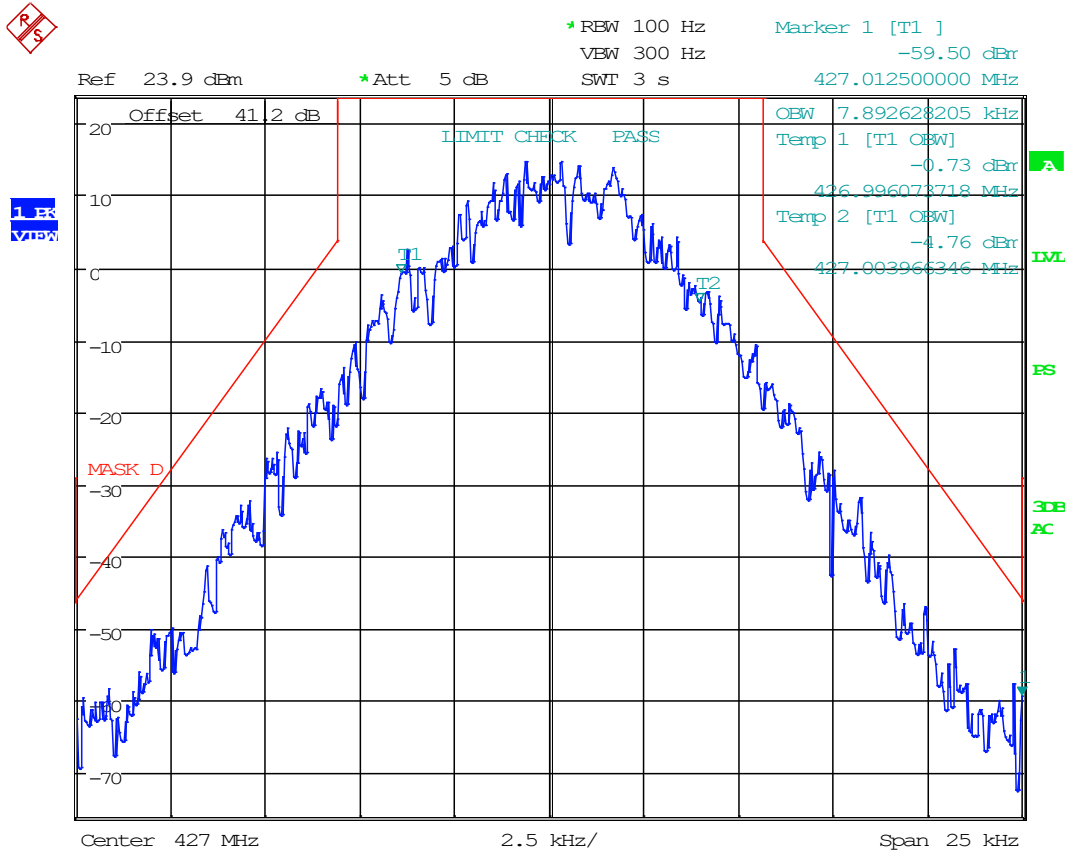

Date: 11.MAY.2022 10:12:09


8.5.67 H-CPM Uplink Mask D, 427 MHz AGC

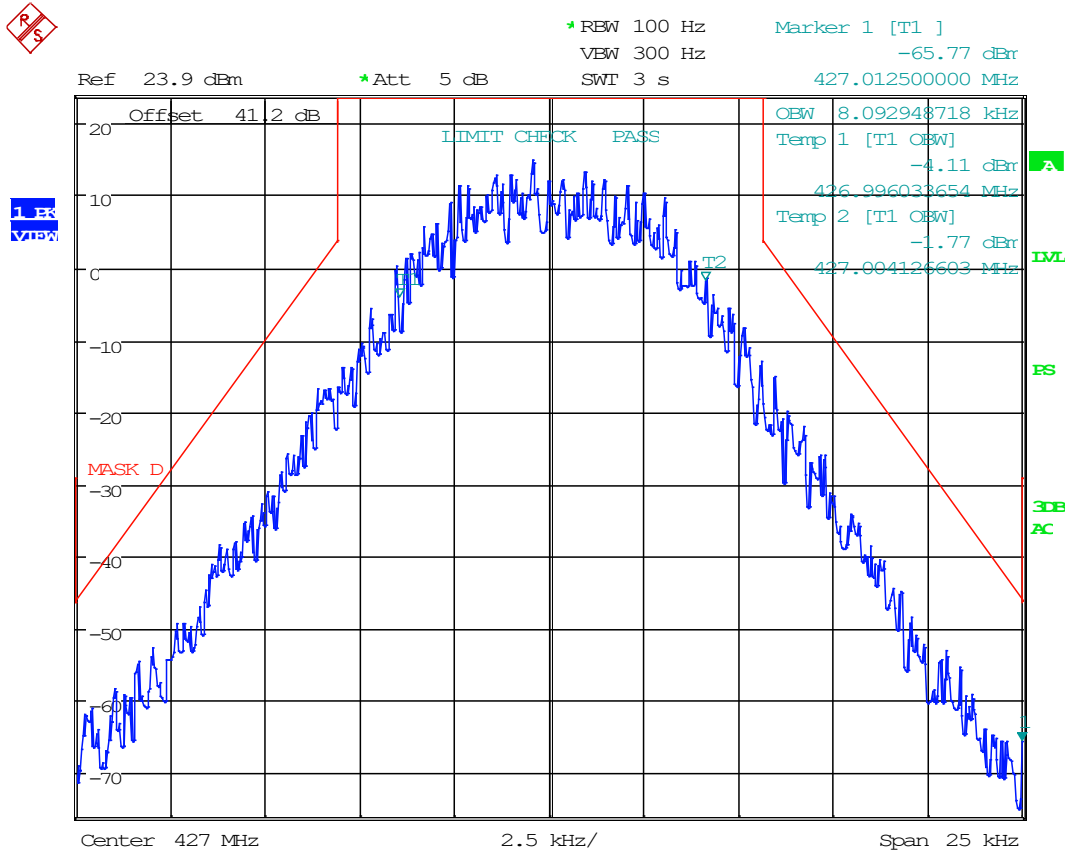

Date: 11.MAY.2022 10:12:36




8.5.68 H-DQPSK Uplink Mask D, 427 MHz AGC

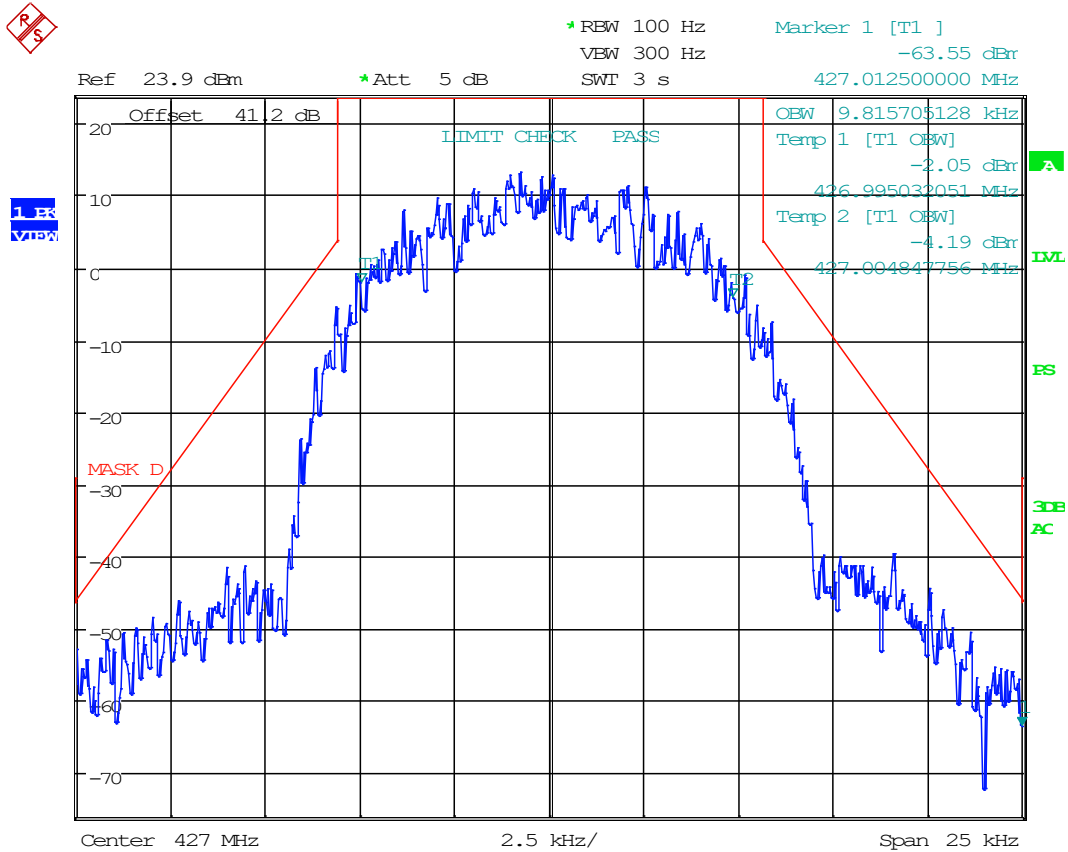


Date: 11.MAY.2022 10:13:28

8.5.69 FM Downlink Mask D, 427 MHz AGC

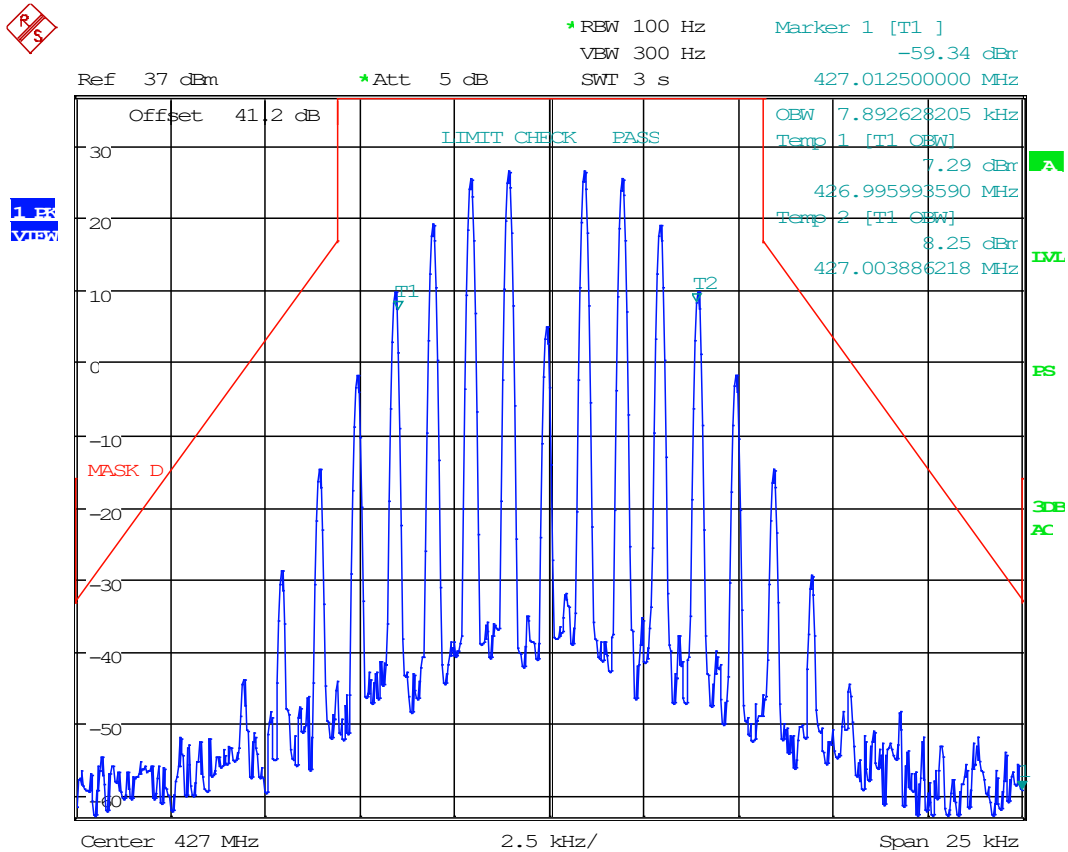


Date: 6.APR.2022 11:57:16

8.5.70 C4FM Downlink Mask D, 427 MHz AGC

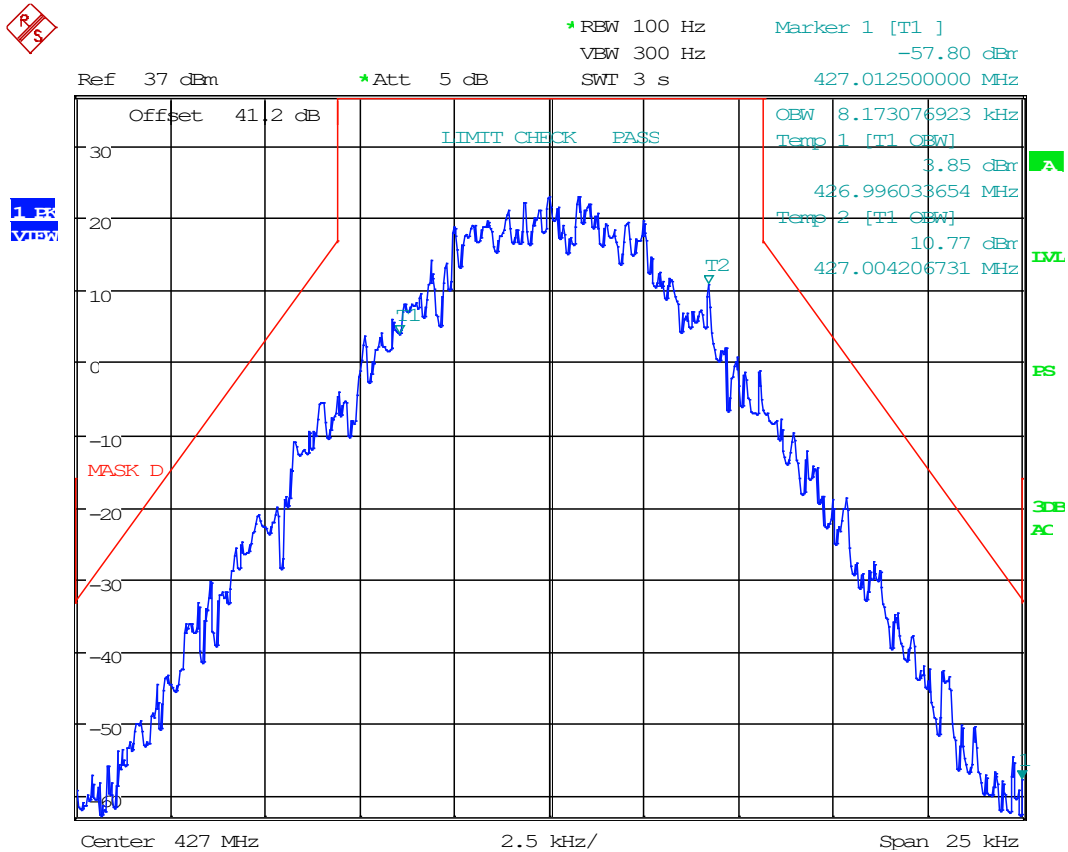

Date: 6.APR.2022 11:59:09


8.5.71 H-CPM Downlink Mask D, 427 MHz AGC

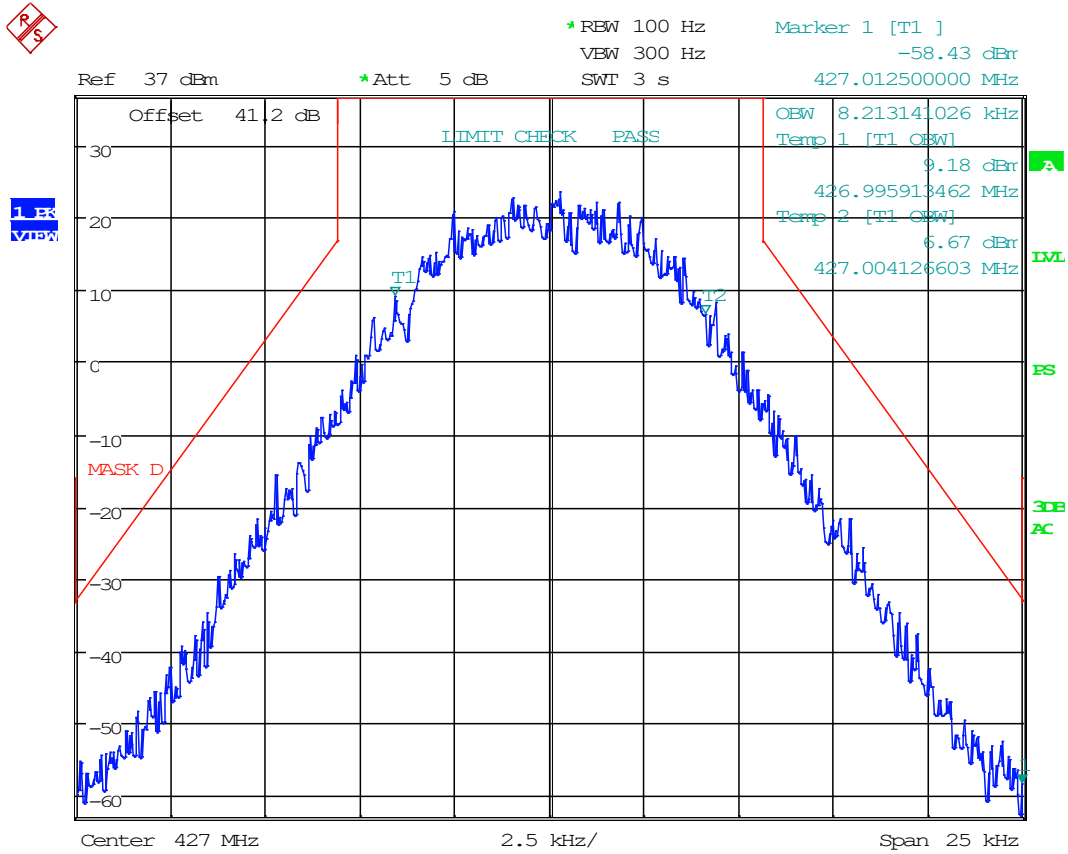

Date: 6.APR.2022 12:01:07




8.5.72 H-DQPSK Downlink Mask D, 427 MHz AGC

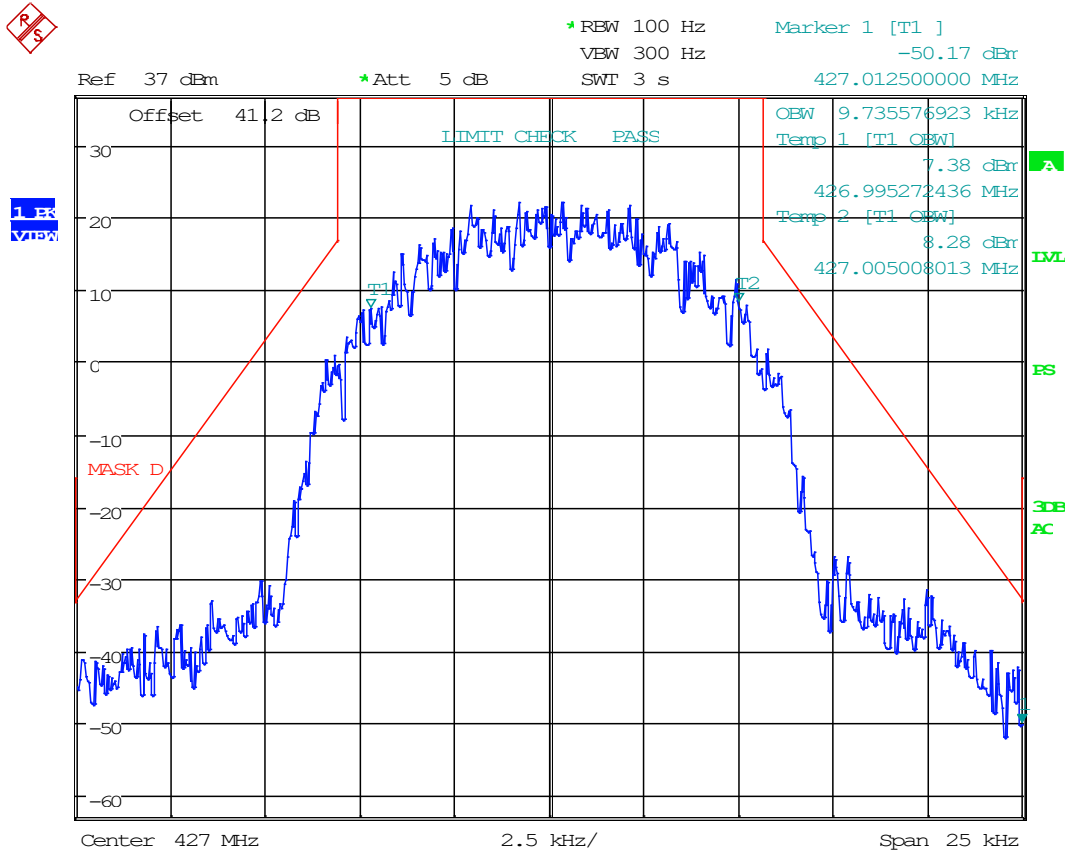

Date: 6.APR.2022 12:03:01


8.5.73 FM Uplink Mask D, 427 MHz AGC+3

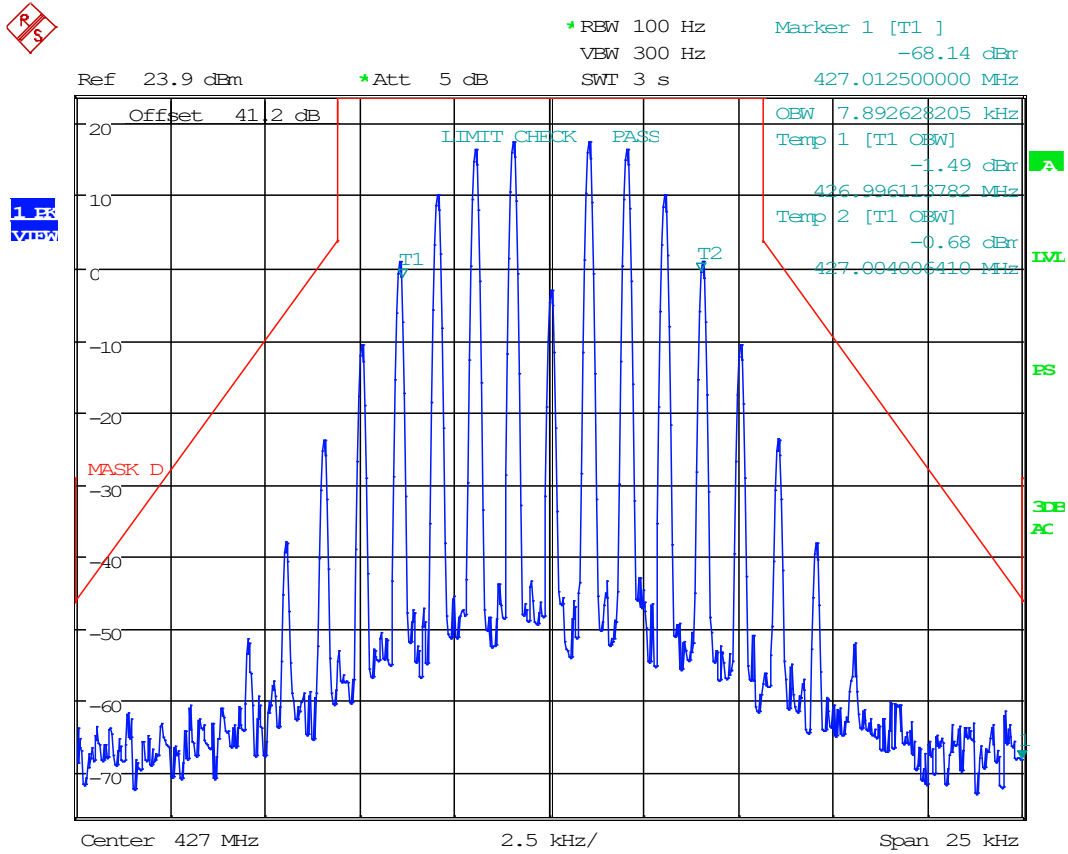

Date: 11.MAY.2022 10:14:28




8.5.74 C4FM Uplink Mask D, 427 MHz AGC+3

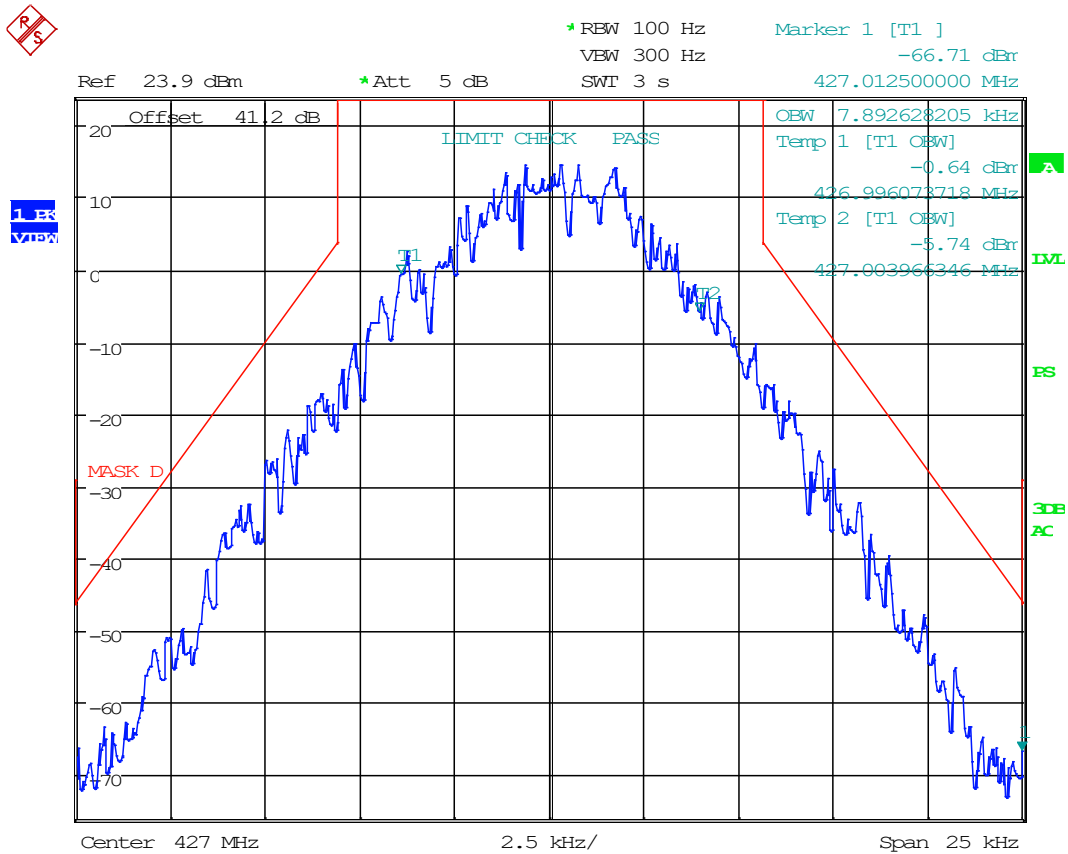

Date: 11.MAY.2022 10:11:50




8.5.75 H-CPM Uplink Mask D, 427 MHz AGC+3

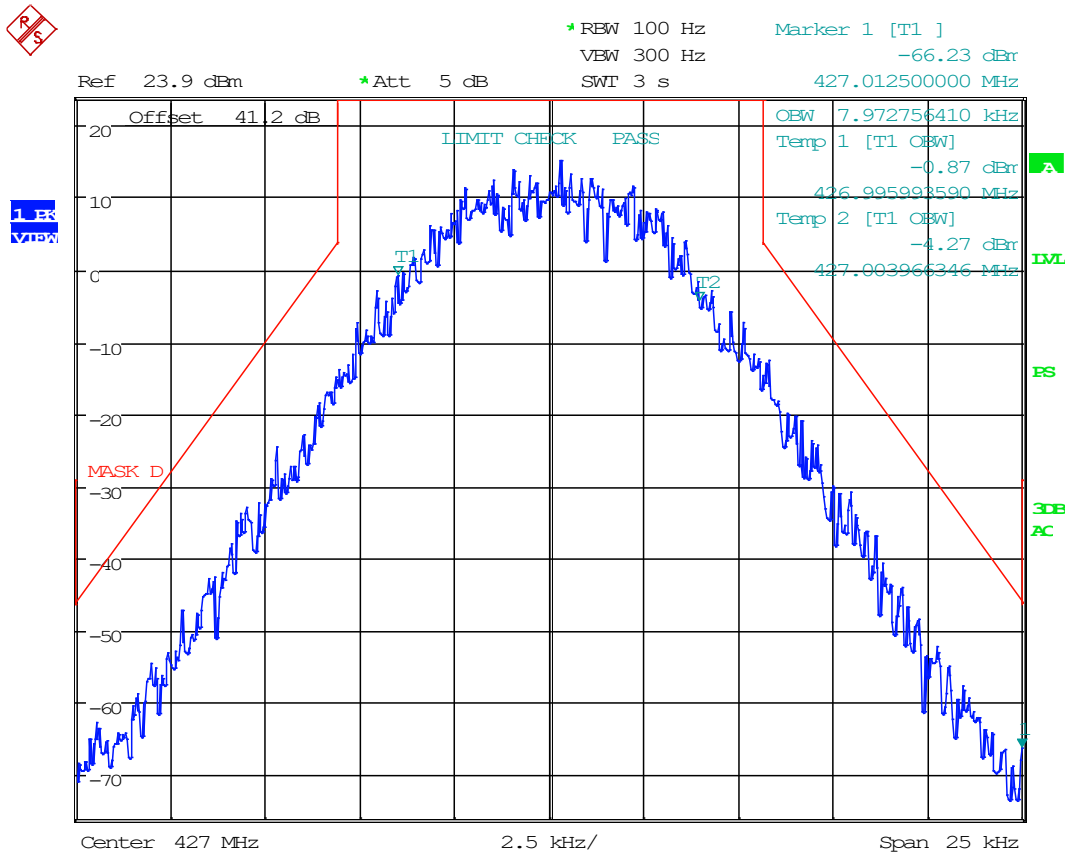

Date: 11.MAY.2022 10:12:50




8.5.76 H-DQPSK Uplink Mask D, 427 MHz AGC+3

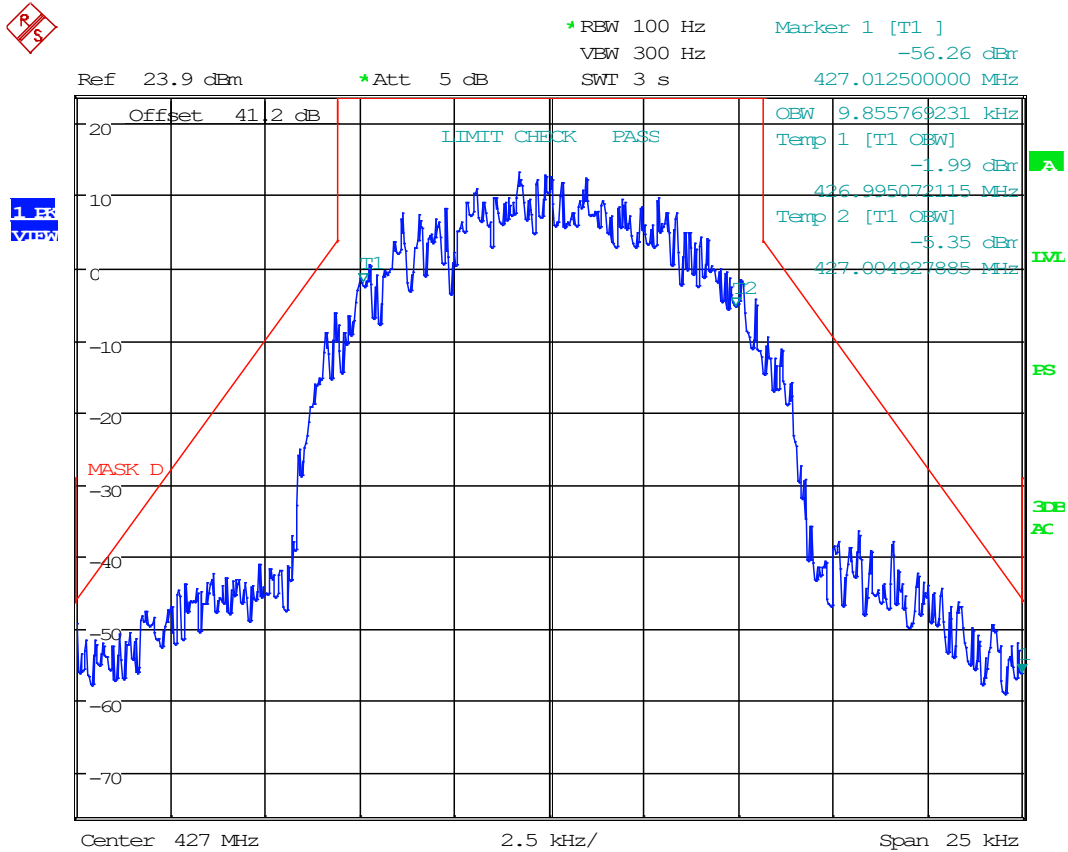

Date: 11.MAY.2022 10:13:08




8.5.77 FM Downlink Mask D, 427 MHz, AGC +3

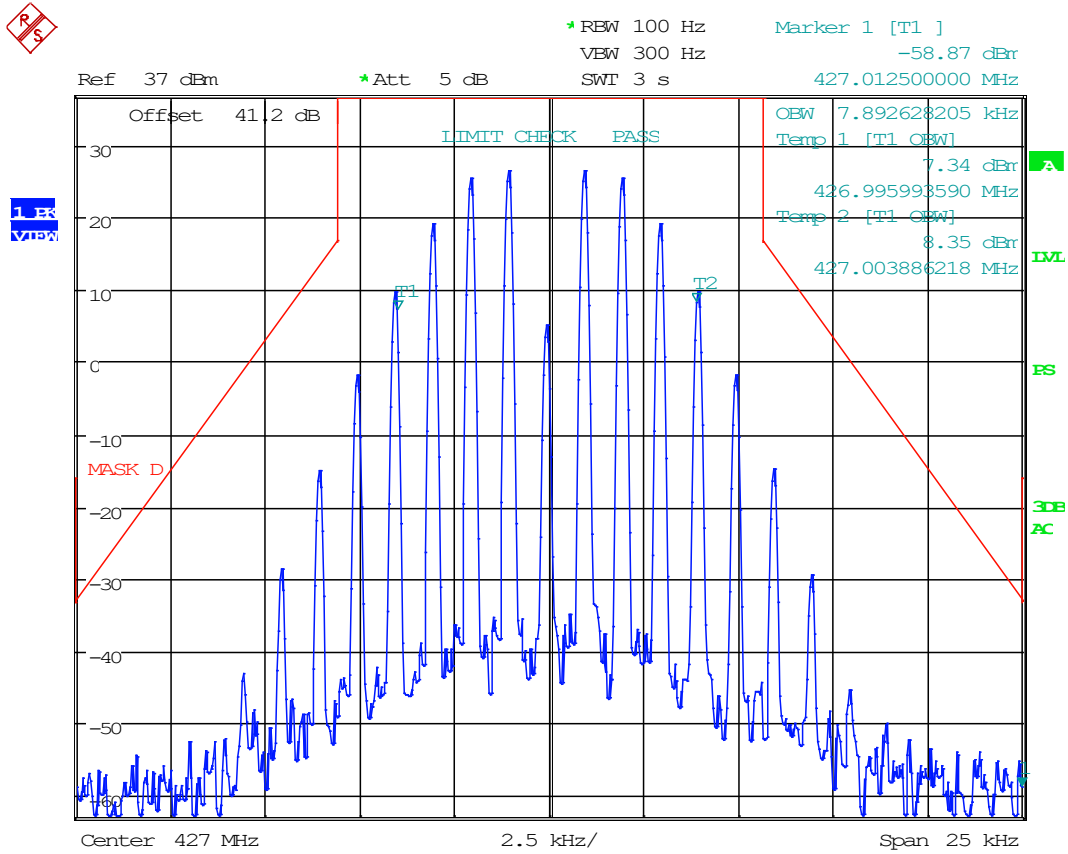

Date: 6.APR.2022 11:58:00




8.5.78 C4FM Downlink Mask D, 427 MHz, AGC +3

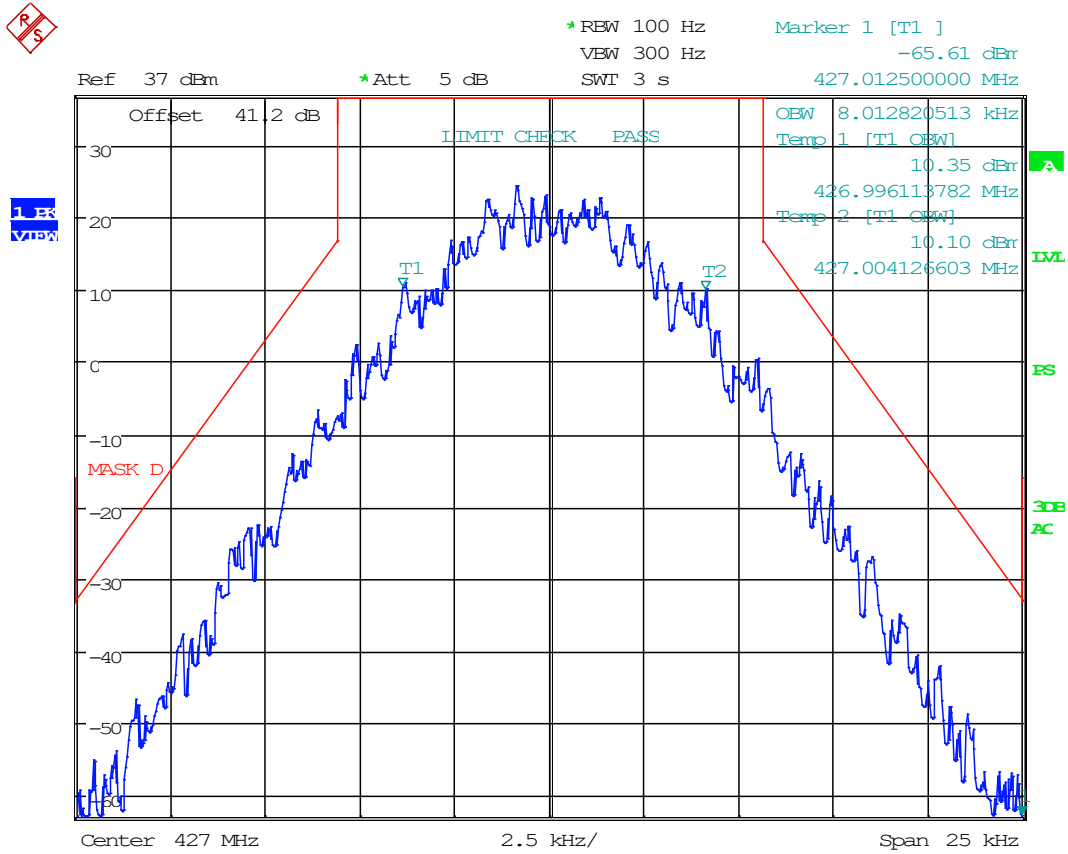

Date: 6.APR.2022 11:59:46


8.5.79 H-CPM Downlink Mask D, 427 MHz, AGC +3

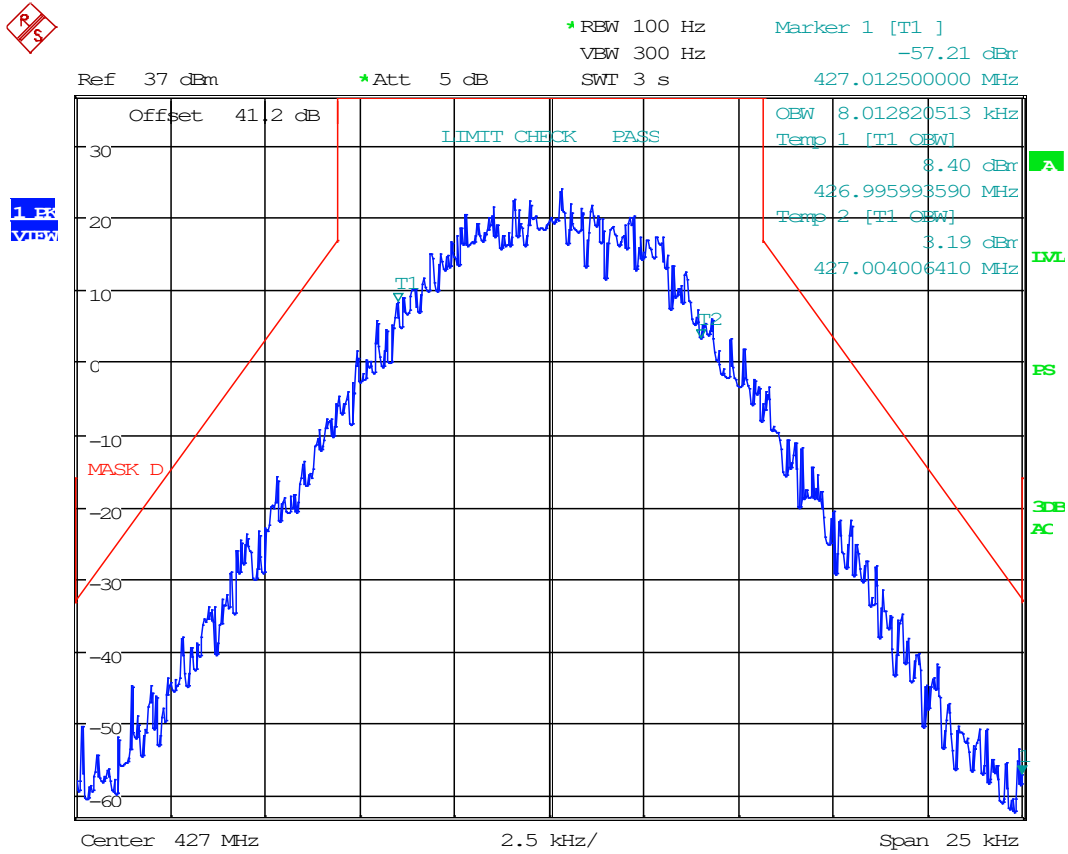

Date: 6.APR.2022 12:00:29



8.5.80 H-DQPSK Downlink Mask D, 427 MHz, AGC +3

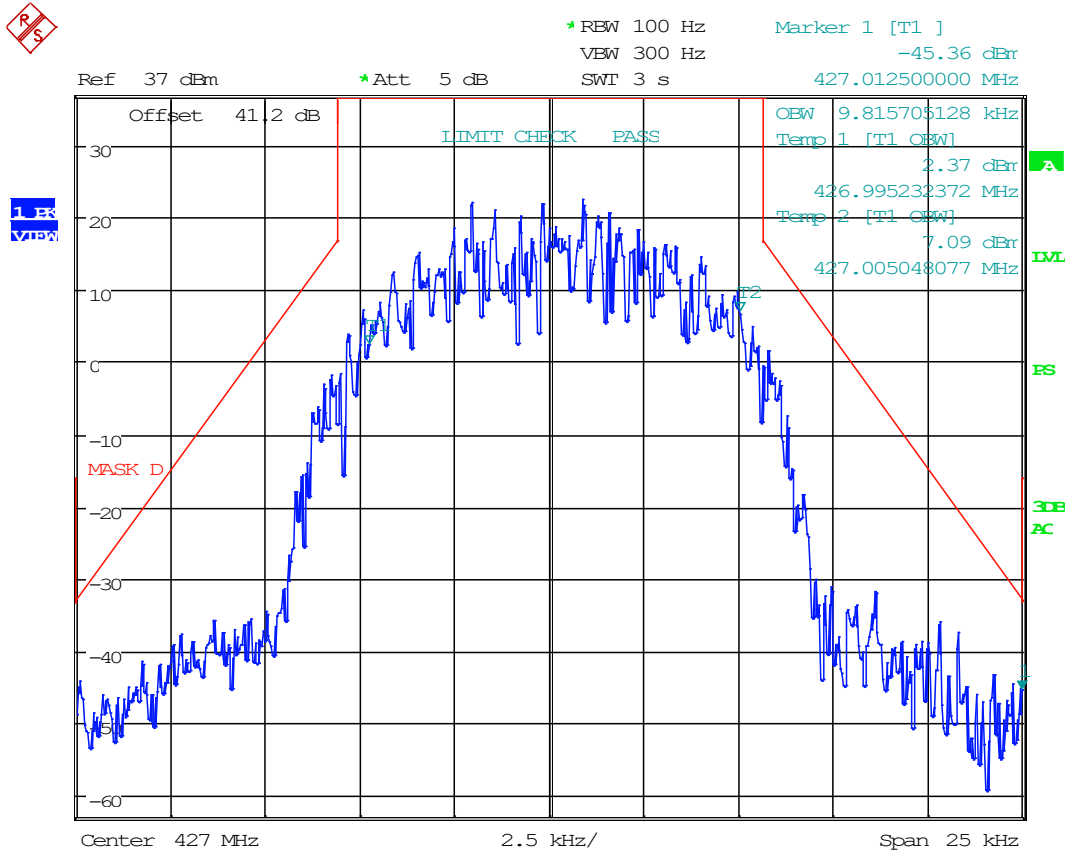


Date: 6.APR.2022 12:02:38



8.6 Noise Figure

Referenced from test report "TR_3693-20_FCC_PT90_Booster Class B_1.docx".

Limits from FCC KDB 935210 D05 v01r04 Industrial Signal Boosters. Test method from "Noise Figure Measurement Accuracy: The Y-Factor Method" by Keysight Technologies.

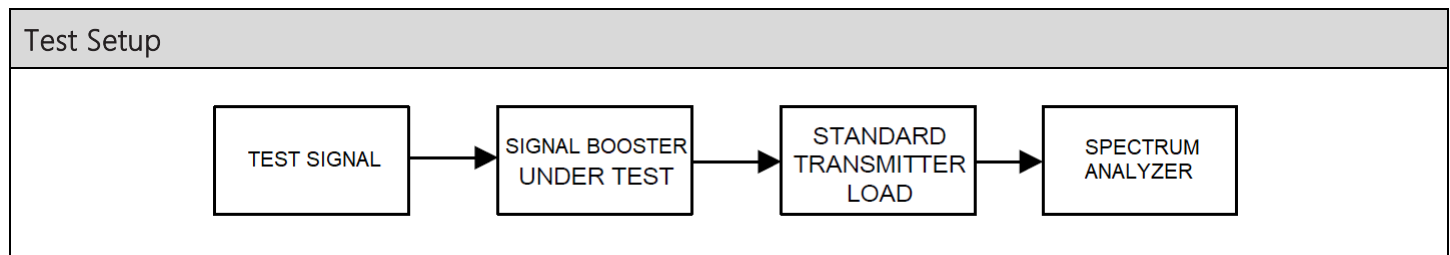


Test Results, Out-of-band Rejection and Class of Operation			
Operating Band	Link Direction	Noise Figure	Limit
425 – 430 MHz	Uplink	4.97 dB	< 9 dB
425 – 430 MHz	Downlink	2.91 dB	< 9 dB




8.7 Out-of-Band/Out-of-Block Emissions (Intermodulation Products)

Limits from FCC Parts 2.1051, 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

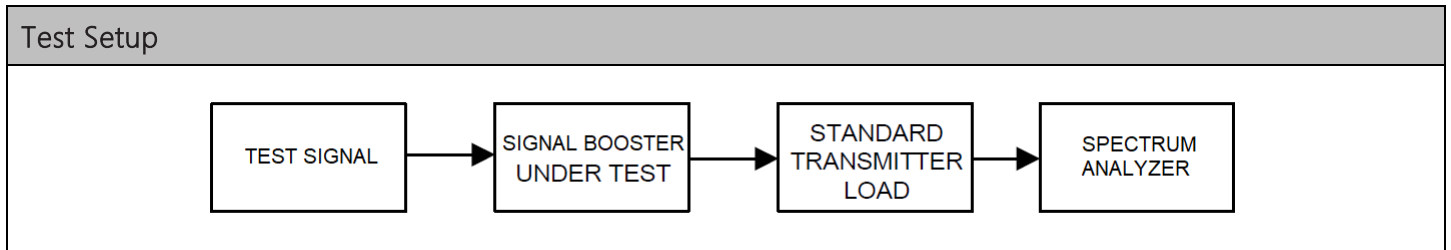


8.7.1 12.5 kHz, Uplink, 412 MHz AGC

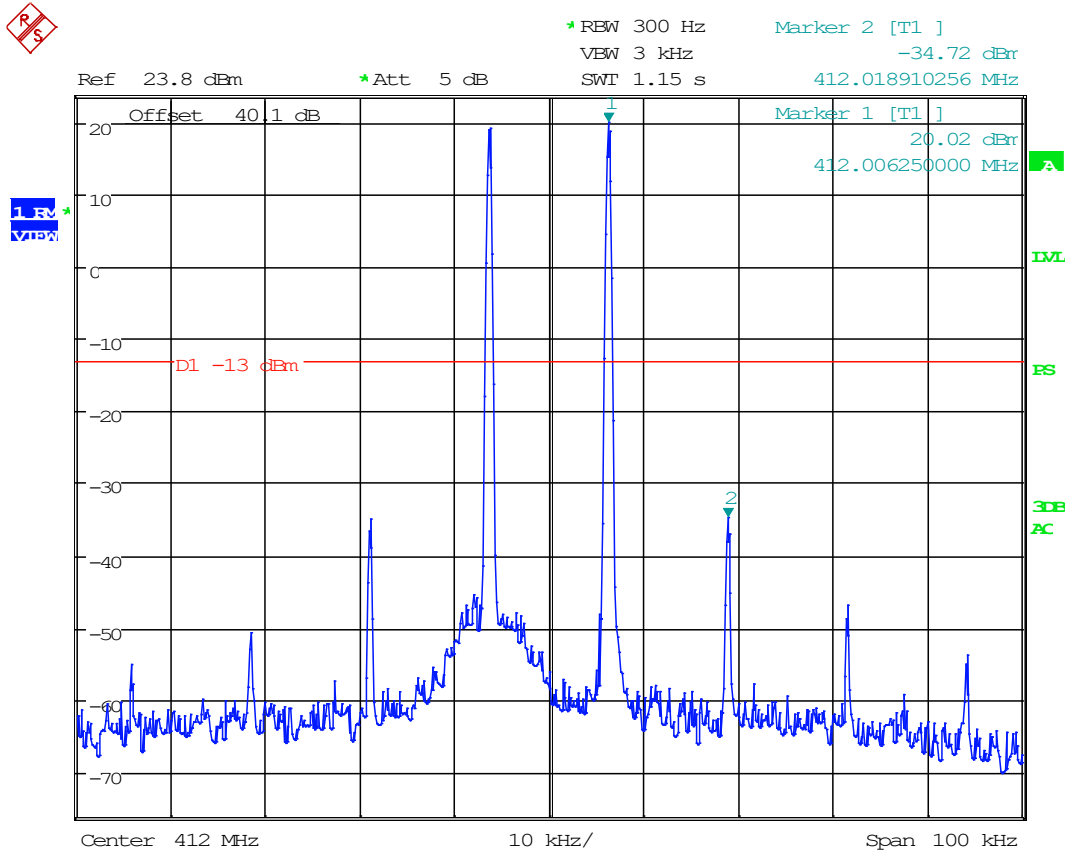


Date: 6.APR.2022 10:38:52

8.7.2 12.5 kHz, Uplink, 412 MHz AGC +3dB

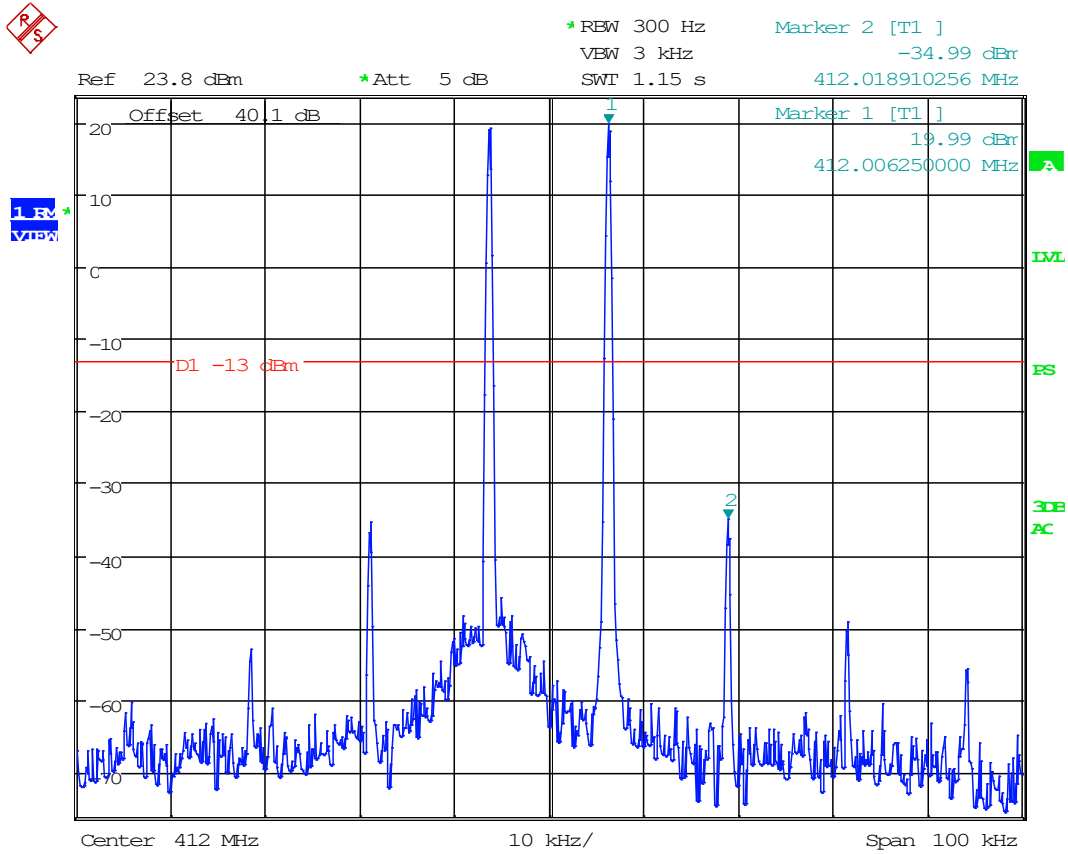

Date: 6.APR.2022 10:40:07


8.7.3 12.5 kHz, Downlink, 412 MHz AGC

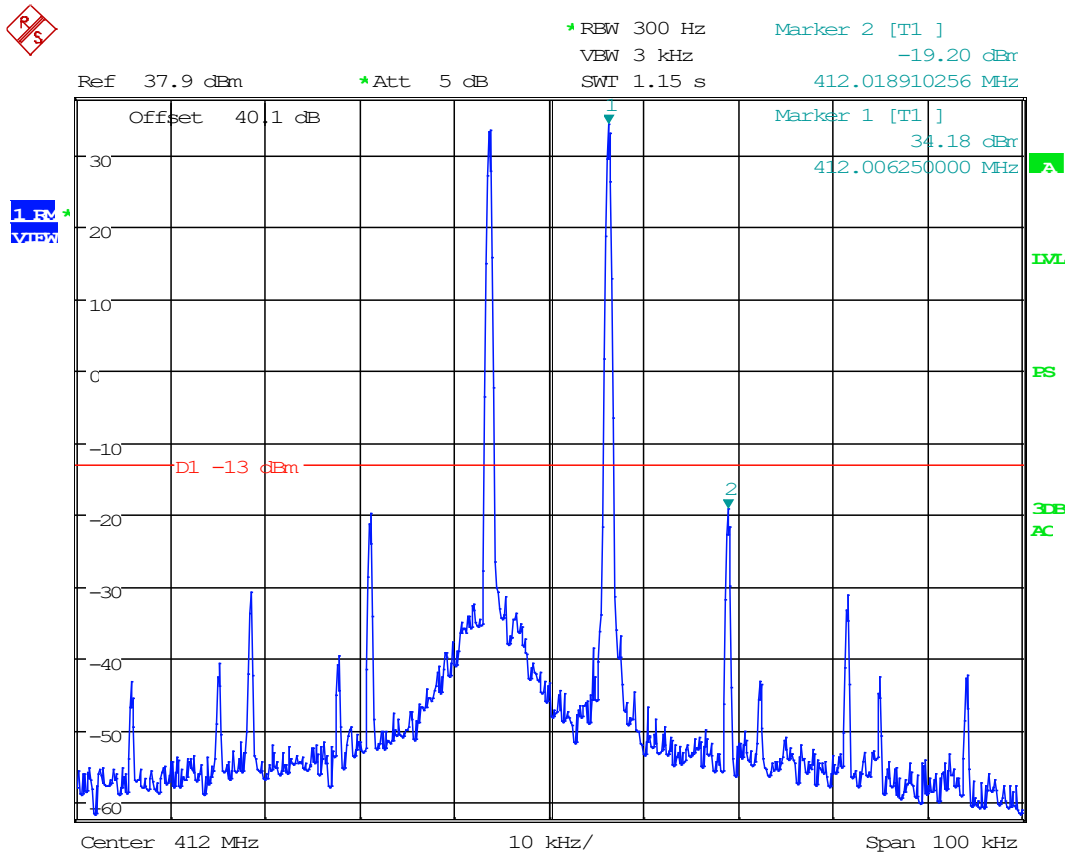

Date: 6.APR.2022 10:31:41




8.7.4 12.5 kHz, Downlink, 412 MHz AGC +3dB

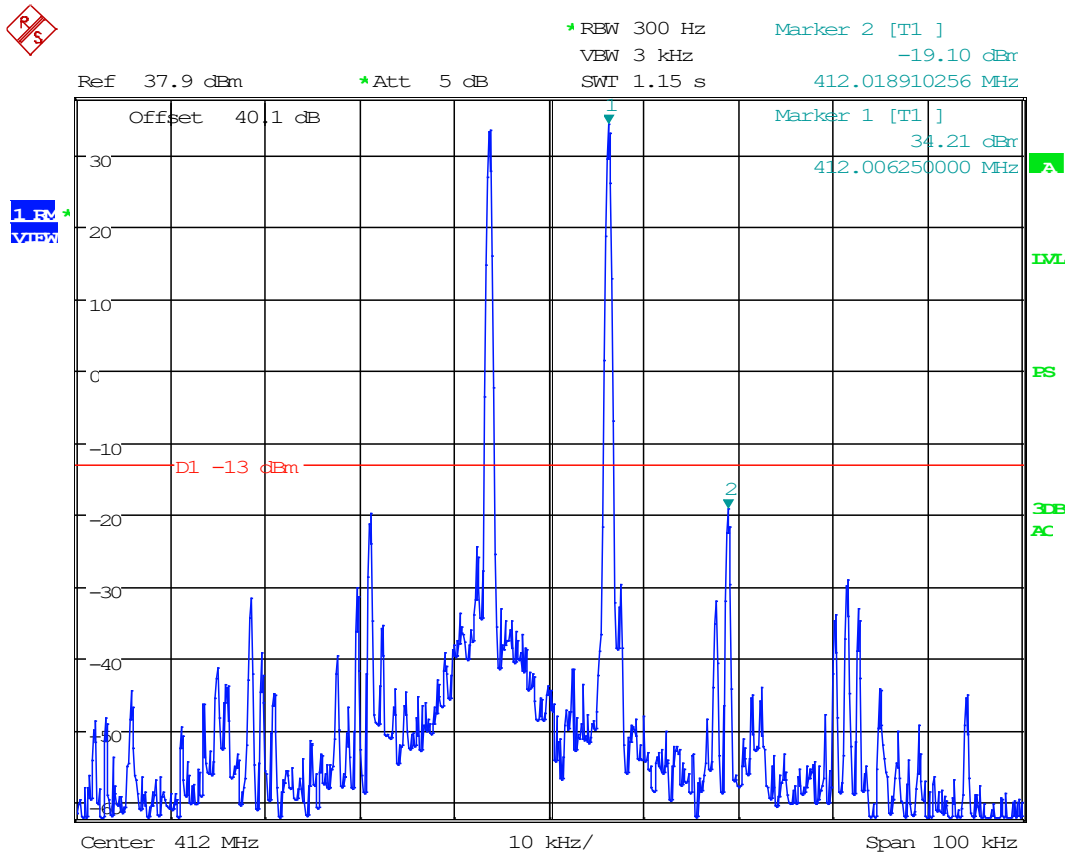

Date: 6.APR.2022 10:33:15




8.7.5 12.5 kHz, Uplink, 417 MHz AGC

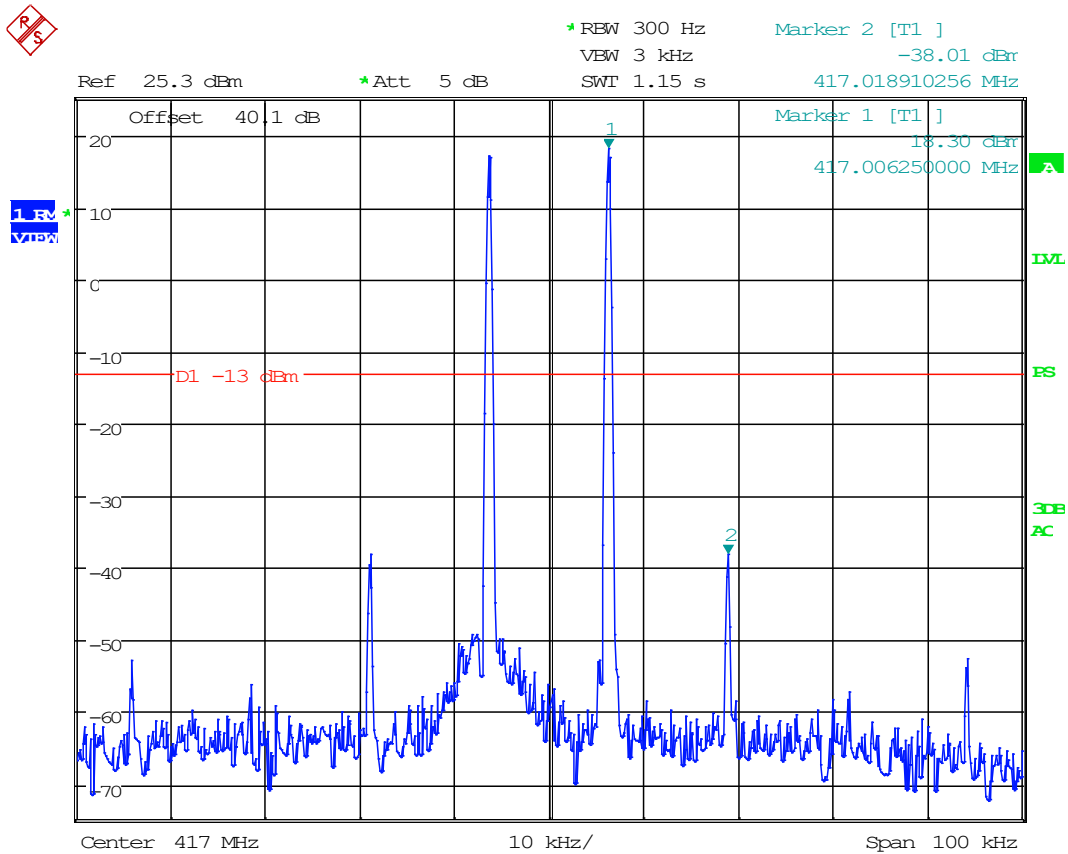

Date: 5.APR.2022 15:16:49




8.7.6 12.5 kHz, Uplink, 417 MHz AGC +3

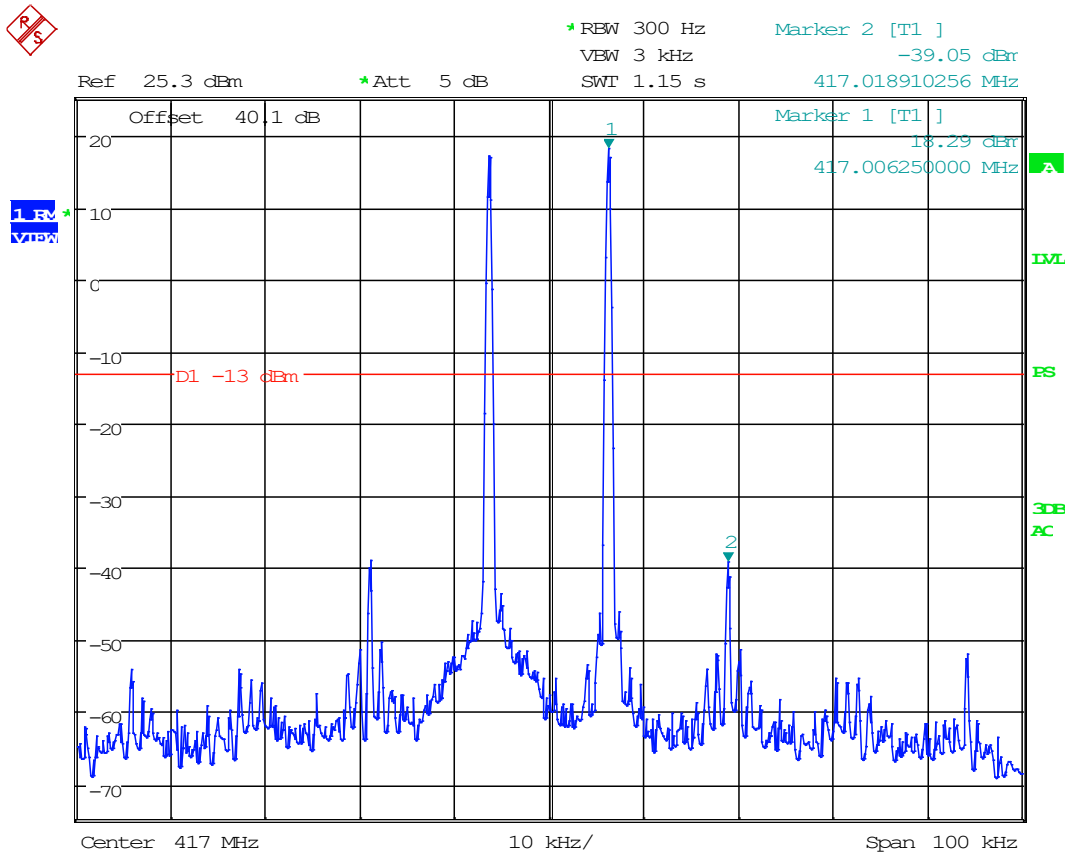

Date: 5.APR.2022 15:17:53


8.7.7 12.5 kHz, Downlink, 417 MHz AGC

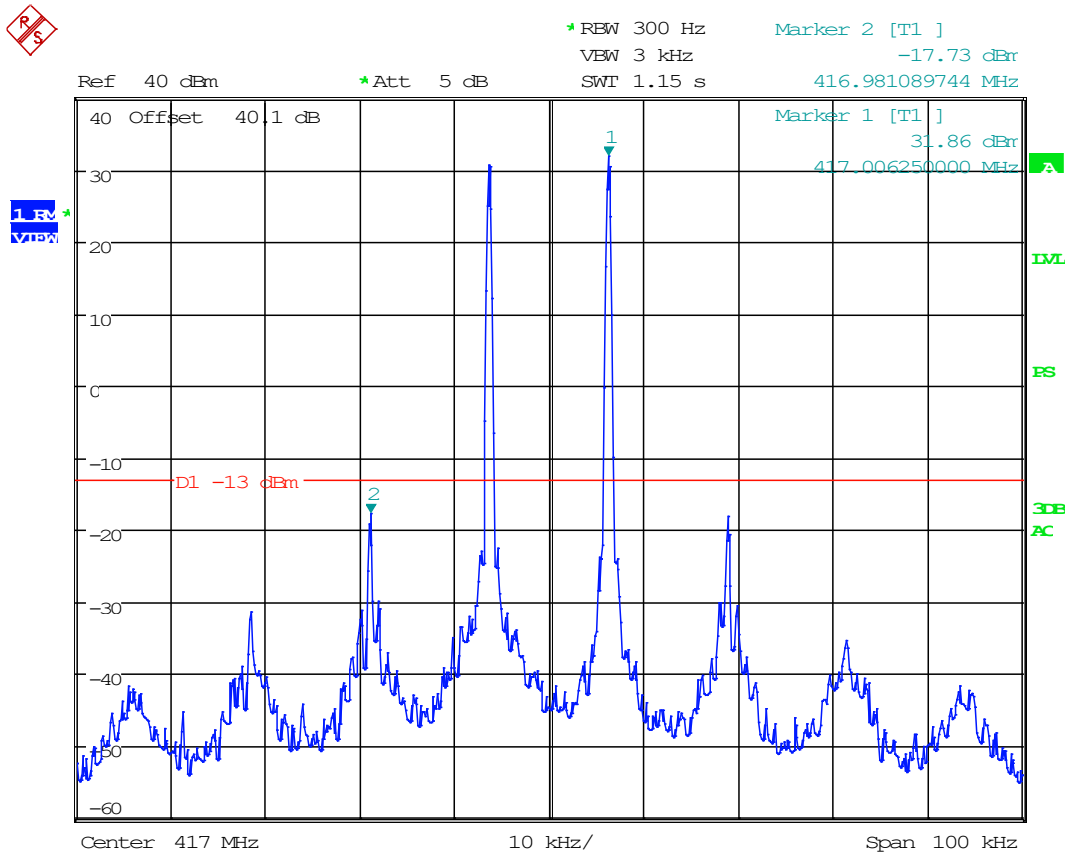

Date: 5.APR.2022 14:43:02




8.7.8 12.5 kHz, Downlink, 417 MHz AGC +3

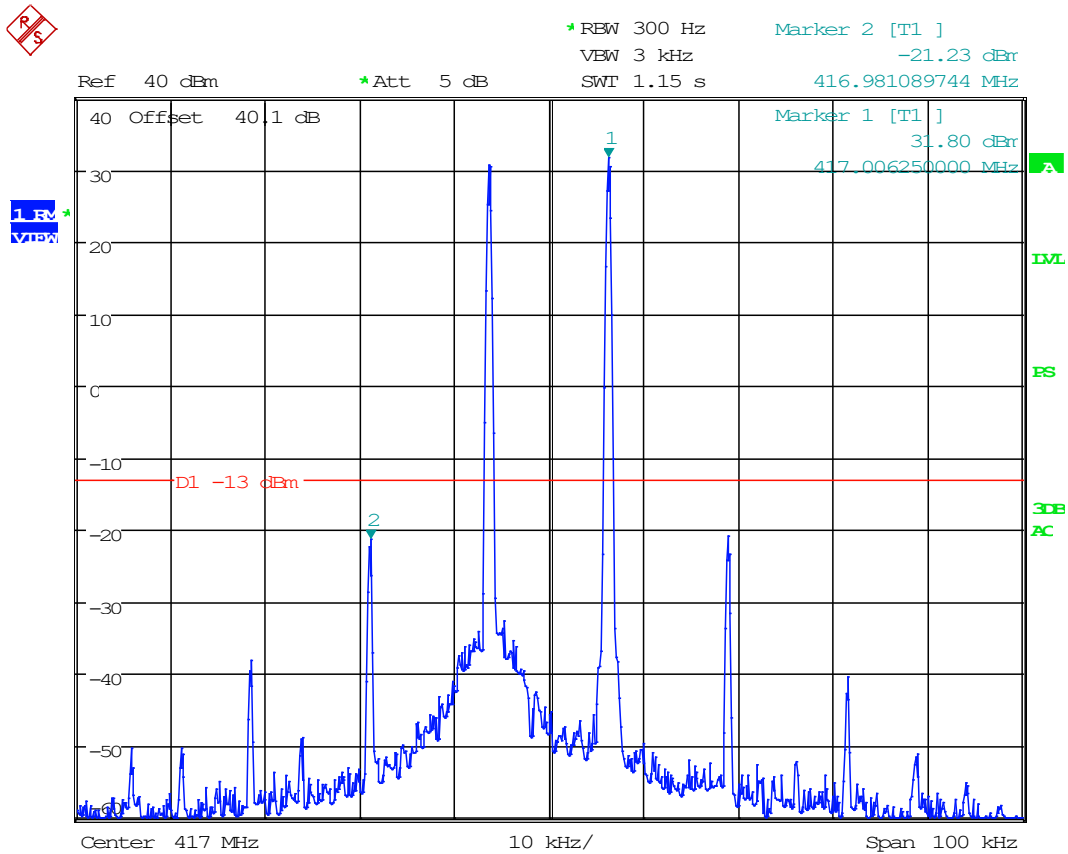

Date: 5.APR.2022 14:44:12



8.7.9 12.5 kHz, Uplink, 427 MHz AGC

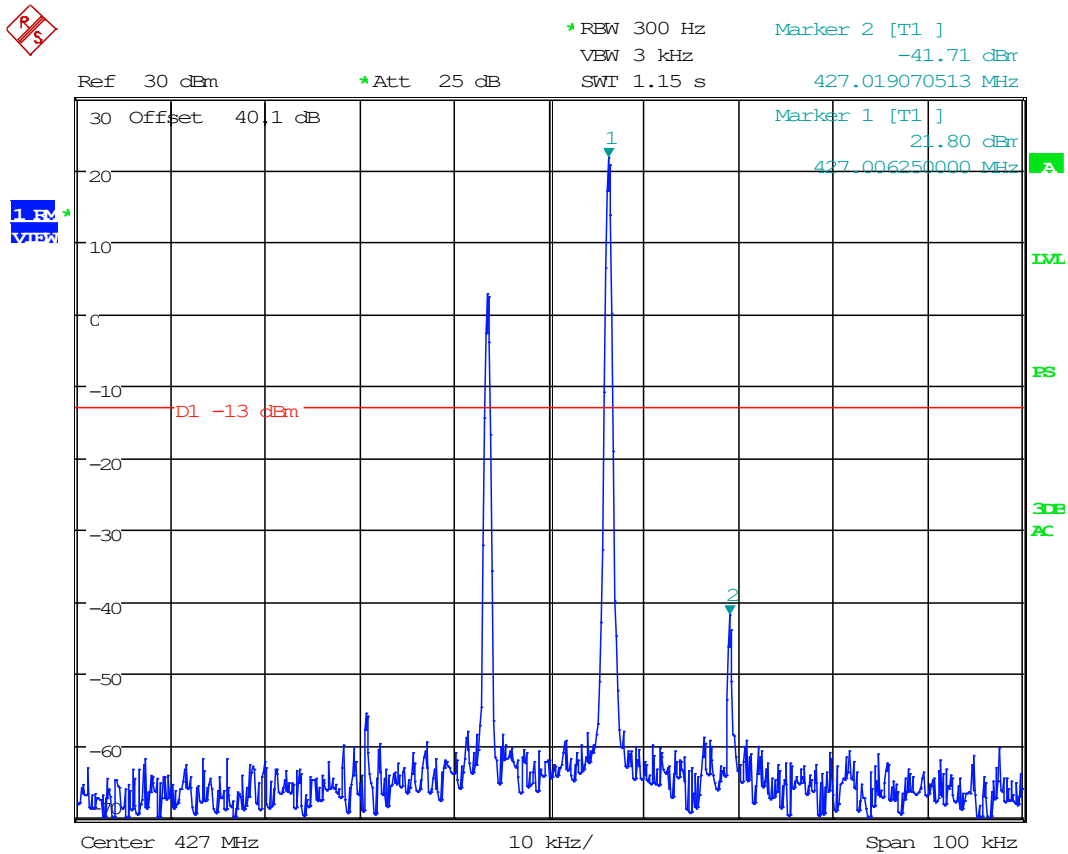


Date: 11.MAY.2022 10:02:35





Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

8.7.10 12.5 kHz, Uplink, 427 MHz AGC+3

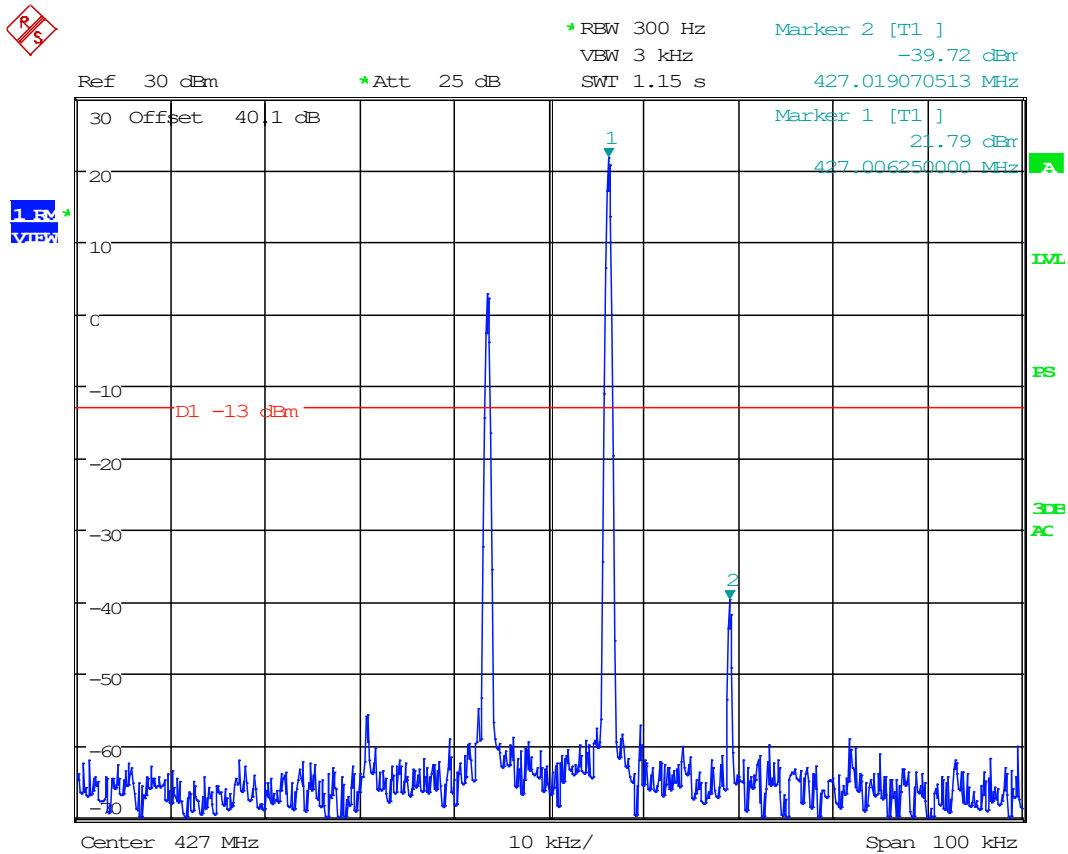

Date: 11.MAY.2022 10:03:43

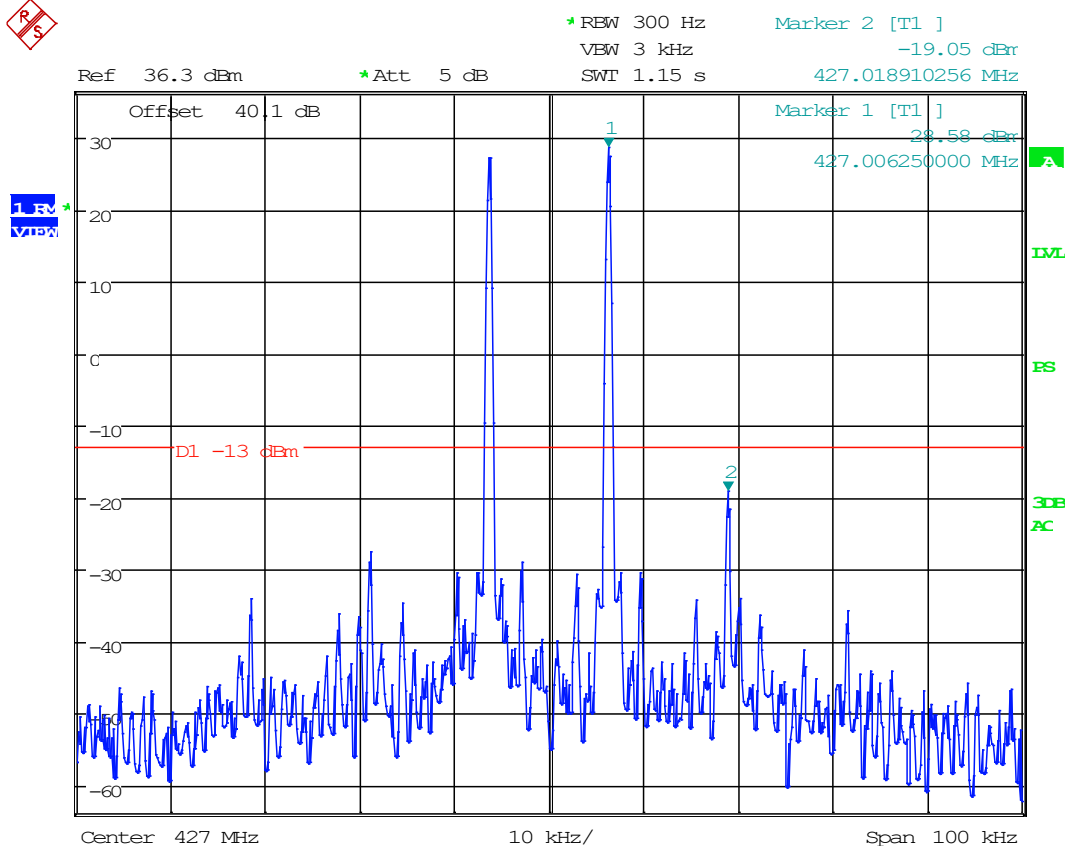


Date: 6.APR.2022 12:16:27



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

8.7.12 12.5 kHz, Downlink, 427 MHz AGC +3

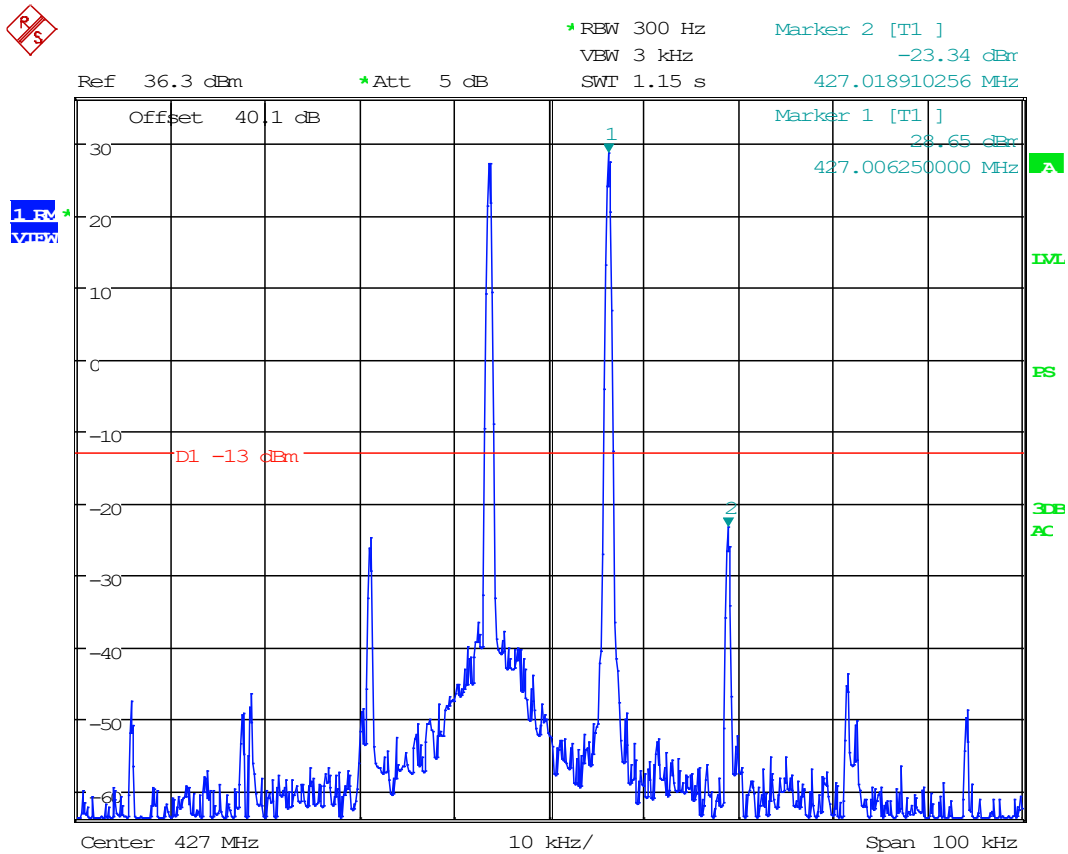


Date: 6.APR.2022 12:16:57



8.8 Emission Mask, Out-of-Band


Limits from FCC Parts 2.1051, 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

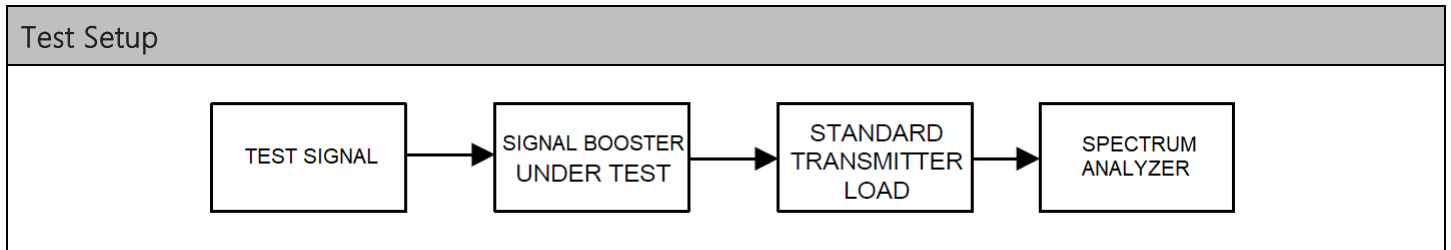



Conducted Emissions Spectrum Plots


8.8.1 30 MHz to 1 GHz, Uplink, 412 MHz

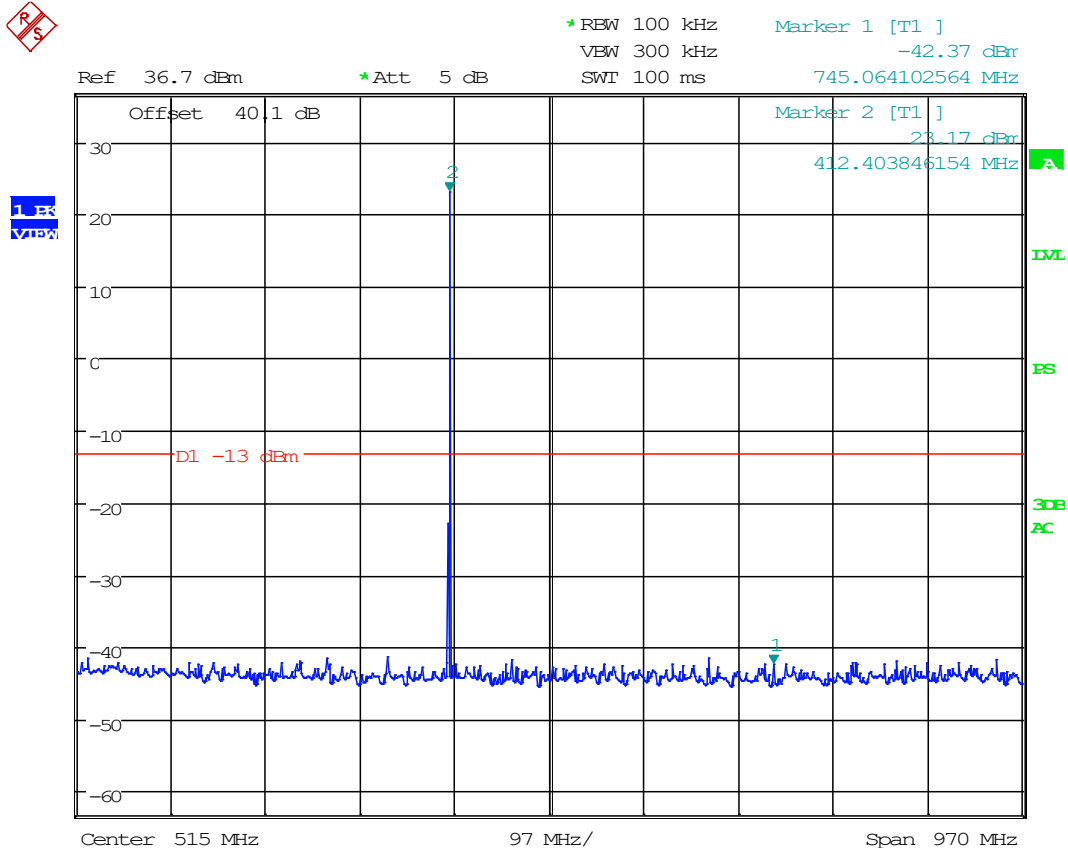

Date: 5.APR.2022 16:23:03



8.8.2 1 GHz to 10th Harmonic, Uplink, 412 MHz

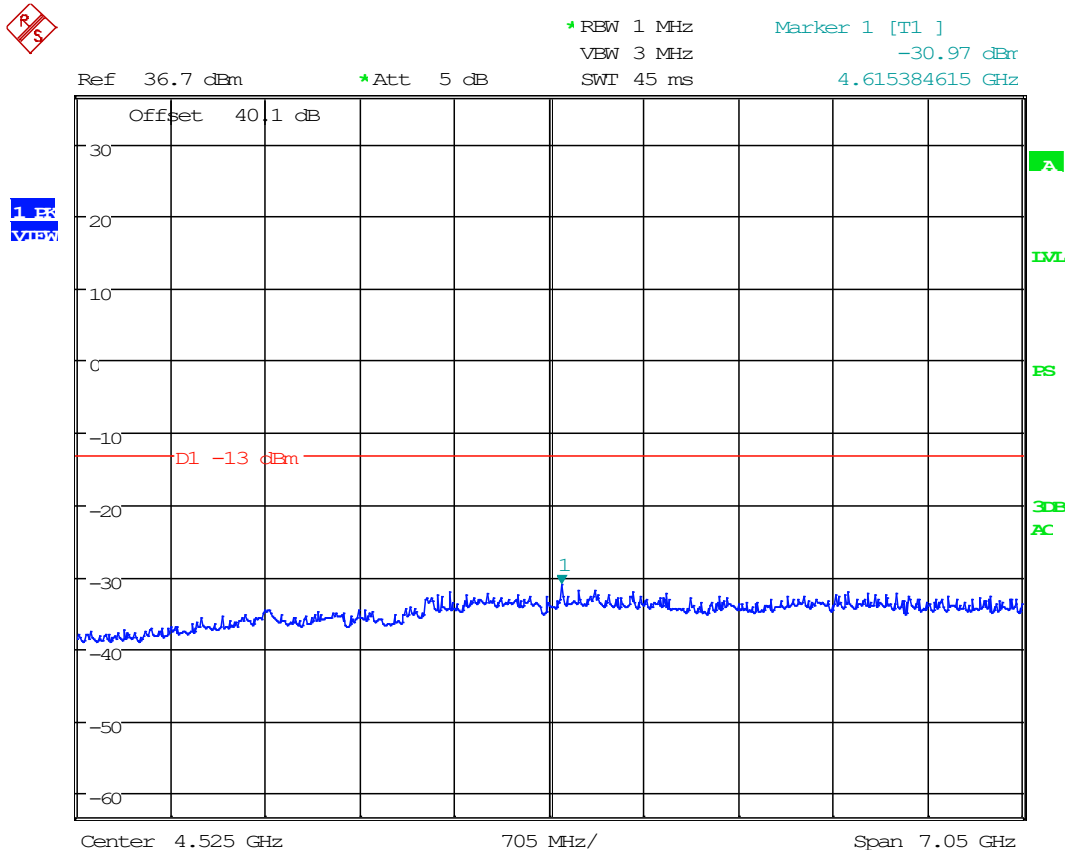

Date: 5.APR.2022 16:24:58



Offset 40.1 dB

Ref 36.7 dBm

*Att 5 dB

REBW 100 kHz

VEW 300 kHz

SWT 100 ms

Marker 1 [T1]

-42.29 dBm

780.817307692 MHz

Marker 2 [T1]

22.88 dBm

412.403846154 MHz

D1 -13 dBm

Center 515 MHz


97 MHz/

Span 970 MHz

Page 124 of 142




8.8.4 1 GHz to 10th Harmonic, Downlink, 412 MHz

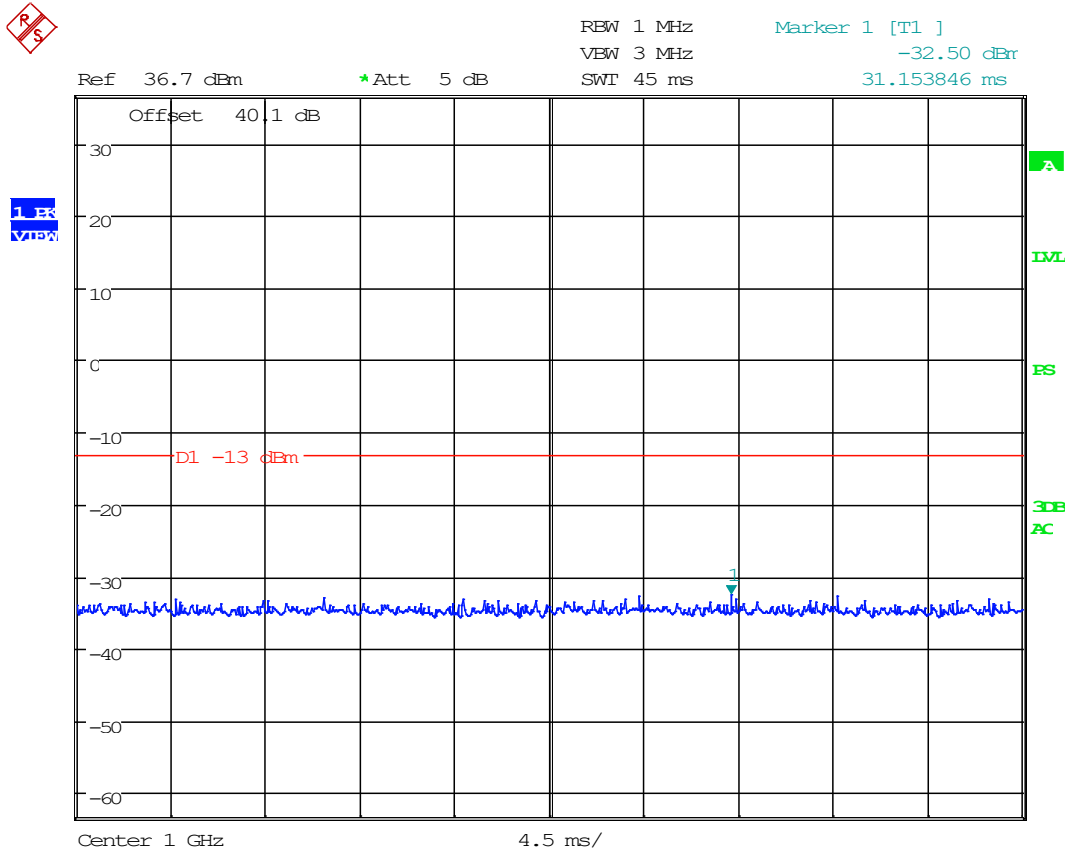

Date: 5.APR.2022 16:50:42




8.8.5 30 MHz to 1 GHz, Uplink, 417 MHz

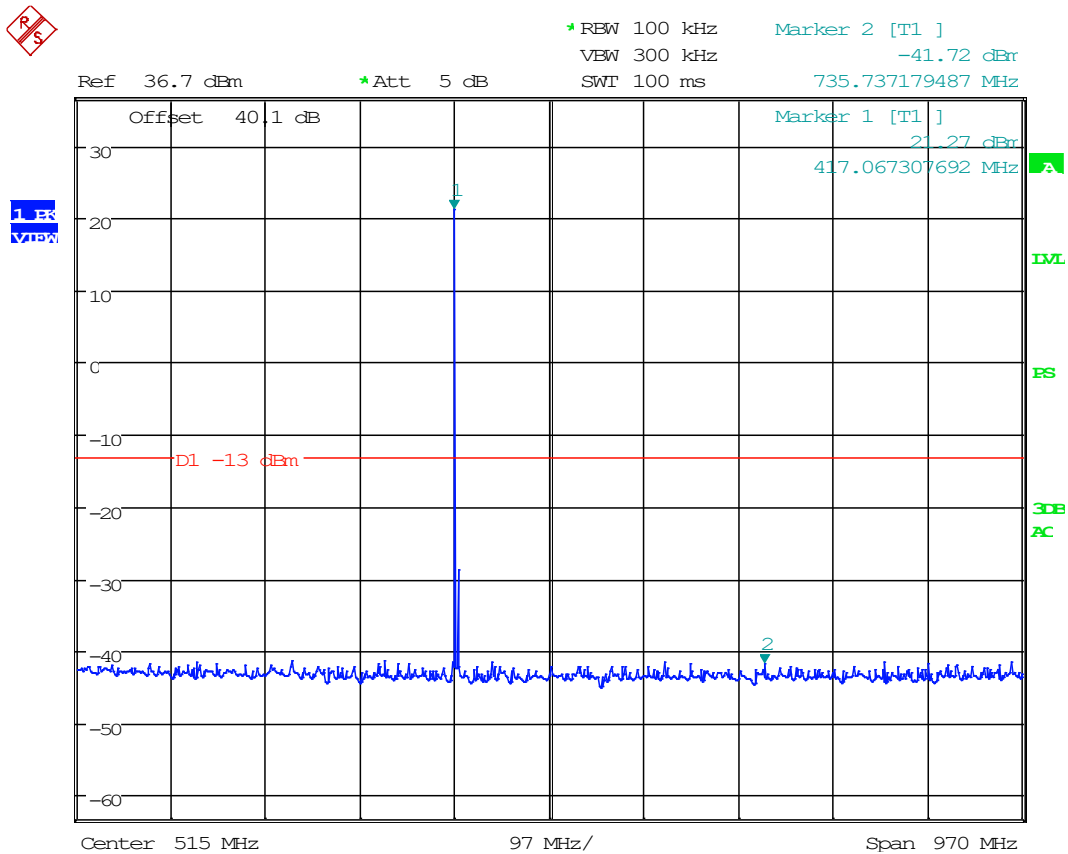

Date: 5.APR.2022 15:09:44




8.8.6 1 GHz to 10th Harmonic, Uplink, 417 MHz

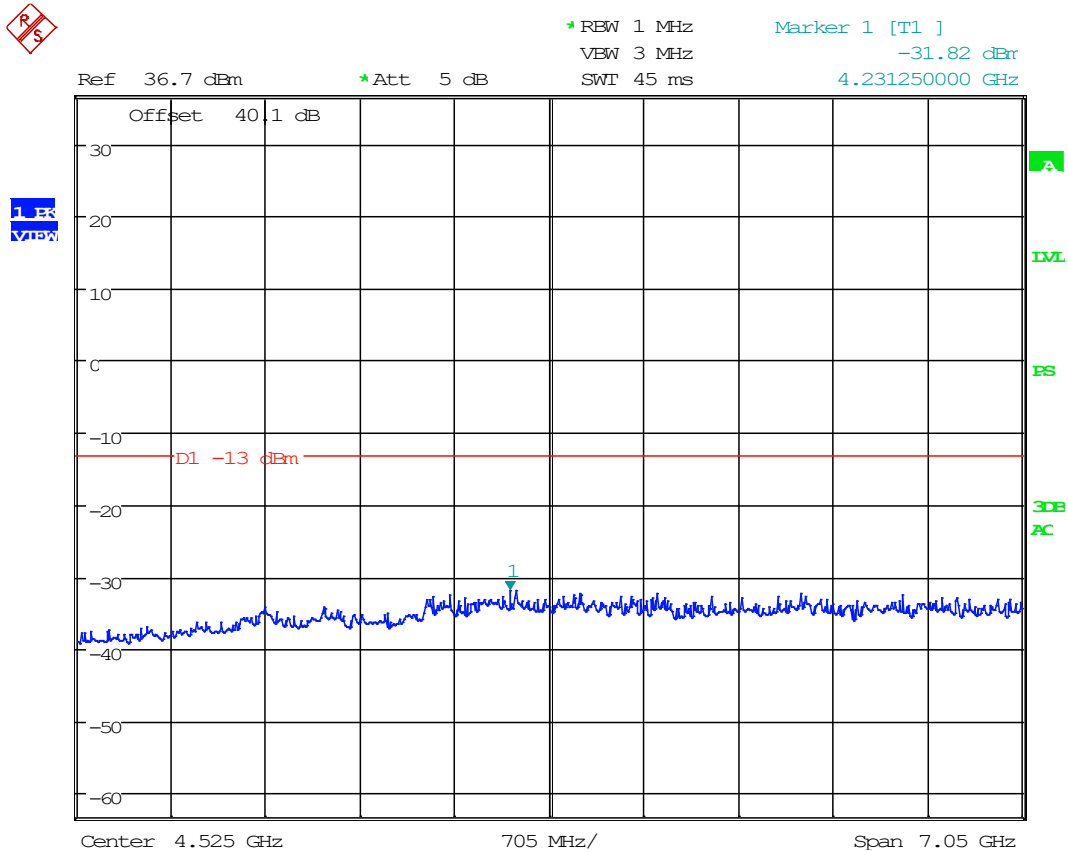

Date: 5.APR.2022 15:10:48




8.8.7 30 MHz to 1 GHz, Downlink, 417 MHz

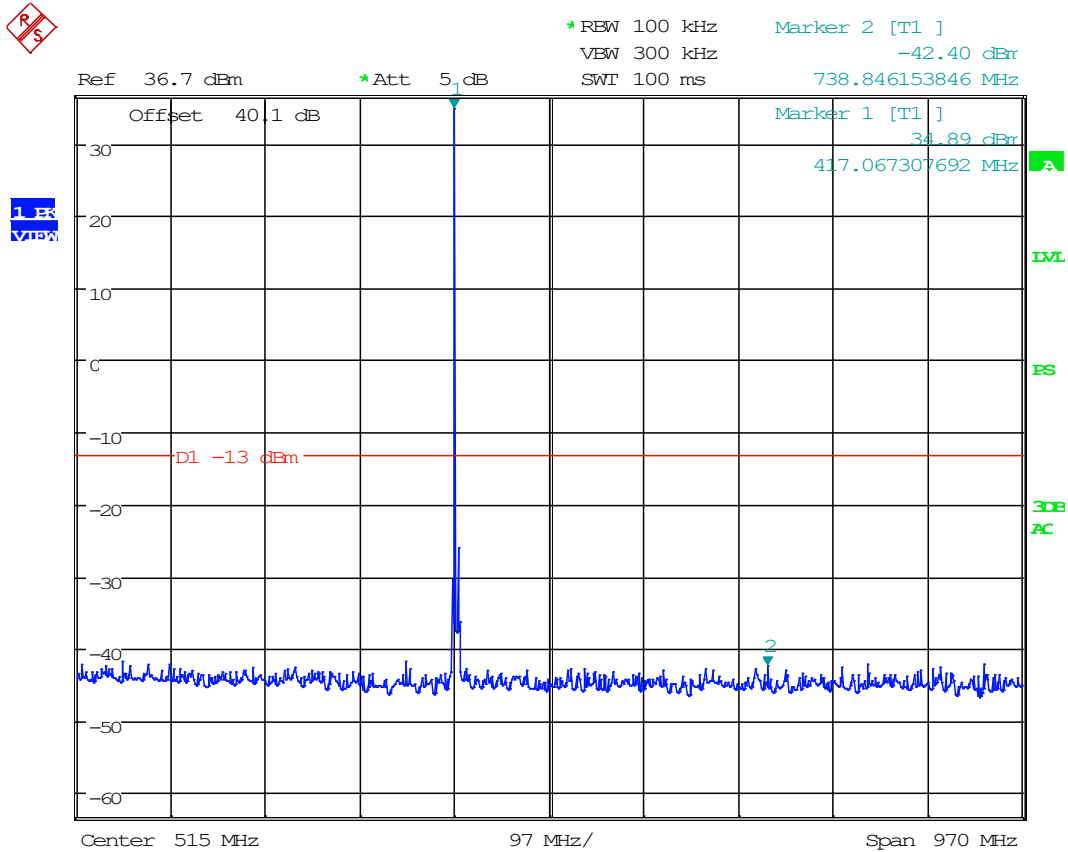

Date: 5.APR.2022 14:46:38




8.8.8 1 GHz to 10th Harmonic, Downlink, 417 MHz

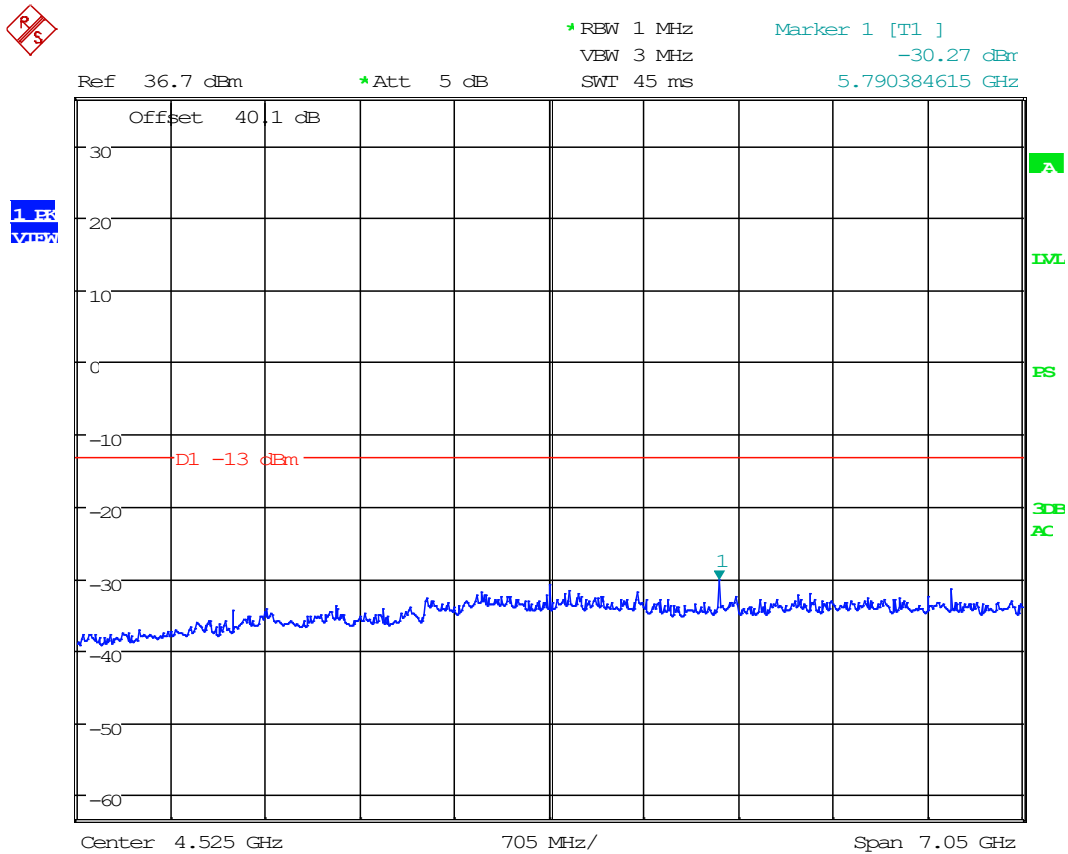

Date: 5.APR.2022 14:47:33




8.8.9 30 MHz to 1 GHz, Uplink, 427 MHz

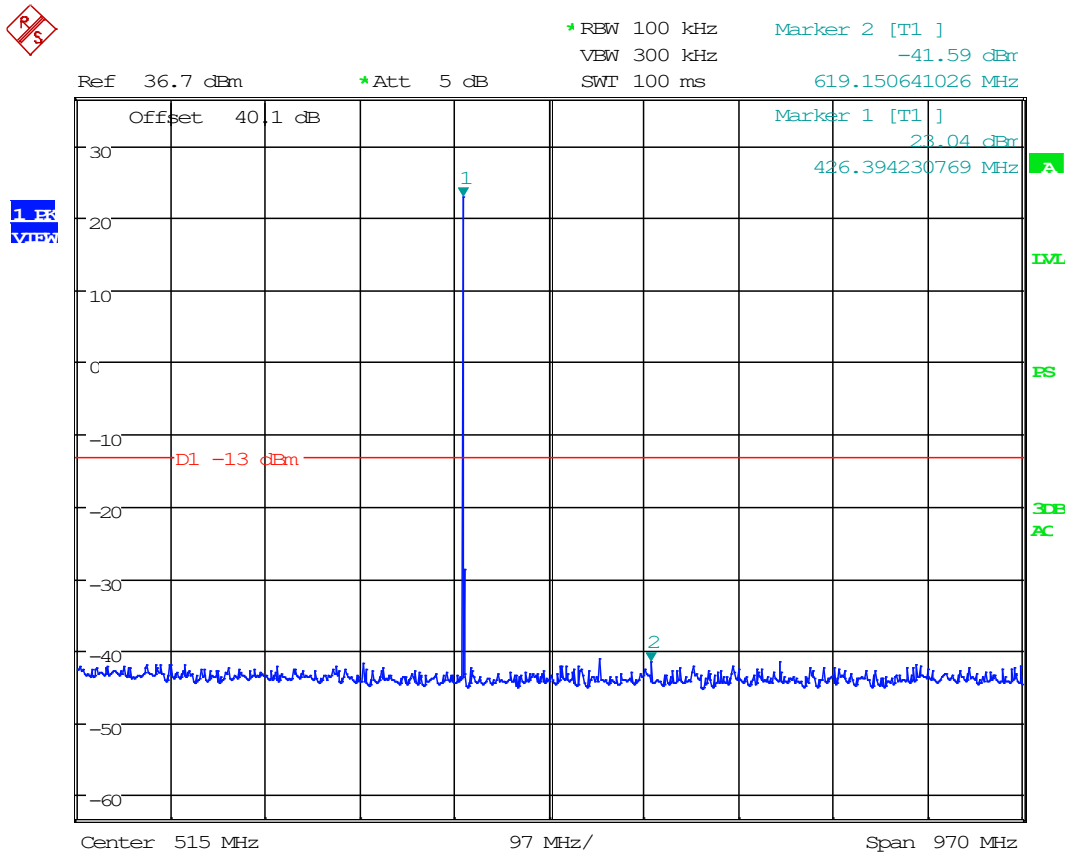

Date: 11.MAY.2022 09:50:14




8.8.10 1 GHz to 10th Harmonic, Uplink, 427 MHz

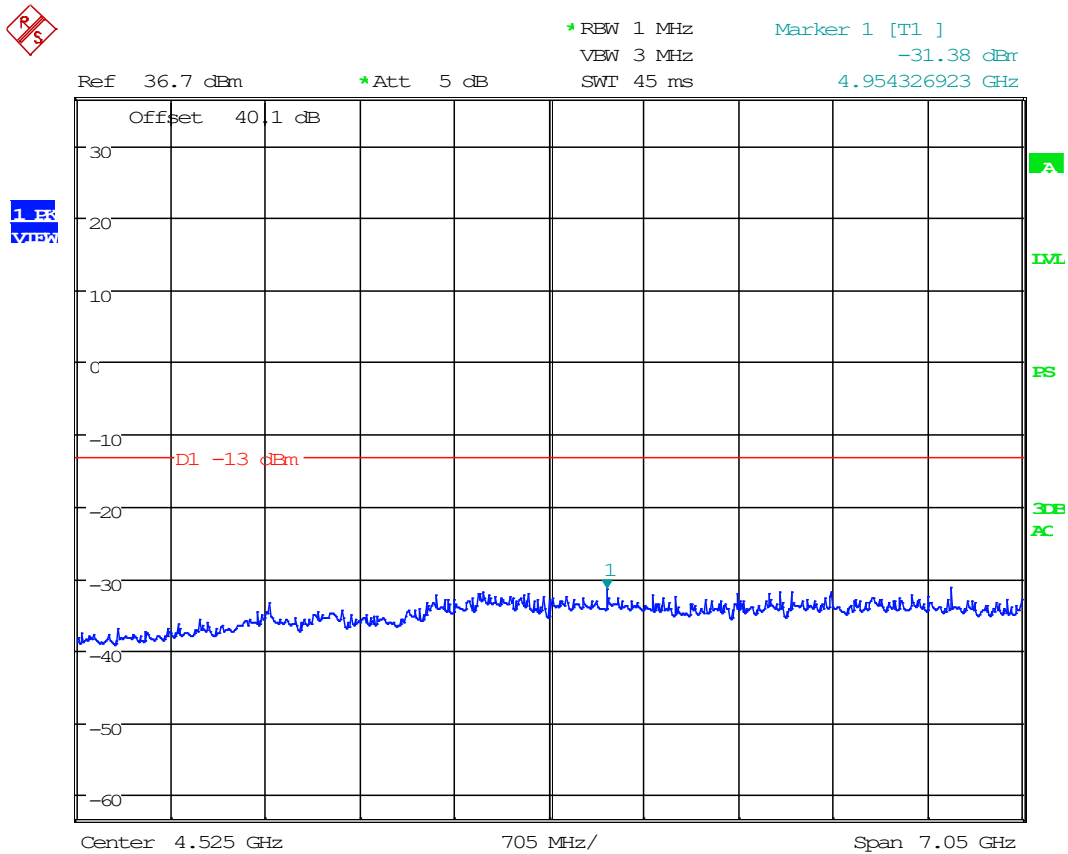

Date: 11.MAY.2022 09:50:38


8.8.11 30 MHz to 1 GHz, Downlink, 427 MHz

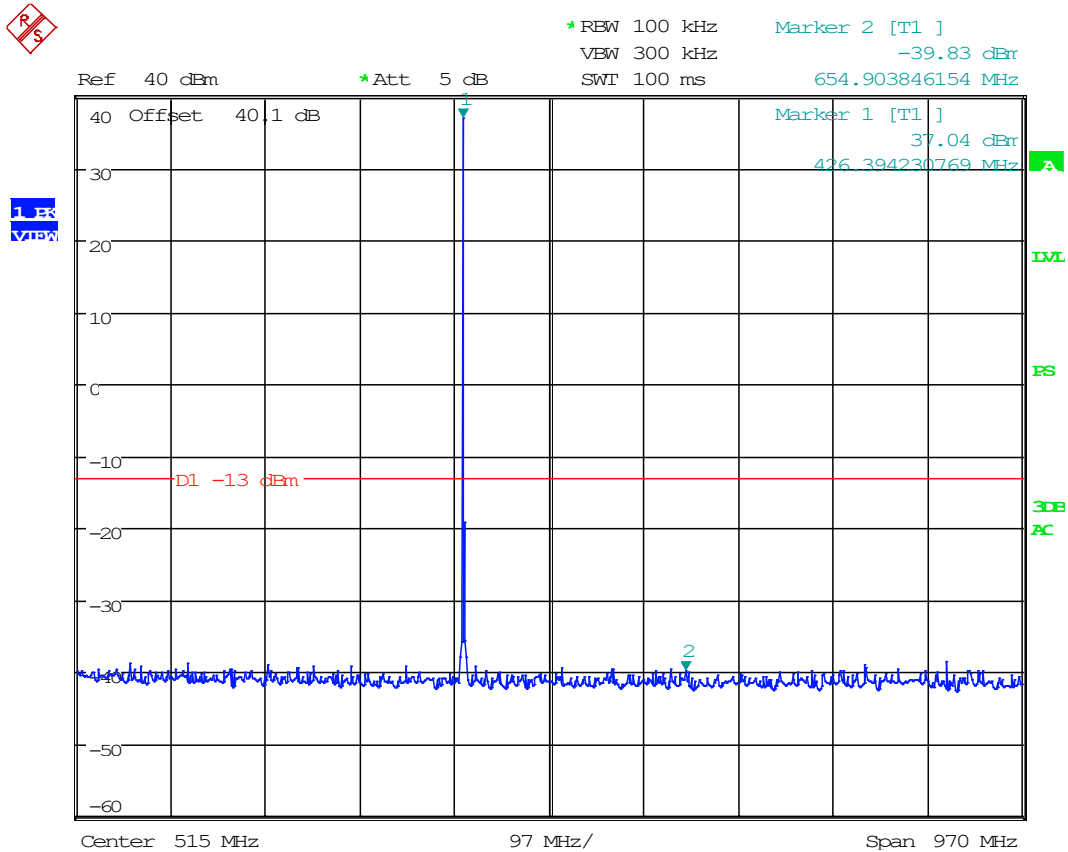

Date: 6.APR.2022 11:46:19



8.8.12 1 GHz to 10th Harmonic, Downlink, 427 MHz

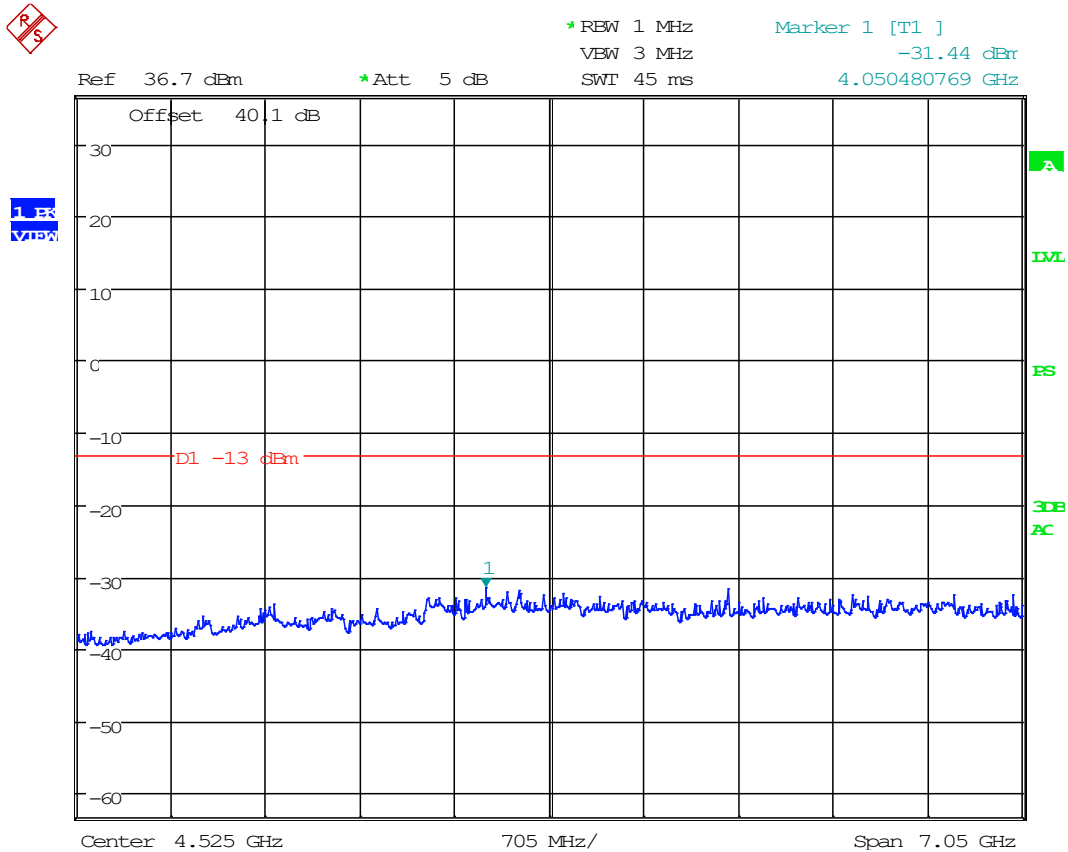


Date: 6.APR.2022 11:47:28


8.9 Spurious Radiated Emissions

Limits from FCC Parts 2.1053, 90.210 and test procedure from ANSI C63.26-2015 and FCC KDB 935210 D05 v01r04 Industrial Signal Boosters.

Radiated Test Setup, 30 – 1000 MHz

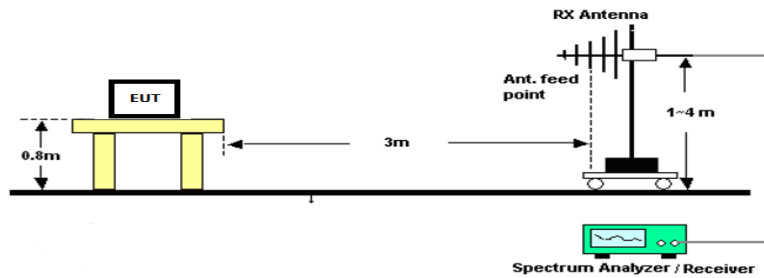

Radiated Test Setup, Above 1000 MHz

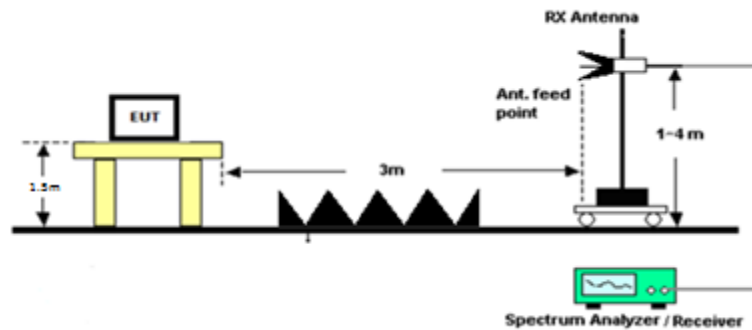

Note: Testing was done simultaneously on all combinations of Uplinks and Downlinks to address co-location of signals.



Timco Engineering, Inc., an IIA Company
 849 NW State Road 45, Newberry, Florida 32669
 (352) 472-5500 / testing@timcoengr.com

8.9.1 Uplink, 412 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
412.00	824.00	PK	14.04	H	3.40	20.88	3.00	38.32	-59.06	-13.00	46.06
412.00	824.00	PK	13.58	V	3.40	20.88	3.00	37.86	-59.52	-13.00	46.52
412.00	1236.00	PK	14.02	H	4.05	28.31	3.00	46.39	-50.99	-13.00	37.99
412.00	1236.00	PK	14.74	V	4.05	28.31	3.00	47.11	-50.27	-13.00	37.27
412.00	1648.00	PK	15.17	H	4.72	28.58	3.00	48.48	-48.90	-13.00	35.90
412.00	1648.00	PK	15.20	V	4.72	28.58	3.00	48.51	-48.87	-13.00	35.87
412.00	2060.00	PK	14.80	H	5.30	30.99	3.00	51.09	-46.29	-13.00	33.29
412.00	2060.00	PK	14.61	V	5.30	30.99	3.00	50.90	-46.48	-13.00	33.48
412.00	2472.00	PK	14.50	H	5.62	32.03	3.00	52.15	-45.23	-13.00	32.23
412.00	2472.00	PK	15.33	V	5.62	32.03	3.00	52.98	-44.40	-13.00	31.40
412.00	2884.00	PK	14.93	H	6.21	32.24	3.00	53.39	-43.99	-13.00	30.99
412.00	2884.00	PK	16.58	V	6.21	32.24	3.00	55.04	-42.34	-13.00	29.34
412.00	3296.00	PK	15.11	H	6.70	32.63	3.00	54.44	-42.94	-13.00	29.94
412.00	3296.00	PK	15.09	V	6.70	32.63	3.00	54.42	-42.96	-13.00	29.96
412.00	3708.00	PK	13.85	H	6.57	33.18	3.00	53.60	-43.77	-13.00	30.77
412.00	3708.00	PK	13.63	V	6.57	33.18	3.00	53.38	-43.99	-13.00	30.99
412.00	4120.00	PK	13.50	H	7.09	33.41	3.00	54.00	-43.38	-13.00	30.38
412.00	4120.00	PK	13.64	V	7.09	33.41	3.00	54.14	-43.24	-13.00	30.24



Timco Engineering, Inc., an IIA Company
 849 NW State Road 45, Newberry, Florida 32669
 (352) 472-5500 / testing@timcoengr.com

8.9.2 Downlink, 412 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
412.00	824.00	PK	14.23	H	3.40	20.88	3.00	38.51	-58.87	-13.00	45.87
412.00	824.00	PK	14.35	V	3.40	20.88	3.00	38.63	-58.75	-13.00	45.75
412.00	1236.00	PK	14.03	H	4.05	28.31	3.00	46.40	-50.98	-13.00	37.98
412.00	1236.00	PK	14.52	V	4.05	28.31	3.00	46.89	-50.49	-13.00	37.49
412.00	1648.00	PK	14.18	H	4.72	28.58	3.00	47.49	-49.89	-13.00	36.89
412.00	1648.00	PK	14.73	V	4.72	28.58	3.00	48.04	-49.34	-13.00	36.34
412.00	2060.00	PK	14.74	H	5.30	30.99	3.00	51.03	-46.35	-13.00	33.35
412.00	2060.00	PK	14.34	V	5.30	30.99	3.00	50.63	-46.75	-13.00	33.75
412.00	2472.00	PK	15.30	H	5.62	32.03	3.00	52.95	-44.43	-13.00	31.43
412.00	2472.00	PK	14.94	V	5.62	32.03	3.00	52.59	-44.79	-13.00	31.79
412.00	2884.00	PK	15.46	H	6.21	32.24	3.00	53.92	-43.46	-13.00	30.46
412.00	2884.00	PK	14.86	V	6.21	32.24	3.00	53.32	-44.06	-13.00	31.06
412.00	3296.00	PK	15.03	H	6.70	32.63	3.00	54.36	-43.02	-13.00	30.02
412.00	3296.00	PK	15.64	V	6.70	32.63	3.00	54.97	-42.41	-13.00	29.41
412.00	3708.00	PK	14.24	H	6.57	33.18	3.00	53.99	-43.38	-13.00	30.38
412.00	3708.00	PK	13.81	V	6.57	33.18	3.00	53.56	-43.81	-13.00	30.81
412.00	4120.00	PK	13.52	H	7.09	33.41	3.00	54.02	-43.36	-13.00	30.36
412.00	4120.00	PK	14.11	V	7.09	33.41	3.00	54.61	-42.77	-13.00	29.77



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

8.9.3 Uplink, 417 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
417.00	834.00	PK	14.08	H	3.42	21.50	3.00	39.00	-58.38	-13.00	45.38
417.00	834.00	PK	14.93	V	3.42	21.50	3.00	39.85	-57.53	-13.00	44.53
417.00	1251.00	PK	14.07	H	4.07	28.42	3.00	46.56	-50.81	-13.00	37.81
417.00	1251.00	PK	14.12	V	4.07	28.42	3.00	46.61	-50.76	-13.00	37.76
417.00	1668.00	PK	15.40	H	4.75	28.77	3.00	48.92	-48.46	-13.00	35.46
417.00	1668.00	PK	14.58	V	4.75	28.77	3.00	48.10	-49.28	-13.00	36.28
417.00	2085.00	PK	14.79	H	5.32	31.02	3.00	51.14	-46.24	-13.00	33.24
417.00	2085.00	PK	14.50	V	5.32	31.02	3.00	50.85	-46.53	-13.00	33.53
417.00	2502.00	PK	15.24	H	5.62	32.29	3.00	53.16	-44.22	-13.00	31.22
417.00	2502.00	PK	15.23	V	5.62	32.29	3.00	53.15	-44.23	-13.00	31.23
417.00	2919.00	PK	15.49	H	6.26	32.26	3.00	54.01	-43.37	-13.00	30.37
417.00	2919.00	PK	15.86	V	6.26	32.26	3.00	54.38	-43.00	-13.00	30.00
417.00	3336.00	PK	15.55	H	6.73	32.64	3.00	54.91	-42.47	-13.00	29.47
417.00	3336.00	PK	15.28	V	6.73	32.64	3.00	54.64	-42.74	-13.00	29.74
417.00	3753.00	PK	13.53	H	6.46	33.12	3.00	53.11	-44.26	-13.00	31.26
417.00	3753.00	PK	14.05	V	6.46	33.12	3.00	53.63	-43.74	-13.00	30.74
417.00	4170.00	PK	14.06	H	6.96	33.38	3.00	54.40	-42.98	-13.00	29.98
417.00	4170.00	PK	13.60	V	6.96	33.38	3.00	53.94	-43.44	-13.00	30.44



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

8.9.4 Downlink, 417 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
417.00	834.00	PK	13.98	H	3.42	21.50	3.00	38.90	-58.48	-13.00	45.48
417.00	834.00	PK	13.93	V	3.42	21.50	3.00	38.85	-58.53	-13.00	45.53
417.00	1251.00	PK	14.28	H	4.07	28.42	3.00	46.77	-50.60	-13.00	37.60
417.00	1251.00	PK	13.90	V	4.07	28.42	3.00	46.39	-50.98	-13.00	37.98
417.00	1668.00	PK	14.76	H	4.75	28.77	3.00	48.28	-49.10	-13.00	36.10
417.00	1668.00	PK	14.46	V	4.75	28.77	3.00	47.98	-49.40	-13.00	36.40
417.00	2085.00	PK	15.60	H	5.32	31.02	3.00	51.95	-45.43	-13.00	32.43
417.00	2085.00	PK	14.42	V	5.32	31.02	3.00	50.77	-46.61	-13.00	33.61
417.00	2502.00	PK	15.23	H	5.62	32.29	3.00	53.15	-44.23	-13.00	31.23
417.00	2502.00	PK	14.97	V	5.62	32.29	3.00	52.89	-44.49	-13.00	31.49
417.00	2919.00	PK	15.66	H	6.26	32.26	3.00	54.18	-43.20	-13.00	30.20
417.00	2919.00	PK	14.80	V	6.26	32.26	3.00	53.32	-44.06	-13.00	31.06
417.00	3336.00	PK	15.28	H	6.73	32.64	3.00	54.64	-42.74	-13.00	29.74
417.00	3336.00	PK	15.65	V	6.73	32.64	3.00	55.01	-42.37	-13.00	29.37
417.00	3753.00	PK	13.46	H	6.46	33.12	3.00	53.04	-44.33	-13.00	31.33
417.00	3753.00	PK	13.44	V	6.46	33.12	3.00	53.02	-44.35	-13.00	31.35
417.00	4170.00	PK	13.75	H	6.96	33.38	3.00	54.09	-43.29	-13.00	30.29
417.00	4170.00	PK	13.80	V	6.96	33.38	3.00	54.14	-43.24	-13.00	30.24



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

8.9.5 Uplink, 427 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
427.00	854.00	PK	3.20	H	3.49	22.18	3.00	28.87	-68.51	-13.00	55.51
427.00	854.00	PK	2.90	V	3.49	22.18	3.00	28.57	-68.81	-13.00	55.81
427.00	1281.00	PK	2.82	H	4.14	28.58	3.00	35.53	-61.84	-13.00	48.84
427.00	1281.00	PK	3.68	V	4.14	28.58	3.00	36.39	-60.98	-13.00	47.98
427.00	1708.00	PK	3.38	H	4.79	29.17	3.00	37.35	-60.03	-13.00	47.03
427.00	1708.00	PK	3.56	V	4.79	29.17	3.00	37.53	-59.85	-13.00	46.85
427.00	2135.00	PK	4.31	H	5.36	31.18	3.00	40.85	-56.53	-13.00	43.53
427.00	2135.00	PK	3.55	V	5.36	31.18	3.00	40.09	-57.29	-13.00	44.29
427.00	2562.00	PK	4.30	H	5.71	32.56	3.00	42.57	-54.81	-13.00	41.81
427.00	2562.00	PK	4.35	V	5.71	32.56	3.00	42.62	-54.76	-13.00	41.76
427.00	2989.00	PK	4.34	H	6.32	32.49	3.00	43.14	-54.24	-13.00	41.24
427.00	2989.00	PK	4.86	V	6.32	32.49	3.00	43.66	-53.72	-13.00	40.72
427.00	3416.00	PK	5.21	H	6.83	32.63	3.00	44.67	-52.71	-13.00	39.71
427.00	3416.00	PK	4.88	V	6.83	32.63	3.00	44.34	-53.04	-13.00	40.04
427.00	3843.00	PK	3.74	H	6.55	33.19	3.00	43.48	-53.90	-13.00	40.90
427.00	3843.00	PK	3.77	V	6.55	33.19	3.00	43.51	-53.87	-13.00	40.87
427.00	4270.00	PK	4.34	H	7.31	33.39	3.00	45.03	-52.35	-13.00	39.35
427.00	4270.00	PK	3.63	V	7.31	33.39	3.00	44.32	-53.06	-13.00	40.06



Timco Engineering, Inc., an IIA Company
 849 NW State Road 45, Newberry, Florida 32669
 (352) 472-5500 / testing@timcoengr.com

8.9.6 Downlink, 427 MHz

Tuned Frequency (MHz)	Emission Frequency (MHz)	Detector	Meter Reading (dBuV)	Antenna Polarity	Coax Loss (dB)	Antenna Correction Factor (dB/m)	Distance (m)	Field Strength (dBuV/m)	ERP (dBm)	Spurious Limit (dBm)	Margin (dB)
427.00	854.00	PK	13.66	H	3.49	22.18	3.00	39.33	-58.05	-13.00	45.05
427.00	854.00	PK	13.60	V	3.49	22.18	3.00	39.27	-58.11	-13.00	45.11
427.00	1281.00	PK	14.45	H	4.14	28.58	3.00	47.16	-50.21	-13.00	37.21
427.00	1281.00	PK	14.44	V	4.14	28.58	3.00	47.15	-50.22	-13.00	37.22
427.00	1708.00	PK	14.90	H	4.79	29.17	3.00	48.87	-48.51	-13.00	35.51
427.00	1708.00	PK	14.86	V	4.79	29.17	3.00	48.83	-48.55	-13.00	35.55
427.00	2135.00	PK	14.60	H	5.36	31.18	3.00	51.14	-46.24	-13.00	33.24
427.00	2135.00	PK	15.51	V	5.36	31.18	3.00	52.05	-45.33	-13.00	32.33
427.00	2562.00	PK	14.92	H	5.71	32.56	3.00	53.19	-44.19	-13.00	31.19
427.00	2562.00	PK	15.93	V	5.71	32.56	3.00	54.20	-43.18	-13.00	30.18
427.00	2989.00	PK	15.39	H	6.32	32.49	3.00	54.19	-43.19	-13.00	30.19
427.00	2989.00	PK	15.43	V	6.32	32.49	3.00	54.23	-43.15	-13.00	30.15
427.00	3416.00	PK	15.94	H	6.83	32.63	3.00	55.40	-41.98	-13.00	28.98
427.00	3416.00	PK	15.41	V	6.83	32.63	3.00	54.87	-42.51	-13.00	29.51
427.00	3843.00	PK	14.84	H	6.55	33.19	3.00	54.58	-42.80	-13.00	29.80
427.00	3843.00	PK	14.32	V	6.55	33.19	3.00	54.06	-43.32	-13.00	30.32
427.00	4270.00	PK	14.34	H	7.31	33.39	3.00	55.03	-42.35	-13.00	29.35
427.00	4270.00	PK	14.07	V	7.31	33.39	3.00	54.76	-42.62	-13.00	29.62



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

9. ANNEX-A - Photographs of the EUT

Photographs of the EUT and any manufacturer supplied accessories to be used with the EUT are in separate supplementary documents labelled EXTERNAL PHOTOS and INTERNAL PHOTOS.

10. ANNEX-B – Test Setup Photographs

Test setup photographs are located in a separate supplementary ANNEX-B document.

11. History of Test Report Changes

Test Report #	Revision #	Description	Date of Issue
TR_1654-22_FCC_PT90_Booster Class A_	1	Initial release	4/15/2022
	2	Updated Page 10–11 (New FCC ID and Description), 17-18, 23, 91-94, 99-102, 116-117, 129-130, 138	5/11/2022



Timco Engineering, Inc., an IIA Company
849 NW State Road 45, Newberry, Florida 32669
(352) 472-5500 / testing@timcoengr.com

END OF TEST REPORT
