



12 COMPLIANCE WITH THE RESTRICTED BAND EDGE TEST DATA

Compliance with the band edges was performed using the FCC's "Radiated Measurement at a Band Edge" guidance document. The final data derived below were from radiated measurements only. The data taken in this report represents the worst case at 11 MBPS. Data rates of 5.5MBPS, 2 MBPS and 1 MBPS were investigated and found to be in compliance. Both absolute and delta method were performed with the same results.


TABLE 28: RESTRICTED BAND EDGE

Band edge Measurement					
Antenna	Channel Set to	Frequency tested MHz	Field Strength Level (dB μ V/m)	FCC Limit (dB μ V/m)	FCC Margin (dB)
Cisco Dipole	1	2390.0	53.1	54.0	-0.9
	11	2483.5	53.9	54.0	-0.1
Dell Dipole	1	2390.0	41.4	54.0	-12.6
	11	2483.5	52.4	54.0	-1.6
Dell Inverted F	1	2390.0	40.4	54.0	-13.6
	11	2483.5	46.9	54.0	-7.1
Toshiba Chip	1	2390.0	37.9	54.0	-16.1
	11	2483.5	47.2	54.0	-6.8
Toshiba Inverted F	1	2390.0	39.8	54.0	-14.2
	11	2483.5	50.2	54.0	-3.8




15 BANDEDGE PLOTS

PLOT 1: CHANNEL 1 CISCO DIPOLE ANTENNA 1MHZ/10HZ

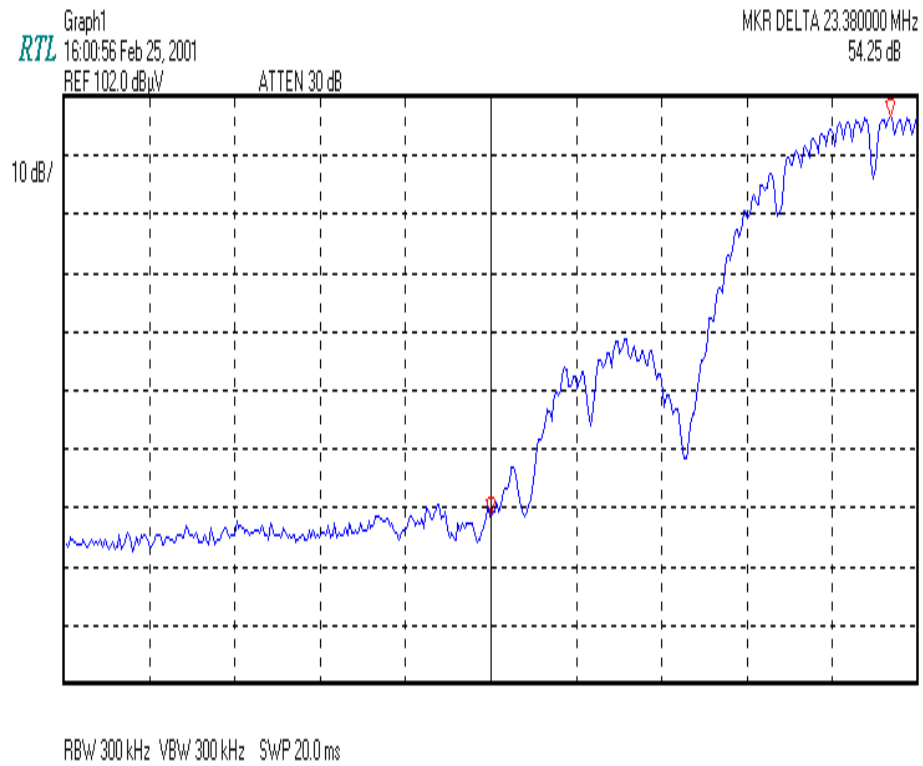



PLOT 2: CHANNEL 1 CISCO DIPOLE ANTENNA

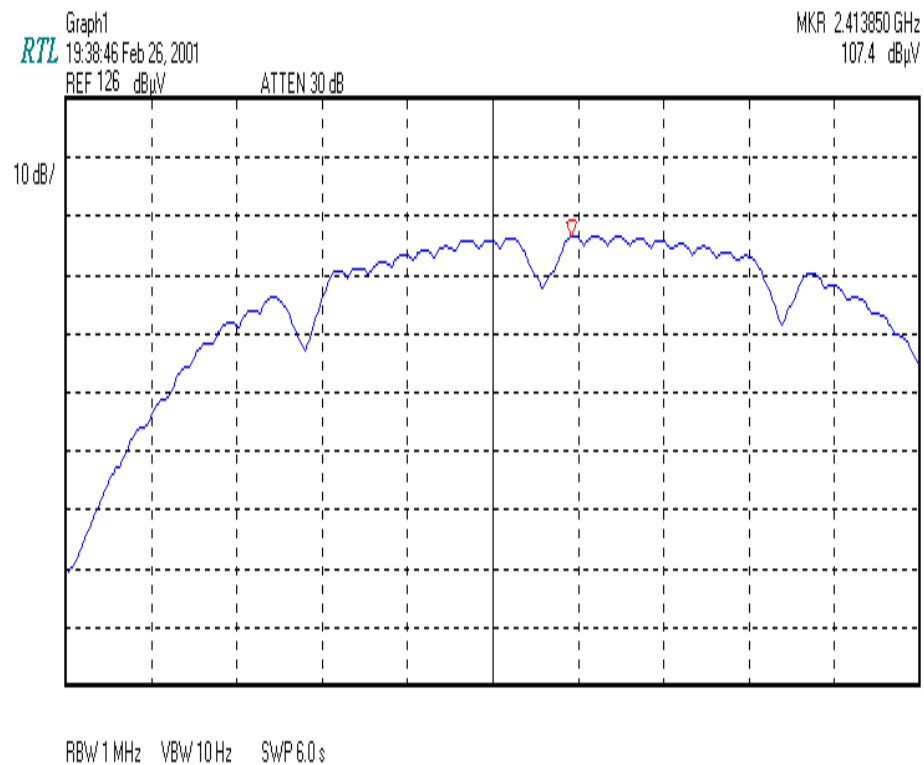


Note site factor entered into analyzer register for corrected final result.




360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 3: CHANNEL 11 CISCO DIPOLEANTENNA

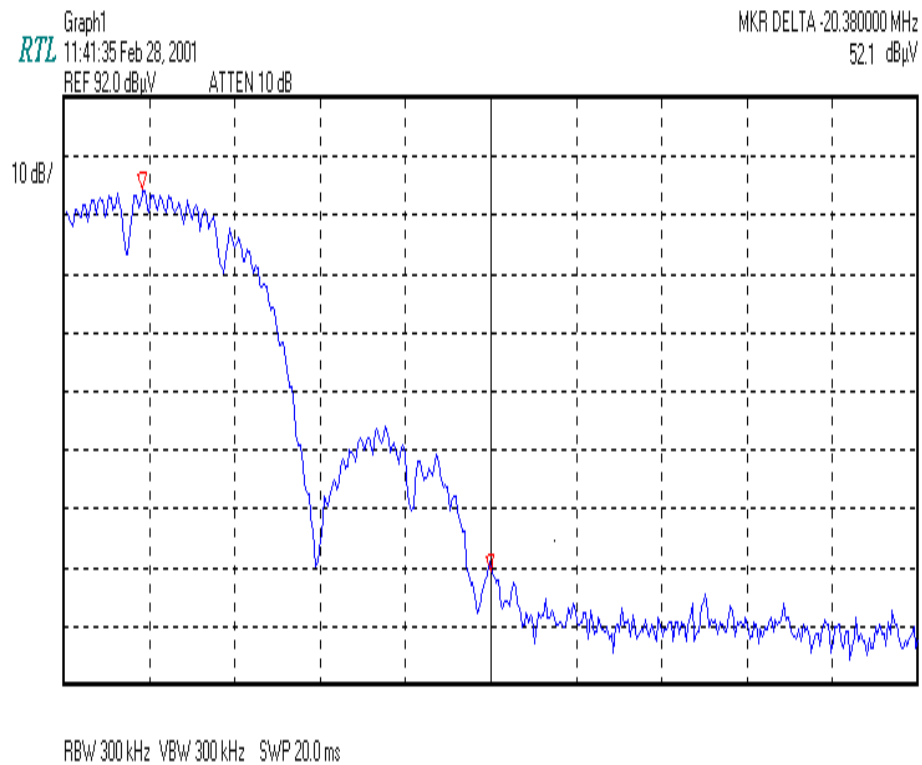



PLOT 4: CHANNEL 11 CISCO DIPOLE ANTENNA

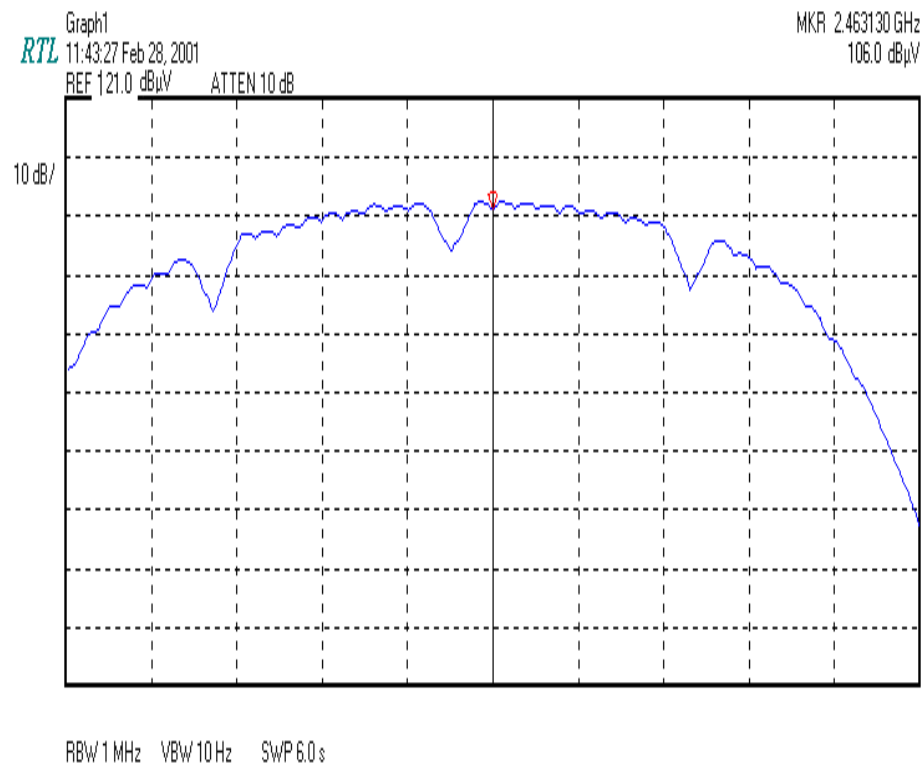


Note site factor entered into analyzer register for corrected final result.



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 5: CHANNEL 1 DELL DIPOLE ANTENNA 1MHZ/10HZ

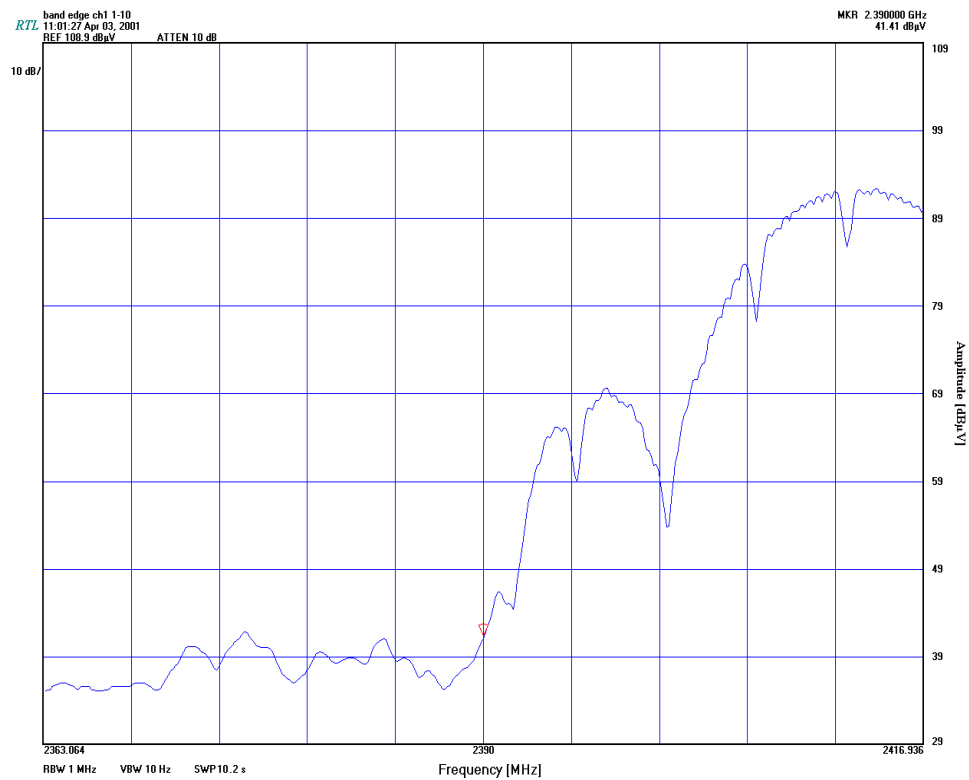




360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 6


CHANNEL 1 DELL DIPOLE ANTENNA 1MHZ/1MHZ

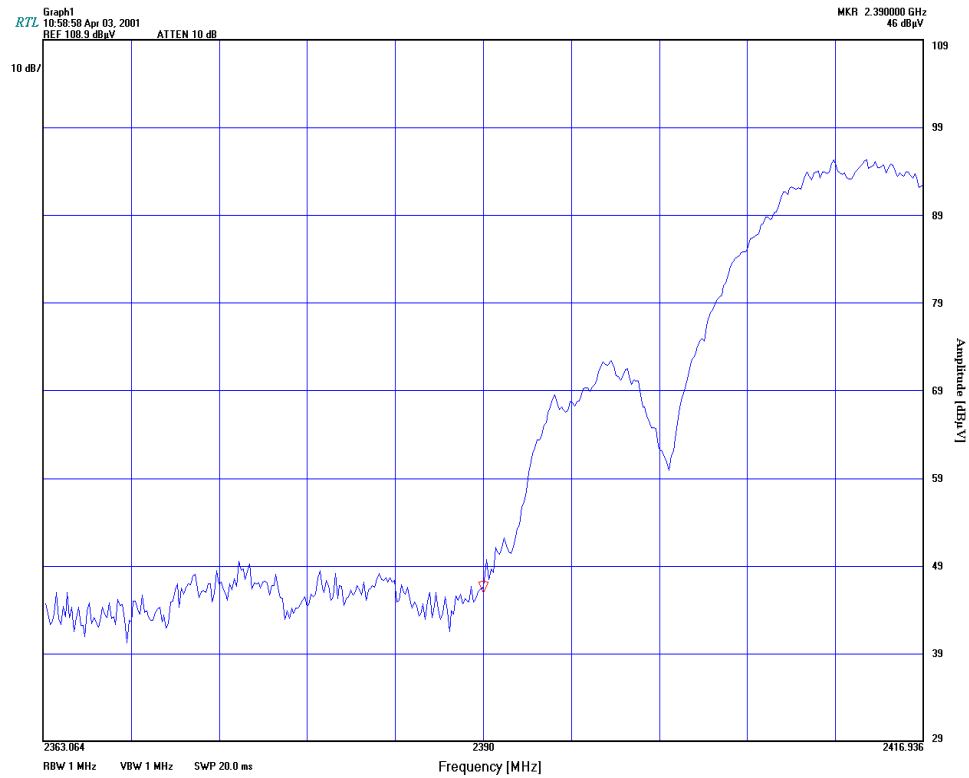



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 7 CHANNEL 11 DELL DIPOLE ANTENNA 1MHZ/10HZ

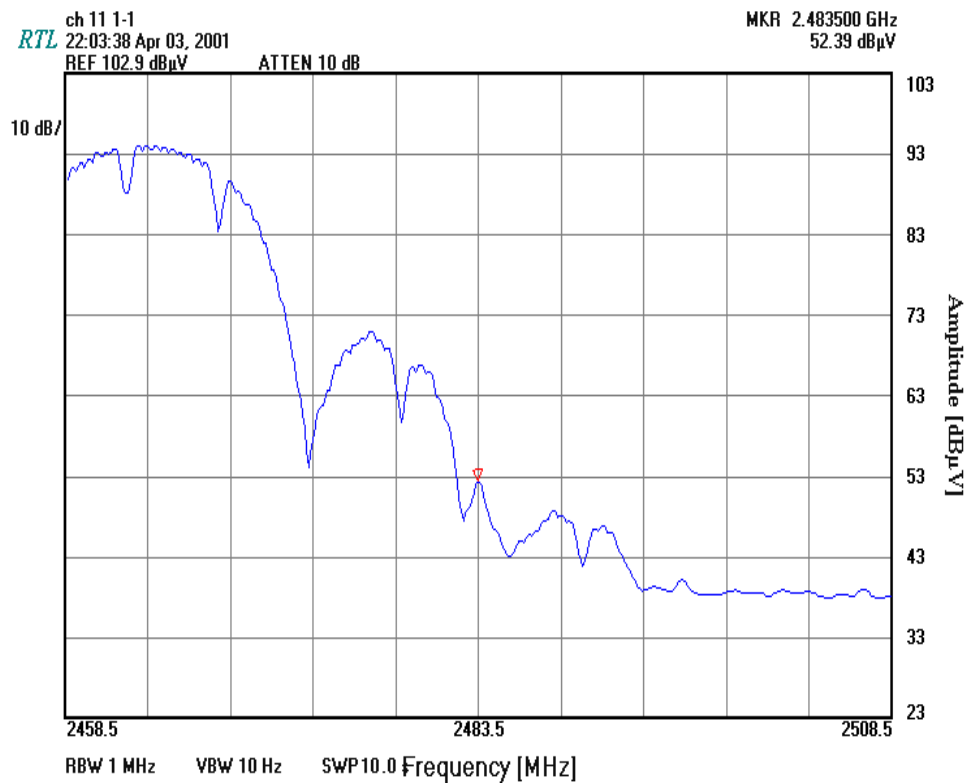




360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 8

CHANNEL 11 DELL DIPOLE ANTENNA 1MHZ/1MHZ

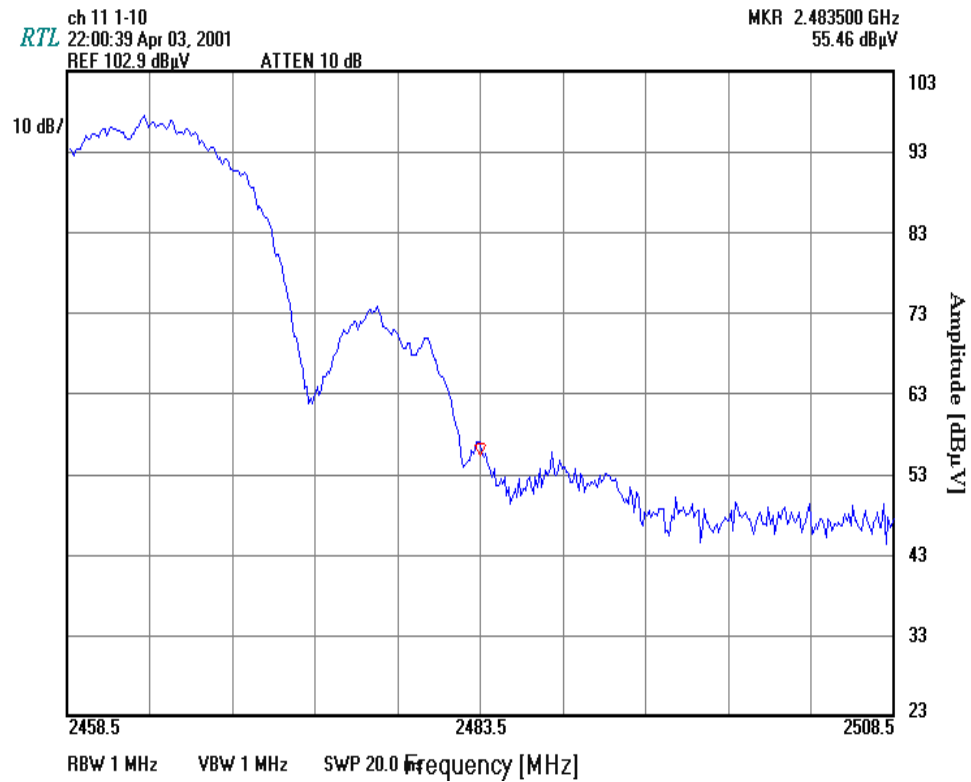




360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 9


CHANNEL 1 DELL INVERTED F ANTENNA 1MHZ/10HZ

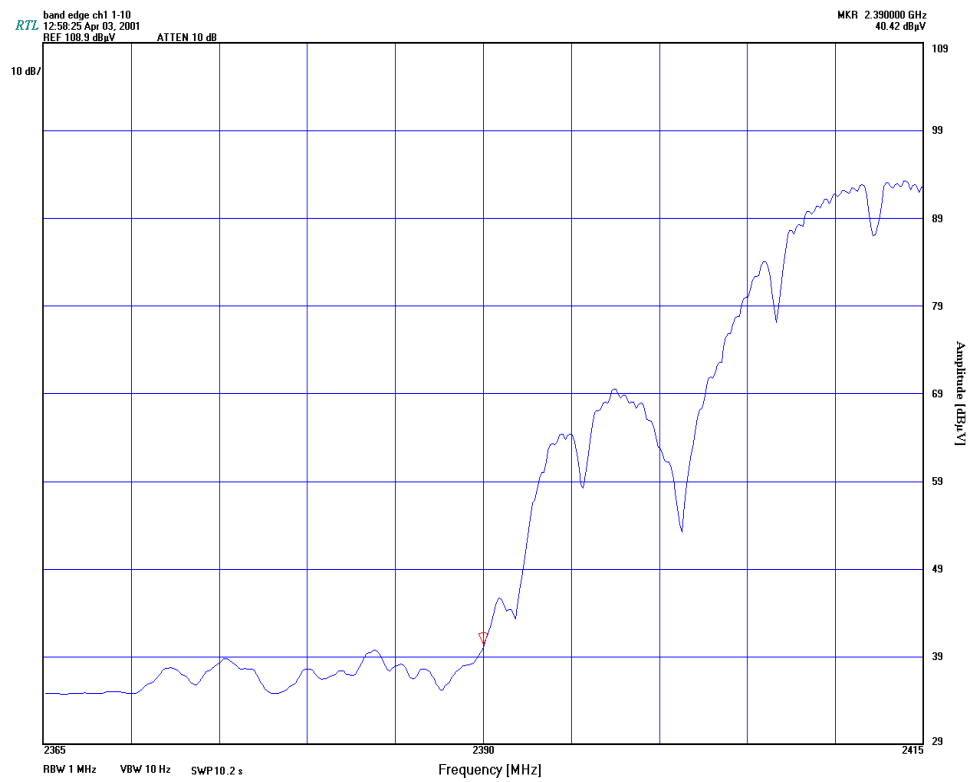



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 10 CHANNEL 1 DELL INVERTED F ANTENNA 1MHZ/1MHZ

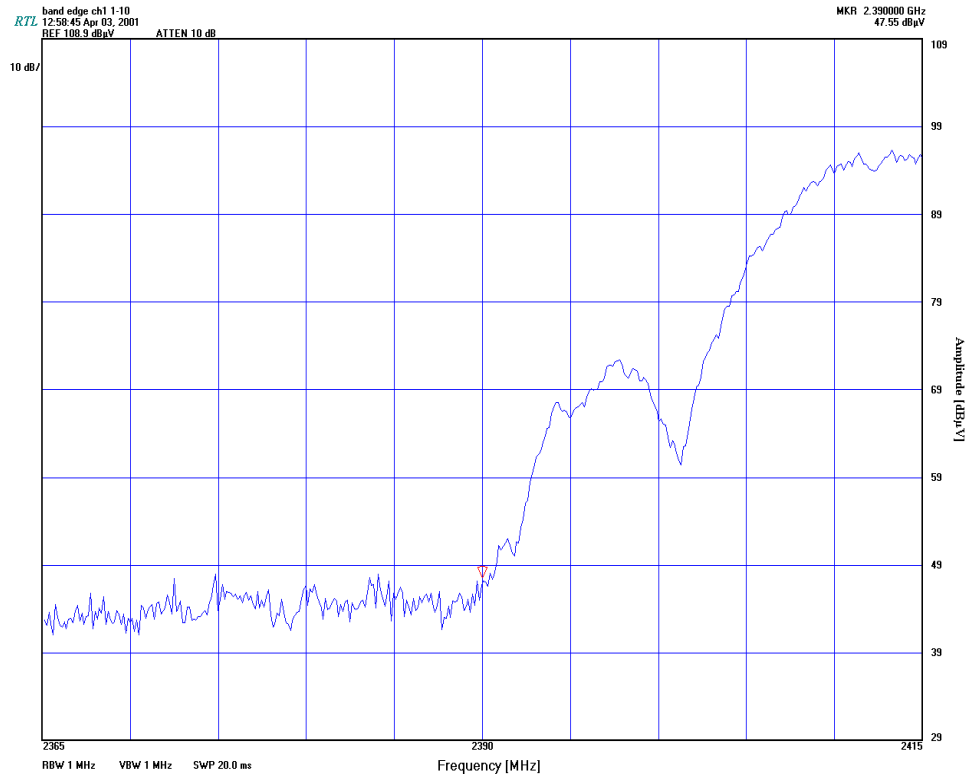



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 11 CHANNEL 11 DELL INVERTED F ANTENNA 1MHZ/10HZ

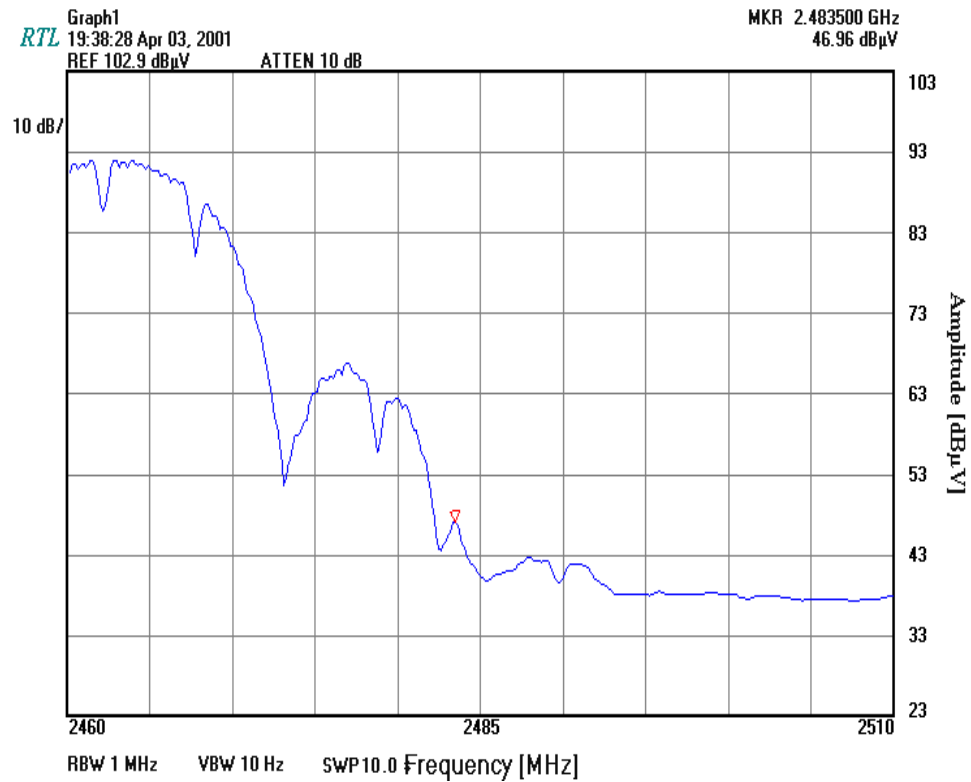



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 12 CHANNEL 11 DELL INVERTED F ANTENNA 1MHZ/1MHZ

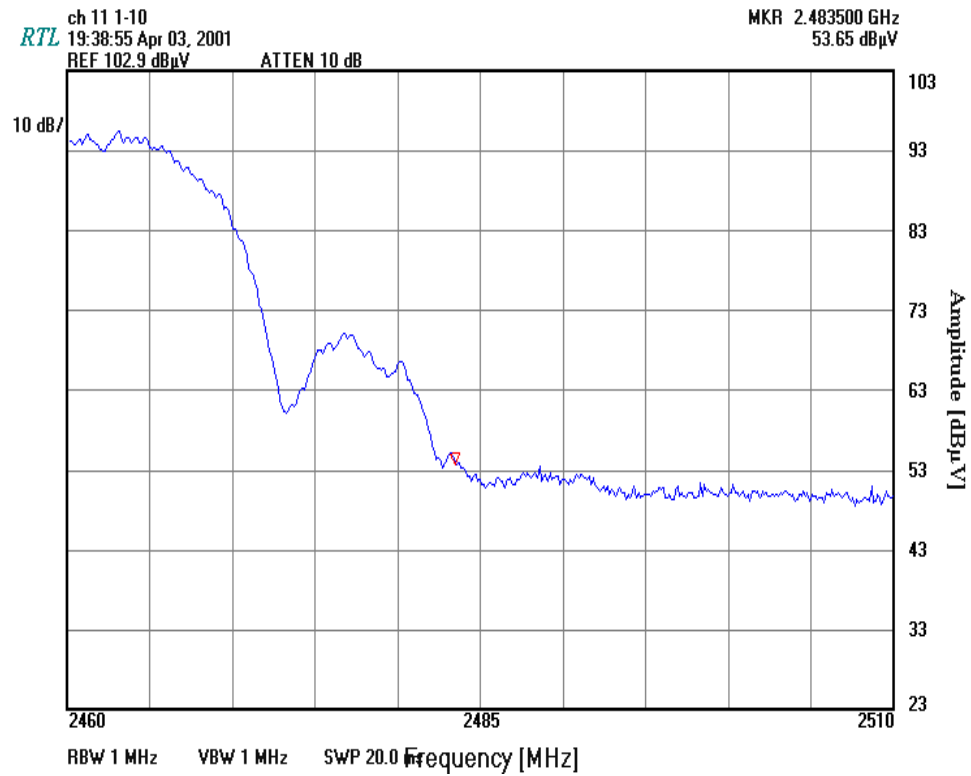



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 13 CHANNEL 1 TOSHIBA CHIP ANTENNA 1MHZ/10HZ

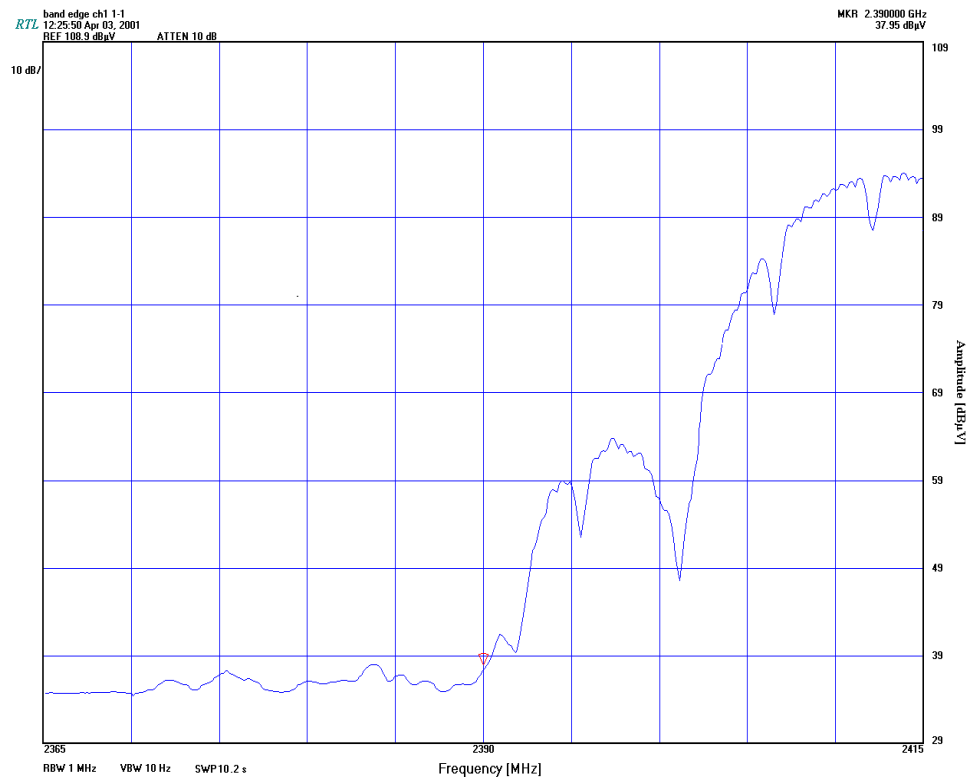



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 14 CHANNEL 1 TOSHIBA CHIP ANTENNA 1MHZ/1MHZ

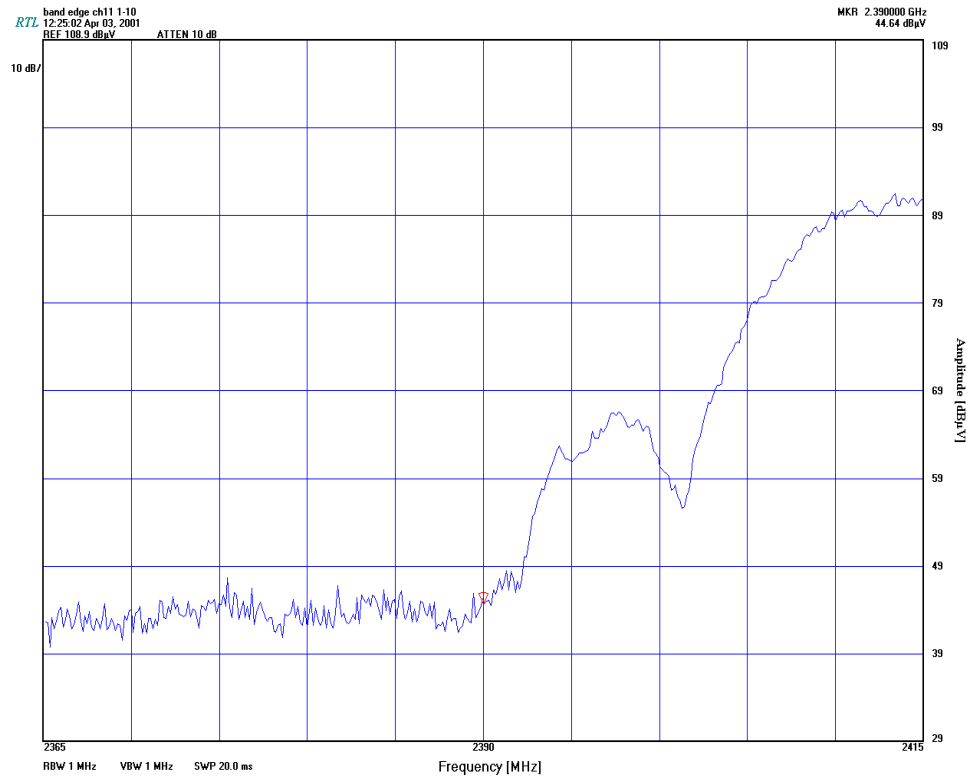



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 15 CHANNEL 11 TOSHIBA CHIP ANTENNA 1MHZ/10HZ

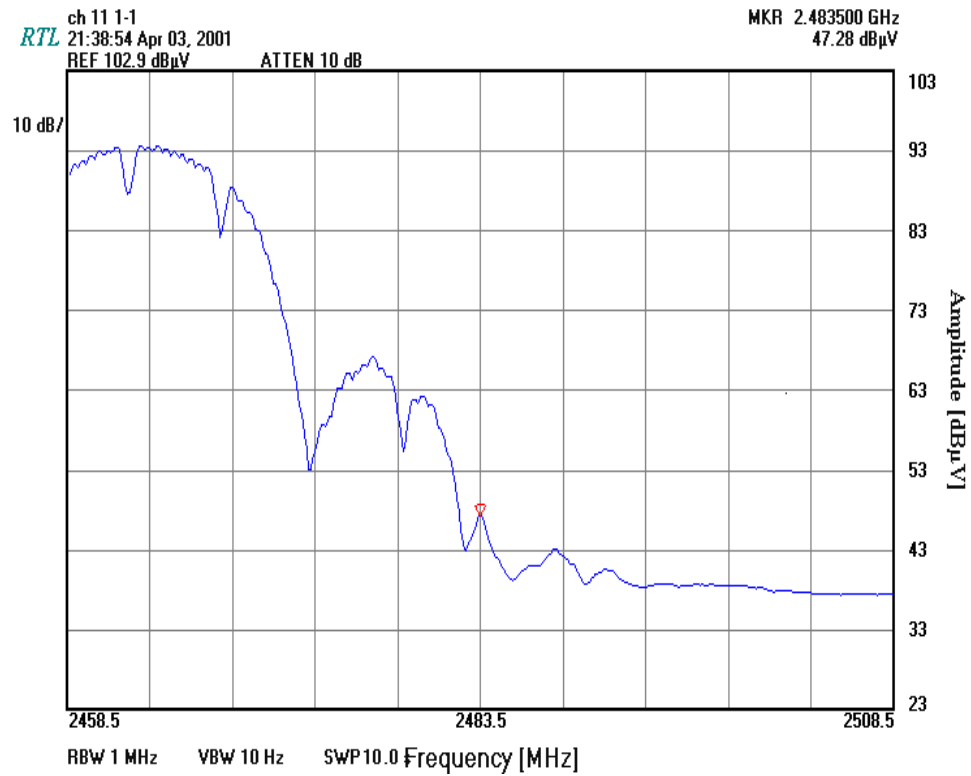



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 16 CHANNEL 11 TOSHIBA CHIP ANTENNA 1MHZ/1MHZ

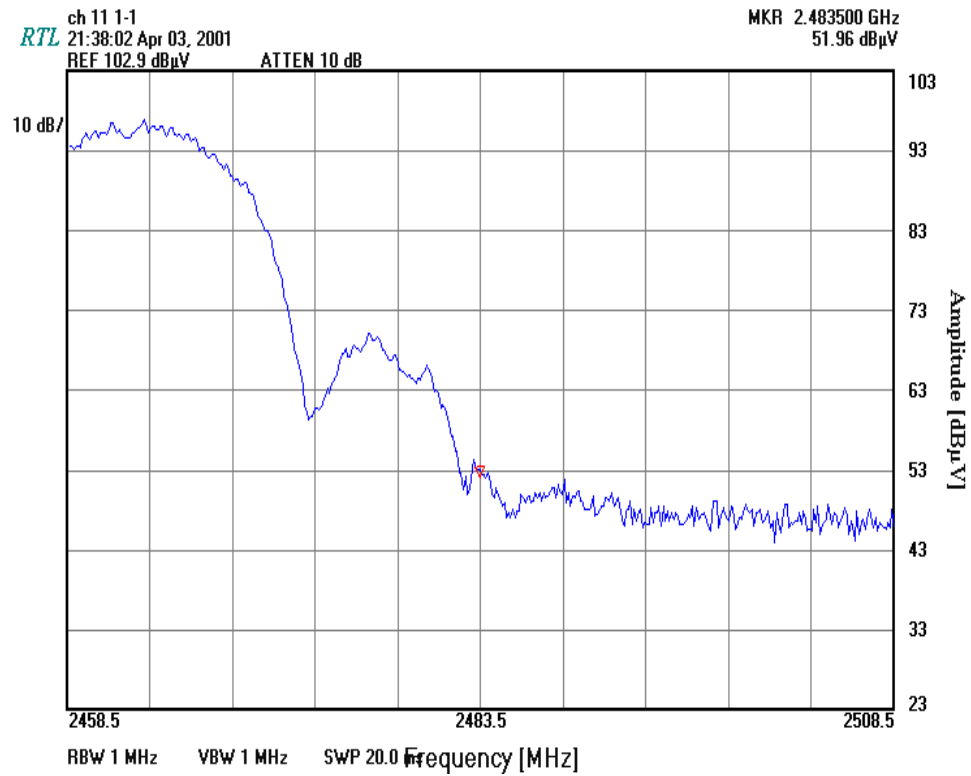



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 17 CHANNEL 1 INVERTED F TOSHIBA ANTENNA 1MHZ/10HZ

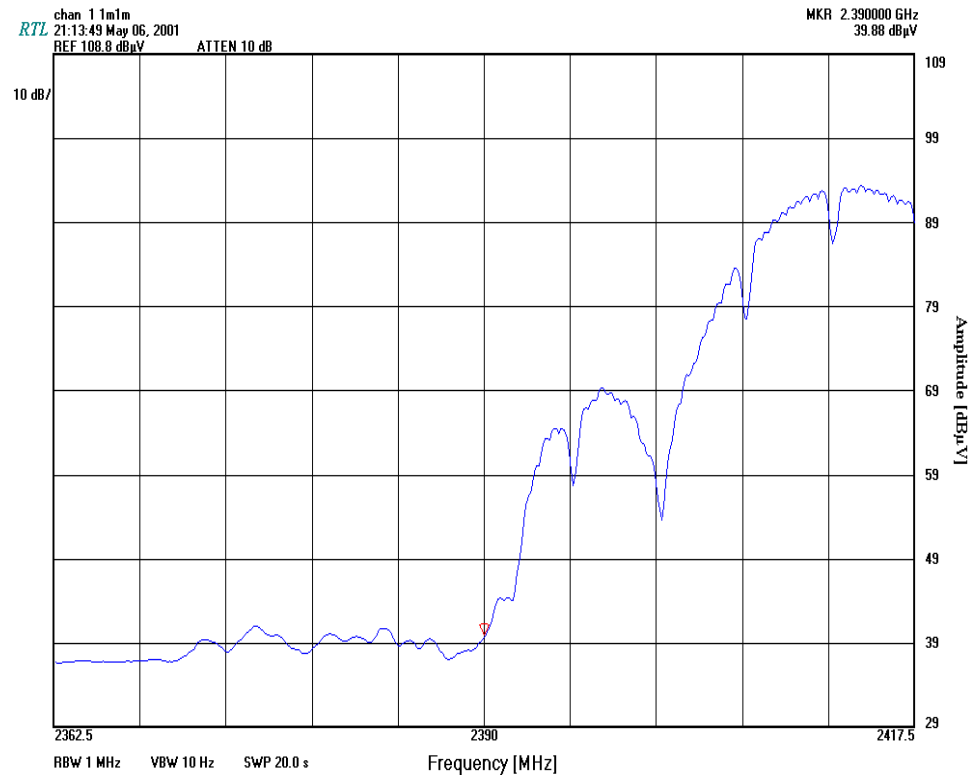



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>


PLOT 18 CHANNEL 1 INVERTED F TOSHIBA ANTENNA 1MHZ/1MHZ

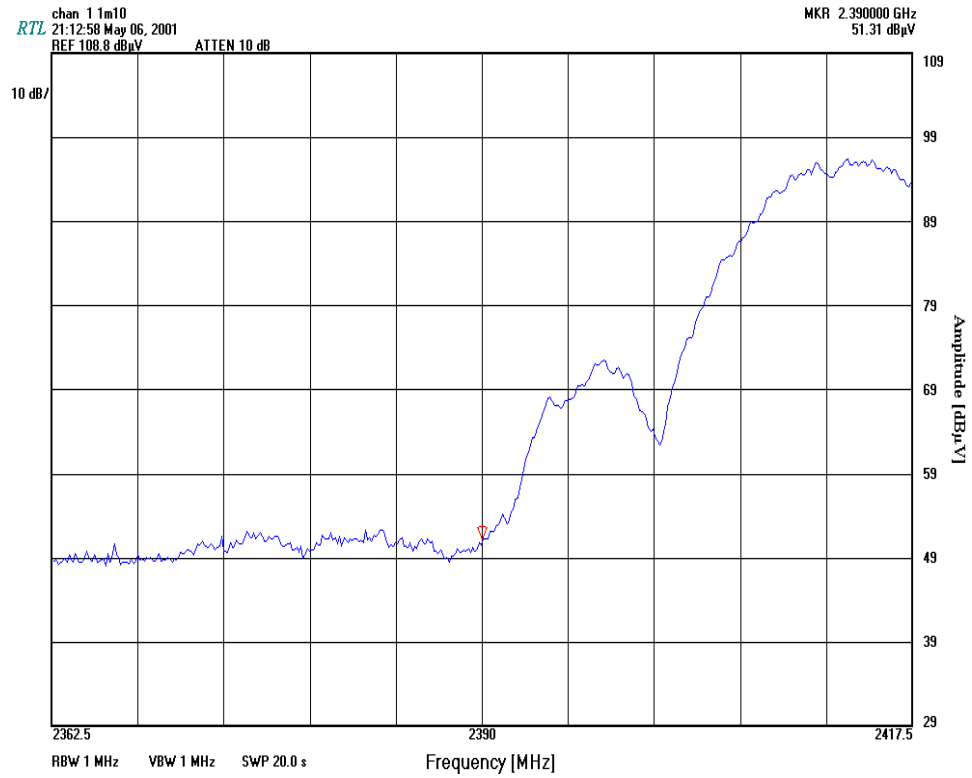



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 19 CHANNEL 11 INVERTED F TOSHIBA ANTENNA 1MHZ/10HZ

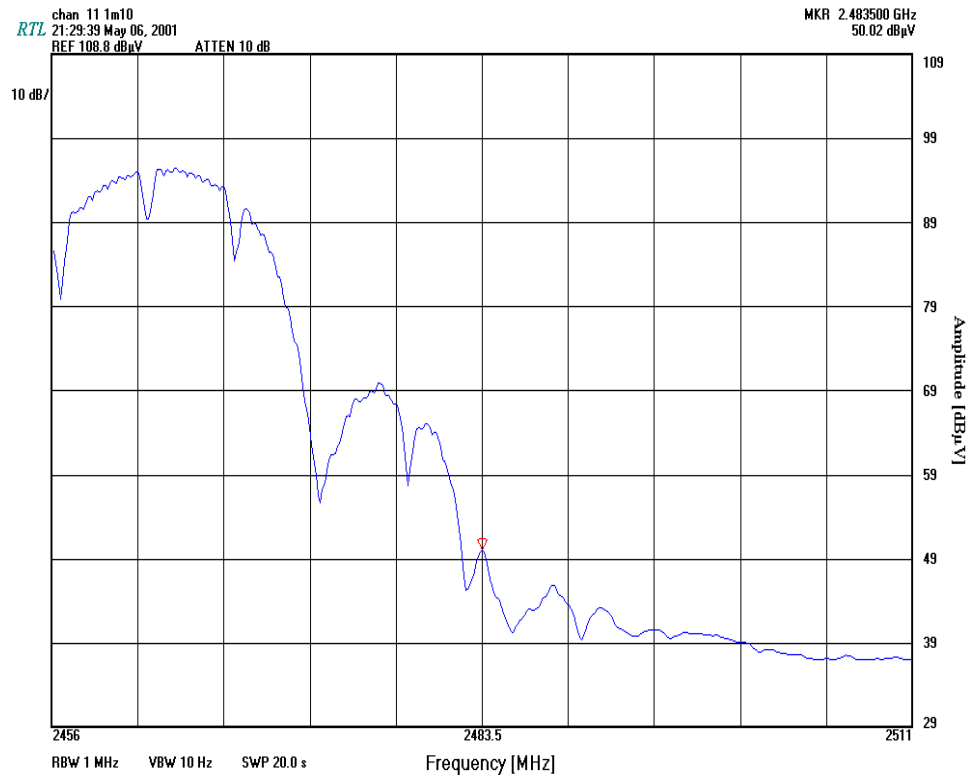



360 Herndon Parkway
Suite 1400
Herndon, VA 20170
<http://www.rheintech.com>

PLOT 20 CHANNEL 11 INVERTED F TOSHIBA ANTENNA 1MHZ/1MHZ

