
# 3.6.6 Test Result of Conducted Hopping Mode Band Edges

#### For Ant 1:


## <1Mbps>

## **Hopping Mode Low Band Edge Plot**

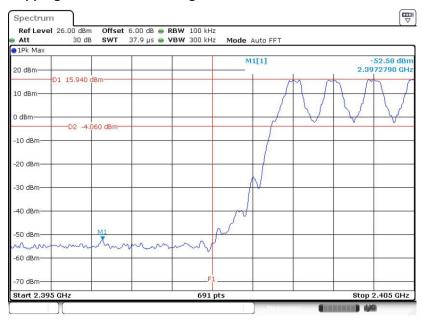

#### Date: 27.JAN.2022 03:04:19

## **Hopping Mode High Band Edge Plot**

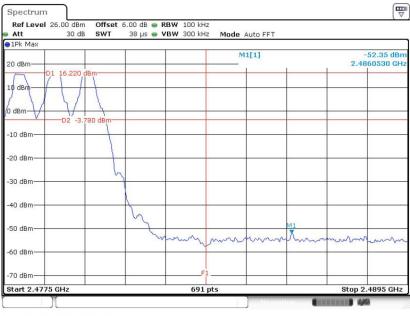


Date: 27.JAN.2022 03:04:49

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 59 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## <2Mbps>

## **Hopping Mode Low Band Edge Plot**

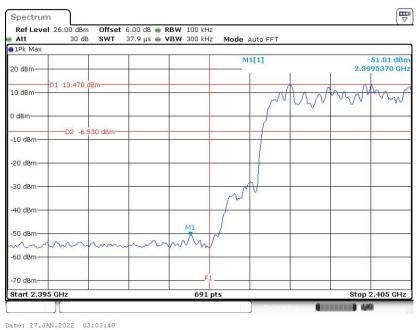

## **Hopping Mode High Band Edge Plot**

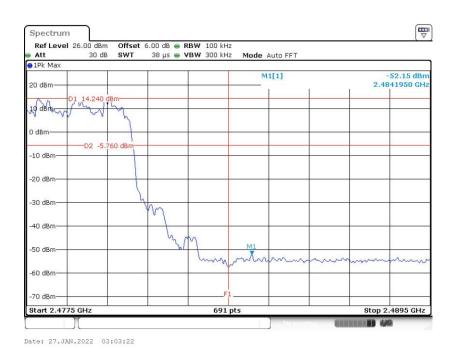


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 60 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## <3Mbps>

## **Hopping Mode Low Band Edge Plot**

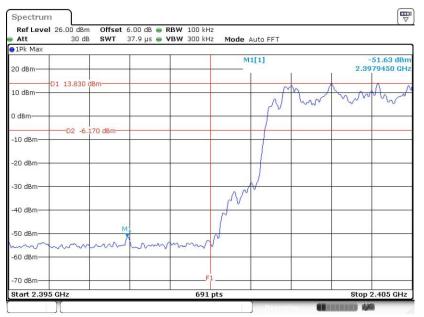

#### Date: 27.JAN.2022 03:01:33

## **Hopping Mode High Band Edge Plot**



Date: 27.JAN.2022 03:02:26


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 61 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## For Ant 2:


## <1Mbps>

## **Hopping Mode Low Band Edge Plot**

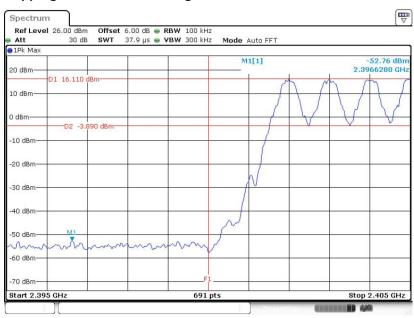

## Date: 27.JAN.2022 02:01:17

## **Hopping Mode High Band Edge Plot**

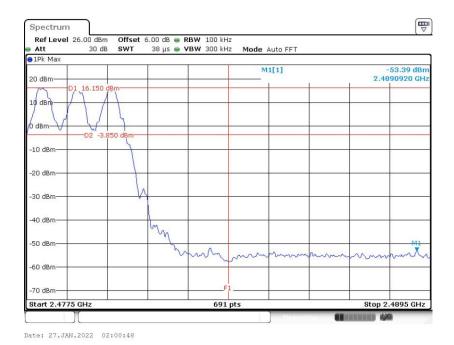


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 62 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## <2Mbps>

## **Hopping Mode Low Band Edge Plot**

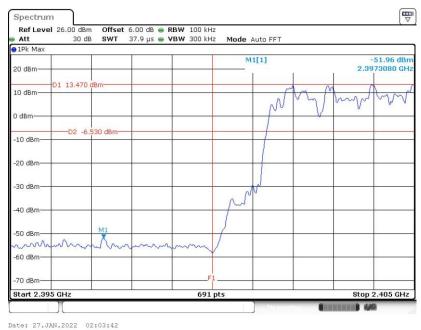

## **Hopping Mode High Band Edge Plot**

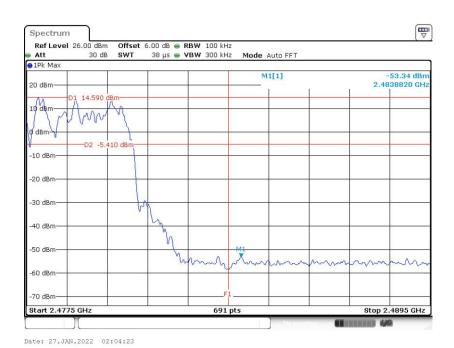


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 63 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## <3Mbps>

## **Hopping Mode Low Band Edge Plot**

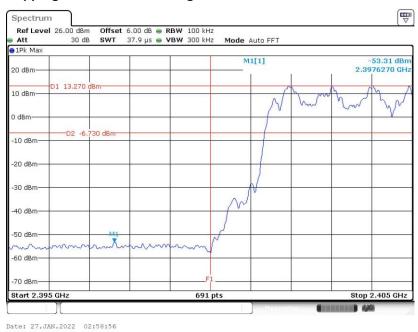

# Hopping Mode High Band Edge Plot

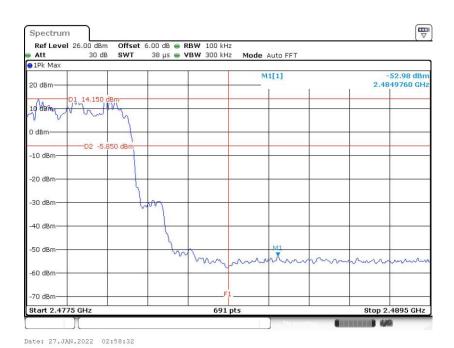

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 64 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

# 3.7 Conducted Spurious Emission Measurement

## 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


## 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

## 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

## 3.7.4 Test Setup



Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 65 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## 3.7.5 Test Result of Conducted Spurious Emission

#### For Ant 1:


## <1Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

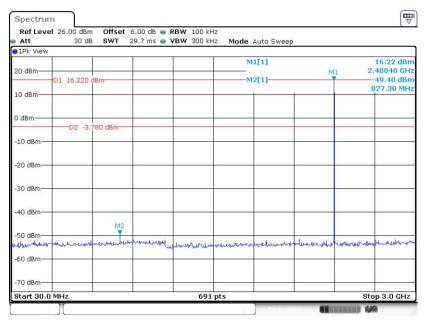

#### Date: 27.JAN.2022 03:12:22

## CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

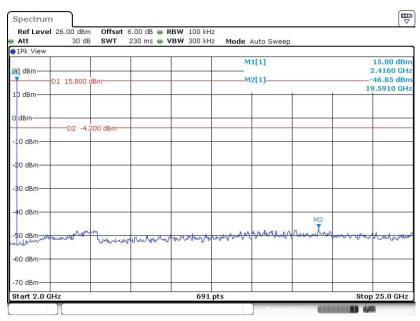


Date: 27.JAN.2022 03:12:54

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 66 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

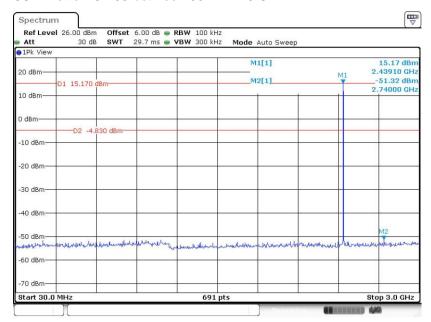

Date: 27.JAN.2022 03:19:41

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

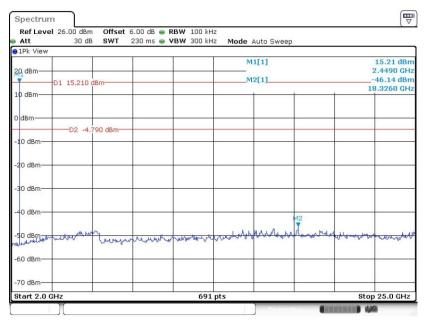


Date: 27.JAN.2022 03:20:12

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 67 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

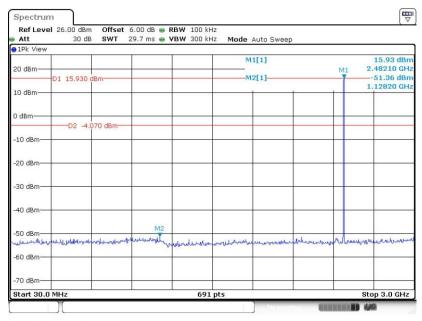

#### Date: 27.JAN.2022 03:25:03

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

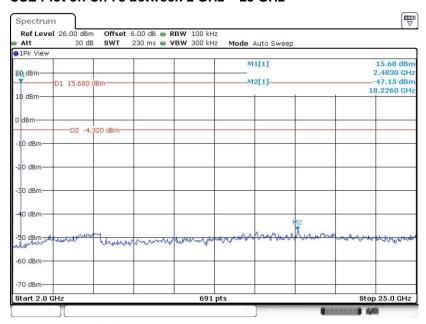


Date: 27.JAN.2022 03:25:39

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 68 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A


## <2Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

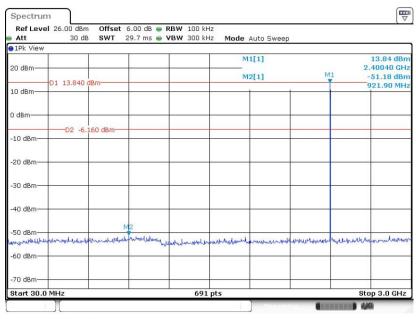

#### Date: 27.JAN.2022 03:45:46

## CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

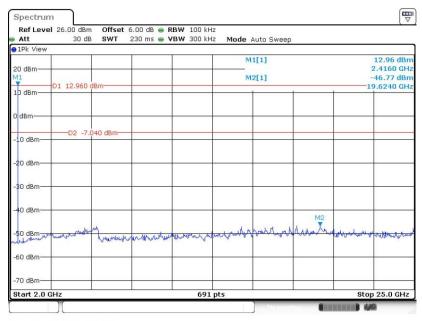


Date: 27.JAN.2022 03:46:21

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 69 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

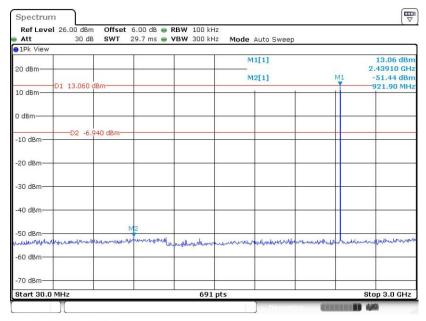

Date: 27.JAN.2022 03:38:01

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

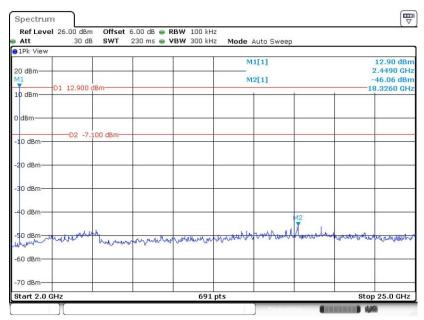


Date: 27.JAN.2022 03:39:28

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 70 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

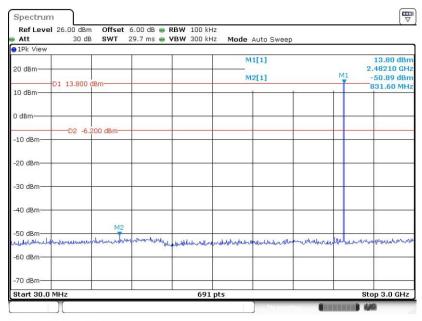

#### Date: 27.JAN.2022 03:29:39

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

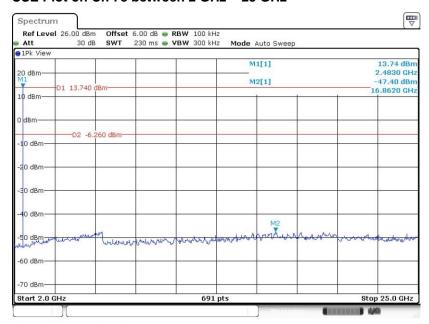


Date: 27.JAN.2022 03:30:08

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 71 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A


## <3Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

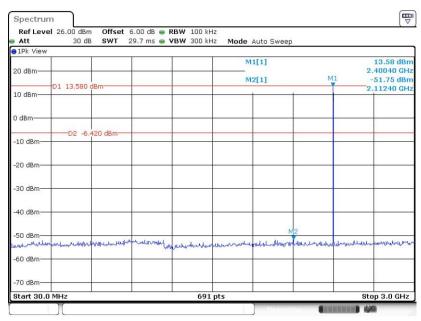

#### Date: 27.JAN.2022 03:50:06

## CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

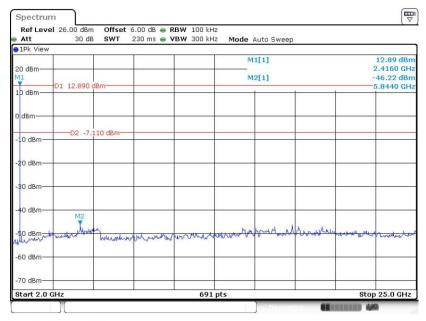


Date: 27.JAN.2022 03:50:35

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 72 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

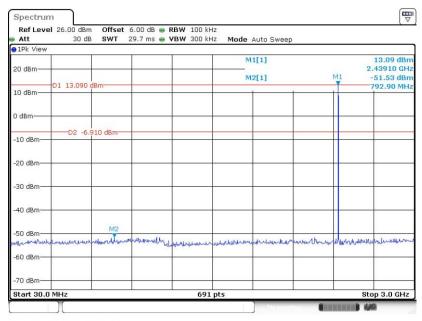

#### Date: 27.JAN.2022 03:56:43

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

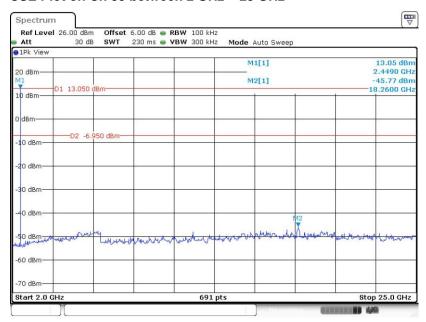


Date: 27.JAN.2022 03:57:12

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 73 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

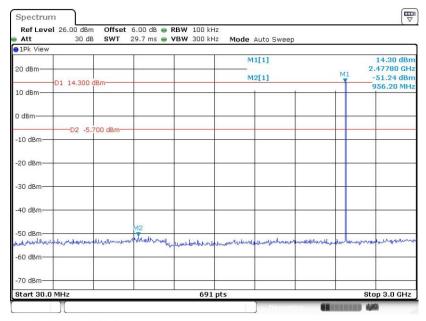

#### Date: 27.JAN.2022 04:01:46

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

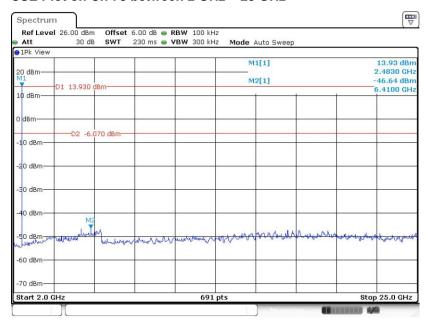

Date: 27.JAN.2022 04:02:32


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 74 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## For Ant 2:


## <1Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

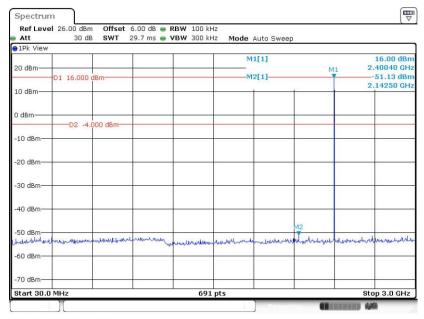

## Date: 27.JAN.2022 01:44:01

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

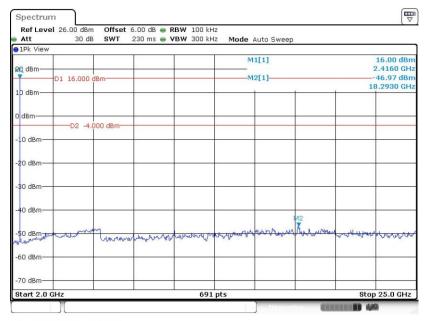


Date: 27.JAN.2022 01:44:53

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 75 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

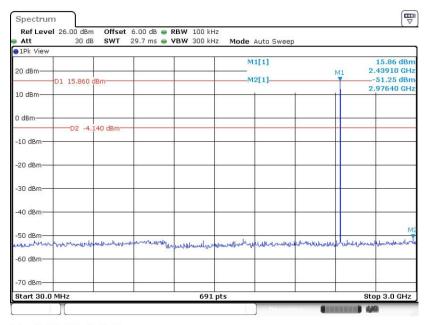

#### Date: 27.JAN.2022 01:51:20

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

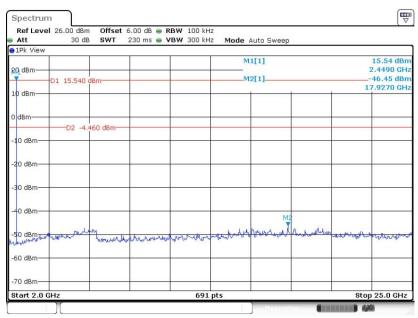


Date: 27.JAN.2022 01:51:55

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 76 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

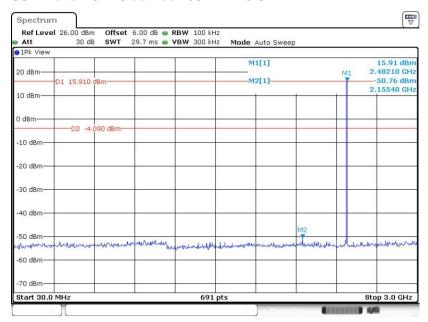

Date: 27.JAN.2022 01:56:56

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

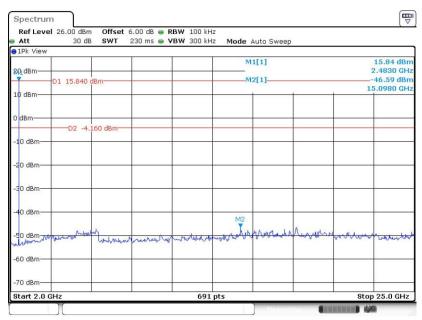


Date: 27.JAN.2022 01:57:23

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 77 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A


## <2Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

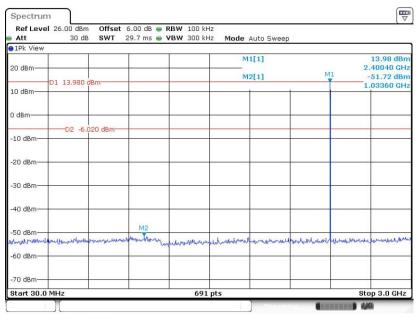

#### Date: 27.JAN.2022 02:24:04

## CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

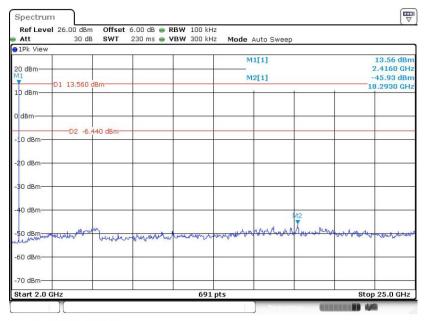


Date: 27.JAN.2022 02:26:30

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 78 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

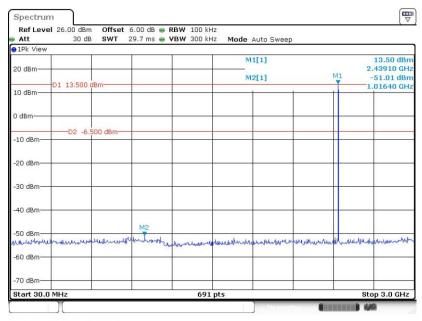

#### Date: 27.JAN.2022 02:15:10

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

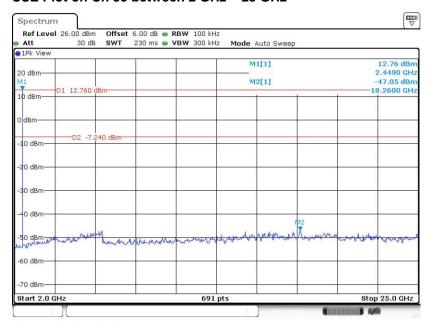


Date: 27.JAN.2022 02:15:39

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 79 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

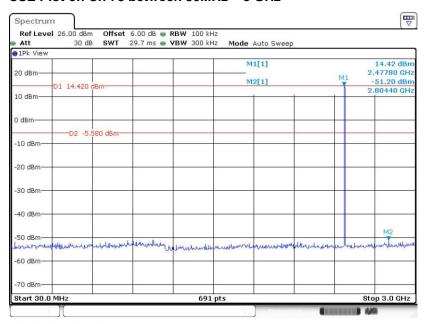

Date: 27.JAN.2022 02:09:26

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

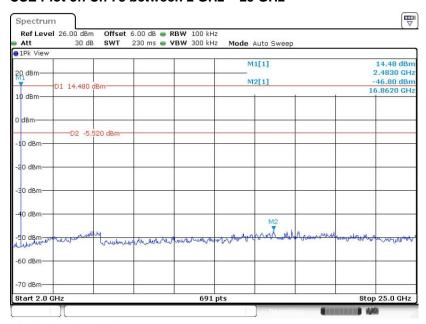

Date: 27.JAN.2022 02:09:54


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 80 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A


## <3Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

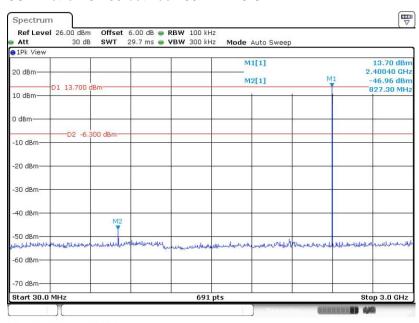

Date: 27.JAN.2022 02:43:35

## CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

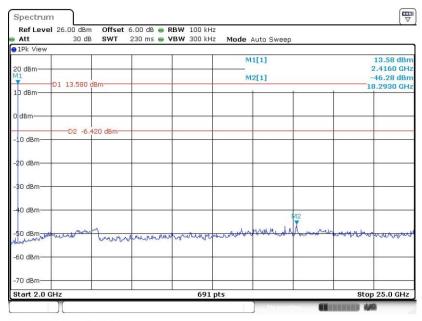


Date: 27.JAN.2022 02:44:03

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 81 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

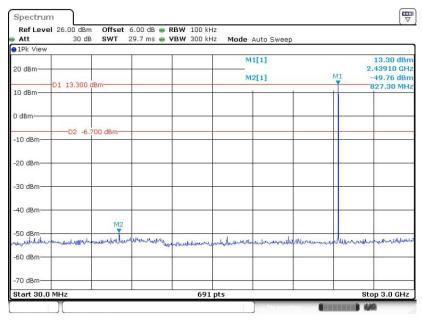

#### Date: 27.JAN.2022 02:47:49

## CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

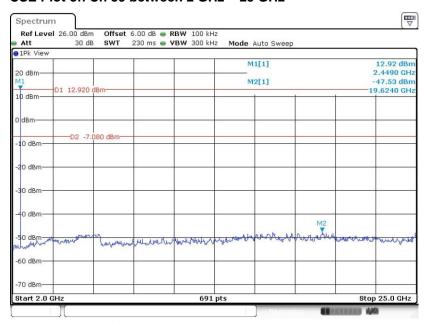


Date: 27.JAN.2022 02:49:32

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 82 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01


Report No.: FR1D2901A

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

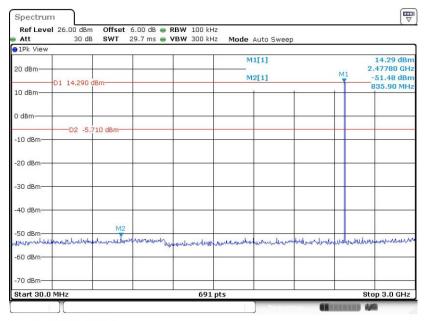

#### Date: 27.JAN.2022 02:54:41

## CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

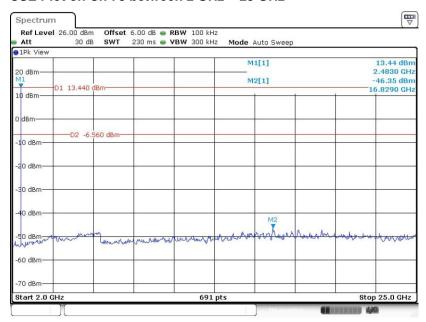

Date: 27.JAN.2022 02:55:08

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 83 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

# 3.8 Radiated Band Edges and Spurious Emission Measurement

## 3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

## 3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 84 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## 3.8.3 Test Procedures

- The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.


Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than peak limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

## 3.8.4 Test Setup


#### For radiated emissions below 30MHz

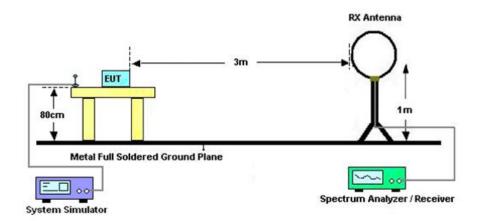

#### For radiated emissions from 30MHz to 1GHz

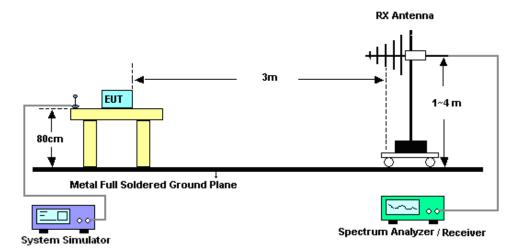

## For radiated emissions above 1GHz

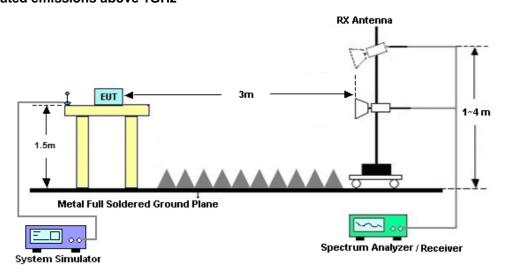

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 86 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## 3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

# 3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C.

# 3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic or 40GHz, whichever is lower)

Please refer to Appendix C.

## 3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix D.

**Sporton International Inc. (Kunshan)** TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 87 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

## 3.9 AC Conducted Emission Measurement

## 3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBµV)				
Frequency of emission (MHz)	Quasi-peak	Average			
0.15-0.5	66 to 56*	56 to 46*			
0.5-5	56	46			
5-30	60	50			

<sup>\*</sup>Decreases with the logarithm of the frequency.


## 3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

## 3.9.3 Test Procedures

- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

## 3.9.4 Test Setup

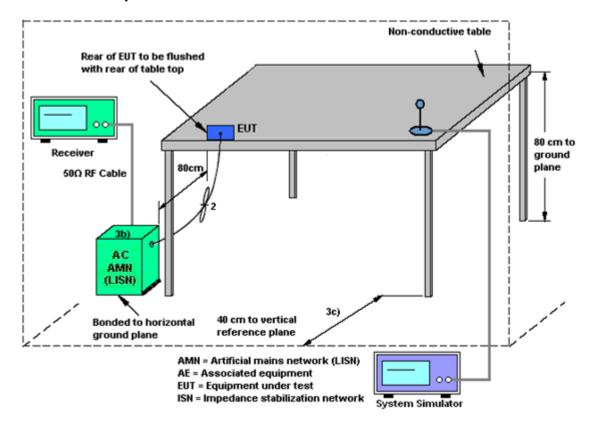

## 3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix B.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 89 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

# 3.10 Antenna Requirements

## 3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

## 3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

## 3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 90 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

# 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101040	10Hz~40GHz	Oct. 14, 2021	Jan. 13, 2022~ Jan. 27, 2022	Oct. 13, 2022	Conducted (TH01-KS)
Pulse Power Senor	Anritsu	MA2411B	0917070	300MHz~40GH z	Jan. 07, 2022	Jan. 13, 2022~ Jan. 27, 2022	Jan. 06, 2023	Conducted (TH01-KS)
Power Meter	Anritsu	ML2495A	1005002	50MHz Bandwidth	Jan. 07, 2022	Jan. 13, 2022~ Jan. 27, 2022	Jan. 06, 2023	Conducted (TH01-KS)
EMI Test Receiver	R&S	ESR7	101403	9kHz~7GHz;Ma x 30dBm	Oct. 16, 2021	Feb. 24, 2022	Oct. 15, 2022	Radiation (03CH02-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY553705 28	10Hz-44G,MAX 30dB	Oct. 16, 2021	Feb. 24, 2022	Oct. 15, 2022	Radiation (03CH02-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 30, 2021	Feb. 24, 2022	Oct. 29, 2022	Radiation (03CH02-KS)
Bilog Antenna	TeseQ	CBL6111D	44483	30MHz-1GHz	Dec. 22, 2021	Feb. 24, 2022	Dec. 21, 2022	Radiation (03CH02-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	75957	1GHz~18GHz	Oct. 30, 2021	Feb. 24, 2022	Oct. 29, 2022	Radiation (03CH02-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	1Ghz-18Ghz	Jul. 30, 2021	Feb. 24, 2022	Jul. 29, 2022	Radiation (03CH02-KS)
SHF-EHF Horn	Com-power	AH-840	101070	18GHz~40GHz	Jan. 05, 2022	Feb. 24, 2022	Jan. 04, 2023	Radiation (03CH02-KS)
Amplifier	SONOMA	310N	187289	9KHz-1GHz	Jan. 05, 2022	Feb. 24, 2022	Jan. 04, 2023	Radiation (03CH02-KS)
Amplifier	Keysight	83017A	MY532703 16	500MHz~26.5G Hz	Oct. 16, 2021	Feb. 24, 2022	Oct. 15, 2022	Radiation (03CH02-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 05, 2022	Feb. 24, 2022	Jan. 04, 2023	Radiation (03CH02-KS)
AC Power Source	Chroma	61601	616010002 473	N/A	NCR	Feb. 24, 2022	NCR	Radiation (03CH02-KS)
Turn Table	MF	MF7802	N/A	0~360 degree	NCR	Feb. 24, 2022	NCR	Radiation (03CH02-KS)
Antenna Mast	MF	MF7802	N/A	1 m~4 m	NCR	Feb. 24, 2022	NCR	Radiation (03CH02-KS)
EMI Receiver	R&S	ESCI7	100768	9kHz~7GHz;	Apr. 21, 2021	Feb. 02, 2022	Apr. 20, 2022	Conduction (CO01-KS)
AC LISN (for auxiliary equipment)	MessTec	AN3016	060103	9kHz~30MHz	Oct. 14, 2021	Feb. 02, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC LISN	R&S	ENV216	100334	9kHz~30MHz	Oct. 14, 2021	Feb. 02, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC Power Source	Chroma	61602	ABP00000 0811	AC 0V~300V, 45Hz~1000Hz	Oct. 14, 2021	Feb. 02, 2022	Oct. 13, 2022	Conduction (CO01-KS)

NCR: No Calibration Required

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : 91 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report No.: FR1D2901A

# 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

## <u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

Measuring Uncertainty for a Level of Confidence	2.94dB
of 95% (U = 2Uc(y))	2.94QB

## <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	4.9dB
of 95% (U = 2Uc(y))	4.9ub

## Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	J.00B

## Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

The state of the s	
Measuring Uncertainty for a Level of Confidence	5.1dB
of 95% (U = 2Uc(y))	3.1UB

----- THE END ------

 Sporton International Inc. (Kunshan)
 Page Number

 TEL: +86-512-57900158
 Report Issued I

 FAX: +86-512-57900958
 Report Version

FCC ID: IHDT56AE6 Re

Page Number : 92 of 92
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

# **Appendix A. Conducted Test Results**

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : A1 of A1
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Report Number : FR1D2901A

## Bluetooth for Ant.1

Test Engineer:	Gene Wang	Temperature:	20~26	ç
Test Date:	2022/1/13~2022/1/27	Relative Humidity:	40~51	%

# TEST RESULTS DATA 20dB and 99% Occupied Bandwidth and Hopping Channel Separation

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (kHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.941	0.836	1146.200	0.6271	Pass
DH	1Mbps	1	39	2441	0.938	0.842	1159.200	0.6252	Pass
DH	1Mbps	1	78	2480	0.938	0.842	998.600	0.6252	Pass
2DH	2Mbps	1	0	2402	1.289	1.166	994.200	0.8596	Pass
2DH	2Mbps	1	39	2441	1.285	1.166	976.800	0.8567	Pass
2DH	2Mbps	1	78	2480	1.289	1.166	998.600	0.8596	Pass
3DH	3Mbps	1	0	2402	1.229	1.149	981.200	0.8191	Pass
3DH	3Mbps	1	39	2441	1.229	1.146	1063.700	0.8191	Pass
3DH	3Mbps	1	78	2480	1.233	1.149	1002.900	0.8220	Pass

# TEST RESULTS DATA Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.887	0.31	0.4	Pass
AFH	20	53.33	2.887	0.15	0.4	Pass

## TEST RESULTS DATA

## Peak Power Table

DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	11.02	20.97	Pass
DH1	39	1	10.89	20.97	Pass
	78	1	10.69	20.97	Pass

2DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	9.95	20.97	Pass
2DH1	39	1	9.58	20.97	Pass
	78	1	9.55	20.97	Pass

3DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	9.89	20.97	Pass
3DH1	39	1	9.71	20.97	Pass
	78	1	9.57	20.97	Pass

## TEST RESULTS DATA

# Number of Hoppina Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	79	> 15	Pass

Report Number : FR1D2901A

## Bluetooth for Ant.2

Test Engineer:	Gene Wang	Temperature:	20~26	°C
Test Date:	2022/1/13~2022/1/27	Relative Humidity:	40~51	%

# TEST RESULTS DATA 20dB and 99% Occupied Bandwidth and Hopping Channel Separation

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (kHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.938	0.836	994.200	0.6252	Pass
DH	1Mbps	1	39	2441	0.938	0.834	998.600	0.6252	Pass
DH	1Mbps	1	78	2480	0.935	0.836	998.600	0.6233	Pass
2DH	2Mbps	1	0	2402	1.285	1.166	1002.900	0.8567	Pass
2DH	2Mbps	1	39	2441	1.281	1.166	1002.900	0.8539	Pass
2DH	2Mbps	1	78	2480	1.285	1.166	1154.800	0.8567	Pass
3DH	3Mbps	1	0	2402	1.229	1.149	1128.800	0.8191	Pass
3DH	3Mbps	1	39	2441	1.229	1.152	1007.200	0.8191	Pass
3DH	3Mbps	1	78	2480	1.233	1.152	1033.300	0.8220	Pass

# TEST RESULTS DATA <u>Dwell Time</u>

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.887	0.31	0.4	Pass
AFH	20	53.33	2.887	0.15	0.4	Pass

# TEST RESULTS DATA Peak Power Table

DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	12.82	20.97	Pass
DH1	39	1	11.91	20.97	Pass
	78	1	12.33	20.97	Pass


2DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	11.65	20.97	Pass
2DH1	39	1	10.85	20.97	Pass
	78	1	11.10	20.97	Pass

3DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	12.06	20.97	Pass
3DH1	39	1	11.33	20.97	Pass
	78	1	11.88	20.97	Pass

## <u>TEST RESULTS DATA</u> <u>Number of Hopping Frequency</u>


Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	79	> 15	Pass

# **Appendix B. AC Conducted Emission Test Results**

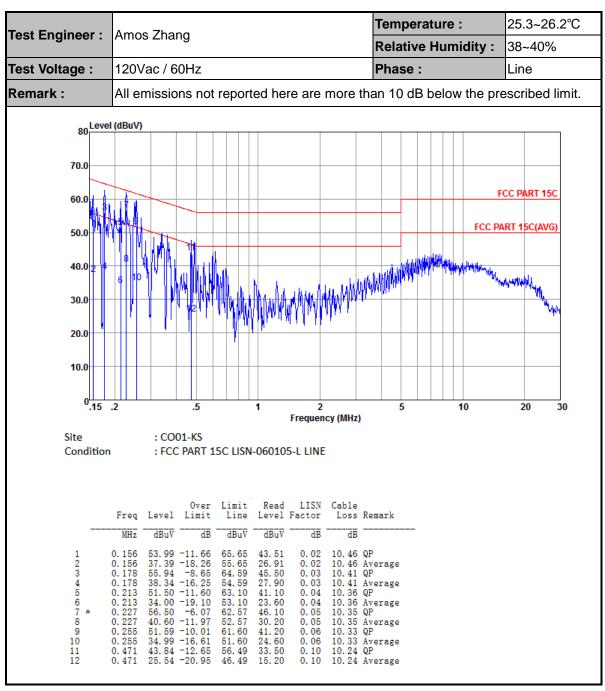

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : B1 of B2
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

Toot Engineer	Amon 7hang	Temperature :	25.3~26.2°C					
Test Engineer : Test Voltage :	Amos znang	Relative Humidity: 38~40%						
Test Voltage :	120Vac / 60Hz	Phase :	Neutral					
Remark :	: All emissions not reported here are more than 10 dB below the prescribed limit.							
80 Level	(dBuV)							

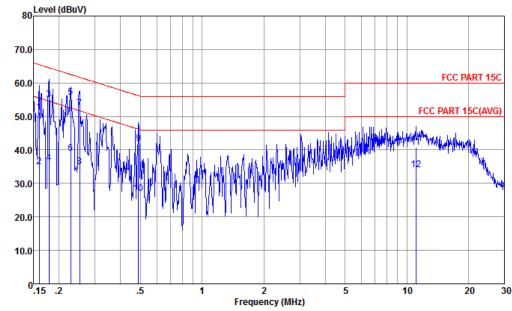

Site : CO01-KS

Condition : FCC PART 15C LISN-060105-N NEUTRAL

Freq	Ov Level Lim	er Limit it Line	Read Level	LISN Factor	Cable Loss	Remark
MHz	dBuV	dB dBuV	dBuV	dB	dB	
1 0.160 2 0.160 3 0.179 4 0.179 5 * 0.228 6 0.228 7 0.252 8 0.252 9 0.489 10 0.489 11 11.080	51. 16 -14. 35. 06 -20. 55. 11 -9. 36. 11 -18. 55. 65 -6. 39. 05 -13. 52. 33 -9. 35. 03 -16. 41. 85 -14. 26. 95 -19. 40. 80 -19. 34. 20 -15.	41 55.47 44 64.55 44 54.55 87 62.52 47 52.52 36 61.69 34 56.19 24 46.19 20 60.00	24. 50 44. 60 25. 60 45. 20 28. 60	0. 10 0. 10 0. 10	10. 41 10. 35 10. 35 10. 33 10. 33 10. 24 10. 24 10. 35	Average QP Average QP Average QP Average QP Average

## Note:

- 1. Level( $dB\mu V$ ) = Read Level( $dB\mu V$ ) + LISN Factor(dB) + Cable Loss(dB)
- 2. Over Limit(dB) = Level(dB $\mu$ V) Limit Line(dB $\mu$ V)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : B2 of B2
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

# Appendix C. Radiated Spurious Emission

## 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
Ant.1				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	( dBµV )	( dB/m )	(dB)	(dB)	( cm )	( deg )	(P/A)	(H/V)
		2483.5	58.15	-15.85	74	54.74	32.98	7.25	36.82	109	78	Р	Н
	*	2483.5	33.36	-20.64	54	-	-	-	-	ı	-	Α	Н
5.7		2480	109.64	-	-	106.23	32.98	7.25	36.82	109	78	Р	Н
BT CH 78		2480	84.85	-	-	-	-	-	-	1	-	Α	Н
2480MHz		2483.5	53.86	-20.14	74	50.45	32.98	7.25	36.82	304	18	Р	V
2400WII 12	*	2483.5	29.07	-24.93	54	-	-	-	-	ı	-	Α	V
		2480	105.65	-	-	102.24	32.98	7.25	36.82	304	18	Р	V
		2480	80.86	-	-	-	-	-	-	ı	-	Α	V
	1. N	lo other spu	rious found	d.									
Remark	2. A	II results are	PASS ag	ainst P	eak and Av	/erage li	mit line.						

## 2.4GHz 2400~2483.5MHz

## BT (Harmonic @ 3m)

21 (Harmonio @ 0111)													
ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
Ant.1				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	(dB)	(dB)	( cm )	( deg )	(P/A)	(H/V)
		4965	41.12	-32.88	74	61.9	34.28	10.41	65.47	300	0	Р	Н
BT CH 78 2480MHz		7440	44.52	-29.48	74	62.15	35.89	12.79	66.31	300	0	Р	Н
		4965	41.07	-32.93	74	61.85	34.28	10.41	65.47	100	0	Р	٧
		7440	42.82	-31.18	74	60.45	35.89	12.79	66.31	100	0	Р	V
Bomork	1. N	lo other spu	rious found	d									
Remark	2. All results are PASS against Peak and Average limit line.												

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : C1 of C3
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

## **Emission below 1GHz**

# 2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
Ant.1				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	( dB )	( dBµV/m )	(dBµV)	( dB/m )	(dB)	(dB)	( cm )	( deg )	(P/A)	(H/V)
		30	20.23	-19.77	40	27.33	24.8	0.5	32.4	-	-	Р	Н
		89.17	26.91	-16.59	43.5	43.6	14.4	1.31	32.4	-	-	Р	Н
		161.92	18.61	-24.89	43.5	33.07	16.1	1.84	32.4	-	-	Р	Н
		265.71	18.46	-27.54	46	28.68	19.8	2.38	32.4	-	-	Р	Н
0.4011-		354.95	18.07	-27.93	46	27.42	20.3	2.75	32.4	-	-	Р	Н
2.4GHz BT		685.72	27.04	-18.96	46	29.21	26.4	3.83	32.4	-	-	Р	Н
LF		48.43	34.33	-5.67	40	50.98	15	0.75	32.4	-	-	Р	V
"		89.17	32.15	-11.35	43.5	48.84	14.4	1.31	32.4	-	-	Р	V
		148.34	19.95	-23.55	43.5	33.49	17.1	1.76	32.4	-	-	Р	V
		196.84	19.32	-24.18	43.5	34.97	14.7	2.05	32.4	-	-	Р	V
		264.74	21.26	-24.74	46	31.29	20	2.37	32.4	-	-	Р	V
		731.31	27.23	-18.77	46	28.28	27.34	3.95	32.34	-	-	Р	V
Remark	1.	No other sp	urious foun	d.									
i i Cilial K	2.	All results a	re PASS aç	gainst lim	it line.								

# Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions							
	shall not exceed the level of the fundamental frequency.							
!	Test result is <b>over limit</b> line.							
P/A	Peak or Average							
H/V	Horizontal or Vertical							

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : C2 of C3
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

## A calculation example for radiated spurious emission is shown as below:

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	( dBµV )	( dB/m )	(dB)	(dB)	( cm )	( deg )	(P/A)	(H/V)
ВТ		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 00													
2402MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

- 1. Path Loss(dB) = Cable loss(dB) + Filter loss(dB) + Attenuator loss(dB)
- 2. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

3. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

## For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBμV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level( $dB\mu V/m$ ) Limit Line( $dB\mu V/m$ )
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : C3 of C3
Report Issued Date : Mar. 01, 2022


Report No.: FR1D2901A

Report Version : Rev. 01


# Appendix D. Duty Cycle Plots

## For Ant.1

## DH5 on time (One Pulse) Plot on Channel 00

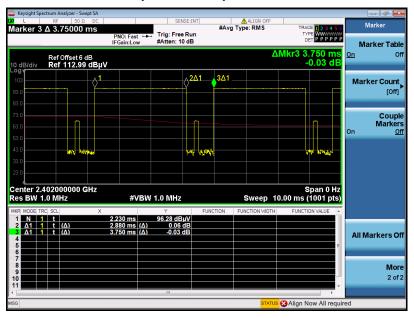

## DH5 on time (Count Pulses) Plot on Channel 00

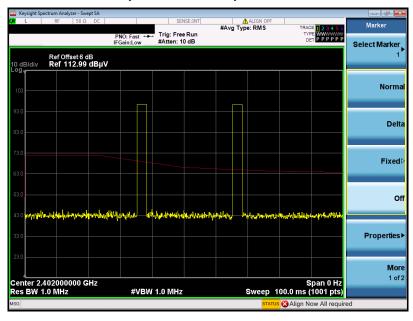

#### Note:


- 1. Worst case Duty cycle = on time/100 milliseconds = 2 \* 2.88 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : D1 of D2
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01

#### For Ant.2:

# DH5 on time (One Pulse) Plot on Channel 00

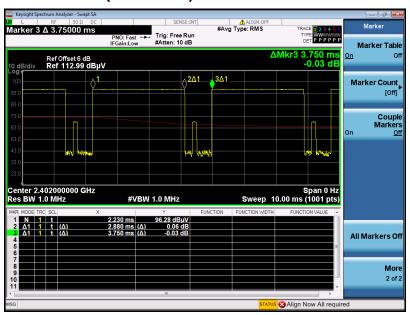

# DH5 on time (Count Pulses) Plot on Channel 00

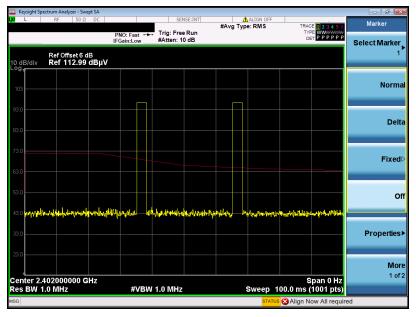

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 \* 2.88 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE6 Page Number : D2 of D2
Report Issued Date : Mar. 01, 2022
Report Version : Rev. 01