



Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 63 of 311

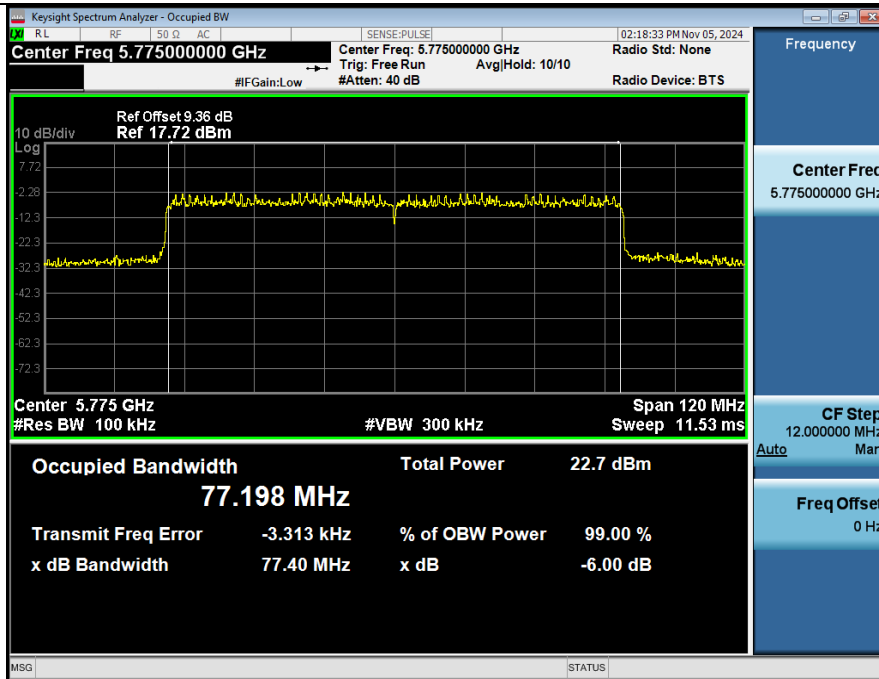

-6dB Emission Bandwidth_NVNT_ANT2_802_11ax(HE80)_5775_80M

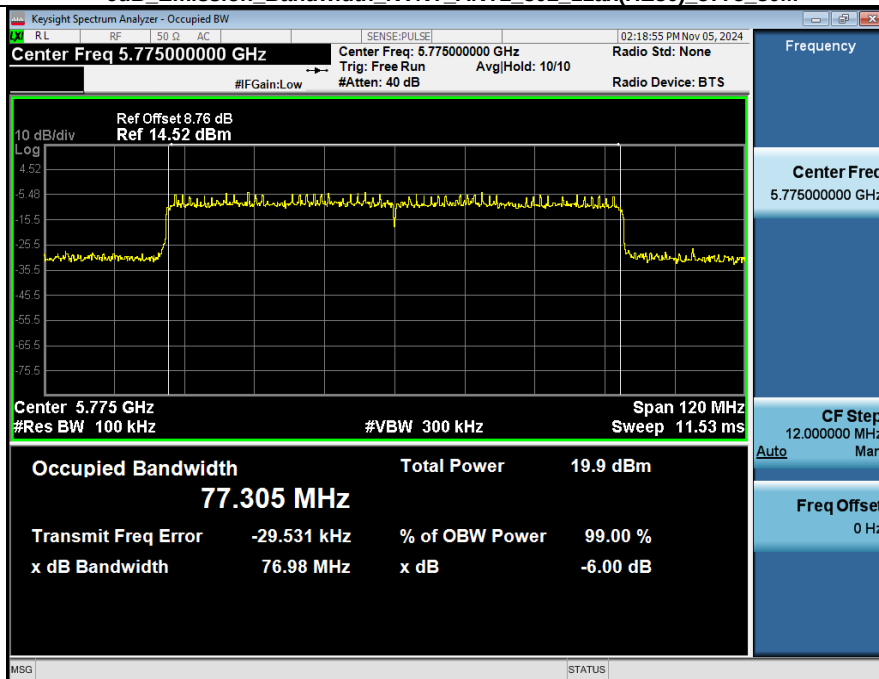

Appendix B

CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 64 of 311

1.3 Test Datas 99% Bandwidth (U-NII-3:)


Condition	Antenna	Modulation	Frequency(MHz)	Occupied Bandwidth(MHz)
NVNT	ANT1	802.11a	5745.00	19.19
NVNT	ANT2	802.11a	5745.00	19.12
NVNT	ANT1	802.11a	5785.00	19.09
NVNT	ANT2	802.11a	5785.00	19.24
NVNT	ANT1	802.11a	5825.00	19.08
NVNT	ANT2	802.11a	5825.00	19.21
NVNT	ANT1	802.11n(HT20)	5745.00	17.15
NVNT	ANT2	802.11n(HT20)	5745.00	17.14
NVNT	ANT1	802.11n(HT20)	5785.00	16.98
NVNT	ANT2	802.11n(HT20)	5785.00	17.06
NVNT	ANT1	802.11n(HT20)	5825.00	17.03
NVNT	ANT2	802.11n(HT20)	5825.00	17.04
NVNT	ANT1	802.11ac(VHT20)	5745.00	18.12
NVNT	ANT2	802.11ac(VHT20)	5745.00	18.17
NVNT	ANT1	802.11ac(VHT20)	5785.00	17.88
NVNT	ANT2	802.11ac(VHT20)	5785.00	17.92
NVNT	ANT1	802.11ac(VHT20)	5825.00	18.11
NVNT	ANT2	802.11ac(VHT20)	5825.00	17.85
NVNT	ANT1	802.11ax(HE20)	5745.00	19.08
NVNT	ANT2	802.11ax(HE20)	5745.00	19.19
NVNT	ANT1	802.11ax(HE20)	5785.00	19.02
NVNT	ANT2	802.11ax(HE20)	5785.00	19.04
NVNT	ANT1	802.11ax(HE20)	5825.00	19.13
NVNT	ANT2	802.11ax(HE20)	5825.00	19.06
NVNT	ANT1	802.11n(HT40)	5755.00	37.29
NVNT	ANT2	802.11n(HT40)	5755.00	36.98
NVNT	ANT1	802.11n(HT40)	5795.00	37.16
NVNT	ANT2	802.11n(HT40)	5795.00	36.72
NVNT	ANT1	802.11ac(VHT40)	5755.00	37.12
NVNT	ANT2	802.11ac(VHT40)	5755.00	36.83
NVNT	ANT1	802.11ac(VHT40)	5795.00	37.01
NVNT	ANT2	802.11ac(VHT40)	5795.00	37.00
NVNT	ANT1	802.11ax(HE40)	5755.00	37.99
NVNT	ANT2	802.11ax(HE40)	5755.00	38.00
NVNT	ANT1	802.11ax(HE40)	5795.00	37.95
NVNT	ANT2	802.11ax(HE40)	5795.00	37.95
NVNT	ANT1	802.11ac(VHT80)	5775.00	76.79
NVNT	ANT2	802.11ac(VHT80)	5775.00	76.79
NVNT	ANT1	802.11ax(HE80)	5775.00	78.13
NVNT	ANT2	802.11ax(HE80)	5775.00	78.06

Appendix B
CN24K76Q 003


Prüfbericht - Produkte
Test Report - Products

Page 65 of 311

99%_OCB_NVNT_ANT1_802_11a_5745

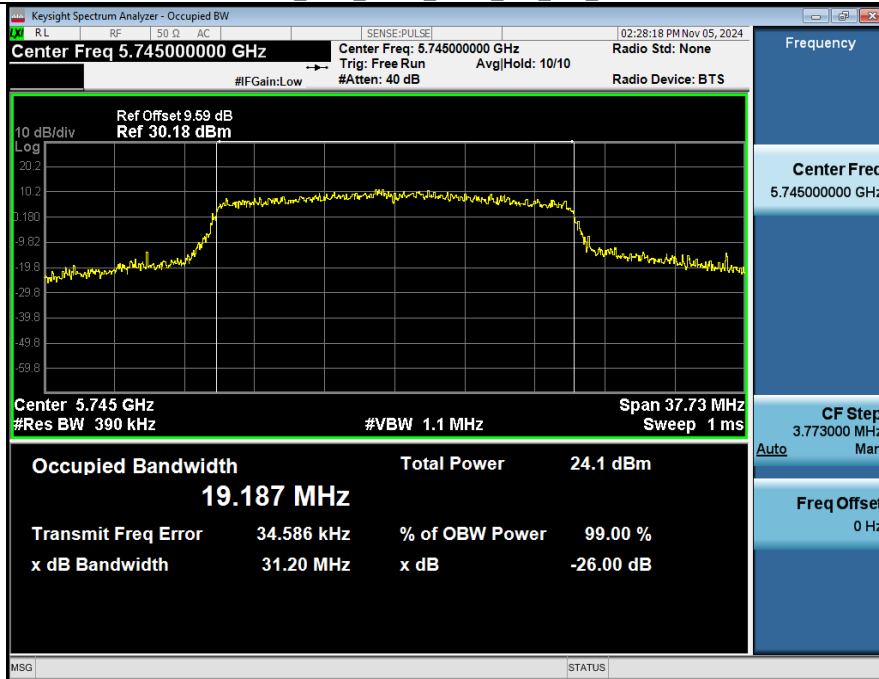

-26BW_NVNT_ANT1_802_11a_5745

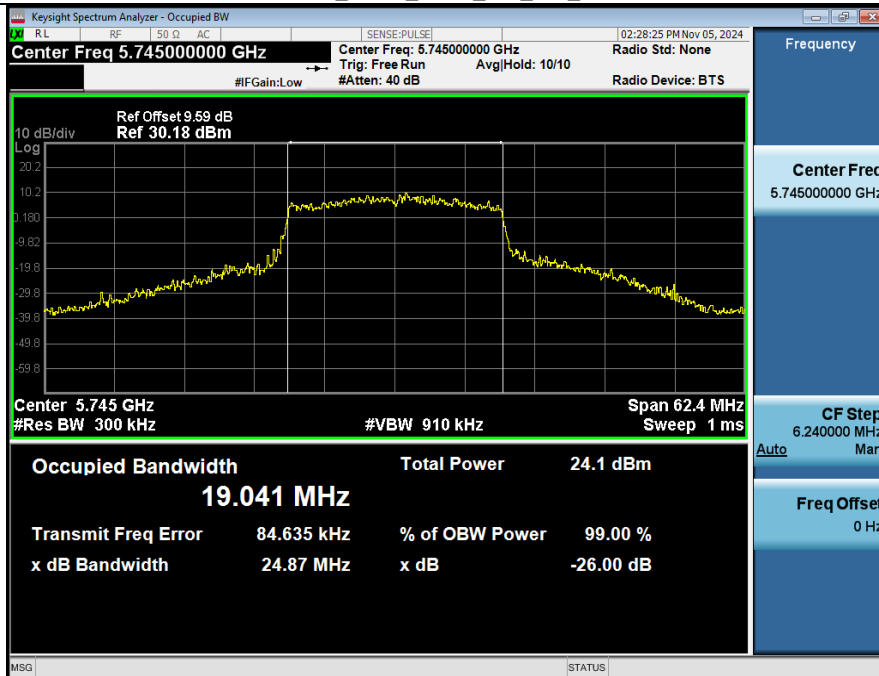


99%_OCB_NVNT_ANT2_802_11a_5745


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 66 of 311

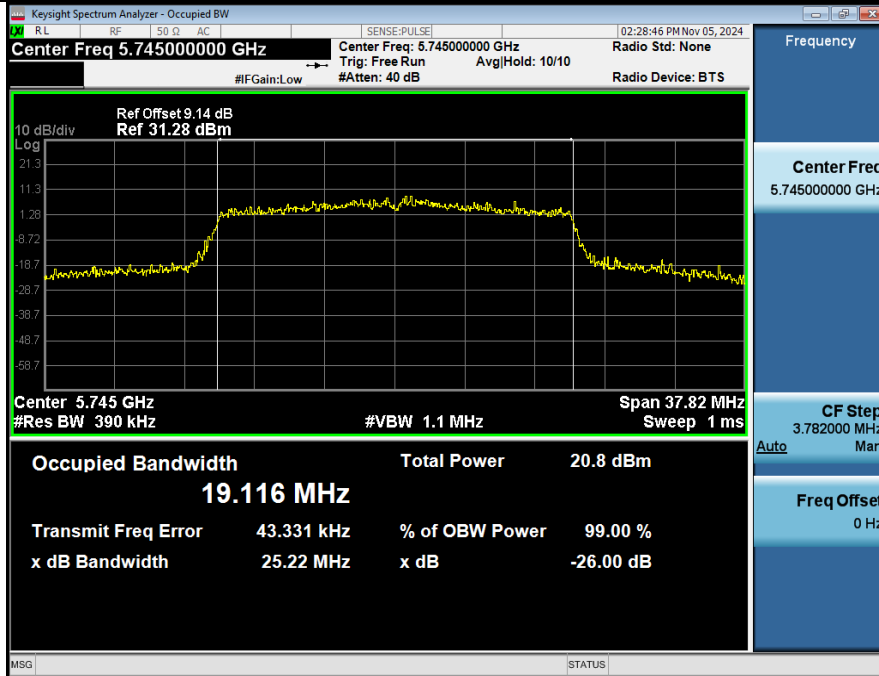

-26BW_NVNT_ANT2_802_11a_5745

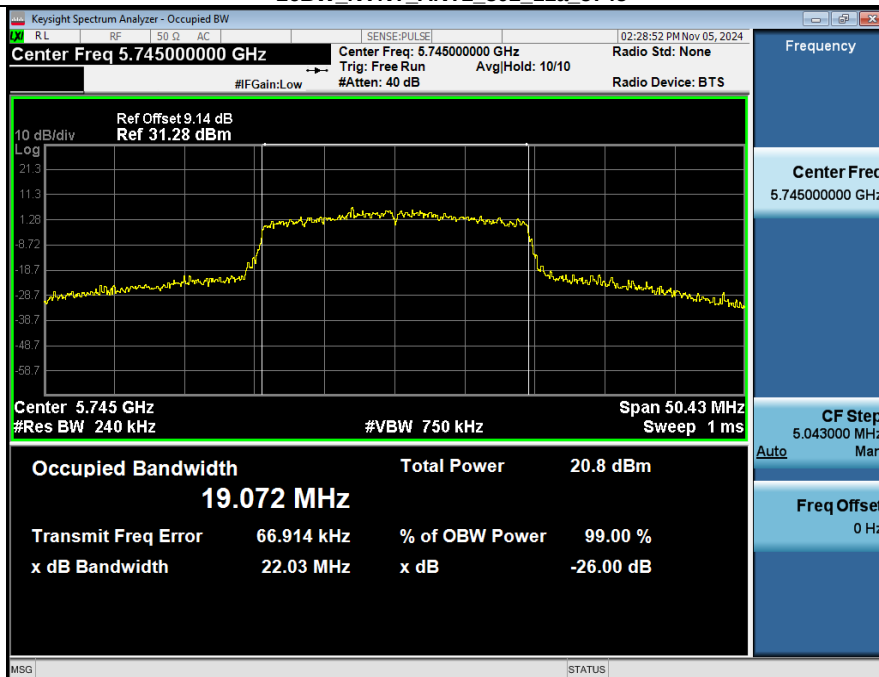


99%_OCB_NVNT_ANT1_802_11a_5785

Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 67 of 311

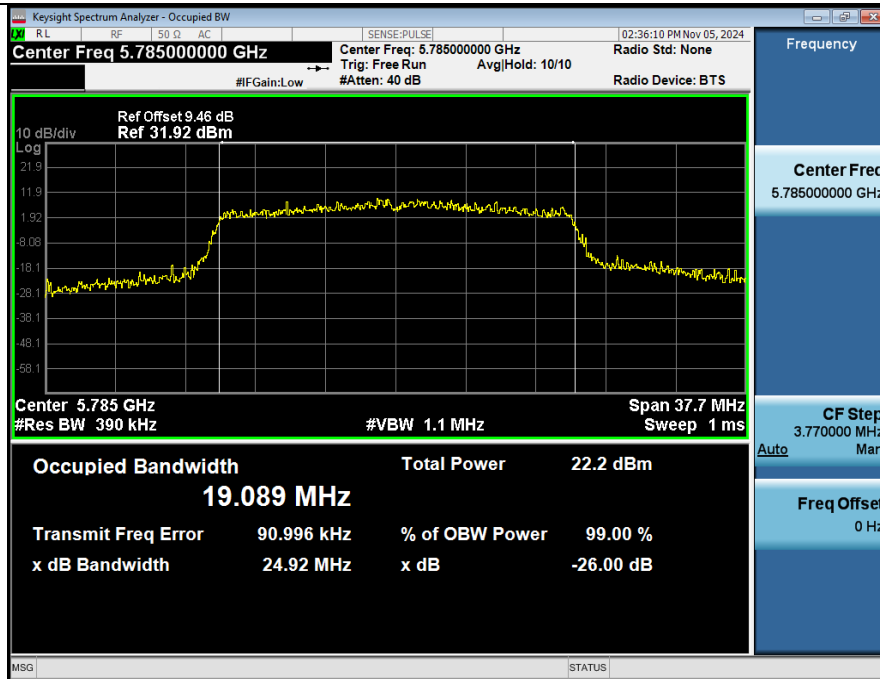

-26BW_NVNT_ANT1_802_11a_5785



99%_OCB_NVNT_ANT2_802_11a_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 68 of 311



-26BW_NVNT_ANT2_802_11a_5785

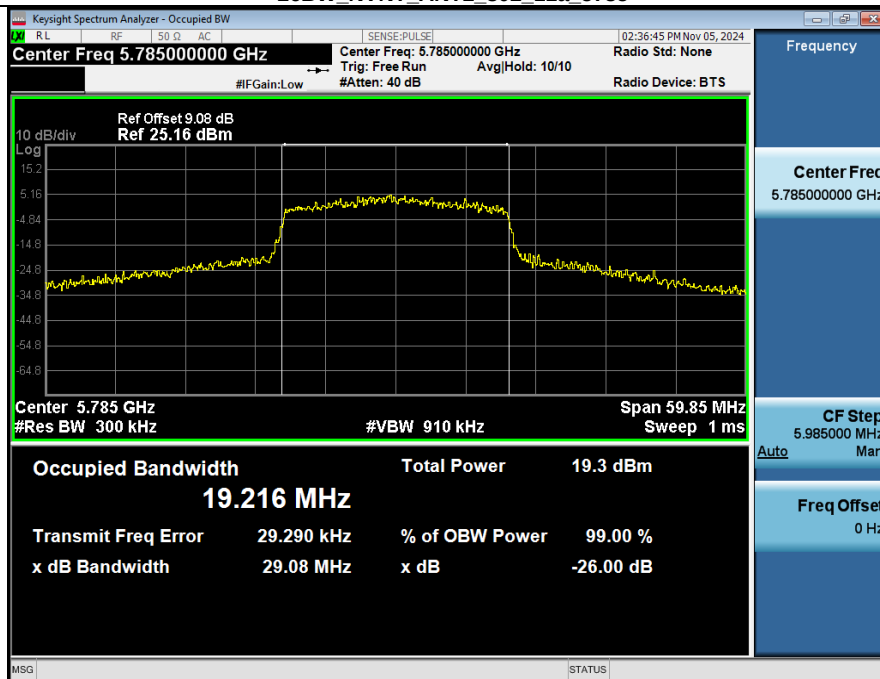

99%_OCB_NVNT_ANT1_802_11a_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 69 of 311



-26BW_NVNT_ANT1_802_11a_5825

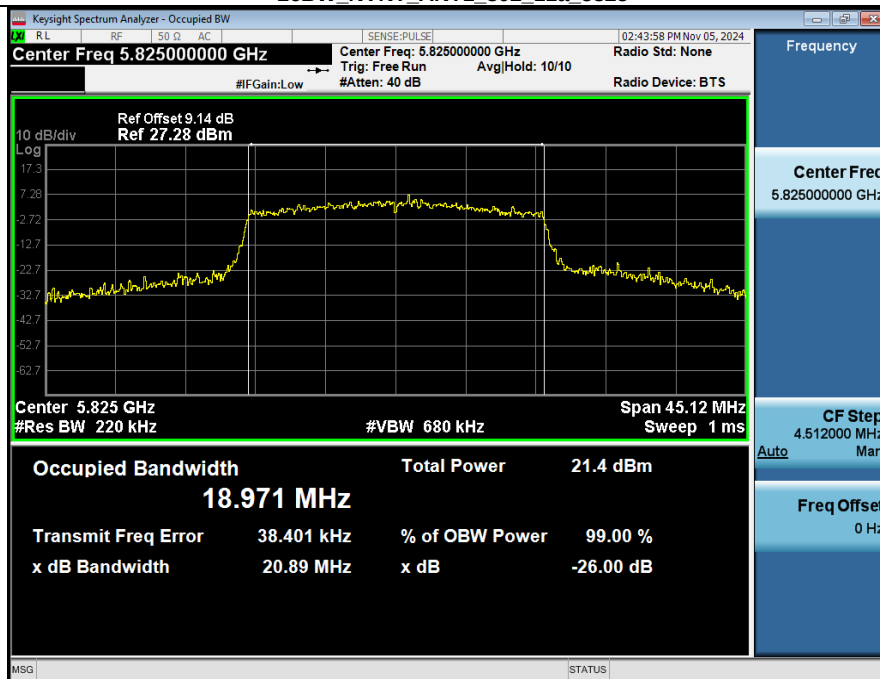


99%_OCB_NVNT_ANT2_802_11a_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 70 of 311

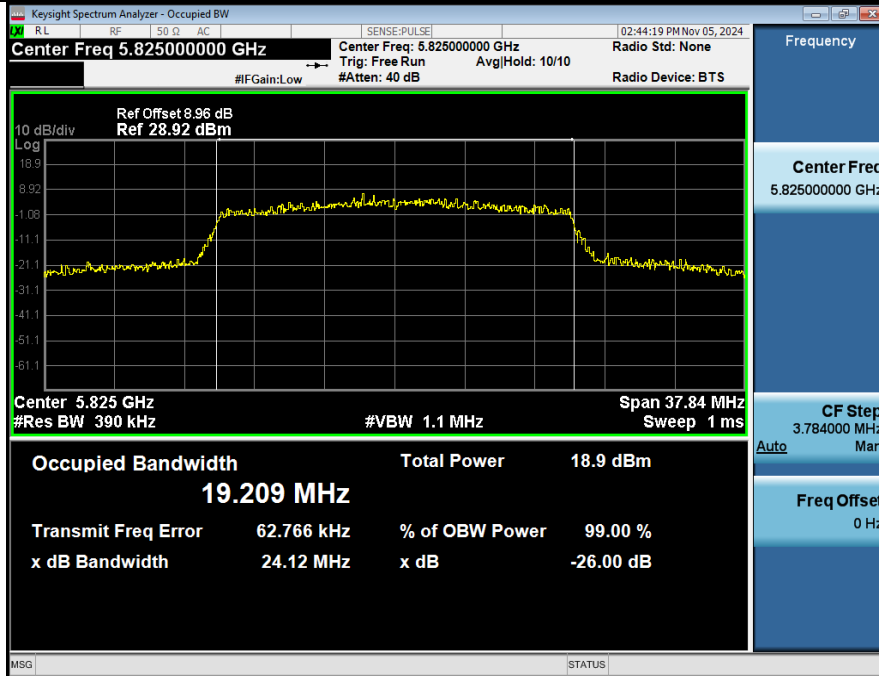

-26BW_NVNT_ANT2_802_11a_5825

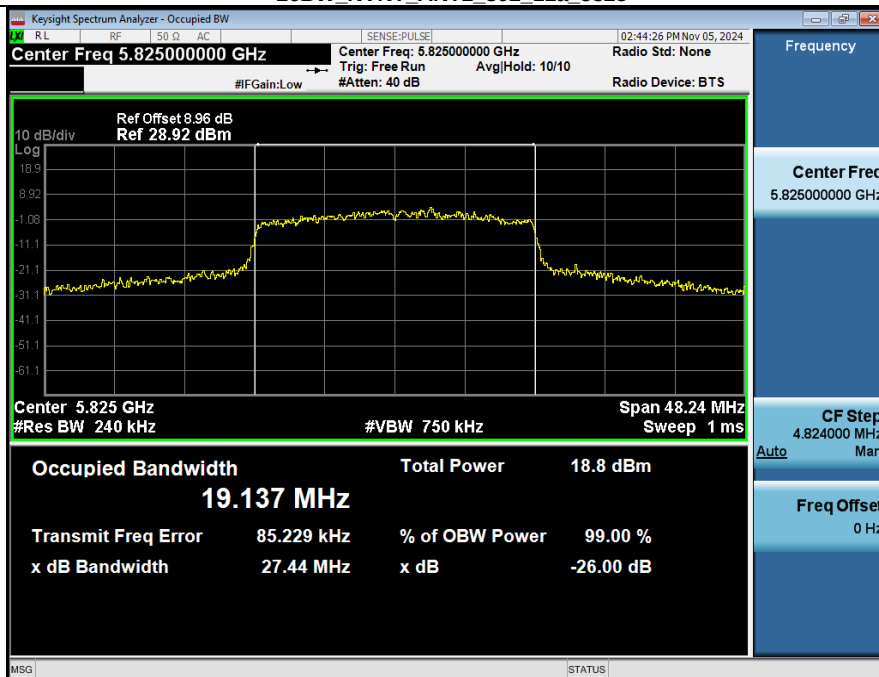


99% OCB_NVNT_ANT1_802_11n(HT20)_5745


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 71 of 311

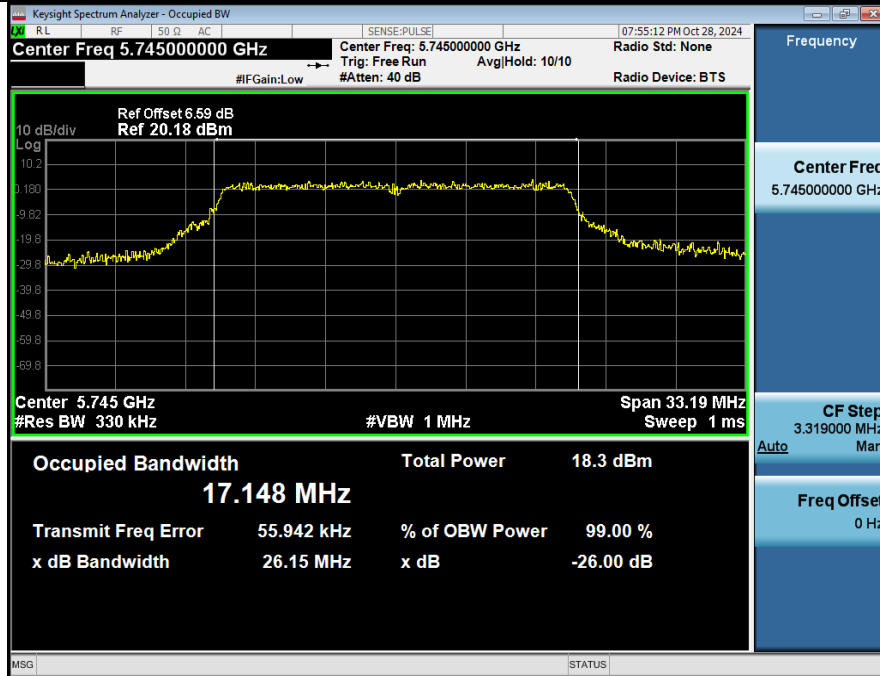

-26BW_NVNT_ANT1_802_11n(HT20)_5745

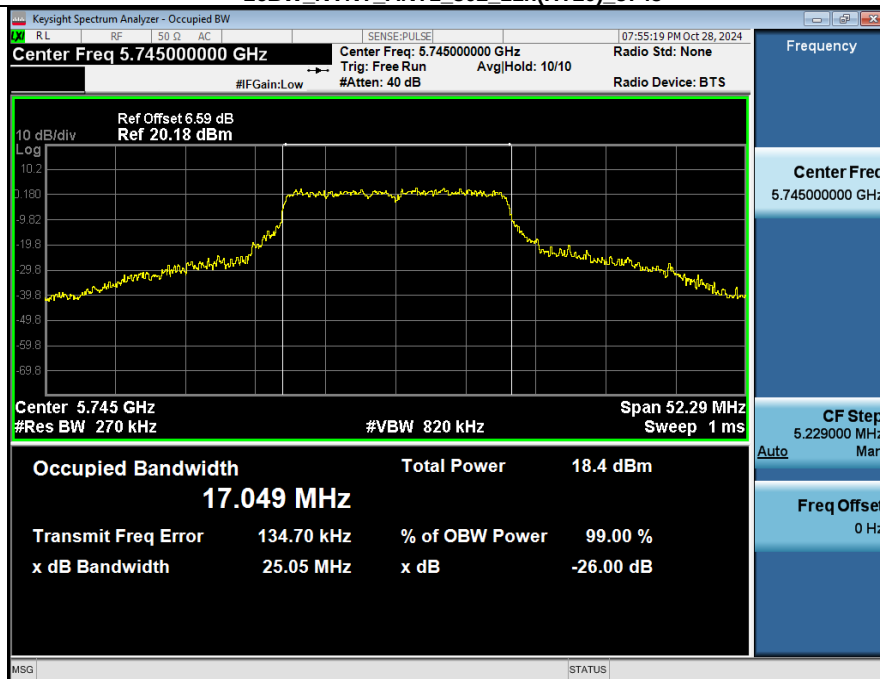


99%_OCB_NVNT_ANT2_802_11n(HT20)_5745


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 72 of 311

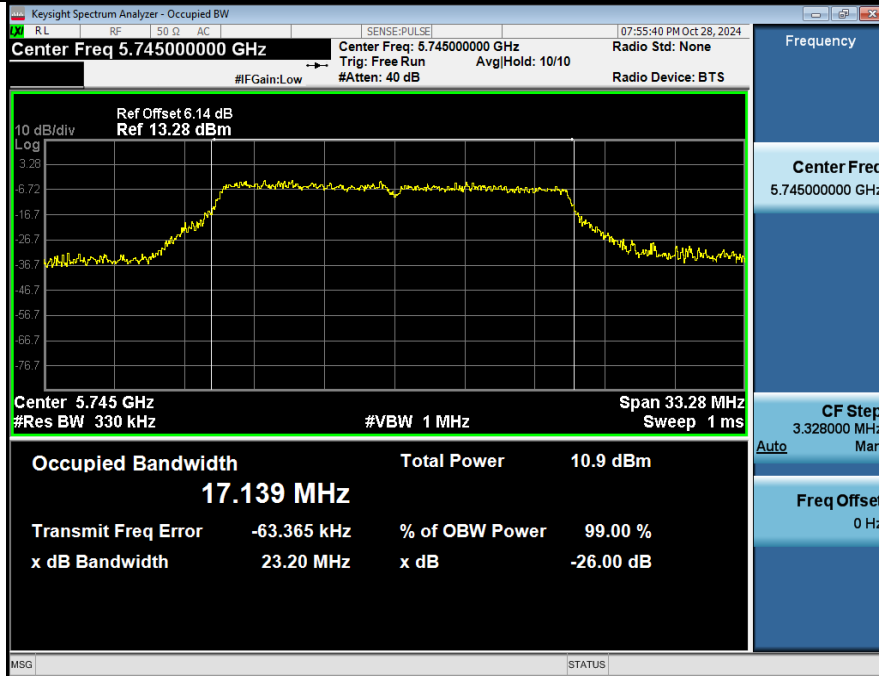

-26BW_NVNT_ANT2_802_11n(HT20)_5745

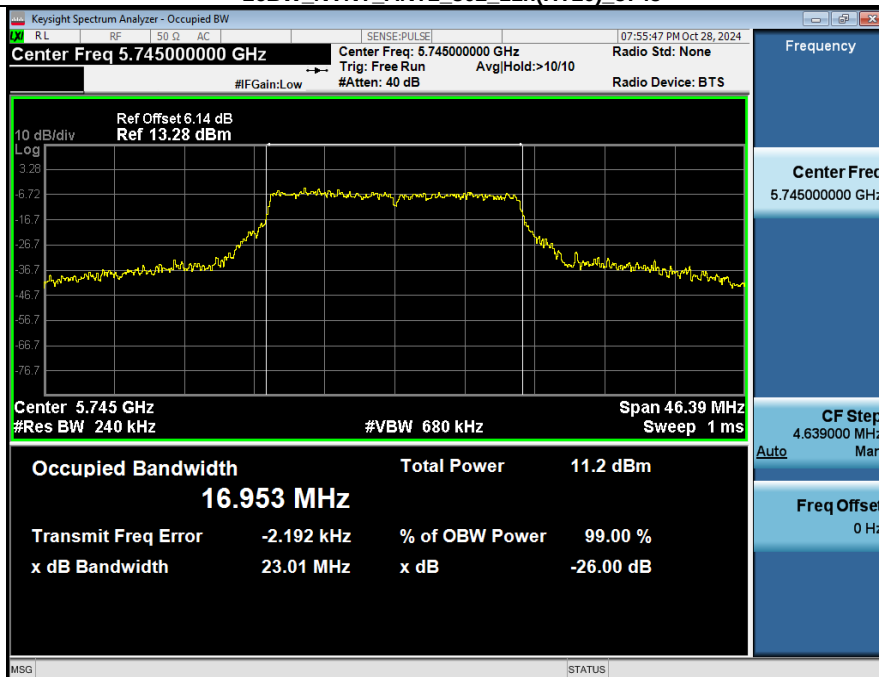


99% OCB_NVNT_ANT1_802_11n(HT20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 73 of 311

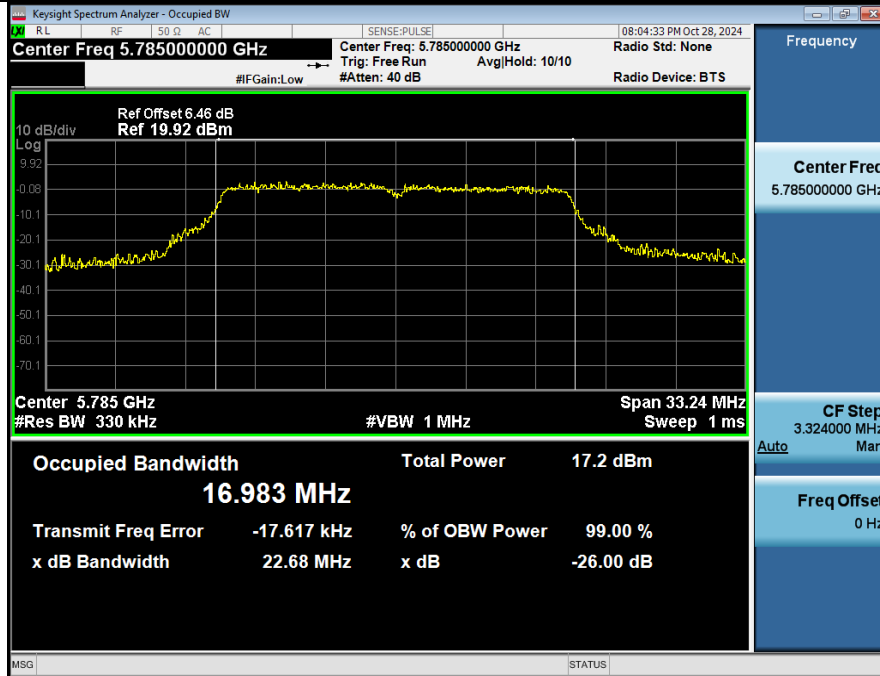

-26BW_NVNT_ANT1_802_11n(HT20)_5785

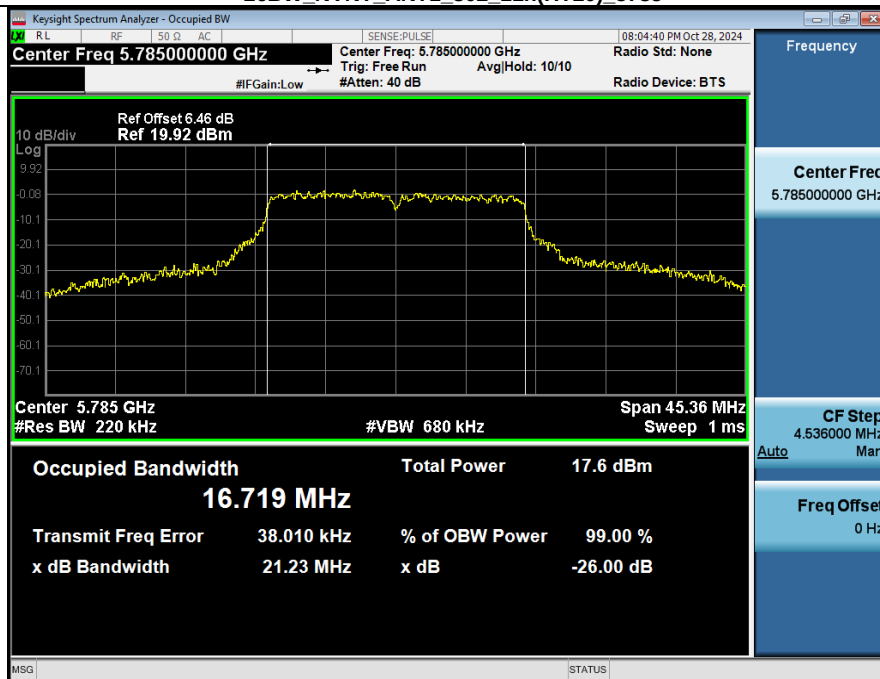


99%_OCB_NVNT_ANT2_802_11n(HT20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 74 of 311

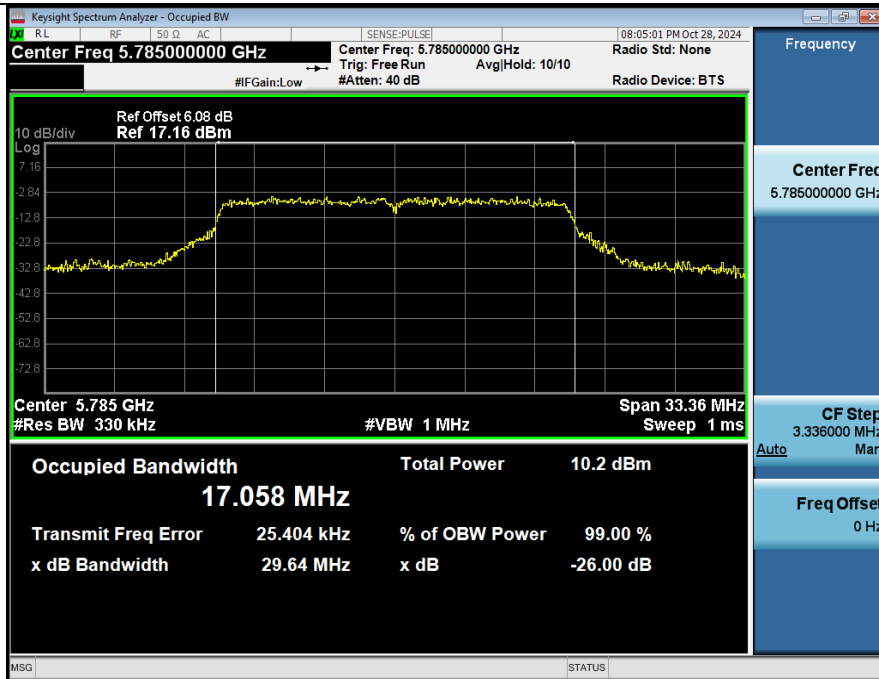

-26BW_NVNT_ANT2_802_11n(HT20)_5785

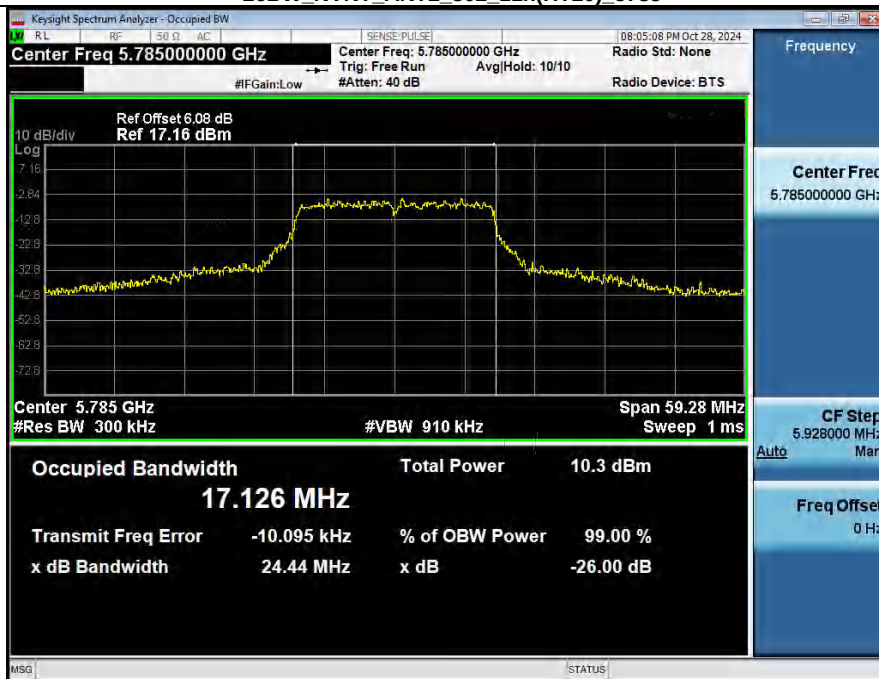


99% OCB_NVNT_ANT1_802_11n(HT20)_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 75 of 311

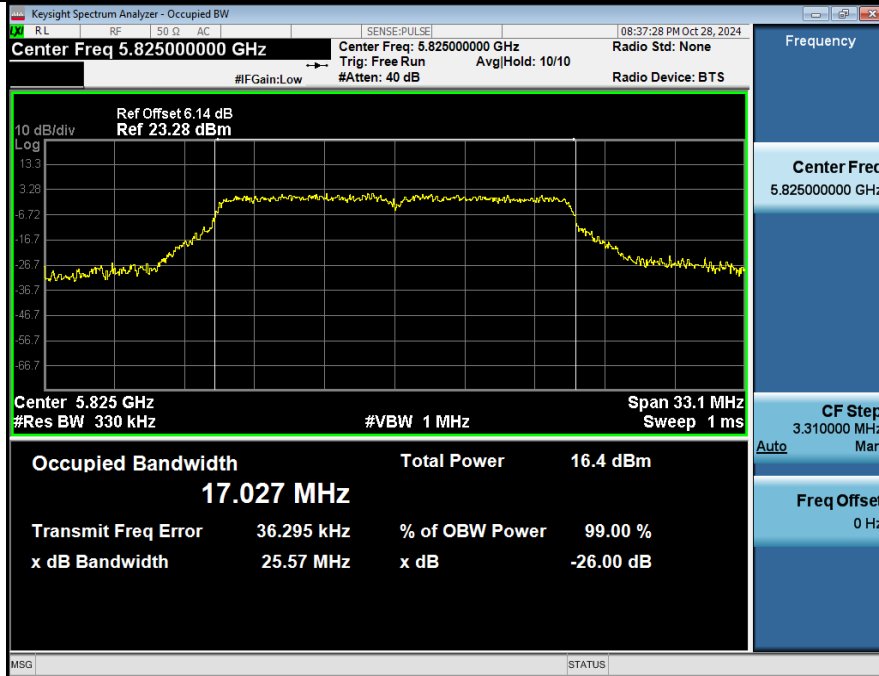

-26BW_NVNT_ANT1_802_11n(HT20)_5825

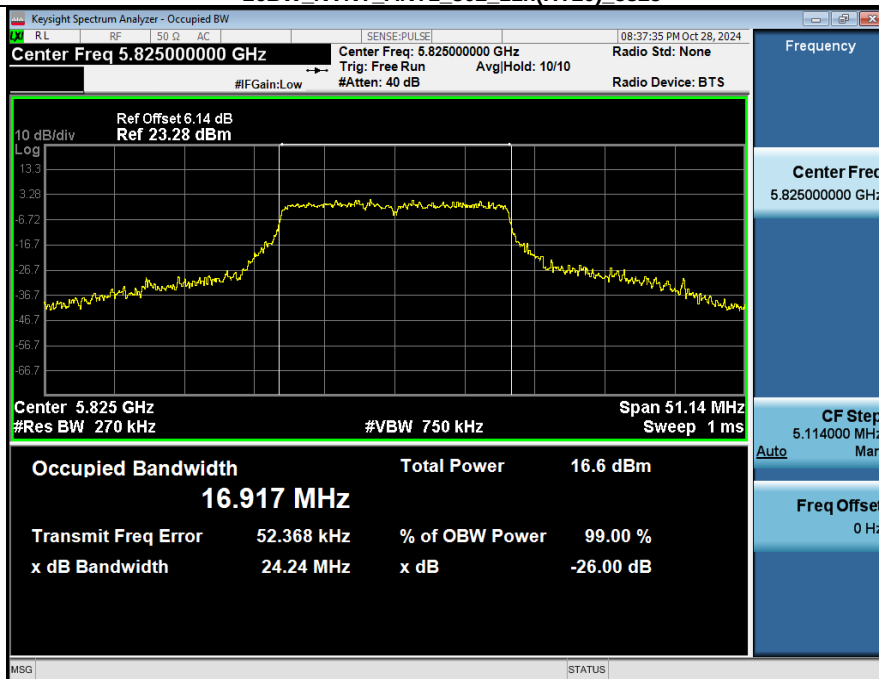


99%_OCB_NVNT_ANT2_802_11n(HT20)_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 76 of 311

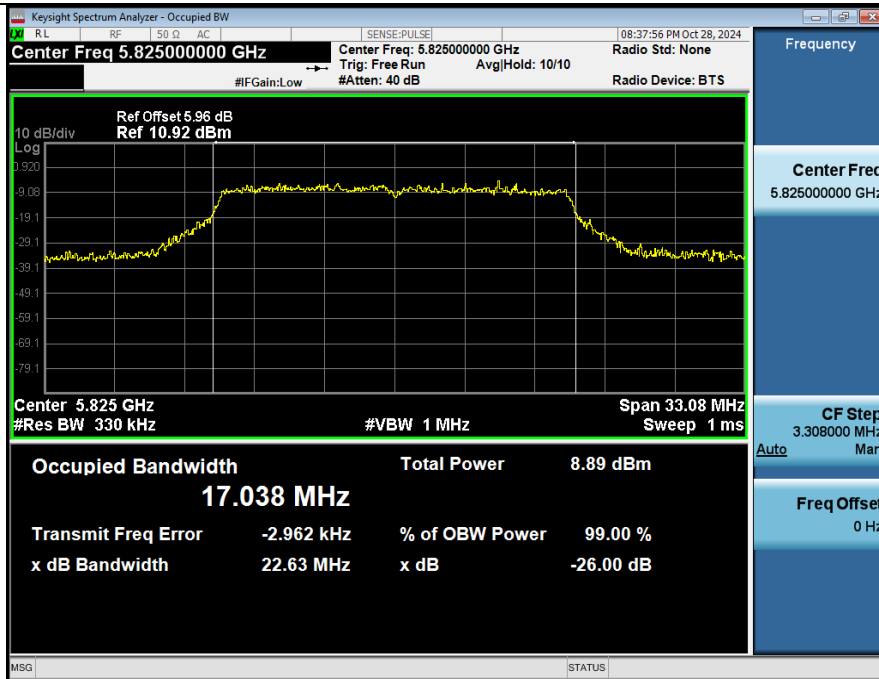


-26BW_NVNT_ANT2_802_11n(HT20)_5825

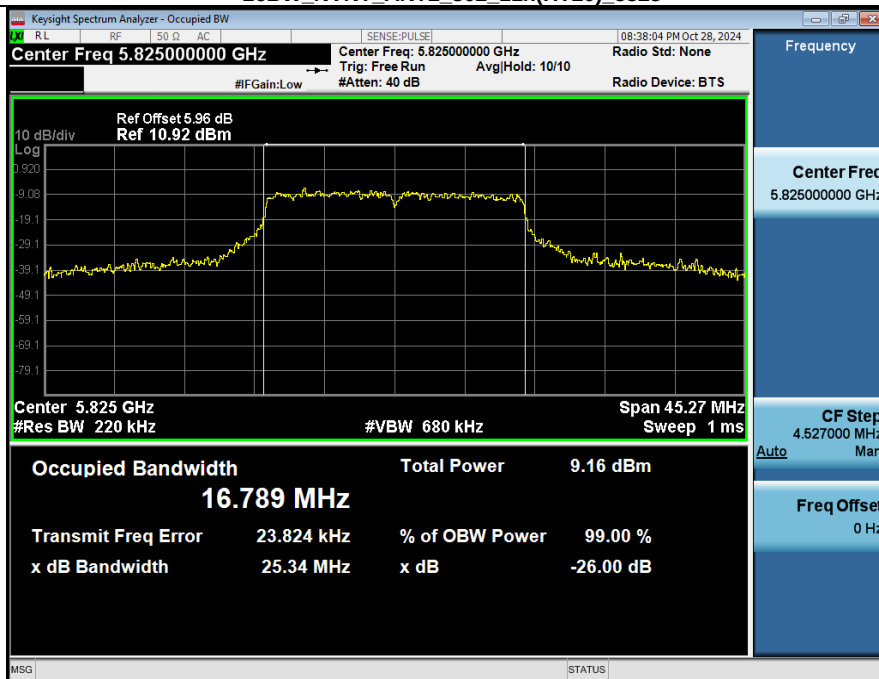

99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5745

Appendix B
CN24K76Q 003
Page 77 of 311

Prüfbericht - Produkte
Test Report - Products

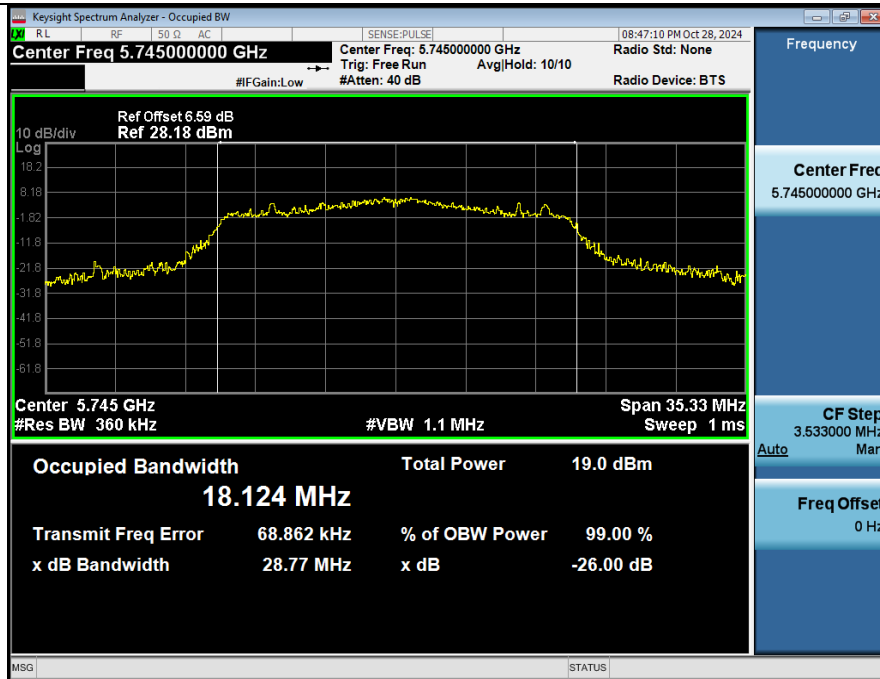

-26BW_NVNT_ANT1_802_11ac(VHT20)_5745




99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5745

Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 78 of 311

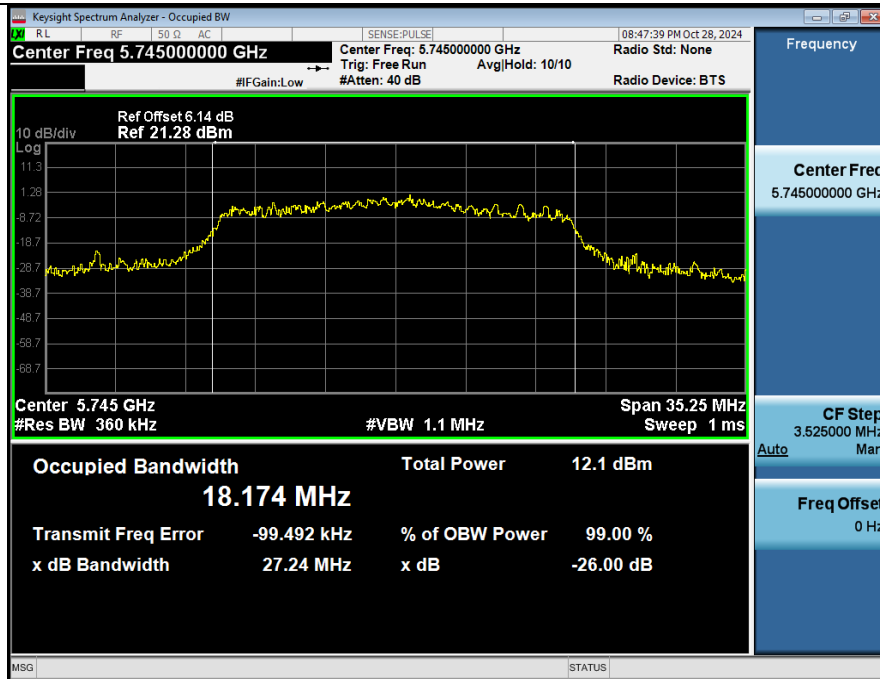

-26BW_NVNT_ANT2_802_11ac(VHT20)_5745




99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 79 of 311

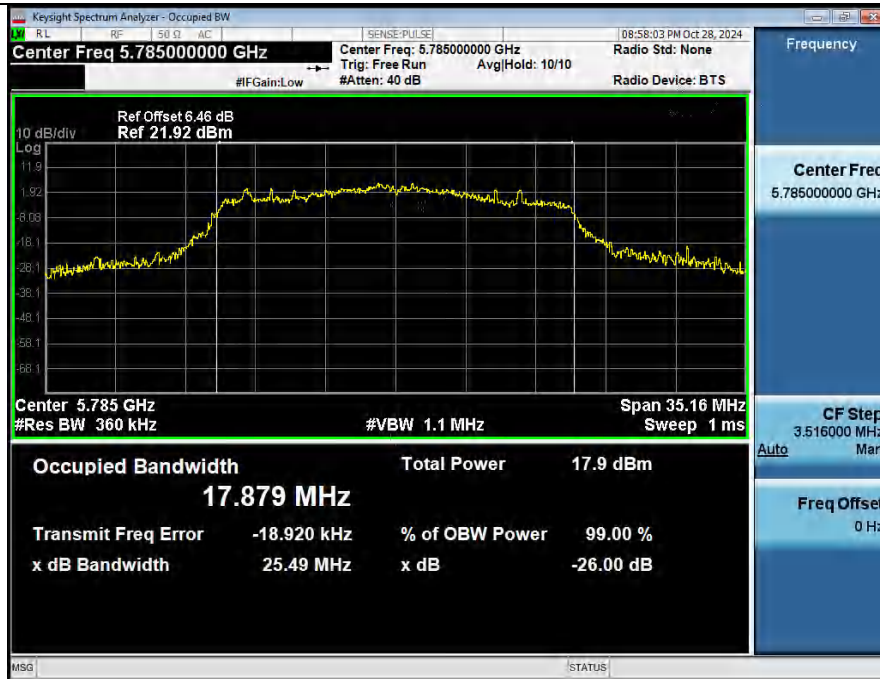

-26BW_NVNT_ANT1_802_11ac(VHT20)_5785

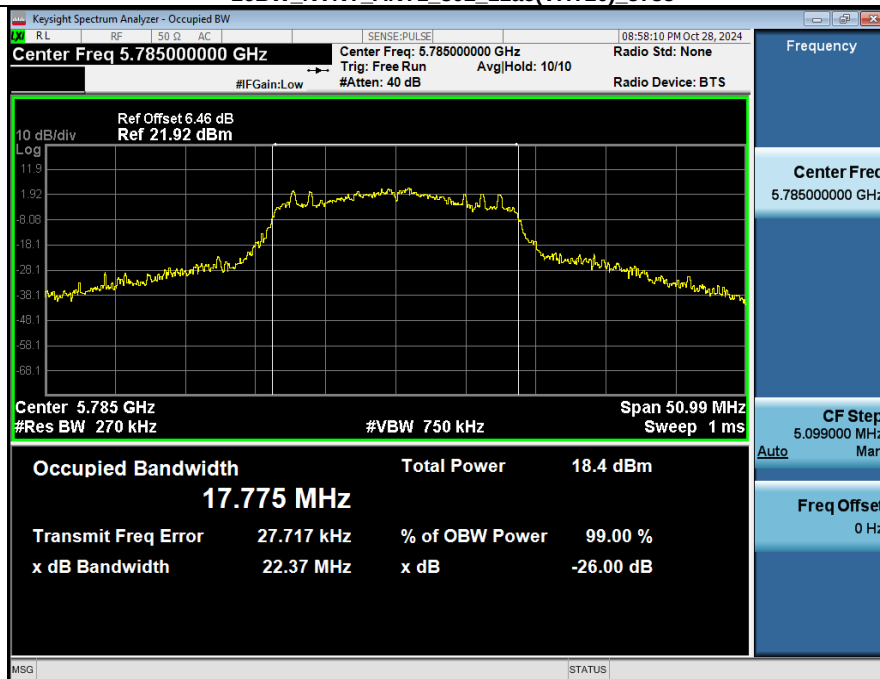

99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 80 of 311



-26BW_NVNT_ANT2_802_11ac(VHT20)_5785

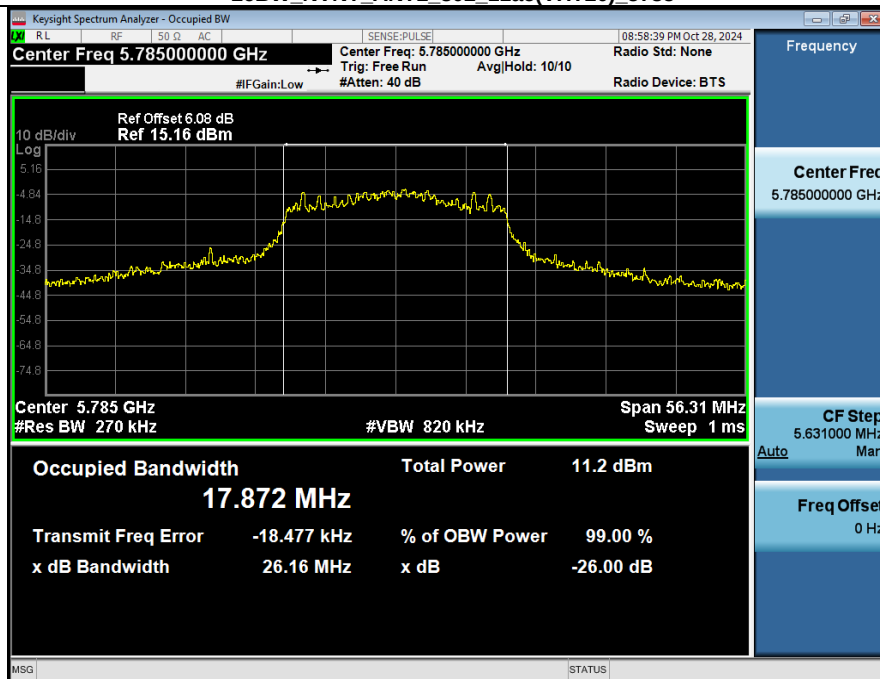


99%_OCB_NVNT_ANT1_802_11ac(VHT20)_5825

Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 81 of 311

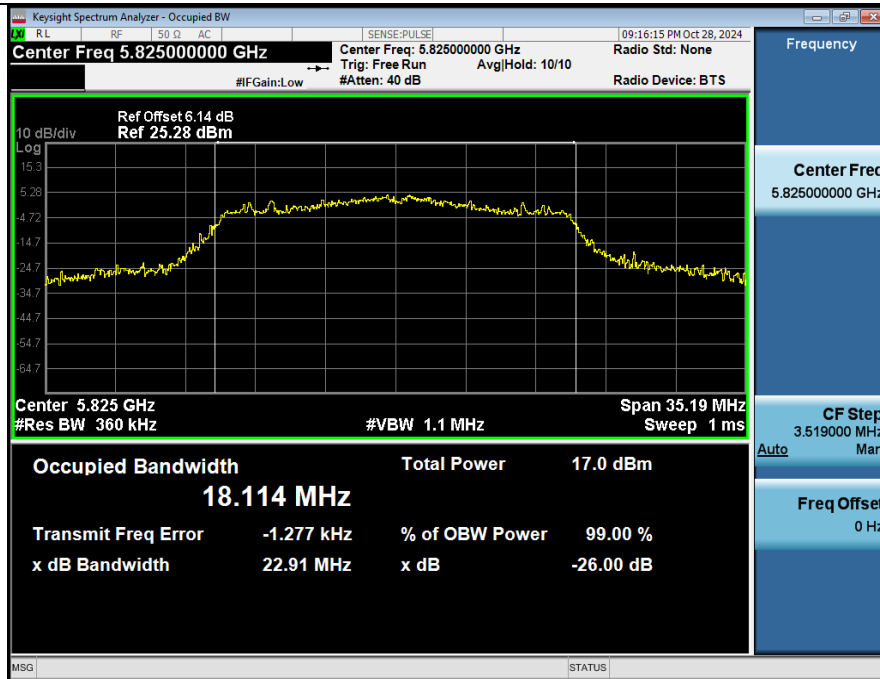

-26BW_NVNT_ANT1_802_11ac(VHT20)_5825




99%_OCB_NVNT_ANT2_802_11ac(VHT20)_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 82 of 311

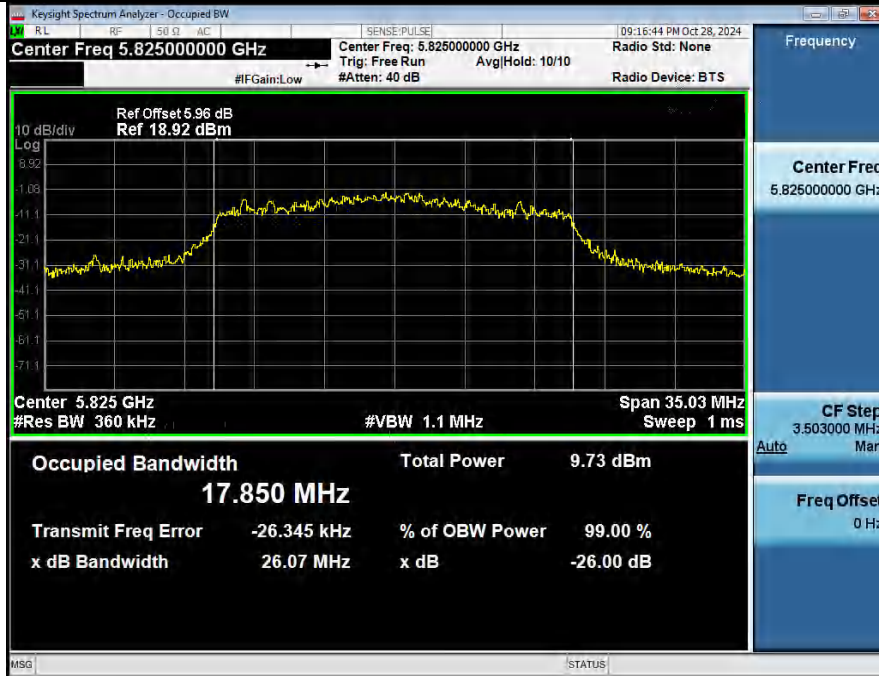

-26BW_NVNT_ANT2_802_11ac(VHT20)_5825

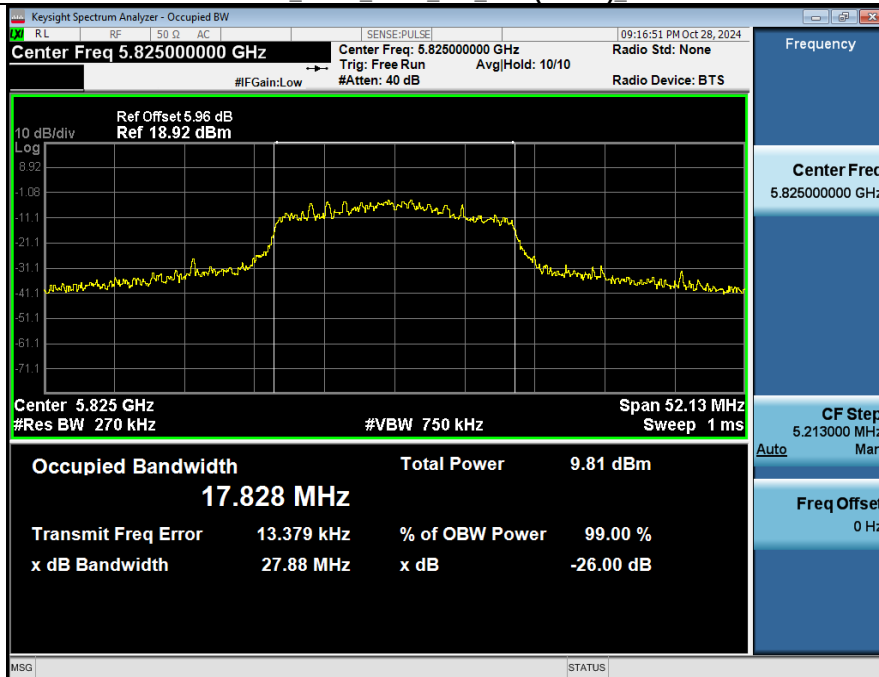


99%_OCB_NVNT_ANT1_802_11ax(HE20)_5745


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 83 of 311

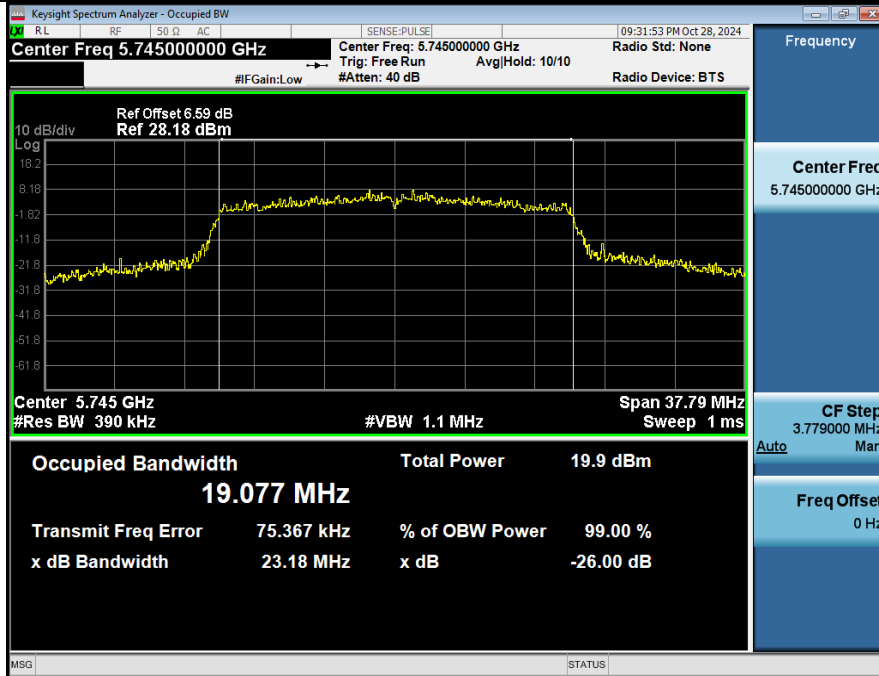

-26BW_NVNT_ANT1_802_11ax(HE20)_5745

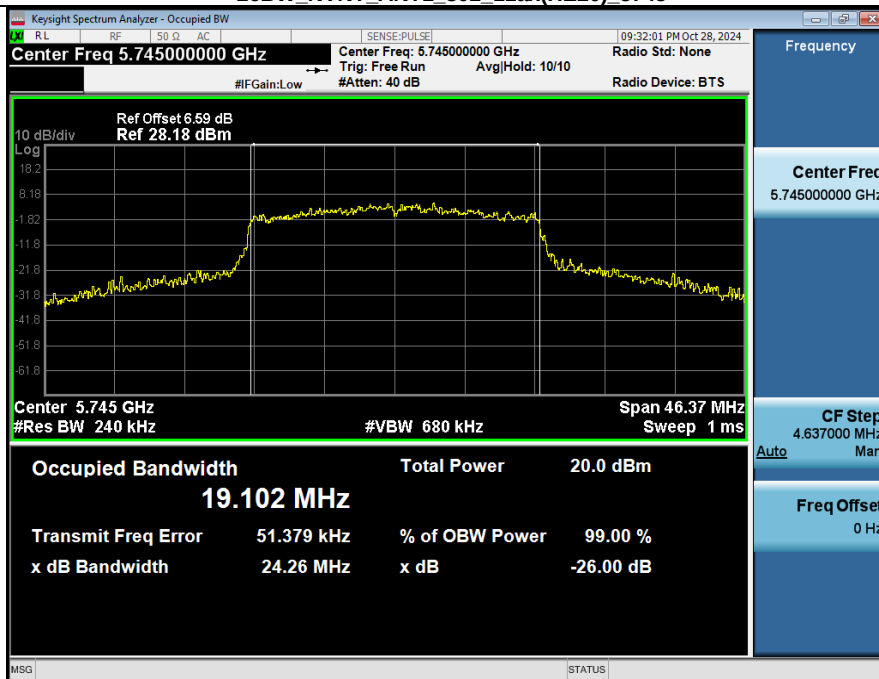


99% OCB NVNT_ANT2_802_11ax(HE20)_5745


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 84 of 311

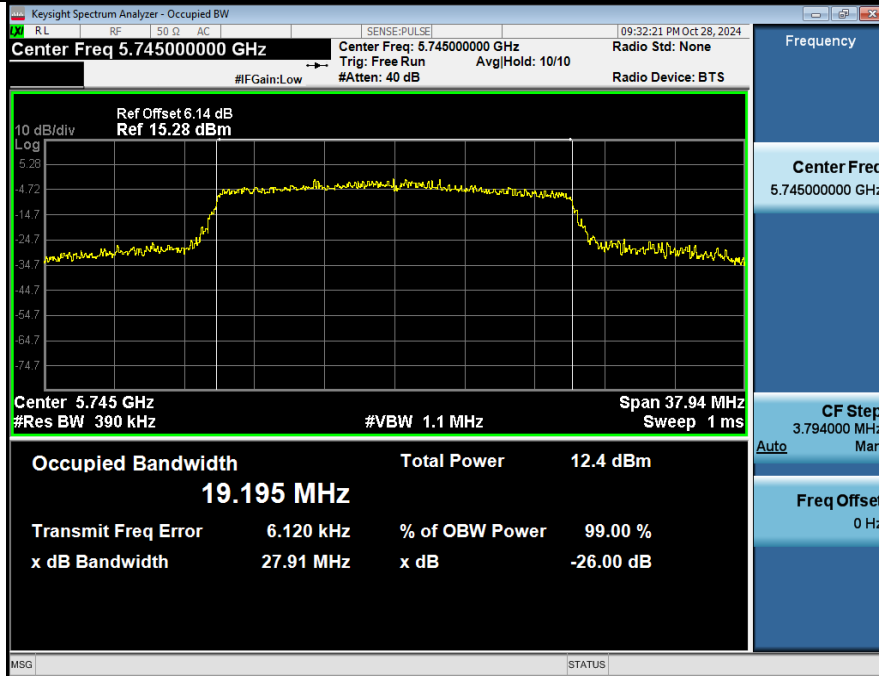

-26BW_NVNT_ANT2_802_11ax(HE20)_5745

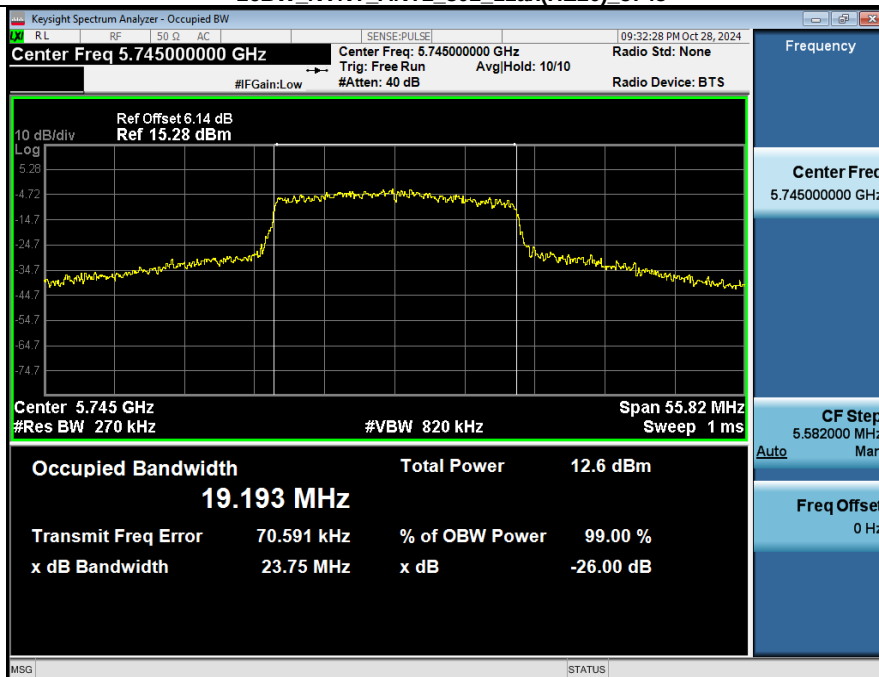


99% OCB_NVNT_ANT1_802_11ax(HE20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 85 of 311

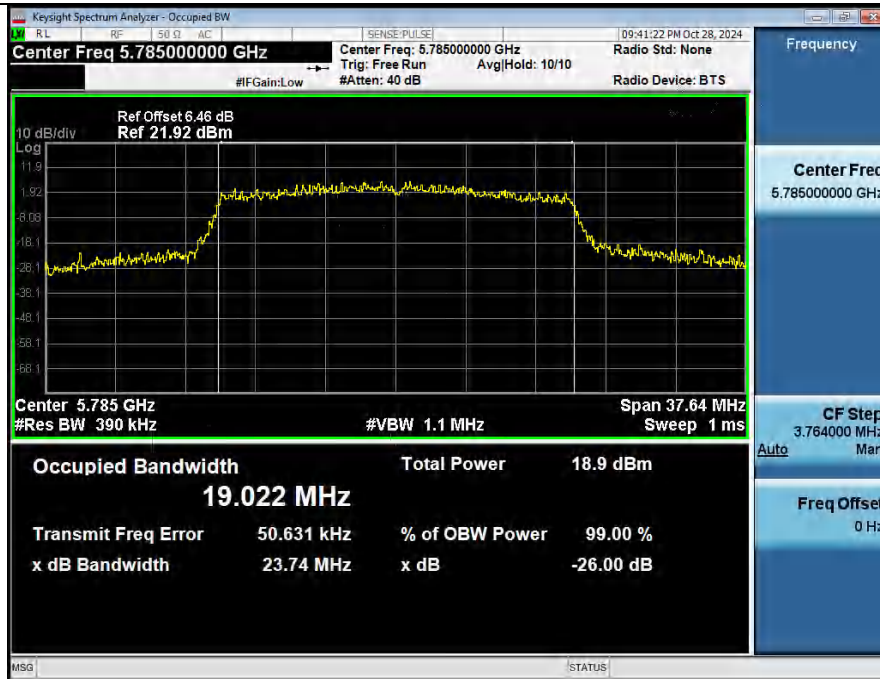

-26BW_NVNT_ANT1_802_11ax(HE20)_5785

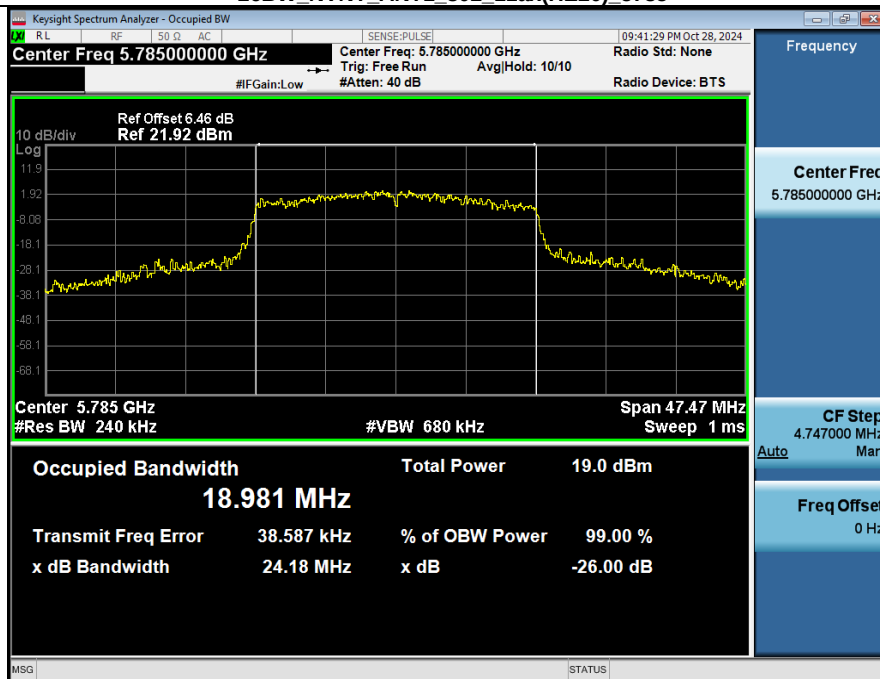


99% OCB NVNT ANT2_802_11ax(HE20)_5785


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 86 of 311

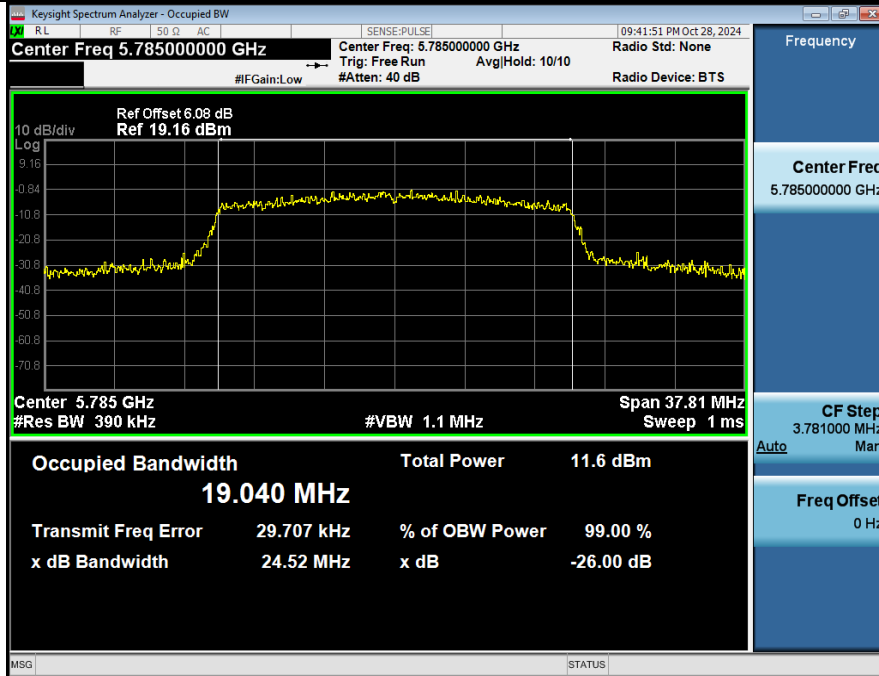

-26BW_NVNT_ANT2_802_11ax(HE20)_5785

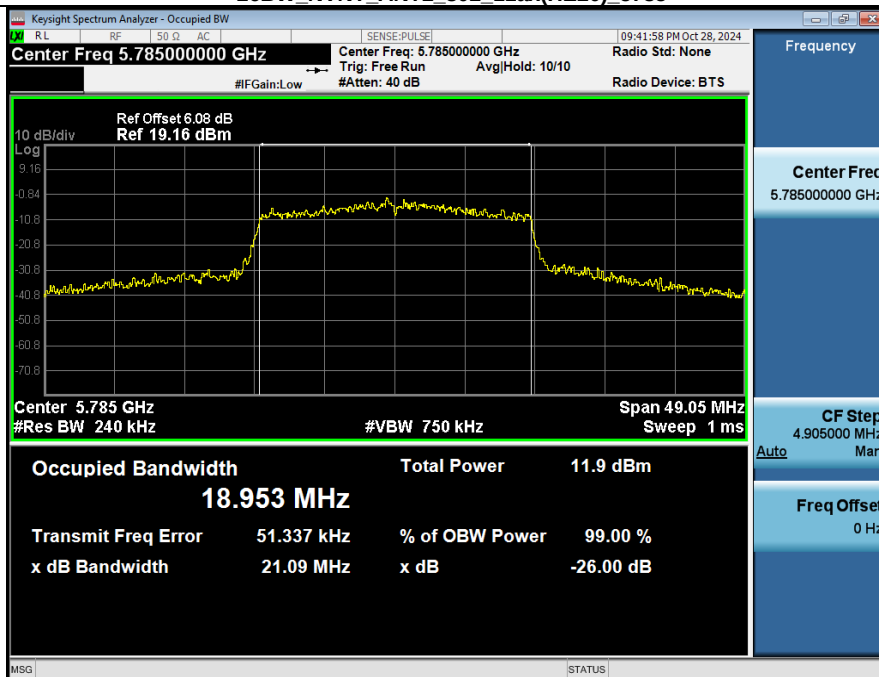

99% OCB_NVNT_ANT1_802_11ax(HE20)_5825

Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 87 of 311



-26BW_NVNT_ANT1_802_11ax(HE20)_5825




99% OCB_NVNT_ANT2_802_11ax(HE20)_5825


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 88 of 311

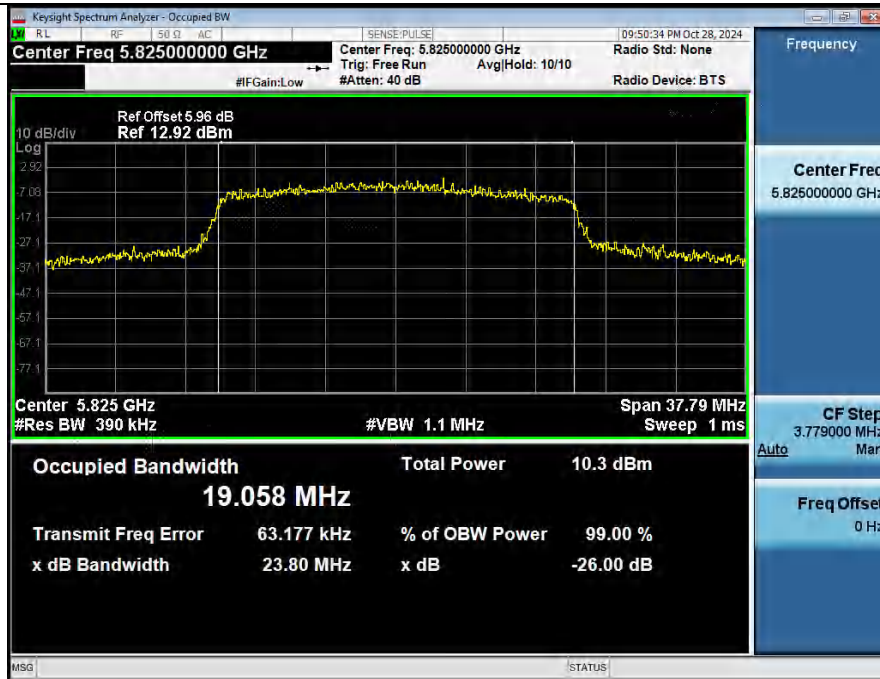

-26BW_NVNT_ANT2_802_11ax(HE20)_5825

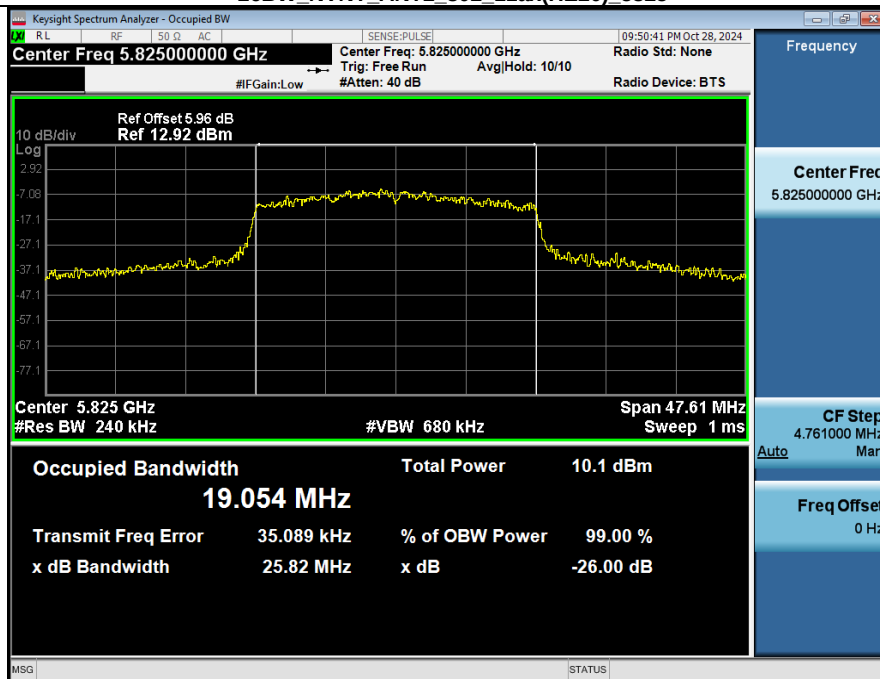


99% OCB_NVNT_ANT1_802_11n(HT40)_5755


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 89 of 311

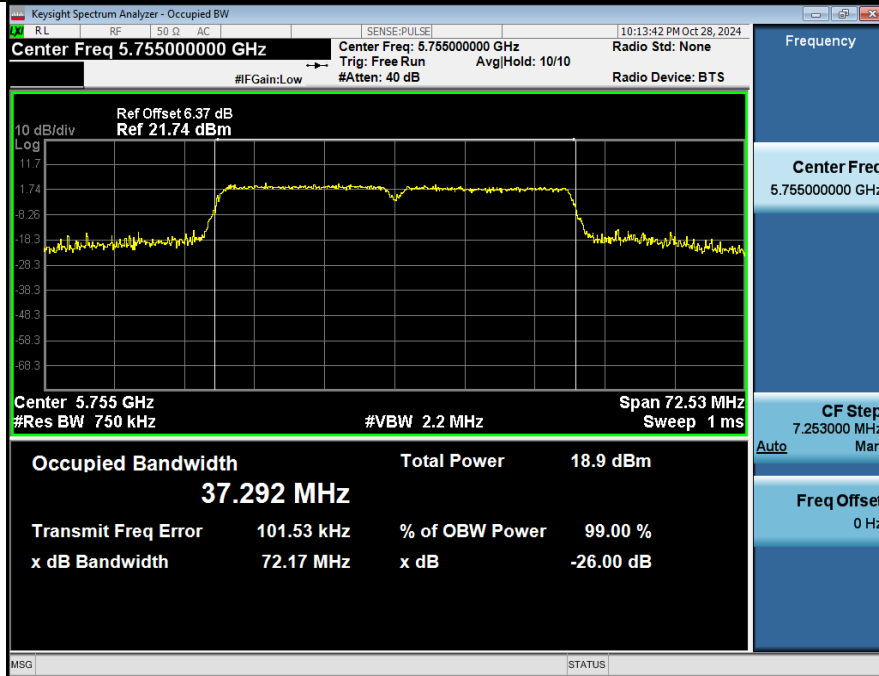

-26BW_NVNT_ANT1_802_11n(HT40)_5755

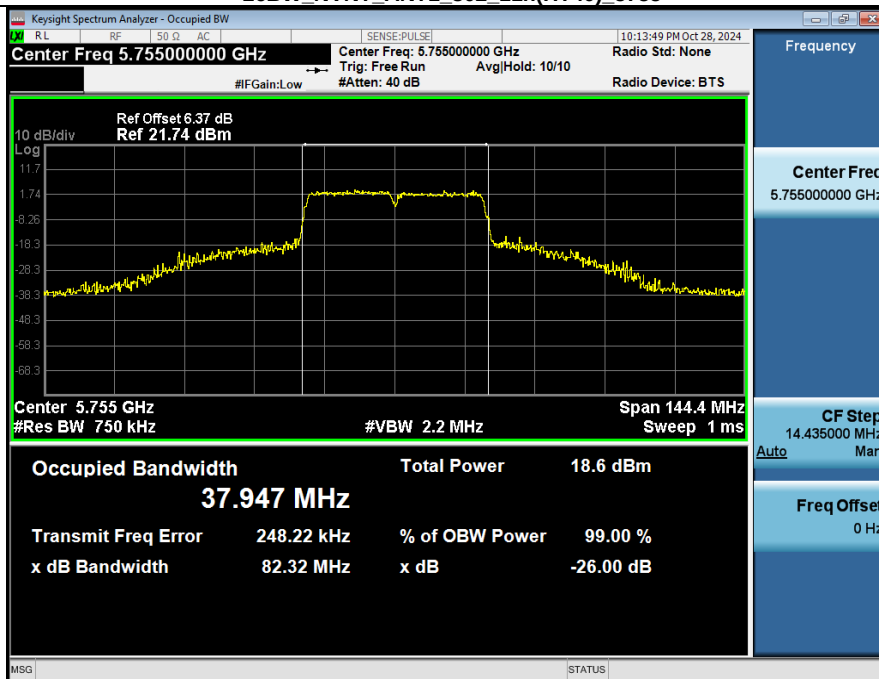


99%_OCB_NVNT_ANT2_802_11n(HT40)_5755


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 90 of 311

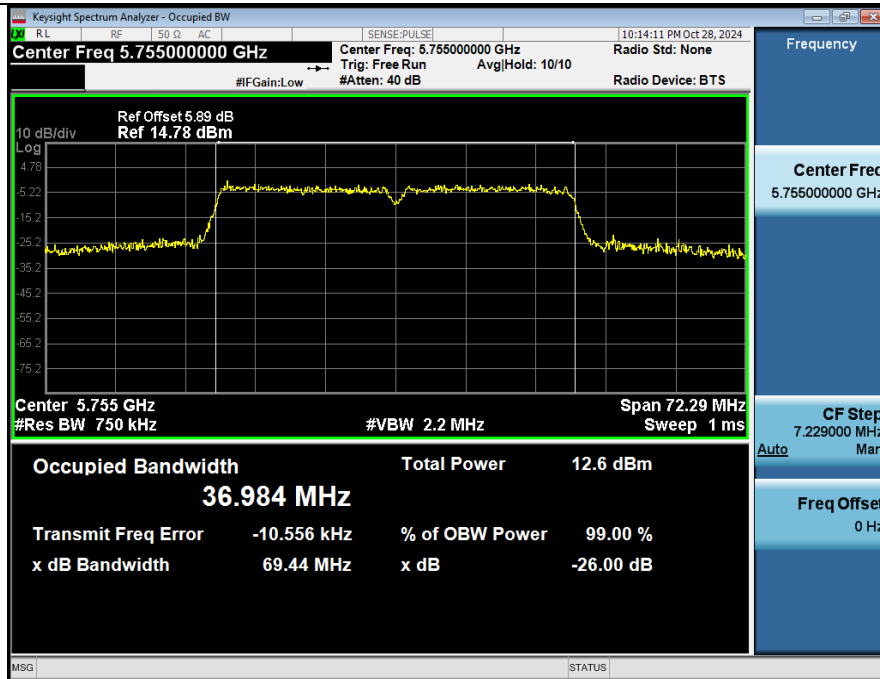

-26BW_NVNT_ANT2_802_11n(HT40)_5755

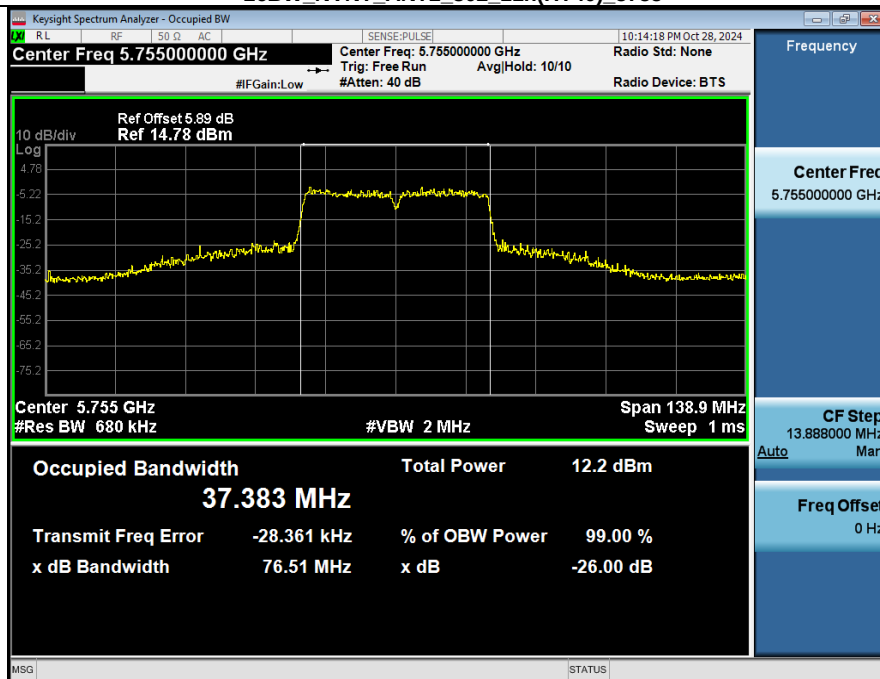


99% OCB_NVNT_ANT1_802_11n(HT40)_5795


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 91 of 311

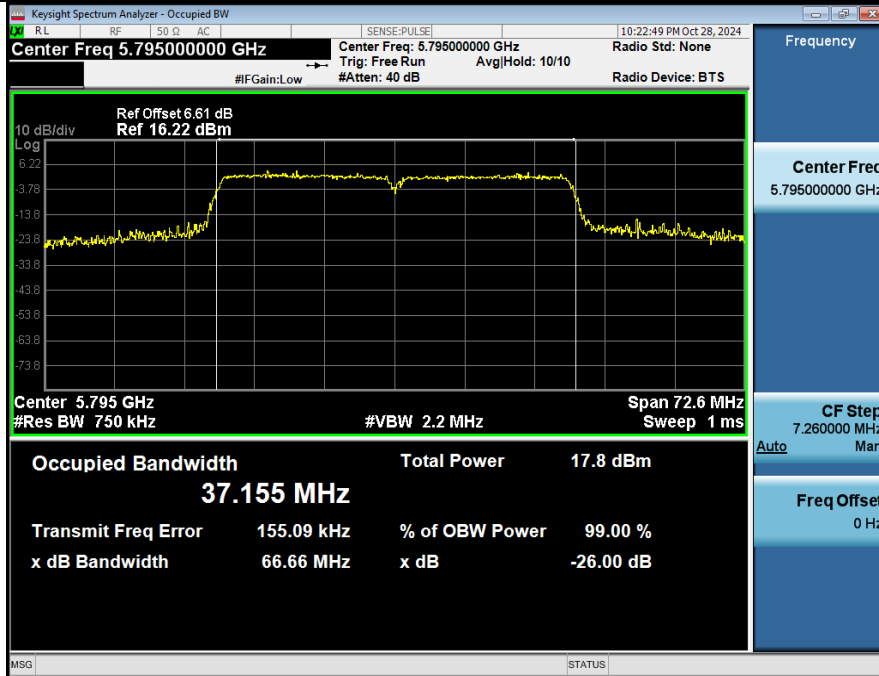

-26BW_NVNT_ANT1_802_11n(HT40)_5795

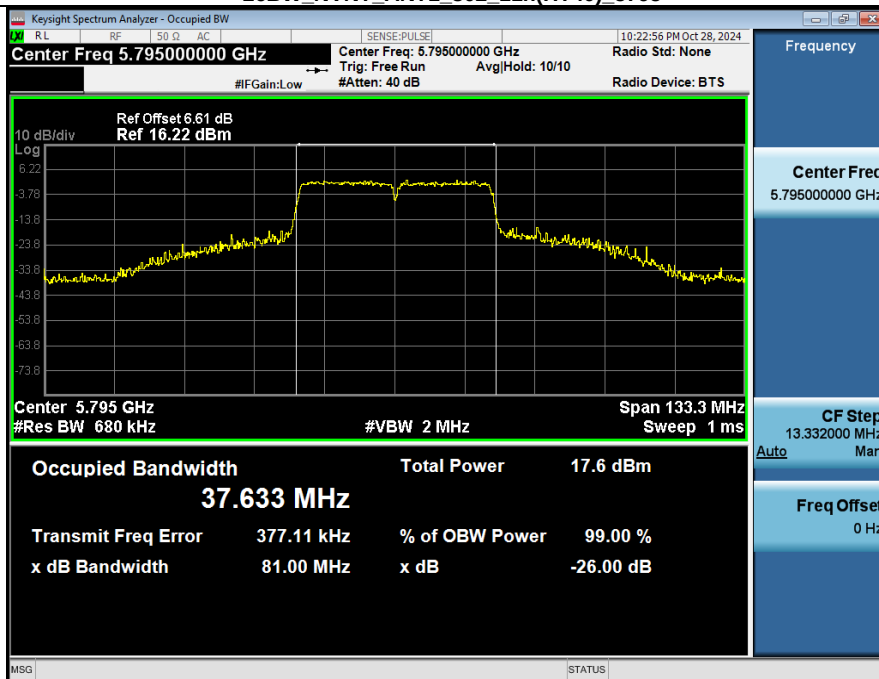


99%_OCB_NVNT_ANT2_802_11n(HT40)_5795


Appendix B
CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 92 of 311

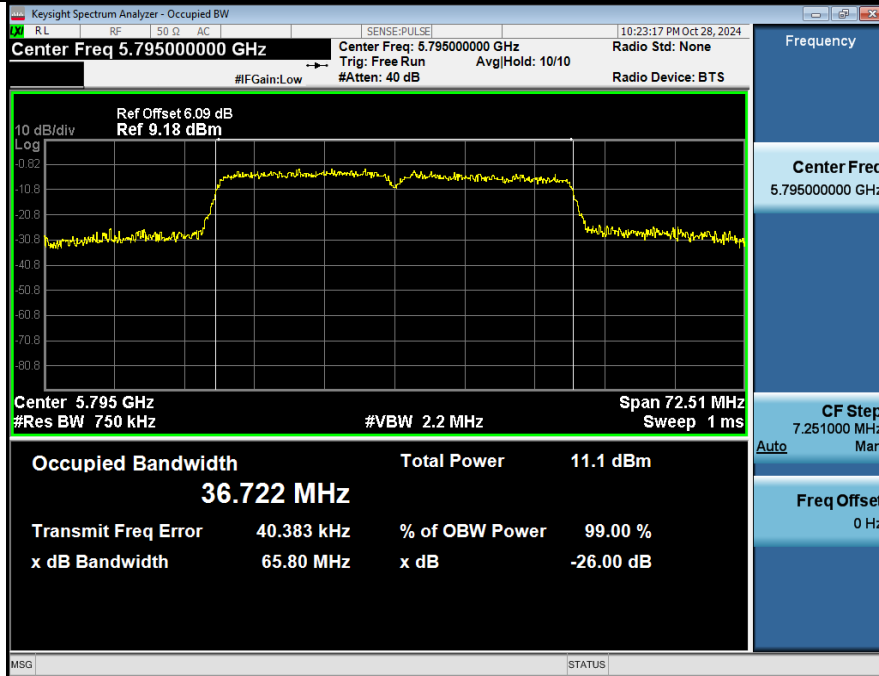

-26BW_NVNT_ANT2_802_11n(HT40)_5795

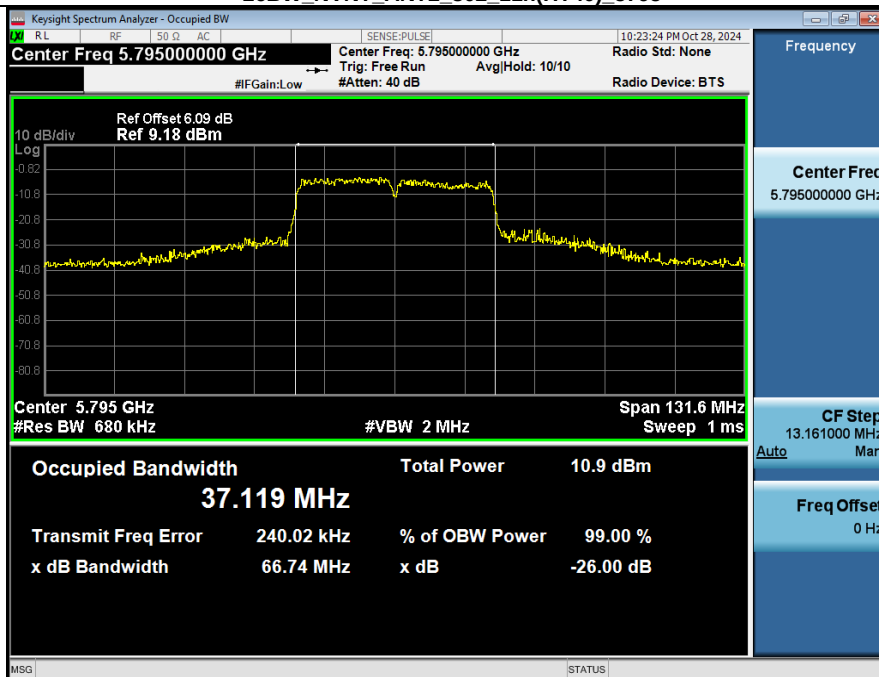


99%_OCB_NVNT_ANT1_802_11ac(VHT40)_5755

Appendix B


CN24K76Q 003

Prüfbericht - Produkte
Test Report - Products

Page 93 of 311

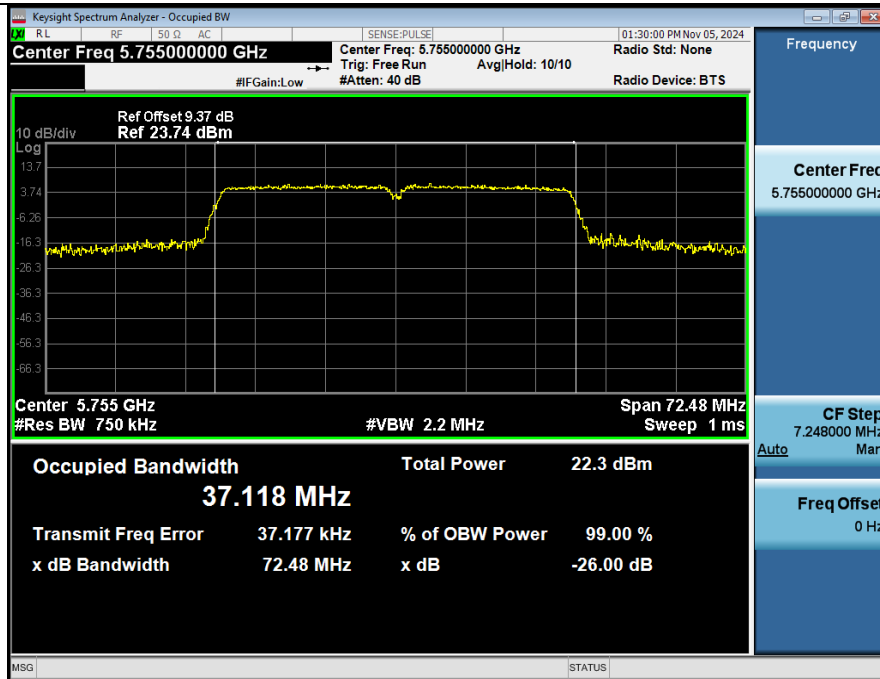

-26BW_NVNT_ANT1_802_11ac(VHT40)_5755

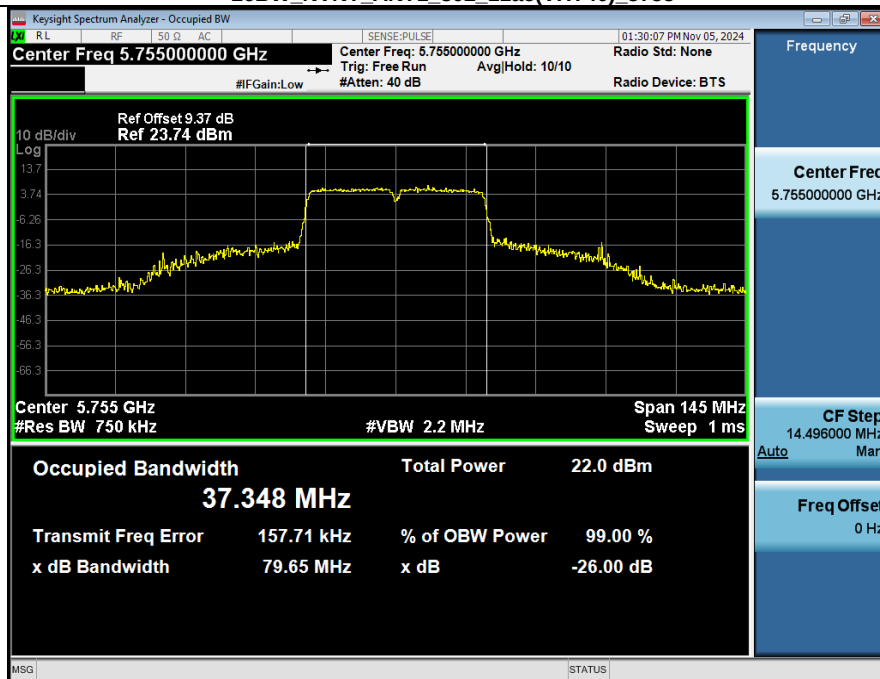

99%_OCB_NVNT_ANT2_802_11ac(VHT40)_5755