




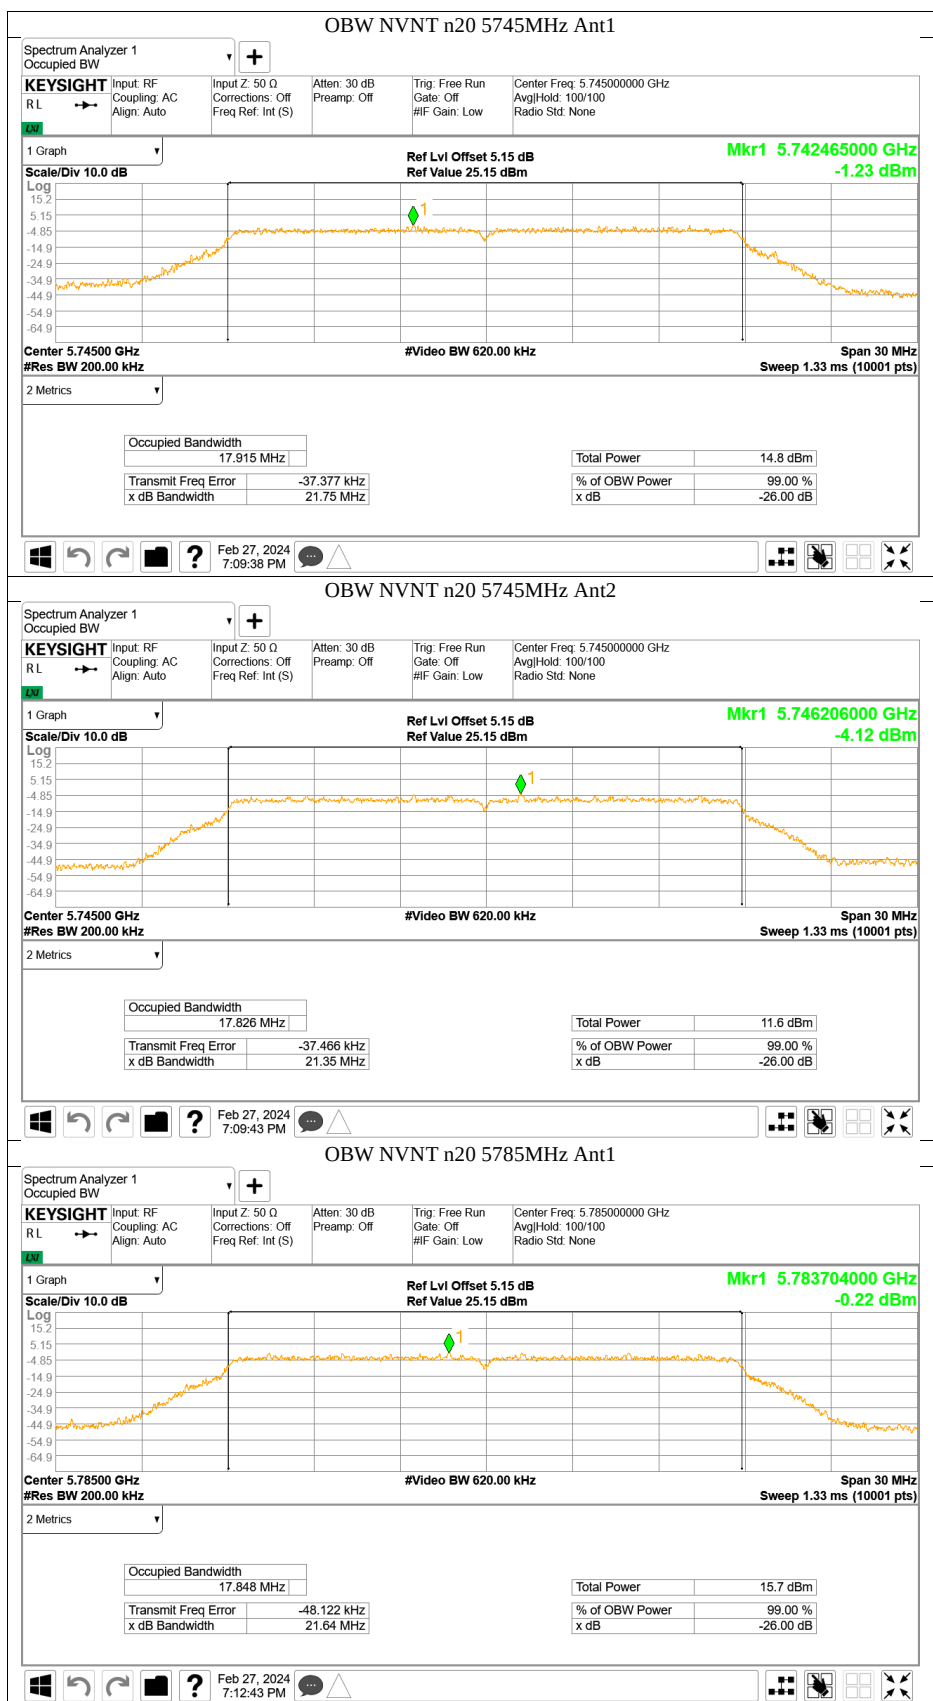
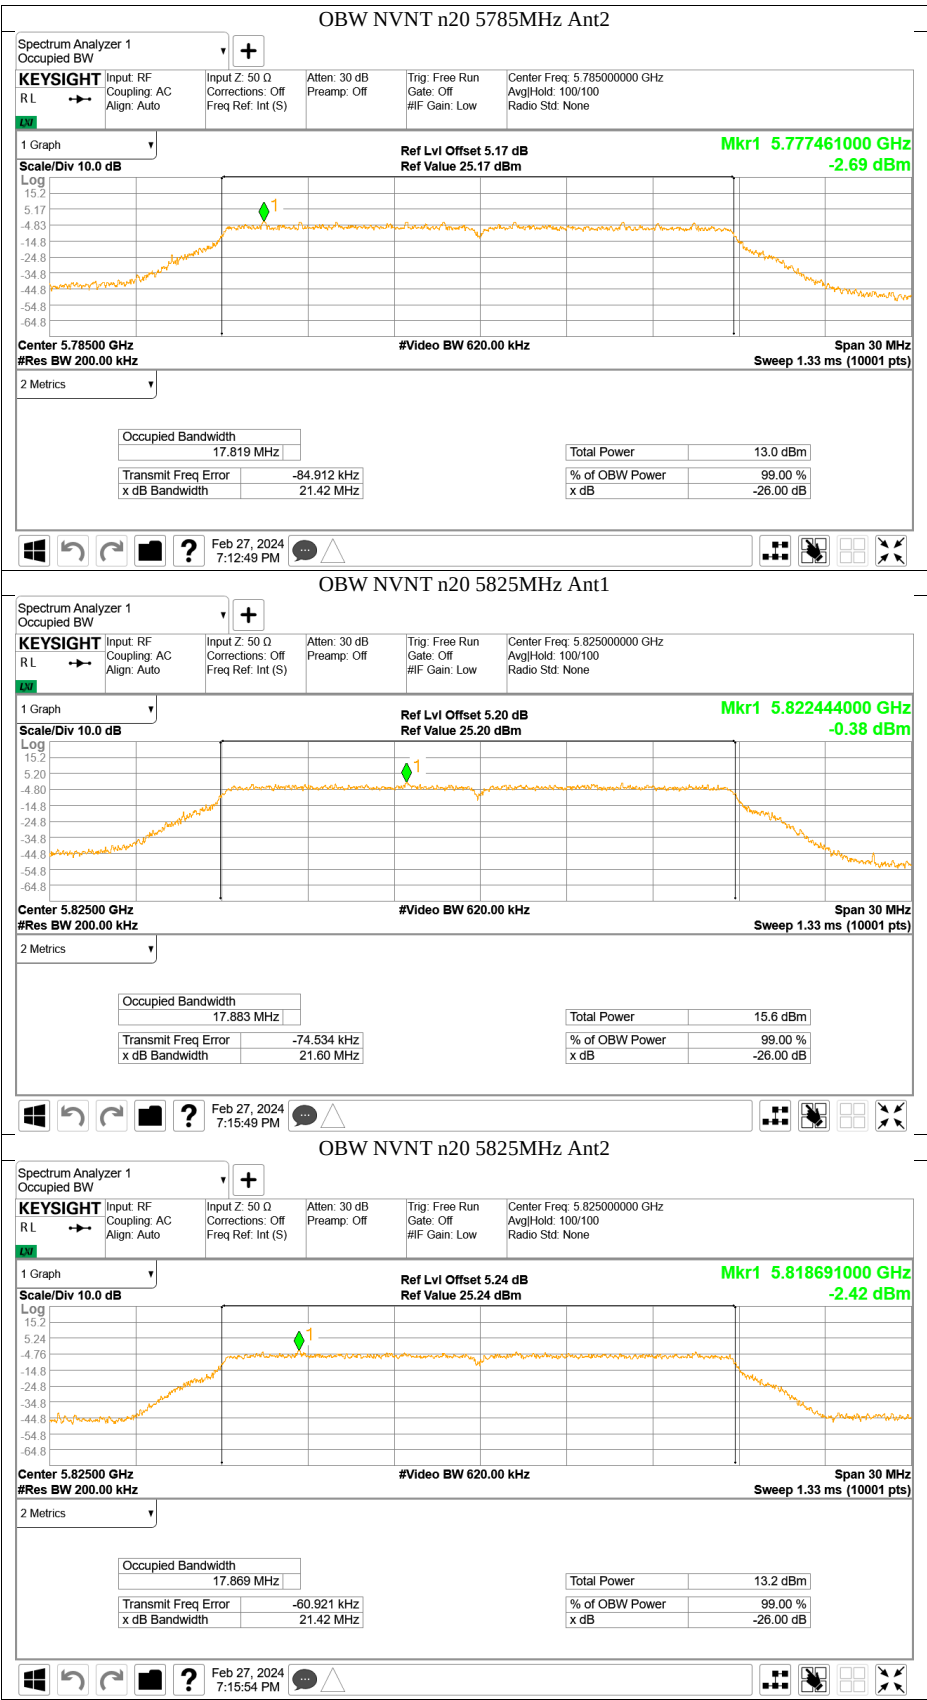


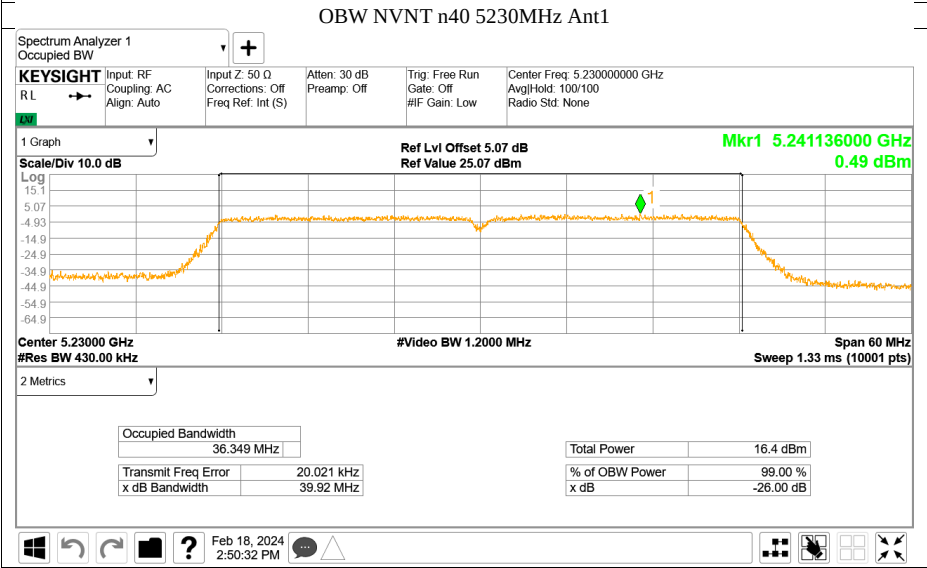


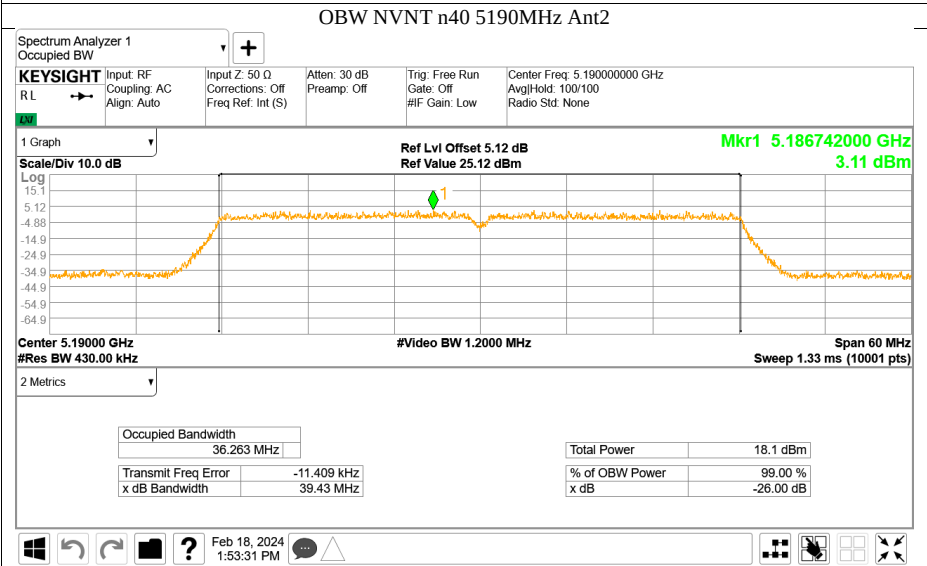


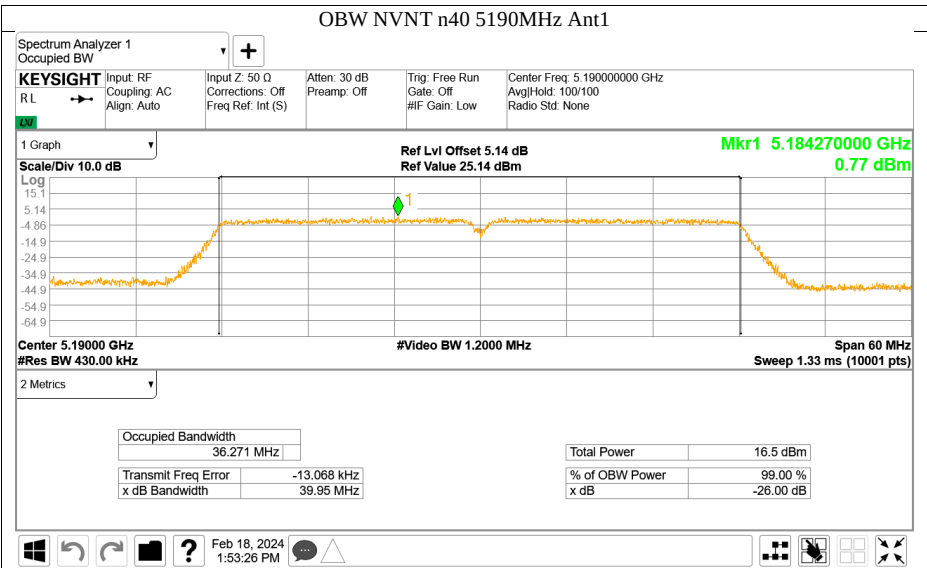


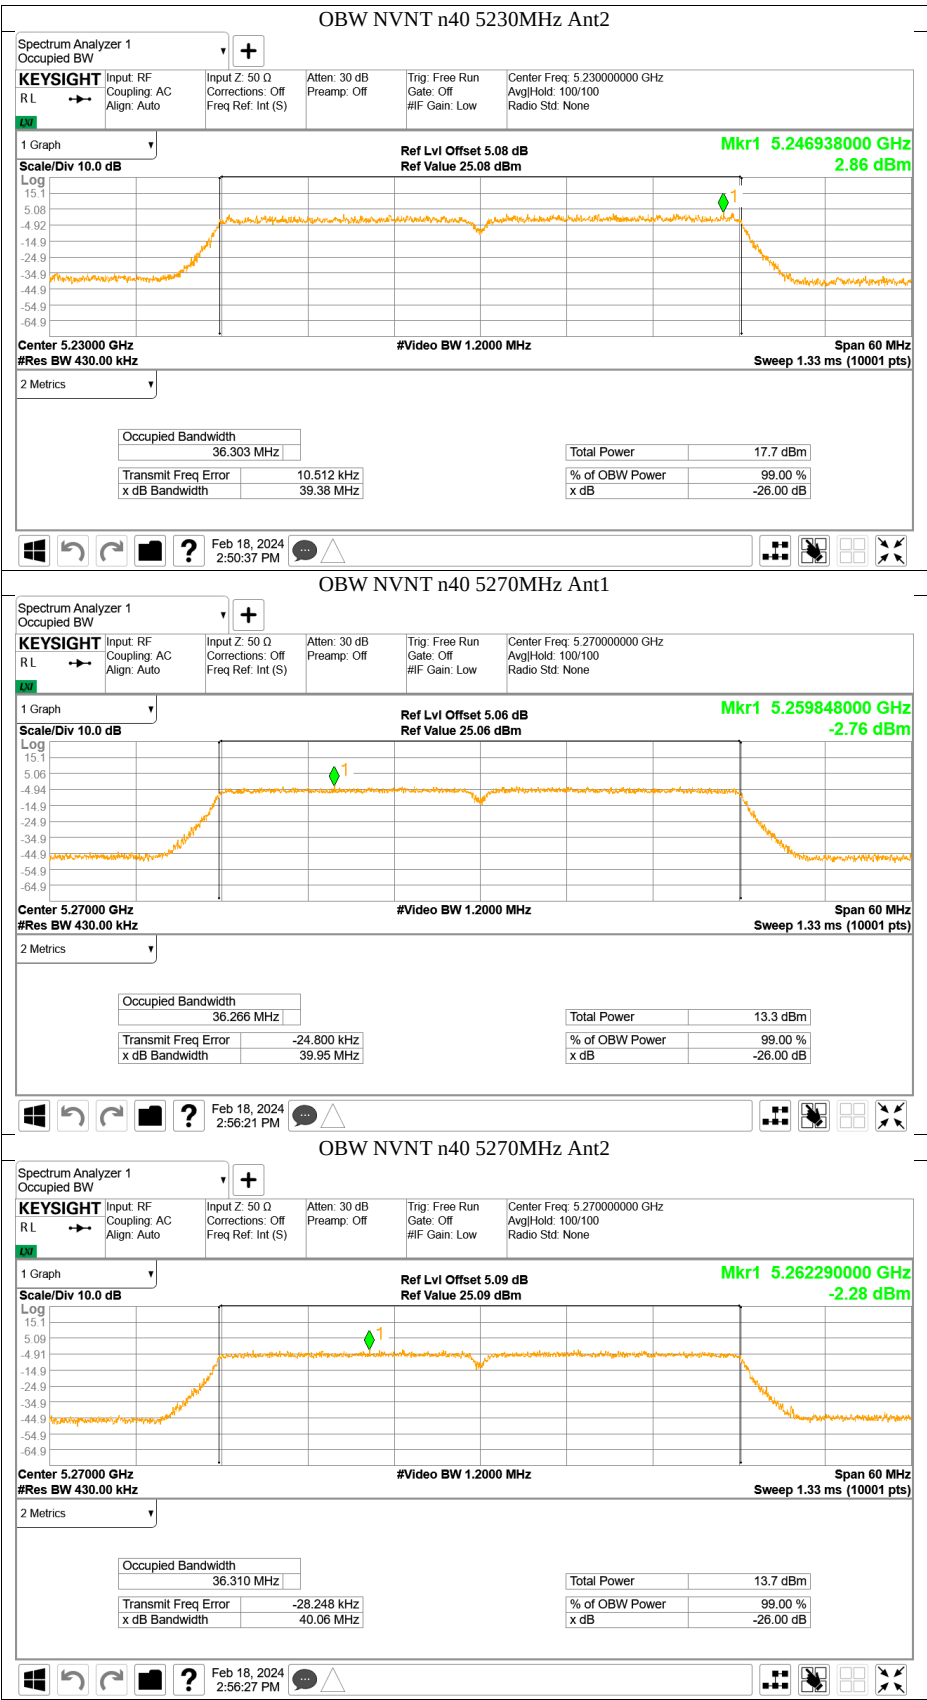


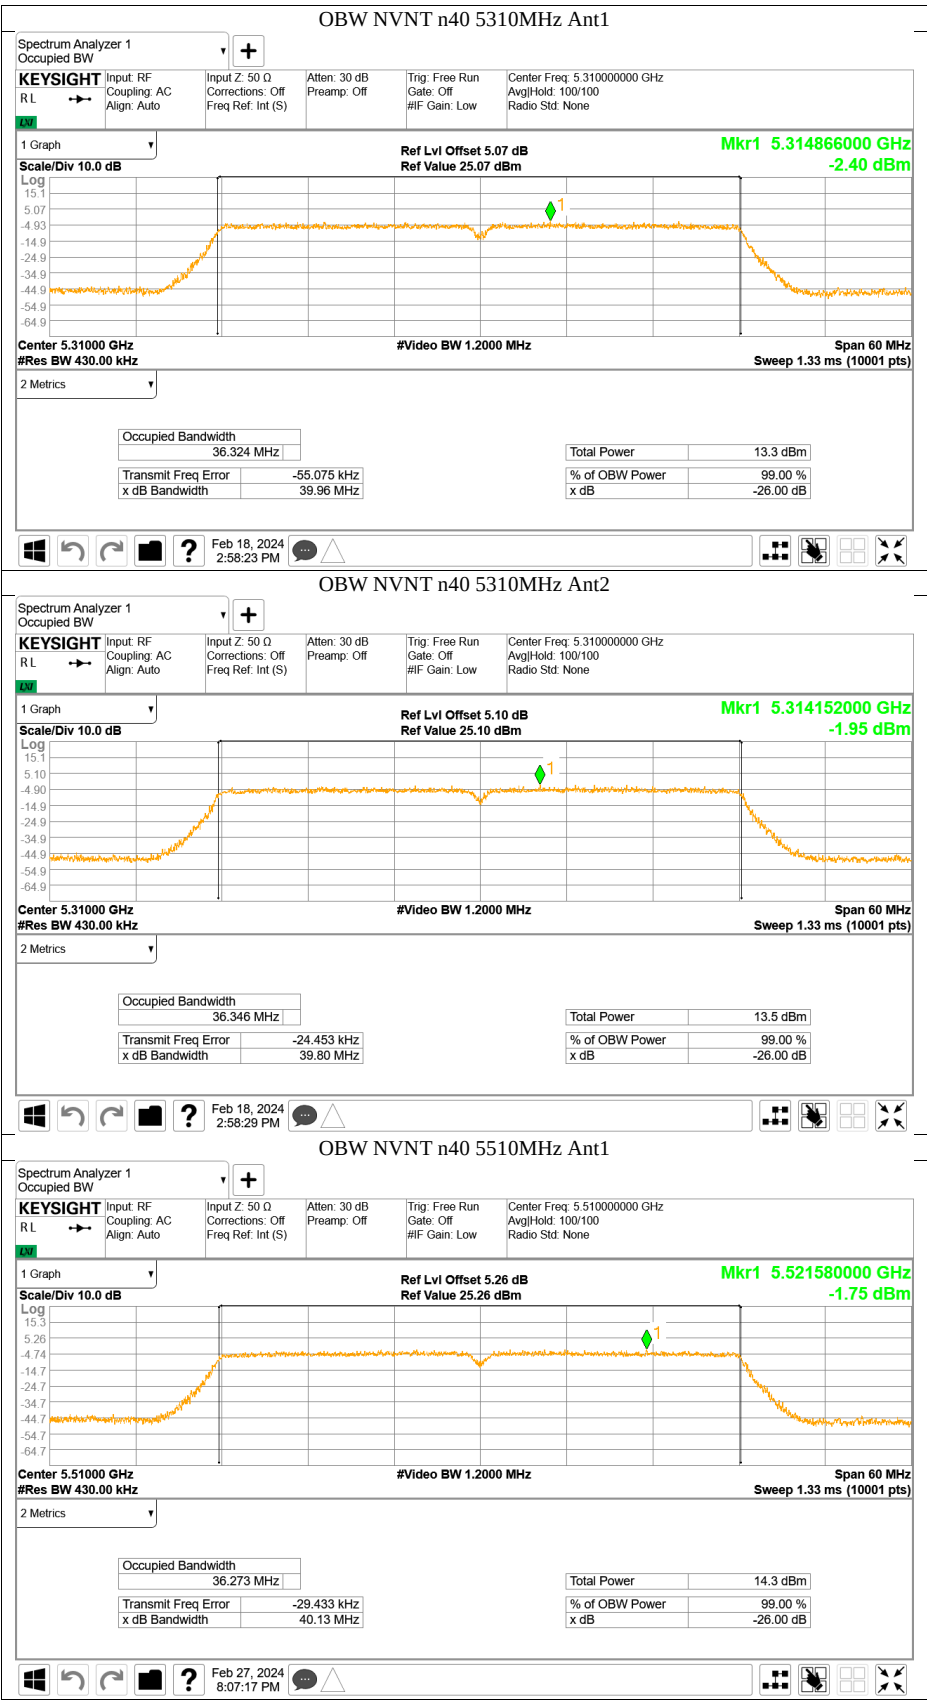


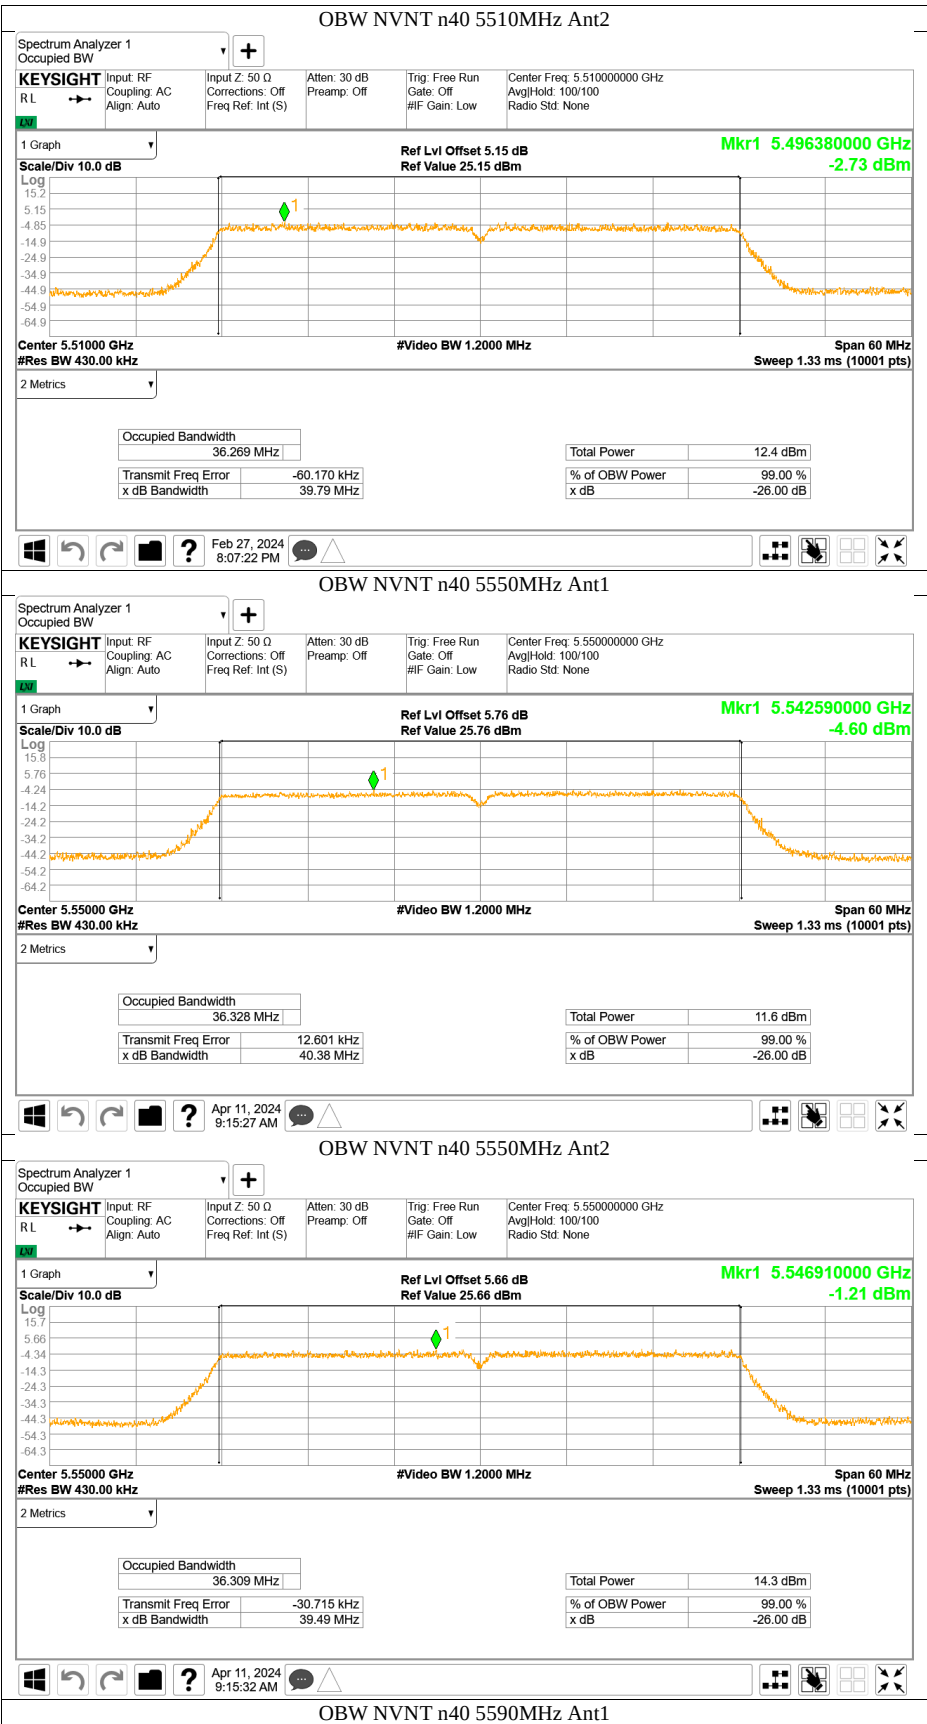


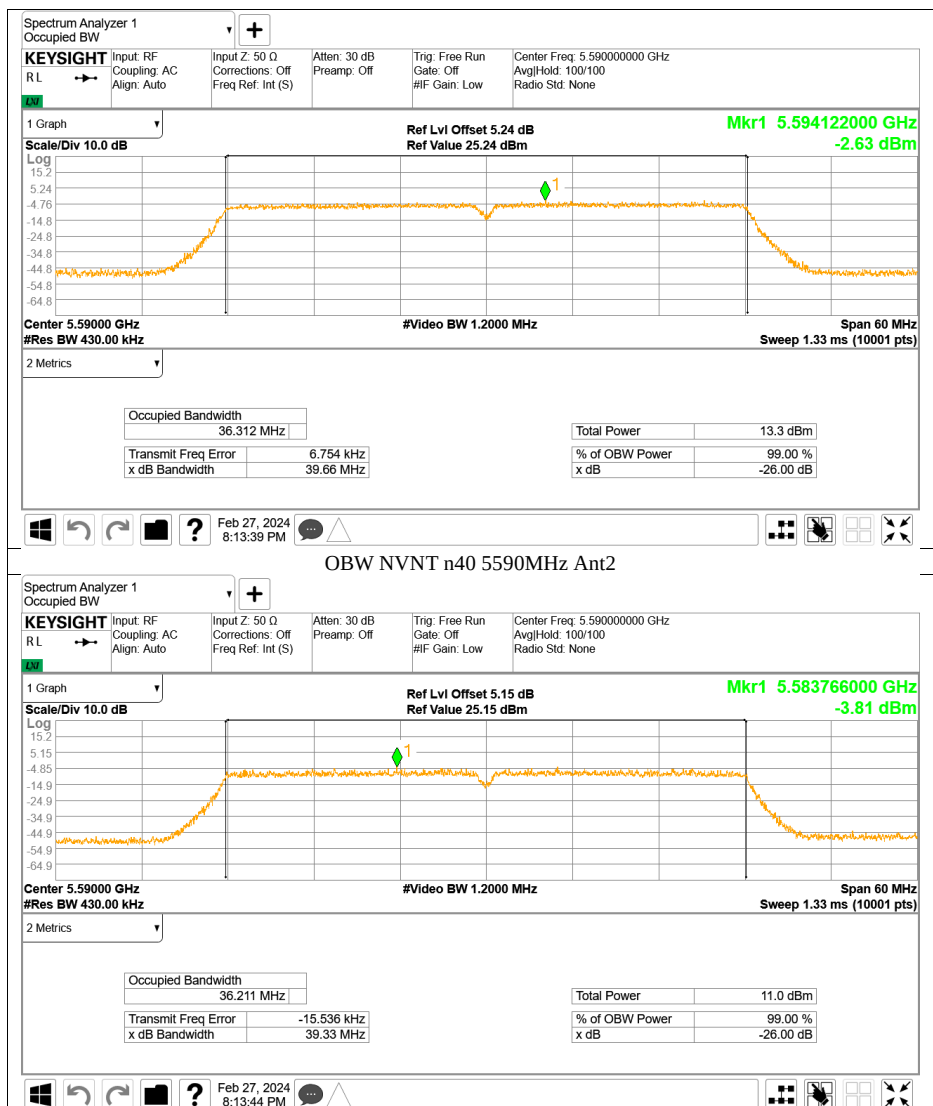


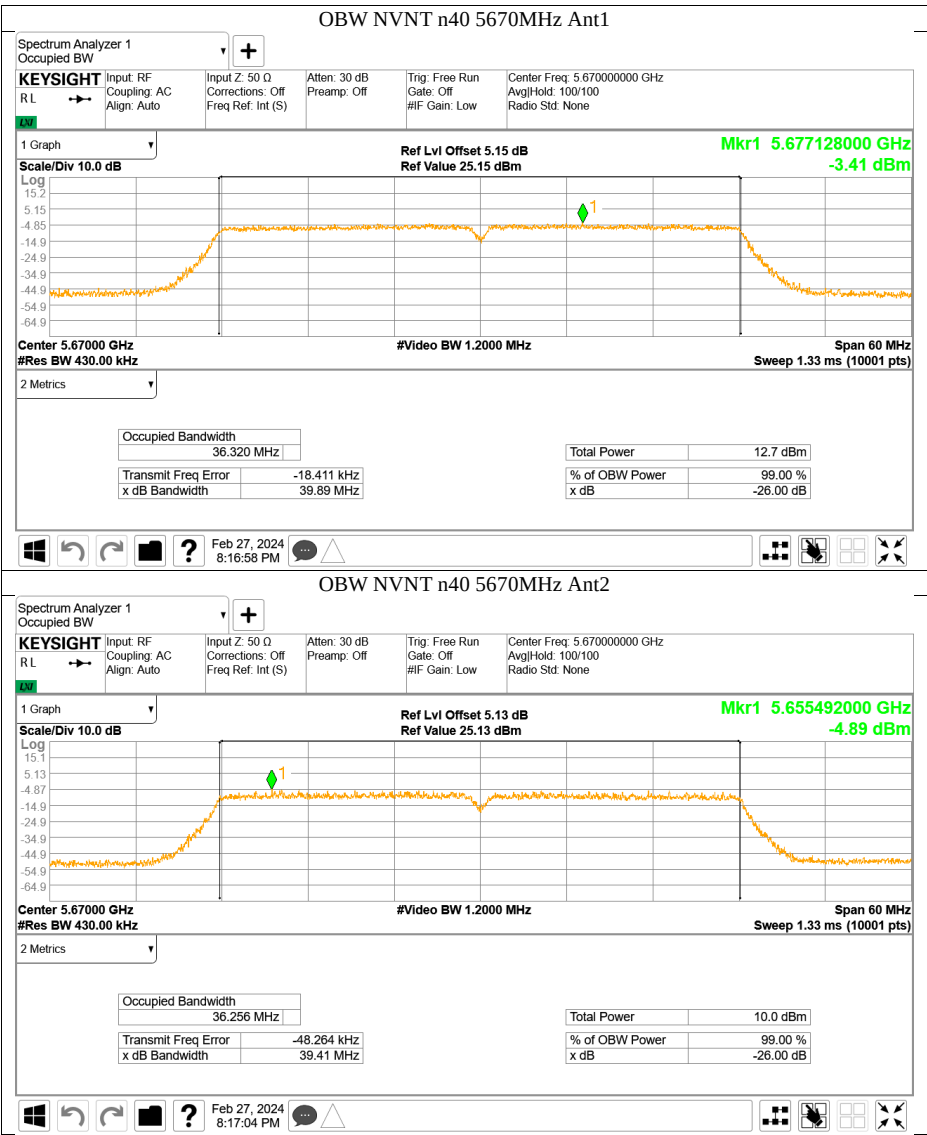


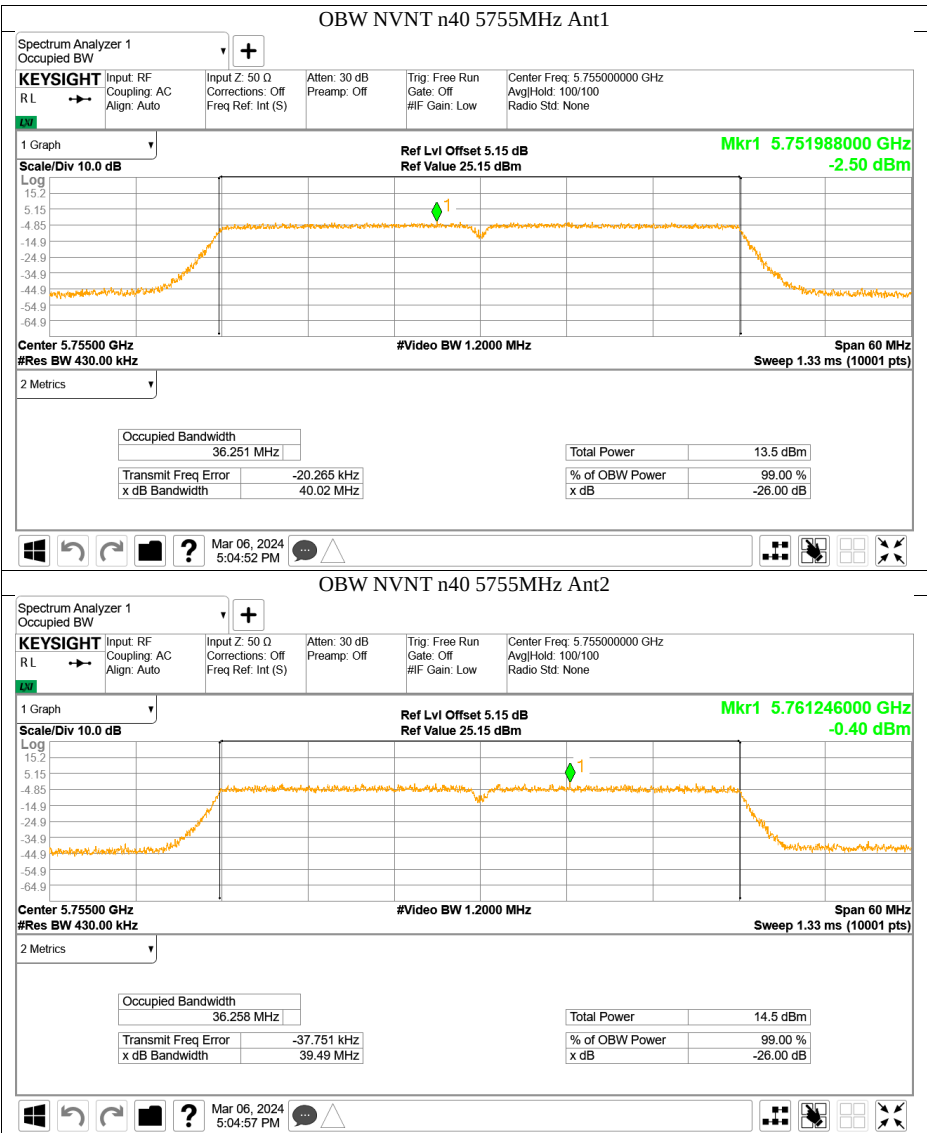


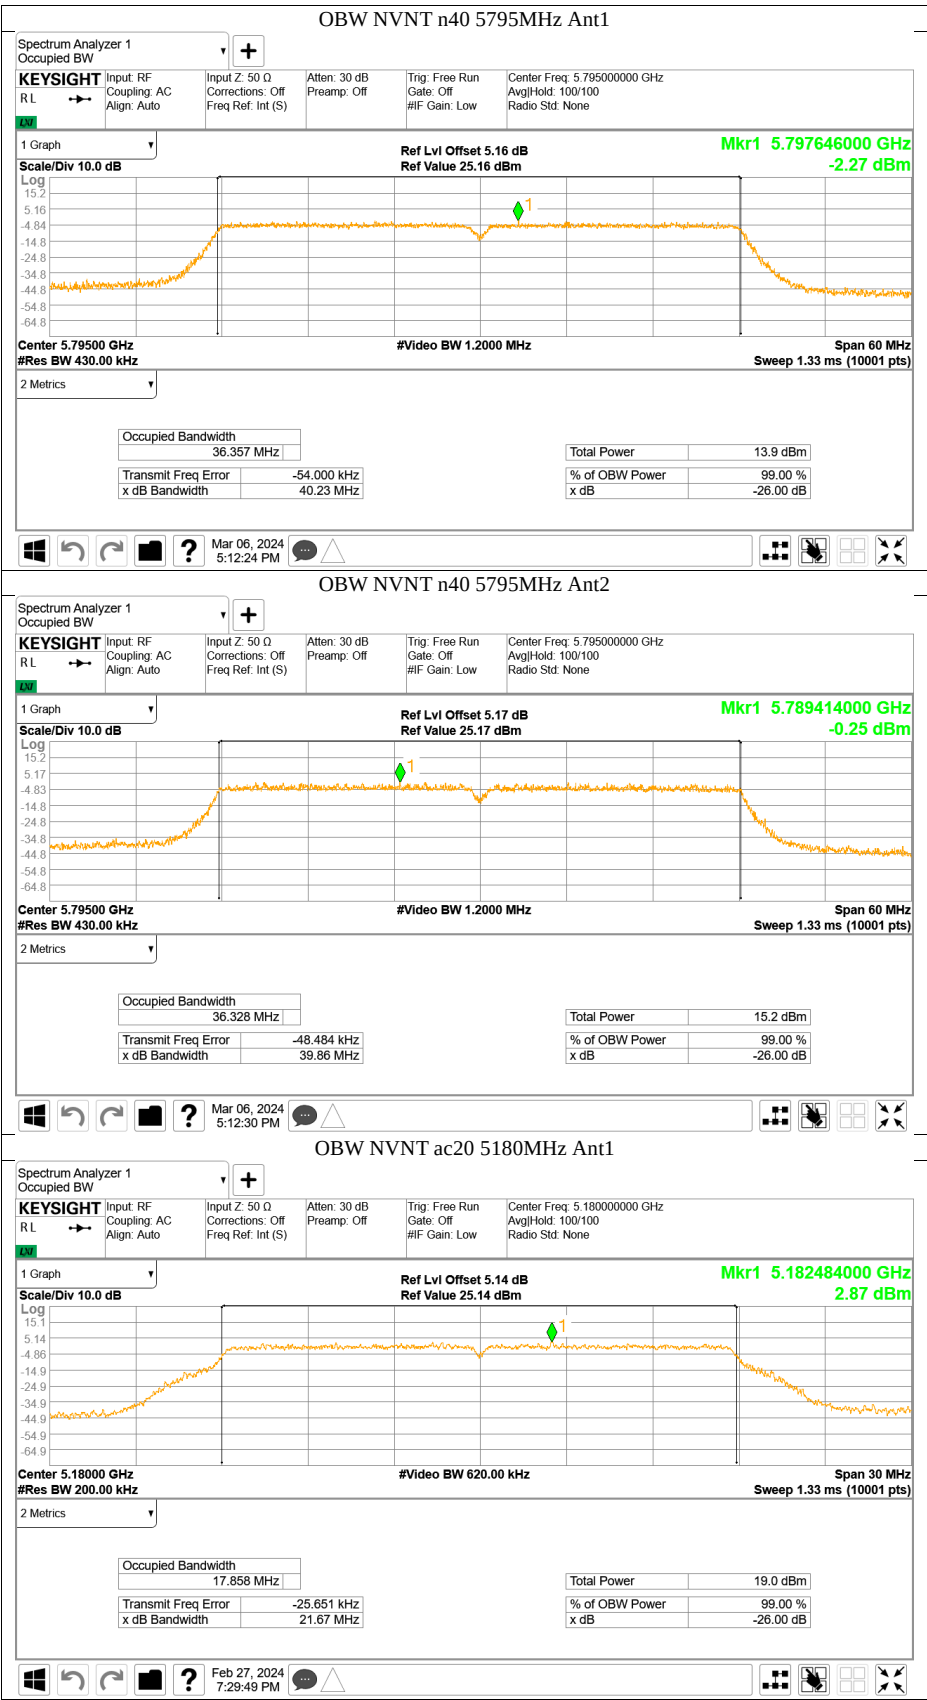


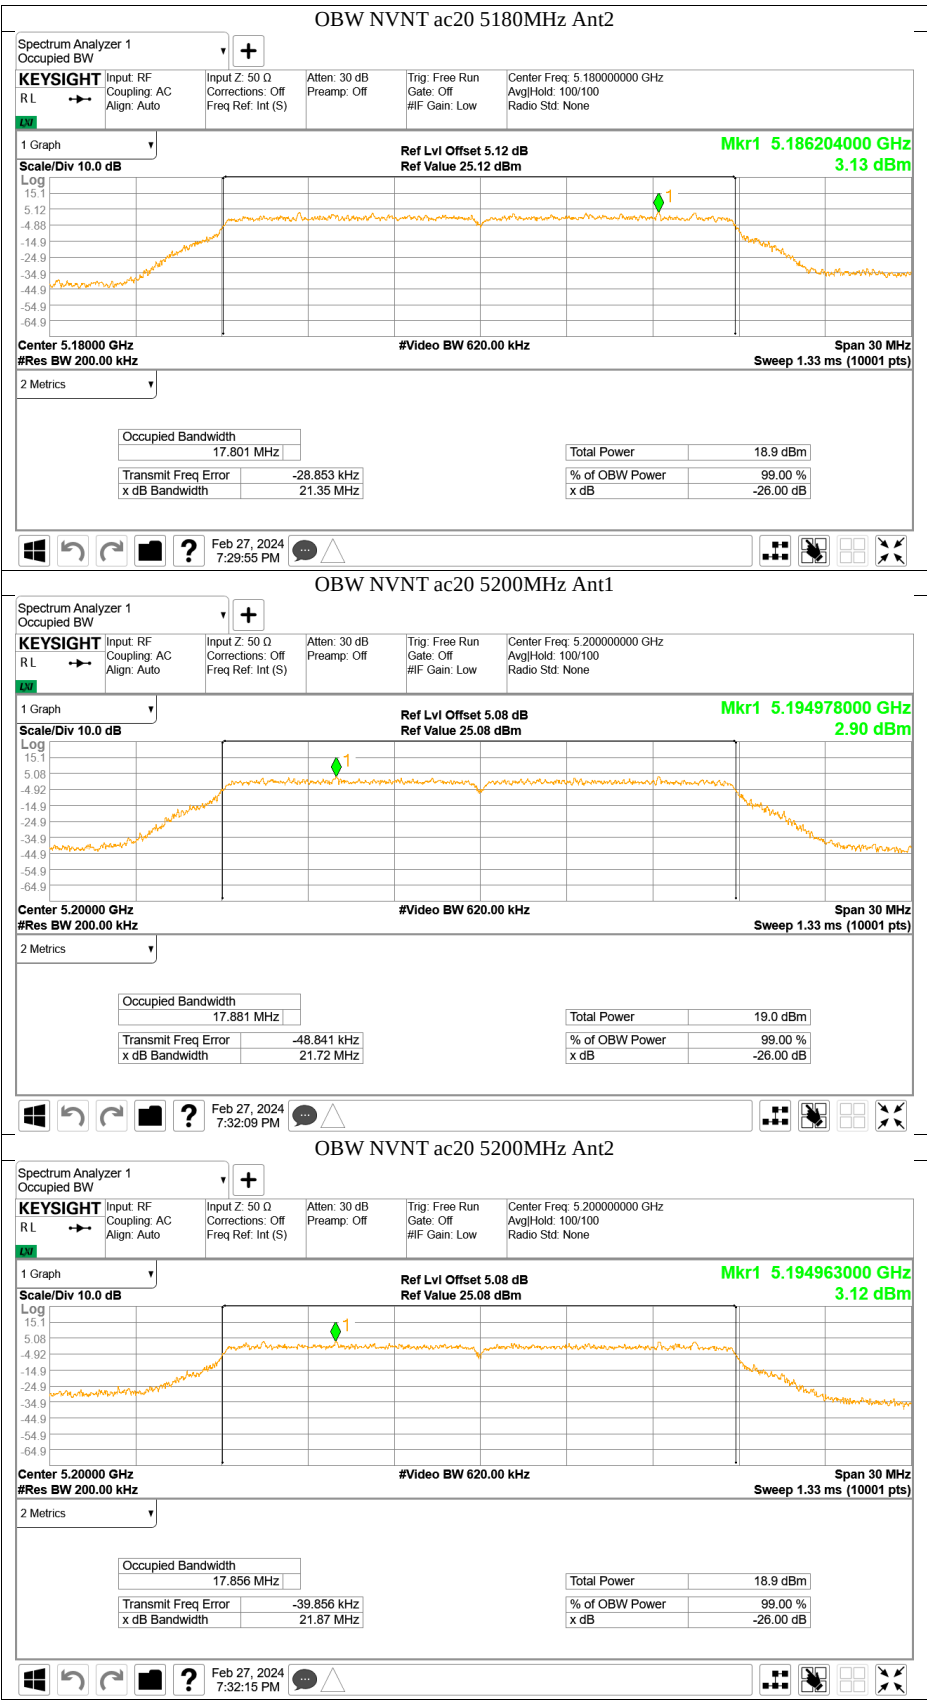


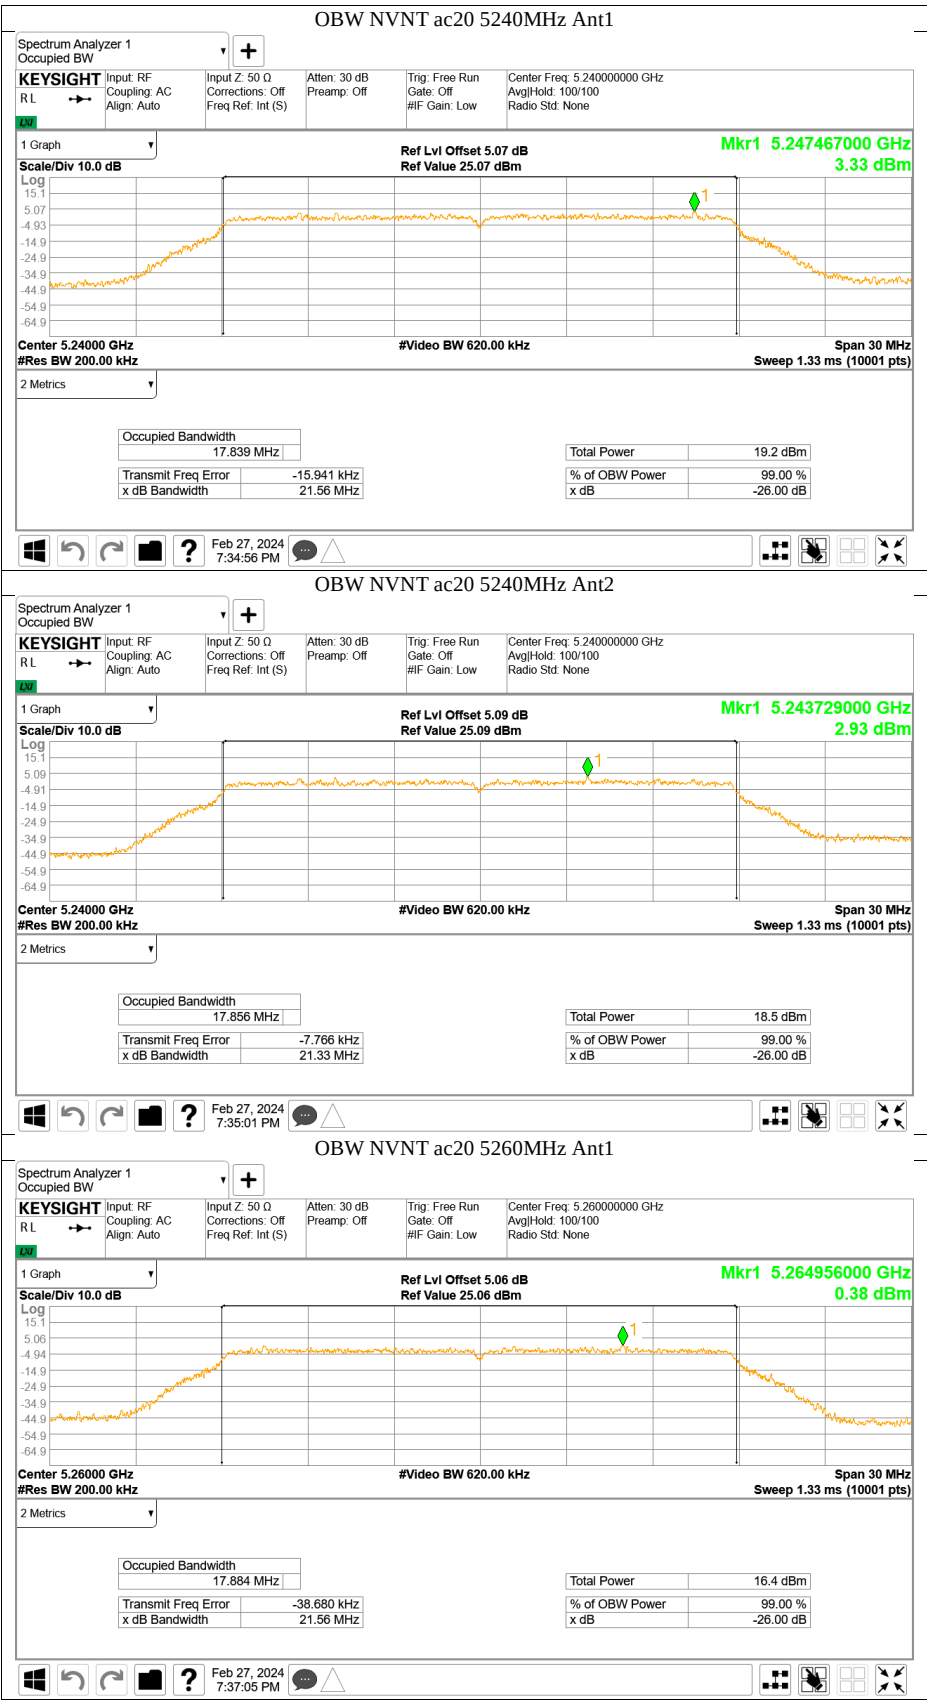


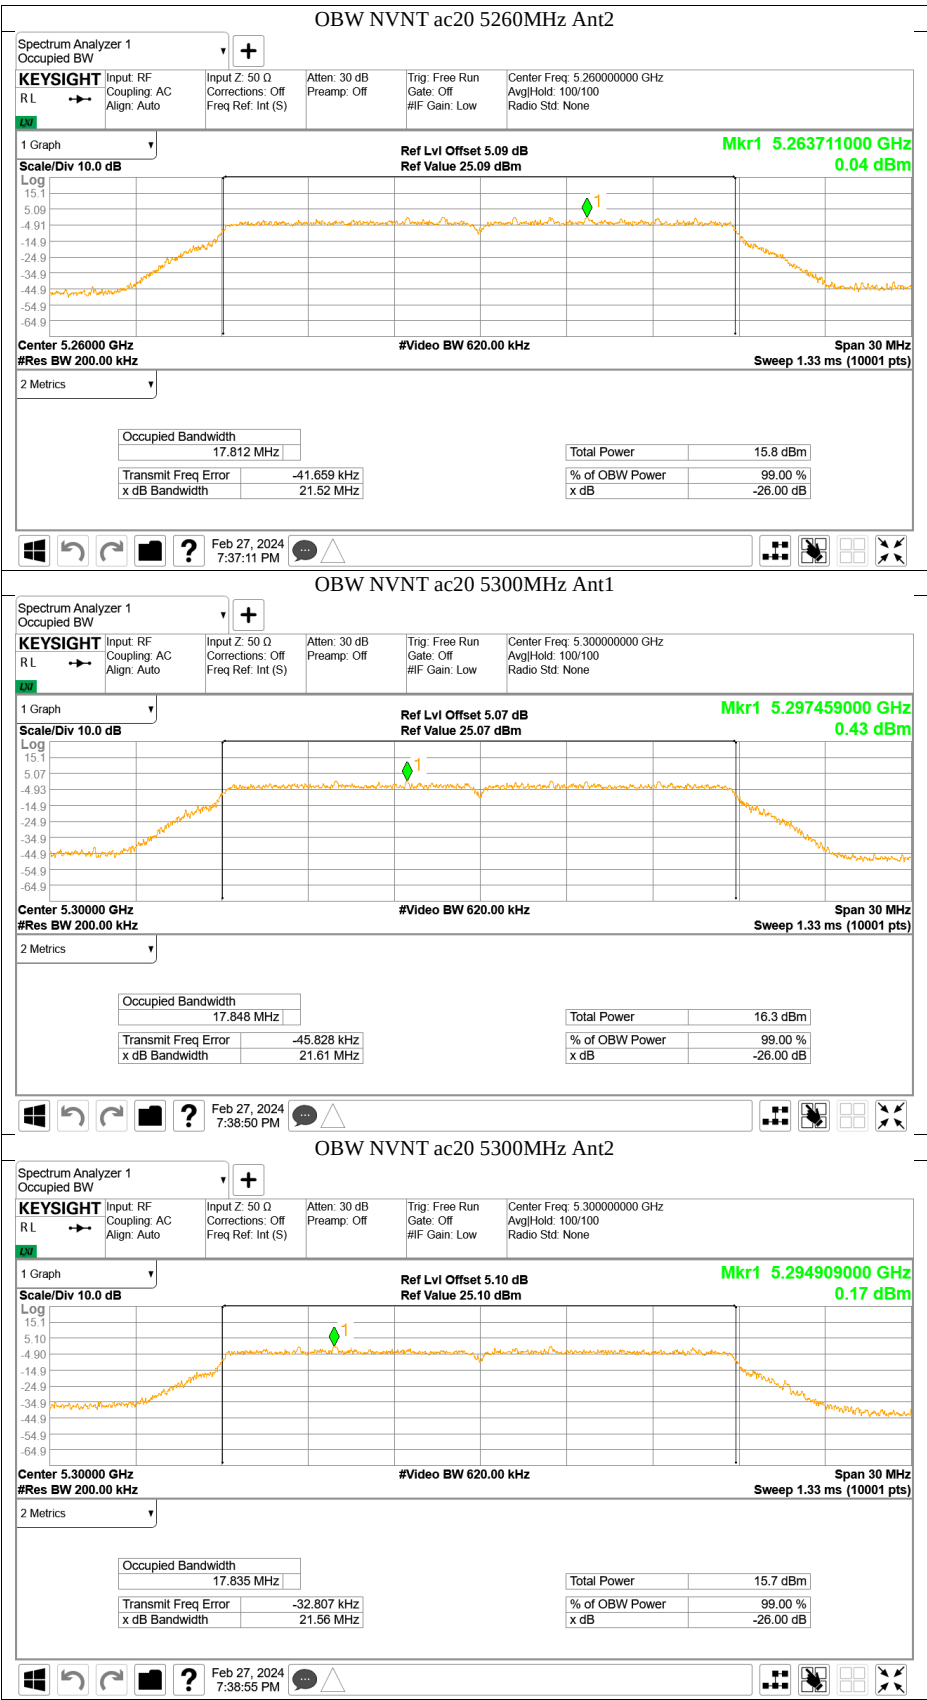


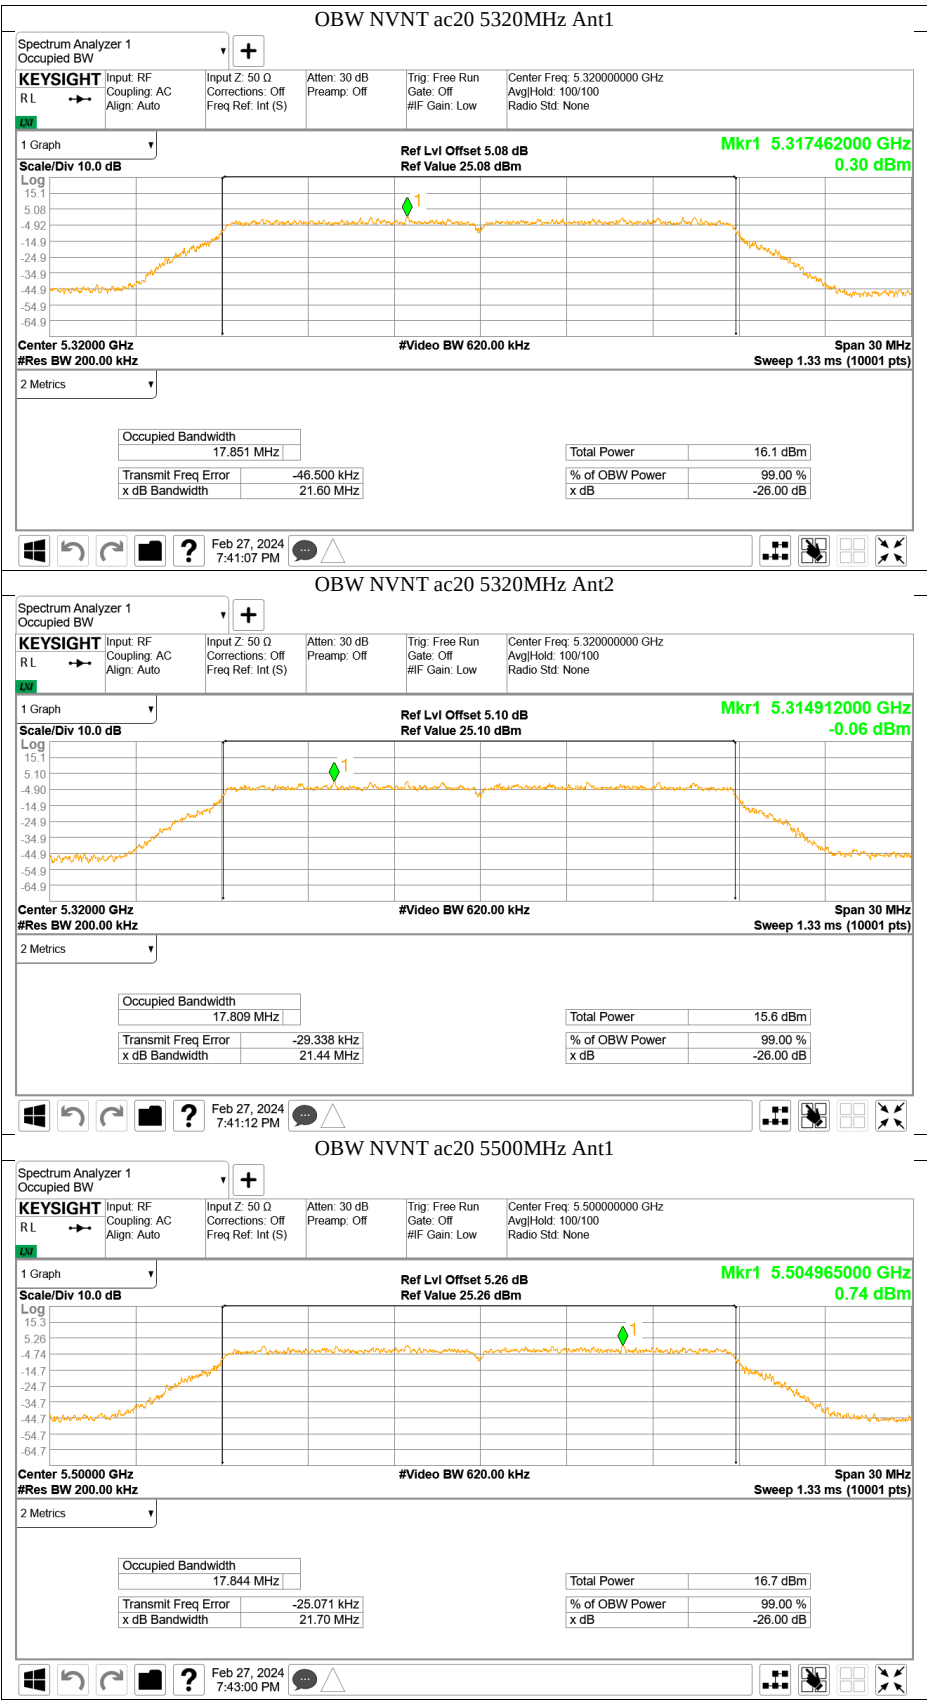


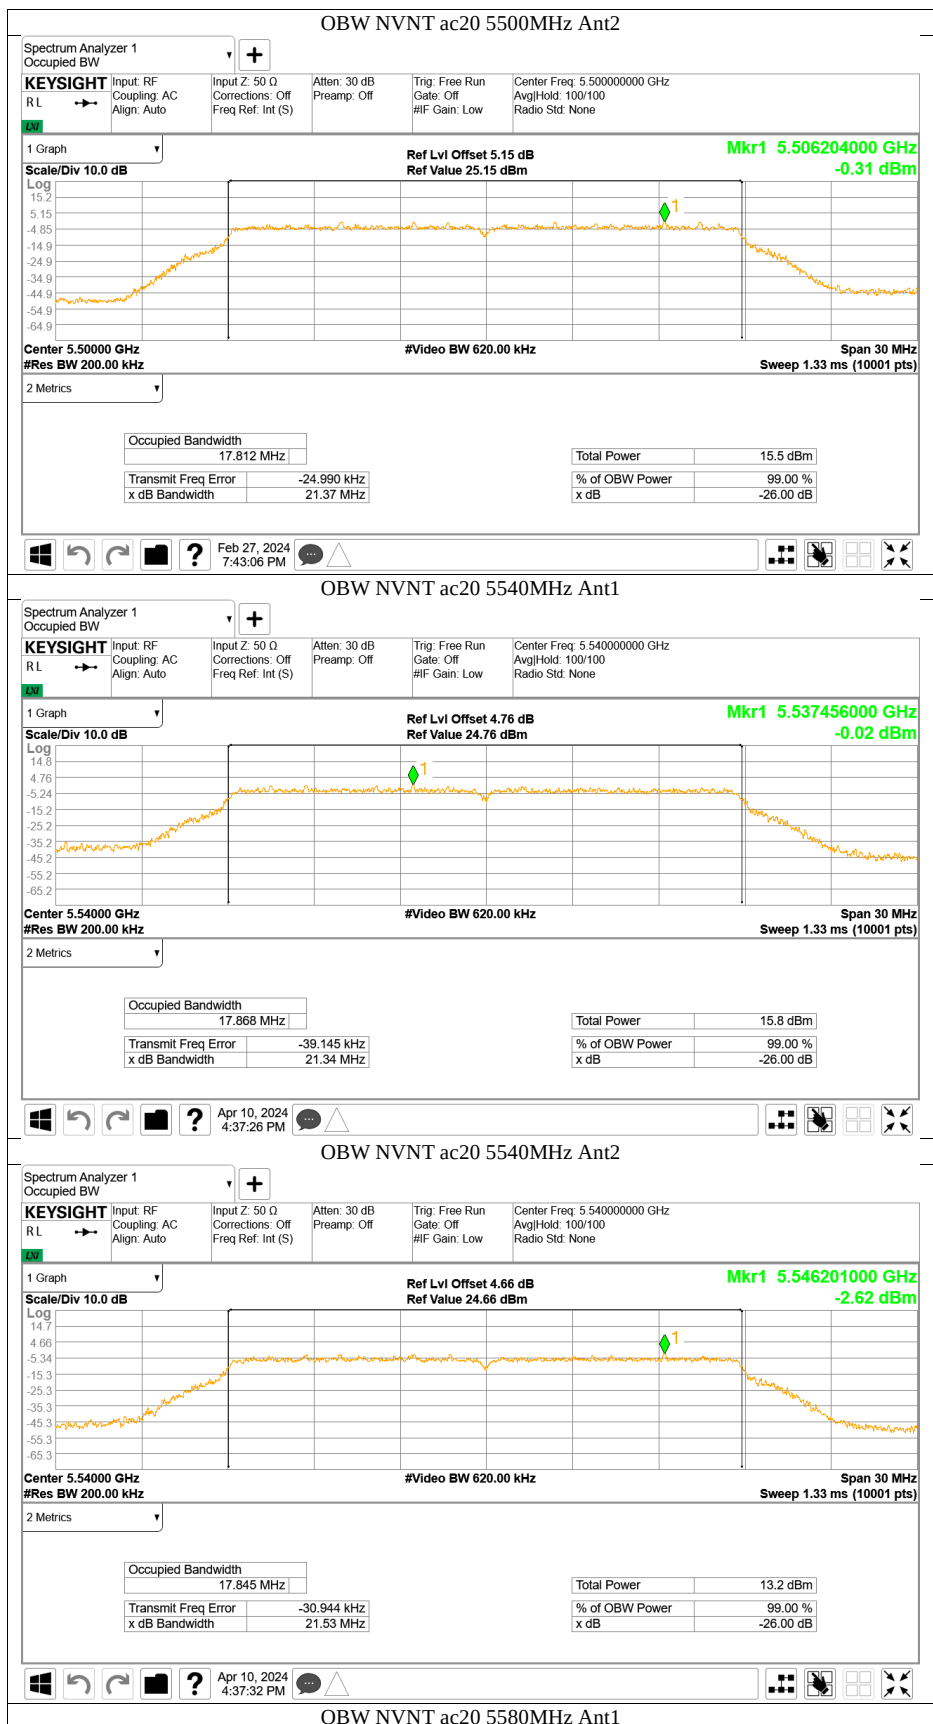


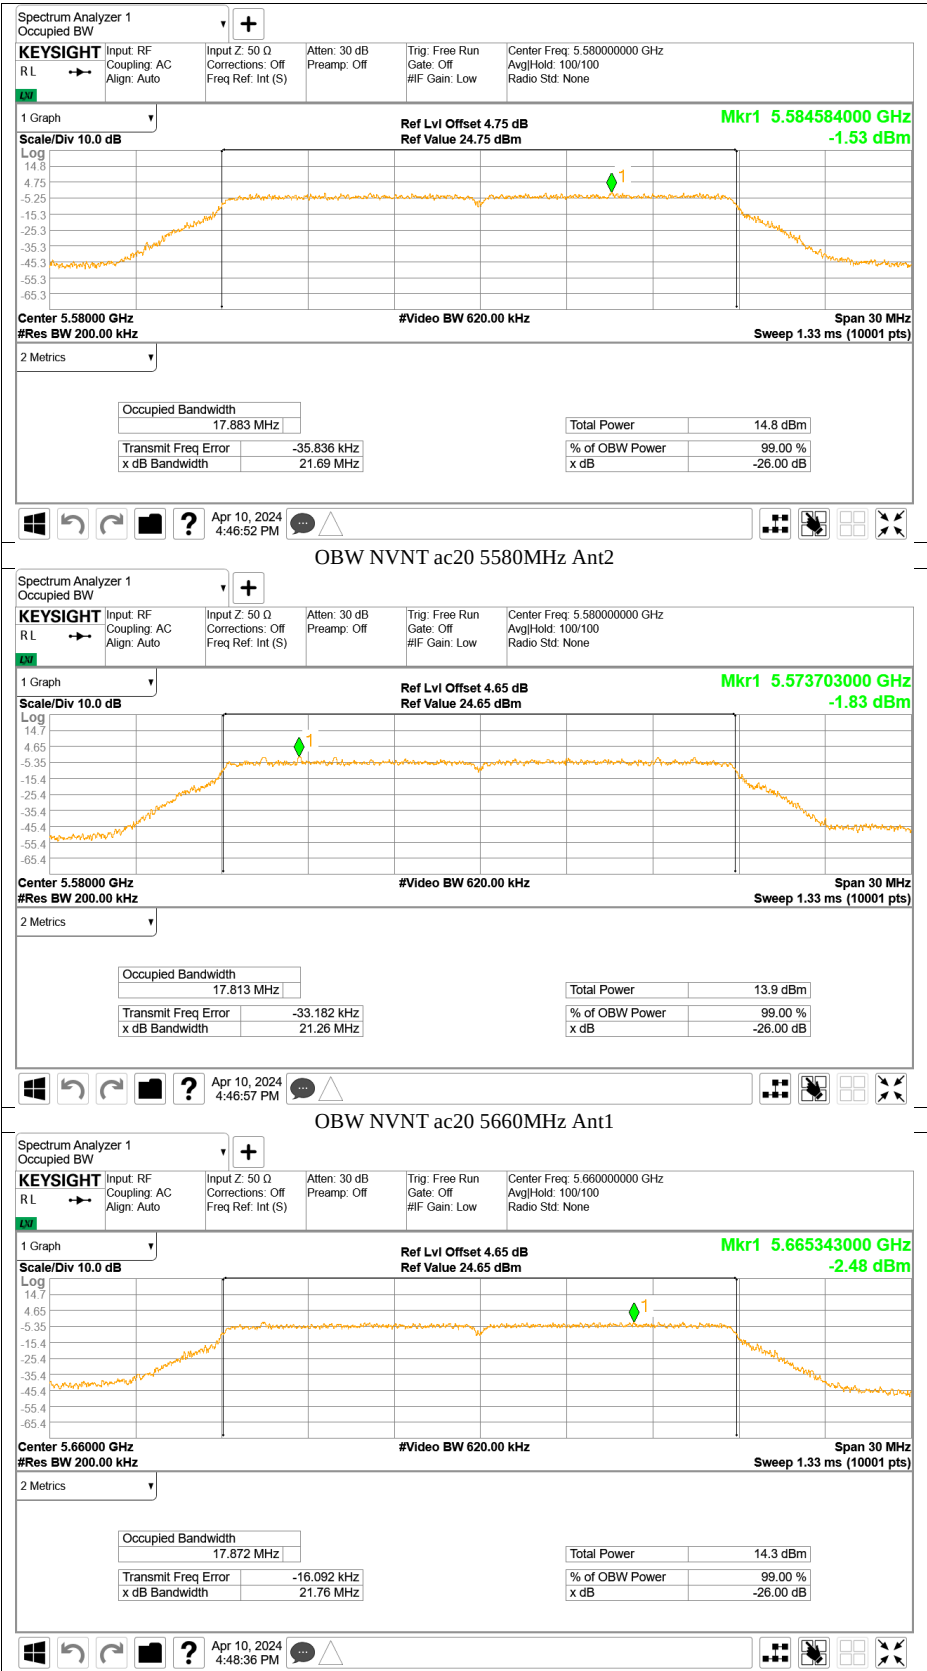


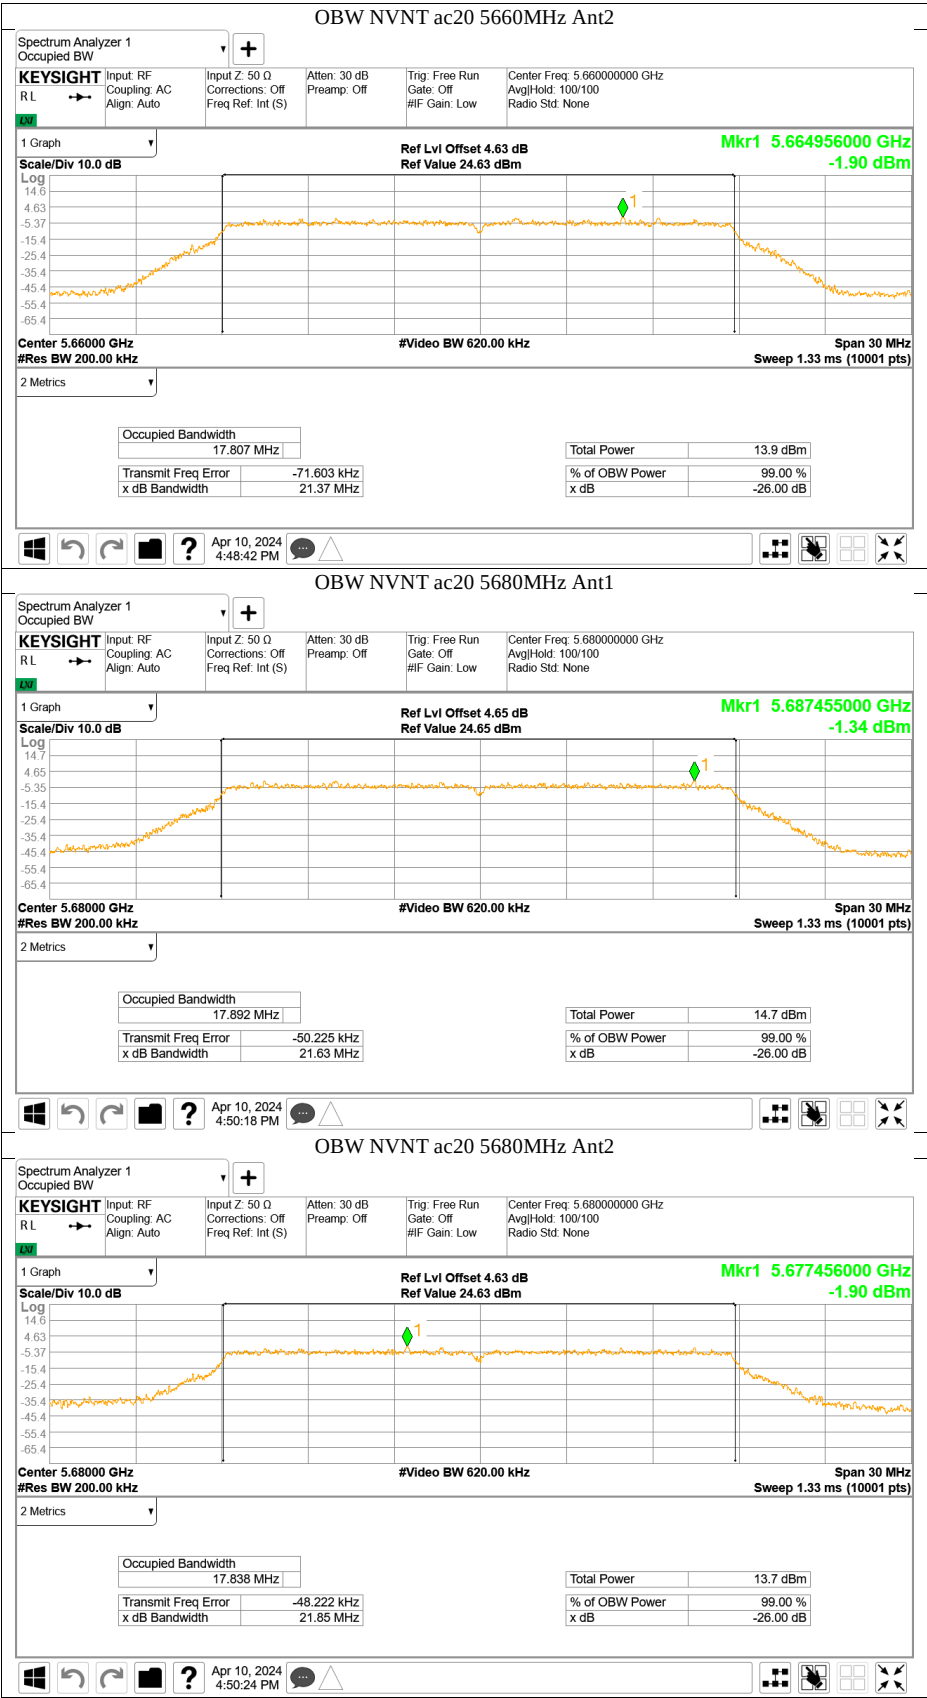


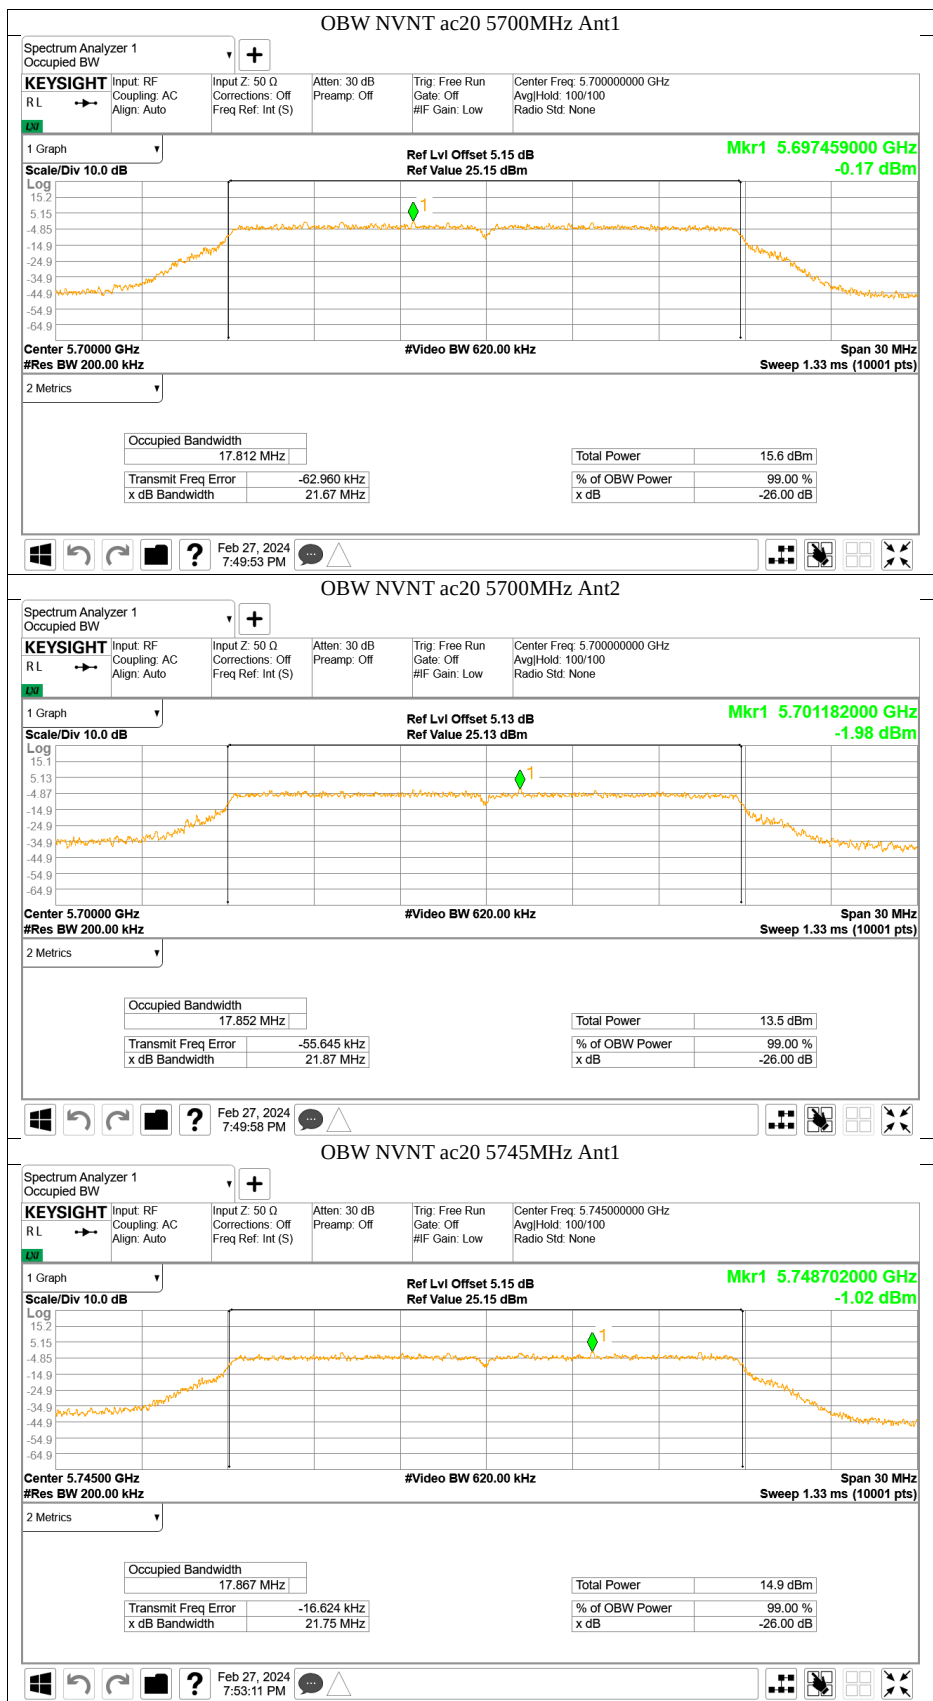


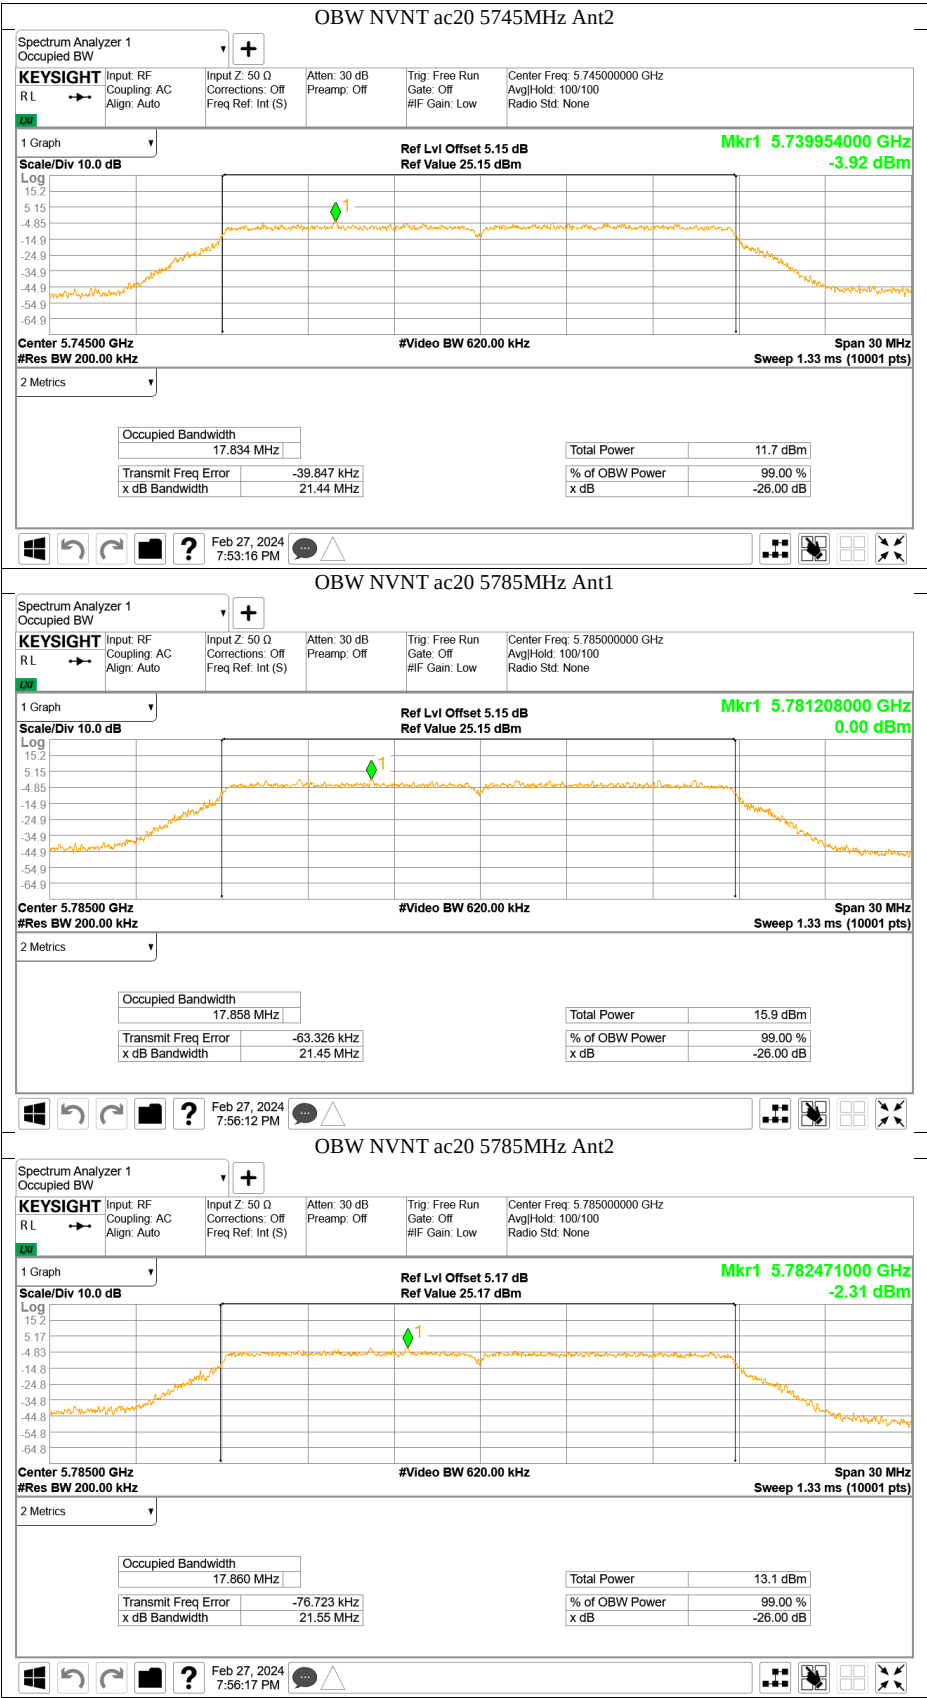


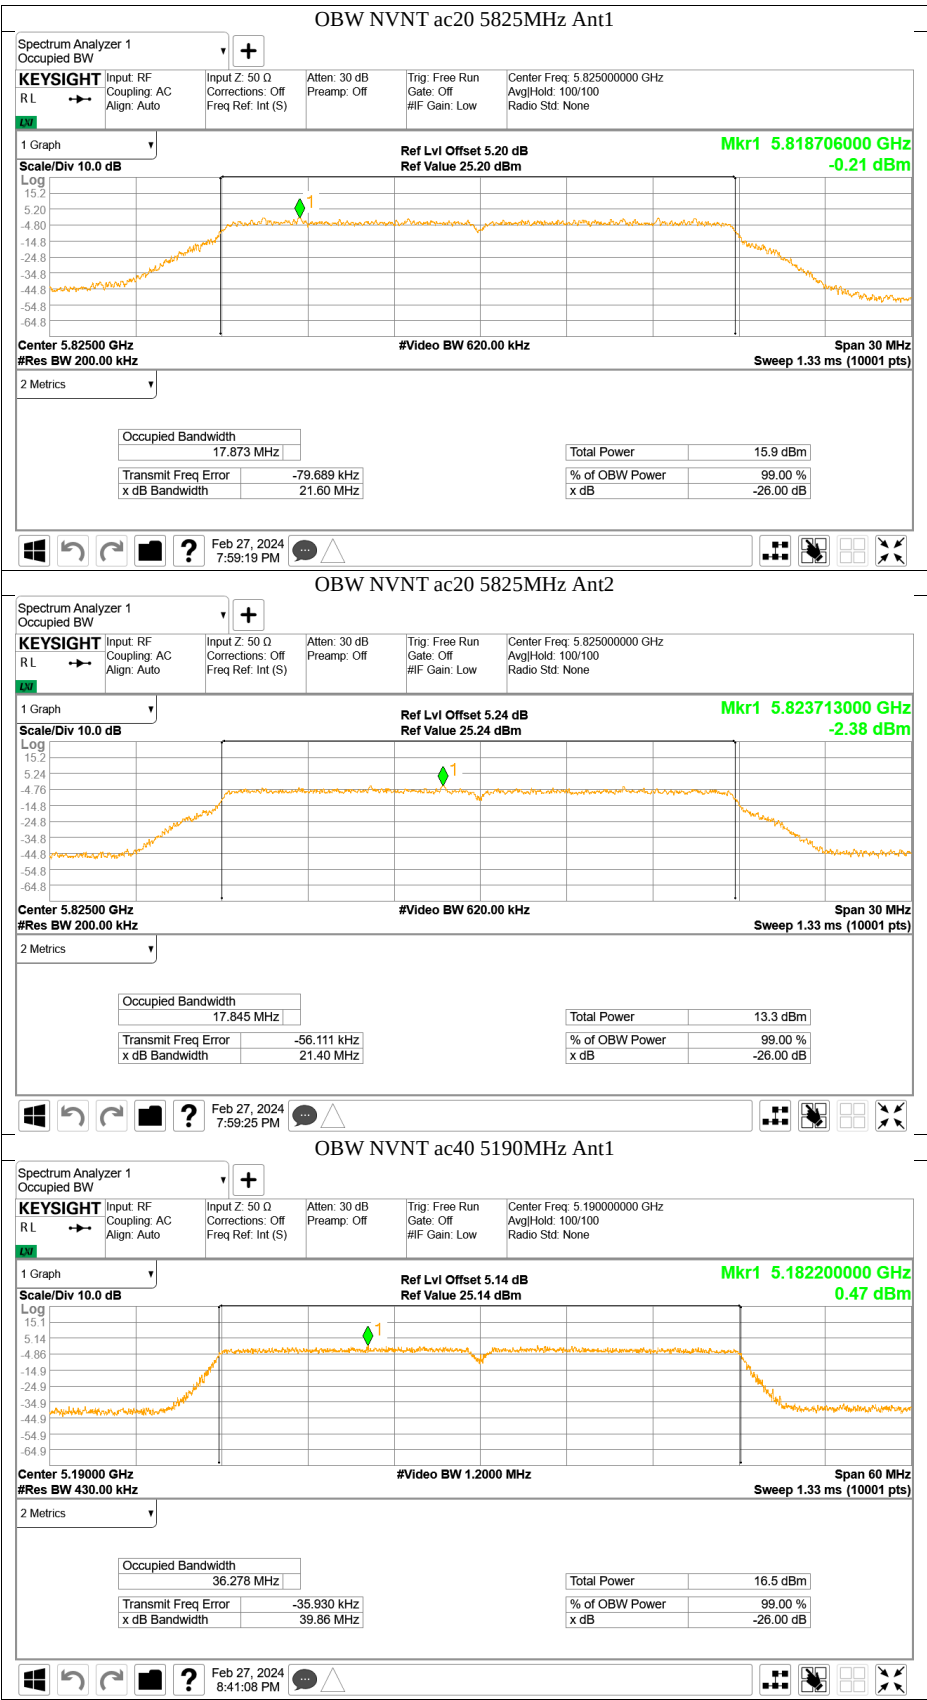


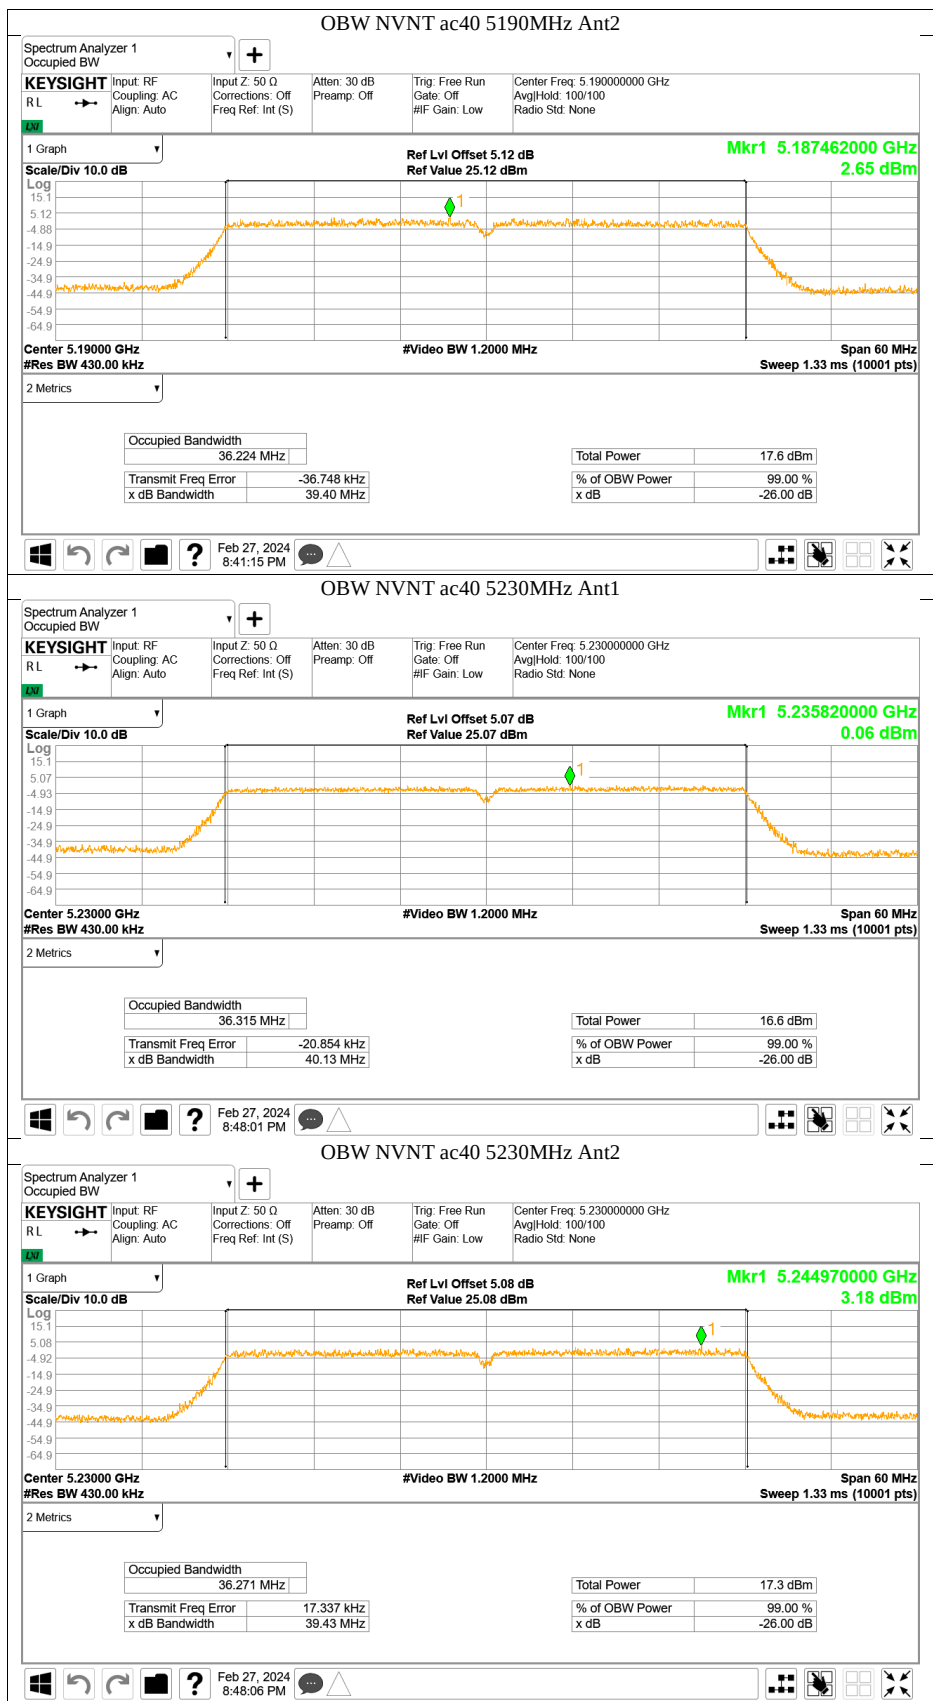


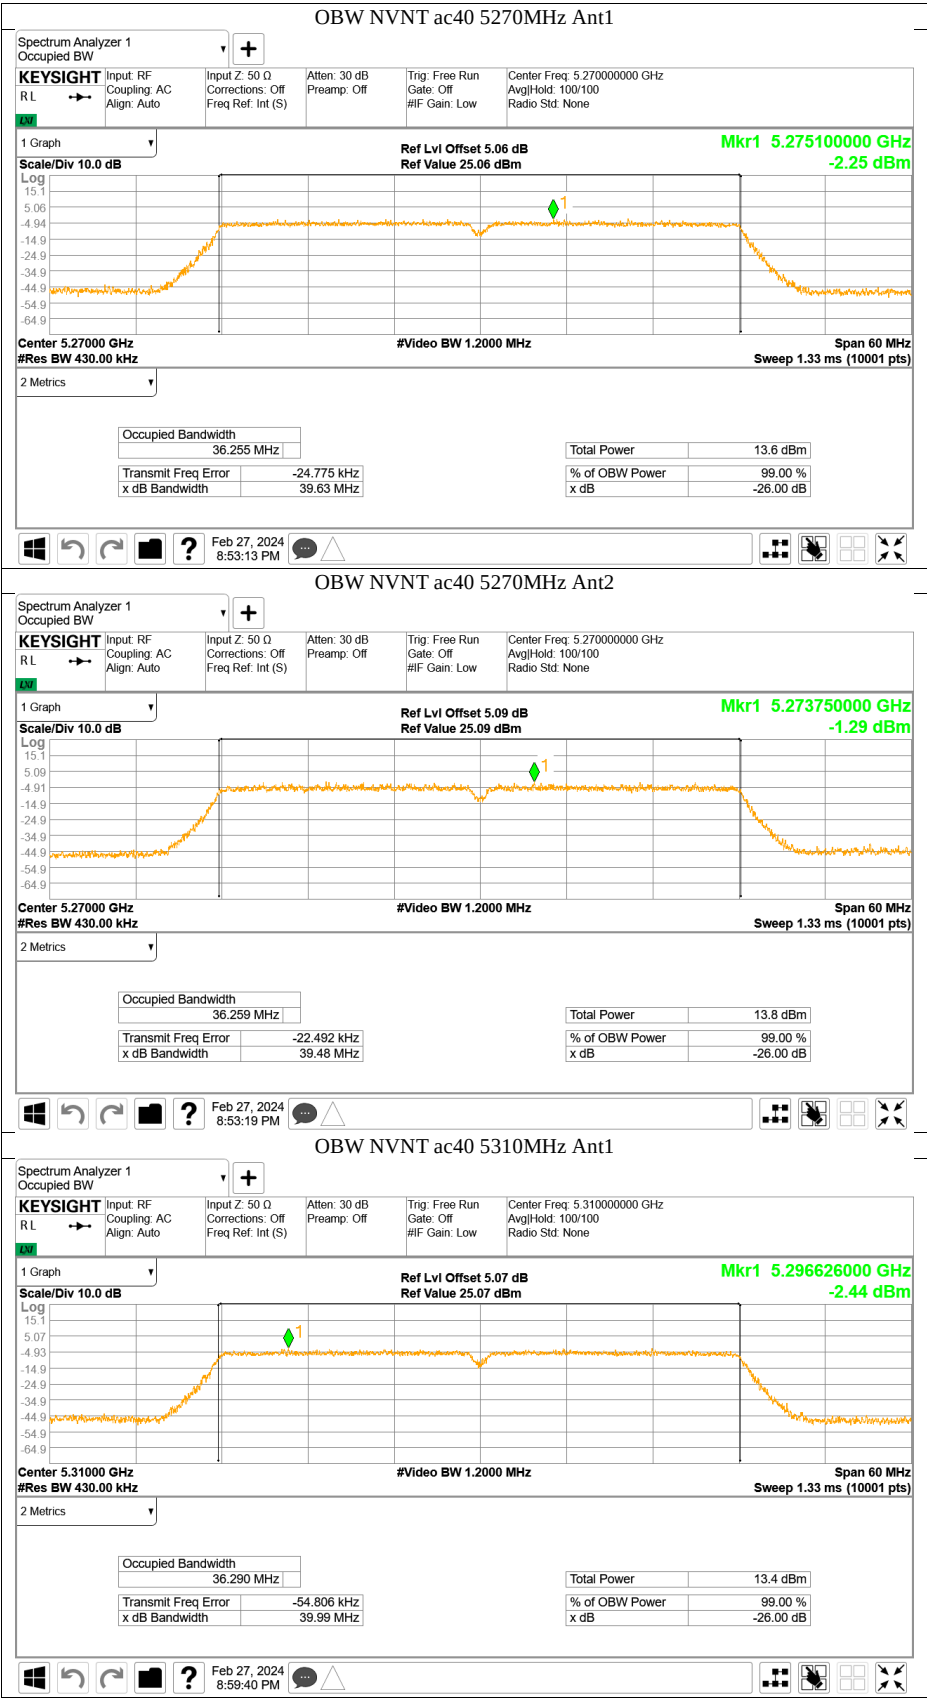


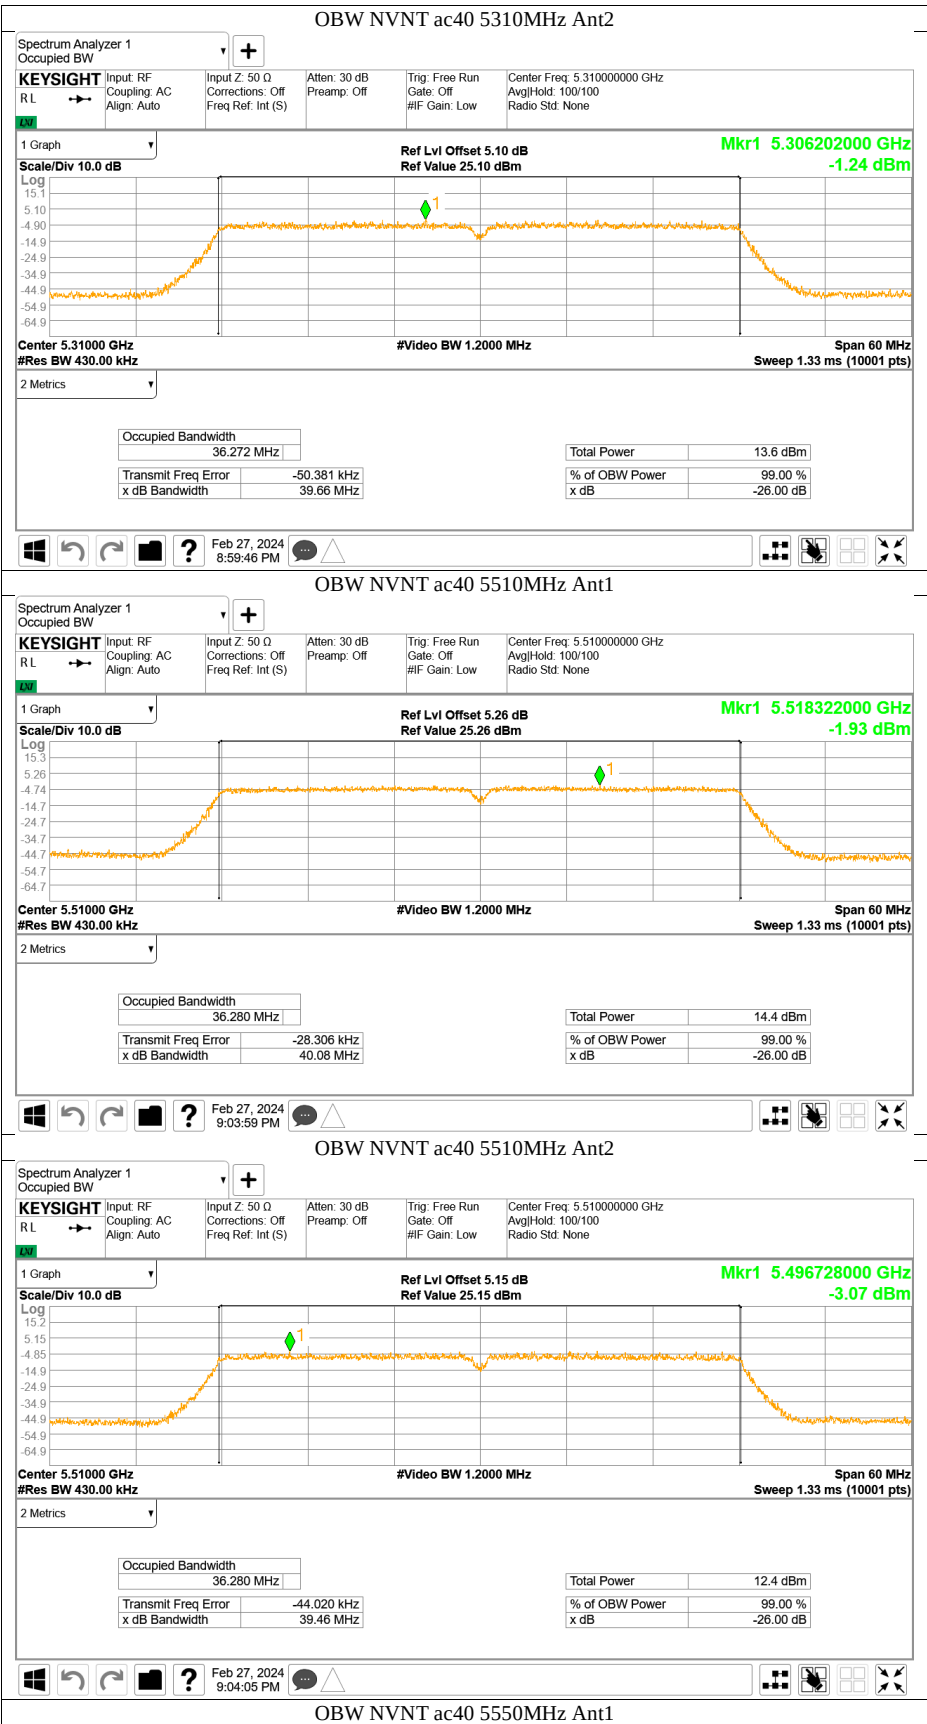


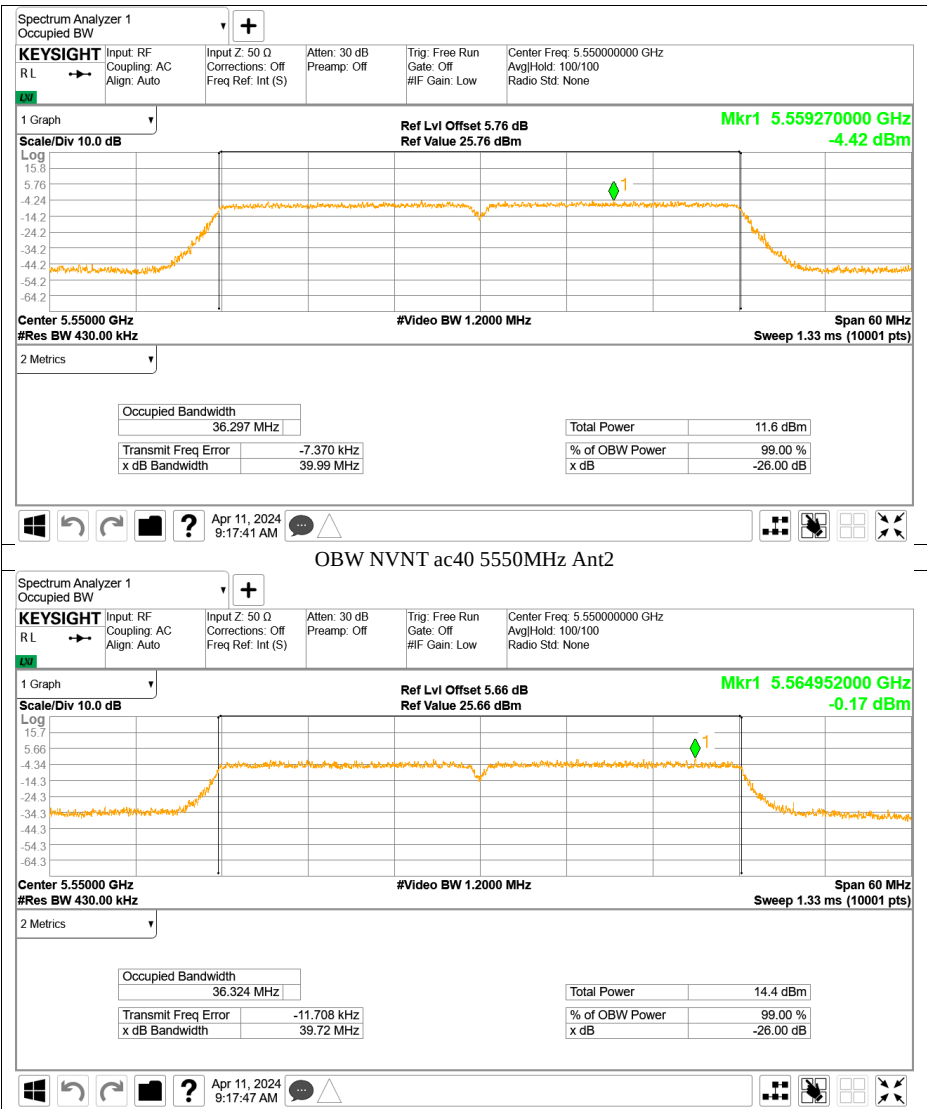


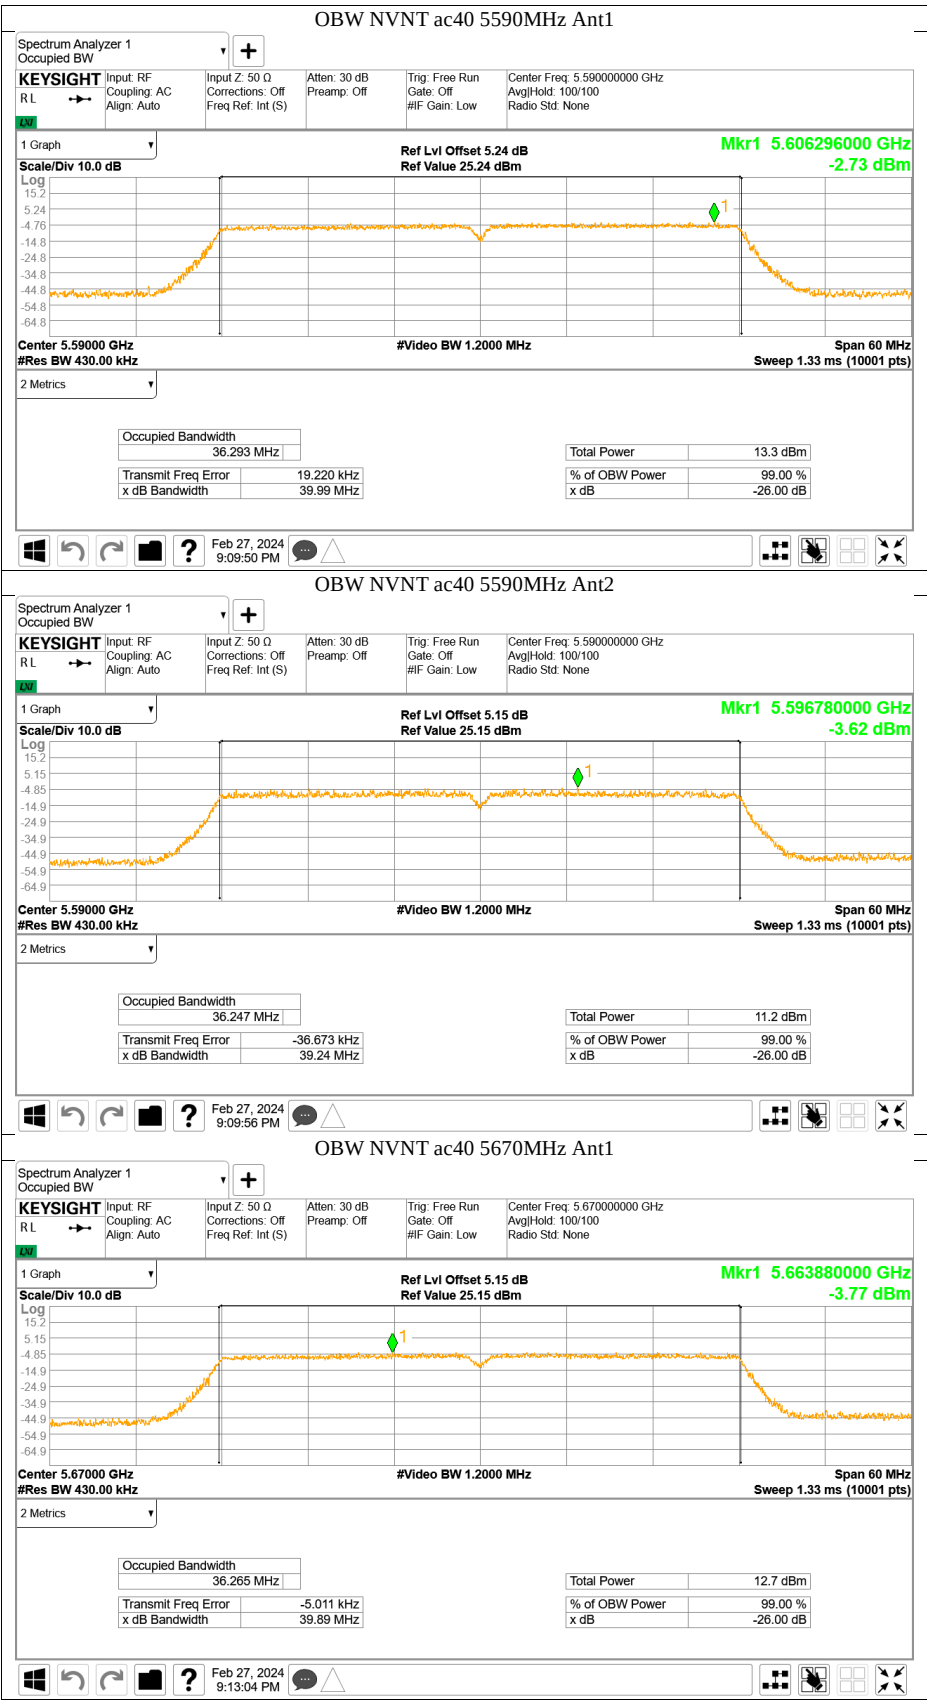


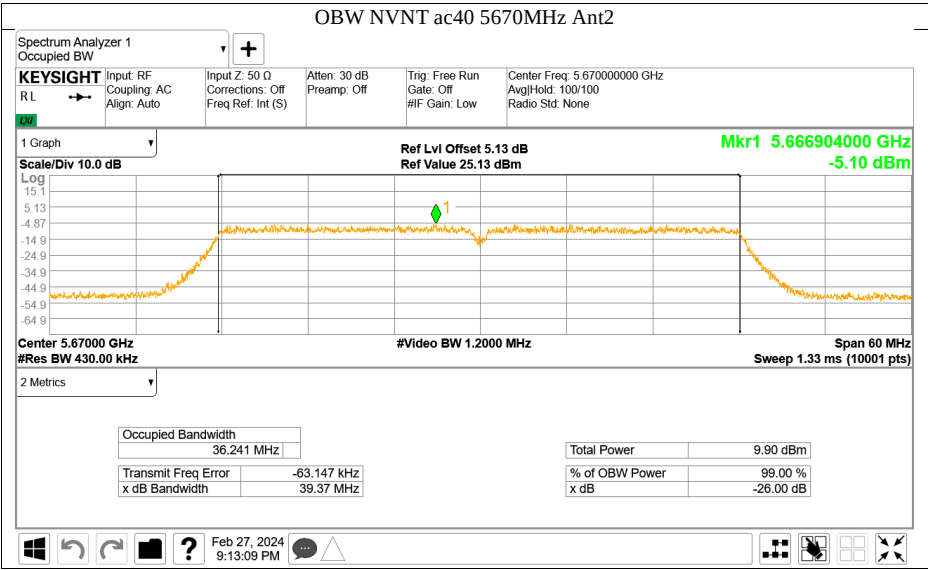


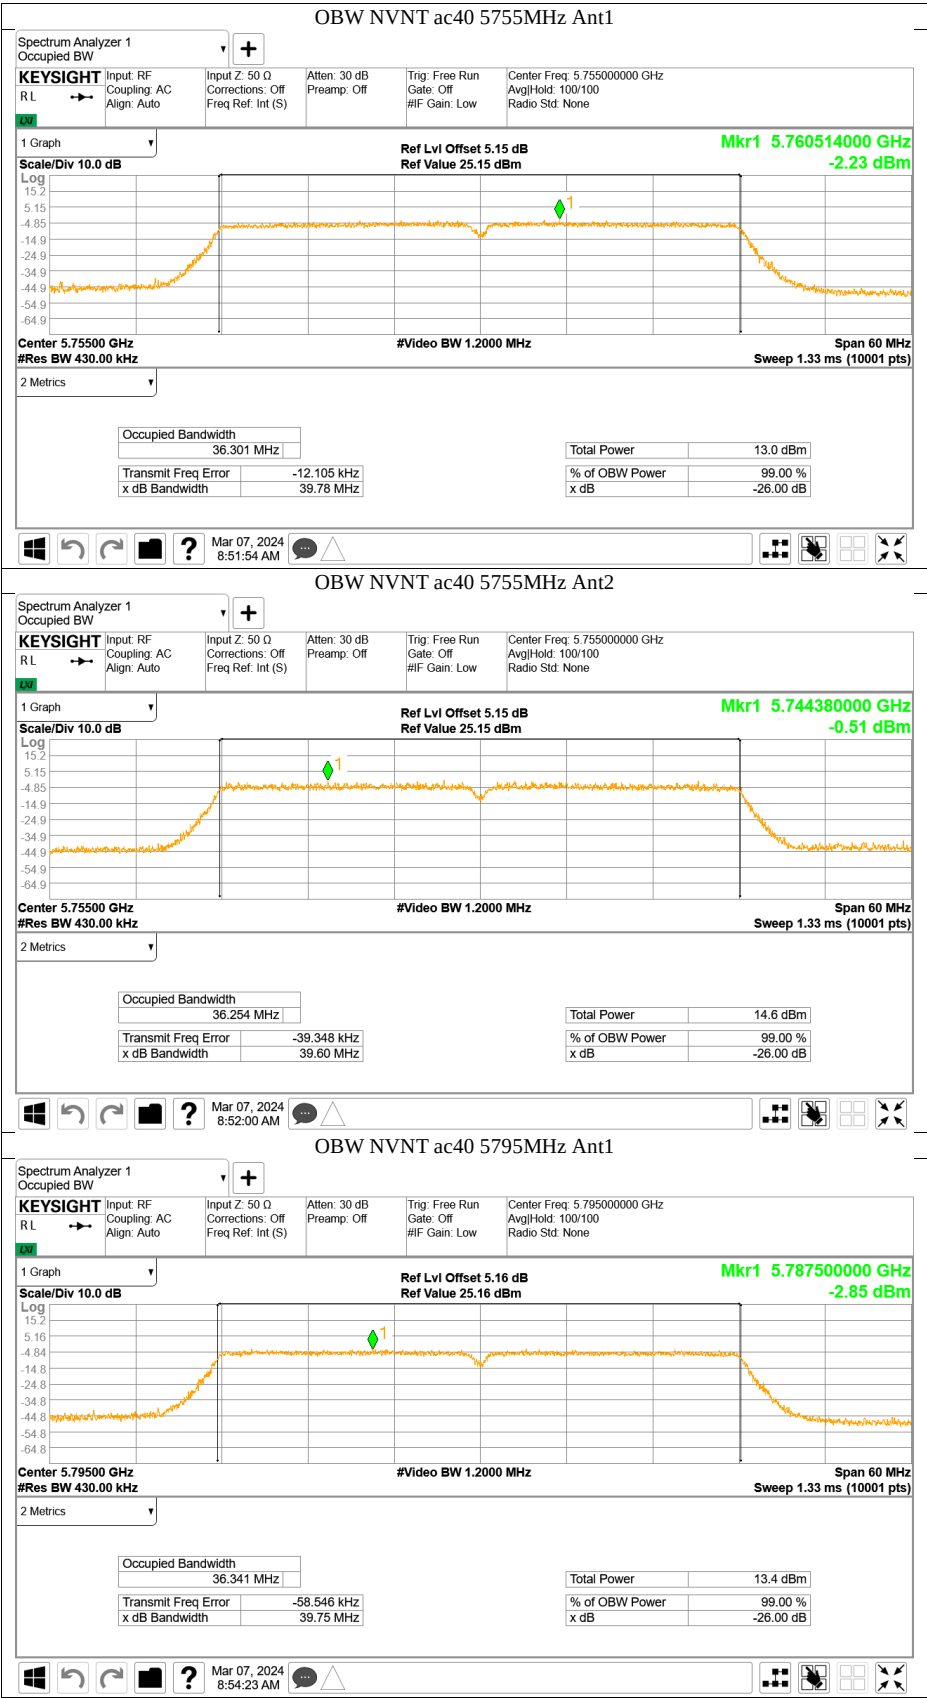


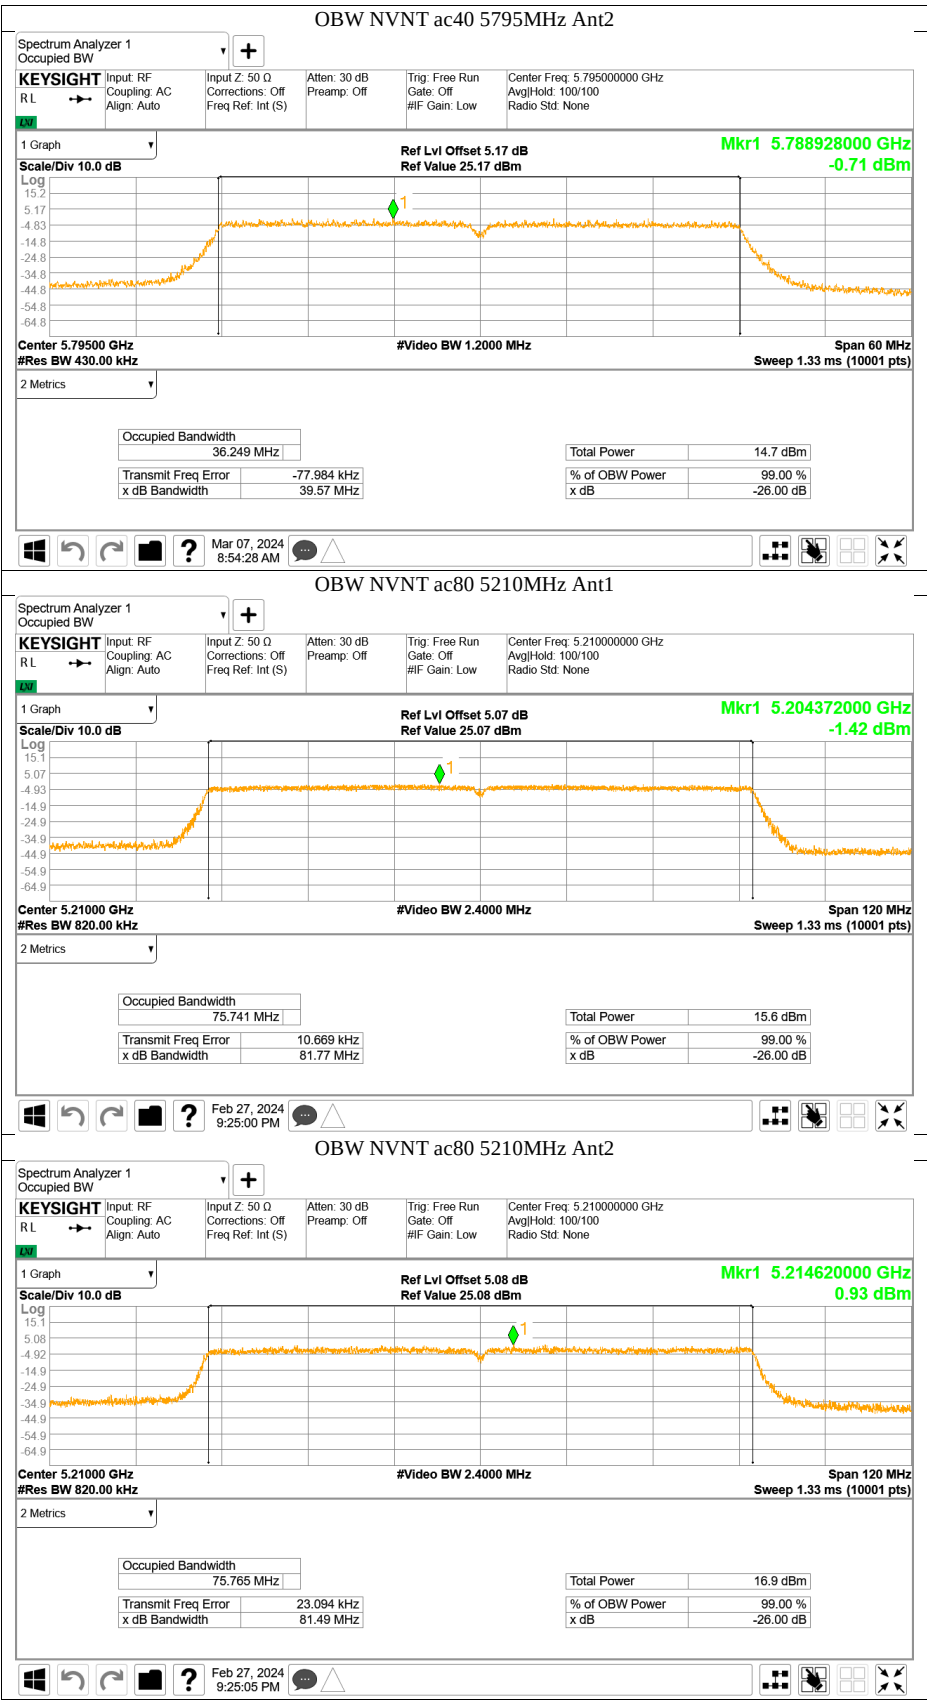

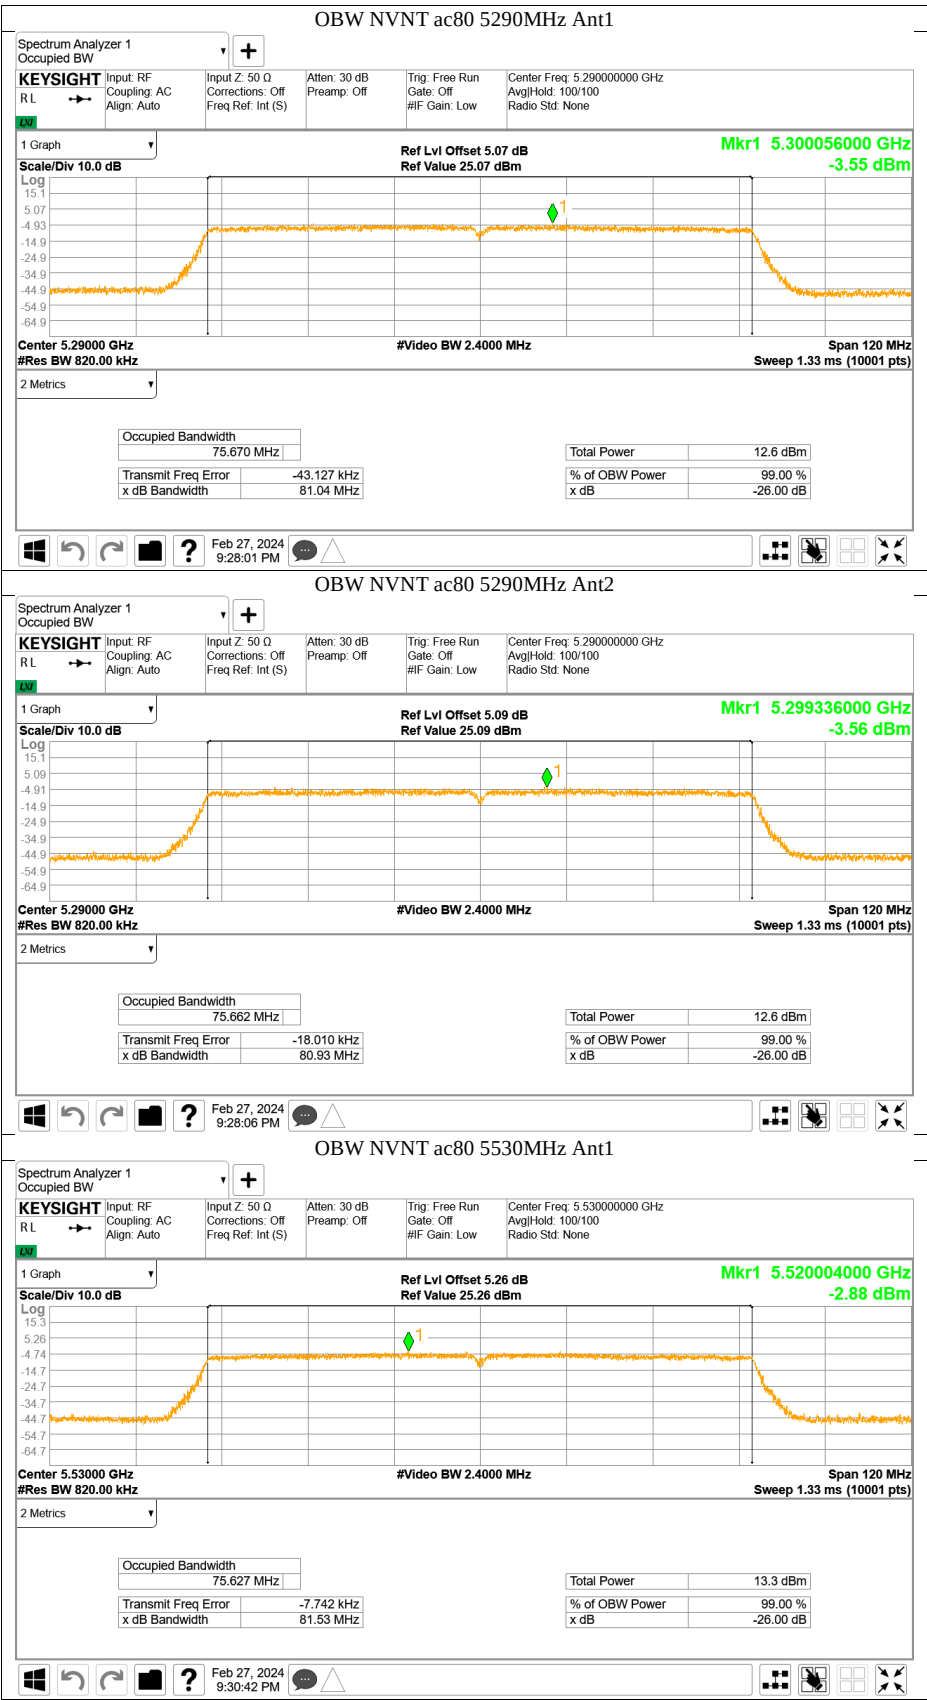

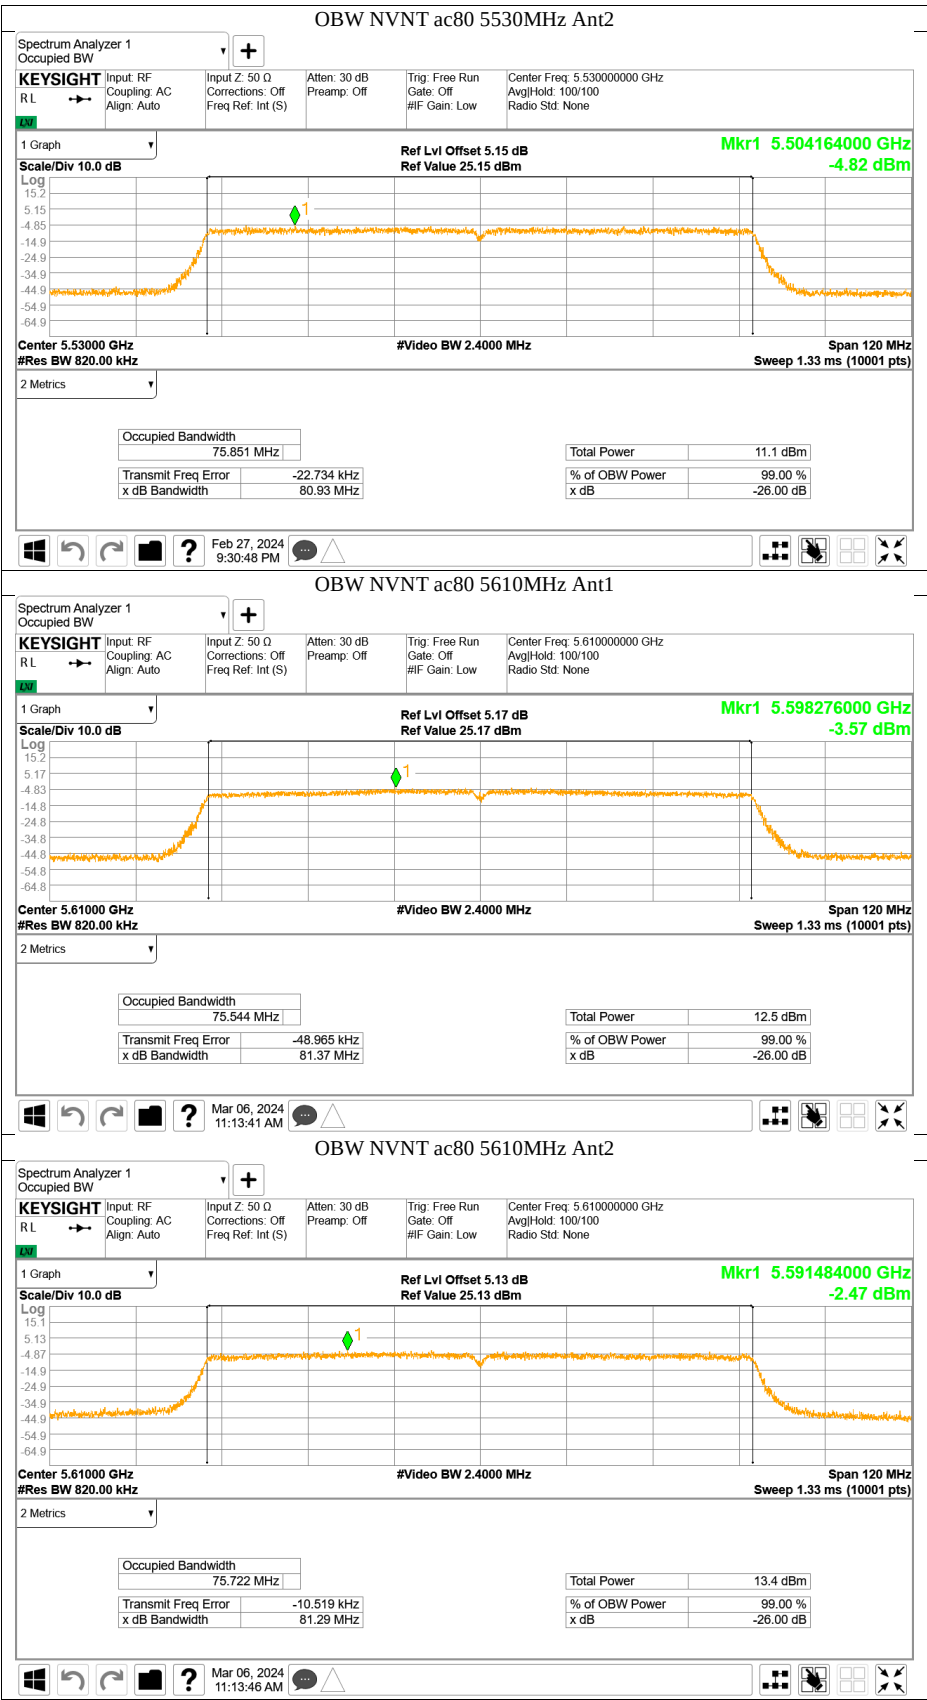

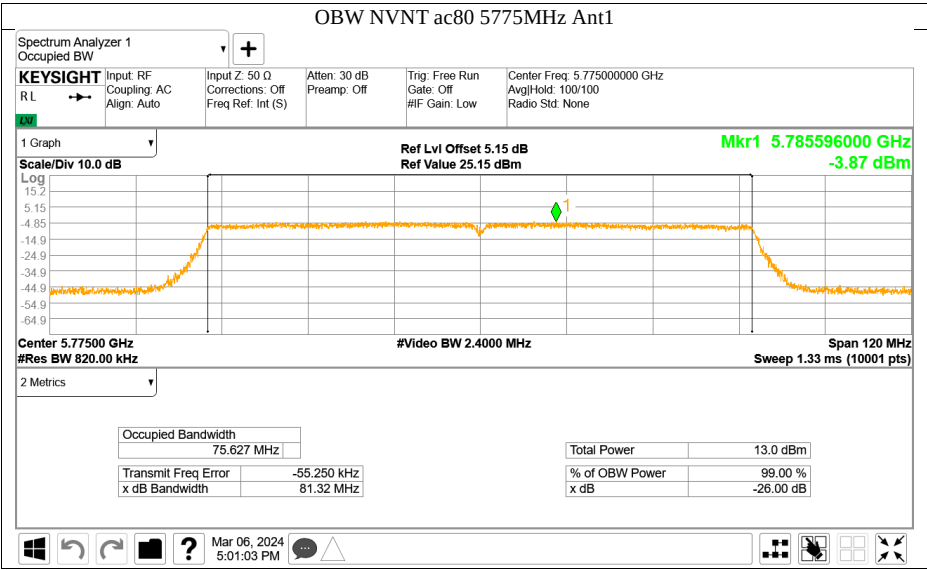

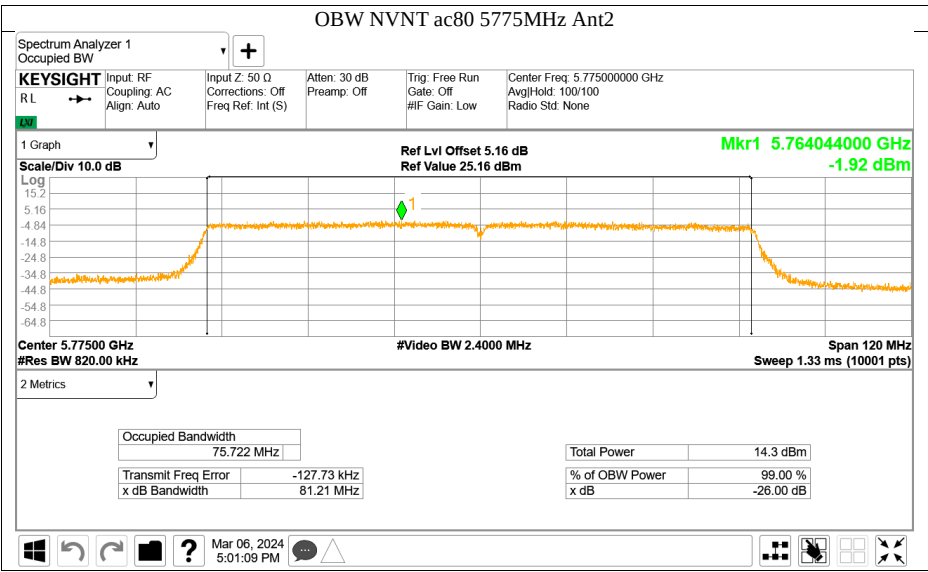



5 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	3.08	0	3.08	11	Pass
NVNT	a	5180	Ant2	3.31	0	3.31	11	Pass
NVNT	a	5180	Sum	6.21	0	6.21	8.9	Pass
NVNT	a	5200	Ant1	2.91	0	2.91	11	Pass
NVNT	a	5200	Ant2	2.94	0	2.94	11	Pass
NVNT	a	5200	Sum	5.94	0	5.94	8.9	Pass
NVNT	a	5240	Ant1	2.93	0	2.93	11	Pass
NVNT	a	5240	Ant2	2.94	0	2.94	11	Pass
NVNT	a	5240	Sum	5.95	0	5.95	8.9	Pass
NVNT	a	5260	Ant1	0.4	0	0.4	11	Pass
NVNT	a	5260	Ant2	-0.03	0	-0.03	11	Pass
NVNT	a	5260	Sum	3.2	0	3.2	8.9	Pass
NVNT	a	5300	Ant1	0.07	0	0.07	11	Pass
NVNT	a	5300	Ant2	-0.26	0	-0.26	11	Pass
NVNT	a	5300	Sum	2.92	0	2.92	8.9	Pass
NVNT	a	5320	Ant1	-0.14	0	-0.14	11	Pass
NVNT	a	5320	Ant2	-0.5	0	-0.5	11	Pass
NVNT	a	5320	Sum	2.69	0	2.69	8.9	Pass
NVNT	a	5500	Ant1	0.53	0	0.53	11	Pass
NVNT	a	5500	Ant2	-1.56	0	-1.56	11	Pass
NVNT	a	5500	Sum	2.62	0	2.62	8.9	Pass
NVNT	a	5540	Ant1	0.27	0	0.27	11	Pass
NVNT	a	5540	Ant2	-2.9	0	-2.9	11	Pass
NVNT	a	5540	Sum	1.98	0	1.98	8.9	Pass
NVNT	a	5580	Ant1	-0.73	0	-0.73	11	Pass
NVNT	a	5580	Ant2	-2.47	0	-2.47	11	Pass
NVNT	a	5580	Sum	1.5	0	1.5	8.9	Pass
NVNT	a	5660	Ant1	-1.06	0	-1.06	11	Pass
NVNT	a	5660	Ant2	-2.41	0	-2.41	11	Pass
NVNT	a	5660	Sum	1.33	0	1.33	8.9	Pass
NVNT	a	5680	Ant1	-0.65	0	-0.65	11	Pass
NVNT	a	5680	Ant2	-2.74	0	-2.74	11	Pass
NVNT	a	5680	Sum	1.44	0	1.44	8.9	Pass
NVNT	a	5700	Ant1	-0.37	0	-0.37	11	Pass
NVNT	a	5700	Ant2	-4.29	0	-4.29	11	Pass
NVNT	a	5700	Sum	1.11	0	1.11	8.9	Pass
NVNT	a	5745	Ant1	-4.13	0	-4.13	30	Pass
NVNT	a	5745	Ant2	-4.31	0	-4.31	30	Pass
NVNT	a	5745	Sum	-1.21	0	-1.21	27.9	Pass
NVNT	a	5785	Ant1	-3.38	0	-3.38	30	Pass
NVNT	a	5785	Ant2	-5.45	0	-5.45	30	Pass
NVNT	a	5785	Sum	-1.28	0	-1.28	27.9	Pass
NVNT	a	5825	Ant1	-3.68	0	-3.68	30	Pass
NVNT	a	5825	Ant2	-5.71	0	-5.71	30	Pass
NVNT	a	5825	Sum	-1.57	0	-1.57	27.9	Pass
NVNT	n20	5180	Ant1	2.47	0	2.47	11	Pass
NVNT	n20	5180	Ant2	2.56	0	2.56	11	Pass
NVNT	n20	5180	Sum	5.53	0	5.53	8.9	Pass
NVNT	n20	5200	Ant1	2.82	0	2.82	11	Pass
NVNT	n20	5200	Ant2	2.49	0	2.49	11	Pass
NVNT	n20	5200	Sum	5.67	0	5.67	8.9	Pass



NVNT	n20	5240	Ant1	2.77	0	2.77	11	Pass
NVNT	n20	5240	Ant2	2.65	0	2.65	11	Pass
NVNT	n20	5240	Sum	5.72	0	5.72	8.9	Pass
NVNT	n20	5260	Ant1	-0.23	0	-0.23	11	Pass
NVNT	n20	5260	Ant2	-0.73	0	-0.73	11	Pass
NVNT	n20	5260	Sum	2.54	0	2.54	8.9	Pass
NVNT	n20	5300	Ant1	-0.35	0	-0.35	11	Pass
NVNT	n20	5300	Ant2	-0.69	0	-0.69	11	Pass
NVNT	n20	5300	Sum	2.49	0	2.49	8.9	Pass
NVNT	n20	5320	Ant1	-0.46	0	-0.46	11	Pass
NVNT	n20	5320	Ant2	-0.48	0	-0.48	11	Pass
NVNT	n20	5320	Sum	2.54	0	2.54	8.9	Pass
NVNT	n20	5500	Ant1	0.26	0	0.26	11	Pass
NVNT	n20	5500	Ant2	-2.12	0	-2.12	11	Pass
NVNT	n20	5500	Sum	2.24	0	2.24	8.9	Pass
NVNT	n20	5540	Ant1	-0.91	0	-0.91	11	Pass
NVNT	n20	5540	Ant2	-2.83	0	-2.83	11	Pass
NVNT	n20	5540	Sum	1.25	0	1.25	8.9	Pass
NVNT	n20	5580	Ant1	-1.61	0	-1.61	11	Pass
NVNT	n20	5580	Ant2	-2.46	0	-2.46	11	Pass
NVNT	n20	5580	Sum	1	0	1	8.9	Pass
NVNT	n20	5660	Ant1	-2	0	-2	11	Pass
NVNT	n20	5660	Ant2	-2.55	0	-2.55	11	Pass
NVNT	n20	5660	Sum	0.74	0	0.74	8.9	Pass
NVNT	n20	5680	Ant1	-1.75	0	-1.75	11	Pass
NVNT	n20	5680	Ant2	-2.67	0	-2.67	11	Pass
NVNT	n20	5680	Sum	0.82	0	0.82	8.9	Pass
NVNT	n20	5700	Ant1	-0.99	0	-0.99	11	Pass
NVNT	n20	5700	Ant2	-4.74	0	-4.74	11	Pass
NVNT	n20	5700	Sum	0.54	0	0.54	8.9	Pass
NVNT	n20	5745	Ant1	-4.73	0	-4.73	30	Pass
NVNT	n20	5745	Ant2	-7.83	0	-7.83	30	Pass
NVNT	n20	5745	Sum	-3	0	-3	27.9	Pass
NVNT	n20	5785	Ant1	-3.96	0	-3.96	30	Pass
NVNT	n20	5785	Ant2	-6.43	0	-6.43	30	Pass
NVNT	n20	5785	Sum	-2.01	0	-2.01	27.9	Pass
NVNT	n20	5825	Ant1	-3.98	0	-3.98	30	Pass
NVNT	n20	5825	Ant2	-6.06	0	-6.06	30	Pass
NVNT	n20	5825	Sum	-1.89	0	-1.89	27.9	Pass
NVNT	n40	5190	Ant1	-2.89	0.14	-2.75	11	Pass
NVNT	n40	5190	Ant2	-2.05	0.14	-1.91	11	Pass
NVNT	n40	5190	Sum	0.56	0.14	0.7	8.9	Pass
NVNT	n40	5230	Ant1	-3.21	0.15	-3.06	11	Pass
NVNT	n40	5230	Ant2	-2	0.15	-1.85	11	Pass
NVNT	n40	5230	Sum	0.45	0.15	0.6	8.9	Pass
NVNT	n40	5270	Ant1	-6.32	0.14	-6.18	11	Pass
NVNT	n40	5270	Ant2	-5.94	0.14	-5.8	11	Pass
NVNT	n40	5270	Sum	-3.12	0.14	-2.98	8.9	Pass
NVNT	n40	5310	Ant1	-6.42	0.14	-6.28	11	Pass
NVNT	n40	5310	Ant2	-5.94	0.14	-5.8	11	Pass
NVNT	n40	5310	Sum	-3.16	0.14	-3.02	8.9	Pass
NVNT	n40	5550	Ant1	-7.87	0	-7.87	11	Pass
NVNT	n40	5550	Ant2	-5.26	0	-5.26	11	Pass
NVNT	n40	5550	Sum	-3.36	0	-3.36	8.9	Pass
NVNT	n40	5510	Ant1	-5.31	0	-5.31	11	Pass
NVNT	n40	5510	Ant2	-7.53	0	-7.53	11	Pass



NVNT	n40	5510	Sum	-3.27	0	-3.27	8.9	Pass
NVNT	n40	5590	Ant1	-6.06	0	-6.06	11	Pass
NVNT	n40	5590	Ant2	-8.71	0	-8.71	11	Pass
NVNT	n40	5590	Sum	-4.18	0	-4.18	8.9	Pass
NVNT	n40	5670	Ant1	-6.95	0	-6.95	11	Pass
NVNT	n40	5670	Ant2	-9.89	0	-9.89	11	Pass
NVNT	n40	5670	Sum	-5.17	0	-5.17	8.9	Pass
NVNT	n40	5755	Ant1	-6.95	0	-6.95	30	Pass
NVNT	n40	5755	Ant2	-8.54	0	-8.54	30	Pass
NVNT	n40	5755	Sum	-4.66	0	-4.66	27.9	Pass
NVNT	n40	5795	Ant1	-8.88	0	-8.88	30	Pass
NVNT	n40	5795	Ant2	-7.86	0	-7.86	30	Pass
NVNT	n40	5795	Sum	-5.33	0	-5.33	27.9	Pass
NVNT	ac20	5180	Ant1	2.46	0	2.46	11	Pass
NVNT	ac20	5180	Ant2	2.45	0	2.45	11	Pass
NVNT	ac20	5180	Sum	5.47	0	5.47	8.9	Pass
NVNT	ac20	5200	Ant1	2.48	0	2.48	11	Pass
NVNT	ac20	5200	Ant2	2.73	0	2.73	11	Pass
NVNT	ac20	5200	Sum	5.62	0	5.62	8.9	Pass
NVNT	ac20	5240	Ant1	2.86	0	2.86	11	Pass
NVNT	ac20	5240	Ant2	2.2	0	2.2	11	Pass
NVNT	ac20	5240	Sum	5.55	0	5.55	8.9	Pass
NVNT	ac20	5260	Ant1	-0.12	0	-0.12	11	Pass
NVNT	ac20	5260	Ant2	-0.54	0	-0.54	11	Pass
NVNT	ac20	5260	Sum	2.69	0	2.69	8.9	Pass
NVNT	ac20	5300	Ant1	-0.26	0	-0.26	11	Pass
NVNT	ac20	5300	Ant2	-0.52	0	-0.52	11	Pass
NVNT	ac20	5300	Sum	2.62	0	2.62	8.9	Pass
NVNT	ac20	5320	Ant1	-0.65	0	-0.65	11	Pass
NVNT	ac20	5320	Ant2	-0.81	0	-0.81	11	Pass
NVNT	ac20	5320	Sum	2.28	0	2.28	8.9	Pass
NVNT	ac20	5500	Ant1	0.19	0	0.19	11	Pass
NVNT	ac20	5500	Ant2	-0.82	0	-0.82	11	Pass
NVNT	ac20	5500	Sum	2.72	0	2.72	8.9	Pass
NVNT	ac20	5540	Ant1	-0.79	0	-0.79	11	Pass
NVNT	ac20	5540	Ant2	-2.96	0	-2.96	11	Pass
NVNT	ac20	5540	Sum	1.27	0	1.27	8.9	Pass
NVNT	ac20	5580	Ant1	-1.64	0	-1.64	11	Pass
NVNT	ac20	5580	Ant2	-2.3	0	-2.3	11	Pass
NVNT	ac20	5580	Sum	1.05	0	1.05	8.9	Pass
NVNT	ac20	5660	Ant1	-2.06	0	-2.06	11	Pass
NVNT	ac20	5660	Ant2	-2.43	0	-2.43	11	Pass
NVNT	ac20	5660	Sum	0.77	0	0.77	8.9	Pass
NVNT	ac20	5680	Ant1	-1.83	0	-1.83	11	Pass
NVNT	ac20	5680	Ant2	-2.71	0	-2.71	11	Pass
NVNT	ac20	5680	Sum	0.76	0	0.76	8.9	Pass
NVNT	ac20	5700	Ant1	-1.1	0	-1.1	11	Pass
NVNT	ac20	5700	Ant2	-4.56	0	-4.56	11	Pass
NVNT	ac20	5700	Sum	0.52	0	0.52	8.9	Pass
NVNT	ac20	5745	Ant1	-4.59	0	-4.59	30	Pass
NVNT	ac20	5745	Ant2	-7.67	0	-7.67	30	Pass
NVNT	ac20	5745	Sum	-2.85	0	-2.85	27.9	Pass
NVNT	ac20	5785	Ant1	-3.88	0	-3.88	30	Pass
NVNT	ac20	5785	Ant2	-6.13	0	-6.13	30	Pass
NVNT	ac20	5785	Sum	-1.85	0	-1.85	27.9	Pass
NVNT	ac20	5825	Ant1	-3.91	0	-3.91	30	Pass