



Test report No. : 4790042400-US-R1-V0
Page : 195 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	48
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5148.05	73.65	-11.74	61.91	74	-12.09	PK
		5149.8	58.48	-11.74	46.74	54	-7.26	AVG
	@	5240	130.75	-11.74	119.01	N/A	N/A	PK
	@	5240	120.74	-11.74	109	N/A	N/A	AVG
		10480	58.89	-11.74	47.15	68.2	-21.05	PK
		10480	50.93	-11.74	39.19	54	-14.81	AVG
Chain 1		5143.85	76.56	-11.74	64.82	74	-9.18	PK
		5148.75	64.67	-11.74	52.93	54	-1.07	AVG
	@	5240	126.24	-11.74	114.5	N/A	N/A	PK
	@	5240	120.64	-11.74	108.9	N/A	N/A	AVG
		10480	58.81	-11.74	47.07	68.2	-21.13	PK
		10480	51.55	-11.74	39.81	54	-14.19	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 196 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

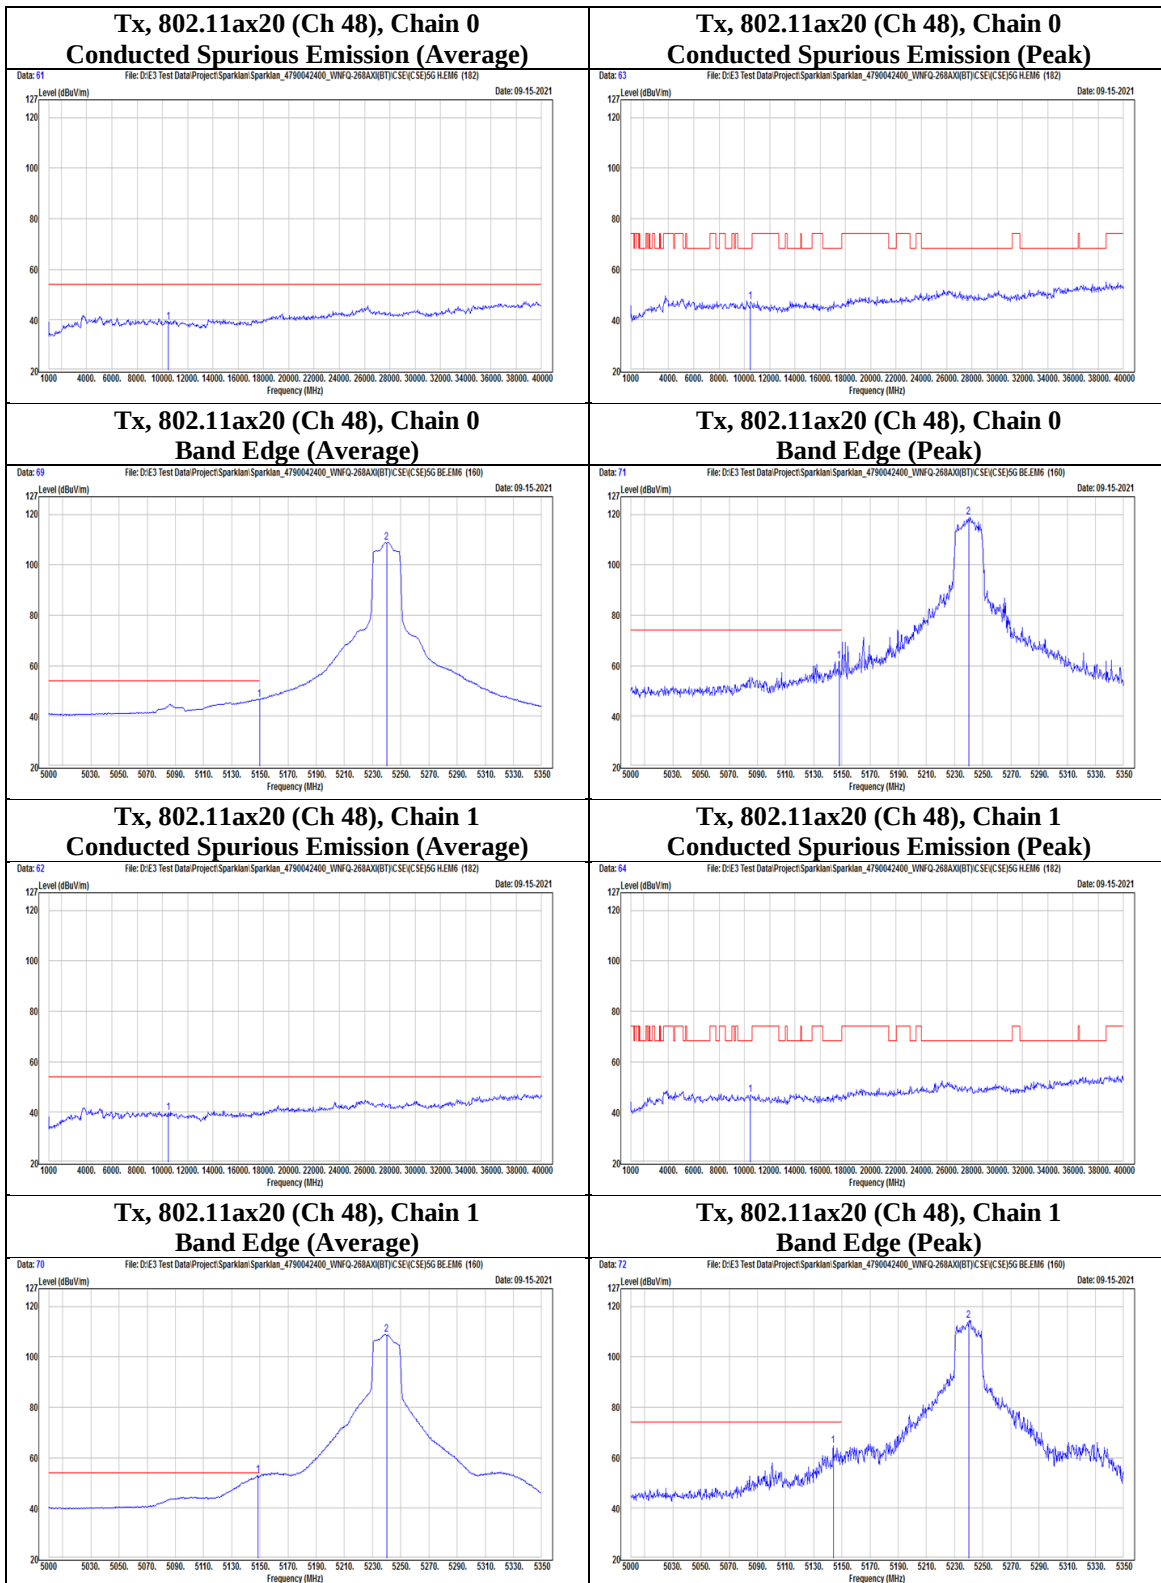

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 197 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	52
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5260	130.6	-11.74	118.86	N/A	N/A	PK
	@	5260	120.3	-11.74	108.56	N/A	N/A	AVG
		5350.2	54.25	-11.74	42.51	54	-11.49	AVG
		5354.1	64.34	-11.74	52.6	74	-21.4	PK
		10520	57.3	-11.74	45.56	68.2	-22.64	PK
		10520	50.94	-11.74	39.2	54	-14.8	AVG
Chain 1	@	5260	131.64	-11.74	119.9	N/A	N/A	PK
	@	5260	121.58	-11.74	109.84	N/A	N/A	AVG
		5351.1	62.84	-11.74	51.1	54	-2.9	AVG
		5355	80.25	-11.74	68.51	74	-5.49	PK
		10520	57.89	-11.74	46.15	68.2	-22.05	PK
		10520	50.66	-11.74	38.92	54	-15.08	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 198 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

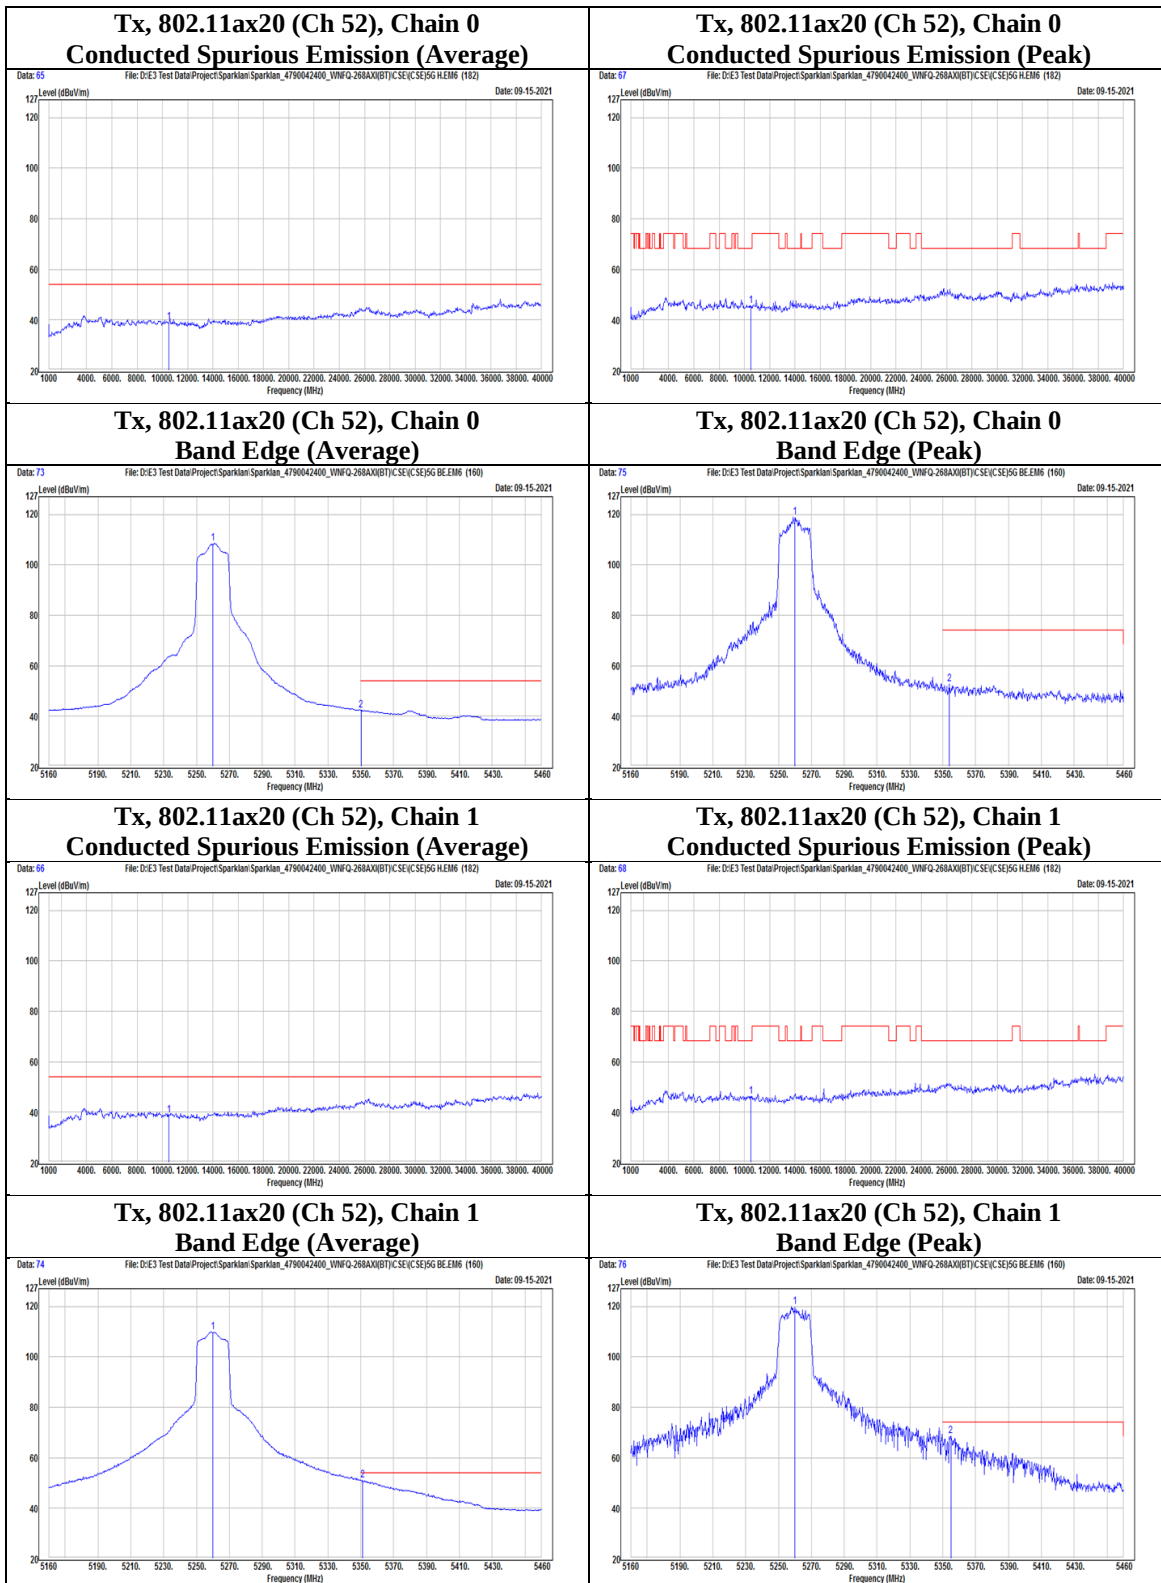

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 199 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	60
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5300	128.96	-11.74	117.22	N/A	N/A	PK
	@	5300	119.12	-11.74	107.38	N/A	N/A	AVG
		5350.2	61.9	-11.74	50.16	54	-3.84	AVG
		5352.3	78.27	-11.74	66.53	74	-7.47	PK
		10600	57.55	-11.74	45.81	68.2	-22.39	PK
		10600	51.18	-11.74	39.44	54	-14.56	AVG
Chain 1	@	5300	130.94	-11.74	119.2	N/A	N/A	PK
	@	5300	123.48	-11.74	111.74	N/A	N/A	AVG
		5350.2	64.35	-11.74	52.61	54	-1.39	AVG
		5352.9	75.75	-11.74	64.01	74	-9.99	PK
		10600	57.69	-11.74	45.95	68.2	-22.25	PK
		10600	50.86	-11.74	39.12	54	-14.88	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 200 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

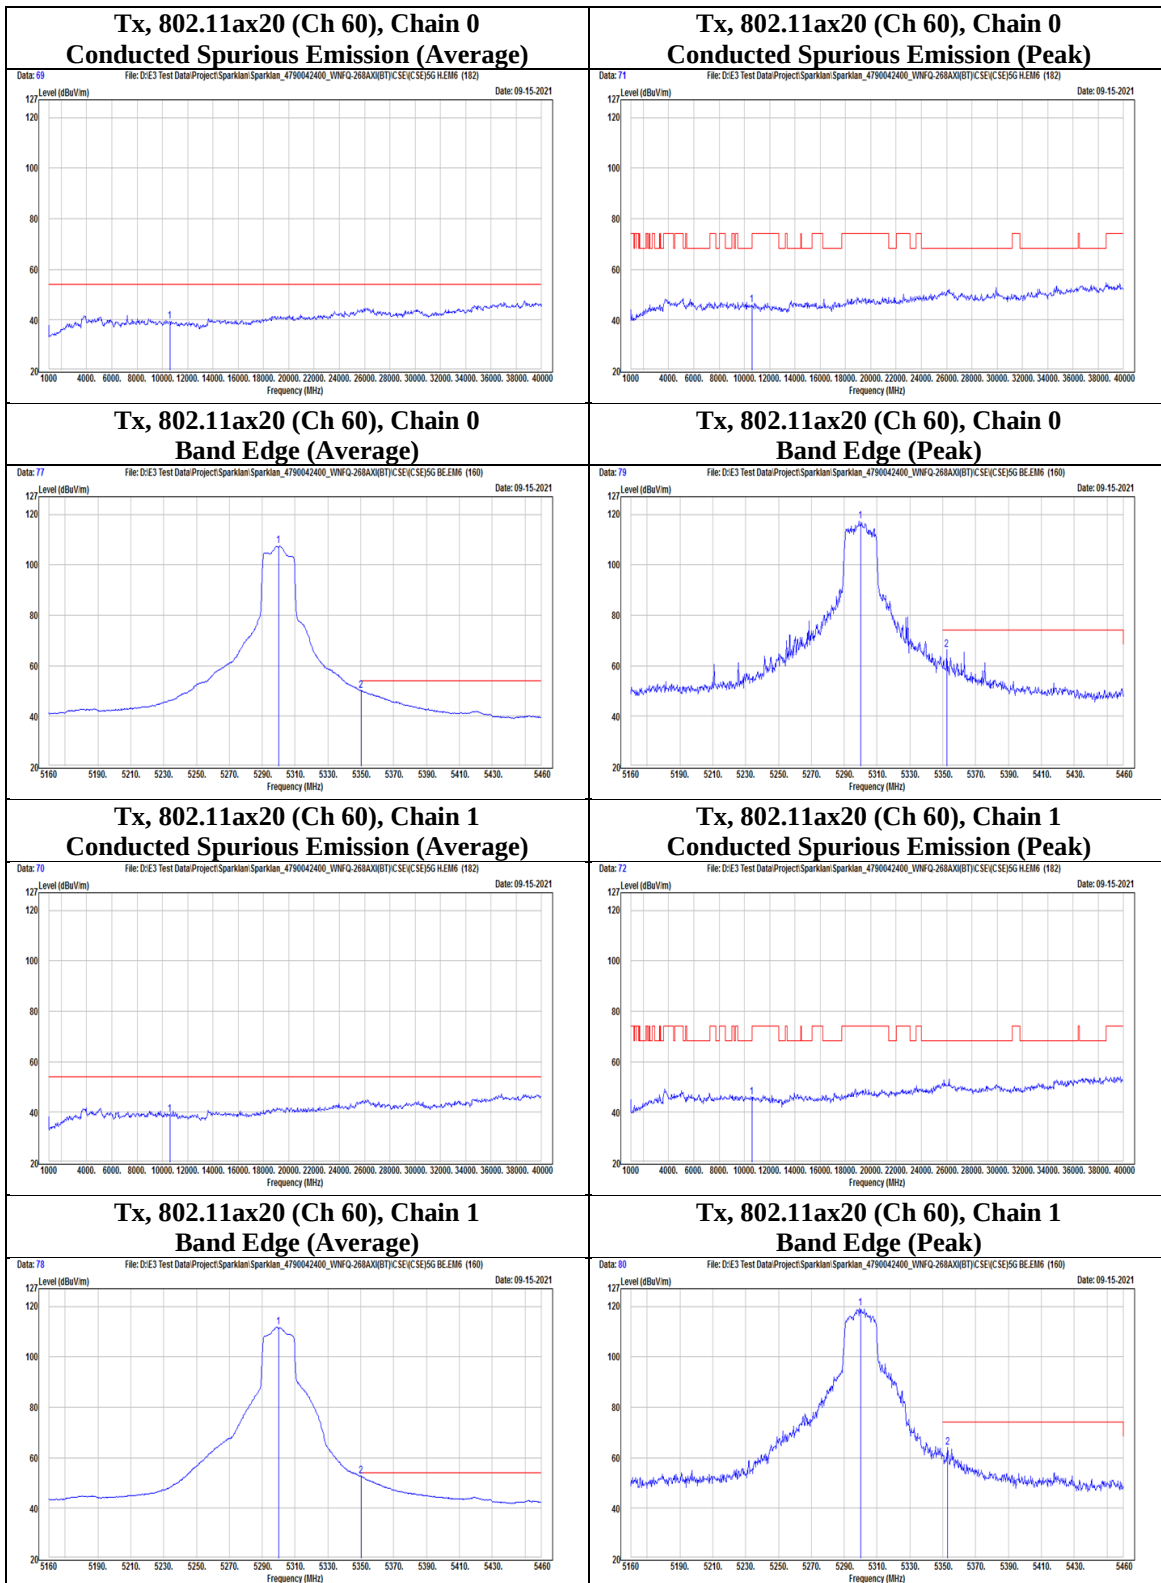

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 201 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	64
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5320	126.9	-11.74	115.16	N/A	N/A	PK
	@	5320	116.67	-11.74	104.93	N/A	N/A	AVG
		5352.6	61.38	-11.74	49.64	54	-4.36	AVG
		5354.1	72.77	-11.74	61.03	74	-12.97	PK
		10640	57.97	-11.74	46.23	74	-27.77	PK
		10640	51.51	-11.74	39.77	54	-14.23	AVG
Chain 1	@	5320	129.05	-11.74	117.31	N/A	N/A	PK
	@	5320	119.32	-11.74	107.58	N/A	N/A	AVG
		5350.5	75.02	-11.74	63.28	74	-10.72	PK
		5350.5	64.48	-11.74	52.74	54	-1.26	AVG
		10640	57.08	-11.74	45.34	74	-28.66	PK
		10640	51.4	-11.74	39.66	54	-14.34	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 202 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

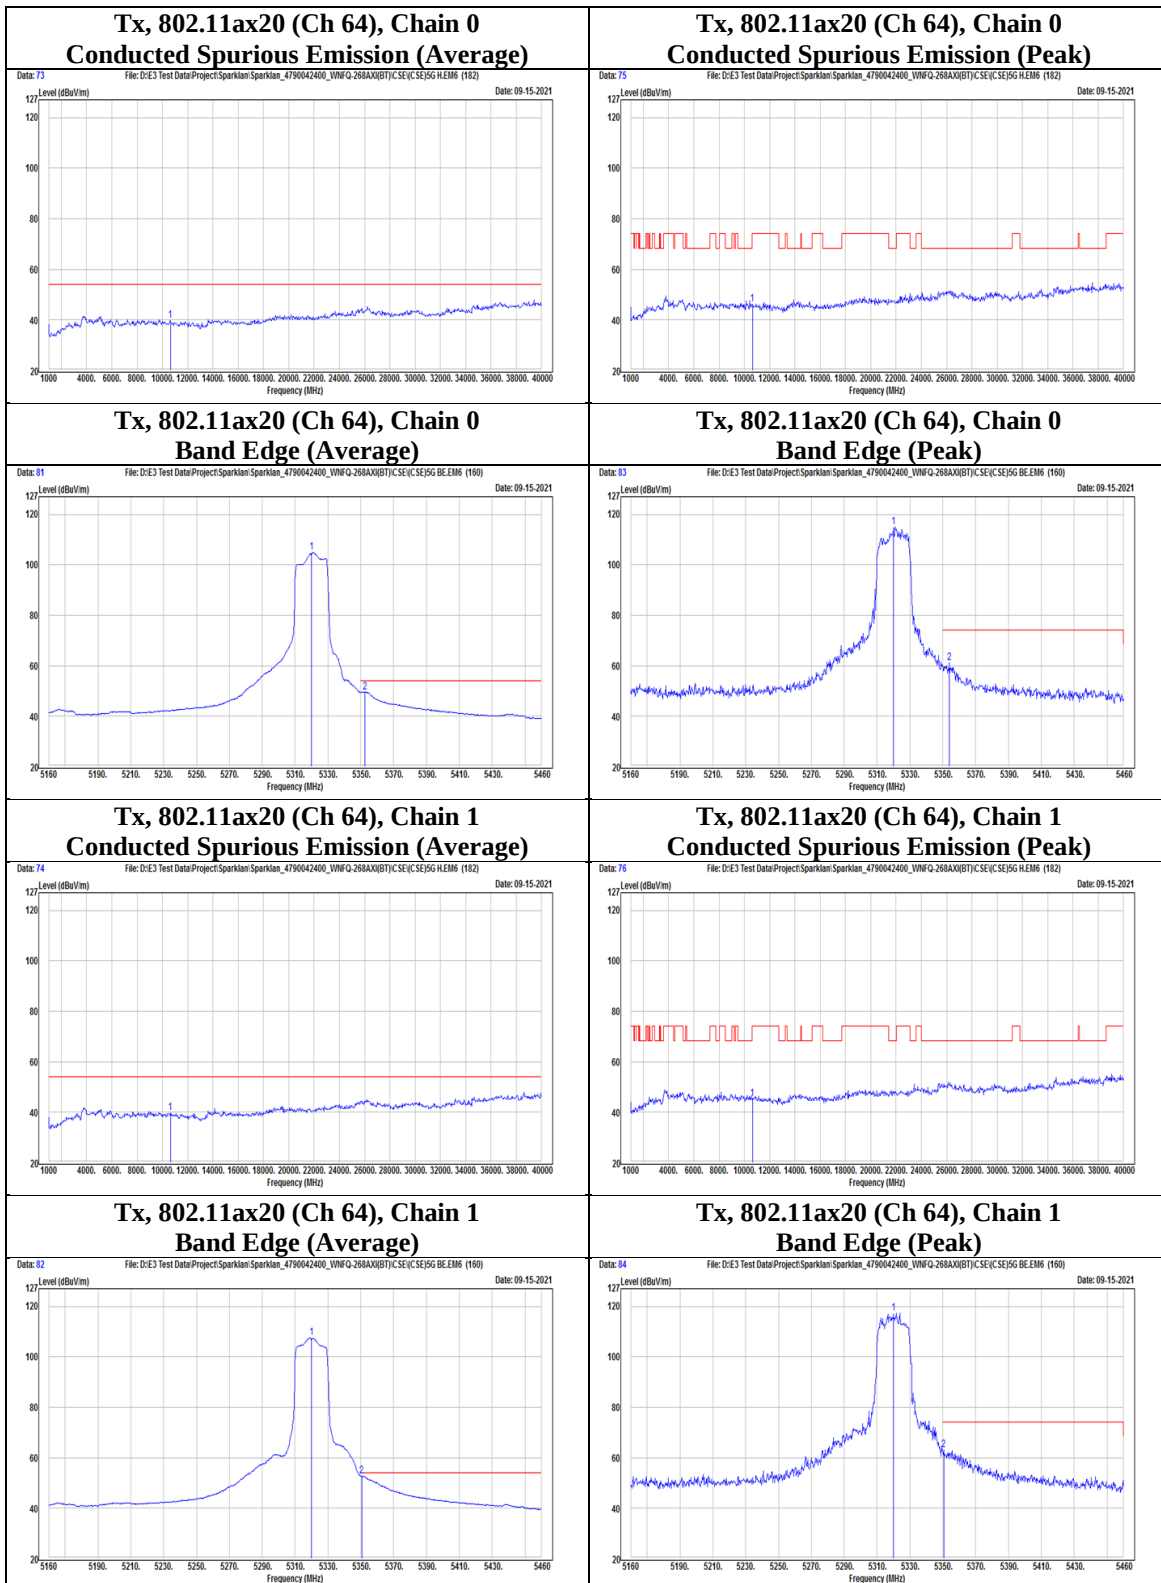

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 203 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	100
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5459.85	72.75	-11.74	61.01	74	-12.99	PK
		5459.85	61.95	-11.74	50.21	54	-3.79	AVG
		5468.6	76.78	-11.74	65.04	68.2	-3.16	PK
	@	5500	128.09	-11.74	116.35	N/A	N/A	PK
	@	5500	116.86	-11.74	105.12	N/A	N/A	AVG
		11000	57.63	-11.74	45.89	74	-28.11	PK
		11000	50.68	-11.74	38.94	54	-15.06	AVG
Chain 1		5453.2	72.06	-11.74	60.32	74	-13.68	PK
		5459.85	64.29	-11.74	52.55	54	-1.45	AVG
		5467.2	78.36	-11.74	66.62	68.2	-1.58	PK
	@	5500	128.87	-11.74	117.13	N/A	N/A	PK
	@	5500	121.04	-11.74	109.3	N/A	N/A	AVG
		11000	58.03	-11.74	46.29	74	-27.71	PK
		11000	51.34	-11.74	39.6	54	-14.4	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 204 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

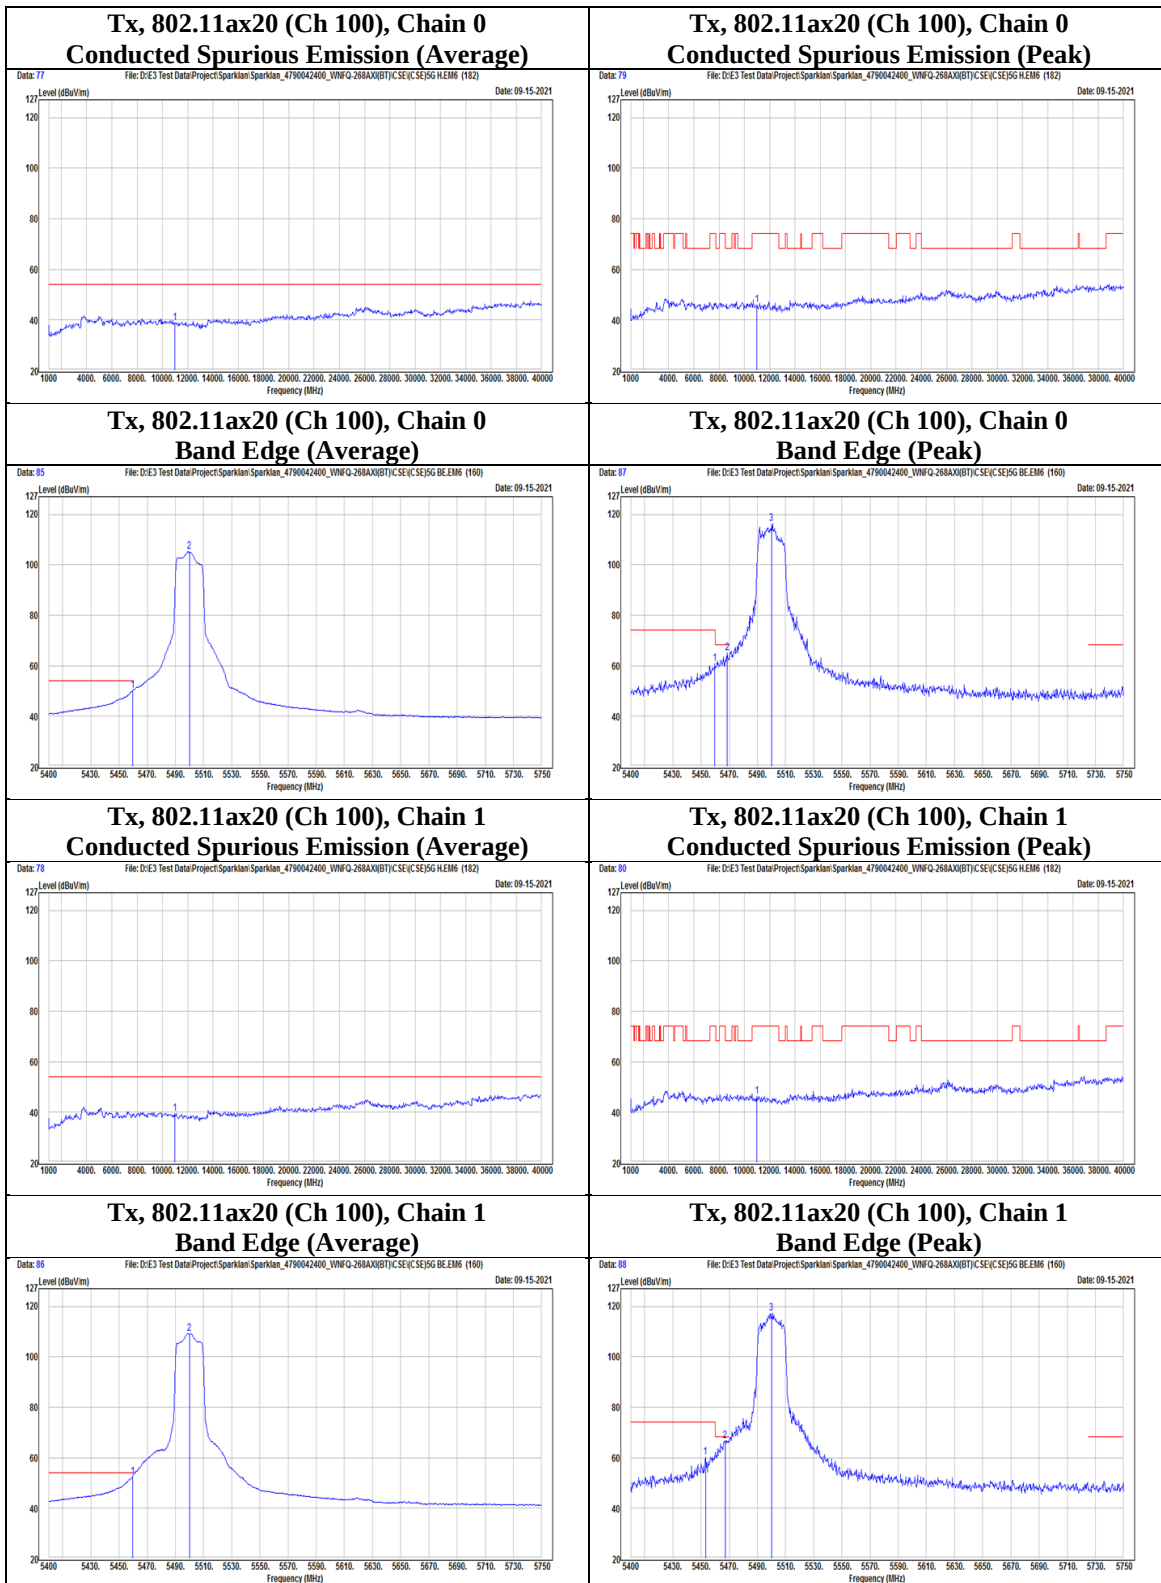

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 205 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	116
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5453.2	56.48	-11.74	44.74	54	-9.26	AVG
		5458.45	72.08	-11.74	60.34	74	-13.66	PK
		5464.05	69.39	-11.74	57.65	68.2	-10.55	PK
	@	5580	130.58	-11.74	118.84	N/A	N/A	PK
	@	5580	121.02	-11.74	109.28	N/A	N/A	AVG
		5726.2	70.88	-11.74	59.14	68.2	-9.06	PK
		11160	57.68	-11.74	45.94	74	-28.06	PK
		11160	50.45	-11.74	38.71	54	-15.29	AVG
		5453.2	58.29	-11.74	46.55	54	-7.45	AVG
Chain 1		5458.45	73.92	-11.74	62.18	74	-11.82	PK
		5468.95	75.38	-11.74	63.64	68.2	-4.56	PK
	@	5580	131.2	-11.74	119.46	N/A	N/A	PK
	@	5580	122.3	-11.74	110.56	N/A	N/A	AVG
		5738.45	67.8	-11.74	56.06	68.2	-12.14	PK
		11160	57.17	-11.74	45.43	74	-28.57	PK
		11160	51.03	-11.74	39.29	54	-14.71	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 206 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

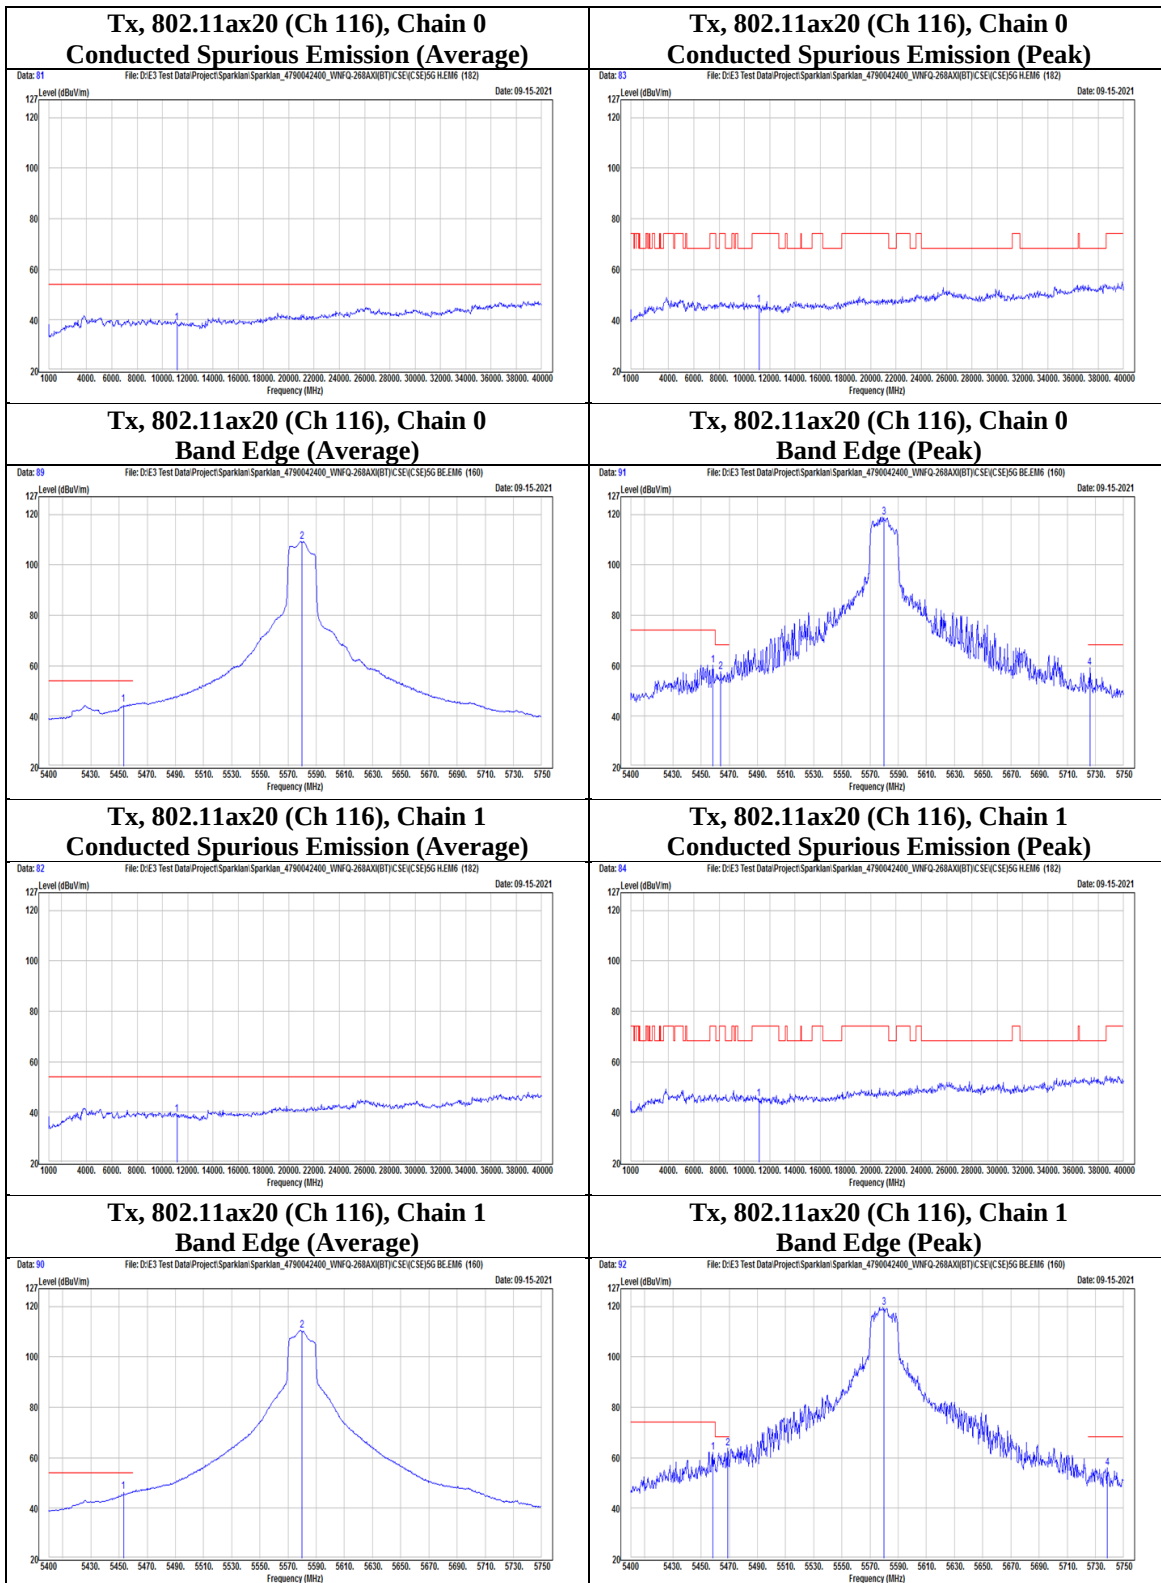

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 207 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	140
------	------------	---------	-----

TX Chain	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Chain 0		5452.15	60.68	-11.74	48.94	74	-25.06	PK
		5452.15	51.25	-11.74	39.51	54	-14.49	AVG
		5466.85	61.8	-11.74	50.06	68.2	-18.14	PK
	@	5700	125.9	-11.74	114.16	N/A	N/A	PK
	@	5700	116.87	-11.74	105.13	N/A	N/A	AVG
		5726.55	73.76	-11.74	62.02	68.2	-6.18	PK
		11400	57.3	-11.74	45.56	74	-28.44	PK
		11400	50.1	-11.74	38.36	54	-15.64	AVG
		5433.25	62.77	-11.74	51.03	74	-22.97	PK
Chain 1		5452.15	50.95	-11.74	39.21	54	-14.79	AVG
		5467.2	60.6	-11.74	48.86	68.2	-19.34	PK
	@	5700	129.04	-11.74	117.3	N/A	N/A	PK
	@	5700	118.2	-11.74	106.46	N/A	N/A	AVG
		5725	78.76	-11.74	67.02	68.2	-1.18	PK
		11400	56.13	-11.74	44.39	74	-29.61	PK
		11400	50.19	-11.74	38.45	54	-15.55	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 208 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXBT

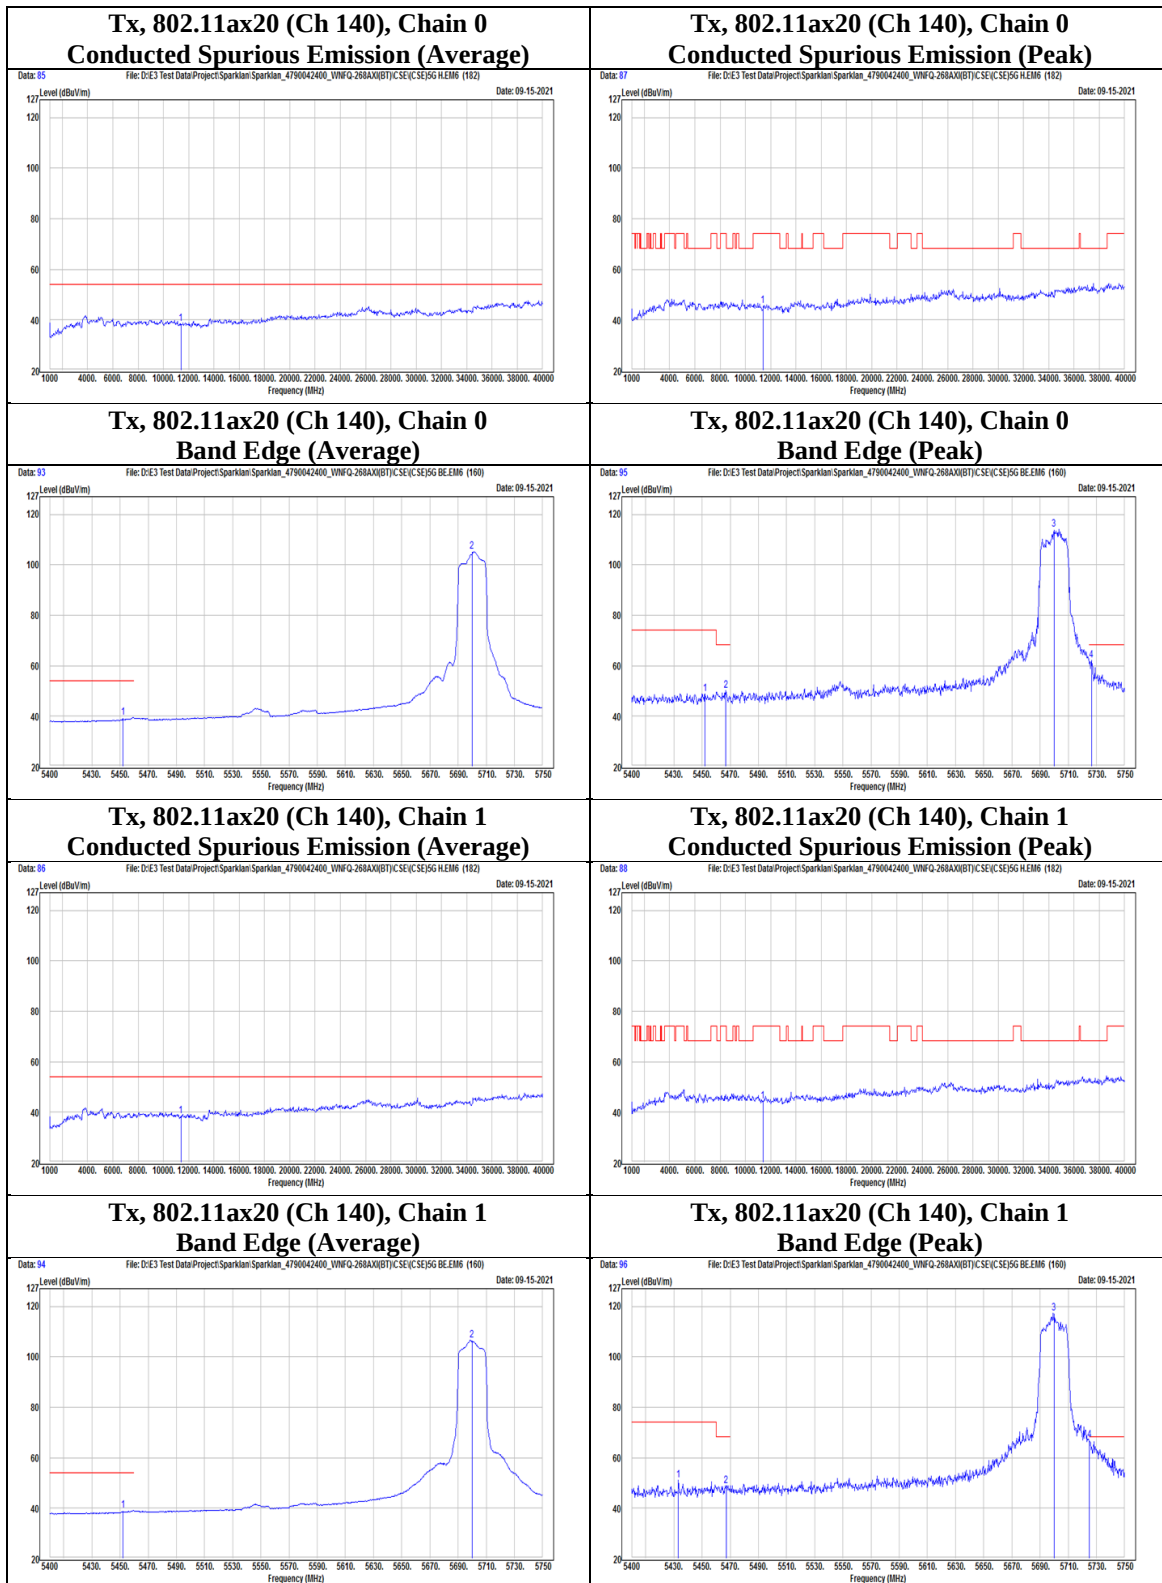

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 209 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXBT

Mode	802.11ax20	Channel	144
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		11440	57.04	-11.74	45.3	74	-28.7	PK
		11440	49.97	-11.74	38.23	54	-15.77	AVG
Chain 1		11440	56.51	-11.74	44.77	74	-29.23	PK
		11440	51.04	-11.74	39.3	54	-14.7	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 210 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

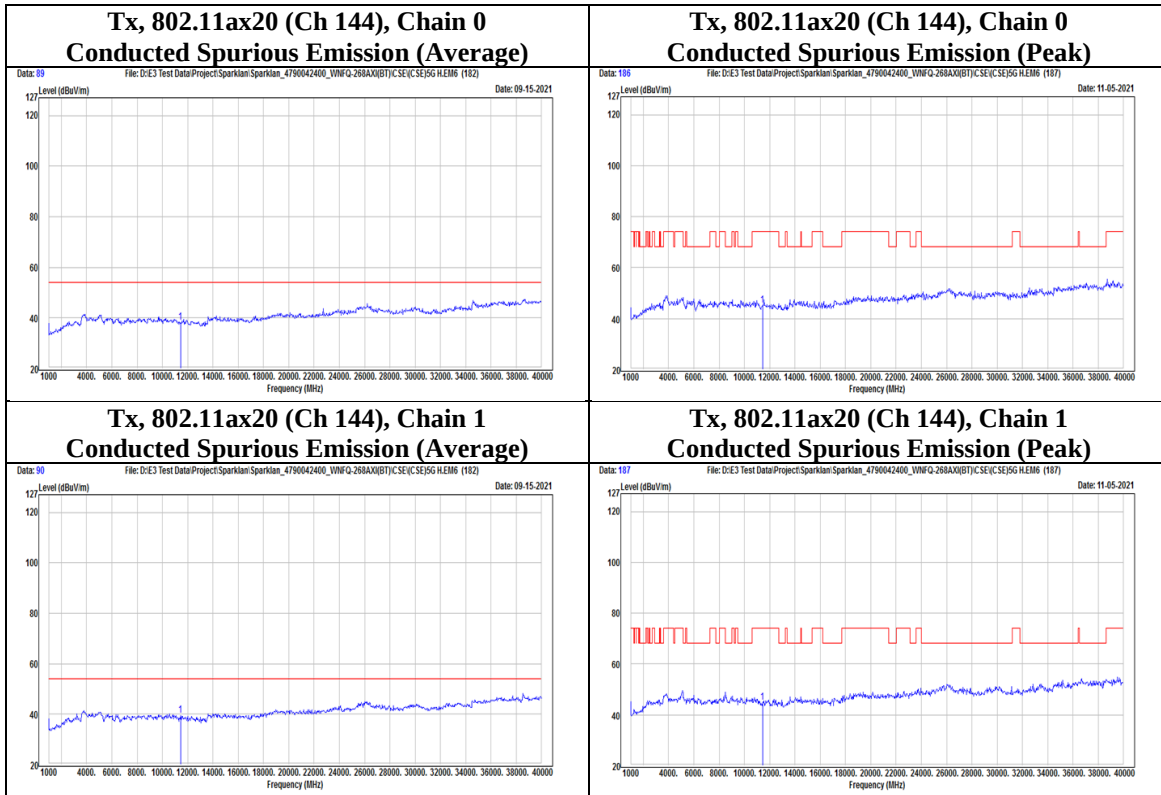

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 211 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	149
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5645	78.86	-11.74	67.12	68.2	-1.08	PK
		5690	88.79	-11.74	77.05	97.83	-20.78	PK
	@	5745	130.37	-11.74	118.63	N/A	N/A	PK
		11490	57.03	-11.74	45.29	74	-28.71	PK
		11490	51.78	-11.74	40.04	54	-13.96	AVG
Chain 1		5648	66.1	-11.74	54.36	68.2	-13.84	PK
		5699	82.8	-11.74	71.06	104.46	-33.4	PK
	@	5745	130.14	-11.74	118.4	N/A	N/A	PK
		11490	56.88	-11.74	45.14	74	-28.86	PK
		11490	51.58	-11.74	39.84	54	-14.16	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 212 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

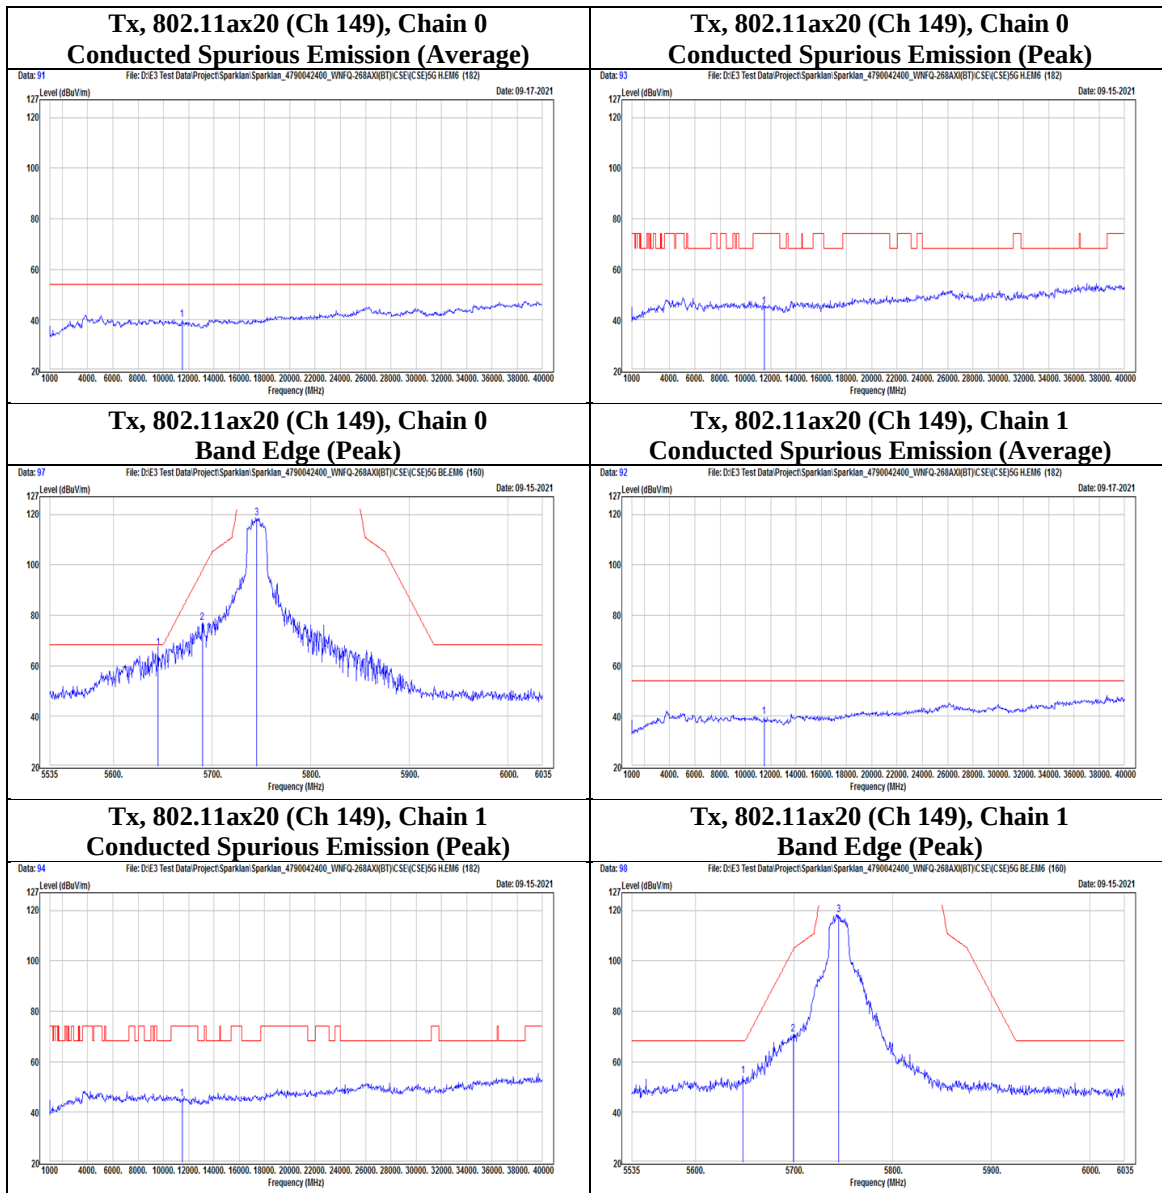

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 213 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	157
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5632	67.88	-11.74	56.14	68.2	-12.06	PK
		5672	66.3	-11.74	54.56	84.52	-29.96	PK
	@	5785	130.47	-11.74	118.73	N/A	N/A	PK
		5906.5	65.14	-11.74	53.4	81.85	-28.45	PK
		5940	64.6	-11.74	52.86	68.2	-15.34	PK
		11570	56.95	-11.74	45.21	74	-28.79	PK
		11570	51.21	-11.74	39.47	54	-14.53	AVG
Chain 1		5635.5	65.07	-11.74	53.33	68.2	-14.87	PK
		5694.5	65.83	-11.74	54.09	101.15	-47.06	PK
	@	5785	130.38	-11.74	118.64	N/A	N/A	PK
		5892	63.85	-11.74	52.11	92.58	-40.47	PK
		5926.5	64.12	-11.74	52.38	68.2	-15.82	PK
		11570	57.92	-11.74	46.18	74	-27.82	PK
		11570	50.72	-11.74	38.98	54	-15.02	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 214 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

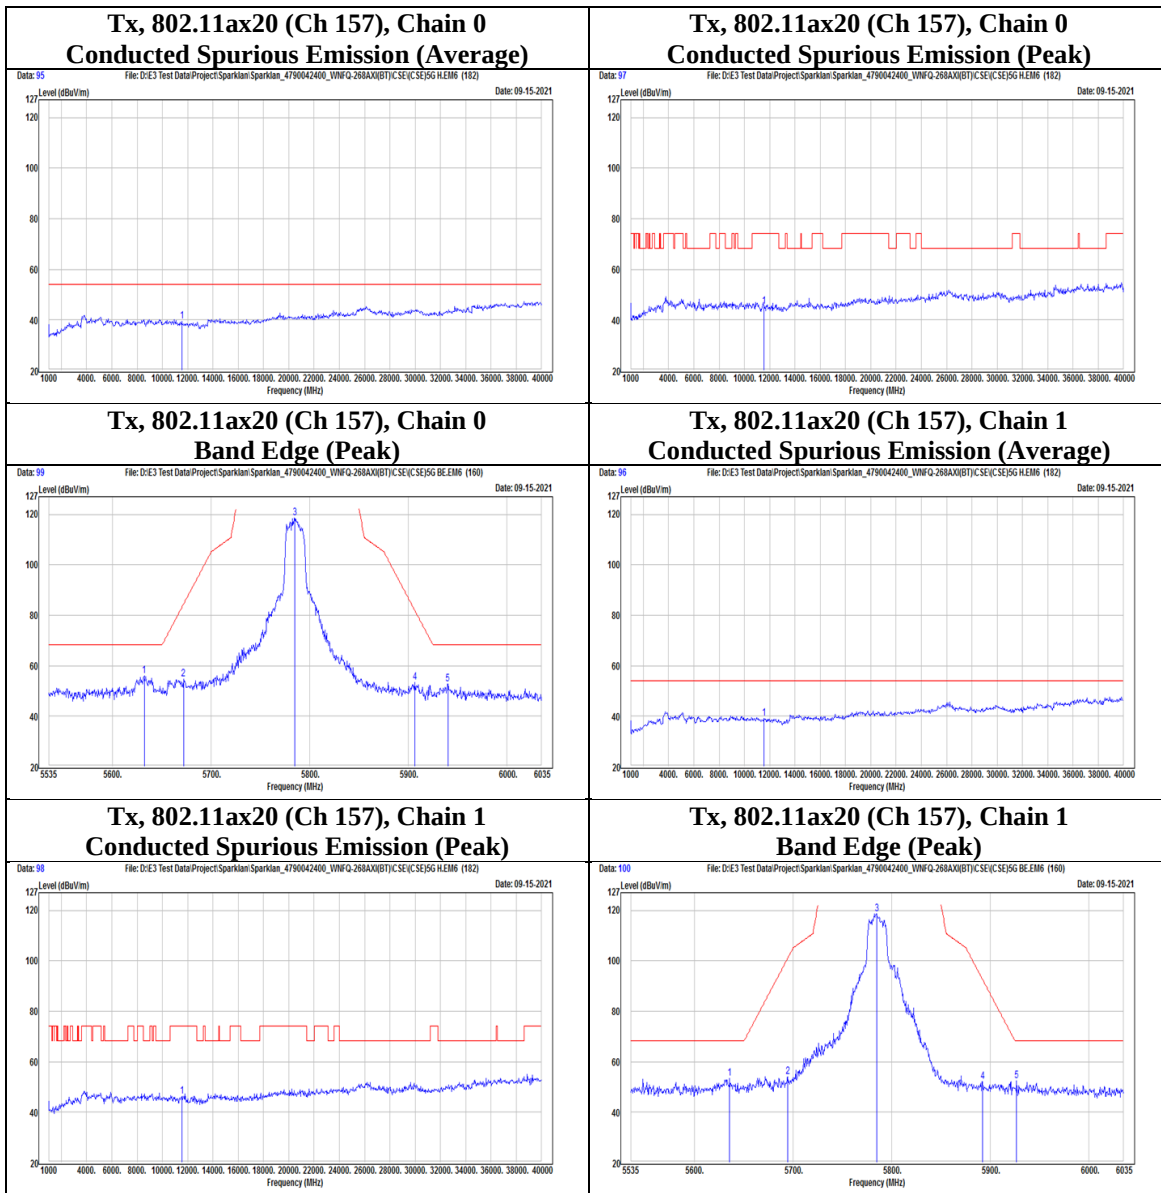

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 215 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax20	Channel	165
------	------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	5825	130.52	-11.74	118.78	N/A	N/A	PK
		5879	90.3	-11.74	78.56	102.23	-23.67	PK
		5925.5	78.88	-11.74	67.14	68.2	-1.06	PK
		11650	58.68	-11.74	46.94	74	-27.06	PK
		11650	50.3	-11.74	38.56	54	-15.44	AVG
Chain 1	@	5825	131.34	-11.74	119.6	N/A	N/A	PK
		5875	74.84	-11.74	63.1	105.2	-42.1	PK
		5946.5	64.61	-11.74	52.87	68.2	-15.33	PK
		11650	56.29	-11.74	44.55	74	-29.45	PK
		11650	50.62	-11.74	38.88	54	-15.12	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 216 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

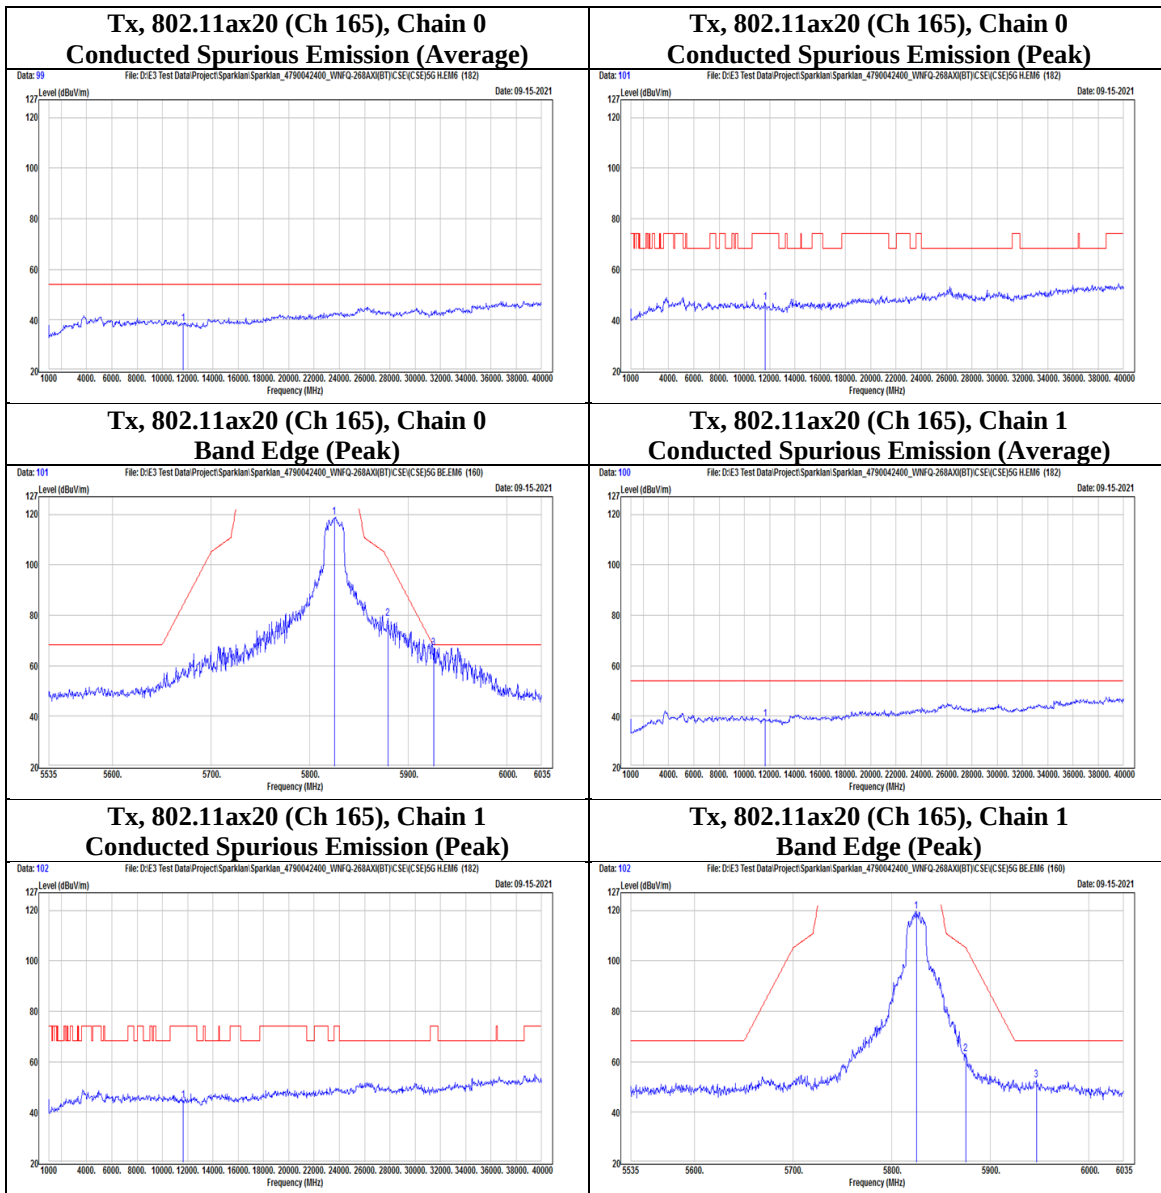

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 217 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax40	Channel	38
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5149.1	62.83	-11.74	51.09	54	-2.91	AVG
		5149.8	72.53	-11.74	60.79	74	-13.21	PK
	@	5190	120.75	-11.74	109.01	N/A	N/A	PK
	@	5190	111.28	-11.74	99.54	N/A	N/A	AVG
		10380	58.14	-11.74	46.4	68.2	-21.8	PK
		10380	50.83	-11.74	39.09	54	-14.91	AVG
Chain 1		5145.95	64.52	-11.74	52.78	54	-1.22	AVG
		5148.75	78.41	-11.74	66.67	74	-7.33	PK
	@	5190	122.21	-11.74	110.47	N/A	N/A	PK
	@	5190	113.7	-11.74	101.96	N/A	N/A	AVG
		10380	59.14	-11.74	47.4	68.2	-20.8	PK
		10380	51.56	-11.74	39.82	54	-14.18	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 218 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

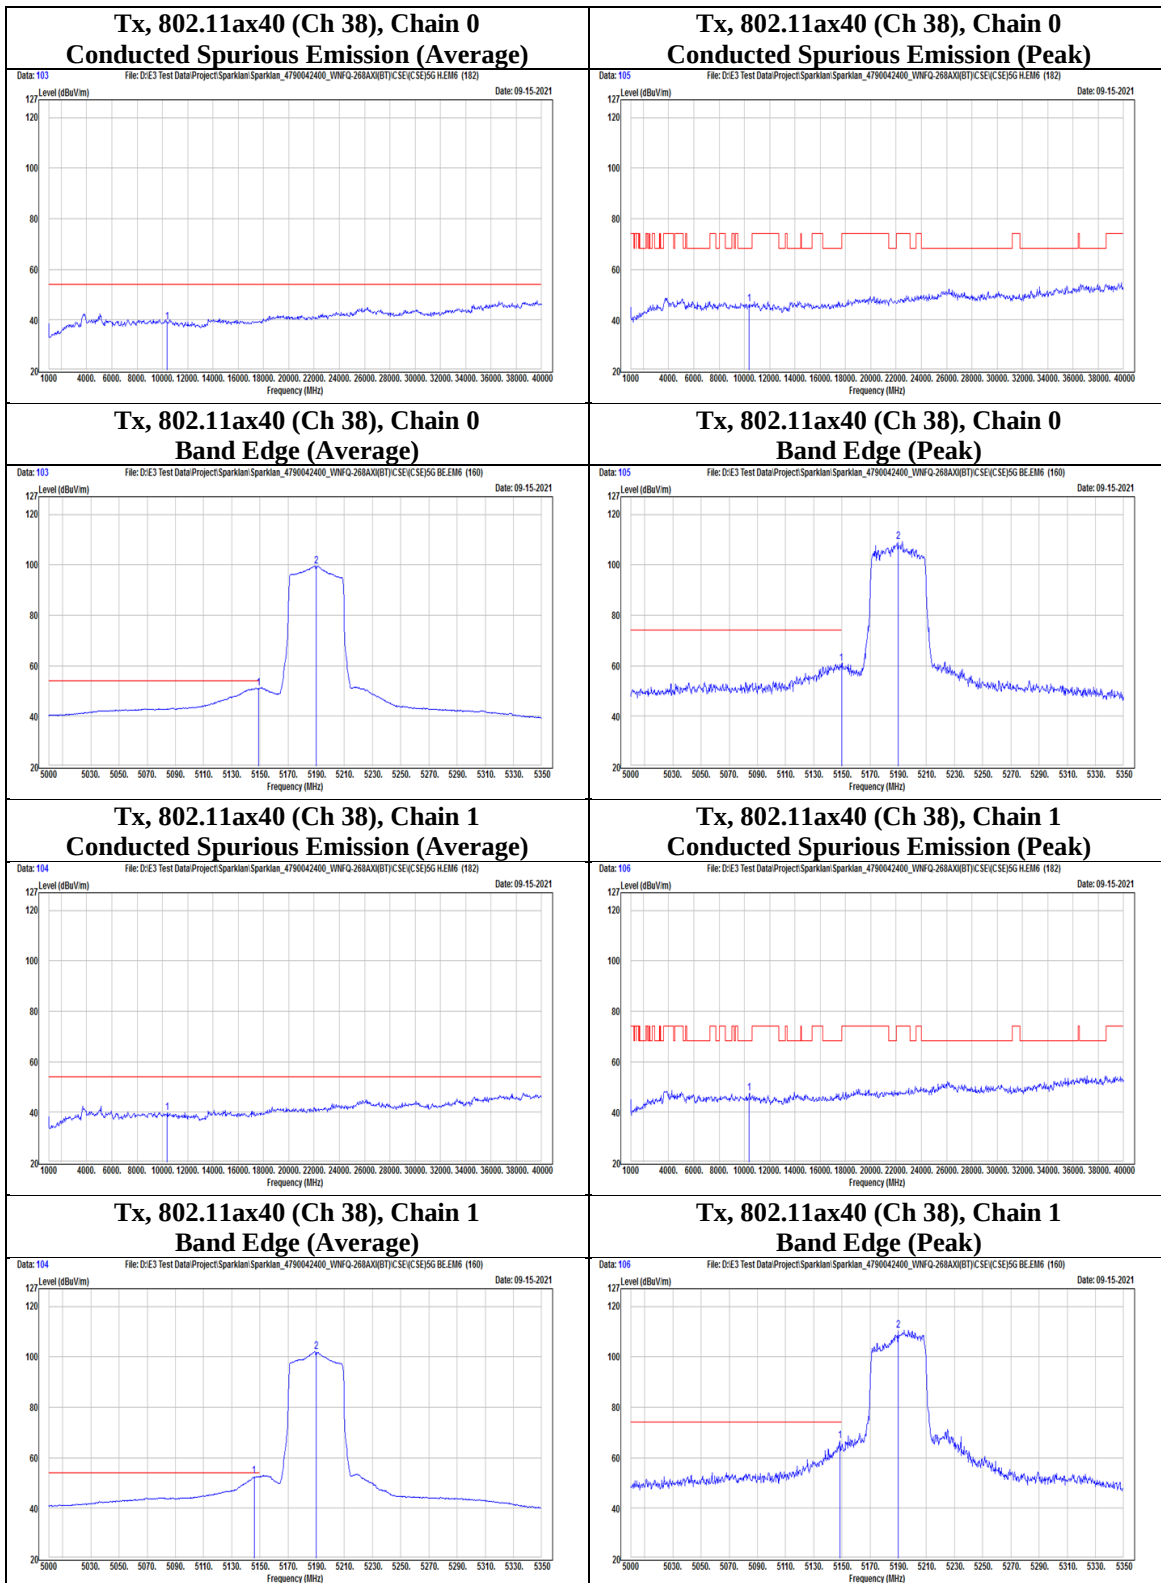

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790042400-US-R1-V0
Page : 219 of 259
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax40	Channel	46
------	------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5147	76.55	-11.74	64.81	74	-9.19	PK
		5149.8	64.63	-11.74	52.89	54	-1.11	AVG
	@	5230	124.02	-11.74	112.28	N/A	N/A	PK
	@	5230	113.93	-11.74	102.19	N/A	N/A	AVG
		10460	57.26	-11.74	45.52	68.2	-22.68	PK
		10460	50.91	-11.74	39.17	54	-14.83	AVG
		5148.4	71.86	-11.74	60.12	74	-13.88	PK
Chain 1		5149.8	61	-11.74	49.26	54	-4.74	AVG
	@	5230	126.44	-11.74	114.7	N/A	N/A	PK
	@	5230	116.97	-11.74	105.23	N/A	N/A	AVG
		10460	56.85	-11.74	45.11	68.2	-23.09	PK
		10460	50.45	-11.74	38.71	54	-15.29	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0