




Test report No. : 4790371368-US-R2-V0
Page : 161 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

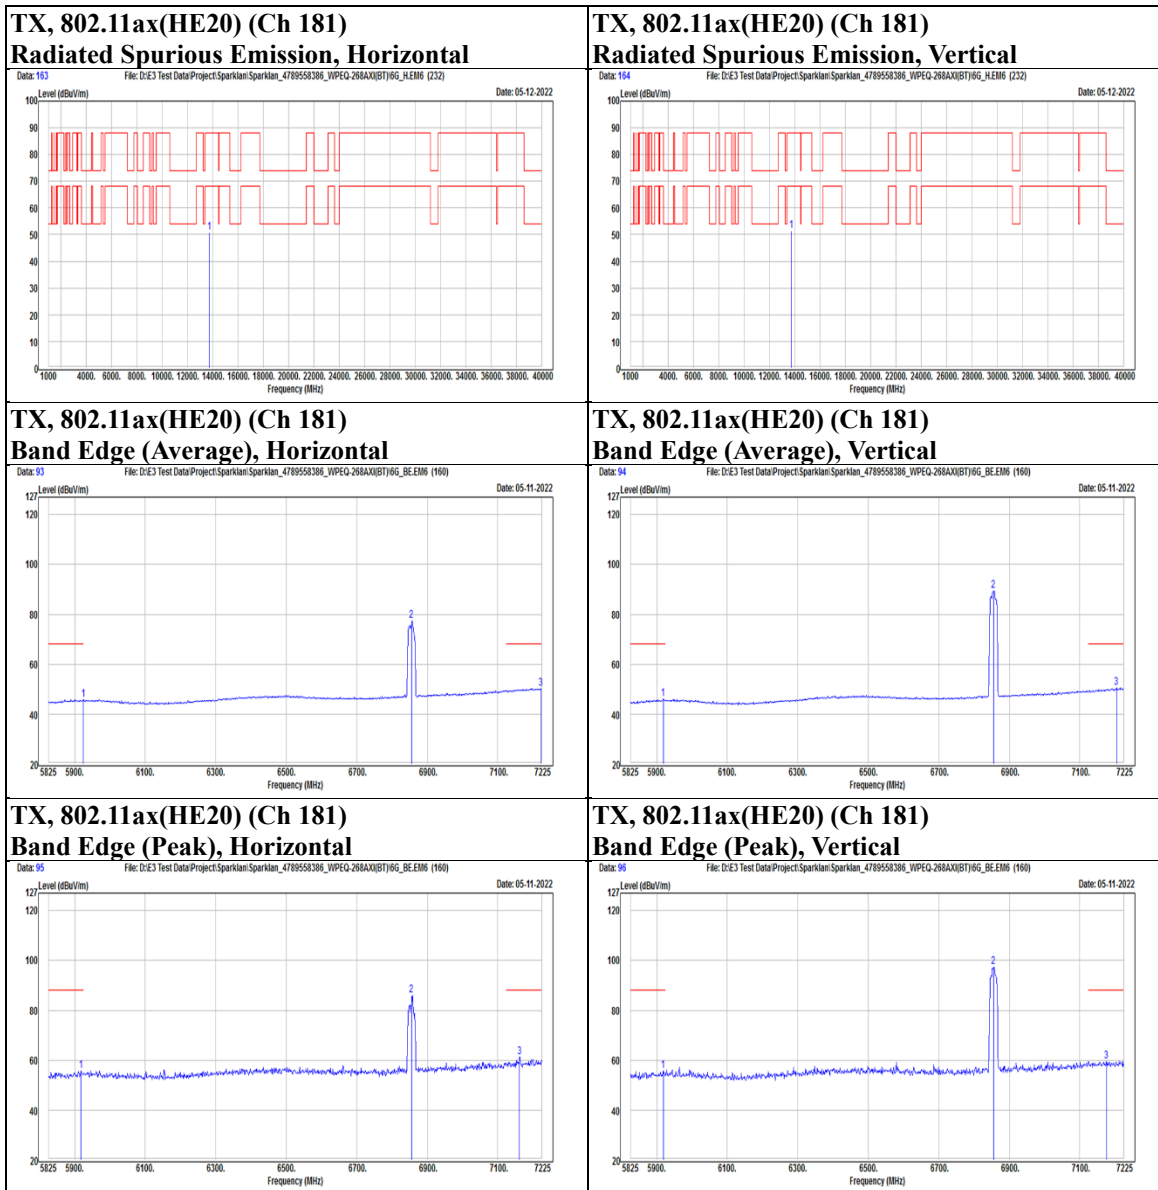

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 162 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	185
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5881	30.87	14.85	45.72	68.2	-22.48	AVG
		5889.4	41.32	14.91	56.23	88.2	-31.97	PK
	@	6875	68.49	18.3	86.79	N/A	N/A	PK
	@	6875	59.66	18.3	77.96	N/A	N/A	AVG
		7176	40.48	19.99	60.47	88.2	-27.73	PK
		7222.2	30.15	20.25	50.4	68.2	-17.8	AVG
	*	13750	28.49	22.94	51.43	88.2	-36.77	PK
Vertical		5843.2	40.82	14.61	55.43	88.2	-32.77	PK
		5889.4	30.87	14.91	45.78	68.2	-22.42	AVG
	@	6875	79.87	18.3	98.17	N/A	N/A	PK
	@	6875	71.71	18.3	90.01	N/A	N/A	AVG
		7127	40.41	19.73	60.14	88.2	-28.06	PK
		7178.8	30.51	20.01	50.52	68.2	-17.68	AVG
	*	13750	27.98	22.94	50.92	88.2	-37.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 163 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

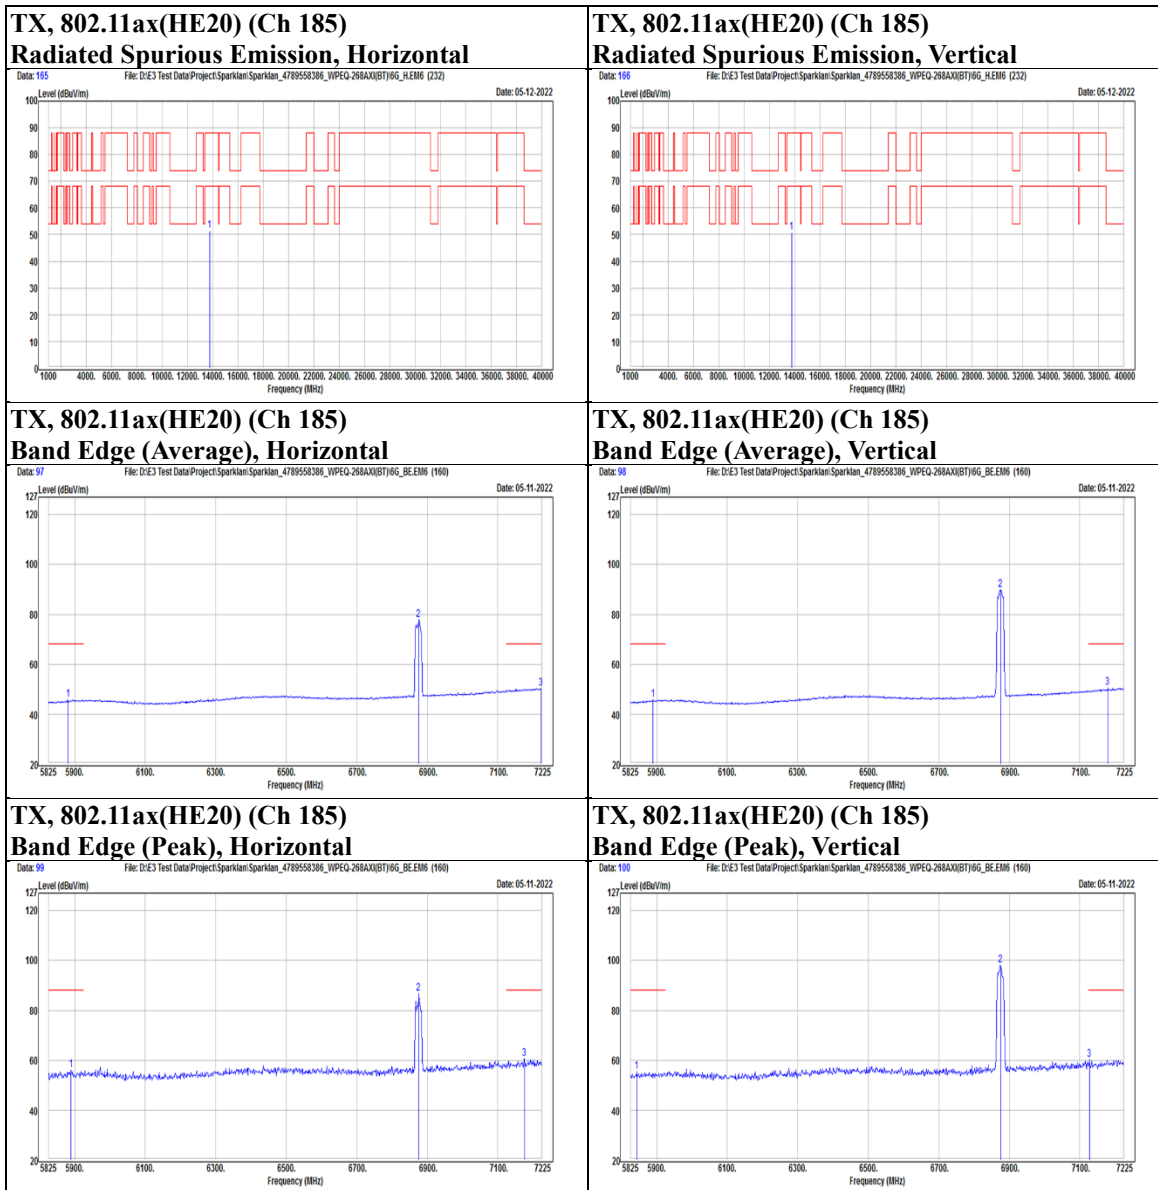

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 164 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	209
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	6995	64.6	18.71	83.31	N/A	N/A	PK
	@	6995	59.64	18.71	78.35	N/A	N/A	AVG
		7219.4	40.72	20.23	60.95	88.2	-27.25	PK
		7225	30.15	20.26	50.41	68.2	-17.79	AVG
	*	13990	28.4	23.87	52.27	88.2	-35.93	PK
Vertical	@	6995	79.53	18.71	98.24	N/A	N/A	PK
	@	6995	70.2	18.71	88.91	N/A	N/A	AVG
		7195.6	40.82	20.1	60.92	88.2	-27.28	PK
		7220.8	30.08	20.23	50.31	68.2	-17.89	AVG
	*	13990	28.61	23.87	52.48	88.2	-35.72	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 165 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

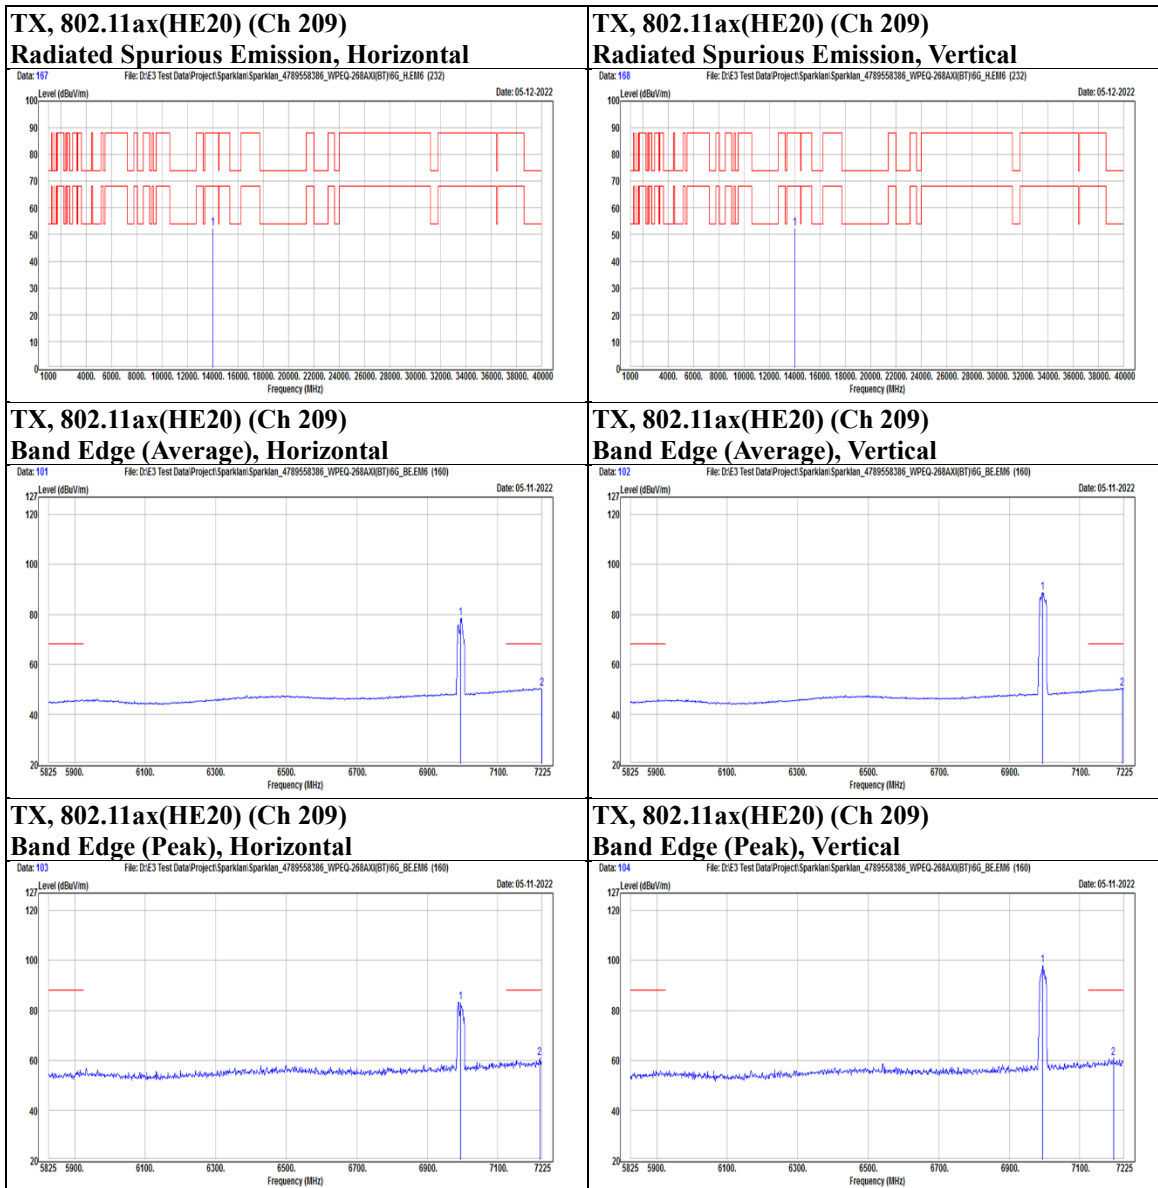

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 166 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	229
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7095	61.92	19.54	81.46	N/A	N/A	PK
	@	7095	54.27	19.54	73.81	N/A	N/A	AVG
		7155	39.86	19.88	59.74	88.2	-28.46	PK
		7216.6	30.11	20.22	50.33	68.2	-17.87	AVG
	*	14190	29.23	24.68	53.91	88.2	-34.29	PK
Vertical	@	7095	75.89	19.54	95.43	N/A	N/A	PK
	@	7095	68.82	19.54	88.36	N/A	N/A	AVG
		7206.8	40.32	20.16	60.48	88.2	-27.72	PK
		7223.6	29.88	20.25	50.13	68.2	-18.07	AVG
	*	14190	29.37	24.68	54.05	88.2	-34.15	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 167 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

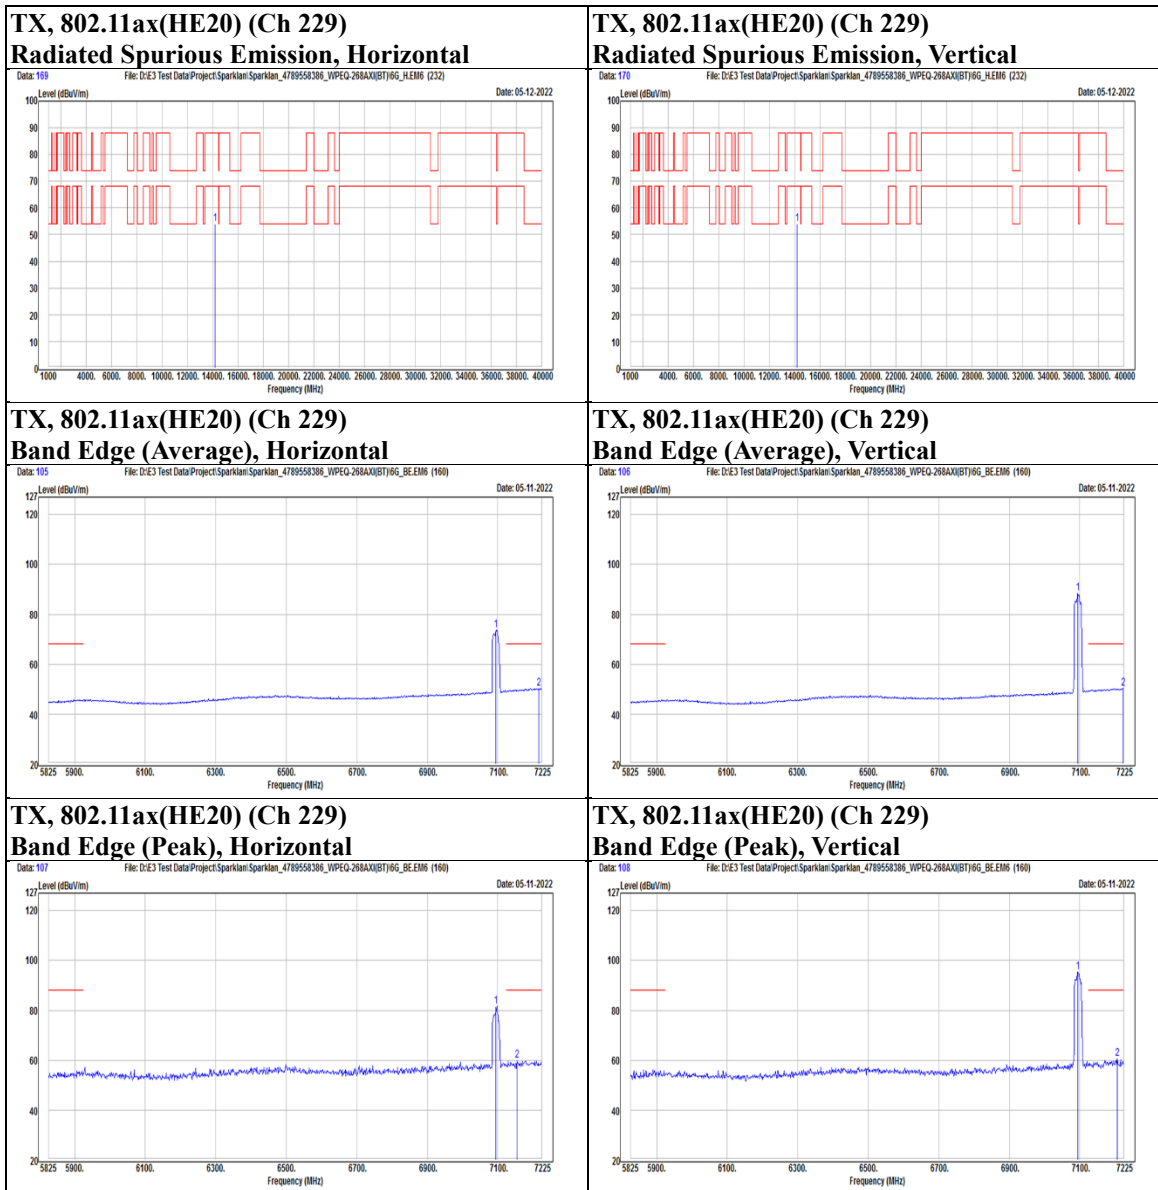

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 168 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	233
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7115	61.64	19.66	81.3	N/A	N/A	PK
	@	7115	53.31	19.66	72.97	N/A	N/A	AVG
		7125.6	49.12	19.72	68.84	88.2	-19.36	PK
		7125.6	40.58	19.72	60.3	68.2	-7.9	AVG
	*	14230	28.25	24.79	53.04	88.2	-35.16	PK
Vertical	@	7115	76.72	19.66	96.38	N/A	N/A	PK
	@	7115	69.02	19.66	88.68	N/A	N/A	AVG
		7125.6	61.09	19.72	80.81	88.2	-7.39	PK
		7125.6	46.37	19.72	66.09	68.2	-2.11	AVG
	*	14230	29.34	24.79	54.13	88.2	-34.07	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 169 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

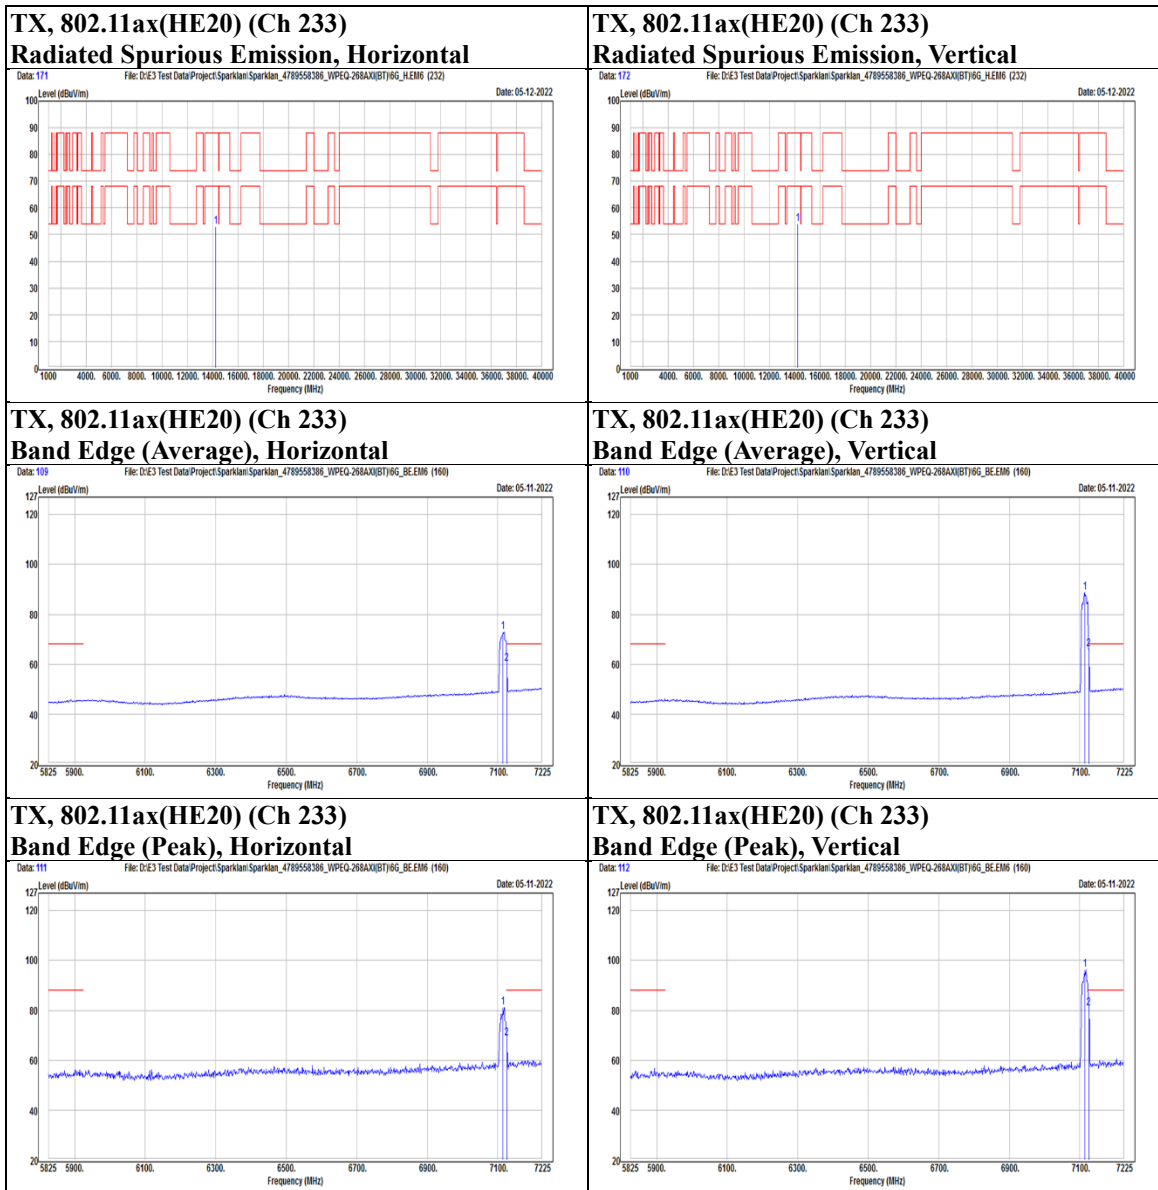

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 170 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	3
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5846	42.09	14.61	56.7	88.2	-31.5	PK
		5896.4	30.86	14.95	45.81	68.2	-22.39	AVG
	@	5965	73.46	14.95	88.41	N/A	N/A	PK
	@	5965	66.26	14.95	81.21	N/A	N/A	AVG
	*	11930	30.9	18.83	49.73	74	-24.27	PK
Vertical		5890.8	40.88	14.91	55.79	88.2	-32.41	PK
		5923	30.7	14.96	45.66	68.2	-22.54	AVG
	@	5965	82.19	14.95	97.14	N/A	N/A	PK
	@	5965	75.7	14.95	90.65	N/A	N/A	AVG
	*	11930	29.84	18.83	48.67	74	-25.33	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

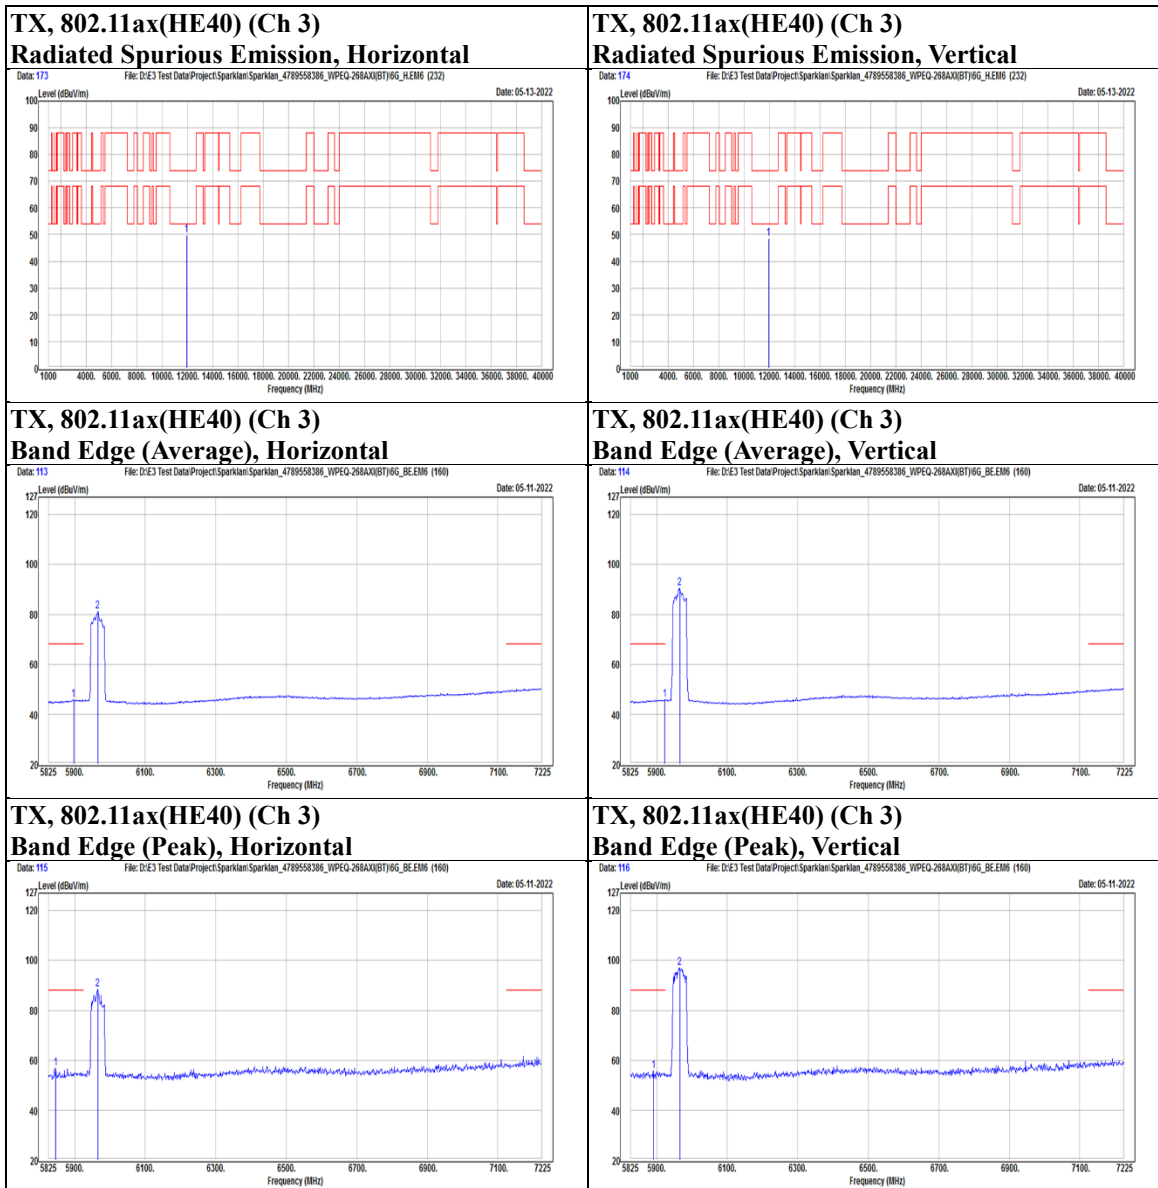



Test report No. : 4790371368-US-R2-V0
Page : 172 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	43
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5895	41.12	14.94	56.06	88.2	-32.14	PK
		5902	30.8	14.98	45.78	68.2	-22.42	AVG
	@	6165	65.43	15.46	80.89	N/A	N/A	PK
	@	6165	57.76	15.46	73.22	N/A	N/A	AVG
	*	12330	29.83	19.29	49.12	74	-24.88	PK
Vertical		5914.6	42.13	14.96	57.09	88.2	-31.11	PK
		5924.4	30.76	14.96	45.72	68.2	-22.48	AVG
	@	6165	81.98	15.46	97.44	N/A	N/A	PK
	@	6165	73.72	15.46	89.18	N/A	N/A	AVG
	*	12330	29.81	19.29	49.1	74	-24.9	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

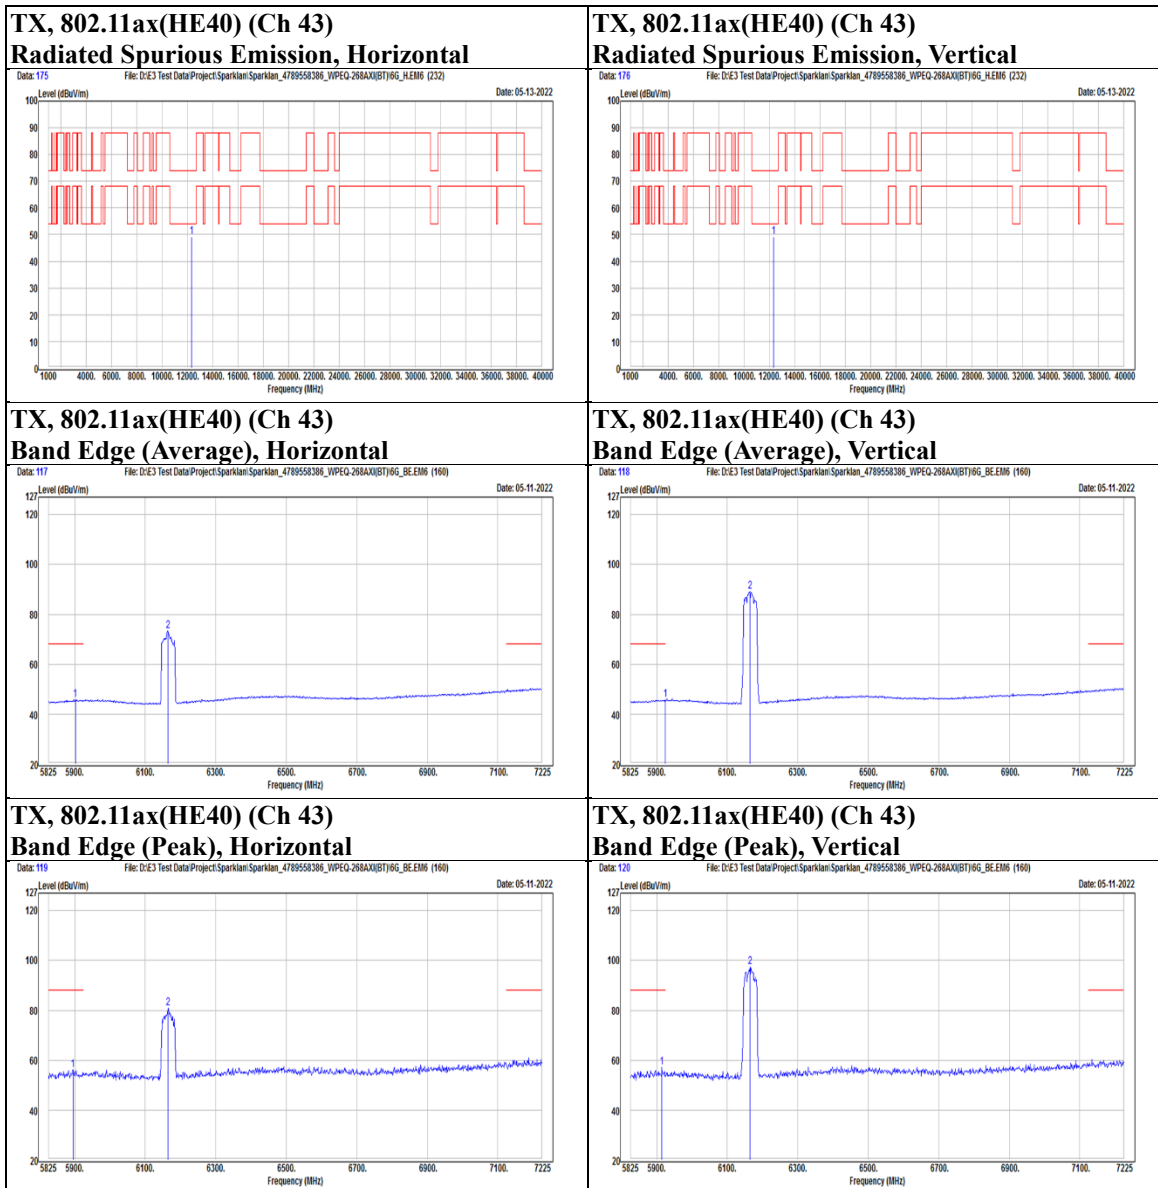



Test report No. : 4790371368-US-R2-V0
Page : 174 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	91
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5886.6	40.87	14.89	55.76	88.2	-32.44	PK
		5913.2	30.89	14.96	45.85	68.2	-22.35	AVG
	@	6405	66.56	16.69	83.25	N/A	N/A	PK
	@	6405	61.06	16.69	77.75	N/A	N/A	AVG
		7212.4	40.22	20.19	60.41	88.2	-27.79	PK
		7223.6	30.55	20.25	50.8	68.2	-17.4	AVG
	*	12810	29.51	20.56	50.07	88.2	-38.13	PK
Vertical		5902	40.77	14.98	55.75	88.2	-32.45	PK
		5909	30.73	14.97	45.7	68.2	-22.5	AVG
	@	6405	80.72	16.69	97.41	N/A	N/A	PK
	@	6405	73.25	16.69	89.94	N/A	N/A	AVG
		7171.8	40.3	19.97	60.27	88.2	-27.93	PK
		7225	30.04	20.26	50.3	68.2	-17.9	AVG
	*	12810	30.25	20.56	50.81	88.2	-37.39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

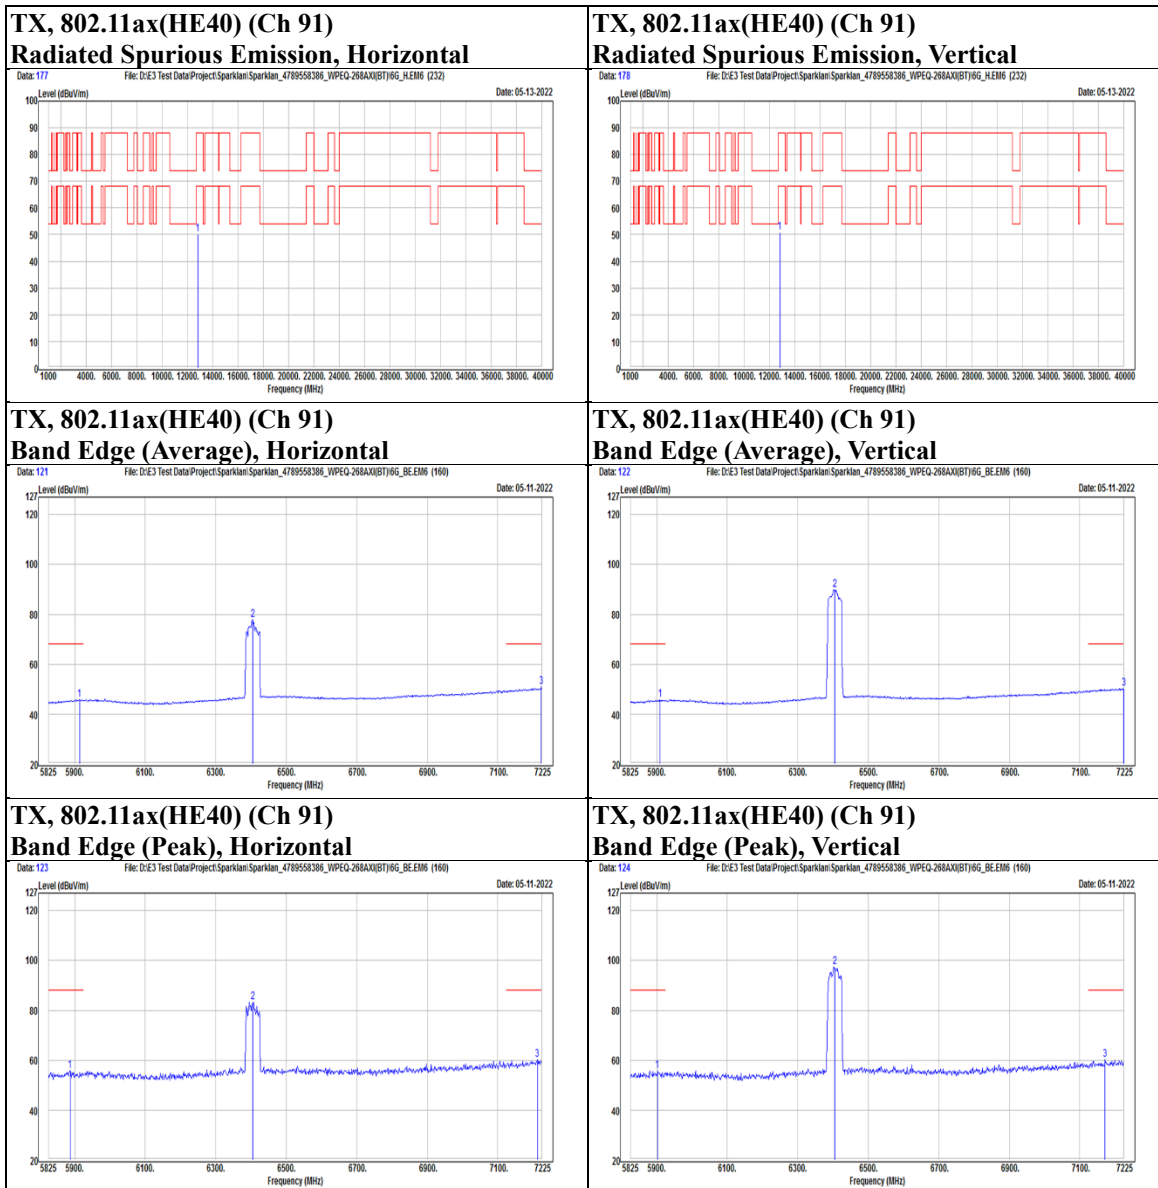



Test report No. : 4790371368-US-R2-V0
Page : 176 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	99
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5906.2	41.02	14.97	55.99	88.2	-32.21	PK
		5916	30.75	14.97	45.72	68.2	-22.48	AVG
	@	6445	64.78	16.82	81.6	N/A	N/A	PK
	@	6445	58.95	16.82	75.77	N/A	N/A	AVG
		7170.4	40.42	19.96	60.38	88.2	-27.82	PK
		7220.8	30.07	20.23	50.3	68.2	-17.9	AVG
	*	12890	29.71	20.79	50.5	88.2	-37.7	PK
Vertical		5844.6	41.5	14.61	56.11	88.2	-32.09	PK
		5921.6	30.82	14.96	45.78	68.2	-22.42	AVG
	@	6445	80.43	16.82	97.25	N/A	N/A	PK
	@	6445	72.76	16.82	89.58	N/A	N/A	AVG
		7160.6	40.92	19.91	60.83	88.2	-27.37	PK
		7212.4	30.11	20.19	50.3	68.2	-17.9	AVG
	*	12890	29.25	20.79	50.04	88.2	-38.16	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 177 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

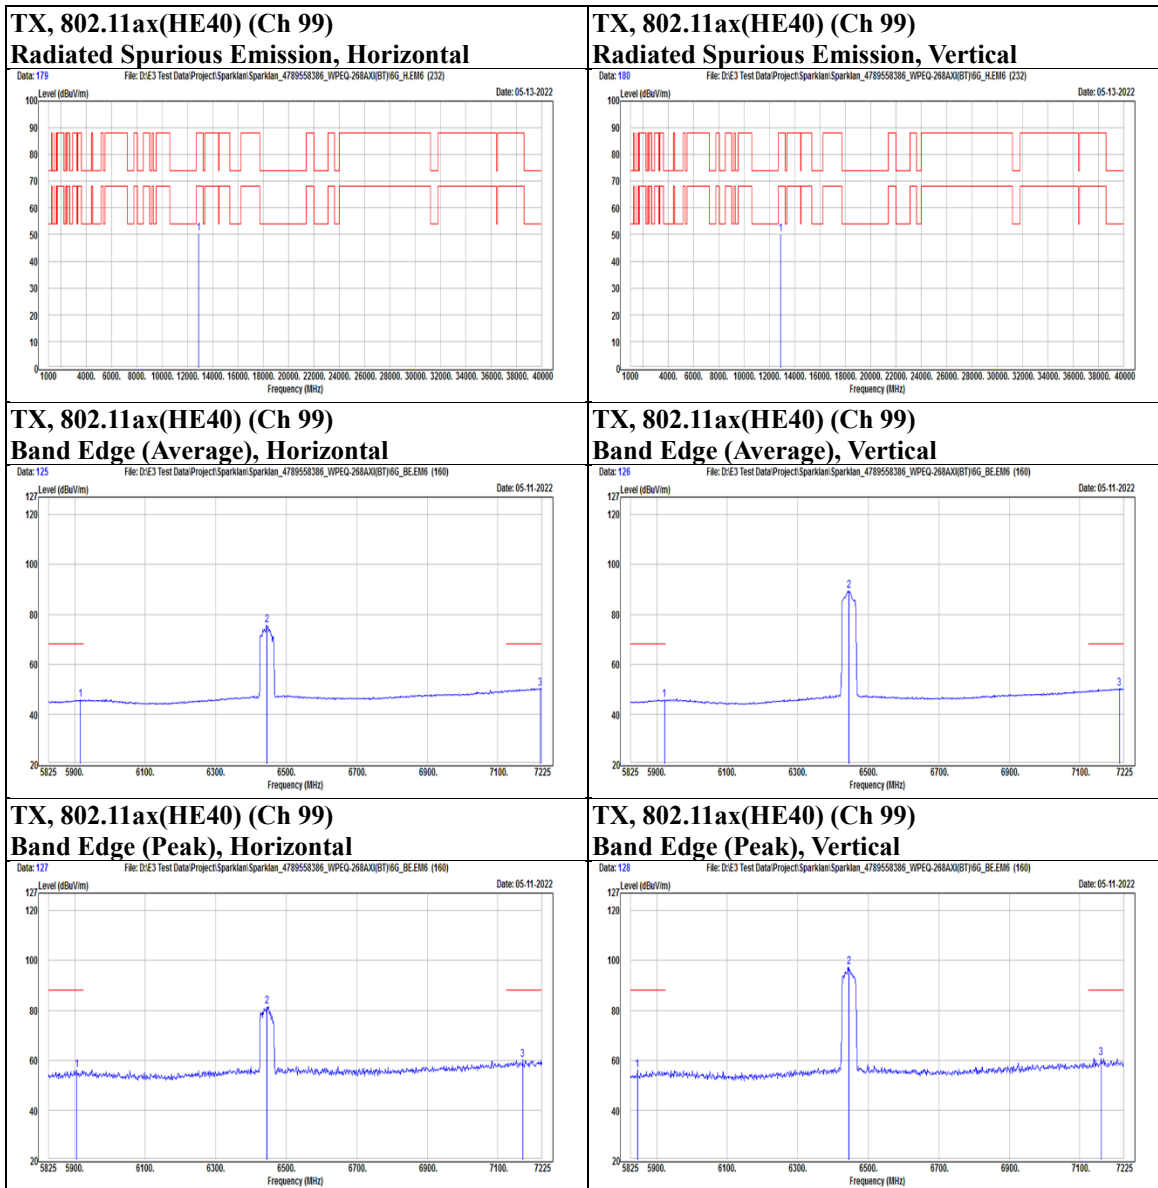

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 178 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	107
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5854.4	41.8	14.65	56.45	88.2	-31.75	PK
		5914.6	30.87	14.96	45.83	68.2	-22.37	AVG
	@	6485	65.8	17.15	82.95	N/A	N/A	PK
	@	6485	59.22	17.15	76.37	N/A	N/A	AVG
		7181.6	40.58	20.03	60.61	88.2	-27.59	PK
		7205.4	30.07	20.15	50.22	68.2	-17.98	AVG
	*	12970	29.2	20.88	50.08	88.2	-38.12	PK
Vertical		5906.2	41	14.97	55.97	88.2	-32.23	PK
		5920.2	30.84	14.96	45.8	68.2	-22.4	AVG
	@	6485	80.67	17.15	97.82	N/A	N/A	PK
	@	6485	72.63	17.15	89.78	N/A	N/A	AVG
		7142.4	40.89	19.81	60.7	88.2	-27.5	PK
		7220.8	30.09	20.23	50.32	68.2	-17.88	AVG
	*	12970	29.81	20.88	50.69	88.2	-37.51	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

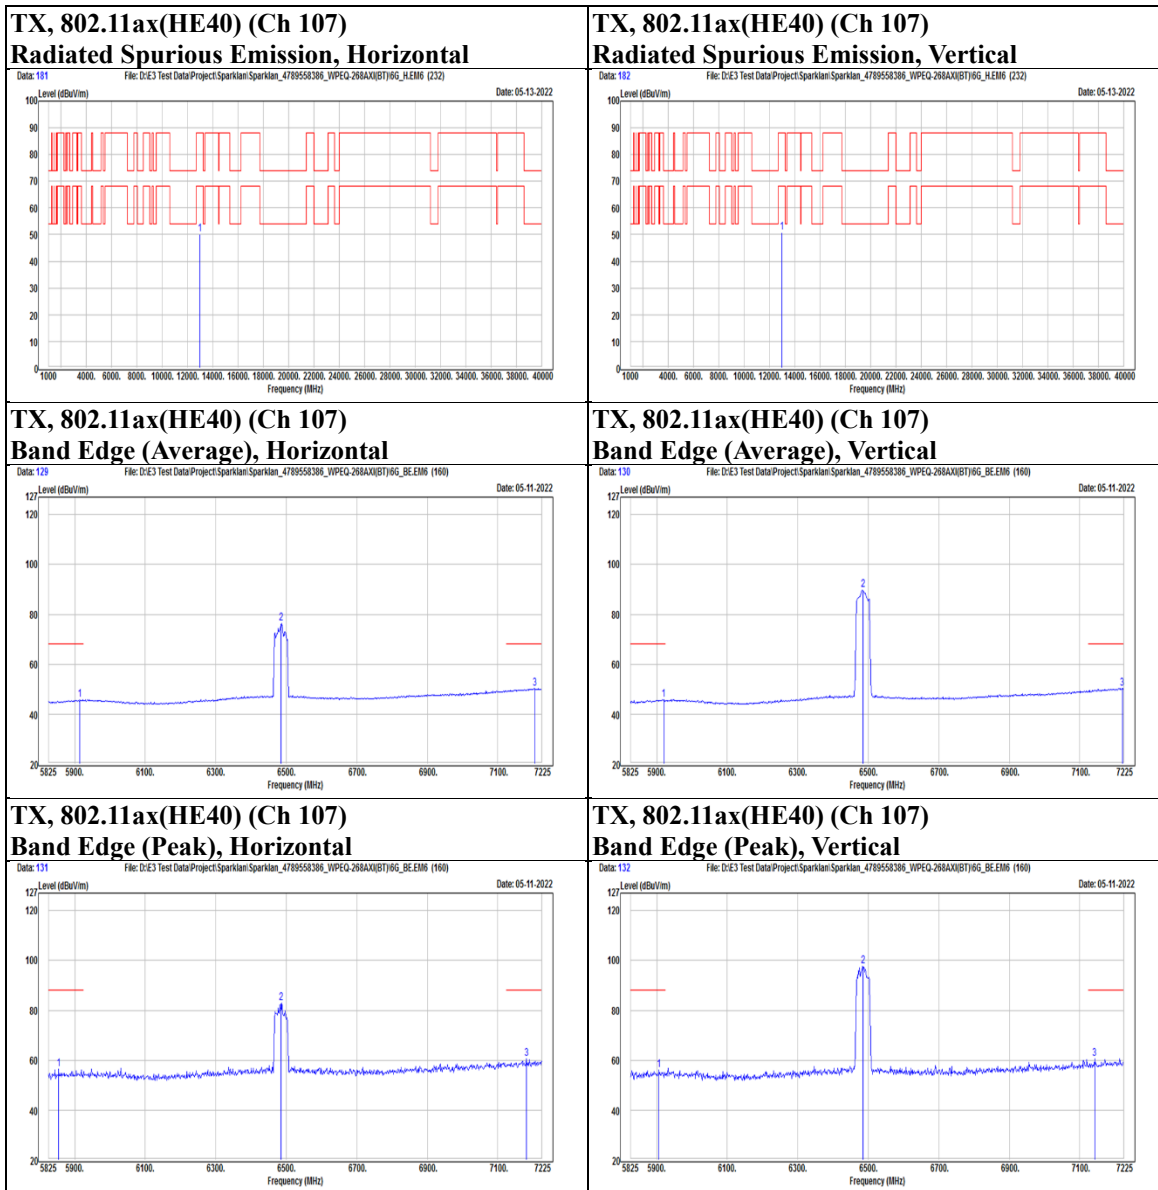



Test report No. : 4790371368-US-R2-V0
Page : 180 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	115
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5830.6	40.65	14.59	55.24	88.2	-32.96	PK
		5897.8	30.8	14.96	45.76	68.2	-22.44	AVG
	@	6525	63.46	17.32	80.78	N/A	N/A	PK
	@	6525	57.19	17.32	74.51	N/A	N/A	AVG
		7204	40.75	20.15	60.9	88.2	-27.3	PK
		7208.2	30.27	20.17	50.44	68.2	-17.76	AVG
	*	13050	29.05	20.98	50.03	88.2	-38.17	PK
Vertical		5855.8	41.09	14.65	55.74	88.2	-32.46	PK
		5924.4	30.68	14.96	45.64	68.2	-22.56	AVG
	@	6525	78.61	17.32	95.93	N/A	N/A	PK
	@	6525	71.17	17.32	88.49	N/A	N/A	AVG
		7195.6	40.25	20.1	60.35	88.2	-27.85	PK
		7219.4	30.08	20.23	50.31	68.2	-17.89	AVG
	*	13050	28.78	20.98	49.76	88.2	-38.44	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

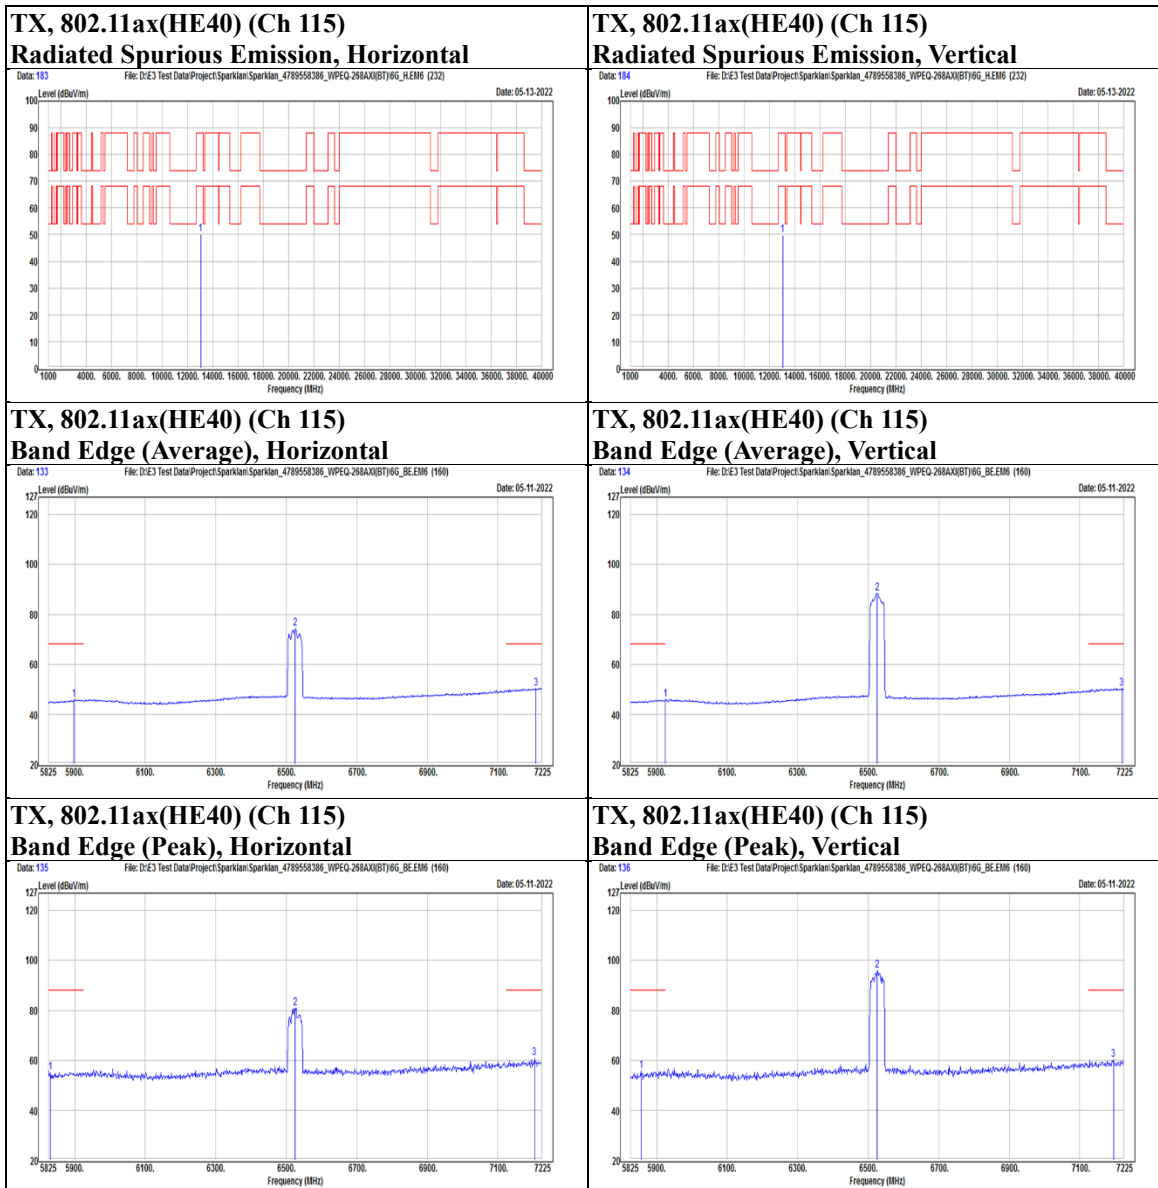



Test report No. : 4790371368-US-R2-V0
Page : 182 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	123
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5839	40.96	14.6	55.56	88.2	-32.64	PK
		5890.8	30.84	14.91	45.75	68.2	-22.45	AVG
	@	6565	67.17	17.37	84.54	N/A	N/A	PK
	@	6565	57.95	17.37	75.32	N/A	N/A	AVG
		7143.8	39.93	19.82	59.75	88.2	-28.45	PK
		7218	29.79	20.22	50.01	68.2	-18.19	AVG
	*	13130	29.79	21.13	50.92	88.2	-37.28	PK
Vertical		5874	31.16	14.79	45.95	68.2	-22.25	AVG
		5923	41.25	14.96	56.21	88.2	-31.99	PK
	@	6565	79.62	17.37	96.99	N/A	N/A	PK
	@	6565	70.85	17.37	88.22	N/A	N/A	AVG
		7212.4	39.65	20.19	59.84	88.2	-28.36	PK
		7220.8	29.64	20.23	49.87	68.2	-18.33	AVG
	*	13130	30.25	21.13	51.38	88.2	-36.82	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

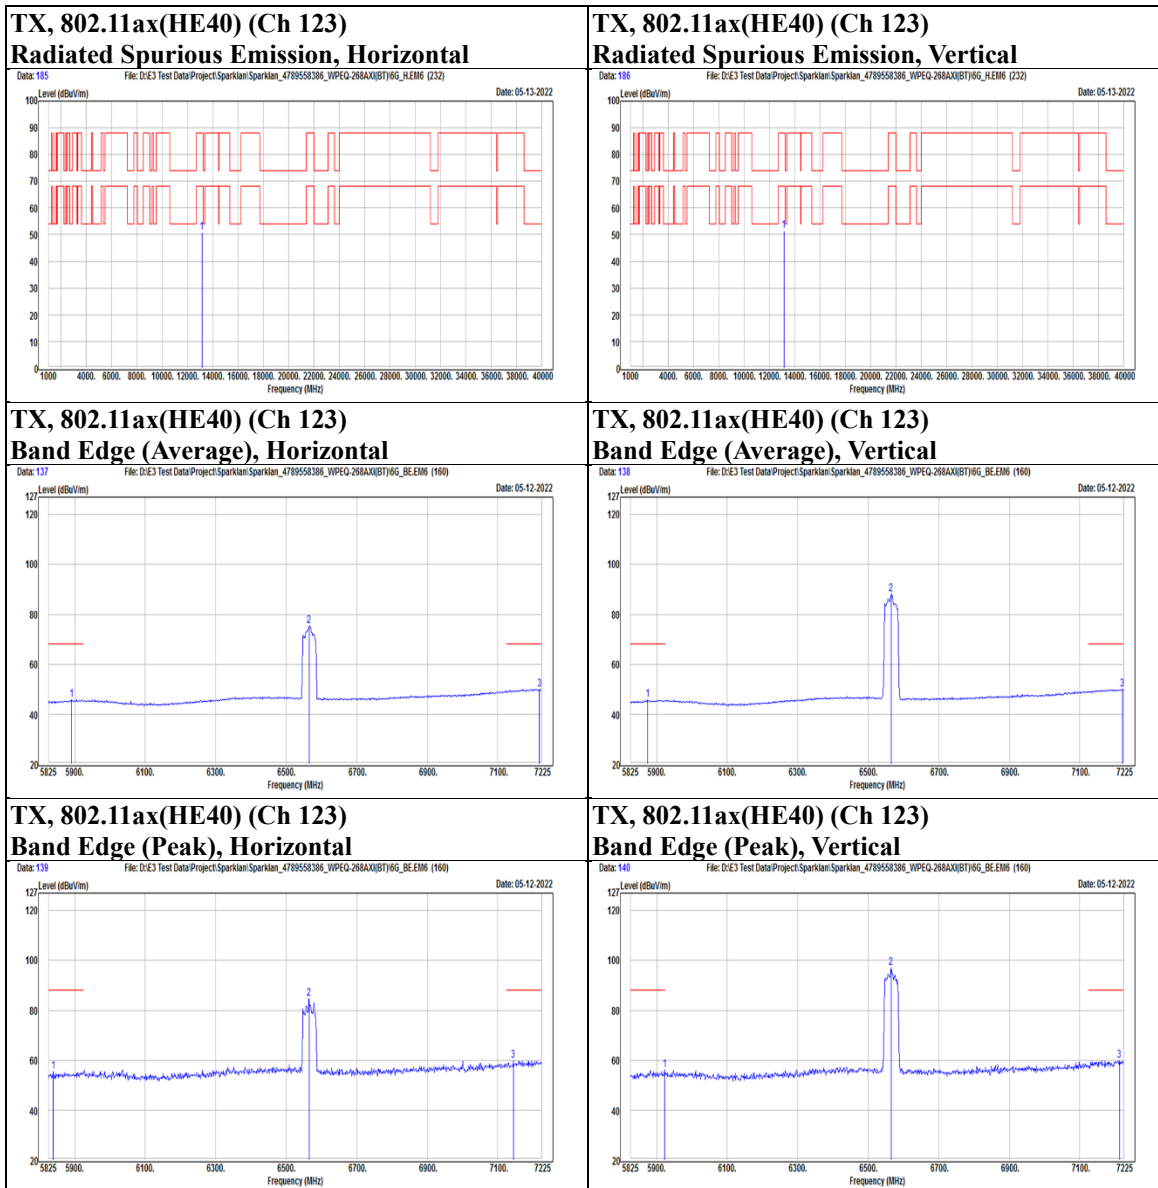



Test report No. : 4790371368-US-R2-V0
Page : 184 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5855.8	42.18	14.65	56.83	88.2	-31.37	PK
		5904.8	30.86	14.97	45.83	68.2	-22.37	AVG
	@	6725	66.41	17.54	83.95	N/A	N/A	PK
	@	6725	57.92	17.54	75.46	N/A	N/A	AVG
		7180.2	39.97	20.02	59.99	88.2	-28.21	PK
		7209.6	29.72	20.18	49.9	68.2	-18.3	AVG
	*	13450	28.93	22.34	51.27	88.2	-36.93	PK
Vertical		5920.2	30.89	14.96	45.85	68.2	-22.35	AVG
		5924.4	40.78	14.96	55.74	88.2	-32.46	PK
	@	6725	79.49	17.54	97.03	N/A	N/A	PK
	@	6725	70.92	17.54	88.46	N/A	N/A	AVG
		7205.4	39.9	20.15	60.05	88.2	-28.15	PK
		7225	29.85	20.26	50.11	68.2	-18.09	AVG
	*	13450	28.31	22.34	50.65	88.2	-37.55	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

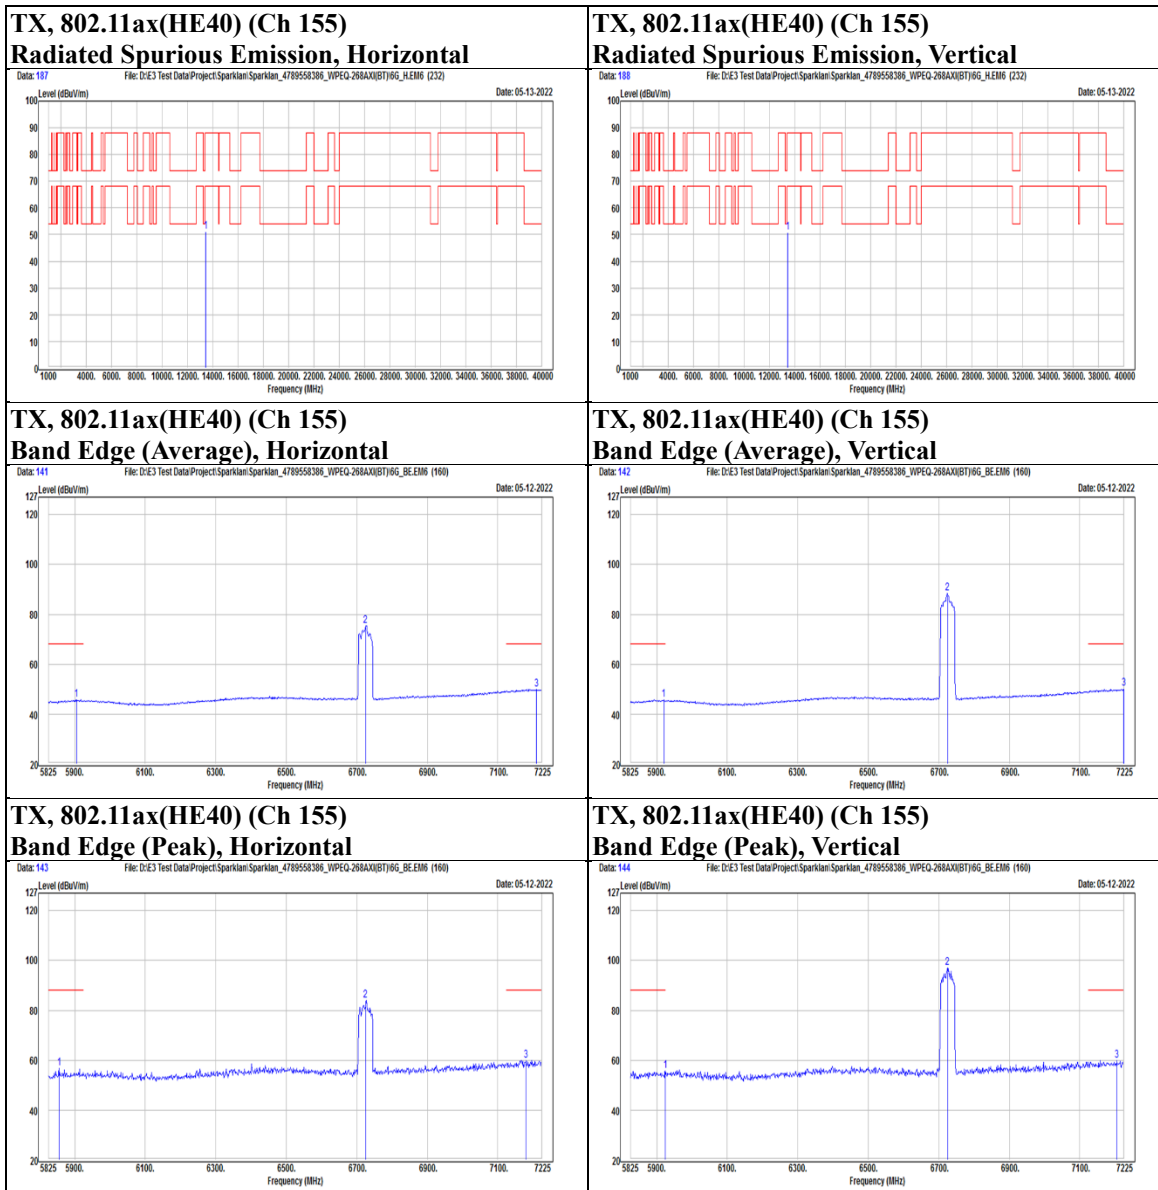



Test report No. : 4790371368-US-R2-V0
Page : 186 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	179
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5889.4	40.53	14.91	55.44	88.2	-32.76	PK
		5902	30.78	14.98	45.76	68.2	-22.44	AVG
	@	6845	65.69	18.24	83.93	N/A	N/A	PK
	@	6845	57.55	18.24	75.79	N/A	N/A	AVG
		7202.6	29.71	20.14	49.85	68.2	-18.35	AVG
		7212.4	40.62	20.19	60.81	88.2	-27.39	PK
	*	13690	30.26	22.77	53.03	88.2	-35.17	PK
Vertical		5889.4	40.64	14.91	55.55	88.2	-32.65	PK
		5897.8	30.77	14.96	45.73	68.2	-22.47	AVG
	@	6845	79.09	18.24	97.33	N/A	N/A	PK
	@	6845	71.38	18.24	89.62	N/A	N/A	AVG
		7208.2	29.73	20.17	49.9	68.2	-18.3	AVG
		7209.6	40.67	20.18	60.85	88.2	-27.35	PK
	*	13690	30.11	22.77	52.88	88.2	-35.32	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 187 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

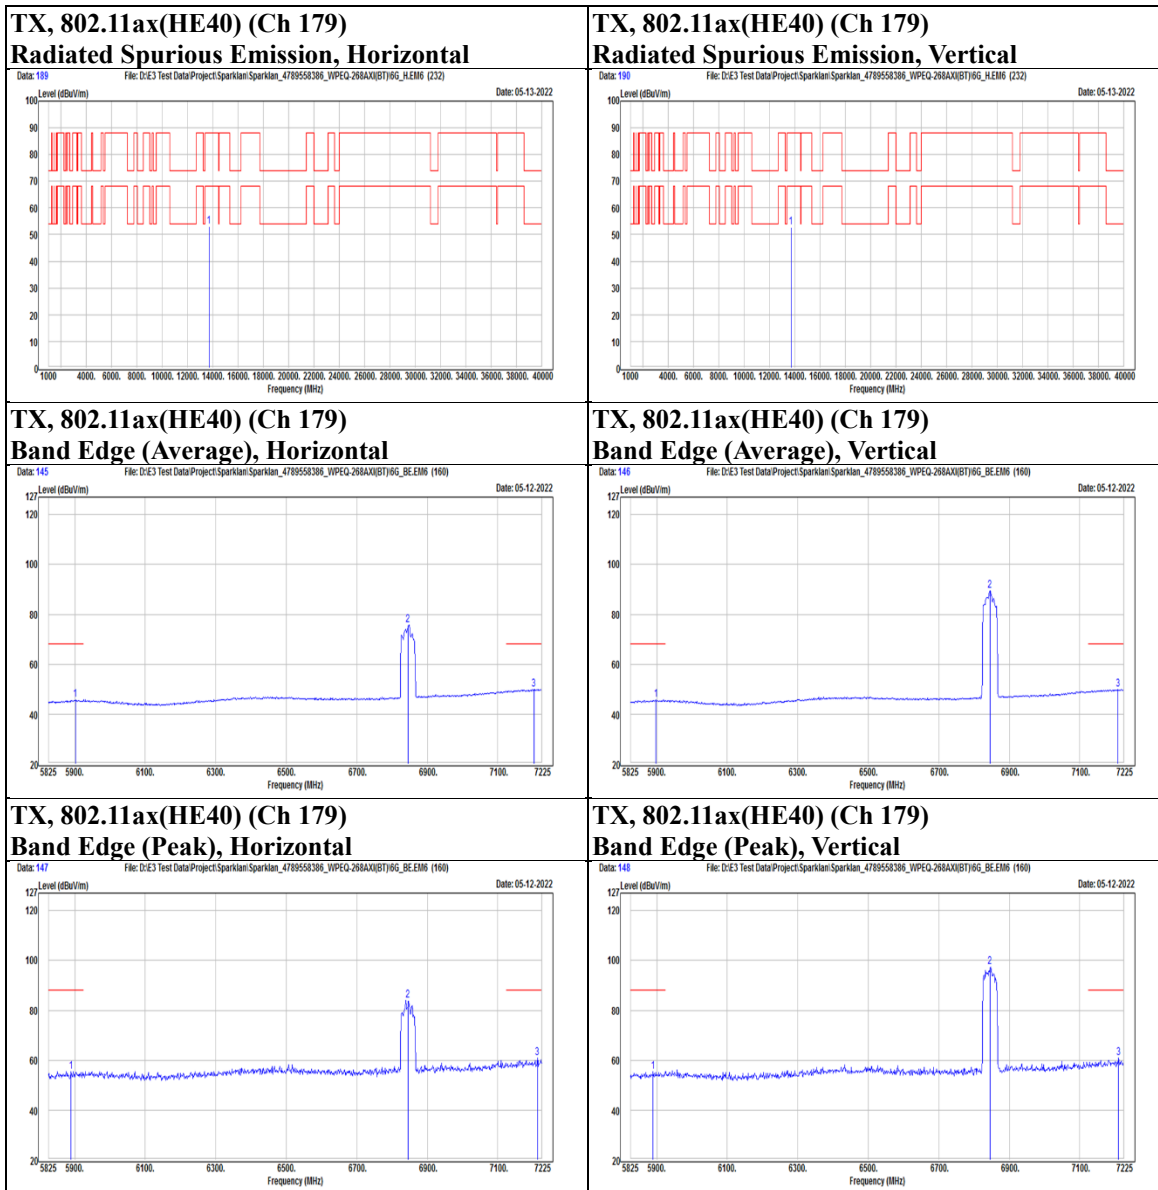

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 188 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	187
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5865.6	40.56	14.73	55.29	88.2	-32.91	PK
		5904.8	30.71	14.97	45.68	68.2	-22.52	AVG
	@	6885	64.46	18.3	82.76	N/A	N/A	PK
	@	6885	57.23	18.3	75.53	N/A	N/A	AVG
		7197	30	20.11	50.11	68.2	-18.09	AVG
		7220.8	41.01	20.23	61.24	88.2	-26.96	PK
	*	13770	30.53	23.01	53.54	88.2	-34.66	PK
Vertical		5903.4	31.11	14.97	46.08	68.2	-22.12	AVG
		5904.8	40.93	14.97	55.9	88.2	-32.3	PK
	@	6885	78.4	18.3	96.7	N/A	N/A	PK
	@	6885	69.33	18.3	87.63	N/A	N/A	AVG
		7157.8	30.13	19.89	50.02	68.2	-18.18	AVG
		7208.2	40.42	20.17	60.59	88.2	-27.61	PK
	*	13770	30.56	23.01	53.57	88.2	-34.63	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

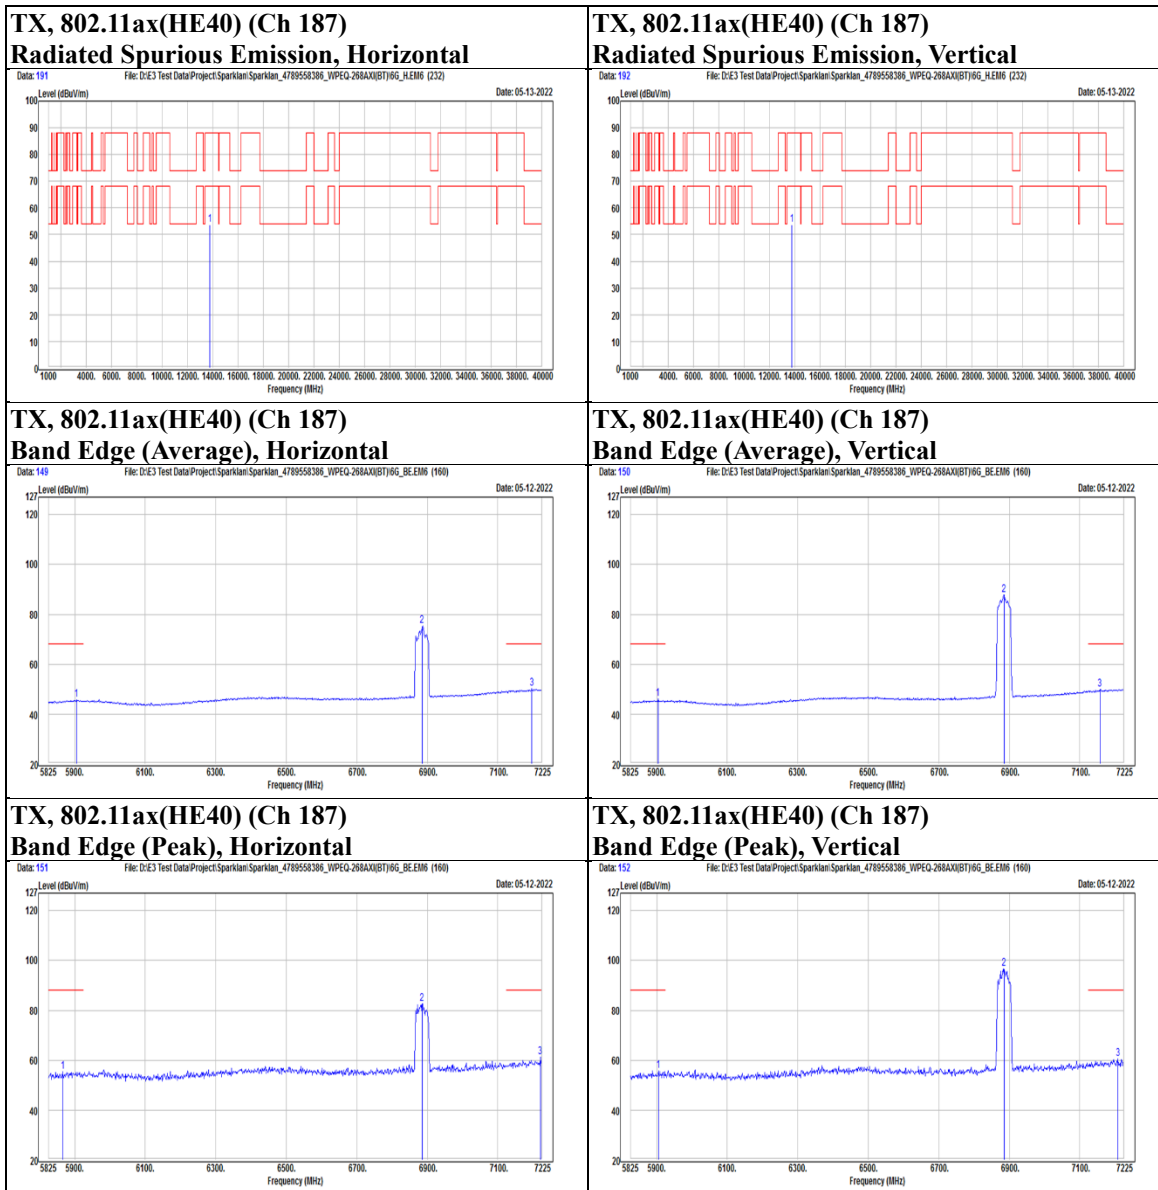



Test report No. : 4790371368-US-R2-V0
Page : 190 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	211
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7005	64.25	18.78	83.03	N/A	N/A	PK
	@	7005	55.51	18.78	74.29	N/A	N/A	AVG
		7171.8	40.65	19.97	60.62	88.2	-27.58	PK
		7220.8	29.53	20.23	49.76	68.2	-18.44	AVG
	*	14010	30.17	23.96	54.13	88.2	-34.07	PK
Vertical	@	7005	77.65	18.78	96.43	N/A	N/A	PK
	@	7005	68.14	18.78	86.92	N/A	N/A	AVG
		7191.4	39.54	20.08	59.62	88.2	-28.58	PK
		7222.2	29.91	20.25	50.16	68.2	-18.04	AVG
	*	14010	30.69	23.96	54.65	88.2	-33.55	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 191 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

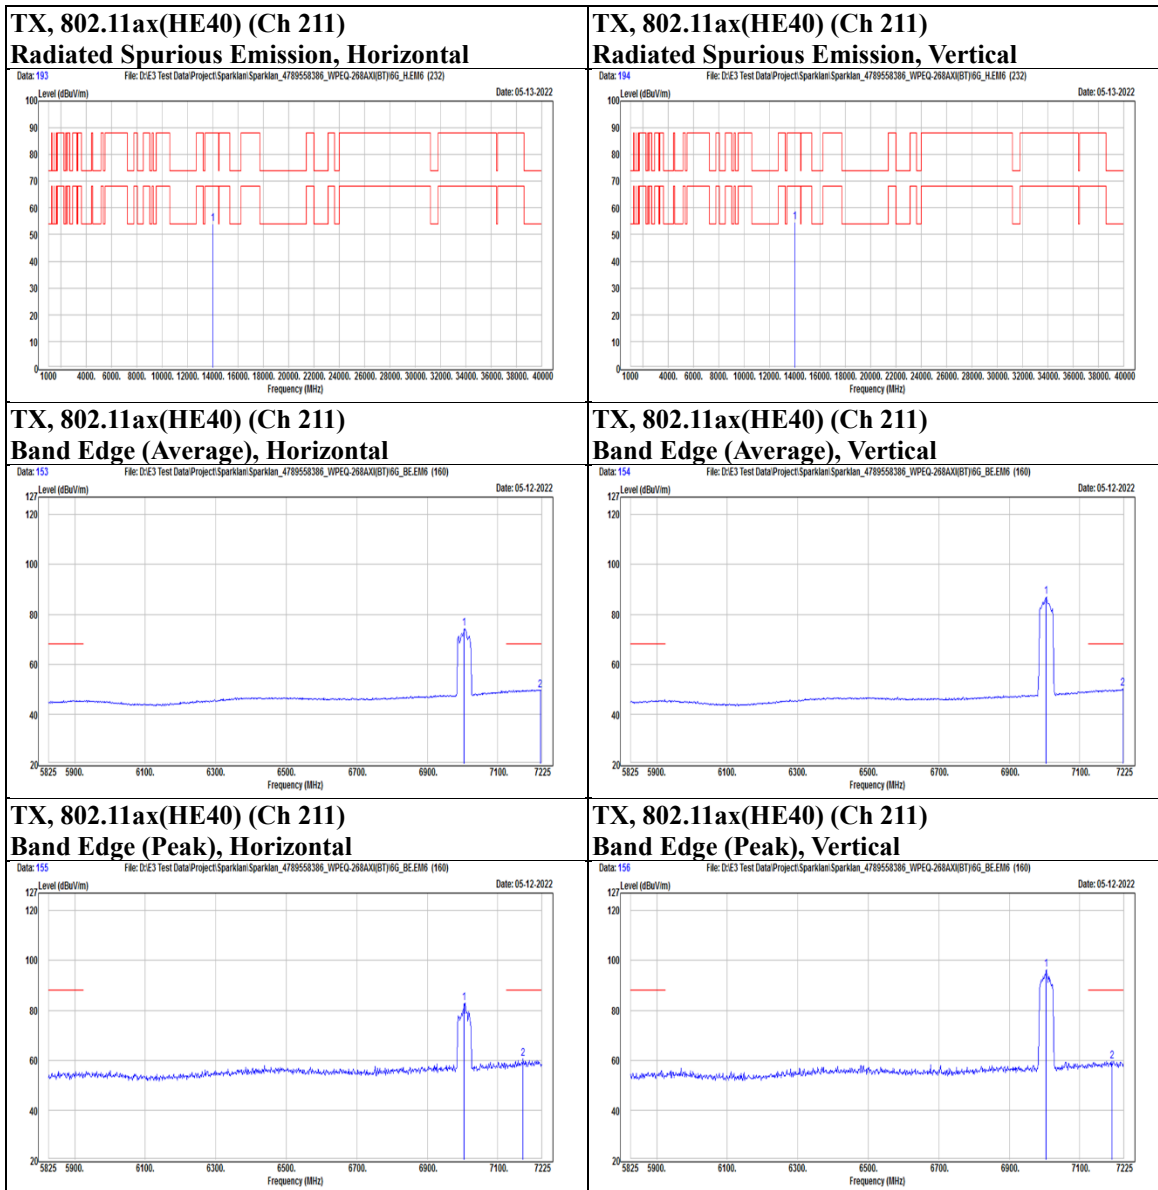

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 192 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	227
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7085	64.46	19.47	83.93	N/A	N/A	PK
	@	7085	55.12	19.47	74.59	N/A	N/A	AVG
		7180.2	40.55	20.02	60.57	88.2	-27.63	PK
		7213.8	29.77	20.2	49.97	68.2	-18.23	AVG
	*	14170	29.69	24.64	54.33	88.2	-33.87	PK
Vertical	@	7085	77.06	19.47	96.53	N/A	N/A	PK
	@	7085	68.34	19.47	87.81	N/A	N/A	AVG
		7204	29.82	20.15	49.97	68.2	-18.23	AVG
		7211	40.01	20.18	60.19	88.2	-28.01	PK
	*	14170	30.06	24.64	54.7	88.2	-33.5	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0