

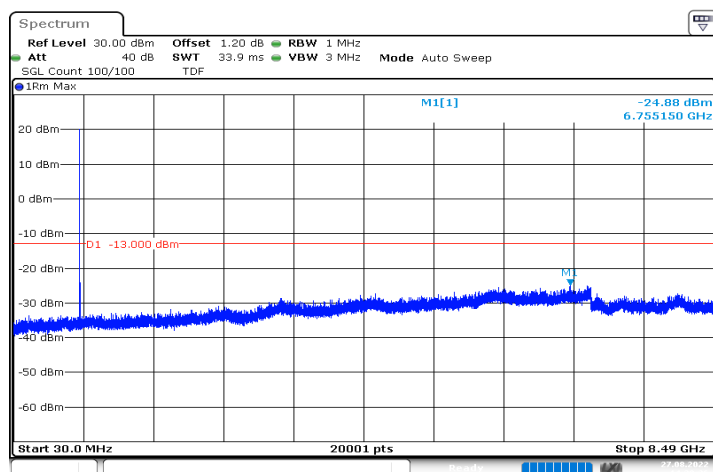
Spurious emissions at antenna terminals

DC_2A_n5A , Normal

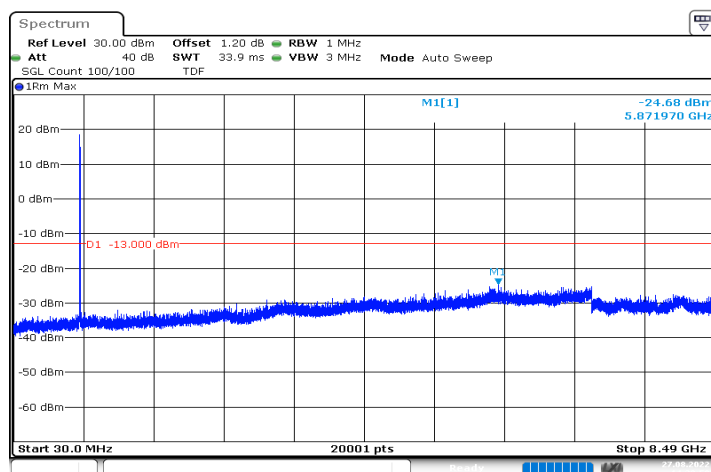
Mode	Value (dBm)	Limit (dBm)	Result
DC_2A_n5A_10MHz 5MHz_15kHz_1880MHz 826.5MHz_DFT-s-OFDM QPSK_RB0 RB1@0 30MHz_8.49GHz	-24.88	-13	Pass
DC_2A_n5A_10MHz 5MHz_15kHz_1880MHz 826.5MHz_DFT-s-OFDM QPSK_RB0 RB25@0 30MHz_8.49GHz	-24.68	-13	Pass
DC_2A_n5A_10MHz 5MHz_15kHz_1880MHz 836.5MHz_DFT-s-OFDM QPSK_RB0 RB25@0 30MHz_8.49GHz	-25.42	-13	Pass
DC_2A_n5A_10MHz 5MHz_15kHz_1880MHz 846.5MHz_DFT-s-OFDM QPSK_RB0 RB1@24 30MHz_8.49GHz	-24.53	-13	Pass
DC_2A_n5A_10MHz 5MHz_15kHz_1880MHz 846.5MHz_DFT-s-OFDM QPSK_RB0 RB25@0 30MHz_8.49GHz	-24.85	-13	Pass
DC_2A_n5A_10MHz 10MHz_15kHz_1880MHz 829MHz_DFT-s-OFDM QPSK_RB0 RB1@0 30MHz_8.49GHz	-25.16	-13	Pass
DC_2A_n5A_10MHz 10MHz_15kHz_1880MHz 829MHz_DFT-s-OFDM QPSK_RB0 RB50@0 30MHz_8.49GHz	-25.47	-13	Pass
DC_2A_n5A_10MHz 10MHz_15kHz_1880MHz 836.5MHz_DFT-s-OFDM QPSK_RB0 RB50@0 30MHz_8.49GHz	-25.34	-13	Pass
DC_2A_n5A_10MHz 10MHz_15kHz_1880MHz 844MHz_DFT-s-OFDM QPSK_RB0 RB1@51 30MHz_8.49GHz	-24.65	-13	Pass
DC_2A_n5A_10MHz 10MHz_15kHz_1880MHz 844MHz_DFT-s-OFDM QPSK_RB0 RB50@0 30MHz_8.49GHz	-25.06	-13	Pass
DC_2A_n5A_10MHz 15MHz_15kHz_1880MHz 831.5MHz_DFT-s-OFDM QPSK_RB0 RB1@0 30MHz_8.49GHz	-25.28	-13	Pass
DC_2A_n5A_10MHz 15MHz_15kHz_1880MHz 831.5MHz_DFT-s-OFDM QPSK_RB0 RB75@0 30MHz_8.49GHz	-25.02	-13	Pass
DC_2A_n5A_10MHz 15MHz_15kHz_1880MHz 841.5MHz_DFT-s-OFDM QPSK_RB0 RB1@78 30MHz_8.49GHz	-25.18	-13	Pass
DC_2A_n5A_10MHz 20MHz_15kHz_1880MHz 834MHz_DFT-s-OFDM QPSK_RB0 RB1@0 30MHz_8.49GHz	-21.71	-13	Pass
DC_2A_n5A_10MHz 20MHz_15kHz_1880MHz 834MHz_DFT-s-OFDM QPSK_RB0 RB100@0 30MHz_8.49GHz	-25.33	-13	Pass
DC_2A_n5A_10MHz 20MHz_15kHz_1880MHz 836.5MHz_DFT-s-OFDM QPSK_RB0 RB100@0 30MHz_8.49GHz	-24.96	-13	Pass
DC_2A_n5A_10MHz 20MHz_15kHz_1880MHz 839MHz_DFT-s-OFDM QPSK_RB0 RB1@105 30MHz_8.49GHz	-24.8	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
DC_2A_n5A_10MHz 20MHz_15kHz_1880MHz 839MHz_DFT-s-OFDM QPSK_RB0 RB100@0 30MHz_8.49GHz	-25.1	-13	Pass
DC_2A_n5A_10MHz 15MHz_15kHz_1880MHz 836.5MHz_DFT-s-OFDM QPSK_RB0 RB75@0 30MHz_8.49GHz	-25.24	-13	Pass
DC_2A_n5A_10MHz 15MHz_15kHz_1880MHz 841.5MHz_DFT-s-OFDM QPSK_RB0 RB75@0 30MHz_8.49GHz	-25.08	-13	Pass

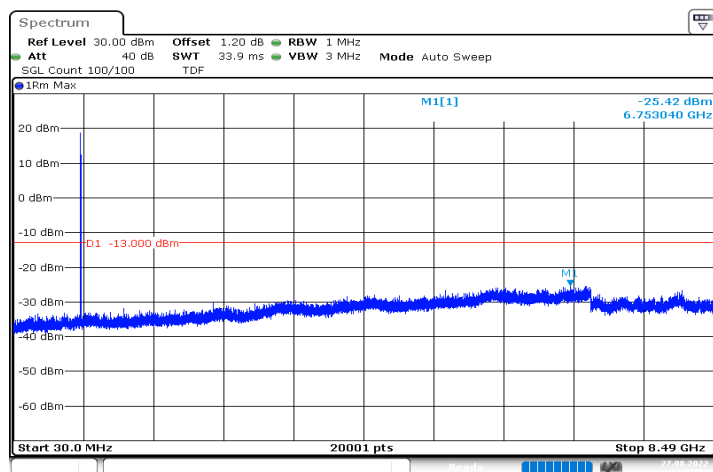
DC_2A_n5A , Normal

DC_2A_n5A_10MHz|5MHz_15kHz_1880MHz|826.5MHz_DFT
-s-OFDM QPSK_RB0|RB1@0|30MHz_8.49GHz

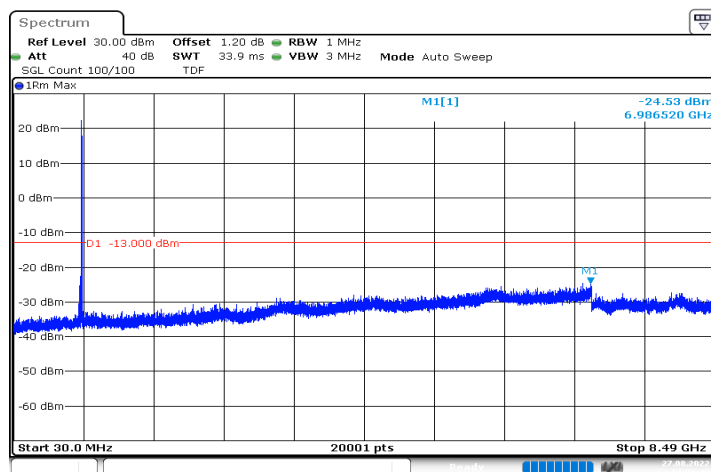
Date: 27.AUG.2022 14:30:36

DC_2A_n5A_10MHz|5MHz_15kHz_1880MHz|826.5MHz_DFT
-s-OFDM QPSK_RB0|RB25@0|30MHz_8.49GHz

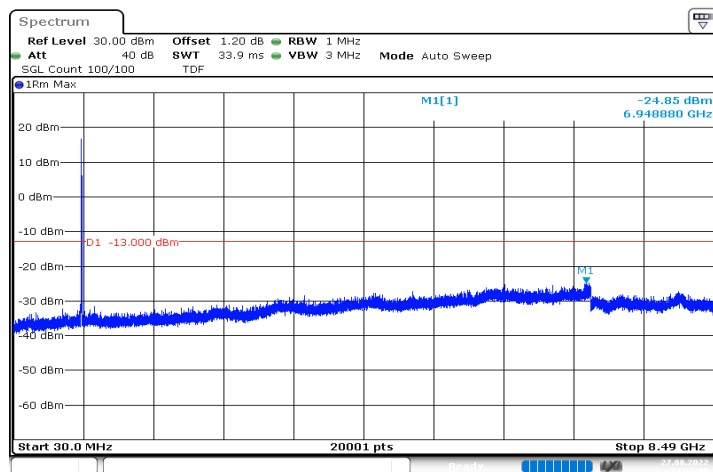
Date: 27.AUG.2022 14:30:58

DC_2A_n5A_10MHz|5MHz_15kHz_1880MHz|836.5MHz_DFT
-s-OFDM QPSK_RB0|RB25@0|30MHz_8.49GHz

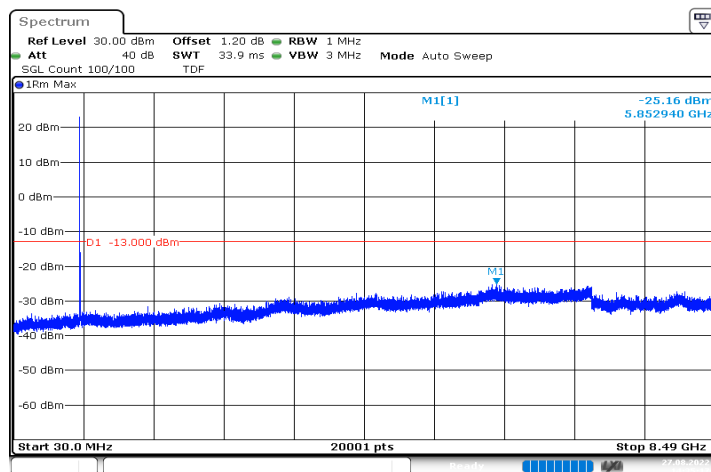
Date: 27.AUG.2022 14:31:49

DC_2A_n5A_10MHz|5MHz_15kHz_1880MHz|846.5MHz_DFT
-s-OFDM QPSK_RB0|RB1@24|30MHz_8.49GHz

Date: 27.AUG.2022 14:33:42

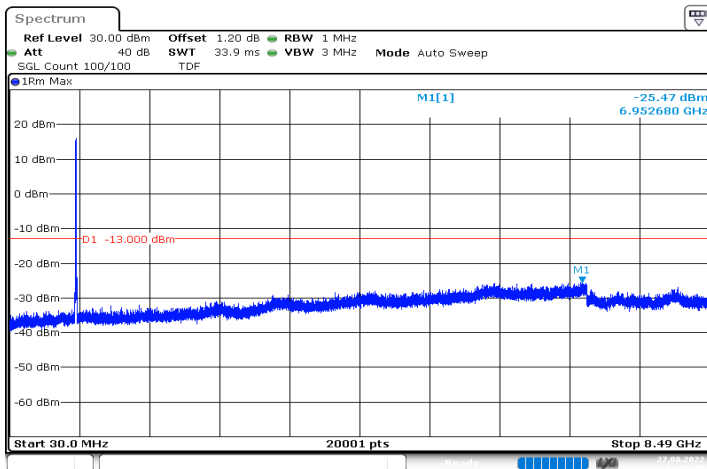
DC_2A_n5A_10MHz|5MHz_15kHz_1880MHz|846.5MHz_DFT
-s-OFDM QPSK_RB0|RB25@0|30MHz_8.49GHz

Date: 27.AUG.2022 14:34:04

DC_2A_n5A_10MHz|10MHz_15kHz_1880MHz|829MHz_DFT
-s-OFDM QPSK_RB0|RB1@0|30MHz_8.49GHz

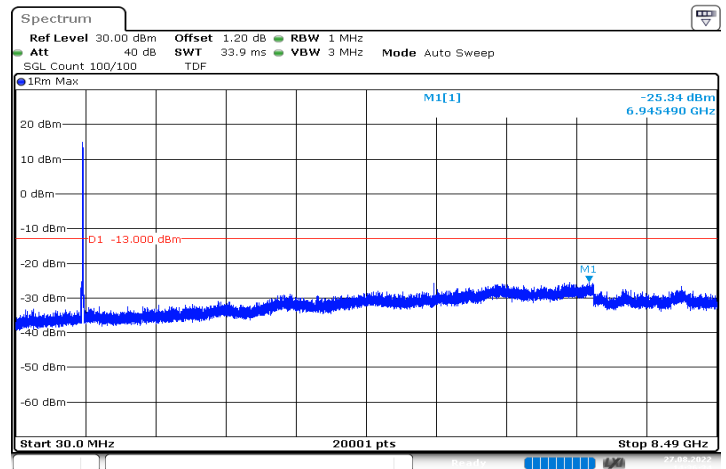
Date: 27.AUG.2022 14:35:17

DC_2A_n5A_10MHz|10MHz_15kHz_1880MHz|829MHz_DFT-
s-OFDM QPSK_RB0|RB50@0|30MHz_8.49GHz



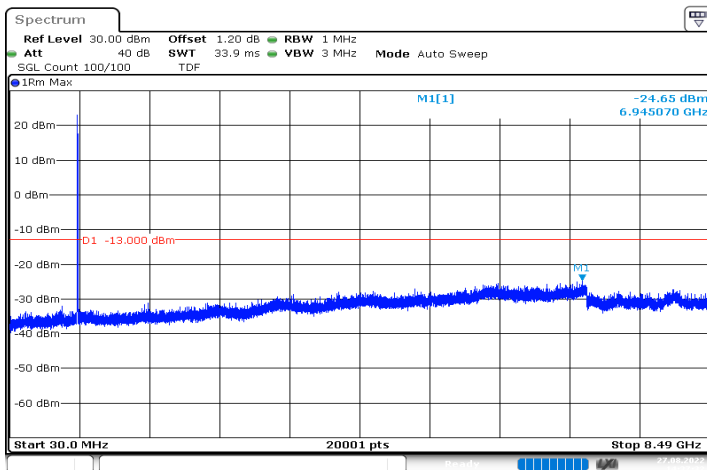
Date: 27.AUG.2022 14:35:39

DC_2A_n5A_10MHz|10MHz_15kHz_1880MHz|836.5MHz_DF
T-s-OFDM QPSK_RB0|RB50@0|30MHz_8.49GHz



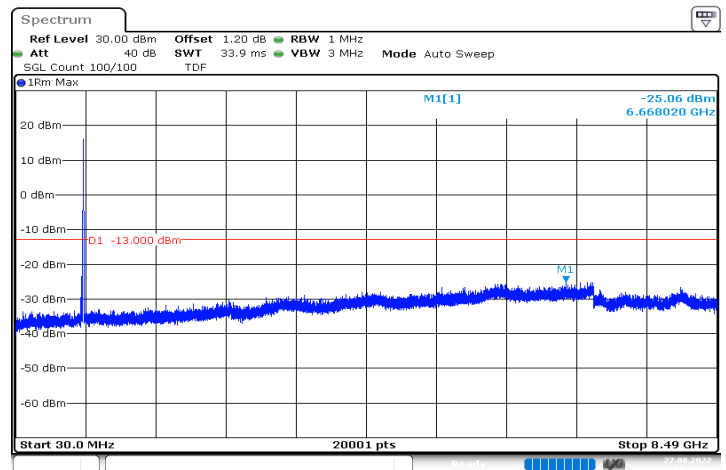
Date: 27.AUG.2022 14:36:34

DC_2A_n5A_10MHz|10MHz_15kHz_1880MHz|844MHz_DFT-
s-OFDM QPSK_RB0|RB1@51|30MHz_8.49GHz



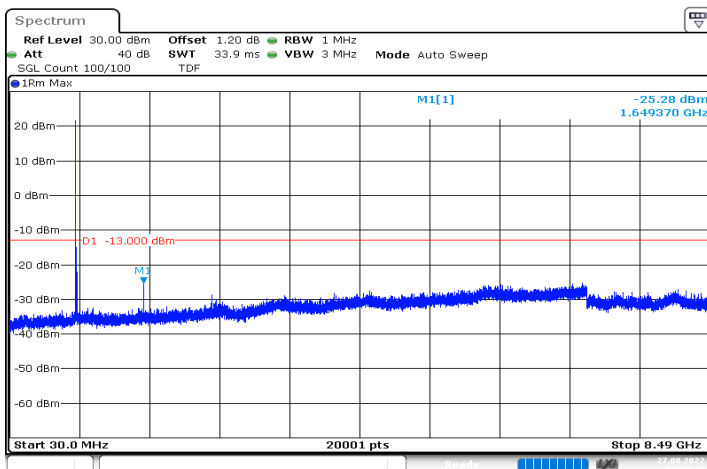
Date: 27.AUG.2022 14:37:32

DC_2A_n5A_10MHz|10MHz_15kHz_1880MHz|844MHz_DFT-
s-OFDM QPSK_RB0|RB50@0|30MHz_8.49GHz



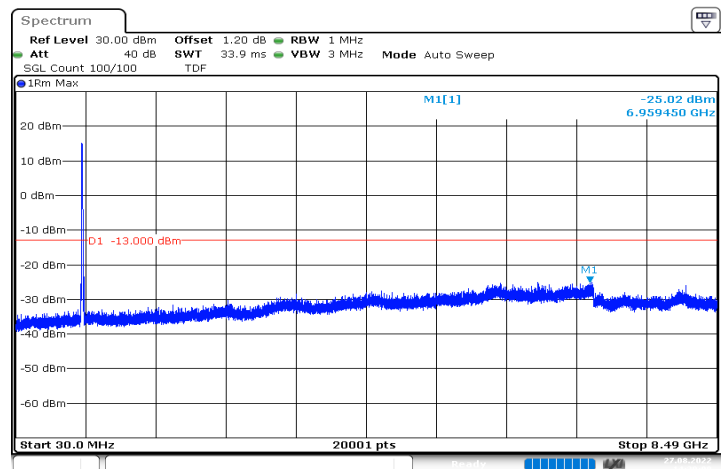
Date: 27.AUG.2022 14:37:54

DC_2A_n5A_10MHz|15MHz_15kHz_1880MHz|831.5MHz_DF
T-s-OFDM QPSK_RB0|RB1@0|30MHz_8.49GHz

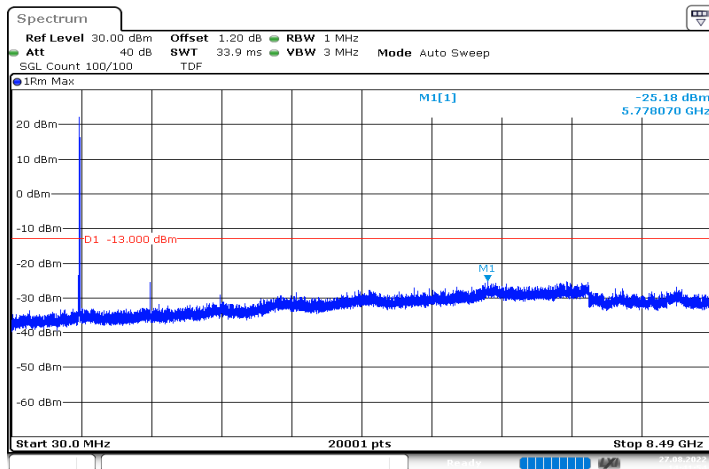


Date: 27.AUG.2022 14:38:46

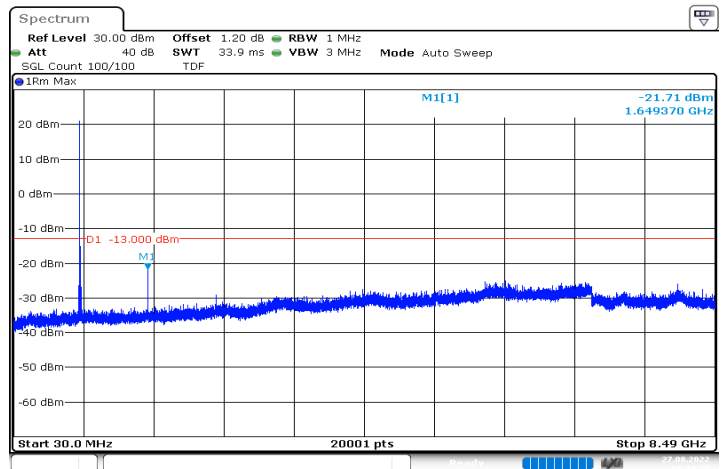
DC_2A_n5A_10MHz|15MHz_15kHz_1880MHz|831.5MHz_DF
T-s-OFDM QPSK_RB0|RB75@0|30MHz_8.49GHz



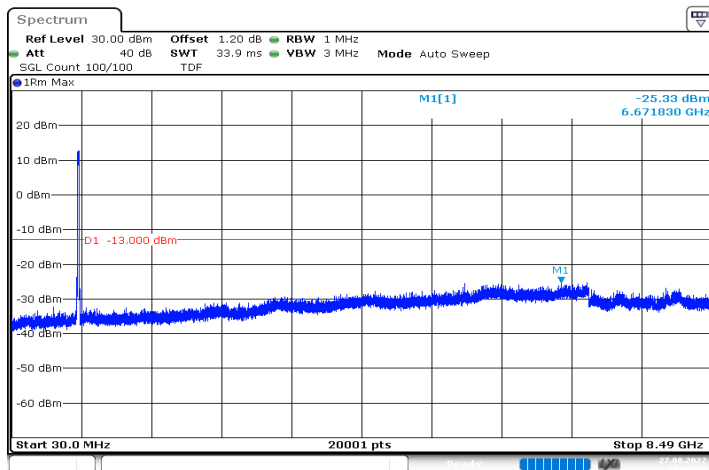
Date: 27.AUG.2022 14:39:08

DC_2A_n5A_10MHz|15MHz_15kHz_1880MHz|841.5MHz_DF
T-s-OFDM QPSK_RB0|RB1@78|30MHz_8.49GHz

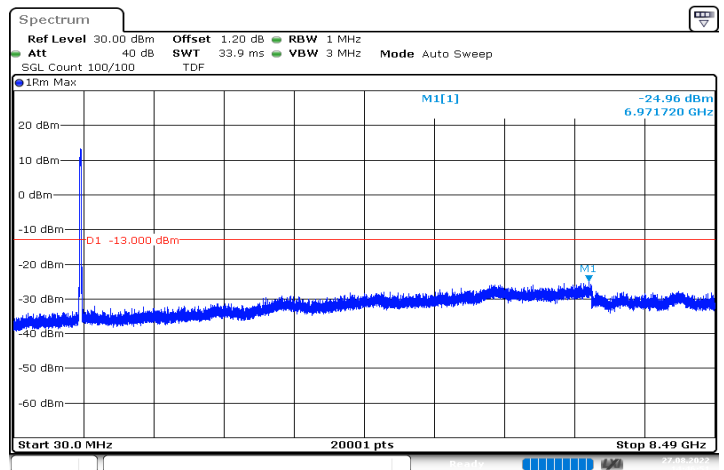
Date: 27.AUG.2022 14:41:54

DC_2A_n5A_10MHz|20MHz_15kHz_1880MHz|834MHz_DFT-
s-OFDM QPSK_RB0|RB1@0|30MHz_8.49GHz

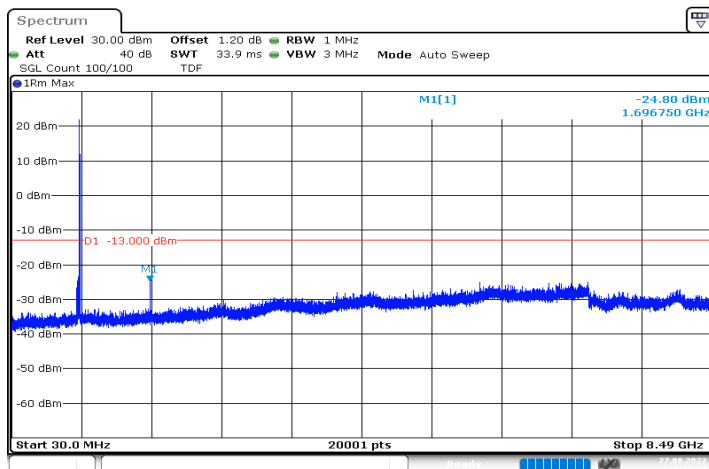
Date: 27.AUG.2022 14:44:28

DC_2A_n5A_10MHz|20MHz_15kHz_1880MHz|834MHz_DFT-
s-OFDM QPSK_RB0|RB100@0|30MHz_8.49GHz

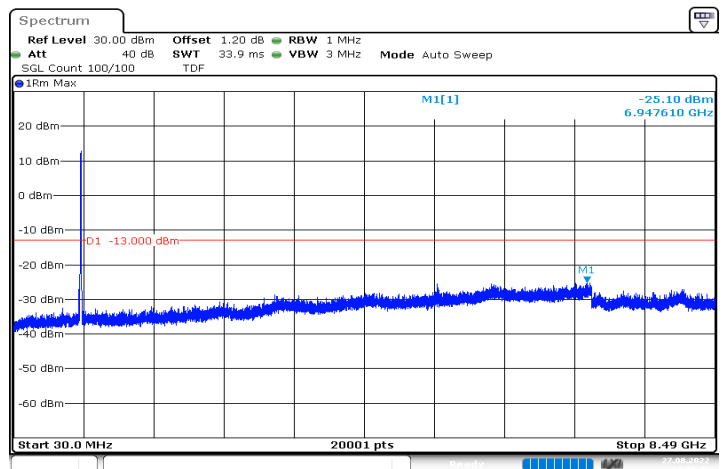
Date: 27.AUG.2022 14:45:27

DC_2A_n5A_10MHz|20MHz_15kHz_1880MHz|836.5MHz_DF
T-s-OFDM QPSK_RB0|RB100@0|30MHz_8.49GHz

Date: 27.AUG.2022 14:46:51

DC_2A_n5A_10MHz|20MHz_15kHz_1880MHz|839MHz_DFT-
s-OFDM QPSK_RB0|RB1@105|30MHz_8.49GHz

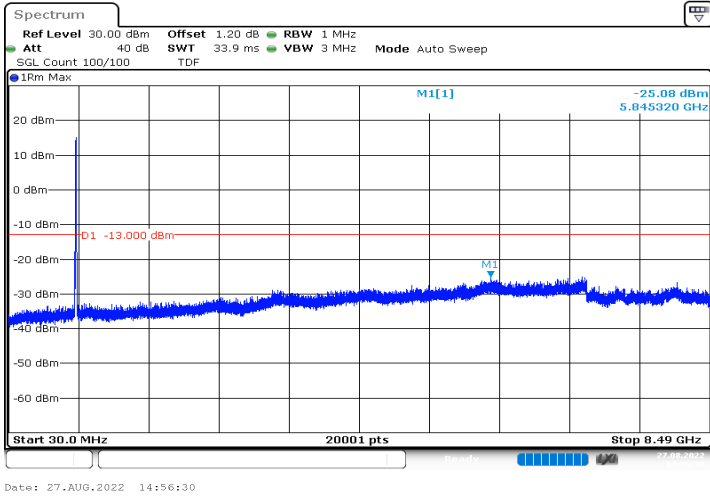
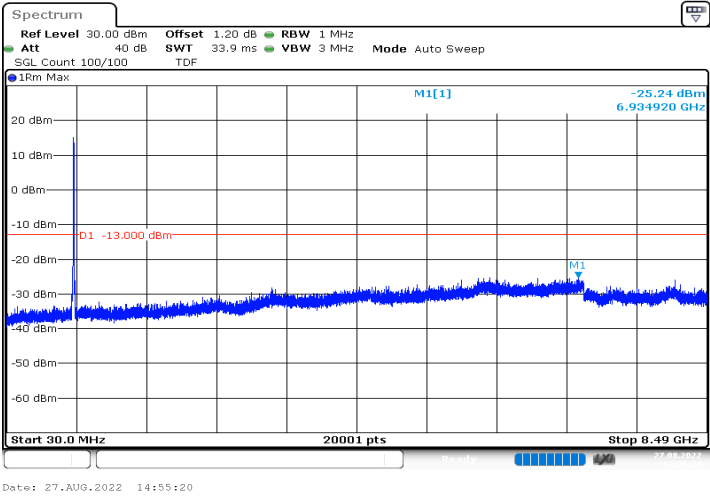
Date: 27.AUG.2022 14:47:43

DC_2A_n5A_10MHz|20MHz_15kHz_1880MHz|839MHz_DFT-
s-OFDM QPSK_RB0|RB100@0|30MHz_8.49GHz

Date: 27.AUG.2022 14:48:32

DC_2A_n5A_10MHz|15MHz_15kHz_1880MHz|836.5MHz_DF
T-s-OFDM QPSK_RB0|RB75@0|30MHz_8.49GHz

DC_2A_n5A_10MHz|15MHz_15kHz_1880MHz|841.5MHz_DF
T-s-OFDM QPSK_RB0|RB75@0|30MHz_8.49GHz

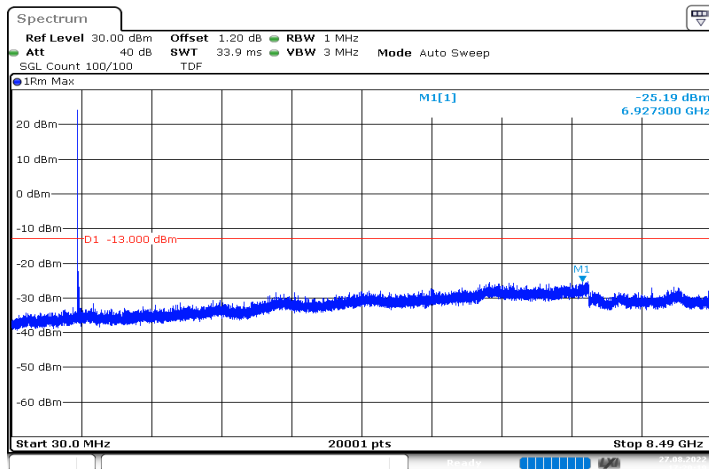


Spurious emissions at antenna terminals**n5 , Normal**

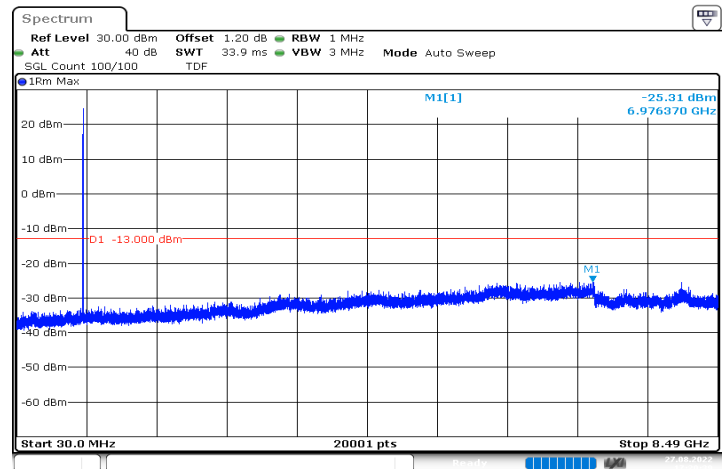
Mode	Value (dBm)	Limit (dBm)	Result
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.19	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-25.31	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-16.6	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.96	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-24.9	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-21.87	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.32	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-24.03	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-24.09	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.75	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-25.01	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-24.73	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.35	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-24.63	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-24.11	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.1	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-24.63	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-24.9	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.97	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-25.01	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-25.02	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.07	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-24.29	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-24.87	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.19	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-24.65	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-24.88	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-22.03	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-24.8	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-24.42	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.99	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.66	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-24.96	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.17	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.59	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-24.97	-13	Pass

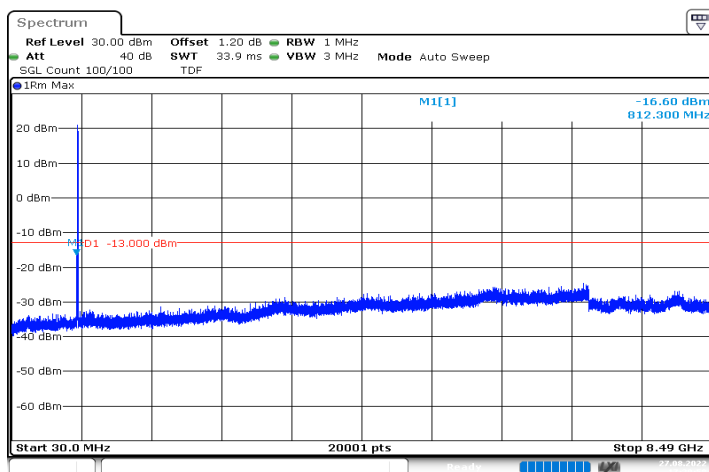
n5 , Normal

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

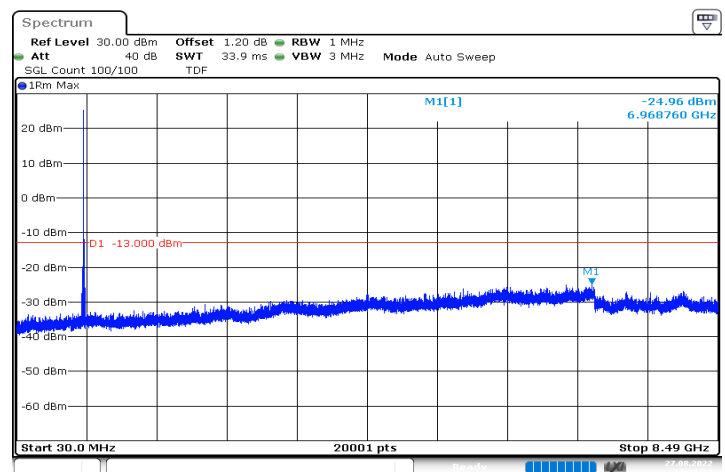
Date: 27.AUG.2022 17:20:19

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

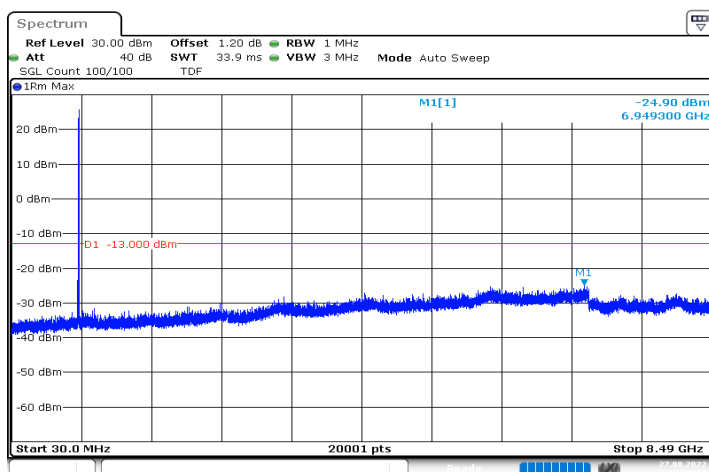
Date: 27.AUG.2022 17:20:39

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

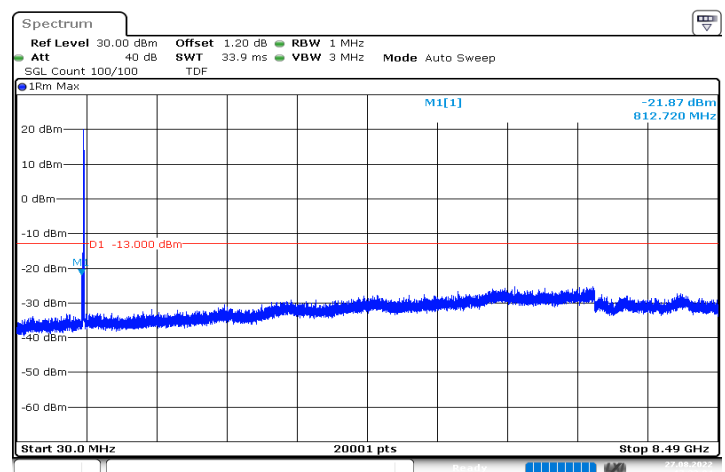
Date: 27.AUG.2022 17:20:58

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

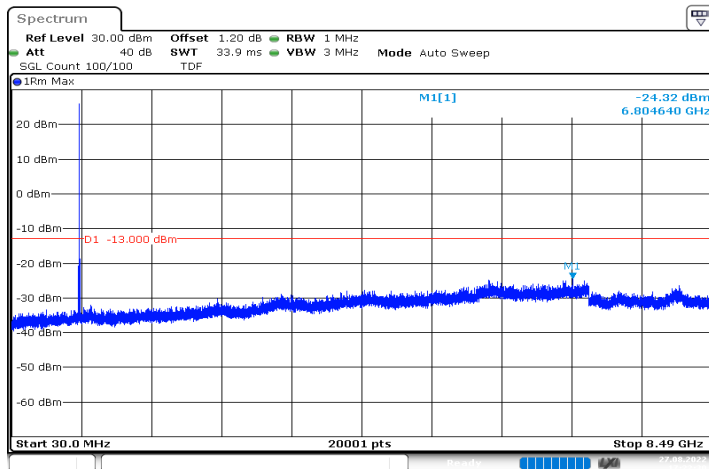
Date: 27.AUG.2022 17:21:24

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

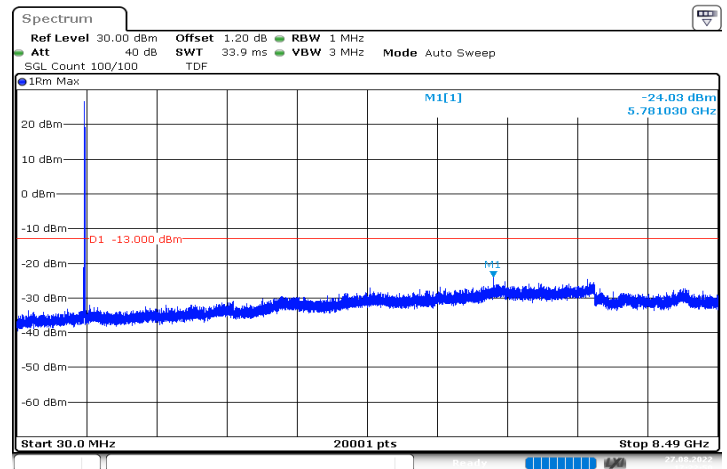
Date: 27.AUG.2022 17:21:44

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

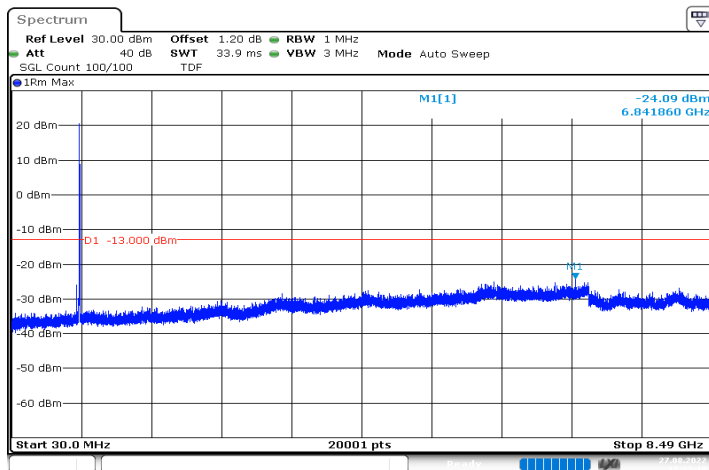
Date: 27.AUG.2022 17:22:04

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

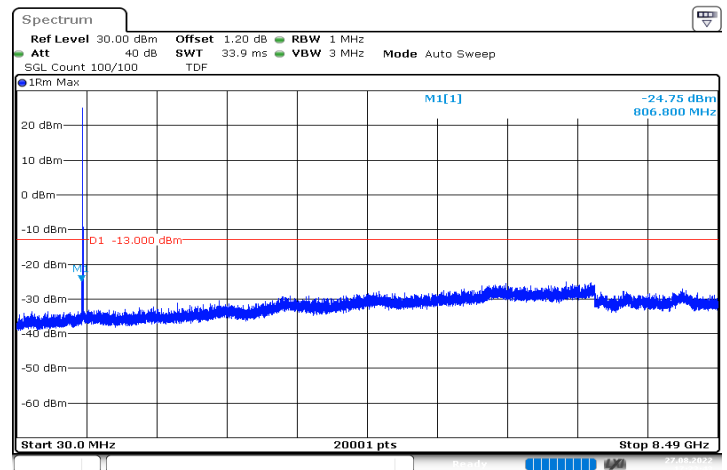
Date: 27.AUG.2022 17:22:30

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

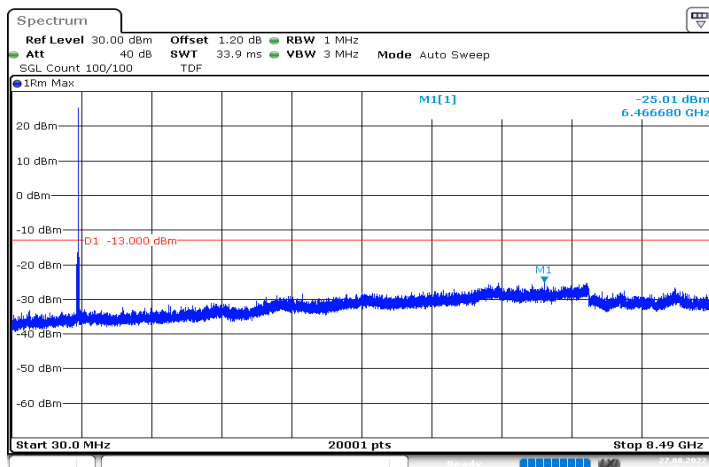
Date: 27.AUG.2022 17:22:50

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

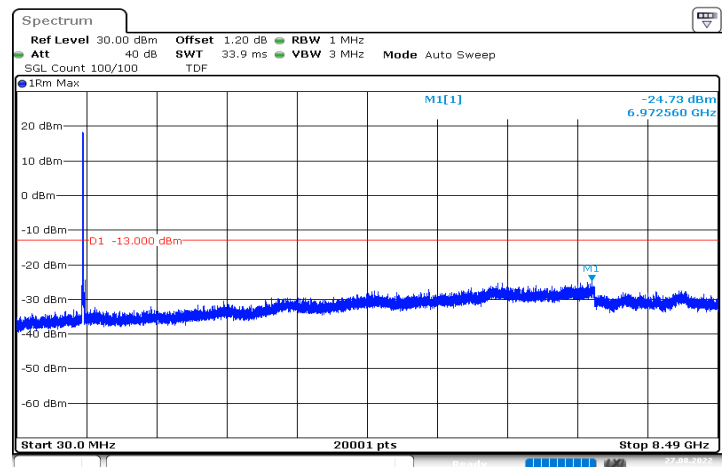
Date: 27.AUG.2022 17:23:10

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

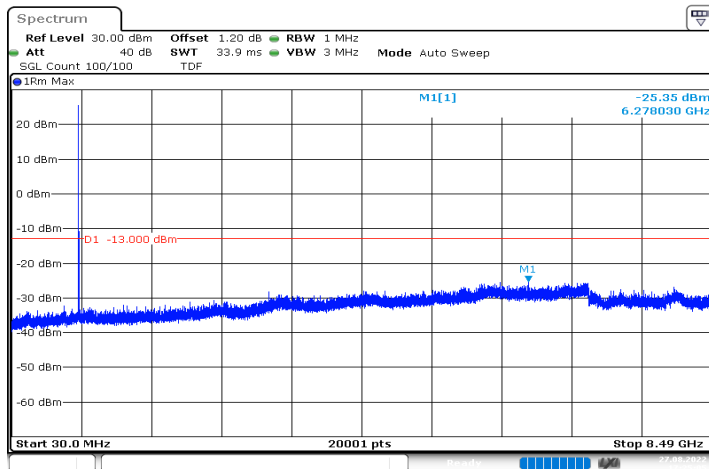
Date: 27.AUG.2022 17:23:43

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

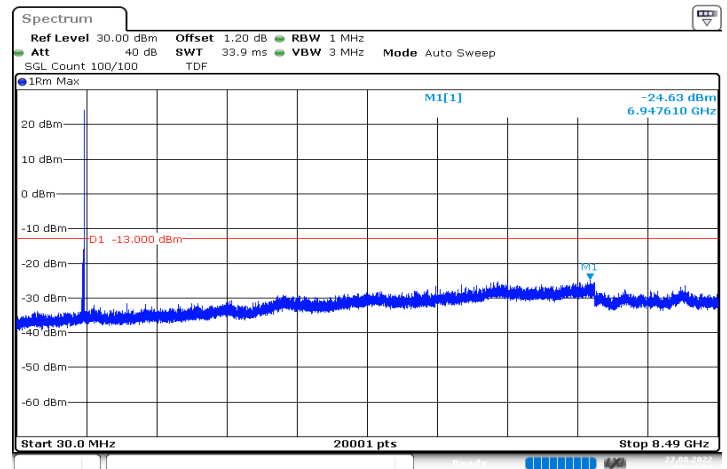
Date: 27.AUG.2022 17:24:04

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

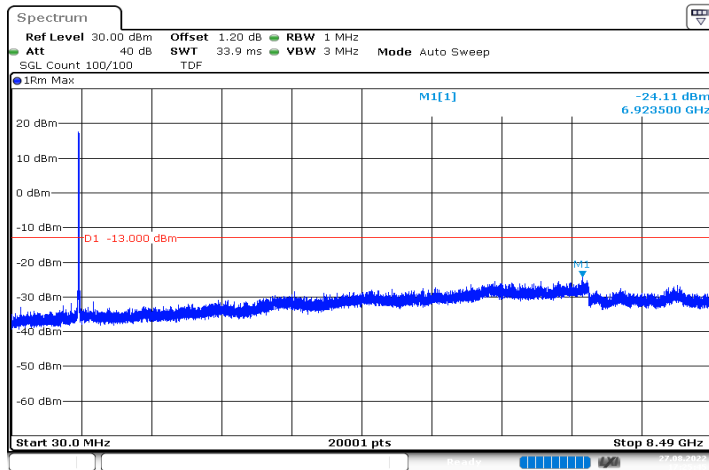
Date: 27.AUG.2022 17:24:39

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

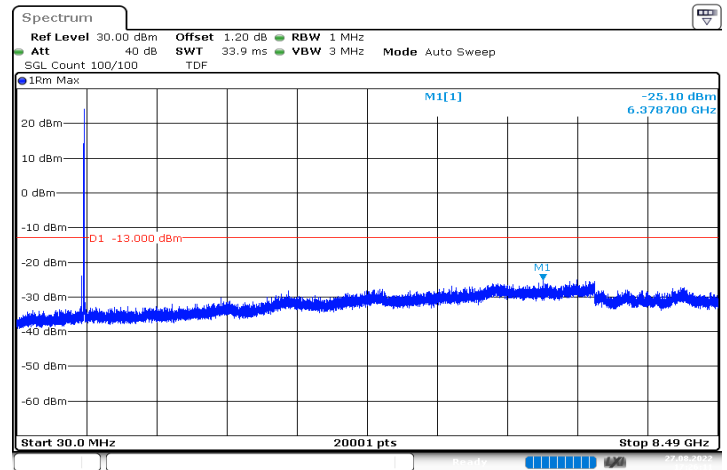
Date: 27.AUG.2022 17:25:05

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

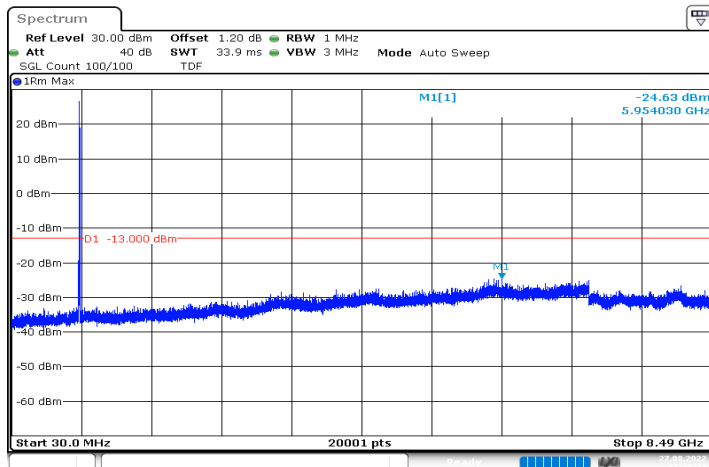
Date: 27.AUG.2022 17:25:25

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

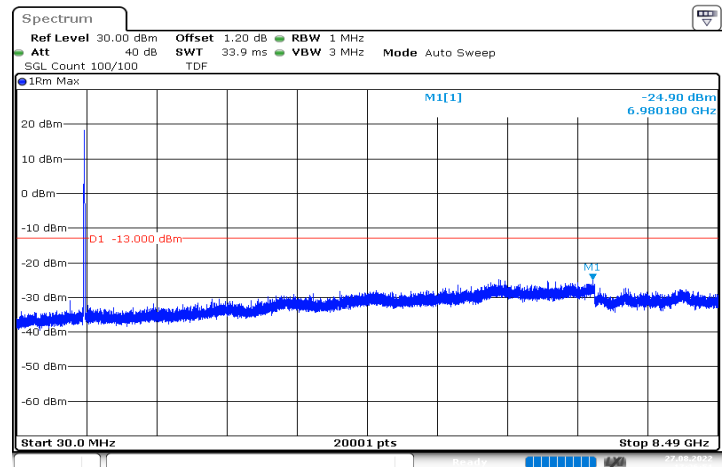
Date: 27.AUG.2022 17:25:45

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

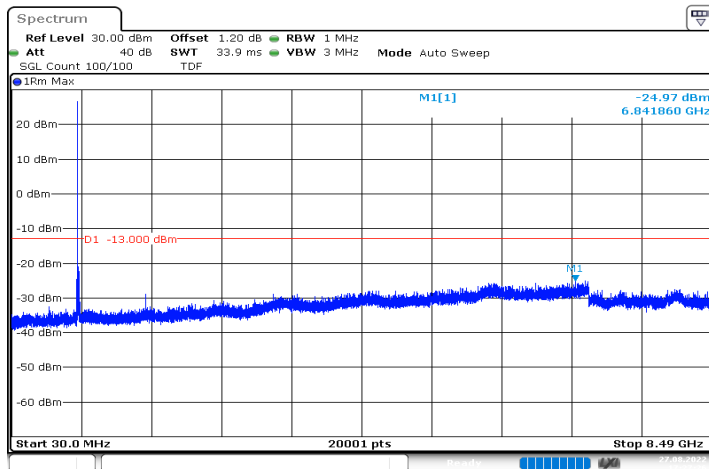
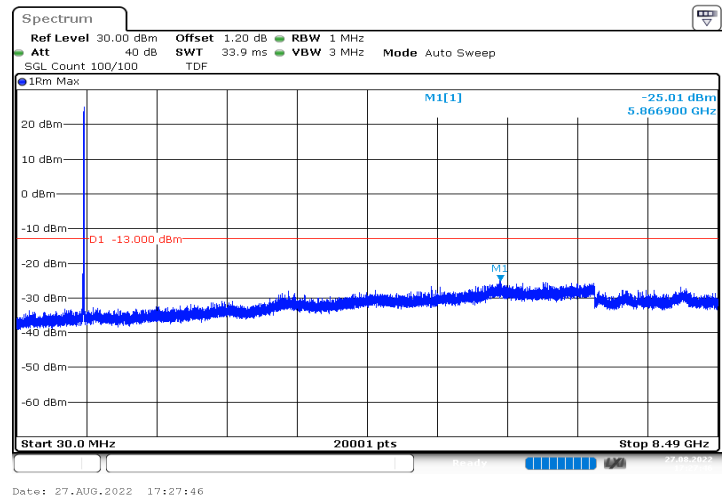
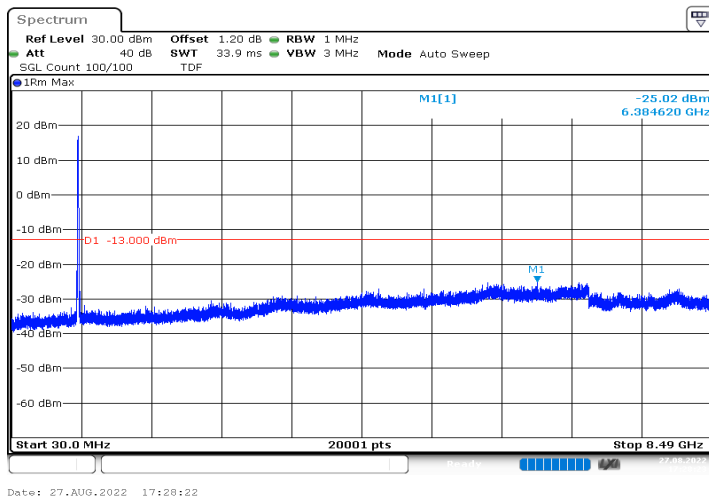
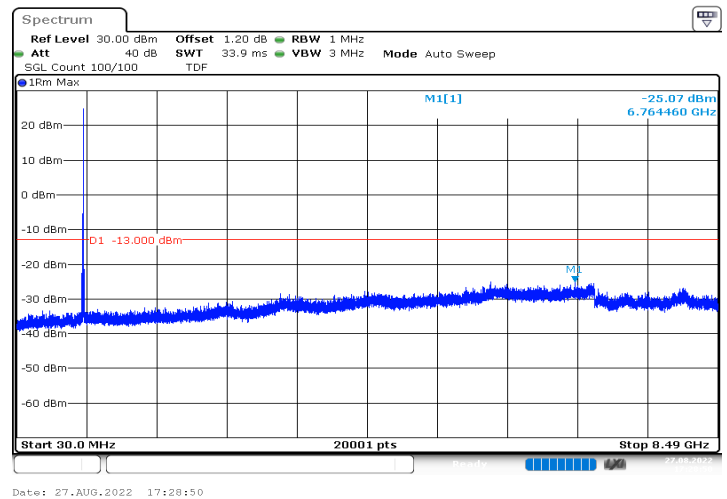
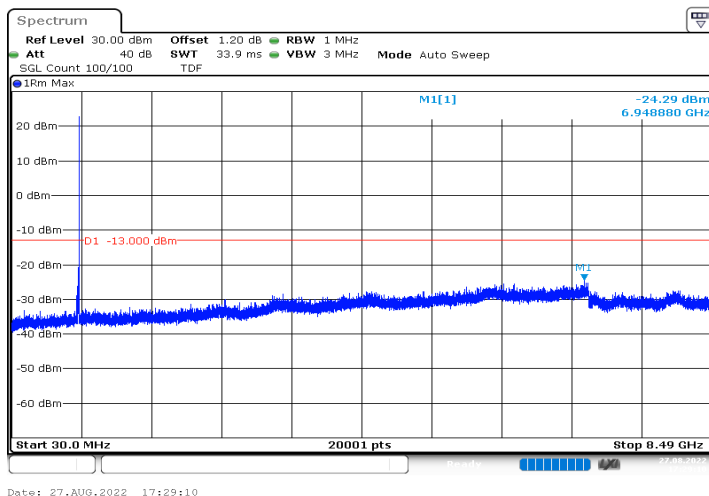
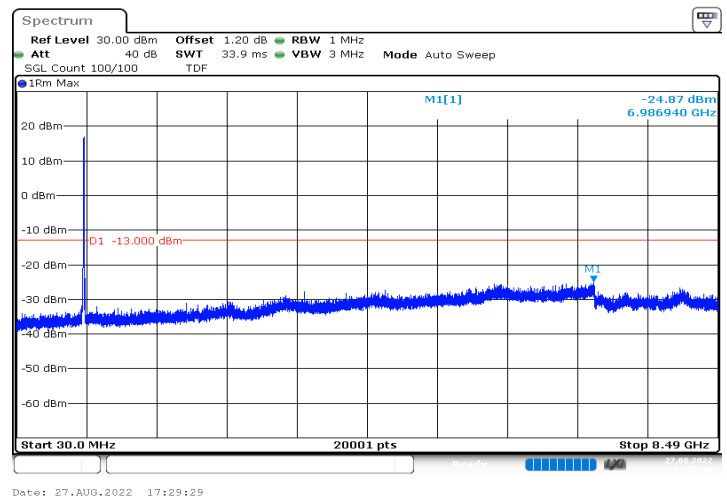
Date: 27.AUG.2022 17:26:11

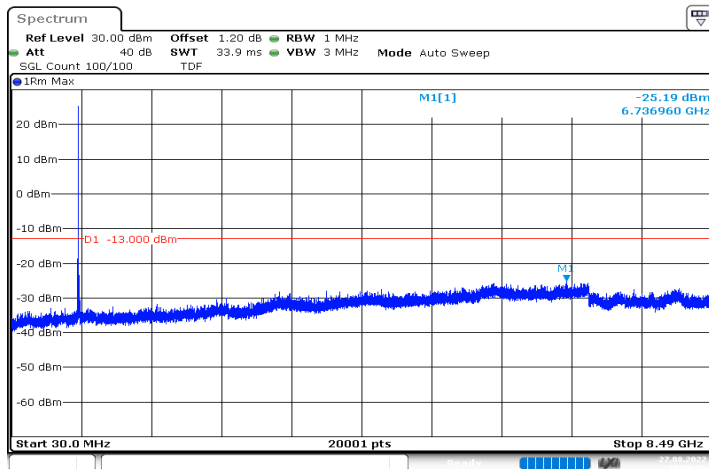
n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

Date: 27.AUG.2022 17:26:31

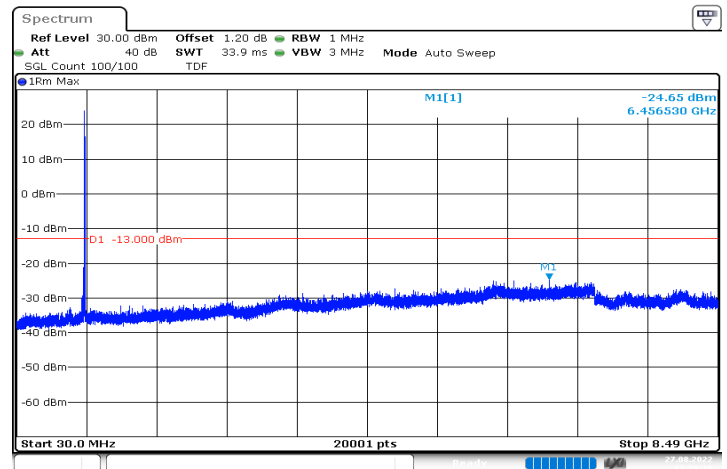
n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

Date: 27.AUG.2022 17:26:51

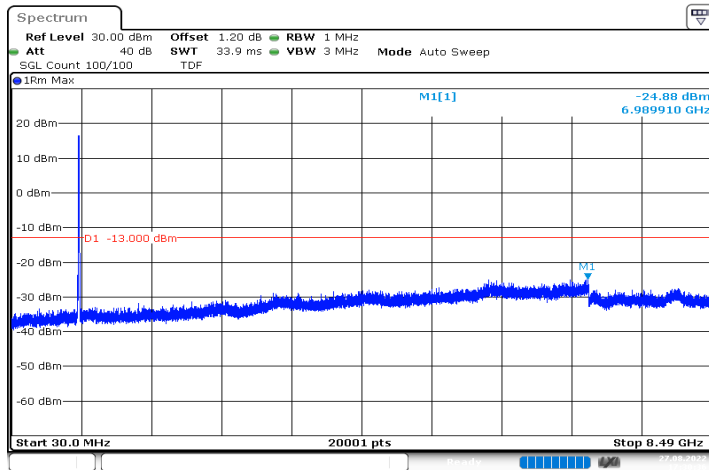
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHzn5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHzn5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHzn5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHzn5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHzn5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

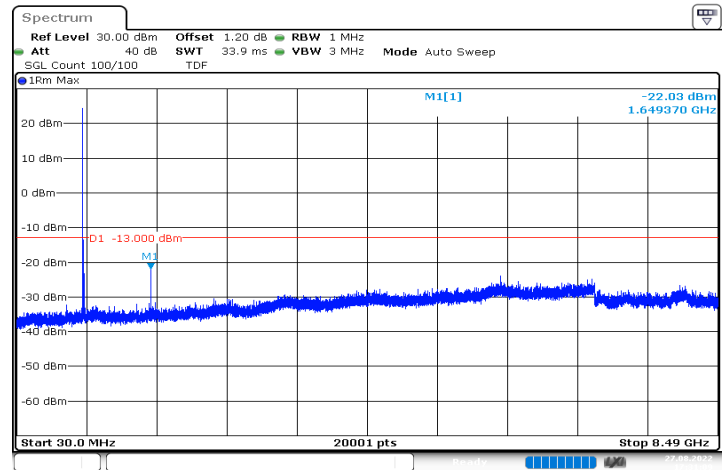
Date: 27.AUG.2022 17:29:56

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

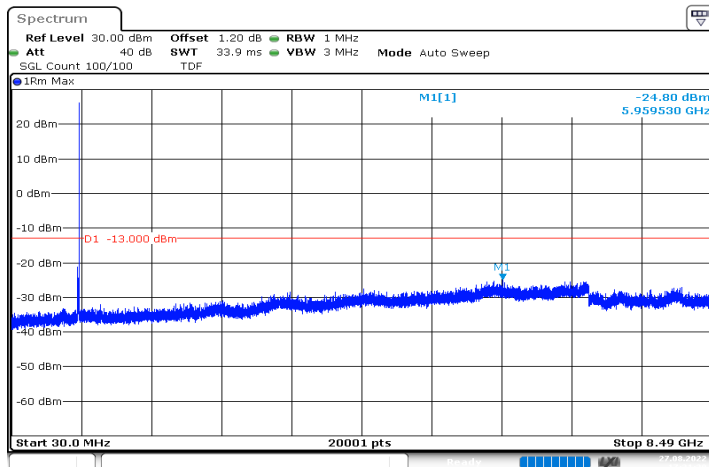
Date: 27.AUG.2022 17:30:16

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

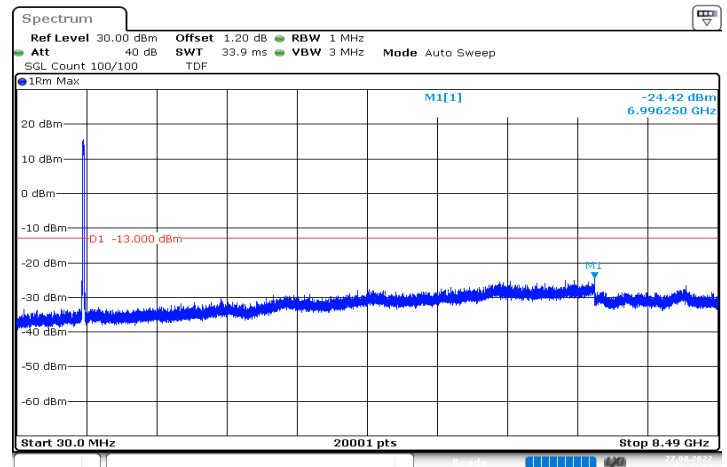
Date: 27.AUG.2022 17:30:36

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

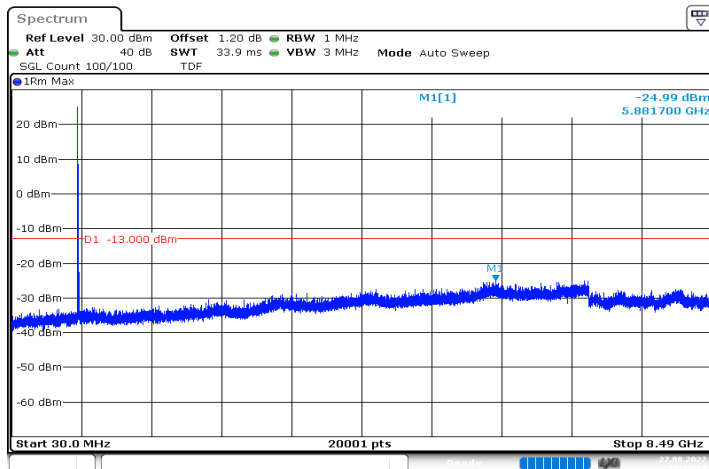
Date: 27.AUG.2022 17:31:09

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

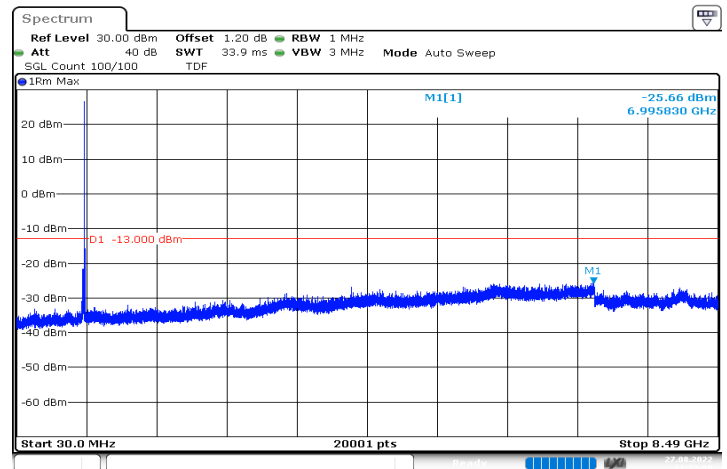
Date: 27.AUG.2022 17:31:29

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

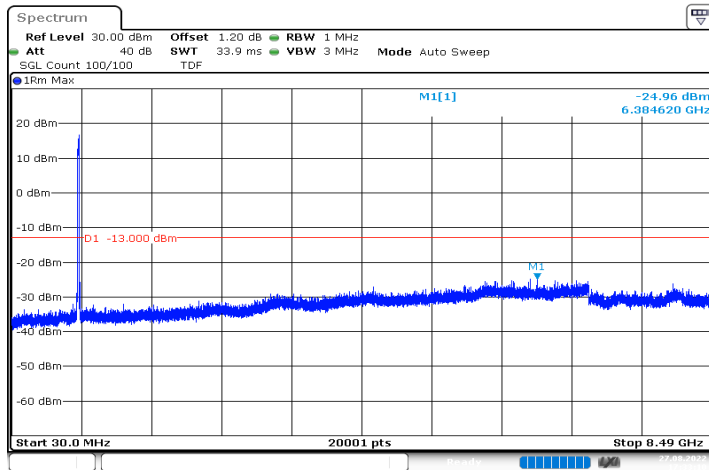
Date: 27.AUG.2022 17:32:03

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

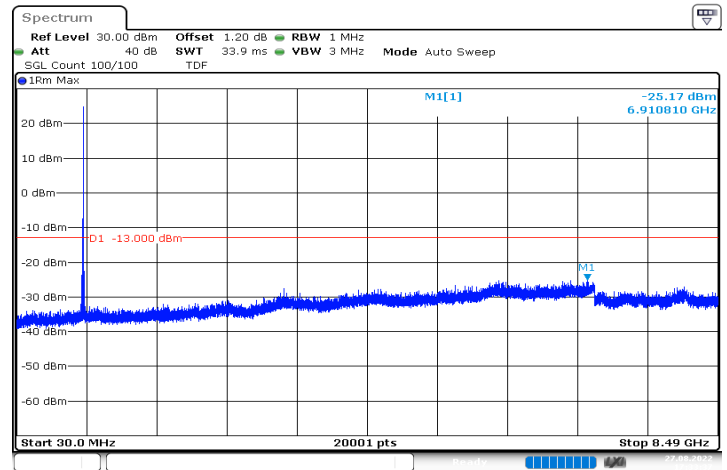
Date: 27.AUG.2022 17:32:29

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

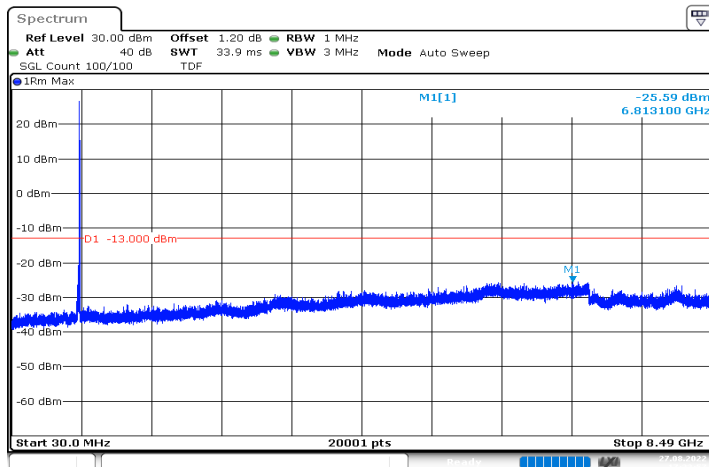
Date: 27.AUG.2022 17:32:50

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

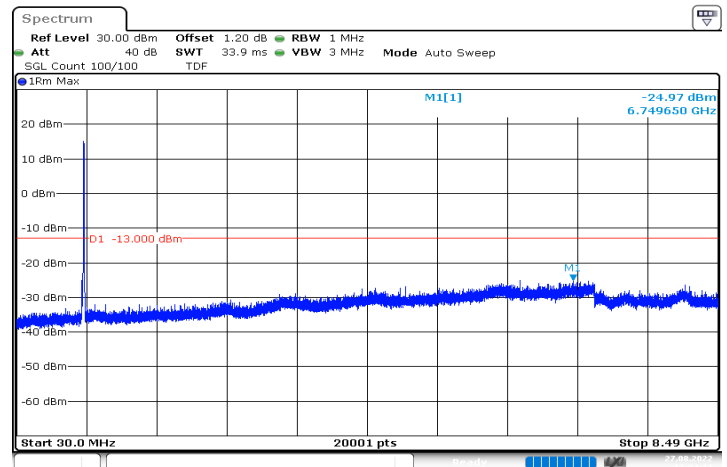
Date: 27.AUG.2022 17:33:10

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

Date: 27.AUG.2022 17:33:37

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

Date: 27.AUG.2022 17:33:57

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

Date: 27.AUG.2022 17:34:17