




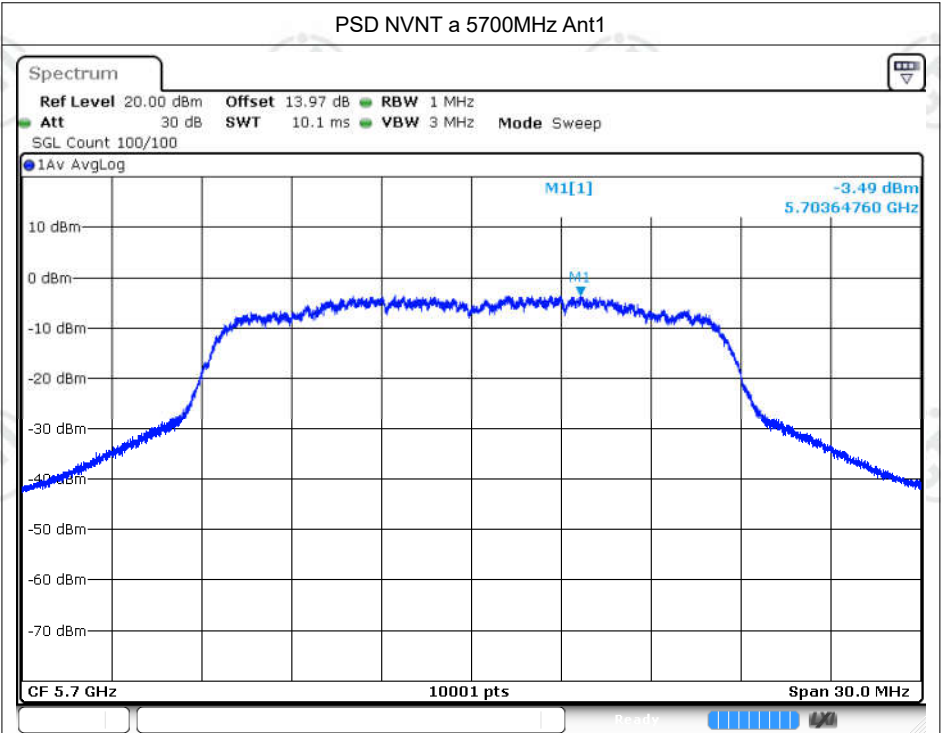


Date: 6 JAN.2025 08:27:50

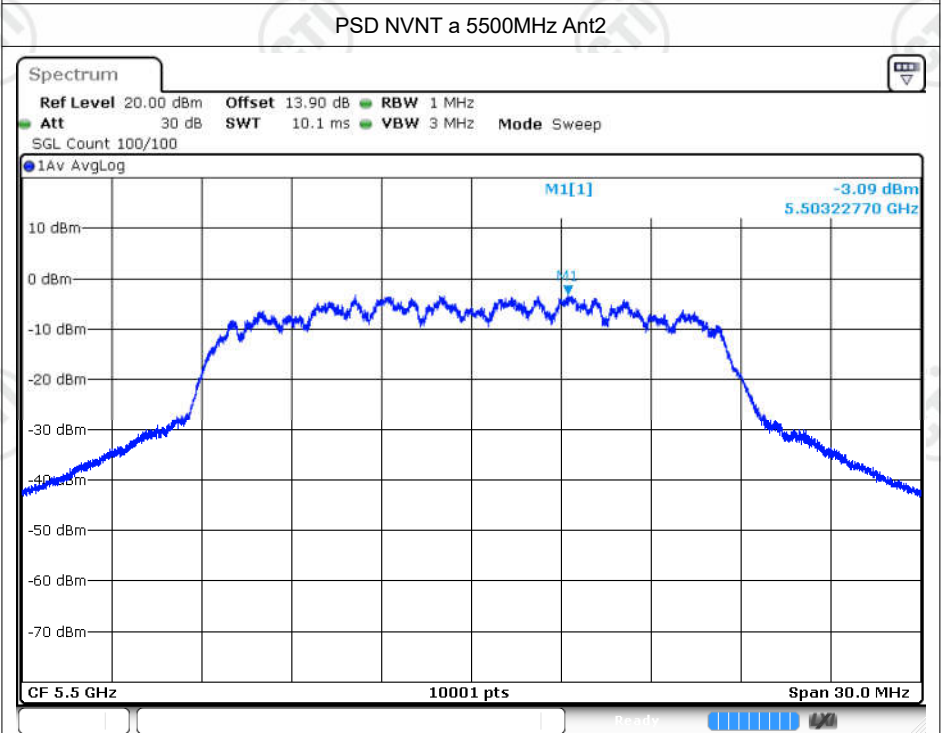


Date: 6 JAN.2025 09:09:13

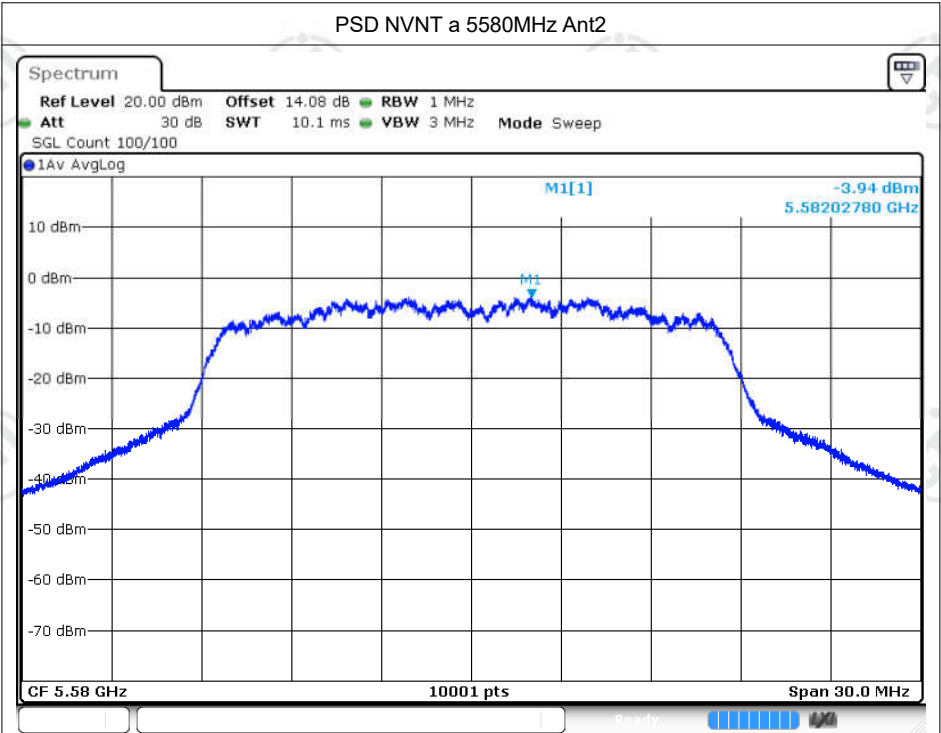


Date: 6 JAN 2025 09:10:42

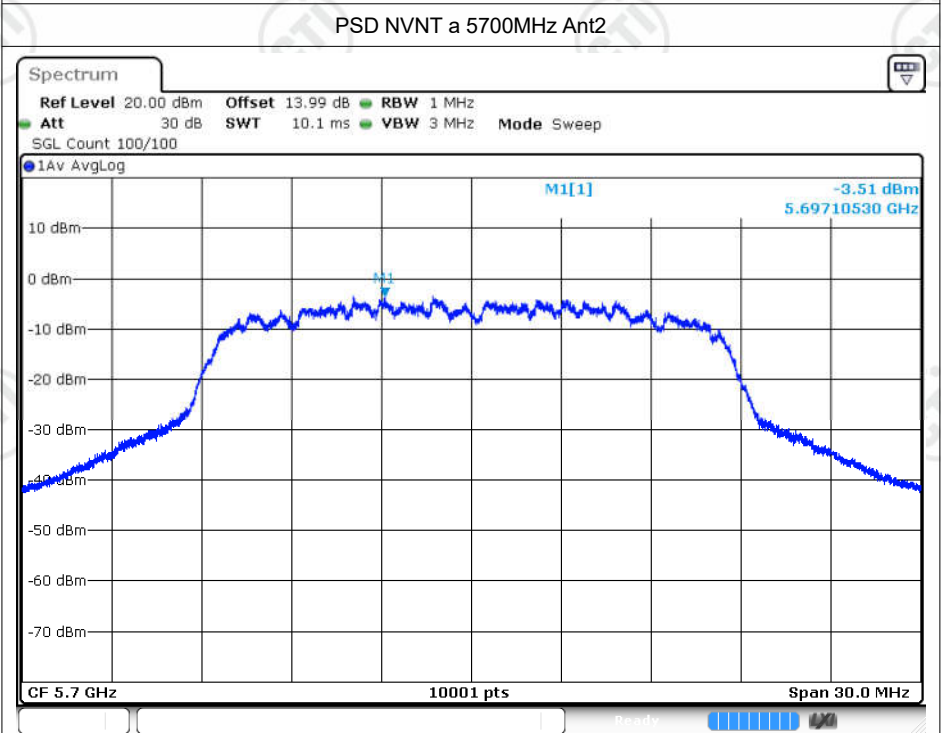


Date: 6 JAN 2025 09:12:44

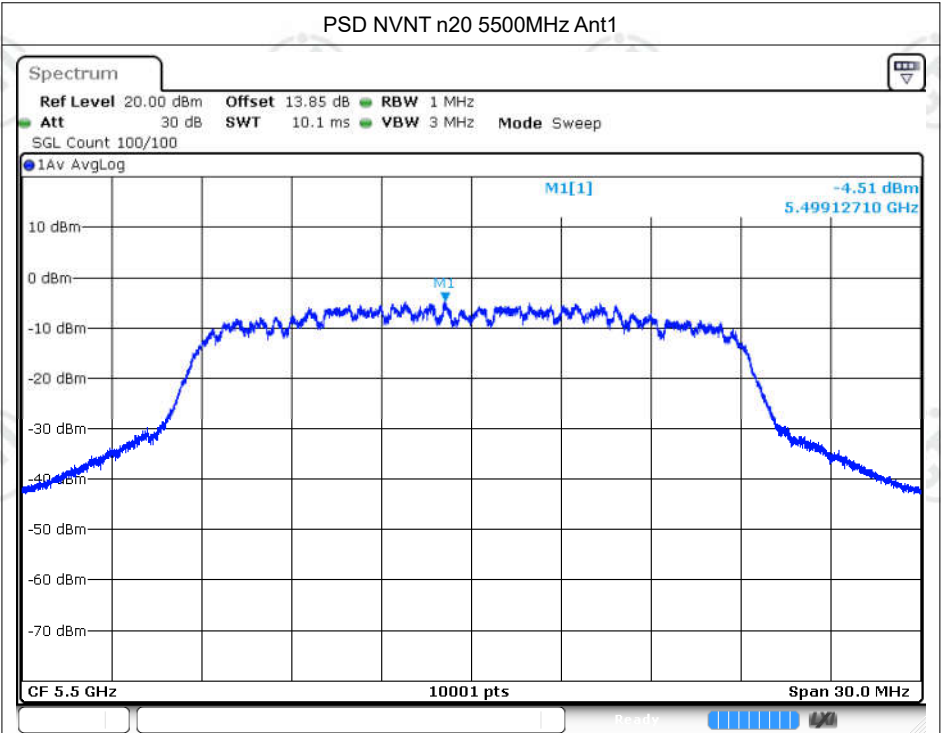


Date: 6 JAN 2025 08:29:58

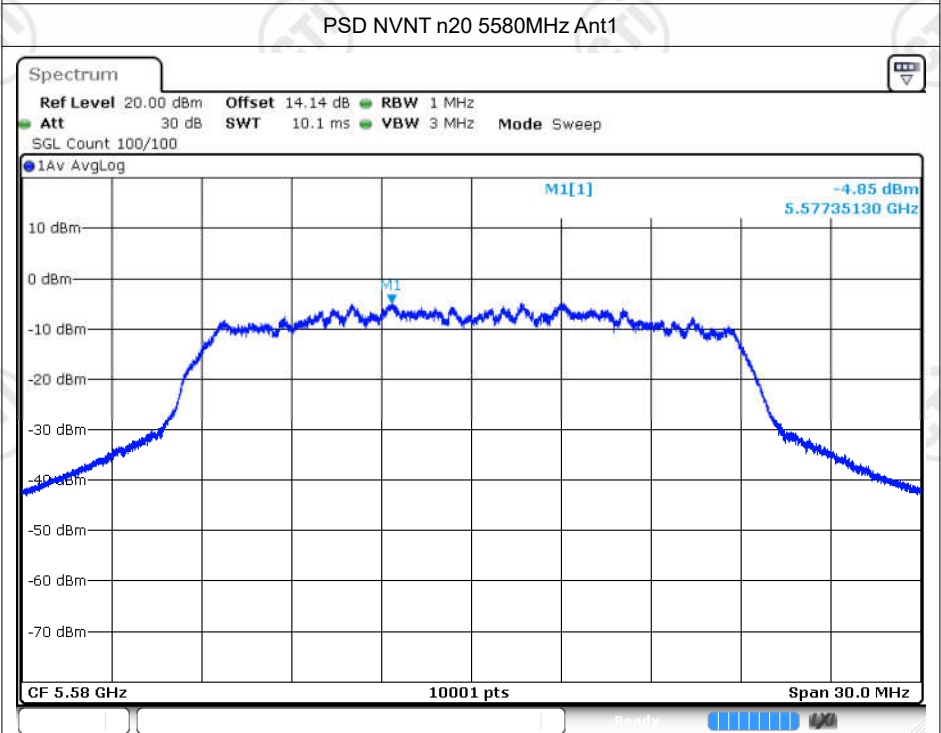


Date: 6 JAN 2025 08:31:18

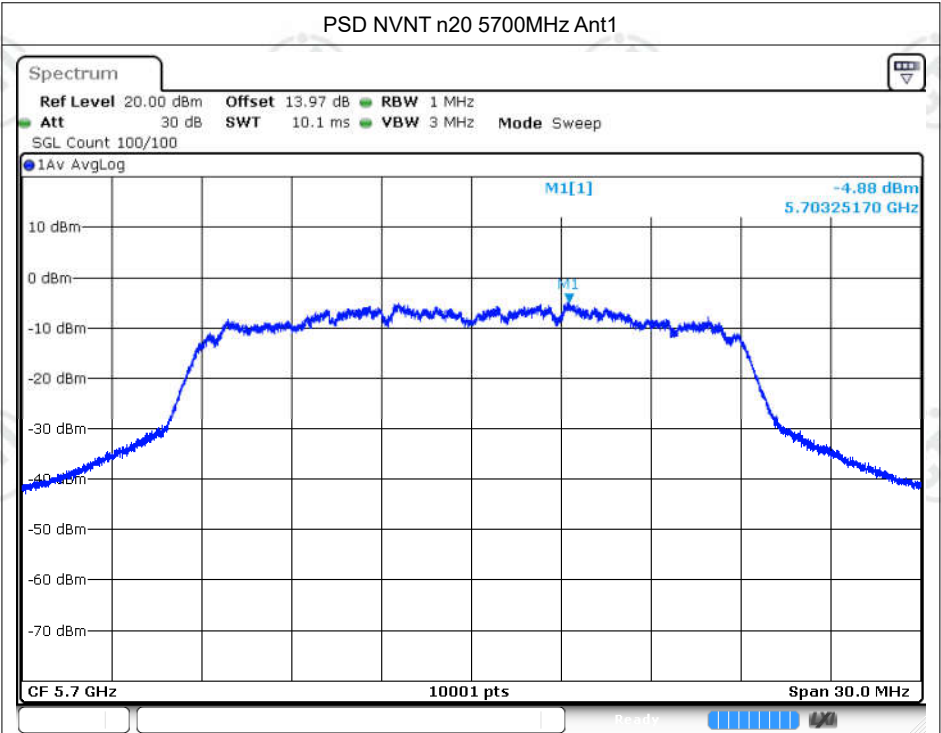


Date: 6 JAN.2025 08:32:59

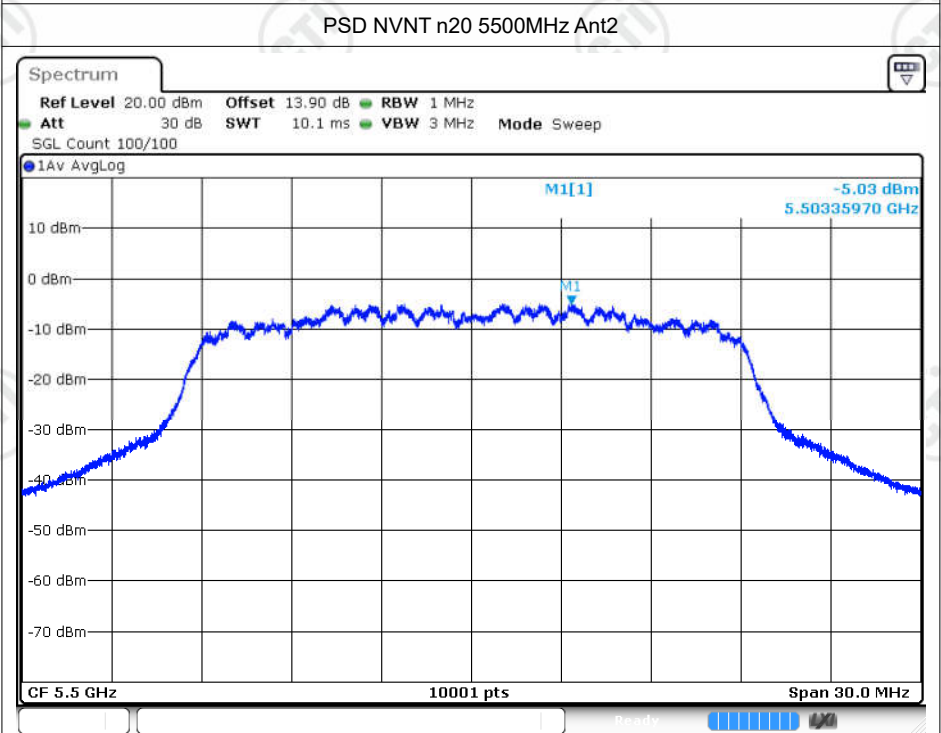



Date: 6 JAN.2025 09:14:50


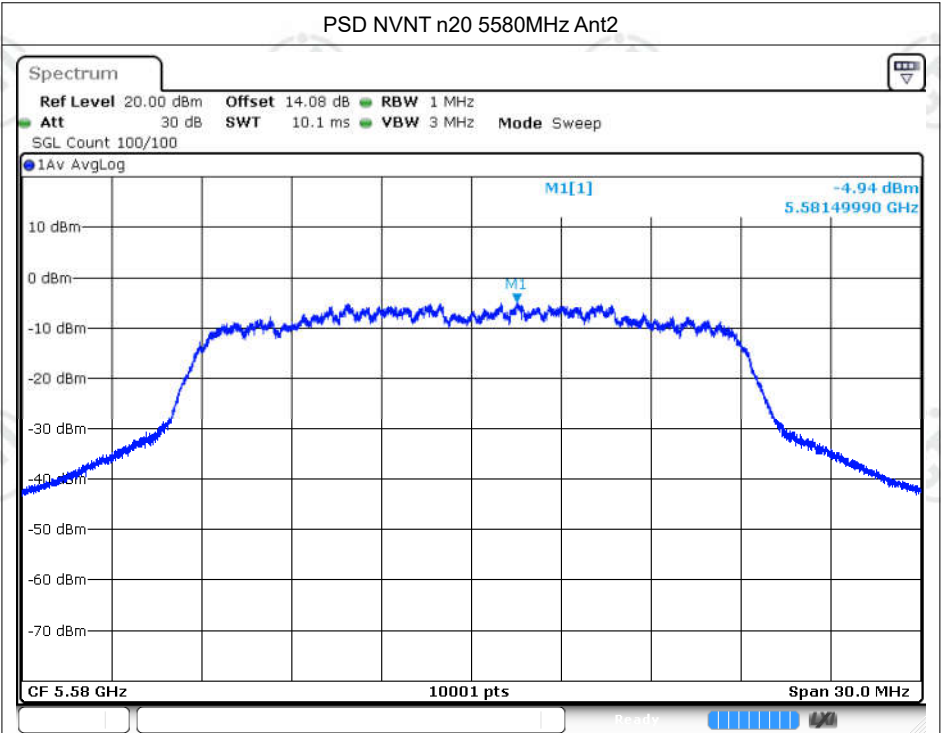




Date: 6 JAN 2025 09:16:13

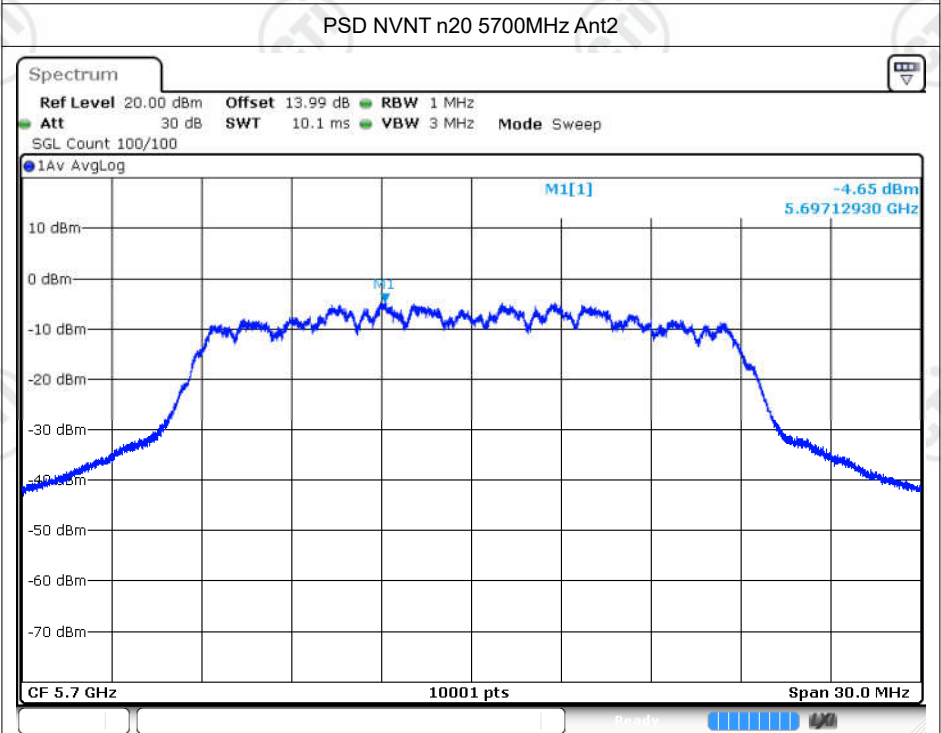


Date: 6 JAN 2025 09:18:08

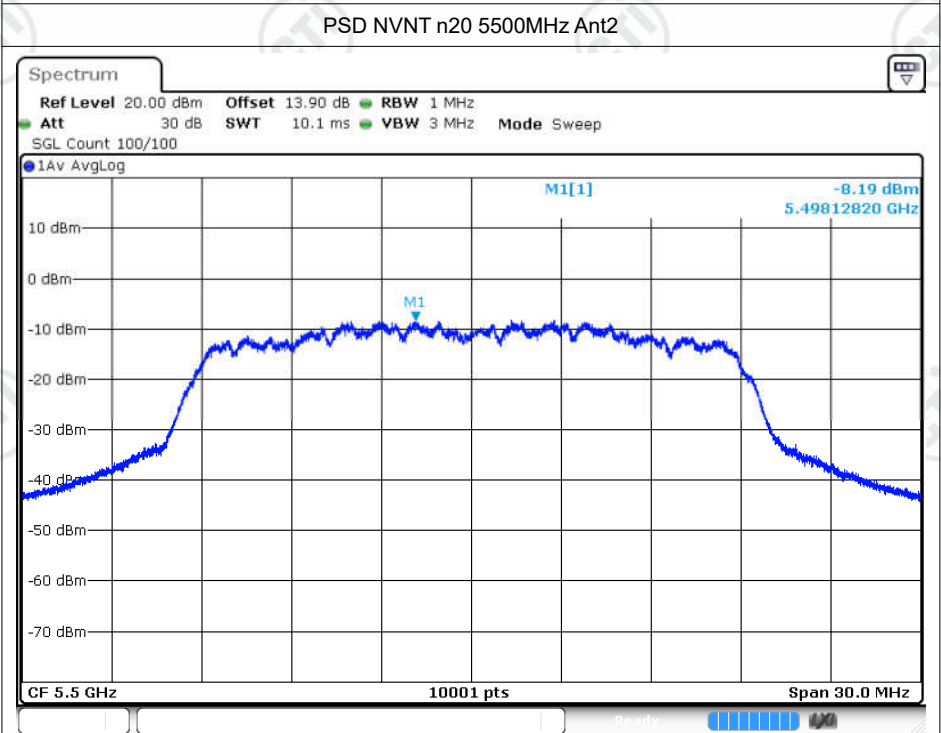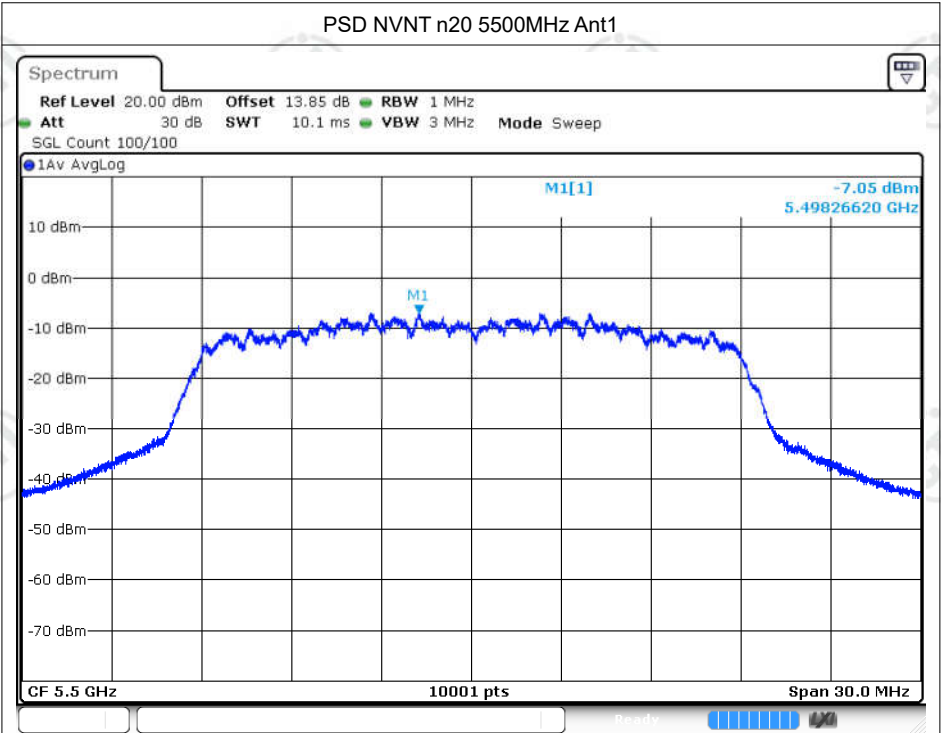


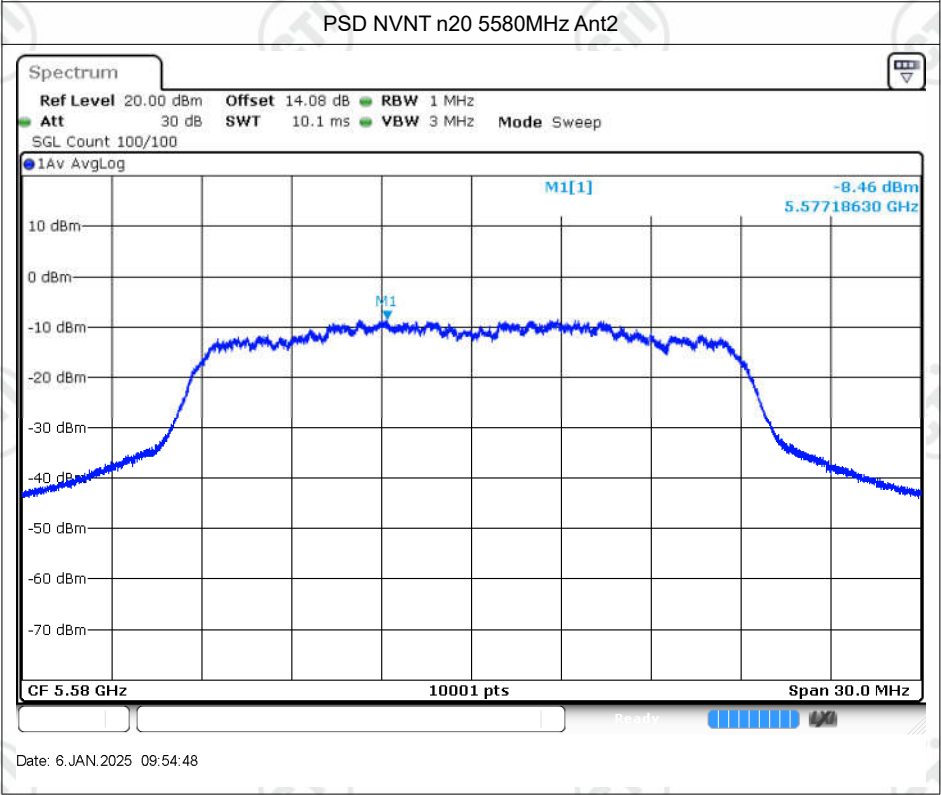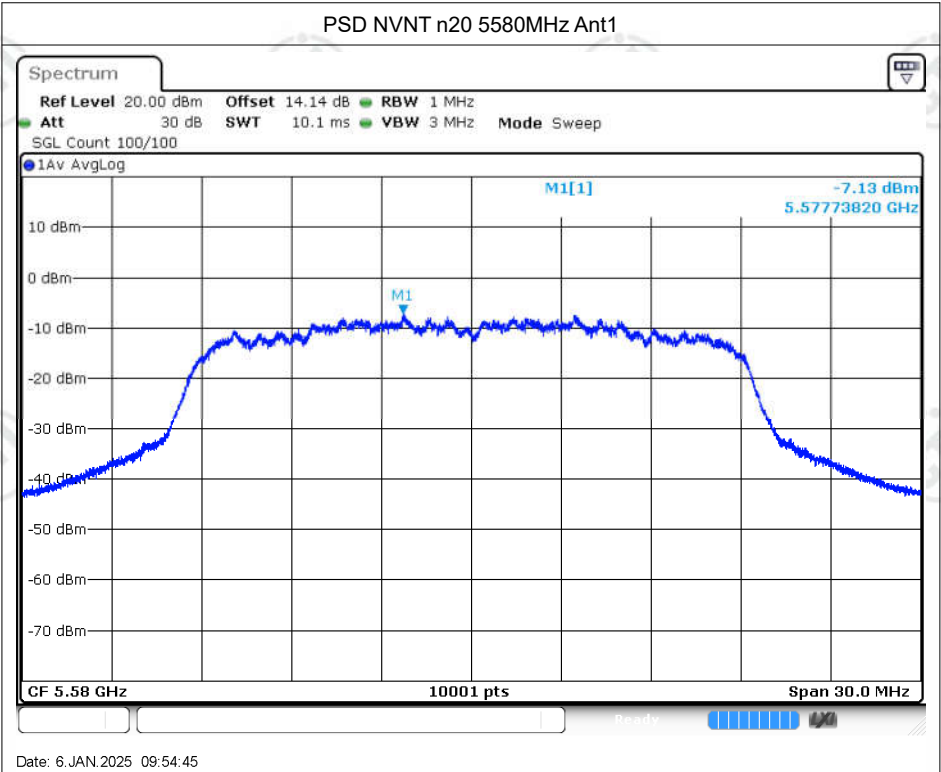

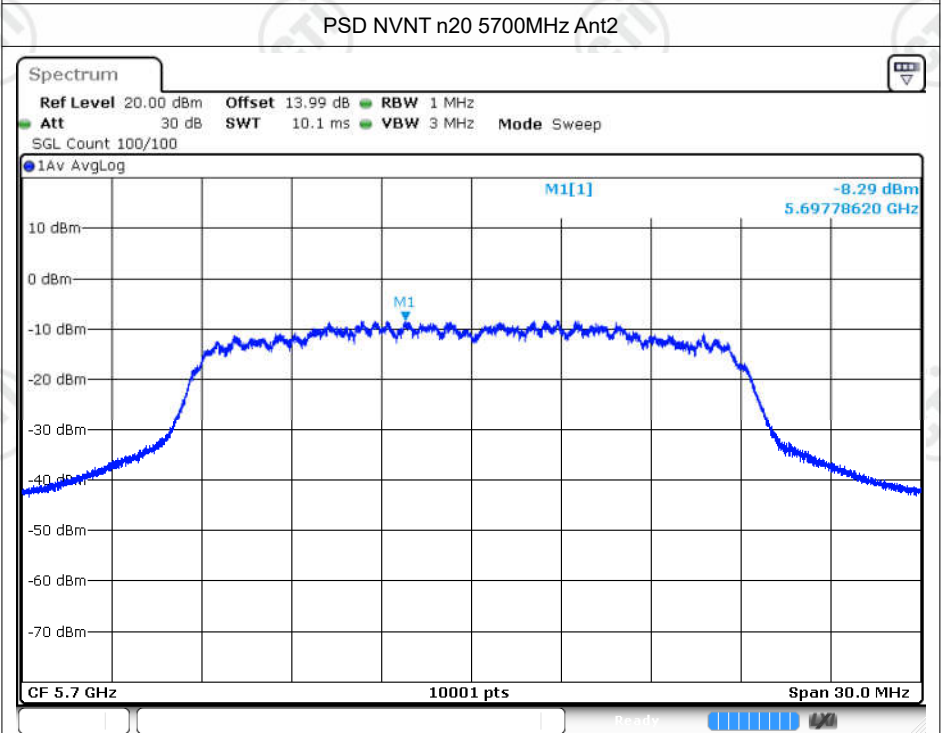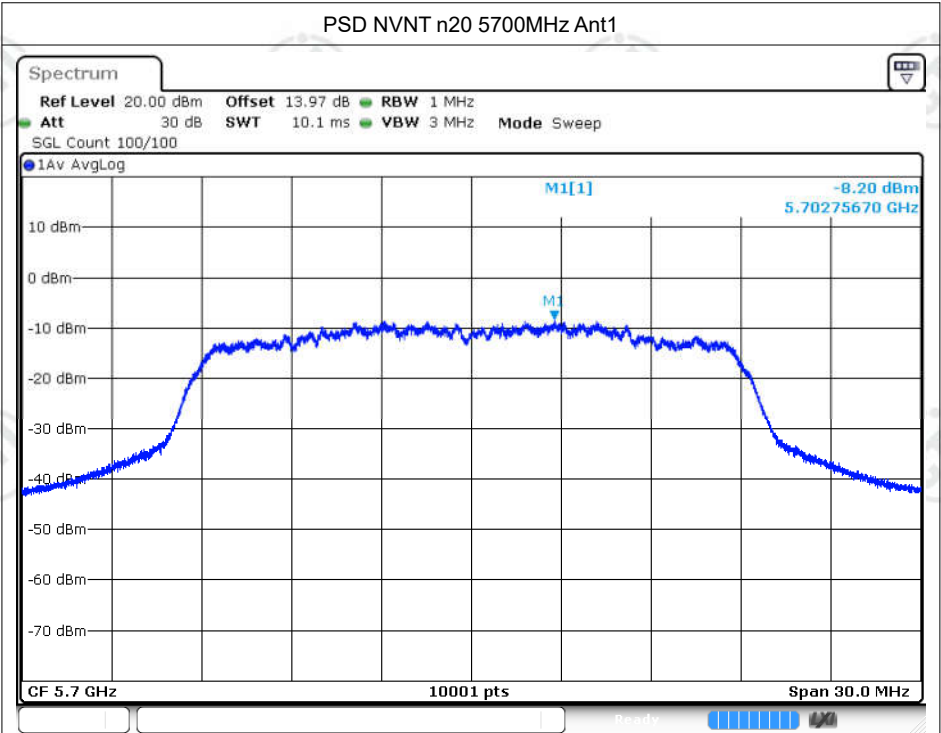


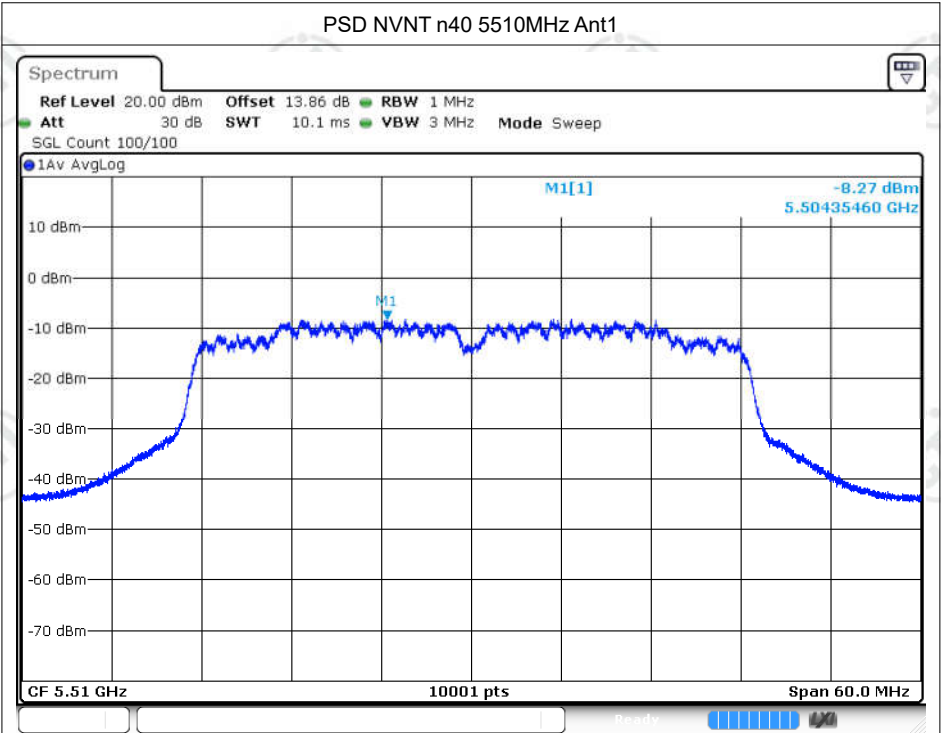


Date: 6 JAN 2025 08:40:48

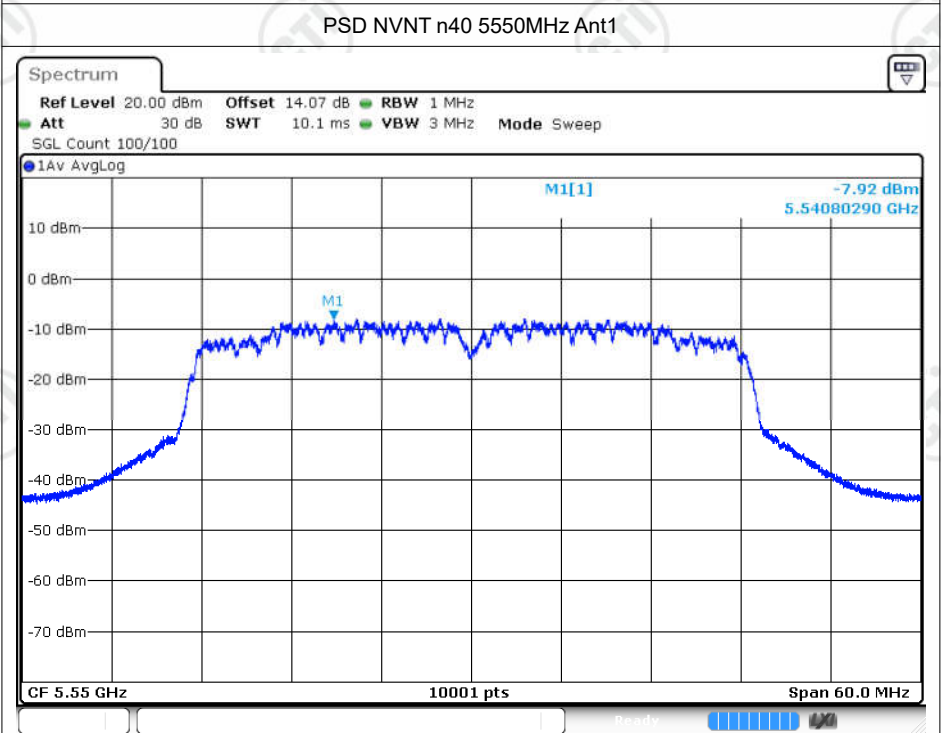


Date: 6 JAN 2025 08:42:39

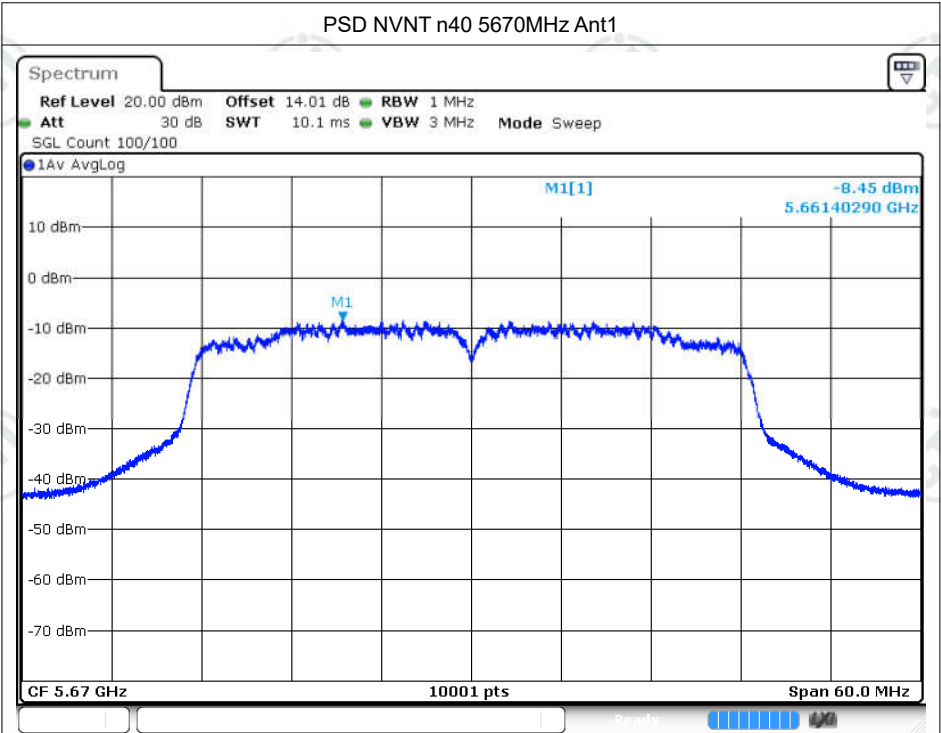


Date: 6 JAN 2025 08:52:59

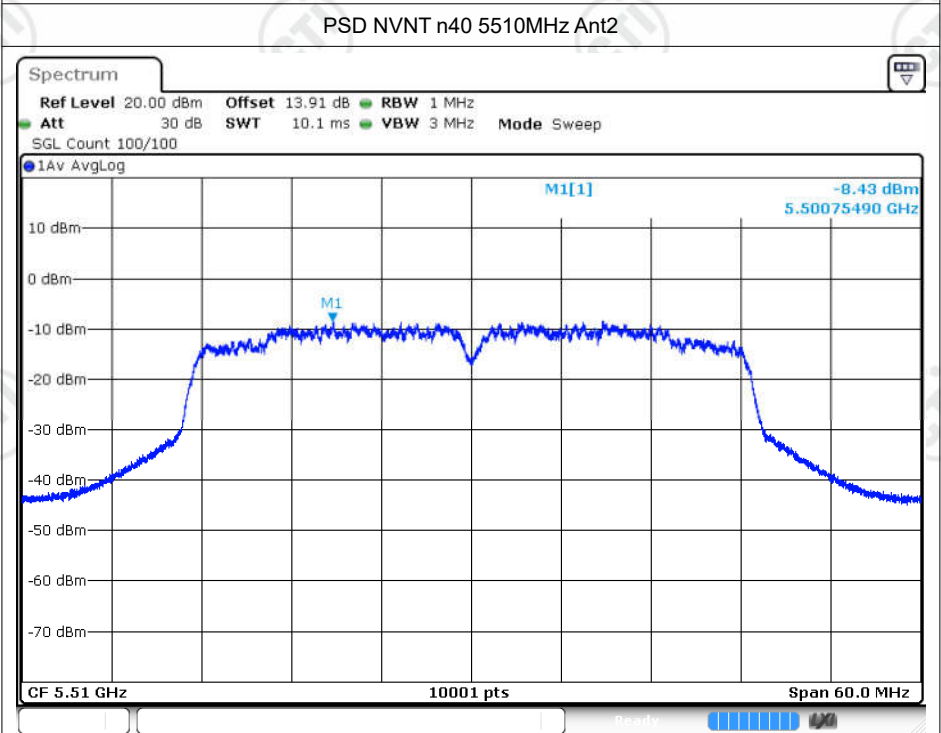


Date: 6 JAN 2025 09:35:33

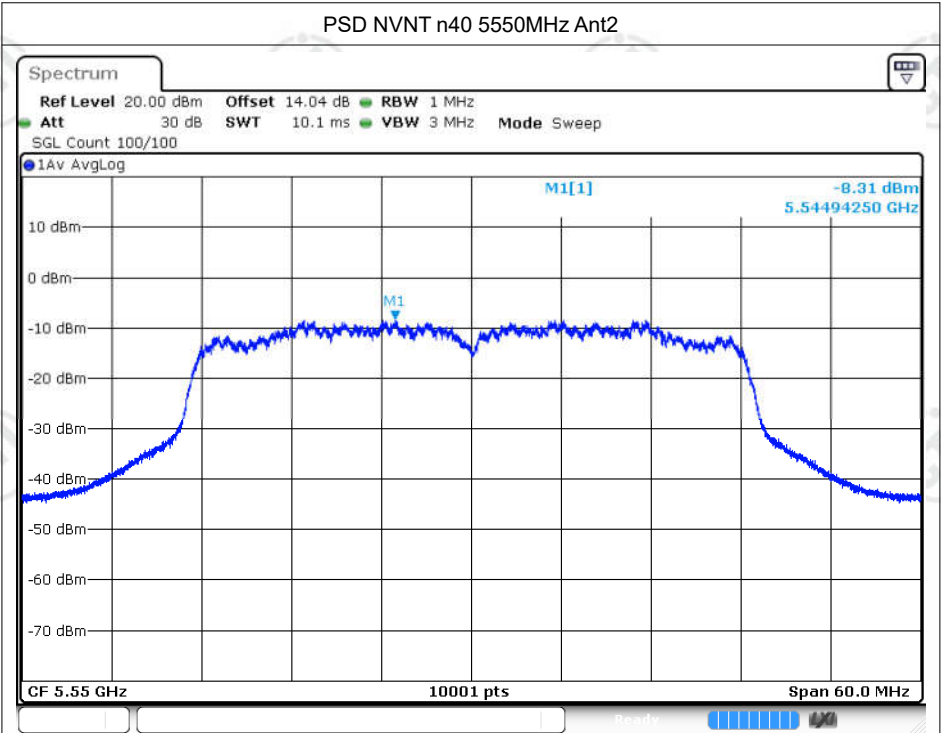


Date: 6 JAN.2025 09:37:45

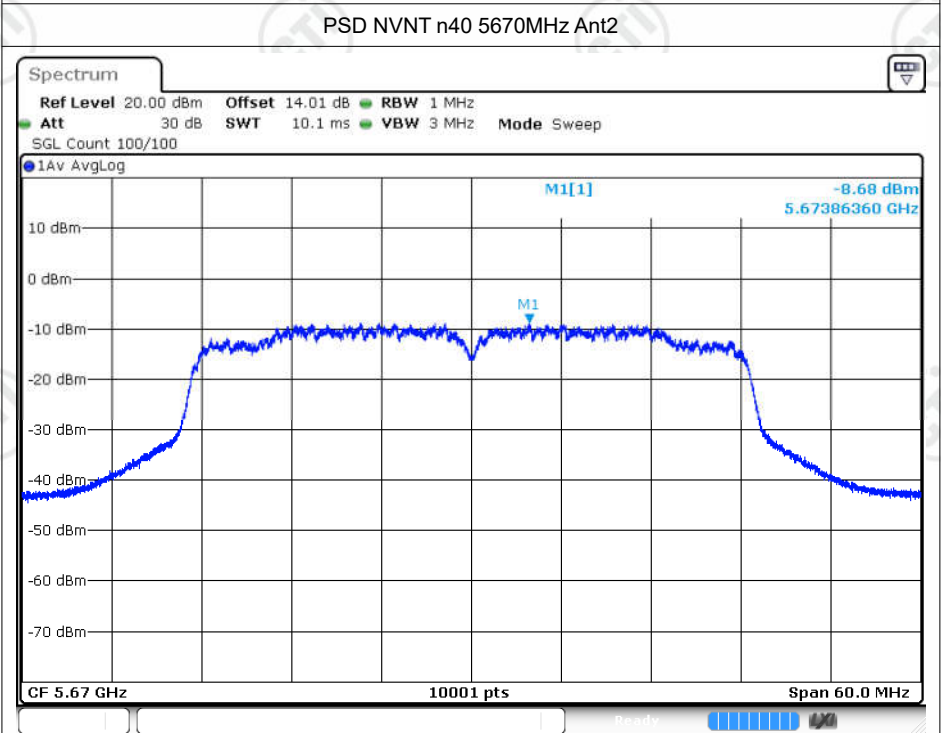


Date: 6 JAN.2025 09:39:29

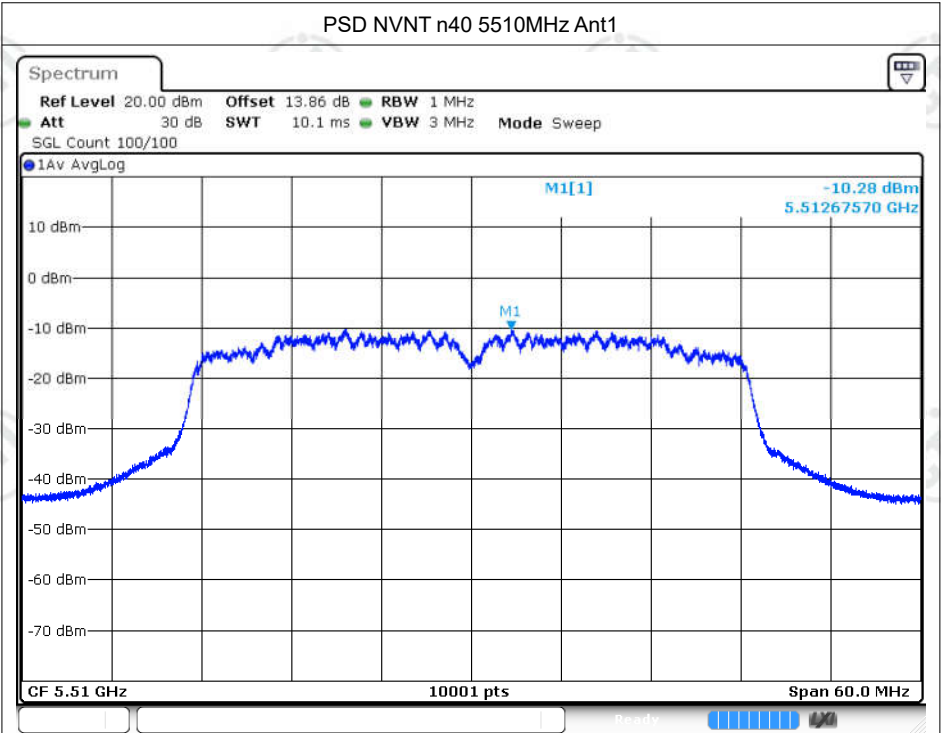


Date: 6 JAN 2025 10:02:12

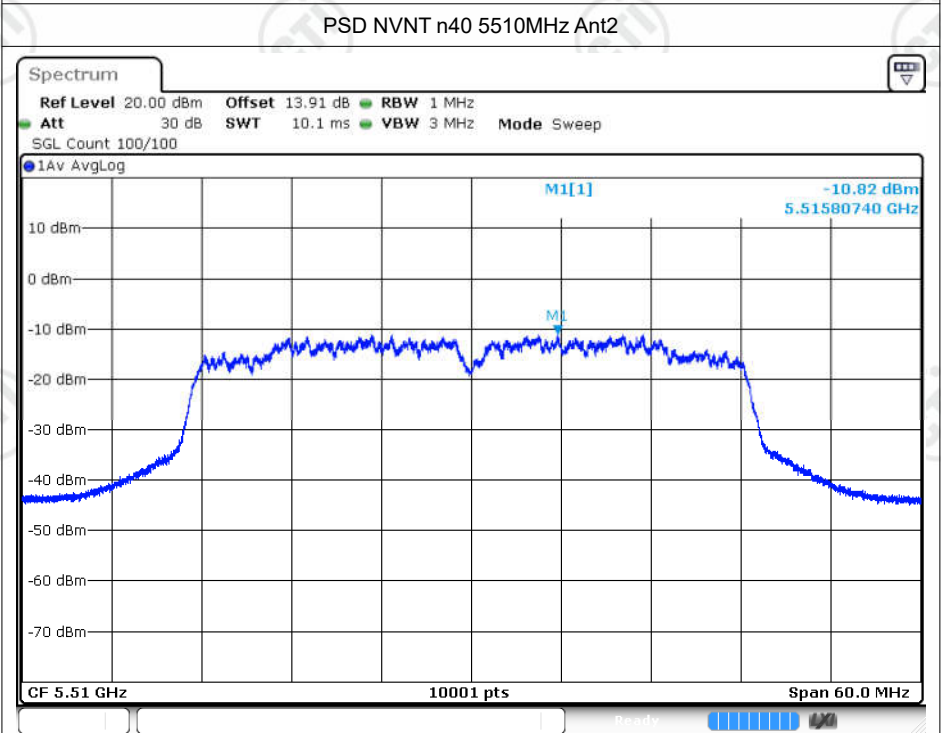


Date: 6 JAN 2025 10:02:16

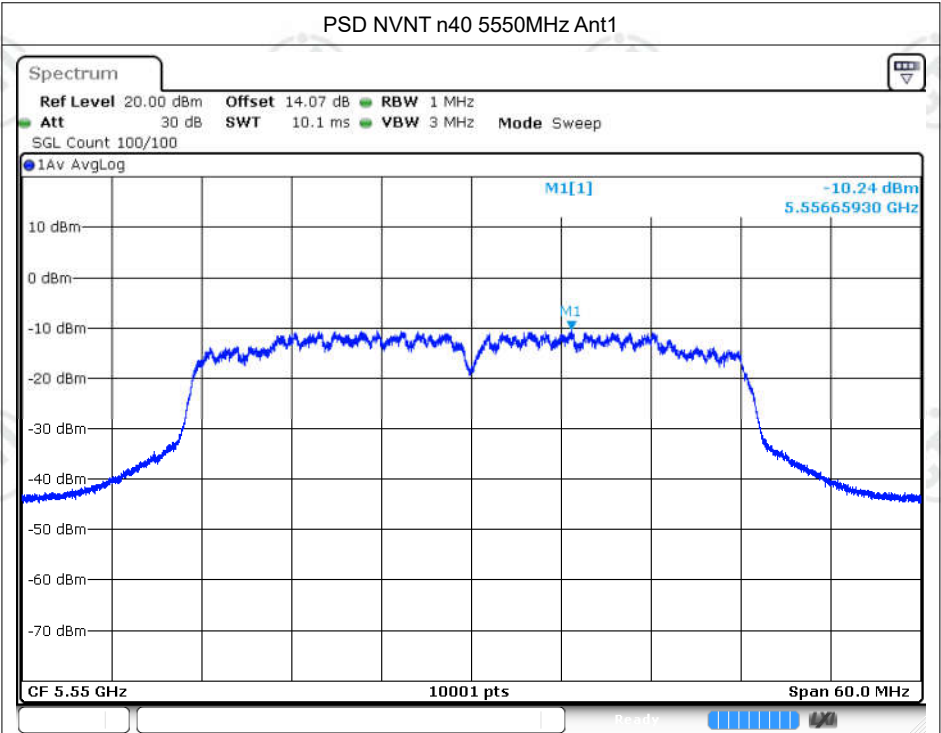


Date: 6 JAN.2025 10:04:27

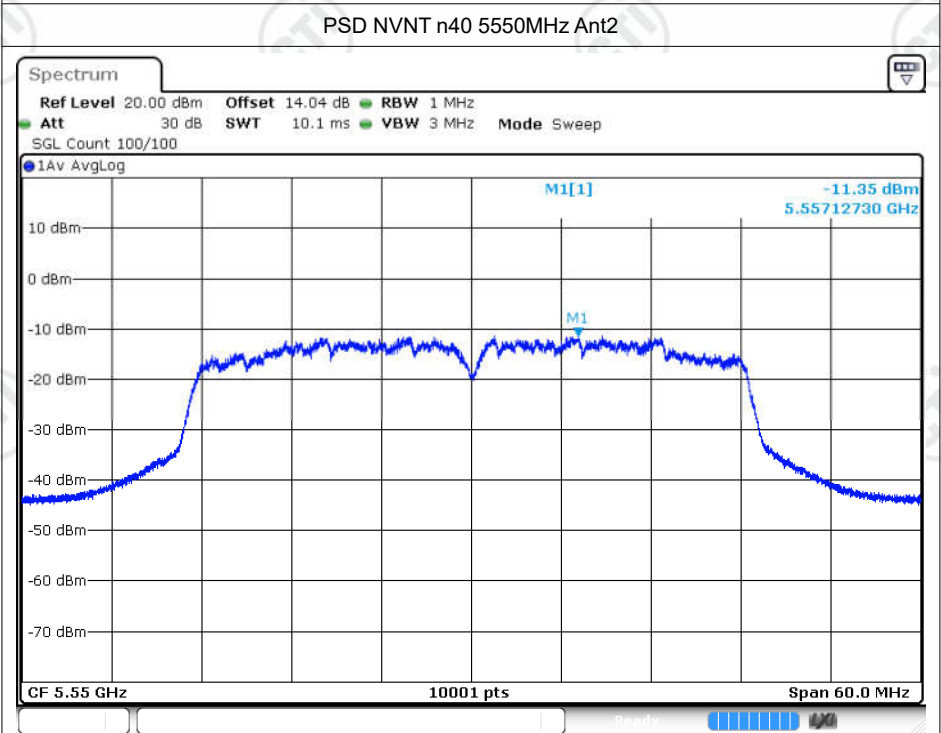


Date: 6 JAN.2025 10:04:30

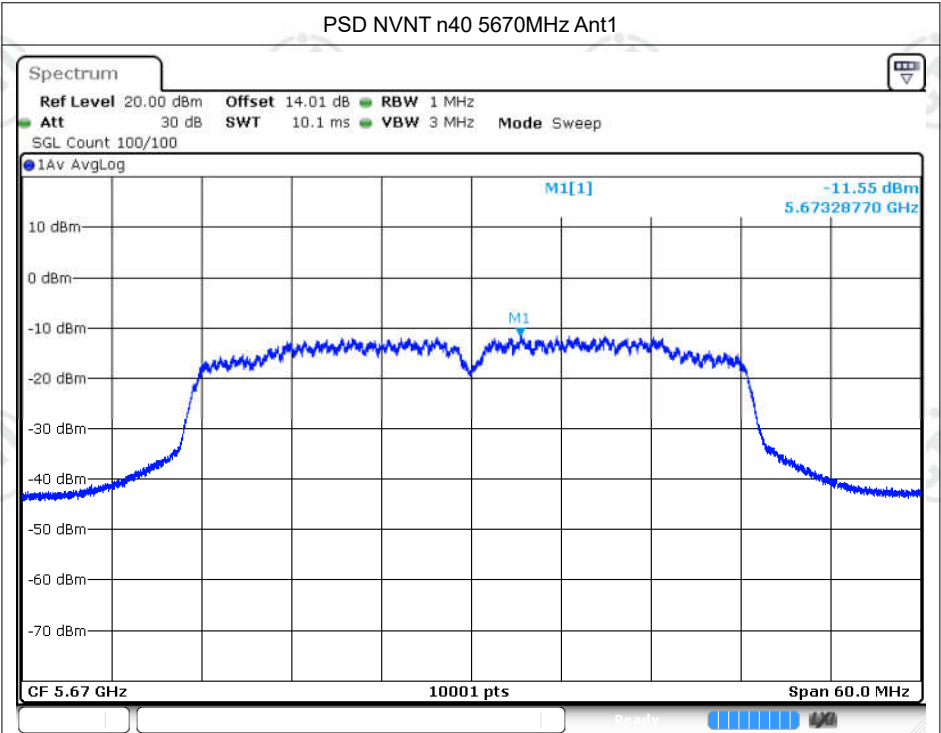


Date: 6 JAN 2025 10:06:06

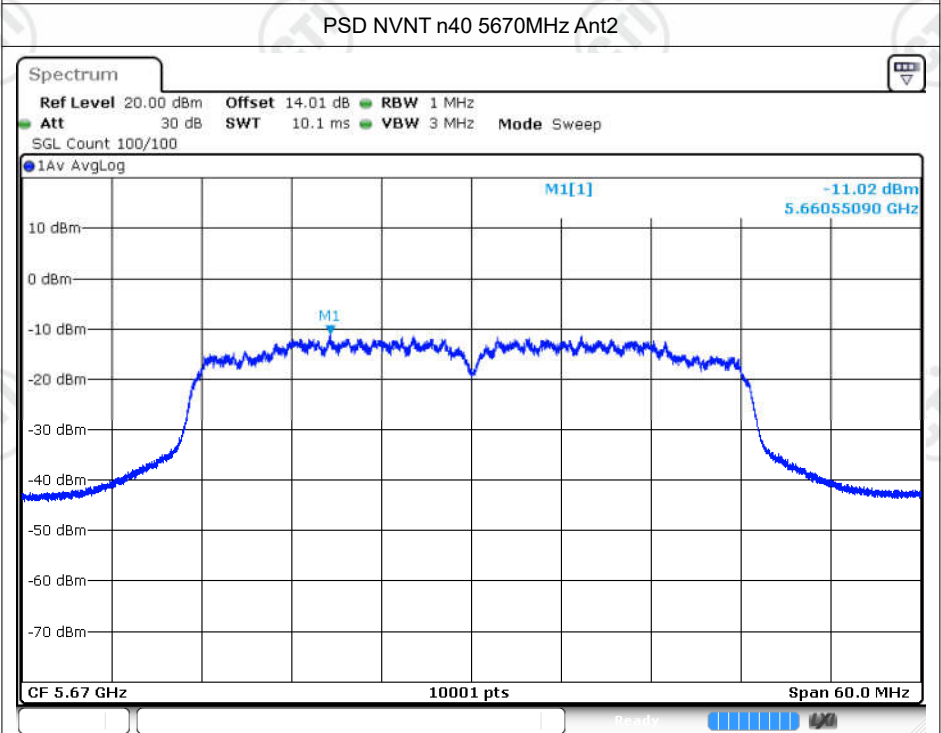


Date: 6 JAN 2025 10:06:10

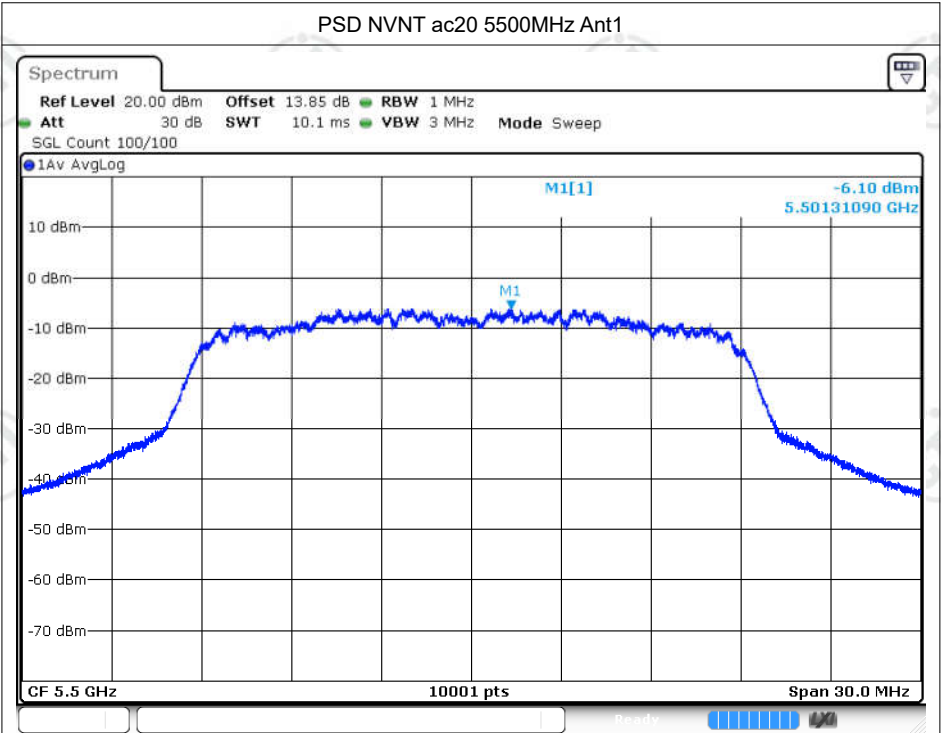


Date: 6 JAN 2025 08:34:54

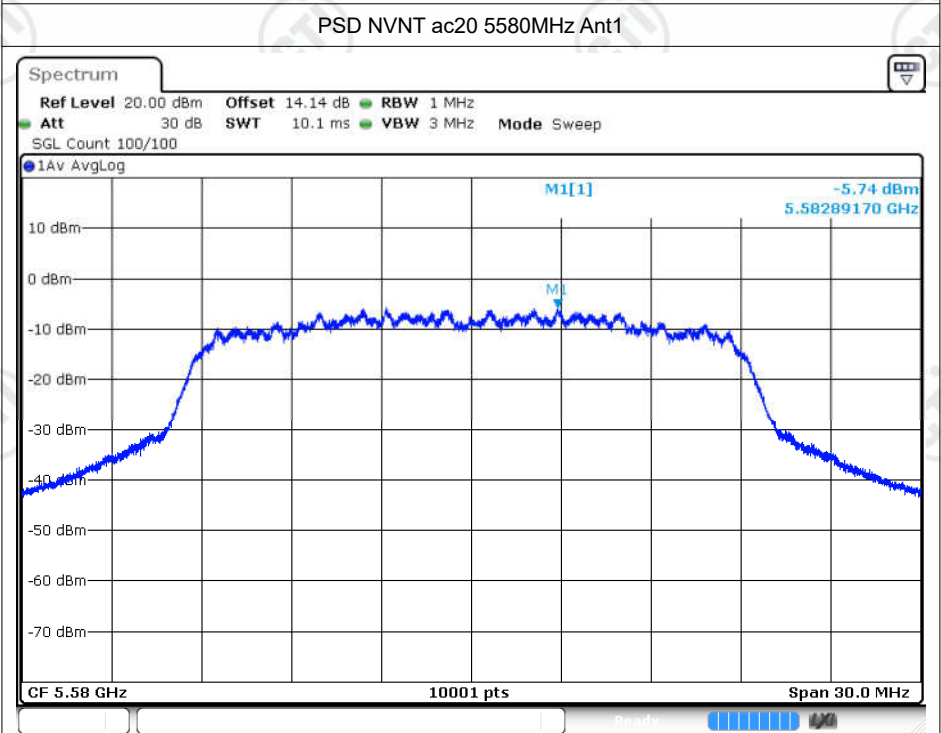


Date: 6 JAN 2025 08:36:13

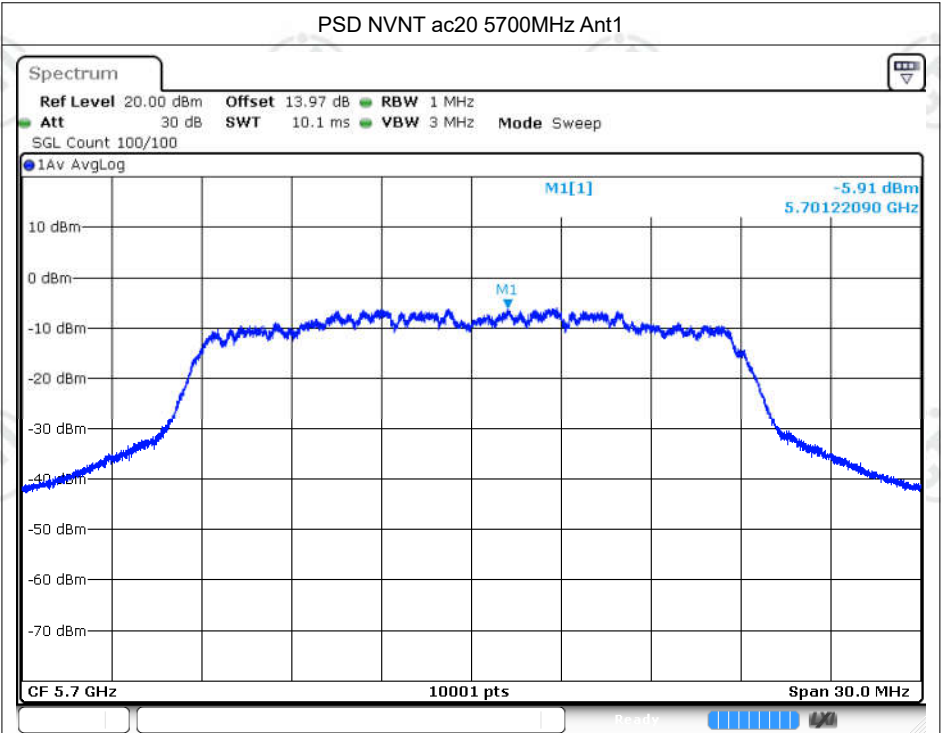


Date: 6 JAN 2025 08:38:19

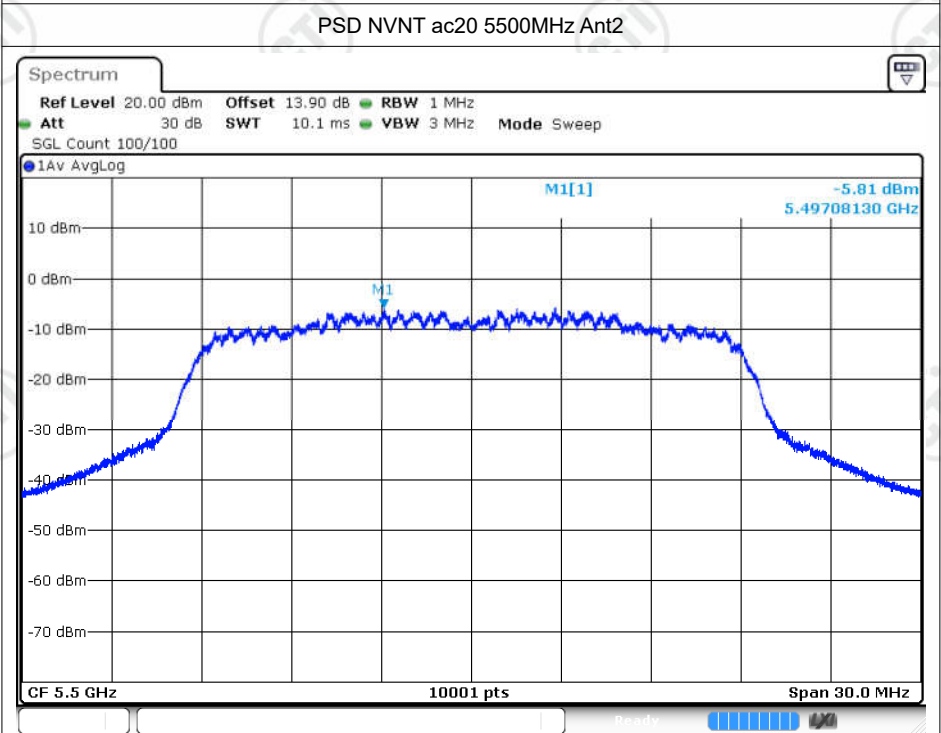



Date: 6 JAN 2025 09:20:08

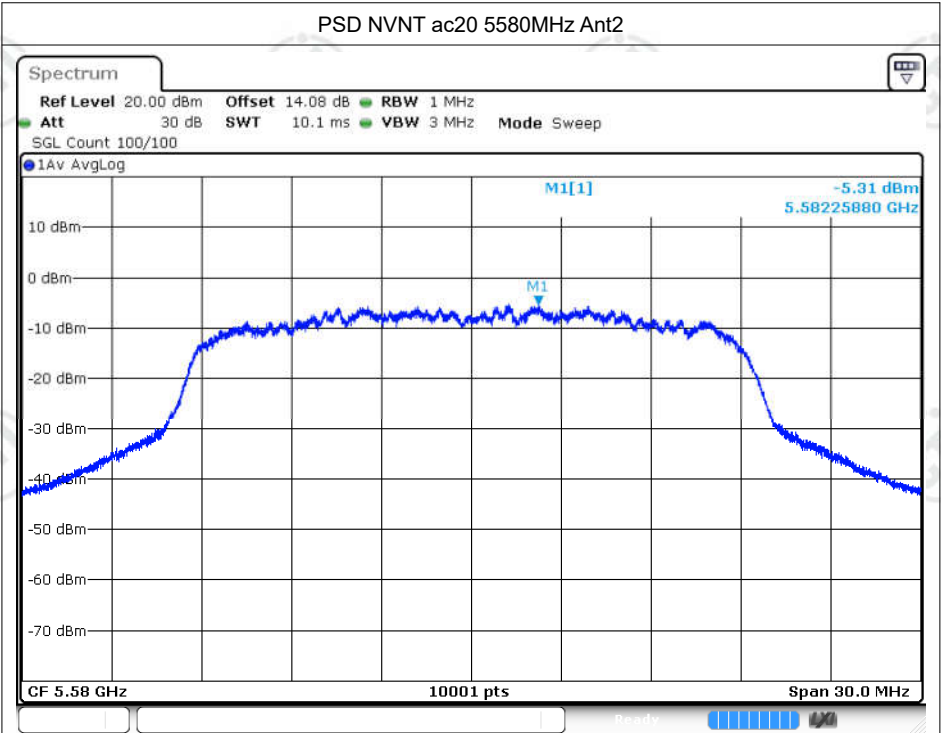


Date: 6 JAN.2025 09:22:47

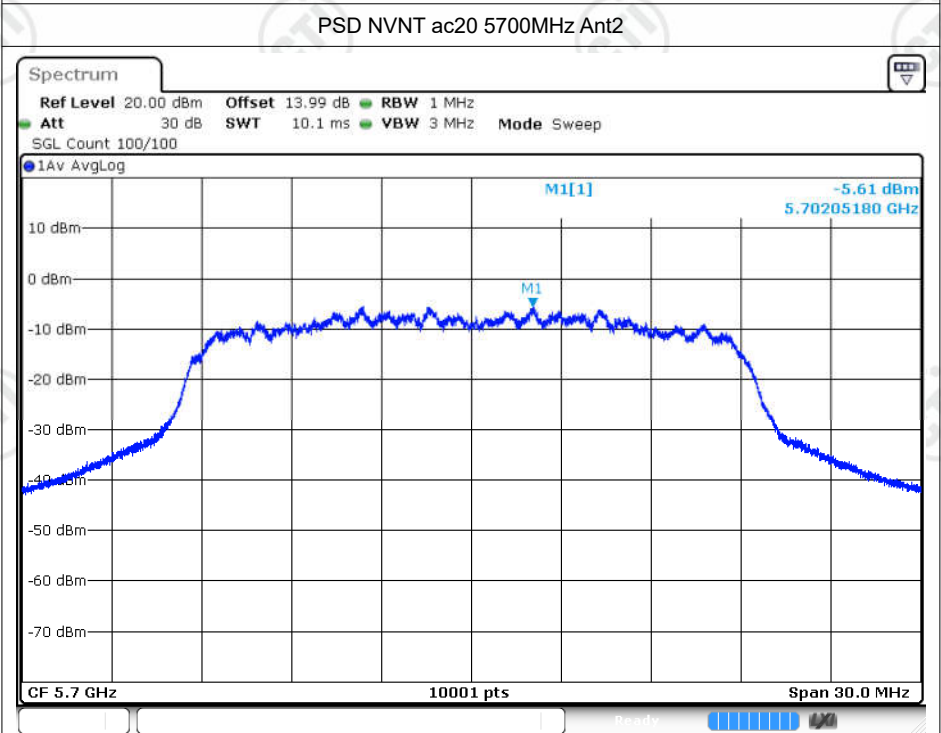


Date: 6 JAN.2025 09:33:14

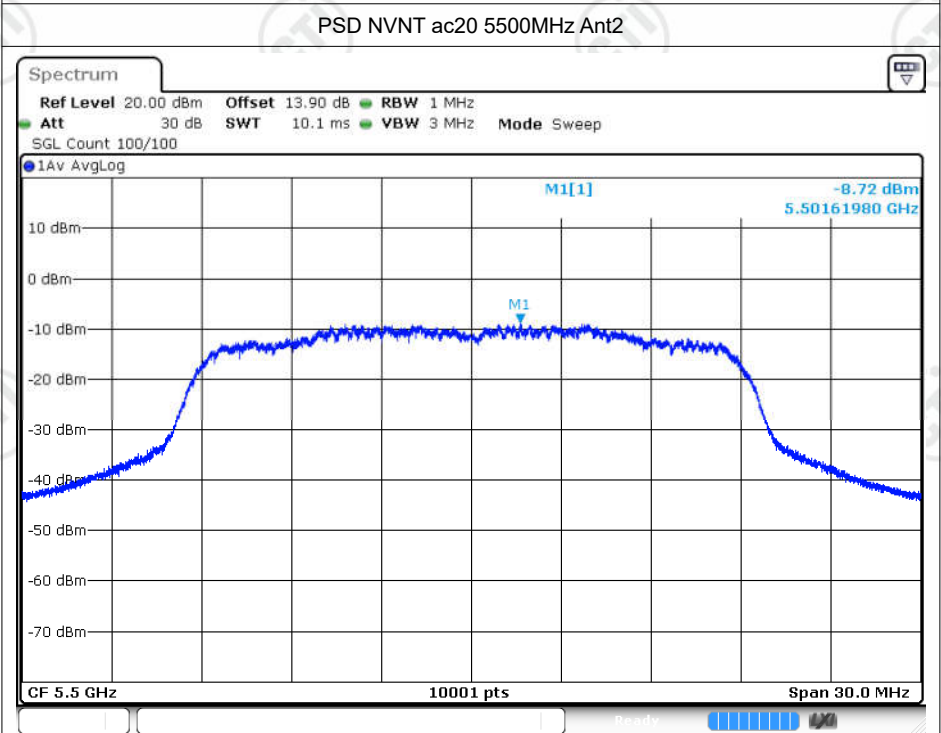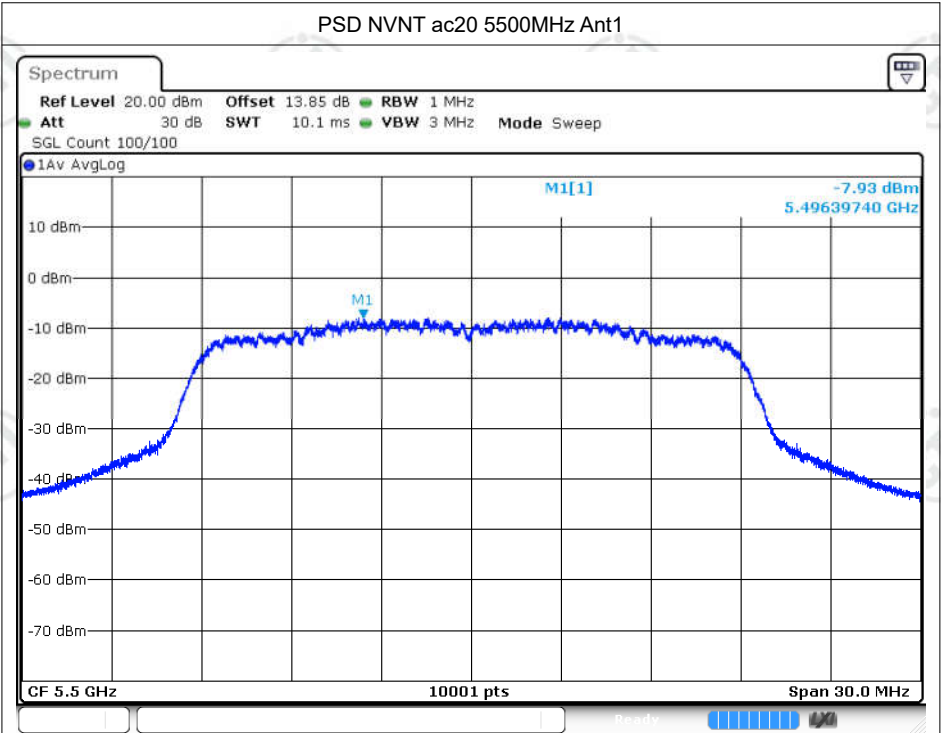


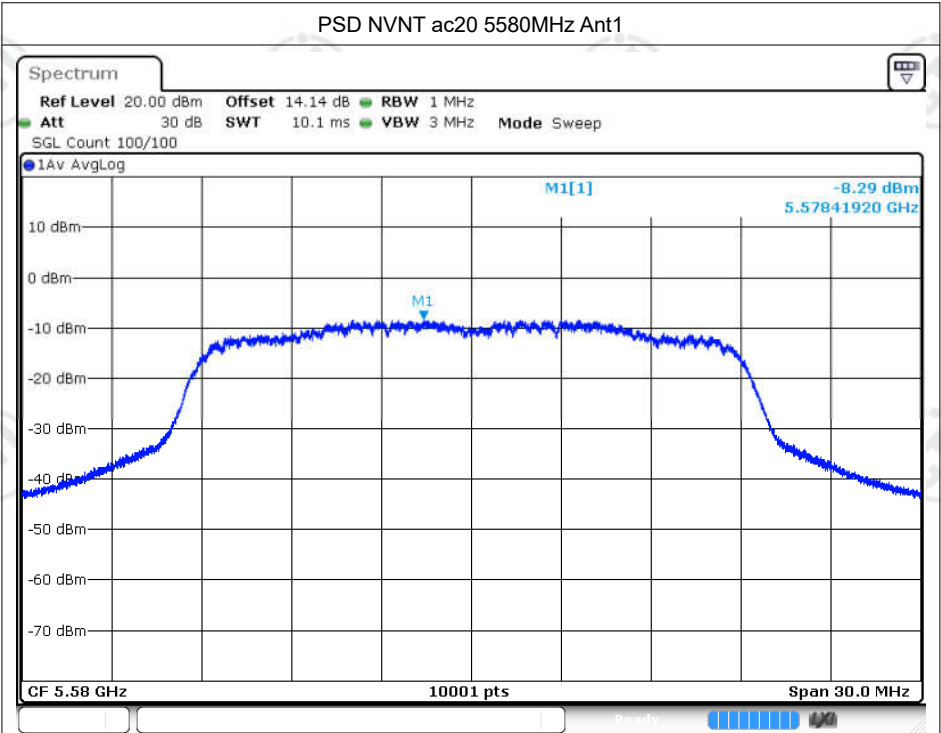


Date: 6 JAN 2025 09:57:16

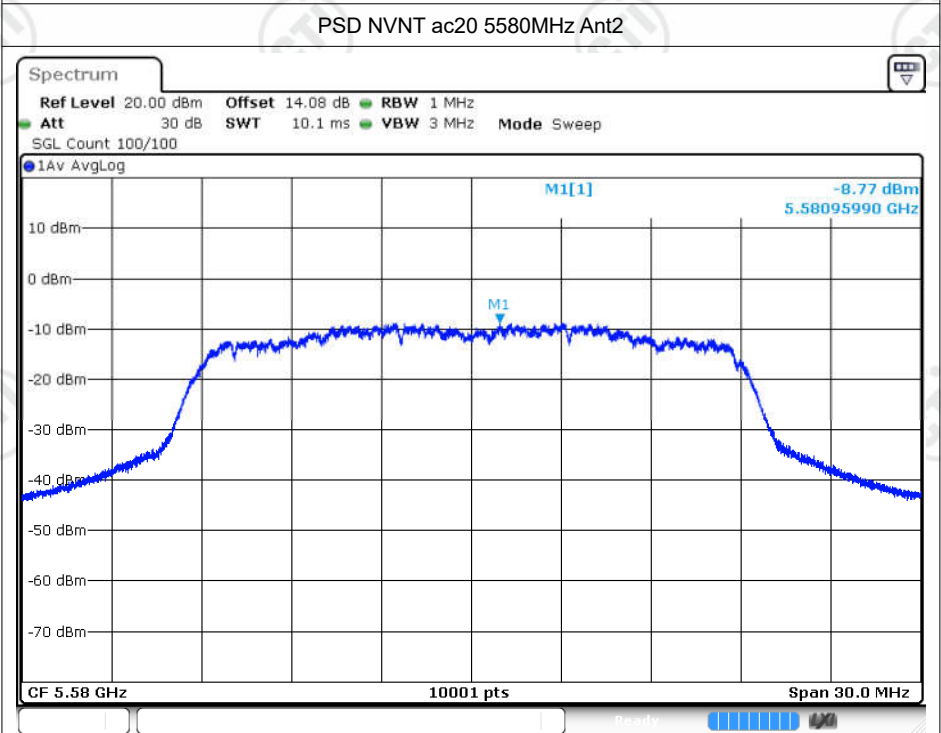


Date: 6 JAN 2025 09:57:20

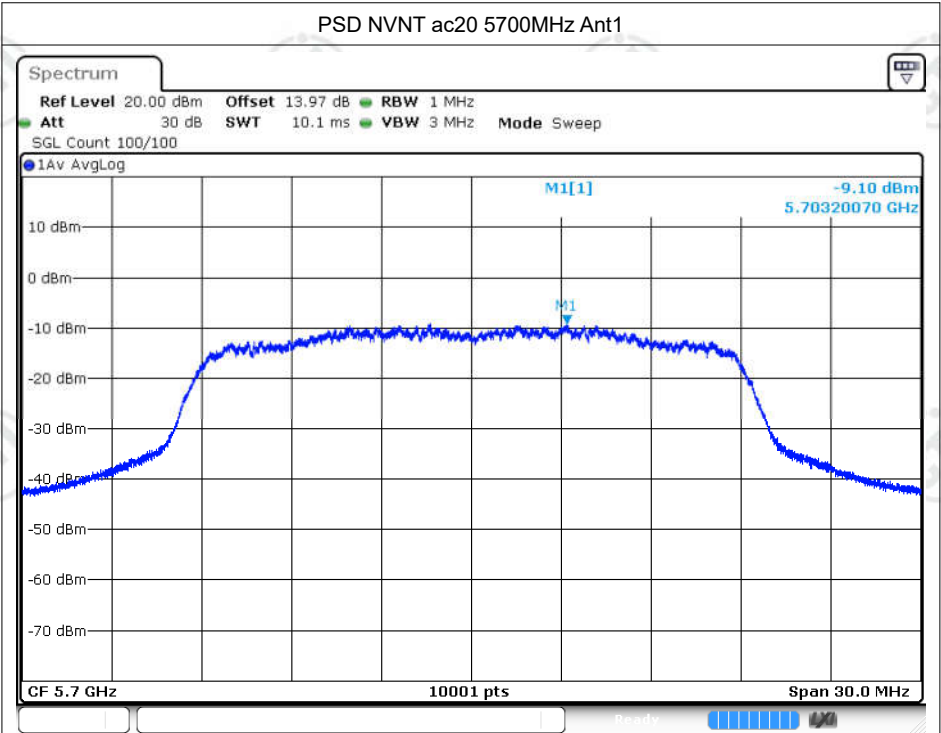


Date: 6 JAN 2025 09:58:05

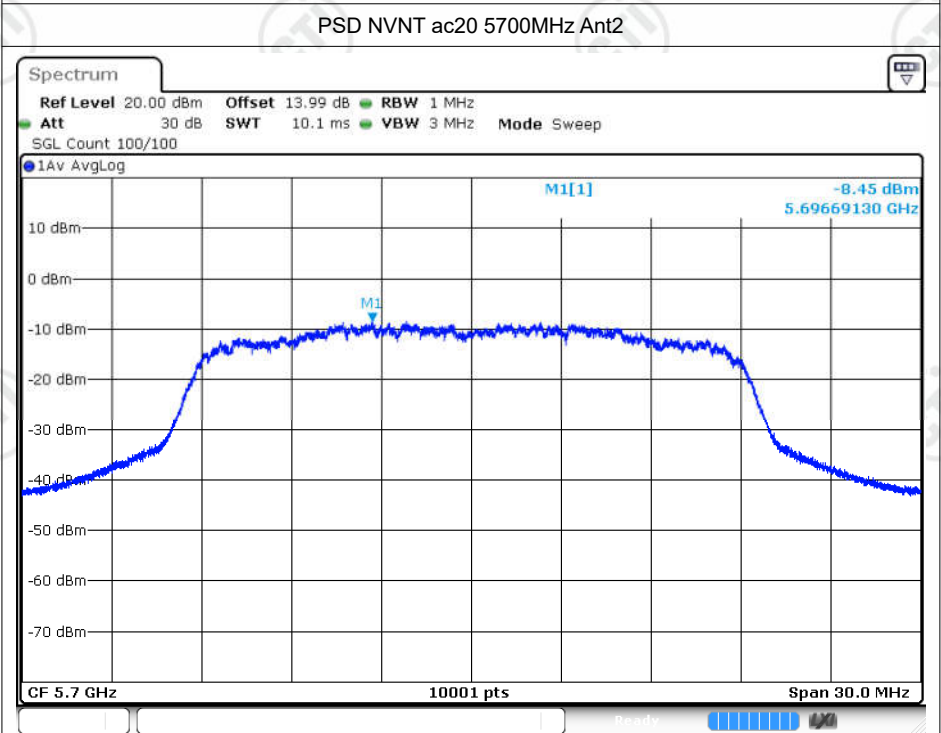


Date: 6 JAN 2025 09:58:08

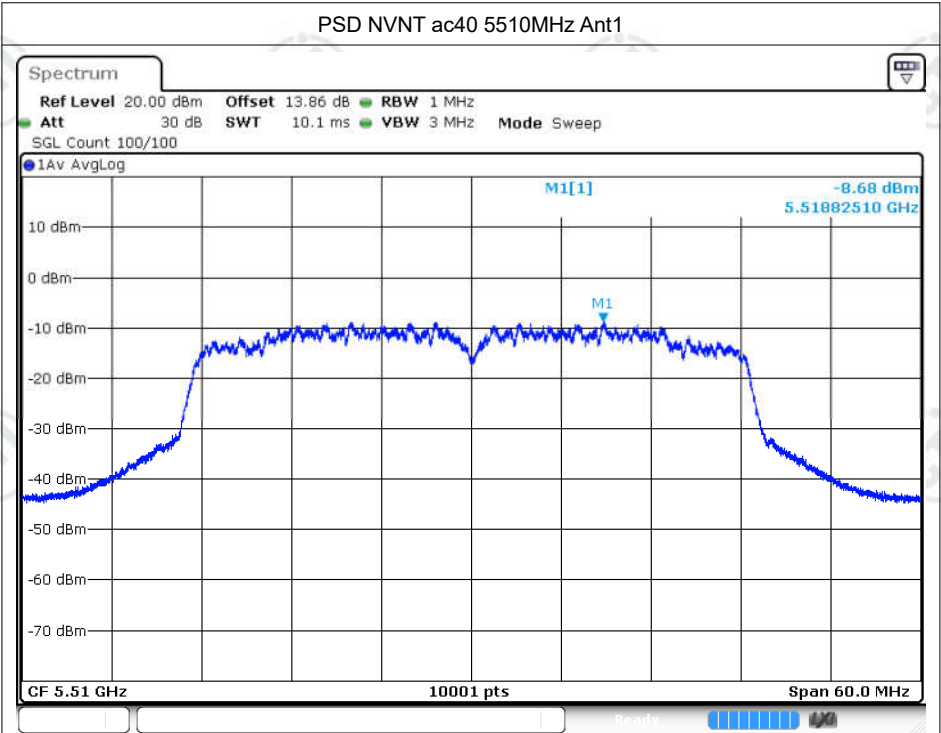


Date: 6 JAN 2025 08:56:06

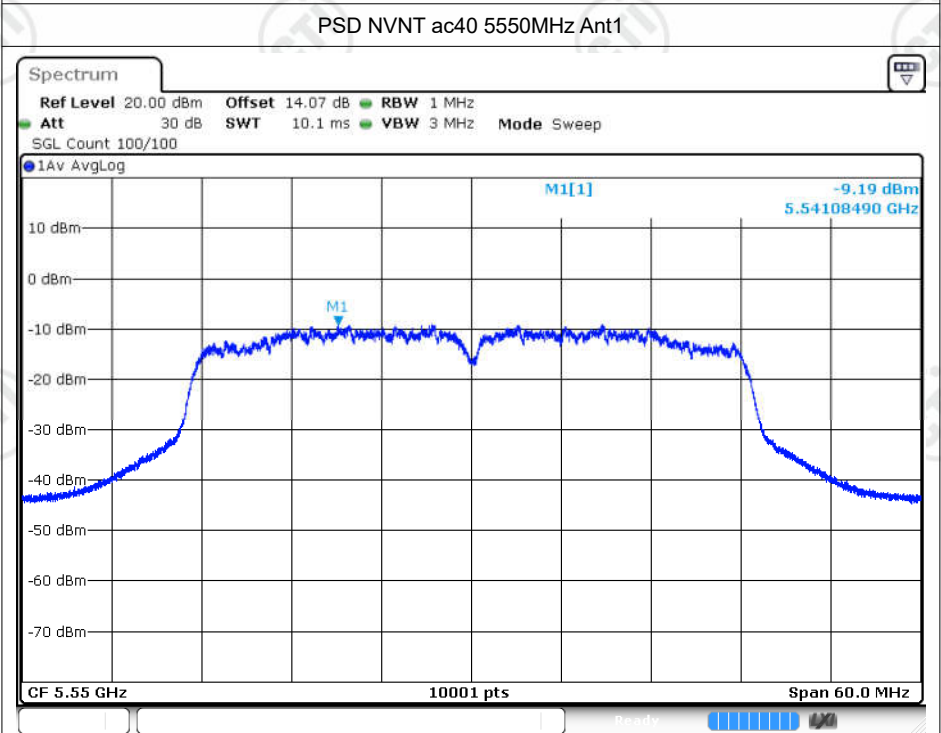



Date: 6 JAN 2025 08:58:16


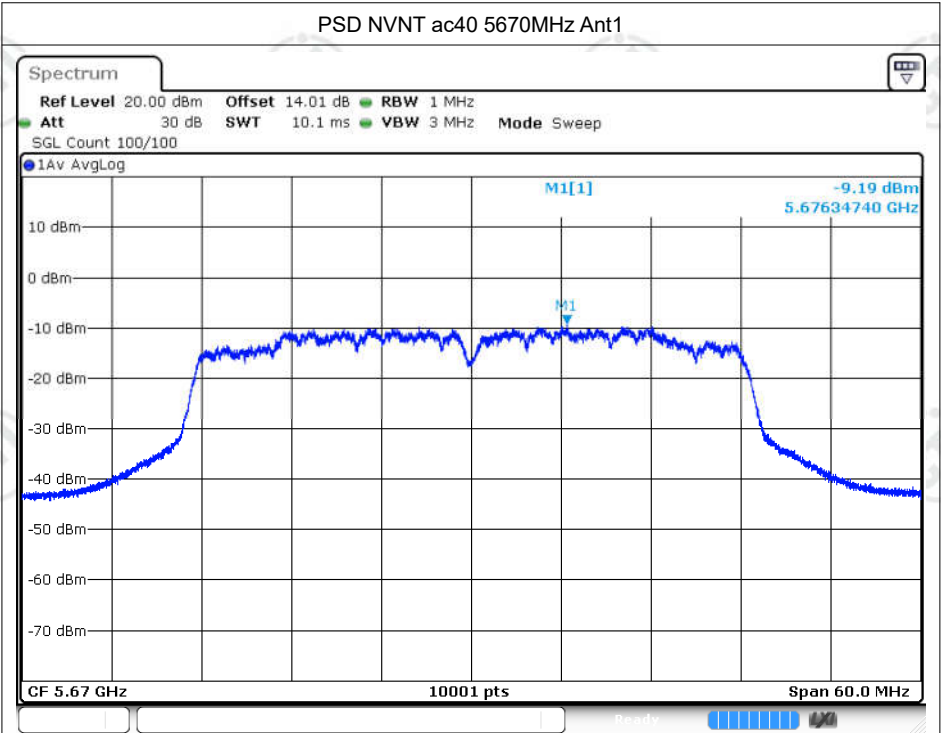



Date: 6 JAN 2025 09:00:58

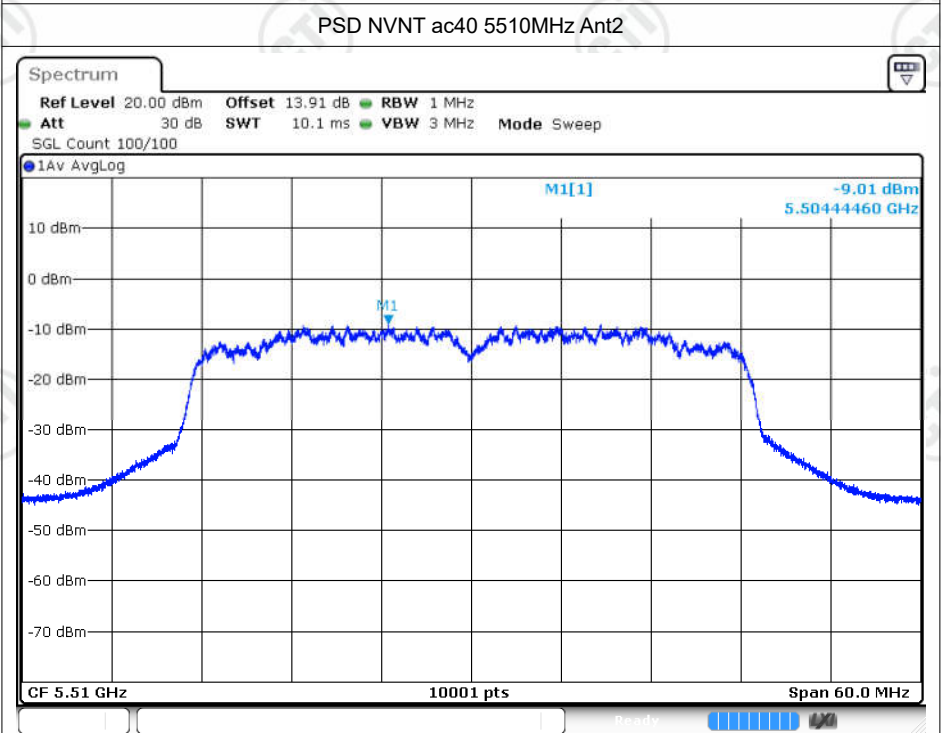


Date: 6 JAN 2025 09:43:01

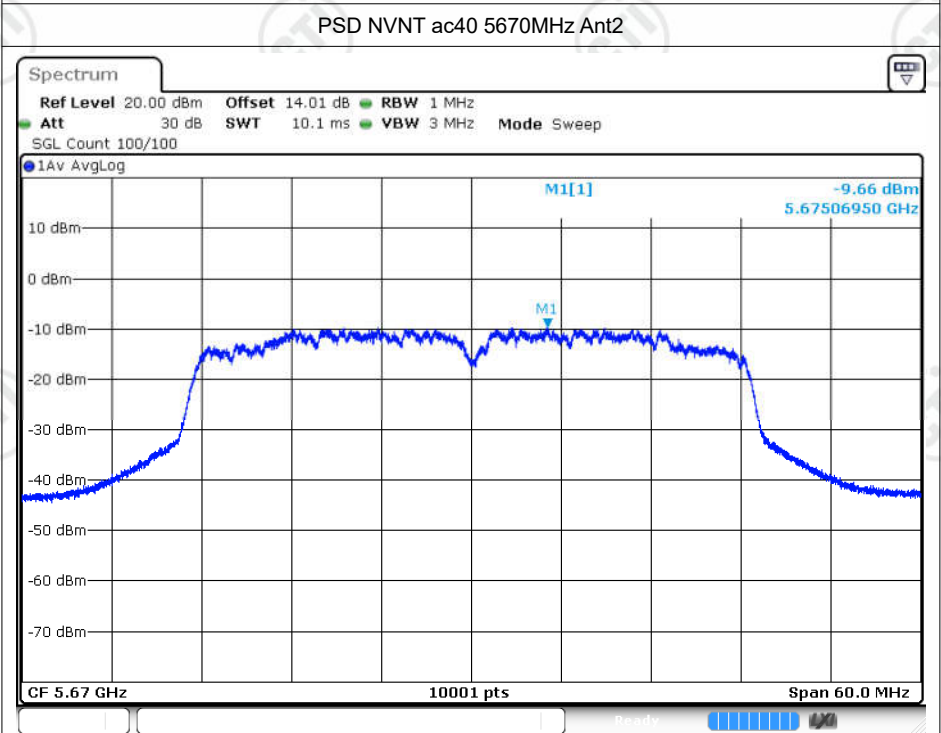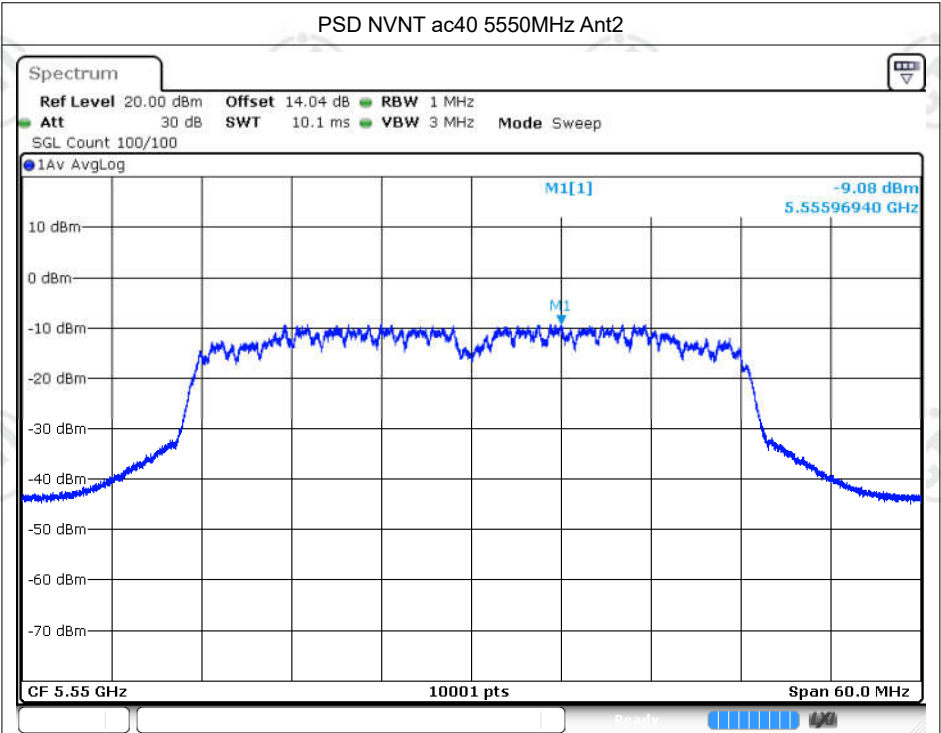

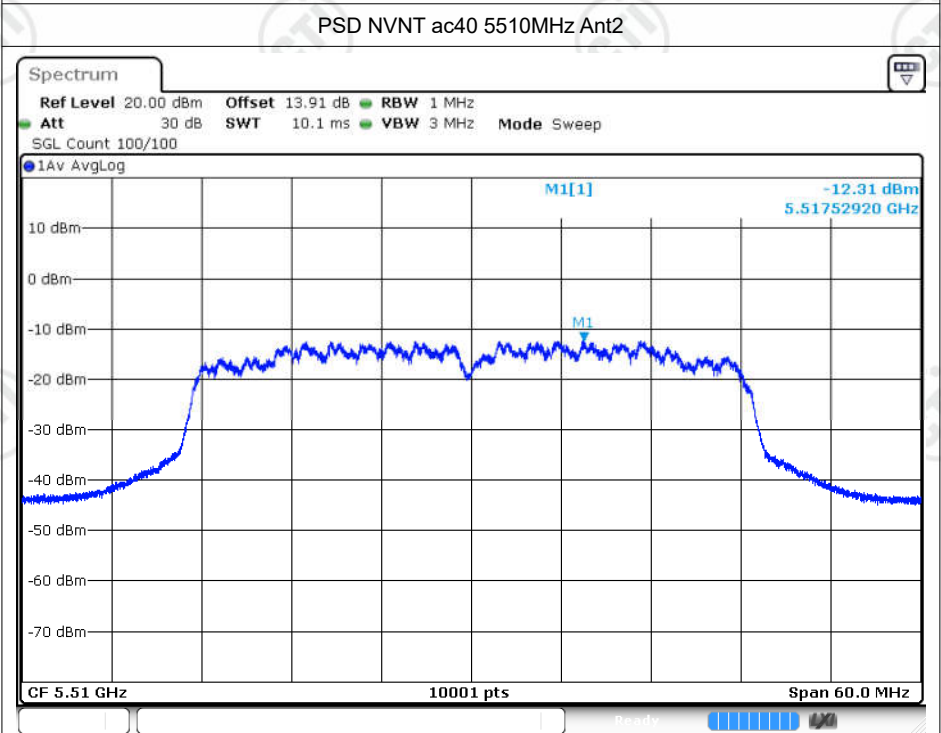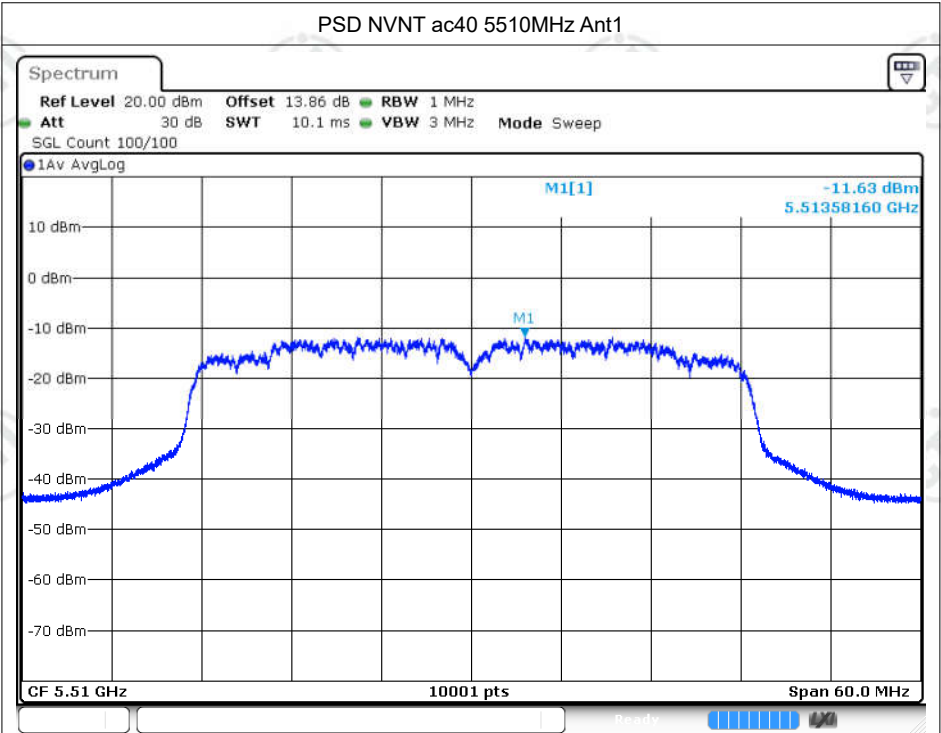


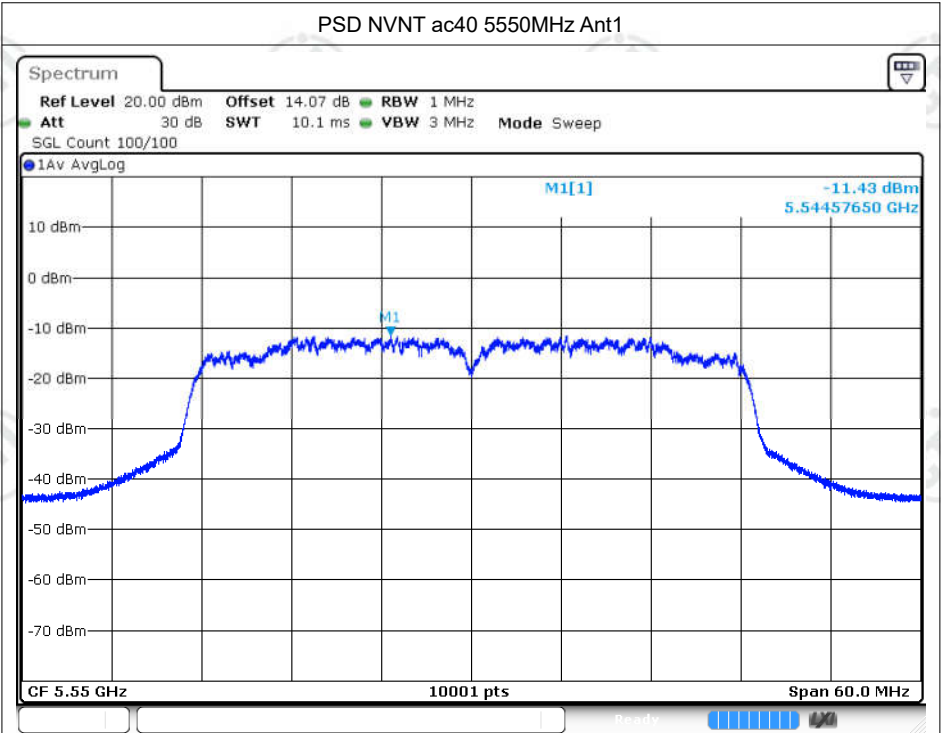


Date: 6 JAN 2025 10:12:35

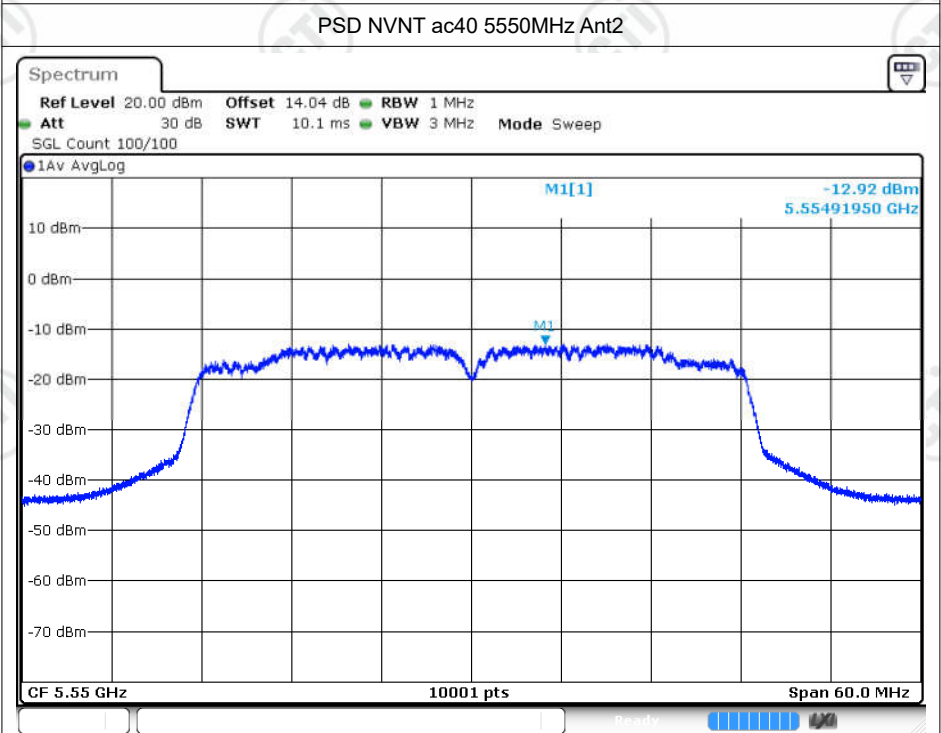


Date: 6 JAN 2025 10:12:38

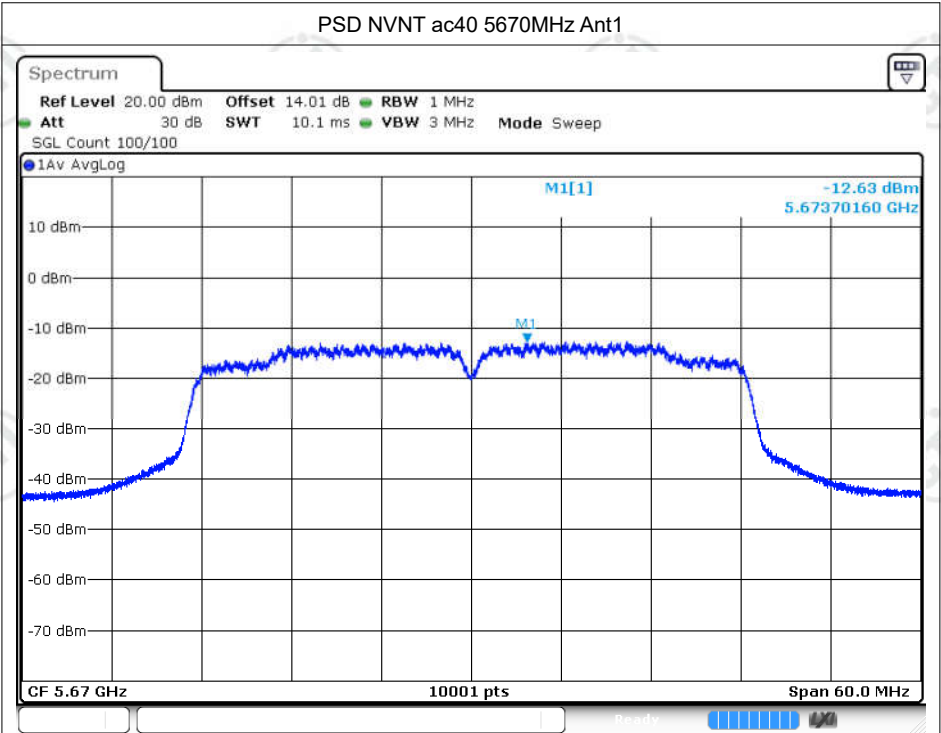


Date: 6 JAN 2025 10:15:29

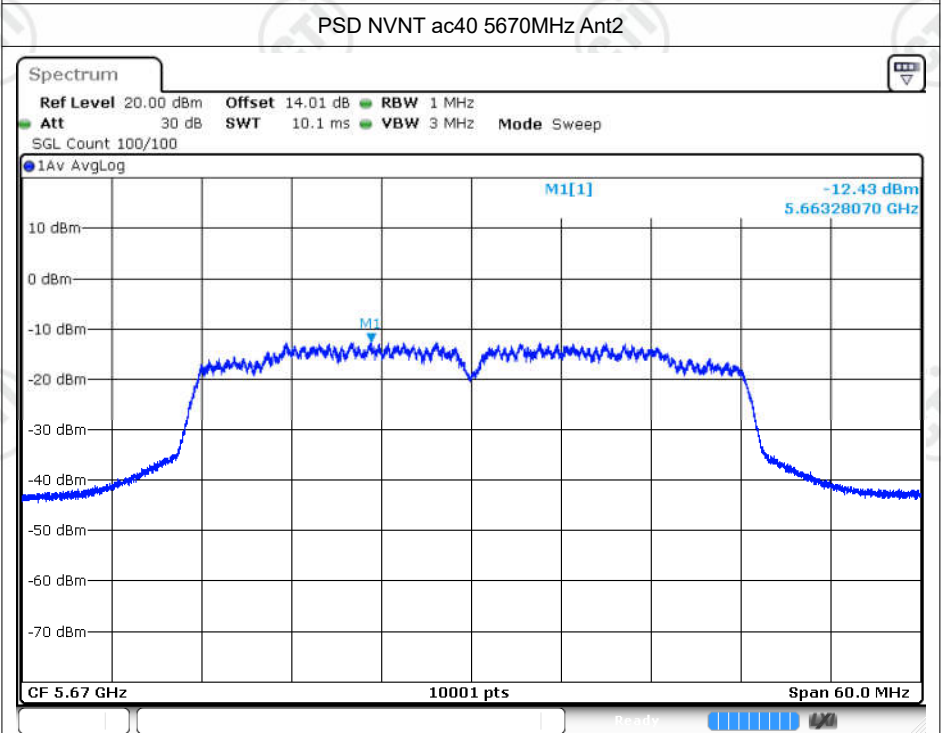


Date: 6 JAN 2025 10:15:32

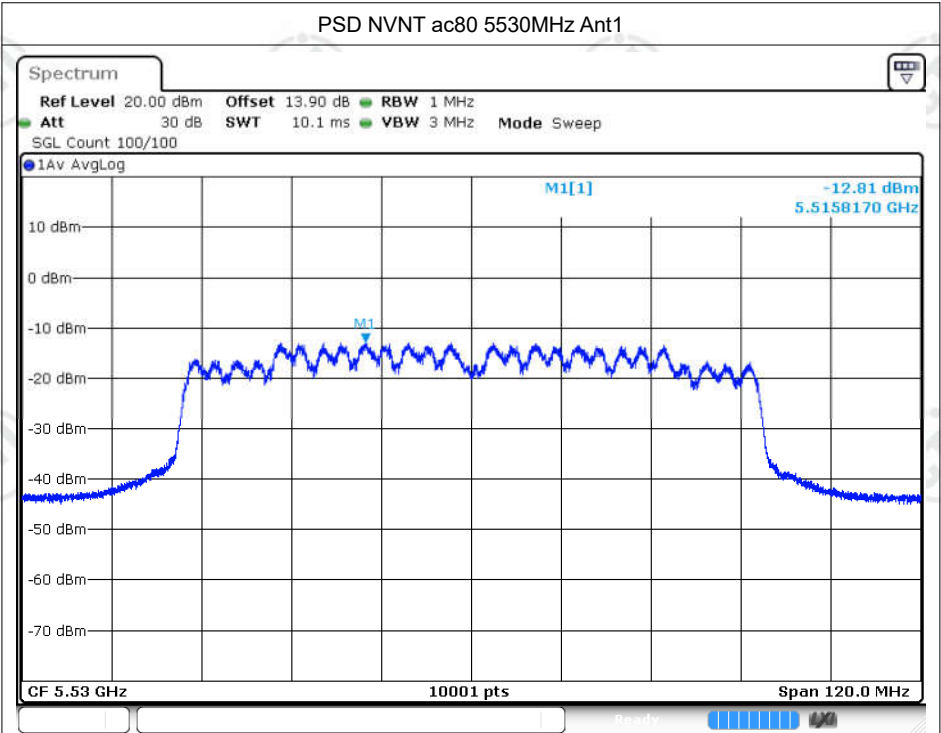


Date: 6 JAN.2025 09:04:56

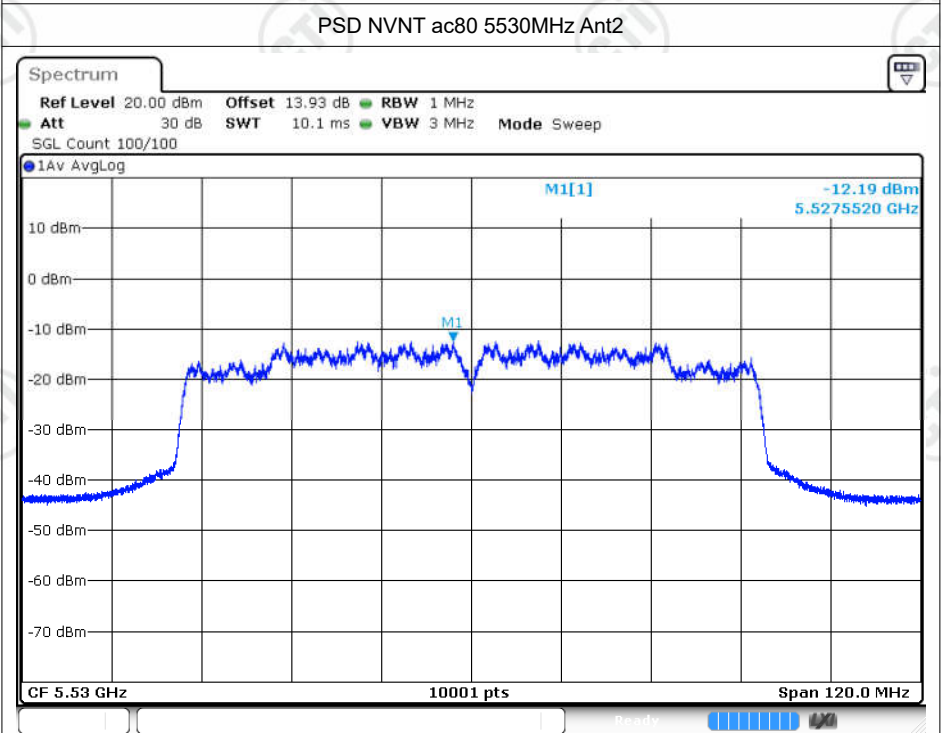

Date: 6 JAN.2025 09:49:58

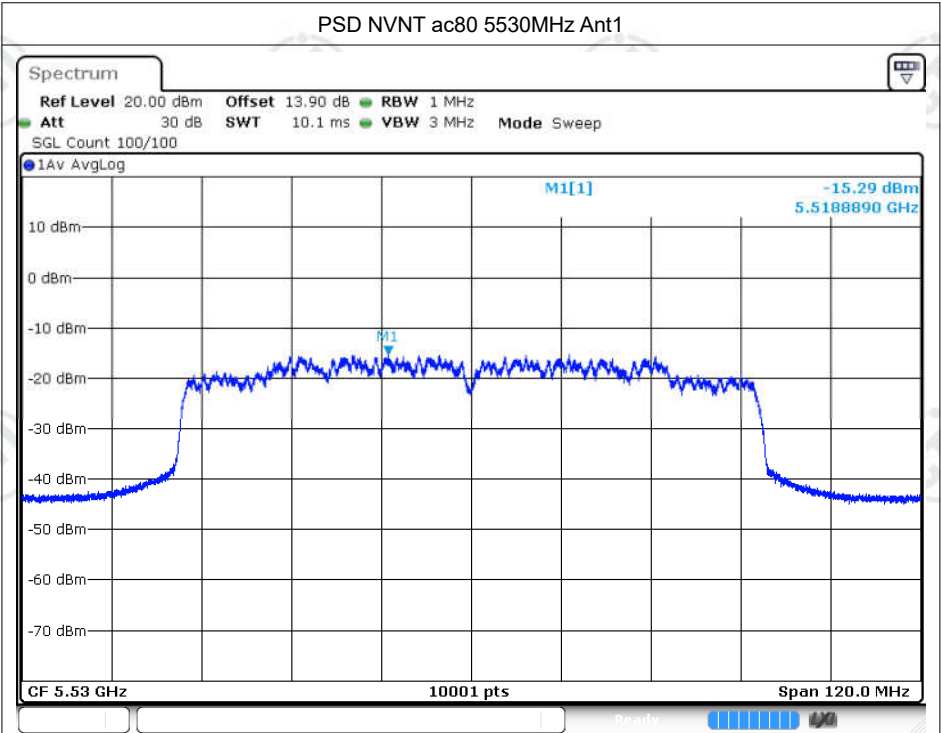

Date: 6 JAN 2025 10:16:51

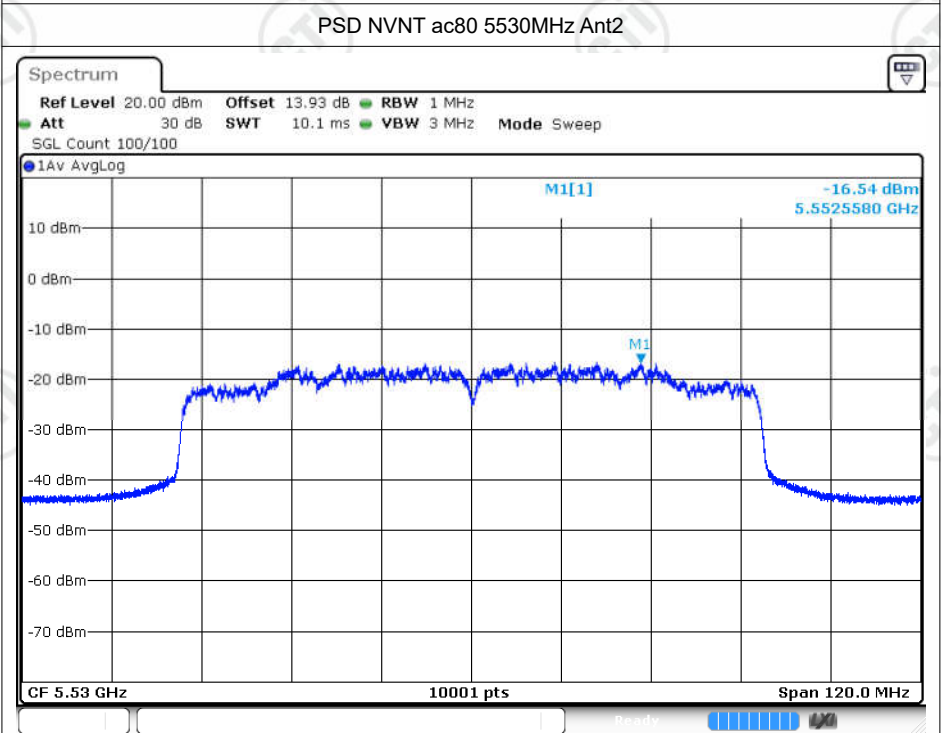

Date: 6 JAN 2025 10:16:55

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 138V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
-20C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
0C 120V	a	5500	Ant1	5500	0	0	25	Pass
10C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 120V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
40C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 120V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 102V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 120V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 138V	a	5580	Ant1	5579.96	-40000	-7.17	25	Pass
-20C 120V	a	5580	Ant1	5580	0	0	25	Pass
-10C 120V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
0C 120V	a	5580	Ant1	5580	0	0	25	Pass
10C 120V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
30C 120V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
40C 120V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
50C 120V	a	5580	Ant1	5580	0	0	25	Pass
20C 102V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 120V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 138V	a	5700	Ant1	5700	0	0	25	Pass
-20C 120V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
-10C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
0C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
10C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
30C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 120V	a	5700	Ant1	5700	0	0	25	Pass
50C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 102V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 120V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 138V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-20C 120V	a	5500	Ant2	5500	0	0	25	Pass
-10C 120V	a	5500	Ant2	5500	0	0	25	Pass
0C 120V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
10C 120V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass

30C 120V	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 120V	a	5500	Ant2	5500	0	0	25	Pass
50C 120V	a	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 102V	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
20C 120V	a	5580	Ant2	5580.02	20000	3.58	25	Pass
20C 138V	a	5580	Ant2	5580	0	0	25	Pass
-20C 120V	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
-10C 120V	a	5580	Ant2	5579.96	-40000	-7.17	25	Pass
0C 120V	a	5580	Ant2	5580	0	0	25	Pass
10C 120V	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
30C 120V	a	5580	Ant2	5579.96	-40000	-7.17	25	Pass
40C 120V	a	5580	Ant2	5580	0	0	25	Pass
50C 120V	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
20C 102V	a	5700	Ant2	5700	0	0	25	Pass
20C 120V	a	5700	Ant2	5700	0	0	25	Pass
20C 138V	a	5700	Ant2	5700	0	0	25	Pass
-20C 120V	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
-10C 120V	a	5700	Ant2	5700	0	0	25	Pass
0C 120V	a	5700	Ant2	5699.96	-40000	-7.02	25	Pass
10C 120V	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
30C 120V	a	5700	Ant2	5699.96	-40000	-7.02	25	Pass
40C 120V	a	5700	Ant2	5699.96	-40000	-7.02	25	Pass
50C 120V	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
20C 102V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 138V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
-20C 120V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
-10C 120V	n20	5500	Ant1	5500	0	0	25	Pass
0C 120V	n20	5500	Ant1	5500	0	0	25	Pass
10C 120V	n20	5500	Ant1	5500	0	0	25	Pass
30C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 120V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 102V	n20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 120V	n20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 138V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
-20C 120V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
-10C 120V	n20	5580	Ant1	5580.02	20000	3.58	25	Pass
0C 120V	n20	5580	Ant1	5580	0	0	25	Pass
10C 120V	n20	5580	Ant1	5579.94	-60000	-10.75	25	Pass
30C 120V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
40C 120V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass

50C 120V	n20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
20C 102V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 120V	n20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 138V	n20	5700	Ant1	5700	0	0	25	Pass
-20C 120V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 120V	n20	5700	Ant1	5699.94	-60000	-10.53	25	Pass
0C 120V	n20	5700	Ant1	5700	0	0	25	Pass
10C 120V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 120V	n20	5700	Ant1	5700	0	0	25	Pass
40C 120V	n20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
50C 120V	n20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 102V	n20	5500	Ant2	5500	0	0	25	Pass
20C 120V	n20	5500	Ant2	5500	0	0	25	Pass
20C 138V	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-20C 120V	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-10C 120V	n20	5500	Ant2	5500	0	0	25	Pass
0C 120V	n20	5500	Ant2	5500	0	0	25	Pass
10C 120V	n20	5500	Ant2	5500	0	0	25	Pass
30C 120V	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 120V	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
50C 120V	n20	5500	Ant2	5499.96	-40000	-7.27	25	Pass
20C 102V	n20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
20C 120V	n20	5580	Ant2	5580	0	0	25	Pass
20C 138V	n20	5580	Ant2	5580	0	0	25	Pass
-20C 120V	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
-10C 120V	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
0C 120V	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
10C 120V	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
30C 120V	n20	5580	Ant2	5580	0	0	25	Pass
40C 120V	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
50C 120V	n20	5580	Ant2	5580	0	0	25	Pass
20C 102V	n20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
20C 120V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
20C 138V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
-20C 120V	n20	5700	Ant2	5700	0	0	25	Pass
-10C 120V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
0C 120V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
10C 120V	n20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
30C 120V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
40C 120V	n20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
50C 120V	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
20C 102V	n40	5510	Ant1	5510	0	0	25	Pass


20C 120V	n40	5510	Ant1	5510	0	0	25	Pass
20C 138V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
-20C 120V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
-10C 120V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
0C 120V	n40	5510	Ant1	5510	0	0	25	Pass
10C 120V	n40	5510	Ant1	5510	0	0	25	Pass
30C 120V	n40	5510	Ant1	5510	0	0	25	Pass
40C 120V	n40	5510	Ant1	5510	0	0	25	Pass
50C 120V	n40	5510	Ant1	5510	0	0	25	Pass
20C 102V	n40	5550	Ant1	5550	0	0	25	Pass
20C 120V	n40	5550	Ant1	5550	0	0	25	Pass
20C 138V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
-20C 120V	n40	5550	Ant1	5550	0	0	25	Pass
-10C 120V	n40	5550	Ant1	5550	0	0	25	Pass
0C 120V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
10C 120V	n40	5550	Ant1	5550	0	0	25	Pass
30C 120V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
40C 120V	n40	5550	Ant1	5550	0	0	25	Pass
50C 120V	n40	5550	Ant1	5550	0	0	25	Pass
20C 102V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 138V	n40	5670	Ant1	5670	0	0	25	Pass
-20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
-10C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
0C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
10C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
30C 120V	n40	5670	Ant1	5670	0	0	25	Pass
40C 120V	n40	5670	Ant1	5670	0	0	25	Pass
50C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 102V	n40	5510	Ant2	5510	0	0	25	Pass
20C 120V	n40	5510	Ant2	5510	0	0	25	Pass
20C 138V	n40	5510	Ant2	5510	0	0	25	Pass
-20C 120V	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
-10C 120V	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
0C 120V	n40	5510	Ant2	5510	0	0	25	Pass
10C 120V	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
30C 120V	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
40C 120V	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
50C 120V	n40	5510	Ant2	5510	0	0	25	Pass
20C 102V	n40	5550	Ant2	5549.92	-80000	-14.41	25	Pass
20C 120V	n40	5550	Ant2	5550	0	0	25	Pass
20C 138V	n40	5550	Ant2	5550	0	0	25	Pass

-20C 120V	n40	5550	Ant2	5550	0	0	25	Pass
-10C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
0C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
10C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
30C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
40C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
50C 120V	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
20C 102V	n40	5670	Ant2	5670	0	0	25	Pass
20C 120V	n40	5670	Ant2	5670	0	0	25	Pass
20C 138V	n40	5670	Ant2	5670	0	0	25	Pass
-20C 120V	n40	5670	Ant2	5670	0	0	25	Pass
-10C 120V	n40	5670	Ant2	5670	0	0	25	Pass
0C 120V	n40	5670	Ant2	5670	0	0	25	Pass
10C 120V	n40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
30C 120V	n40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
40C 120V	n40	5670	Ant2	5670	0	0	25	Pass
50C 120V	n40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
20C 102V	ac20	5500	Ant1	5499.94	-60000	-10.91	25	Pass
20C 120V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 138V	ac20	5500	Ant1	5500	0	0	25	Pass
-20C 120V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 120V	ac20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
0C 120V	ac20	5500	Ant1	5500	0	0	25	Pass
10C 120V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 120V	ac20	5500	Ant1	5500	0	0	25	Pass
40C 120V	ac20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
50C 120V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 102V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 120V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 138V	ac20	5580	Ant1	5580	0	0	25	Pass
-20C 120V	ac20	5580	Ant1	5580	0	0	25	Pass
-10C 120V	ac20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
0C 120V	ac20	5580	Ant1	5580	0	0	25	Pass
10C 120V	ac20	5580	Ant1	5580	0	0	25	Pass
30C 120V	ac20	5580	Ant1	5580.02	20000	3.58	25	Pass
40C 120V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
50C 120V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 102V	ac20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 120V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 138V	ac20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
-20C 120V	ac20	5700	Ant1	5700	0	0	25	Pass
-10C 120V	ac20	5700	Ant1	5700	0	0	25	Pass


0C 120V	ac20	5700	Ant1	5699.96	-40000	-7.02	25	Pass
10C 120V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
30C 120V	ac20	5700	Ant1	5700	0	0	25	Pass
40C 120V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
50C 120V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 102V	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 120V	ac20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 138V	ac20	5500	Ant2	5500	0	0	25	Pass
-20C 120V	ac20	5500	Ant2	5500	0	0	25	Pass
-10C 120V	ac20	5500	Ant2	5500	0	0	25	Pass
0C 120V	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
10C 120V	ac20	5500	Ant2	5500	0	0	25	Pass
30C 120V	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 120V	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
50C 120V	ac20	5500	Ant2	5500	0	0	25	Pass
20C 102V	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
20C 120V	ac20	5580	Ant2	5580.02	20000	3.58	25	Pass
20C 138V	ac20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
-20C 120V	ac20	5580	Ant2	5580	0	0	25	Pass
-10C 120V	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
0C 120V	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
10C 120V	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
30C 120V	ac20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
40C 120V	ac20	5580	Ant2	5580	0	0	25	Pass
50C 120V	ac20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
20C 102V	ac20	5700	Ant2	5699.94	-60000	-10.53	25	Pass
20C 120V	ac20	5700	Ant2	5699.94	-60000	-10.53	25	Pass
20C 138V	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
-20C 120V	ac20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
-10C 120V	ac20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
0C 120V	ac20	5700	Ant2	5699.92	-80000	-14.04	25	Pass
10C 120V	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
30C 120V	ac20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
40C 120V	ac20	5700	Ant2	5700	0	0	25	Pass
50C 120V	ac20	5700	Ant2	5699.96	-40000	-7.02	25	Pass
20C 102V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 120V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
20C 138V	ac40	5510	Ant1	5509.92	-80000	-14.52	25	Pass
-20C 120V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
-10C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
0C 120V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
10C 120V	ac40	5510	Ant1	5510	0	0	25	Pass

30C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
40C 120V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
50C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 102V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
20C 120V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
20C 138V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
-20C 120V	ac40	5550	Ant1	5550	0	0	25	Pass
-10C 120V	ac40	5550	Ant1	5550	0	0	25	Pass
0C 120V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
10C 120V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
30C 120V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
40C 120V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
50C 120V	ac40	5550	Ant1	5550	0	0	25	Pass
20C 102V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 138V	ac40	5670	Ant1	5670	0	0	25	Pass
-20C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
-10C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
0C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
10C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
30C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
40C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
50C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 102V	ac40	5510	Ant2	5510	0	0	25	Pass
20C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
20C 138V	ac40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
-20C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
-10C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
0C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
10C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
30C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
40C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
50C 120V	ac40	5510	Ant2	5510	0	0	25	Pass
20C 102V	ac40	5550	Ant2	5549.92	-80000	-14.41	25	Pass
20C 120V	ac40	5550	Ant2	5550	0	0	25	Pass
20C 138V	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
-20C 120V	ac40	5550	Ant2	5550	0	0	25	Pass
-10C 120V	ac40	5550	Ant2	5550	0	0	25	Pass
0C 120V	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
10C 120V	ac40	5550	Ant2	5550	0	0	25	Pass
30C 120V	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
40C 120V	ac40	5550	Ant2	5550	0	0	25	Pass


50C 120V	ac40	5550	Ant2	5550	0	0	25	Pass
20C 102V	ac40	5670	Ant2	5670	0	0	25	Pass
20C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
20C 138V	ac40	5670	Ant2	5670	0	0	25	Pass
-20C 120V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
-10C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
0C 120V	ac40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
10C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
30C 120V	ac40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
40C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
50C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
20C 102V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 138V	ac80	5530	Ant1	5530	0	0	25	Pass
-20C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
-10C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
0C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
10C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
30C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
40C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
50C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 102V	ac80	5530	Ant2	5530	0	0	25	Pass
20C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
20C 138V	ac80	5530	Ant2	5530	0	0	25	Pass
-20C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
-10C 120V	ac80	5530	Ant2	5530.16	160000	28.93	25	Pass
0C 120V	ac80	5530	Ant2	5529.92	-80000	-14.47	25	Pass
10C 120V	ac80	5530	Ant2	5529.92	-80000	-14.47	25	Pass
30C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
40C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
50C 120V	ac80	5530	Ant2	5530	0	0	25	Pass

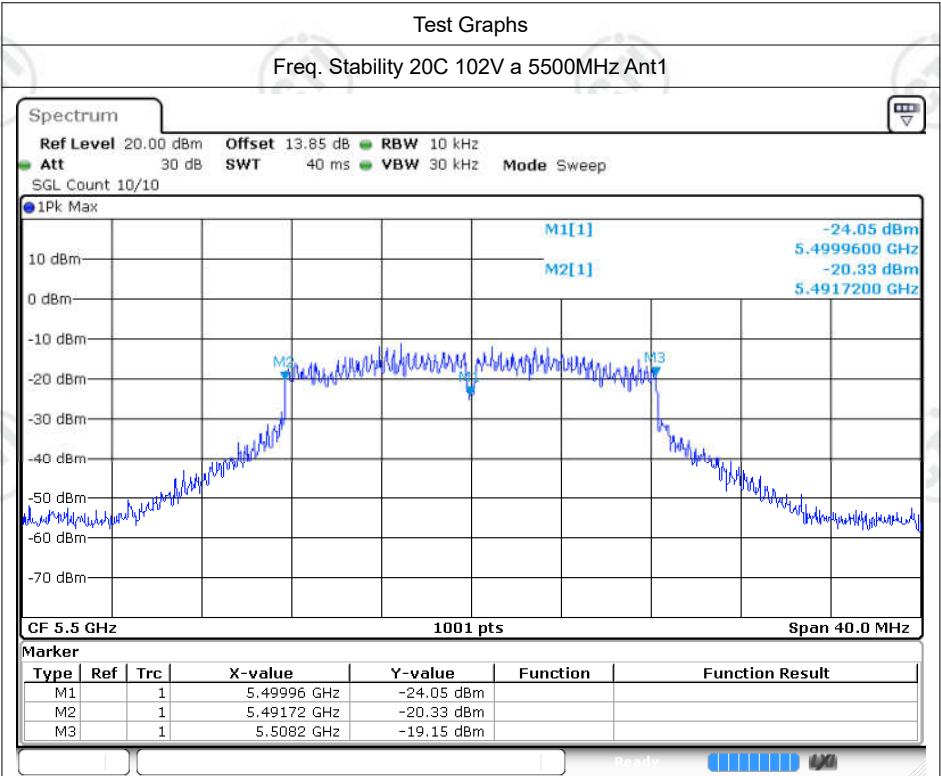


Date: 6 JAN.2025 08:23:56

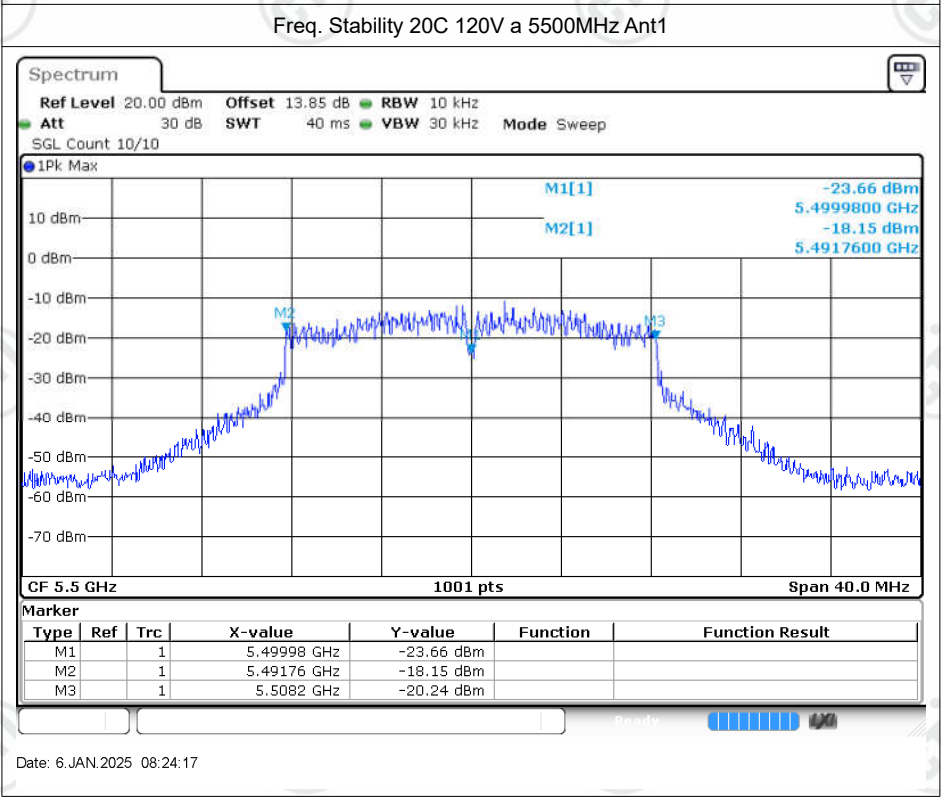


Date: 6 JAN.2025 08:24:17

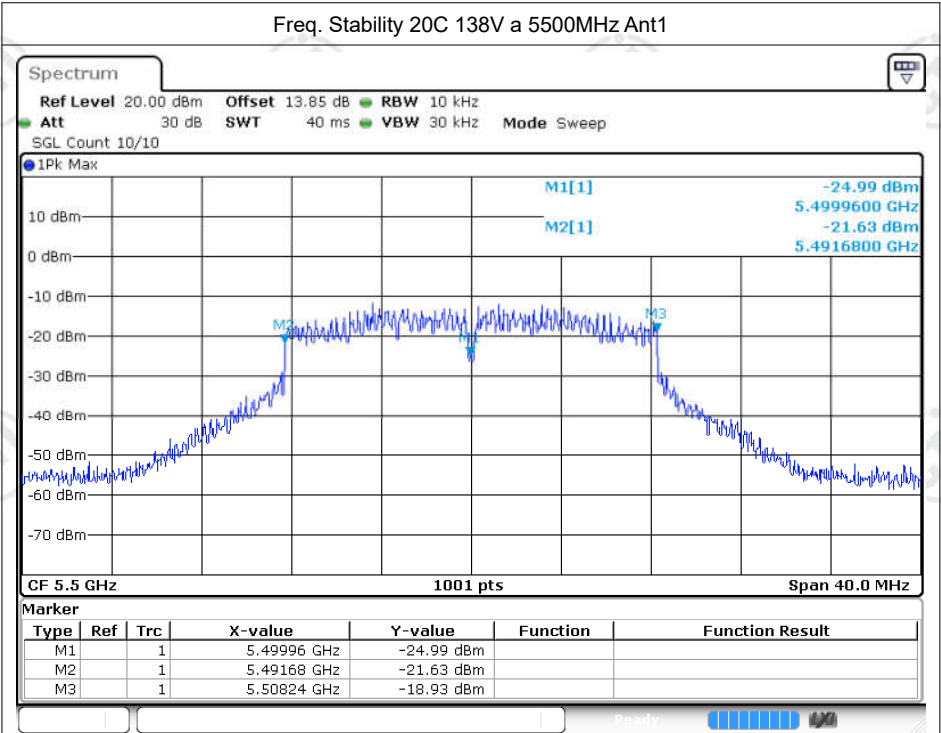


Date: 6 JAN.2025 08:24:02

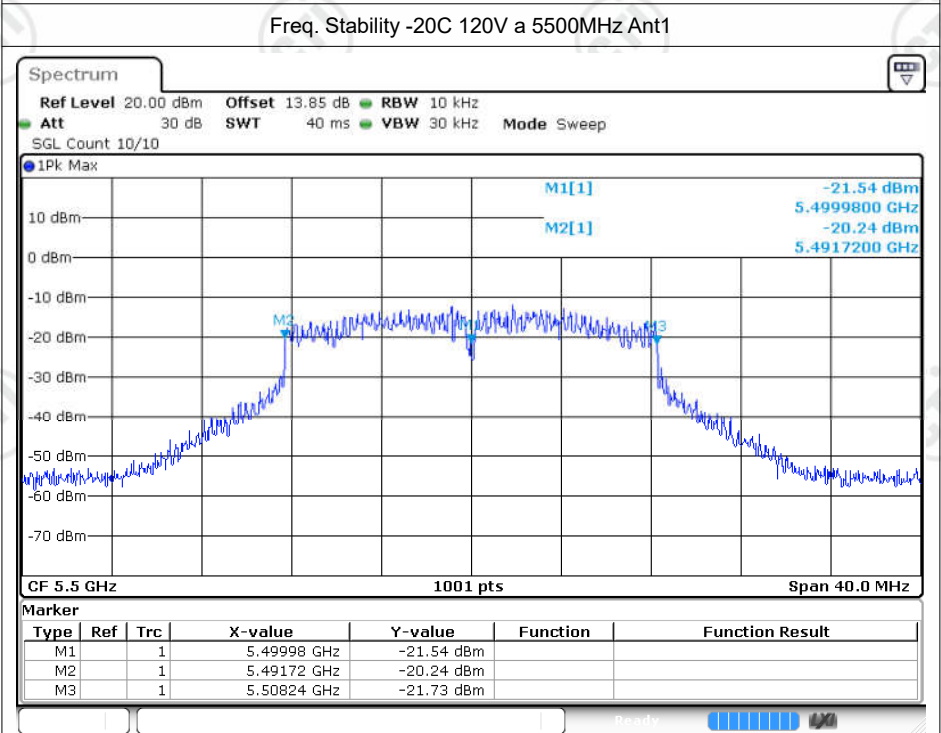


Date: 6 JAN.2025 08:24:05

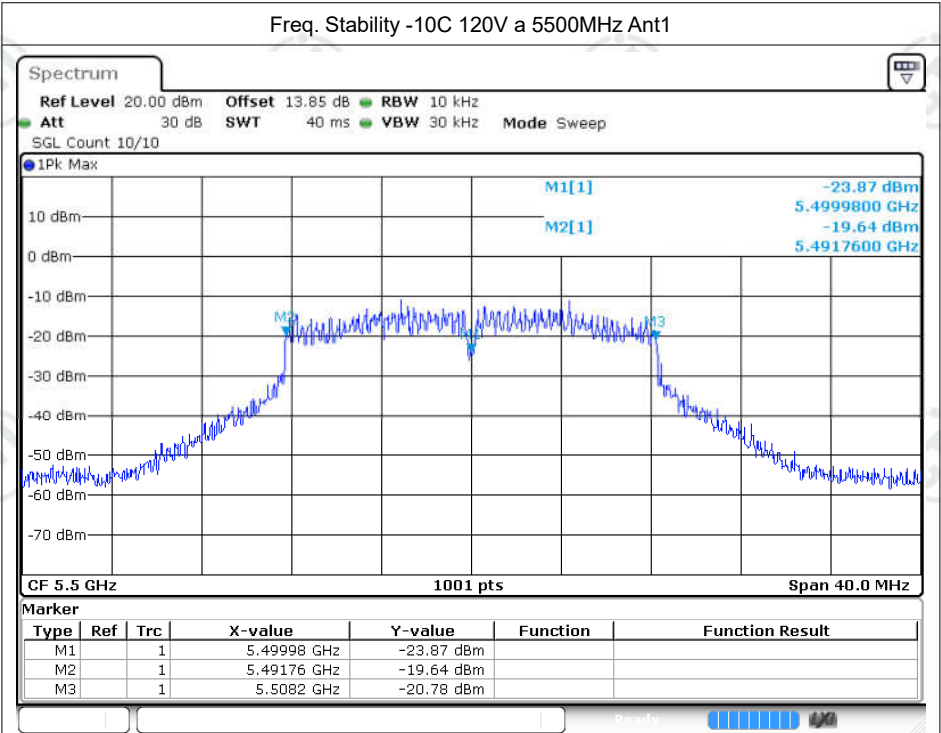


Date: 6 JAN.2025 08:24:08

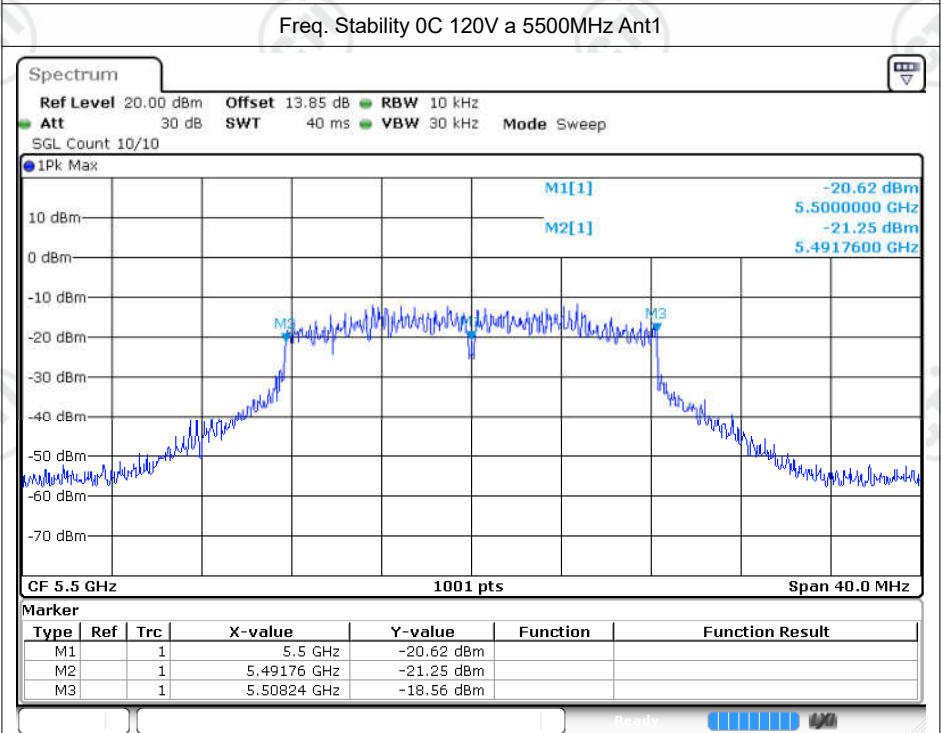


Date: 6 JAN.2025 08:24:11

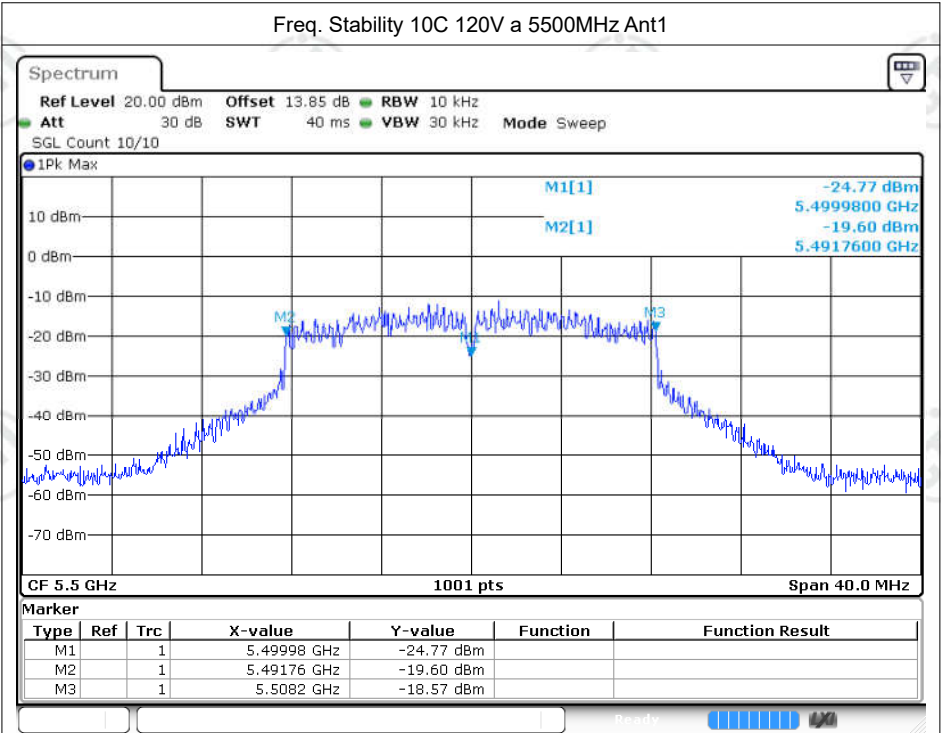


Date: 6 JAN.2025 08:24:14

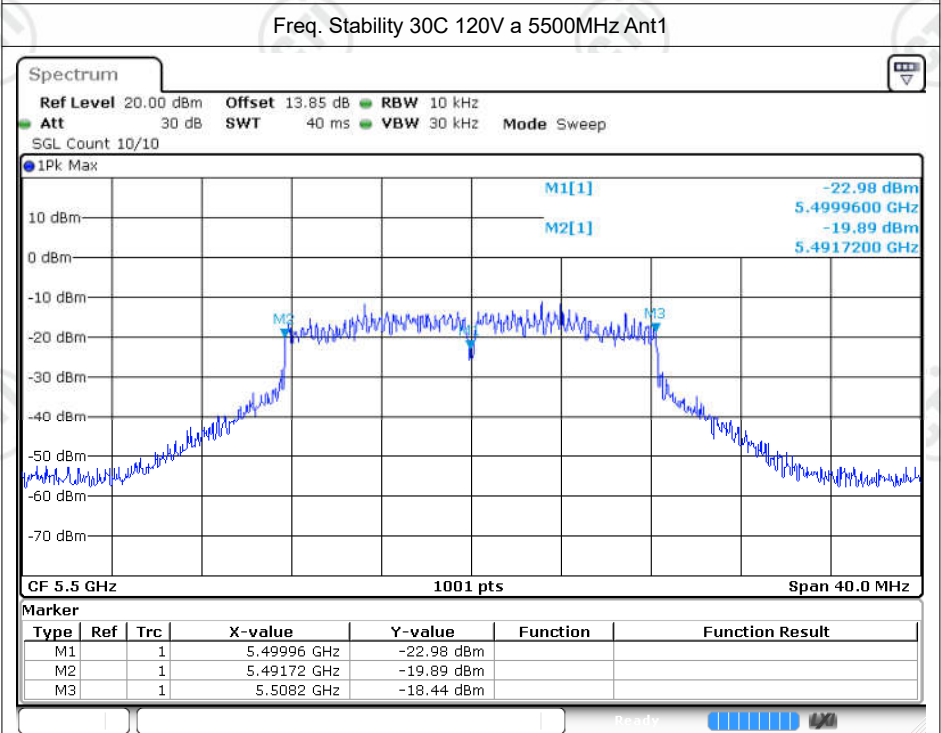


Date: 6 JAN.2025 08:24:20

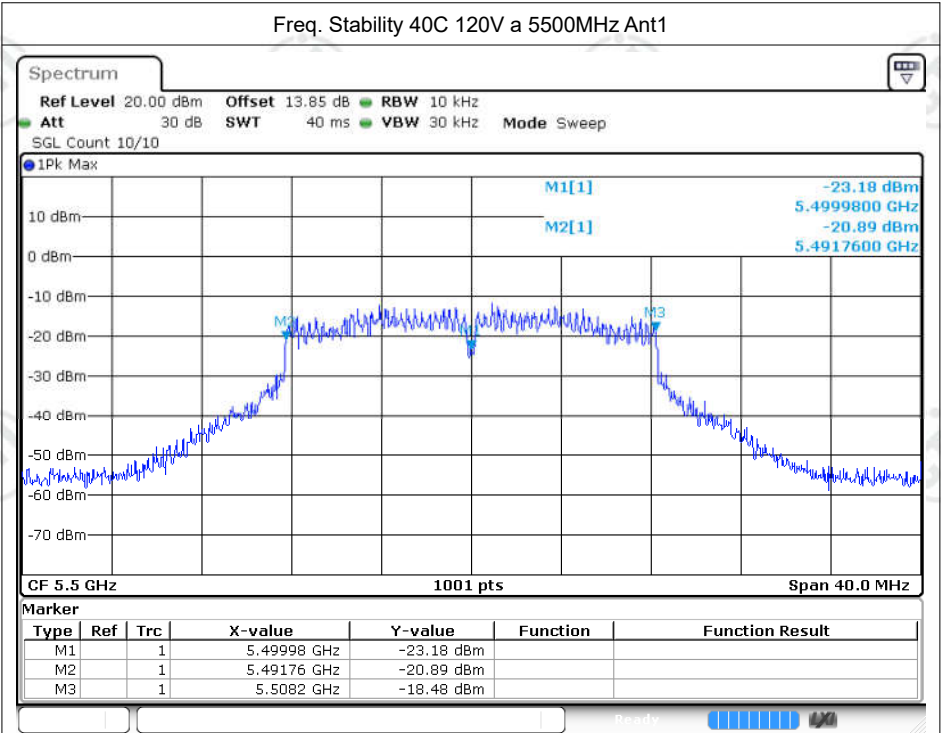


Date: 6 JAN 2025 08:24:23

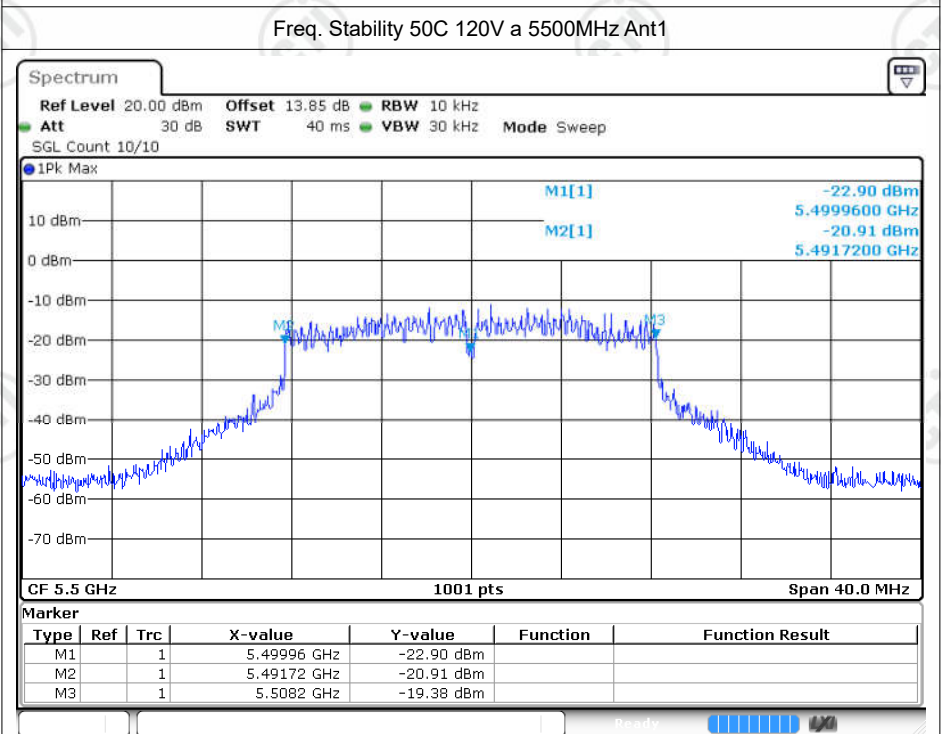



Date: 6 JAN 2025 08:24:26

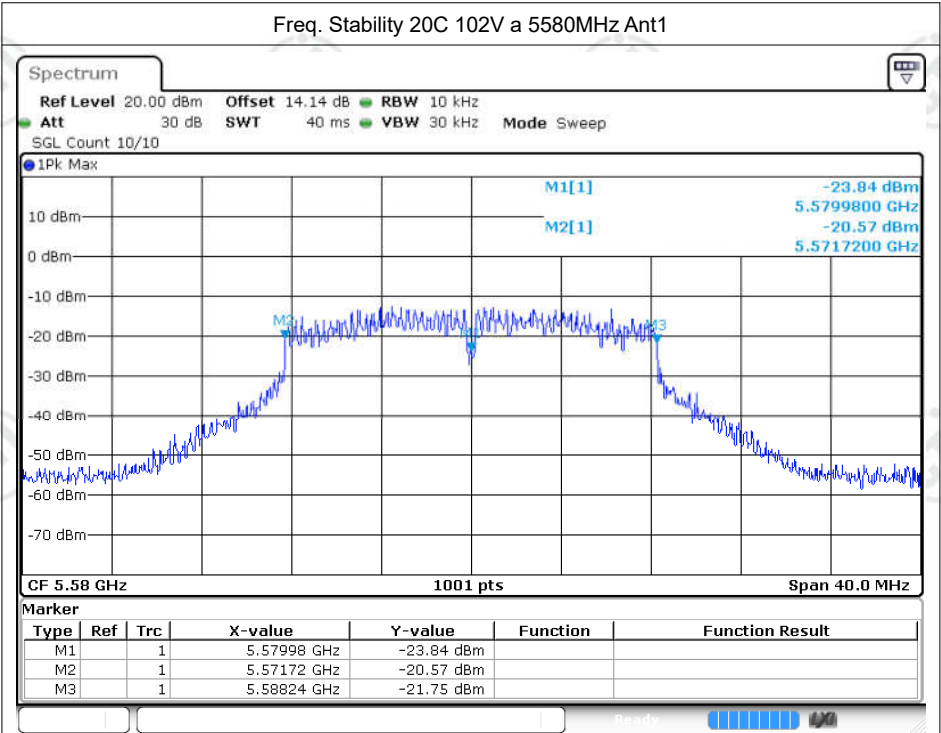


Date: 6 JAN.2025 08:25:15

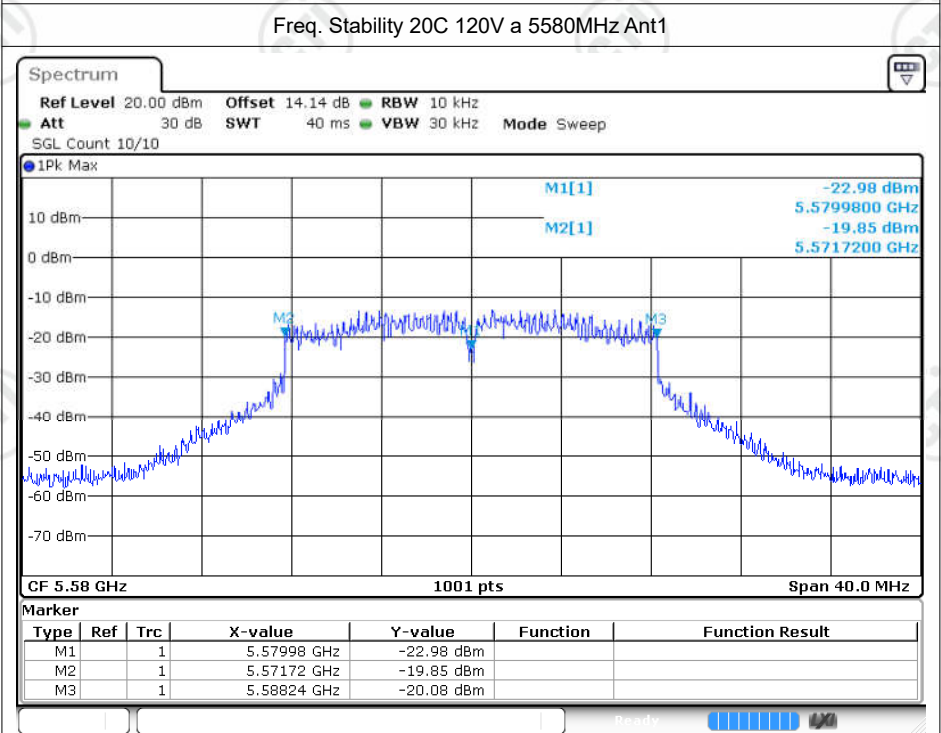


Date: 6 JAN.2025 08:25:36

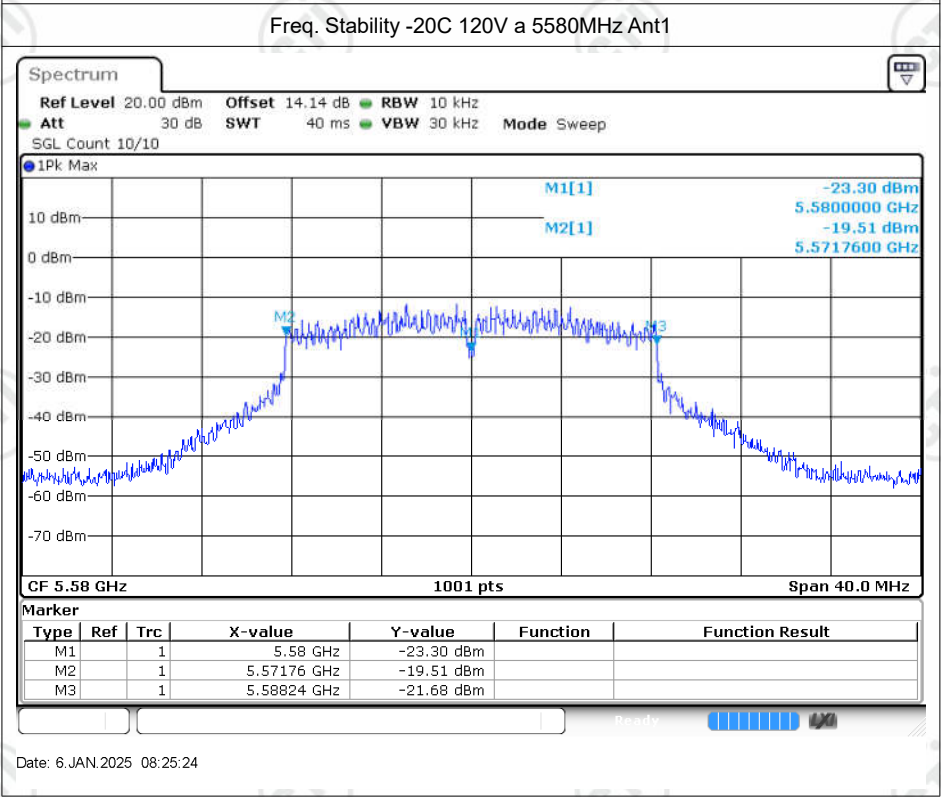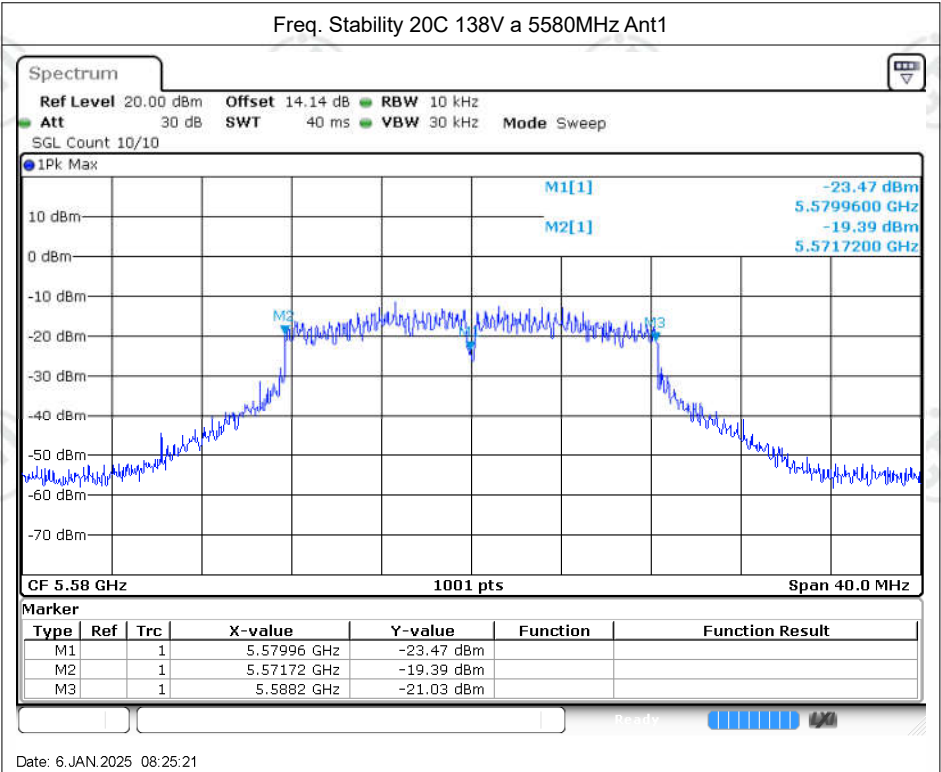


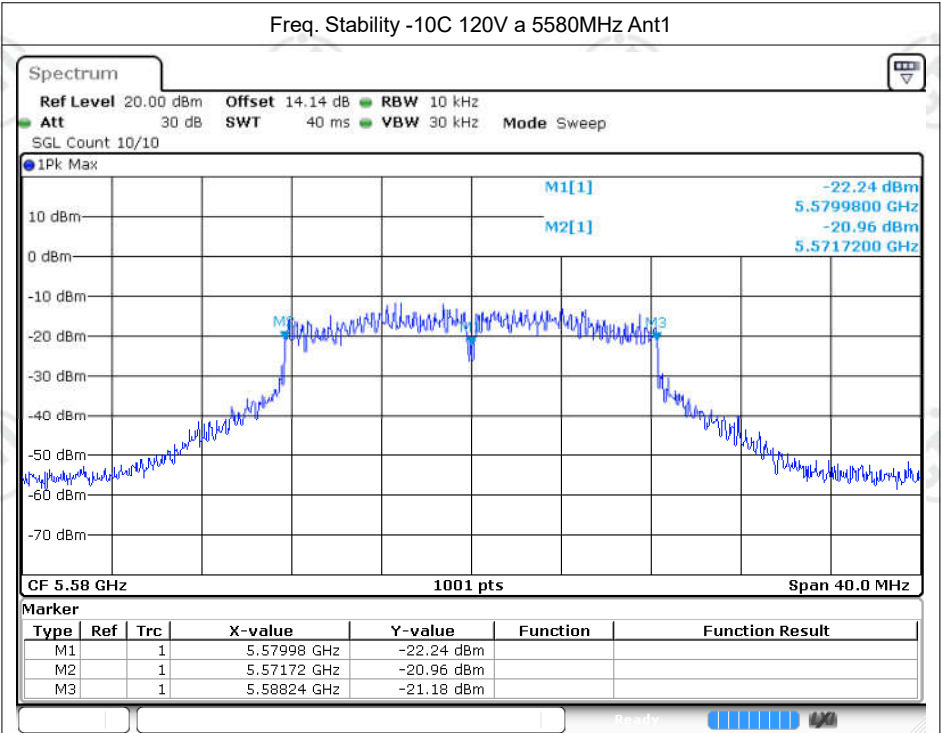


Date: 6 JAN.2025 08:25:27

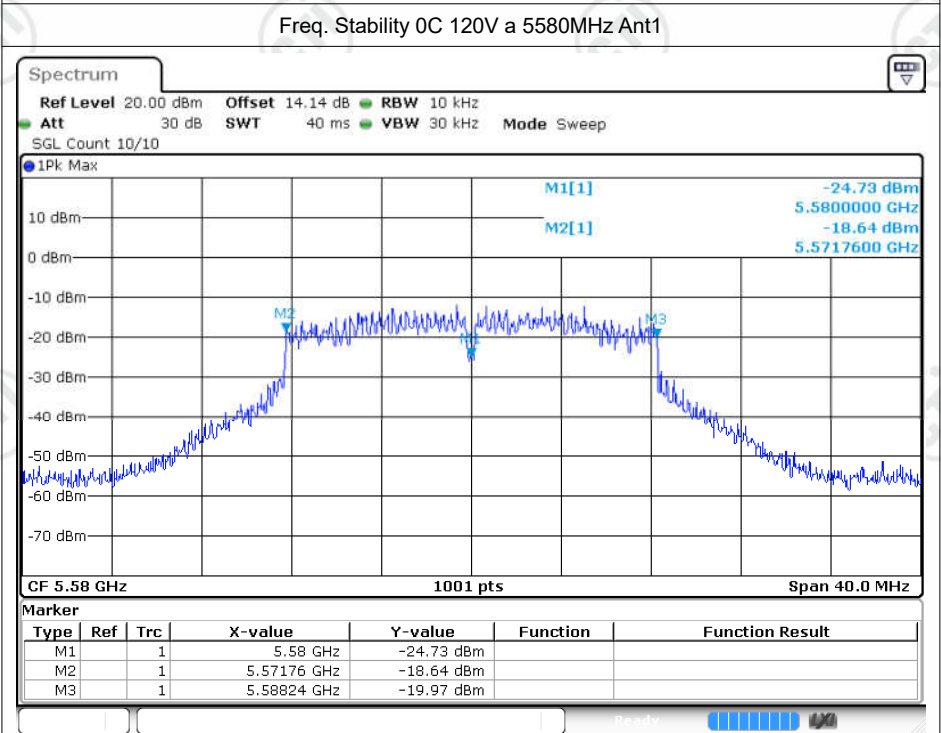


Date: 6 JAN.2025 08:25:30

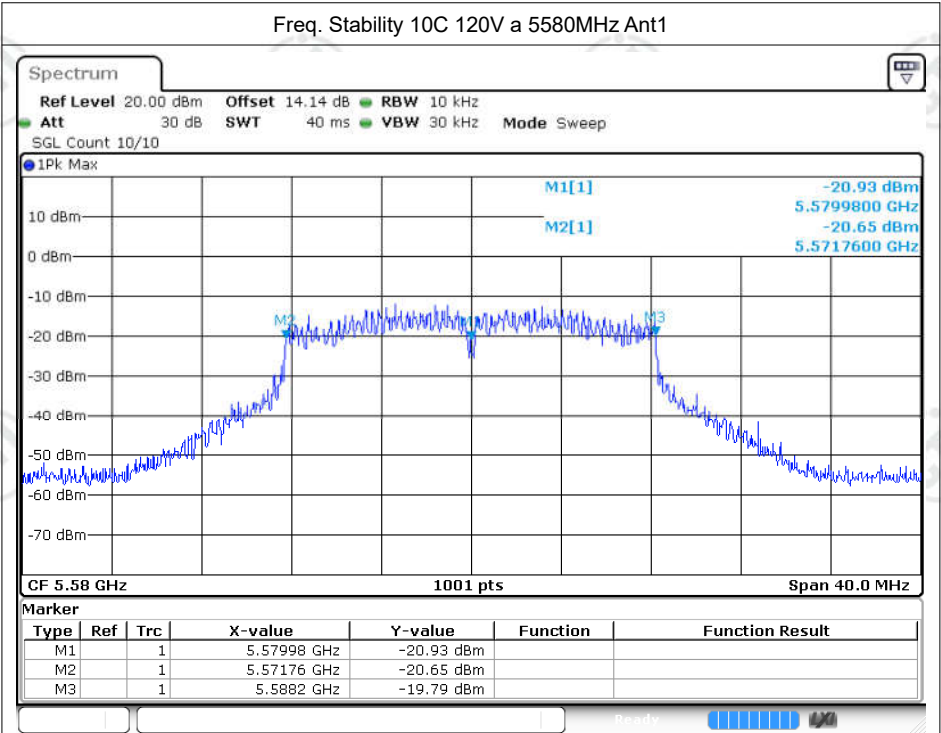


Date: 6 JAN.2025 08:25:33

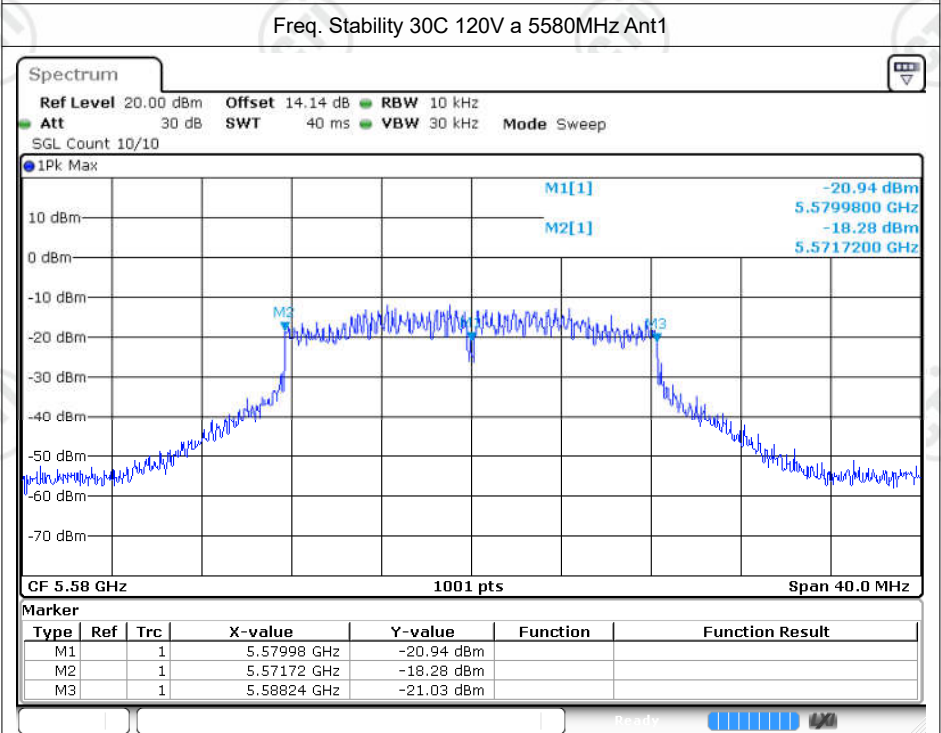


Date: 6 JAN.2025 08:25:39

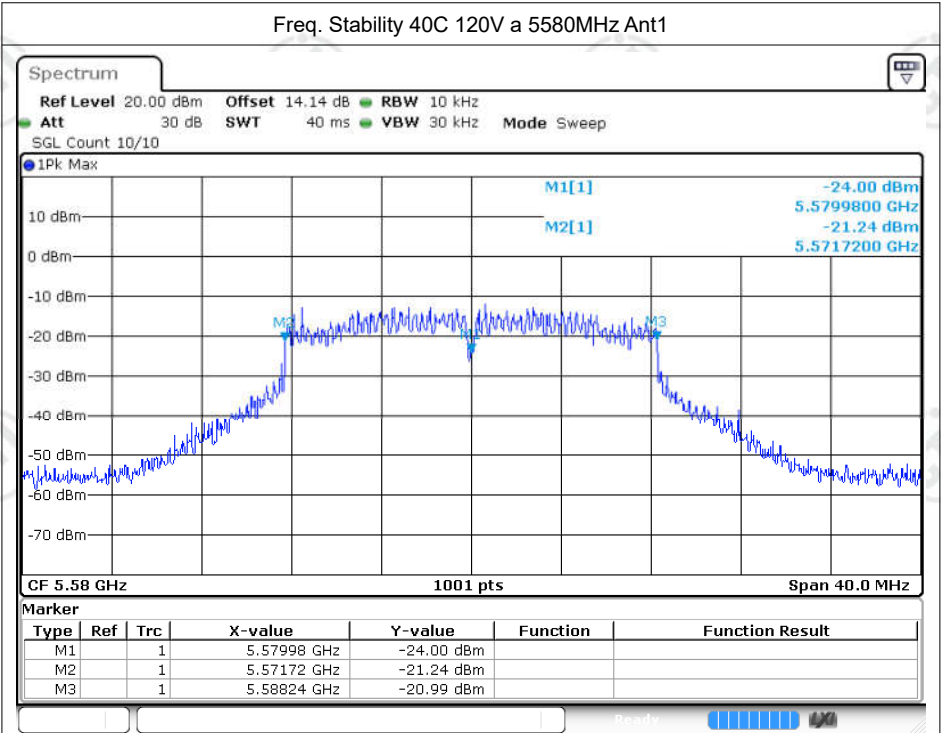


Date: 6 JAN.2025 08:25:42

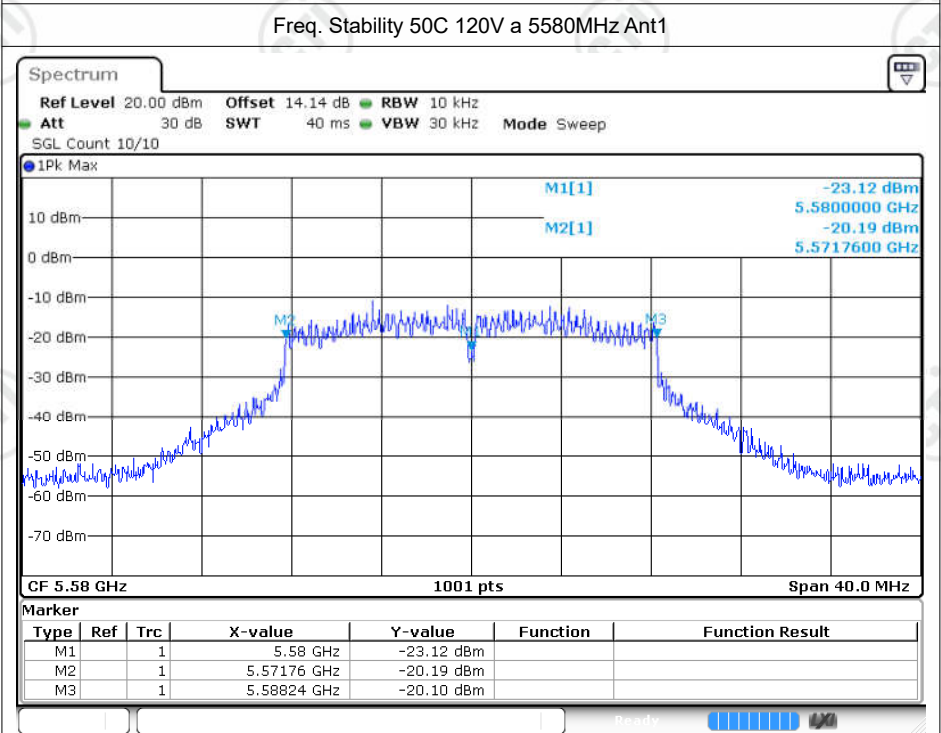



Date: 6 JAN.2025 08:25:45

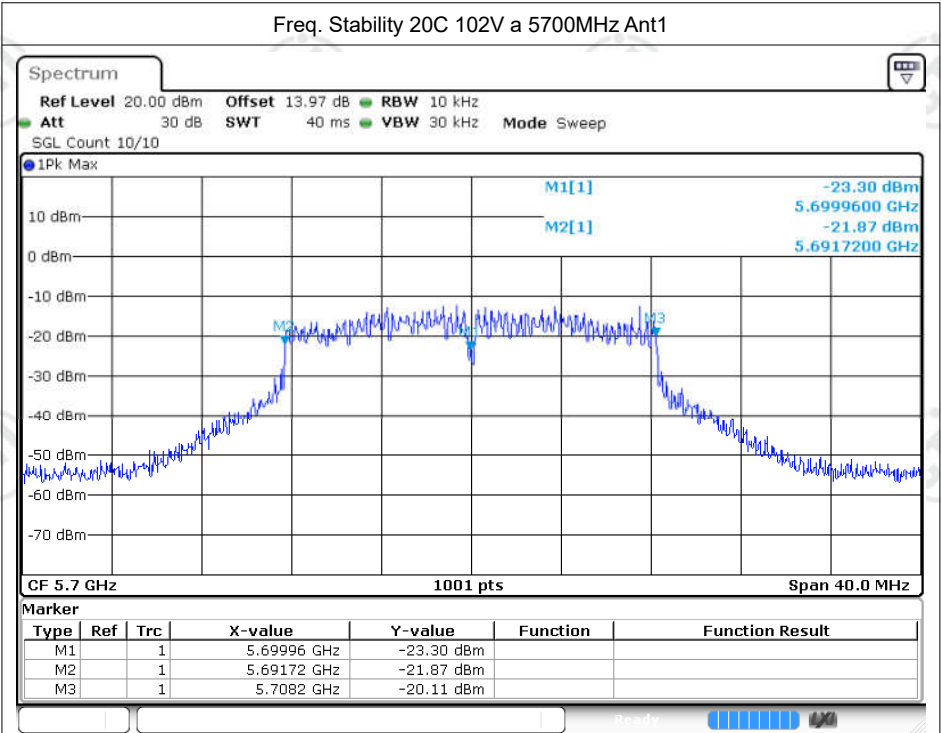


Date: 6 JAN.2025 08:27:58

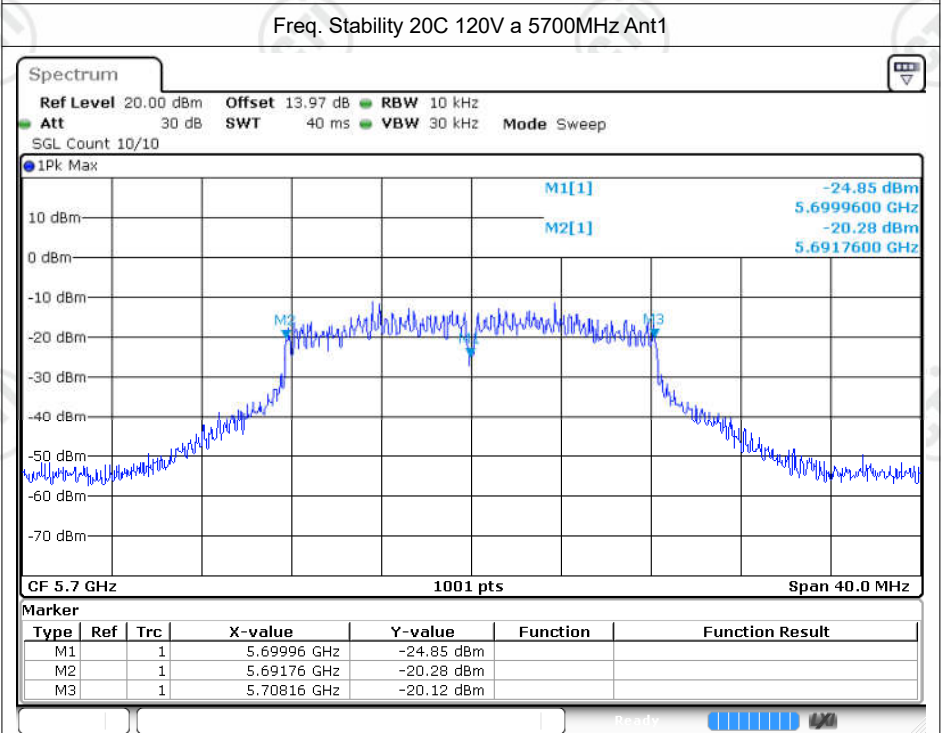


Date: 6 JAN.2025 08:28:19

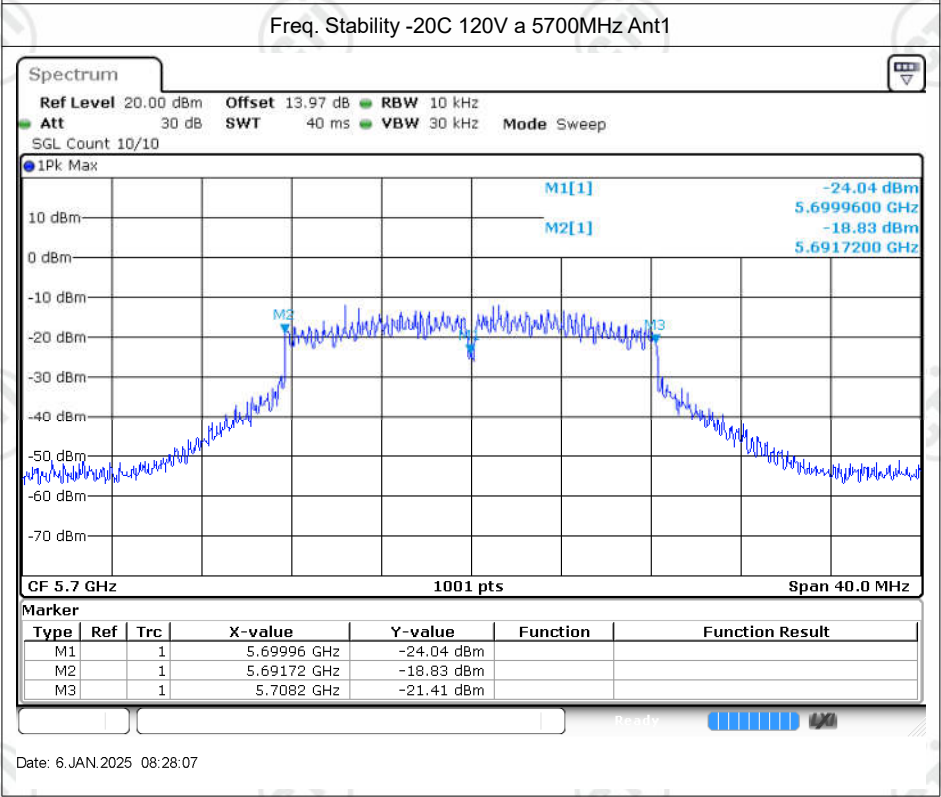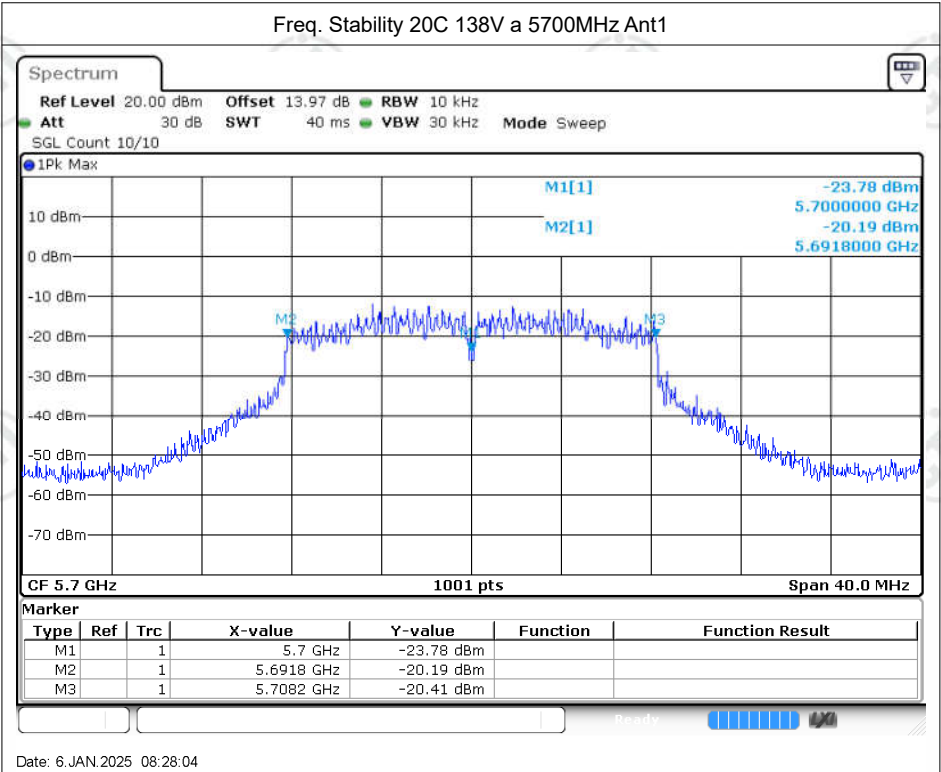


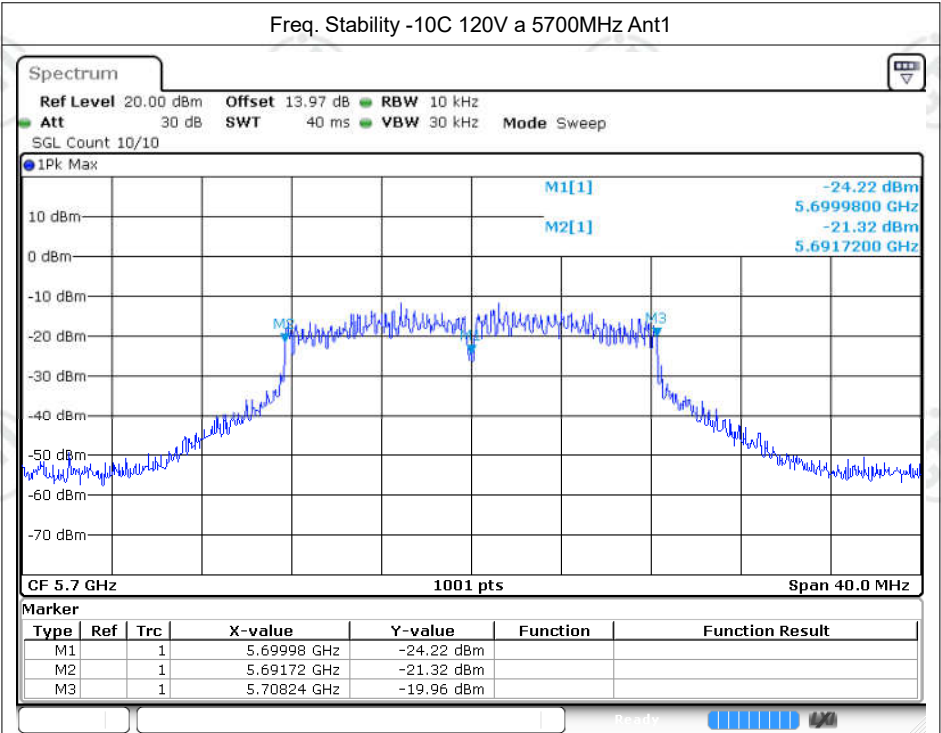


Date: 6 JAN.2025 08:28:10

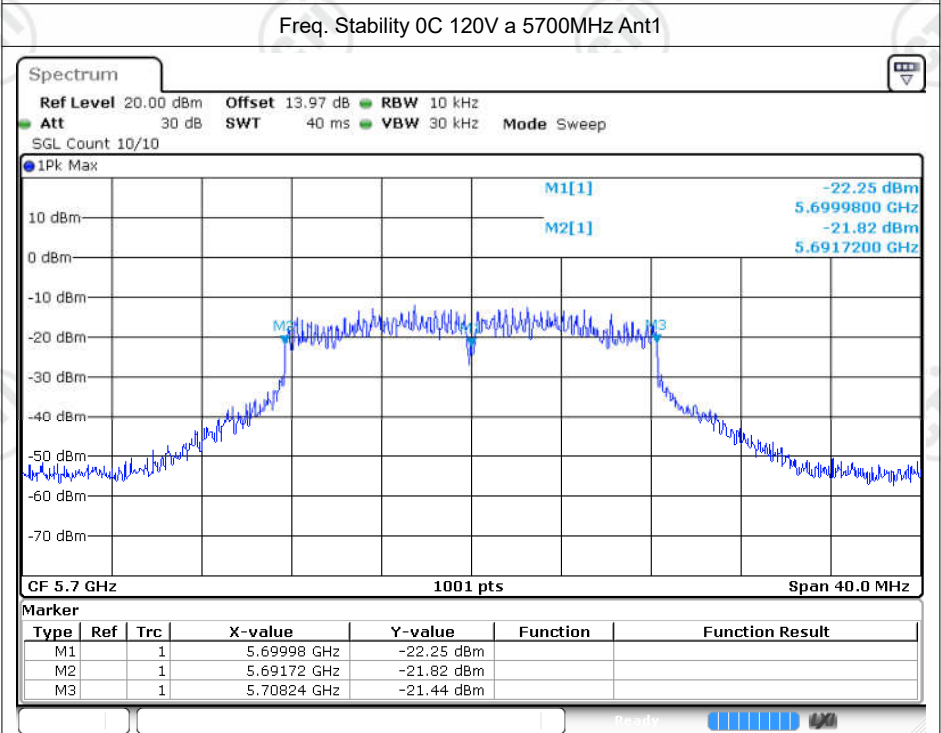


Date: 6 JAN.2025 08:28:13

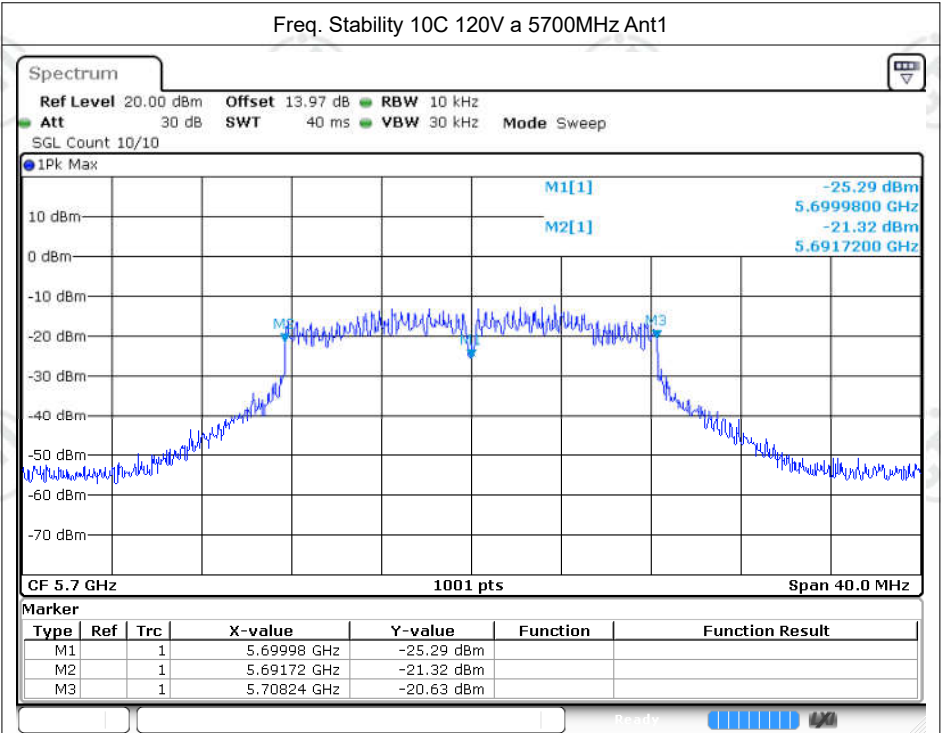


Date: 6 JAN.2025 08:28:16

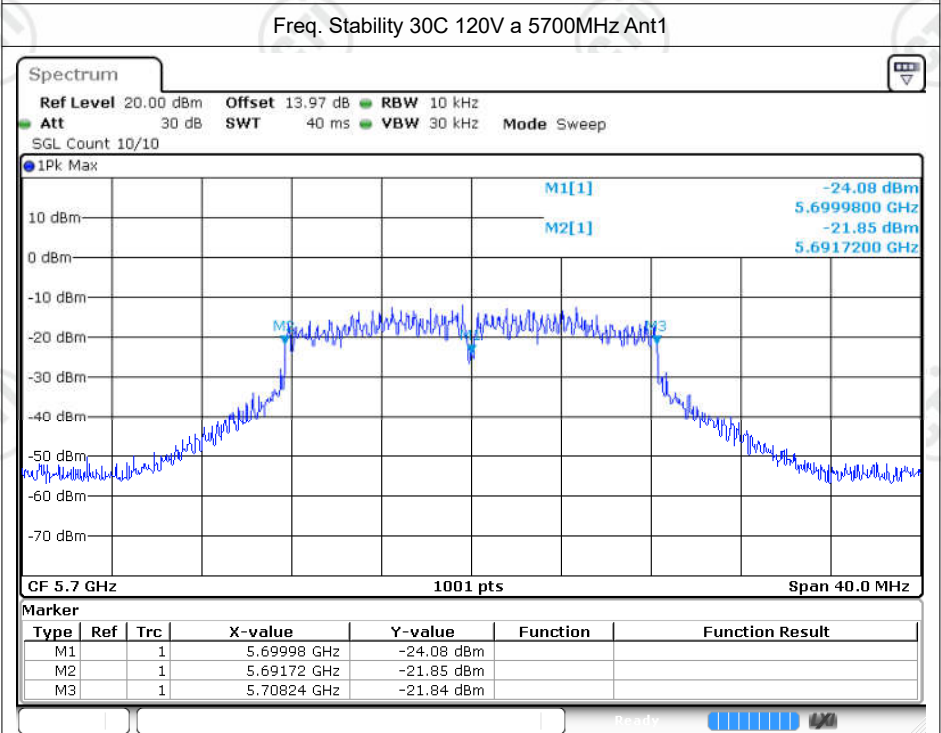


Date: 6 JAN.2025 08:28:23

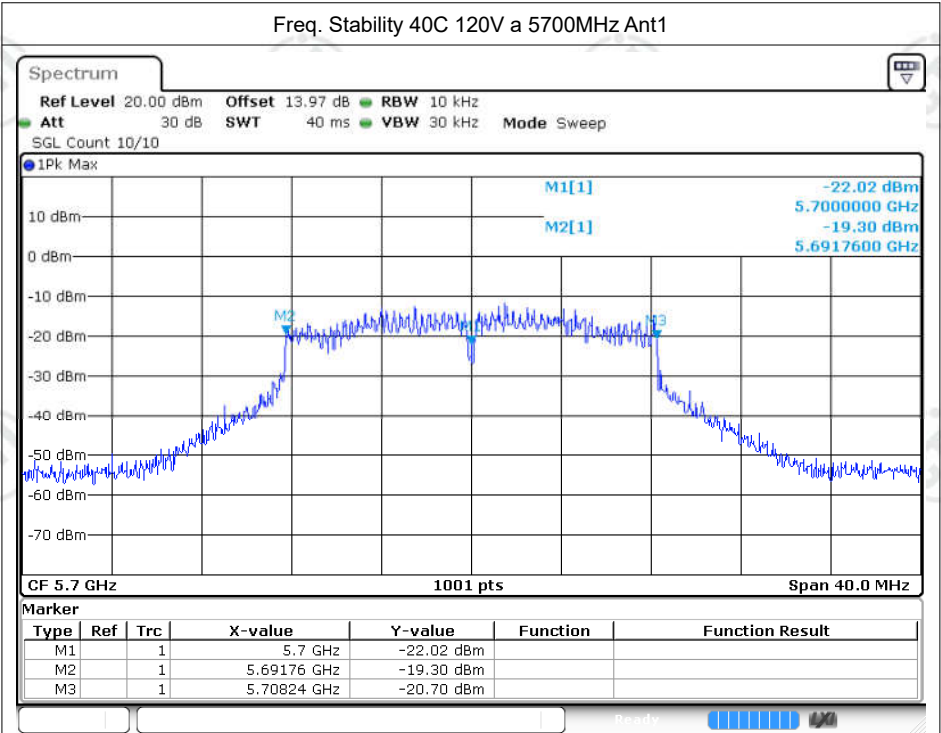


Date: 6 JAN.2025 08:28:26

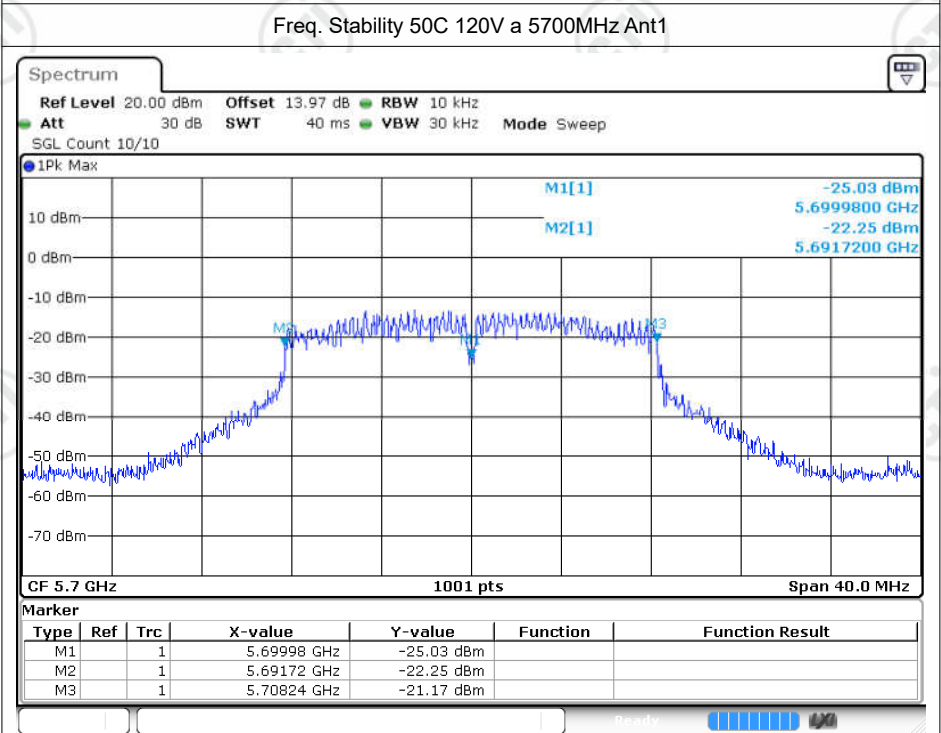


Date: 6 JAN.2025 08:28:29

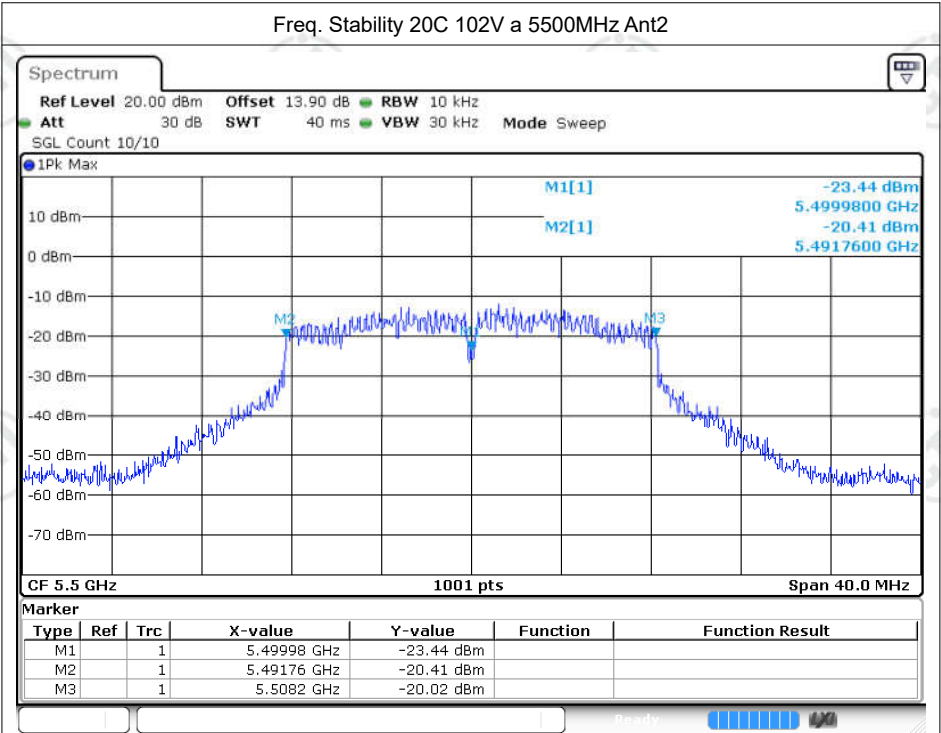


Date: 6 JAN.2025 09:09:19

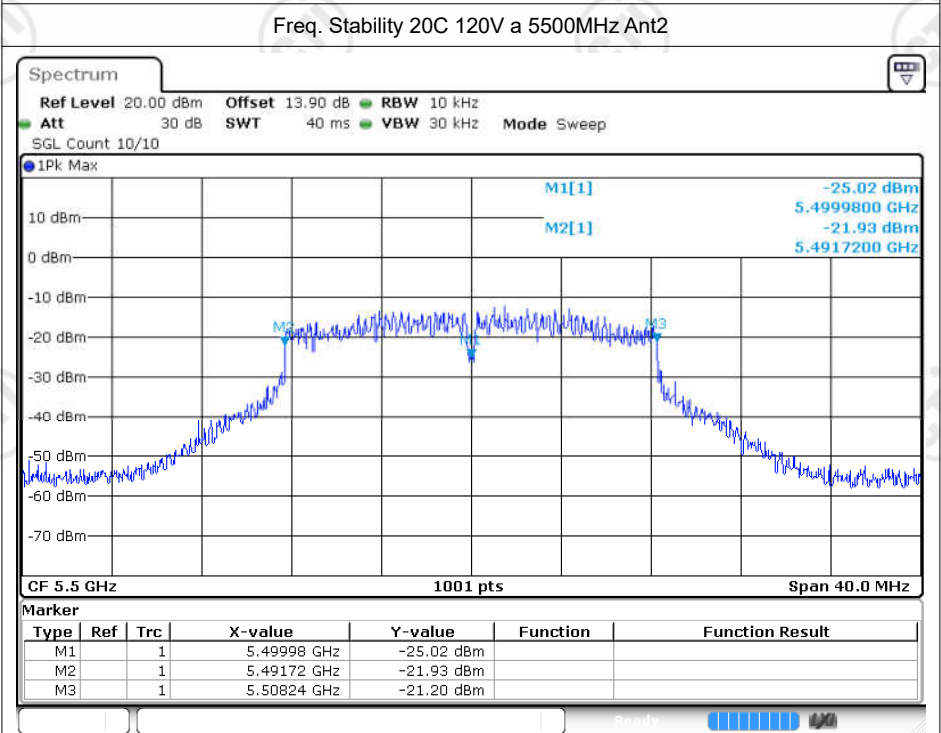


Date: 6 JAN.2025 09:09:41

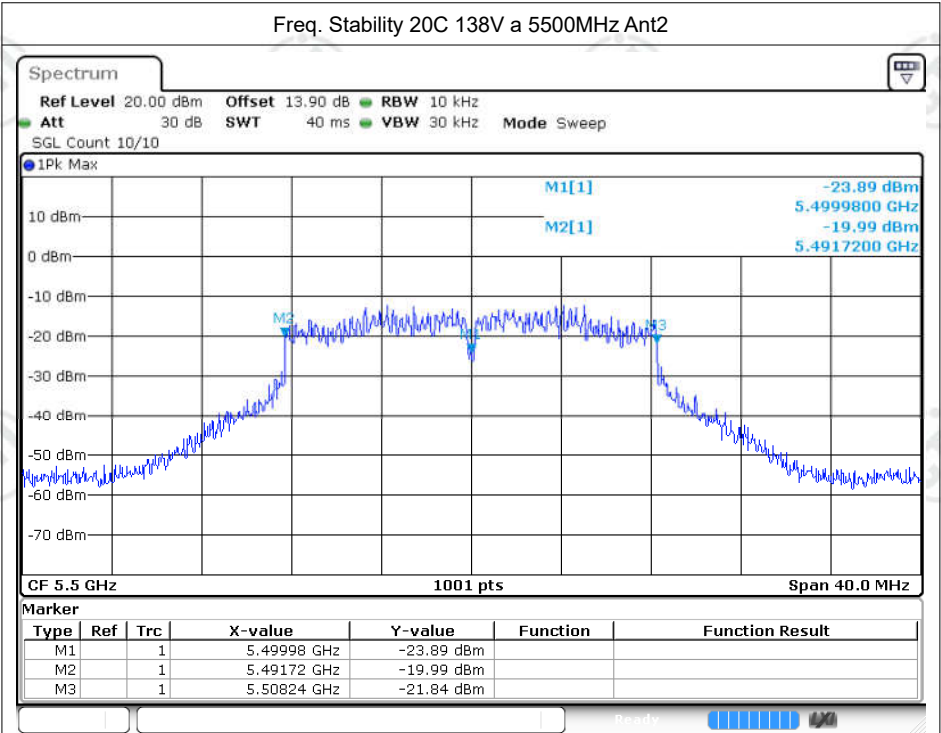


Date: 6 JAN.2025 09:09:26

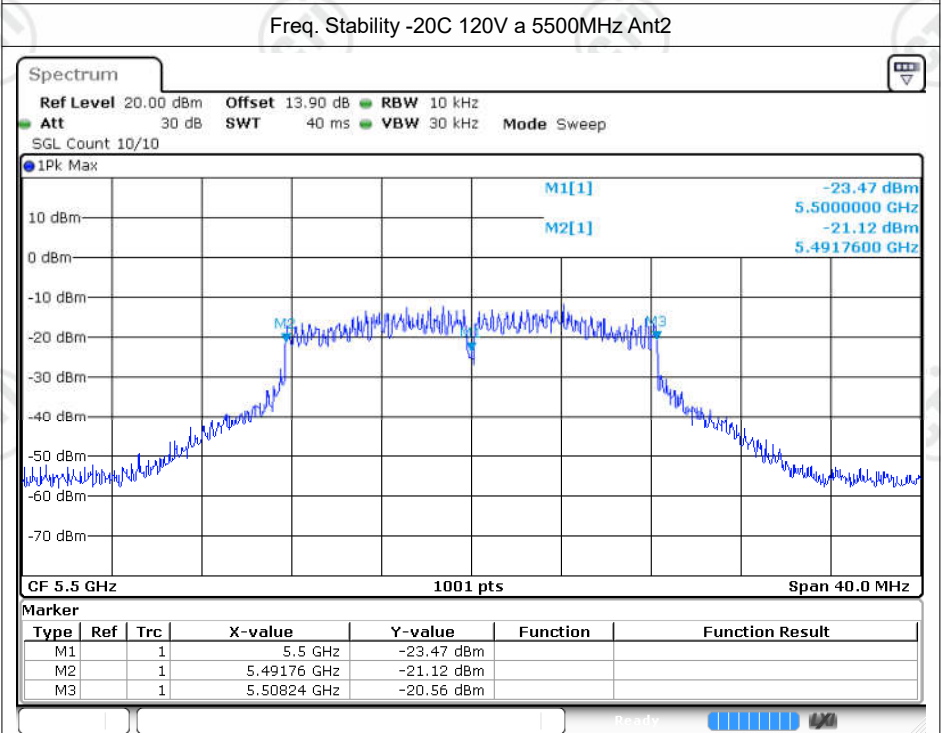


Date: 6 JAN.2025 09:09:29

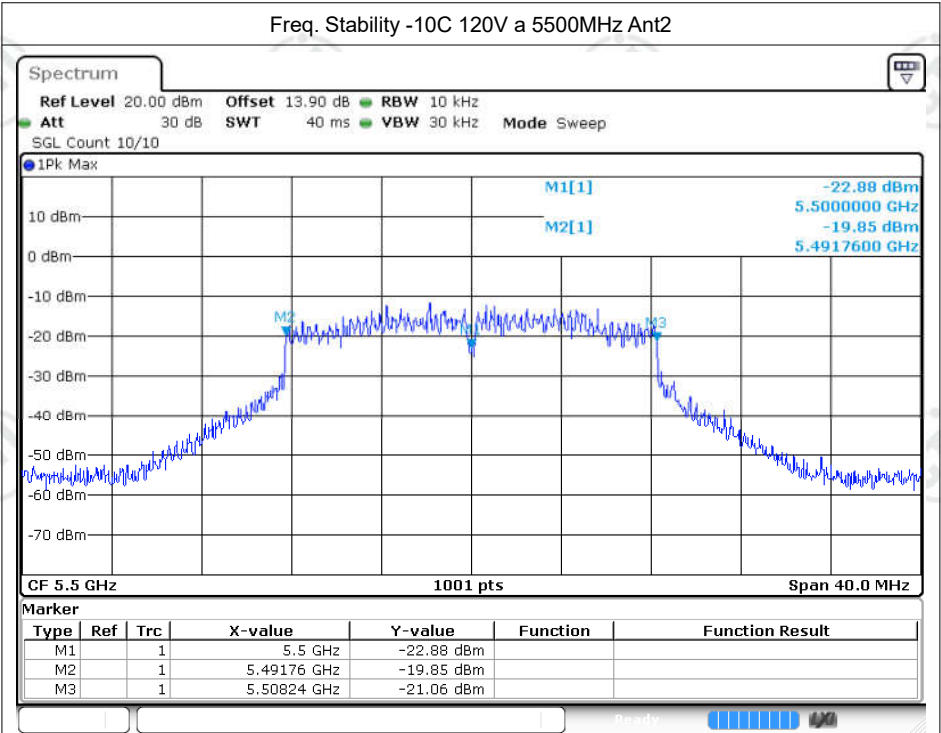


Date: 6 JAN 2025 09:09:32

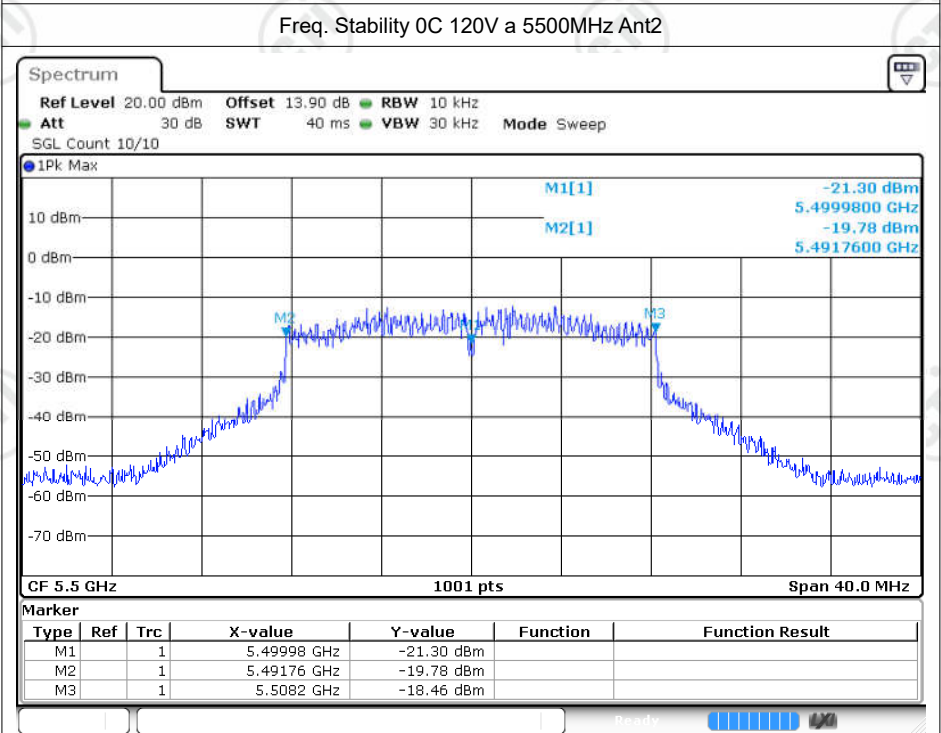


Date: 6 JAN 2025 09:09:35

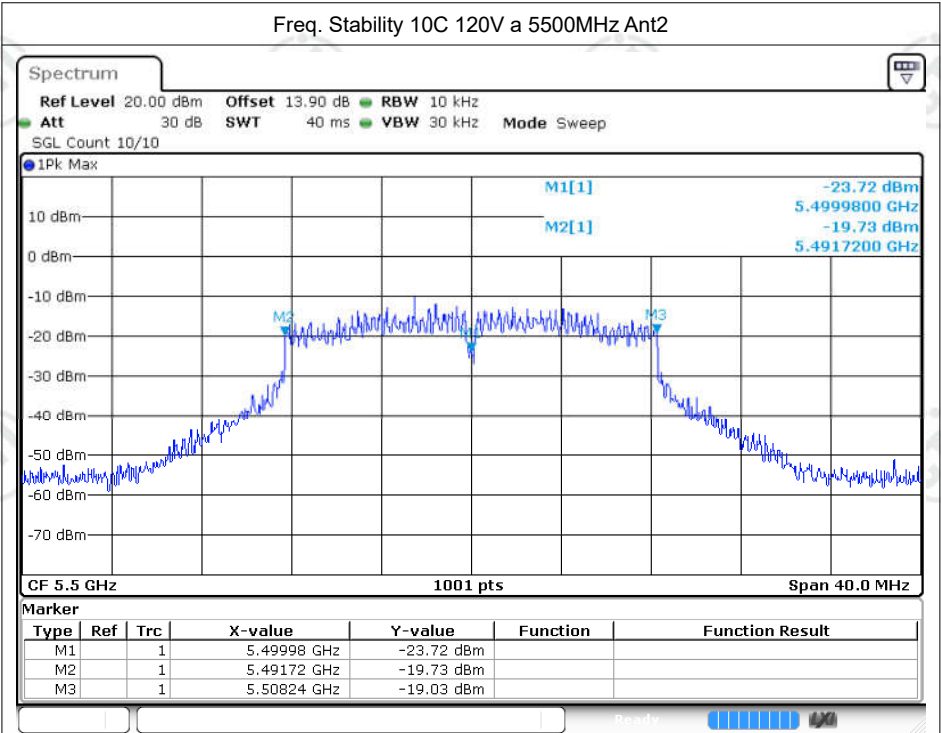


Date: 6 JAN.2025 09:09:38

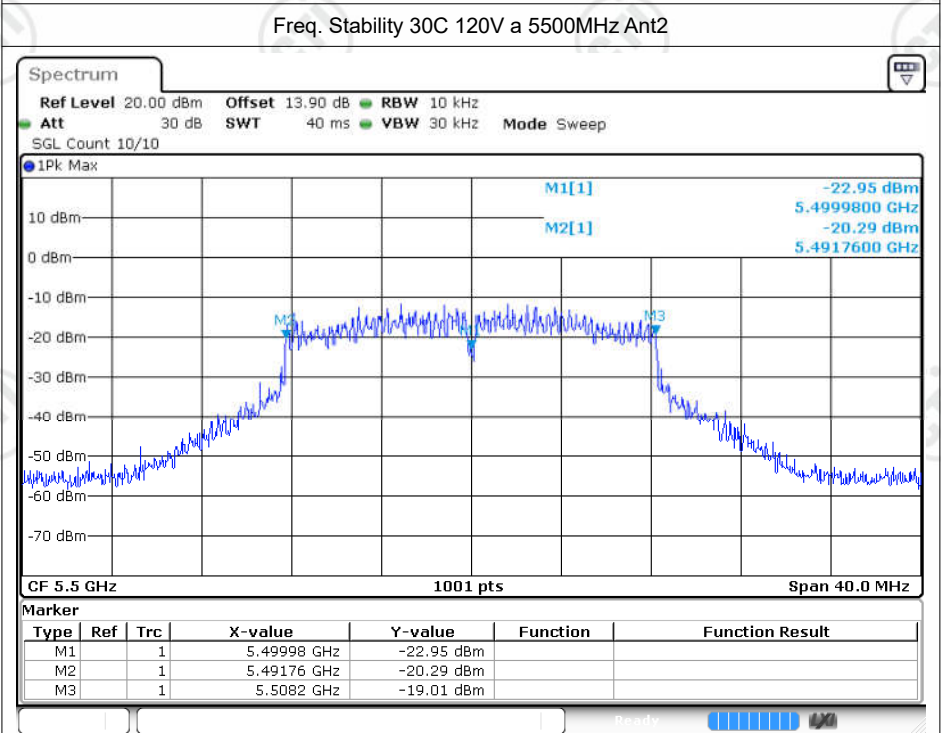


Date: 6 JAN.2025 09:09:44

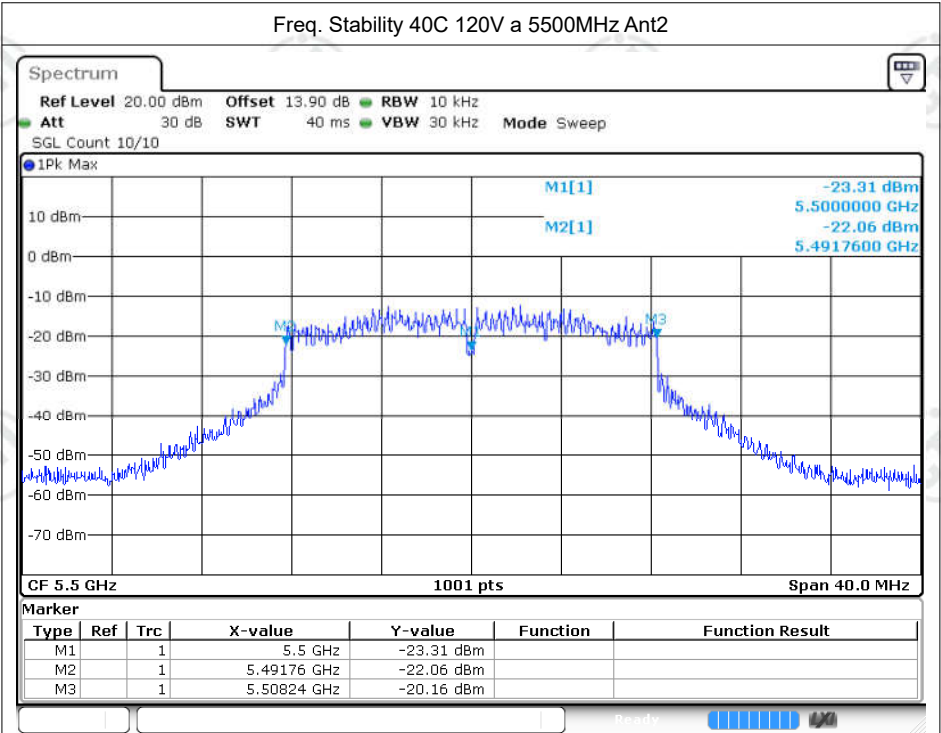


Date: 6 JAN.2025 09:09:47

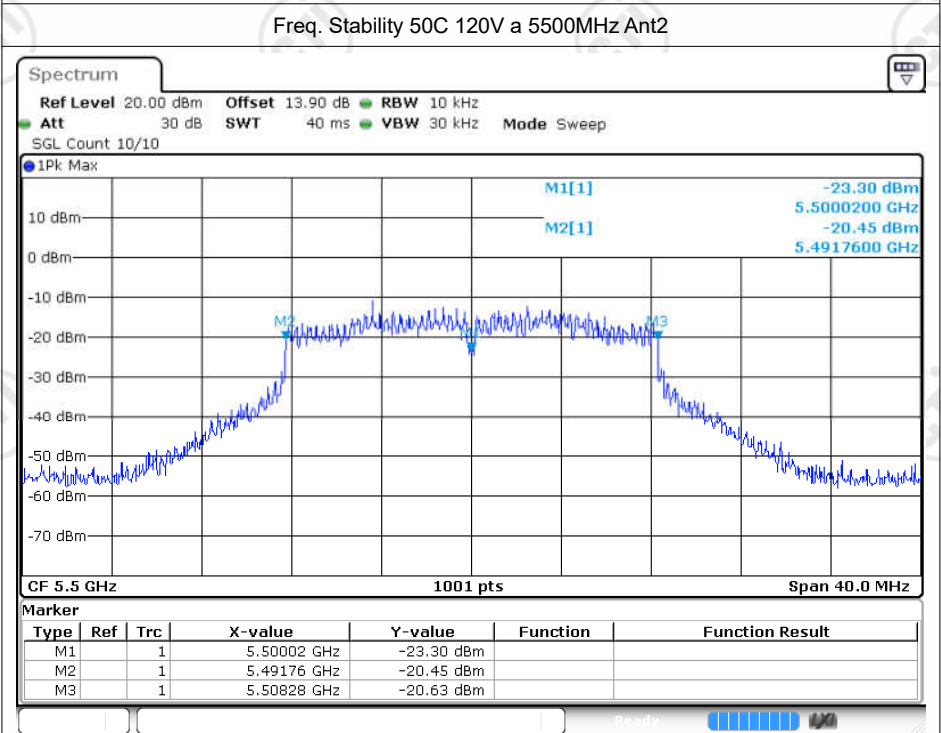


Date: 6 JAN.2025 09:09:50

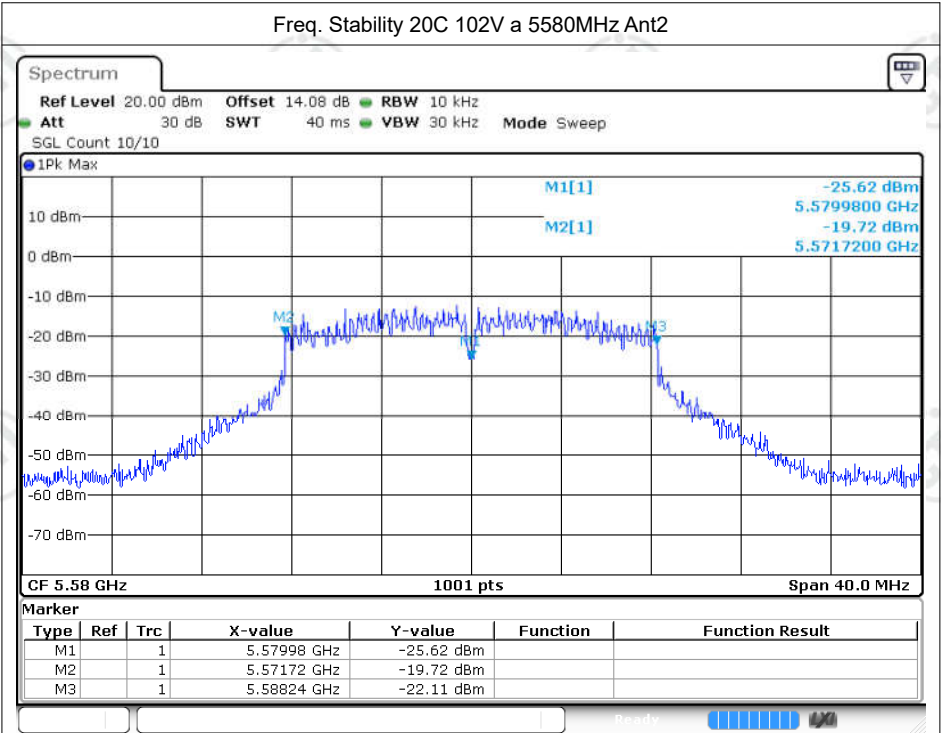


Date: 6 JAN 2025 09:10:48

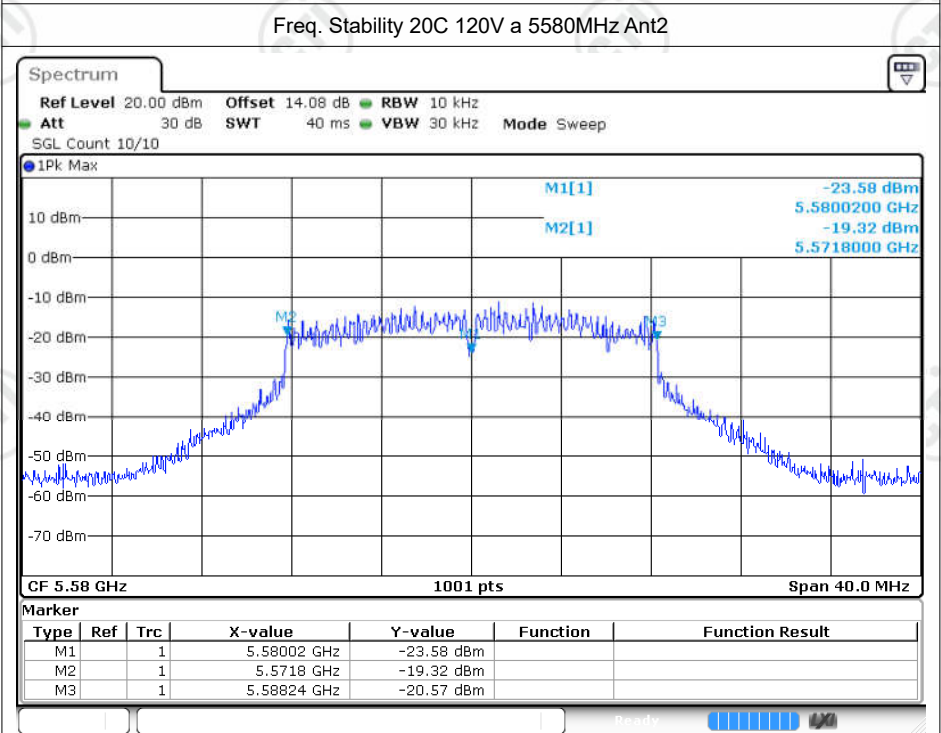


Date: 6 JAN 2025 09:11:09

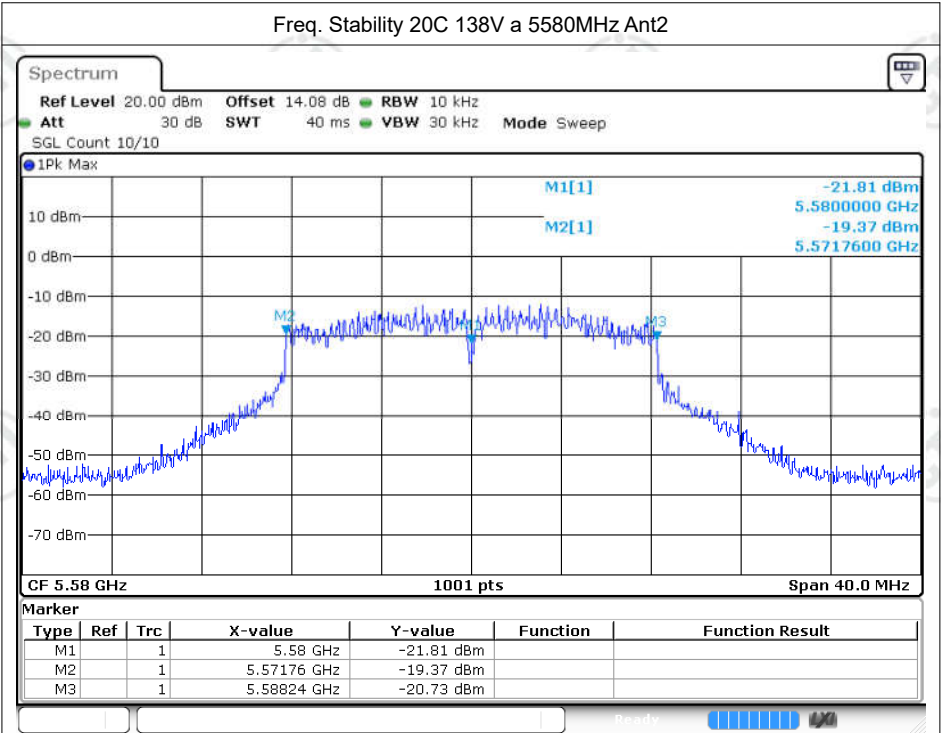


Date: 6 JAN.2025 09:10:54

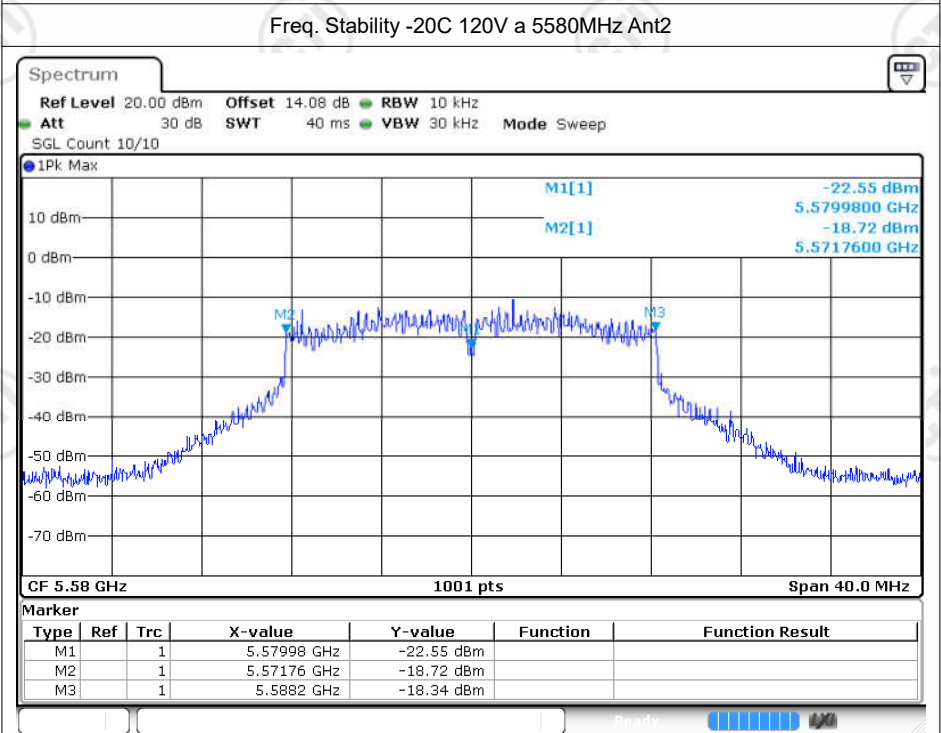


Date: 6 JAN.2025 09:10:57

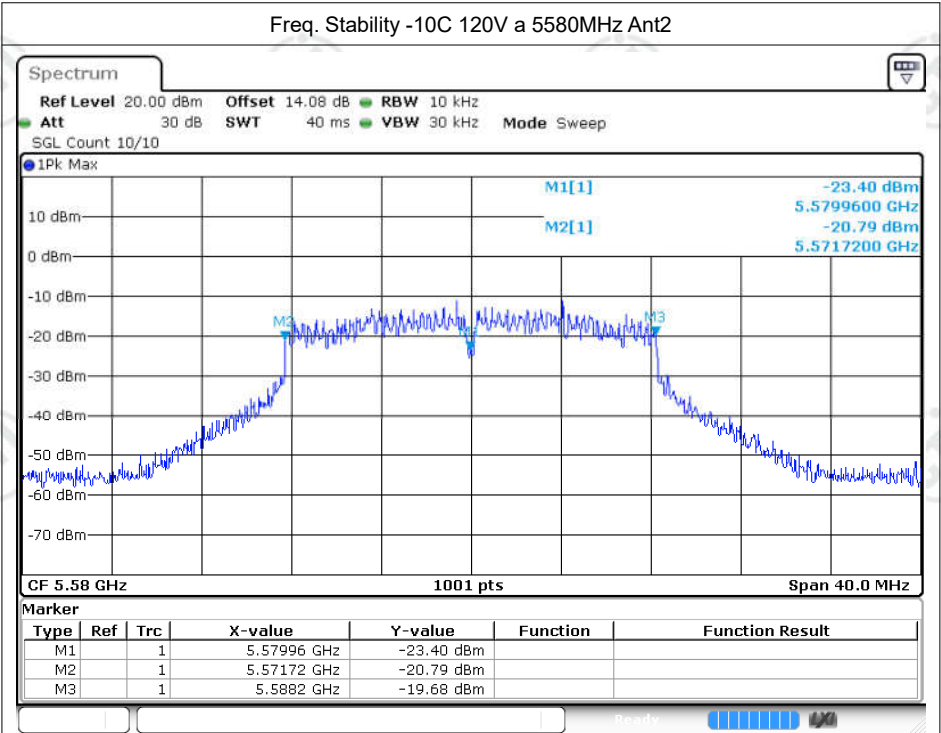


Date: 6 JAN 2025 09:11:00

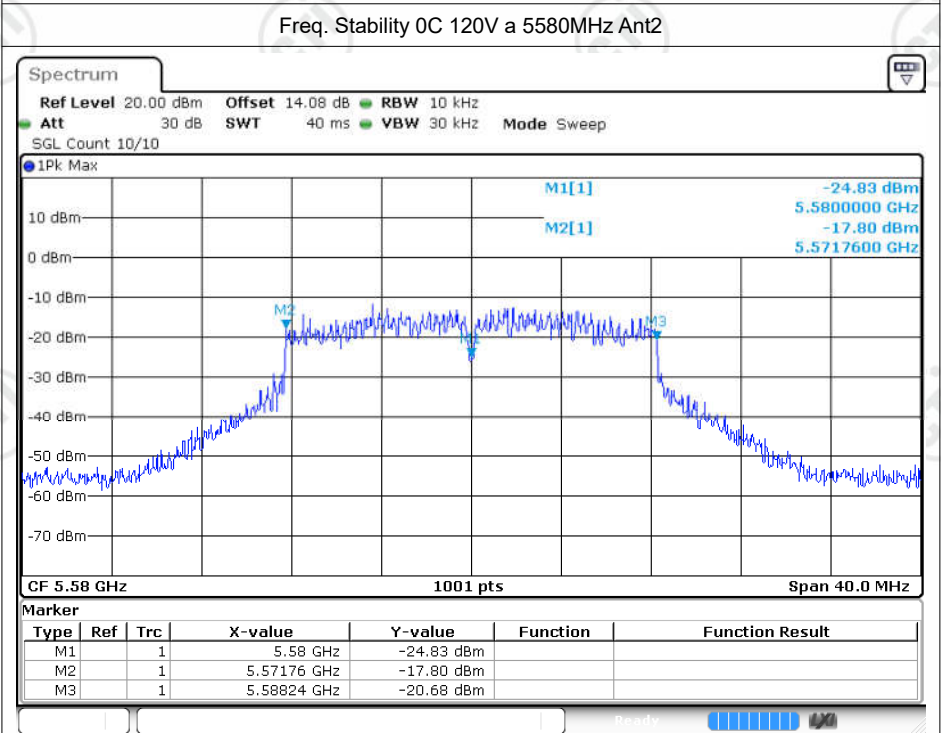


Date: 6 JAN 2025 09:11:03

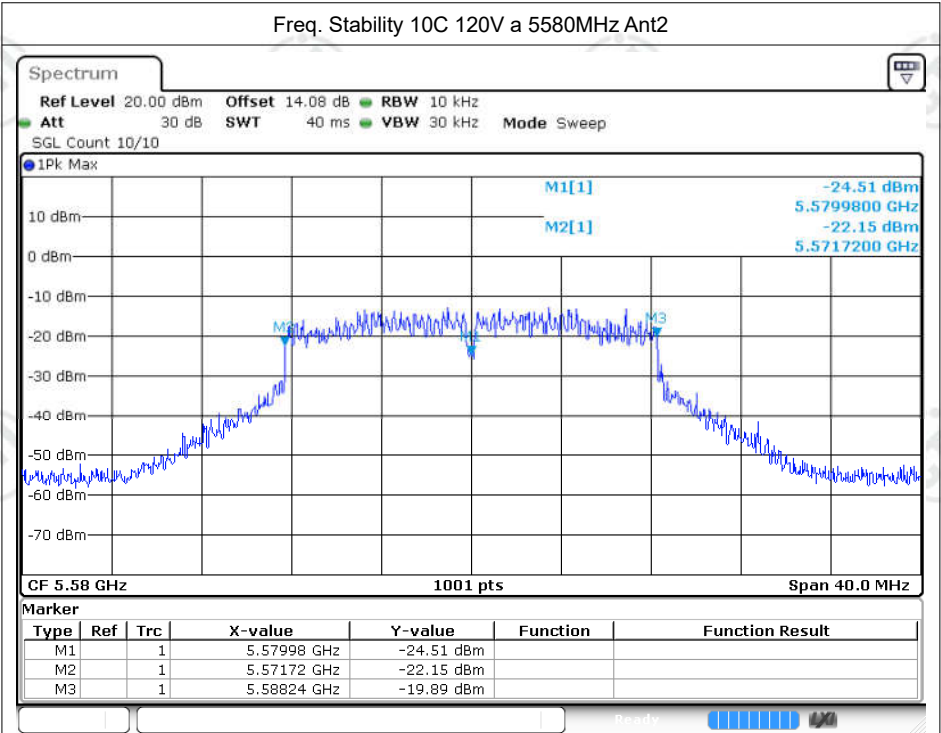


Date: 6 JAN.2025 09:11:06

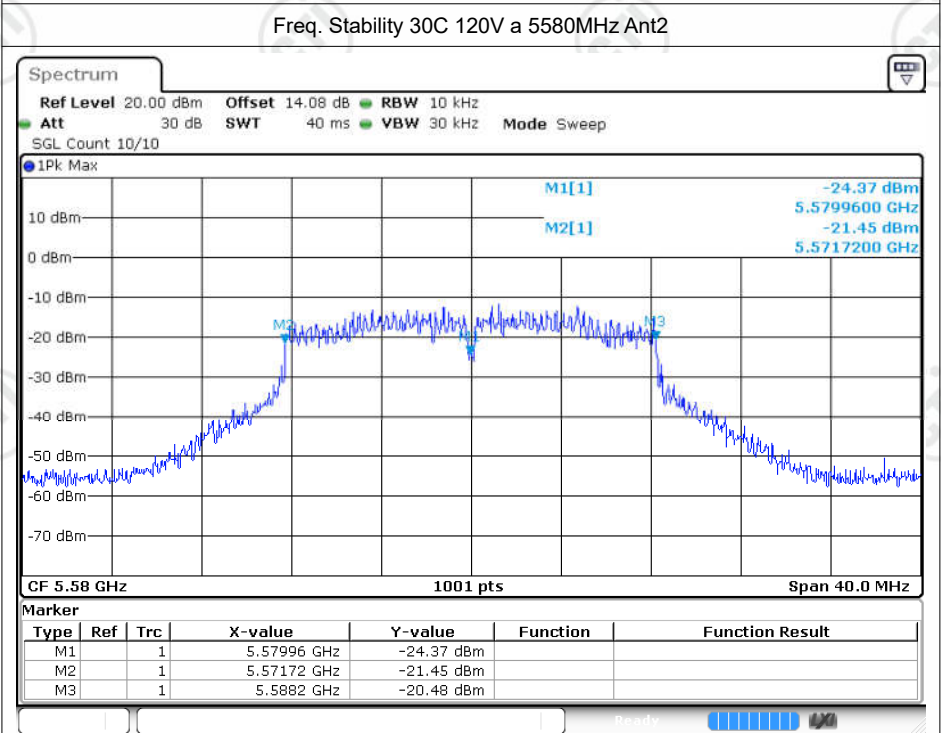


Date: 6 JAN.2025 09:11:12

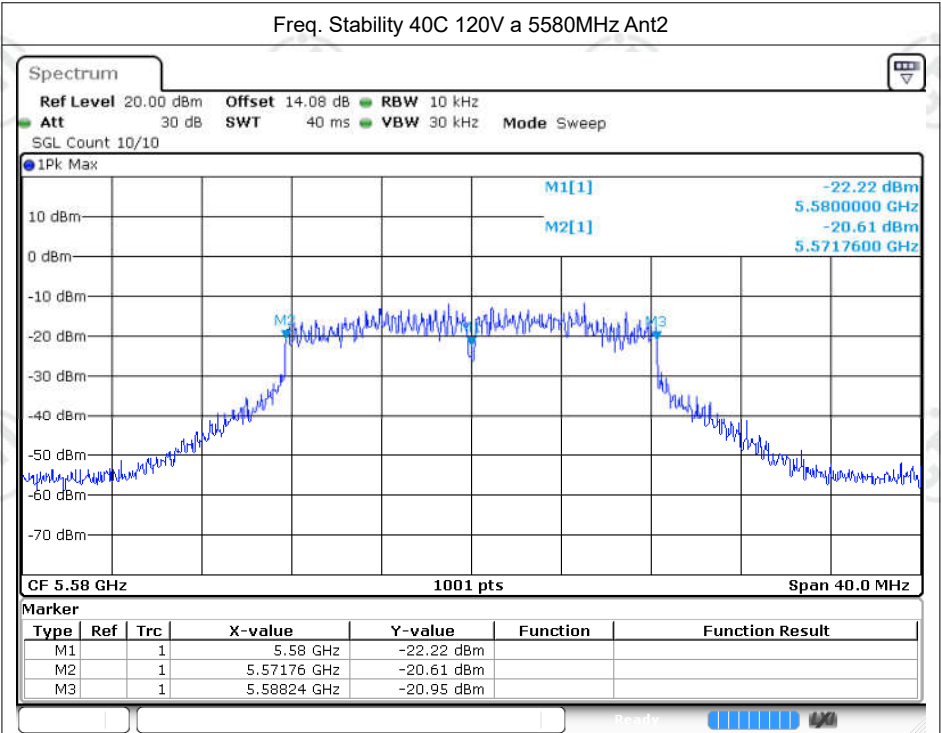


Date: 6 JAN.2025 09:11:15

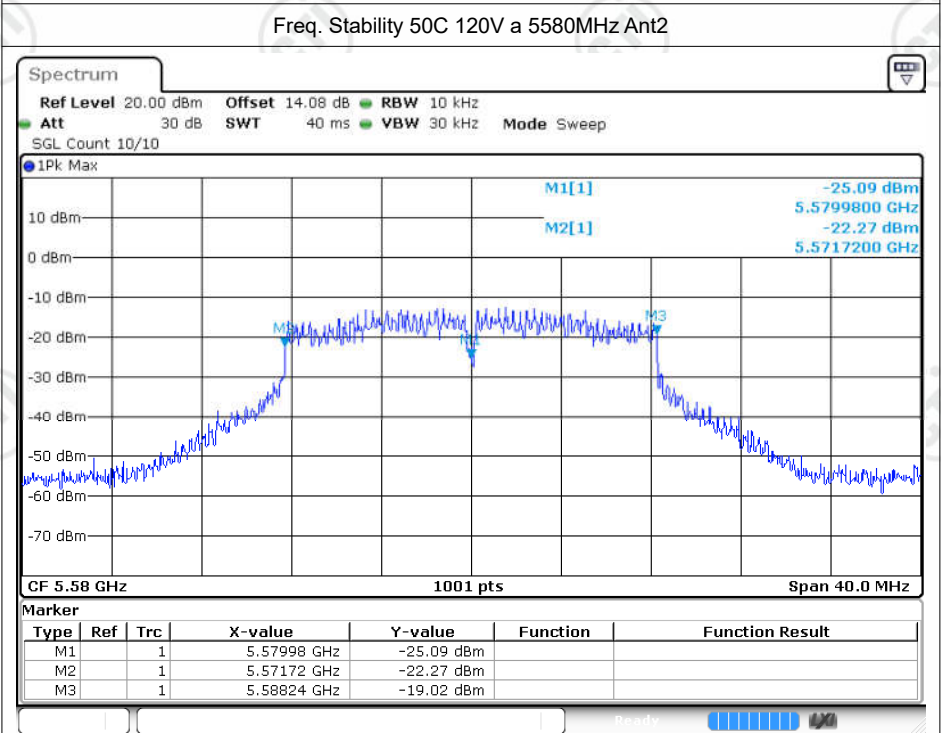


Date: 6 JAN.2025 09:11:19

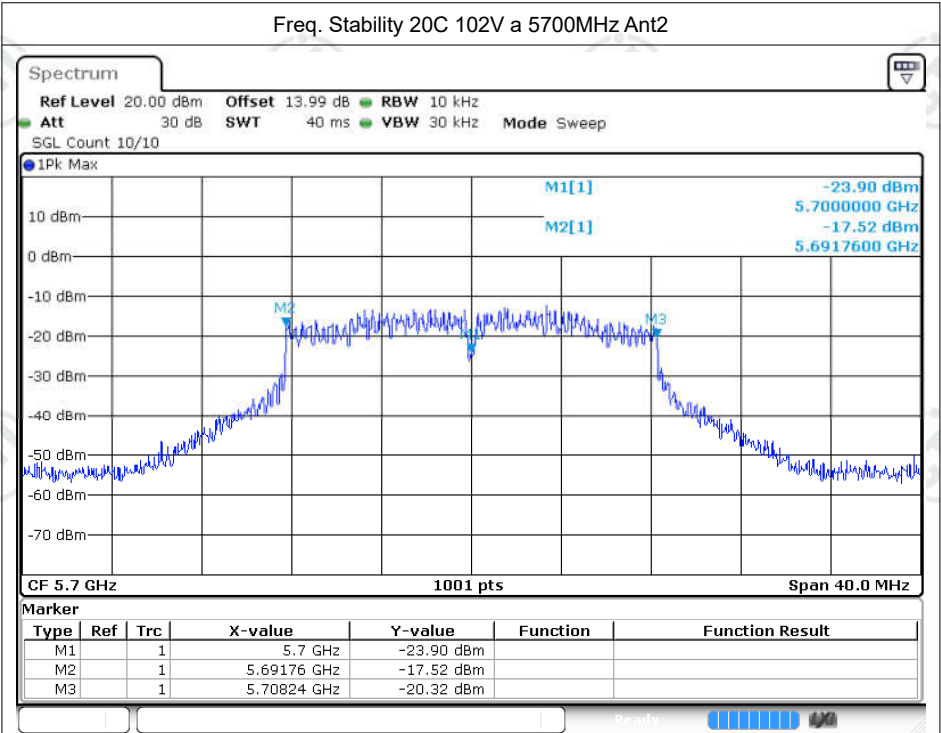


Date: 6 JAN.2025 09:12:51

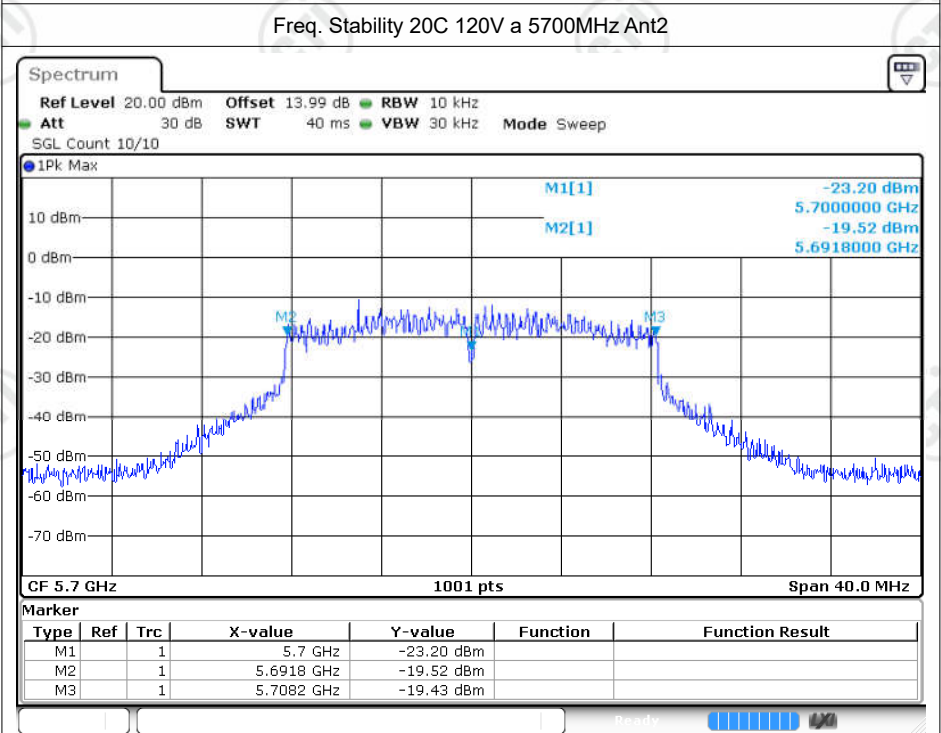


Date: 6 JAN.2025 09:13:13

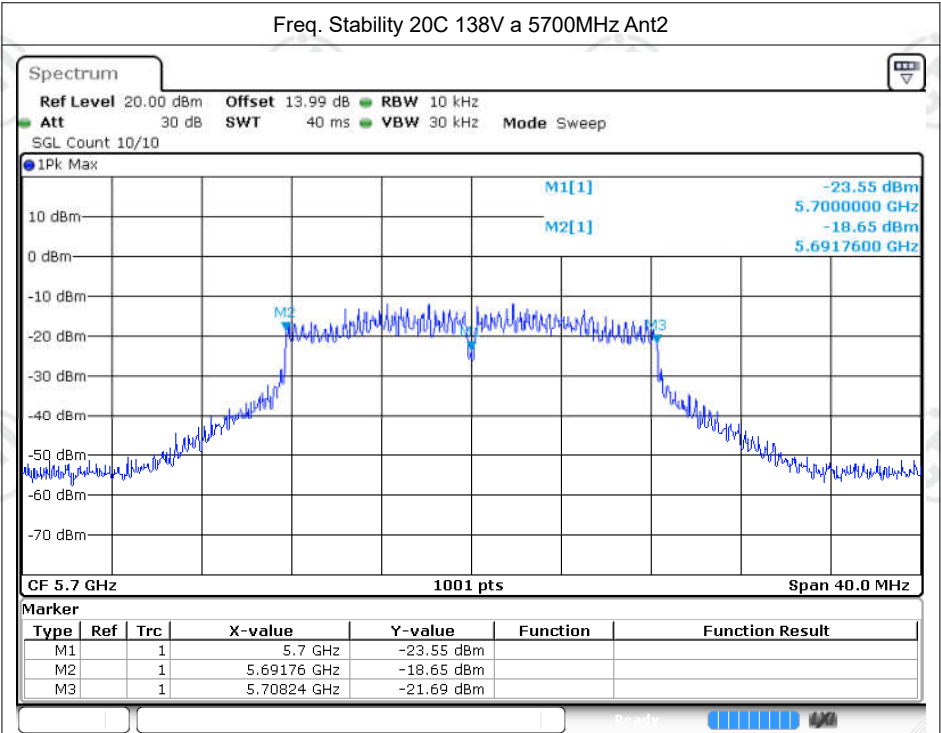


Date: 6 JAN 2025 09:12:58

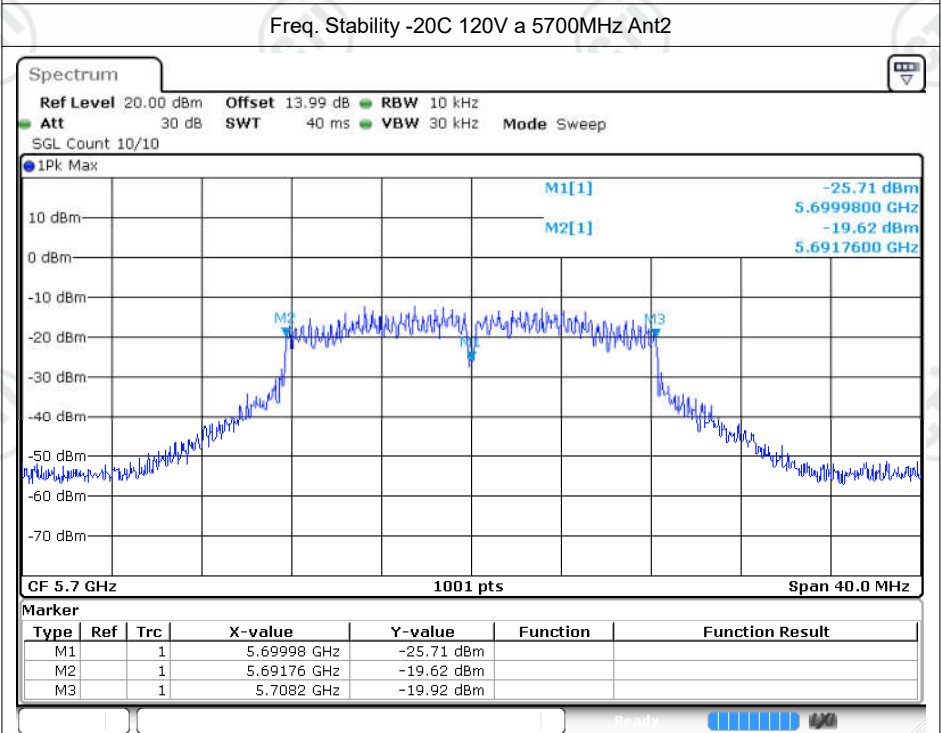


Date: 6 JAN 2025 09:13:01

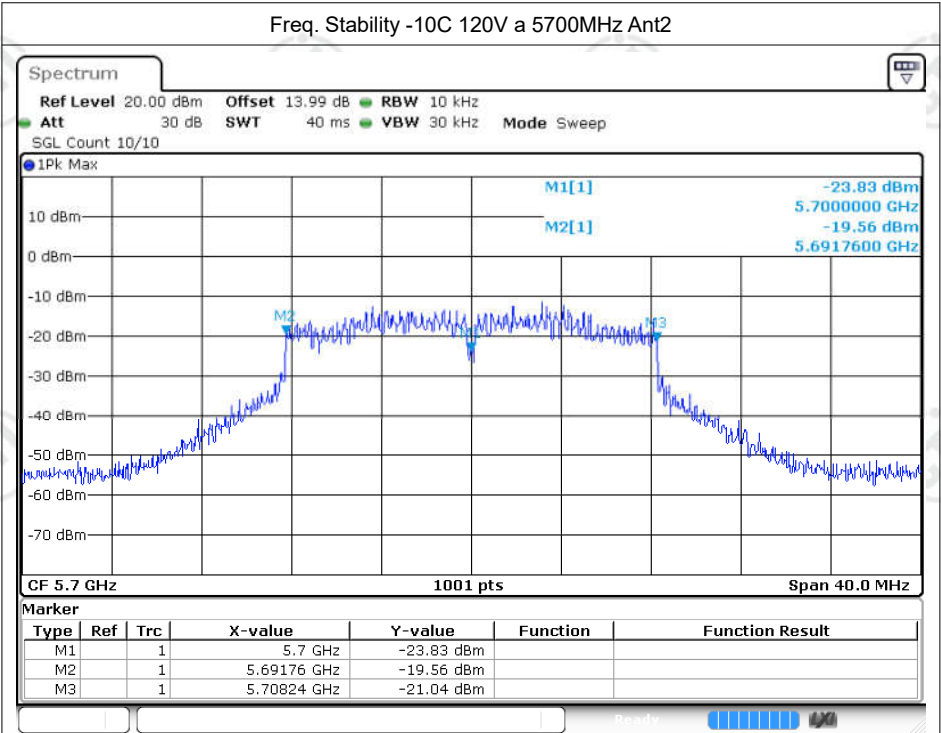


Date: 6 JAN.2025 09:13:04

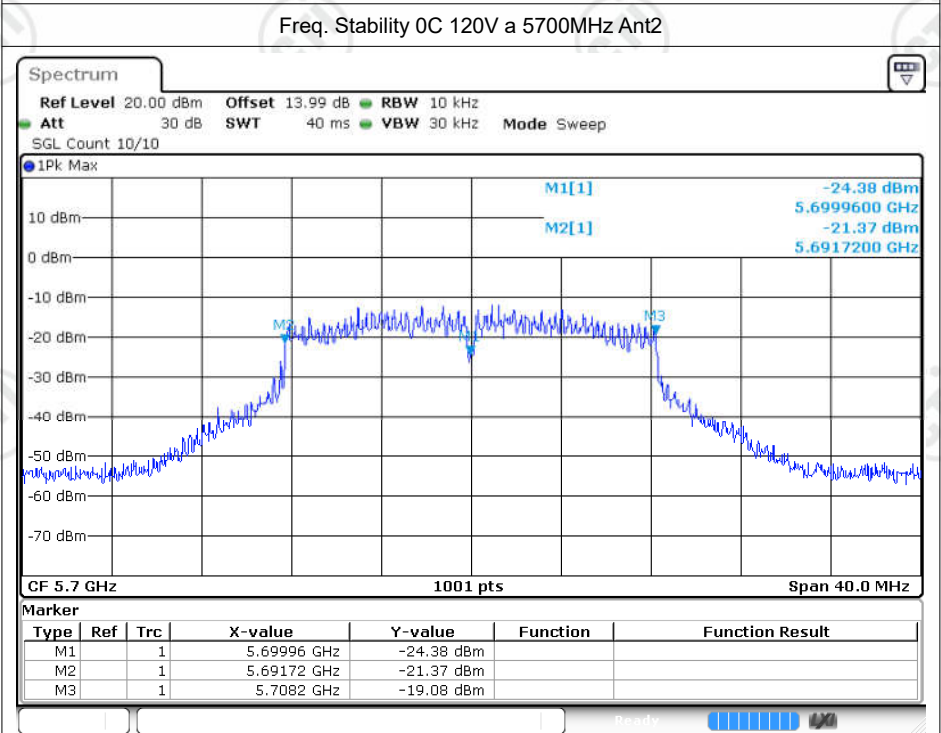


Date: 6 JAN.2025 09:13:07

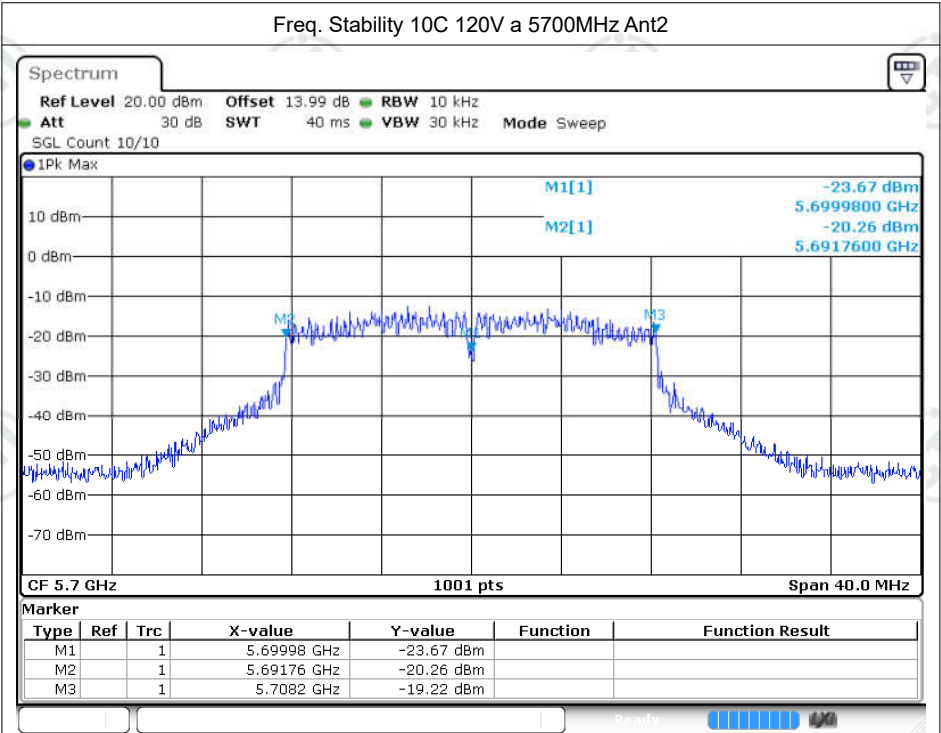


Date: 6 JAN.2025 09:13:10

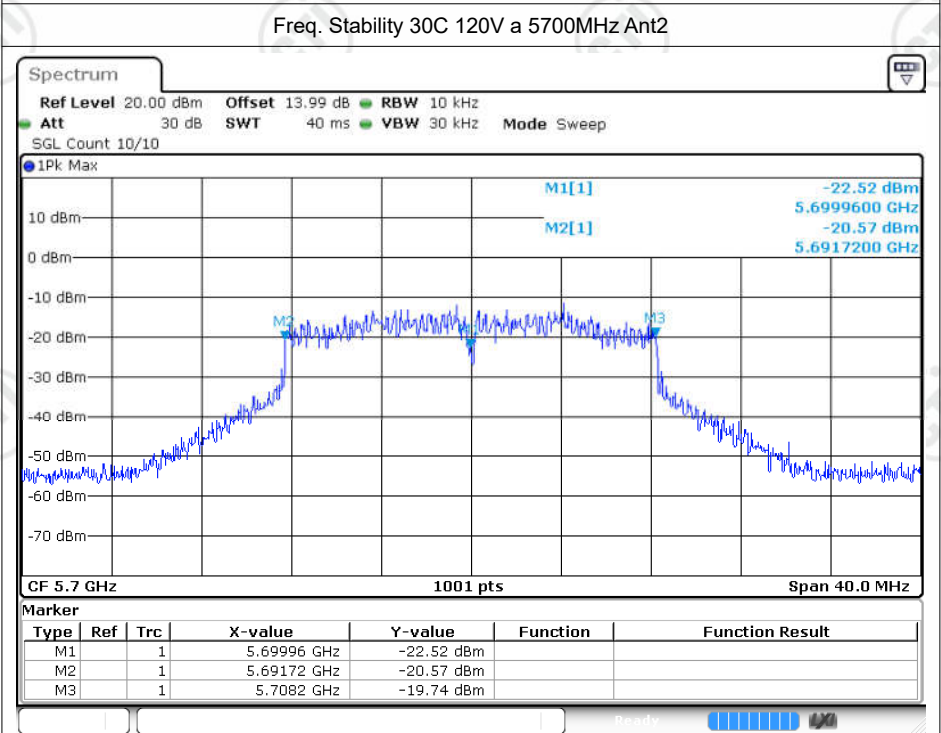

Date: 6 JAN.2025 09:13:16

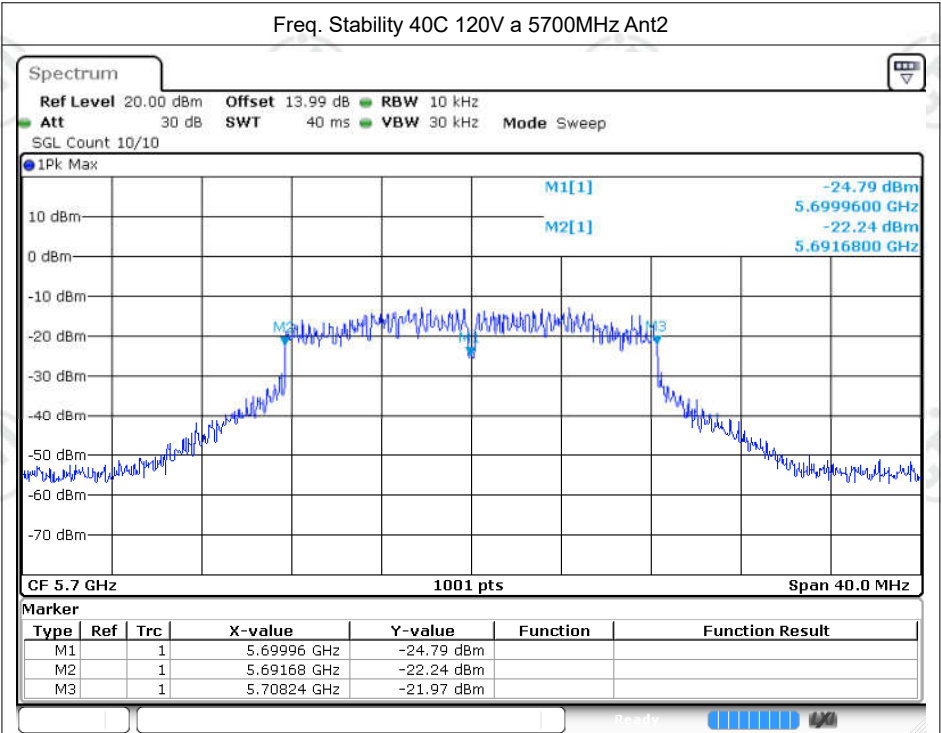

Date: 6 JAN.2025 09:13:19

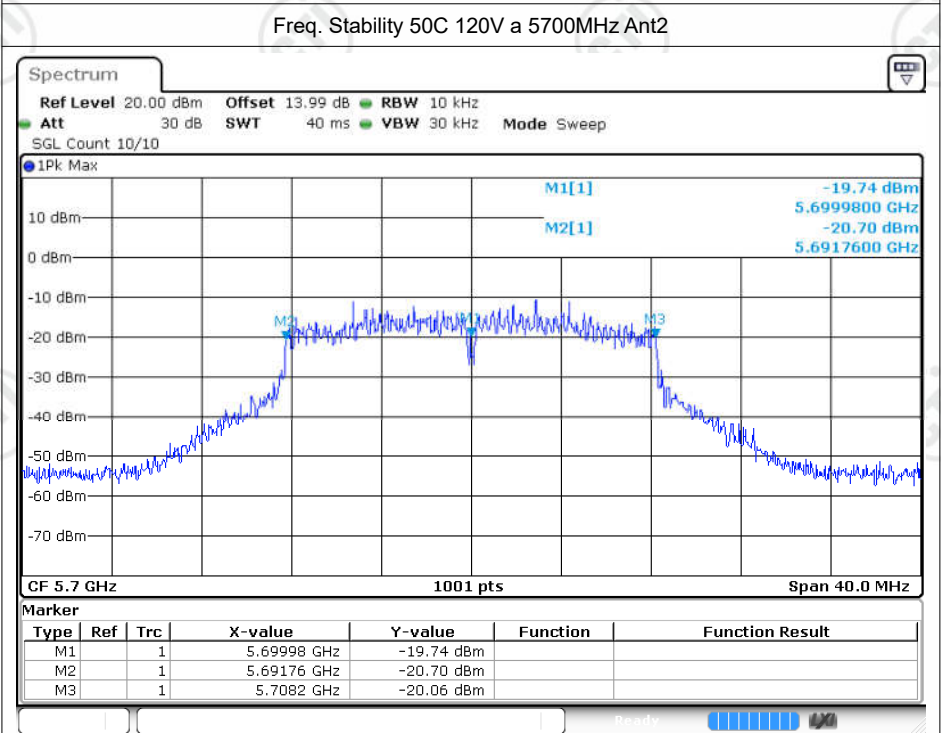

Date: 6 JAN.2025 09:13:22