

0 cm separation



SPORTON INTERNATIONAL
Haw Ya 1st Road, Qui Shan, Ta
Taiwan, R.O.C
Tel : +886-3-3273456 Fax : +886-3-3180055
www.sporton.com.tw

Data# 36 File# D:\2004案件\452108.EMI



Site : 03CH03-HY
Condition : FCC CLASS-B 3m BIC-9124--301 HORIZONTAL
EUT : WLAN 11b USB MODULE 12x71
Power : FOR SYSTEM
Model : WL-1205
Memo : TX CH11 2462MHz
平放


Freq	Level	Over Limit	Limit Line	Read Level	Probe Factor	Cable Loss	Preamplifier	Remark	Ant Pos	Table Pos
MHz	dBuV/m	dB	dBuV/m	dBuV	dB	dB	dB		cm	deg
1	167.870	31.74	-11.76	43.50	44.02	13.13	2.35	27.76 Peak	---	---
2	181.300	34.99	-8.51	43.50	46.61	13.68	2.44	27.74 Peak	---	---
3	192.180	37.03	-6.47	43.50	47.63	14.62	2.49	27.71 Peak	---	---

2cm separation



SPORTON INTERNATIONAL INC.
Haw Ya 1st Road, Qui Shan, Tao Yuan
Taiwan, R.O.C
Tel : +886-3-3273456 Fax : +886-3-3180055
www.sporton.com.tw

Data# 37 File# D:\2004案件\452108.EMI

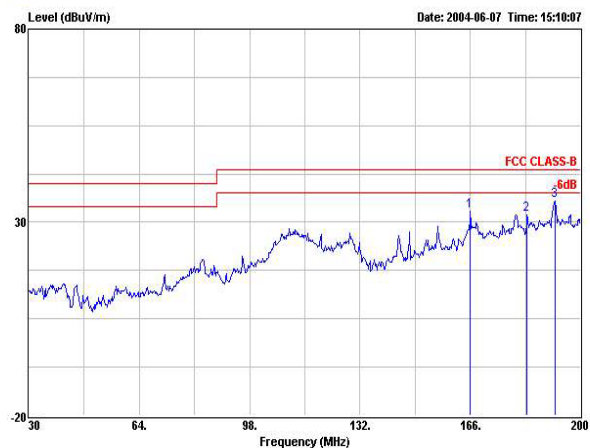

Site : 03CH03-HY
Condition : FCC CLASS-B 3m BIC-9124--301 HORIZONTAL
EUT : WLAN 11b USB MODULE 12x71
Power : FOR SYSTEM
Model : WL-1205
Memo : TX CH11 2462MHz
墊高

Freq	Level	Over Limit	Limit Line	Read Level	Probe Factor	Cable Loss	Preamplifier	Remark	Ant Pos	Table Pos
MHz	dBuV/m	dB	dBuV/m	dBuV	dB	dB	dB		cm	deg
1	166.000	32.85	-10.65	43.50	45.26	13.03	2.33	27.77 Peak	---	---
2	183.510	31.82	-11.68	43.50	43.19	13.91	2.45	27.73 Peak	---	---
3	192.180	35.54	-7.96	43.50	46.14	14.62	2.49	27.71 Peak	---	---