





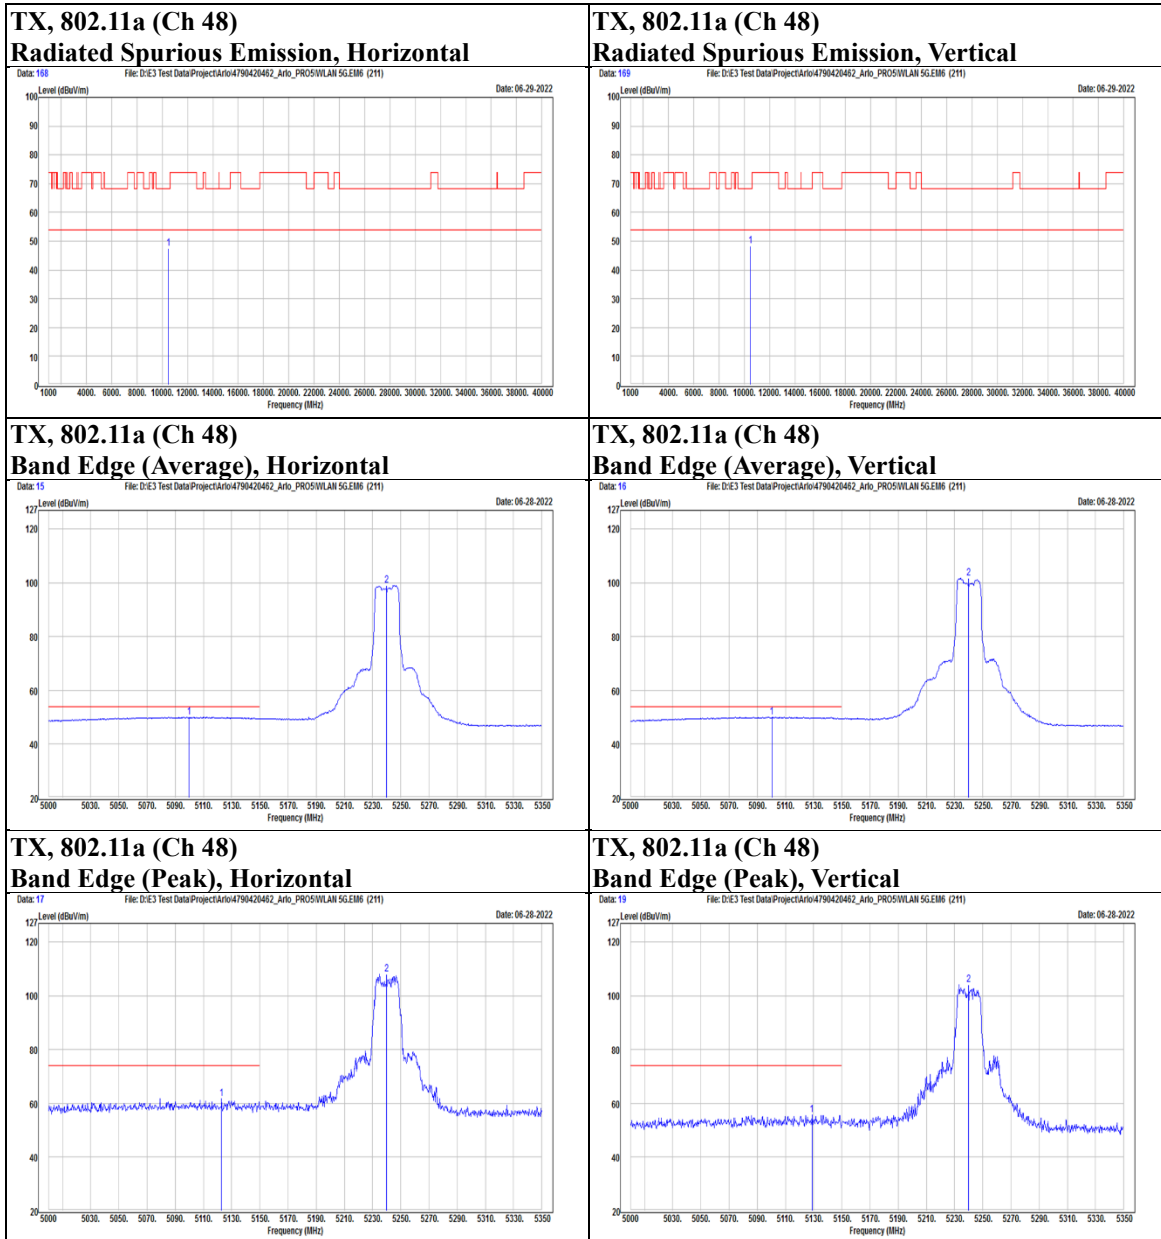

Test report No. : 4790420462-US-R1-V0
Page : 67 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	52
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5260	89.35	18.88	108.23	N/A	N/A	PK
	@	5260	80.59	18.88	99.47	N/A	N/A	AVG
		5450.4	41.24	19.52	60.76	74	-13.24	PK
		5456.4	28.62	19.55	48.17	54	-5.83	AVG
Vertical	@	5260	91.51	18.88	110.39	N/A	N/A	PK
	@	5260	82.93	18.88	101.81	N/A	N/A	AVG
		5449.2	39.91	19.51	59.42	74	-14.58	PK
		5451.9	28.62	19.53	48.15	54	-5.85	AVG

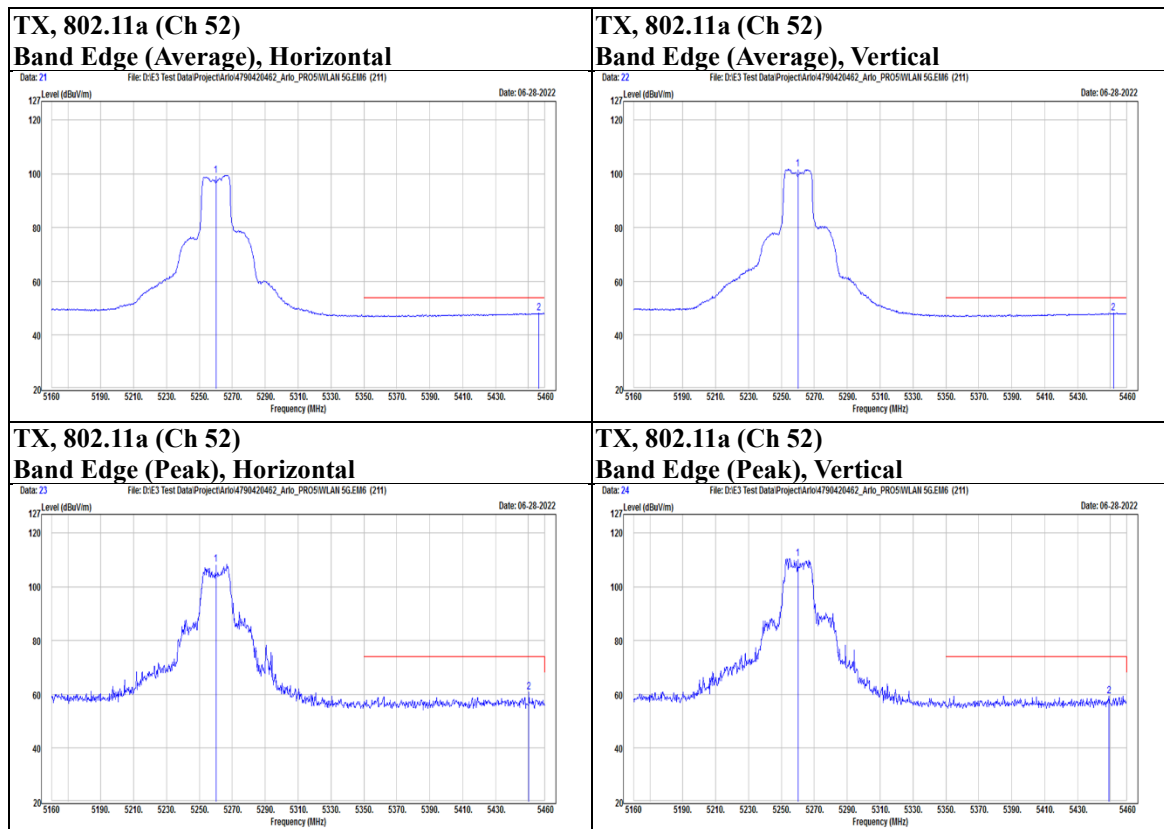

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 68 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	60
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5300	89.29	18.77	108.06	N/A	N/A	PK
	@	5300	80.89	18.77	99.66	N/A	N/A	AVG
		5351.1	30.2	19.01	49.21	54	-4.79	AVG
		5452.8	40.17	19.53	59.7	74	-14.3	PK
	*	10600	30.13	18.04	48.17	68.2	-20.03	PK
Vertical	@	5300	91.51	18.77	110.28	N/A	N/A	PK
	@	5300	82.62	18.77	101.39	N/A	N/A	AVG
		5350.2	31.39	19.01	50.4	54	-3.6	AVG
		5351.1	41.92	19.01	60.93	74	-13.07	PK
	*	10600	30.96	18.04	49	68.2	-19.2	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 69 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

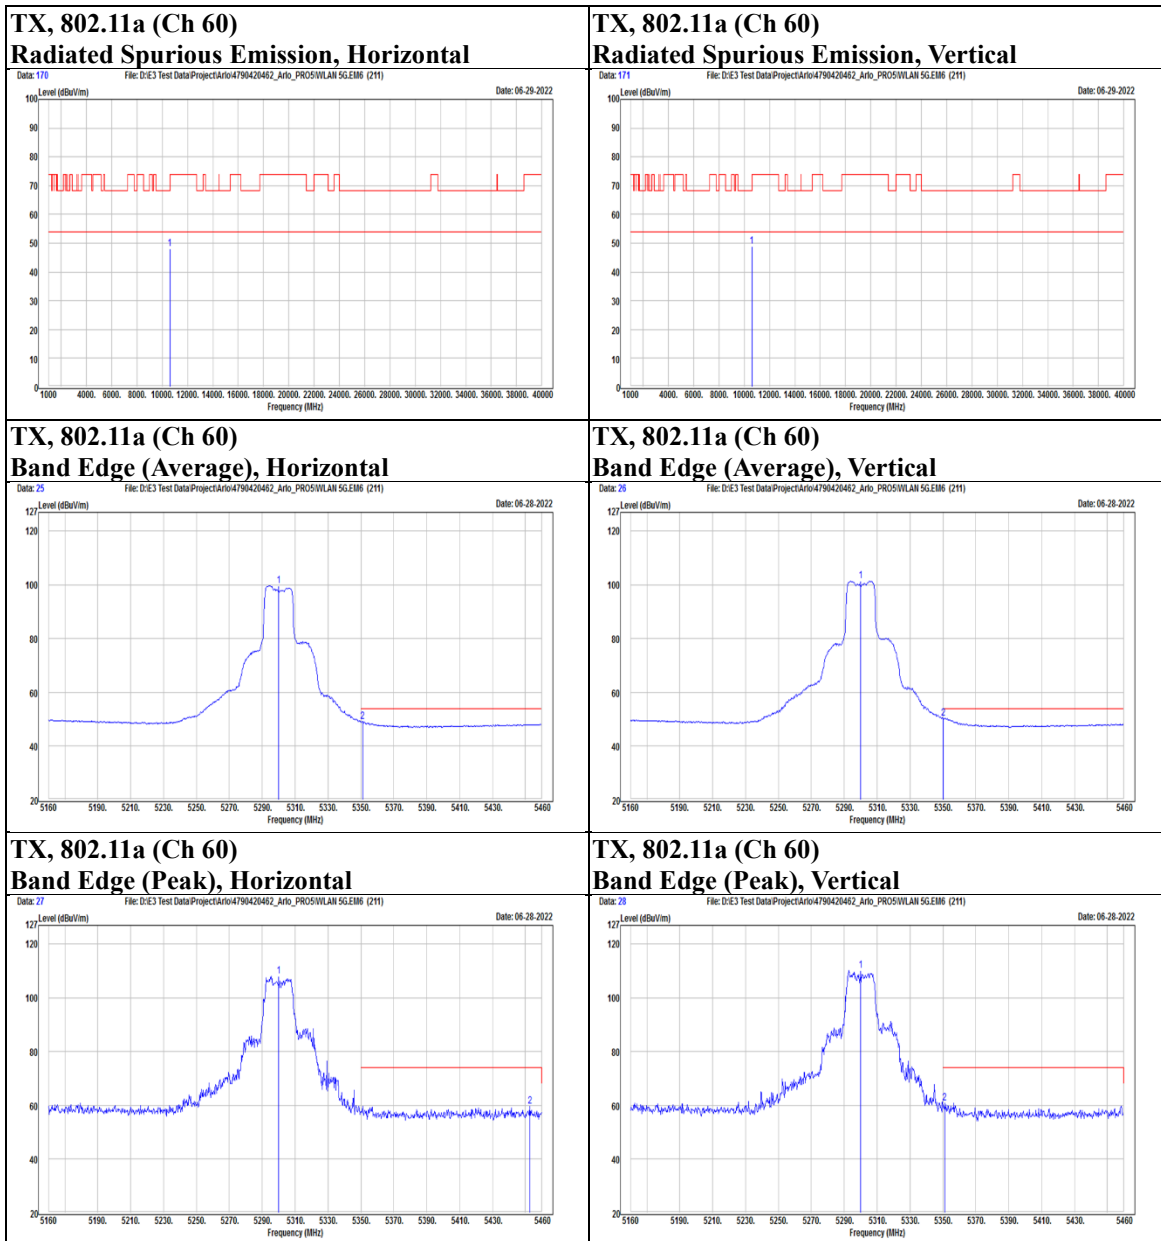

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 70 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	87.39	18.86	106.25	N/A	N/A	PK
	@	5320	78.89	18.86	97.75	N/A	N/A	AVG
		5350.5	47.83	19.01	66.84	74	-7.16	PK
		5350.5	31.98	19.01	50.99	54	-3.01	AVG
	*	10640	30.79	18.03	48.82	74	-25.18	PK
Vertical	@	5320	90.3	18.86	109.16	N/A	N/A	PK
	@	5320	80.76	18.86	99.62	N/A	N/A	AVG
		5350.2	45.87	19.01	64.88	74	-9.12	PK
		5350.5	34.12	19.01	53.13	54	-0.87	AVG
	*	10640	31.38	18.03	49.41	74	-24.59	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

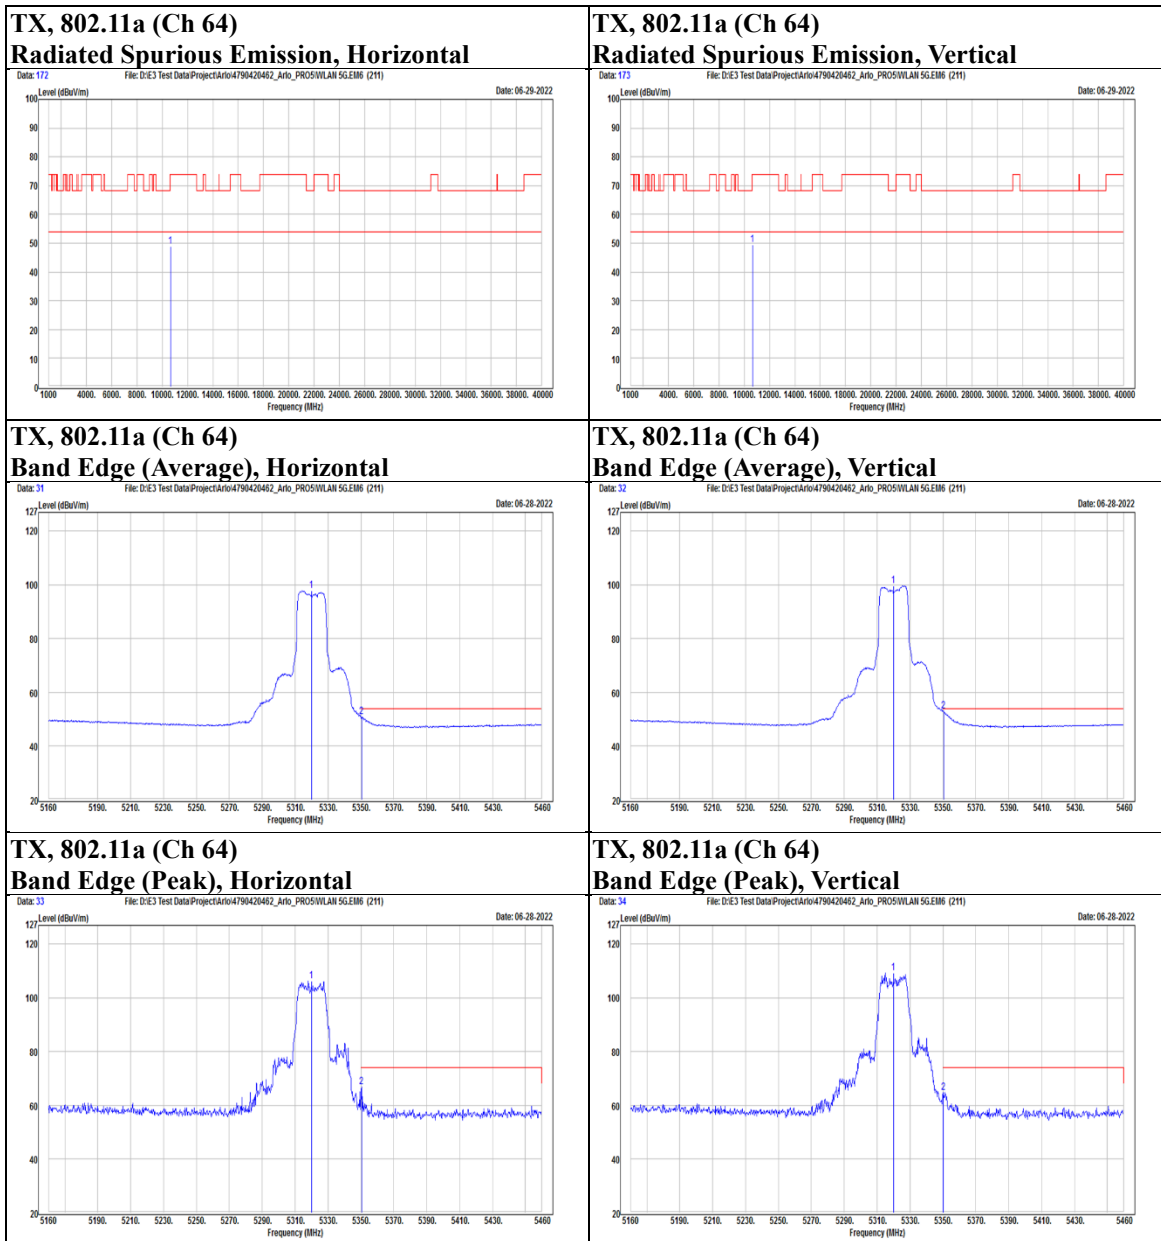



Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dBm)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5436.4	39.9	19.46	59.36	74	-14.64	PK
		5436.4	28.89	19.46	48.35	54	-5.65	AVG
		5467.55	42.29	19.61	61.9	68.2	-6.3	PK
	@	5500	82.24	19.77	102.01	N/A	N/A	PK
	@	5500	74.48	19.77	94.25	N/A	N/A	AVG
	*	11000	30.62	18.41	49.03	74	-24.97	PK
Vertical		5412.95	40.28	19.33	59.61	74	-14.39	PK
		5436.4	29.46	19.46	48.92	54	-5.08	AVG
		5466.85	47.64	19.61	67.25	68.2	-0.95	PK
	@	5500	87.75	19.77	107.52	N/A	N/A	PK
	@	5500	78.4	19.77	98.17	N/A	N/A	AVG
	*	11000	29.92	18.41	48.33	74	-25.67	PK

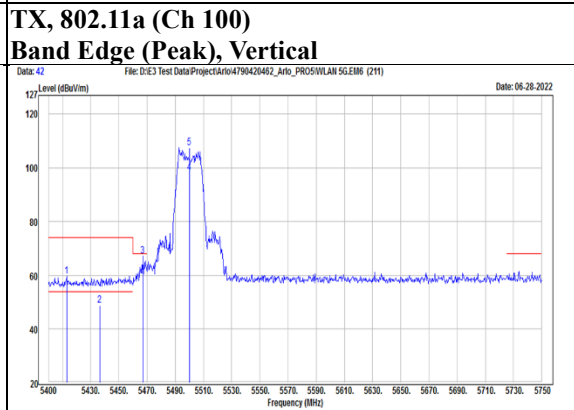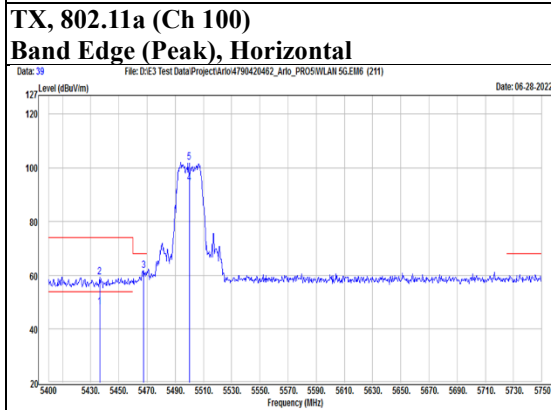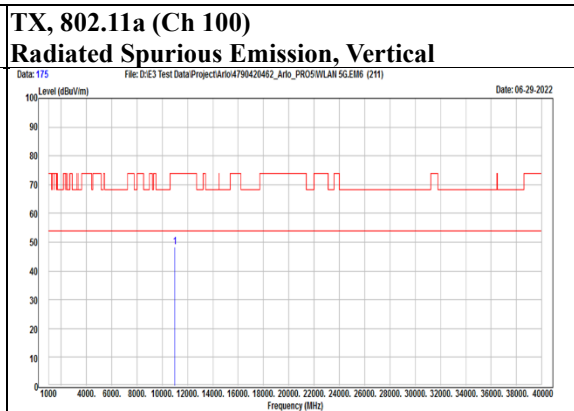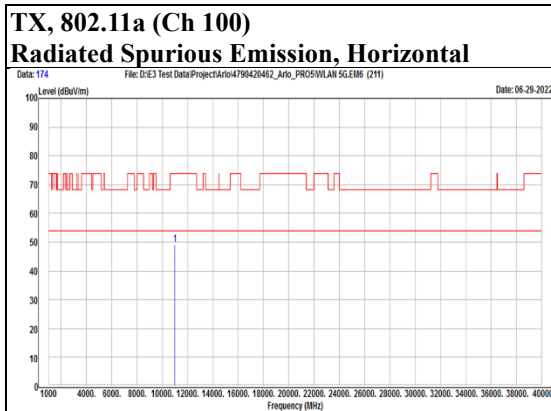

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790420462-US-R1-V0
Page : 73 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422


Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5429.4	39.34	19.42	58.76	74	-15.24	PK
		5450.75	28.7	19.52	48.22	54	-5.78	AVG
		5460.2	39.55	19.57	59.12	68.2	-9.08	PK
	@	5580	85.61	19.76	105.37	N/A	N/A	PK
	@	5580	76.87	19.76	96.63	N/A	N/A	AVG
		5737.4	39.88	20.08	59.96	68.2	-8.24	PK
	*	11160	30.06	18.47	48.53	74	-25.47	PK
Vertical		5450.75	40.26	19.52	59.78	74	-14.22	PK
		5450.75	28.7	19.52	48.22	54	-5.78	AVG
		5467.9	39.53	19.61	59.14	68.2	-9.06	PK
	@	5580	90.29	19.76	110.05	N/A	N/A	PK
	@	5580	82.47	19.76	102.23	N/A	N/A	AVG
		5746.15	39.83	20.16	59.99	68.2	-8.21	PK
	*	11160	31.03	18.47	49.5	74	-24.5	PK


TX, 802.11a (Ch 116)
Radiated Spurious Emission, Horizontal

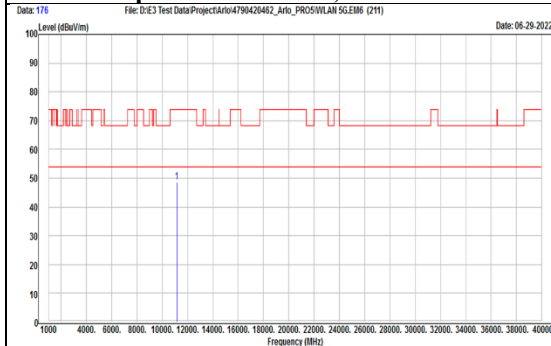


TX, 802.11a (Ch 116)
Radiated Spurious Emission, Vertical

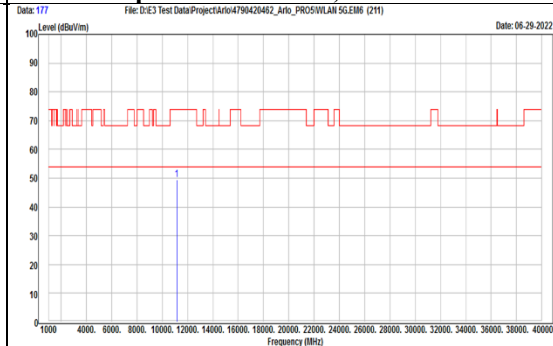

TX, 802.11a (Ch 116)
Band Edge (Peak), Horizontal

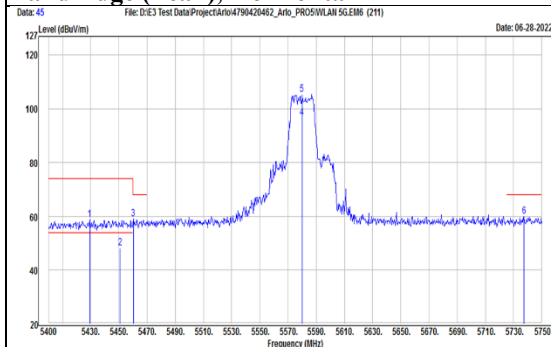

TX, 802.11a (Ch 116)
Band Edge (Peak), Vertical

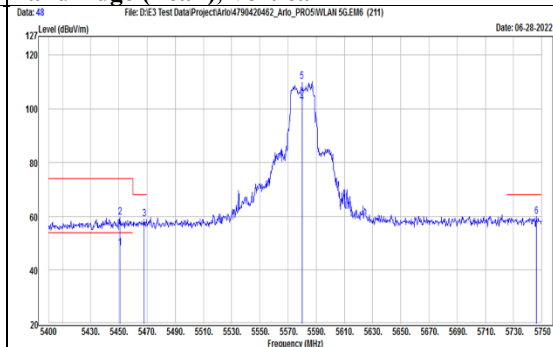

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 74 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5700	86.17	19.73	105.9	N/A	N/A	PK
	@	5700	75.7	19.73	95.43	N/A	N/A	AVG
		5725	43.74	19.96	63.7	68.2	-4.5	PK
	*	11400	30.46	18.85	49.31	74	-24.69	PK
Vertical	@	5700	89.7	19.73	109.43	N/A	N/A	PK
	@	5700	79.29	19.73	99.02	N/A	N/A	AVG
		5725.15	47.76	19.96	67.72	68.2	-0.48	PK
	*	11400	30.19	18.85	49.04	74	-24.96	PK

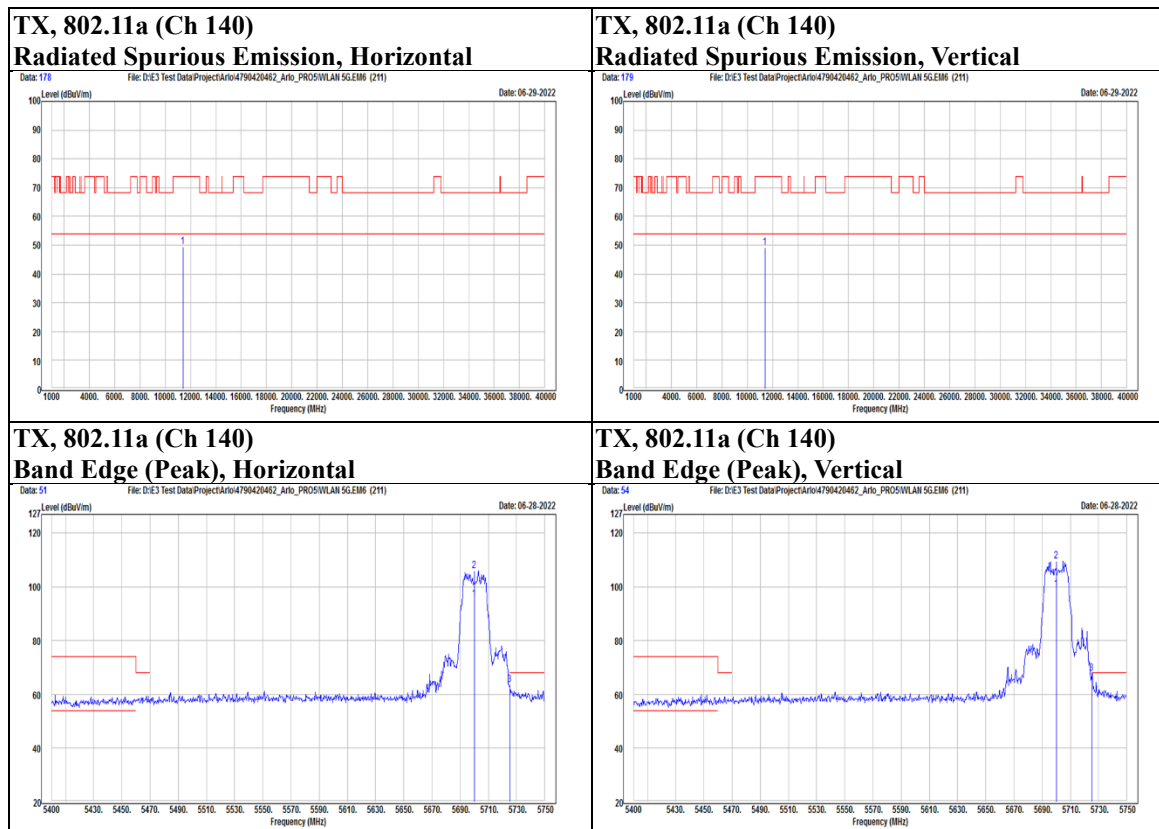

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 75 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	144
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	*	11440	30.13	19.06	49.19	74	-24.81	PK
Vertical	*	11440	30.05	19.06	49.11	74	-24.89	PK

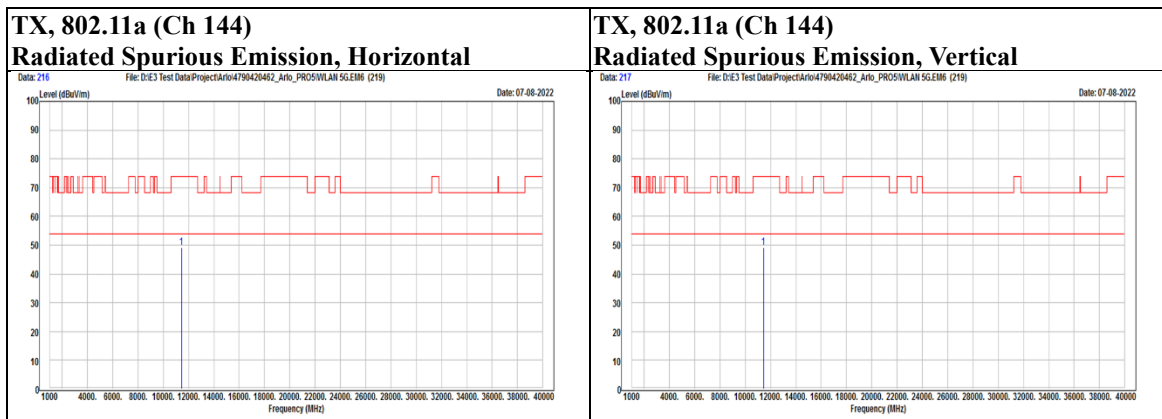

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 76 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5593	40.46	19.72	60.18	68.2	-8.02	PK
		5698.5	43.05	19.73	62.78	104.09	-41.31	PK
	@	5745	86.52	20.15	106.67	N/A	N/A	PK
	*	11490	31	19.33	50.33	74	-23.67	PK
Vertical		5589.5	40.69	19.73	60.42	68.2	-7.78	PK
		5699.5	48.67	19.73	68.4	104.83	-36.43	PK
	@	5745	89.79	20.15	109.94	N/A	N/A	PK
	*	11490	30.02	19.33	49.35	74	-24.65	PK

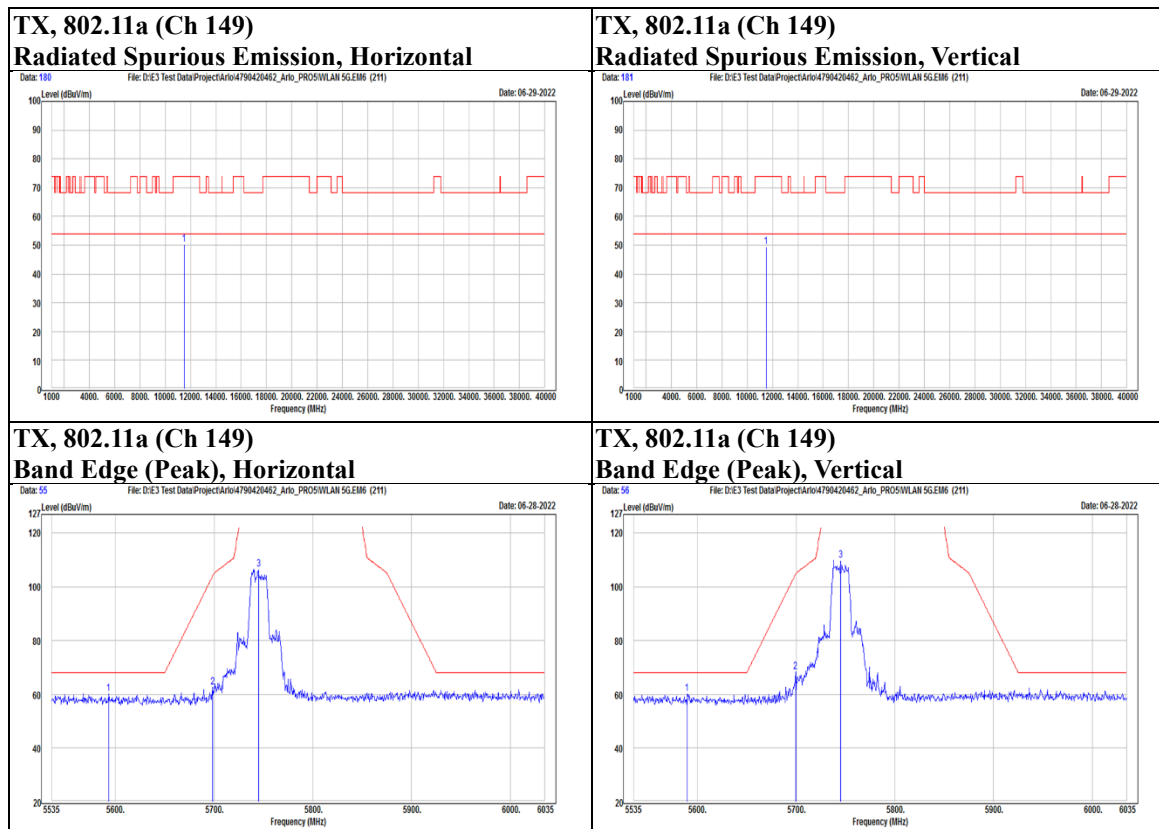

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dBm)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5574.5	39.96	19.77	59.73	68.2	-8.47	PK
		5699.5	40.86	19.73	60.59	104.83	-44.24	PK
	@	5785	86.83	20.45	107.28	N/A	N/A	PK
		5898	40.38	20.96	61.34	88.14	-26.8	PK
		6018	41.38	20.98	62.36	68.2	-5.84	PK
	*	11570	29.42	19.07	48.49	74	-25.51	PK
Vertical		5579	41.48	19.75	61.23	68.2	-6.97	PK
		5698.5	40.8	19.73	60.53	104.09	-43.56	PK
	@	5785	88.99	20.45	109.44	N/A	N/A	PK
		5918	40.41	20.96	61.37	73.36	-11.99	PK
		5966	40.84	20.95	61.79	68.2	-6.41	PK
	*	11570	29.28	19.07	48.35	74	-25.65	PK


TX, 802.11a (Ch 157)
Radiated Spurious Emission, Horizontal

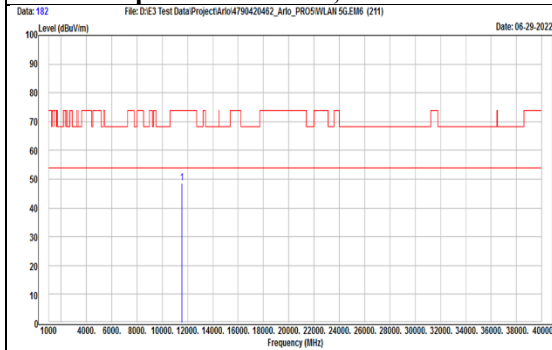


TX, 802.11a (Ch 157)
Radiated Spurious Emission, Vertical

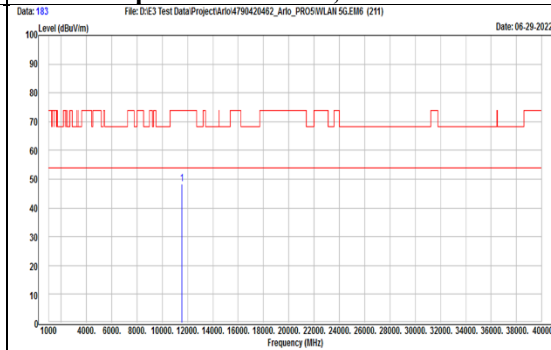

TX, 802.11a (Ch 157)
Band Edge (Peak), Horizontal

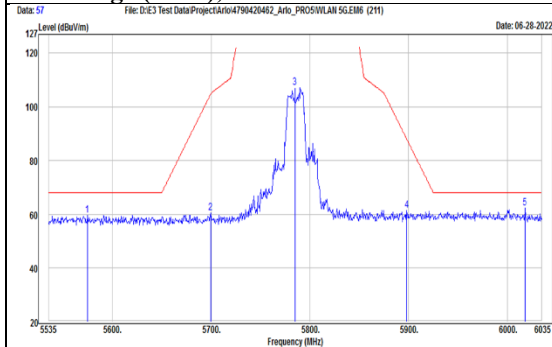

TX, 802.11a (Ch 157)
Band Edge (Peak), Vertical




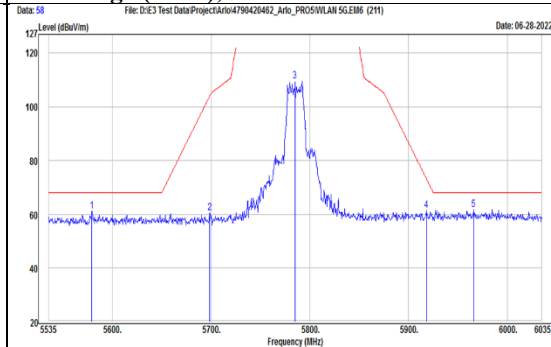




Test report No. : 4790420462-US-R1-V0
Page : 78 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5825	87.47	20.58	108.05	N/A	N/A	PK
		5918.5	40.06	20.96	61.02	72.99	-11.97	PK
		5970	40.43	20.96	61.39	68.2	-6.81	PK
	*	11650	30.04	18.83	48.87	74	-25.13	PK
Vertical	@	5825	89.68	20.58	110.26	N/A	N/A	PK
		5903.5	41.45	20.97	62.42	84.07	-21.65	PK
		5954.5	41.17	20.95	62.12	68.2	-6.08	PK
	*	11650	29.37	18.83	48.2	74	-25.8	PK

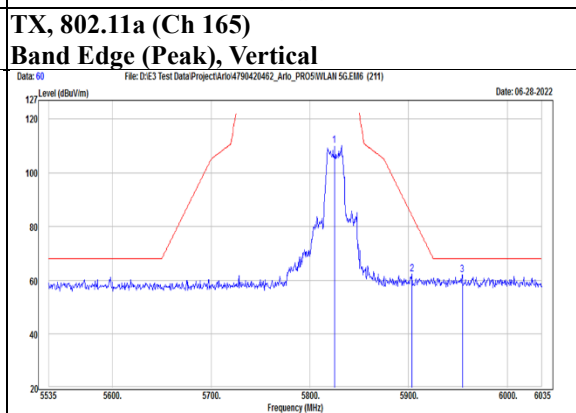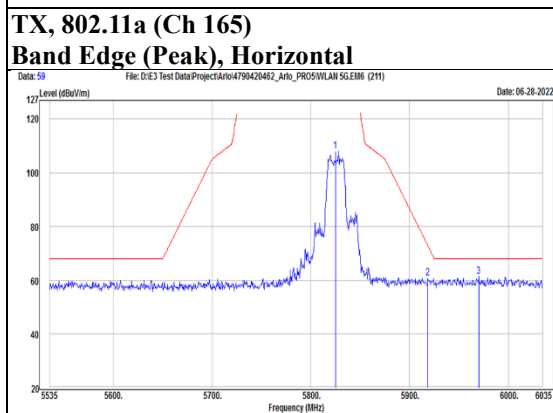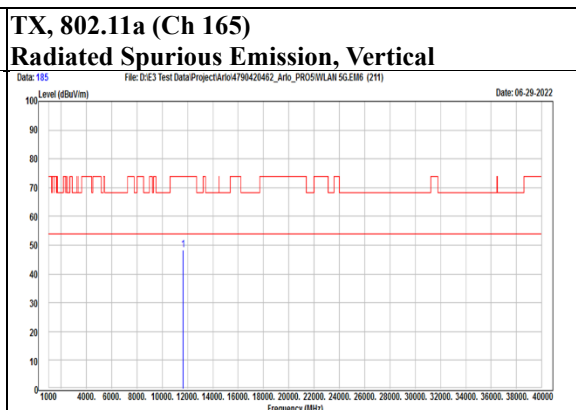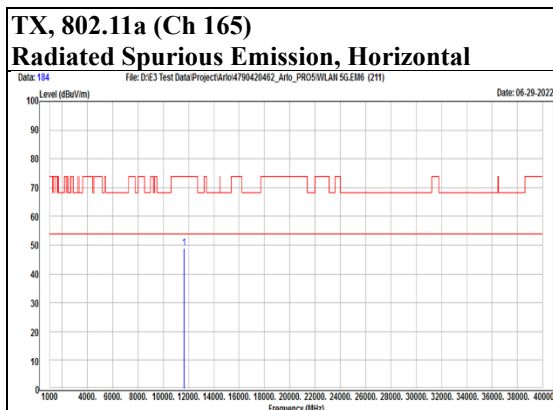

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 79 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	36
------	---------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5147.35	46.01	19.41	65.42	74	-8.58	PK
		5148.05	32.53	19.4	51.93	54	-2.07	AVG
	@	5180	85.53	19.31	104.84	N/A	N/A	PK
	@	5180	76.32	19.31	95.63	N/A	N/A	AVG
	*	10360	30.64	17.51	48.15	68.2	-20.05	PK
Vertical		5144.2	41.22	19.4	60.62	74	-13.38	PK
		5148.4	34.02	19.4	53.42	54	-0.58	AVG
	@	5180	82.51	19.31	101.82	N/A	N/A	PK
	@	5180	79.86	19.31	99.17	N/A	N/A	AVG
	*	10360	30.66	17.51	48.17	68.2	-20.03	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 80 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

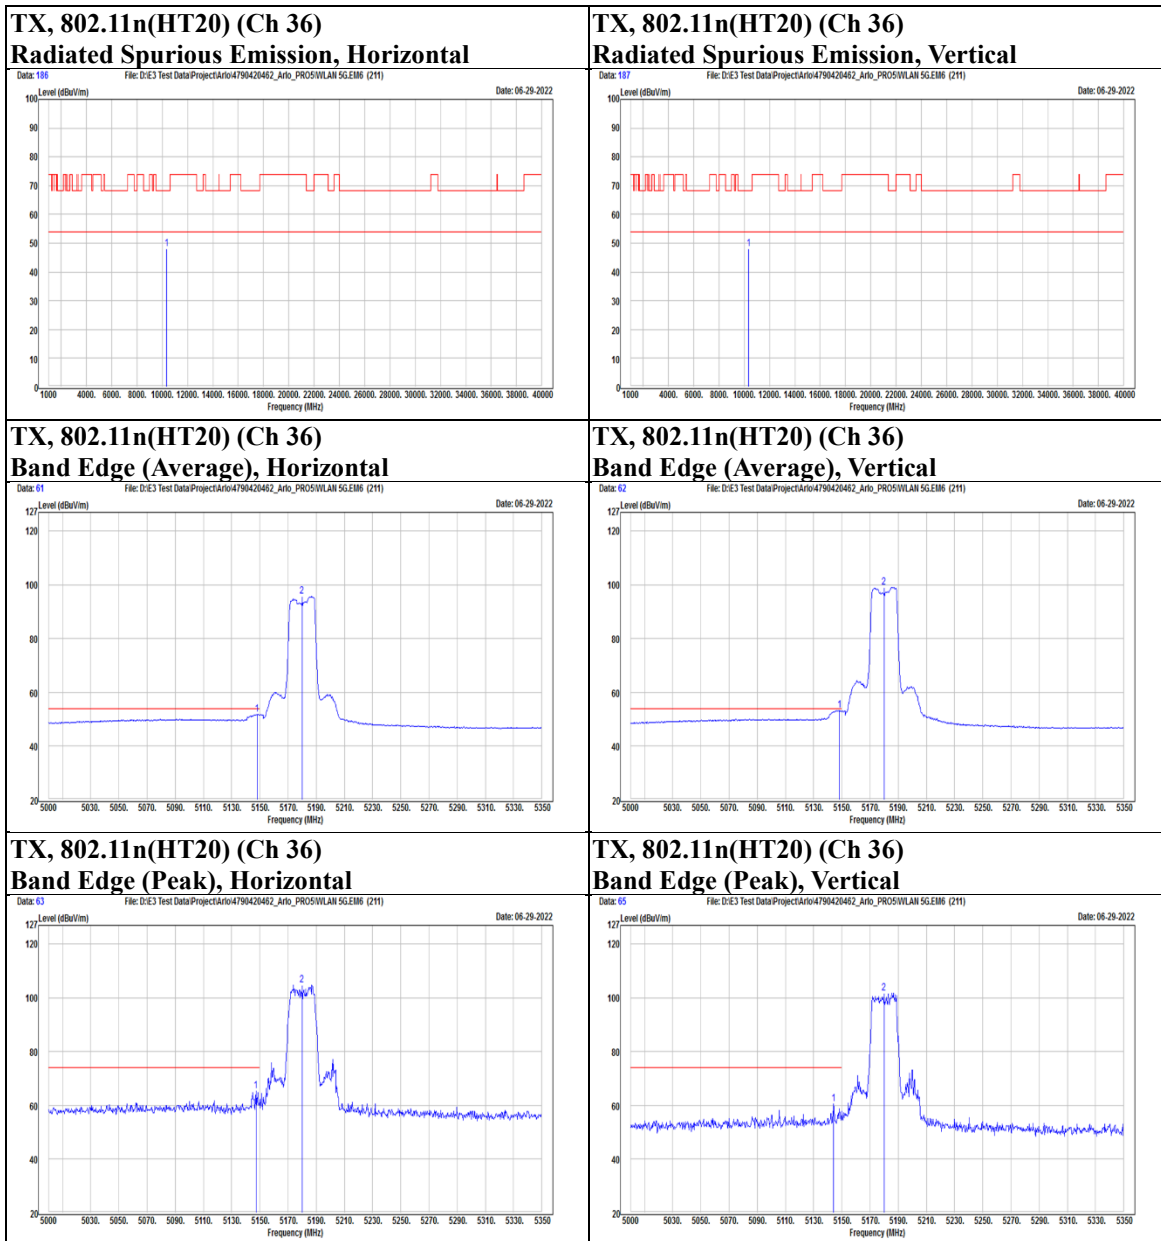

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 81 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	44
------	---------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5093.8	30.6	19.39	49.99	54	-4.01	AVG
		5105	41.64	19.44	61.08	74	-12.92	PK
	@	5220	90.05	19.12	109.17	N/A	N/A	PK
	@	5220	80.5	19.12	99.62	N/A	N/A	AVG
	*	10440	29.71	17.81	47.52	68.2	-20.68	PK
Vertical		5064.05	36.85	19.18	56.03	74	-17.97	PK
		5147.35	30.9	19.41	50.31	54	-3.69	AVG
	@	5220	86.28	19.12	105.4	N/A	N/A	PK
	@	5220	84.07	19.12	103.19	N/A	N/A	AVG
	*	10440	31.51	17.81	49.32	68.2	-18.88	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 82 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

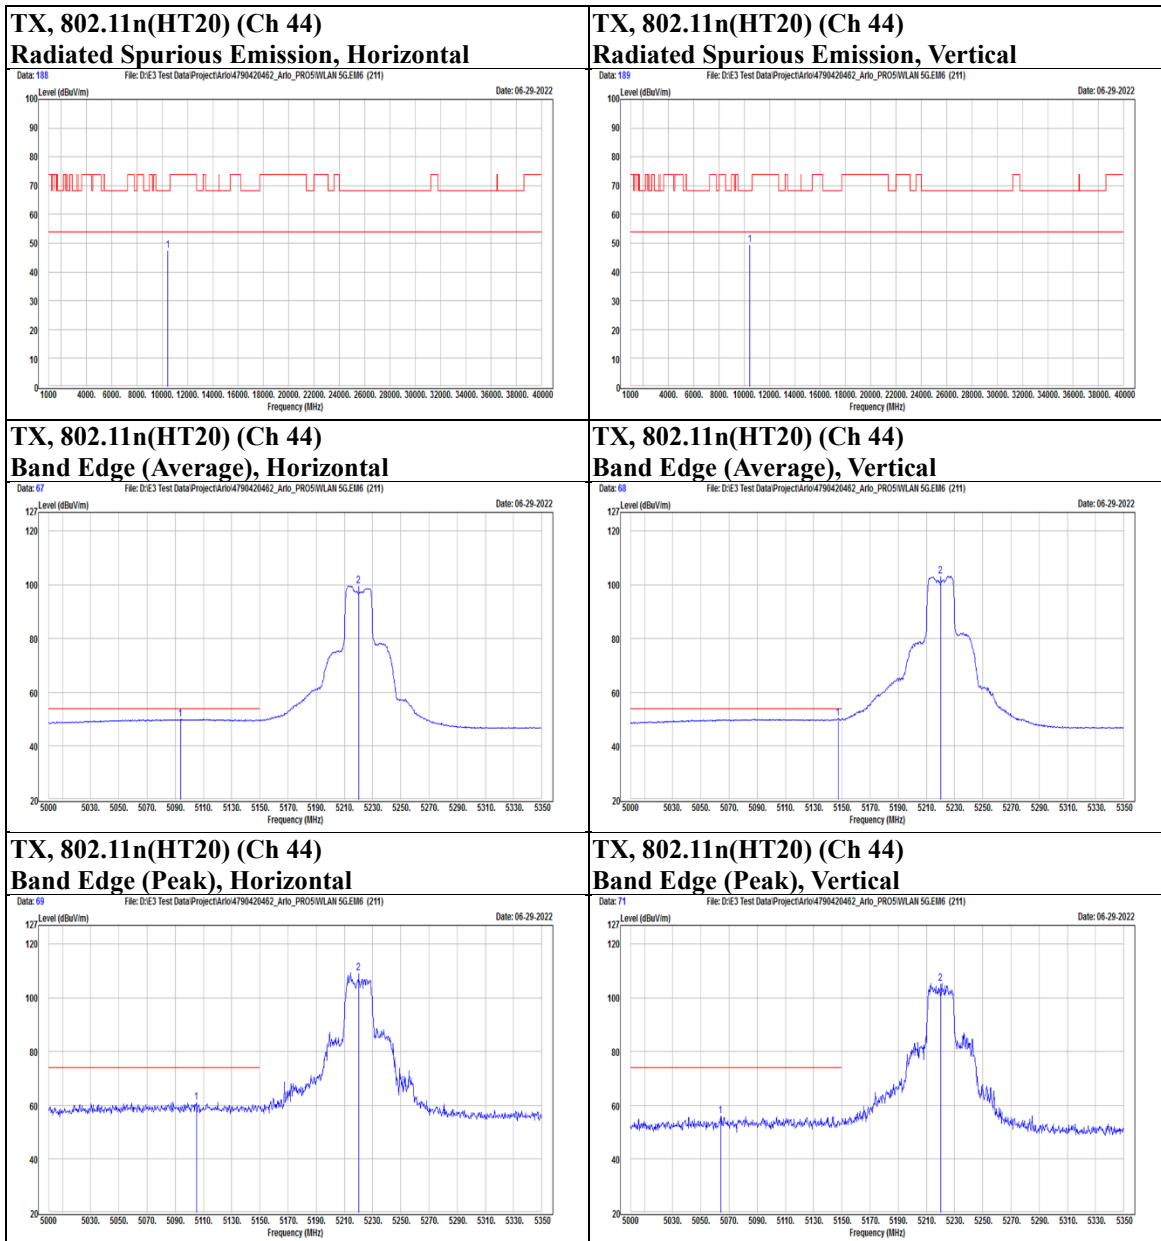

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 83 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	48
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5082.6	41.54	19.33	60.87	74	-13.13	PK
		5093.1	30.59	19.39	49.98	54	-4.02	AVG
	@	5240	90.41	18.97	109.38	N/A	N/A	PK
	@	5240	80.52	18.97	99.49	N/A	N/A	AVG
	*	10480	29.98	17.92	47.9	68.2	-20.3	PK
Vertical		5084.7	30.74	19.34	50.08	54	-3.92	AVG
		5104.65	36.89	19.44	56.33	74	-17.67	PK
	@	5240	87.33	18.97	106.3	N/A	N/A	PK
	@	5240	84.49	18.97	103.46	N/A	N/A	AVG
	*	10480	30.28	17.92	48.2	68.2	-20	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

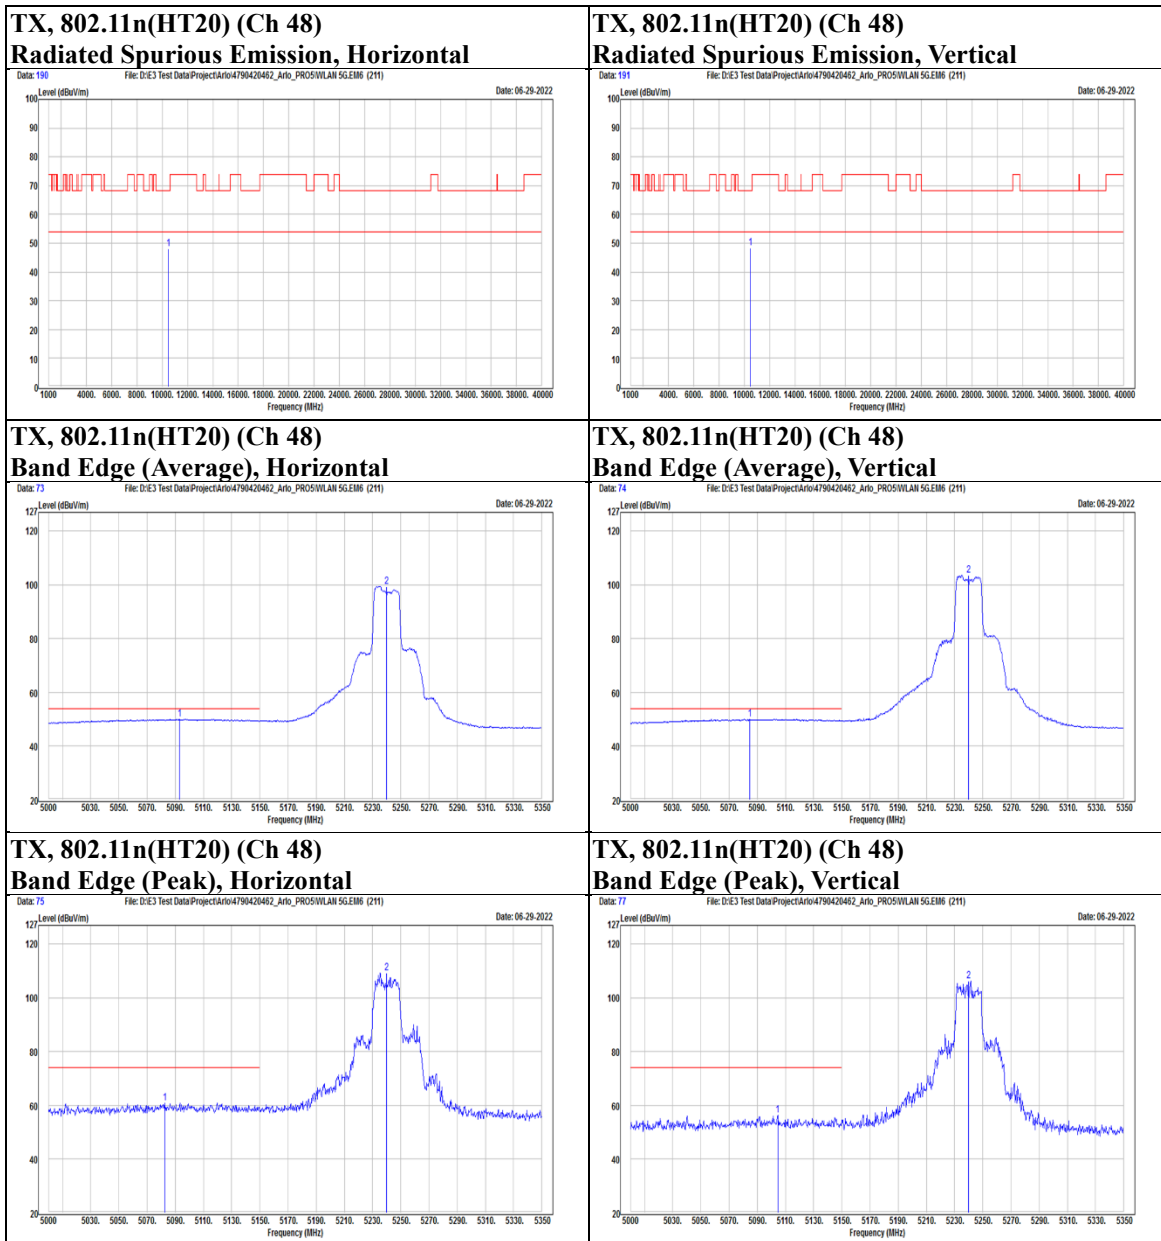



Test report No. : 4790420462-US-R1-V0
Page : 85 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	52
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	87.79	18.88	106.67	N/A	N/A	PK
	@	5260	79.85	18.88	98.73	N/A	N/A	AVG
		5455.8	40.38	19.54	59.92	74	-14.08	PK
		5459.1	28.5	19.57	48.07	54	-5.93	AVG
	*	10520	30	17.99	47.99	68.2	-20.21	PK
Vertical	@	5260	91.06	18.88	109.94	N/A	N/A	PK
	@	5260	84.14	18.88	103.02	N/A	N/A	AVG
		5451.6	39.86	19.53	59.39	74	-14.61	PK
		5451.9	28.53	19.53	48.06	54	-5.94	AVG
	*	10520	30.08	17.99	48.07	68.2	-20.13	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 86 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

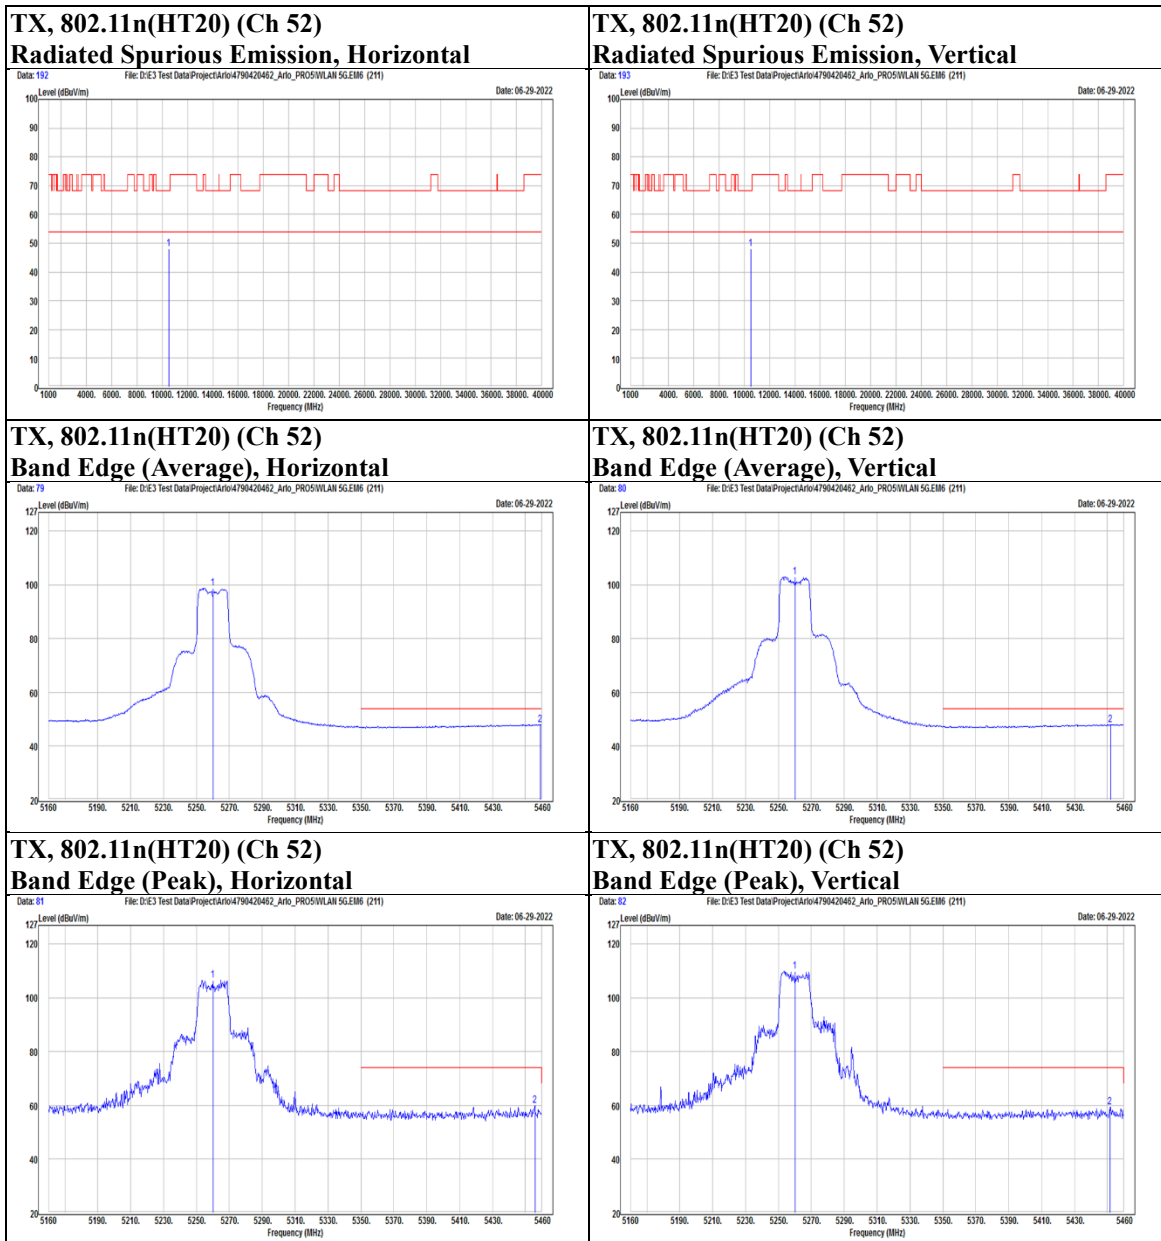

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 87 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	60
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	87.83	18.77	106.6	N/A	N/A	PK
	@	5300	79.37	18.77	98.14	N/A	N/A	AVG
		5350.2	31.23	19.01	50.24	54	-3.76	AVG
		5351.7	41.98	19.02	61	74	-13	PK
	*	10600	30.82	18.04	48.86	68.2	-19.34	PK
Vertical	@	5300	92.29	18.77	111.06	N/A	N/A	PK
	@	5300	83.91	18.77	102.68	N/A	N/A	AVG
		5350.2	33.26	19.01	52.27	54	-1.73	AVG
		5358.9	43.17	19.06	62.23	74	-11.77	PK
	*	10600	30.47	18.04	48.51	68.2	-19.69	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 88 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

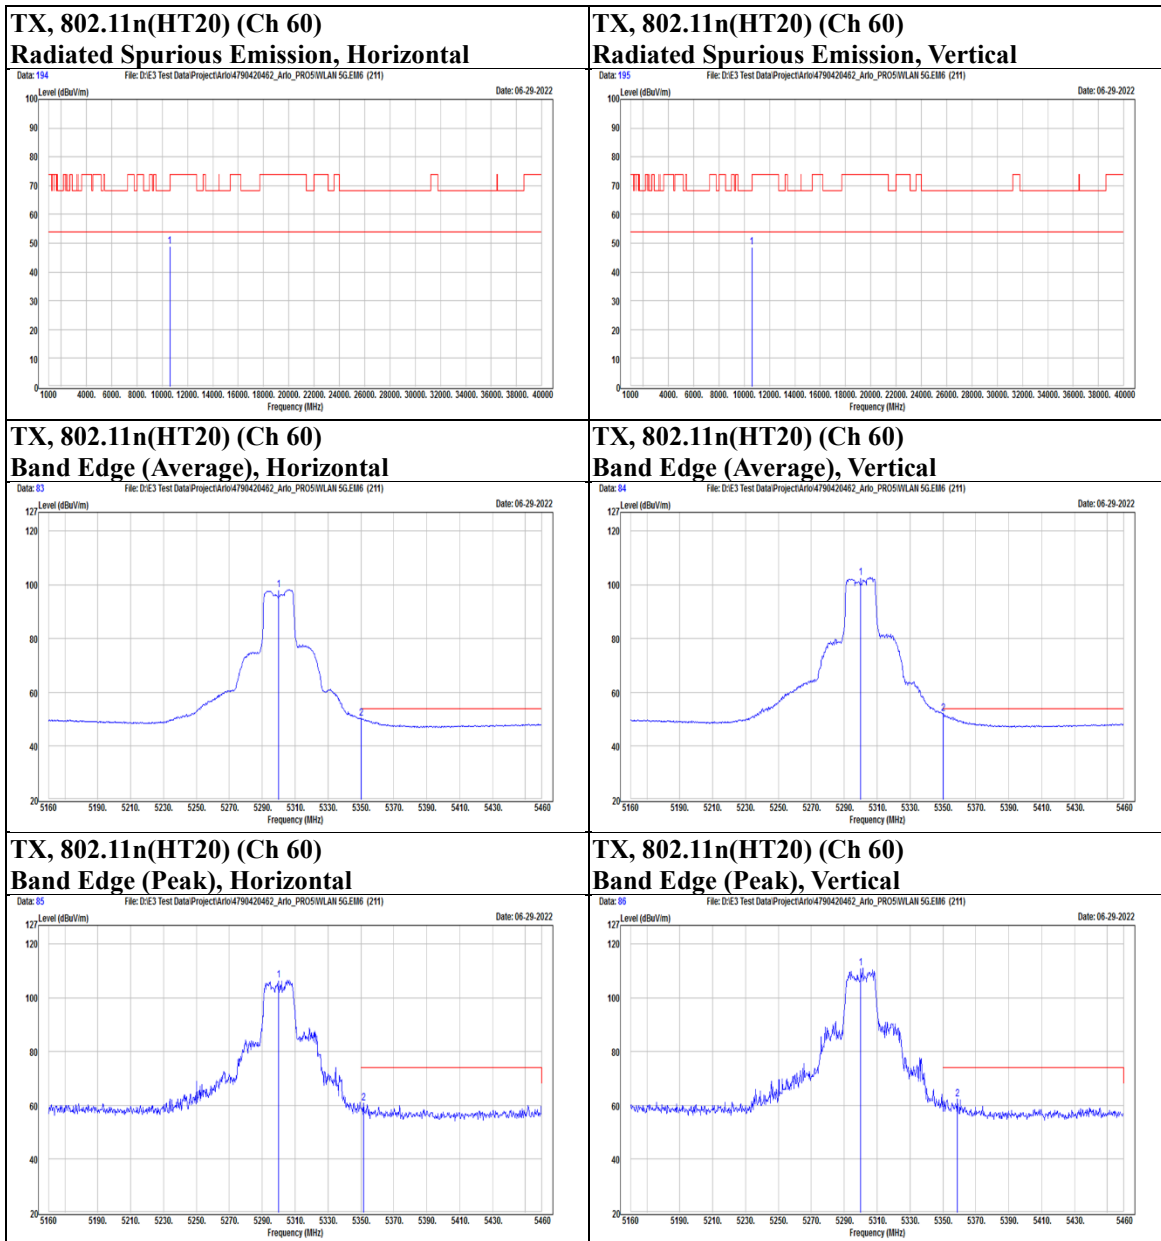

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 89 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	64
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	85.94	18.86	104.8	N/A	N/A	PK
	@	5320	77.64	18.86	96.5	N/A	N/A	AVG
		5351.1	32.03	19.01	51.04	54	-2.96	AVG
		5355.3	48.48	19.04	67.52	74	-6.48	PK
	*	10640	29.58	18.03	47.61	74	-26.39	PK
Vertical	@	5320	89.61	18.86	108.47	N/A	N/A	PK
	@	5320	80.45	18.86	99.31	N/A	N/A	AVG
		5350.5	34.91	19.01	53.92	54	-0.08	AVG
		5353.2	50.87	19.03	69.9	74	-4.1	PK
	*	10640	30.74	18.03	48.77	74	-25.23	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 90 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

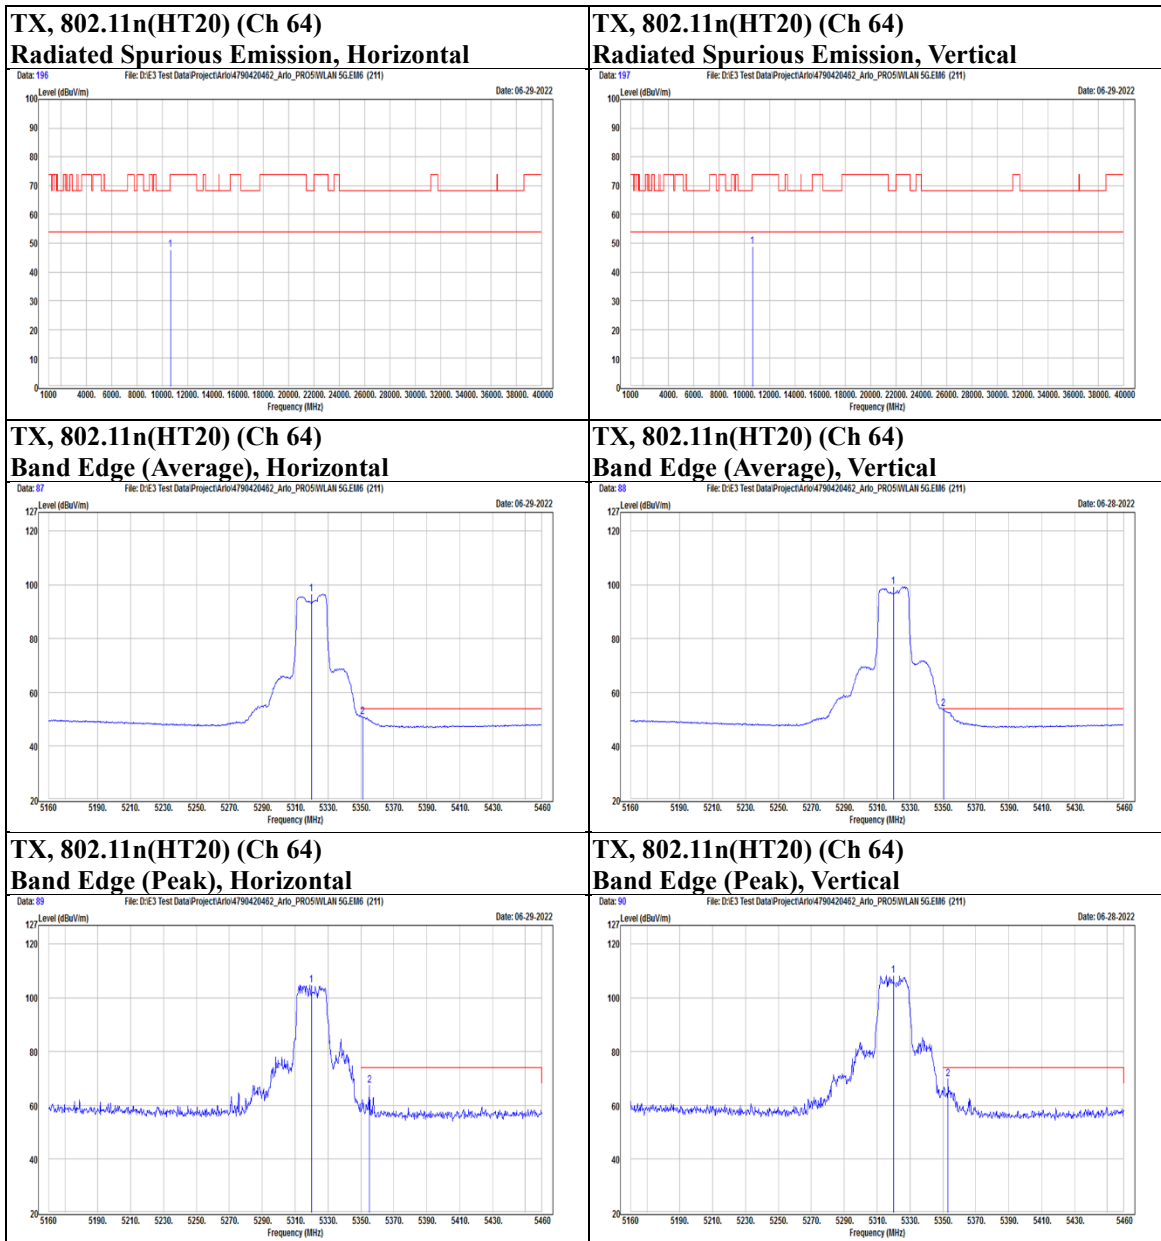

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11n(HT20)	Channel	100
------	---------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dBm)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5412.25	40.21	19.33	59.54	74	-14.46	PK
		5412.25	29.12	19.33	48.45	54	-5.55	AVG
		5463	42.84	19.58	62.42	68.2	-5.78	PK
	@	5500	83.21	19.77	102.98	N/A	N/A	PK
	@	5500	74.57	19.77	94.34	N/A	N/A	AVG
	*	11000	31.02	18.41	49.43	74	-24.57	PK
Vertical		5459.5	41.39	19.57	60.96	74	-13.04	PK
		5459.5	29.94	19.57	49.51	54	-4.49	AVG
		5466.85	48.57	19.61	68.18	68.2	-0.02	PK
	@	5500	87.28	19.77	107.05	N/A	N/A	PK
	@	5500	78.31	19.77	98.08	N/A	N/A	AVG
	*	11000	30.03	18.41	48.44	74	-25.56	PK

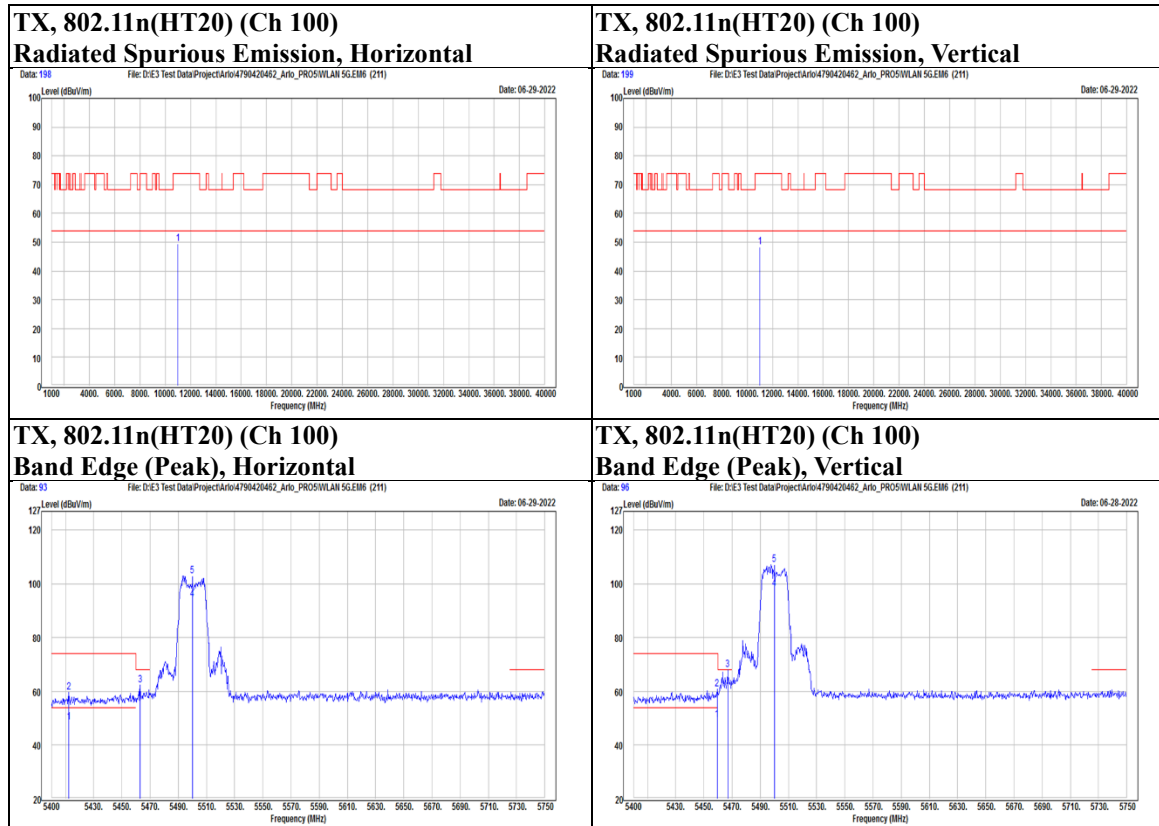

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790420462-US-R1-V0
Page : 92 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	116
------	---------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5440.6	39.27	19.47	58.74	74	-15.26	PK
		5440.6	28.59	19.47	48.06	54	-5.94	AVG
		5467.55	38.86	19.61	58.47	68.2	-9.73	PK
	@	5580	84.88	19.76	104.64	N/A	N/A	PK
	@	5580	77.93	19.76	97.69	N/A	N/A	AVG
		5748.25	40.23	20.19	60.42	68.2	-7.78	PK
	*	11160	30.23	18.47	48.7	74	-25.3	PK
Vertical		5405.25	40.25	19.3	59.55	74	-14.45	PK
		5405.25	28.87	19.3	48.17	54	-5.83	AVG
		5467.55	39.23	19.61	58.84	68.2	-9.36	PK
	@	5580	91.14	19.76	110.9	N/A	N/A	PK
	@	5580	82.74	19.76	102.5	N/A	N/A	AVG
		5736	40.35	20.07	60.42	68.2	-7.78	PK
	*	11160	30.11	18.47	48.58	74	-25.42	PK


TX, 802.11n(HT20) (Ch 116)

Radiated Spurious Emission, Horizontal

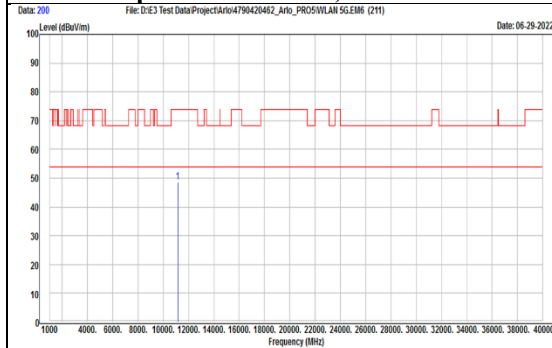


TX, 802.11n(HT20) (Ch 116)

Radiated Spurious Emission, Vertical

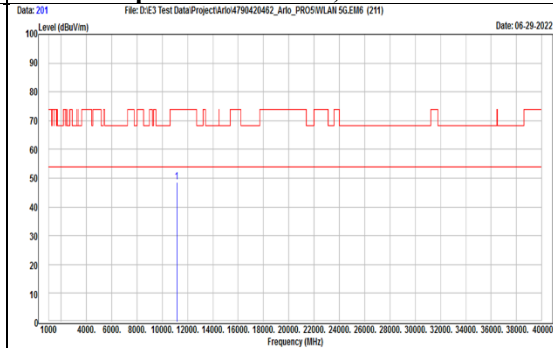


TX, 802.11n(HT20) (Ch 116)

Band Edge (Peak), Horizontal

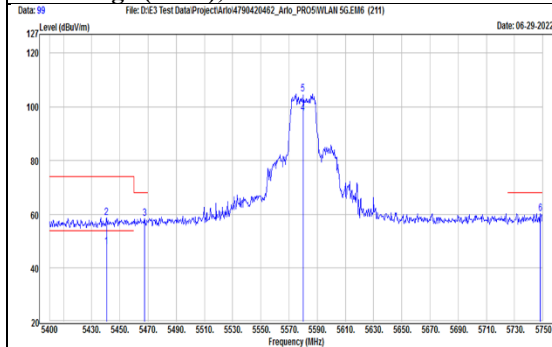

TX, 802.11n(HT20) (Ch 116)

Band Edge (Peak), Vertical

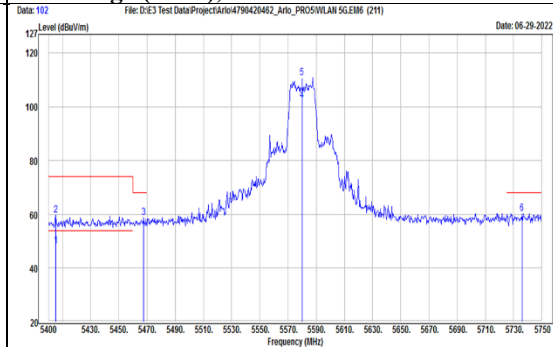

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0