

Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	Burst Length (ms)
NVNT	a	5180	Ant1	97.2	0.12	1.4
NVNT	a	5200	Ant1	97.1	0.13	1.4
NVNT	a	5240	Ant1	96.9	0.14	1.4
NVNT	a	5260	Ant1	97	0.13	1.4
NVNT	a	5280	Ant1	97	0.13	1.39
NVNT	a	5320	Ant1	96.9	0.14	1.4
NVNT	a	5500	Ant1	96.9	0.14	1.39
NVNT	a	5580	Ant1	97.5	0.11	1.39
NVNT	a	5700	Ant1	97	0.13	1.39
NVNT	a	5745	Ant1	97	0.13	1.39
NVNT	a	5785	Ant1	97	0.13	1.4
NVNT	a	5825	Ant1	96.8	0.14	1.39
NVNT	a	5180	Ant2	96.9	0.14	1.39
NVNT	a	5200	Ant2	96.9	0.14	1.39
NVNT	a	5240	Ant2	97	0.13	1.4
NVNT	a	5260	Ant2	97	0.13	1.39
NVNT	a	5280	Ant2	97	0.13	1.39
NVNT	a	5320	Ant2	96.9	0.14	1.39
NVNT	a	5500	Ant2	96.9	0.14	1.39
NVNT	a	5580	Ant2	96.9	0.14	1.4
NVNT	a	5700	Ant2	97.2	0.12	1.39
NVNT	a	5745	Ant2	97.1	0.13	1.39
NVNT	a	5785	Ant2	97	0.13	1.4
NVNT	a	5825	Ant2	96.9	0.14	1.39
NVNT	a	5180	Ant3	96.9	0.14	1.39
NVNT	a	5200	Ant3	96.9	0.14	1.39
NVNT	a	5240	Ant3	97.2	0.12	1.39
NVNT	a	5260	Ant3	96.9	0.14	1.39
NVNT	a	5280	Ant3	97.1	0.13	1.39
NVNT	a	5320	Ant3	96.9	0.14	1.39
NVNT	a	5500	Ant3	96.9	0.14	1.39
NVNT	a	5580	Ant3	96.9	0.14	1.4
NVNT	a	5700	Ant3	96.9	0.14	1.39
NVNT	a	5745	Ant3	96.9	0.14	1.4
NVNT	a	5785	Ant3	96.9	0.14	1.39
NVNT	a	5825	Ant3	96.9	0.14	1.4
NVNT	ac160	5250	Sum	68.23	1.66	0.1
NVNT	ac160	5570	Sum	70.43	1.52	0.1
NVNT	ac20	5180	Sum	91.71	0.38	0.47
NVNT	ac20	5200	Sum	91.81	0.37	0.48

NVNT	ac20	5240	Sum	91.71	0.38	0.48
NVNT	ac20	5260	Sum	91.41	0.39	0.48
NVNT	ac20	5280	Sum	91.91	0.37	0.47
NVNT	ac20	5320	Sum	92.11	0.36	0.48
NVNT	ac20	5500	Sum	91.81	0.37	0.48
NVNT	ac20	5580	Sum	91.81	0.37	0.47
NVNT	ac20	5700	Sum	92.21	0.35	0.48
NVNT	ac20	5745	Sum	92.01	0.36	0.48
NVNT	ac20	5785	Sum	92.01	0.36	0.47
NVNT	ac20	5825	Sum	91.91	0.37	0.48
NVNT	ac40	5190	Sum	86.21	0.64	0.26
NVNT	ac40	5230	Sum	86.31	0.64	0.26
NVNT	ac40	5270	Sum	86.01	0.65	0.25
NVNT	ac40	5310	Sum	86.21	0.64	0.26
NVNT	ac40	5510	Sum	86.11	0.65	0.26
NVNT	ac40	5550	Sum	86.21	0.64	0.26
NVNT	ac40	5670	Sum	86.21	0.64	0.26
NVNT	ac40	5755	Sum	86.01	0.65	0.25
NVNT	ac40	5795	Sum	86.01	0.65	0.25
NVNT	ac80	5210	Sum	78.82	1.03	0.15
NVNT	ac80	5290	Sum	78.82	1.03	0.15
NVNT	ac80	5530	Sum	78.62	1.04	0.15
NVNT	ac80	5610	Sum	78.62	1.04	0.15
NVNT	ac80	5775	Sum	79.02	1.02	0.15
NVNT	ax160	5250	Sum	90.61	0.43	0.42
NVNT	ax160	5570	Sum	90.81	0.42	0.42
NVNT	ax20	5180	Sum	91.21	0.4	0.42
NVNT	ax20	5200	Sum	91.61	0.38	0.43
NVNT	ax20	5240	Sum	91.11	0.4	0.42
NVNT	ax20	5260	Sum	91.41	0.39	0.43
NVNT	ax20	5280	Sum	91.71	0.38	0.42
NVNT	ax20	5320	Sum	91.61	0.38	0.43
NVNT	ax20	5500	Sum	91.11	0.4	0.43
NVNT	ax20	5580	Sum	91.61	0.38	0.43
NVNT	ax20	5700	Sum	91.11	0.4	0.42
NVNT	ax20	5745	Sum	91.61	0.38	0.43
NVNT	ax20	5785	Sum	91.61	0.38	0.42
NVNT	ax20	5825	Sum	91.11	0.4	0.42
NVNT	ax40	5190	Sum	91.11	0.4	0.43
NVNT	ax40	5230	Sum	91.51	0.39	0.44
NVNT	ax40	5270	Sum	90.91	0.41	0.43
NVNT	ax40	5310	Sum	91.01	0.41	0.43
NVNT	ax40	5510	Sum	78.82	1.03	0.43
NVNT	ax40	5550	Sum	91.51	0.39	0.43

NVNT	ax40	5670	Sum	91.41	0.39	0.43
NVNT	ax40	5755	Sum	91.41	0.39	0.43
NVNT	ax40	5795	Sum	91.01	0.41	0.44
NVNT	ax80	5210	Sum	90.91	0.41	0.42
NVNT	ax80	5290	Sum	89.41	0.49	0.42
NVNT	ax80	5530	Sum	89.31	0.49	0.41
NVNT	ax80	5610	Sum	89.51	0.48	0.42
NVNT	ax80	5775	Sum	89.51	0.48	0.41
NVNT	be160	5250	Sum	90.91	0.41	0.43
NVNT	be160	5570	Sum	91.01	0.41	0.42
NVNT	be20	5180	Sum	91.81	0.37	0.44
NVNT	be20	5200	Sum	91.41	0.39	0.43
NVNT	be20	5240	Sum	91.41	0.39	0.43
NVNT	be20	5260	Sum	91.31	0.39	0.43
NVNT	be20	5280	Sum	91.31	0.39	0.43
NVNT	be20	5320	Sum	91.51	0.39	0.43
NVNT	be20	5500	Sum	91.51	0.39	0.43
NVNT	be20	5580	Sum	91.81	0.37	0.44
NVNT	be20	5700	Sum	91.61	0.38	0.43
NVNT	be20	5745	Sum	91.91	0.37	0.43
NVNT	be20	5785	Sum	91.71	0.38	0.43
NVNT	be20	5825	Sum	91.91	0.37	0.44
NVNT	be40	5190	Sum	91.31	0.39	0.44
NVNT	be40	5230	Sum	91.11	0.4	0.44
NVNT	be40	5270	Sum	91.51	0.39	0.44
NVNT	be40	5310	Sum	91.51	0.39	0.44
NVNT	be40	5510	Sum	91.31	0.39	0.44
NVNT	be40	5550	Sum	91.01	0.41	0.44
NVNT	be40	5670	Sum	91.51	0.39	0.44
NVNT	be40	5755	Sum	91.51	0.39	0.44
NVNT	be40	5795	Sum	91.51	0.39	0.44
NVNT	be80	5210	Sum	90.81	0.42	0.42
NVNT	be80	5290	Sum	91.01	0.41	0.43
NVNT	be80	5530	Sum	90.81	0.42	0.43
NVNT	be80	5610	Sum	90.51	0.43	0.42
NVNT	be80	5775	Sum	90.61	0.43	0.42
NVNT	n20	5180	Sum	91.81	0.37	0.47
NVNT	n20	5200	Sum	91.91	0.37	0.48
NVNT	n20	5240	Sum	91.71	0.38	0.47
NVNT	n20	5260	Sum	91.61	0.38	0.47
NVNT	n20	5280	Sum	91.61	0.38	0.48
NVNT	n20	5320	Sum	91.61	0.38	0.47
NVNT	n20	5500	Sum	91.71	0.38	0.47
NVNT	n20	5580	Sum	91.81	0.37	0.47

NVNT	n20	5700	Sum	91.61	0.38	0.47
NVNT	n20	5745	Sum	91.81	0.37	0.47
NVNT	n20	5785	Sum	91.81	0.37	0.48
NVNT	n20	5825	Sum	91.71	0.38	0.47
NVNT	n40	5190	Sum	86.41	0.63	0.26
NVNT	n40	5230	Sum	86.21	0.64	0.26
NVNT	n40	5270	Sum	86.01	0.65	0.25
NVNT	n40	5310	Sum	86.01	0.65	0.25
NVNT	n40	5510	Sum	86.11	0.65	0.26
NVNT	n40	5550	Sum	86.11	0.65	0.25
NVNT	n40	5670	Sum	85.71	0.67	0.26
NVNT	n40	5755	Sum	86.01	0.65	0.26
NVNT	n40	5795	Sum	86.21	0.64	0.25

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	Burst Length (ms)
NVNT	ax20 26RU Index 4	5180	Sum	93.01	0.31	0.56
NVNT	ax20 26RU Index 4	5200	Sum	93.01	0.31	0.55
NVNT	ax20 26RU Index 4	5240	Sum	93.21	0.31	0.55
NVNT	ax20 26RU Index 4	5260	Sum	92.41	0.34	0.55
NVNT	ax20 26RU Index 4	5280	Sum	92.91	0.32	0.55
NVNT	ax20 26RU Index 4	5320	Sum	92.51	0.34	0.56
NVNT	ax20 26RU Index 4	5500	Sum	93.01	0.31	0.55
NVNT	ax20 26RU Index 4	5580	Sum	93.01	0.31	0.56
NVNT	ax20 26RU Index 4	5700	Sum	93.01	0.31	0.56
NVNT	ax20 26RU Index 4	5745	Sum	92.81	0.32	0.55
NVNT	ax20 26RU Index 4	5785	Sum	93.11	0.31	0.56
NVNT	ax20 26RU Index 4	5825	Sum	92.81	0.32	0.56
NVNT	be20 52+26RU Index 38+1	5180	Sum	94.11	0.26	0.7
NVNT	be20 52+26RU Index 38+1	5200	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+1	5240	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+1	5260	Sum	93.61	0.29	0.69
NVNT	be20 52+26RU Index 38+1	5280	Sum	94.01	0.27	0.69
NVNT	be20 52+26RU Index 38+1	5320	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+1	5500	Sum	94.31	0.25	0.69
NVNT	be20 52+26RU Index 38+1	5580	Sum	94.11	0.26	0.7
NVNT	be20 52+26RU Index 38+1	5700	Sum	93.61	0.29	0.69
NVNT	be20 52+26RU Index 38+1	5745	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+1	5785	Sum	93.81	0.28	0.69
NVNT	be20 52+26RU Index 38+1	5825	Sum	93.71	0.28	0.69
NVNT	be20 52+26RU Index 38+4	5180	Sum	94.01	0.27	0.69
NVNT	be20 52+26RU Index 38+4	5200	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+4	5240	Sum	93.61	0.29	0.69
NVNT	be20 52+26RU Index 38+4	5260	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+4	5280	Sum	94.11	0.26	0.69

NVNT	be20 52+26RU Index 38+4	5320	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 38+4	5500	Sum	93.41	0.3	0.69
NVNT	be20 52+26RU Index 38+4	5580	Sum	93.51	0.29	0.7
NVNT	be20 52+26RU Index 38+4	5700	Sum	93.71	0.28	0.69
NVNT	be20 52+26RU Index 38+4	5745	Sum	93.61	0.29	0.69
NVNT	be20 52+26RU Index 38+4	5785	Sum	94.21	0.26	0.69
NVNT	be20 52+26RU Index 38+4	5825	Sum	93.61	0.29	0.69
NVNT	be20 52+26RU Index 39+7	5180	Sum	94.21	0.26	0.7
NVNT	be20 52+26RU Index 39+7	5200	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 39+7	5240	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 39+7	5260	Sum	93.61	0.29	0.7
NVNT	be20 52+26RU Index 39+7	5280	Sum	93.71	0.28	0.7
NVNT	be20 52+26RU Index 39+7	5320	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 39+7	5500	Sum	94.11	0.26	0.69
NVNT	be20 52+26RU Index 39+7	5580	Sum	89.11	0.5	0.69
NVNT	be20 52+26RU Index 39+7	5700	Sum	94.01	0.27	0.69
NVNT	be20 52+26RU Index 39+7	5745	Sum	94.01	0.27	0.69
NVNT	be20 52+26RU Index 39+7	5785	Sum	94.31	0.25	0.69
NVNT	be20 52+26RU Index 39+7	5825	Sum	94.11	0.26	0.69
NVNT	be20 106+26RU Index 53+4	5180	Sum	94.11	0.26	0.68
NVNT	be20 106+26RU Index 53+4	5200	Sum	93.81	0.28	0.68
NVNT	be20 106+26RU Index 53+4	5240	Sum	93.81	0.28	0.68
NVNT	be20 106+26RU Index 53+4	5260	Sum	94.01	0.27	0.68
NVNT	be20 106+26RU Index 53+4	5280	Sum	93.61	0.29	0.69
NVNT	be20 106+26RU Index 53+4	5320	Sum	93.61	0.29	0.69
NVNT	be20 106+26RU Index 53+4	5500	Sum	93.61	0.29	0.68
NVNT	be20 106+26RU Index 53+4	5580	Sum	93.71	0.28	0.69
NVNT	be20 106+26RU Index 53+4	5700	Sum	93.71	0.28	0.68
NVNT	be20 106+26RU Index 53+4	5745	Sum	94.01	0.27	0.69
NVNT	be20 106+26RU Index 53+4	5785	Sum	94.31	0.25	0.69
NVNT	be20 106+26RU Index 53+4	5825	Sum	93.61	0.29	0.69
NVNT	be20 106+26RU Index 54+4	5180	Sum	93.81	0.28	0.68
NVNT	be20 106+26RU Index 54+4	5200	Sum	93.71	0.28	0.67
NVNT	be20 106+26RU Index 54+4	5240	Sum	93.91	0.27	0.68
NVNT	be20 106+26RU Index 54+4	5260	Sum	93.71	0.28	0.67
NVNT	be20 106+26RU Index 54+4	5280	Sum	94.11	0.26	0.67
NVNT	be20 106+26RU Index 54+4	5320	Sum	93.31	0.3	0.67
NVNT	be20 106+26RU Index 54+4	5500	Sum	94.21	0.26	0.67
NVNT	be20 106+26RU Index 54+4	5580	Sum	93.71	0.28	0.67
NVNT	be20 106+26RU Index 54+4	5700	Sum	93.71	0.28	0.68
NVNT	be20 106+26RU Index 54+4	5745	Sum	93.71	0.28	0.67
NVNT	be20 106+26RU Index 54+4	5785	Sum	93.61	0.29	0.67
NVNT	be20 106+26RU Index 54+4	5825	Sum	93.91	0.27	0.67
NVNT	be40 106+26RU Index 55+13	5190	Sum	93.71	0.28	0.68


NVNT	be40 106+26RU Index 55+13	5230	Sum	93.71	0.28	0.67
NVNT	be40 106+26RU Index 55+13	5270	Sum	93.31	0.3	0.67
NVNT	be40 106+26RU Index 55+13	5310	Sum	94.01	0.27	0.67
NVNT	be40 106+26RU Index 55+13	5510	Sum	94.11	0.26	0.68
NVNT	be40 106+26RU Index 55+13	5550	Sum	93.81	0.28	0.67
NVNT	be40 106+26RU Index 55+13	5670	Sum	94.11	0.26	0.68
NVNT	be40 106+26RU Index 55+13	5755	Sum	94.31	0.25	0.68
NVNT	be40 106+26RU Index 55+13	5795	Sum	93.81	0.28	0.67
NVNT	be40 106+26RU Index 56+13	5190	Sum	93.51	0.29	0.68
NVNT	be40 106+26RU Index 56+13	5230	Sum	93.31	0.3	0.67
NVNT	be40 106+26RU Index 56+13	5270	Sum	93.51	0.29	0.67
NVNT	be40 106+26RU Index 56+13	5310	Sum	93.61	0.29	0.68
NVNT	be40 106+26RU Index 56+13	5510	Sum	93.81	0.28	0.67
NVNT	be40 106+26RU Index 56+13	5550	Sum	93.71	0.28	0.67
NVNT	be40 106+26RU Index 56+13	5670	Sum	93.61	0.29	0.67
NVNT	be40 106+26RU Index 56+13	5755	Sum	93.71	0.28	0.67
NVNT	be40 106+26RU Index 56+13	5795	Sum	93.31	0.3	0.67

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	Burst Length (ms)
NVNT	be80 484+242-tone MRU4	5210	Sum	90.61	0.43	0.41
NVNT	be80 484+242-tone MRU4	5290	Sum	91.11	0.4	0.41
NVNT	be80 484+242-tone MRU4	5530	Sum	90.81	0.42	0.4
NVNT	be80 484+242-tone MRU4	5610	Sum	90.51	0.43	0.41
NVNT	be80 484+242-tone MRU4	5775	Sum	90.71	0.42	0.41
NVNT	be80 484+242-tone MRU3	5210	Sum	90.61	0.43	0.41
NVNT	be80 484+242-tone MRU3	5290	Sum	90.51	0.43	0.41
NVNT	be80 484+242-tone MRU3	5530	Sum	90.51	0.43	0.4
NVNT	be80 484+242-tone MRU3	5610	Sum	90.71	0.42	0.41
NVNT	be80 484+242-tone MRU3	5775	Sum	90.81	0.42	0.4
NVNT	be80 484+242-tone MRU2	5210	Sum	91.11	0.4	0.4
NVNT	be80 484+242-tone MRU2	5290	Sum	90.61	0.43	0.41
NVNT	be80 484+242-tone MRU2	5530	Sum	90.61	0.43	0.41
NVNT	be80 484+242-tone MRU2	5610	Sum	91.01	0.41	0.4
NVNT	be80 484+242-tone MRU2	5775	Sum	90.71	0.42	0.4
NVNT	be80 484+242-tone MRU1	5210	Sum	90.51	0.43	0.4
NVNT	be80 484+242-tone MRU1	5290	Sum	91.01	0.41	0.41
NVNT	be80 484+242-tone MRU1	5530	Sum	90.71	0.42	0.41
NVNT	be80 484+242-tone MRU1	5610	Sum	90.81	0.42	0.41
NVNT	be80 484+242-tone MRU1	5775	Sum	90.61	0.43	0.4
NVNT	be160 996+484+242-tone MRU1	5250	Sum	90.31	0.44	0.4
NVNT	be160 996+484+242-tone MRU1	5570	Sum	90.51	0.43	0.4
NVNT	be160 996+484+242-tone MRU2	5250	Sum	90.11	0.45	0.4
NVNT	be160 996+484+242-tone MRU2	5570	Sum	90.11	0.45	0.4
NVNT	be160 996+484+242-tone MRU3	5250	Sum	90.41	0.44	0.4


NVNT	be160 996+484+242-tone MRU3	5570	Sum	90.21	0.45	0.4
NVNT	be160 996+484+242-tone MRU4	5250	Sum	90.21	0.45	0.4
NVNT	be160 996+484+242-tone MRU4	5570	Sum	90.61	0.43	0.4
NVNT	be160 996+484+242-tone MRU5	5250	Sum	90.61	0.43	0.4
NVNT	be160 996+484+242-tone MRU5	5570	Sum	90.21	0.45	0.4
NVNT	be160 996+484+242-tone MRU6	5250	Sum	90.21	0.45	0.4
NVNT	be160 996+484+242-tone MRU6	5570	Sum	90.71	0.42	0.4
NVNT	be160 996+484+242-tone MRU7	5250	Sum	90.41	0.44	0.39
NVNT	be160 996+484+242-tone MRU7	5570	Sum	90.71	0.42	0.39
NVNT	be160 996+484+242-tone MRU8	5250	Sum	90.71	0.42	0.4
NVNT	be160 996+484+242-tone MRU8	5570	Sum	90.81	0.42	0.4
NVNT	be160 996+484-tone MRU1	5250	Sum	90.51	0.43	0.4
NVNT	be160 996+484-tone MRU1	5570	Sum	90.71	0.42	0.4
NVNT	be160 996+484-tone MRU2	5250	Sum	90.61	0.43	0.4
NVNT	be160 996+484-tone MRU2	5570	Sum	90.41	0.44	0.4
NVNT	be160 996+484-tone MRU3	5250	Sum	90.01	0.46	0.4
NVNT	be160 996+484-tone MRU3	5570	Sum	90.01	0.46	0.4
NVNT	be160 996+484-tone MRU4	5250	Sum	89.91	0.46	0.39
NVNT	be160 996+484-tone MRU4	5570	Sum	90.71	0.42	0.4

Test Graphs


Duty Cycle NVNT a 5180MHz Ant1

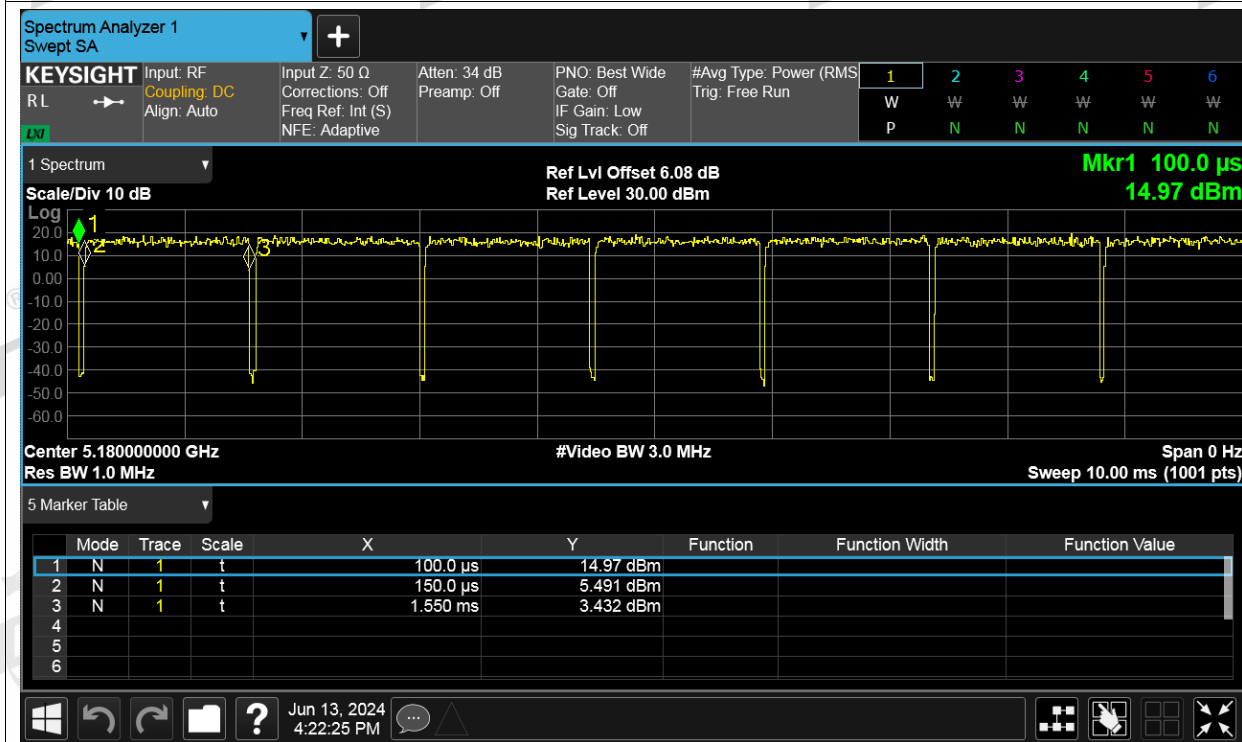


Duty Cycle NVNT a 5200MHz Ant1

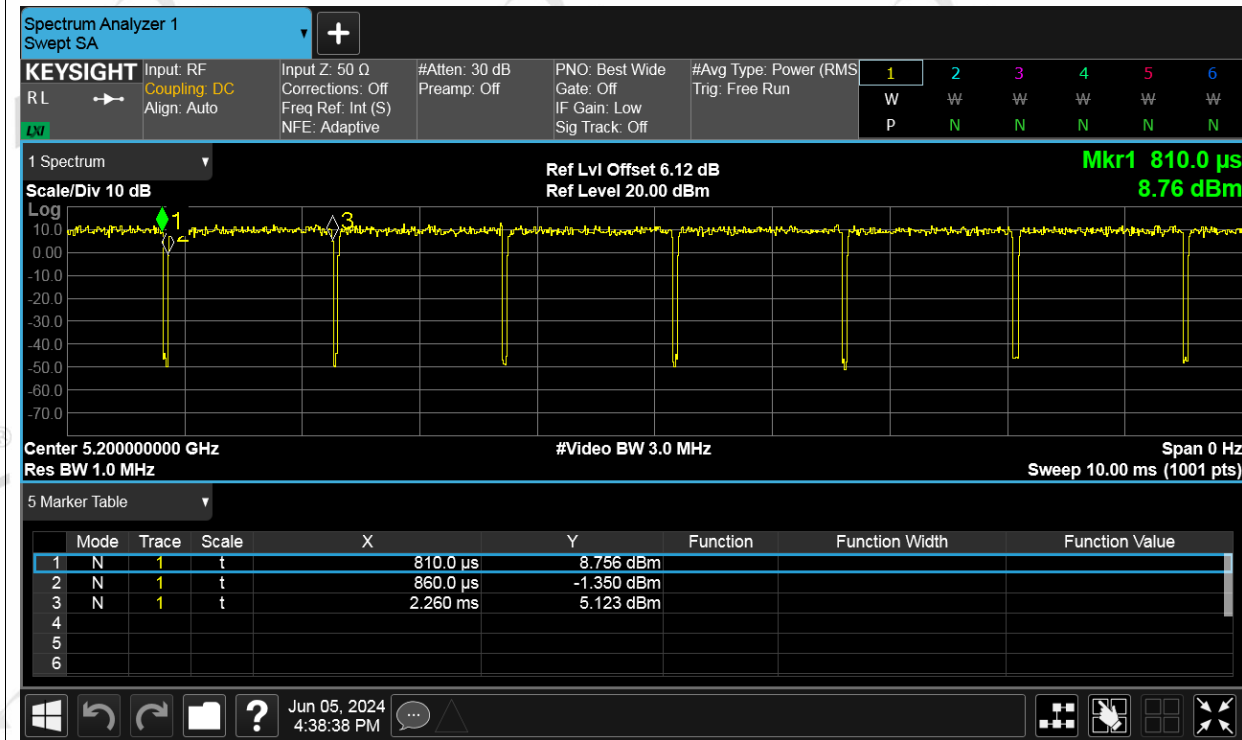


Duty Cycle NVNT a 5240MHz Ant1

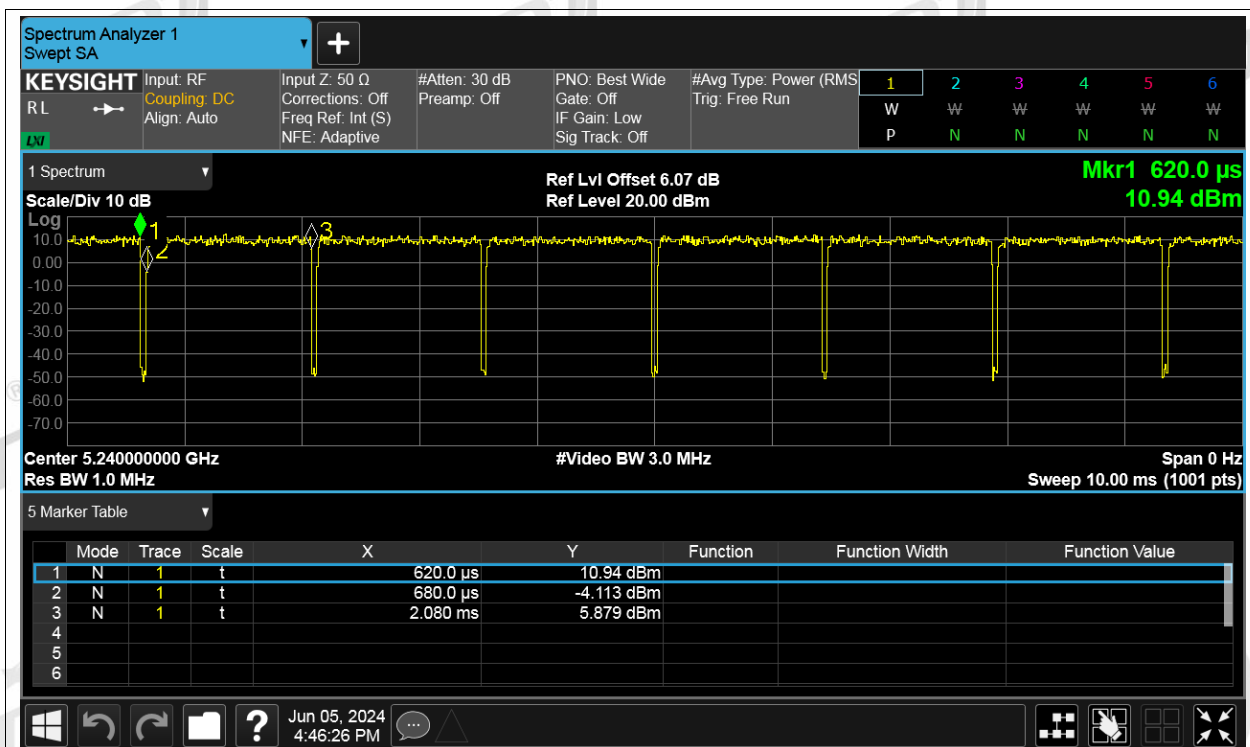


Duty Cycle NVNT a 5260MHz Ant1

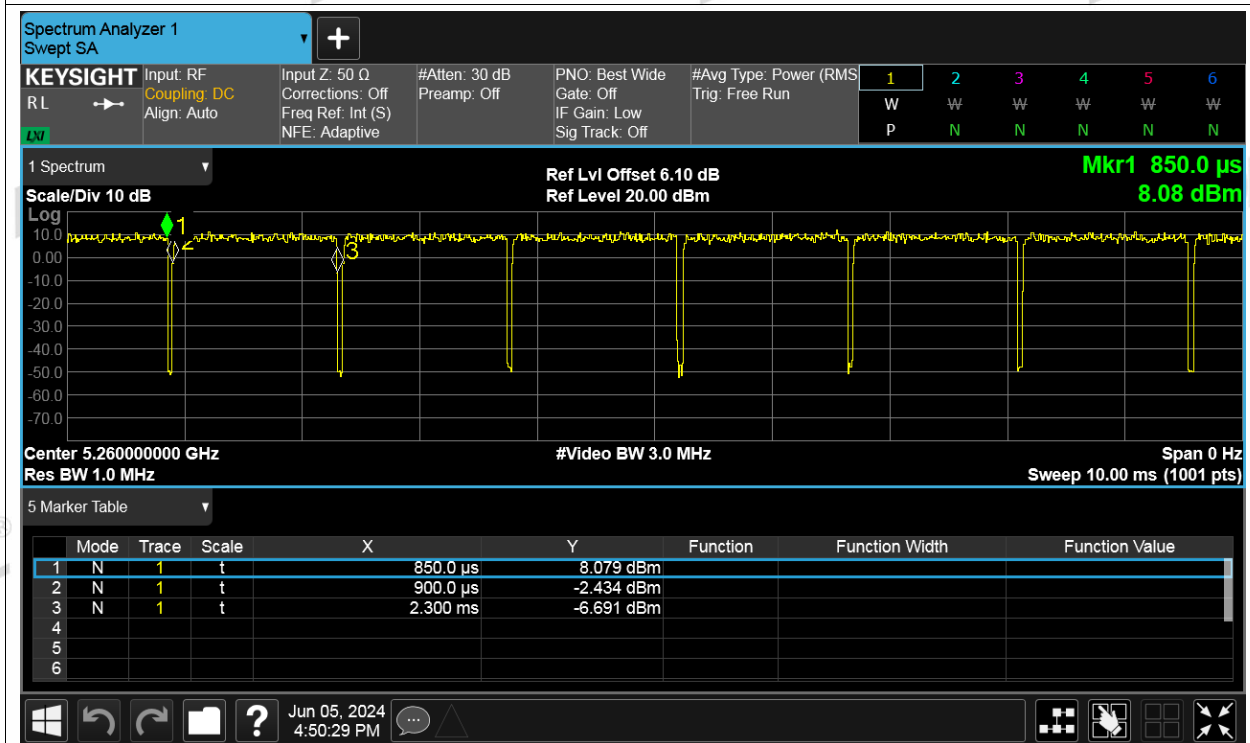


Duty Cycle NVNT a 5280MHz Ant1

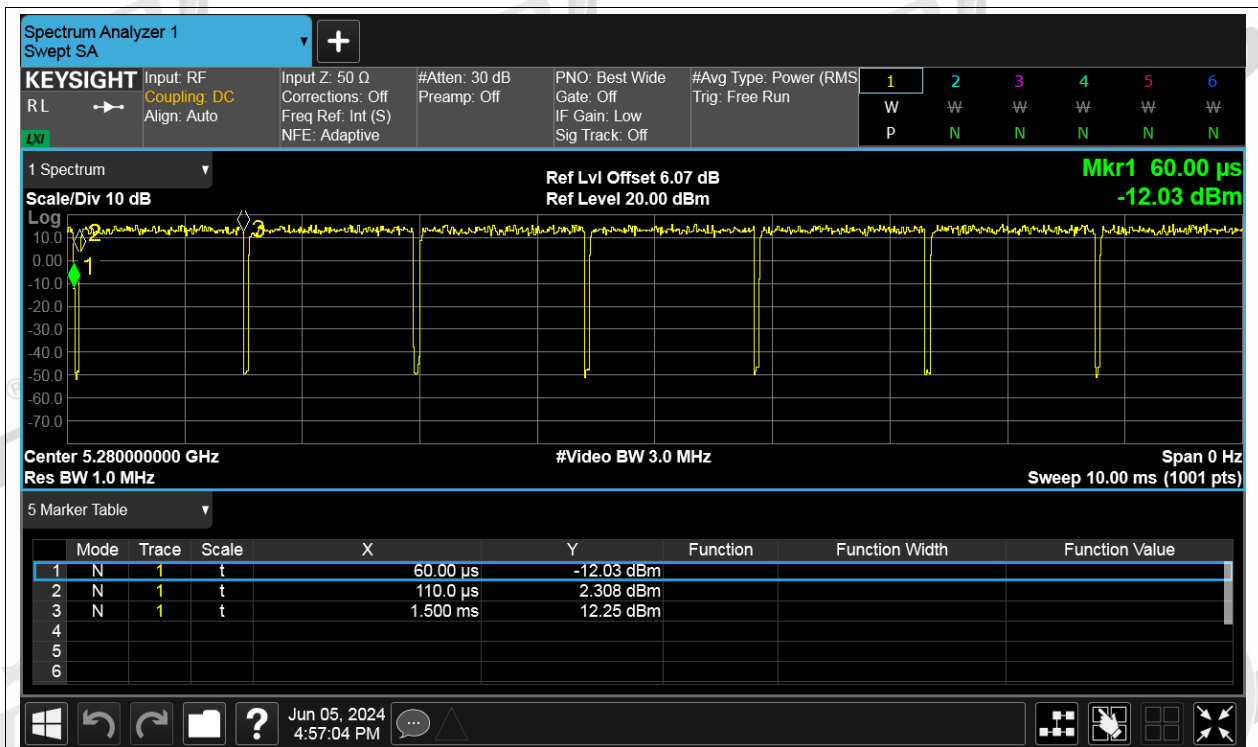


Duty Cycle NVNT a 5320MHz Ant1

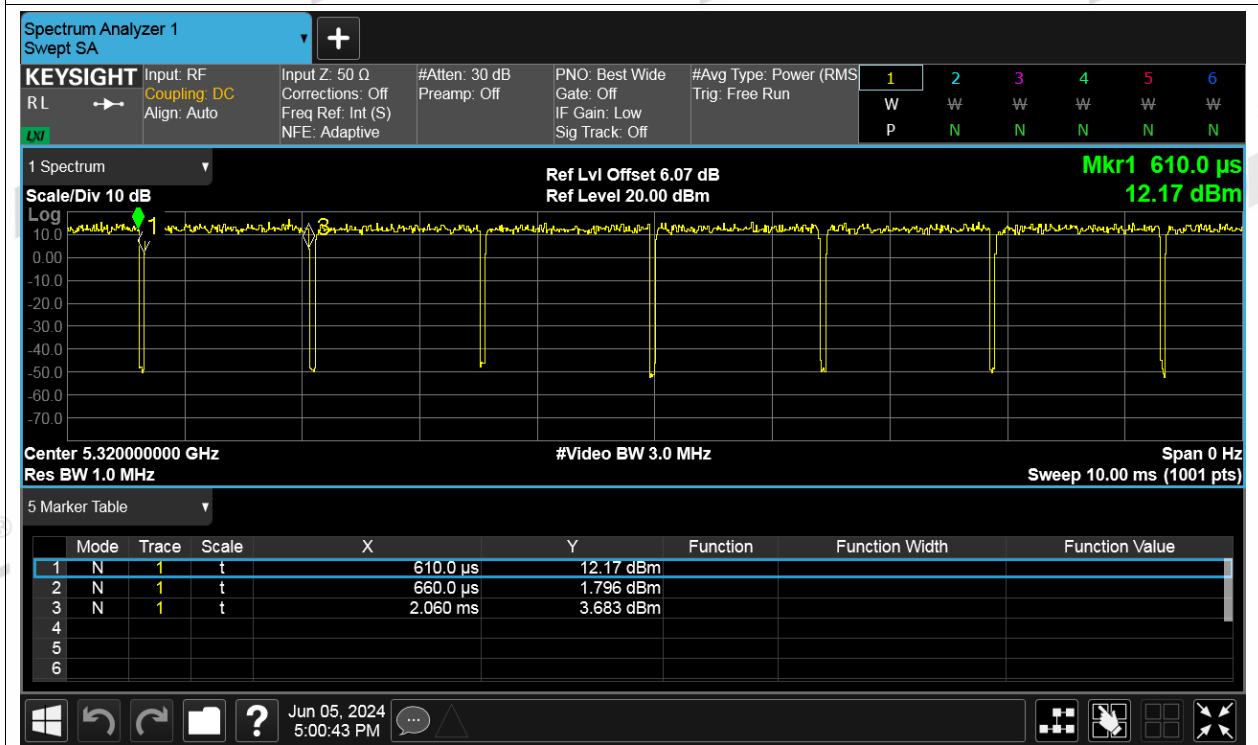


Duty Cycle NVNT a 5500MHz Ant1

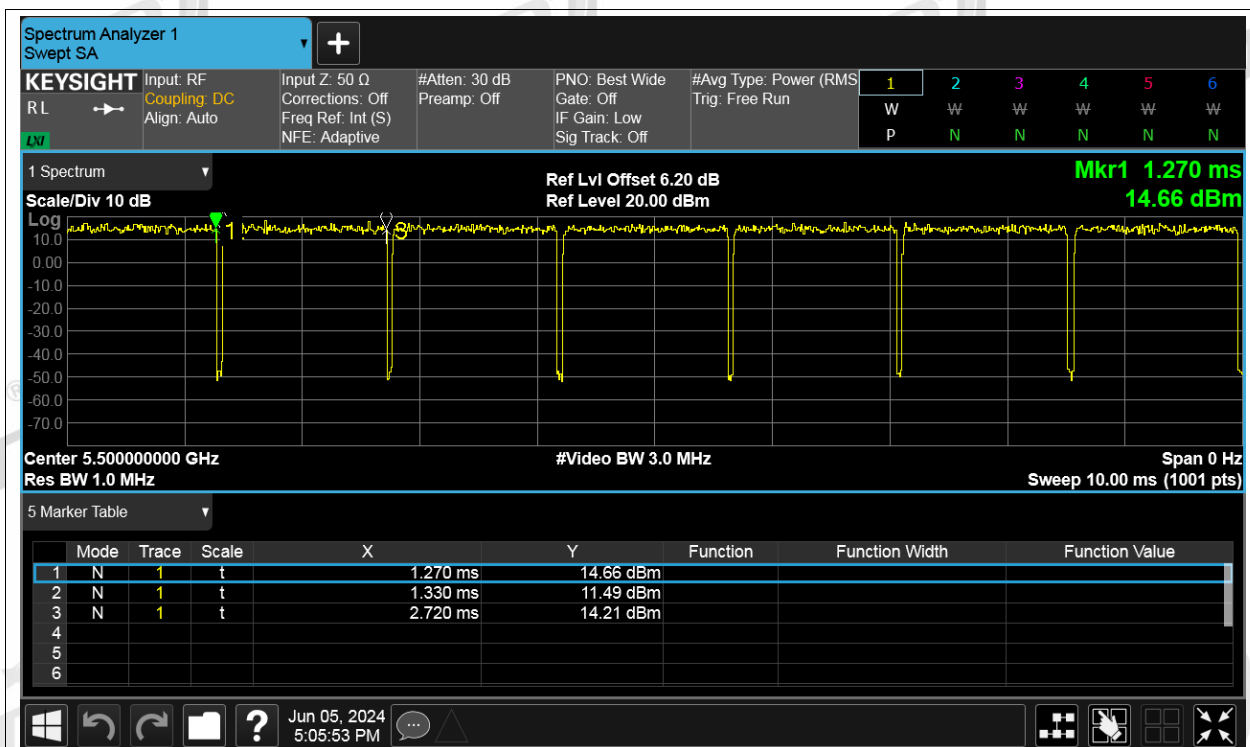


Duty Cycle NVNT a 5580MHz Ant1

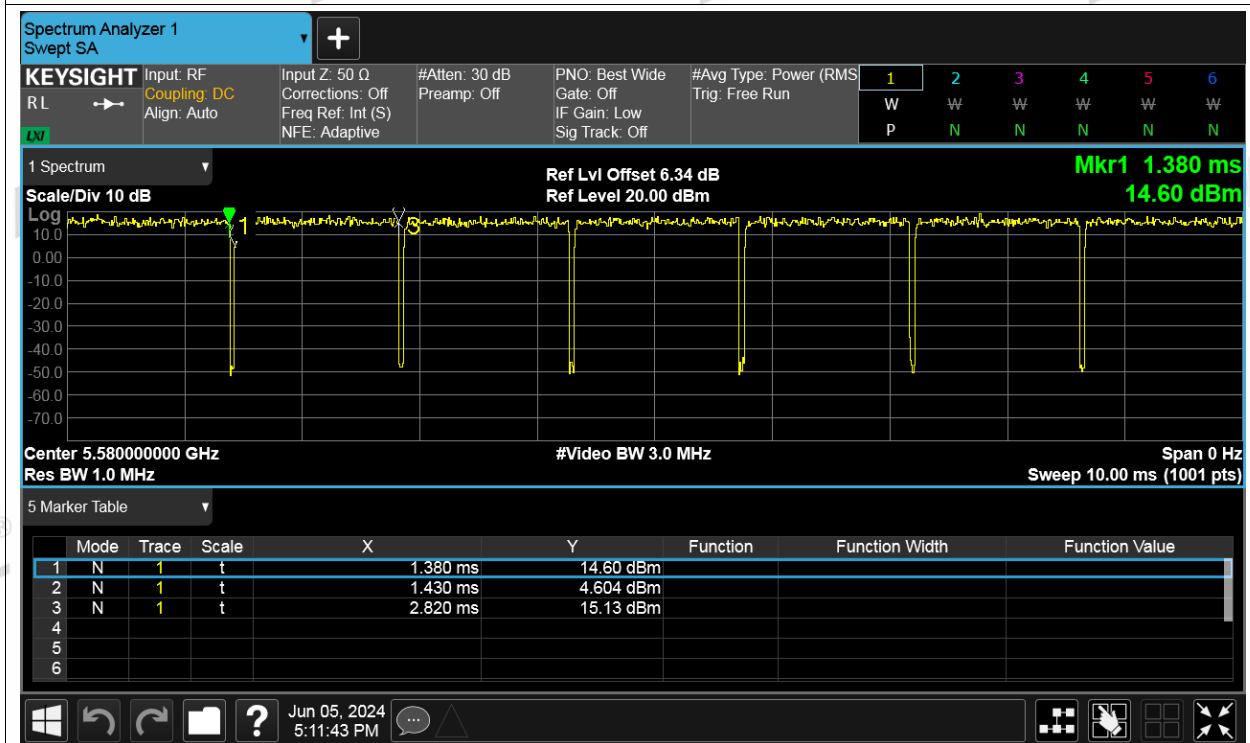


Duty Cycle NVNT a 5700MHz Ant1

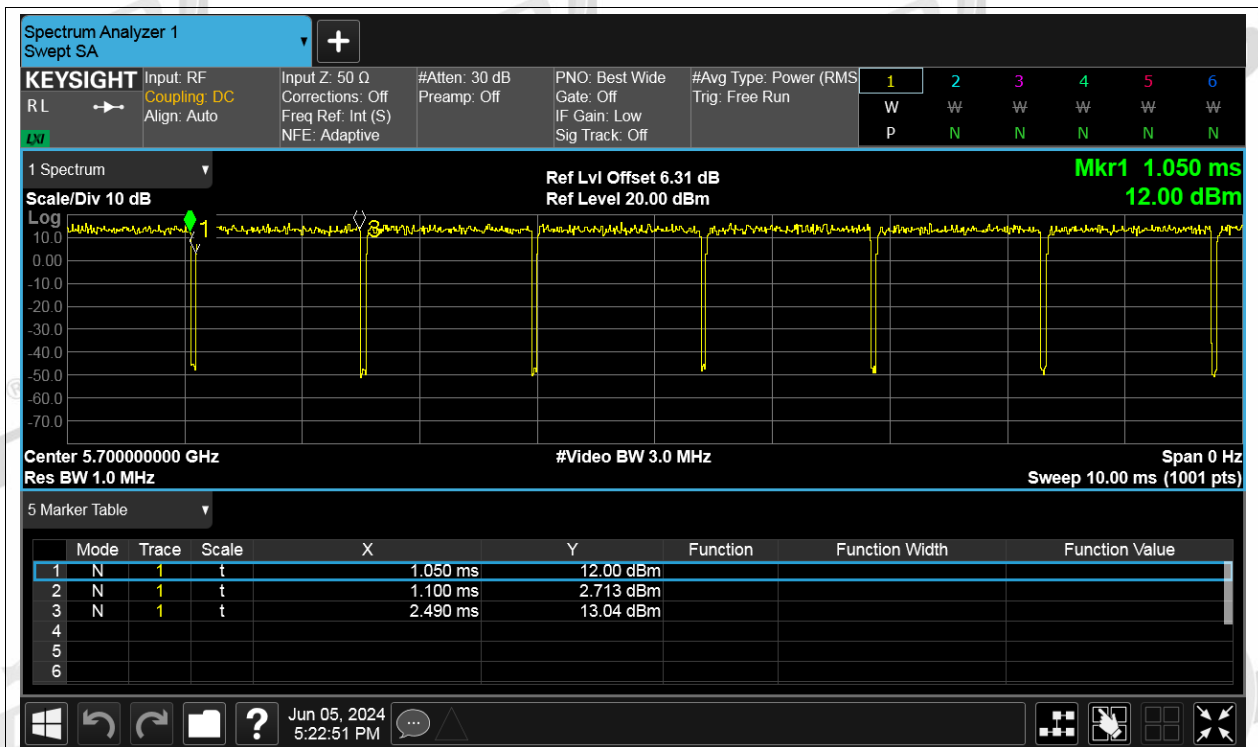


Duty Cycle NVNT a 5745MHz Ant1

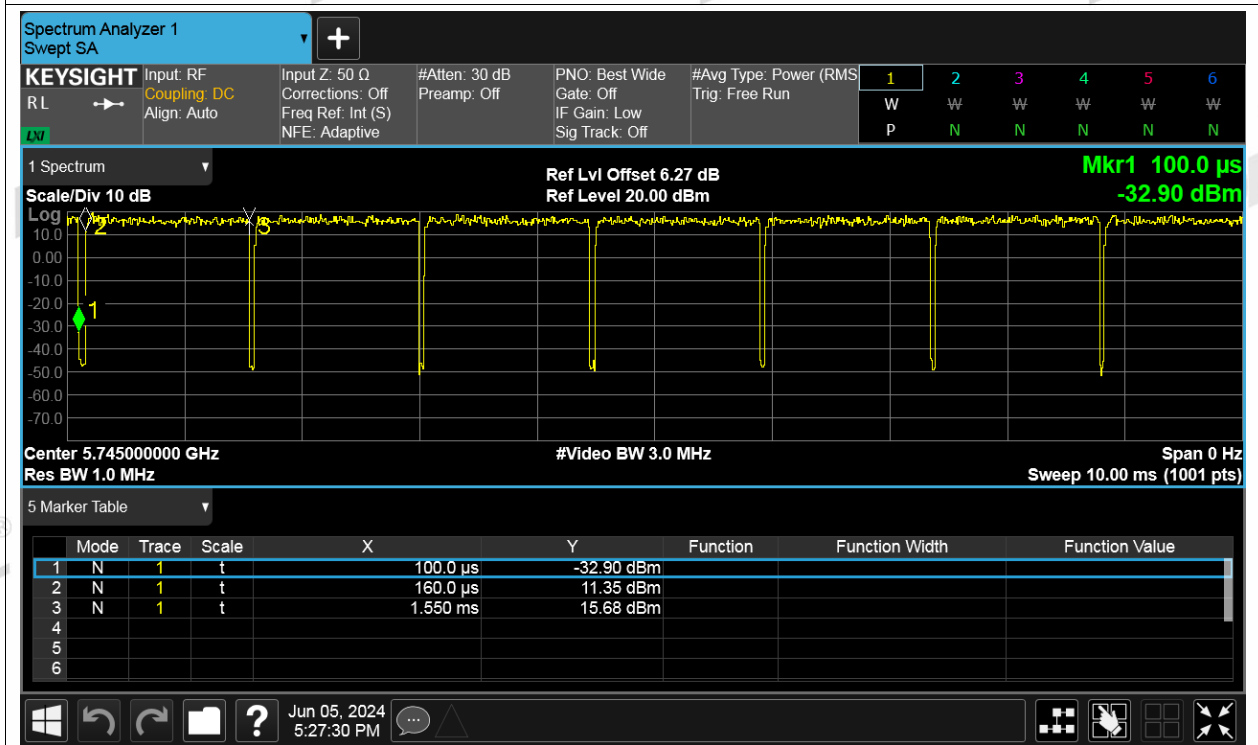


Duty Cycle NVNT a 5785MHz Ant1

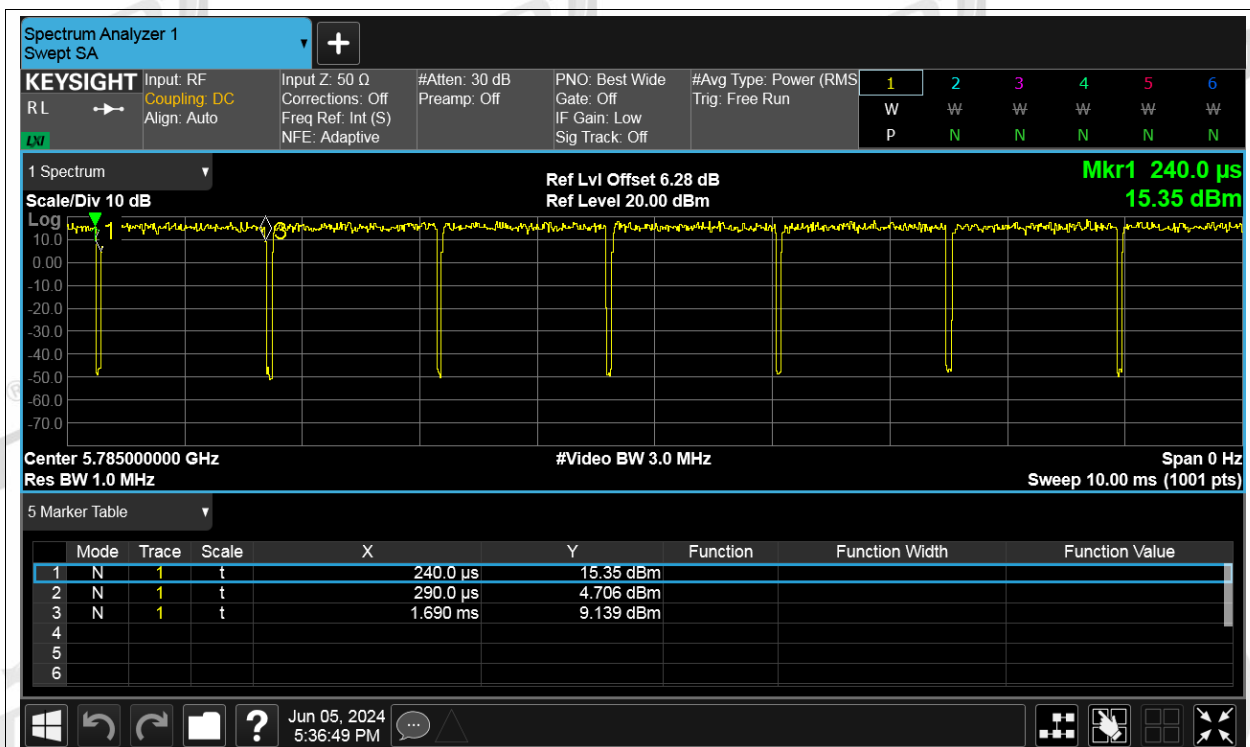


Duty Cycle NVNT a 5825MHz Ant1

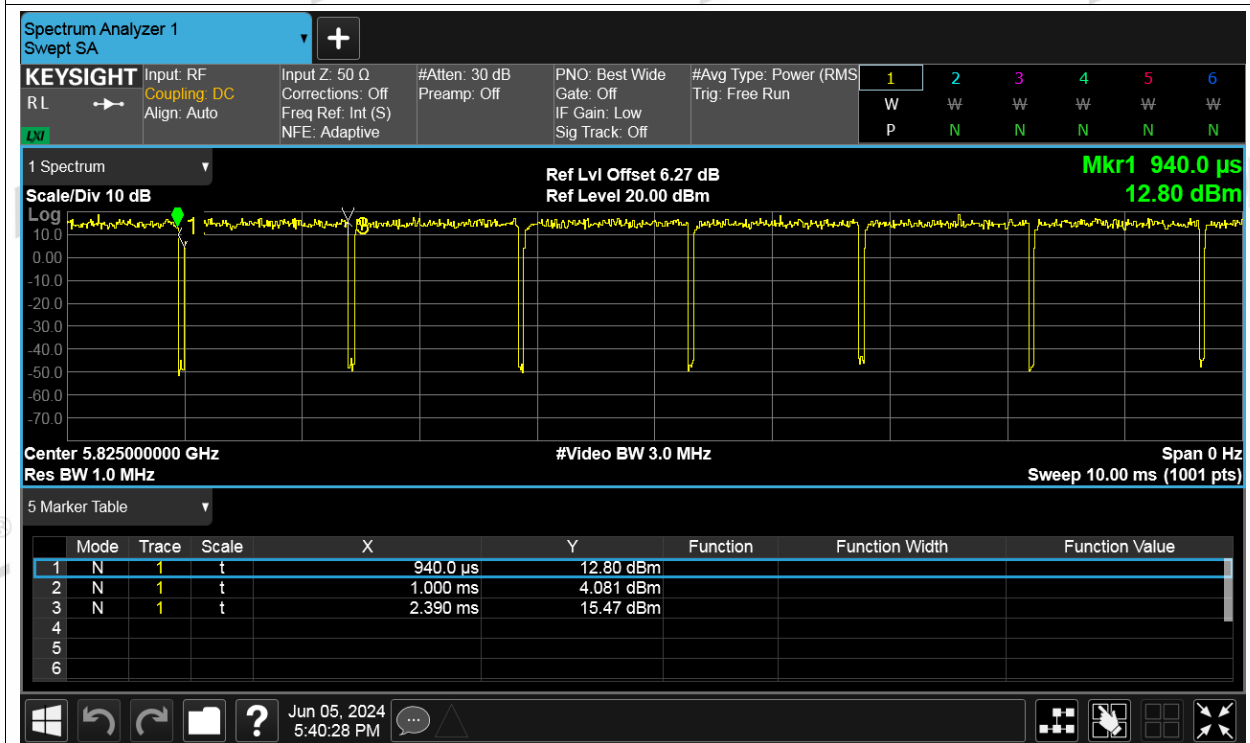


Duty Cycle NVNT a 5180MHz Ant2

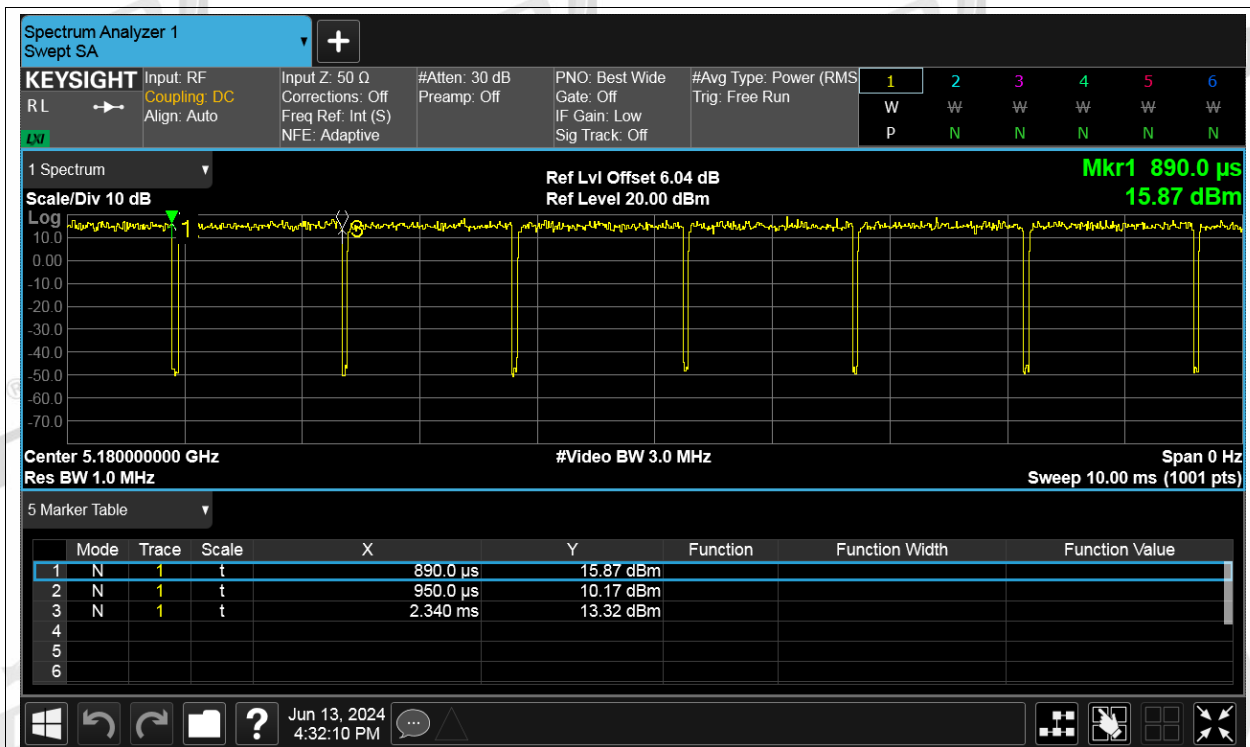


Duty Cycle NVNT a 5200MHz Ant2

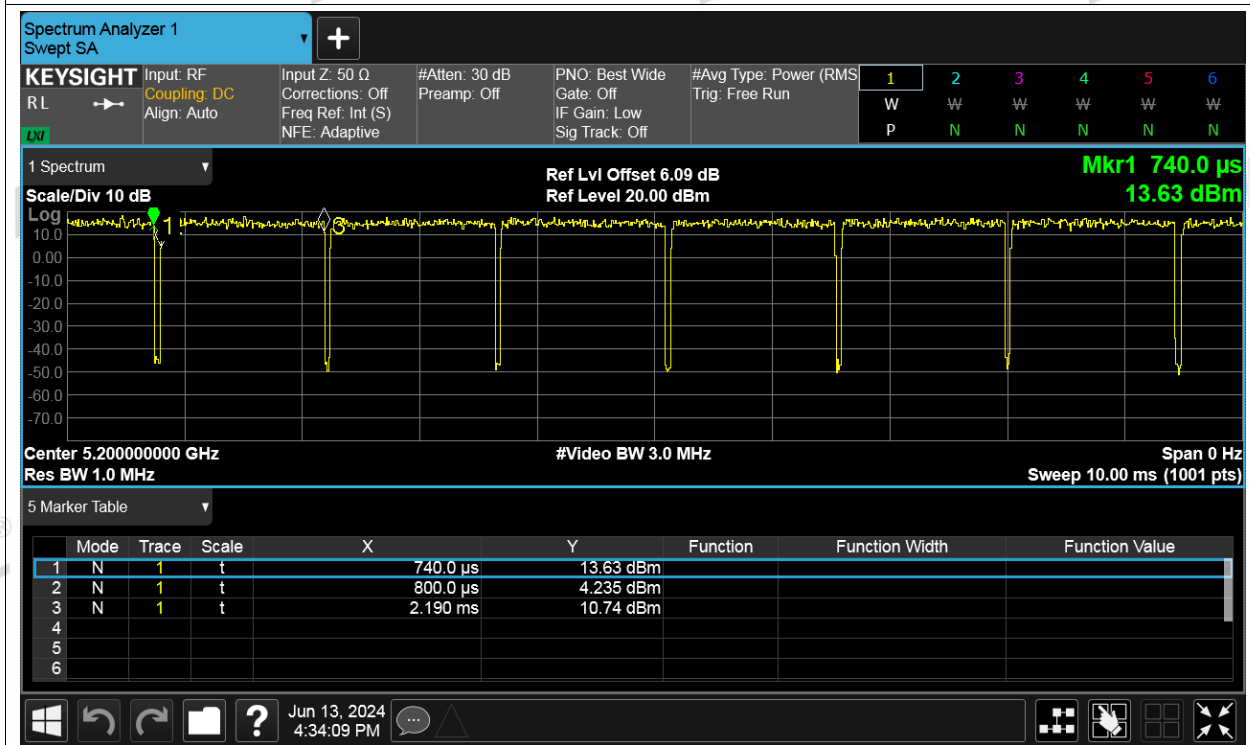


Duty Cycle NVNT a 5240MHz Ant2

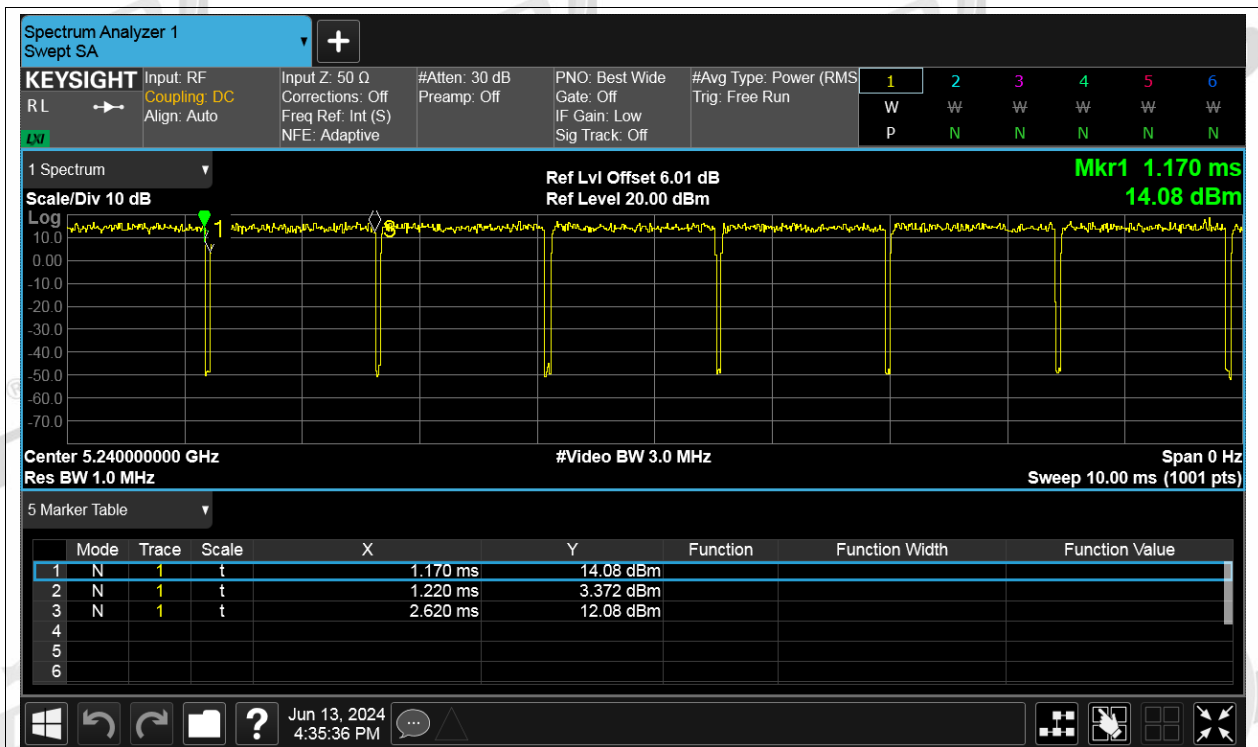


Duty Cycle NVNT a 5260MHz Ant2

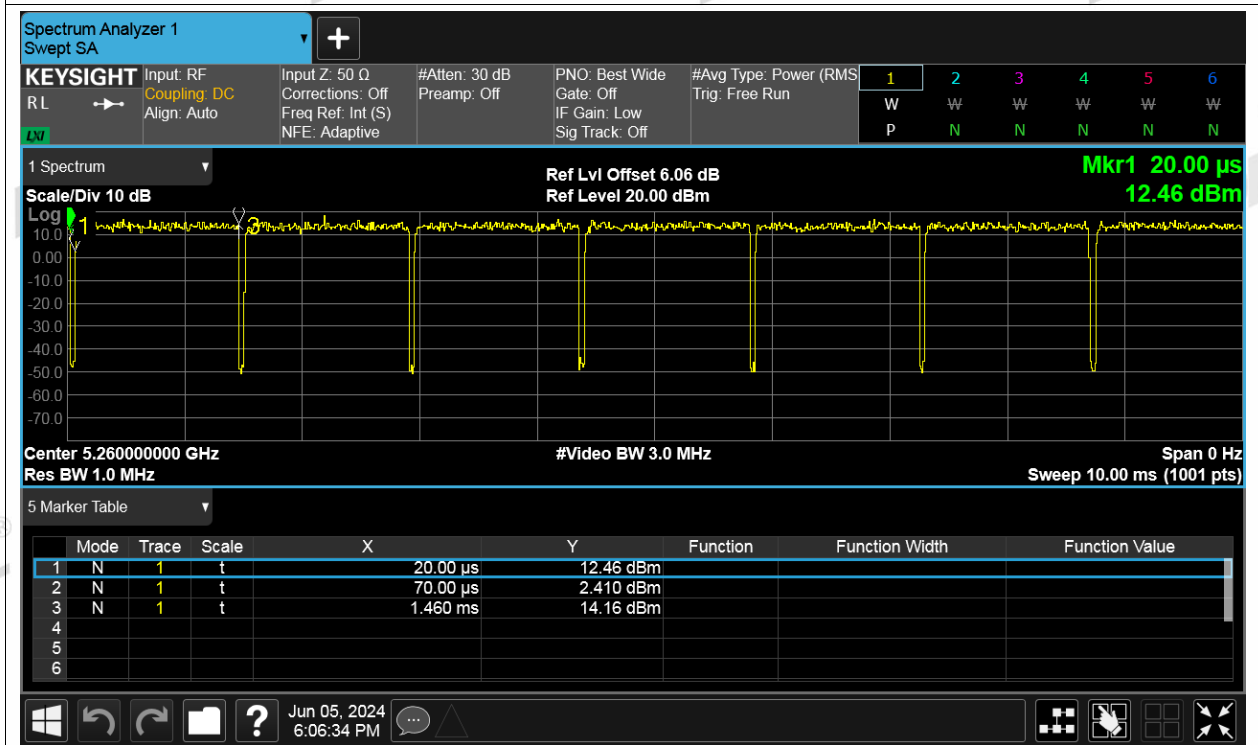


Duty Cycle NVNT a 5280MHz Ant2

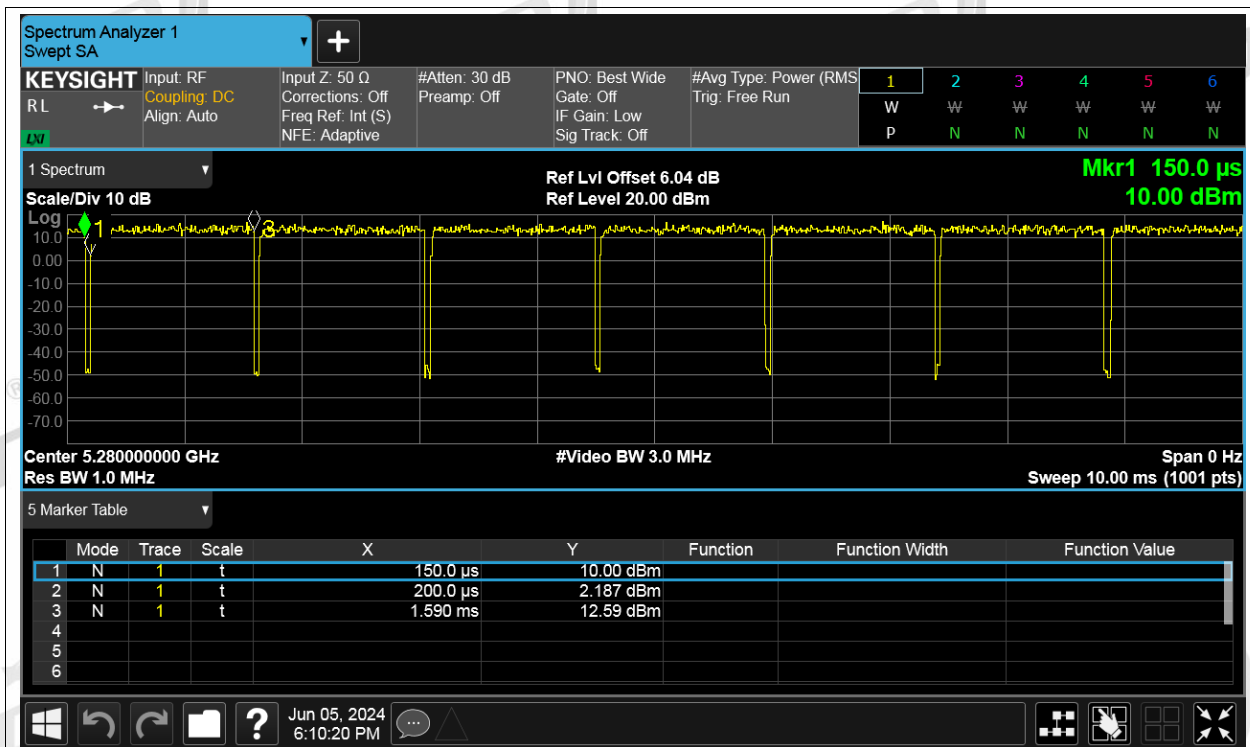


Duty Cycle NVNT a 5320MHz Ant2

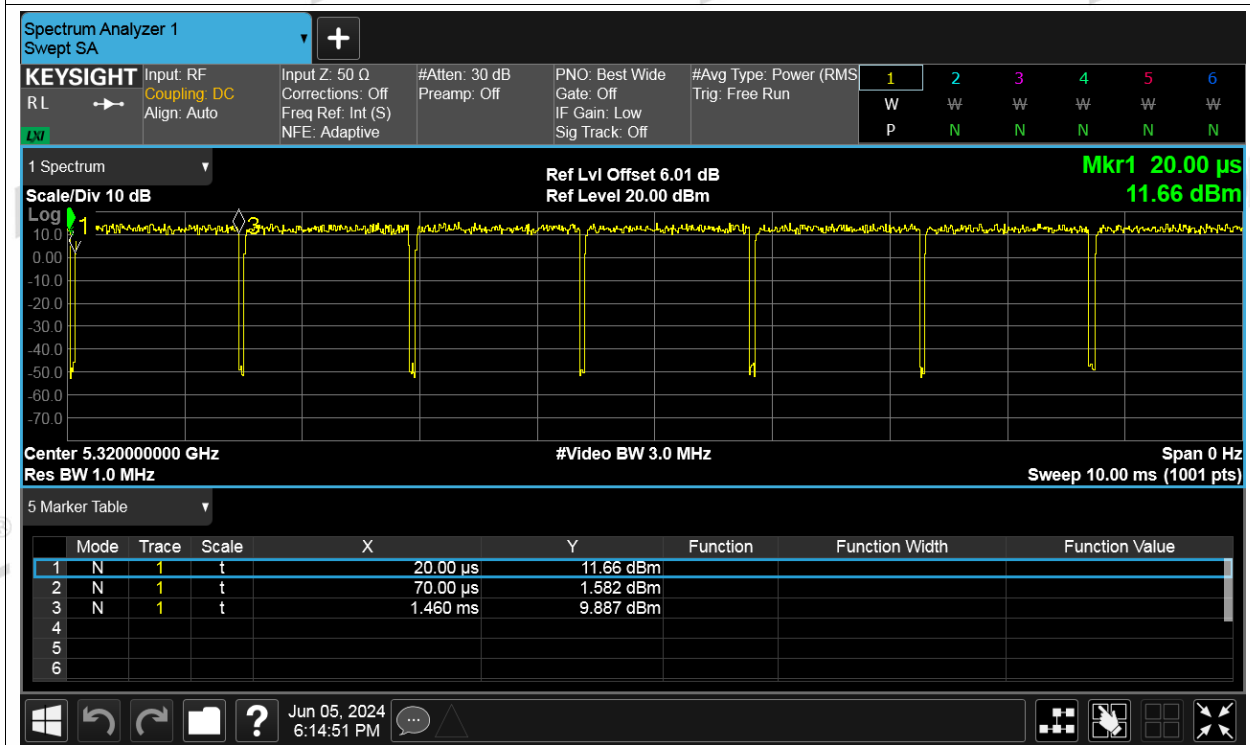


Duty Cycle NVNT a 5500MHz Ant2

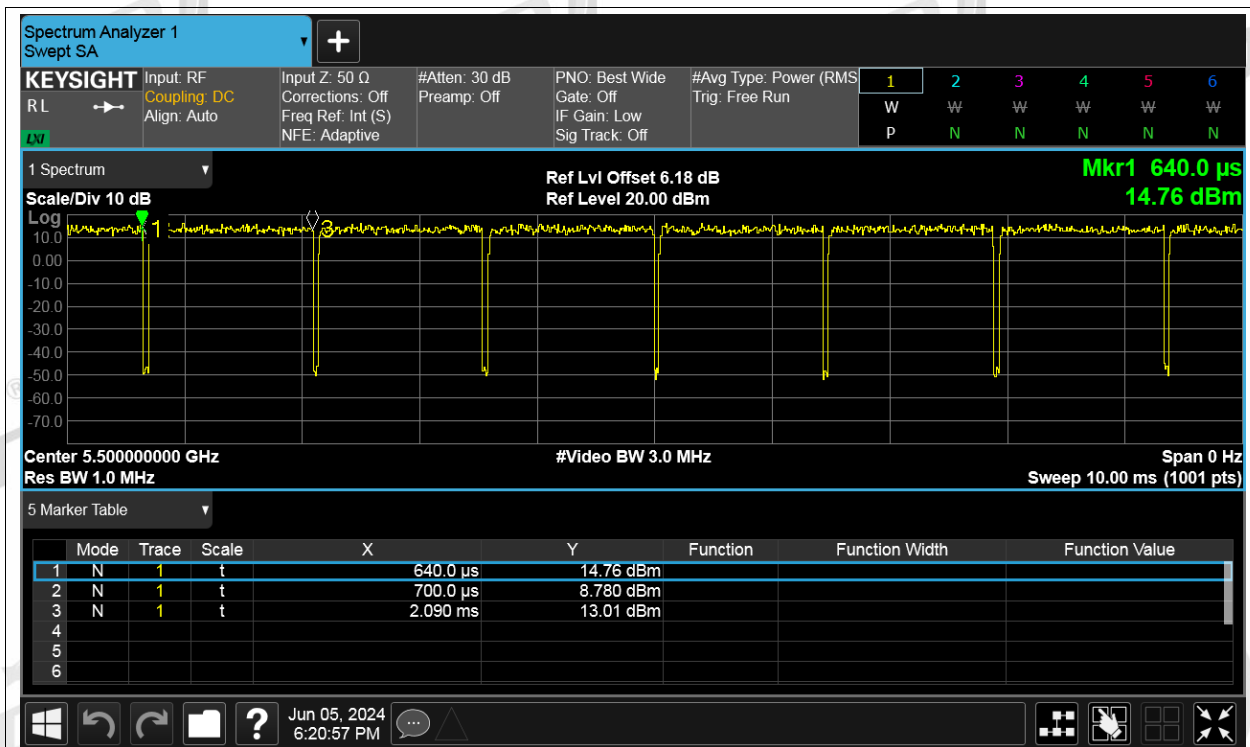


Duty Cycle NVNT a 5580MHz Ant2

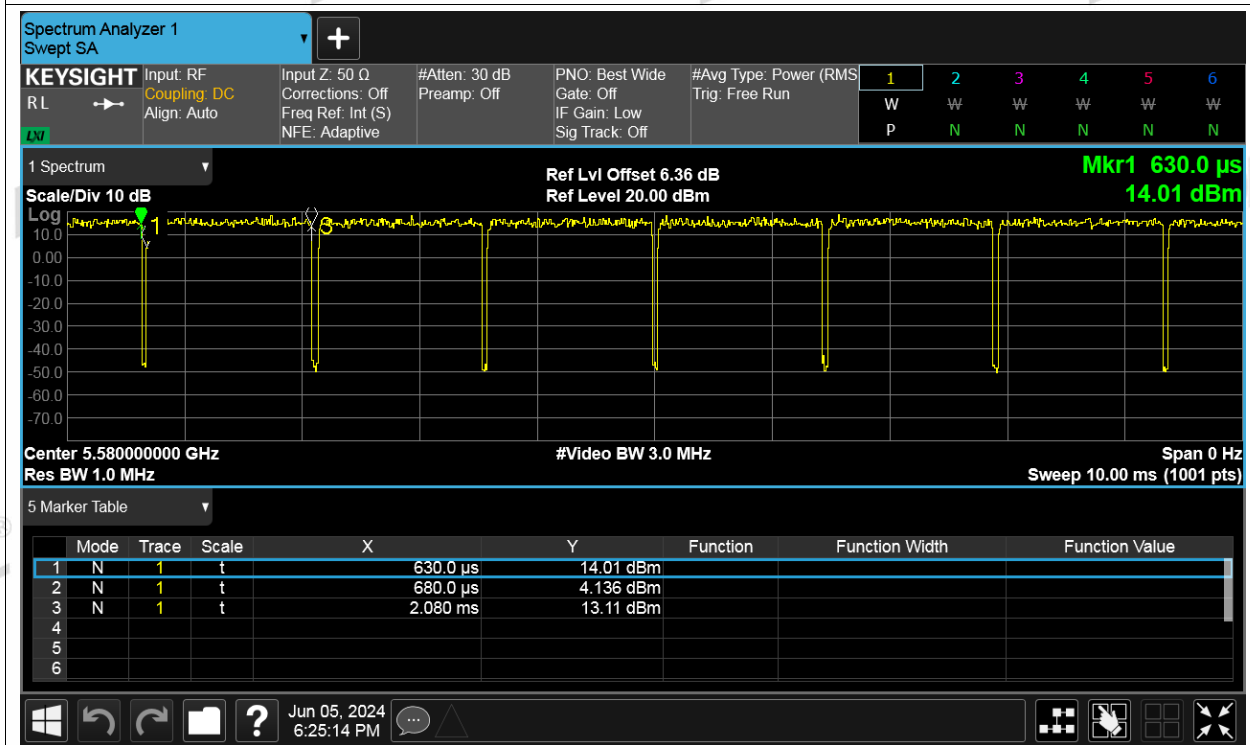


Duty Cycle NVNT a 5700MHz Ant2

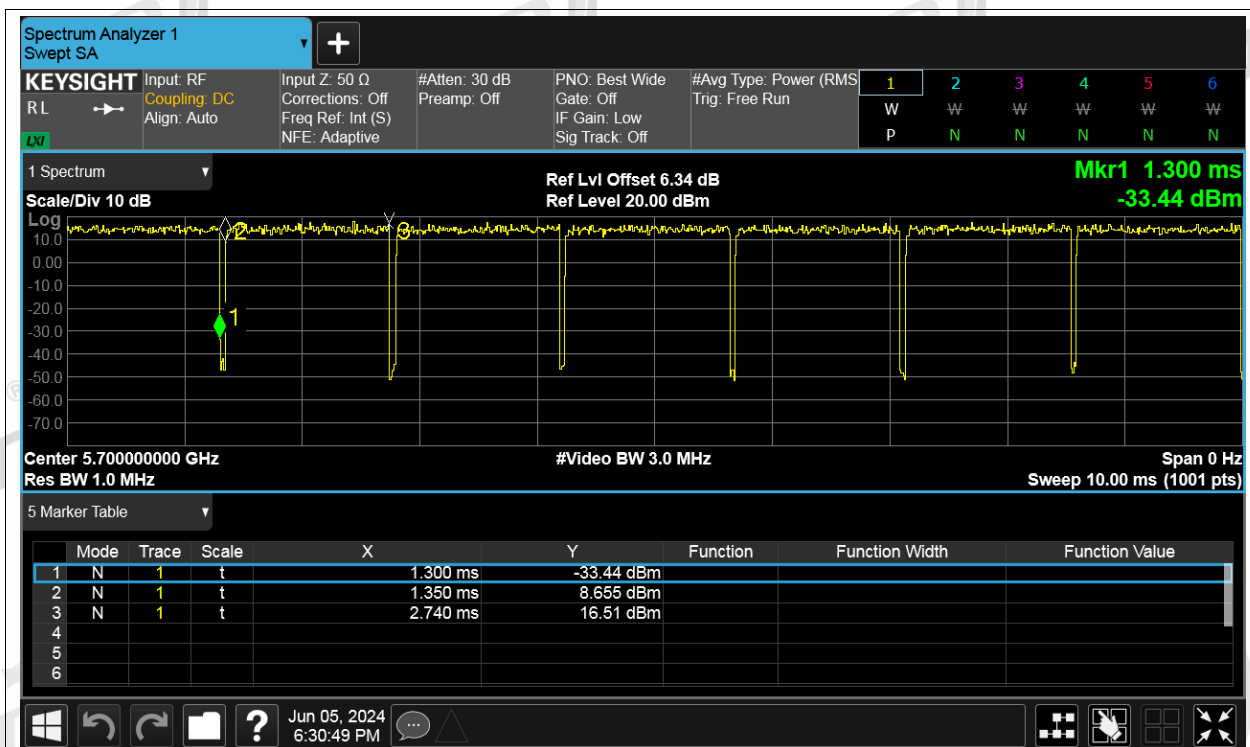


Duty Cycle NVNT a 5745MHz Ant2

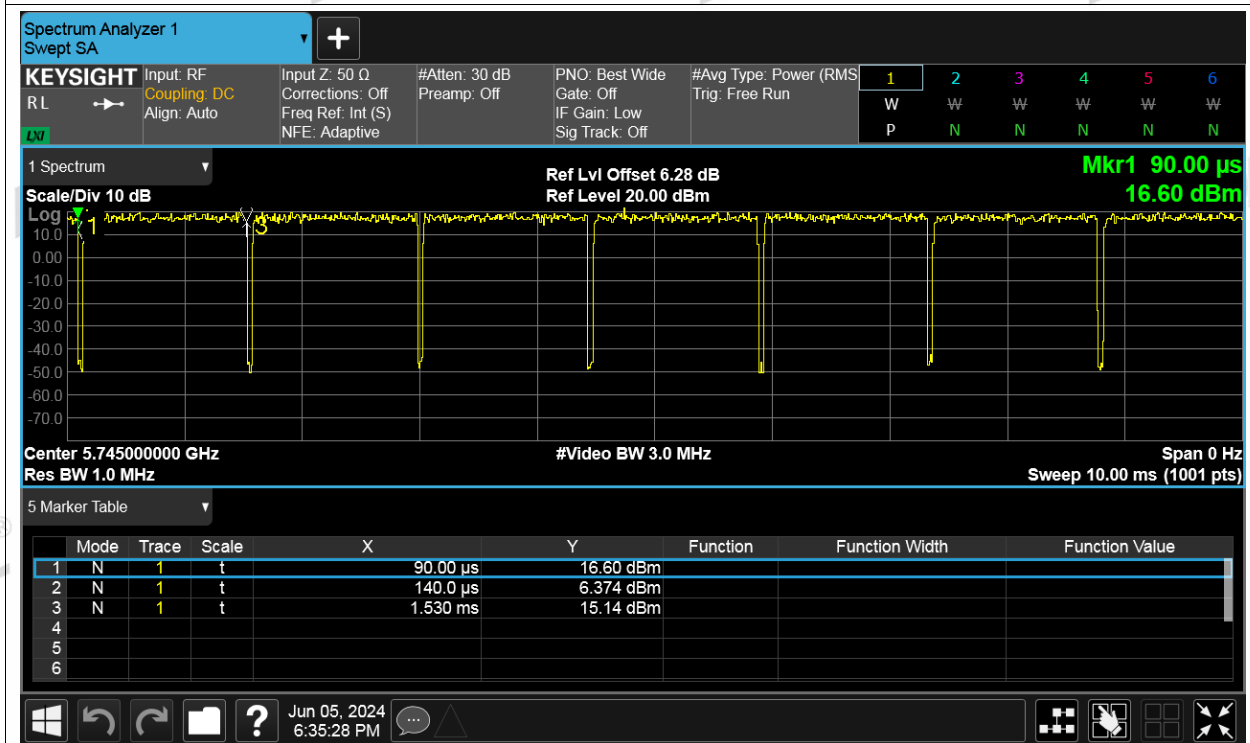


Duty Cycle NVNT a 5785MHz Ant2

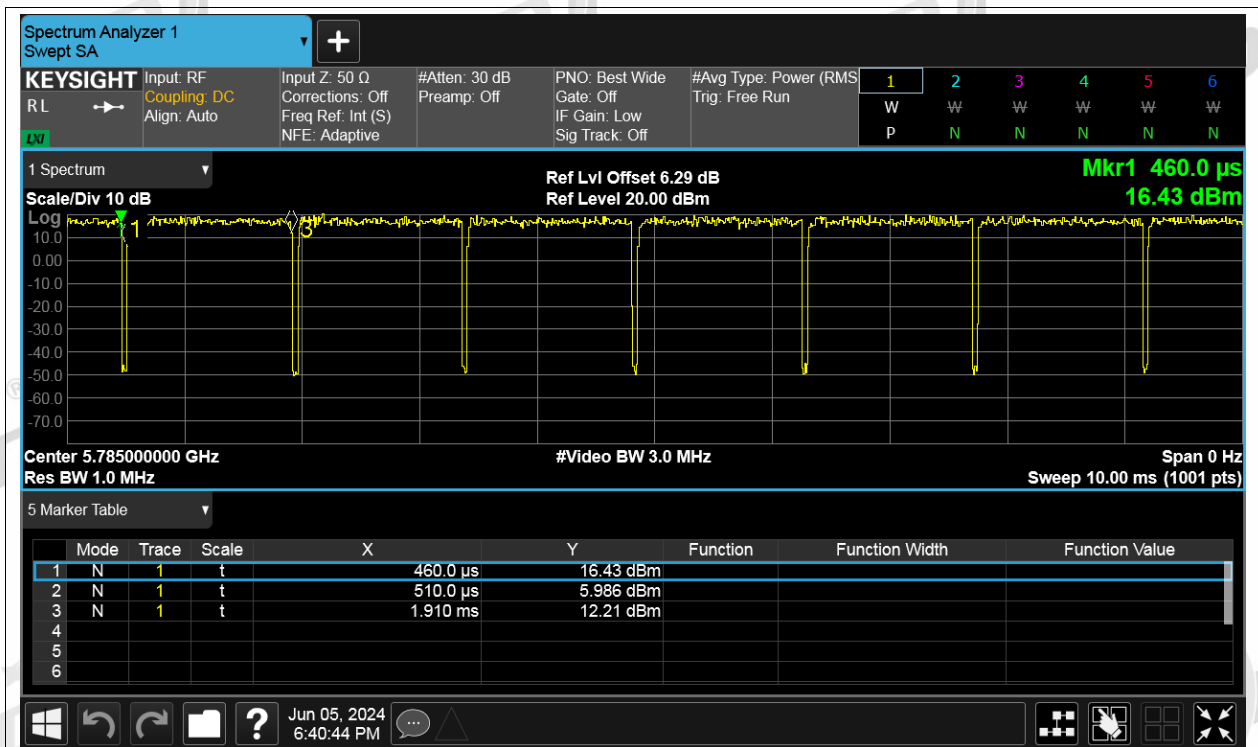


Duty Cycle NVNT a 5825MHz Ant2

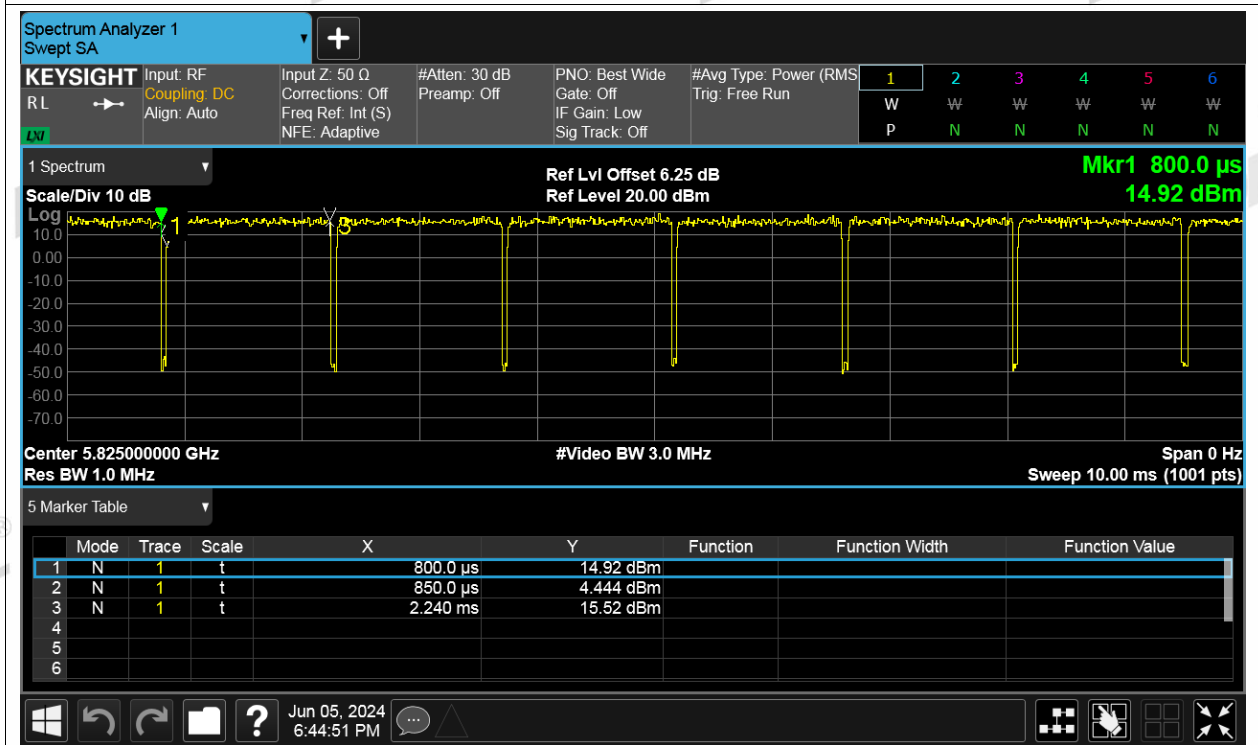


Duty Cycle NVNT a 5180MHz Ant3

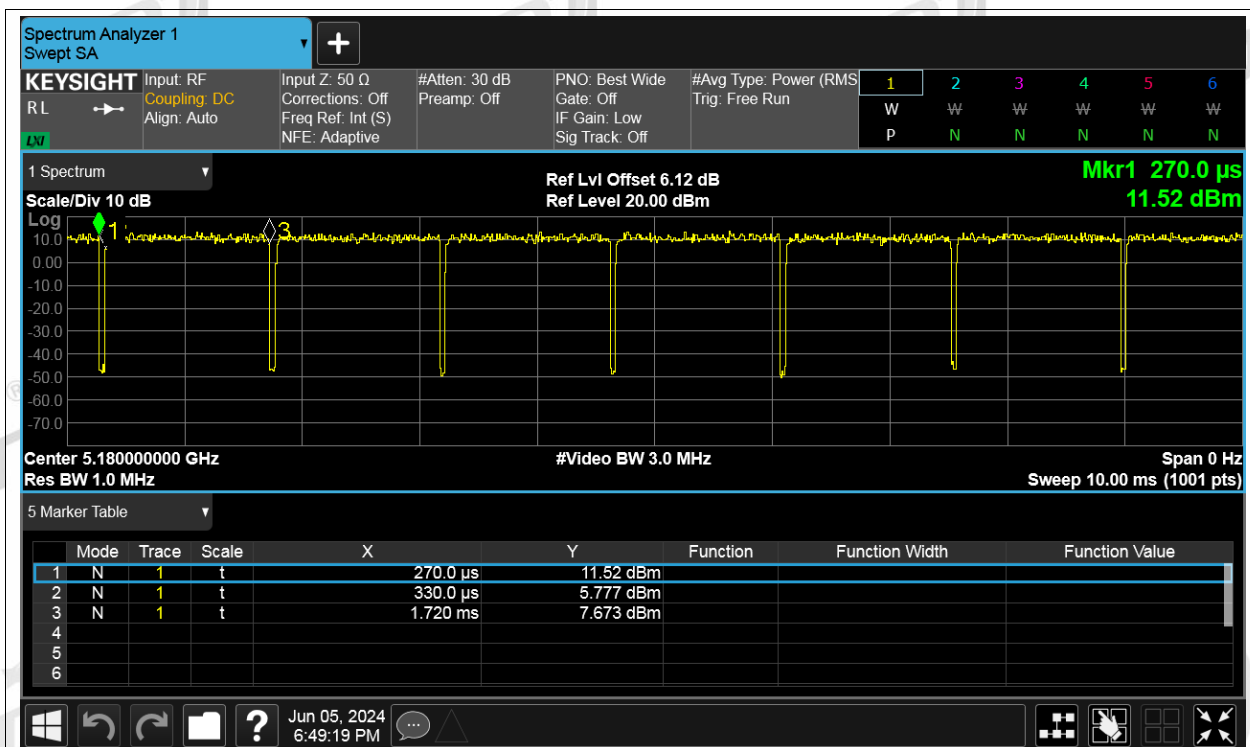


Duty Cycle NVNT a 5200MHz Ant3

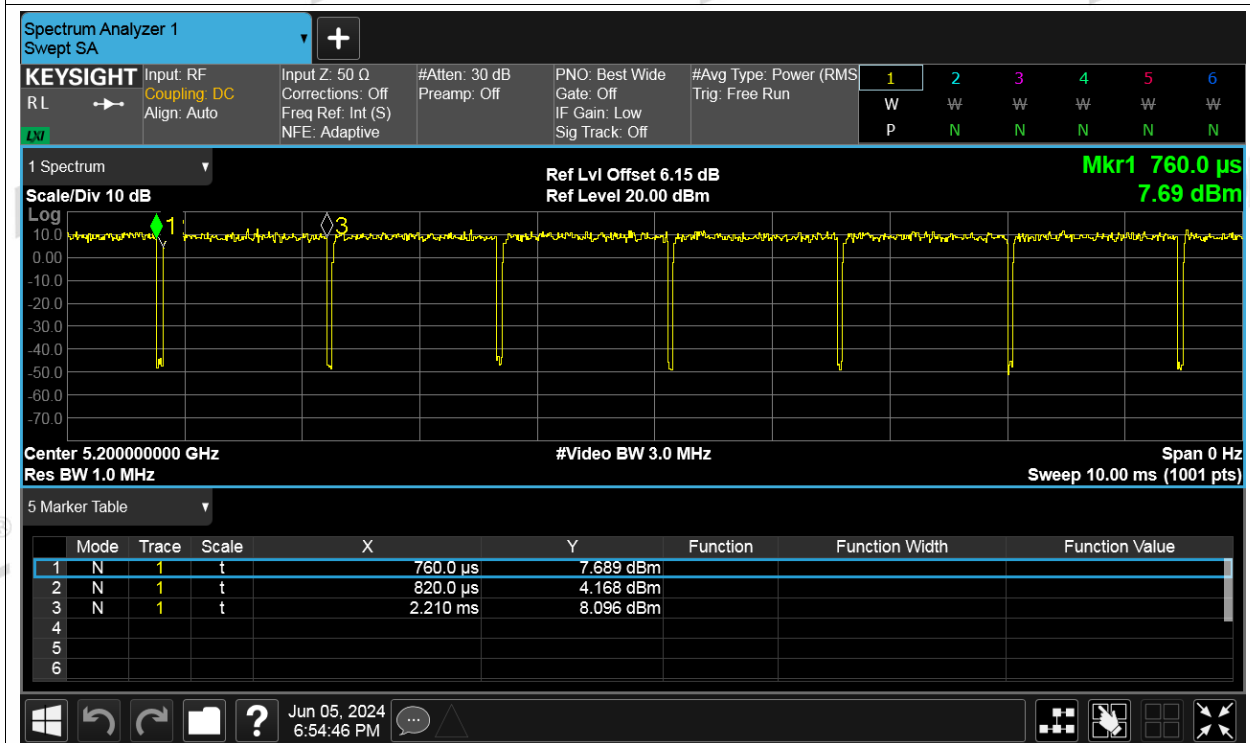


Duty Cycle NVNT a 5240MHz Ant3

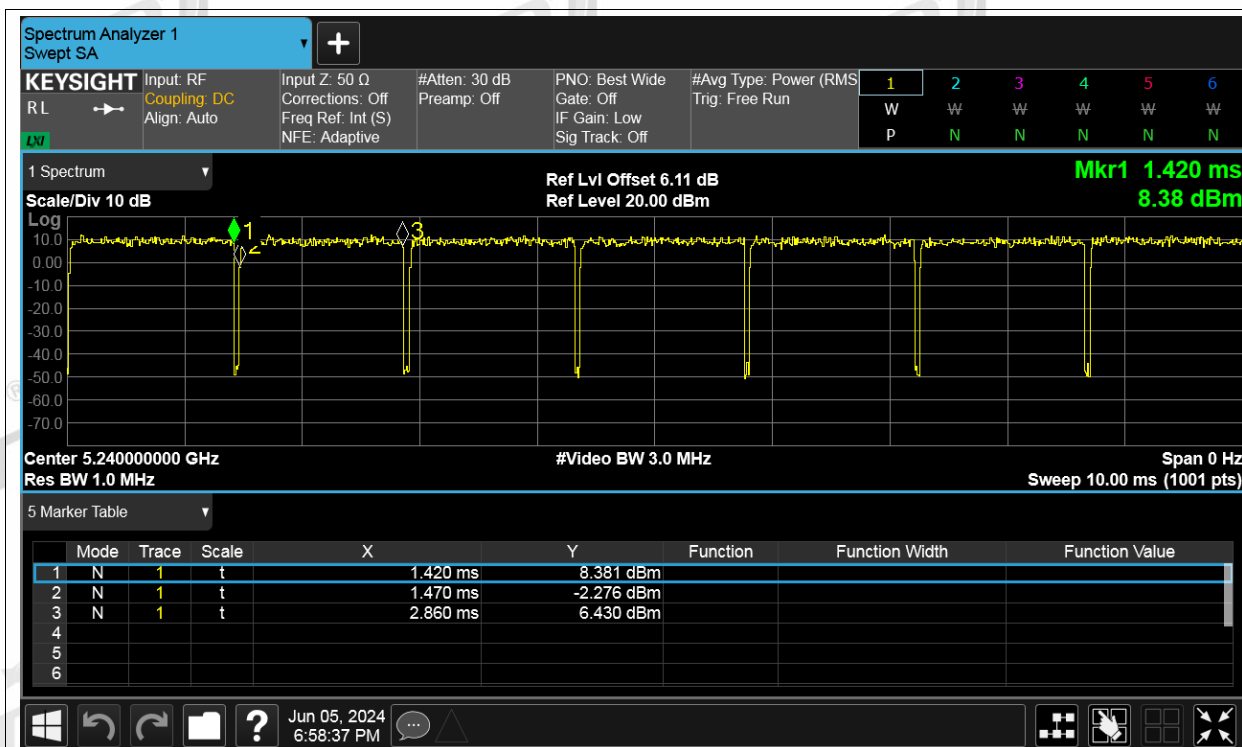


Duty Cycle NVNT a 5260MHz Ant3

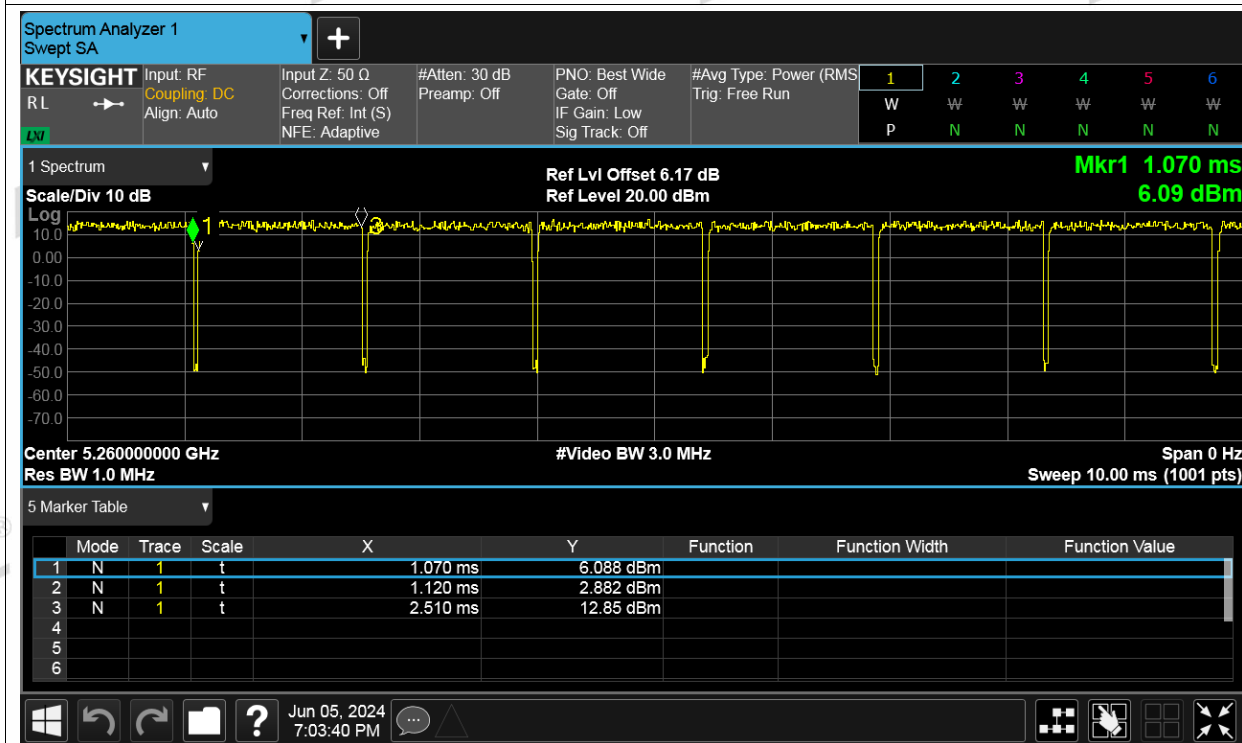


Duty Cycle NVNT a 5280MHz Ant3

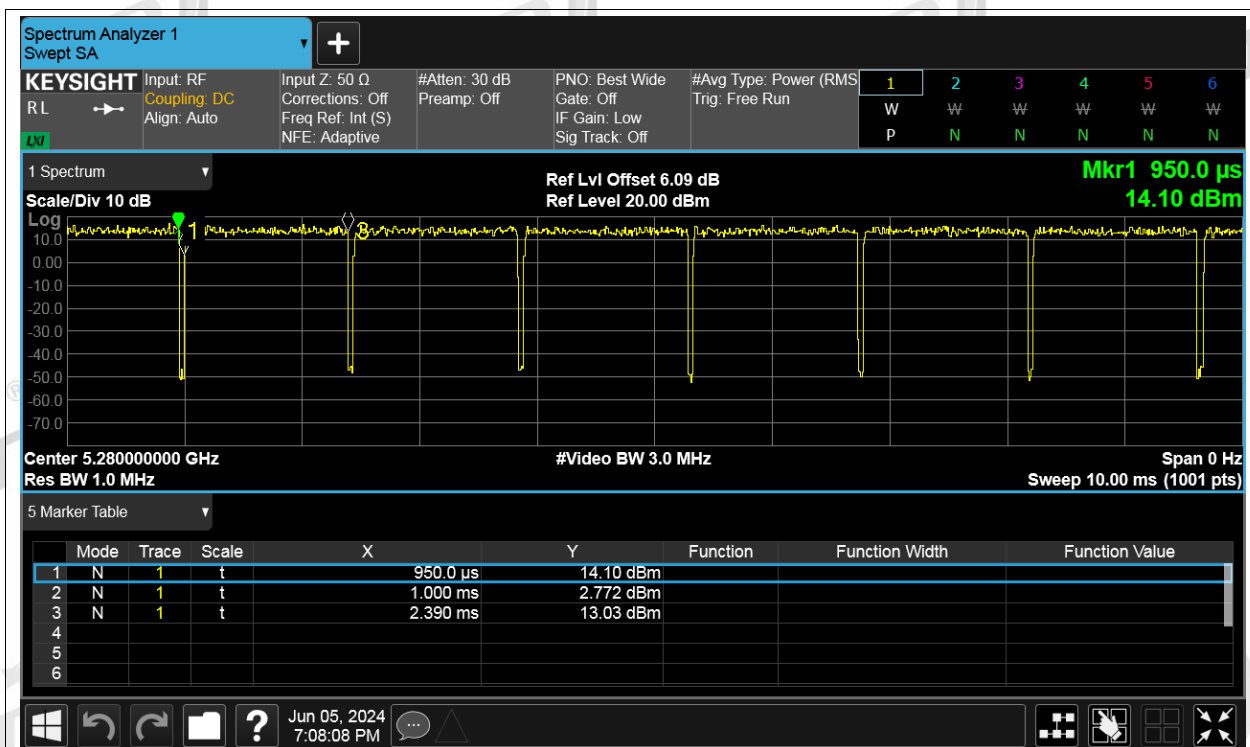


Duty Cycle NVNT a 5320MHz Ant3

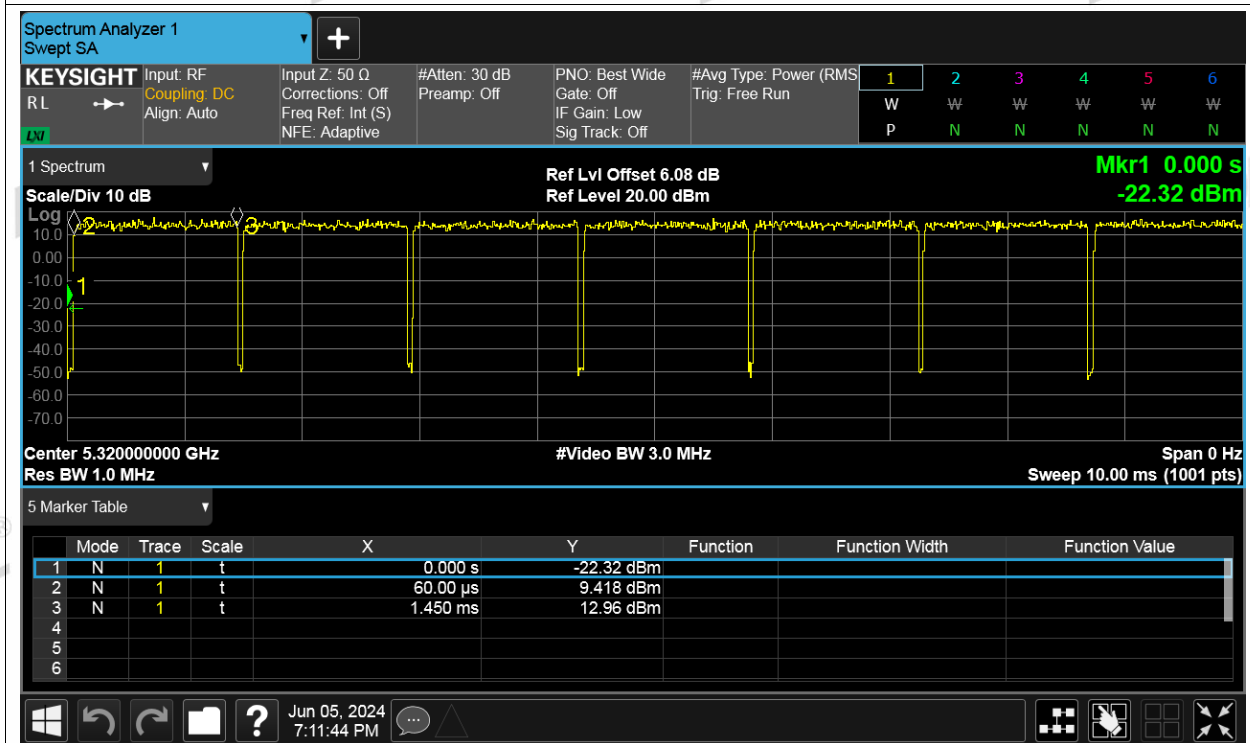


Duty Cycle NVNT a 5500MHz Ant3

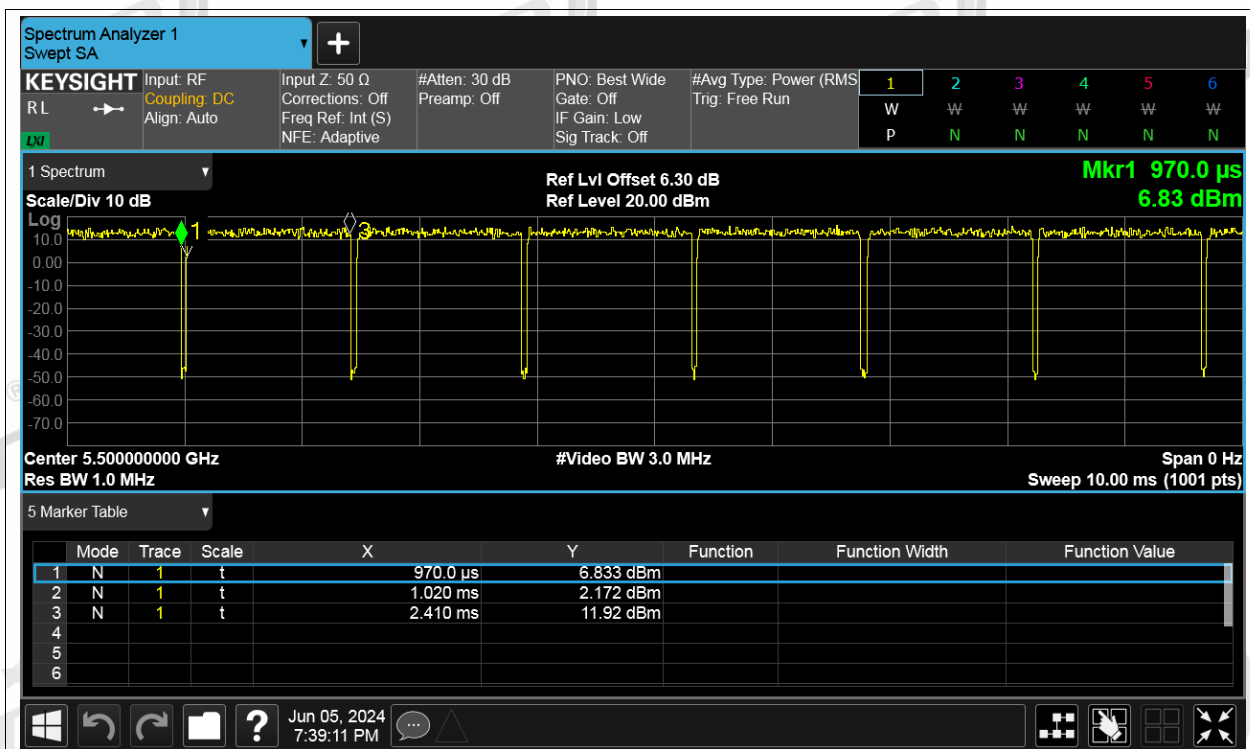


Duty Cycle NVNT a 5580MHz Ant3

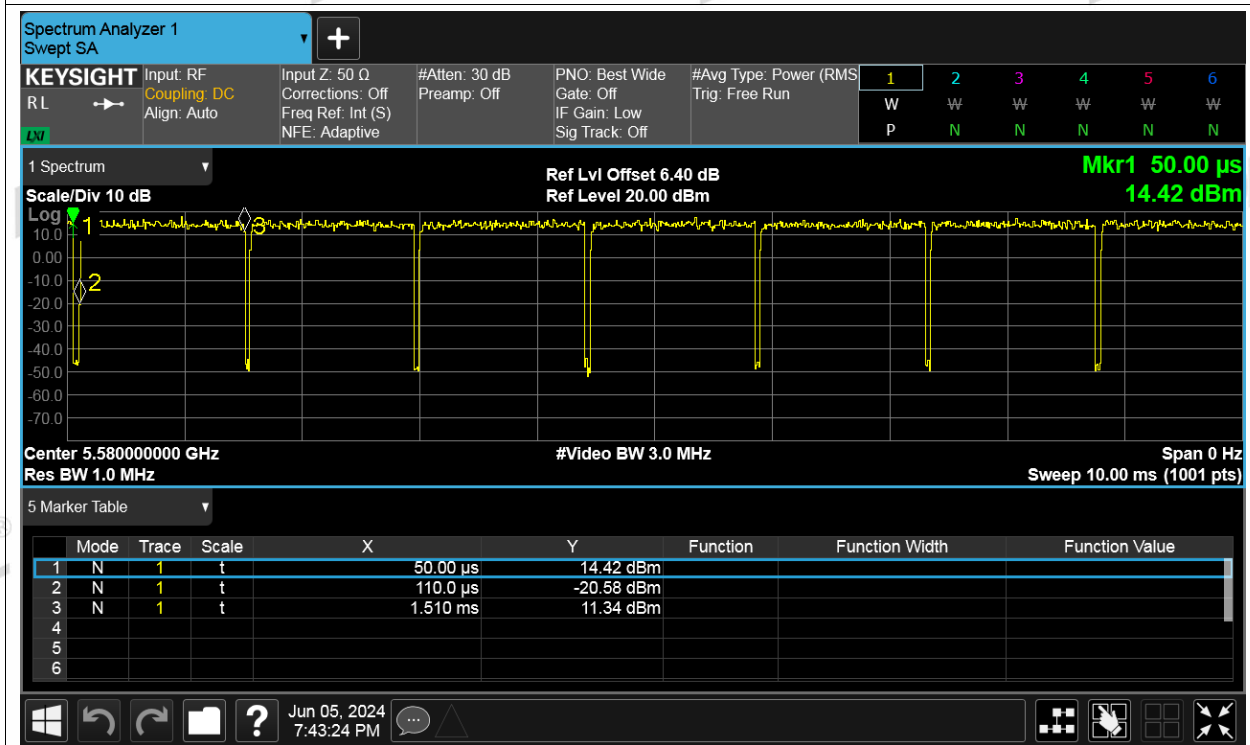


Duty Cycle NVNT a 5700MHz Ant3

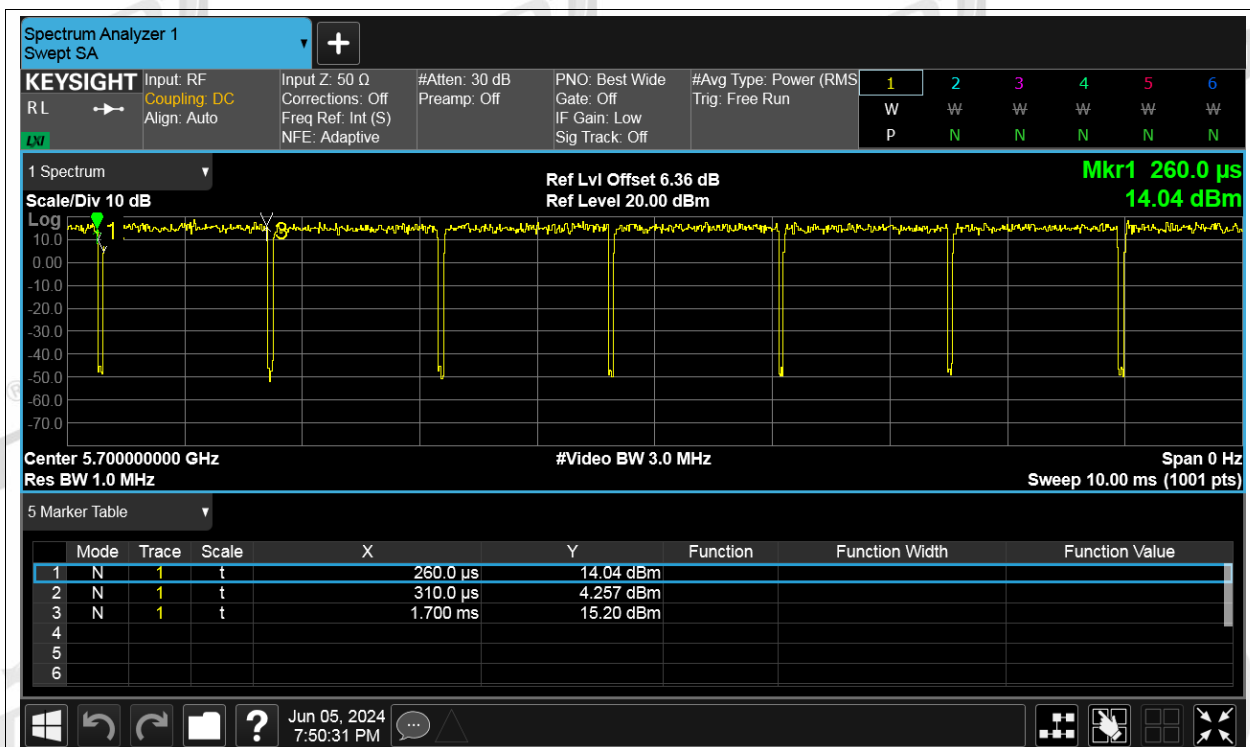


Duty Cycle NVNT a 5745MHz Ant3

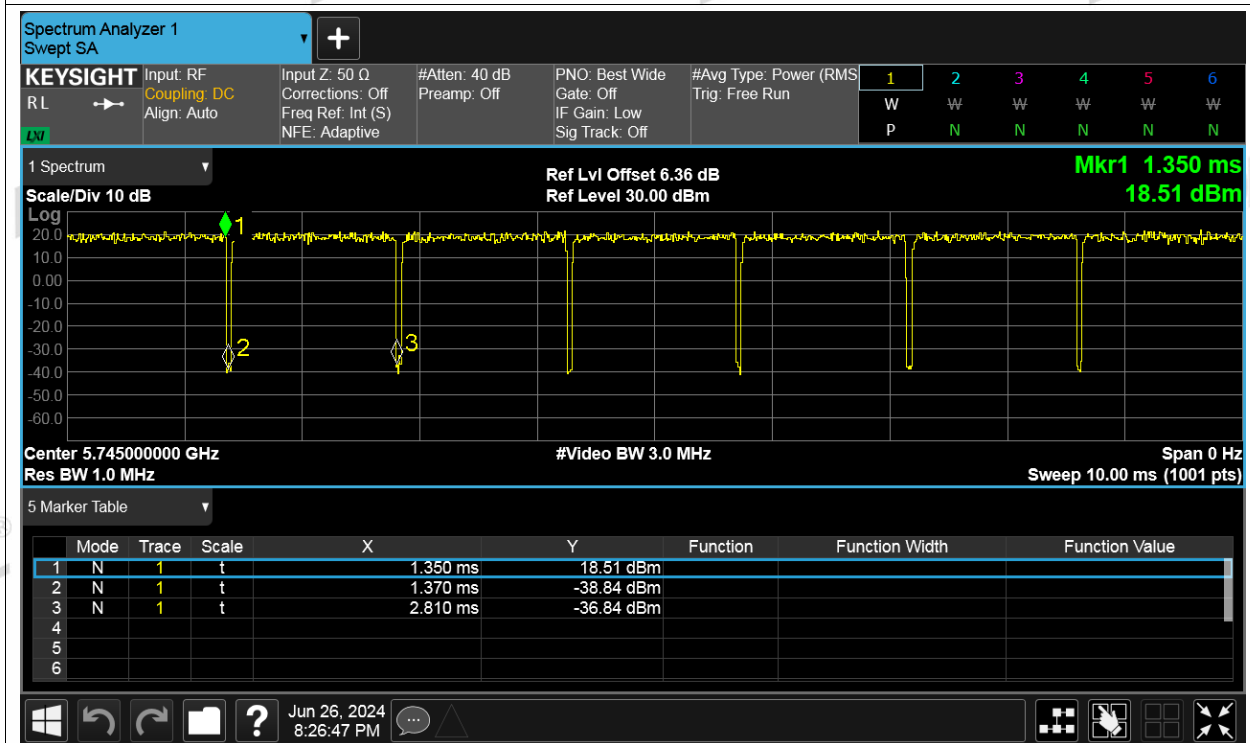


Duty Cycle NVNT a 5785MHz Ant3

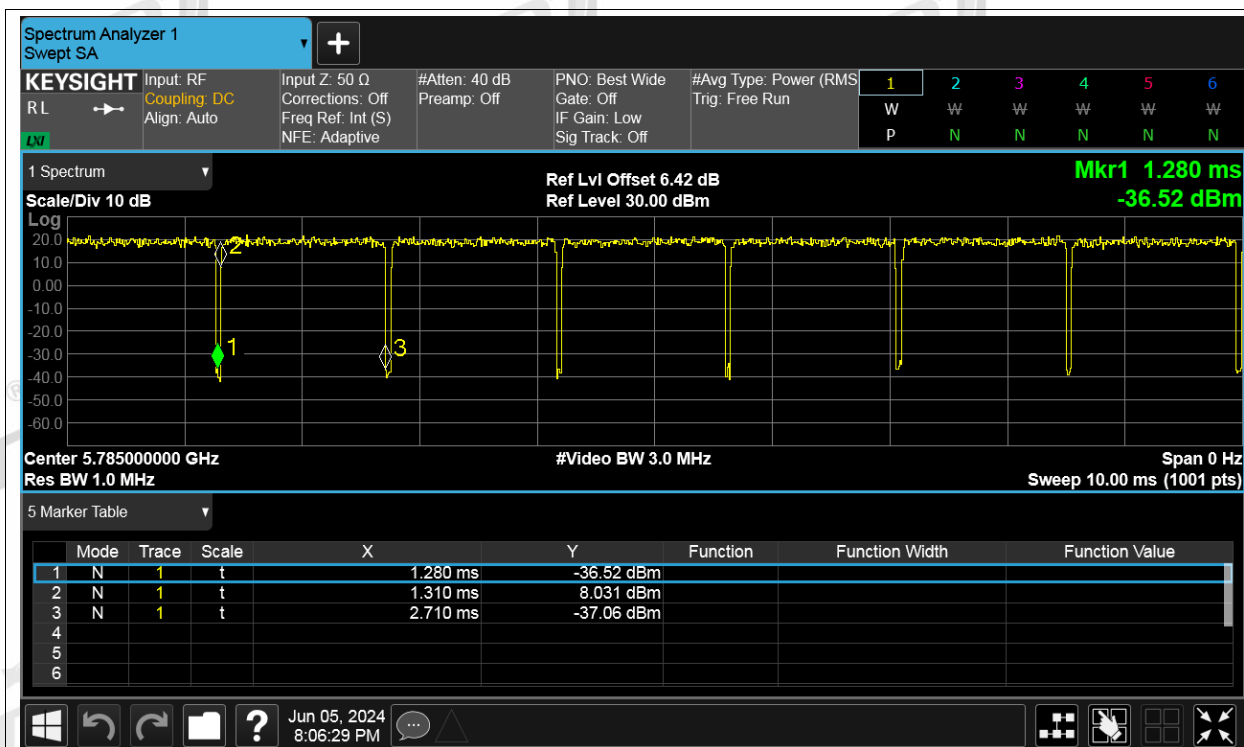


Duty Cycle NVNT a 5825MHz Ant3

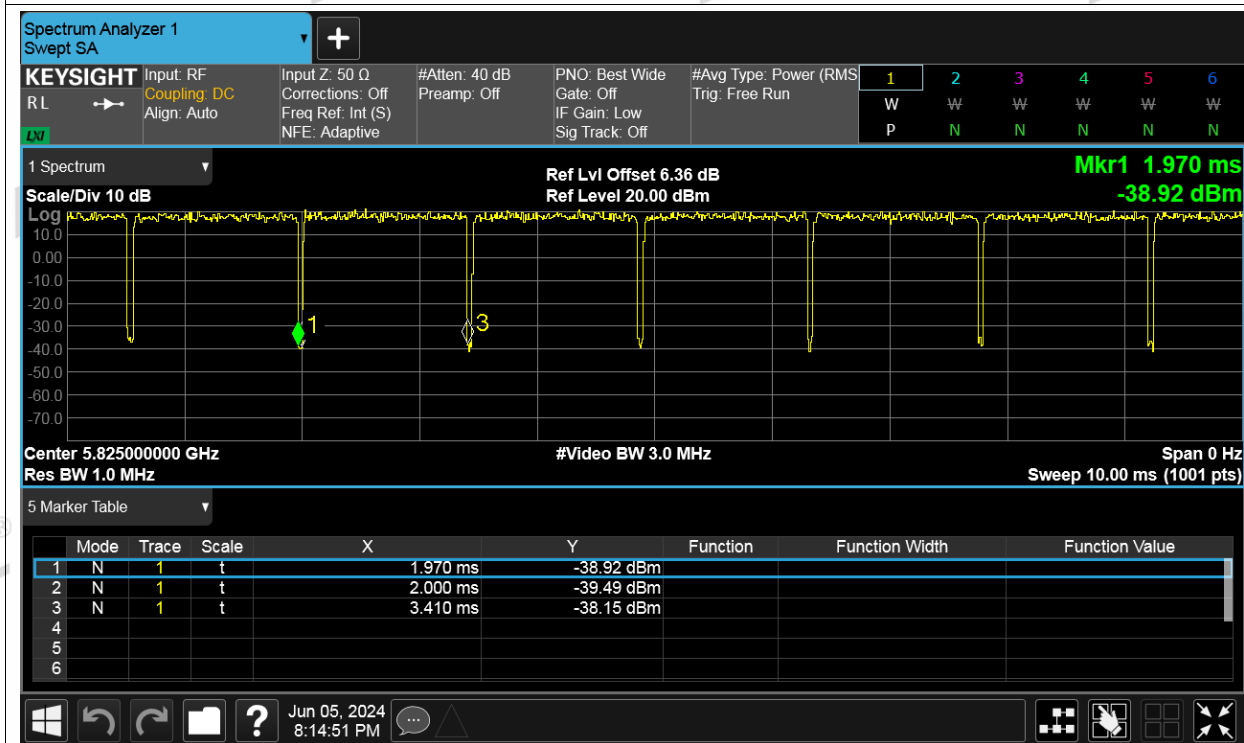


Duty Cycle NVNT ac160 5250MHz Sum

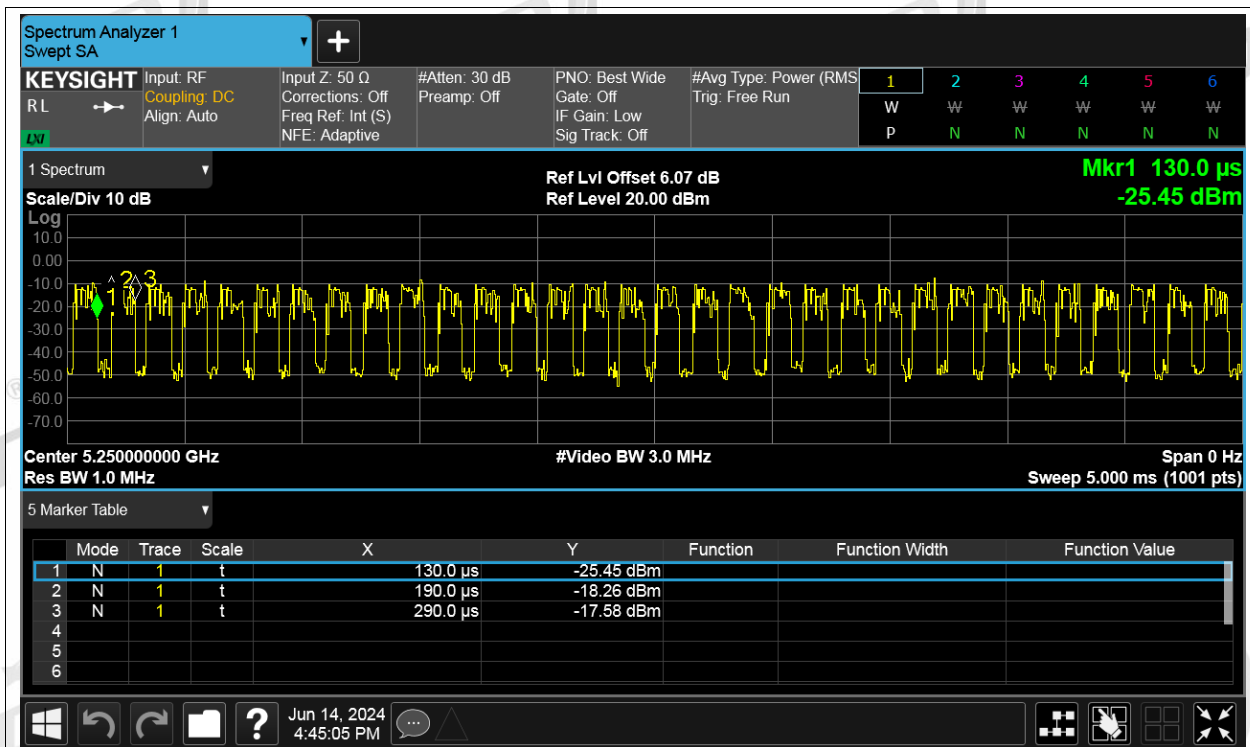


Duty Cycle NVNT ac160 5570MHz Sum

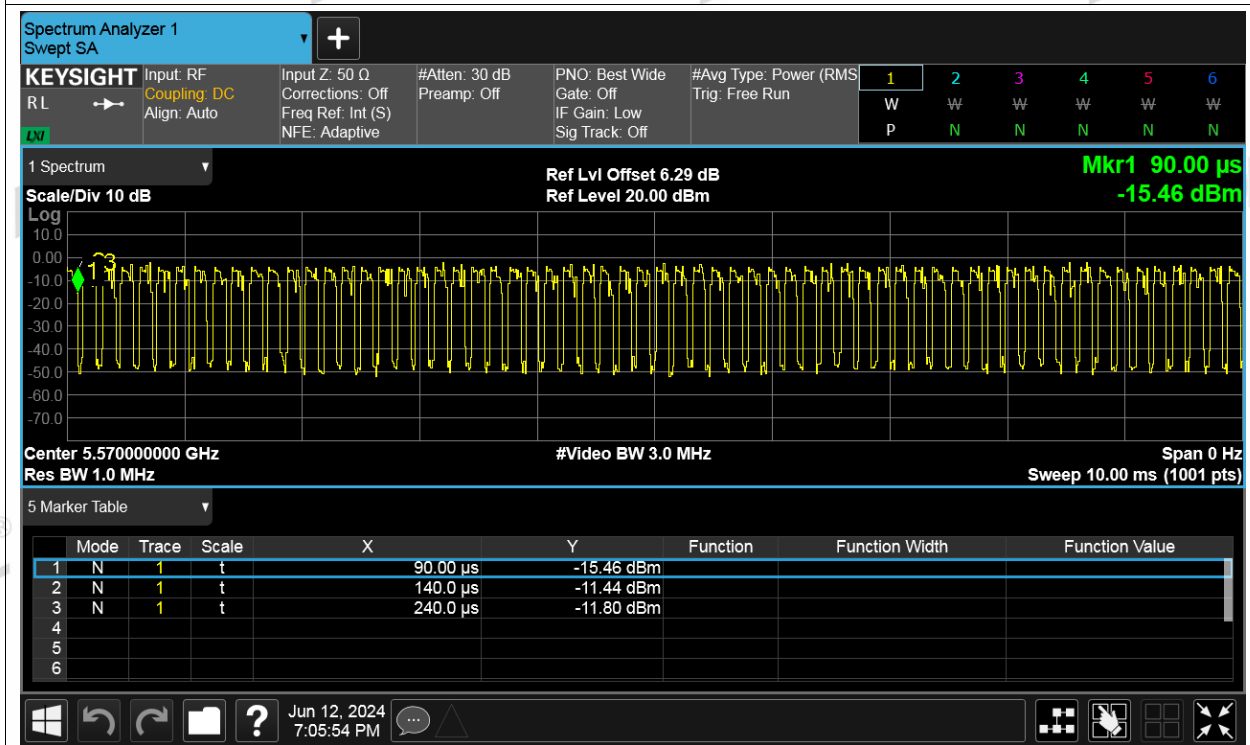


Duty Cycle NVNT ac20 5180MHz Sum

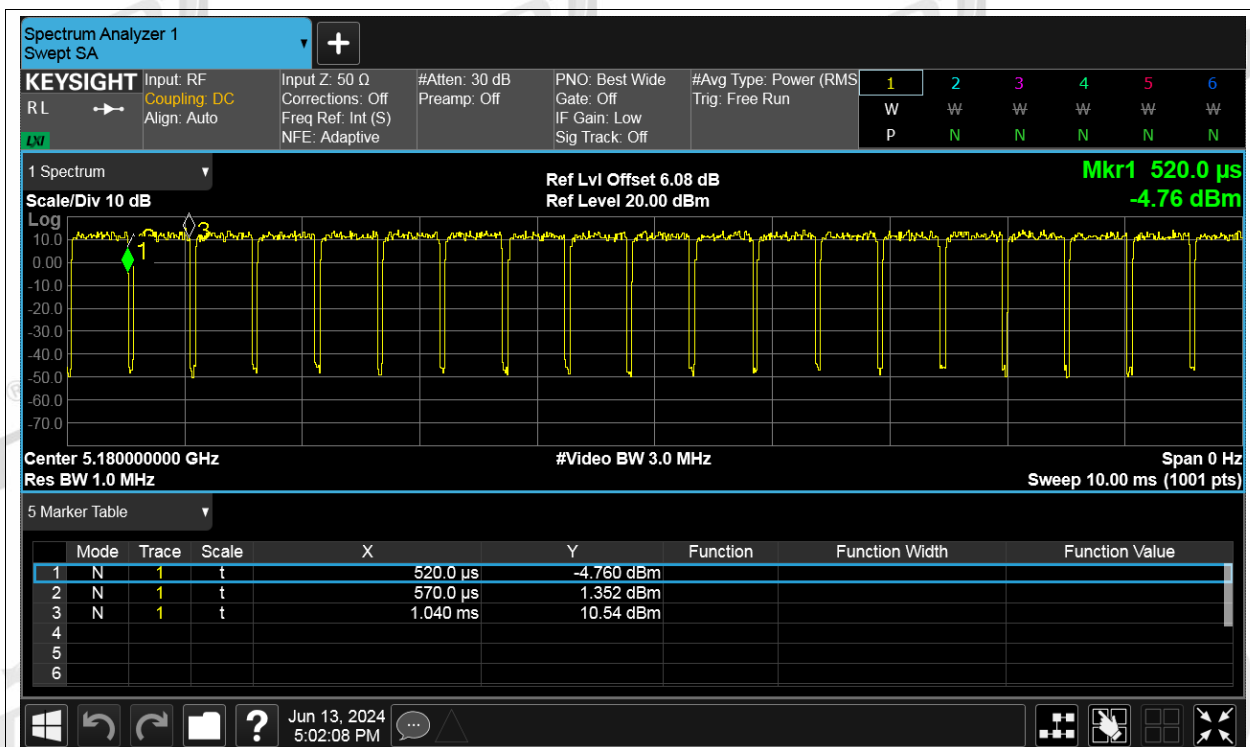


Duty Cycle NVNT ac20 5200MHz Sum

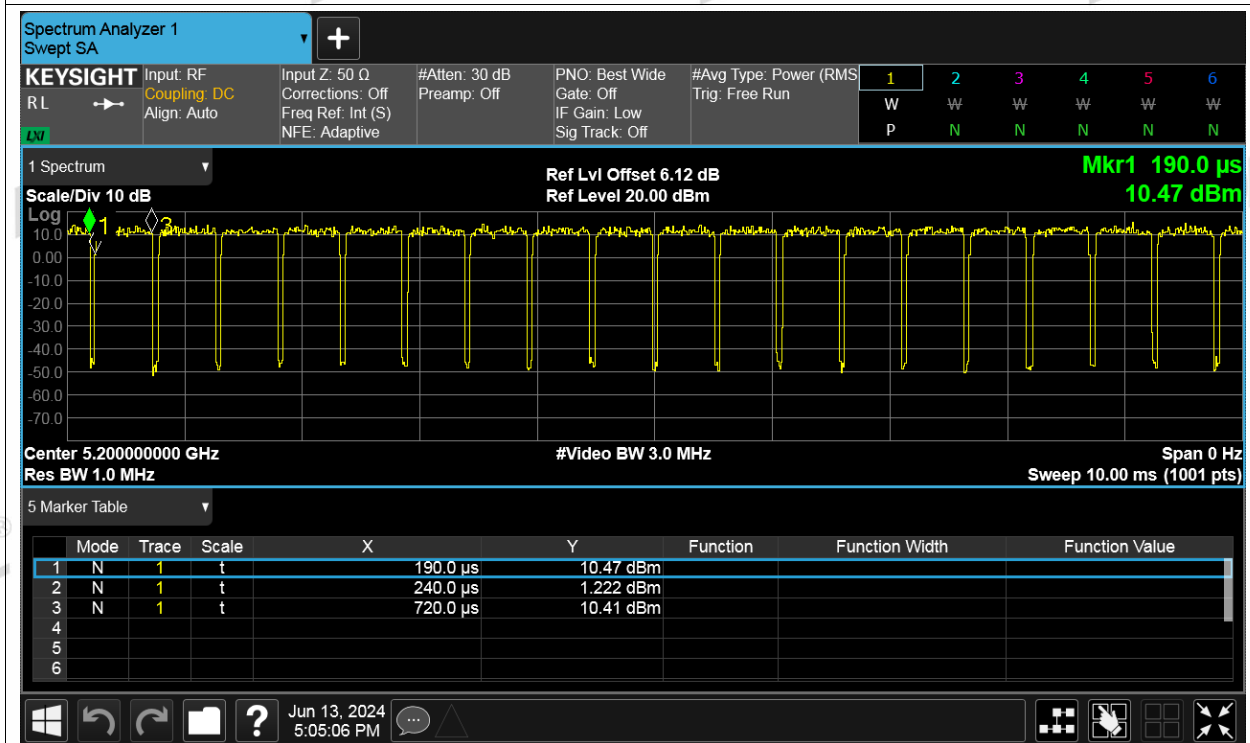


Duty Cycle NVNT ac20 5240MHz Sum

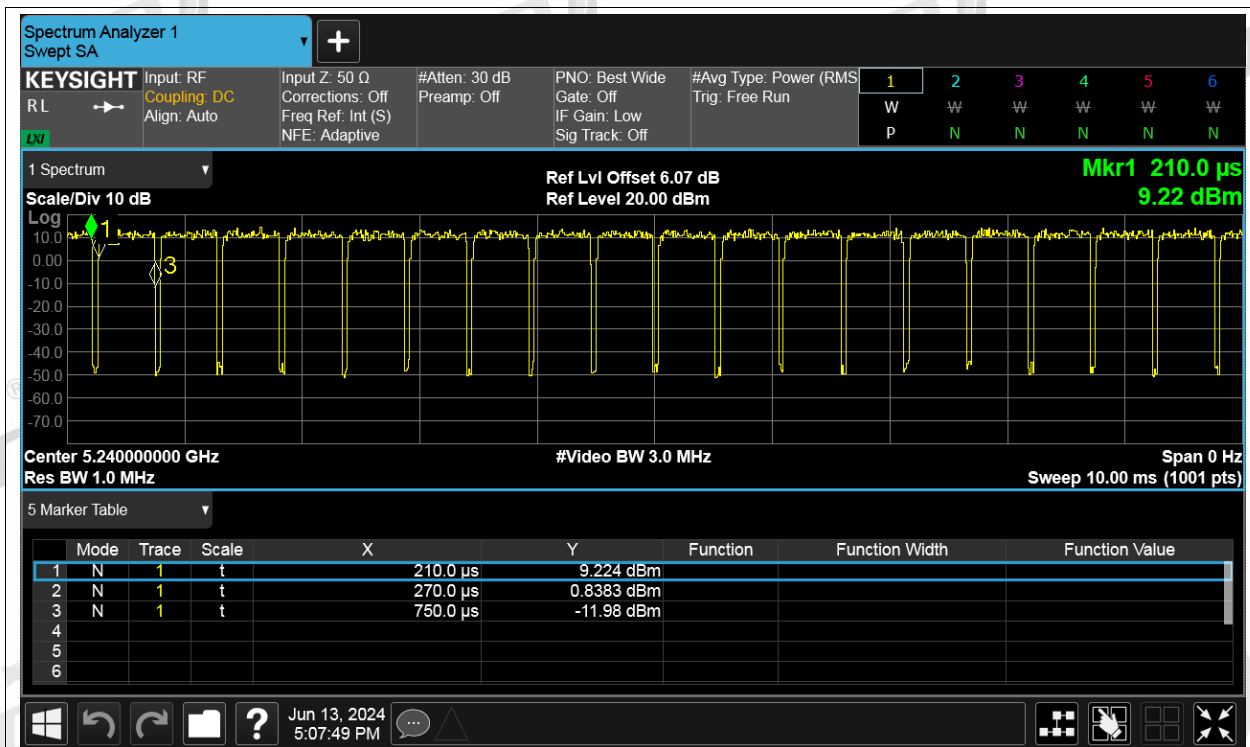


Duty Cycle NVNT ac20 5260MHz Sum

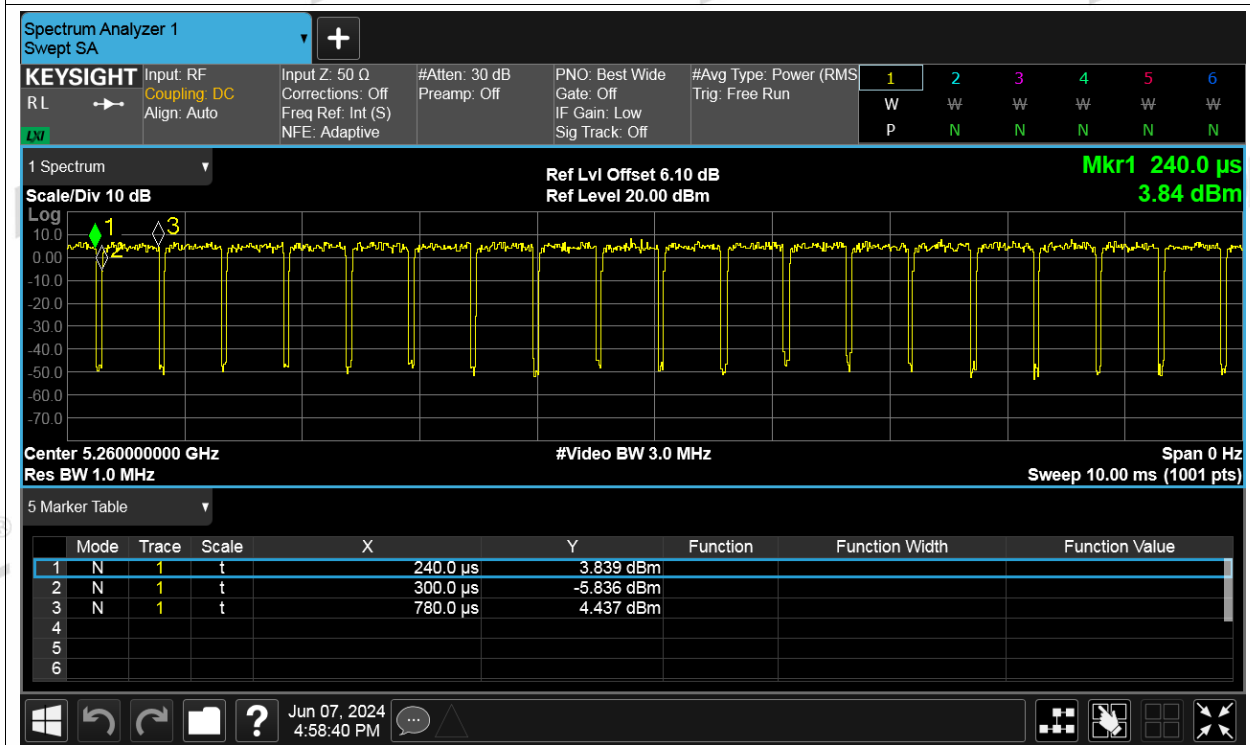


Duty Cycle NVNT ac20 5280MHz Sum

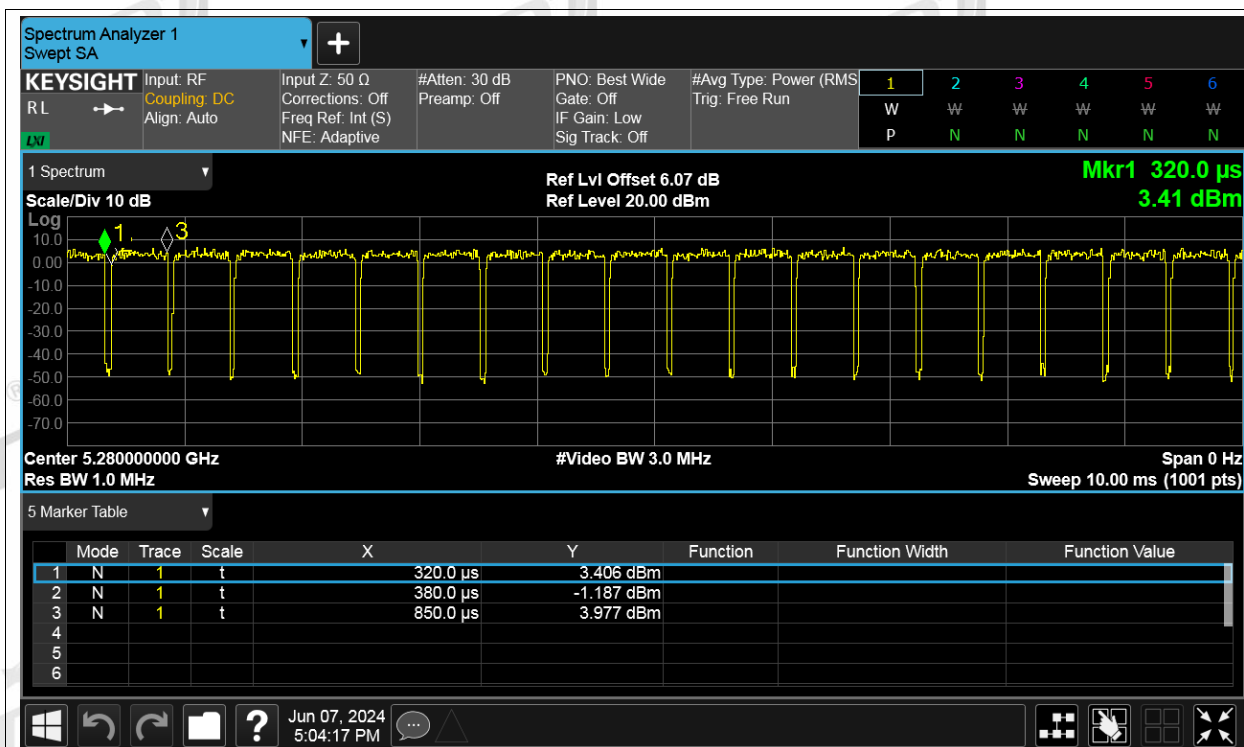


Duty Cycle NVNT ac20 5320MHz Sum

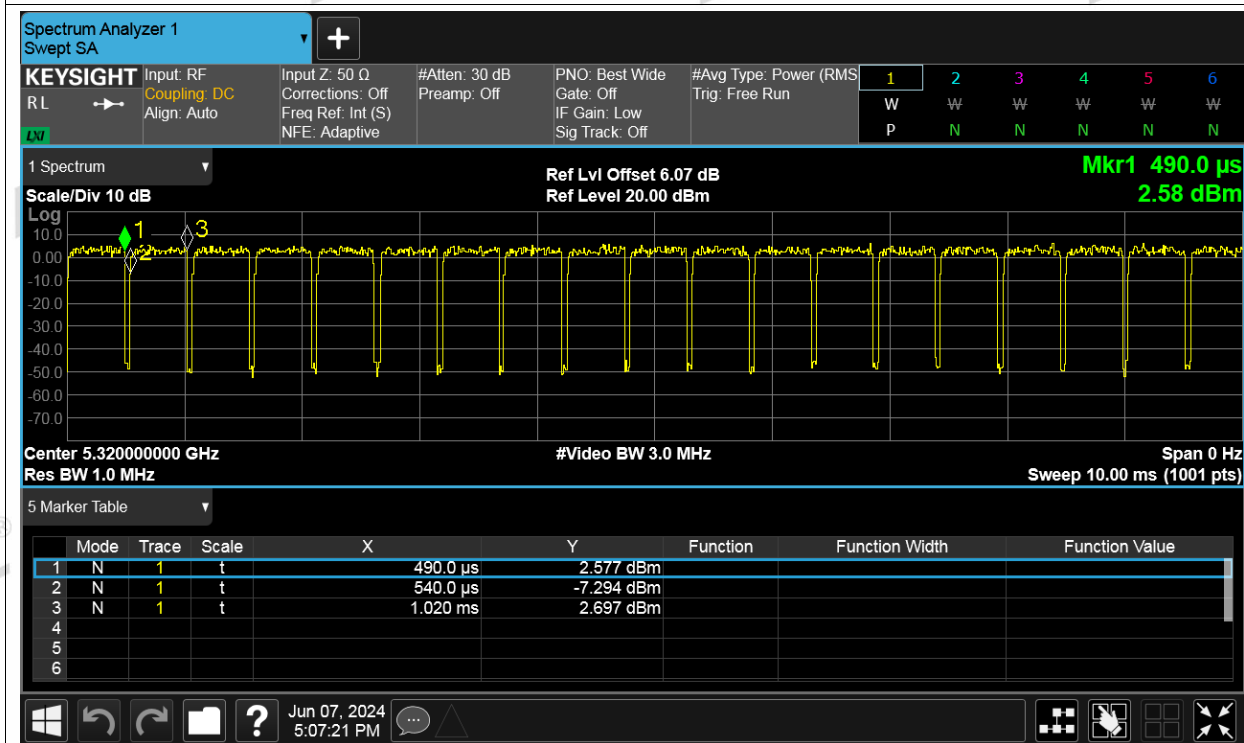


Duty Cycle NVNT ac20 5500MHz Sum

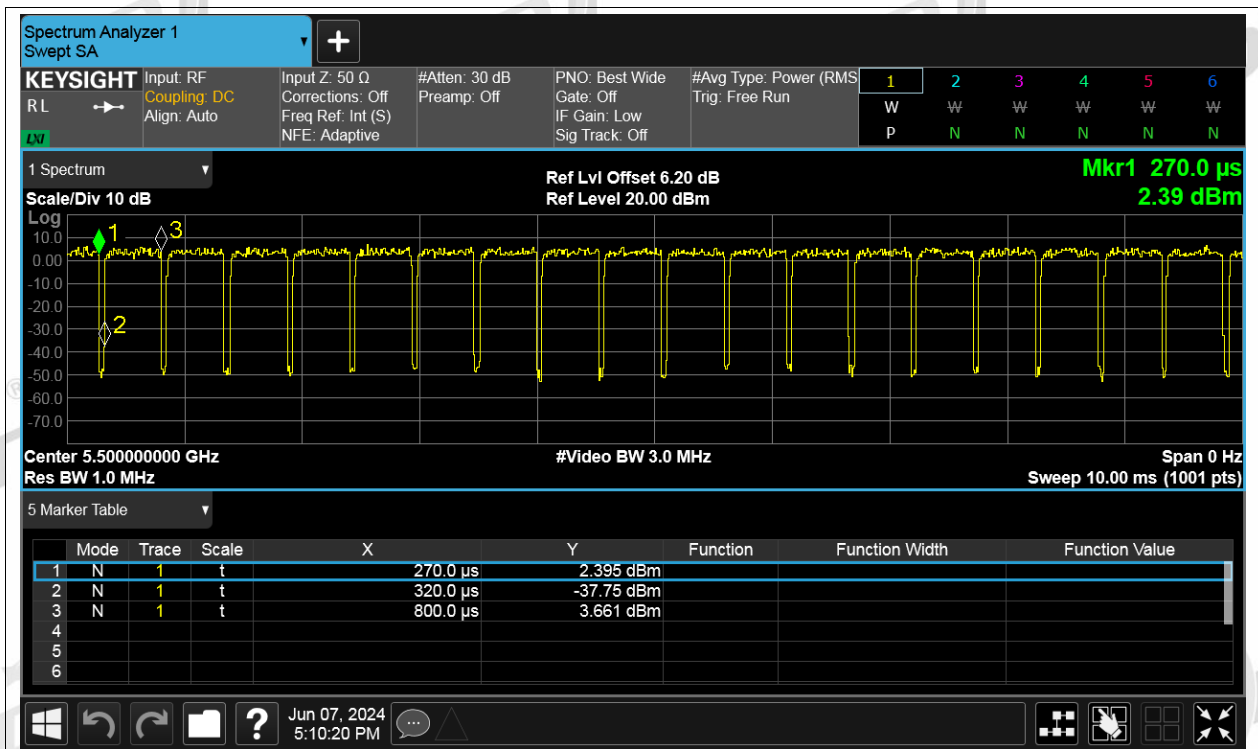


Duty Cycle NVNT ac20 5580MHz Sum

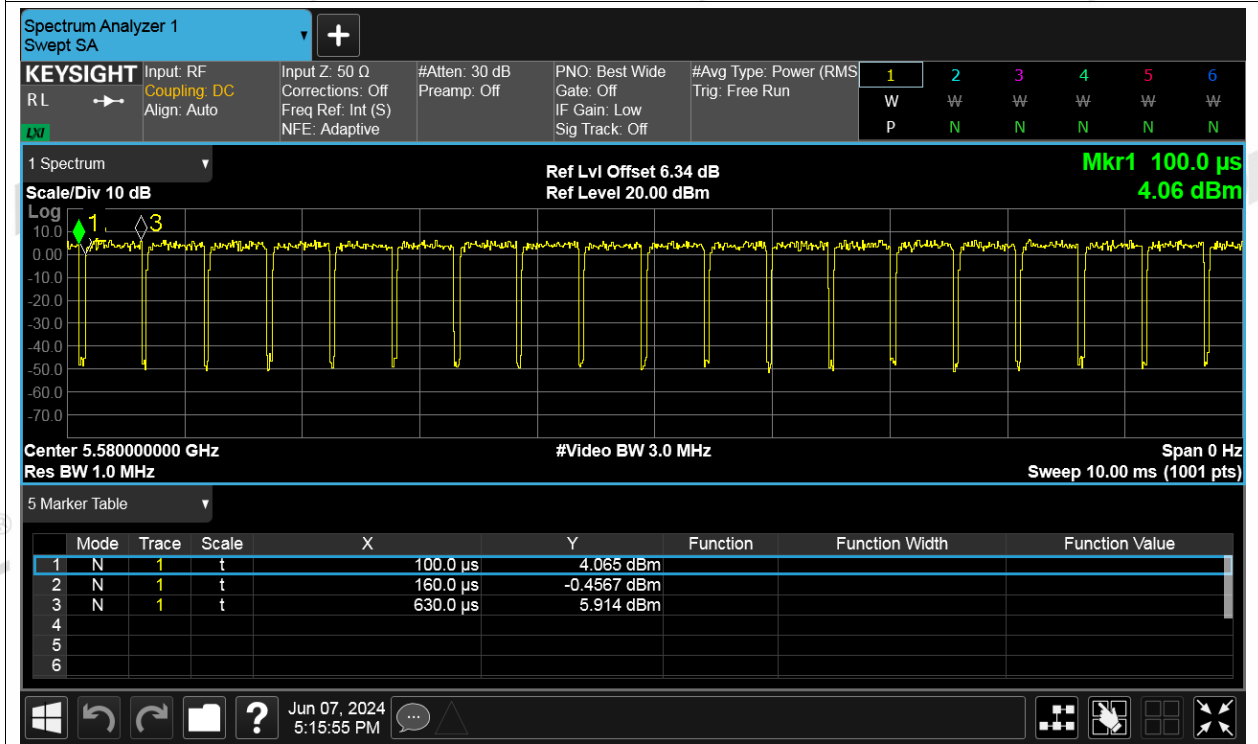


Duty Cycle NVNT ac20 5700MHz Sum

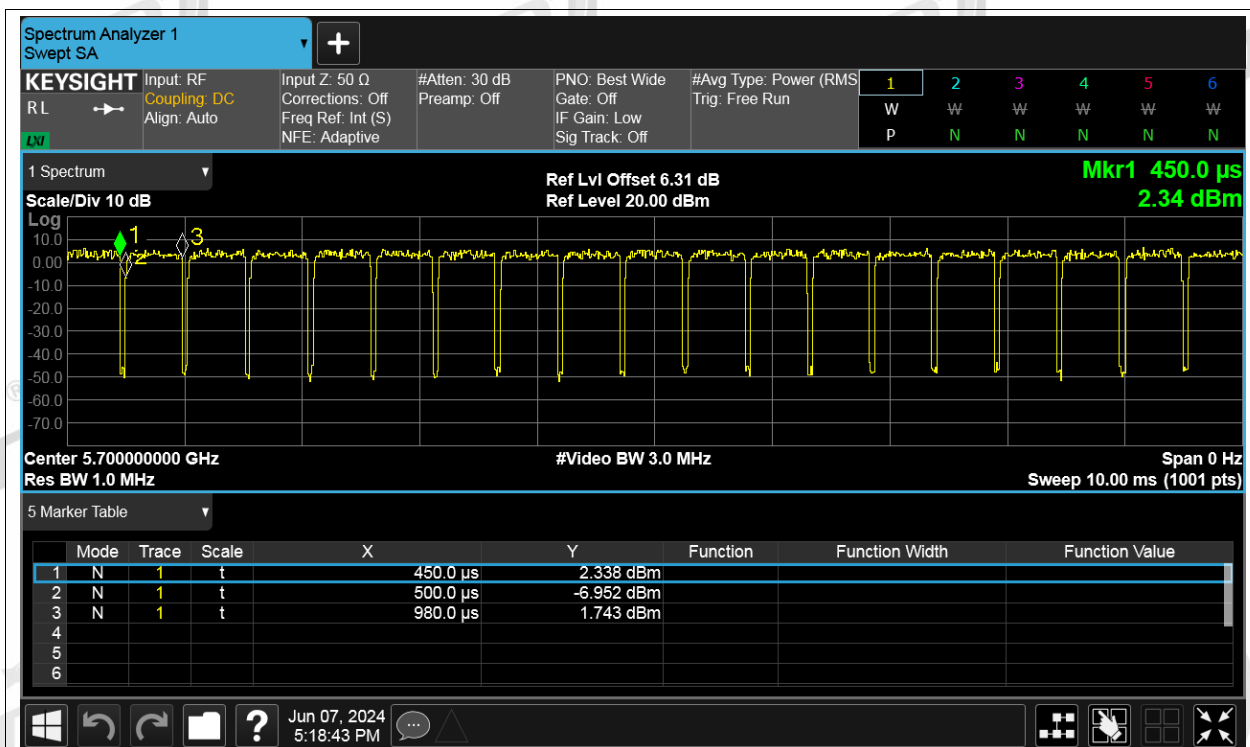


Duty Cycle NVNT ac20 5745MHz Sum

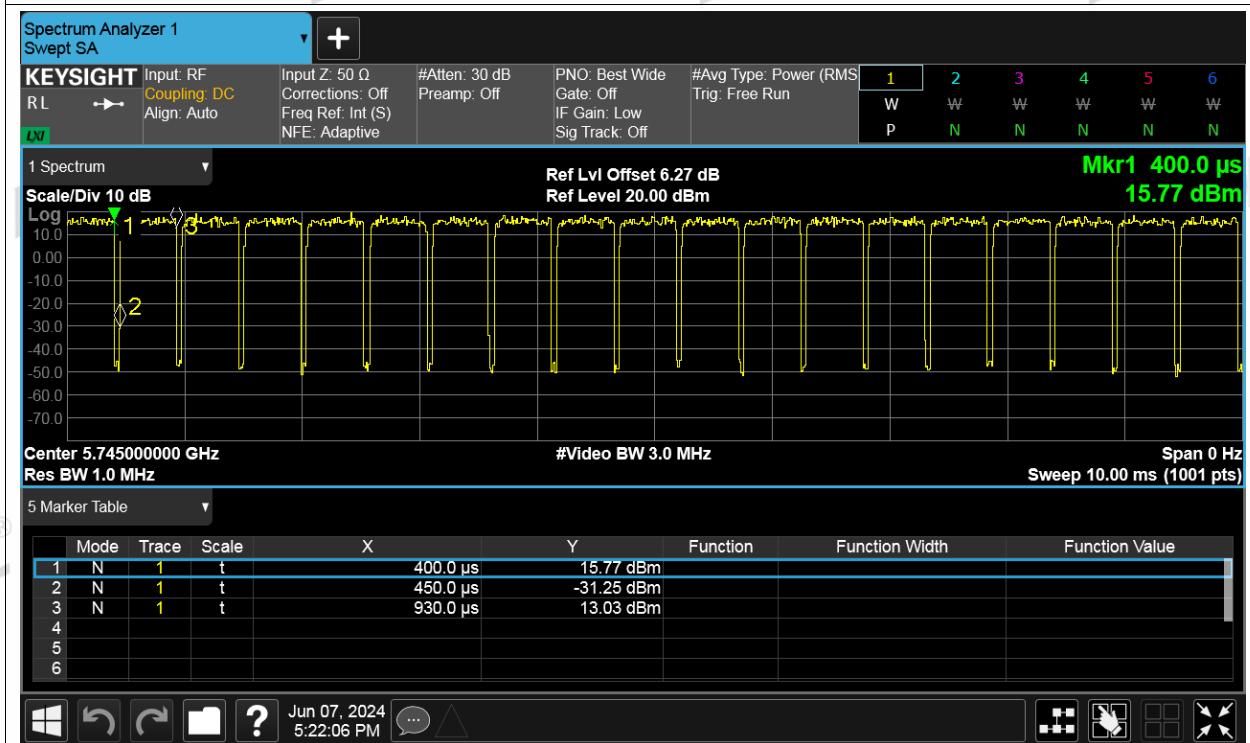


Duty Cycle NVNT ac20 5785MHz Sum

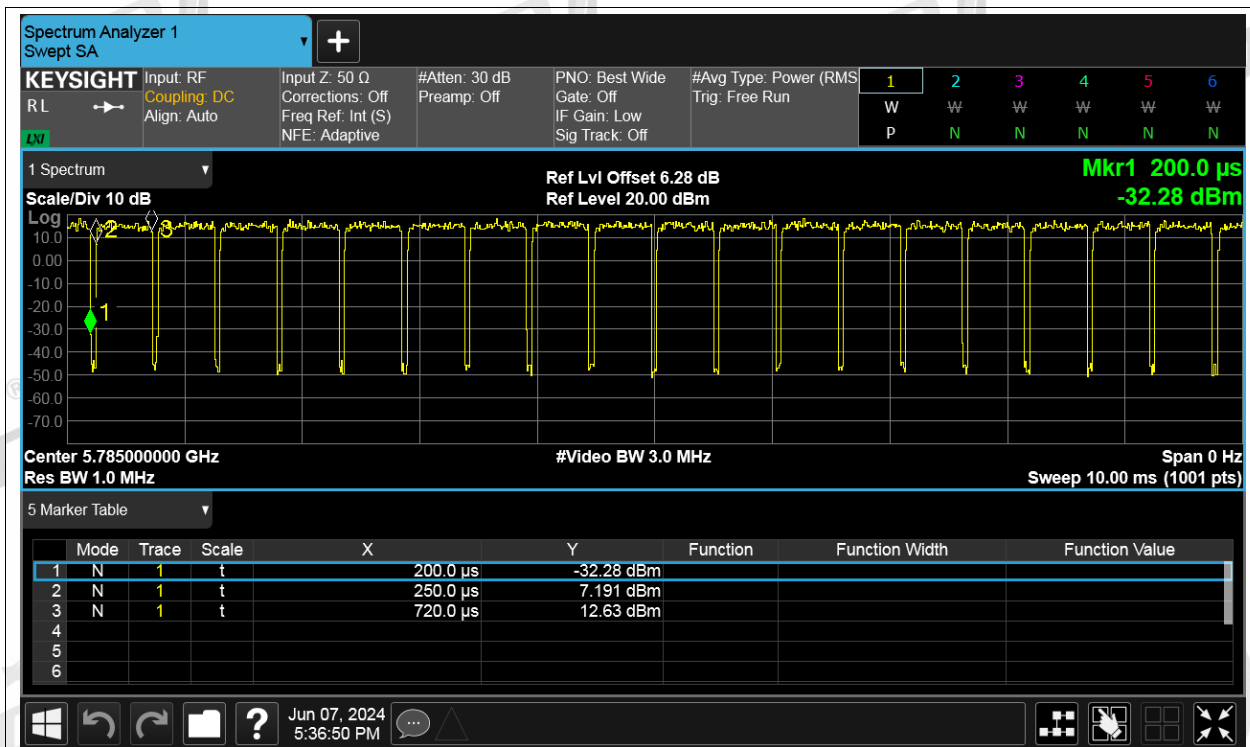


Duty Cycle NVNT ac20 5825MHz Sum

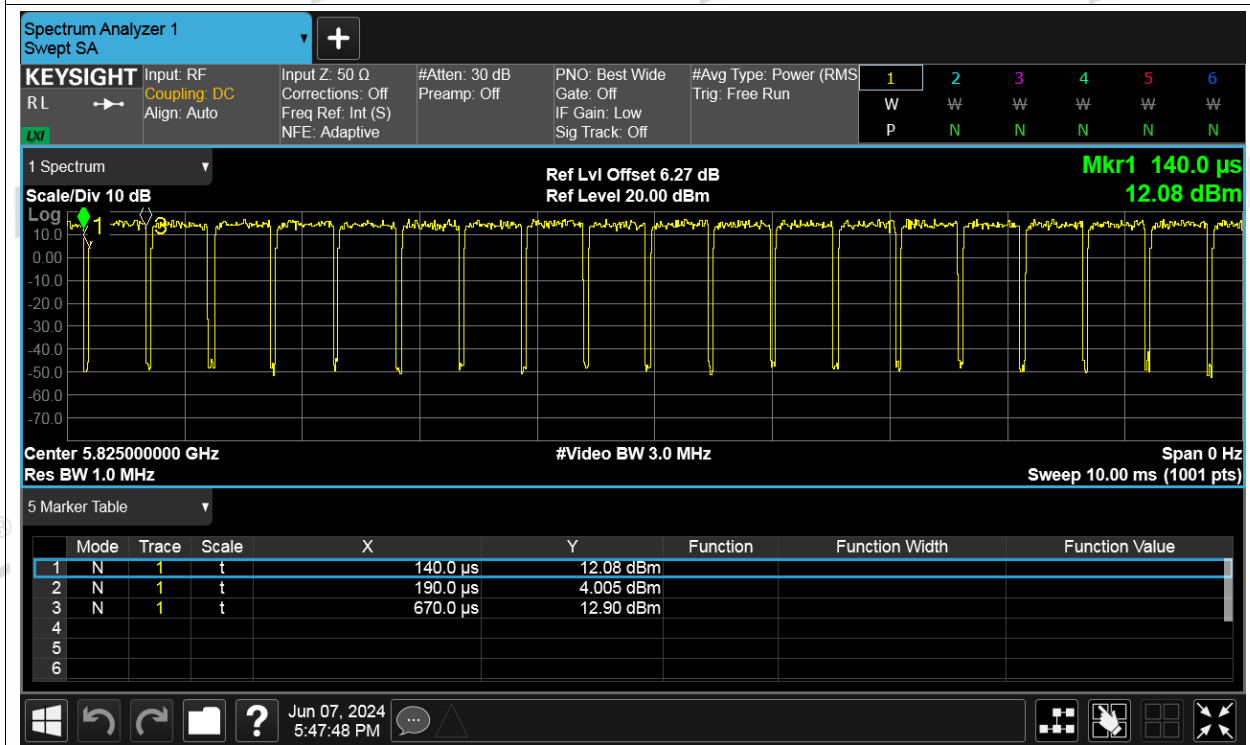


Duty Cycle NVNT ac40 5190MHz Sum

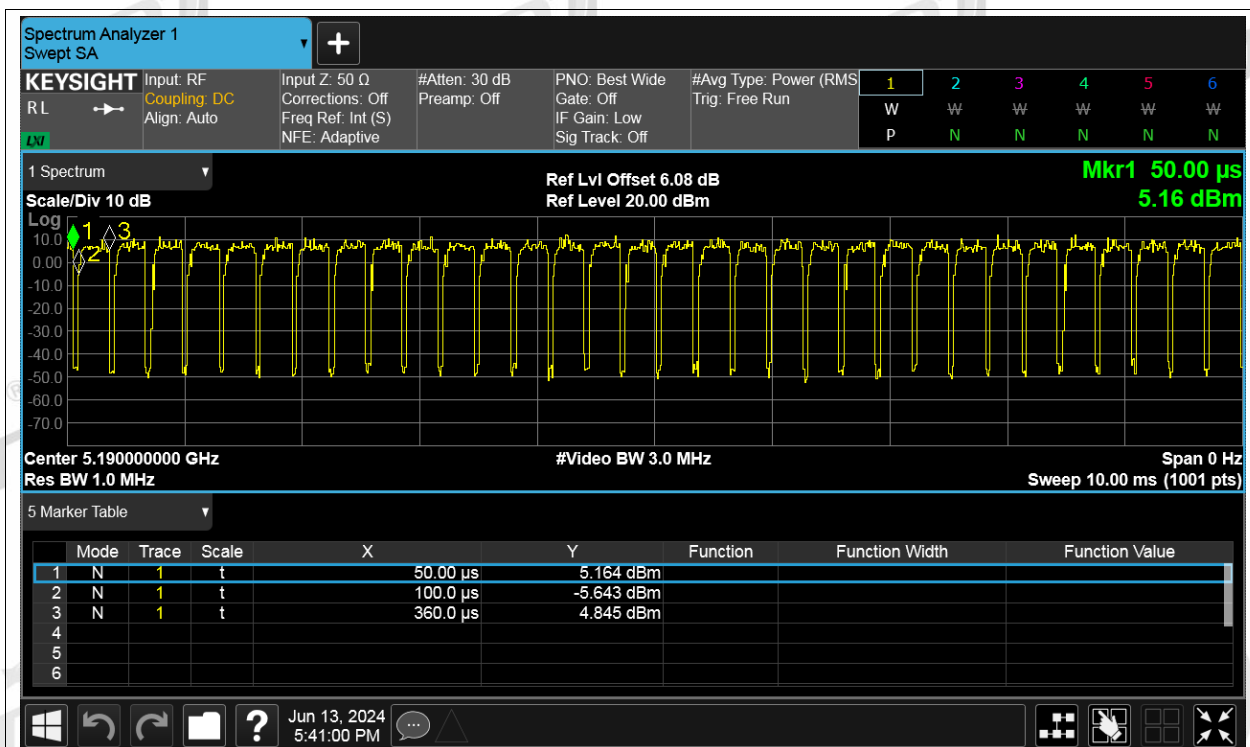


Duty Cycle NVNT ac40 5230MHz Sum

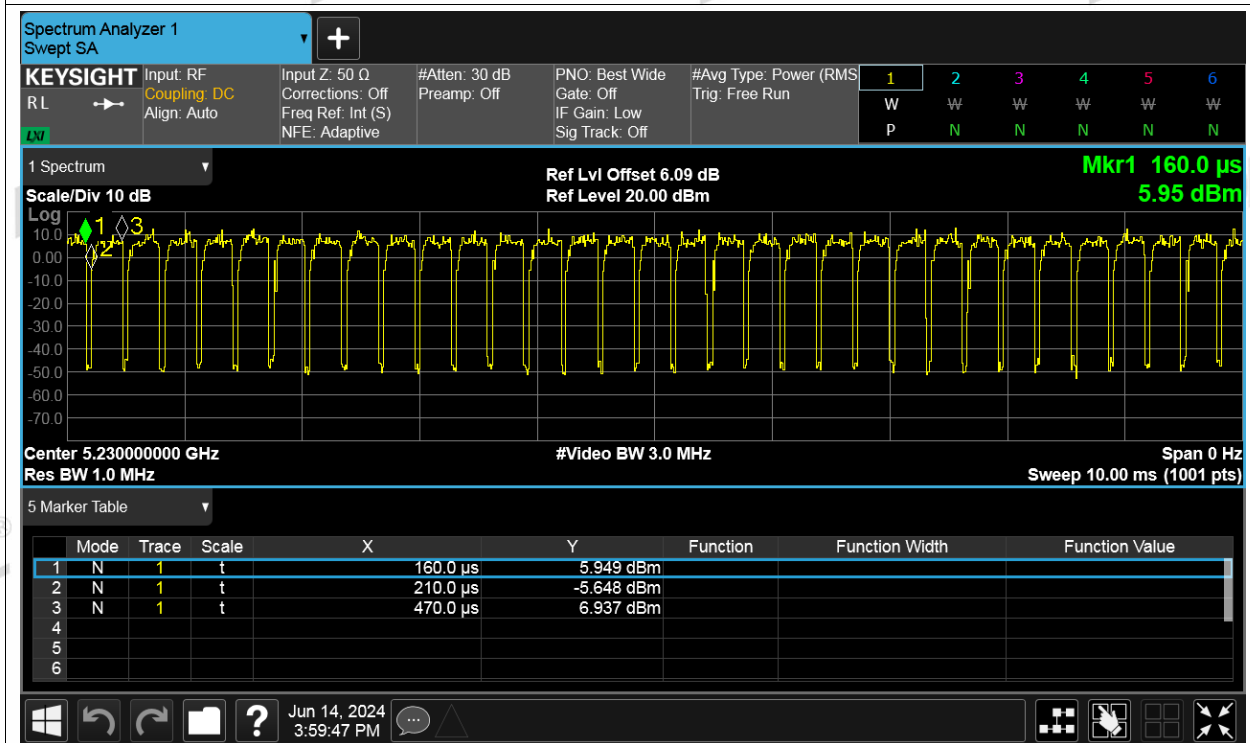


Duty Cycle NVNT ac40 5270MHz Sum

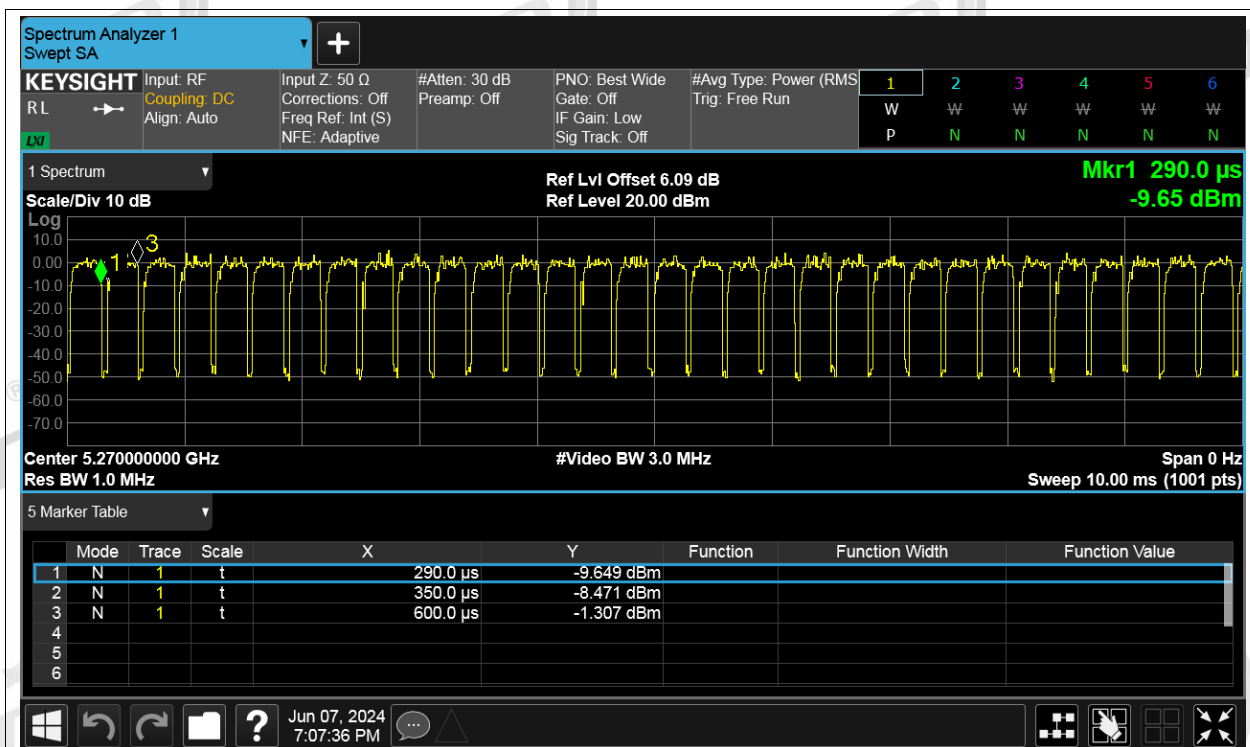


Duty Cycle NVNT ac40 5310MHz Sum

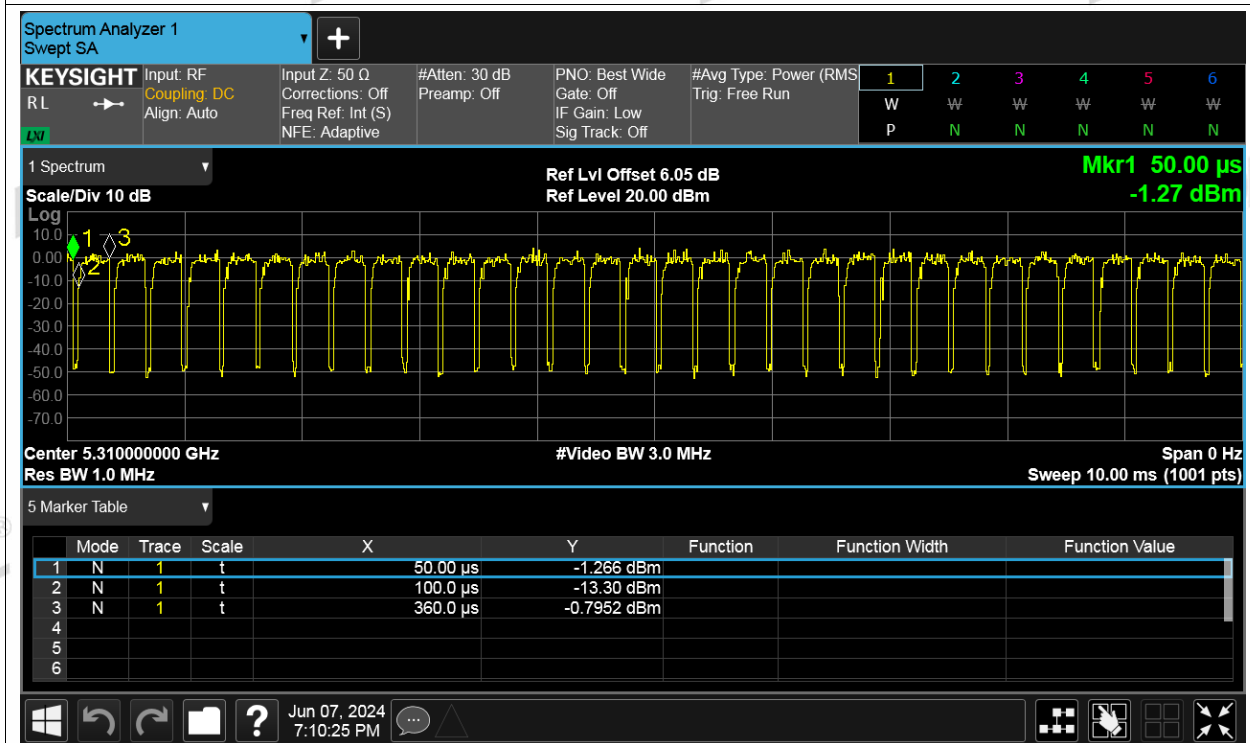


Duty Cycle NVNT ac40 5510MHz Sum

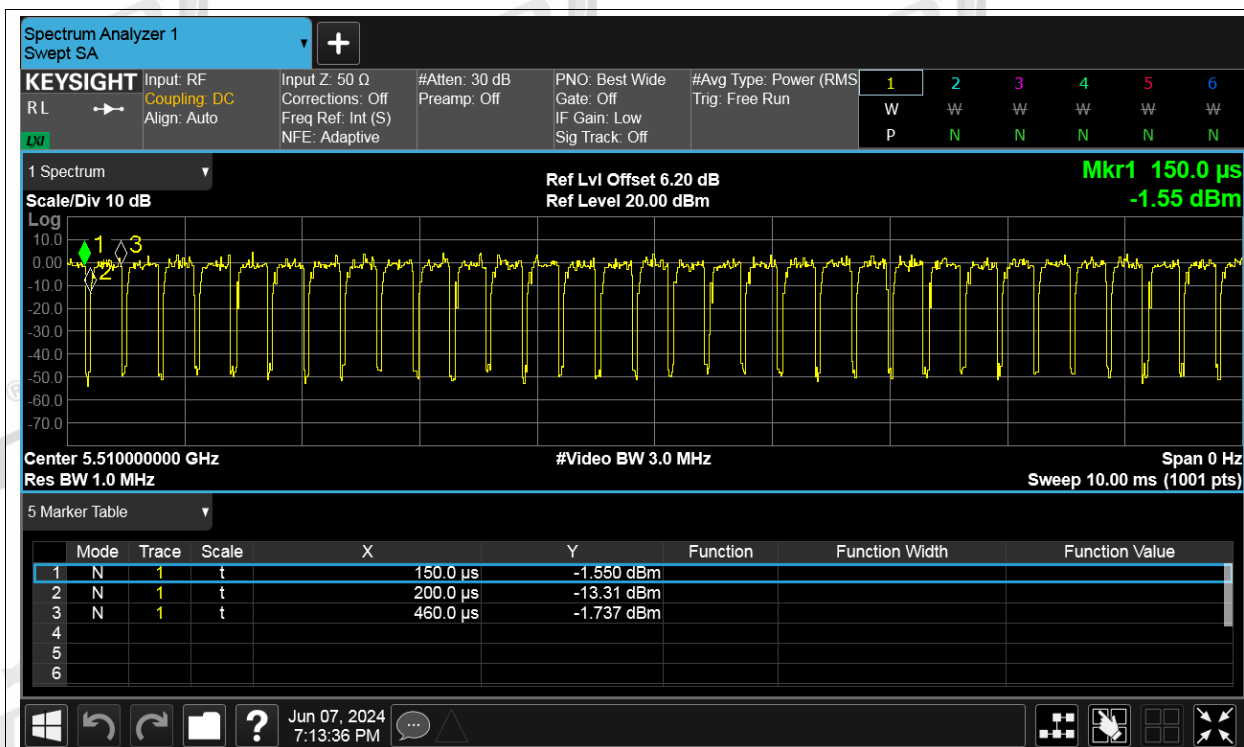


Duty Cycle NVNT ac40 5550MHz Sum

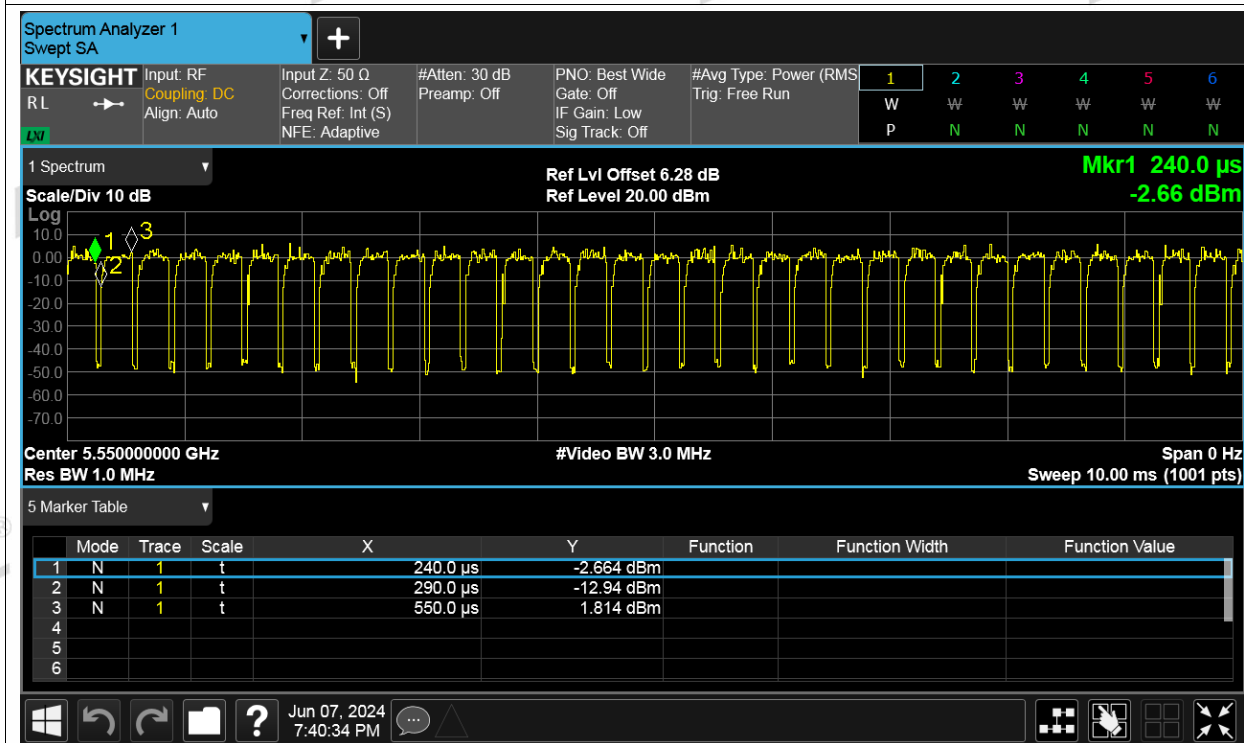


Duty Cycle NVNT ac40 5670MHz Sum

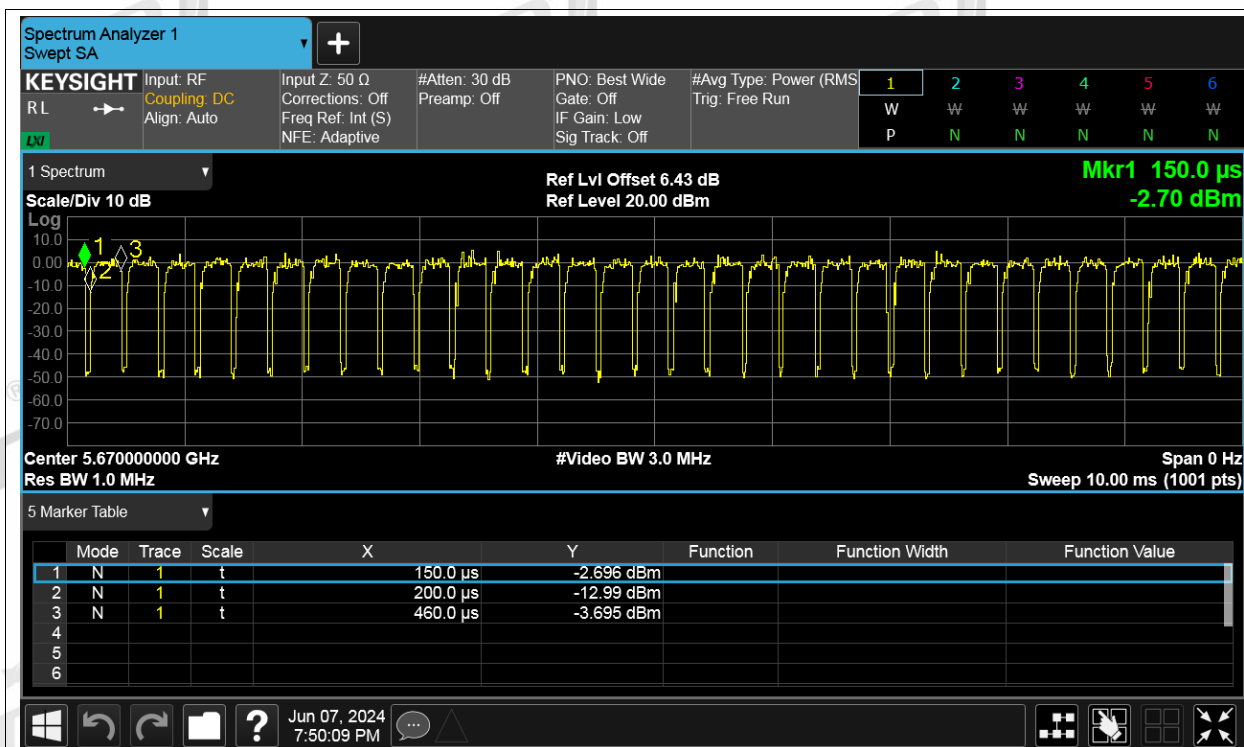


Duty Cycle NVNT ac40 5755MHz Sum

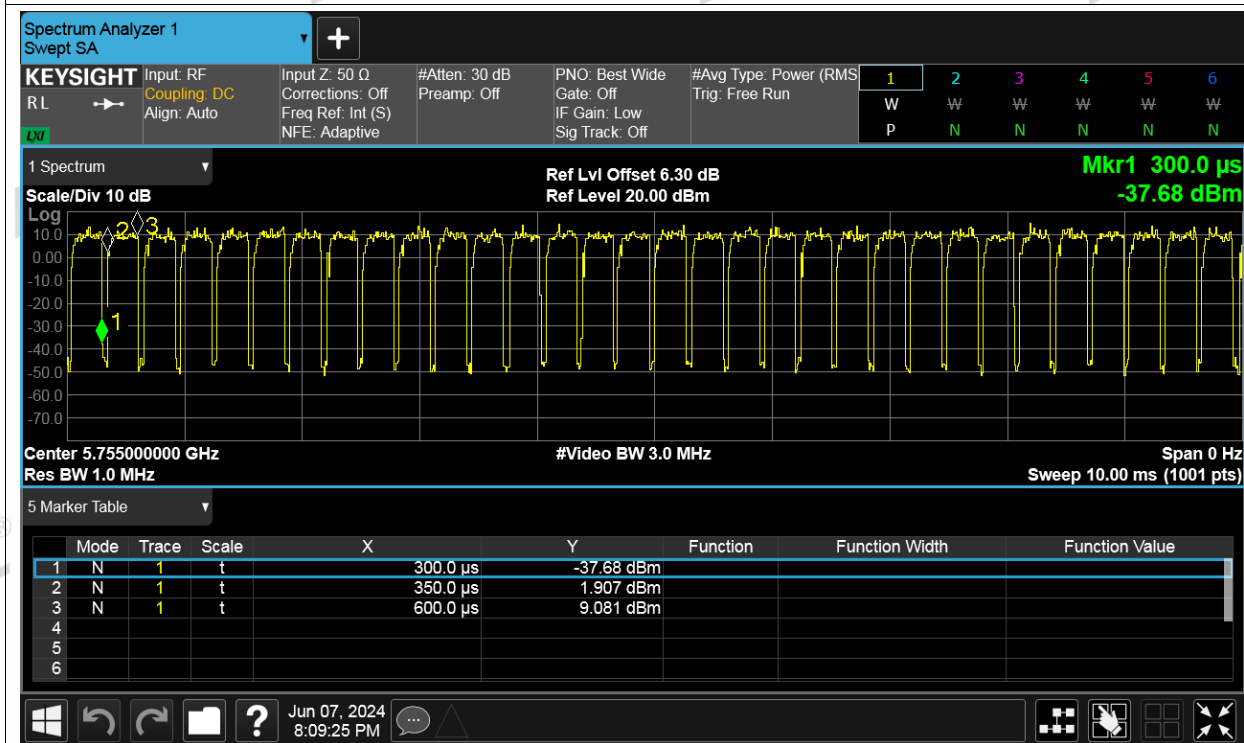


Duty Cycle NVNT ac40 5795MHz Sum

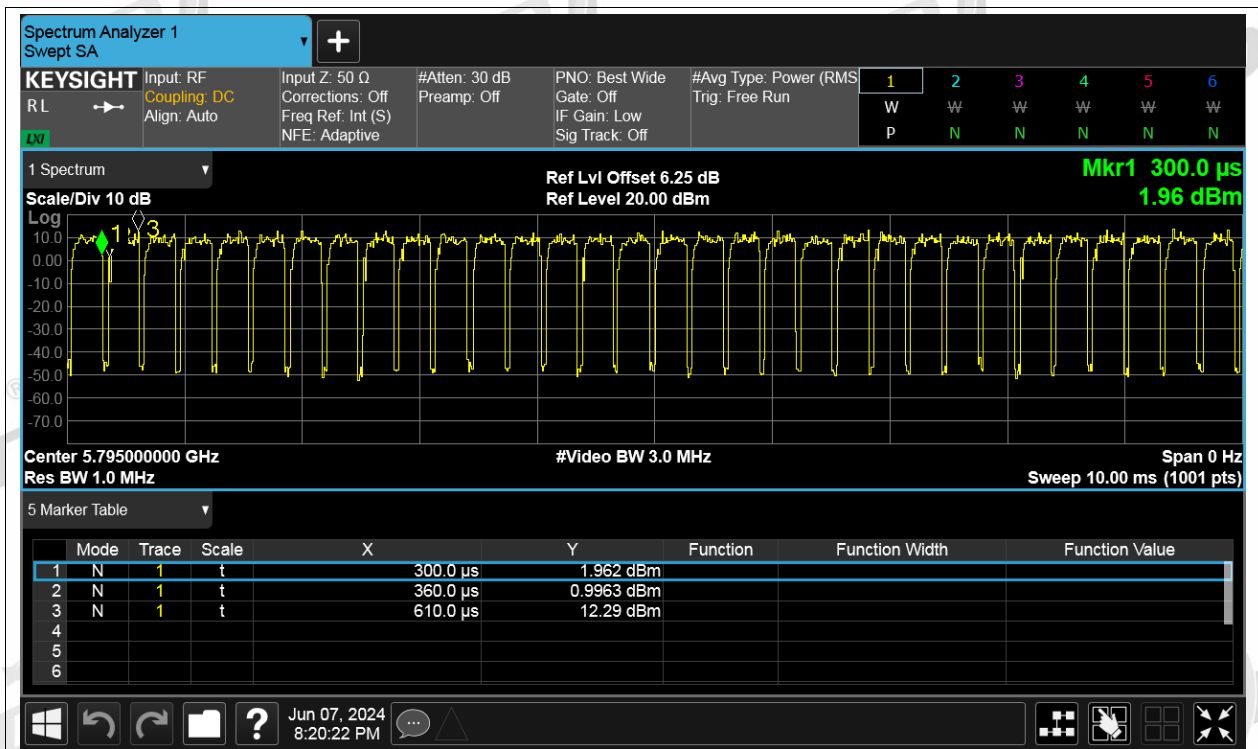


Duty Cycle NVNT ac80 5210MHz Sum

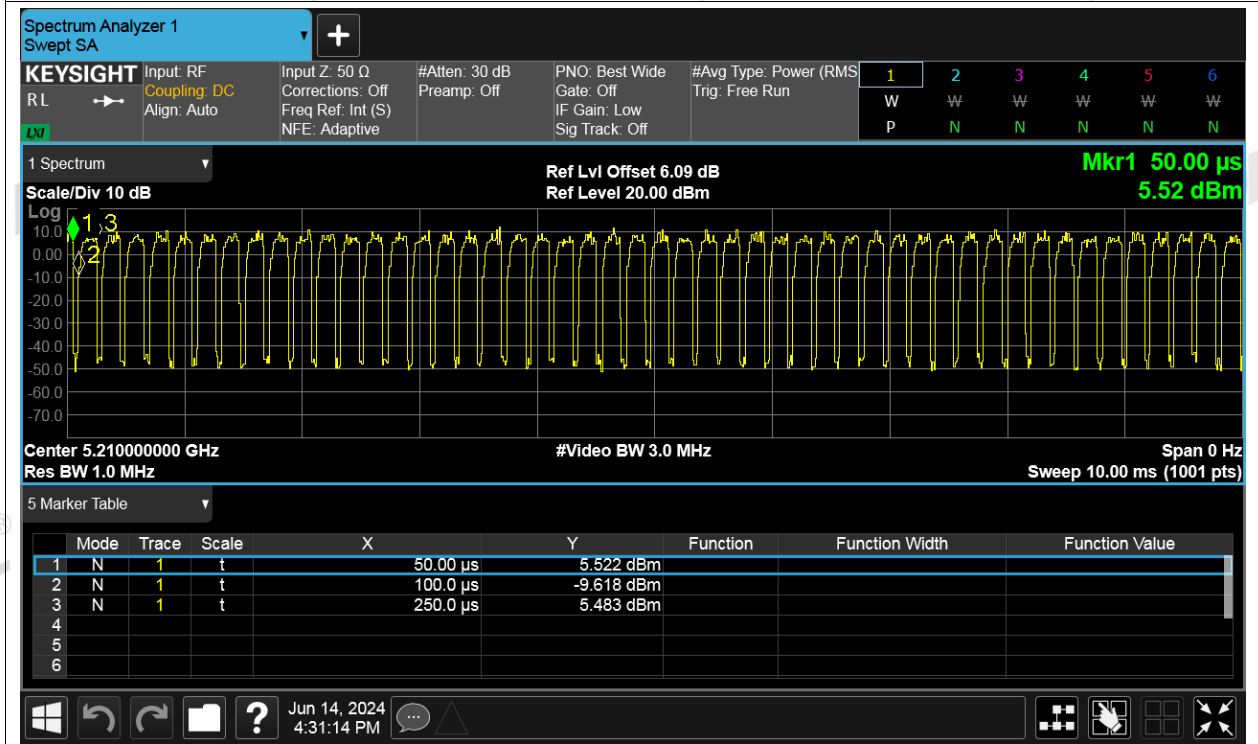


Duty Cycle NVNT ac80 5290MHz Sum

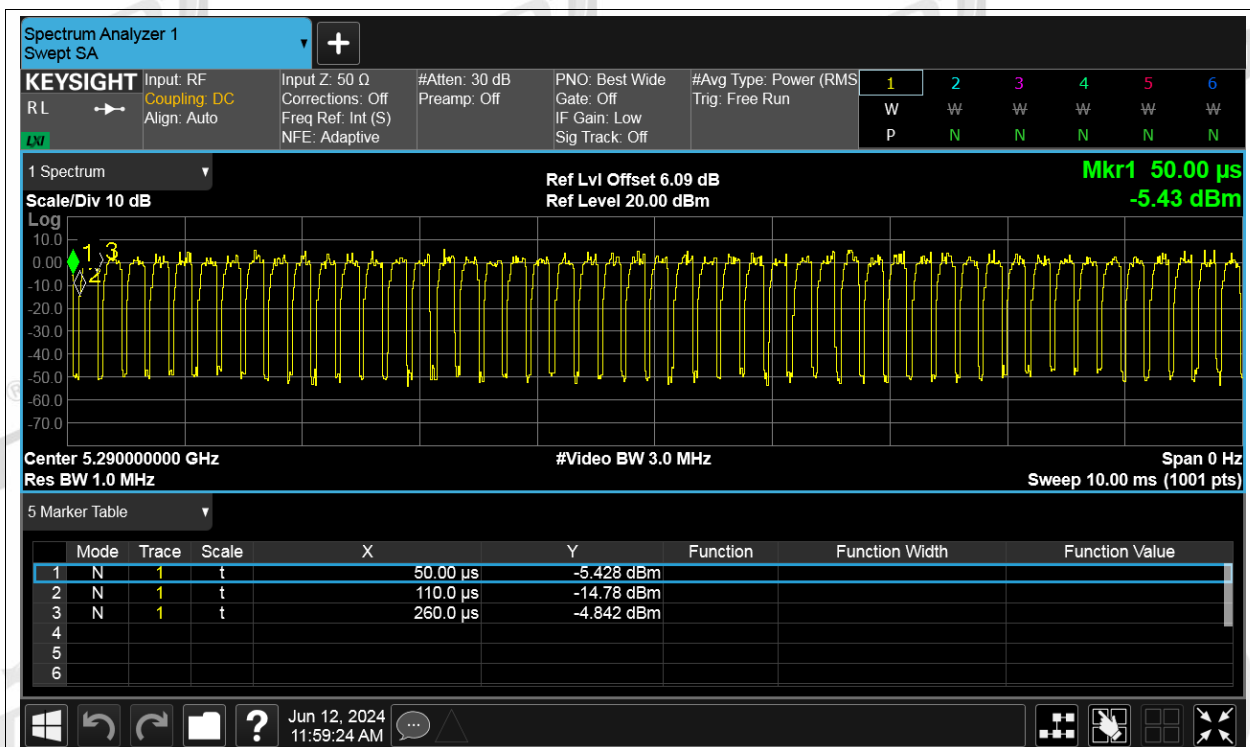


Duty Cycle NVNT ac80 5530MHz Sum

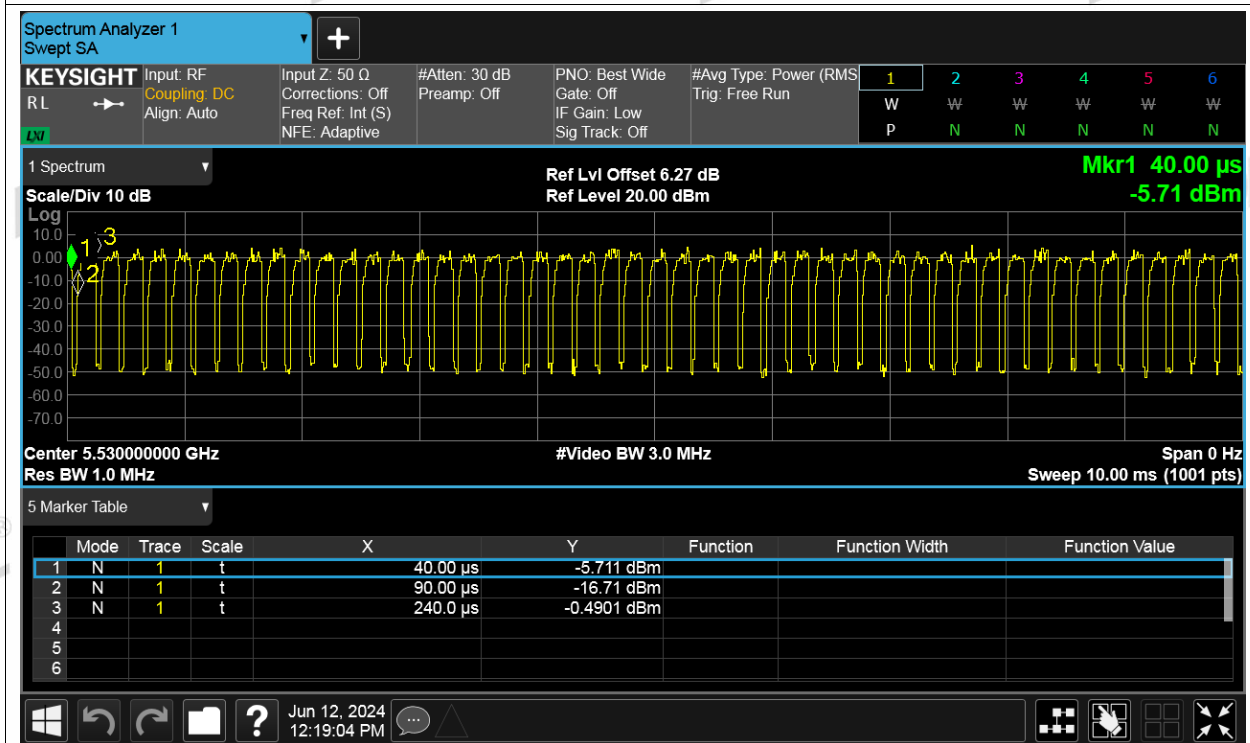


Duty Cycle NVNT ac80 5610MHz Sum

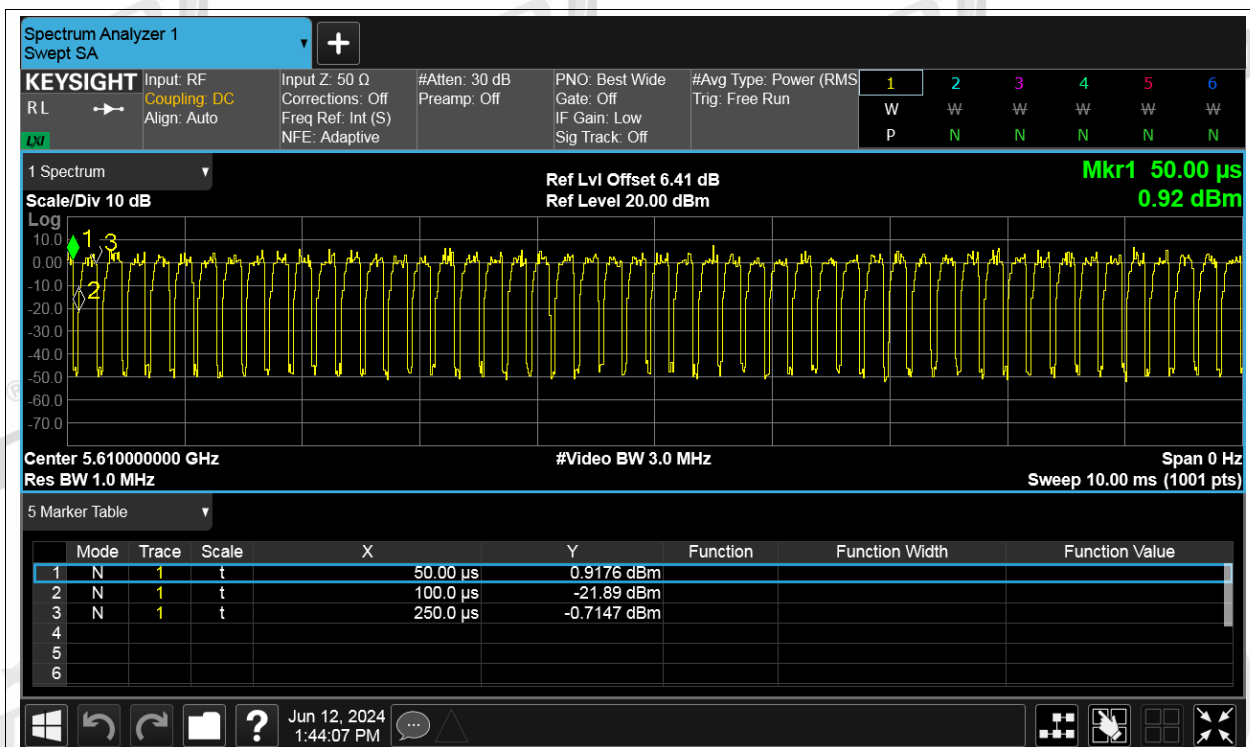

Duty Cycle NVNT ac80 5775MHz Sum

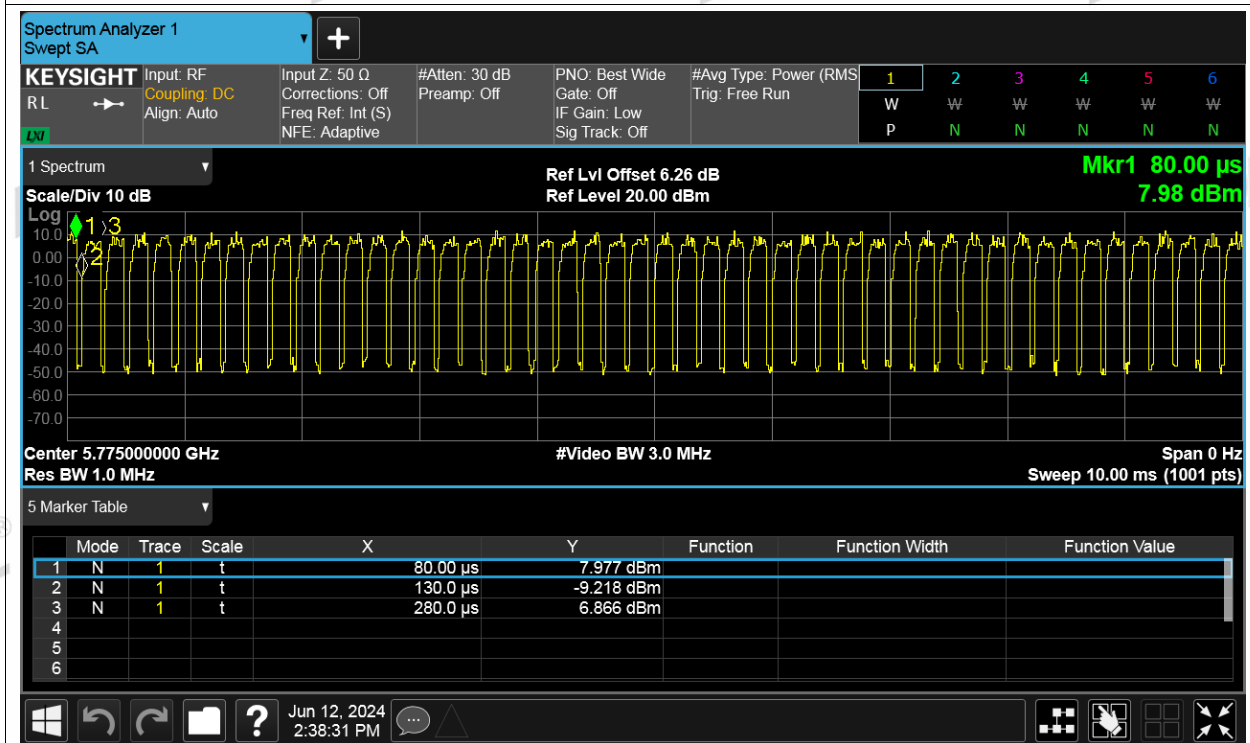


Duty Cycle NVNT ax160 5250MHz Sum

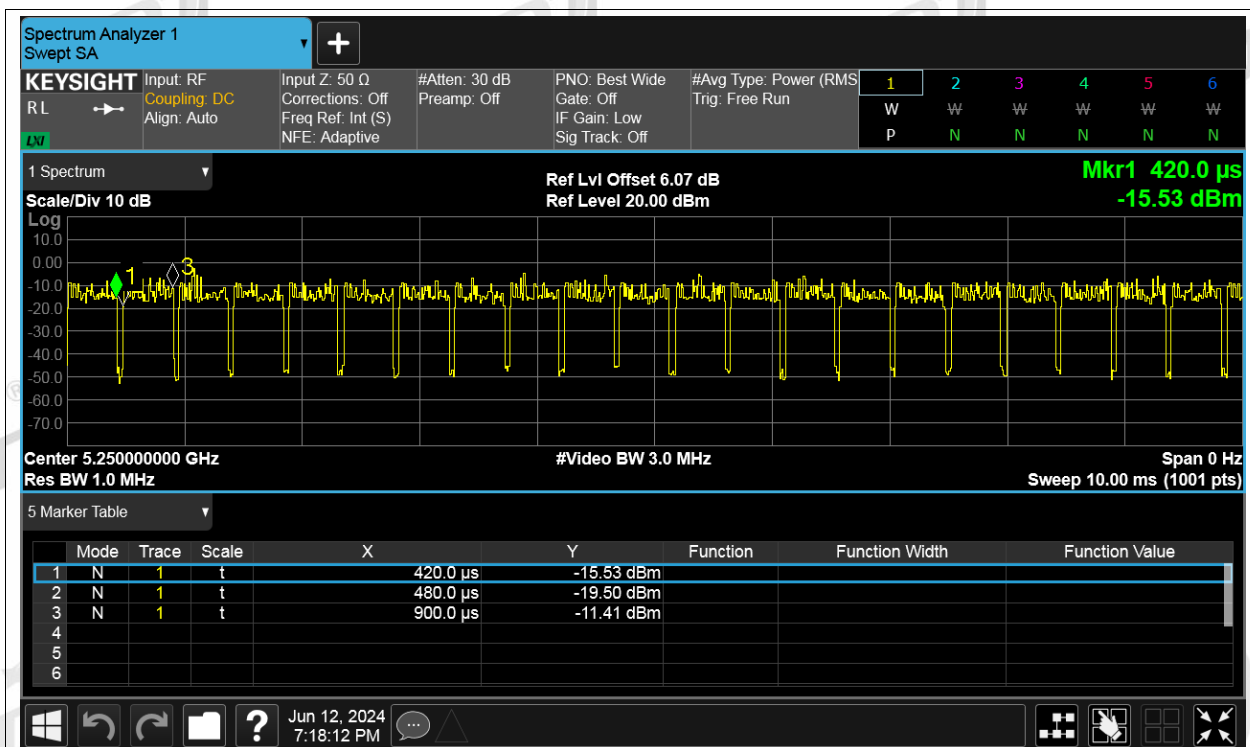


Duty Cycle NVNT ax160 5570MHz Sum




Duty Cycle NVNT ax20 5180MHz Sum

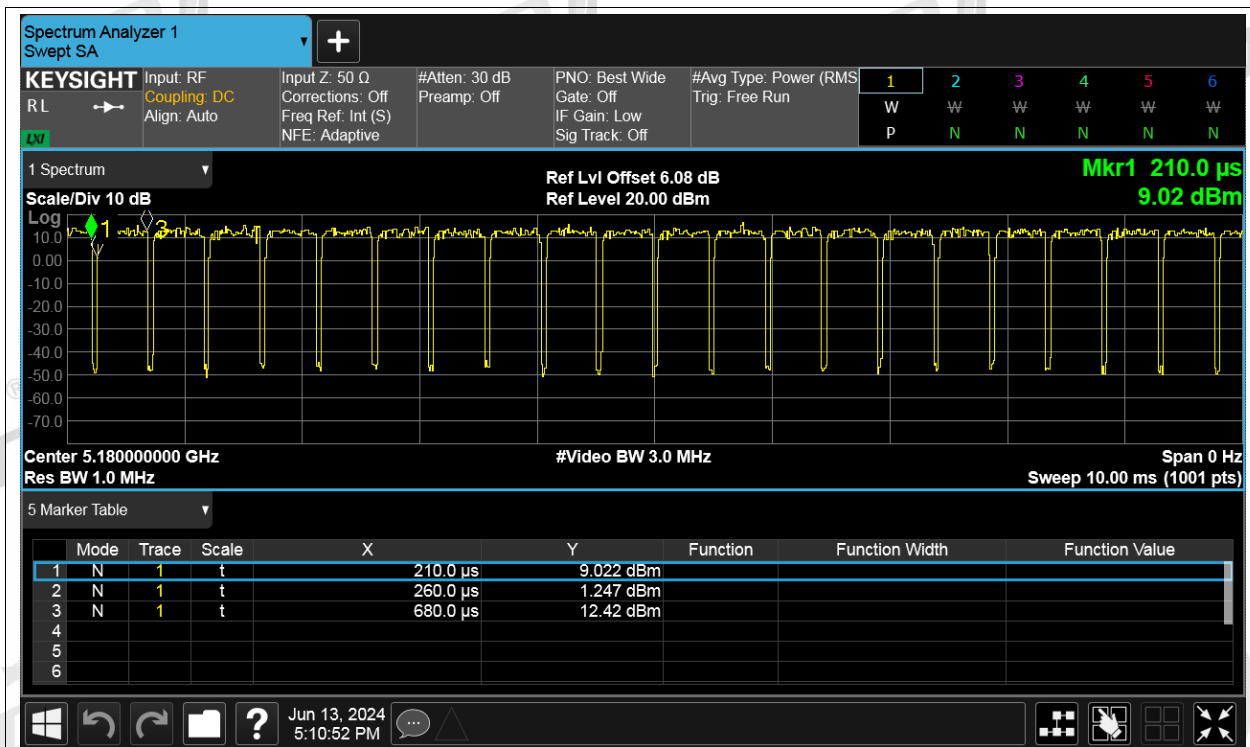


Duty Cycle NVNT ax20 5200MHz Sum

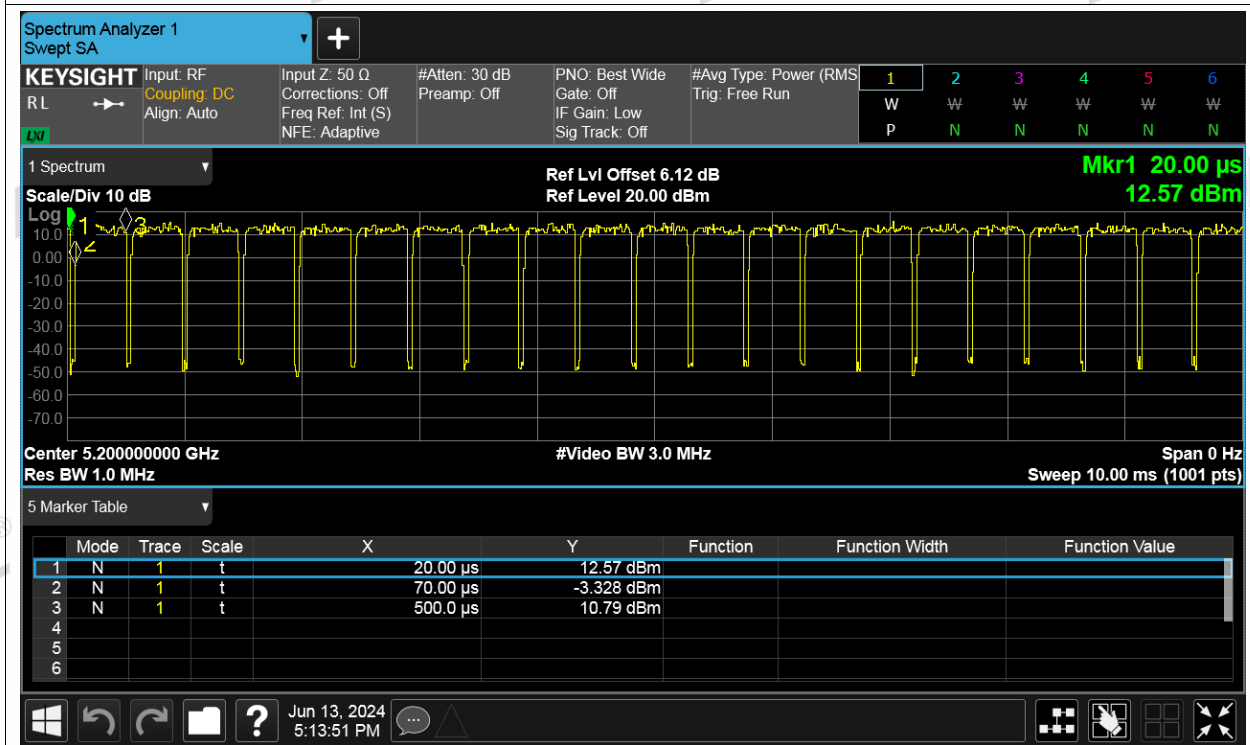


Duty Cycle NVNT ax20 5240MHz Sum

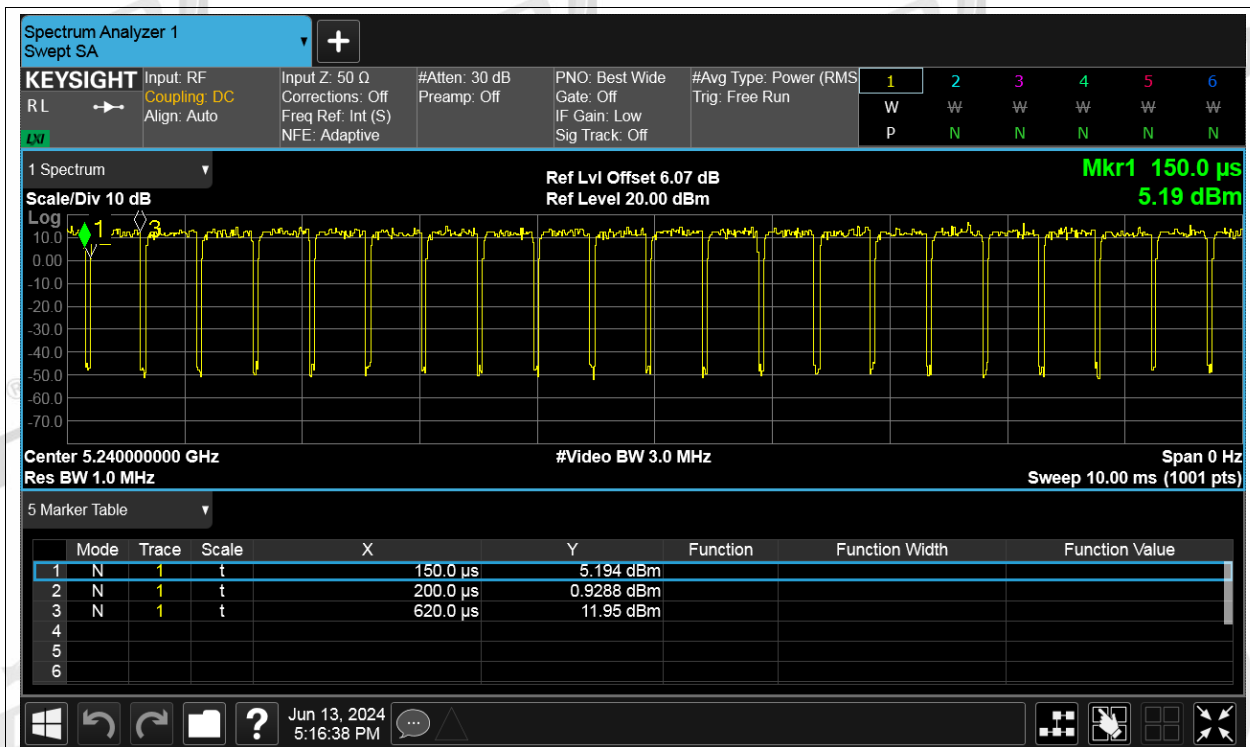


Duty Cycle NVNT ax20 5260MHz Sum

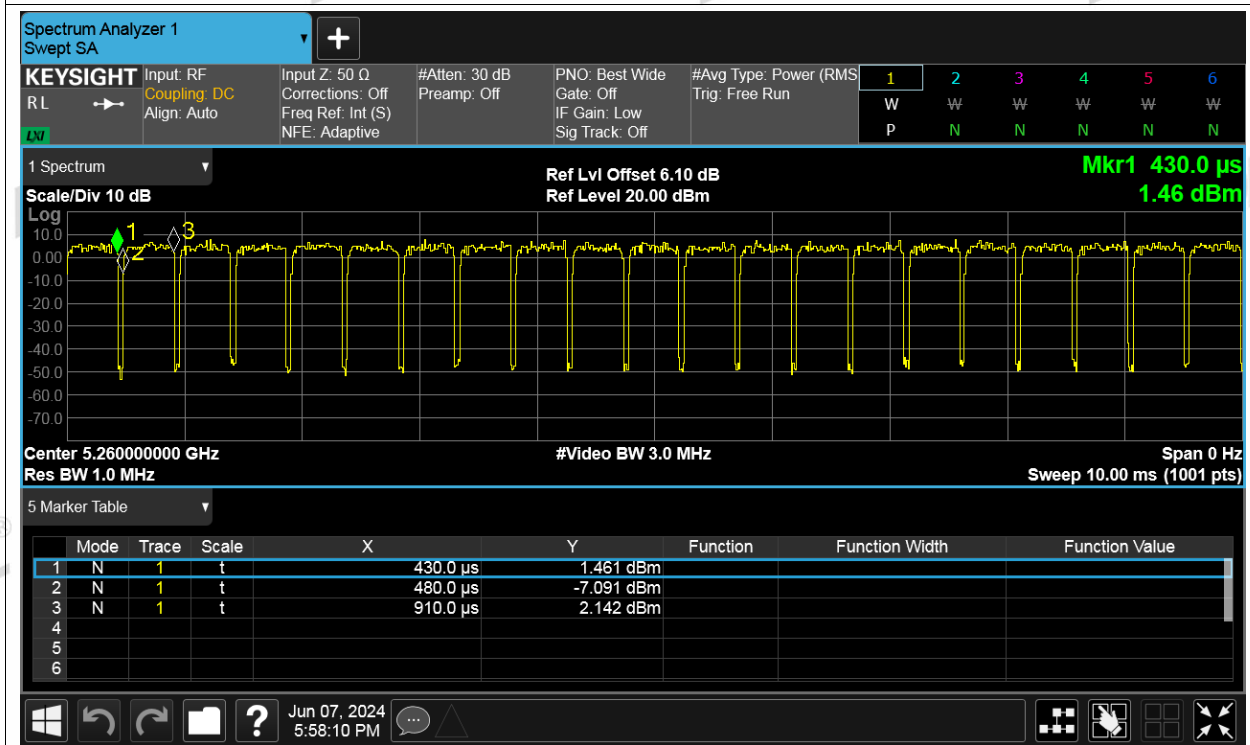


Duty Cycle NVNT ax20 5280MHz Sum

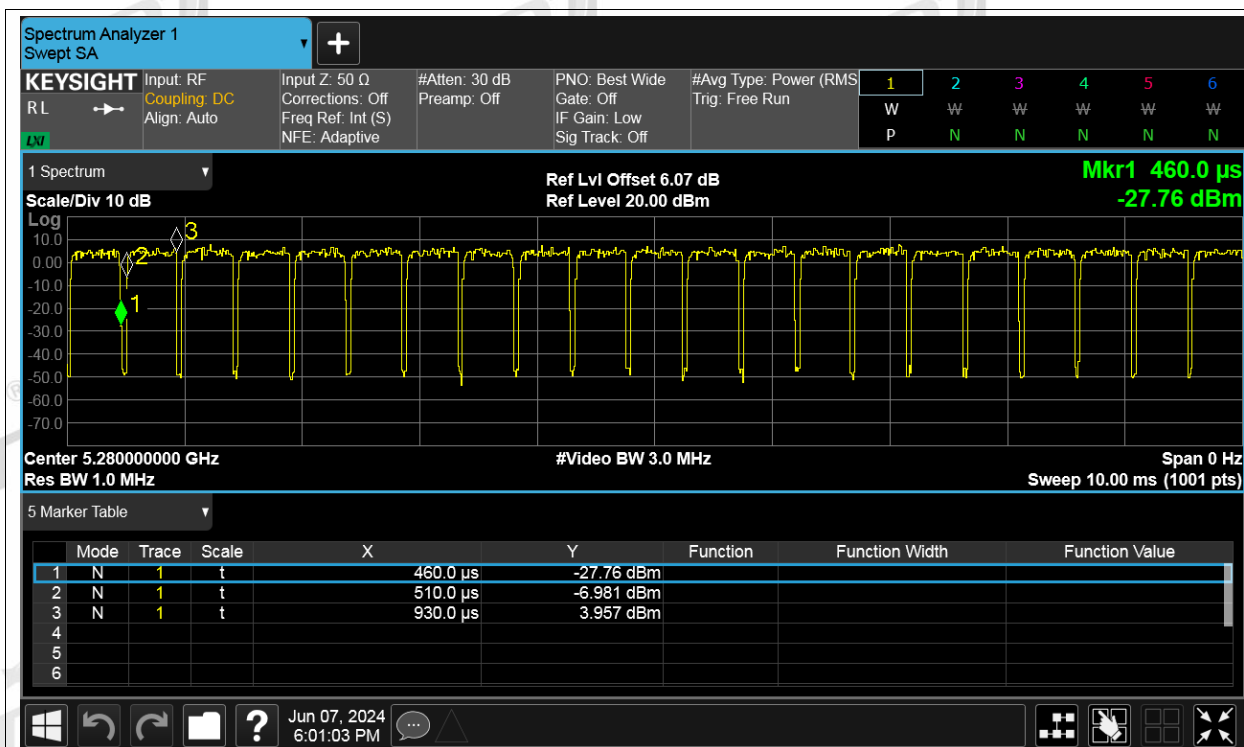


Duty Cycle NVNT ax20 5320MHz Sum

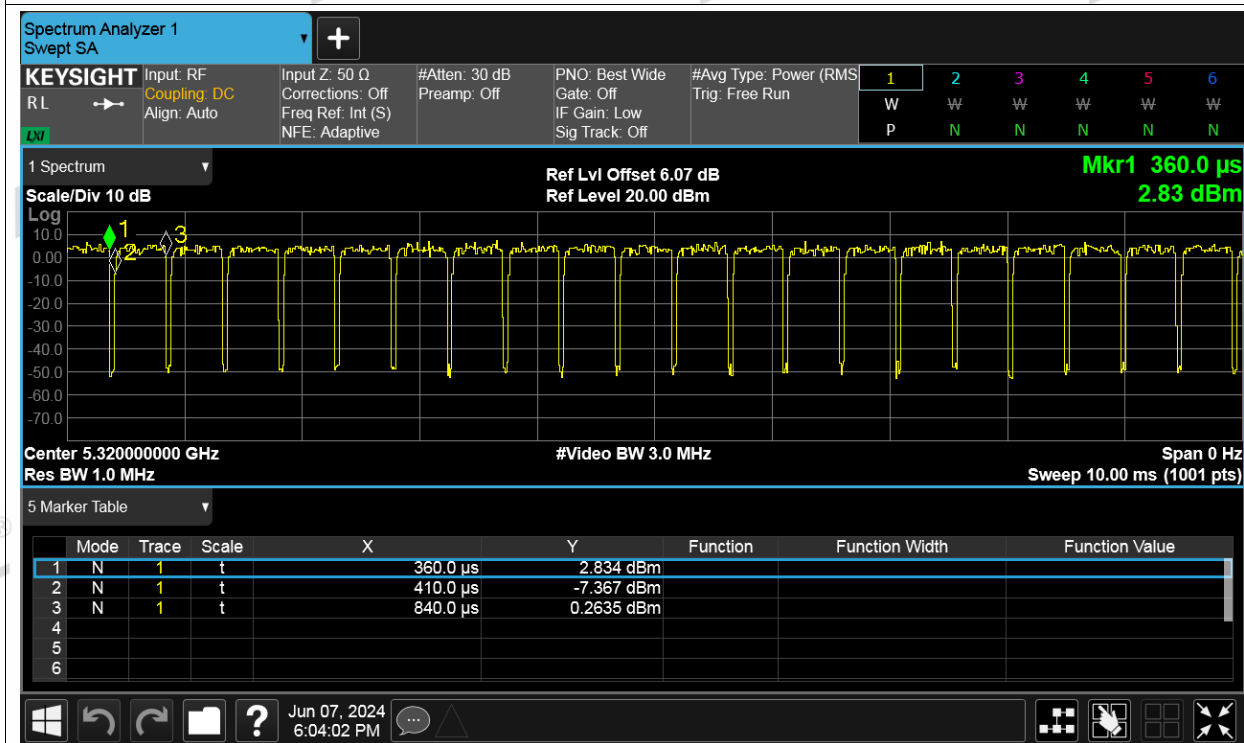


Duty Cycle NVNT ax20 5500MHz Sum

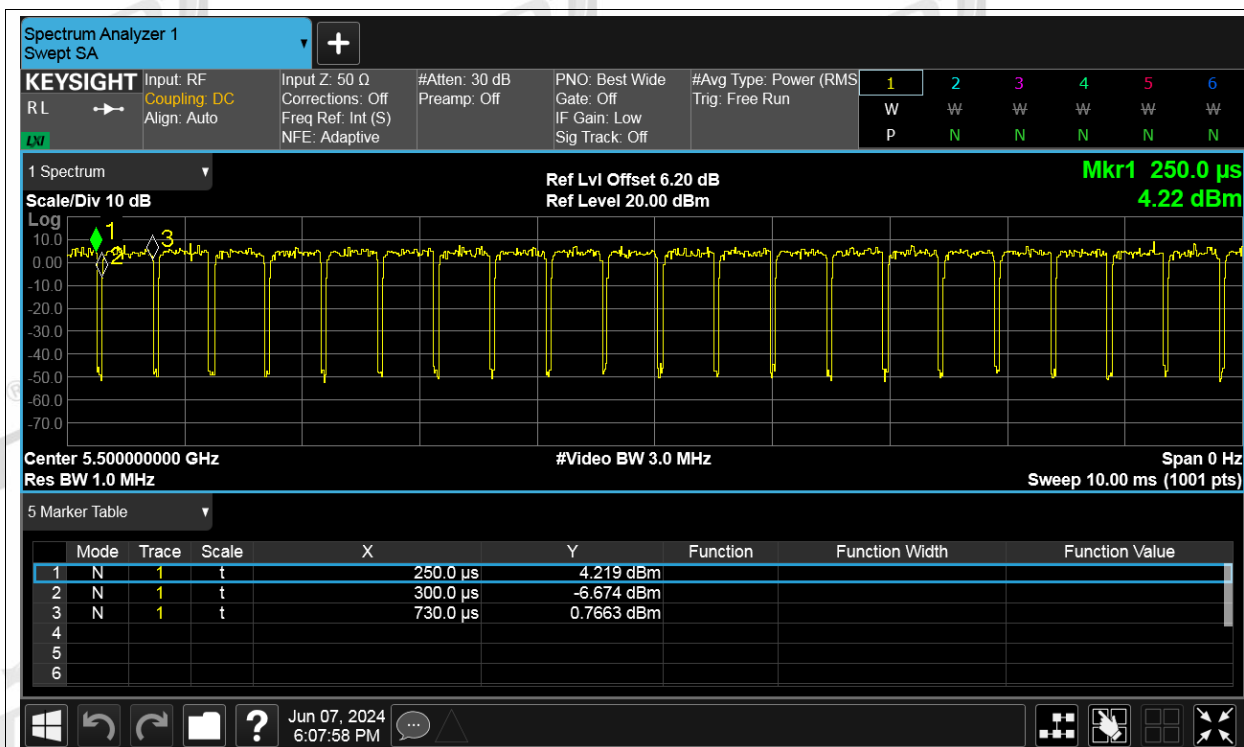


Duty Cycle NVNT ax20 5580MHz Sum

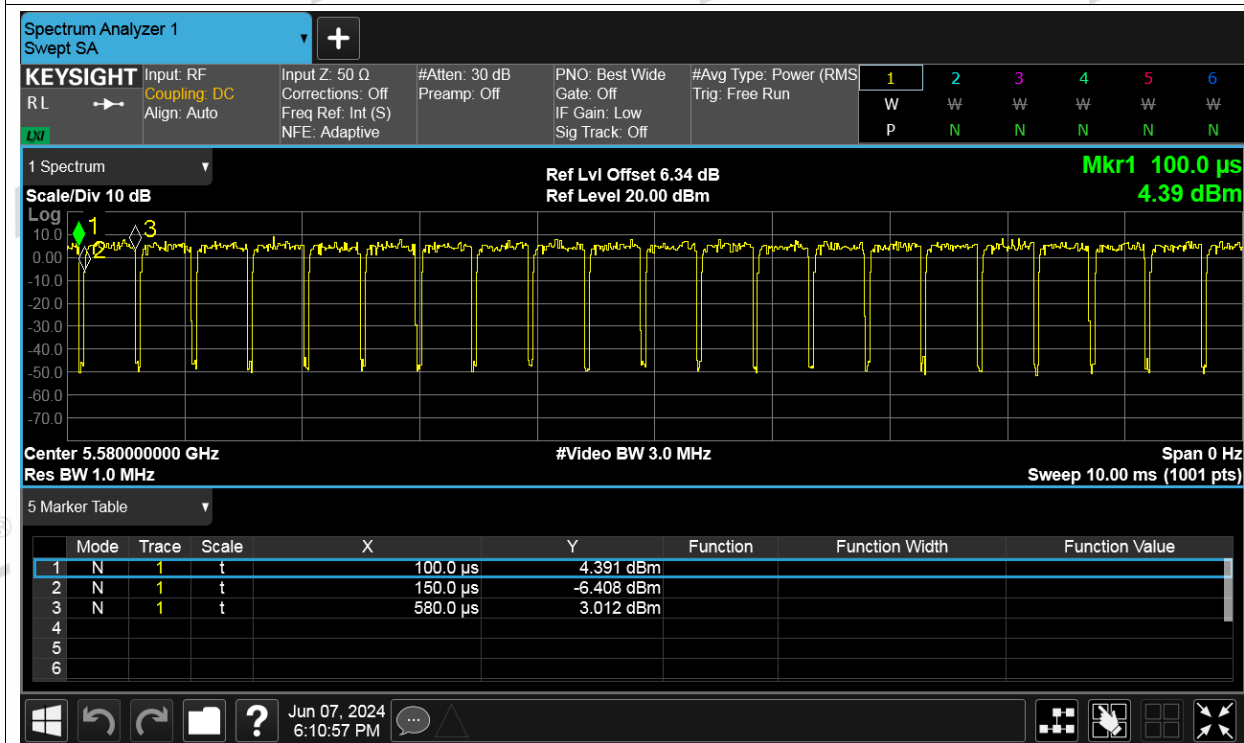

Duty Cycle NVNT ax20 5700MHz Sum

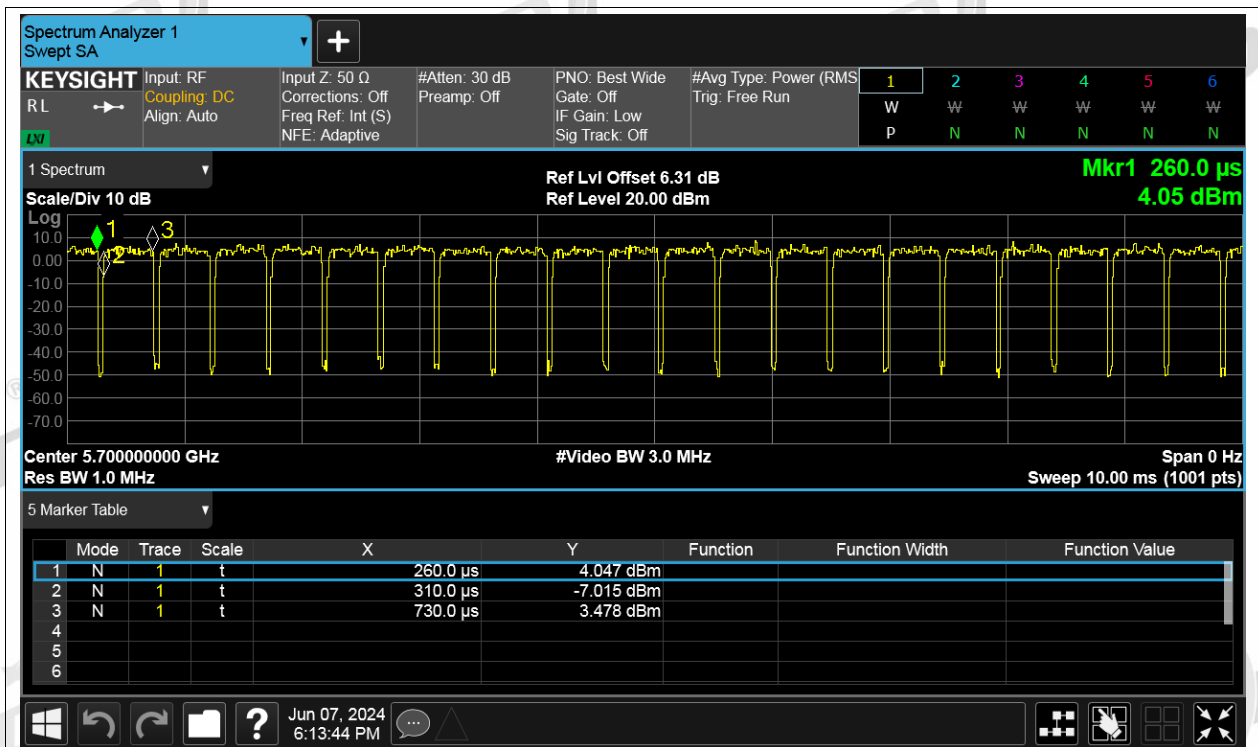

Duty Cycle NVNT ax20 5745MHz Sum

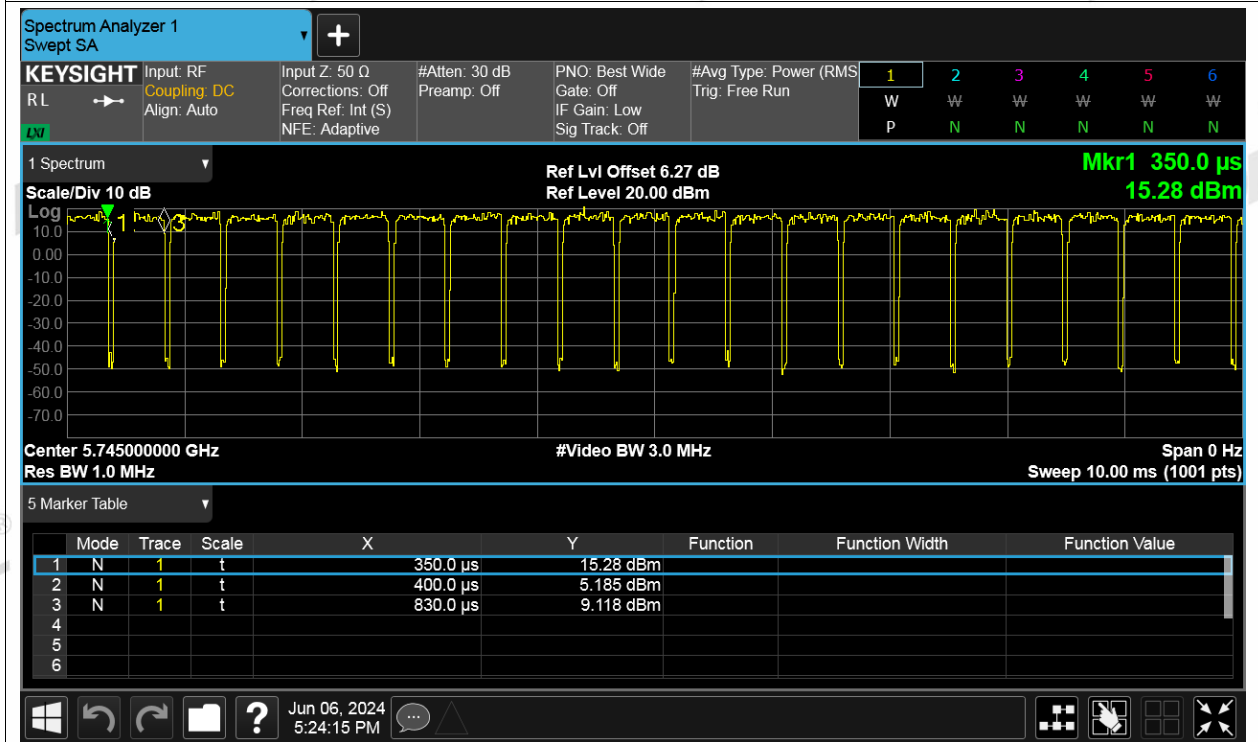

Duty Cycle NVNT ax20 5785MHz Sum