



n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.58dBm

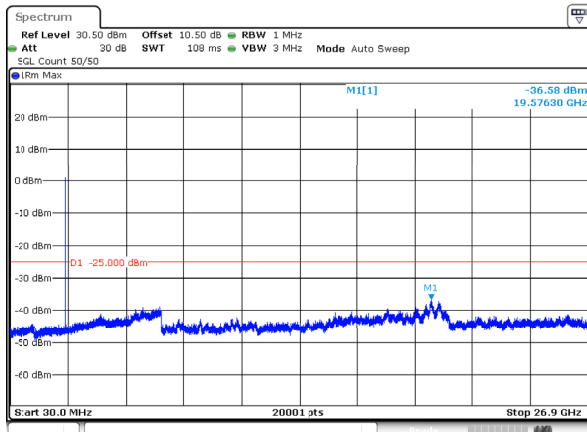


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:49:45

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@37 -36.89dBm

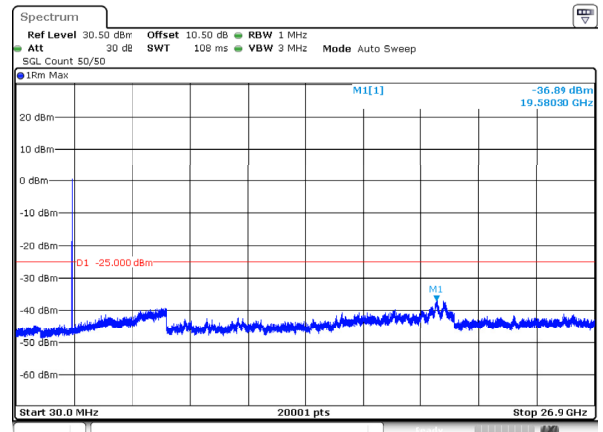


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:50:42

n41_15MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB36@0 -36.16dBm

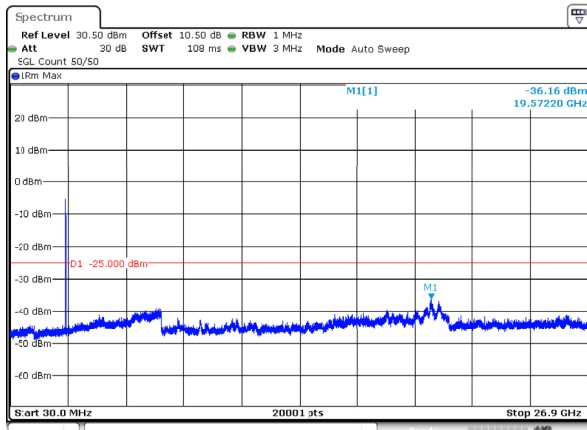


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:51:40

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@0 -36.63dBm

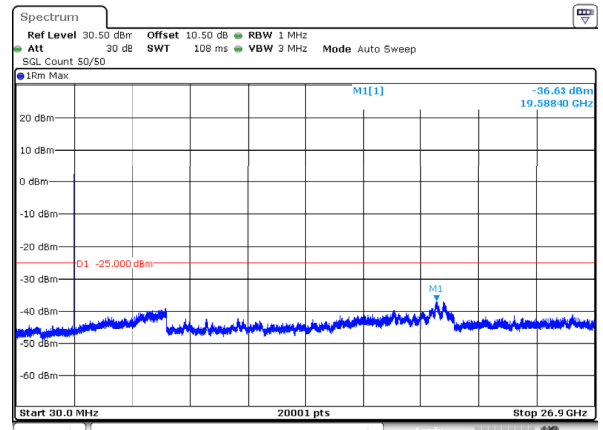


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:52:49

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB1@37 -36.44dBm

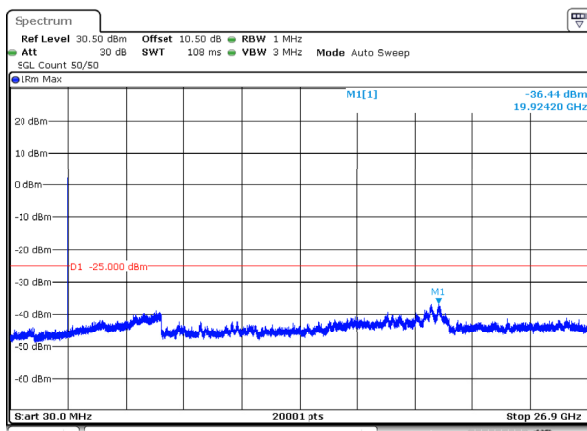


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:53:46

n41_15MHz_30kHz_2682.48MHz_DFT-s-OFDM
QPSK_RB36@0 -36.99dBm

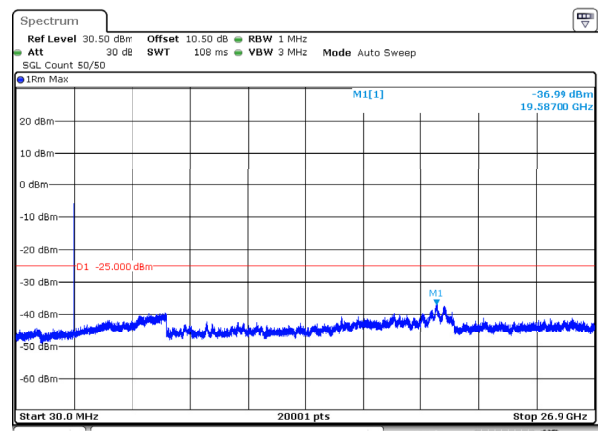


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 11:54:44

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@0 -36.28dBm

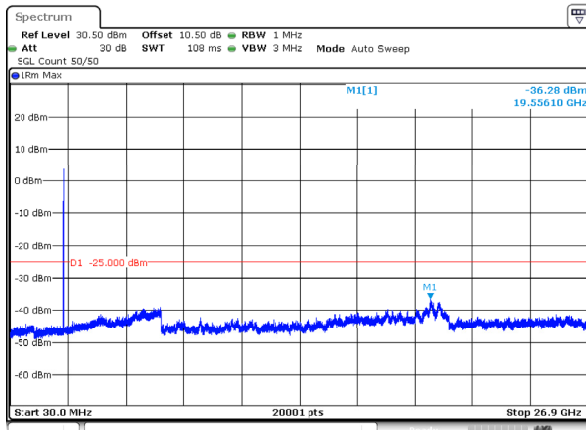


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 11:57:15

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB1@50 -37.02dBm

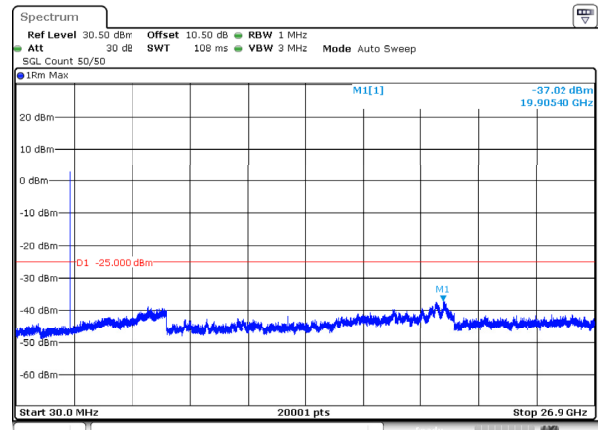


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 11:58:13

n41_20MHz_30kHz_2506.02MHz_DFT-s-OFDM
QPSK_RB50@0 -36.79dBm

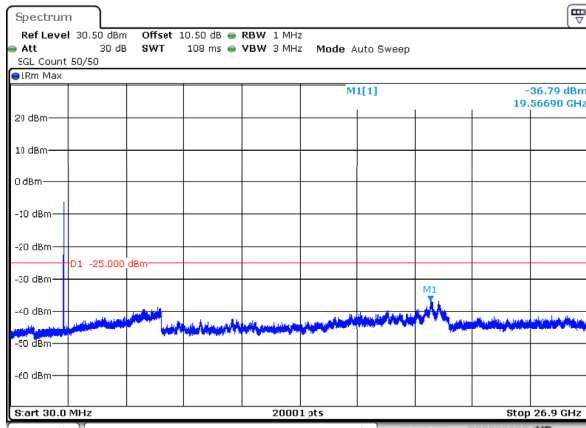


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 11:59:11

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.12dBm

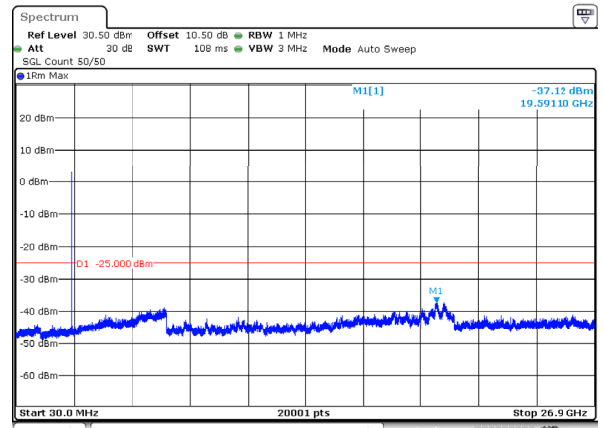


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 12:00:13

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@50 -36.87dBm

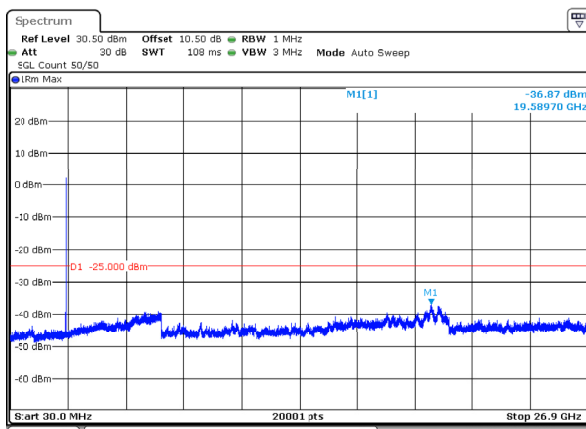


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 12:01:11

n41_20MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB50@0 -36.74dBm

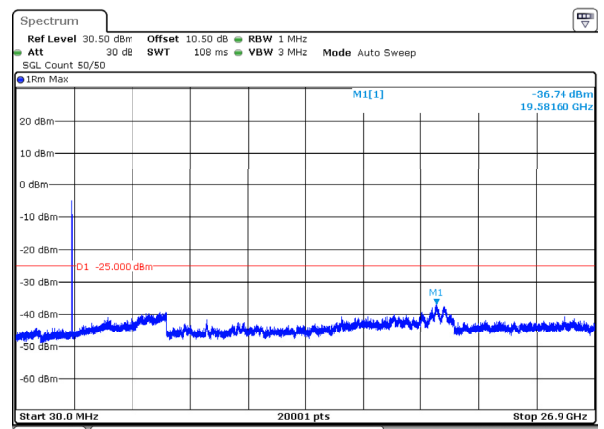


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 12:02:09

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@0 -35.97dBm

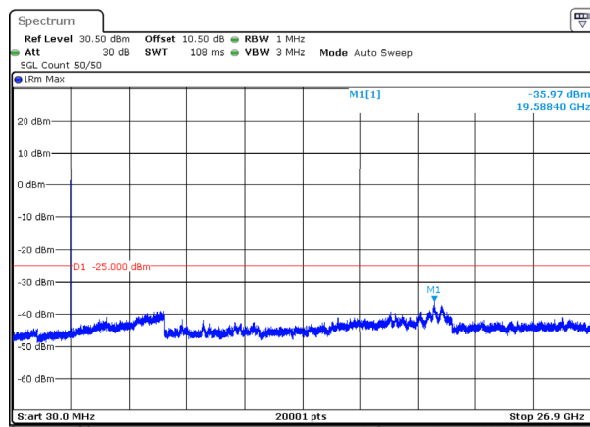


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:03:12

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB1@50 -36.70dBm

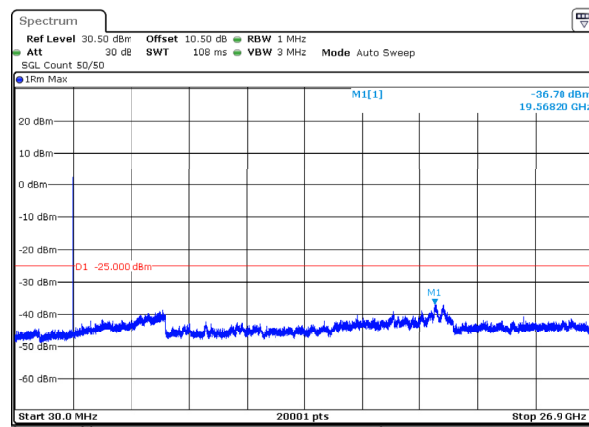


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:04:11

n41_20MHz_30kHz_2679.99MHz_DFT-s-OFDM
QPSK_RB50@0 -36.90dBm

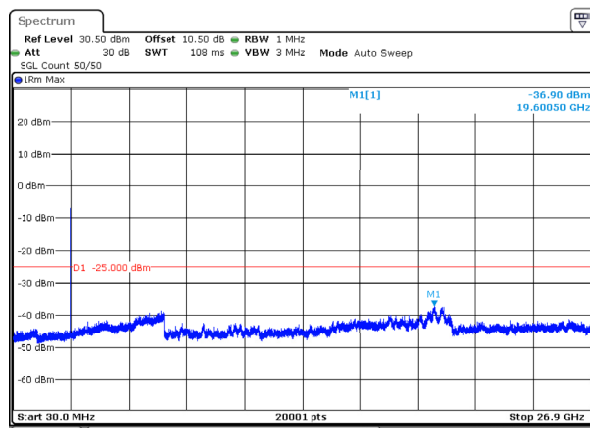


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:05:05

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB1@0 -36.53dBm

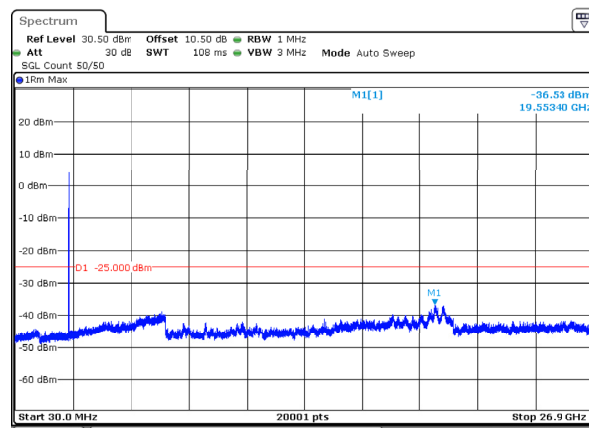


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:07:16

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB1@77 -36.06dBm

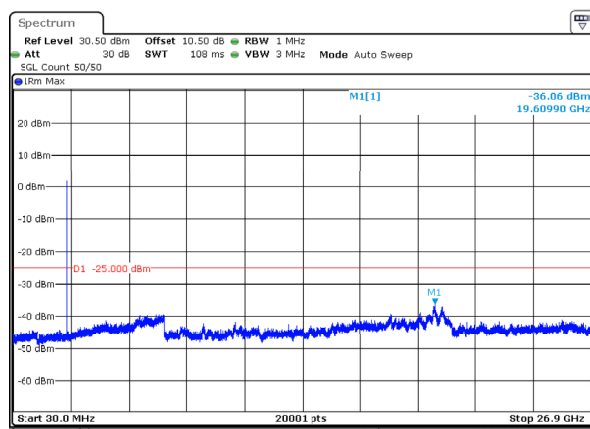


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:08:15

n41_30MHz_30kHz_2511MHz_DFT-s-OFDM
QPSK_RB75@0 -36.58dBm

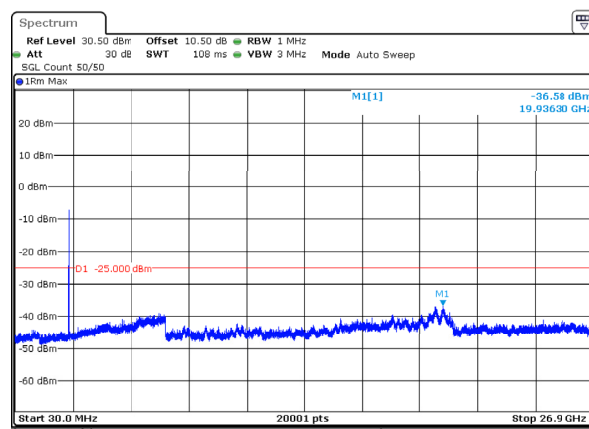


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:09:13

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.90dBm

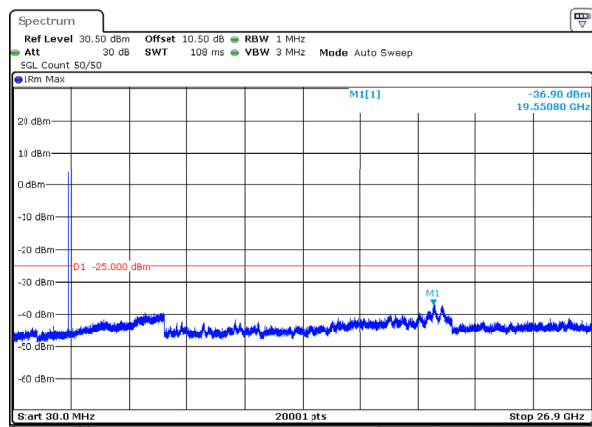


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:10:15

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@77 -36.52dBm

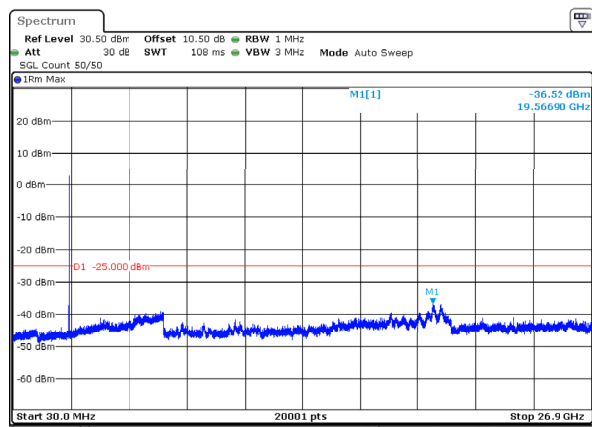


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:11:13

n41_30MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB75@0 -36.67dBm

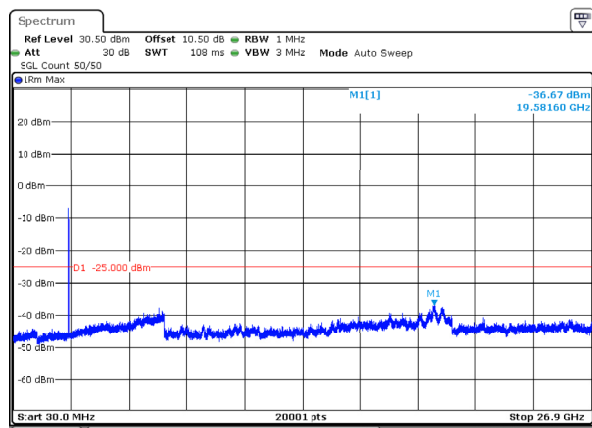


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:12:11

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB1@0 -36.14dBm

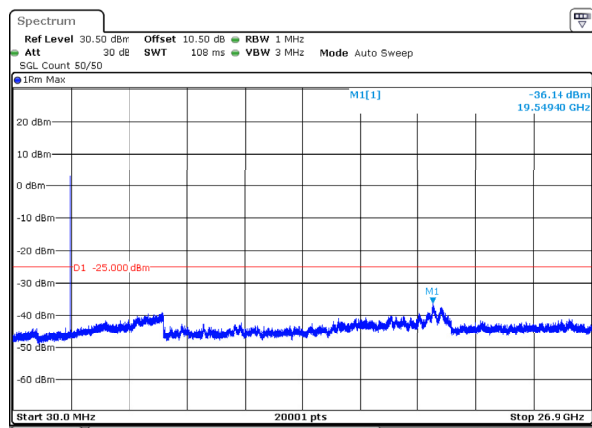


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:13:14

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB1@77 -36.98dBm

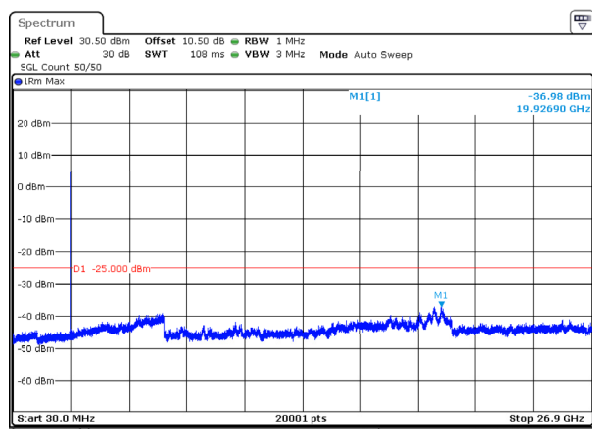


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:14:12

n41_30MHz_30kHz_2674.98MHz_DFT-s-OFDM
QPSK_RB75@0 -36.90dBm

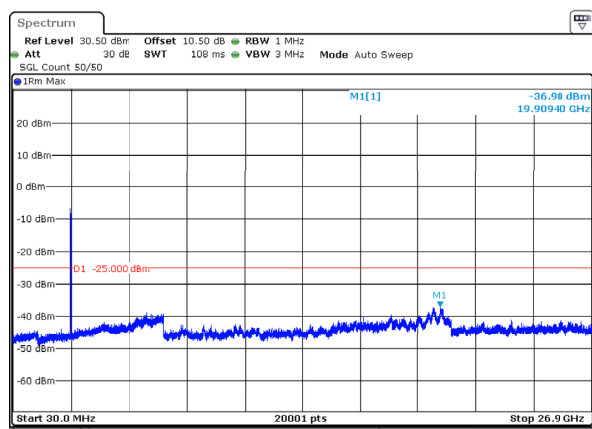


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 12:15:11

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB100@0 -37.21dBm

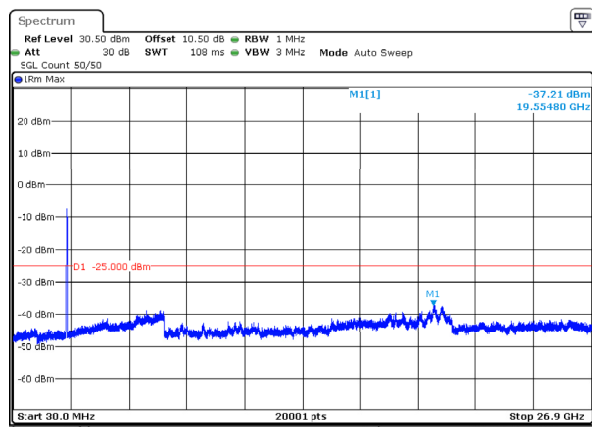


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:19:51

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@0 -36.19dBm

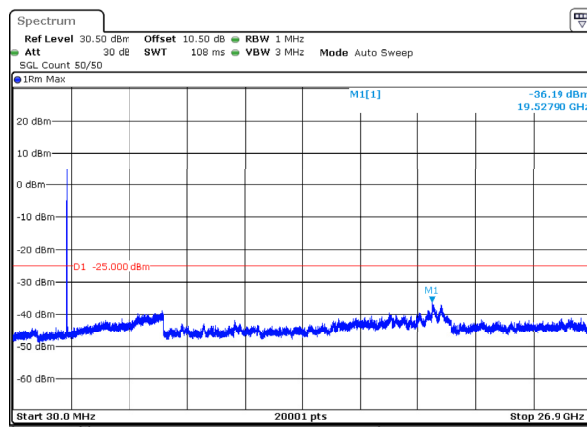


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:17:54

n41_40MHz_30kHz_2516.01MHz_DFT-s-OFDM
QPSK_RB1@105 -36.50dBm

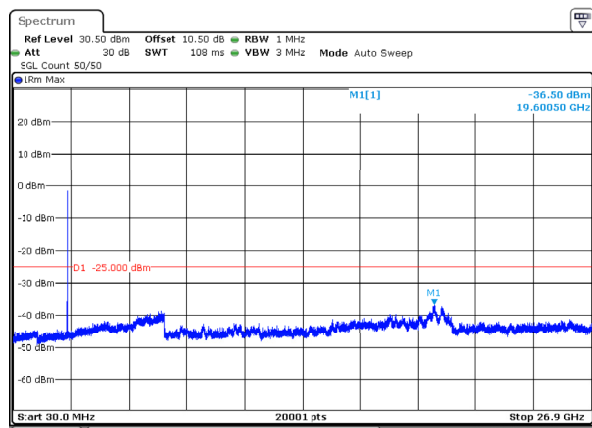


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:18:53

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB100@0 -36.83dBm

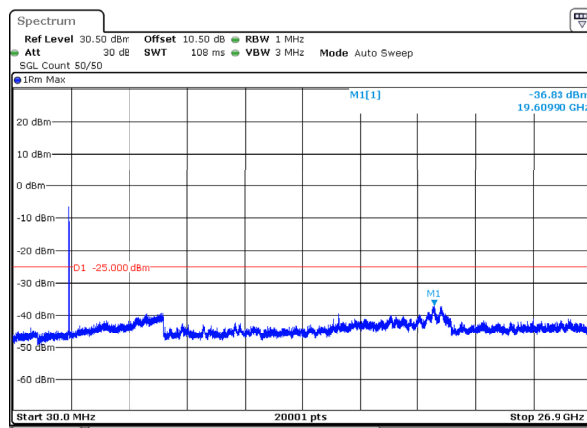


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:26:48

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -37.16dBm

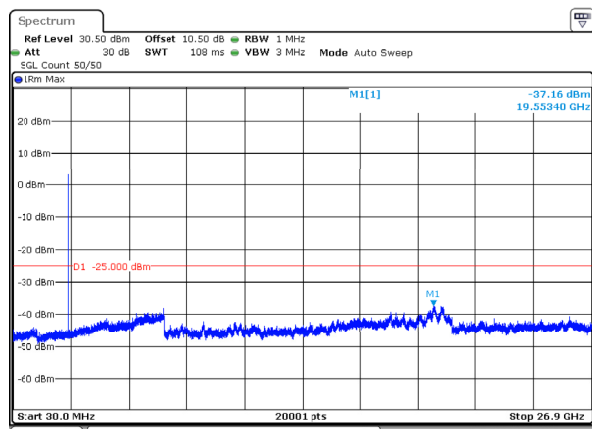


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:24:52

n41_40MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@105 -36.22dBm

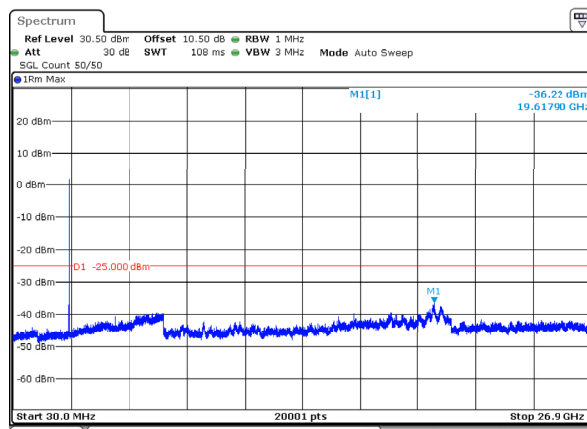


ProjectNo.: 2401Z104805E-RF Tester: Rungfunaster Liang
Date: 18.DEC.2024 12:25:50

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB100@0 -36.40dBm

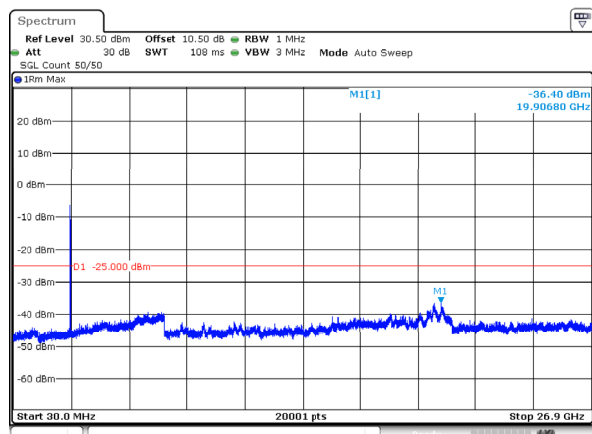


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:29:46

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@0 -36.18dBm

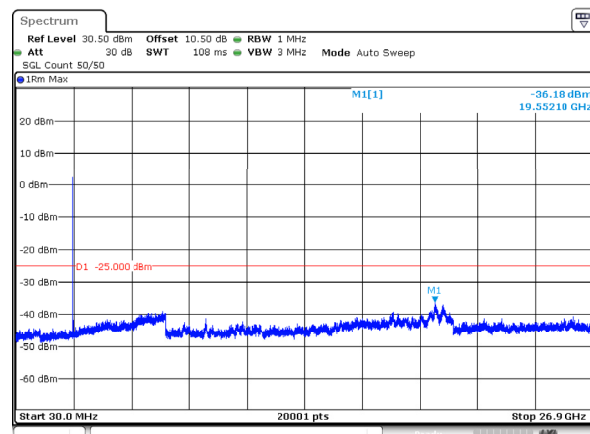


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:27:50

n41_40MHz_30kHz_2670MHz_DFT-s-OFDM
QPSK_RB1@105 -36.82dBm

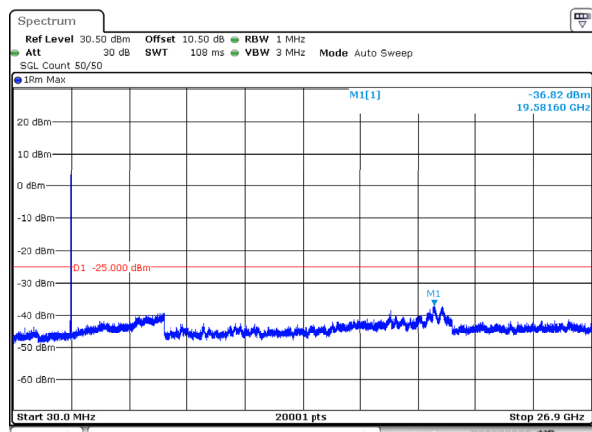


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:28:48

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB128@0 -36.67dBm

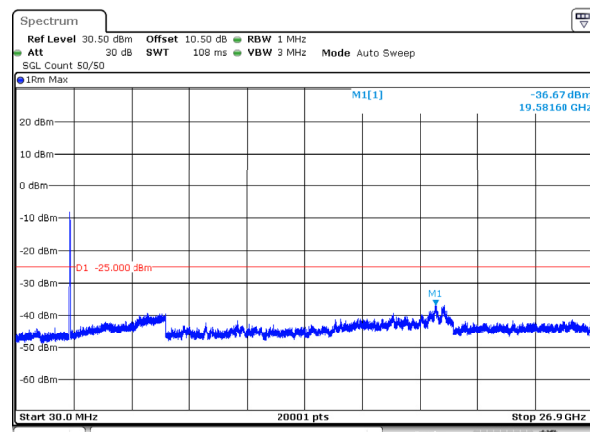


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:34:39

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@0 -36.89dBm

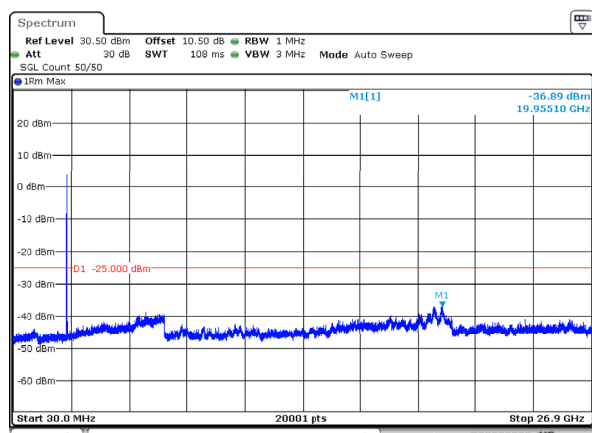


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:32:43

n41_50MHz_30kHz_2521.02MHz_DFT-s-OFDM
QPSK_RB1@132 -36.83dBm

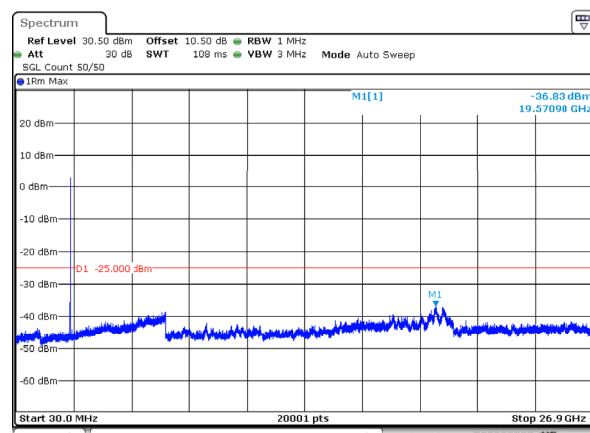


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:33:42

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB128@0 -36.83dBm

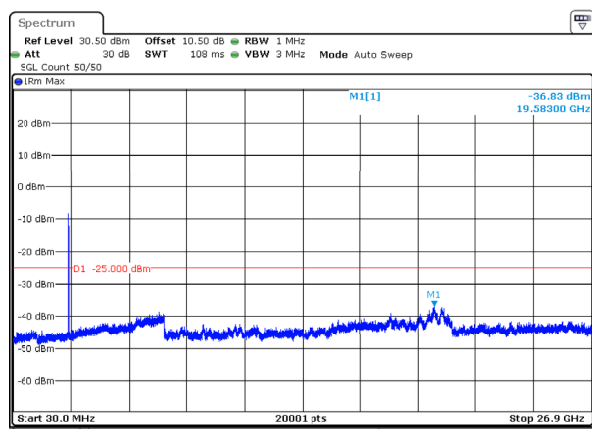


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:41:38

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.69dBm

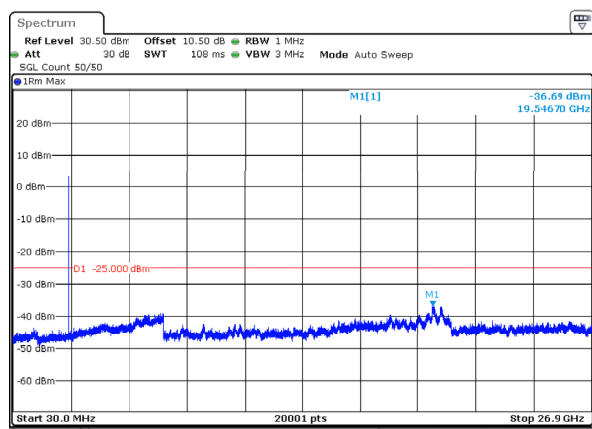


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:39:40

n41_50MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@132 -36.91dBm

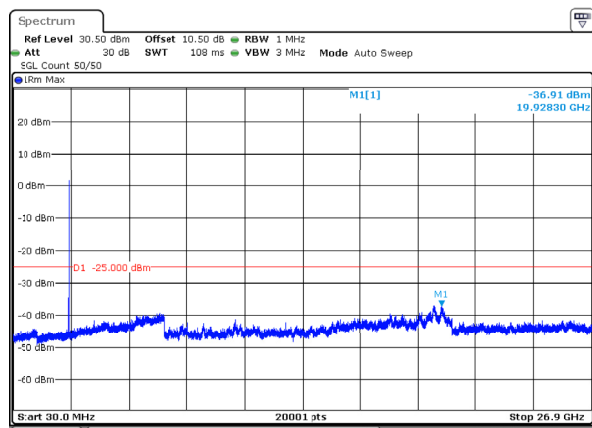


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:40:38

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB128@0 -36.30dBm

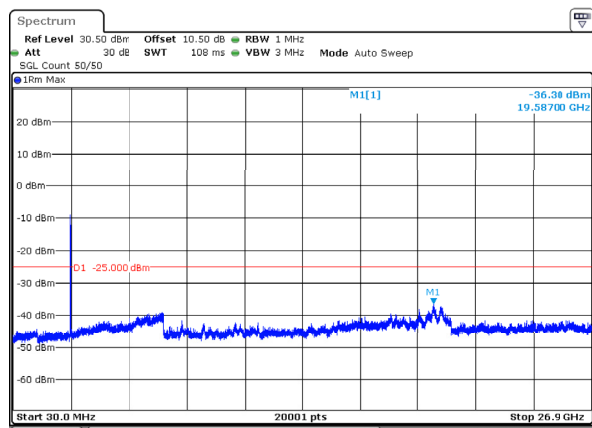


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:48:15

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.48dBm

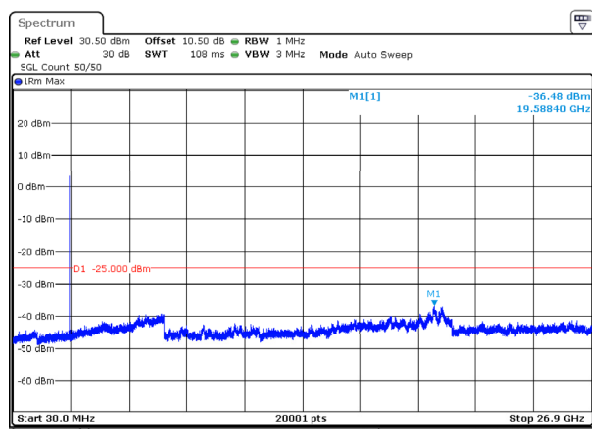


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:46:15

n41_50MHz_30kHz_2664.99MHz_DFT-s-OFDM
QPSK_RB1@132 -36.48dBm

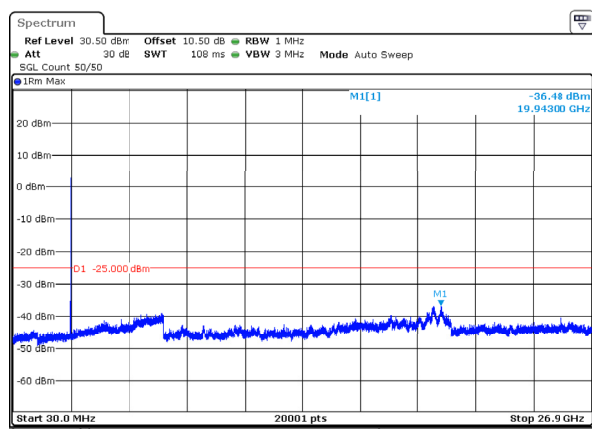


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmeter Liang
Date: 18.DEC.2024 12:47:15

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB162@0 -36.73dBm

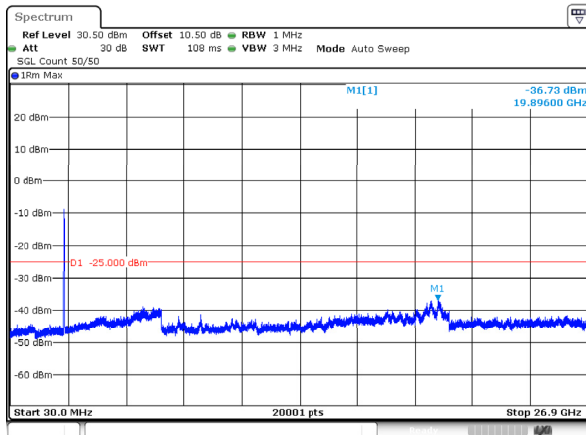


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:54:17

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@0 -36.34dBm

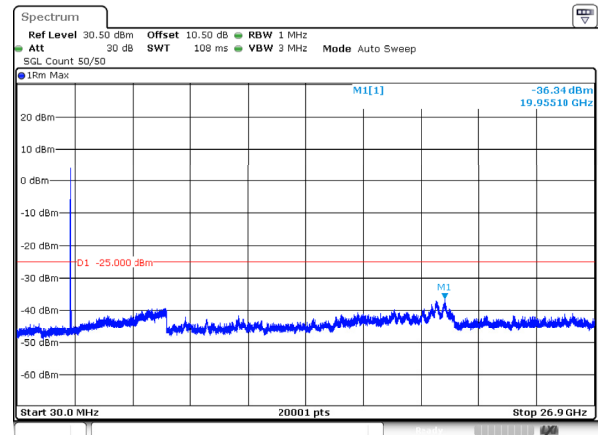


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:52:19

n41_60MHz_30kHz_2526MHz_DFT-s-OFDM
QPSK_RB1@161 -36.96dBm

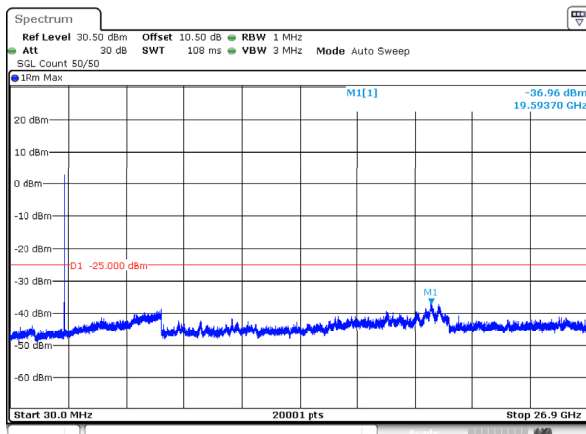


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 12:53:19

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB162@0 -36.55dBm

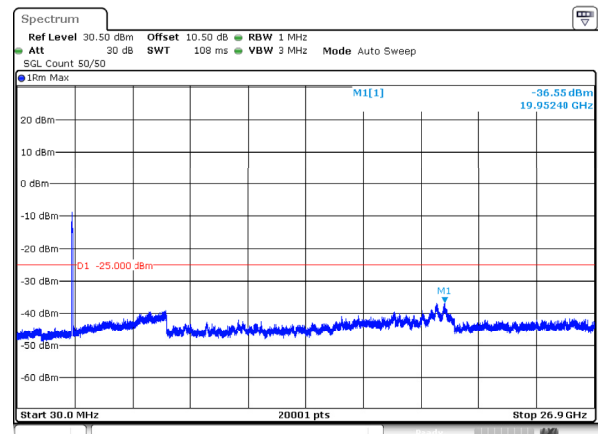


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 13:21:21

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.30dBm

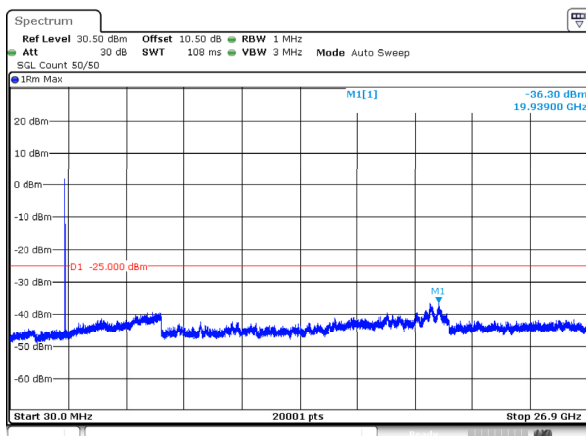


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 13:19:28

n41_60MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@161 -36.51dBm

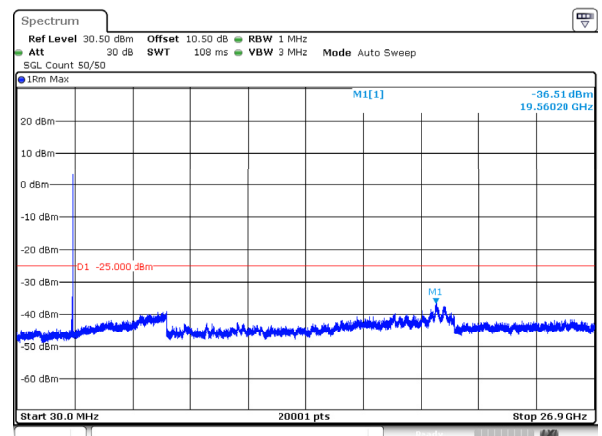


ProjectNo.: 2401Z104805E-RF Tester: Kungfumeister Liang
Date: 18.DEC.2024 13:20:25

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB162@0 -36.75dBm

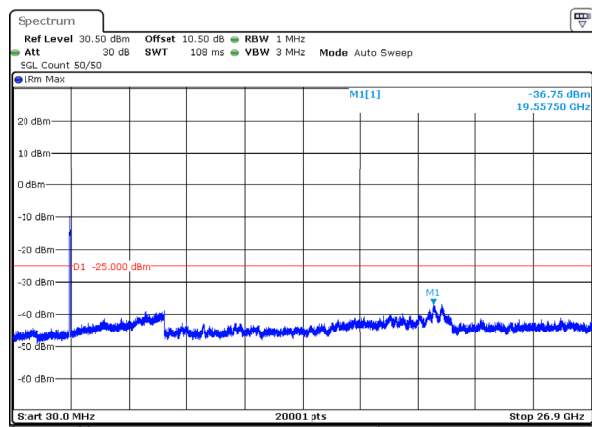


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:13:30

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@0 -36.47dBm

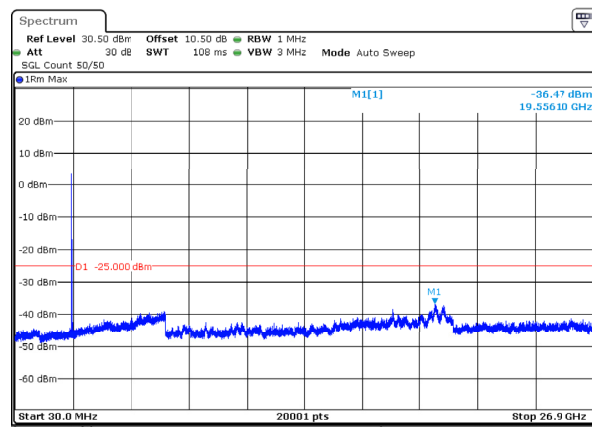


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:11:28

n41_60MHz_30kHz_2659.98MHz_DFT-s-OFDM
QPSK_RB1@161 -36.49dBm

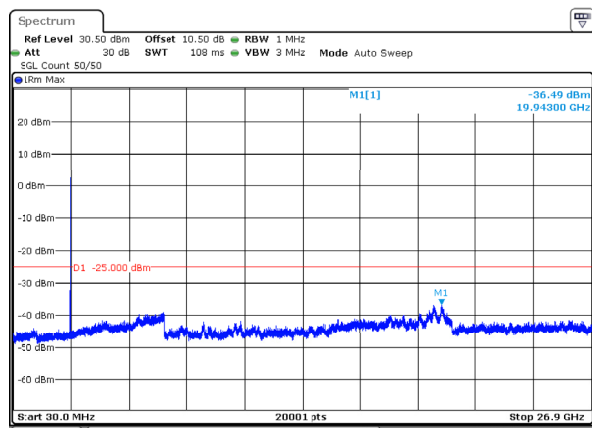


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:12:25

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@0 -36.54dBm

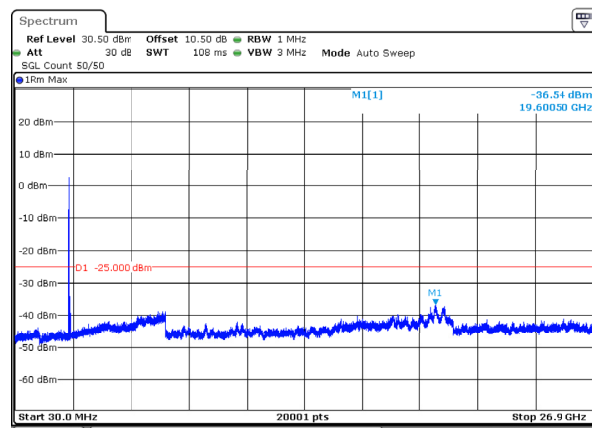


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:22:30

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB1@216 -36.36dBm

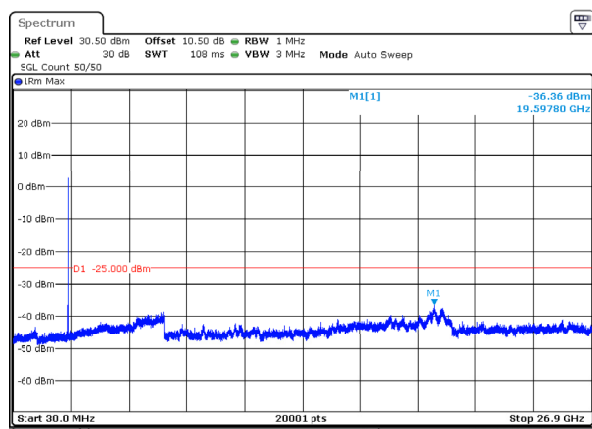


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:23:31

n41_80MHz_30kHz_2536.02MHz_DFT-s-OFDM
QPSK_RB216@0 -36.29dBm

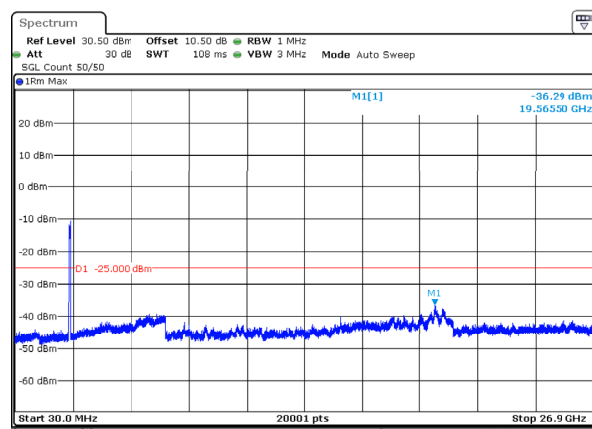


ProjectNo.: 2401Z104805E-RF Tester: Rungfunester Liang
Date: 18.DEC.2024 13:24:31

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.58dBm

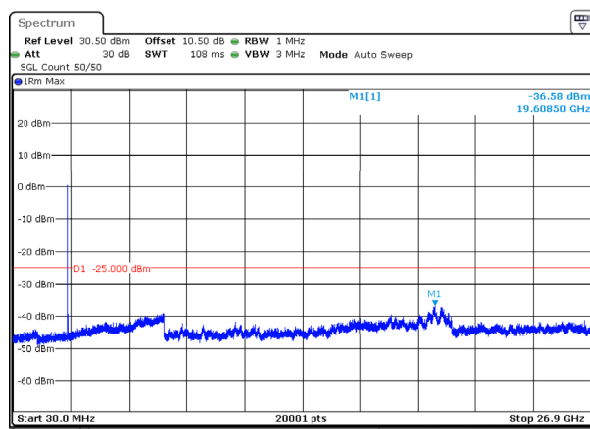


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:25:35

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@216 -36.61dBm

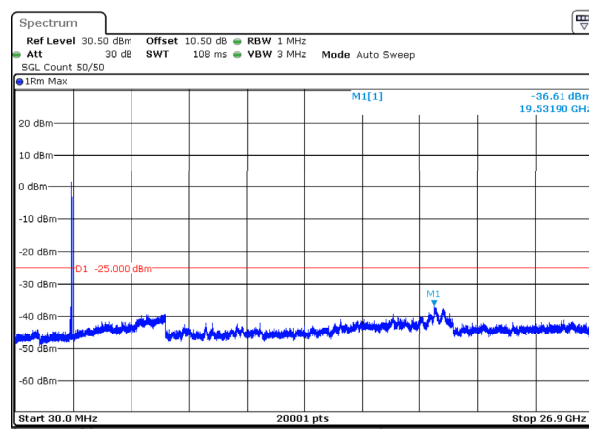


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:26:36

n41_80MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB216@0 -36.65dBm

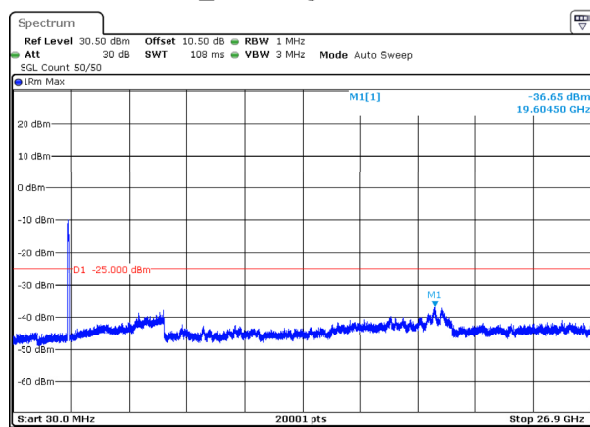


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:27:36

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.66dBm

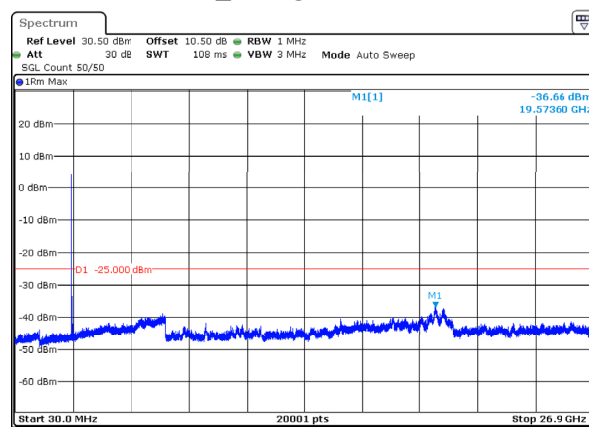


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:28:41

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB1@216 -37.19dBm

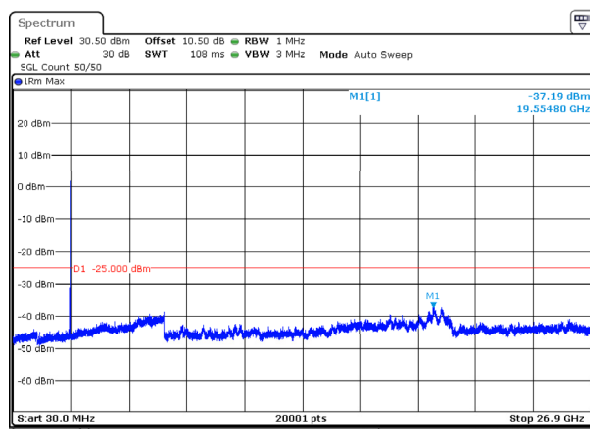


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:29:41

n41_80MHz_30kHz_2649.99MHz_DFT-s-OFDM
QPSK_RB216@0 -36.76dBm

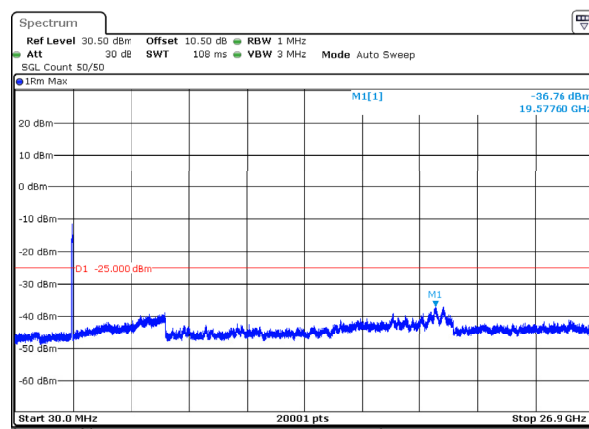


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster Liang
Date: 18.DEC.2024 13:30:41

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@0 -36.91dBm

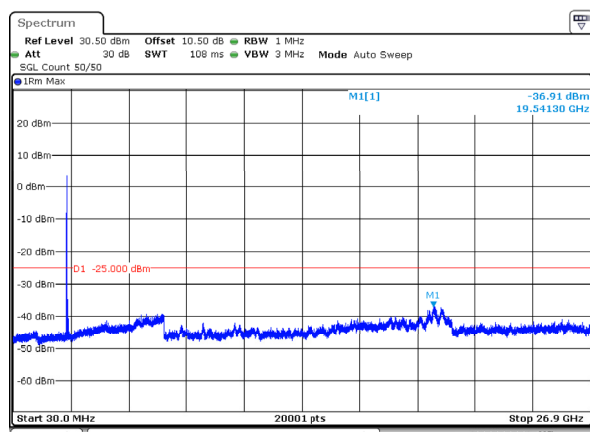


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:34:42

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB1@244 -36.98dBm

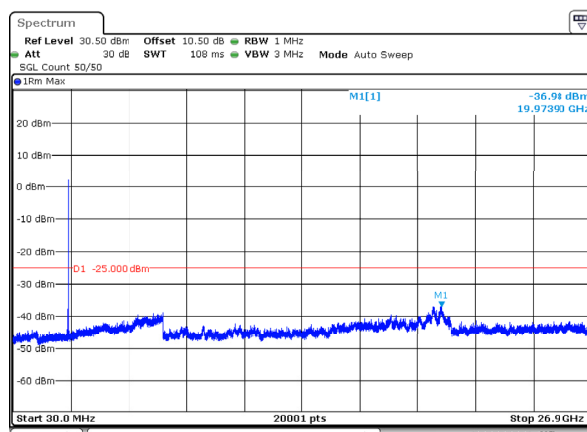


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:35:42

n41_90MHz_30kHz_2541MHz_DFT-s-OFDM
QPSK_RB243@0 -36.51dBm

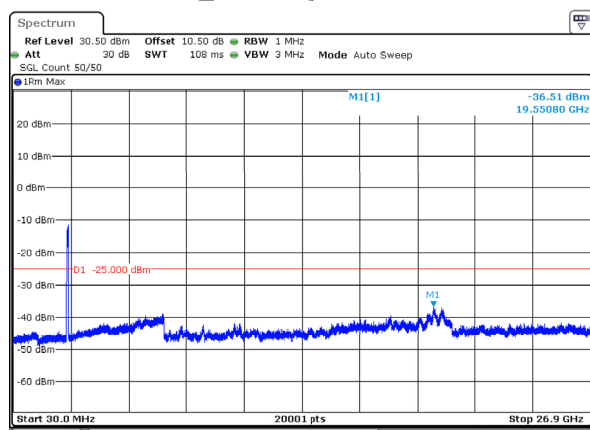


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:36:43

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@0 -36.97dBm

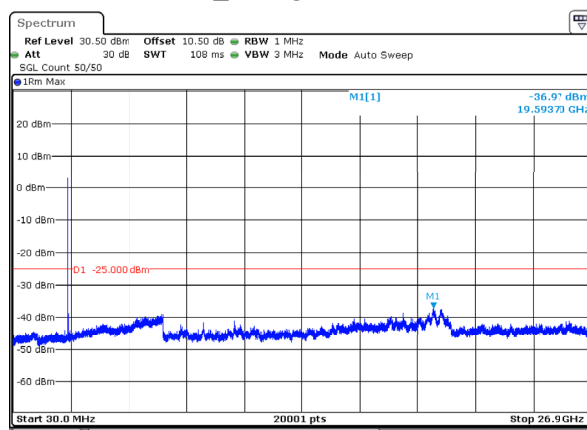


ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:37:56

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB1@244 -37.11dBm

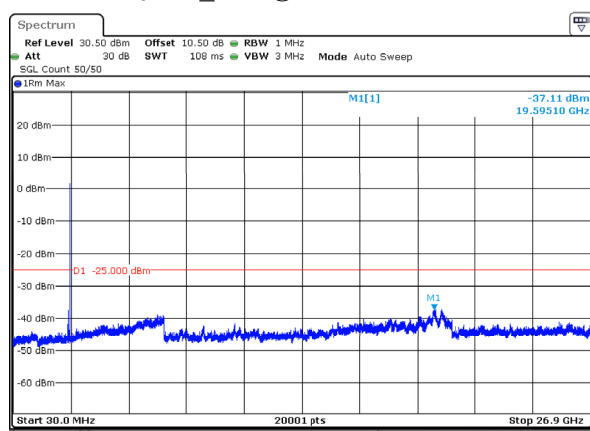

ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:38:57

n41_90MHz_30kHz_2592.99MHz_DFT-s-OFDM
QPSK_RB243@0 -36.81dBm

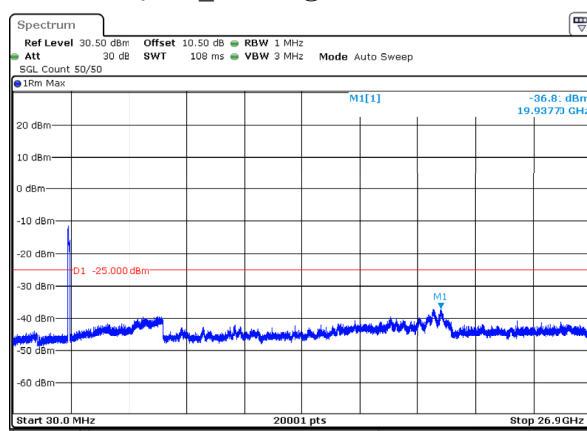

ProjectNo.: 2401Z104805E-RF Tester: Rungfunmaster: Liang
Date: 18 DEC 2024 13:39:57