

Report No.: FG0O1212A

WINNF-TS-0122 Test Report

Applicant	HON LIN Technology Co., Ltd			
Equipment	LTE Small Cell			
Model Name	T99B226			
FCC ID	2AQ68T99B226			
Reference	WINNF-TS-0122 Version V1.0.1			

The product was received on Oct. 12, 2020 and testing was started from Nov. 27, 2020 and completed on Jan. 13, 2021. We, SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory, would like to declare that the tested sample has been evaluated in accordance with the test procedures given in WINNF-TS-0122 Version V1.0.1 and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Sam Chen

SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page Number : 1 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

Table of Contents

Rev	ision /	History	- 4
1.	Admi	nistration Data	- 5
	1.1	Testing Laboratory	- 5
	1.2	Applicant	- 5
	1.3	Manufacturer	- 5
2.	Gene	ral Information	- 6
	2.1	Description of Equipment Under Test (EUT)	- 6
	2.2	Protocol Test Summary	- 7
	2.3	Support Equipment	8
	2.4	Test Equipment List	8
3.	Meas	surement Environment	- 9
	3.1	Test configuration without Domain Proxy	10
	3.2	Standards	10
4.	Proto	ocol Test Results	·11
	4.1	[WINNF.FT.C.REG.1] Multi-Step registration	· 11
	4.2	[WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data	12
	4.3	[WINNF.FT.C.REG.7] Registration due to change of an installation parameter	13
	4.4	[WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)	14
	4.5	[WINNF.FT.C.REG.10] Pending registration (responseCode 200)	15
	4.6	[WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)	16
	4.7	[WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)	·17
	4.8	[WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)	18
	4.9	[WINNF.FT.C.REG.18] Group Error (responseCode 201)	19
	4.10	[WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)	20
	4.11	[WINNF.FT.C.GRA.2] Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)	·21
	4.12	[WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)	22
	4.13	[WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)	24
	4.14	[WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED_GRANT)	25
	4.15	$[WINNF.FT.C.HBT.5]\ Heartbeat\ responseCode = 501\ (SUSPENDED_GRANT)\ in\ First\ Heartbeat$	
	Resp	onse	26
	4.16	[WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent	
	Hear	tbeat Response	27
	4.17	[WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	29
	4.18	[WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)	30
	4.19	[WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)	31

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number : 2 of 52 Issued Date : Jan. 21, 2021

Report No.: FG0O1212A

Report Version : 02

4.20	[WINNF.FT.C.HBT.11] Successful Grant Renewal in Heartbeat Test Case32
4.21	[WINNF.FT.C.MES.1] Registration Response contains measReportConfig34
4.22	[WINNF.FT.C.MES.3] Grant Response contains measReportConfig36
4.23	[WINNF.FT.C.MES.4] Heartbeat Response contains measReportConfig38
4.24	[WINNF.FT.C.RLQ.1] Successful Relinquishment40
4.25	[WINNF.FT.C.RLQ.3] Unsuccessful Relinquishment, responseCode=10241
4.26	[WINNF.FT.C.RLQ.5] Unsuccessful Relinquishment, responseCode=10342
4.27	[WINNF.FT.C.DRG.1] Successful Deregistration43
4.28	[WINNF.FT.C.DRG.3] Deregistration responseCode=10244
4.29	[WINNF.FT.C.DRG.5] Deregistration responseCode=10345
4.30	[WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness46
4.31	[WINNF.FT.C.SCS.2] TLS failure due to revoked certificate47
4.32	[WINNF.FT.C.SCS.3] TLS failure due to expired server certificate48
4.33	[WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown CA49
4.34	[WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted50
4.35	[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement51

Appendix A. Setup Plot

Appendix B. RF measurement plots

TEL: 886-3-327-3456 Page Number : 3 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

Revision History

Report No.: FG0O1212A

Report No.	Version	Description	Issued Date
FG0O1212A	01	Initial issue of report	Jan. 18, 2021
FG0O1212A	02	Add the MRA number of testing laboratory	Jan. 21, 2021

TEL: 886-3-327-3456 Page Number : 4 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

1. Administration Data

1.1 Testing Laboratory

Test Site	SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978
Test Site No.	Sporton Site No.
rest site No.	DFS02-HY
Test Engineer Thomas Chen	
Temperature 21 ~ 25 °C	
Relative Humidity 50 ~ 56 %	

Note: The test site complies with ANSI C63.42014requirement.FCC Designation No.: TW1190

1.2 Applicant

Company Name HON LIN Technology Co., Ltd	
Address	11F, No. 32, Jihu Rd., Neihu Dist., Taipei City, Taiwan.

1.3 Manufacturer

Company Name HON LIN Technology Co., Ltd	
Address	11F, No. 32, Jihu Rd., Neihu Dist., Taipei City, Taiwan.

TEL: 886-3-327-3456 Page Number : 5 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

2. General Information

2.1 Description of Equipment Under Test (EUT)

Product Feature & Specification					
EUT Type LTE Small Cell					
Model Name	T99B226				
FCC ID	2AQ68T99B226				
Professional Installation	✓ Yes☐ No				
UUT Category	☐ Category A ☑ Category B				
Unit Under Test in Test ID	☐ UUT with Domain Proxy☑ UUT without Domain Proxy				
UUT Antenna Gain	13.2 dBi				
UUT HW Version	S1				
UUT FW Version	0.0.1.307-454_20201201A				
UUT SW Version	0.0.1.50_20201201A				
UUT Serial Number	ACD5647A5439				
Device Power Class LTE Band 48: Power Class 3					

TEL: 886-3-327-3456 Page Number : 6 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

2.2 Protocol Test Summary

Section	Test Case ID	Test Case Title	Test Result
6.1.4.1.1	WINNF.FT.C.REG.1	Multi-Step registration	PASS
6.1.4.1.5	WINNF.FT.C.REG.5	Single-Step registration for CBSD with CPI signed data	PASS
6.1.4.1.7	WINNF.FT.C.REG.7	Registration due to change of an installation parameter	PASS
6.1.4.2.1	WINNF.FT.C.REG.8	Missing Required parameters (responseCode 102)	PASS
6.1.4.2.3	WINNF.FT.C.REG.10	Pending registration (responseCode 200)	PASS
6.1.4.2.5	WINNF.FT.C.REG.12	Invalid parameter (responseCode 103)	PASS
6.1.4.2.7	WINNF.FT.C.REG.14	Blacklisted CBSD (responseCode 101)	PASS
6.1.4.2.9	WINNF.FT.C.REG.16	Unsupported SAS protocol version (responseCode 100)	PASS
6.1.4.2.11	WINNF.FT.C.REG.18	Group Error (responseCode 201)	PASS
6.3.4.2.1	WINNF.FT.C.GRA.1	Unsuccessful Grant responseCode=400	PASS
		(INTERFERENCE)	PASS
6.3.4.2.2	WINNF.FT.C.GRA.2	Unsuccessful Grant responseCode=401	DASS
		(GRANT_CONFLICT)	PASS
6.4.4.1.1	WINNF.FT.C.HBT.1	Heartbeat Success Case (first Heartbeat Response)	PASS
6.4.4.2.1	WINNF.FT.C.HBT.3	Heartbeat responseCode=105 (DEREGISTER)	PASS
6.4.4.2.2	WINNF.FT.C.HBT.4	4 Heartbeat responseCode=500 (TERMINATED_GRANT)	
6.4.4.2.3	WINNF.FT.C.HBT.5	Heartbeat responseCode=501 (SUSPENDED_GRANT) in	PASS
		First Heartbeat Response	
6.4.4.2.4	WINNF.FT.C.HBT.6	Heartbeat responseCode=501 (SUSPENDED_GRANT) in	PASS
		Subsequent Heartbeat Response	FAGG
6.4.4.2.5	WINNF.FT.C.HBT.7	Heartbeat responseCode=502 (UNSYNC_OP_PARAM)	PASS
6.4.4.3.1	4.4.3.1 WINNF.FT.C.HBT.9 Heartbeat Response Absent (First Heartbeat)		PASS
6.4.4.3.2	WINNF.FT.C.HBT.10	Heartbeat Response Absent (Subsequent Heartbeat)	PASS
6.4.4.4.1	WINNF.FT.C.HBT.11	F.FT.C.HBT.11 Successful Grant Renewal in Heartbeat Test Case	
6.5.4.2.1	WINNF.FT.C.MES.1	MES.1 Registration Response contains measReportConfig	
6.5.4.2.3	WINNF.FT.C.MES.3	Grant Response contains measReportConfig	PASS
6.5.4.2.4	WINNF.FT.C.MES.4	Heartbeat Response contains measReportConfig	PASS
6.6.4.1.1	WINNF.FT.C.RLQ.1	Successful Relinquishment	PASS
6.6.4.2.1	WINNF.FT.C.RLQ.3	Unsuccessful Relinquishment, responseCode=102	PASS

TEL: 886-3-327-3456 Page Number : 7 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

Section	Test Case ID	Test Case Title	Test Result	
6.6.4.3.1	WINNF.FT.C.RLQ.5	Unsuccessful Relinquishment, responseCode=103	PASS	
6.7.4.1.1	WINNF.FT.C.DRG.1	Successful Deregistration	PASS	
6.7.4.2.1	WINNF.FT.C.DRG.3	Deregistration responseCode=102	PASS	
6.7.4.3.1	WINNF.FT.C.DRG.5	Deregistration responseCode=103	PASS	
6.8.4.1.1	WINNF.FT.C.SCS.1	Successful TLS connection between UUT and SAS Test	PASS	
		Harness		
6.8.4.2.1	WINNF.FT.C.SCS.2	TLS failure due to revoked certificate	PASS	
6.8.4.2.2	WINNF.FT.C.SCS.3	TLS failure due to expired server certificate	PASS	
6.8.4.2.3	WINNF.FT.C.SCS.4	TLS failure when SAS Test Harness certificate is issue by	DAGG	
		unknown CA	PASS	
6.8.4.2.4	WINNF.FT.C.SCS.5	TLS failure when certificate at the SAS Test Harness is	PASS	
		corrupted	FAGG	
7.1.4.1.1	WINNF.PT.C.HBT	UUT RF Transmit Power Measurement	PASS	

2.3 Support Equipment

Name Manufacturer		Type/Model	Serial Number	SW Version
LTE-EPC HonLin		N/A	N/A	R4.6.0
POE PHIHONG		POEA30U-1ATE	P203400991 A1	N/A

2.4 Test Equipment List

Name	Manufacturer	Type/Model	Serial Number	Calibration	
				Last Cal.	Due Date
Spectrum Analyzer	Rohde & Schwarz	FSV3044	101048	Apr. 29, 2020	Apr. 28, 2021

TEL: 886-3-327-3456 Page Number : 8 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

3. Measurement Environment


Measurement Environment Information		
SAS Test Harness version	1.0.0.3	
Operating System	Windows 10	
TLS version	V 1.2	
Python version	V 2.7	

Conditional Test Case		
Condition	Definition	
C1	Mandatory for UUT which supports multi-step registration message	
	Mandatory for UUT which supports single-step registration with no CPI-signed	
Ca	data in the registration message. By definition, this is a subset of Category A	
C2	devices which determine all registration information, including location,	
	without CPI intervention.	
C3	Mandatory for UUT which supports single-step registration containing	
	CPIsigned data in the registration message.	
0.4	Mandatory for UUT which supports RECEIVED_POWER_WITHOUT_GRANT	
C4	measurement report type	
0.5	Mandatory for UUT which supports RECEIVED_POWER_WITH_GRANT	
C5	measurement report type.	
	Mandatory for UUT which supports parameter change being made at the UUT	
C6	and prior to sending a deregistration.	
	C1	

TEL: 886-3-327-3456 Page Number : 9 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

3.1 Test configuration without Domain Proxy

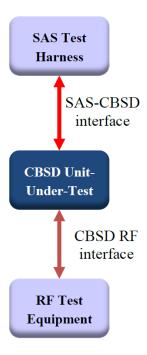

3.2 Standards

[n.1]. WINNF-TS-0122 Version 1.0.2, "Conformance and Performance Test Technical Specification; CBSD/DP as Unit Under Test (UUT)", 25 November 2020.

[n.2]. WINNF-TS-0016 Version 1.2.5, "SAS to CBSD Technical Specification", 18 May 2020.

TEL: 886-3-327-3456 Page Number : 10 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4. Protocol Test Results

4.1 [WINNF.FT.C.REG.1] Multi-Step registration

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
'	Authentication with the SAS Test Harness	
	UUT is in the Unregistered state	
	CBSD sends correct Registration request information, as specified in [n.5],	
	to the SAS Test Harness:	
	The required userId, fccId and cbsdSerialNumber registration	
	parameters shall be sent from the CBSD and conform to proper	
2	format and acceptable ranges.	PASS
	Any REG-conditional or optional registration parameters that may	17.00
	be included in the message shall be verified that they conform to	
	proper format and are within acceptable ranges.	
	Note: It is outside the scope of this document to test the Registration	
	information that is supplied via another means.	
	SAS Test Harness sends a CBSD Registration Response as	
	follows:	
3	- cbsdld = C	
	 measReportConfig shall not be included 	
	- responseCode = 0	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=0) to further request messages from the	
	UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 11 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.2 [WINNF.FT.C.REG.5] Single-Step registration for CBSD with CPI signed data

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT is in the Unregistered state All of the required and REG-Conditional parameters shall be configured and CPI signature provided 	
2	CBSD sends Registration request to the SAS Test Harness: The required userId, fccId and cbsdSerialNumber and REG-Conditional cbsdCategory, airInterface, measCapability and cpiSignatureData registration parameters shall be sent from the CBSD and conform to proper format and acceptable ranges.	PASS
	 Any optional registration parameters that may be included in the message shall be verified that they conform to proper format and are within acceptable ranges. 	
3	 SAS Test Harness sends a CBSD Registration Response as follows: - cbsdld = C - measReportConfig shall not be included. - responseCode = 0 	
4	After completion of step 3, SAS Test Harness will not provide any positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 12 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.3 [WINNF.FT.C.REG.7] Registration due to change of an installation parameter

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
2	UUT has successfully registered with SAS Test Harness	-1
	Change an installation parameters at the UUT (time T)	
3	Tester needs to record the current time at which the parameter change is	
	executed.	
4	Monitor the SAS-CBSD interface.	
	UUT sends a deregistrationRequest to the SAS Test Harness	PASS
	The deregistration request shall be sent within (T + 60 seconds) from step	FASS
	3.	

TEL: 886-3-327-3456 Page Number : 13 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.4 [WINNF.FT.C.REG.8] Missing Required parameters (responseCode 102)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
	 SAS response does not include cbsdld 	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 14 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.5 [WINNF.FT.C.REG.10] Pending registration (responseCode 200)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	 SAS response does not include cbsdld 	 I
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=200) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 15 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.6 [WINNF.FT.C.REG.12] Invalid parameter (responseCode 103)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT is in the Unregistered state 	
2	CBSD sends a Registration request to SAS Test Harness.	
3	SAS Test Harness rejects the request by sending a CBSD Registration Response as follows: - SAS response does not include cbsdld - responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive response (<i>responseCode</i> =103) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 16 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.7 [WINNF.FT.C.REG.14] Blacklisted CBSD (responseCode 101)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	 SAS response does not include cbsdld 	 I
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=101) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 17 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.8 [WINNF.FT.C.REG.16] Unsupported SAS protocol version (responseCode 100)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	 SAS response does not include cbsdld 	 I
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=100) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 18 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.9 [WINNF.FT.C.REG.18] Group Error (responseCode 201)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has successfully completed SAS Discovery and	
'	Authentication with SAS Test Harness	
	UUT is in the Unregistered state	
2	CBSD sends a Registration request to SAS Test Harness.	
	SAS Test Harness rejects the request by sending a CBSD Registration	
3	Response as follows:	
3	 SAS response does not include cbsdld 	
	– responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=201) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after	
	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 19 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.10[WINNF.FT.C.GRA.1] Unsuccessful Grant responseCode=400 (INTERFERENCE)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has registered successfully with SAS Test Harness, with	
	cbsdld = C	
2	UUT sends valid Grant Request.	
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=0) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 20 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.11[WINNF.FT.C.GRA.2] Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
1	UUT has registered successfully with SAS Test Harness, with	
	cbsdld = C	
2	UUT sends valid Grant Request.	1
	SAS Test Harness sends a Grant Response message, including	
3	• cbsdld=C	
	• responseCode = R	
4	After completion of step 3, SAS Test Harness will not provide any positive	
4	response (responseCode=401) to further request messages from the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 21 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.12[WINNF.FT.C.HBT.1] Heartbeat Success Case (first Heartbeat Response)

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry: • UUT has registered successfully with SAS Test Harness, with cbsdld = C	
2	UUT sends a message: • If message is type Spectrum Inquiry Request, go to step 3, or • If message is type Grant Request, go to step 5	
3	 UUT sends Spectrum Inquiry Request. Validate: cbsdld = C List of frequencyRange objects sent by UUT are within the CBRS frequency range 	PASS
4	SAS Test Harness sends a Spectrum Inquiry Response message, including the following parameters: • cbsdld = C • availableChannel is an array of availableChannel objects • responseCode = 0	
5	UUT sends Grant Request message. Validate: • cbsdld = C • maxEIRP is at or below the limit appropriate for CBSD category as defined by Part 96 • operationFrequencyRange, F, sent by UUT is a valid range within the CBRS band	PASS
6	SAS Test Harness sends a Grant Response message, including the parameters: • cbsdld = C • grantld = G = a valid grant ID • grantExpireTime = UTC time greater than duration of the test • responseCode = 0	
7	UUT sends a first Heartbeat Request message. Verify Heartbeat Request message is formatted correctly, including: • cbsdld = C • grantld = G • operationState = "GRANTED"	PASS

TEL: 886-3-327-3456 Page Number : 22 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

	SAS Test Harness sends a Heartbeat Response message, with the	
8	following parameters:	
	• cbsdld = C	
	• grantId = G	
	transmitExpireTime = current UTC time + 200 seconds	
	• responseCode = 0	
	For further Heartbeat Request messages sent from UUT after completion	
	of step 8, validate message is sent within latest specified heartbeatInterval,	
	and:	
	• cbsdld = C	
	• grantId = G	
9	operationState = "AUTHORIZED"	PASS
	and SAS Test Harness responds with a Heartbeat Response message	. ,
	including the following parameters:	
	• cbsdld = C	
	• grantId = G	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
	Monitor the RF output of the UUT from start of test until UUT	
10	transmission commences. Verify:	
	UUT does not transmit at any time prior to completion of the first	DACC
	heartbeat response	PASS
	UUT transmits after step 8 is complete, and its transmission is	
	limited to within the bandwidth range F.	

TEL: 886-3-327-3456 Page Number : 23 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.13[WINNF.FT.C.HBT.3] Heartbeat responseCode=105 (DEREGISTER)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows:	
2	UUT sends a Heartbeat Request message. Ensure Heartbeat Request message is sent within Heartbeat Interval specified in the latest Heartbeat Response, and formatted correctly, including: • cbsdld = C • grantld = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = Current UTC time • responseCode = 105 (DEREGISTER)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify: UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-3456 Page Number : 24 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.14[WINNF.FT.C.HBT.4] Heartbeat responseCode=500 (TERMINATED_GRANT)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows:	
2	UUT sends a Heartbeat Request message. Ensure Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including: • cbsdld = C • grantId = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = current UTC time • responseCode = 500 (TERMINATED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the RF output of the UUT. Verify: UUT shall stop transmission within (T + 60 seconds) of completion of step 3	PASS

TEL: 886-3-327-3456 Page Number : 25 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.15[WINNF.FT.C.HBT.5] Heartbeat responseCode=501 (SUSPENDED_GRANT) in First Heartbeat Response

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows:	
2	UUT sends a Heartbeat Request message. Verify Heartbeat Request message is formatted correctly, including: • cbsdld = C • grantld = G • operationState = "GRANTED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = current UTC time • responseCode = 501 (SUSPENDED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify either A OR B occurs: A. UUT sends a Heartbeat Request message. Ensure message is sent within latest specified heartbeatInterval, and is correctly formatted with parameters: • cbsdld = C • grantld = G • operationState = "GRANTED" B. UUT sends a Relinquishment request message. Ensure message is correctly formatted with parameters: • cbdsld = C • grantld = G Monitor the RF output of the UUT. Verify: • UUT does not transmit at any time	PASS

TEL: 886-3-327-3456 Page Number : 26 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.16[WINNF.FT.C.HBT.6] Heartbeat responseCode=501 (SUSPENDED_GRANT) in Subsequent Heartbeat Response

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	 UUT has registered successfully with SAS Test Harness 	
	 UUT has a valid single grant as follows: 	
	○ valid <i>cbsdld</i> = C	
1	○ valid <i>grantld</i> = G	
'	 grant is for frequency range F, power P 	
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	 UUT is in AUTHORIZED state and is transmitting within the grant 	
	bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message is sent within latest specified	PASS
2	heartbeatInterval, and is formatted correctly, including:	
_	• cbsdld = C	
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, including the	
	following parameters:	
3	• cbsdld = C	
3	• grantId = G	
	 transmitExpireTime = T = current UTC time 	
	responseCode = 501 (SUSPENDED_GRANT)	
4	After completion of step 3, SAS Test Harness shall not allow any further	
	grants to the UUT.	

TEL: 886-3-327-3456 Page Number : 27 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

	Monitor the SAS-CBSD interface. Verify either A OR B occurs:	
	A. UUT sends a Heartbeat Request message. Ensure message is	
	sent within latest specified heartbeatInterval, and is correctly	
	formatted with parameters:	
	• cbsdld = C	
	• grantld = G	
_	operationState = "GRANTED"	D400
5	B. UUT sends a Relinquishment Request message. Ensure	PASS
	message is correctly formatted with parameters:	
	• cbdsld = C	
	• grantId = G	
	Monitor the RF output of the UUT. Verify:	
	 UUT shall stop transmission within (T + 60 seconds) of 	
	completion of step 3	

TEL: 886-3-327-3456 Page Number : 28 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.17[WINNF.FT.C.HBT.7] Heartbeat responseCode=502 (UNSYNC_OP_PARAM)

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has registered successfully with SAS Test Harness UUT has a valid single grant as follows:	
2	UUT sends a Heartbeat Request message. Verify Heartbeat Request message is sent within latest specified heartbeatInterval, and is formatted correctly, including: • cbsdld = C • grantId = G • operationState = "AUTHORIZED"	PASS
3	SAS Test Harness sends a Heartbeat Response message, including the following parameters: • cbsdld = C • grantld = G • transmitExpireTime = T = Current UTC Time • responseCode = 502 (UNSYNC_OP_PARAM)	
4	After completion of step 3, SAS Test Harness shall not allow any further grants to the UUT.	
5	Monitor the SAS-CBSD interface. Verify: • UUT sends a Grant Relinquishment Request message. Verify message is correctly formatted with parameters: • cbdsId = C • grantId = G Monitor the RF output of the UUT. Verify: • UUT shall stop transmission within (T+60) seconds of completion of step 3.	PASS

TEL: 886-3-327-3456 Page Number : 29 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.18[WINNF.FT.C.HBT.9] Heartbeat Response Absent (First Heartbeat)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	 UUT has registered successfully with SAS Test Harness 	
	 UUT has a valid single grant as follows: 	
	○ valid <i>cbsdld</i> = C	
1	○ valid <i>grantId</i> = G	
•	 grant is for frequency range F, power P 	
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	 UUT is in GRANTED, but not AUTHORIZED state (i.e. has not 	
	performed its first Heartbeat Request)	
	UUT sends a Heartbeat Request message.	
	Ensure Heartbeat Request message is sent within latest specified	PASS
2	heartbeatInterval, and is formatted correctly, including:	
	• <i>cbsdld</i> = C	1 700
	• grantId = G	
	operationState = "GRANTED"	
3	After completion of Step 2, SAS Test Harness does not respond to any	
<u> </u>	further messages from UUT to simulate loss of network connection	
4	Monitor the RF output of the UUT from start of test to 60 seconds after step 3.	
	Verify:	PASS
	 At any time during the test, UUT shall not transmit on RF 	1700
	interface	

TEL: 886-3-327-3456 Page Number : 30 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.19[WINNF.FT.C.HBT.10] Heartbeat Response Absent (Subsequent Heartbeat)

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	 UUT has registered successfully with SAS Test Harness 	
	 UUT has a valid single grant as follows: 	
	○ valid <i>cbsdld</i> = C	
4	○ valid <i>grantId</i> = G	
1	 grant is for frequency range F, power P 	
	 grantExpireTime = UTC time greater than duration of the 	
	test	
	 UUT is in AUTHORIZED state and is transmitting within the grant 	
	bandwidth F on RF interface	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message issent within the latest specified	
2	heartbeatInterval, and is formatted correctly, including:	PASS
	• cbsdld = C	
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
3	• cbsdld = C	
3	• grantId = G	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
4	After completion of Step 3, SAS Test Harness does not respond to any	
	further messages from UUT	
	Monitor the RF output of the UUT. Verify:	
5	 UUT shall stop all transmission on RF interface within 	PASS
o O	(transmitExpireTime + 60 seconds), using the	1 700
	transmitExpireTime sent in Step 3.	

TEL: 886-3-327-3456 Page Number : 31 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.20[WINNF.FT.C.HBT.11] Successful Grant Renewal in Heartbeat Test Case

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has registered successfully with SAS Test Harness	
	UUT has a valid single grant as follows:	
	○ valid <i>cbsdld</i> = C	
	○ valid <i>grantId</i> = G	
	 grant is for frequency range F, power P 	
1	UUT is in AUTHORIZED state and is transmitting within the grant	
'	bandwidth F on RF interface.	
	Grant has the following parameters at the start of the test:	
	 grantExpireTime =UTC time equal to time at start of test + 	
	300 seconds = Tgrant_expire	
	 transmitExpireTime = UTC time equal to time at start of test + 	
	200 seconds	
	heartbeatInterval = 60 seconds	
	UUT sends a Heartbeat Request message.	
2	If Heartbeat Request message contains grantRenew = TRUE, go to Step	
	6, else go to Step 3.	
	Verify Heartbeat Request message is sent within the latest specified	
	heartbeatInterval, and is formatted correctly, including:	
3	• cbsdld = C	PASS
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
	• cbsdld = C	
4	• grantId = G	
	 transmitExpireTime = current UTC + 200 seconds 	
	 grantExpireTime = same as Step 1 	
	• responseCode = 0	
5	Go to Step 2	

TEL: 886-3-327-3456 Page Number : 32 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

6	Verify Heartbeat Request message is sent within the latest specified	
	heartbeatInterval, and is formatted correctly, including:	
	• cbsdld = C	PASS
	• grantId = G	PASS
	operationState = "AUTHORIZED"	
	• grantRenew = TRUE	
	SAS Test Harness sends a Heartbeat Response message, with the	
	following parameters:	
	• cbsdld = C	
7	• grantId = G	
	grantExpireTime = UTC time set far in the future	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
	Continue to respond to any subsquentHeartbeat Request from CBSD with	
	Heartbeat Response with the following parameters:	
	• cbsdld = C	
8	• grantId = G	
	 transmitExpireTime = same as Step 7 	
	• responseCode = 0	
9	Monitor RF transmission of UUT from start of test until Tgrant_expire	
	+ 60 seconds and ensure UUT continues to transmit throughout the time	PASS
	period.	

TEL: 886-3-327-3456 Page Number : 33 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.21 [WINNF.FT.C.MES.1] Registration Response contains measReportConfig

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
2	UUT sends a Registration Request message.	
	Validate the Registration Request message is formatted correctly, including:	
	userId is present and correct	
	fccld is present and correct	PASS
	cbsdSerialNumber is present and correct	FA33
	measCapability =	
	"RECEIVED_POWER_WITHOUT_GRANT"	
	SAS Test Harness sends a Registration Response message, with the	
	following parameters:	
3	 cbsdld = C = valid cbsdld for this UUT 	
	measReportConfig=	
	"RECEIVED_POWER_WITHOUT_GRANT"	
	• responseCode = 0	
	UUT sends a message:	
4	 If message is type Spectrum Inquiry Request, go to step 5, or 	
	If message is type Grant Request, go to step 7	
	UUT sends message type Spectrum Inquiry Request. Verify message contains	
5	all required parameters properly formatted, and specifically:	
	• cbsdld = C	PASS
	 measReport is present, and is a properly formatted 	
	rcvdPowerMeasReport.	
6	SAS Test Harness sends a Spectrum Inquiry Response, with the	
	following parameters:	
	• cbsdld = C	
	 availableChannel is an array of availableChannel objects 	
	• responseCode = 0	

TEL: 886-3-327-3456 Page Number : 34 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02



	UUT sends message type Grant Request message. Verify message contains	
	all required parameters properly formatted, and specifically:	
7	• cbsdld = C	PASS
	 measReport is present, and is a properly formatted 	
	rcvdPowerMeasReport.	

TEL: 886-3-327-3456 Page Number : 35 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.22[WINNF.FT.C.MES.3] Grant Response contains measReportConfig

#	Test Execution Steps	Results
1	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	UUT has successfully registered with SAS Test Harness, with	
	cbsdld=C and measCapability =	
	"RECEIVED_POWER_WITH_GRANT"	
2	UUT sends a Grant Request message.	
	Verify Grant Request message contains all required parameters properly	
	formatted, and specifically:	PASS
	• cbsdld = C	
	operationParam is present and format is valid	
	SAS Test Harness sends a Grant Response message, with the following	
	parameters:	
	• cbsdld = C	
	• grantId = G = valid grant ID	
3	• grantExpireTime = UTC time in the future	
3	• heartbeatInterval = 60 seconds	
	 measReportConfig= "RECEIVED_POWER_WITH_GRANT" 	
	operationParam is set to valid operating parameters	
	• channelType = "GAA"	
	• responseCode = 0	
	UUT sends a Heartbeat Request message. Verify message contains all	
4	required parameters properly formatted, and specifically:	PASS
	• cbsdld = C	
	• grantId = G	
	operationState = "GRANTED"	
	If Heartbeat Request message (step 4) contains measReport object,	
5	then:	
	 verify measReport is properly formatted as object 	
	rcvdPowerMeasReport	PASS
	end test, with PASS result	
	else, if Heartbeat Request message (step 4) does not contain	
	measReport object, then:	

TEL: 886-3-327-3456 Page Number : 36 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

	If number of Heartbeat Requests sent by UUT after Step 3 is = 5,	
	then stop test with result of FAIL	
	SAS Test Harness sends a Heartbeat Response message, containing all	
	required parameters properly formatted, and specifically:	
	• <i>cbsdld</i> = C	
6	• grantld = G	
	 transmitExpireTime = current UTC time + 200 seconds 	
	• responseCode = 0	
	Go to Step 4, above	

TEL: 886-3-327-3456 Page Number : 37 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.23[WINNF.FT.C.MES.4] Heartbeat Response contains measReportConfig

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	UUT has successfully registered with SAS Test Harness, with	
1	cbsdld=C and measCapability =	
1	"RECEIVED_POWER_WITH_GRANT"	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Grant has heartbeatInterval = 60 seconds	
	UUT sends a Heartbeat Request message.	
	Verify Heartbeat Request message contains all required parameters properly	
2	formatted, and specifically:	PASS
	• cbsdld = C	FASS
	• grantId = G	
	operationState = "AUTHORIZED"	
	SAS Test Harness sends a Heartbeat Response message, containing all	
	required parameters properly formatted, and specifically:	
3	• cbsdld = C	
3	• grantId = G	
	measReportConfig= "RECEIVED_POWER_WITH_GRANT"	
	• responseCode = 0	
	UUT sends a Heartbeat Request message. Verify message contains all	
4	required parameters properly formatted, and specifically:	
	• cbsdld = C	PASS
	• grantId = G	
	operationState = "AUTHORIZED"	

TEL: 886-3-327-3456 Page Number : 38 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

	If Heartbeat Request message (step 4) contains measReport object,	
	then:	
	 verify measReport is properly formatted as object 	
	rcvdPowerMeasReport	
5	end test, with PASS result	PASS
	else, if Heartbeat Request message (step 4) does not contain	
	measReport object, then:	
	 If number of Heartbeat Requests sent by UUT after Step 3 is = 5, 	
	then stop test with result of FAIL	
	SAS Test Harness sends a Heartbeat Response message, containing all	
	required parameters properly formatted, and specifically:	
6	• cbsdld = C	
	• grantld = G	
	• responseCode = 0	
	Go to Step 4, above	

TEL: 886-3-327-3456 Page Number : 39 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.24[WINNF.FT.C.RLQ.1] Successful Relinquishment

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT has successfully registered with SAS Test Harness, with cbsdld=C UUT has received a valid grant with grantld = G UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant. Invoke trigger to relinquish UUT Grant from the SAS Test Harness 	
2	UUT sends a Relinquishment Request message. Verify message contains all required parameters properly formatted, and specifically: • cbsdld = C • grantld = G	PASS
3	SAS Test Harness shall approve the request with a Relinquishment Response message with parameters: - cbsdld = C - grantld = G - responseCode = 0	
4	After completion of step 3, SAS Test Harness will not provide any additional positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall stop RF transmission at any time between triggering the relinquishment and UUT sending the relinquishment request	PASS

TEL: 886-3-327-3456 Page Number : 40 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.25[WINNF.FT.C.RLQ.3] Unsuccessful Relinquishment, responseCode=102

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	UUT has successfully registered with SAS Test Harness, with	
1	cbsdld=C	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Invoke trigger to Relinquish UUT Grant from the SAS Test Harness	
	UUT sends a Relinquishment Request message. Verify message contains	
2	all required parameters properly formatted, and specifically:	
	• cbsdld = C	
	• grantId = G	
	SAS Test Harness shall send a Relinquishment Response message with	
	parameters:	
3	• cbsdld = C	
	No grantId	
	• responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=0) to further request messages from the	
	UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT stopped RF transmission at any time between triggering the	1 700
	relinquishment and UUT sending the relinquishment request	

TEL: 886-3-327-3456 Page Number : 41 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.26[WINNF.FT.C.RLQ.5] Unsuccessful Relinquishment, responseCode=103

#	Test Execution Steps	Results
	Ensure the following conditions are met for test entry:	
	UUT has successfully completed SAS Discovery and	
	Authentication with SAS Test Harness	
	UUT has successfully registered with SAS Test Harness, with	
1	cbsdld=C	
	 UUT has received a valid grant with grantId = G 	
	UUT is in Grant State AUTHORIZED and is actively	
	transmitting within the bounds of its grant.	
	Invoke trigger to Relinquish UUT Grant from the SAS Test Harness	
	UUT sends a Relinquishment Request message. Verify message contains	
2	all required parameters properly formatted, and specifically:	
	• cbsdld = C	
	• grantId = G	
	SAS Test Harness shall send a Relinquishment Response message with	
	parameters:	
3	• cbsdld = C	
	No grantId	
	• responseCode = R	
	After completion of step 3, SAS Test Harness will not provide any	
4	positive response (responseCode=103) to further request messages from	
	the UUT.	
	Monitor the RF output of the UUT from start of test until 60 seconds after	
5	Step 3 is complete. This is the end of the test. Verify:	PASS
	UUT stopped RF transmission at any time between triggering the	1 700
	relinquishment and UUT sending the relinquishment request	

TEL: 886-3-327-3456 Page Number : 42 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.27[WINNF.FT.C.DRG.1] Successful Deregistration

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT has successfully registered with SAS Test Harness, with cbsdld=C UUT has received a valid grant with grantld = G UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant. Invoke trigger to deregister UUT from the SAS Test Harness 	
2	UUT sends a Relinquishment request and receives Relinquishment response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C.	PASS
4	SAS Test Harness shall approve the request with a Deregistration Response message with parameters: • cbsdld = C • responseCode = 0	
5	After completion of step 3, SAS Test Harness will not provide any additional positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
6	Monitor the RF output of the UUT from start of test until 60 seconds after Step 4 is complete. This is the end of the test. Verify: UUT stopped RF transmission at any time between triggering the deregistration and either A OR B occurs: A. UUT sending a Registration Request message, as this is not mandatory B. UUT sending a Deregistration Request message	PASS

TEL: 886-3-327-3456 Page Number : 43 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.28[WINNF.FT.C.DRG.3] Deregistration responseCode=102

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT has successfully registered with SAS Test Harness, with cbsdld=C UUT has received a valid grant with grantld = G UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant. Invoke trigger to deregister UUT from the SAS Test Harness 	
2	UUT sends a Relinquishment request and receives Relinquishment response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C	
4	The SAS Test Harness sends the Deregistration Response Message to UUT with: • No cbsdld • responseCode = 102	
5	After completion of step 3, SAS Test Harness will not provide any positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
6	 Monitor the RF output of the UUT from start of test until 60 seconds after Step 4 is complete. This is the end of the test. Verify: UUT stopped RF transmission at any time between triggering the deregistration and either A OR B occurs: A. UUT sending a Registration Request message, as this is not mandatory B. UUT sending a Deregistration Request message 	PASS

TEL: 886-3-327-3456 Page Number : 44 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.29[WINNF.FT.C.DRG.5] Deregistration responseCode=103

#	Test Execution Steps	Results
1	 Ensure the following conditions are met for test entry: UUT has successfully completed SAS Discovery and Authentication with SAS Test Harness UUT has successfully registered with SAS Test Harness, with cbsdld=C UUT has received a valid grant with grantld = G UUT is in Grant State AUTHORIZED and is actively transmitting within the bounds of its grant. Invoke trigger to deregister UUT from the SAS Test Harness 	
2	UUT sends a Relinquishment request and receives Relinquishment response with responseCode=0	
3	UUT sends Deregistration Request to SAS Test Harness with <i>cbsdld</i> = C	
4	The SAS Test Harness sends the Deregistration Response Message to UUT with: • No cbsdld • responseCode = 103	
5	After completion of step 3, SAS Test Harness will not provide any positive response (<i>responseCode</i> =0) to further request messages from the UUT.	
6	 Monitor the RF output of the UUT from start of test until 60 seconds after Step 4 is complete. This is the end of the test. Verify: UUT stopped RF transmission at any time between triggering the deregistration and either A OR B occurs: A. UUT sending a Registration Request message, as this is not mandatory B. UUT sending a Deregistration Request message 	PASS

TEL: 886-3-327-3456 Page Number : 45 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.30[WINNF.FT.C.SCS.1] Successful TLS connection between UUT and SAS Test Harness

#	Test Execution Steps	Results
1	 UUT shall start CBSD-SAS communication with the security procedure The UUT shall establish a TLS handshake with the SAS Test Harness using configured certificate. Configure the SAS Test Harness to accept the security procedure and establish the connection 	PASS
2	 Make sure that Mutual authentication happens between UUT and the SAS Test Harness. Make sure that UUT uses TLS v1.2 Make sure that cipher suites from one of the following is selected, TLS_RSA_WITH_AES_128_GCM_SHA256 TLS_RSA_WITH_AES_256_GCM_SHA384 TLS_ECDHE_ECDSA_WITH_AES_128_GCM_SHA2 56 TLS_ECDHE_ECDSA_WITH_AES_256_GCM_SHA3 84 TLS_ECDHE_RSA_WITH_AES_128_GCM_SHA256 	PASS
3	A successful registration is accomplished using one of the test cases described in section 6.1.4.1, depending on CBSD capability. • UUT sends a registration request to the SAS Test Harness and the SAS Test Harness sends a Registration Response with responseCode = 0 and cbsdld. Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify:	PASS PASS
	UUT shall not transmit RF	

TEL: 886-3-327-3456 Page Number : 46 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.31 [WINNF.FT.C.SCS.2] TLS failure due to revoked certificate

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
2	 Make sure that UUT uses TLS v1.2 for security establishment. Make sure UUT selects the correct cipher suite. UUT shall use CRL or OCSP to verify the validity of the server certificate. Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness. 	PASS
3	UUT may retry for the security procedure which shall fail	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 47 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.32[WINNF.FT.C.SCS.3] TLS failure due to expired server certificate

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication with the security procedures	PASS
2	 Make sure that UUT uses TLS v1.2 for security establishment. Make sure UUT selects the correct cipher suite. UUT shall use CRL or OCSP to verify the validity of the server certificate. Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness. 	PASS
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 48 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.33[WINNF.FT.C.SCS.4] TLS failure when SAS Test Harness certificate is issued by an unknown CA

#	Test Execution Steps	Results	
1	UUT shall start CBSD-SAS communication with the security procedures	PASS	
	Make sure that UUT uses TLS v1.2 for security establishment.		
	Make sure UUT selects the correct cipher suite.	PASS	
2	UUT shall use CRL or OCSP to verify the validity of the server certificate		
	Make sure that Mutual authentication does not happen between UUT		
	and the SAS Test Harness.		
3	UUT may retry for the security procedure which shall fail.	PASS	
4	SAS Test-Harness shall not receive any Registration request or any		
4	application data.		
	Monitor the RF output of the UUT from start of test until 60 seconds after		
5	Step 3 is complete. This is the end of the test. Verify:	PASS	
	UUT shall not transmit RF		

TEL: 886-3-327-3456 Page Number : 49 of 52
FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.34[WINNF.FT.C.SCS.5] TLS failure when certificate at the SAS Test Harness is corrupted

#	Test Execution Steps	Results
1	UUT shall start CBSD-SAS communication withthe security procedures	PASS
2	 Make sure that UUT uses TLS v1.2 for security establishment. Make sure UUT selects the correct cipher suite. UUT shall use CRL or OCSP to verify the validity of the server certificate. Make sure that Mutual authentication does not happen between UUT and the SAS Test Harness. 	PASS
3	UUT may retry for the security procedure which shall fail.	PASS
4	SAS Test-Harness shall not receive any Registration request or any application data.	
5	Monitor the RF output of the UUT from start of test until 60 seconds after Step 3 is complete. This is the end of the test. Verify: • UUT shall not transmit RF	PASS

TEL: 886-3-327-3456 Page Number : 50 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

4.35[WINNF.PT.C.HBT] UUT RF Transmit Power Measurement

#	Test Execution Steps	Results	
	Ensure the following conditions are met for test entry:		
	UUT has successfully completed SAS Discovery and		
	Authentication with the SAS Test Harness		
	 UUT has registered with the SAS, with CBSD ID = C 		
	UUT has a single valid grant G with parameters {lowFrequency		
	= FL, highFrequency = FH, maxEirp = Pi}, with grant in		
	AUTHORIZED state, and grantExpireTime set to a value far past		
1	the duration of this test case		
'			
	Note: in order for the UUT to request a grant with the parameters		
	{lowFrequency, highFrequency, maxEirp), the SAS Test Harness may need		
	to provide appropriate guidance in the availableChannel object of the		
	spectrumInquiry response message, and the operationParam object of the		
	grant response message. Alternately, the UUT vendor may provide the ability		
	to set those parameters on the UUT so that the UUT will request a grant with		
	those parameters.		
	UUT and SAS Test Harness perform a series of Heartbeat Request/Response		
	cycles, which continues until the other test steps are complete. Messaging for		
	each cycle is as follows:		
	UUT sends Heartbeat Request, including:		
	○ cbsdld = C		
2	○ grantId = G		
_	SAS Test Harness responds with Heartbeat Response,		
	including:		
	○ cbsdld = C		
	○ grantId = G		
	 transmitExpireTime = current UTC time + 200 seconds 		
	o responseCode = 0		

TEL: 886-3-327-3456 Page Number : 51 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

	Tester performs power measurement on RF interface(s) of UUT, and verifies it	
	complies with the maxEirp setting, Pi. The RF measurement method is out of	
	scope of this document, but may include additional configuration of the UUT, as	
	required, to fulfil the requirements of the power measurement method.	
3		PASS
	Note: it may be required for the vendor to provide a method or	
	configuration to bring the UUT to a mode which is required by the	
	measurement methodology. Any such mode is vendor-specific and	
	depends upon UUT behavior and the measurement methodology.	

TEL: 886-3-327-3456 Page Number : 52 of 52 FAX: 886-3-328-4978 Issued Date : Jan. 21, 2021

Report Version : 02

Appendix B. RF measurement plots

Report Clause 4.35 [WINNF.PT.C.HBT] UUT RF Transmit Power Measurement


Center	Bandwidth r	Granted	Conducted PSD [dBm/MHz]				Antenna	UUT total
Frequency [MHz]		maxEIRP [dBm/MHz]	TX 0	TX 1	TX 2	TX 3	Gain [dBi]	MaxEIRP [dBm/MHz]
		36	11.25	13.22	11.85	13.19	13.2	31.68
3560		34	11.18	12.76	11.40	12.88		31.34
		32	10.61	11.50	10.32	11.51		30.24
	20	30	8.12	10.72	9.17	10.82		29.07
3625		28	5.33	8.53	5.79	7.44		26.18
		26	3.70	4.53	3.75	4.56		23.37
		24	2.31	3.71	2.47	3.40		22.23
3690		22	0.18	1.42	0.87	1.53		20.25
		20	-2.19	-0.49	-2.32	-0.36		17.98

Report No.: FG0O1212A

Note: The Spectrum Analyzer Ref Offset 24.91 dB is the cable path loss 24.91 dB.


TEL: 886-3-327-3456 Page Number : B1 of B10



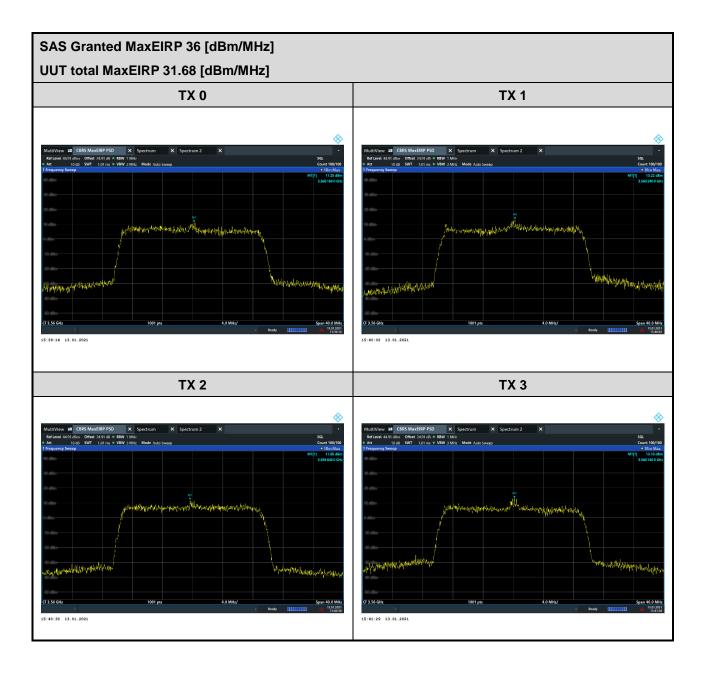


: B2 of B10 TEL: 886-3-327-3456 Page Number



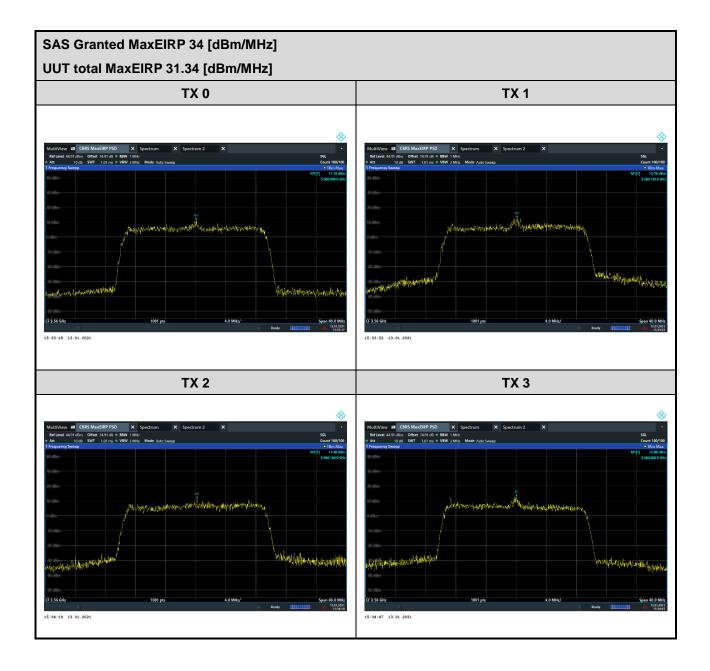

: B3 of B10 TEL: 886-3-327-3456 Page Number




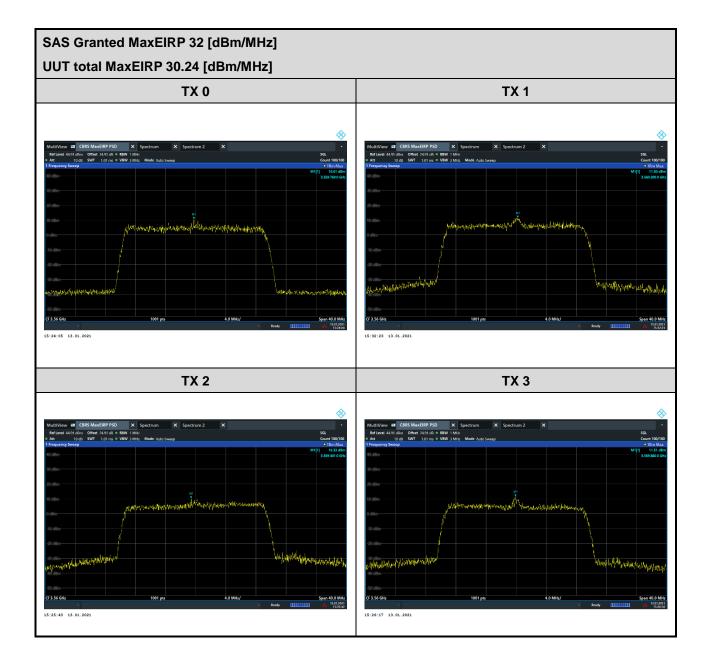

: B4 of B10 TEL: 886-3-327-3456 Page Number



Report No.: FG0O1212A SAS Granted MaxEIRP 30 [dBm/MHz]

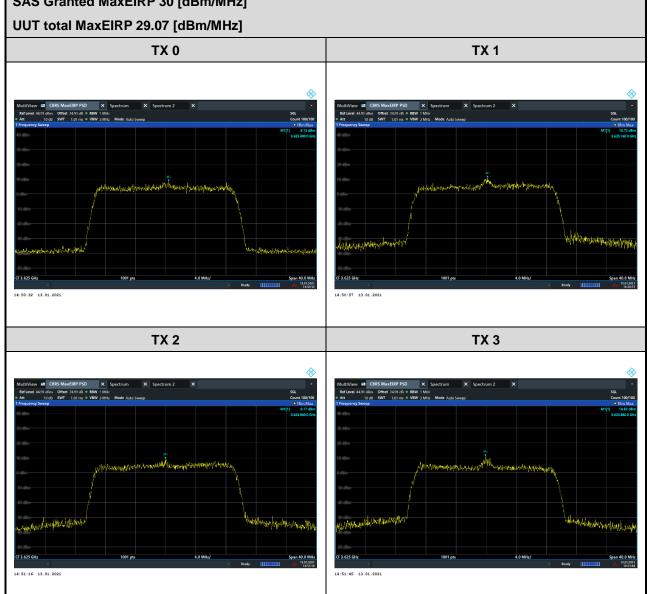

: B5 of B10 TEL: 886-3-327-3456 Page Number



SAS Granted MaxEIRP 28 [dBm/MHz] UUT total MaxEIRP 26.18 [dBm/MHz] TX 0 **TX 1** TX 2 **TX 3**

15:00:28 13.01.2021

Report No.: FG0O1212A

TEL: 886-3-327-3456 Page Number: B6 of B10



SAS Granted MaxEIRP 26 [dBm/MHz] UUT total MaxEIRP 23.37 [dBm/MHz] TX 0 **TX 1** TX 2 **TX 3**

Report No.: FG0O1212A

TEL: 886-3-327-3456 Page Number: B7 of B10



15:49:28 13.01.2021

SAS Granted MaxEIRP 24 [dBm/MHz]

UUT total MaxEIRP 22.23 [dBm/MHz]

TX 0

TX 1

White a second sec


15:49:54 13.01.2021

Report No.: FG0O1212A

TEL: 886-3-327-3456 Page Number : B8 of B10 FAX: 886-3-328-4978




Report No.: FG0O1212A SAS Granted MaxEIRP 22 [dBm/MHz]

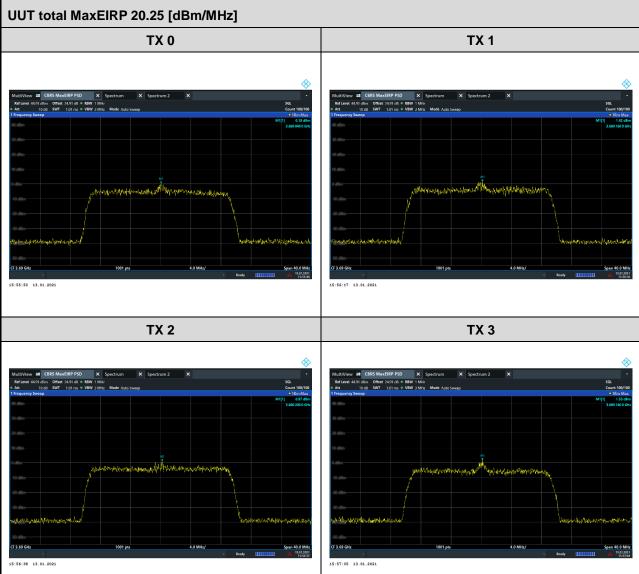

TEL: 886-3-327-3456 : B9 of B10 Page Number



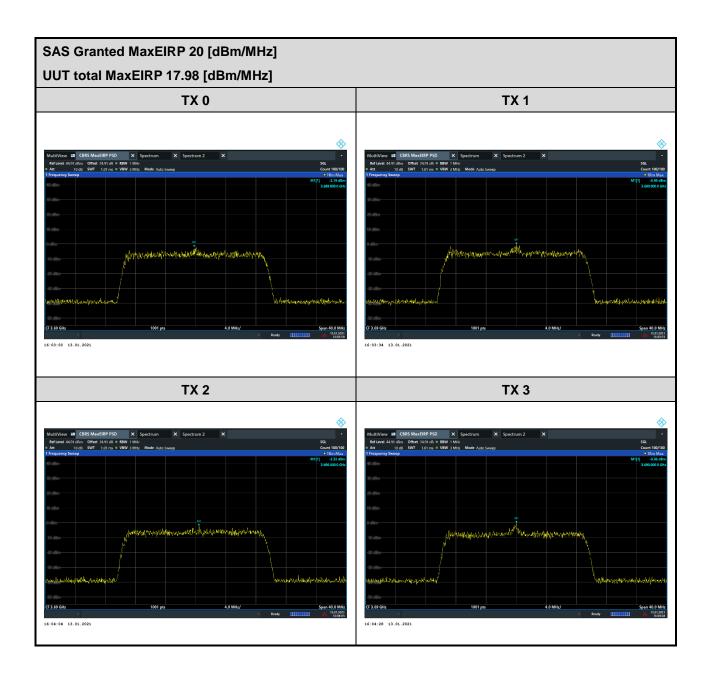



TEL: 886-3-327-3456 Page Number : B10 of B10