






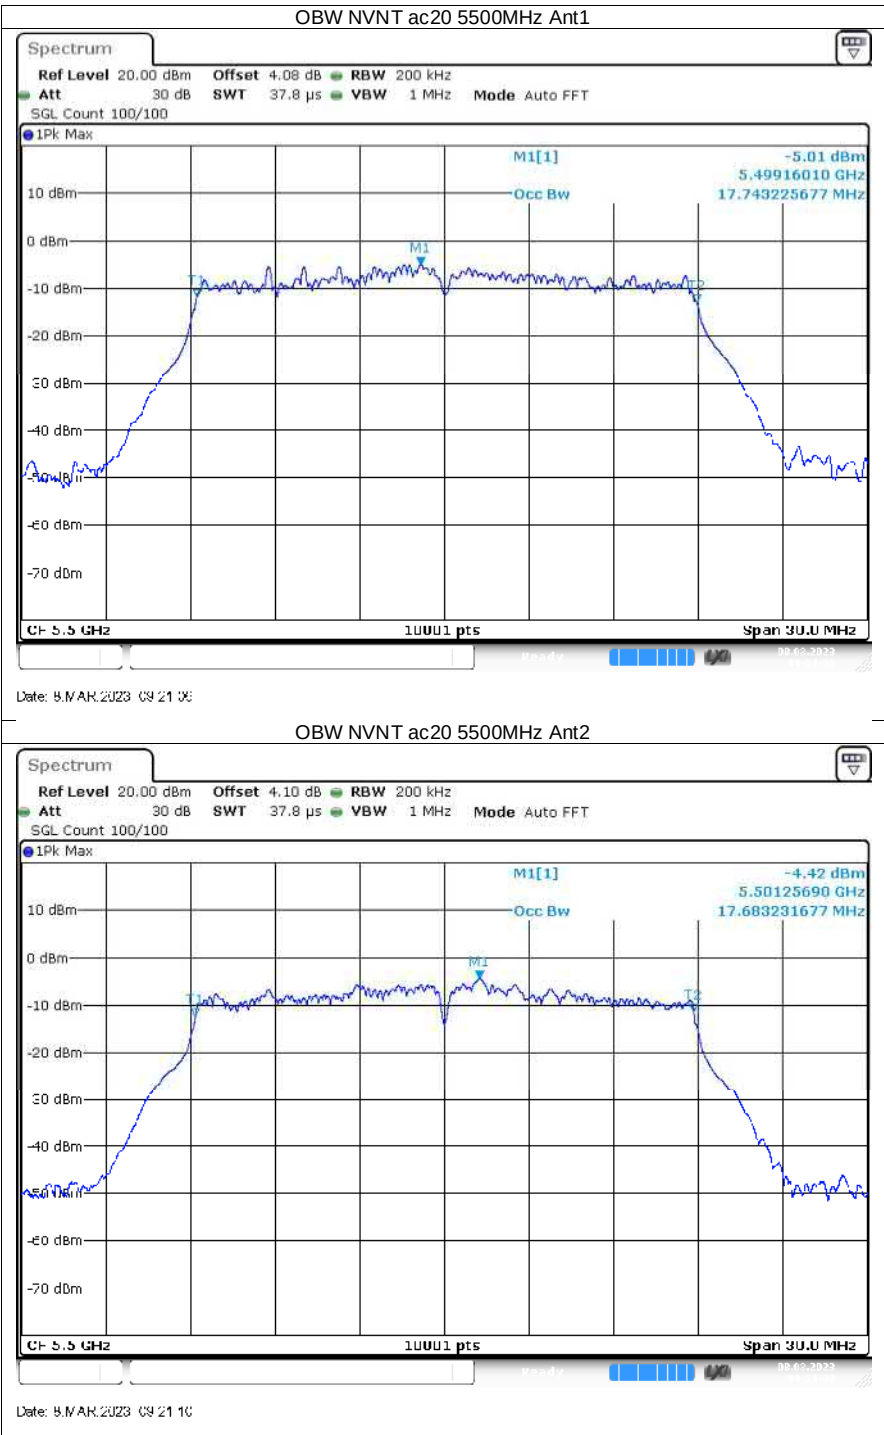


China

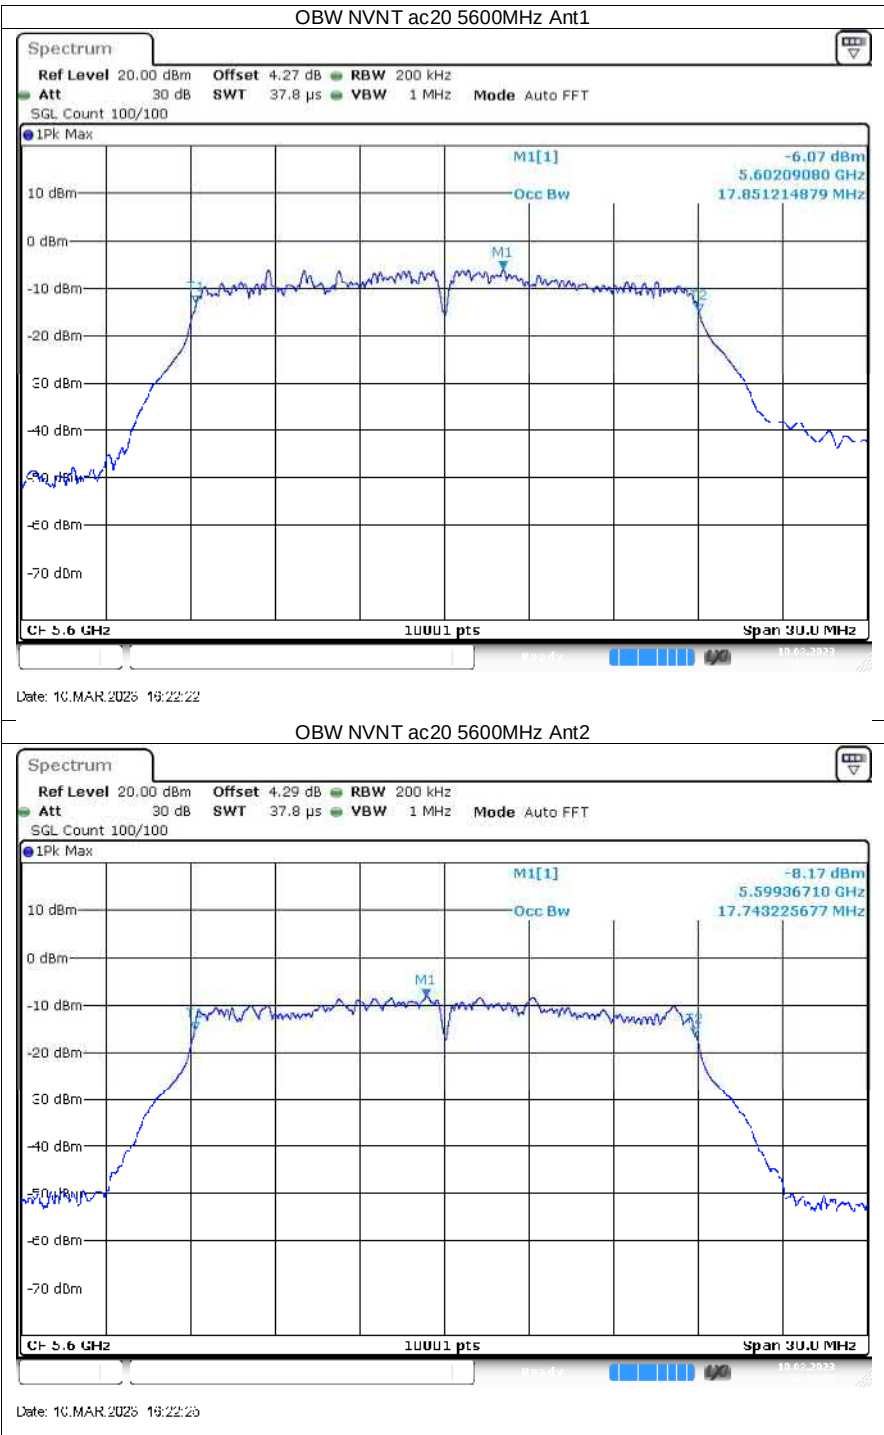

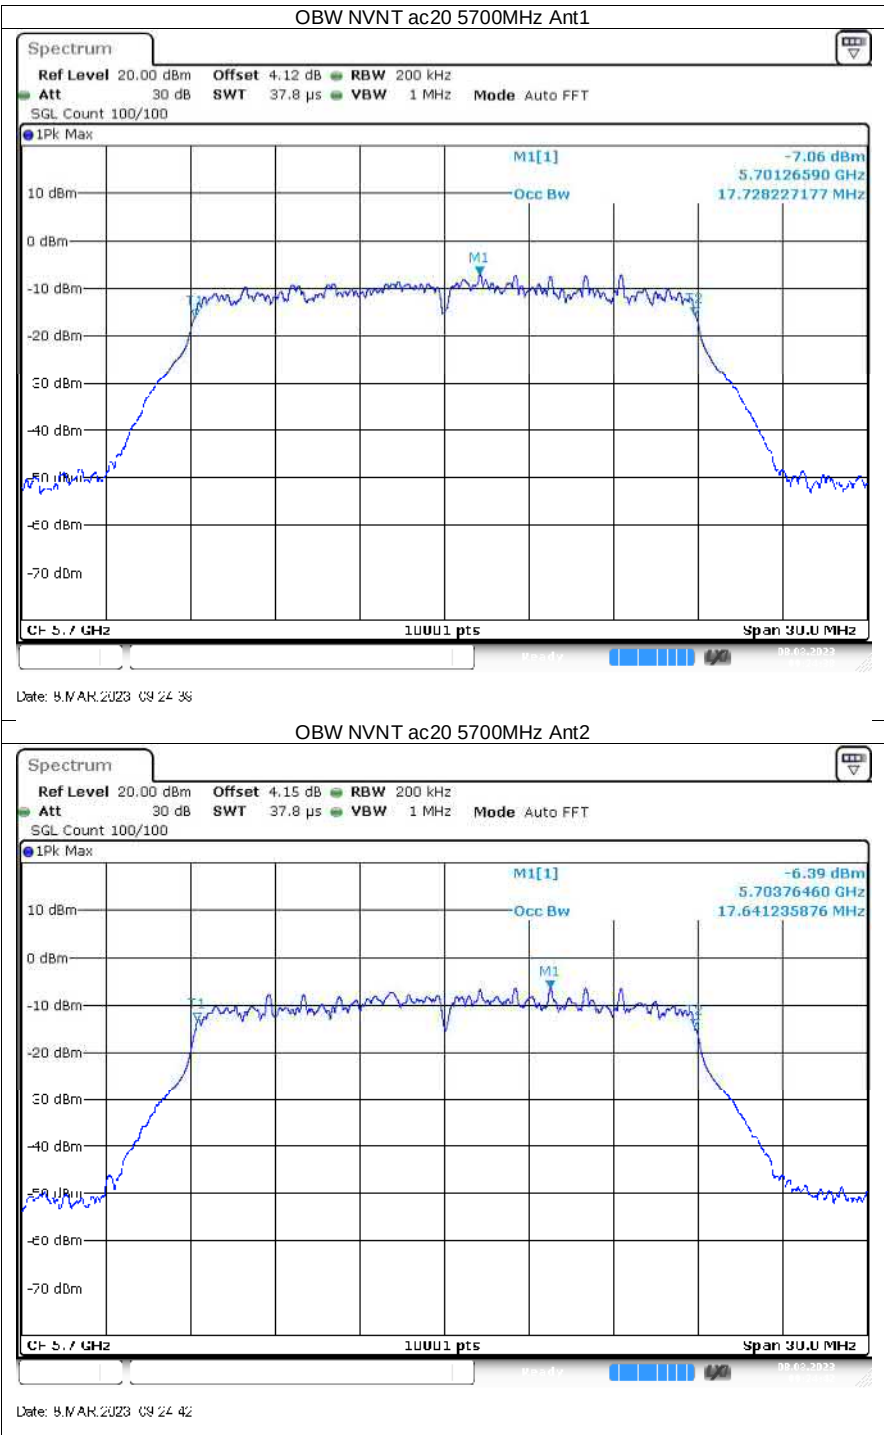





China

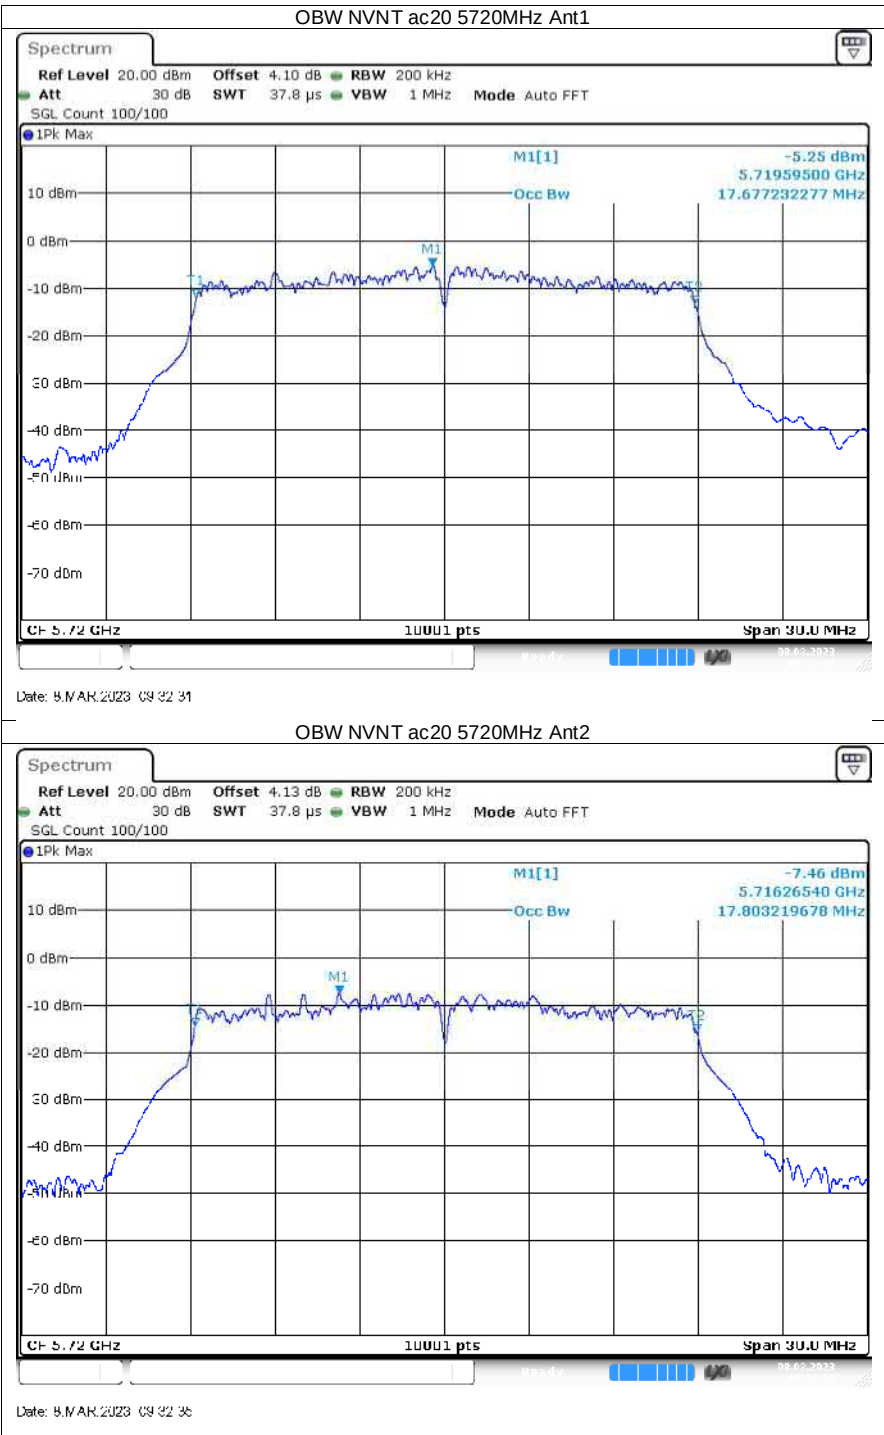





China

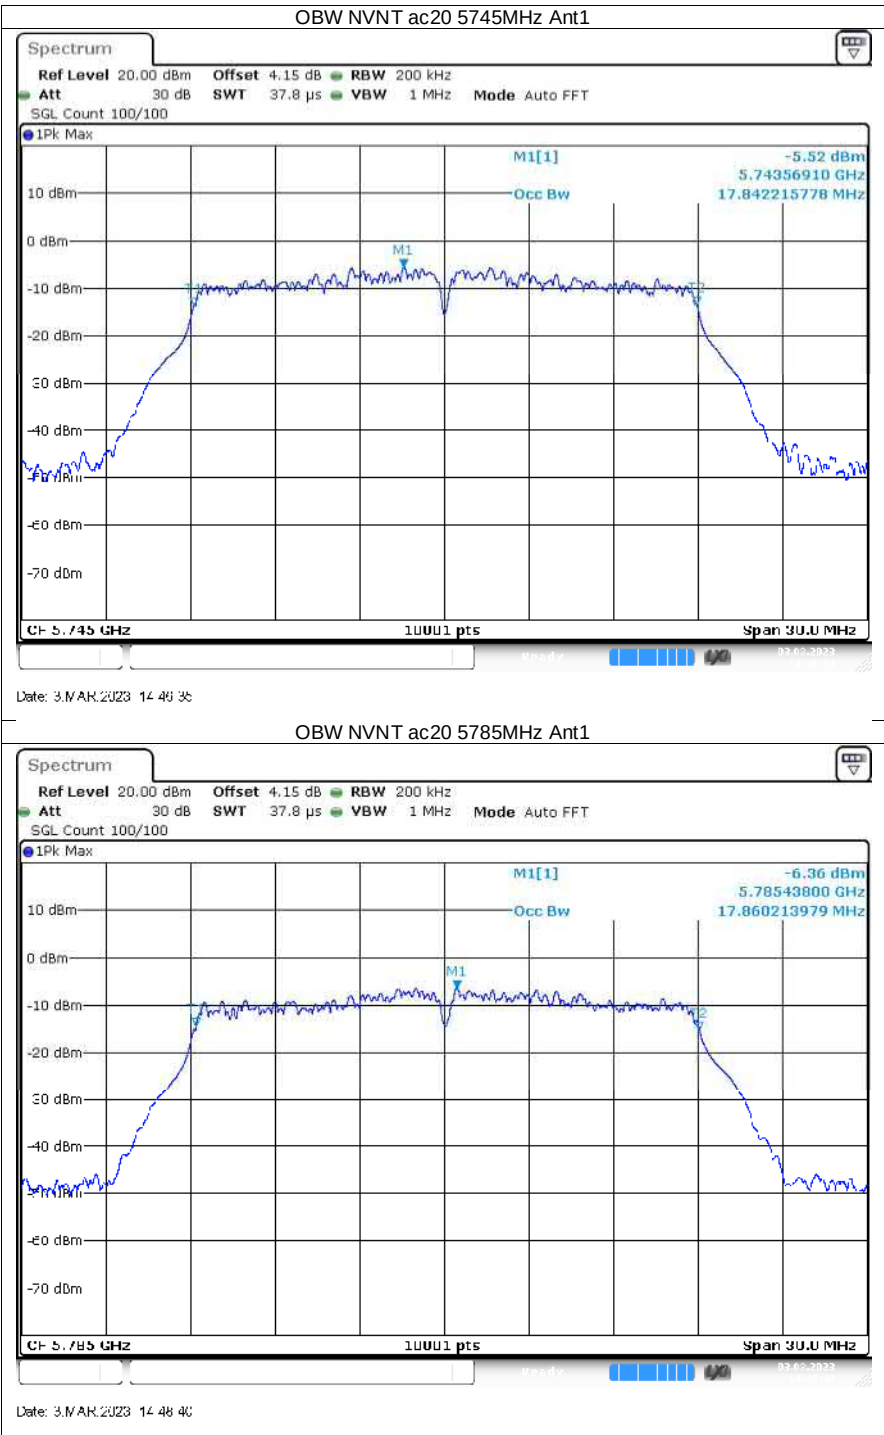

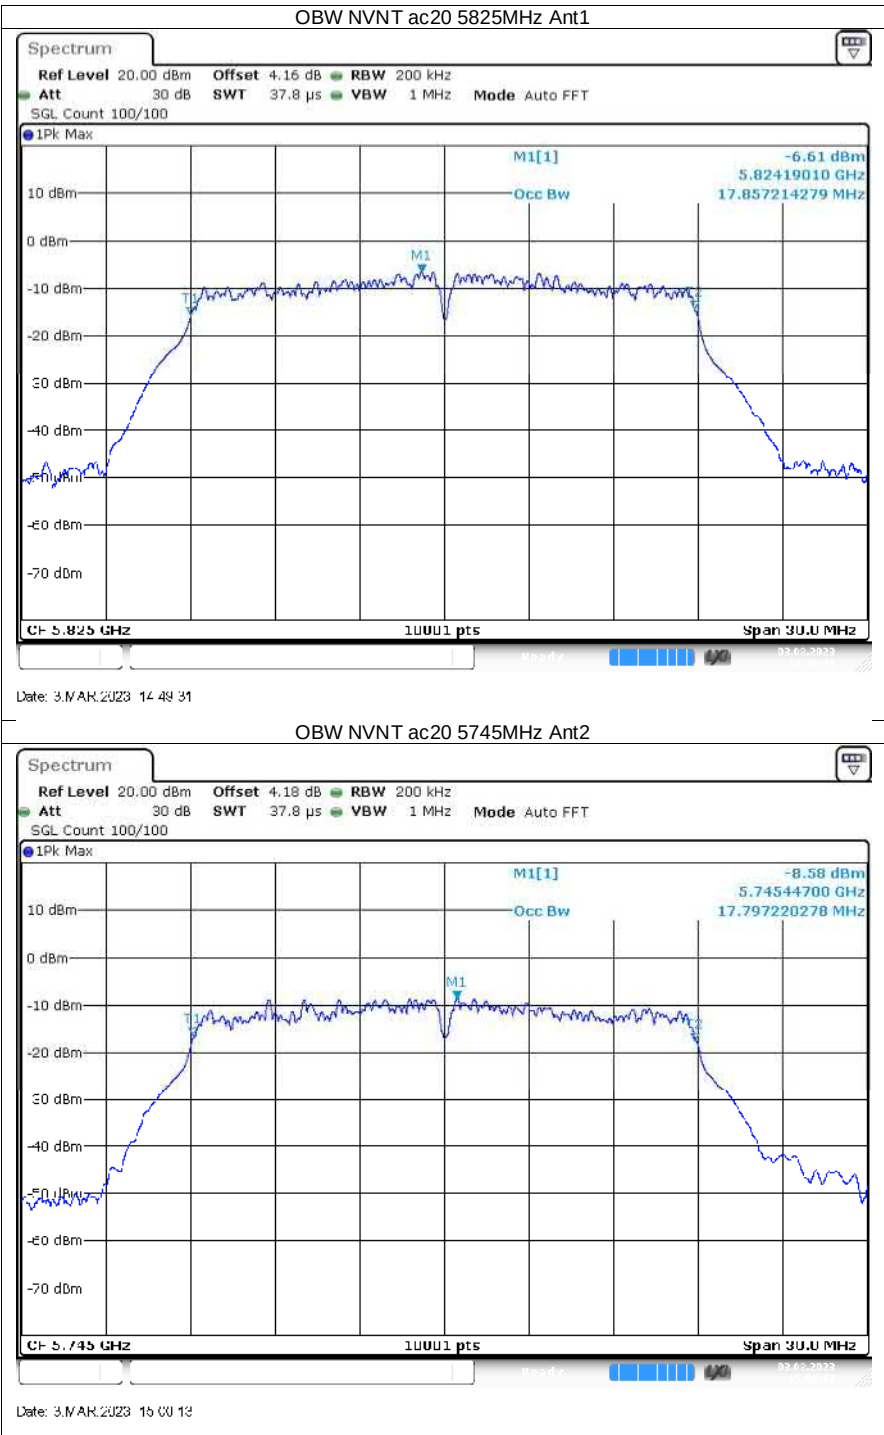


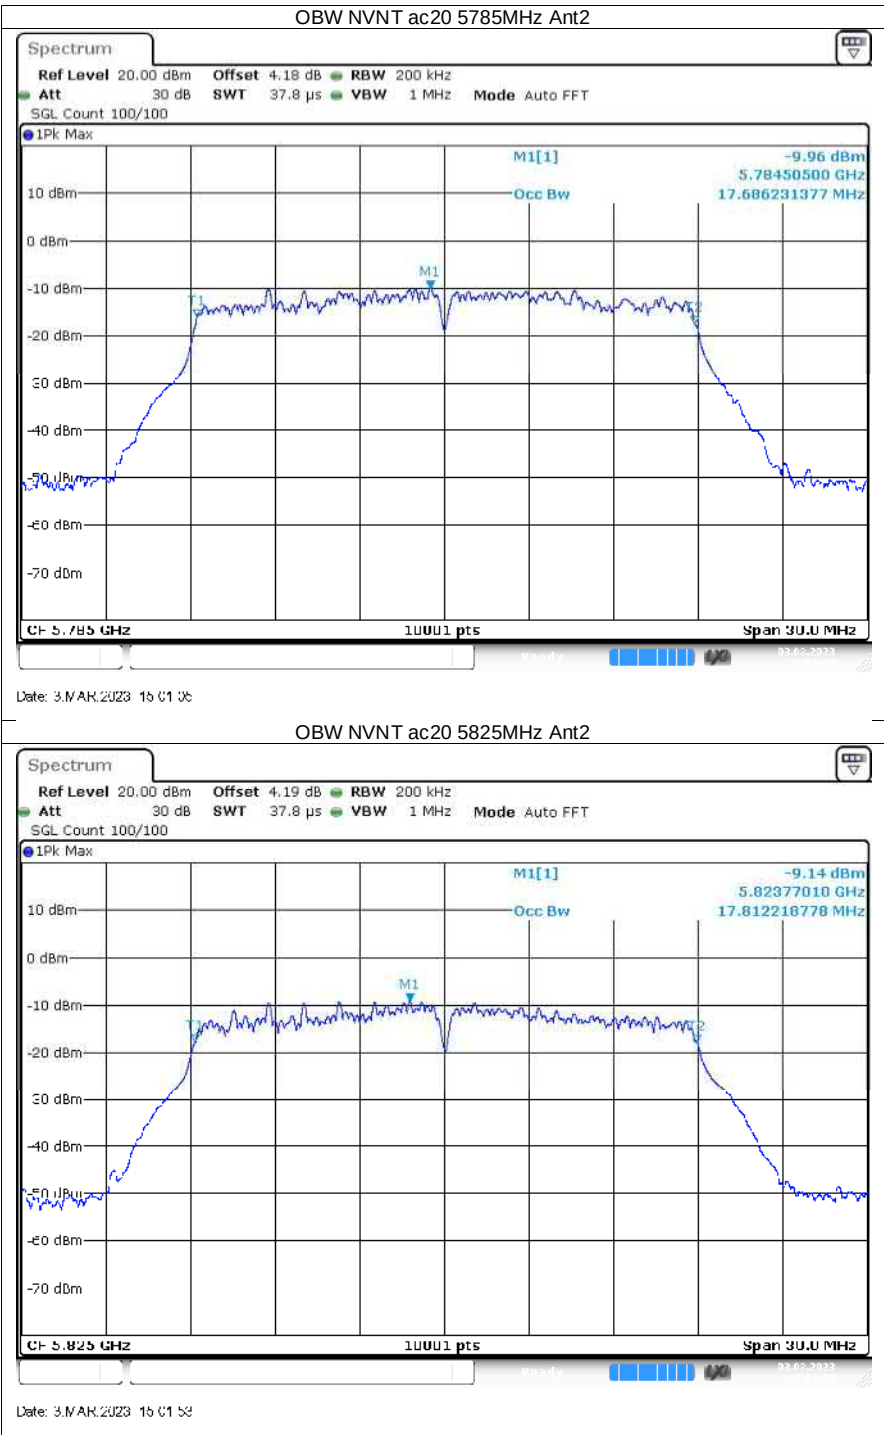


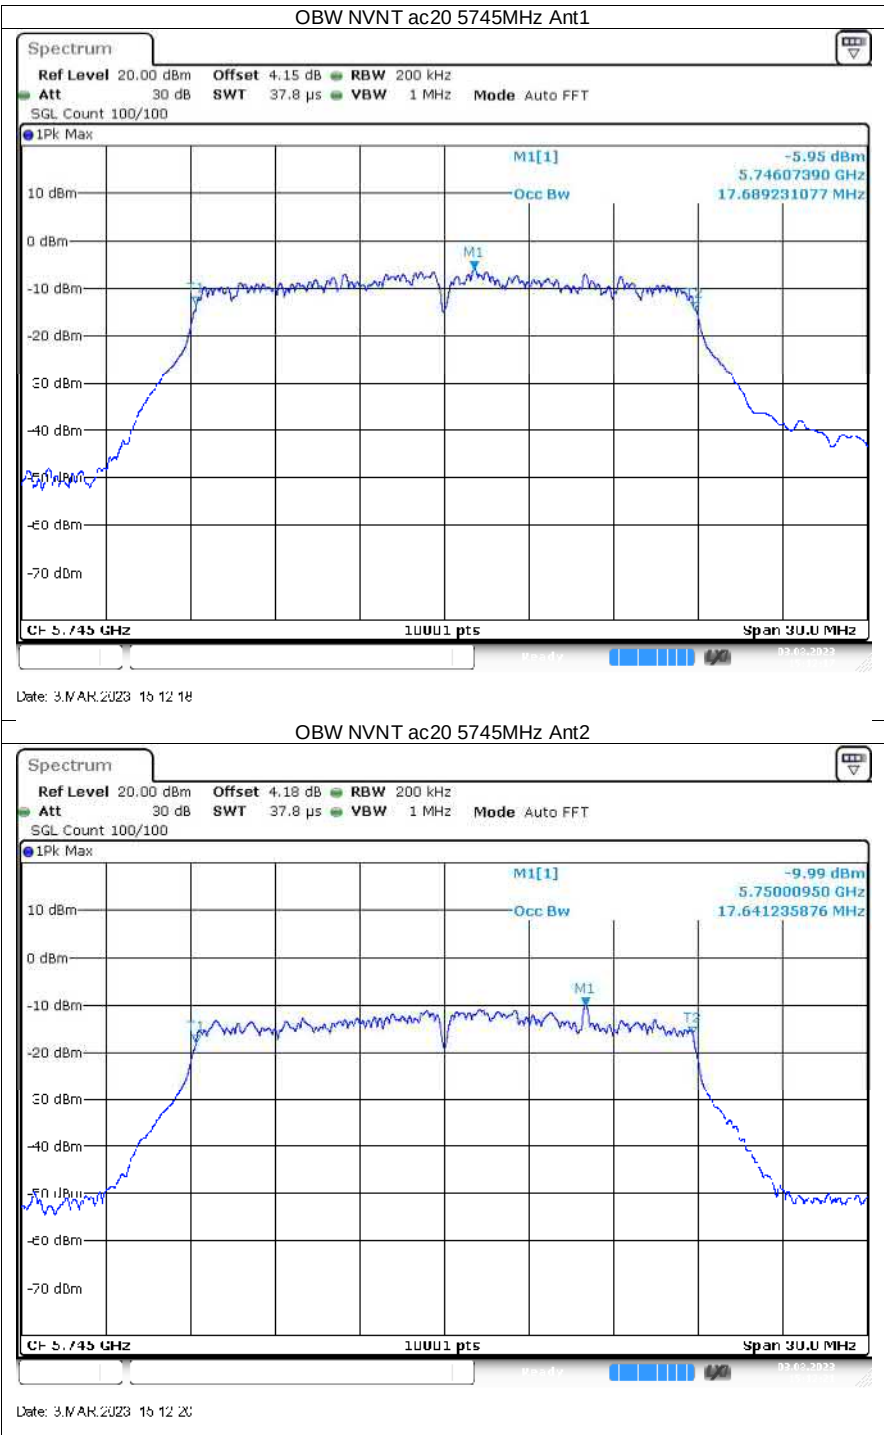




China

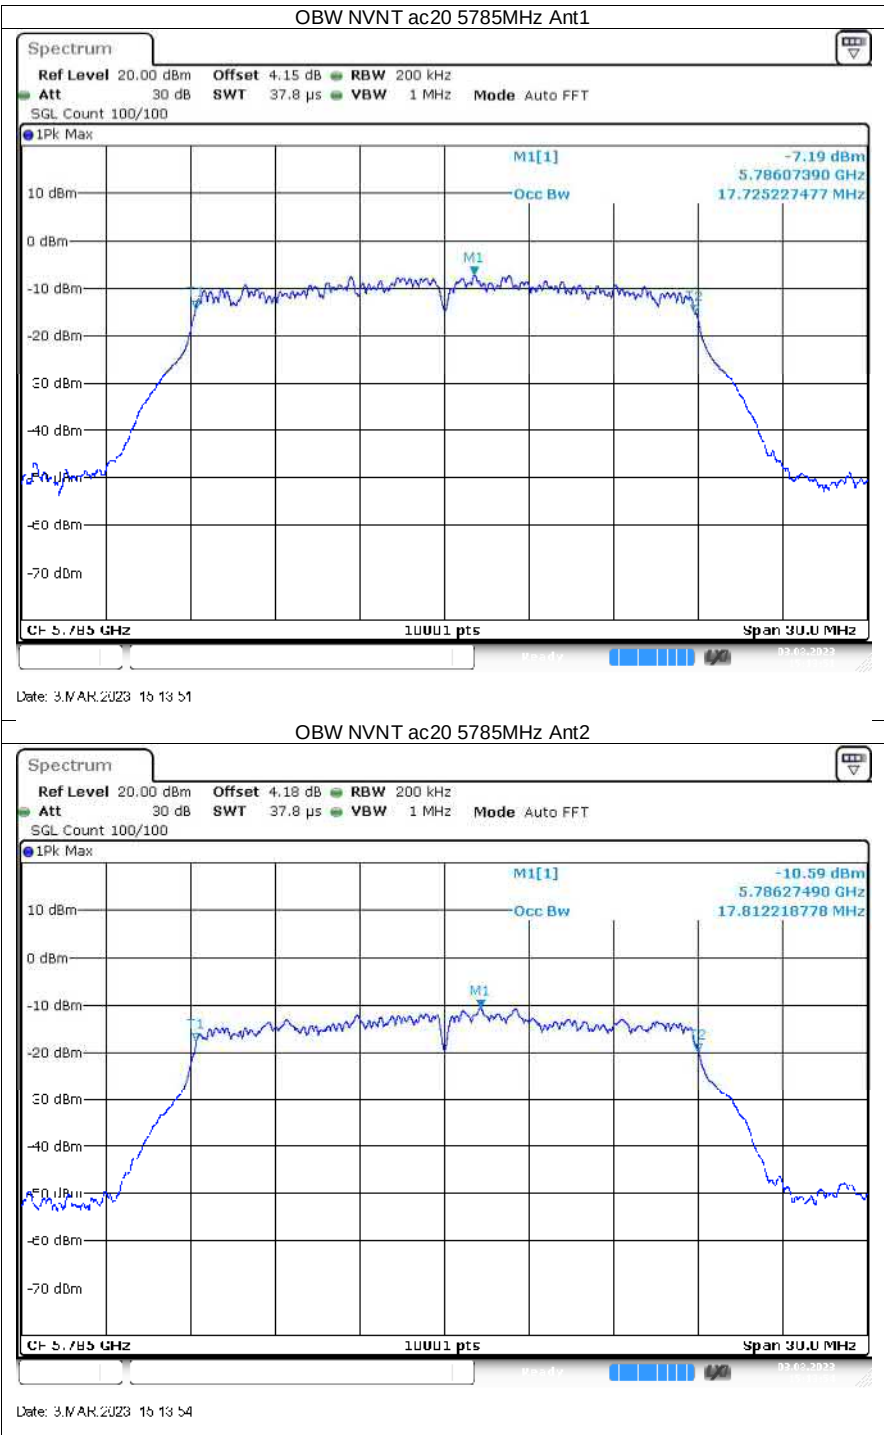


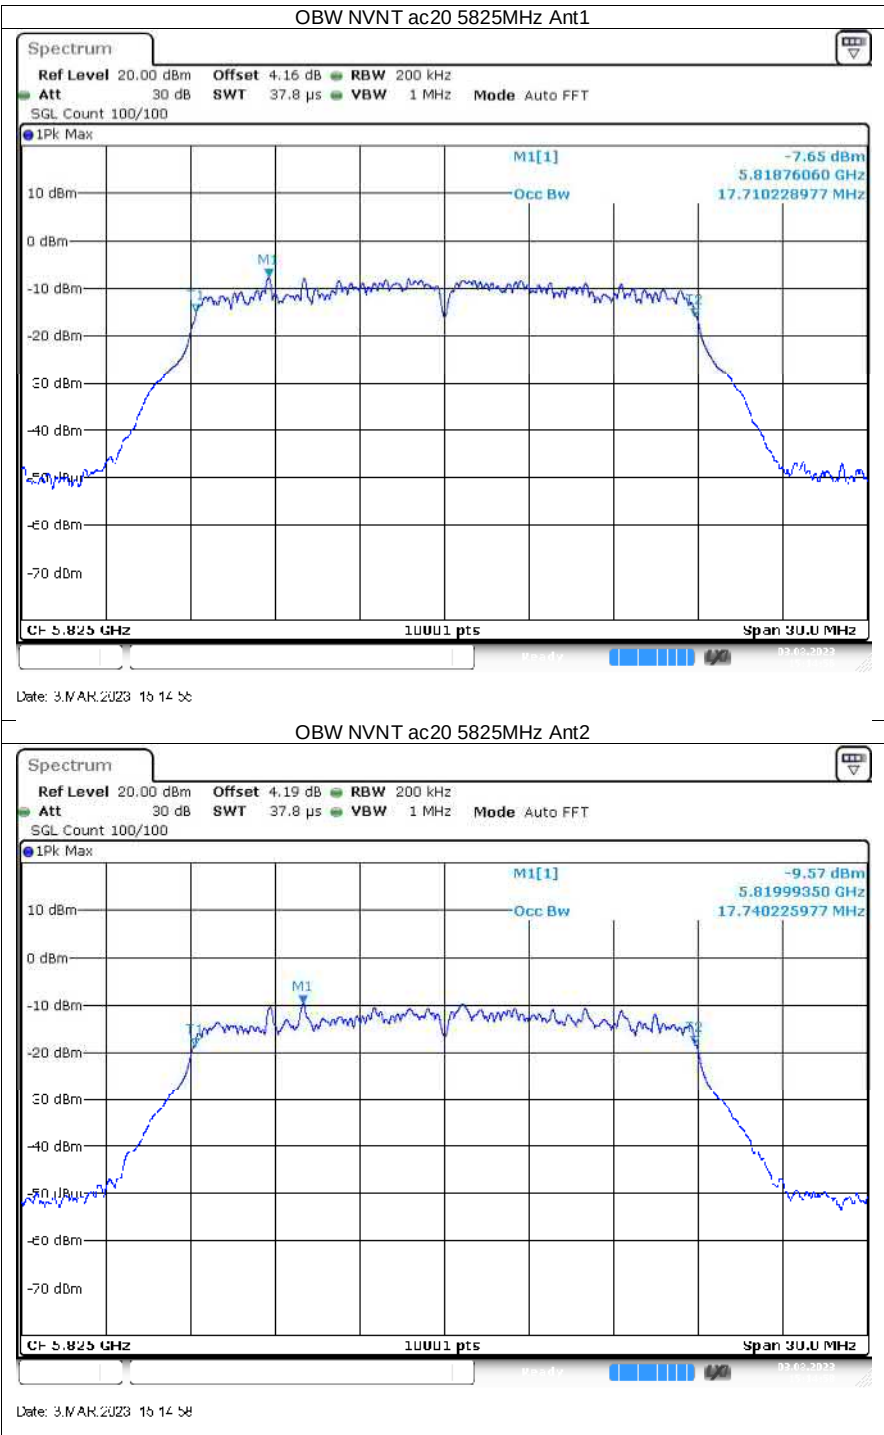


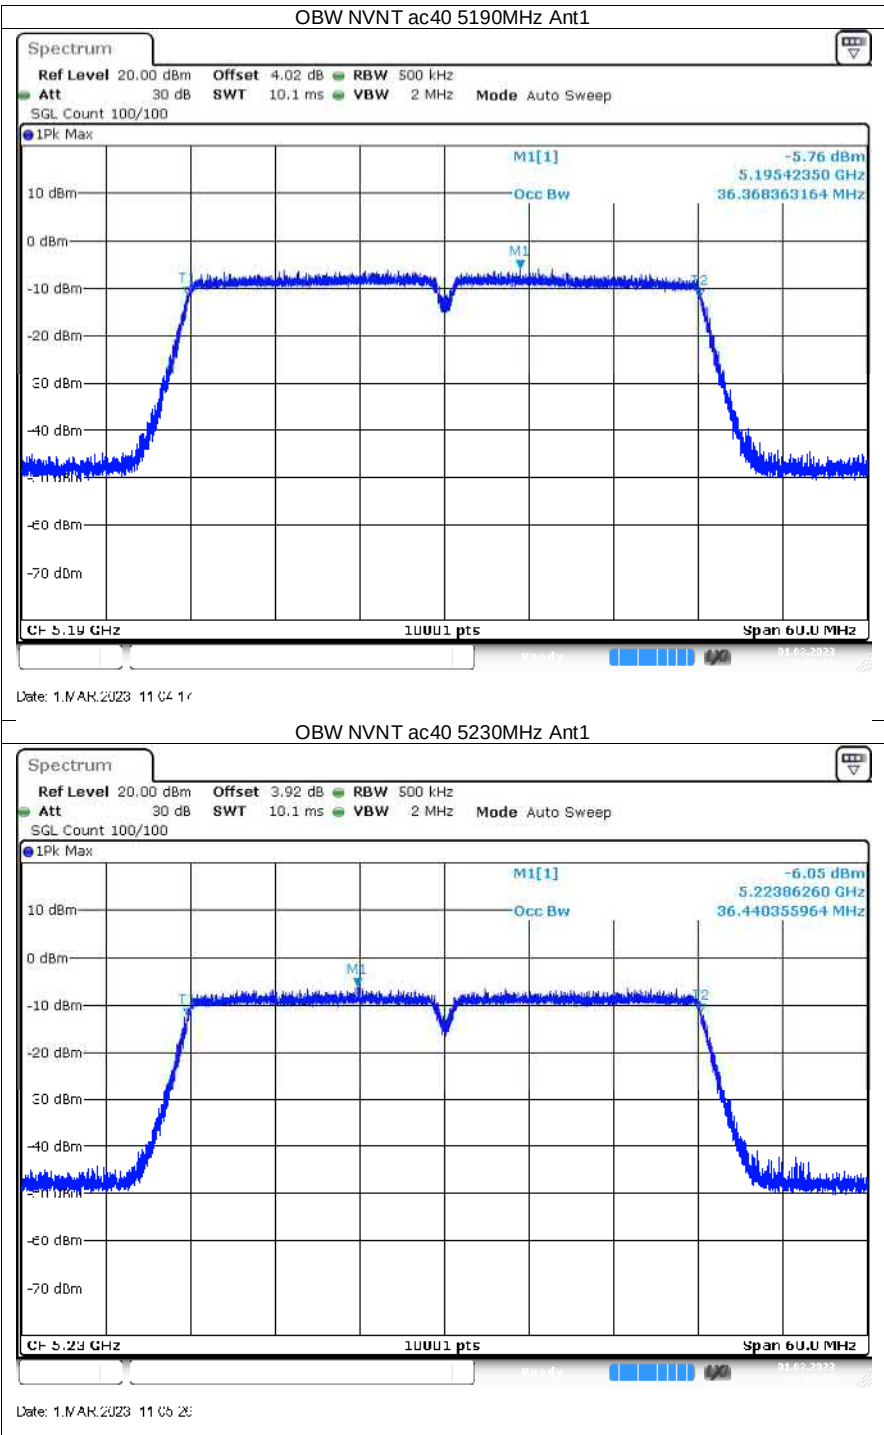






China

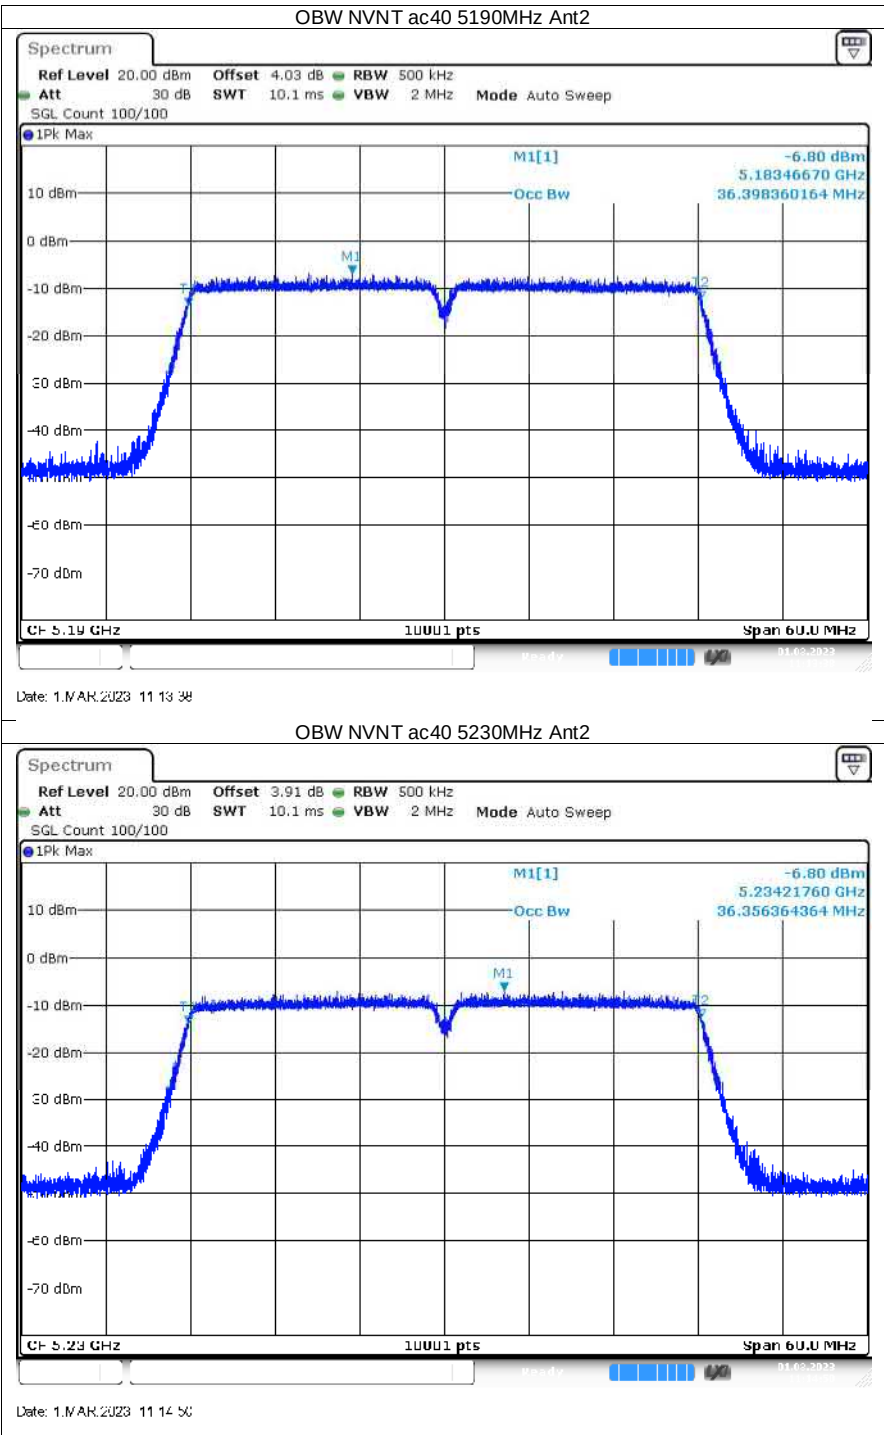

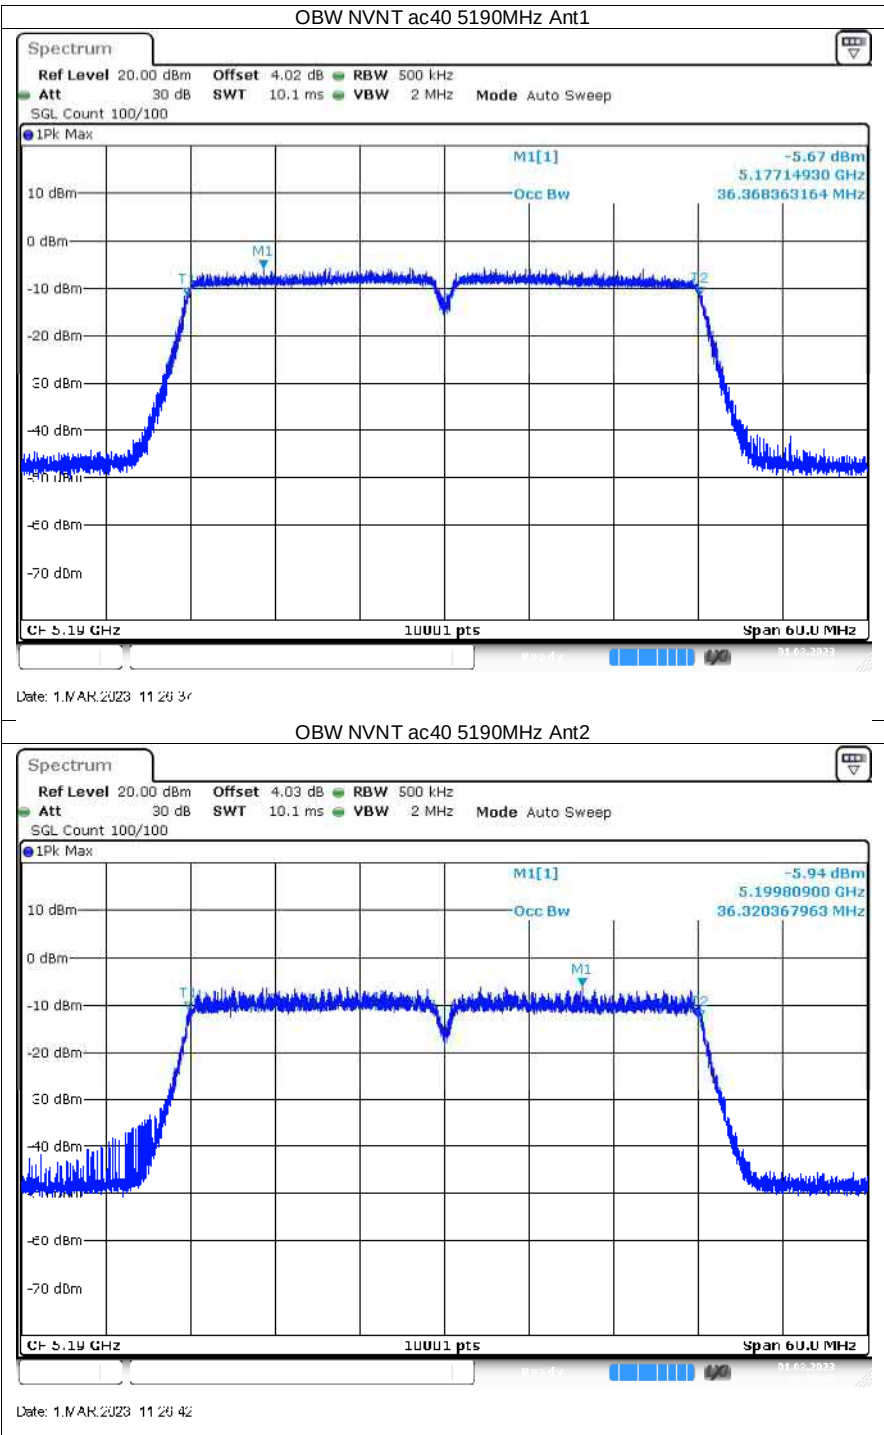

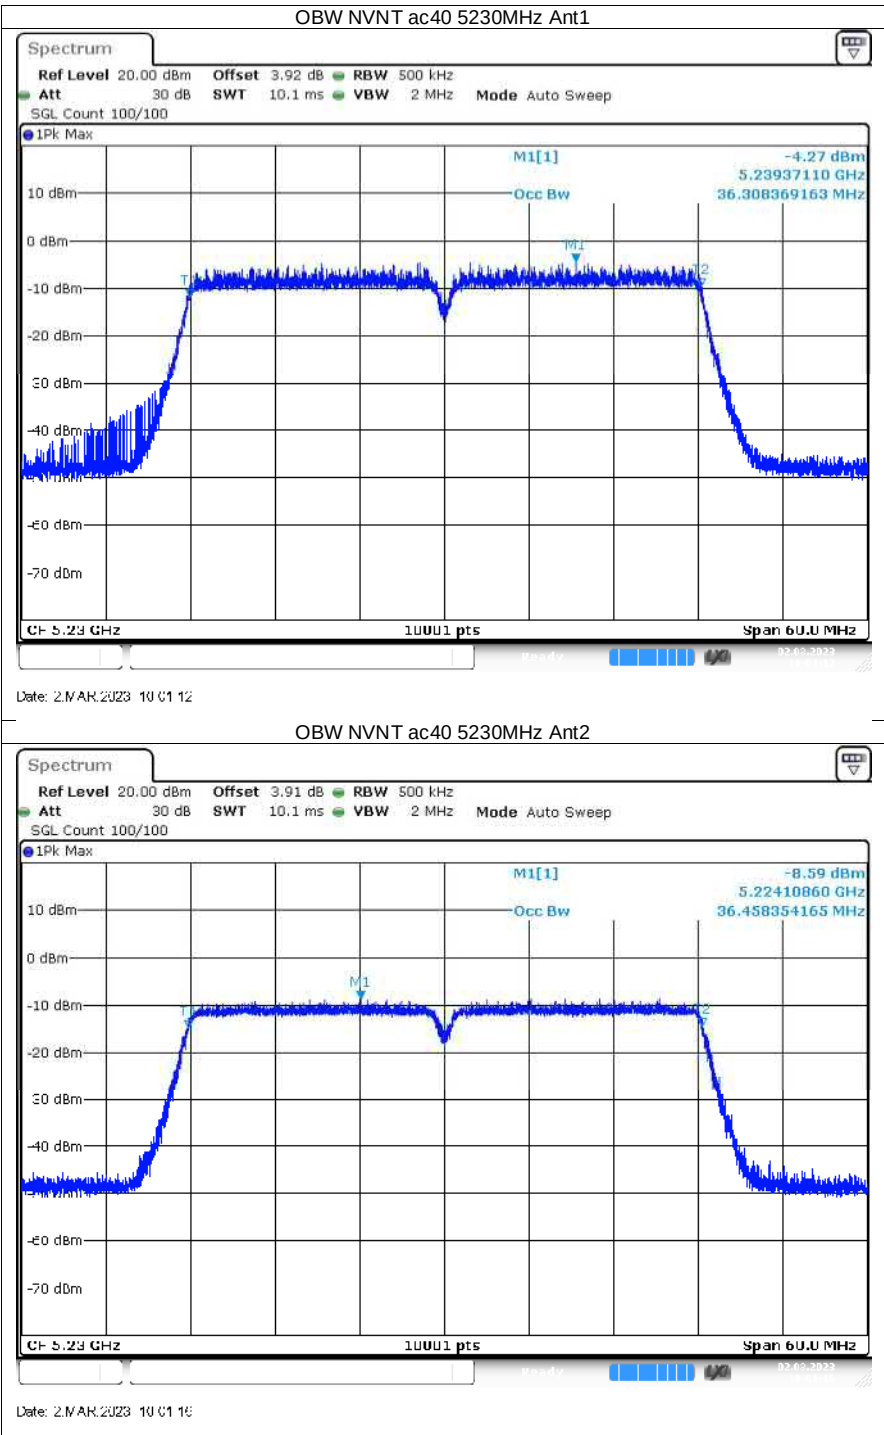


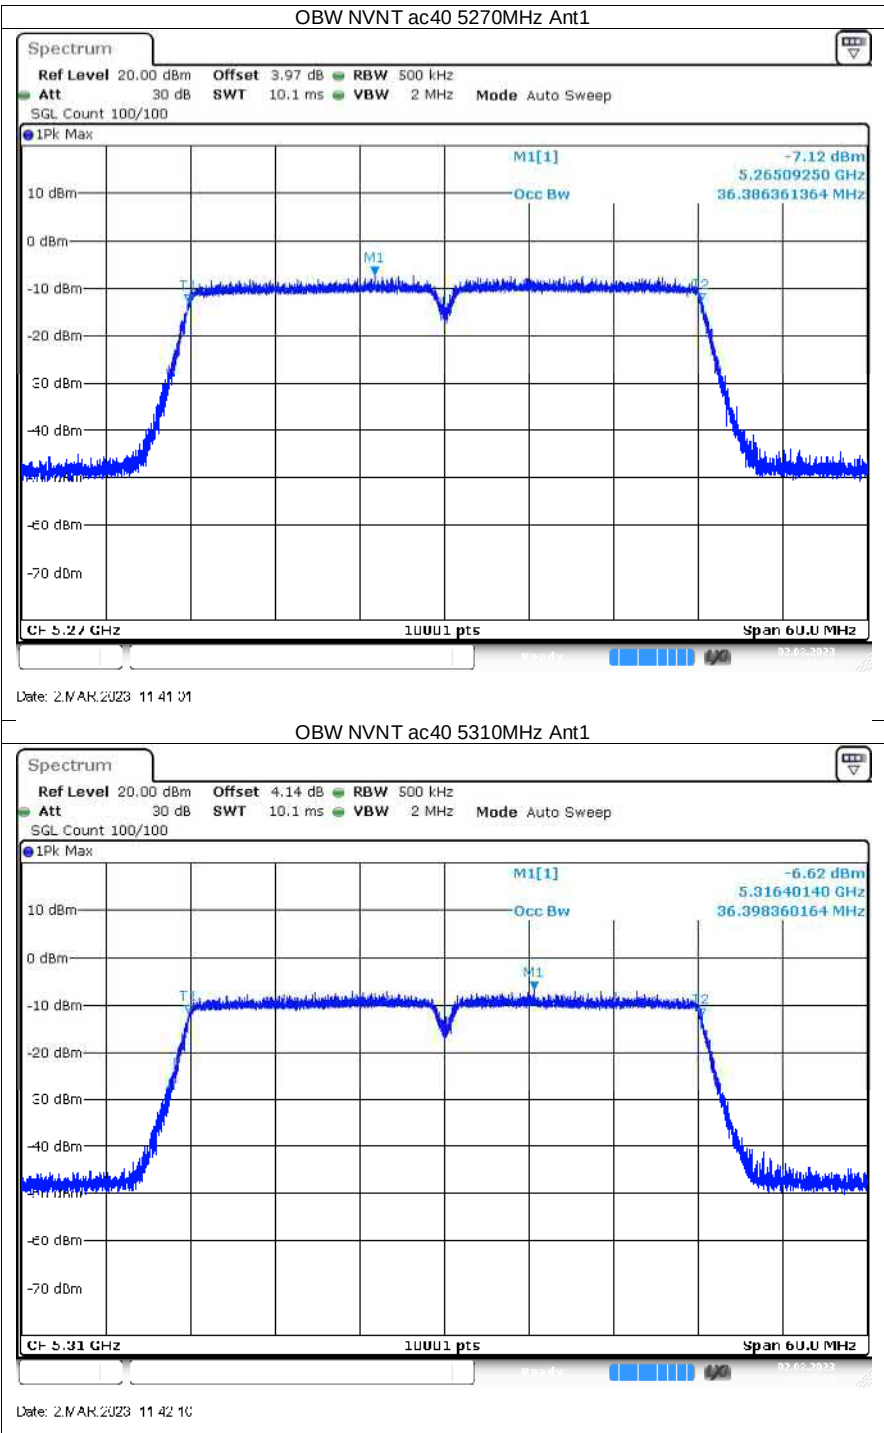


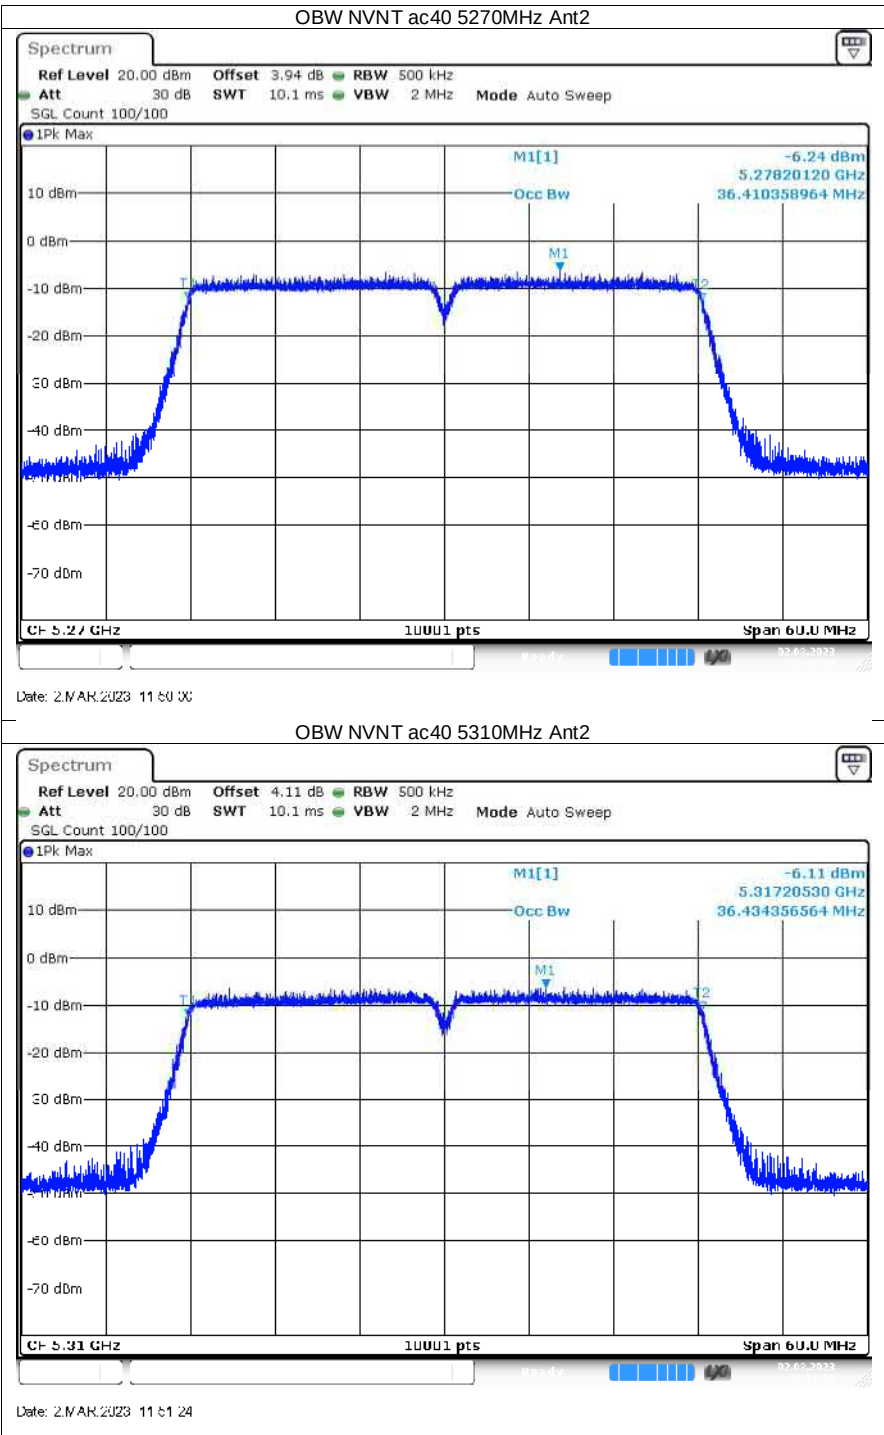




China

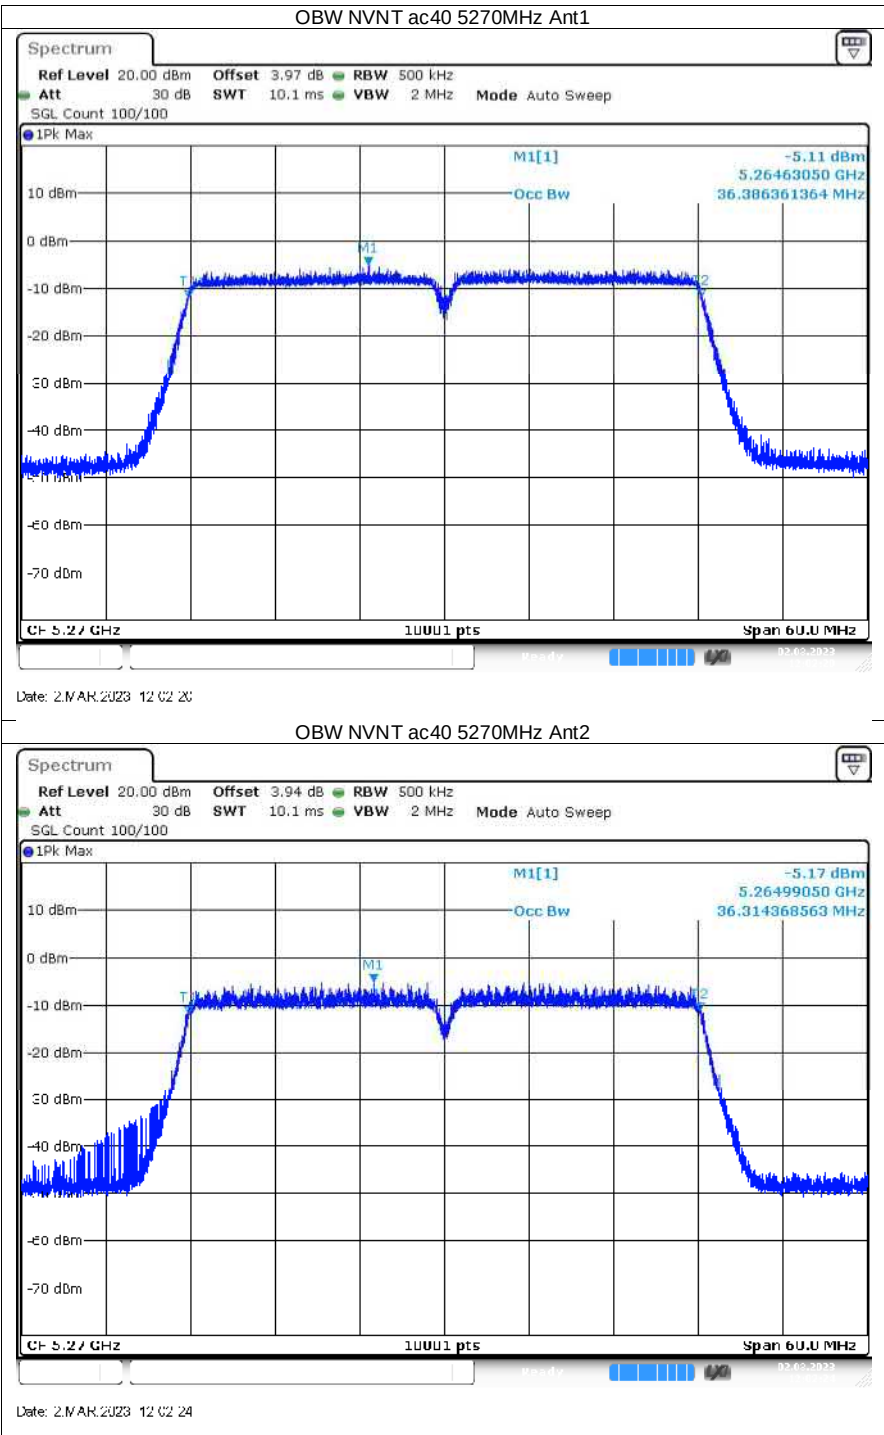


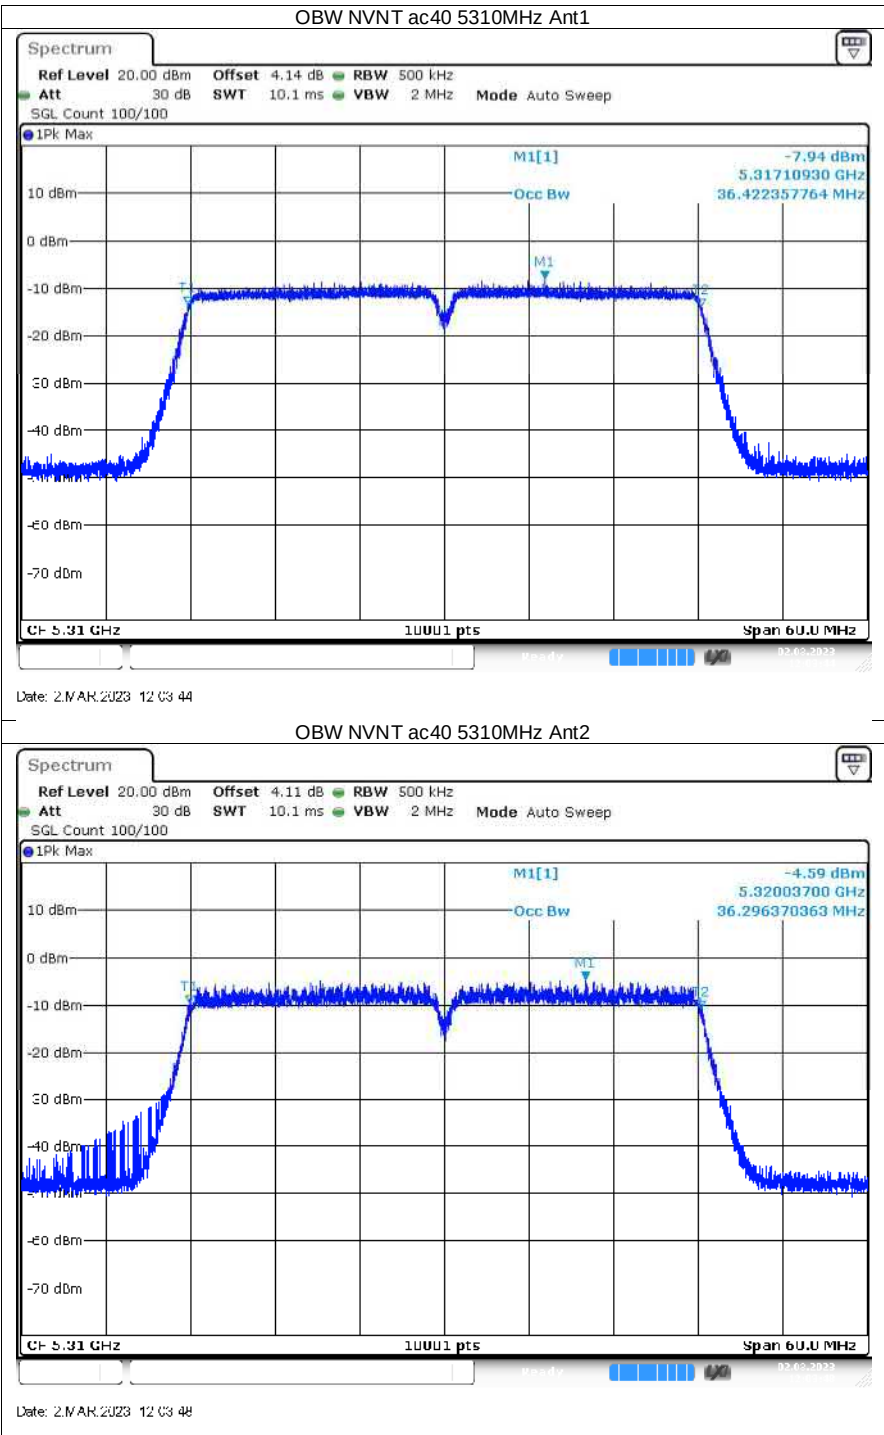




China

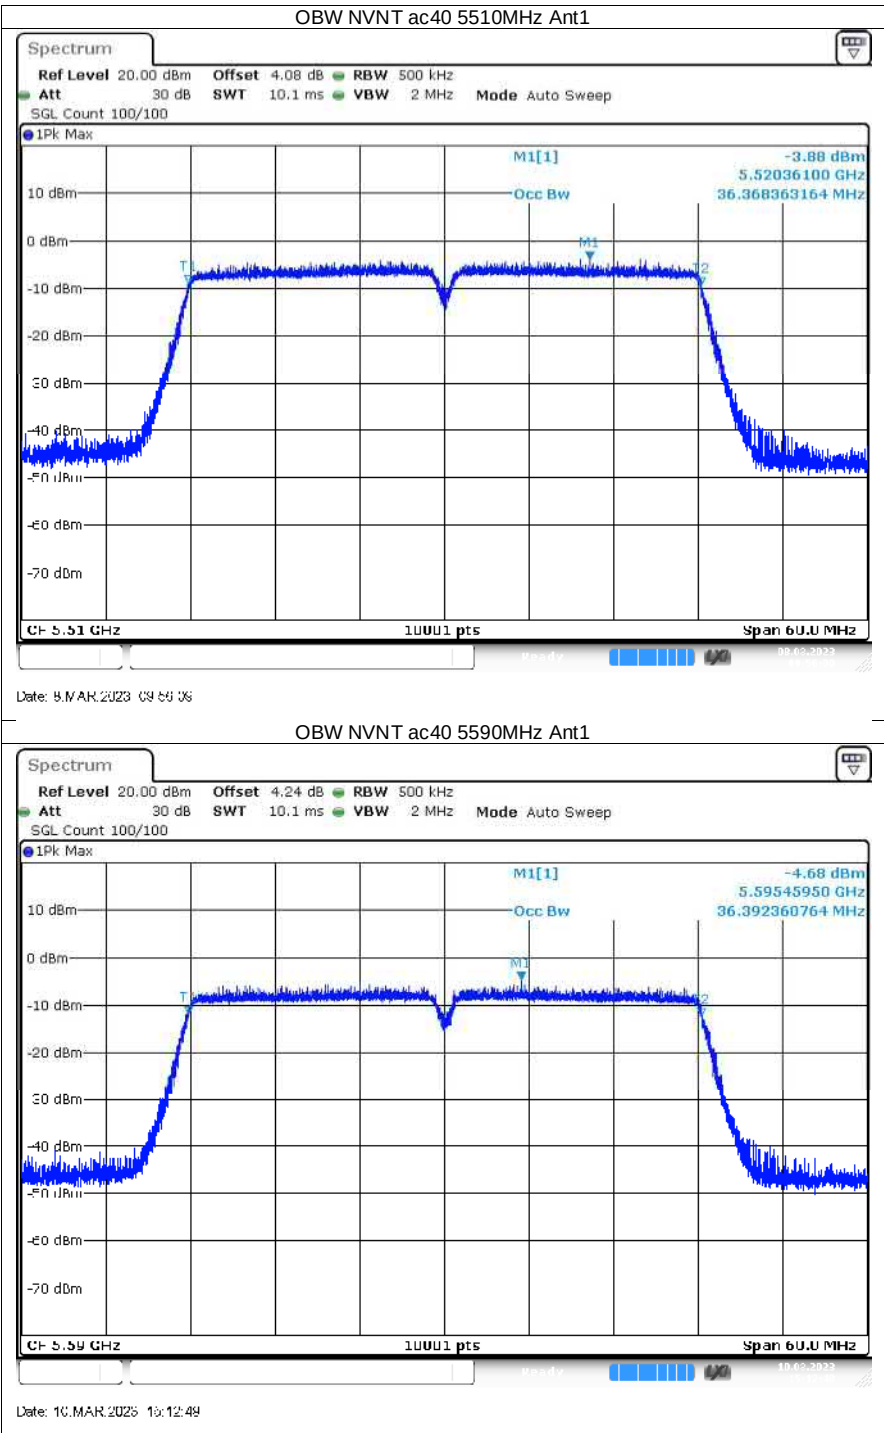


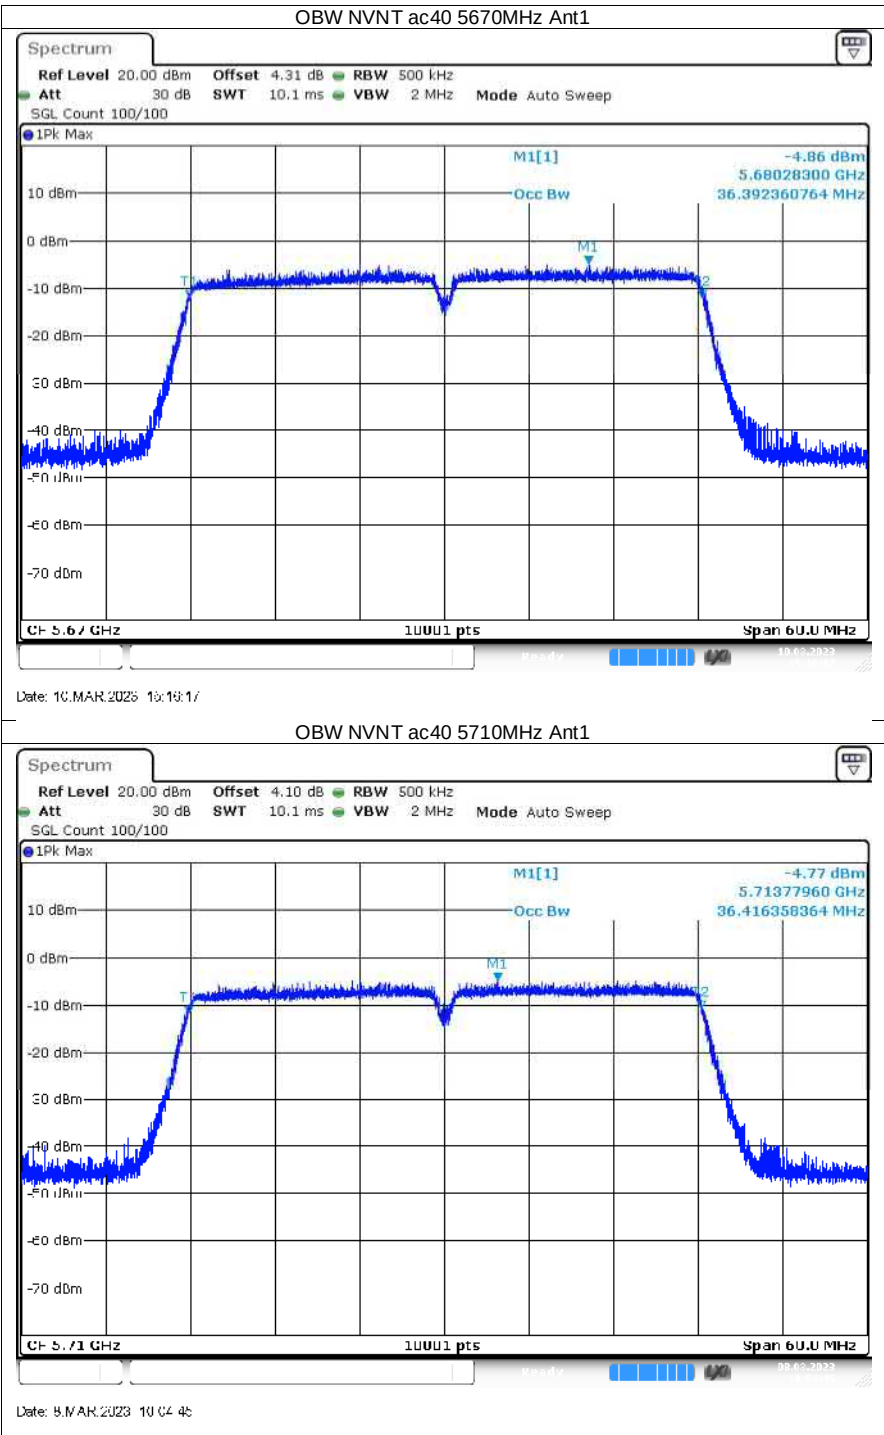


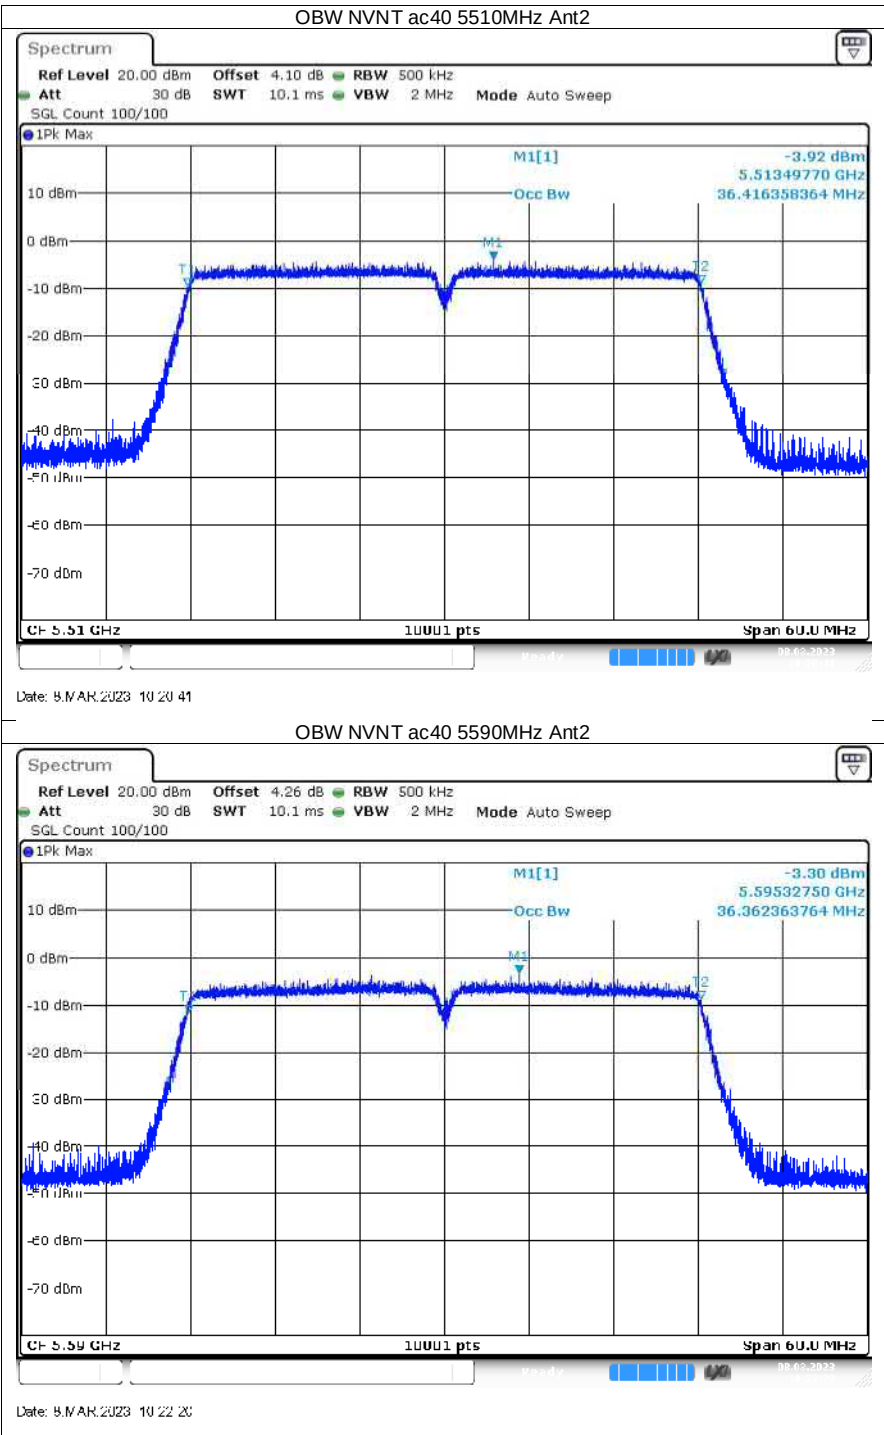




China

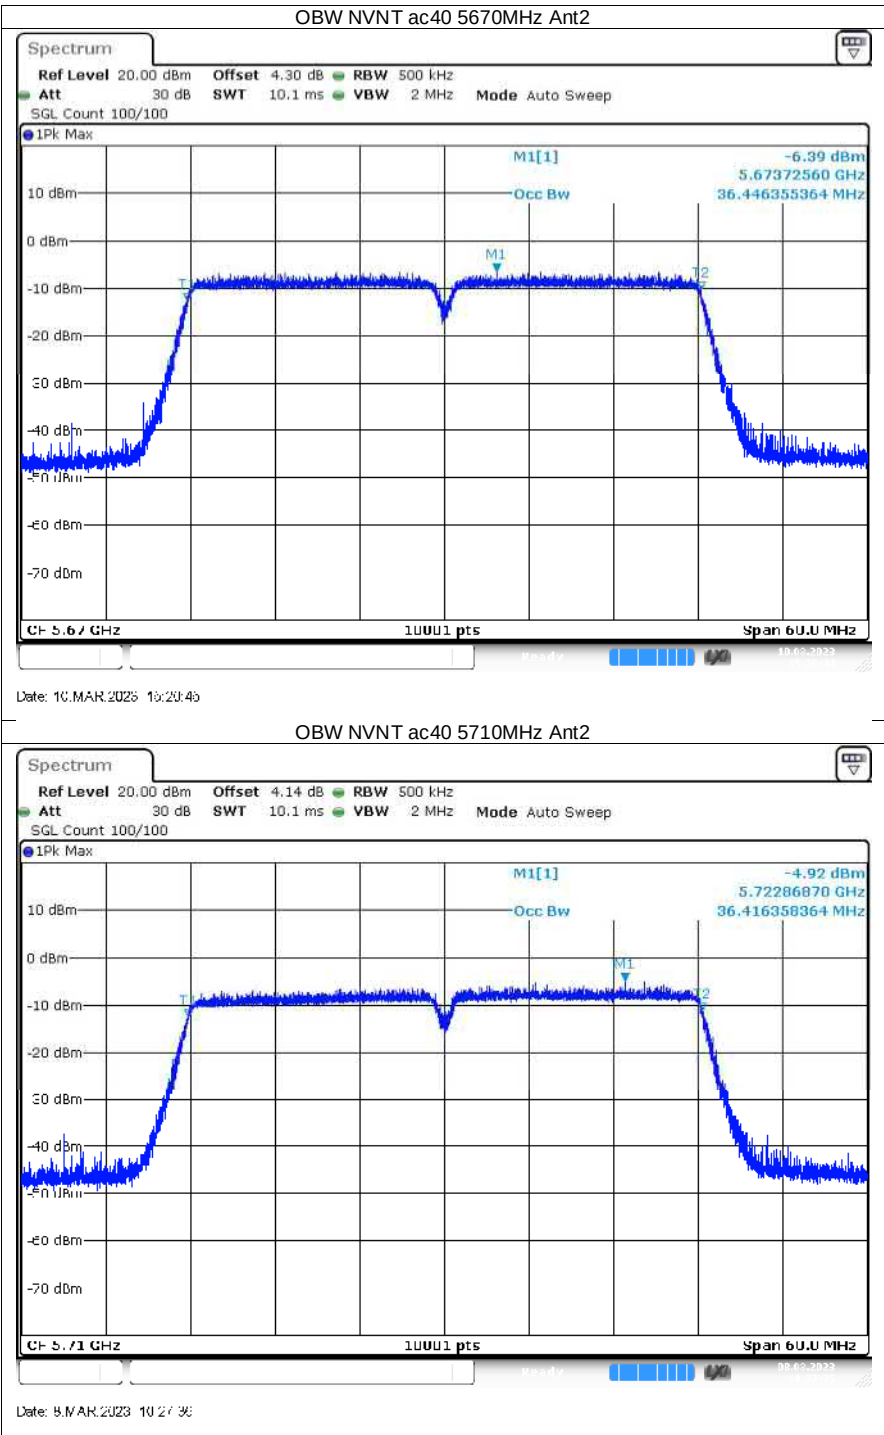

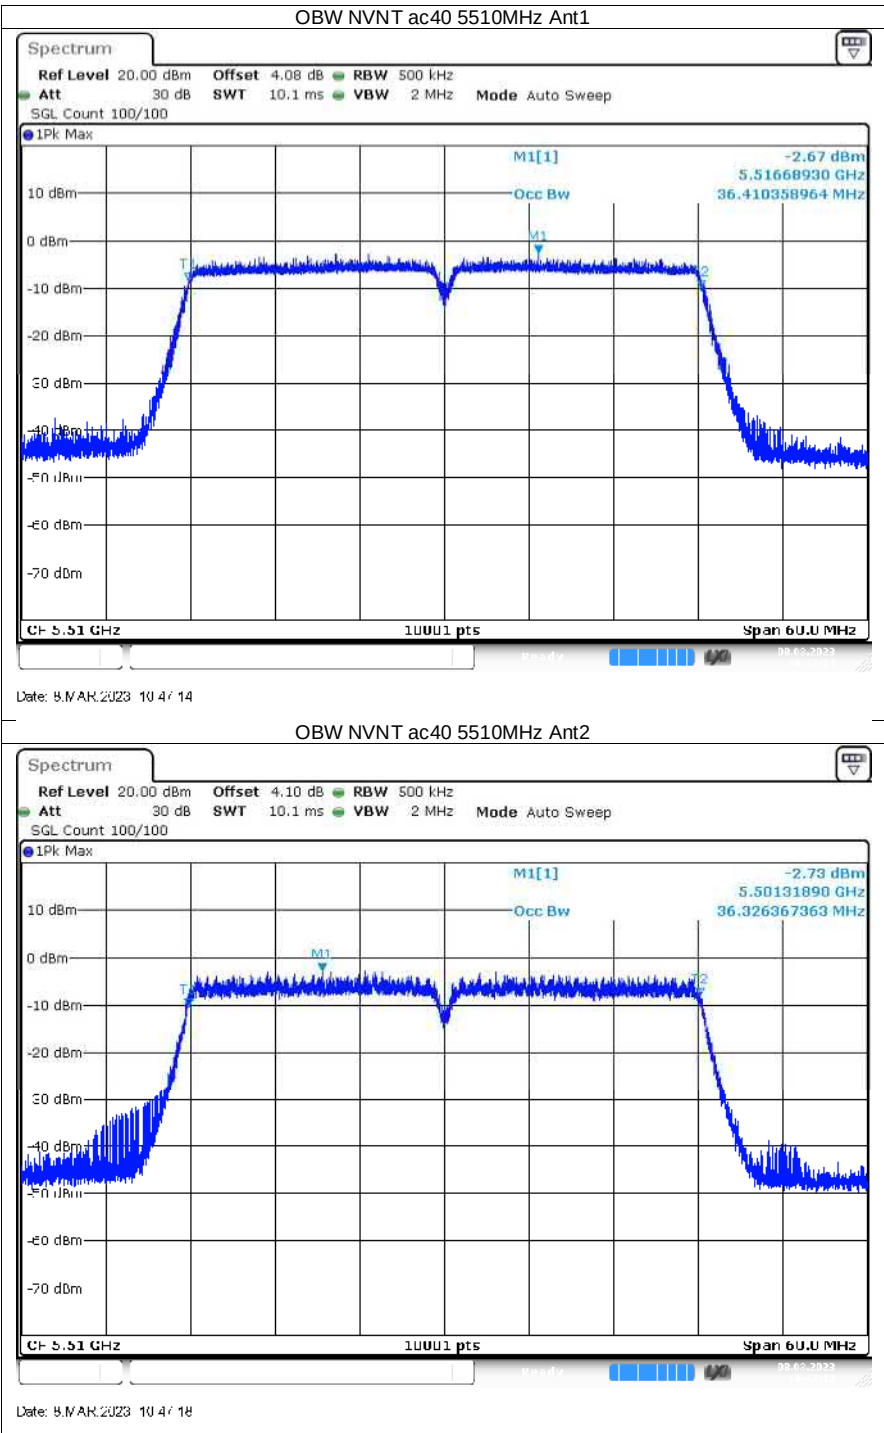





China

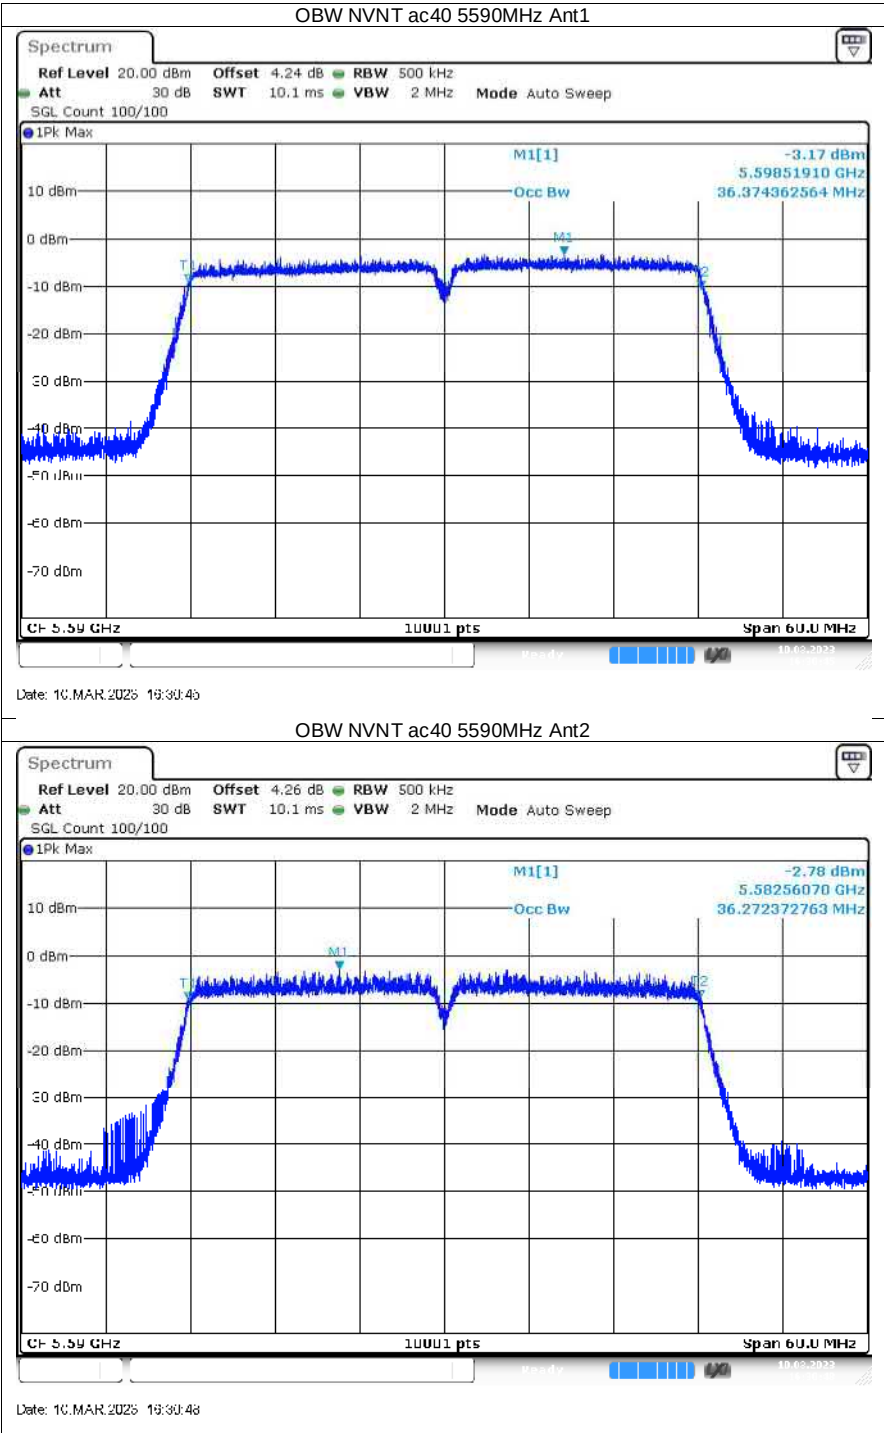






China

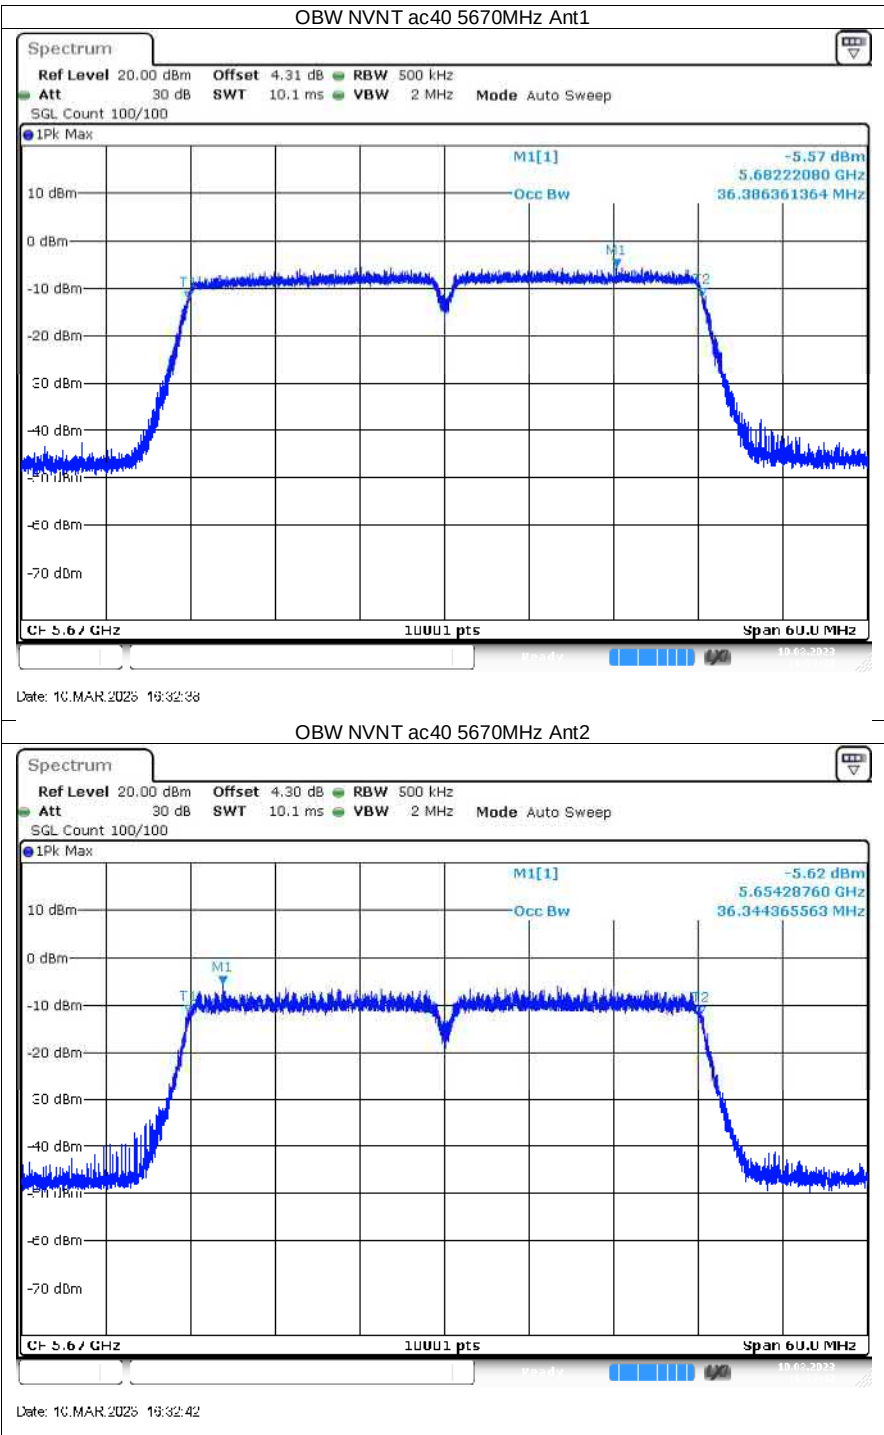


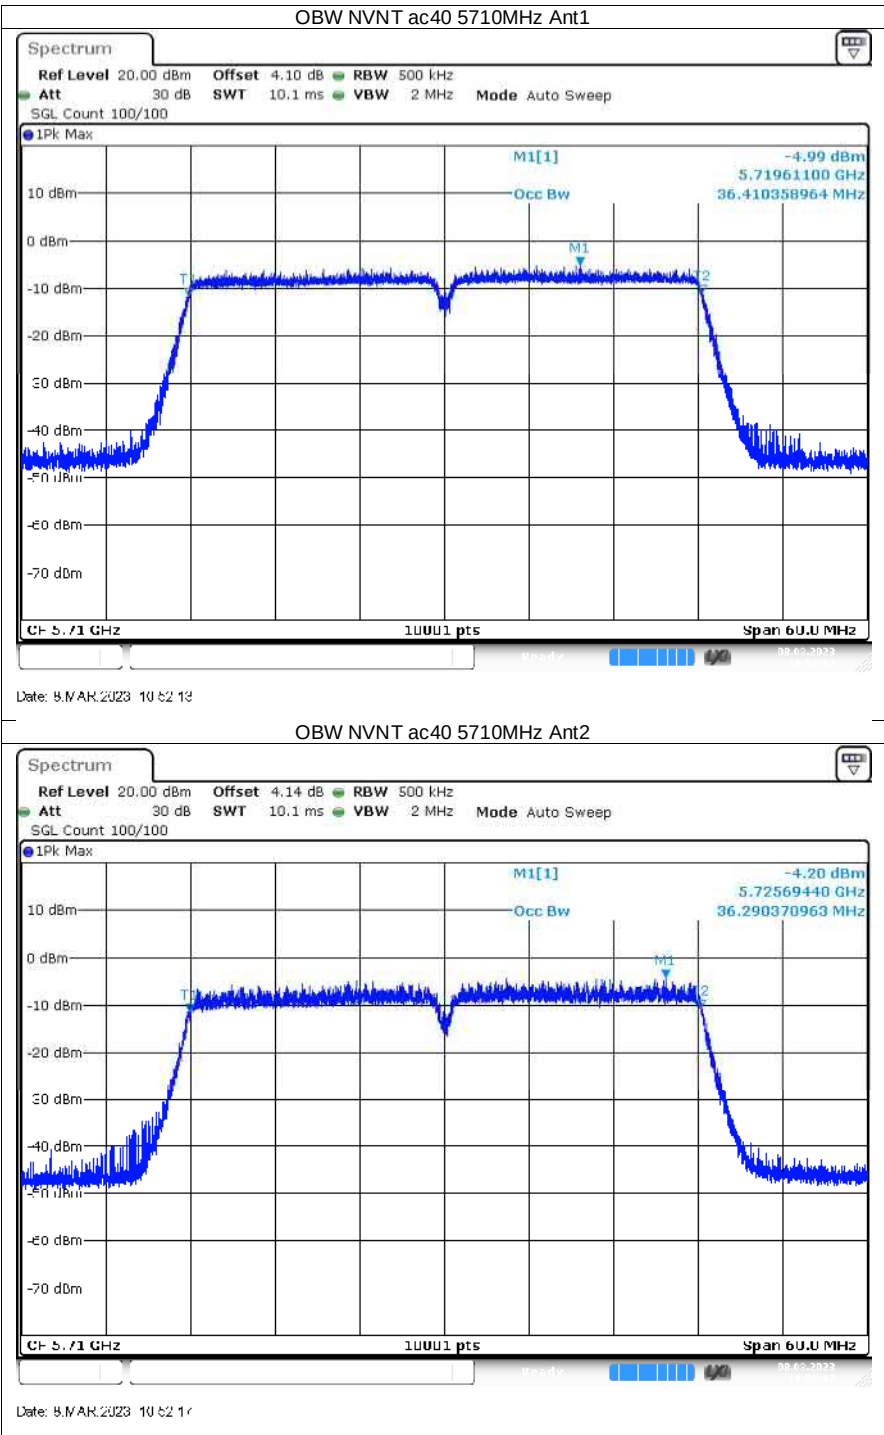


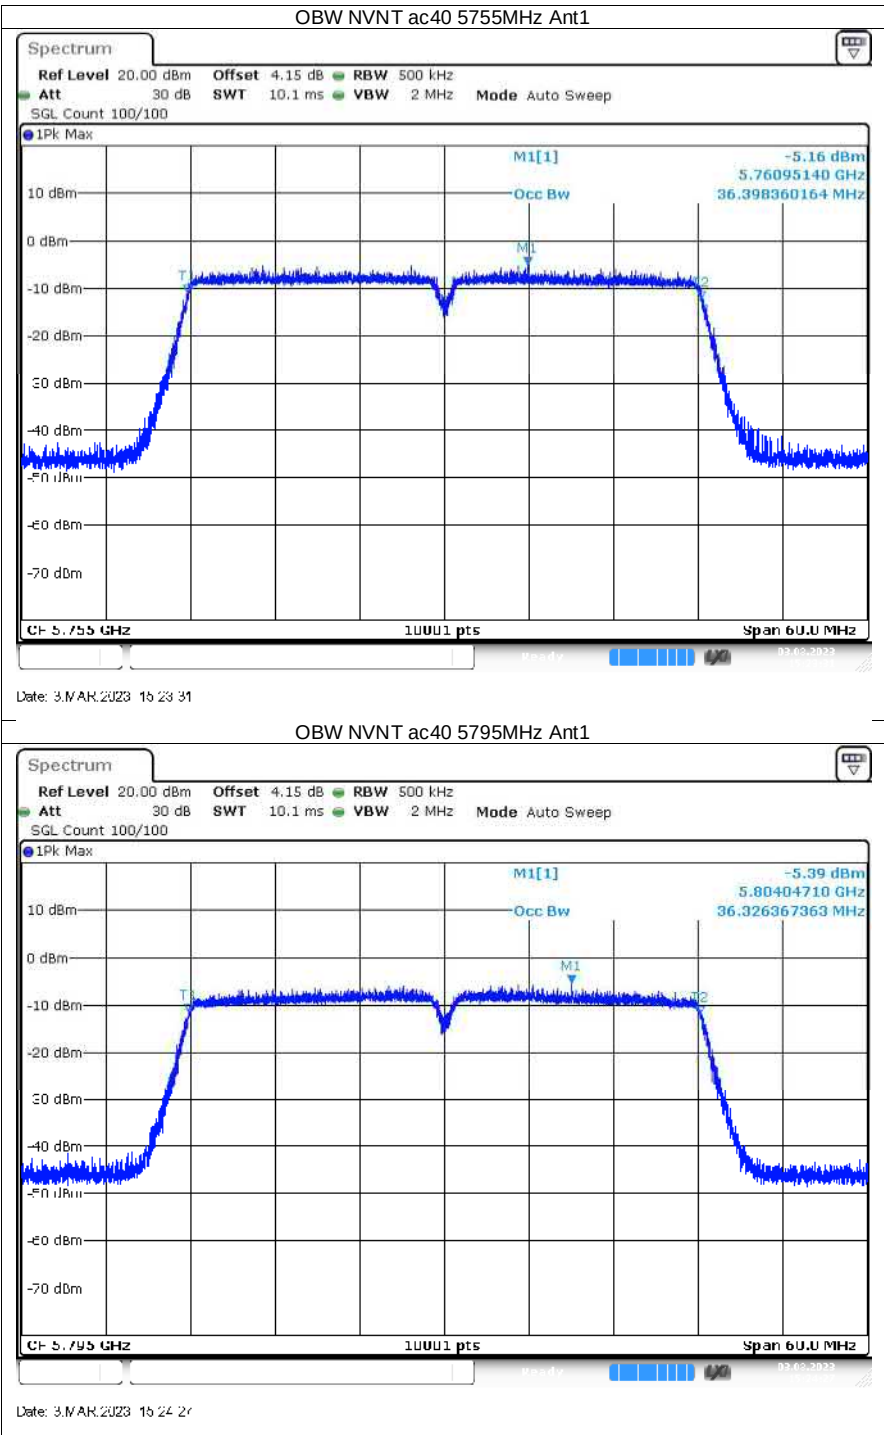


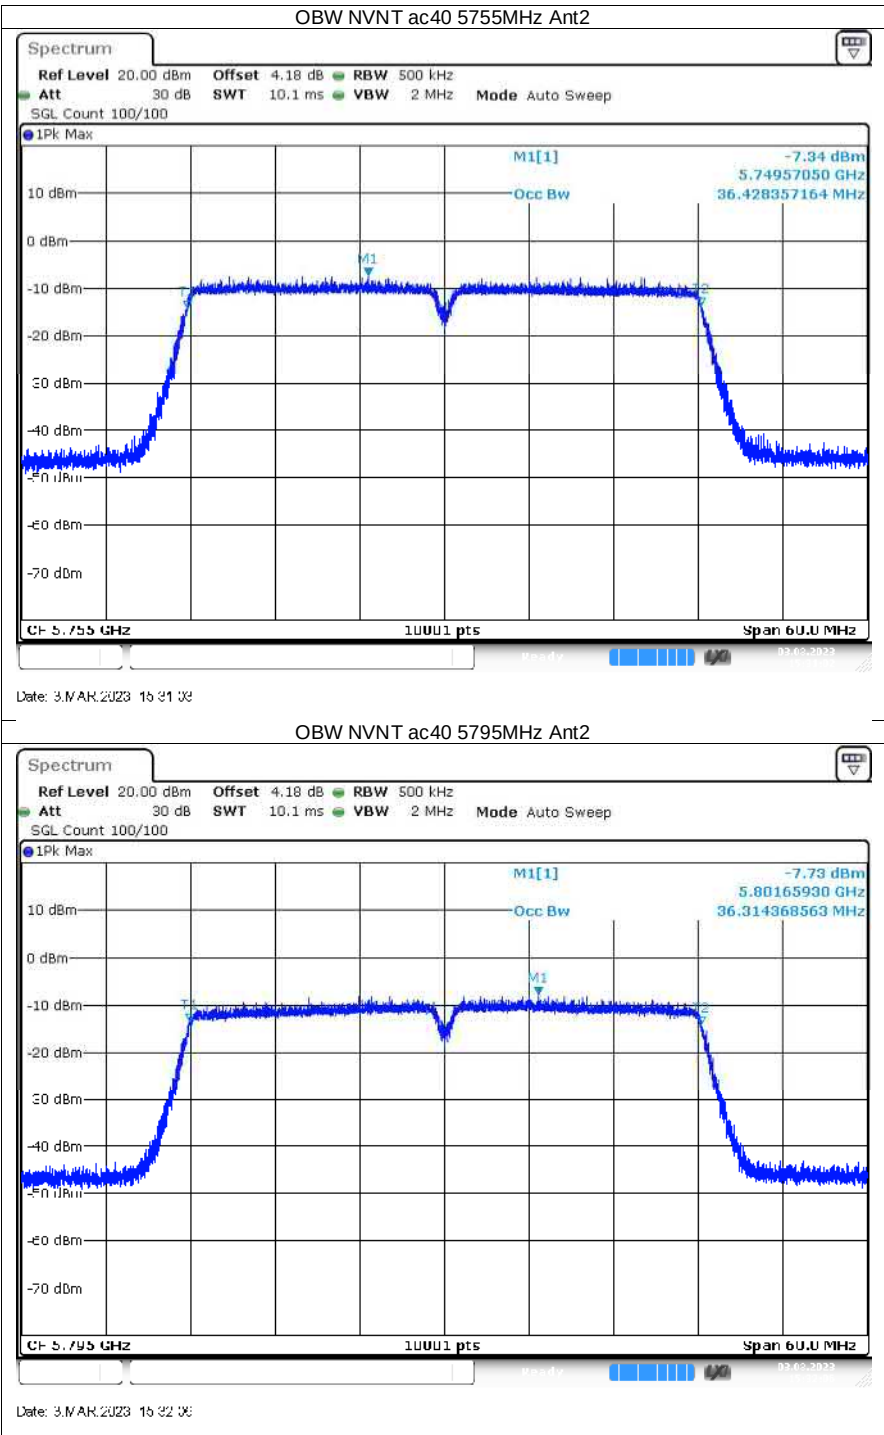


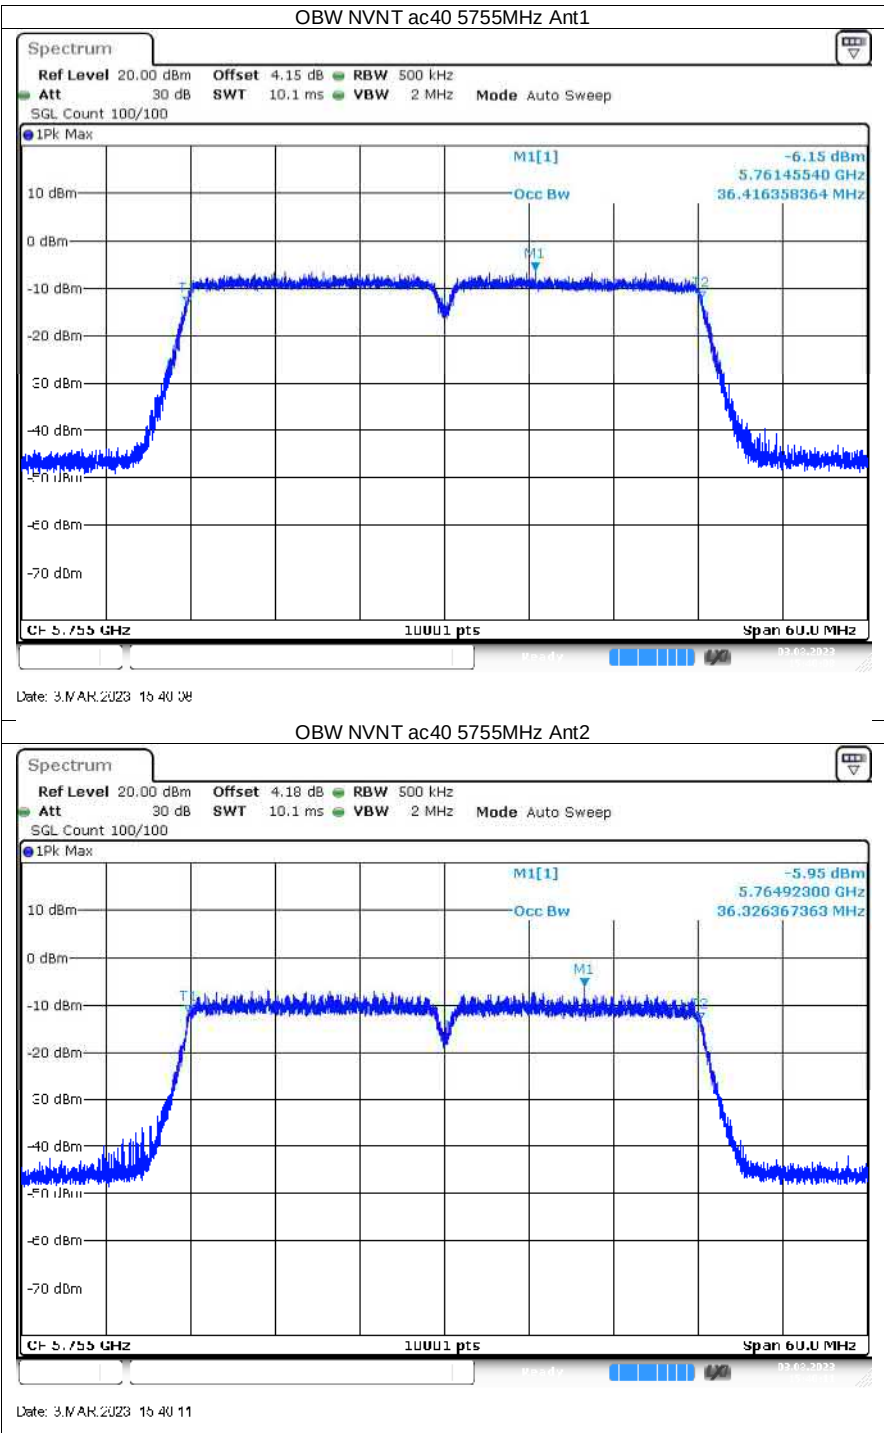


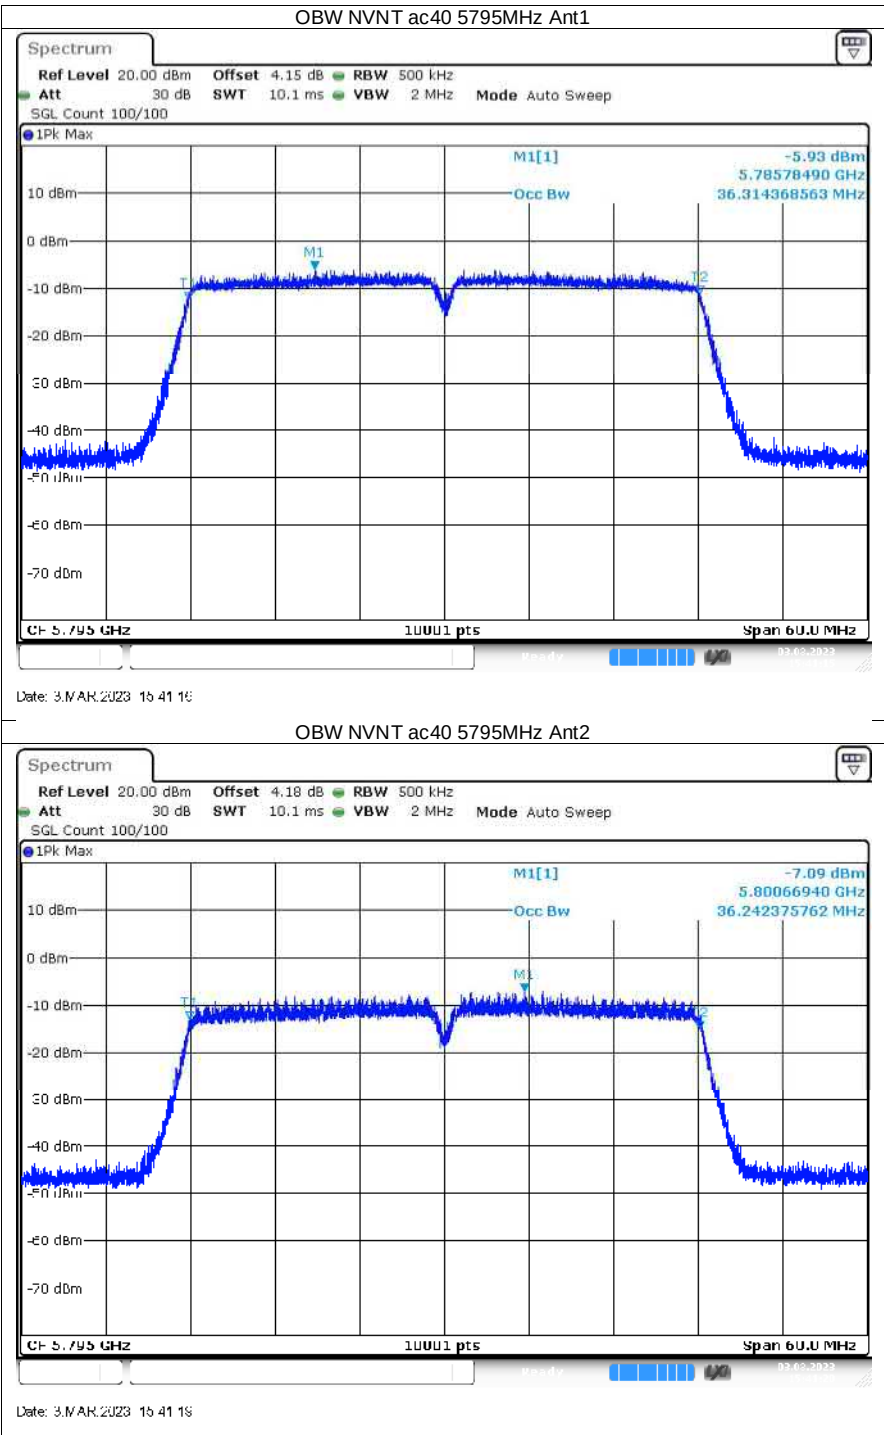


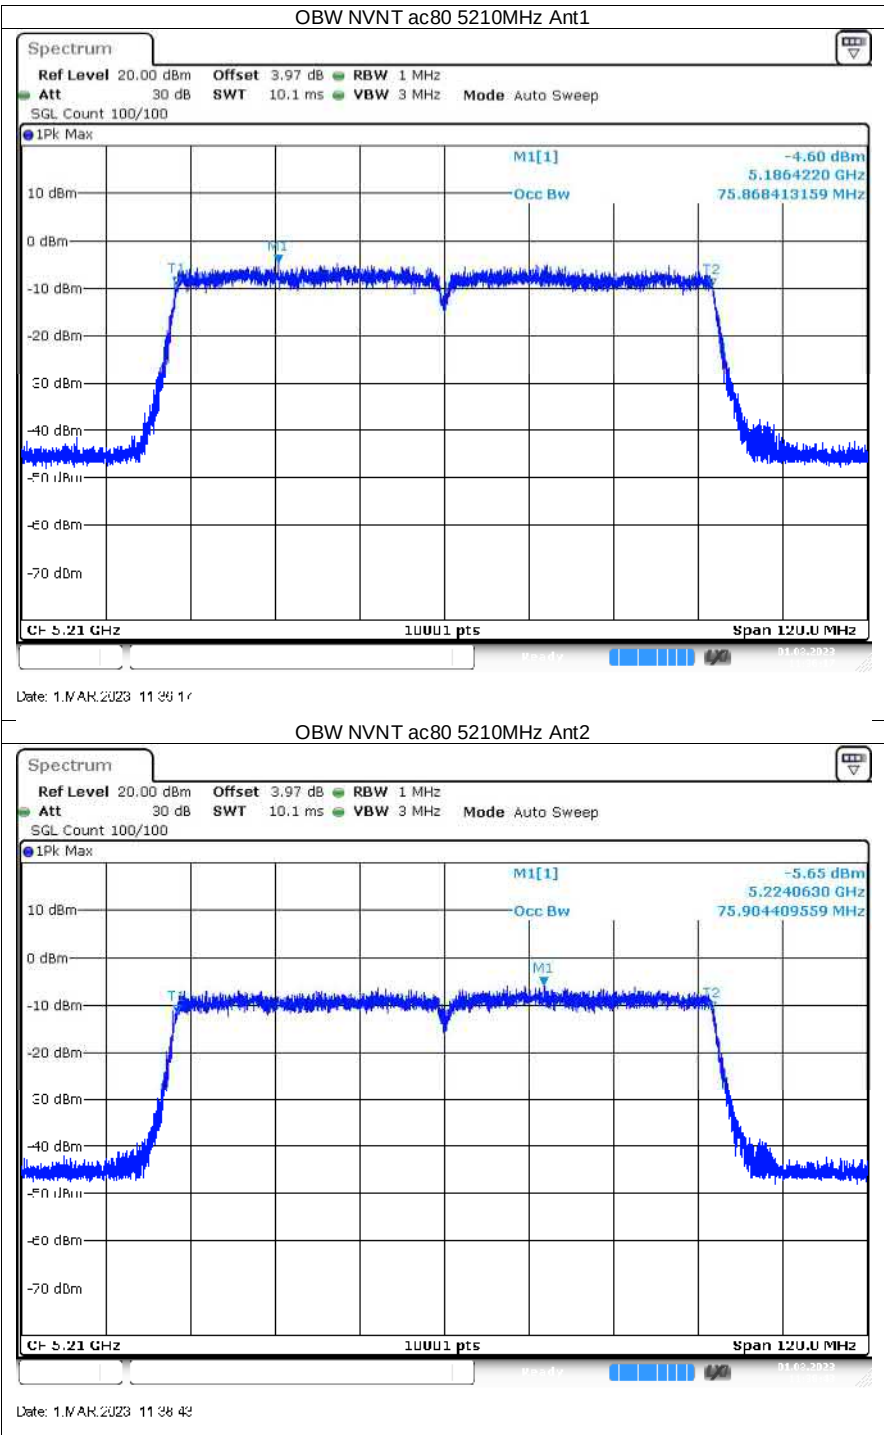


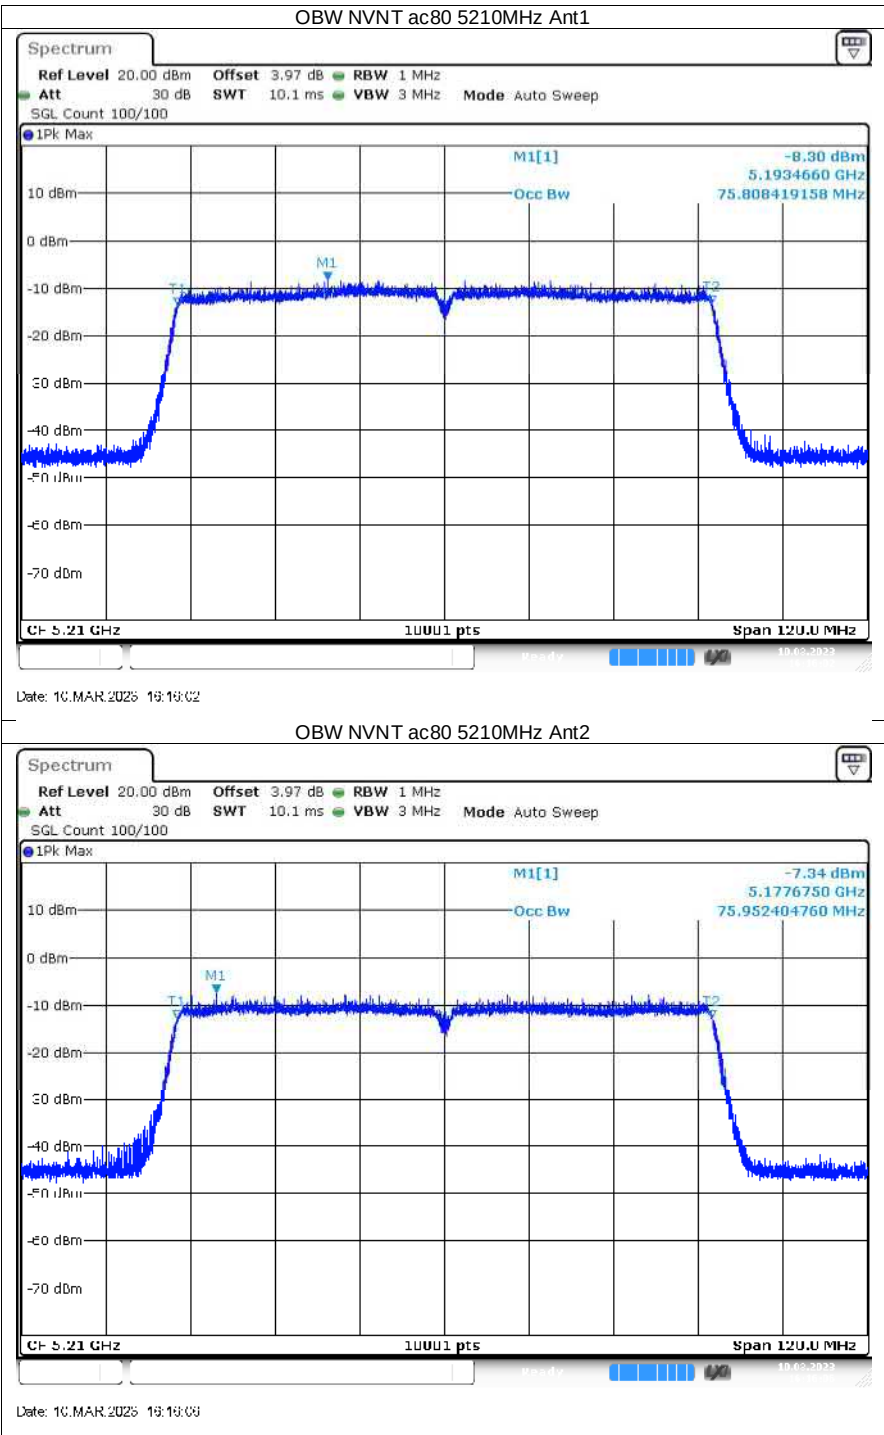

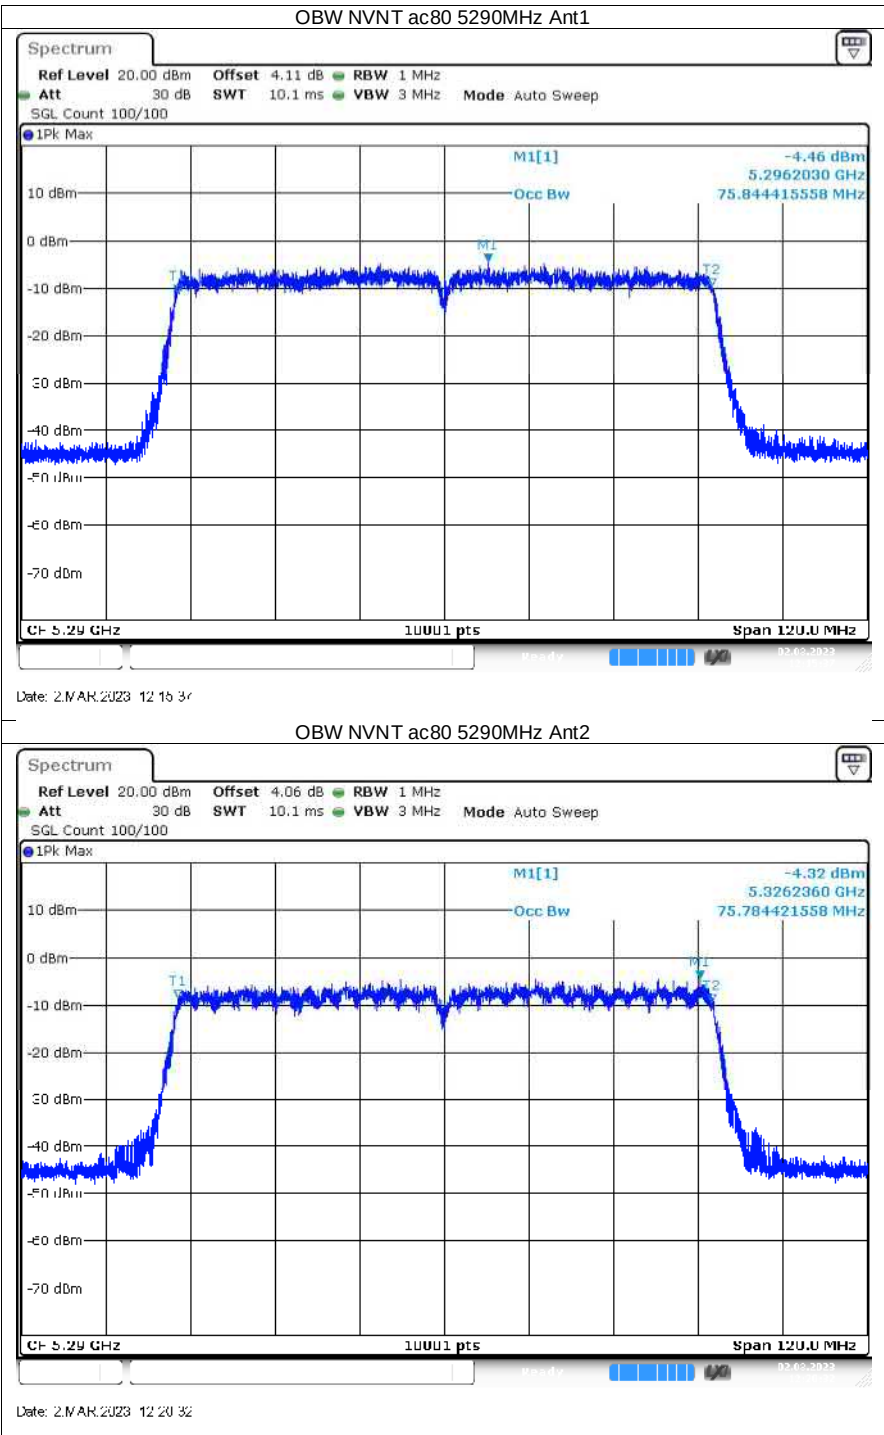

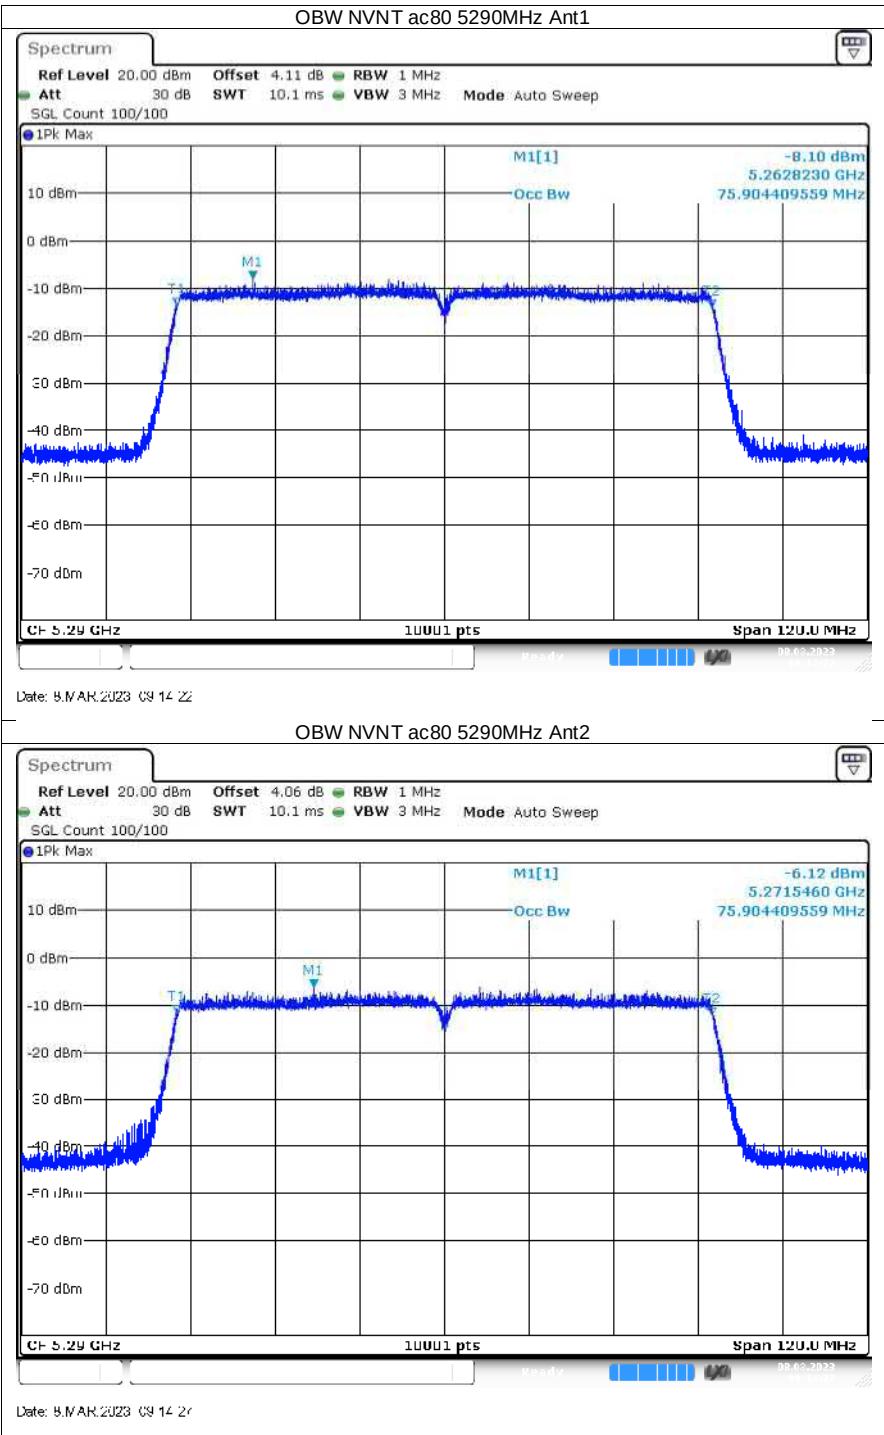


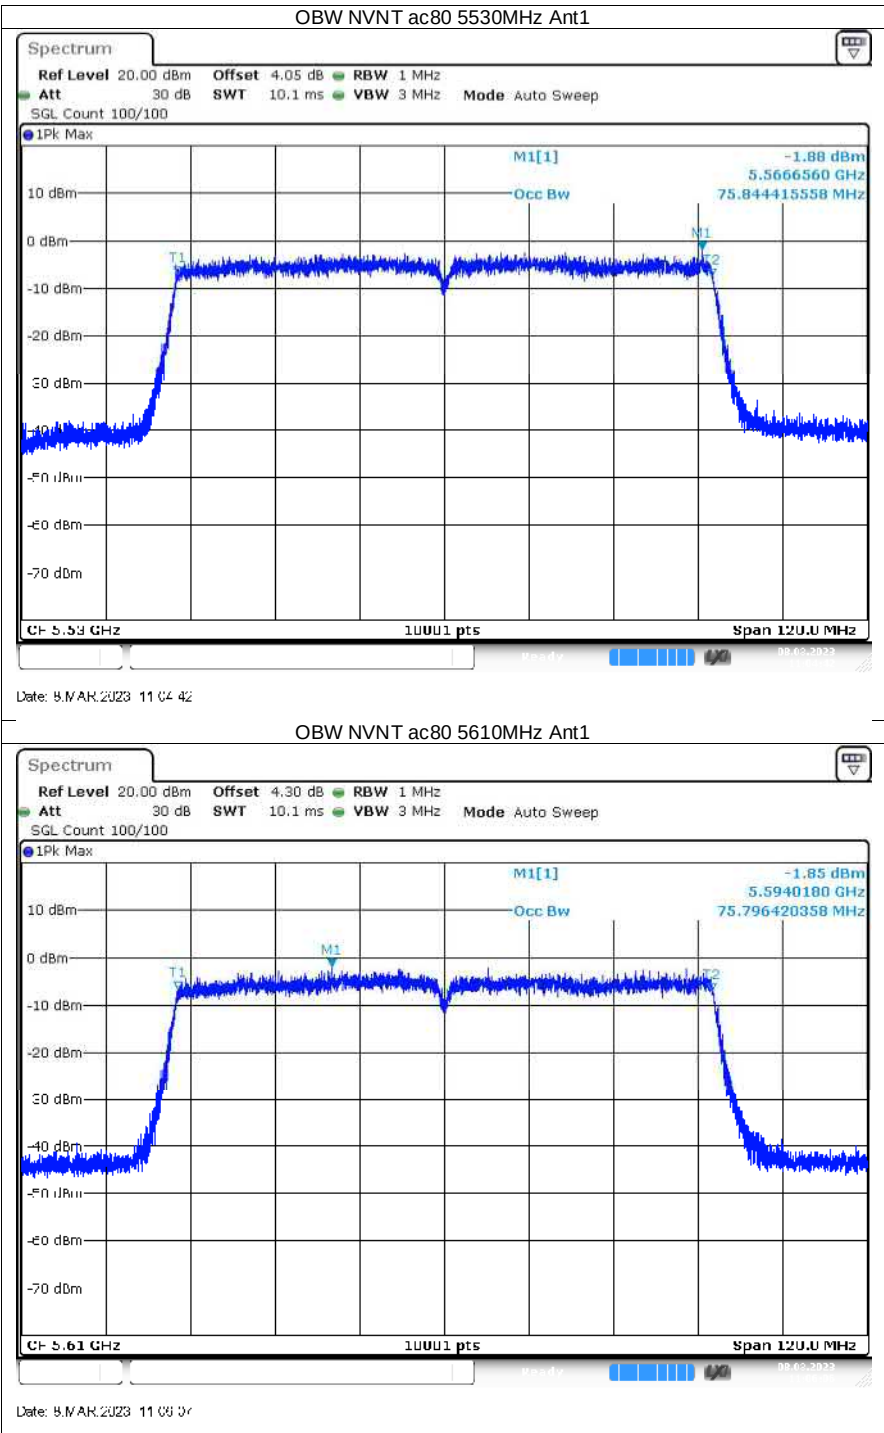

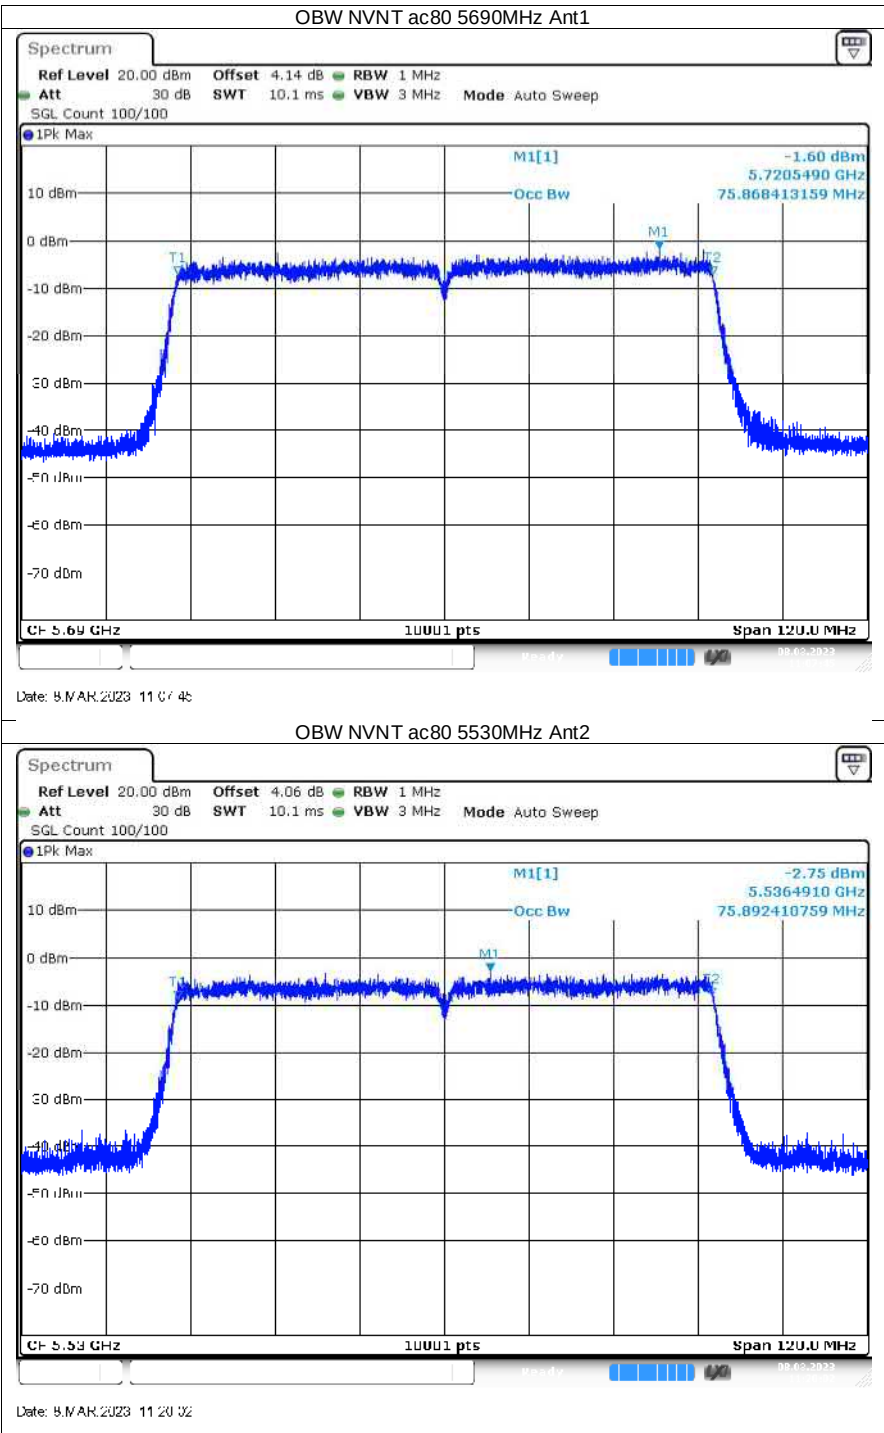




China

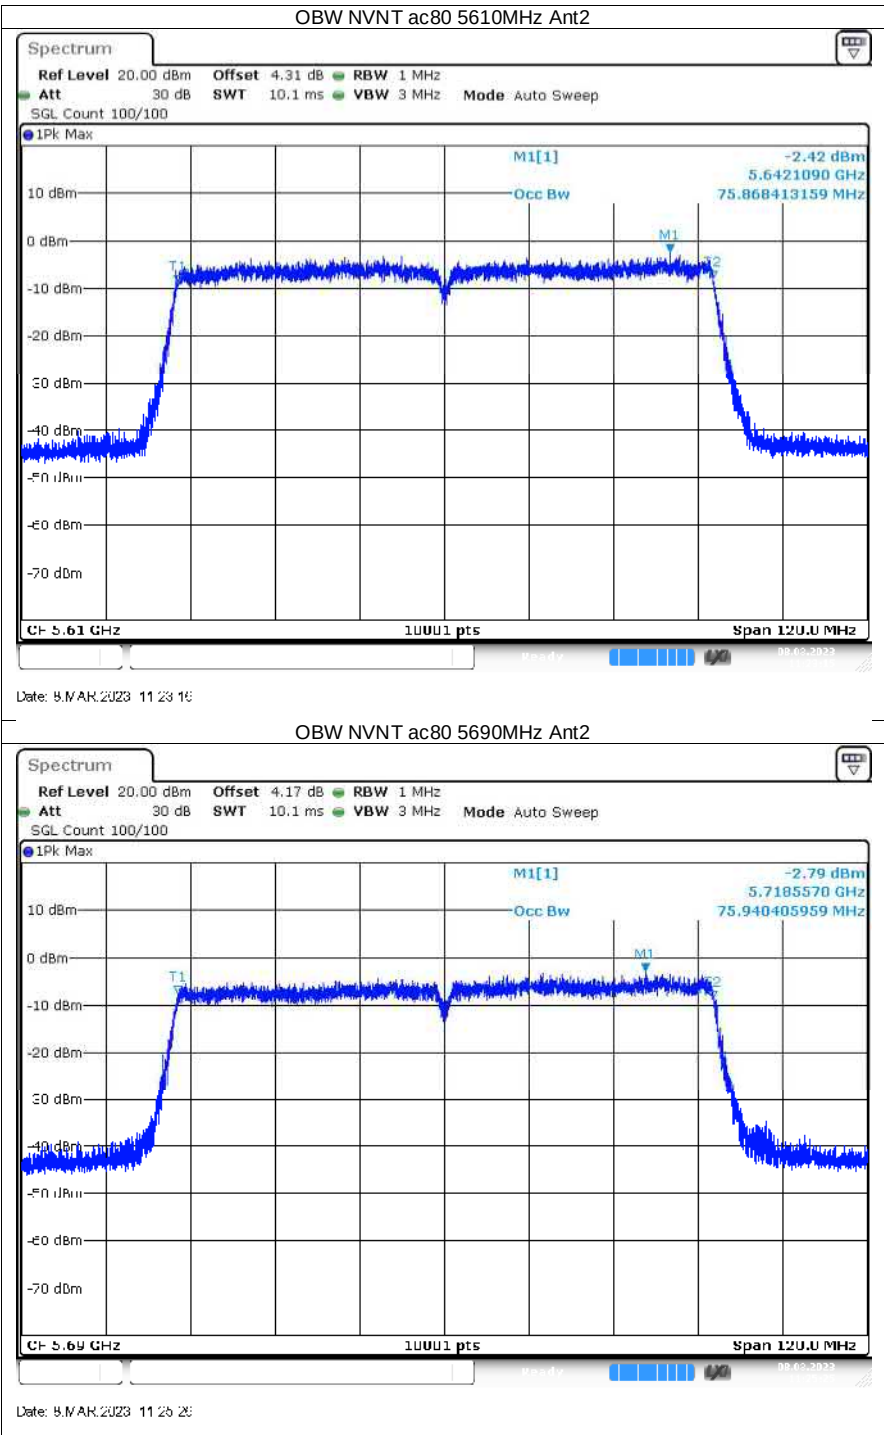





China

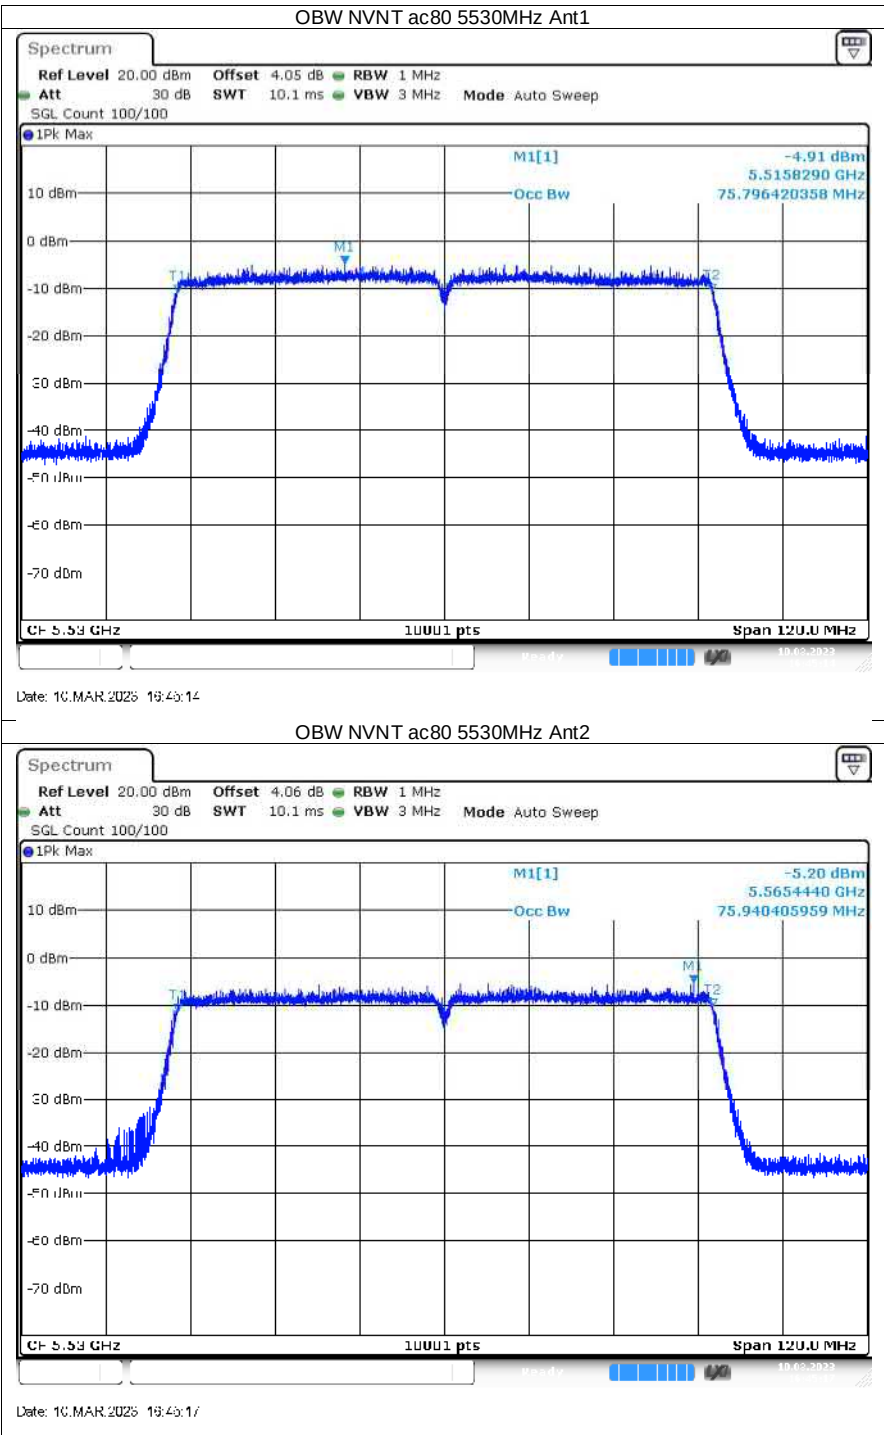





China

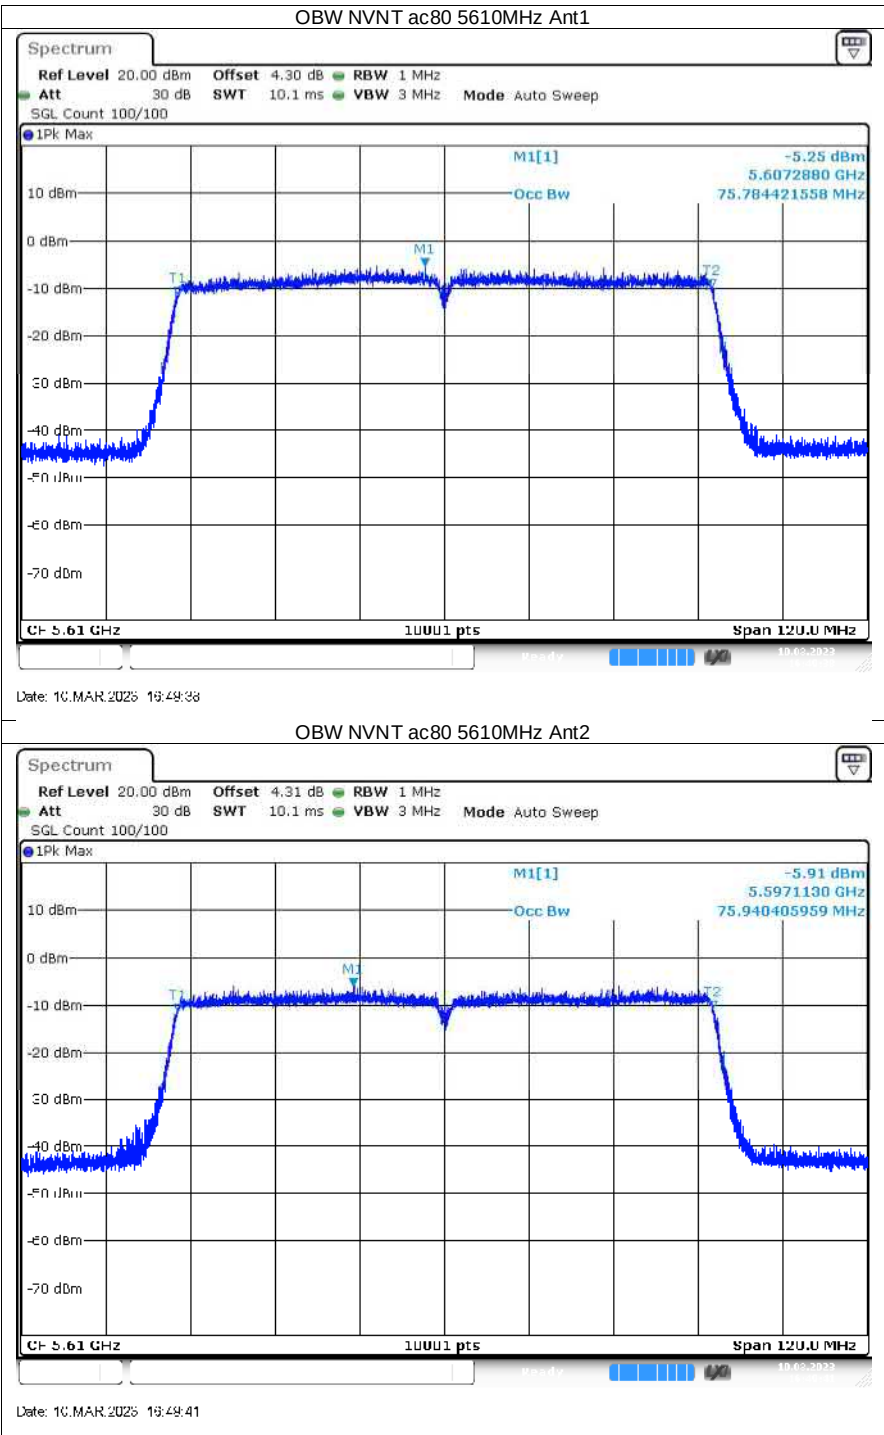

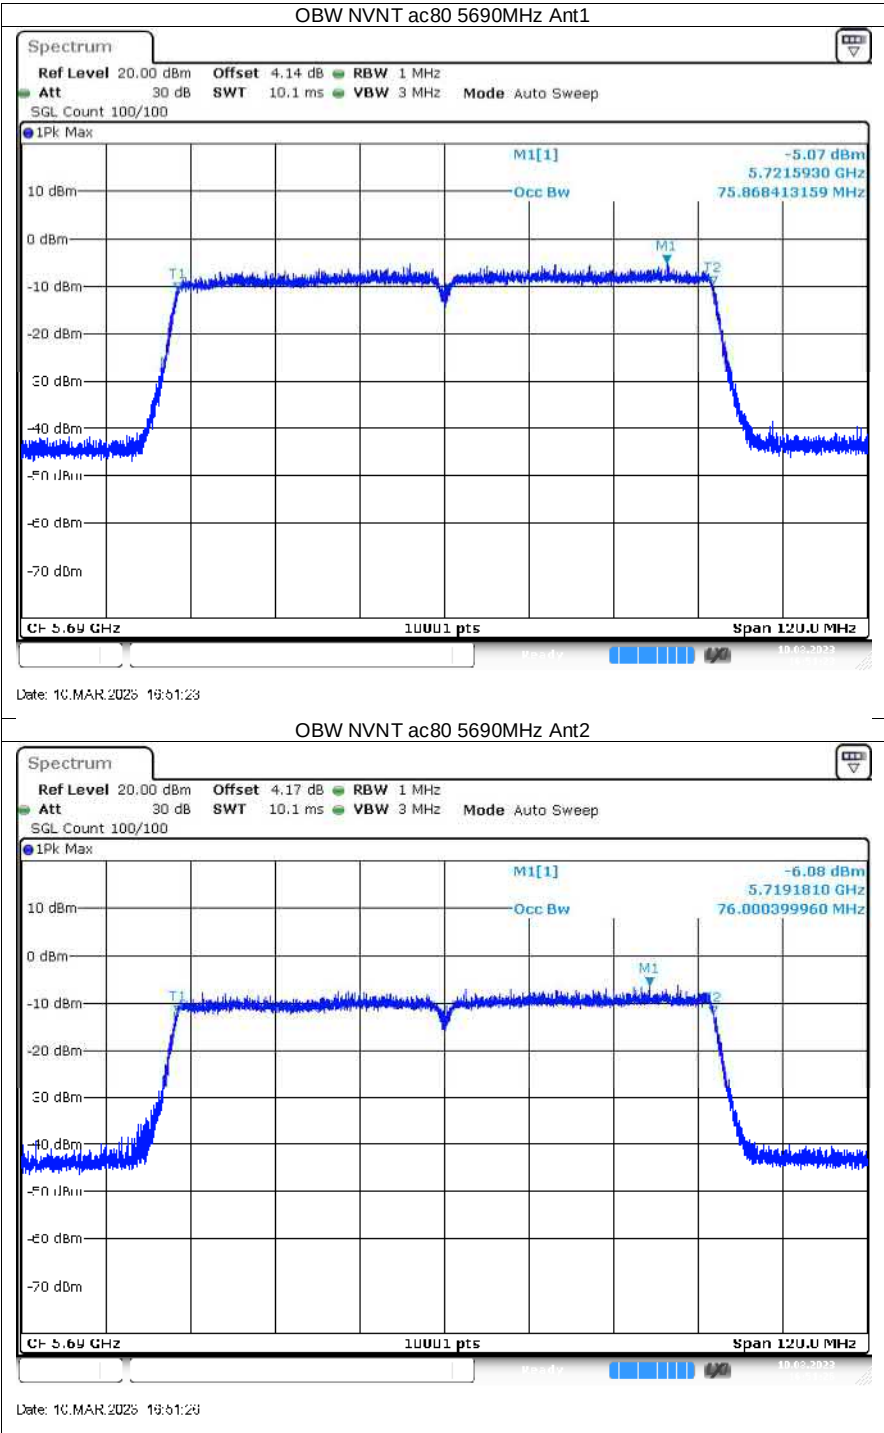


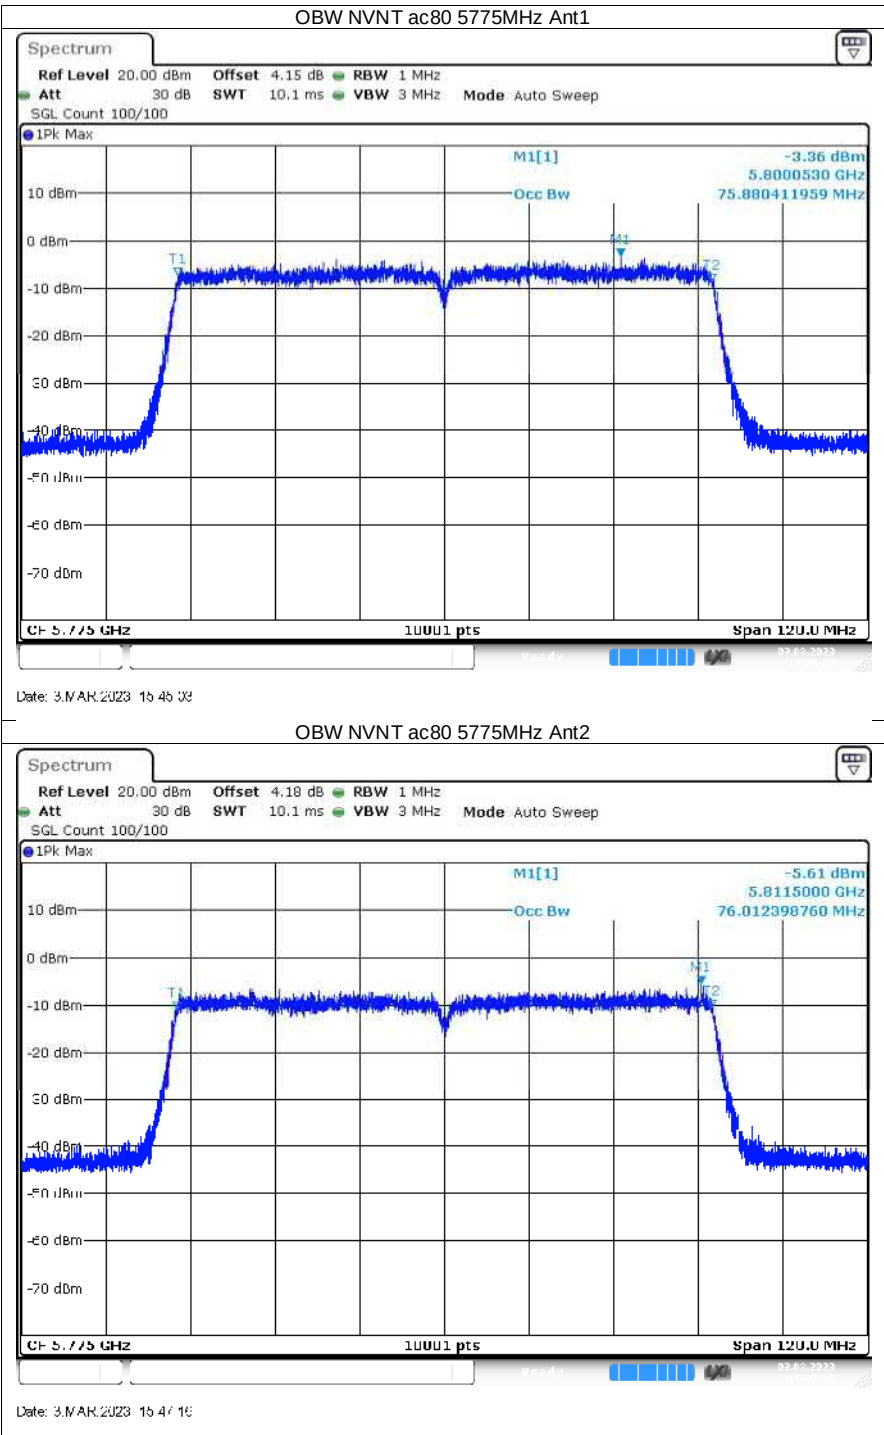


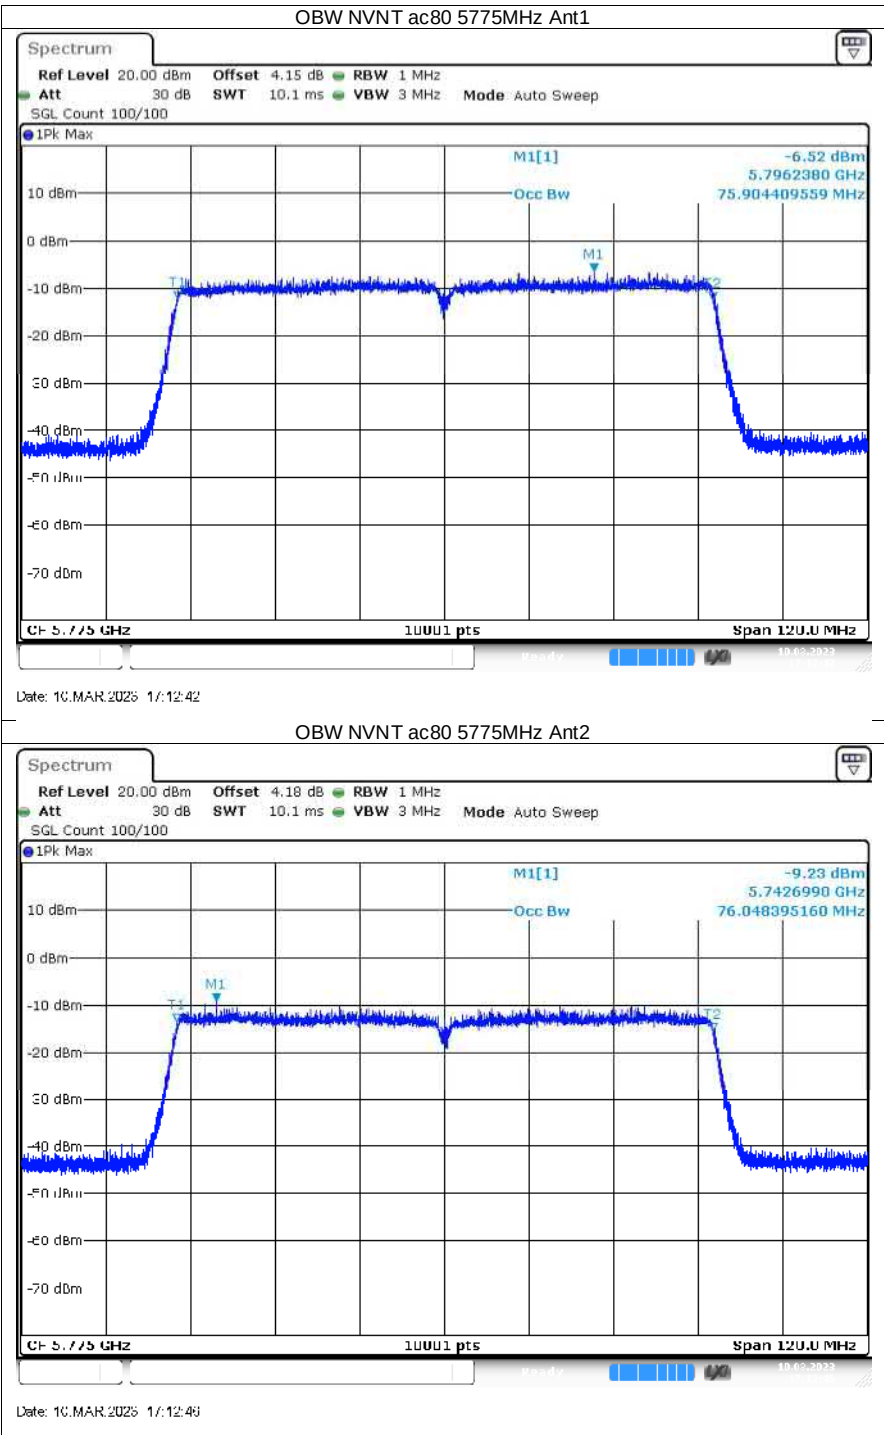





China

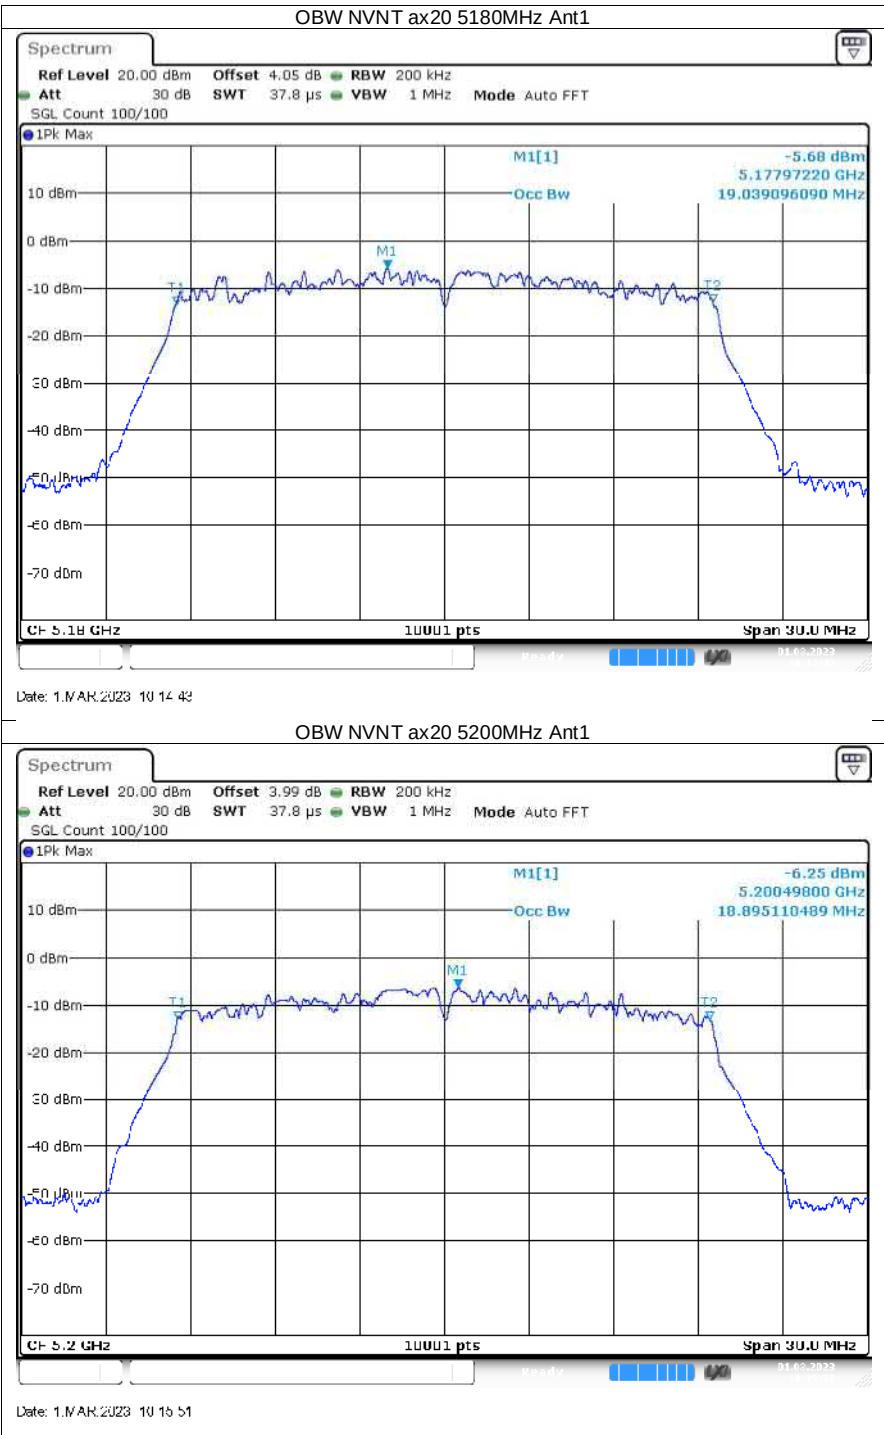

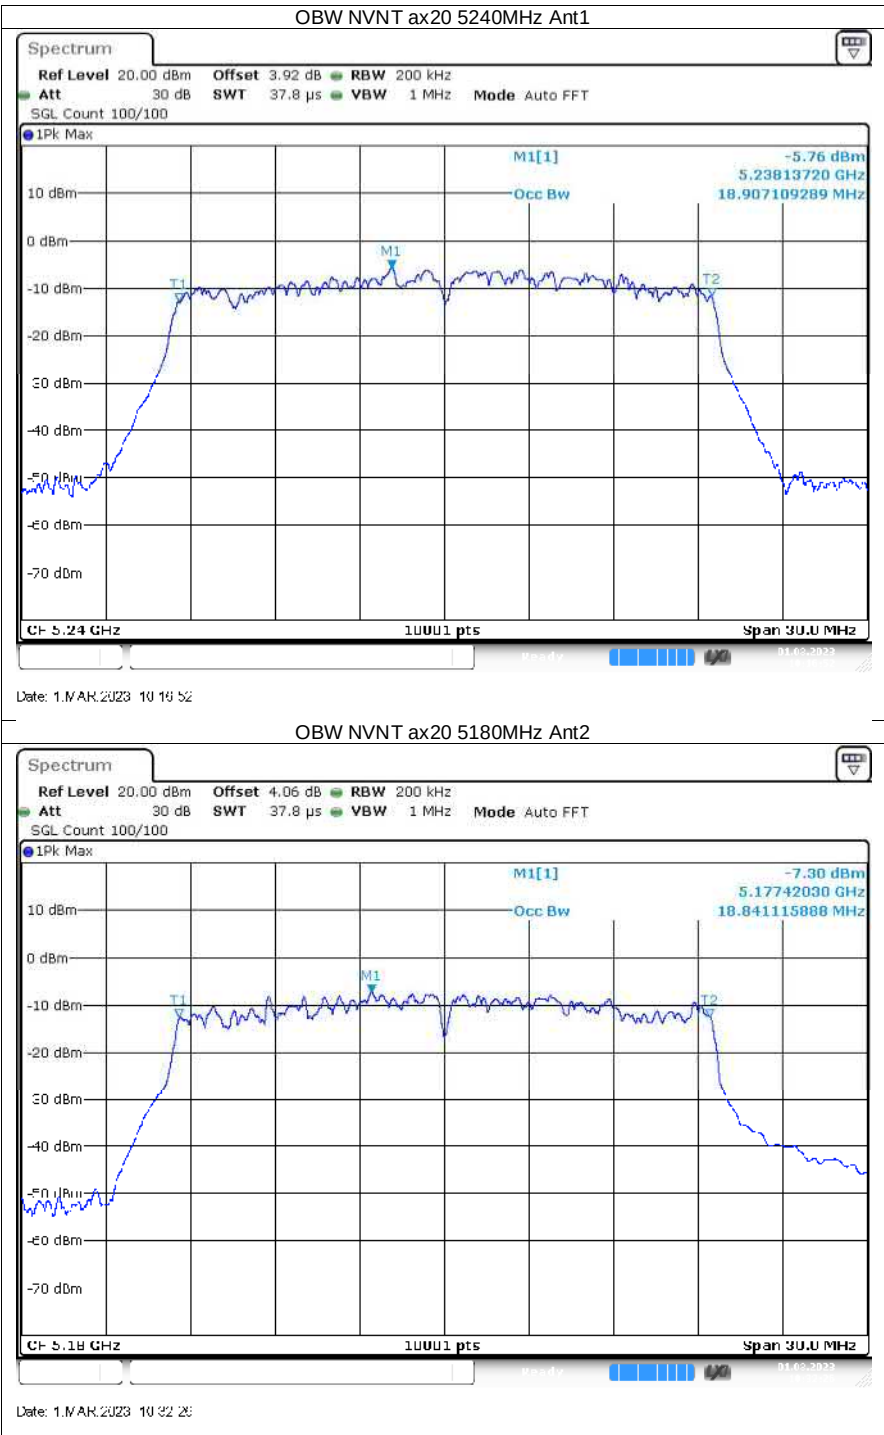


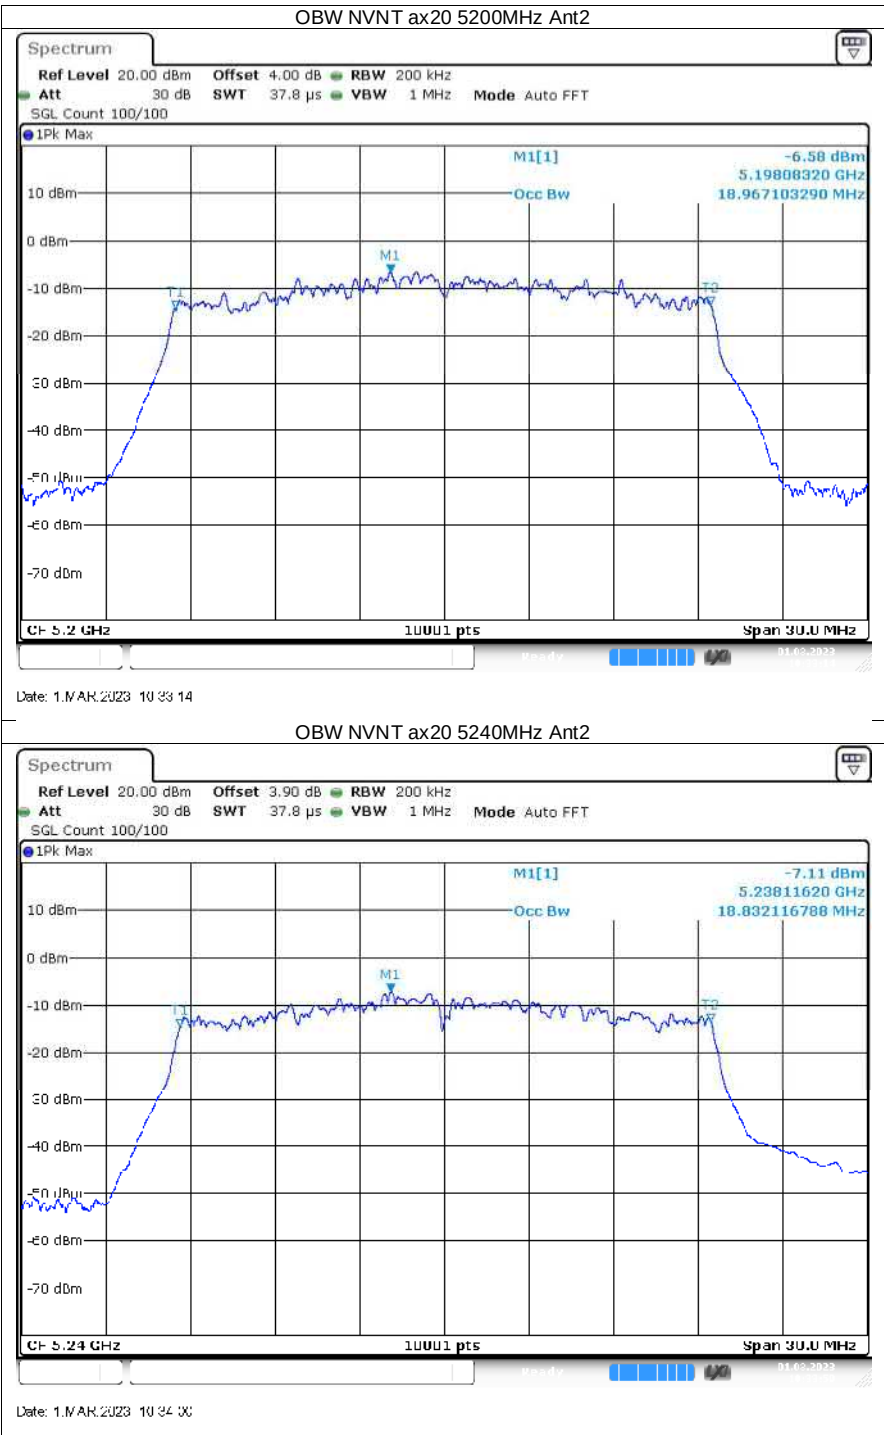


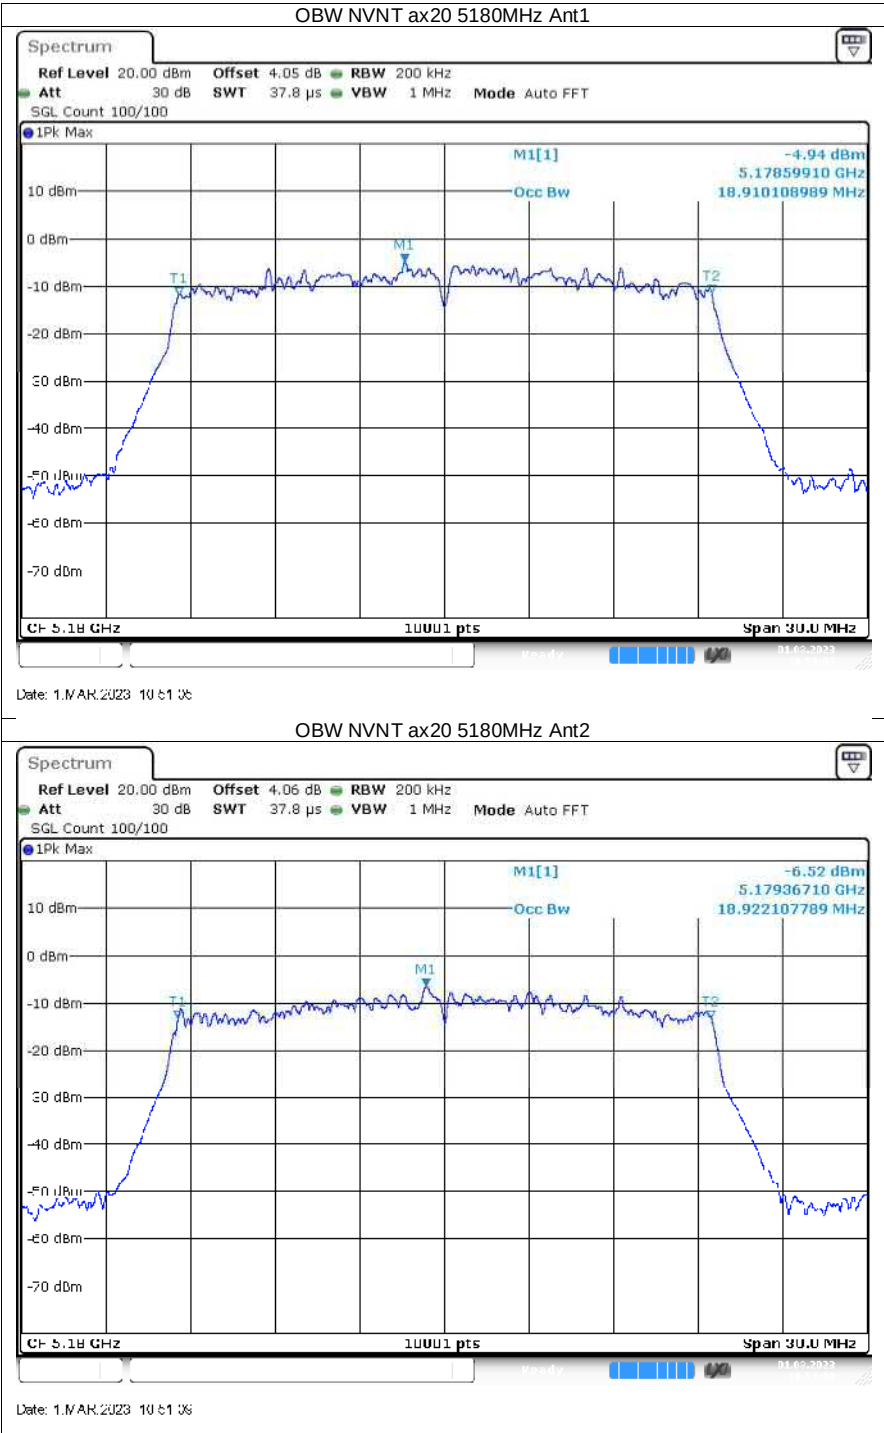




China

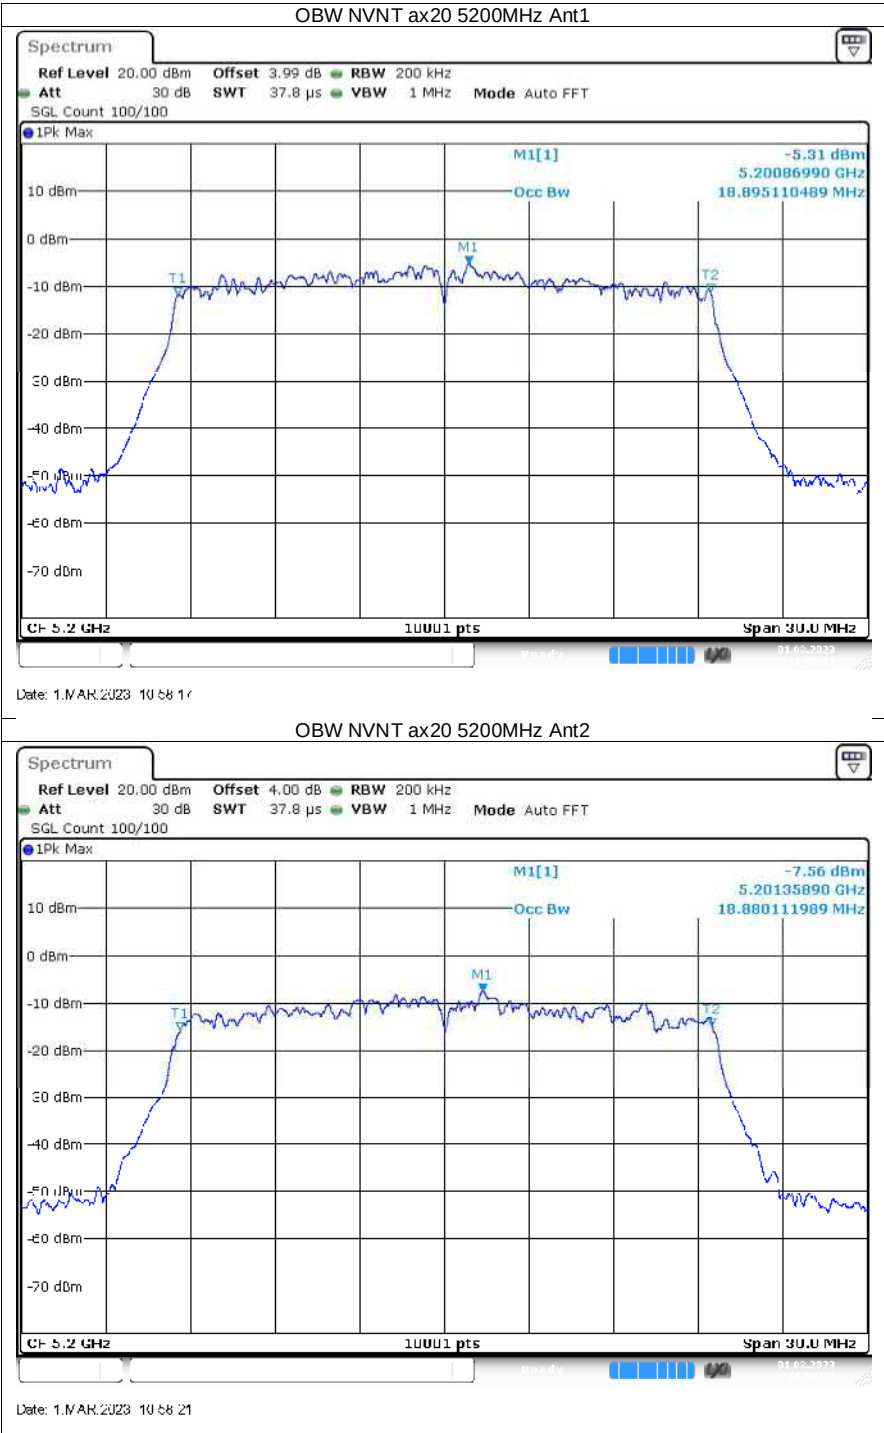


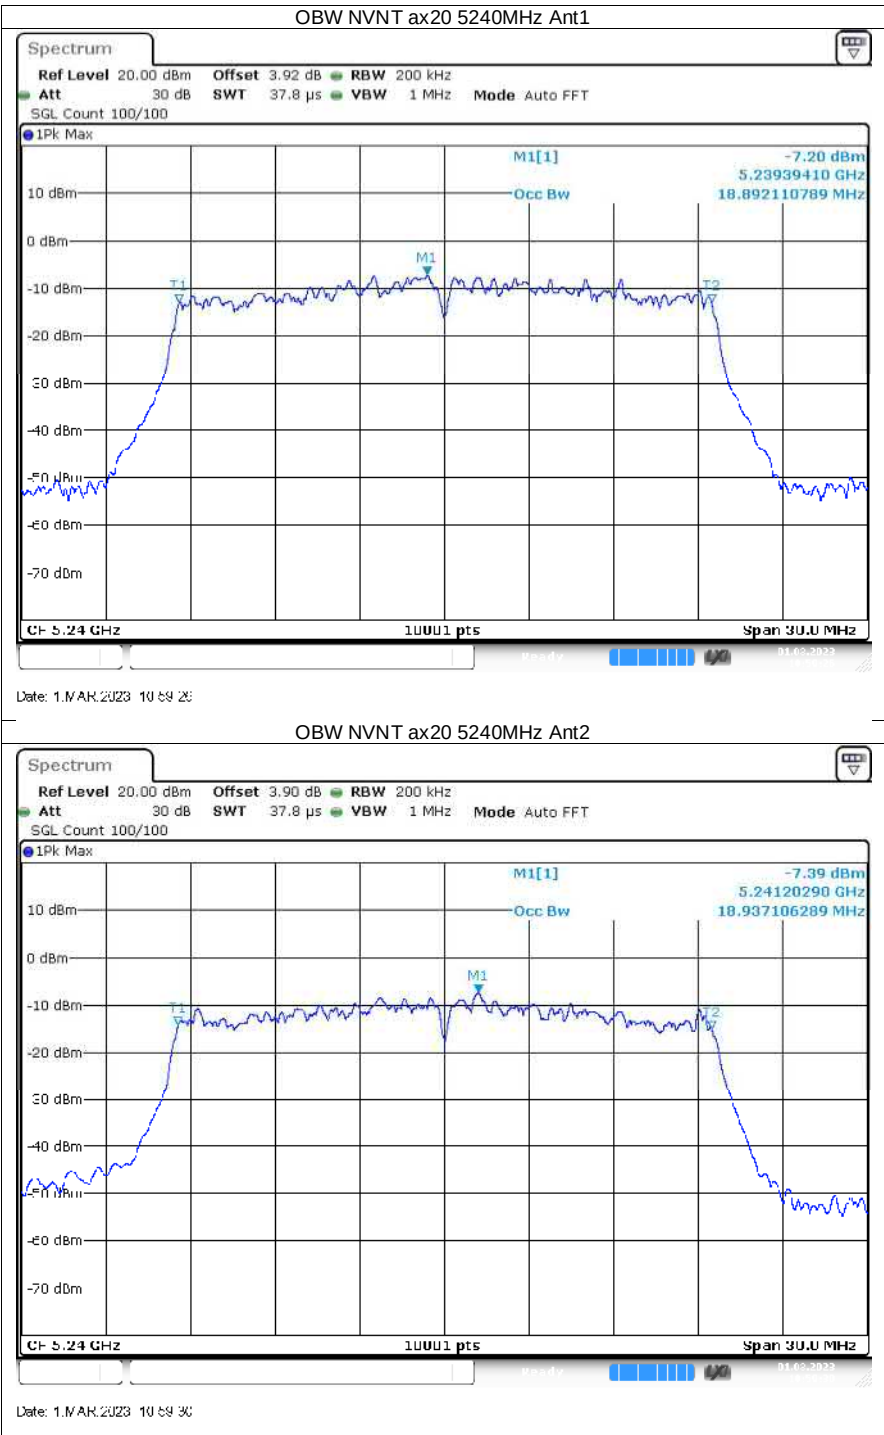


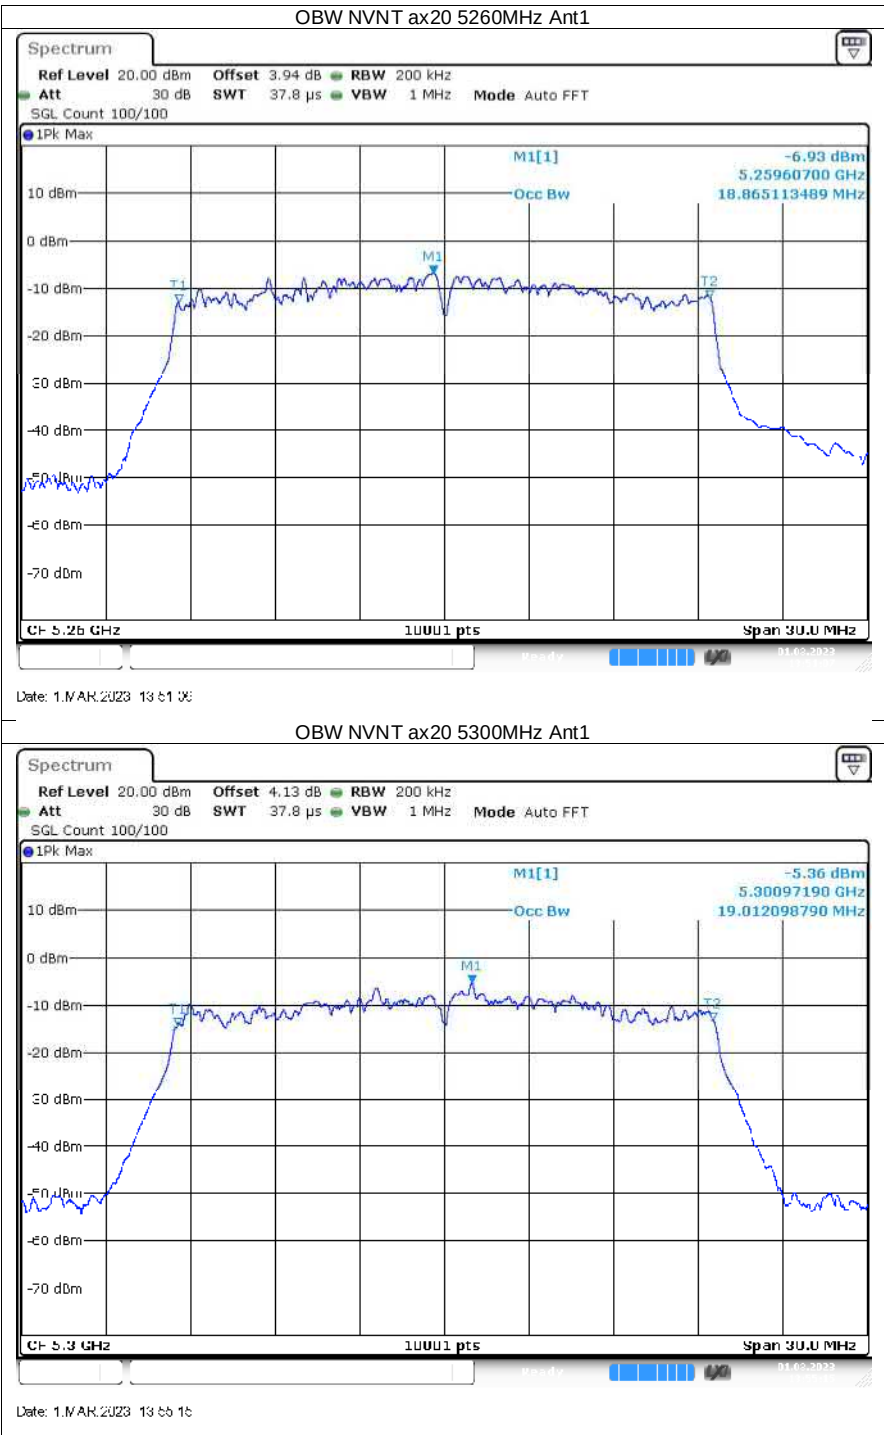




China

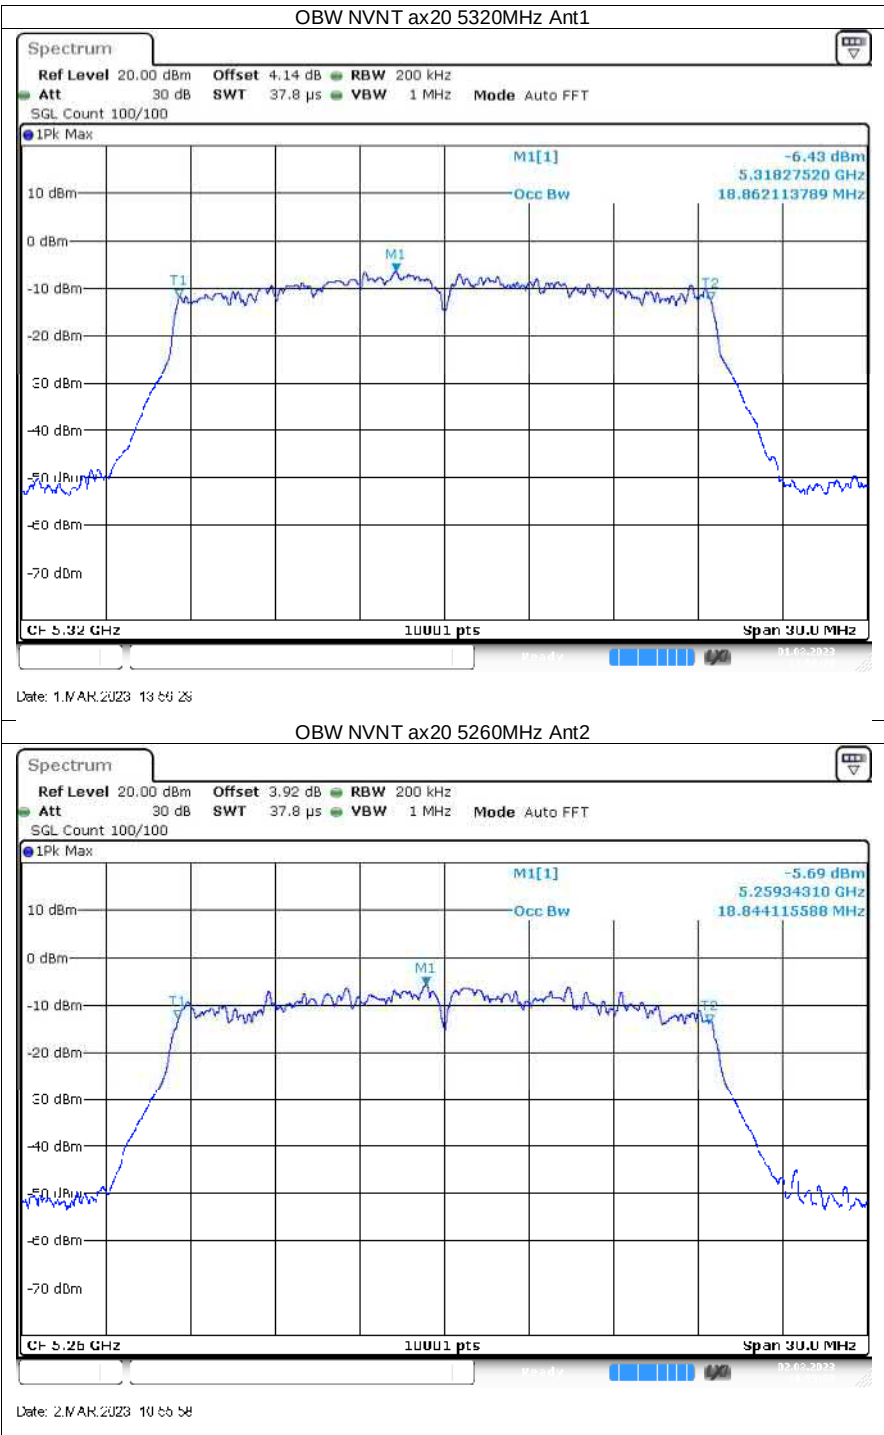


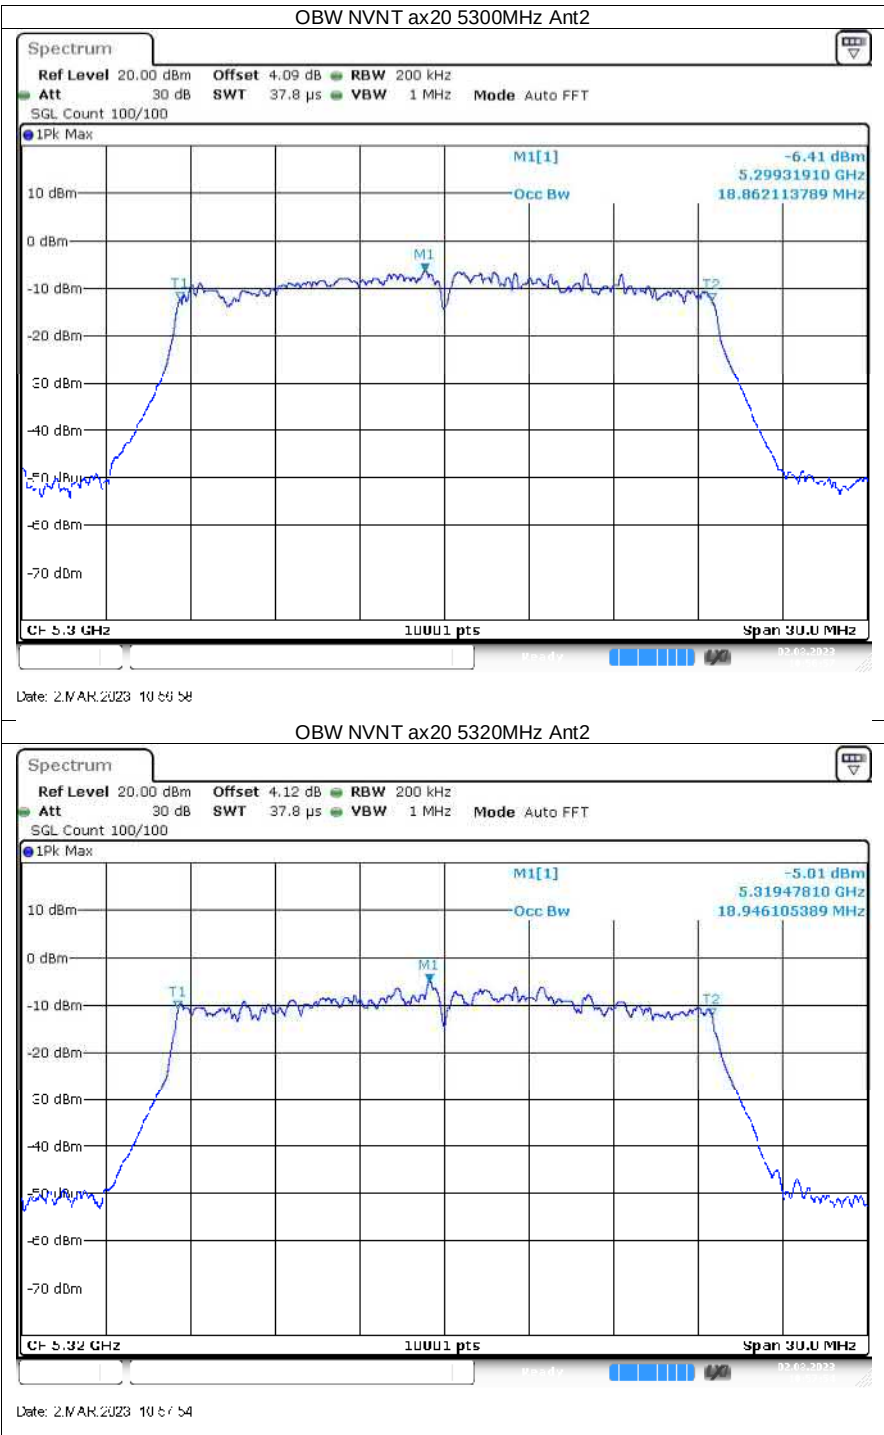


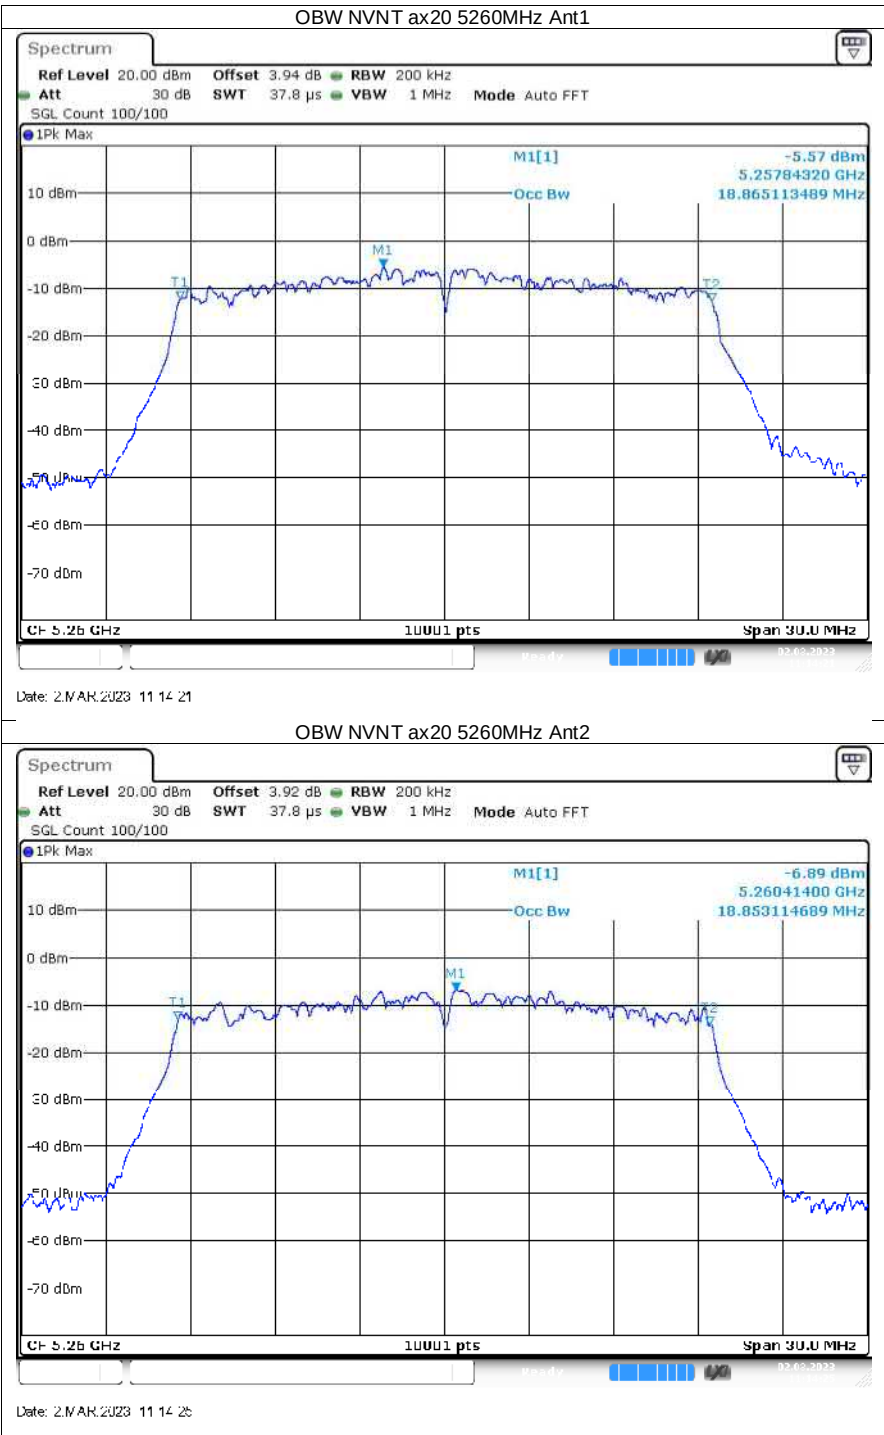





China

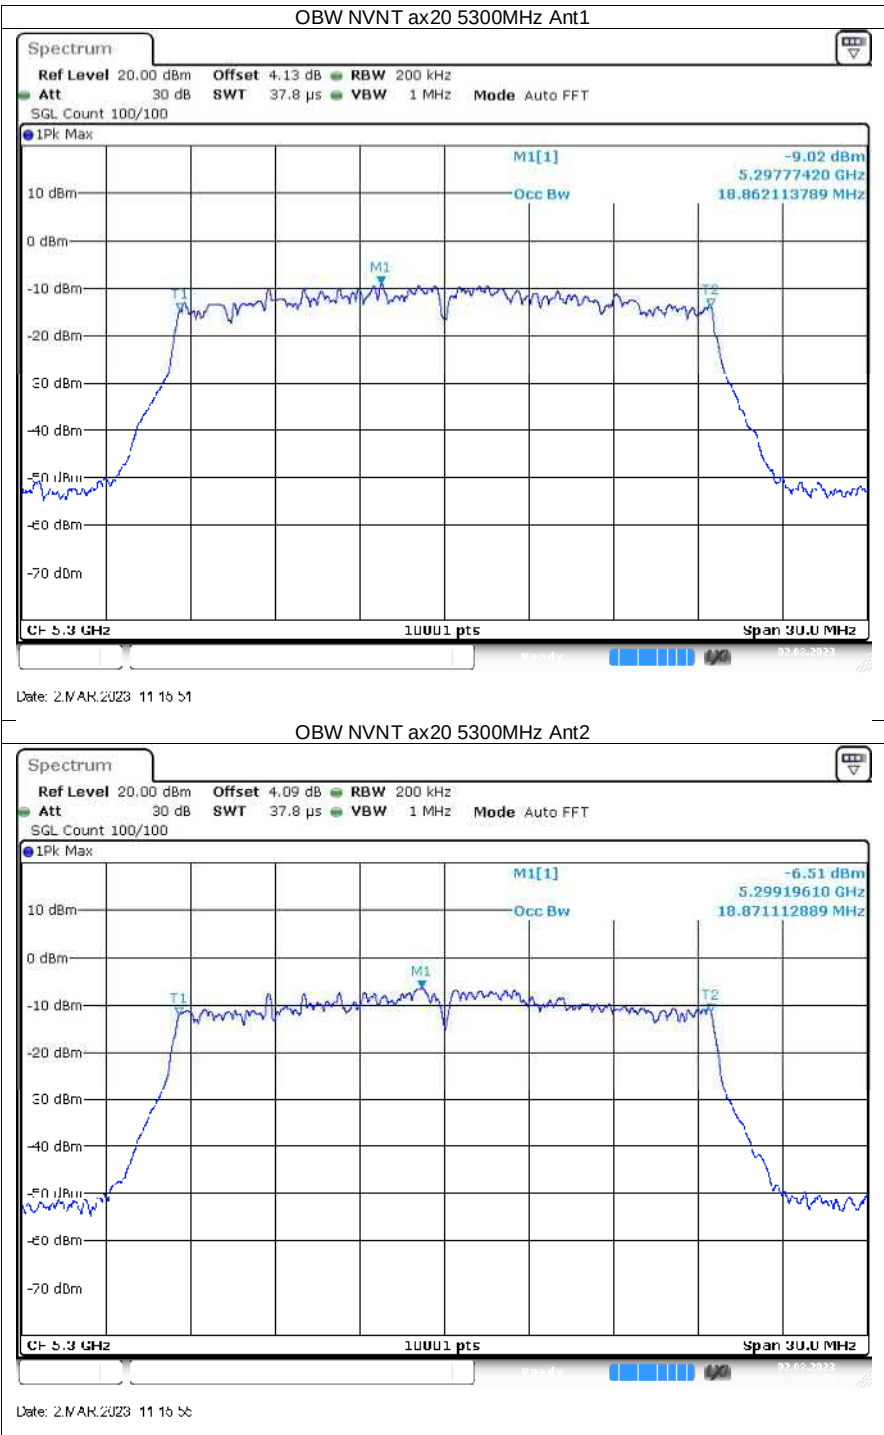

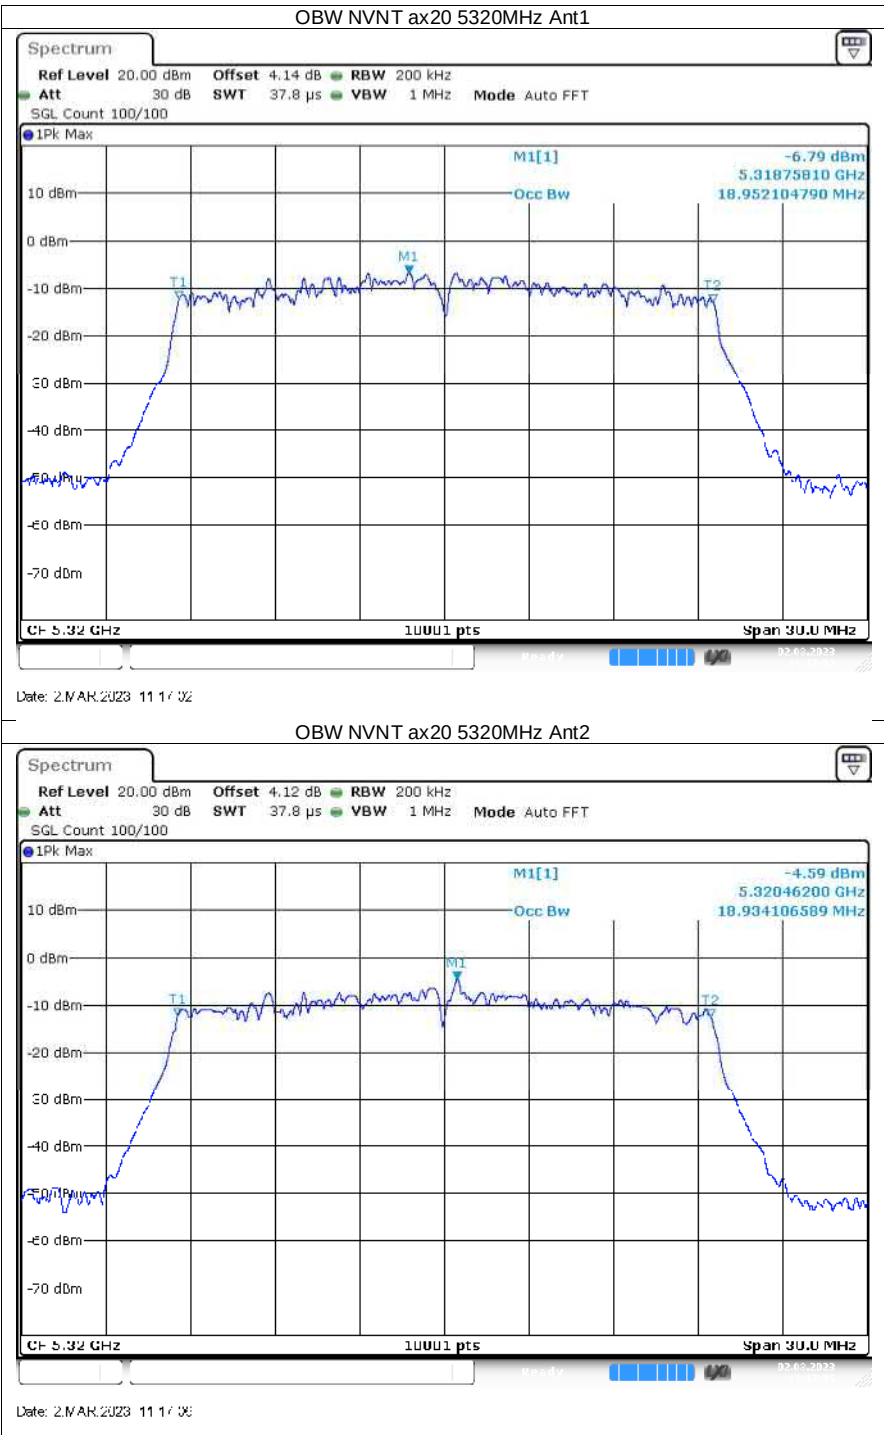


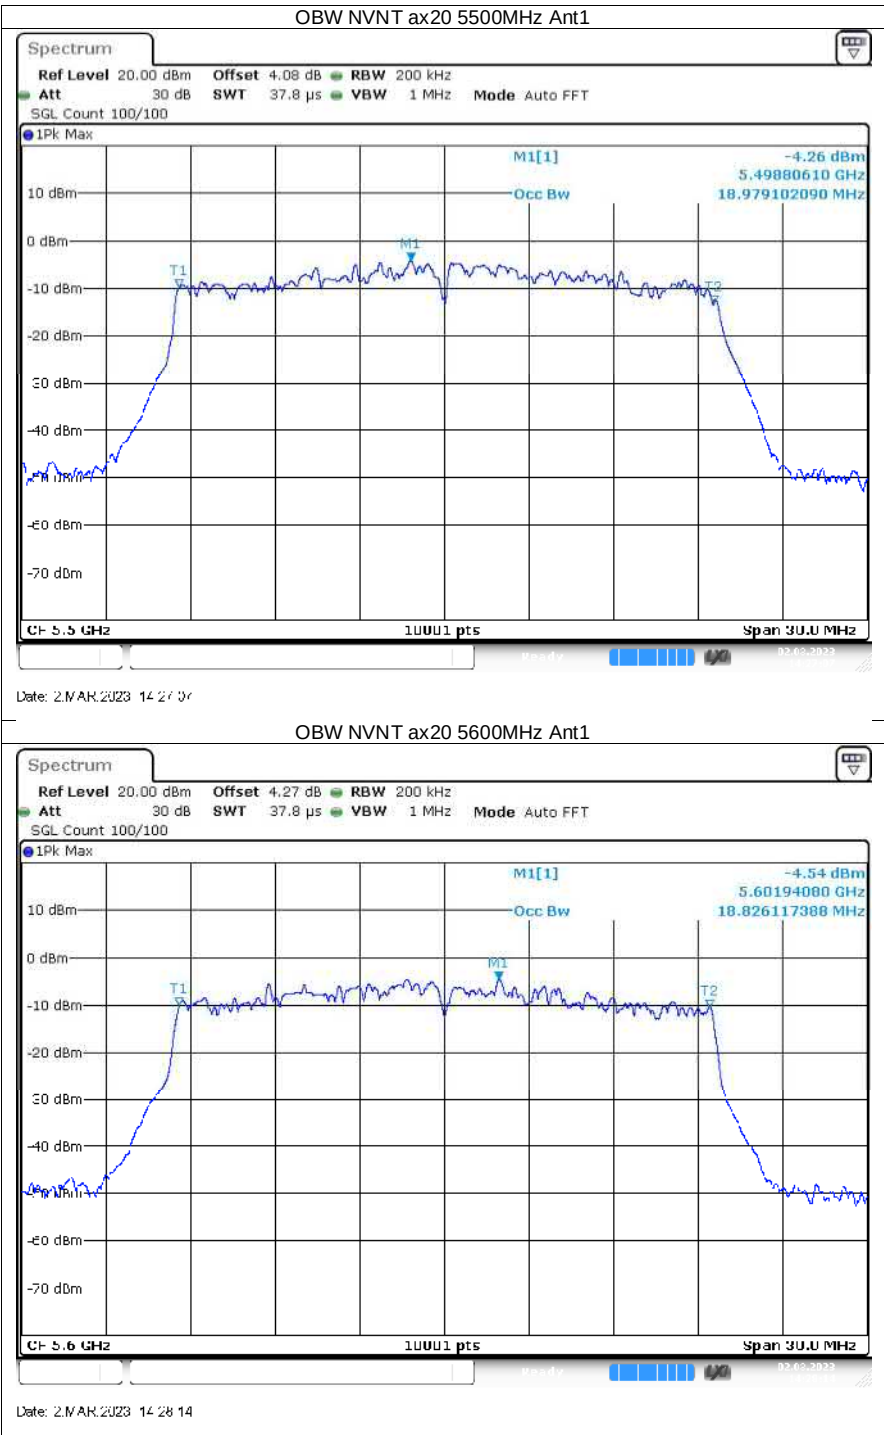

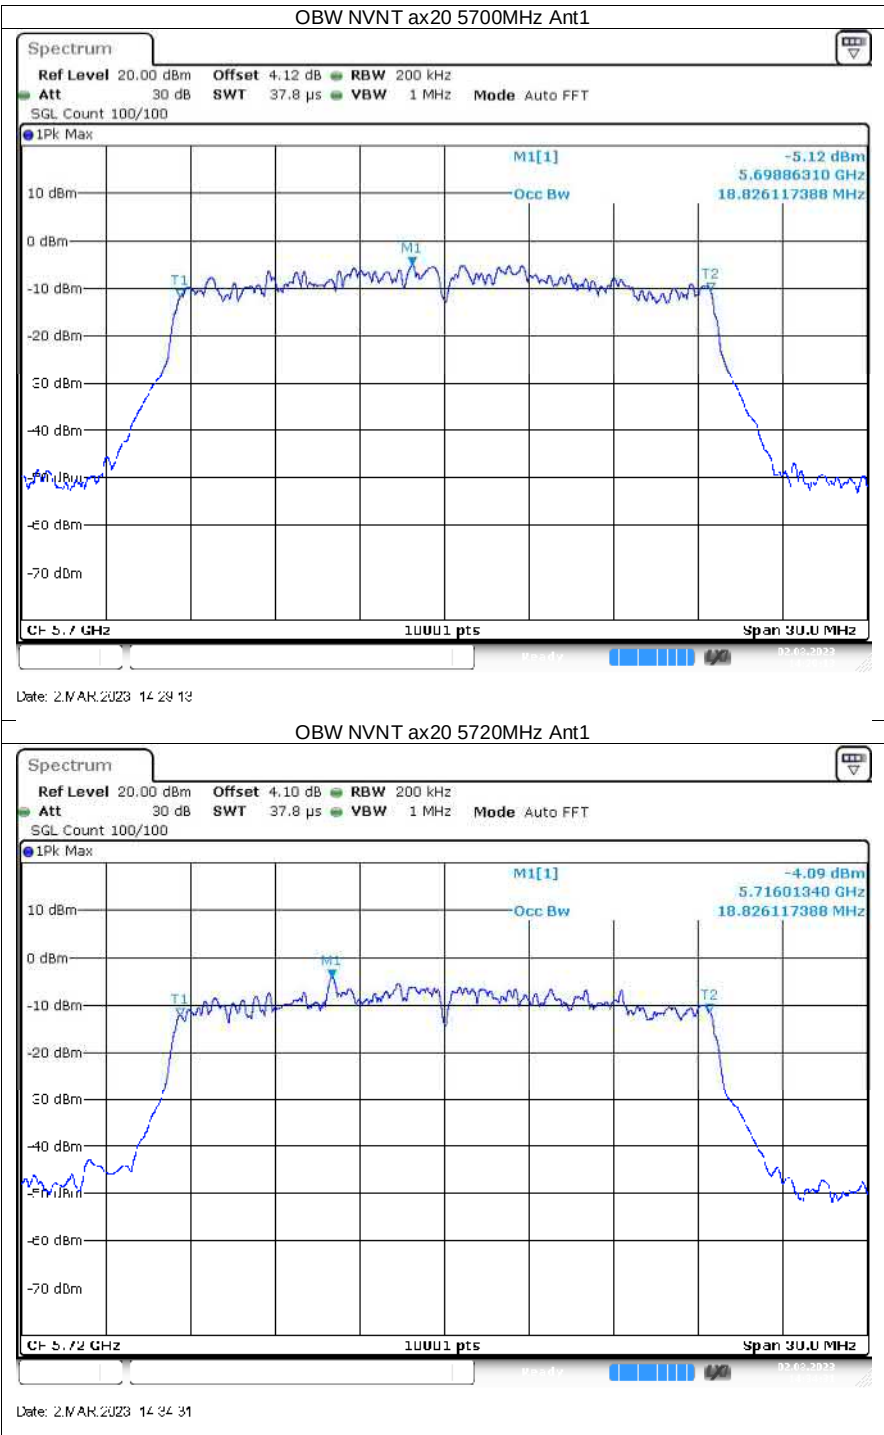





China

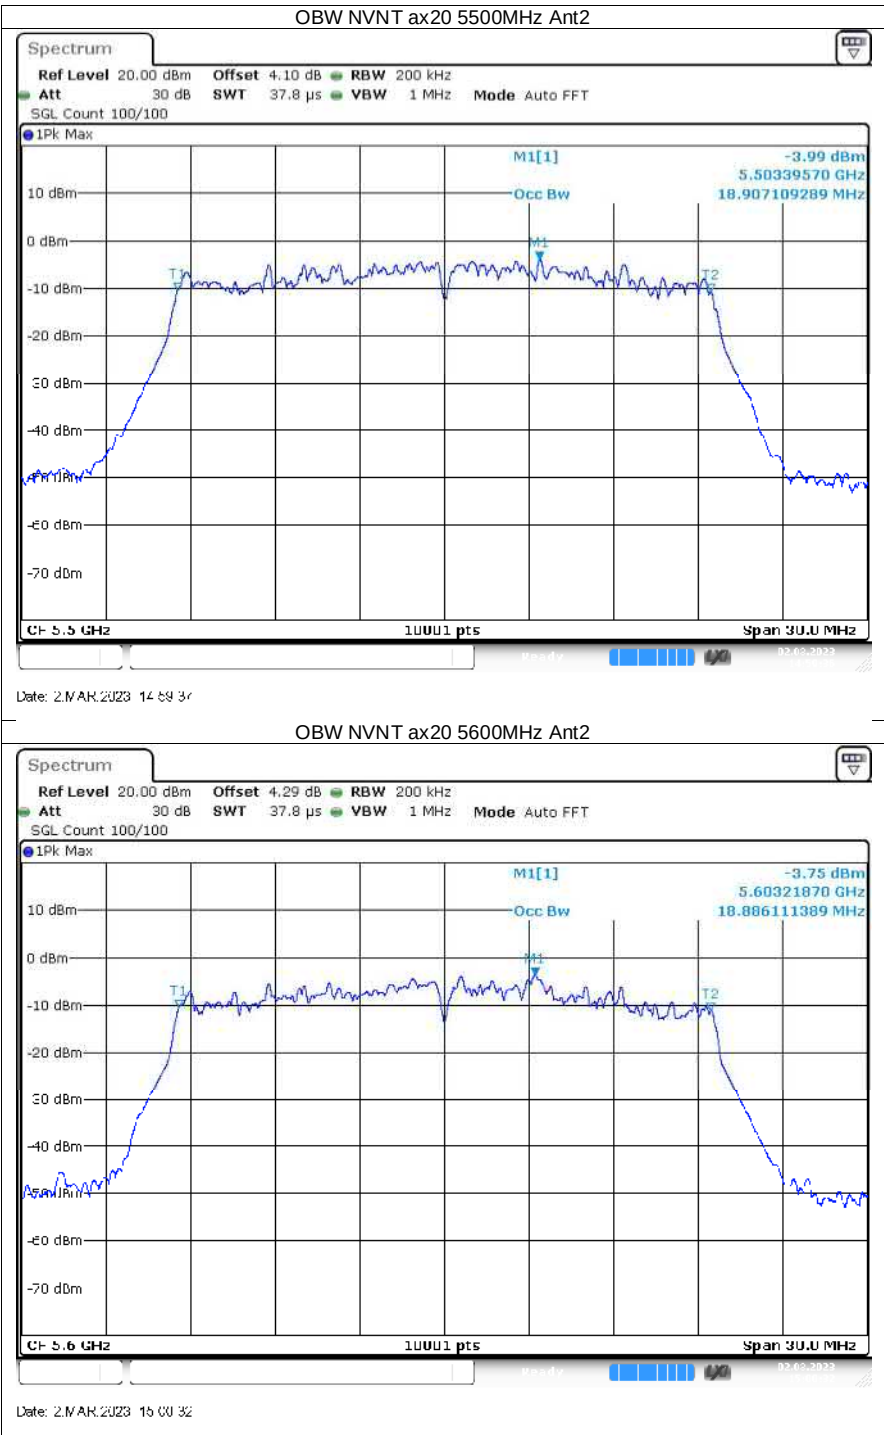






China

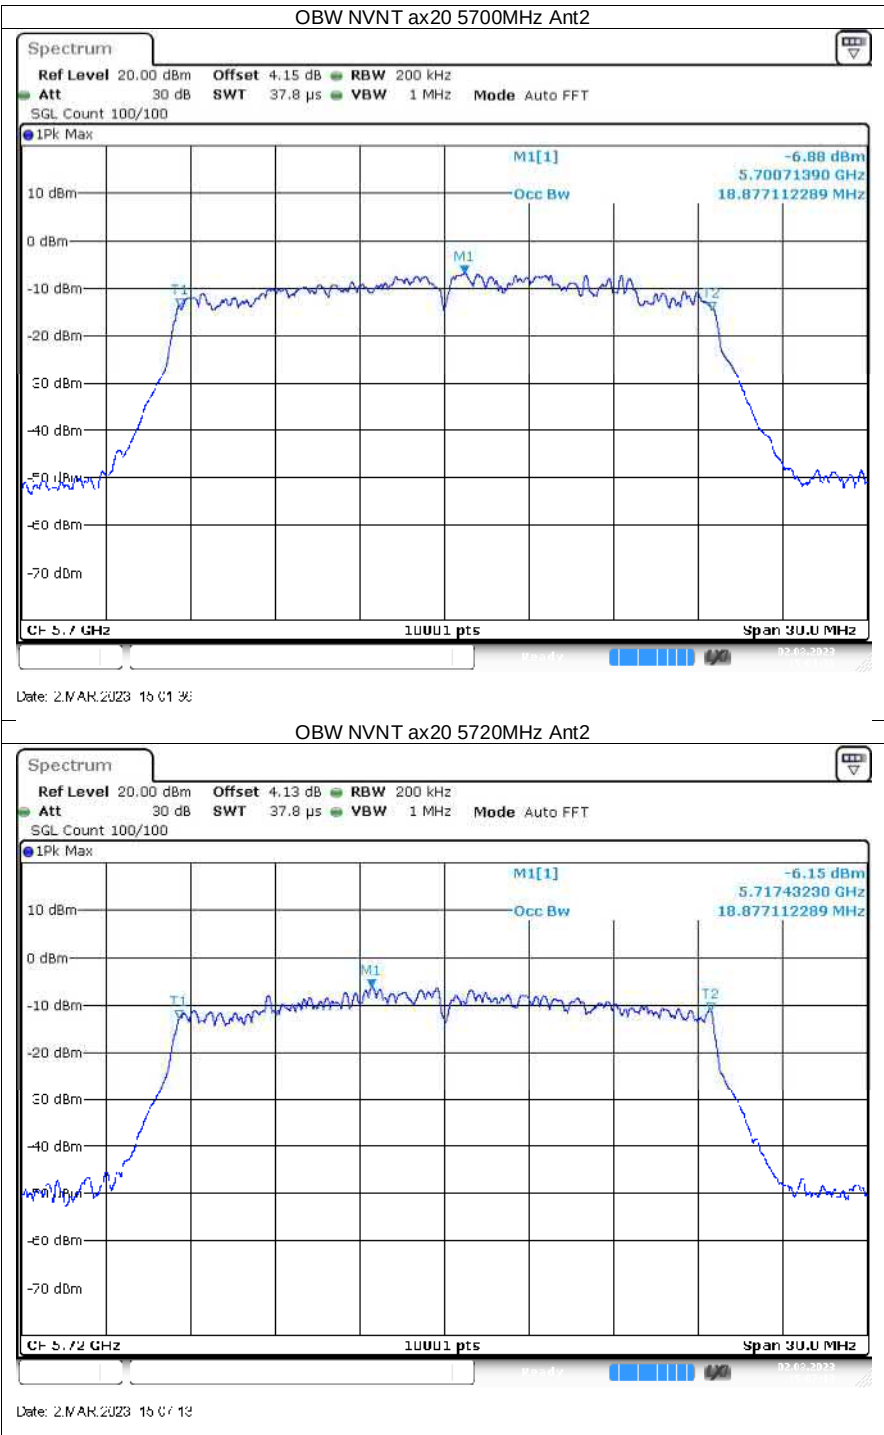


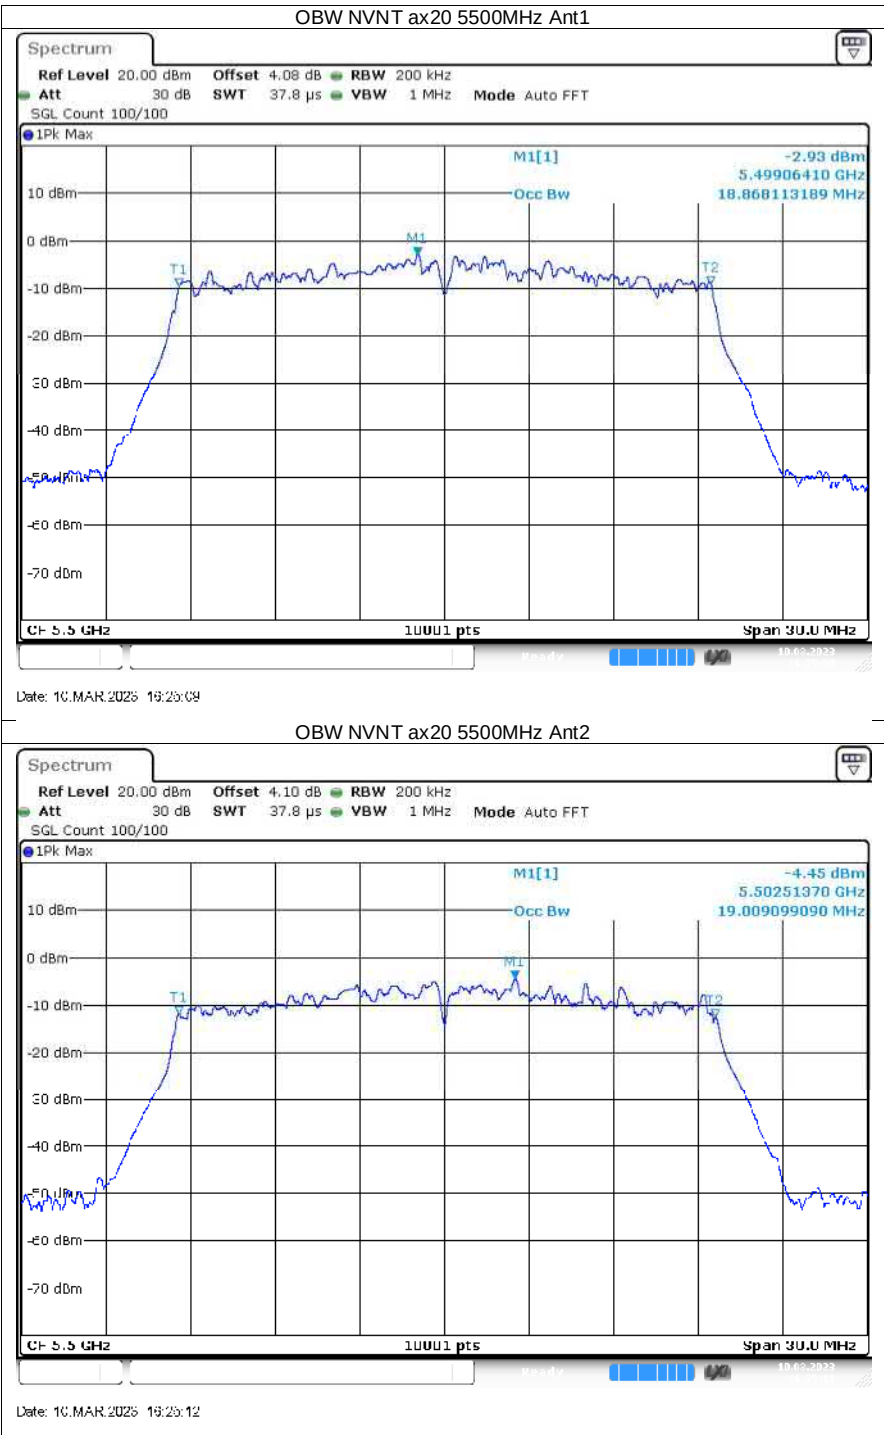


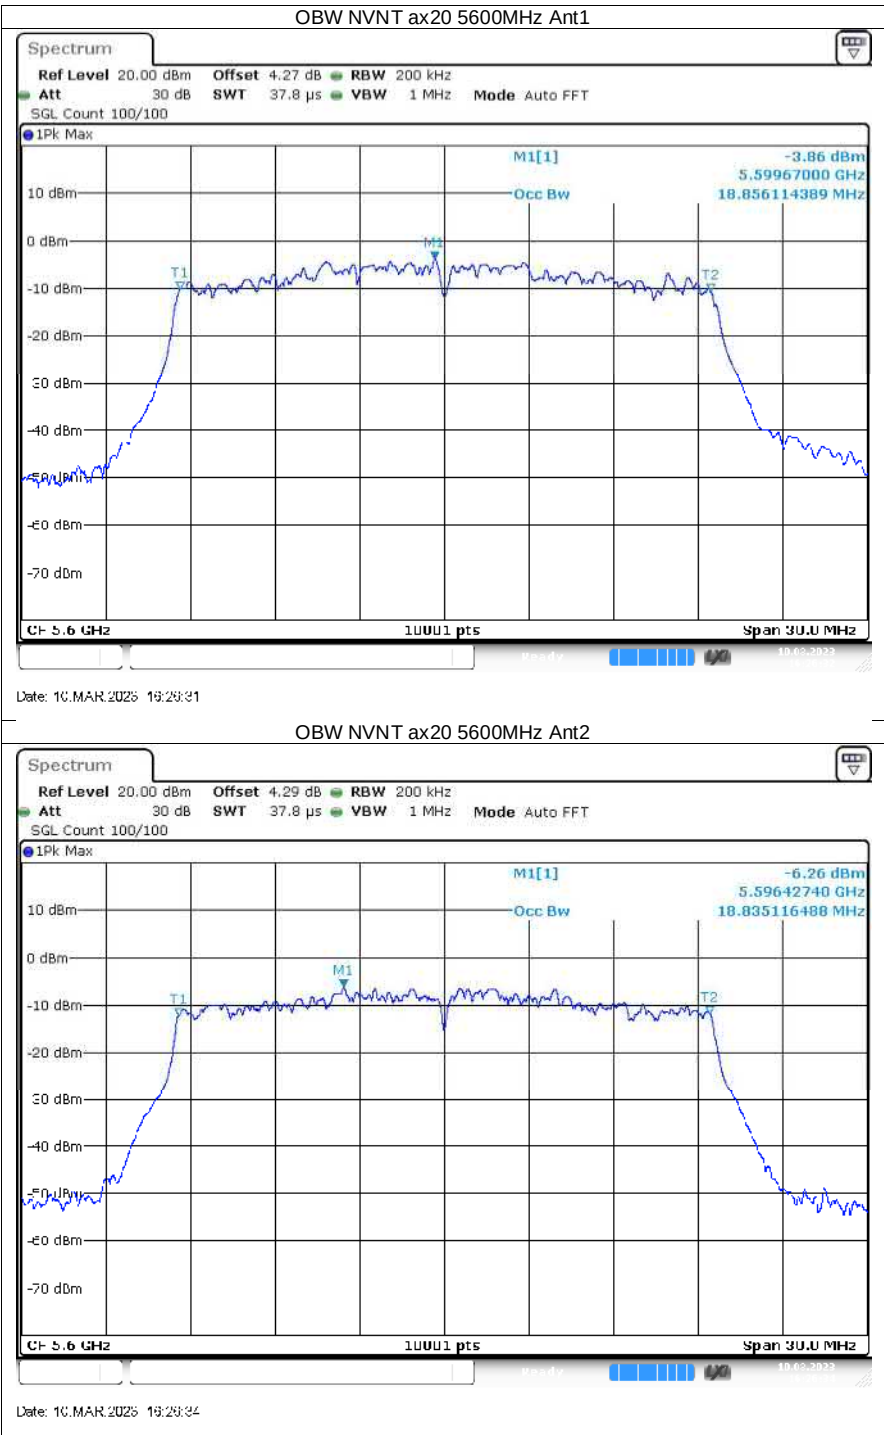


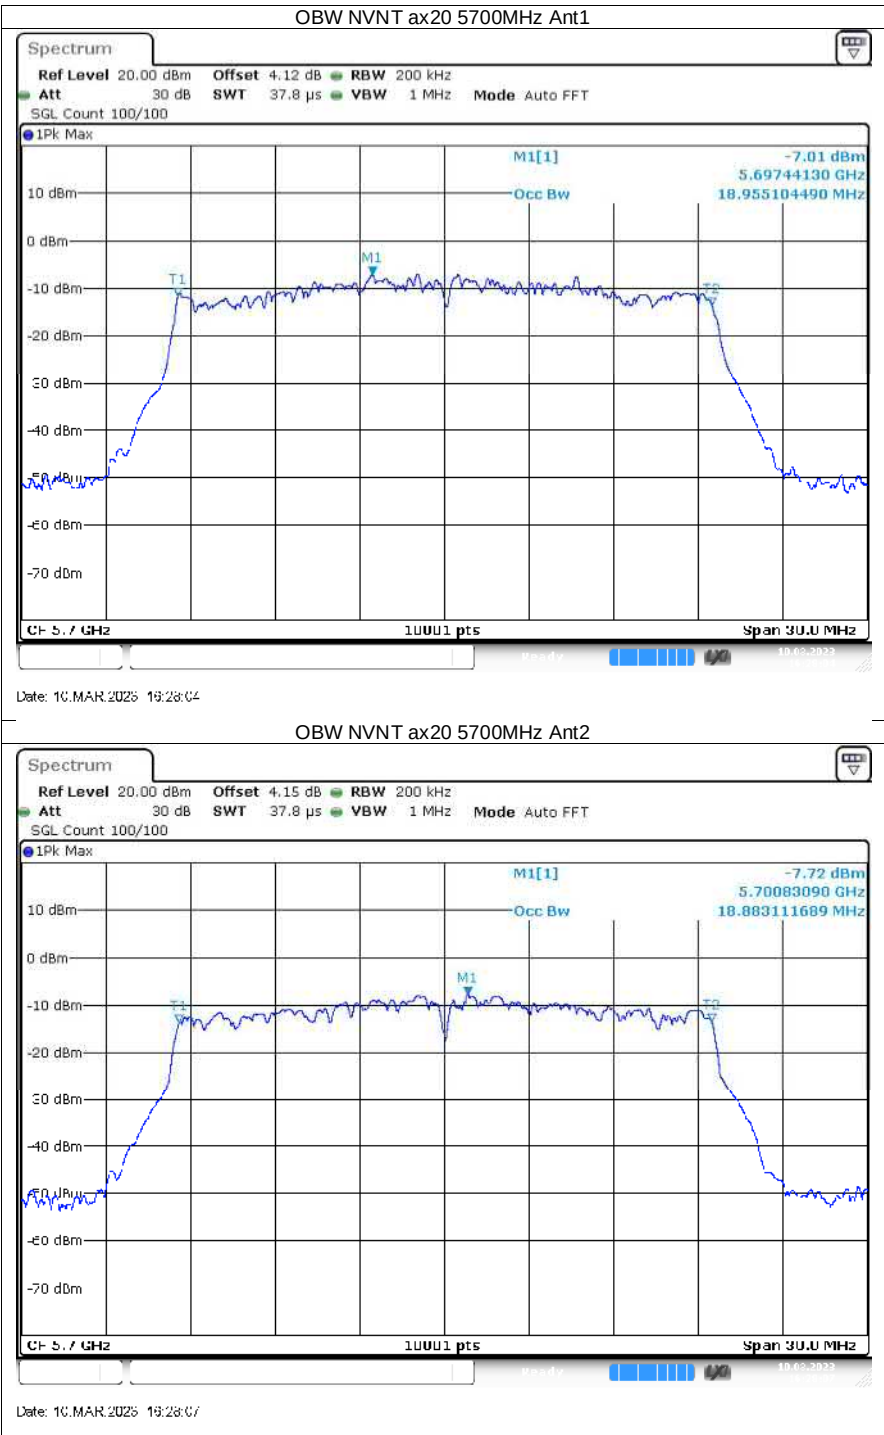


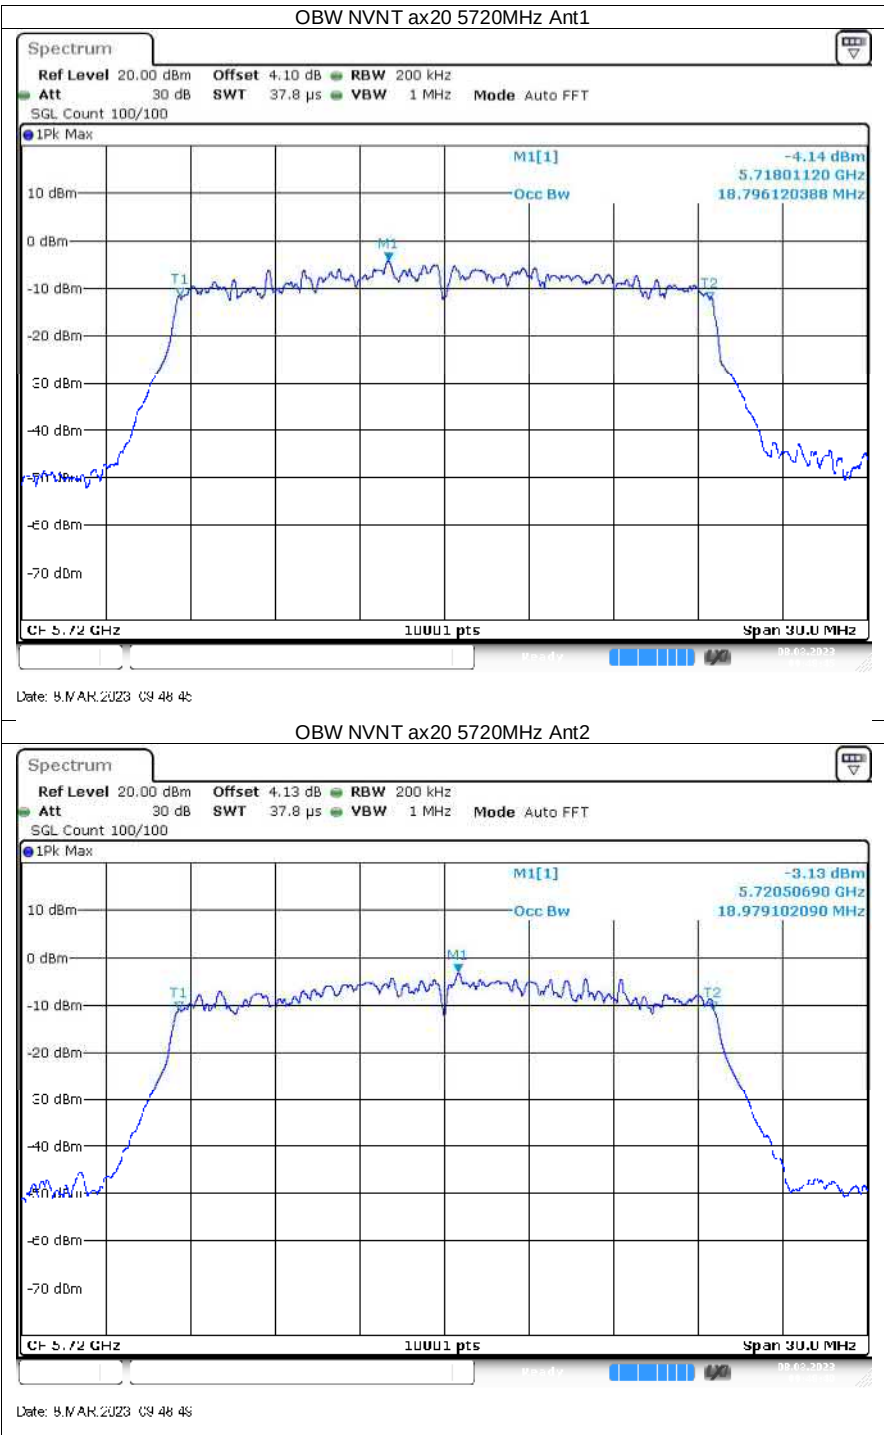


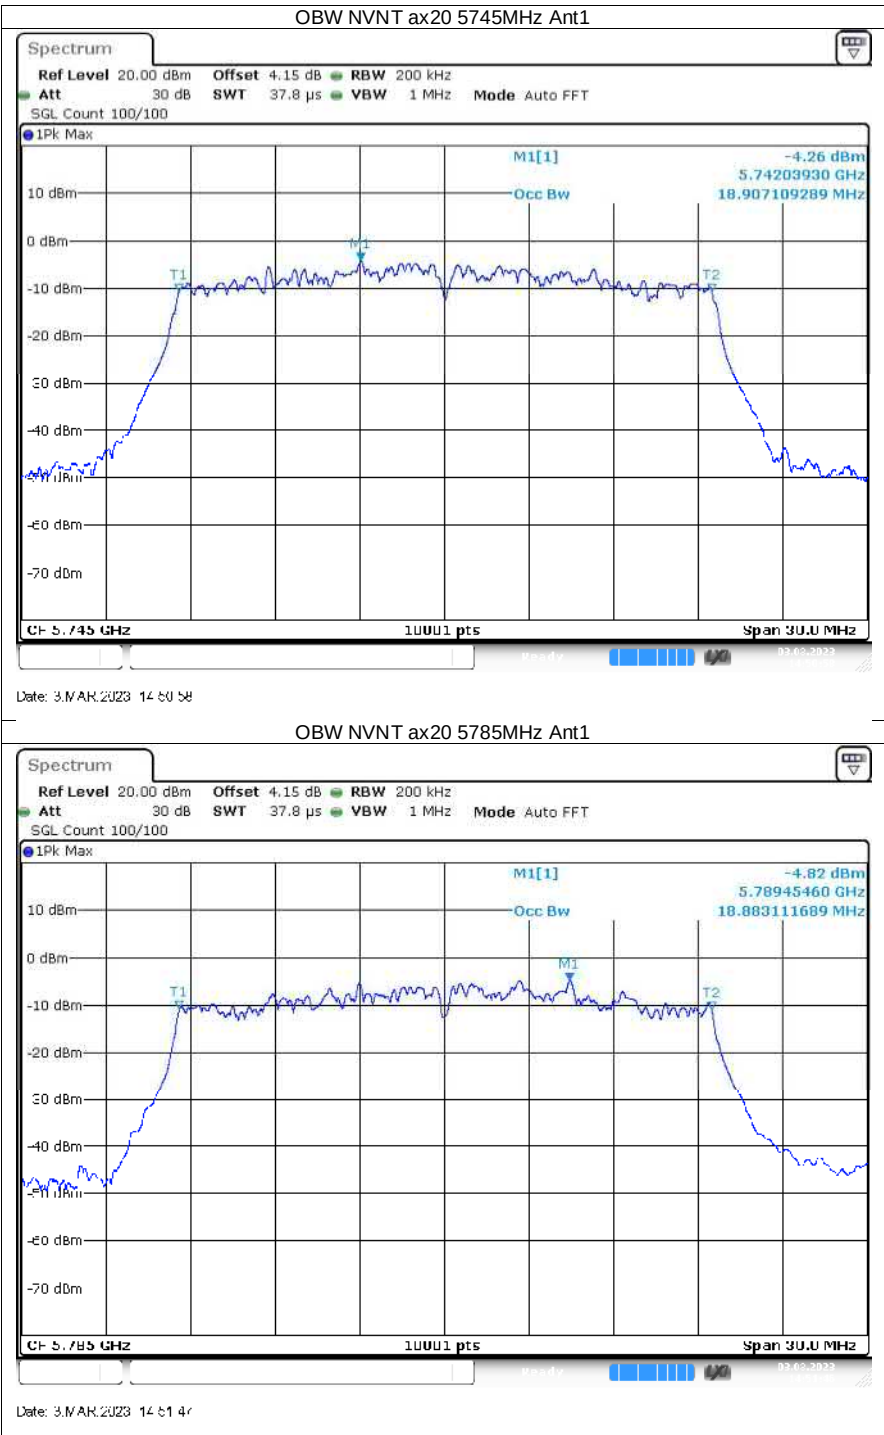

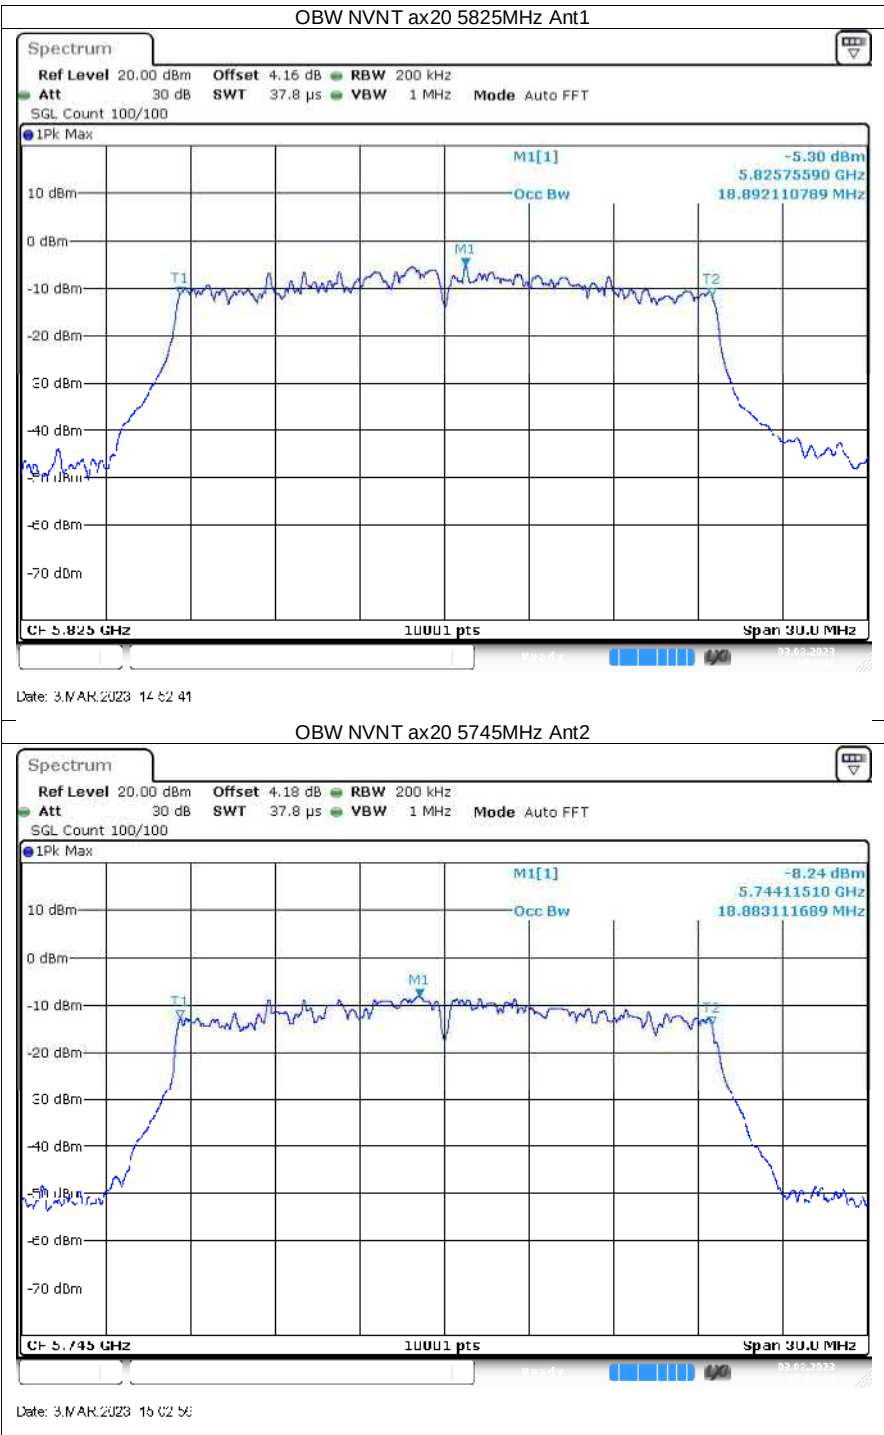

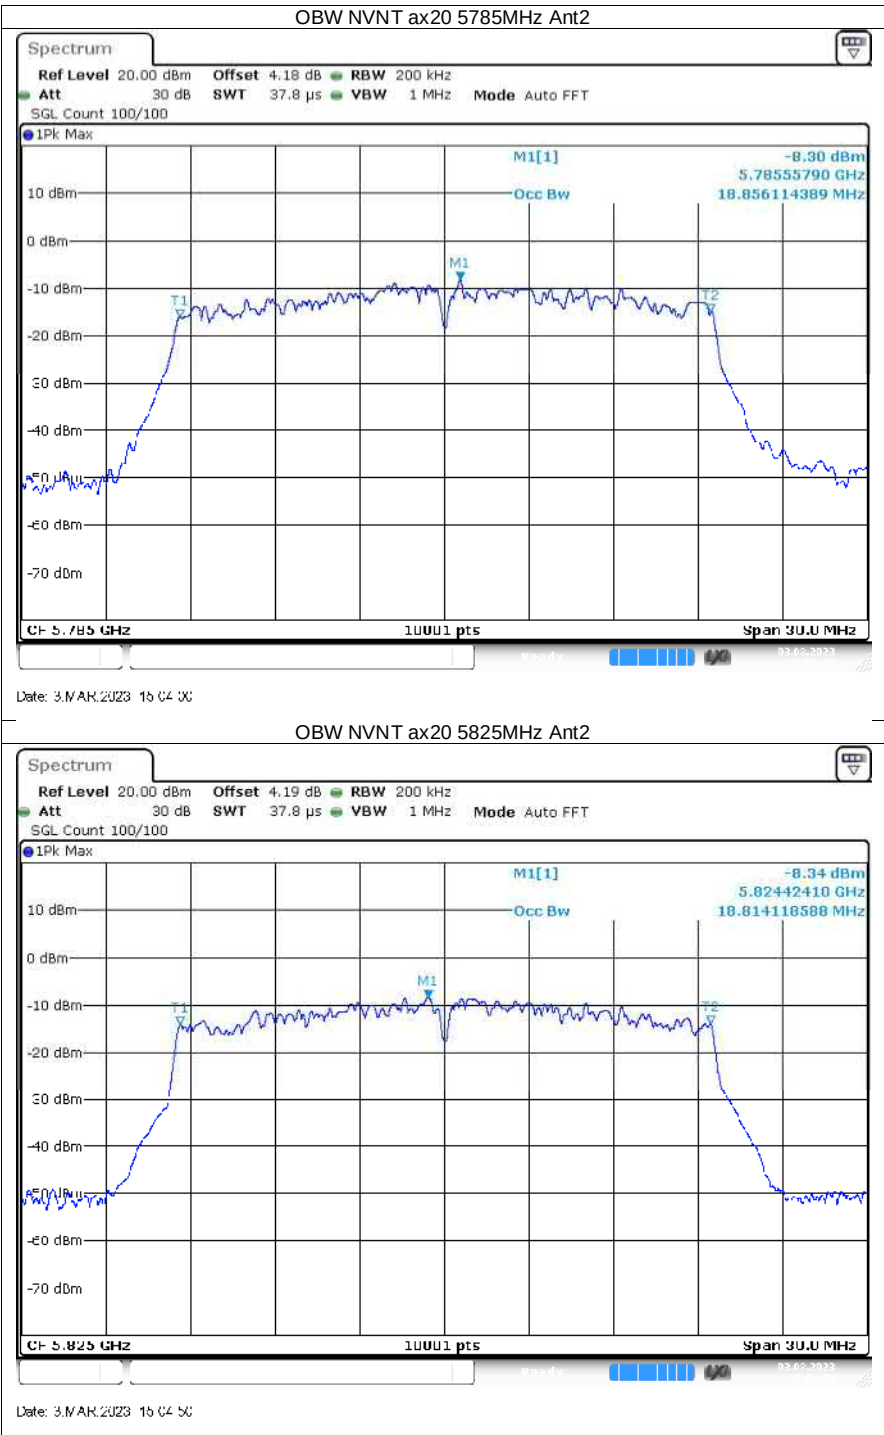


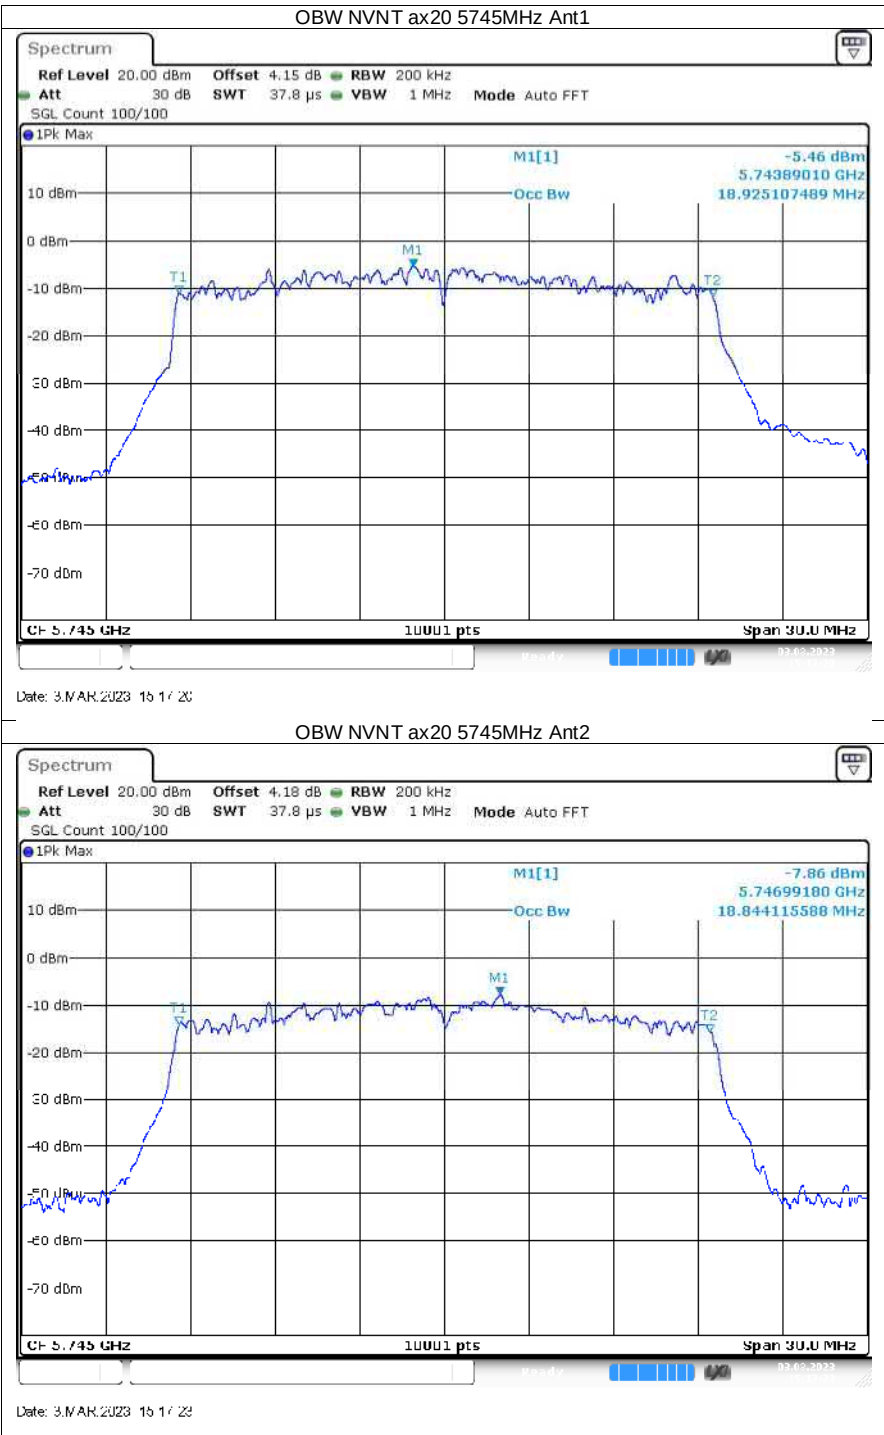


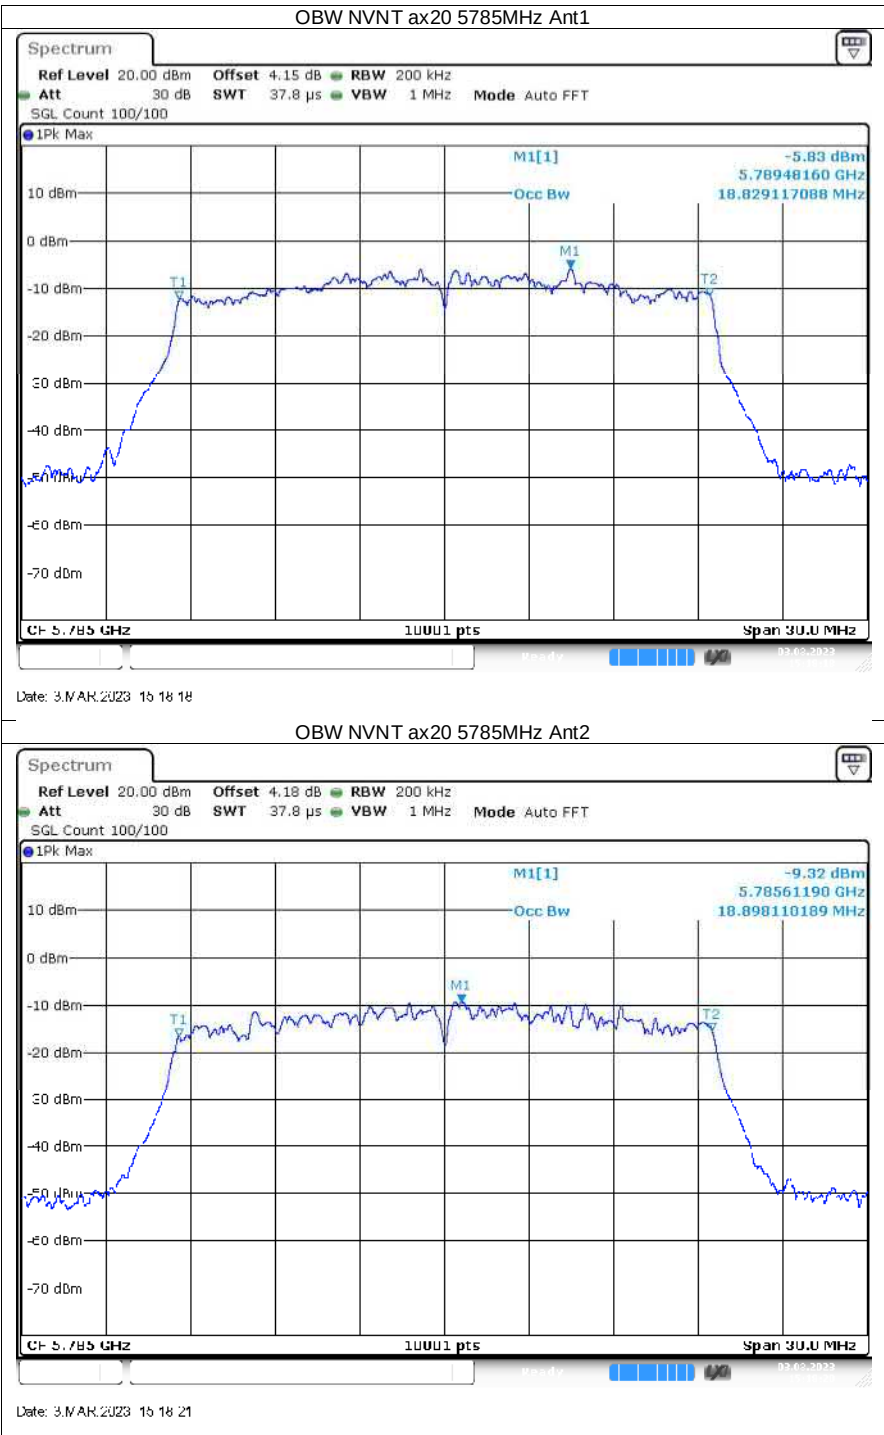






China

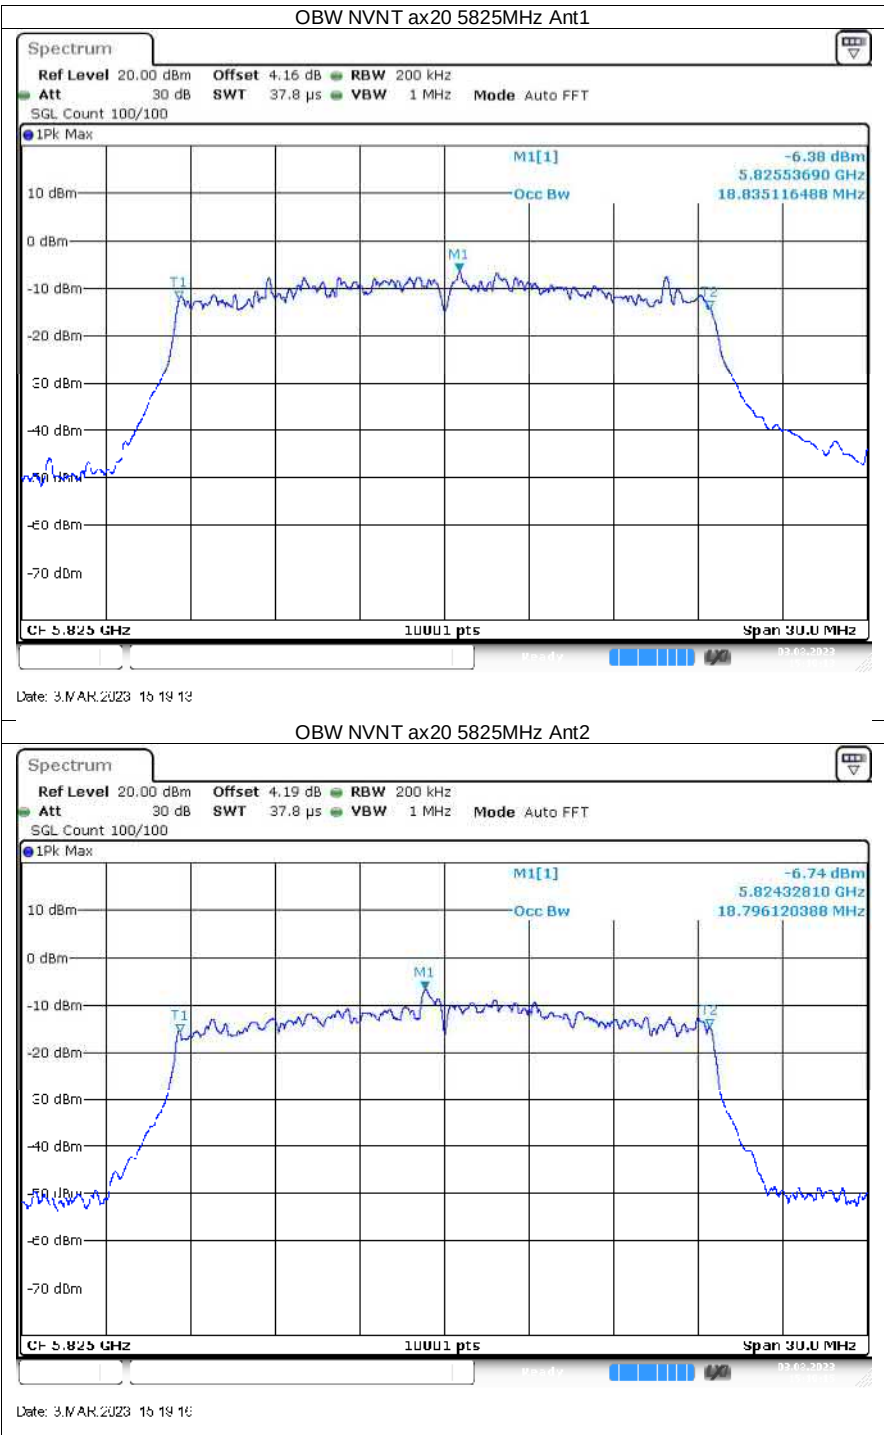

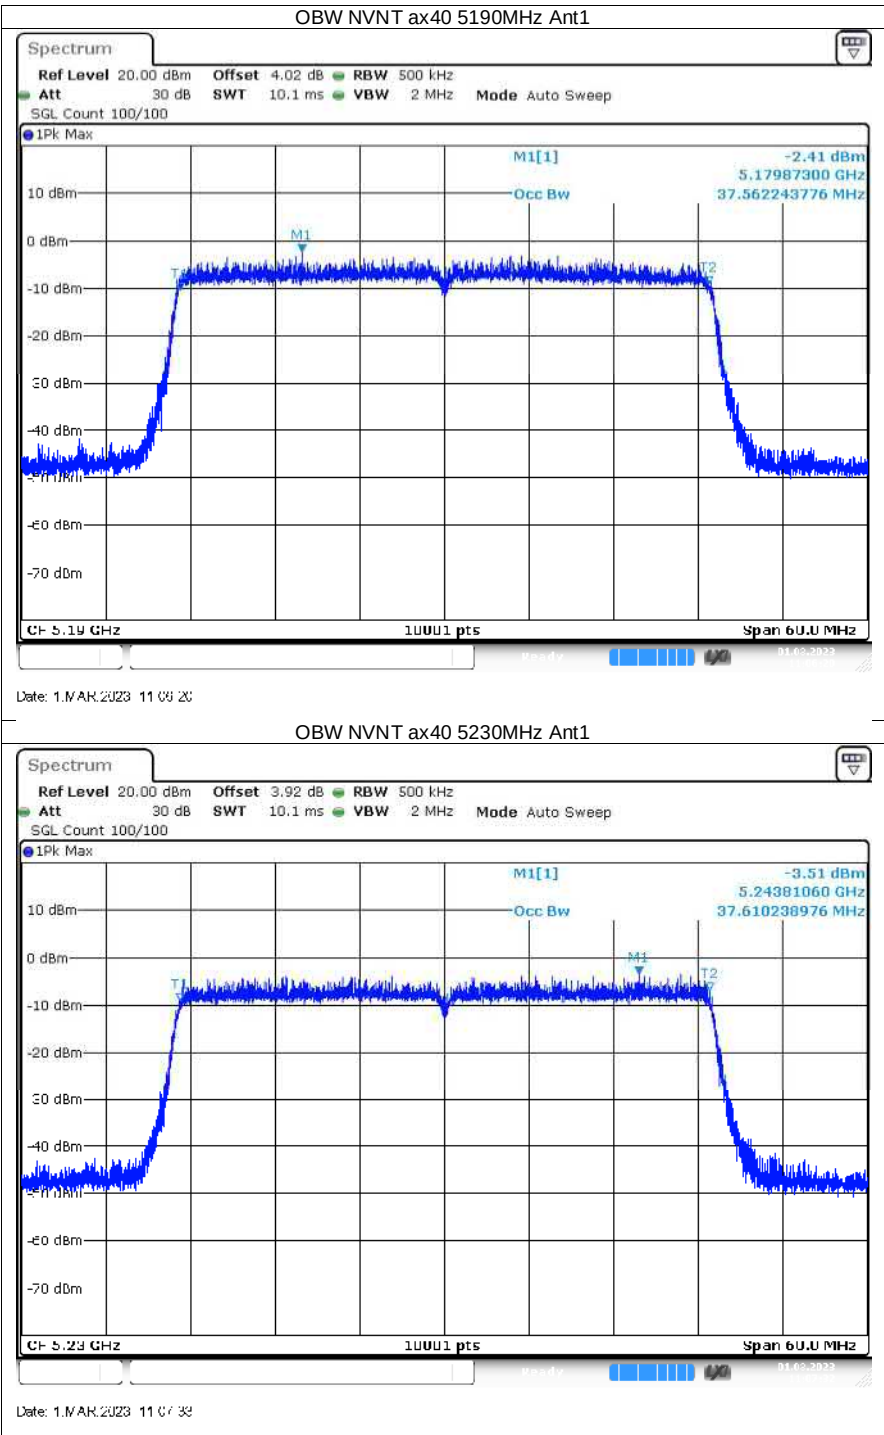

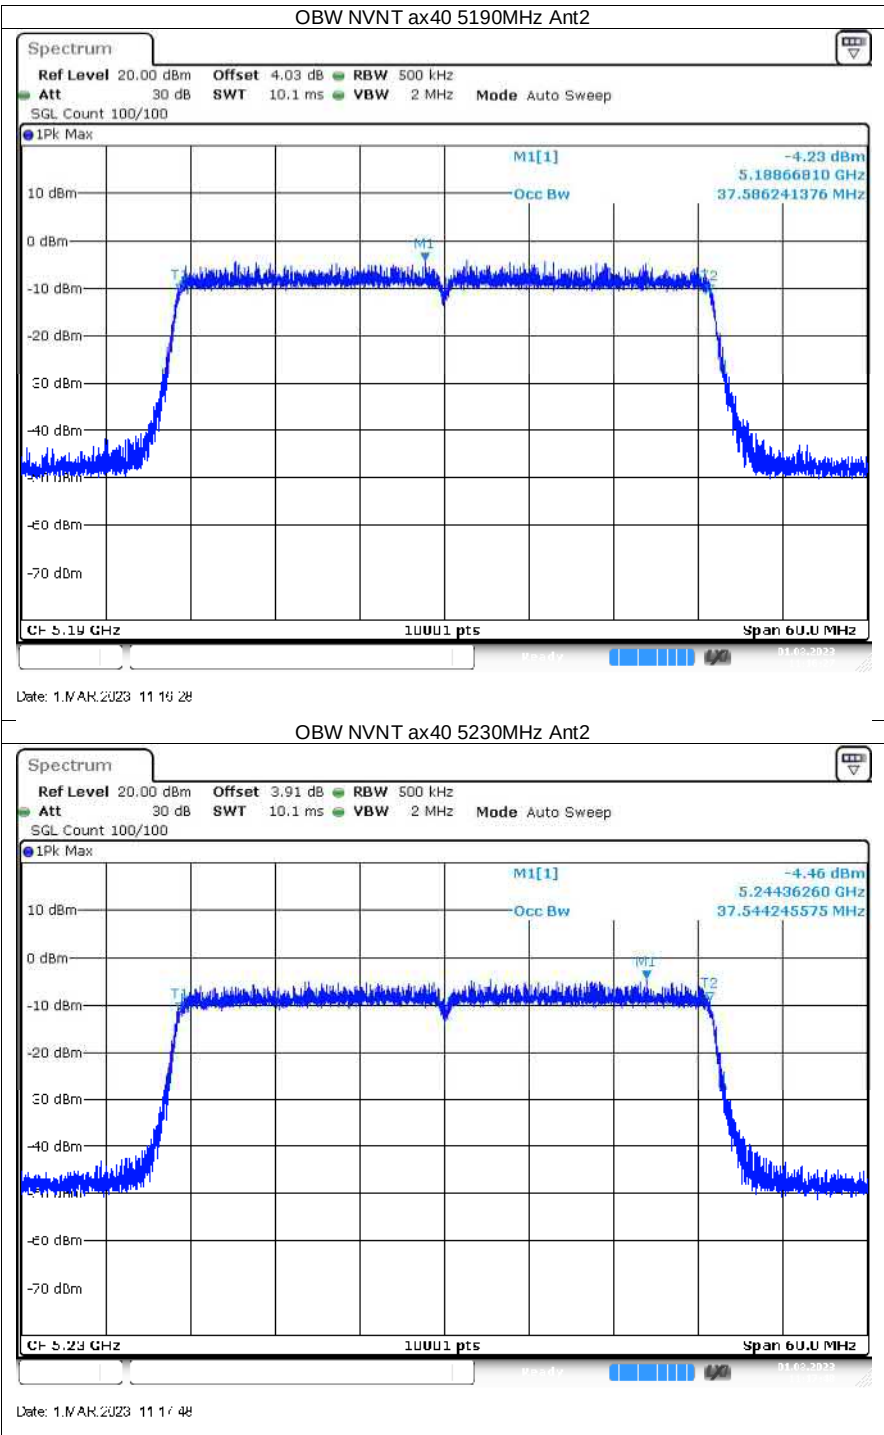


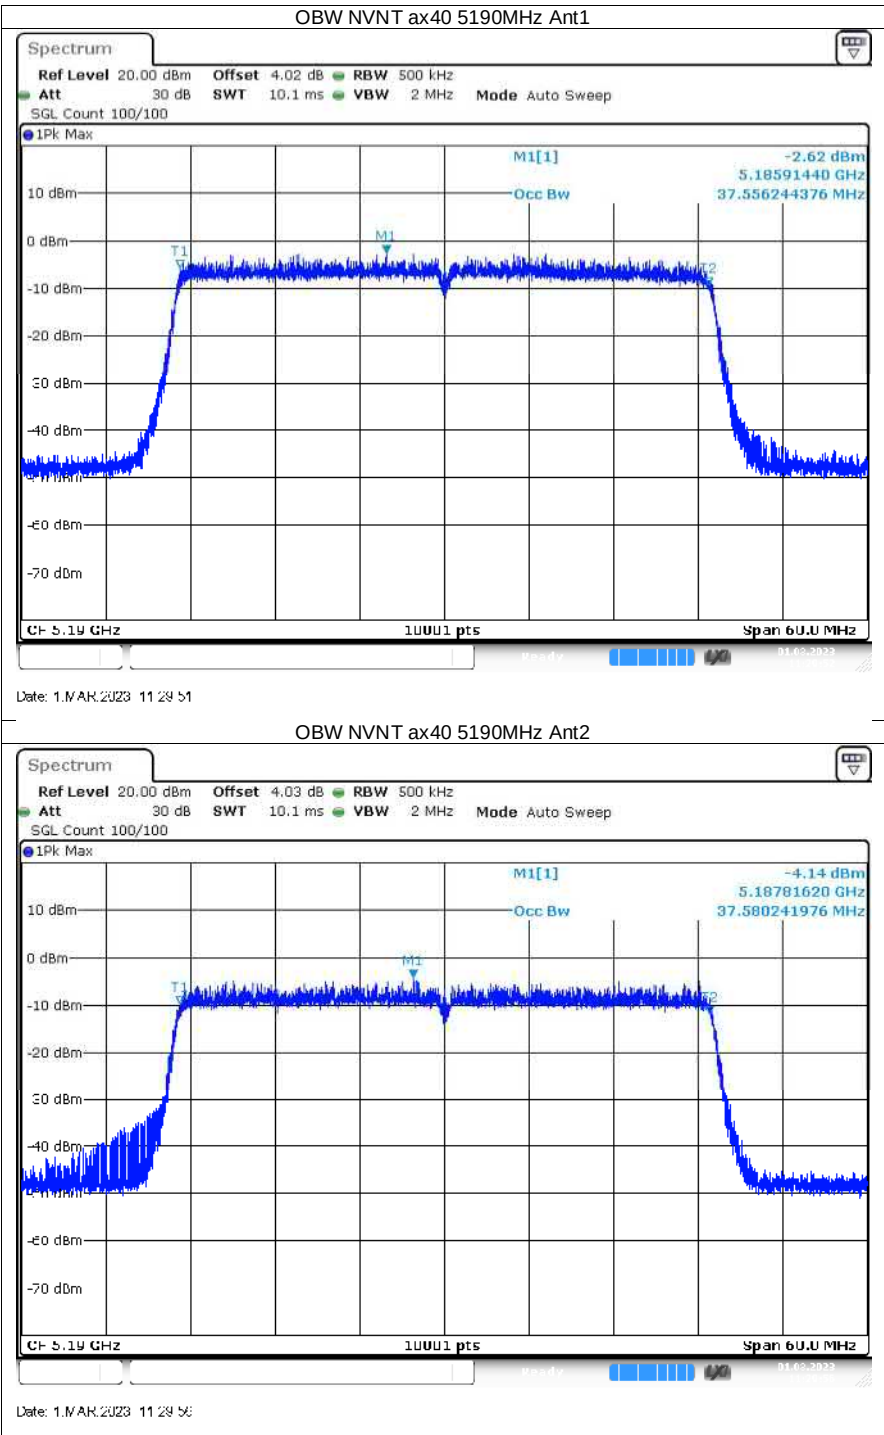


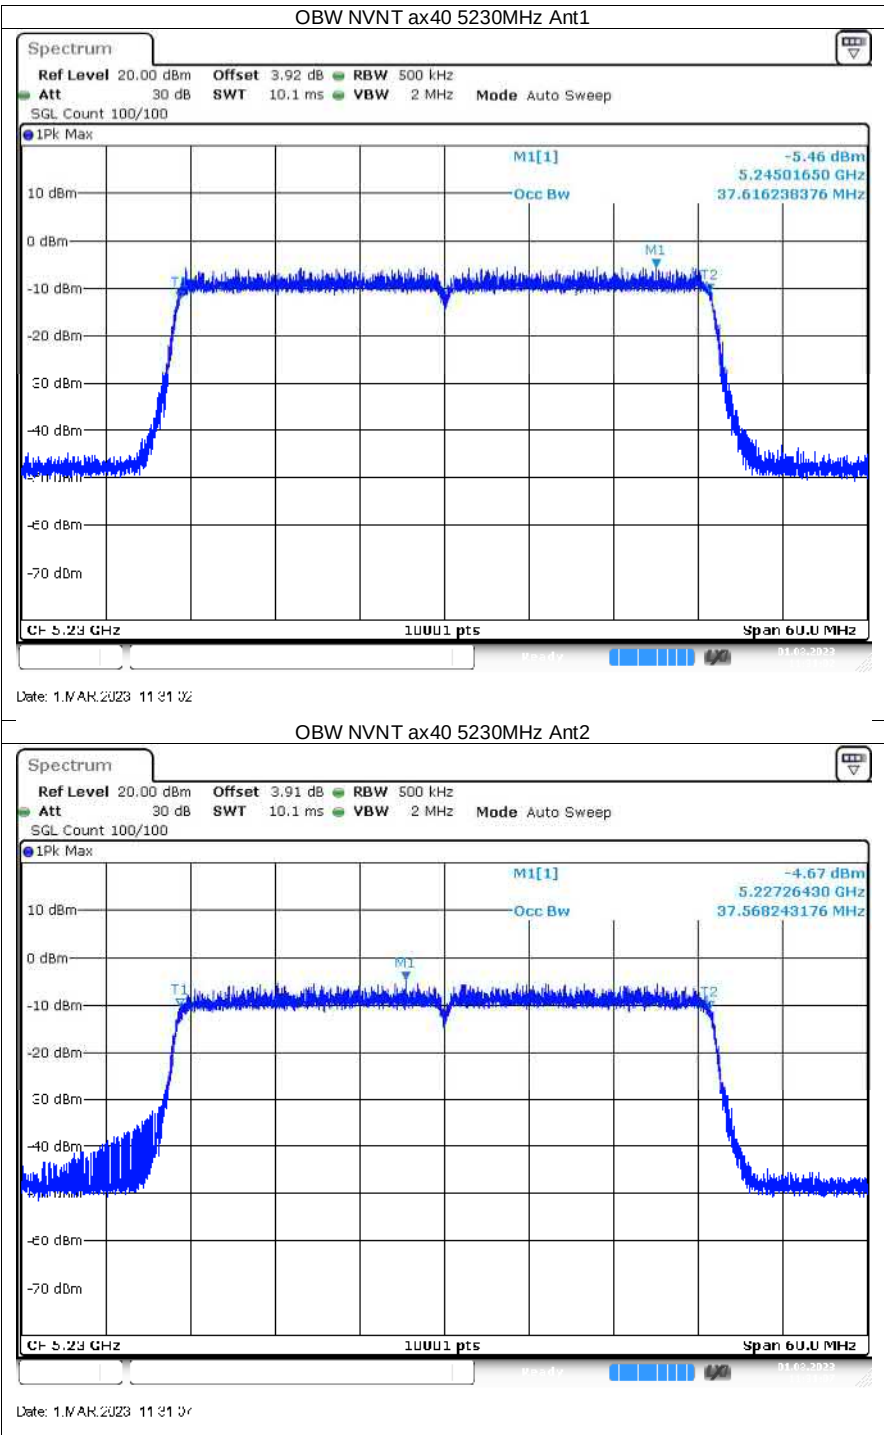






China

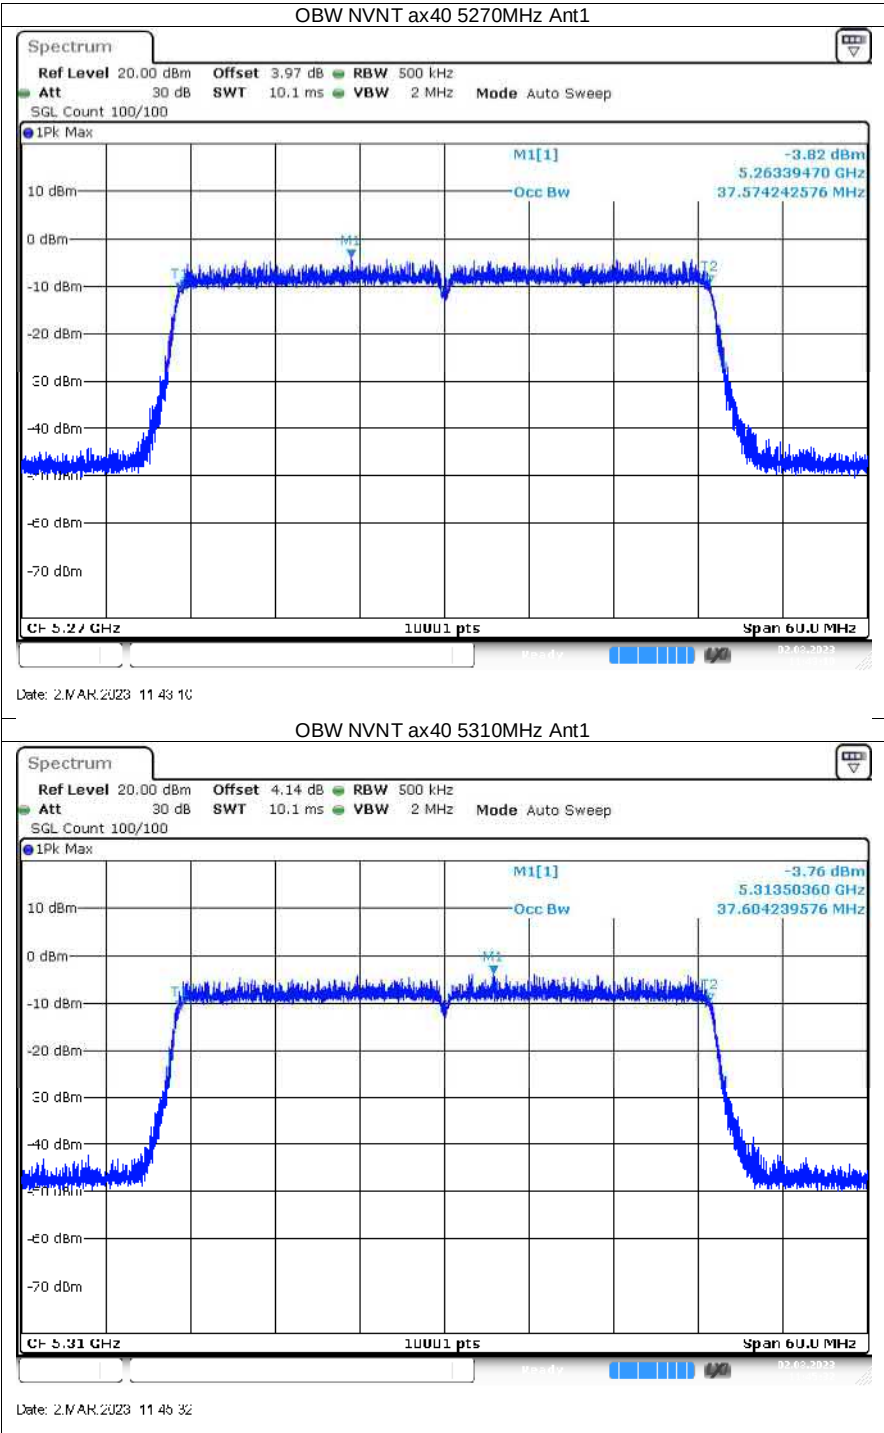


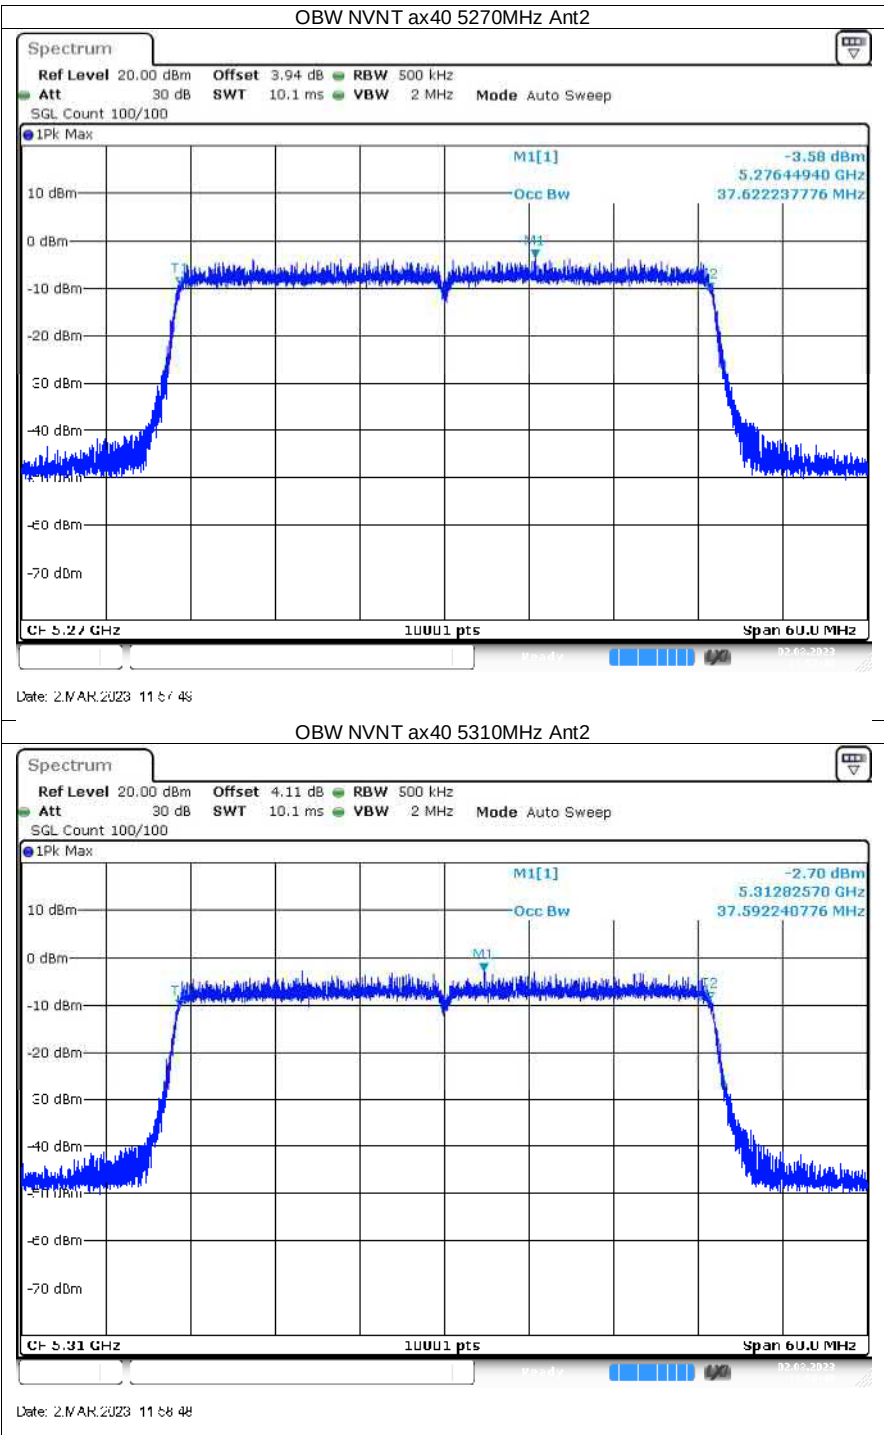


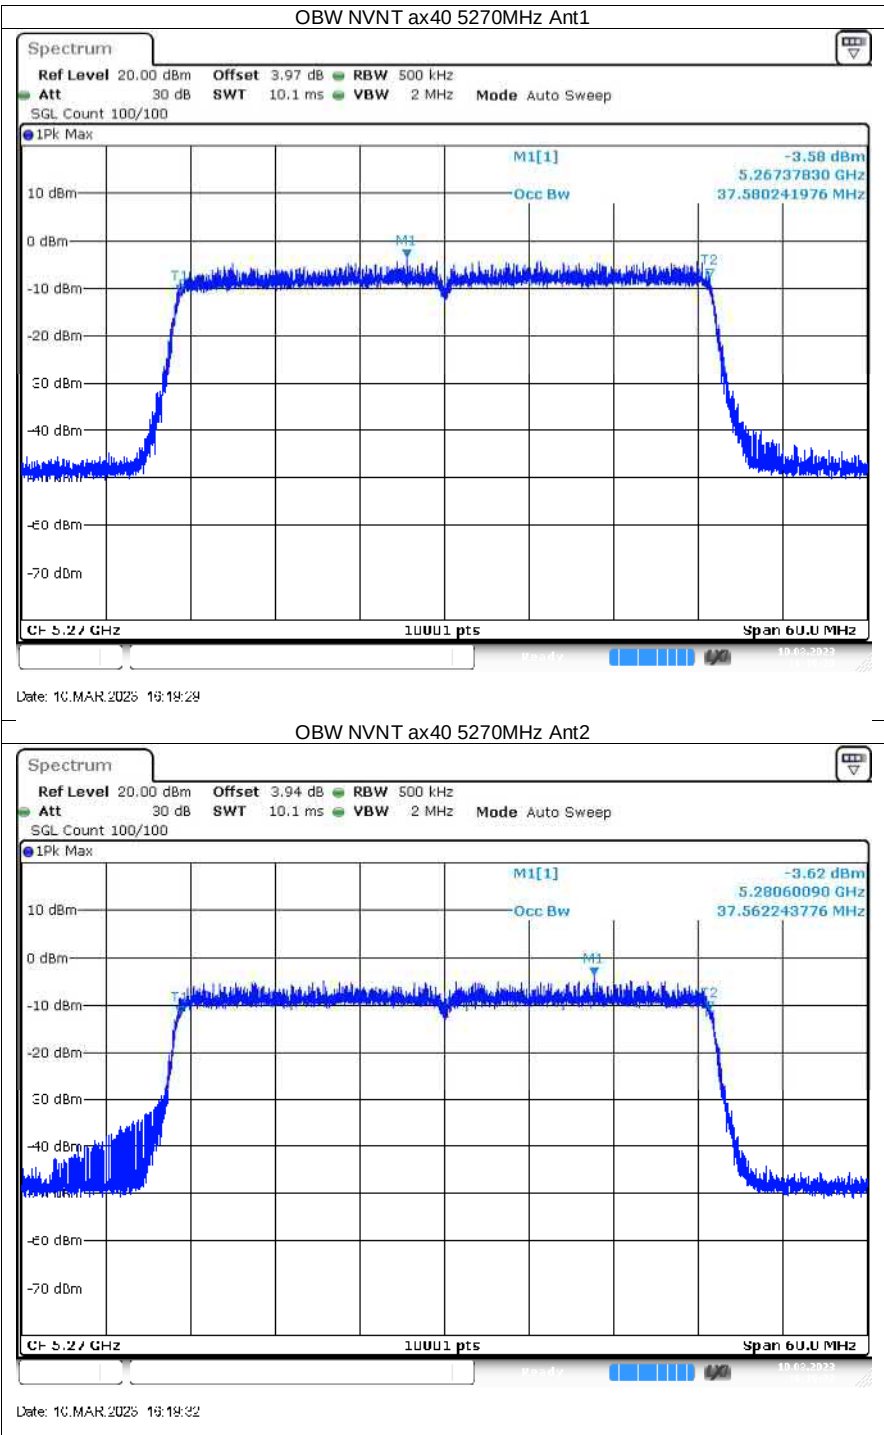


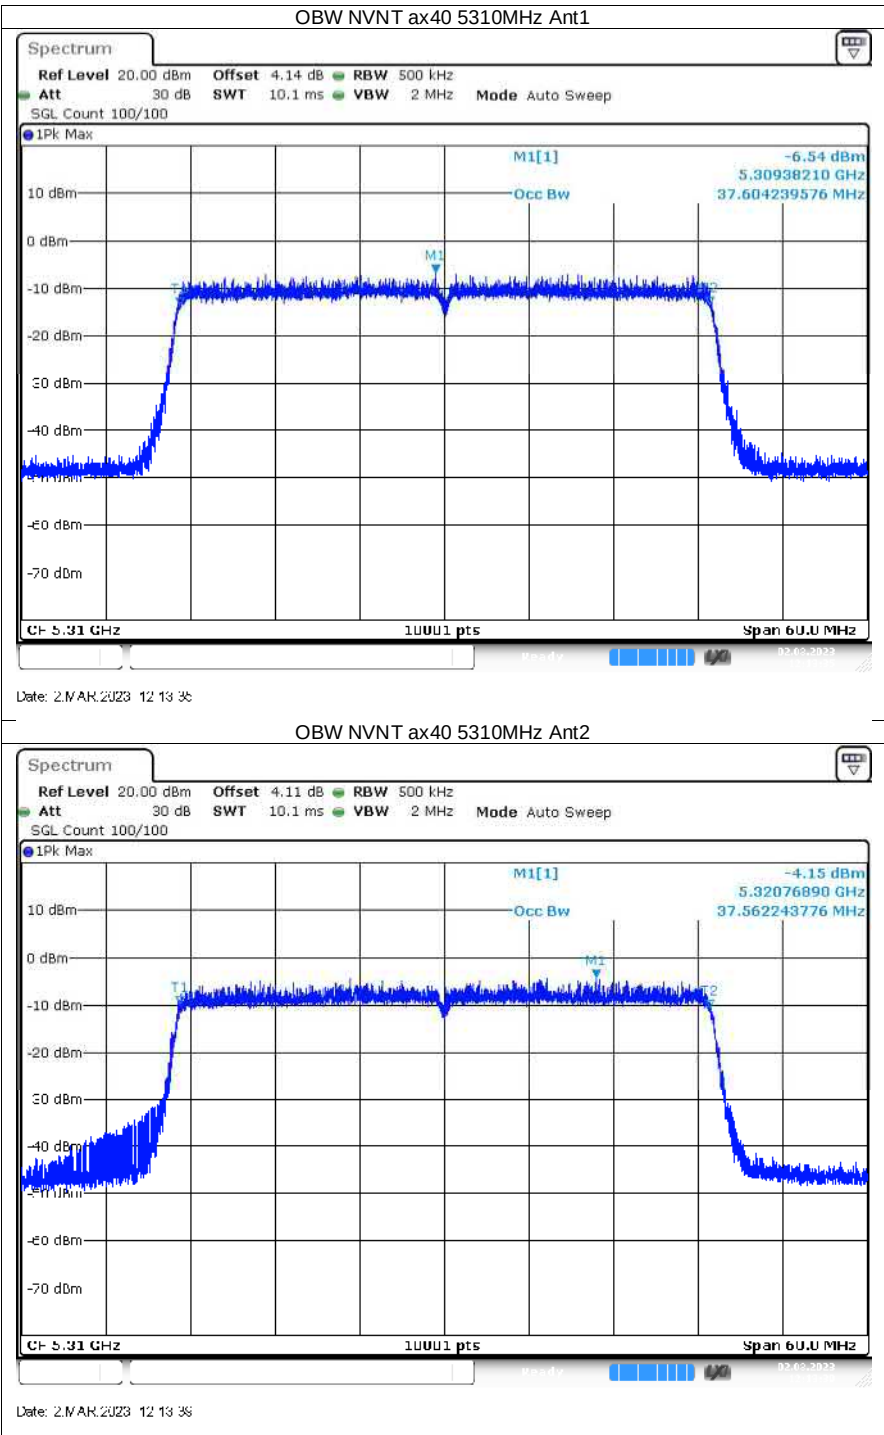


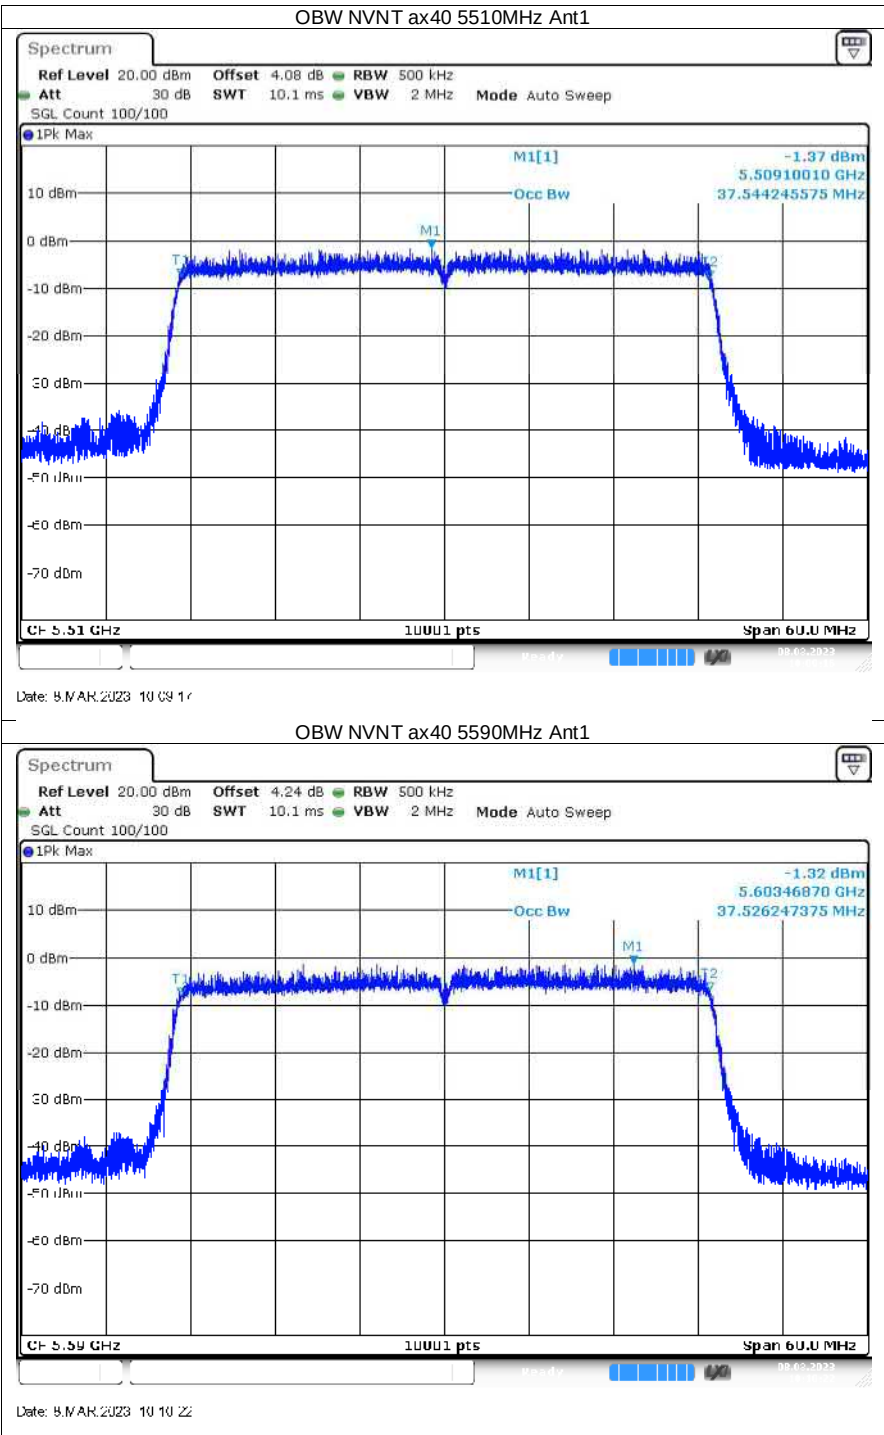


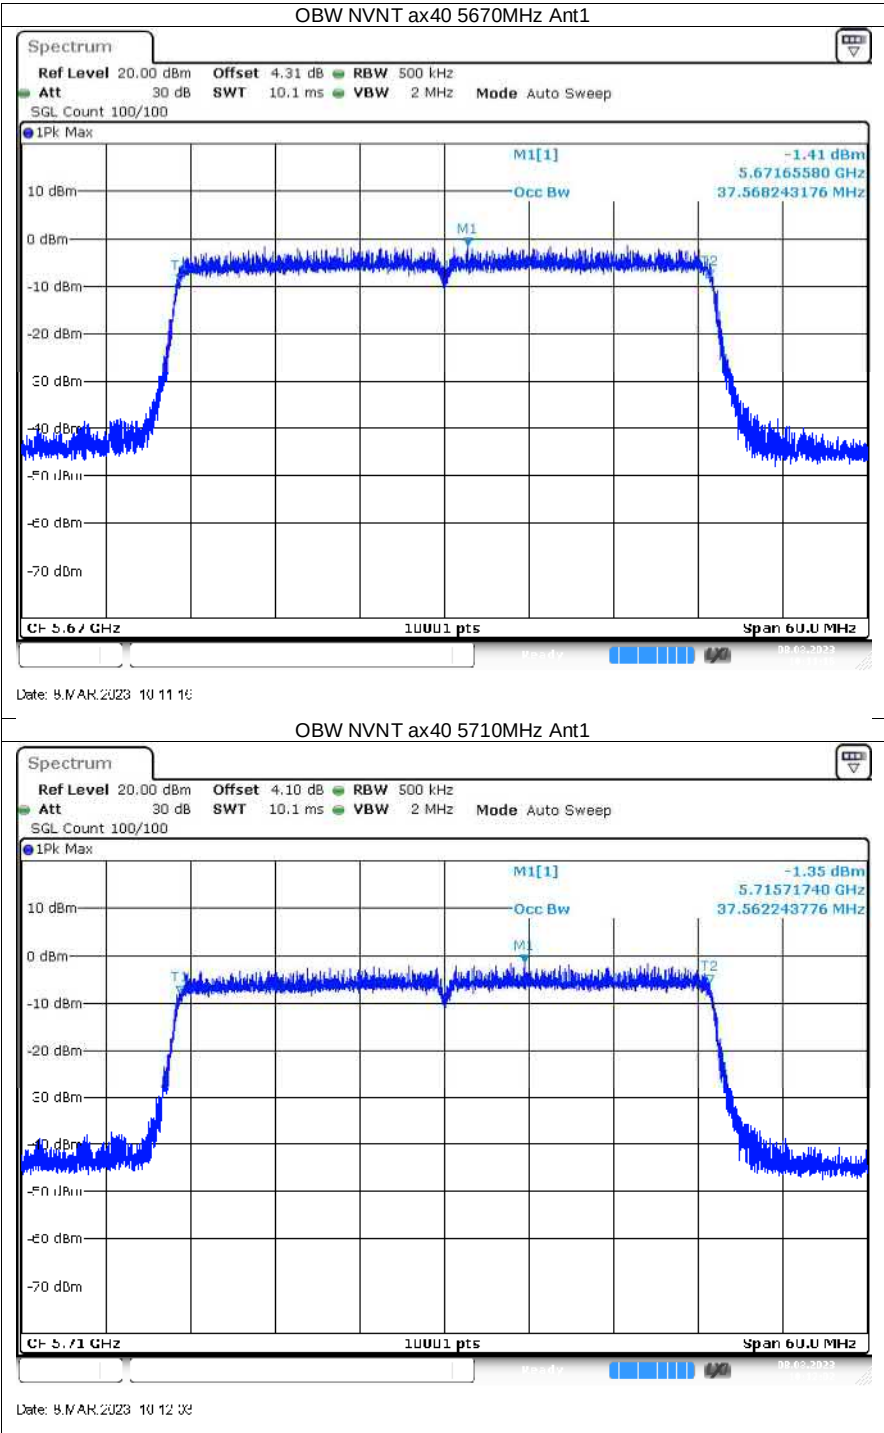


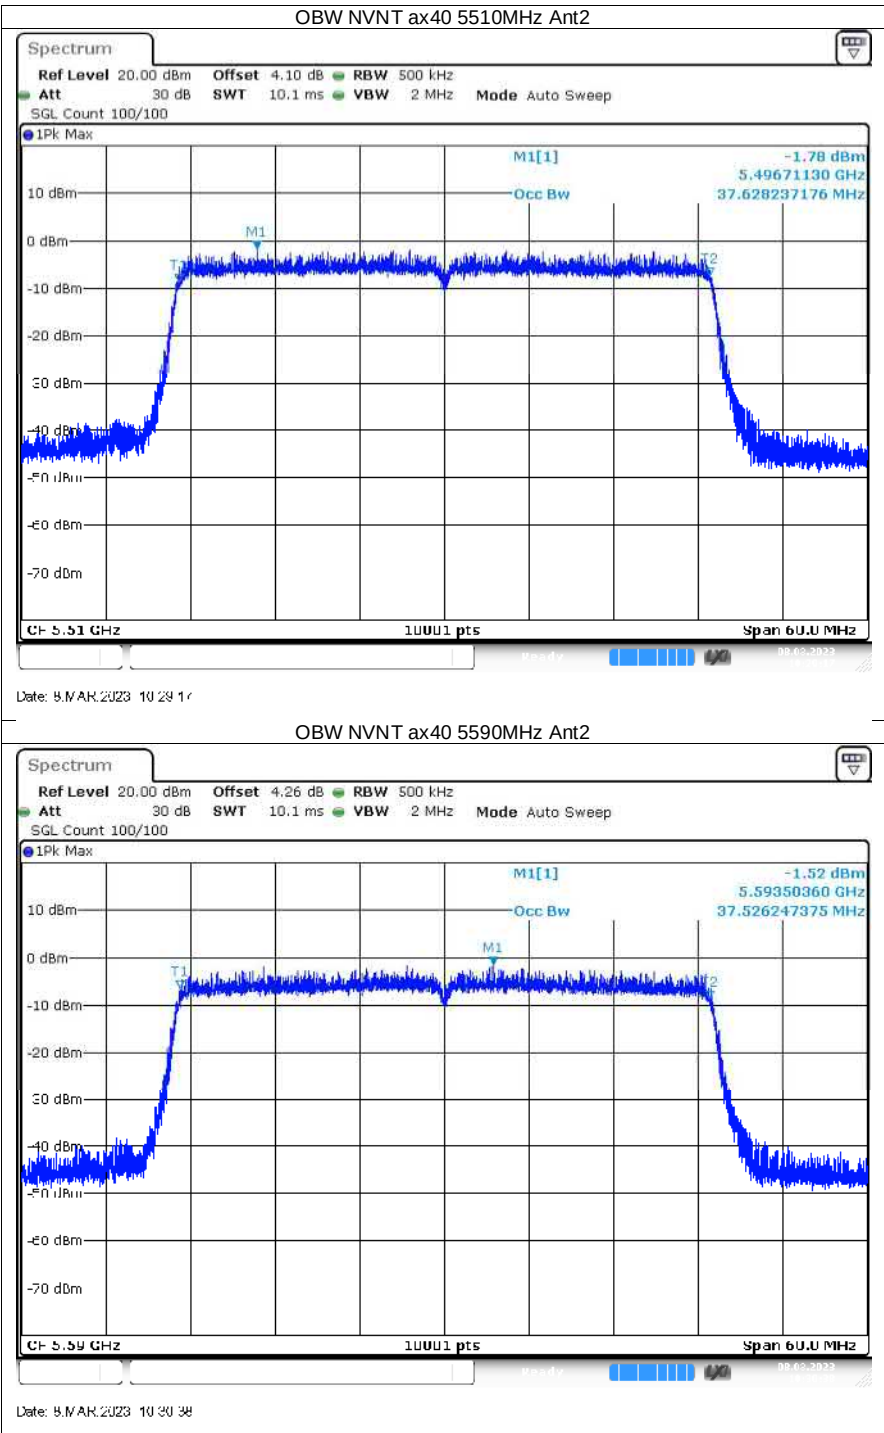


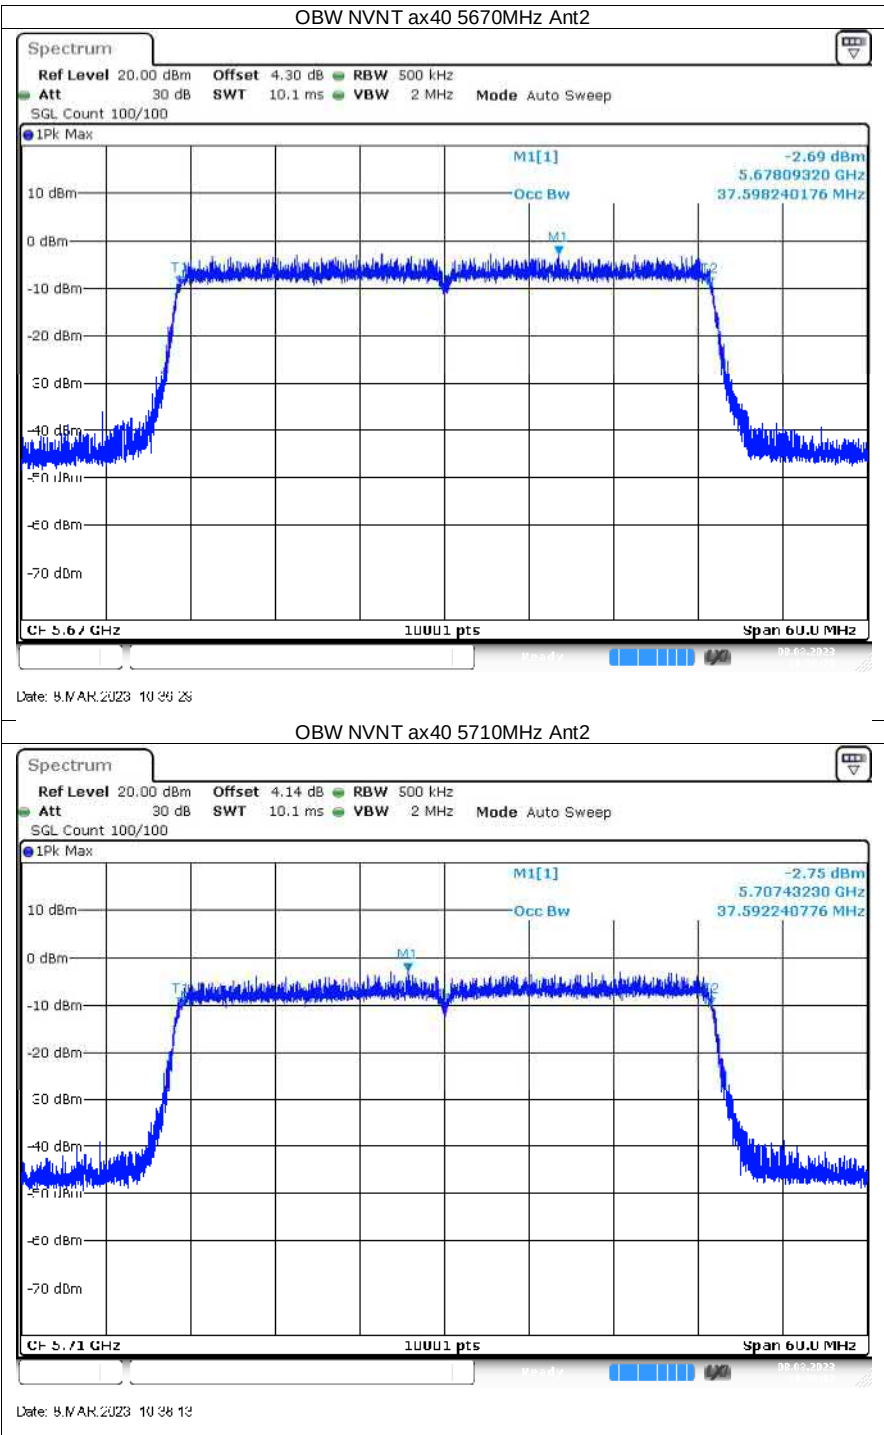


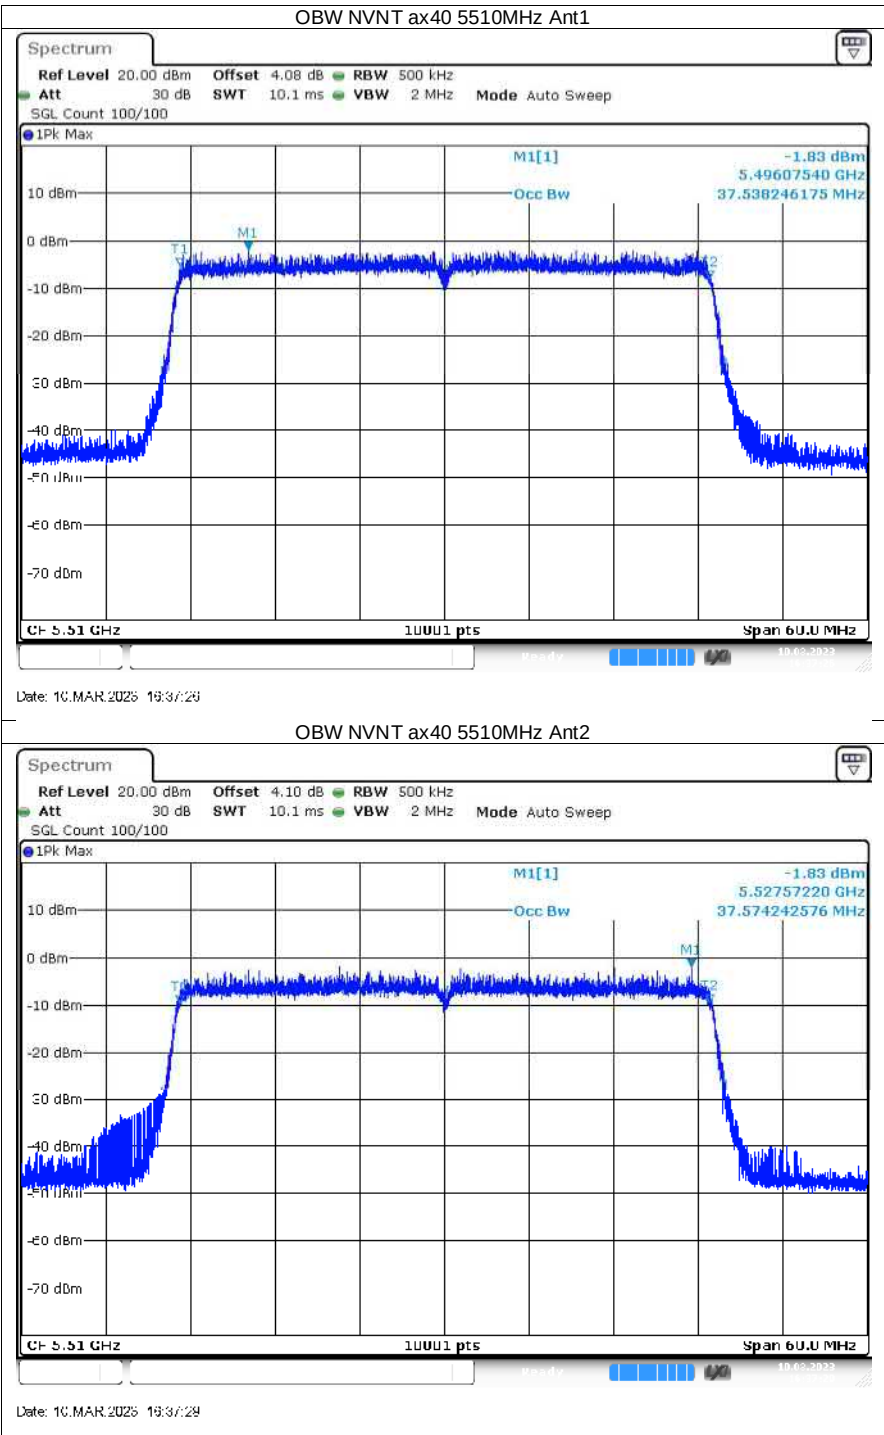


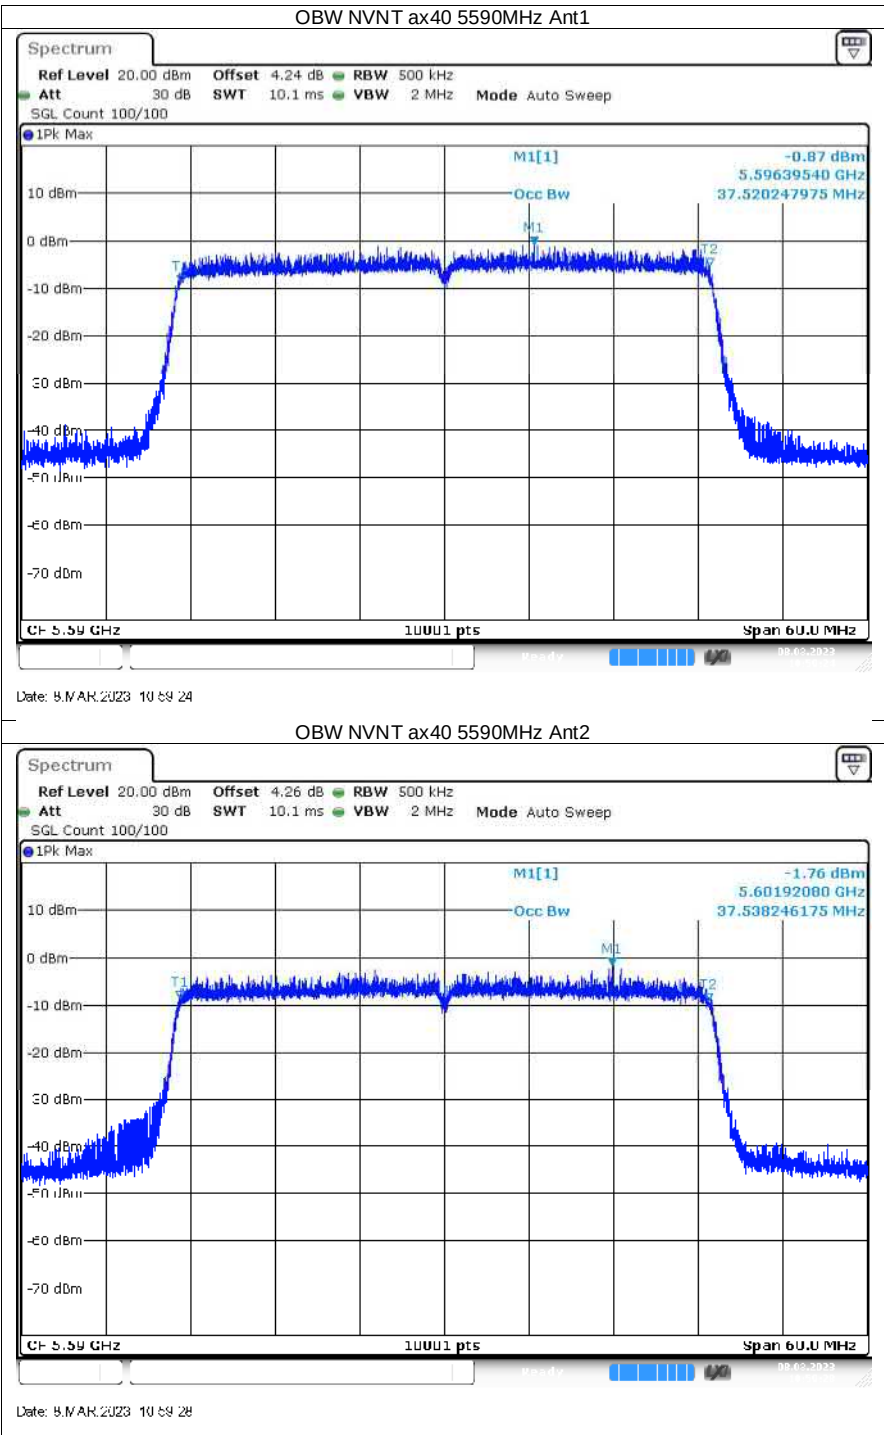


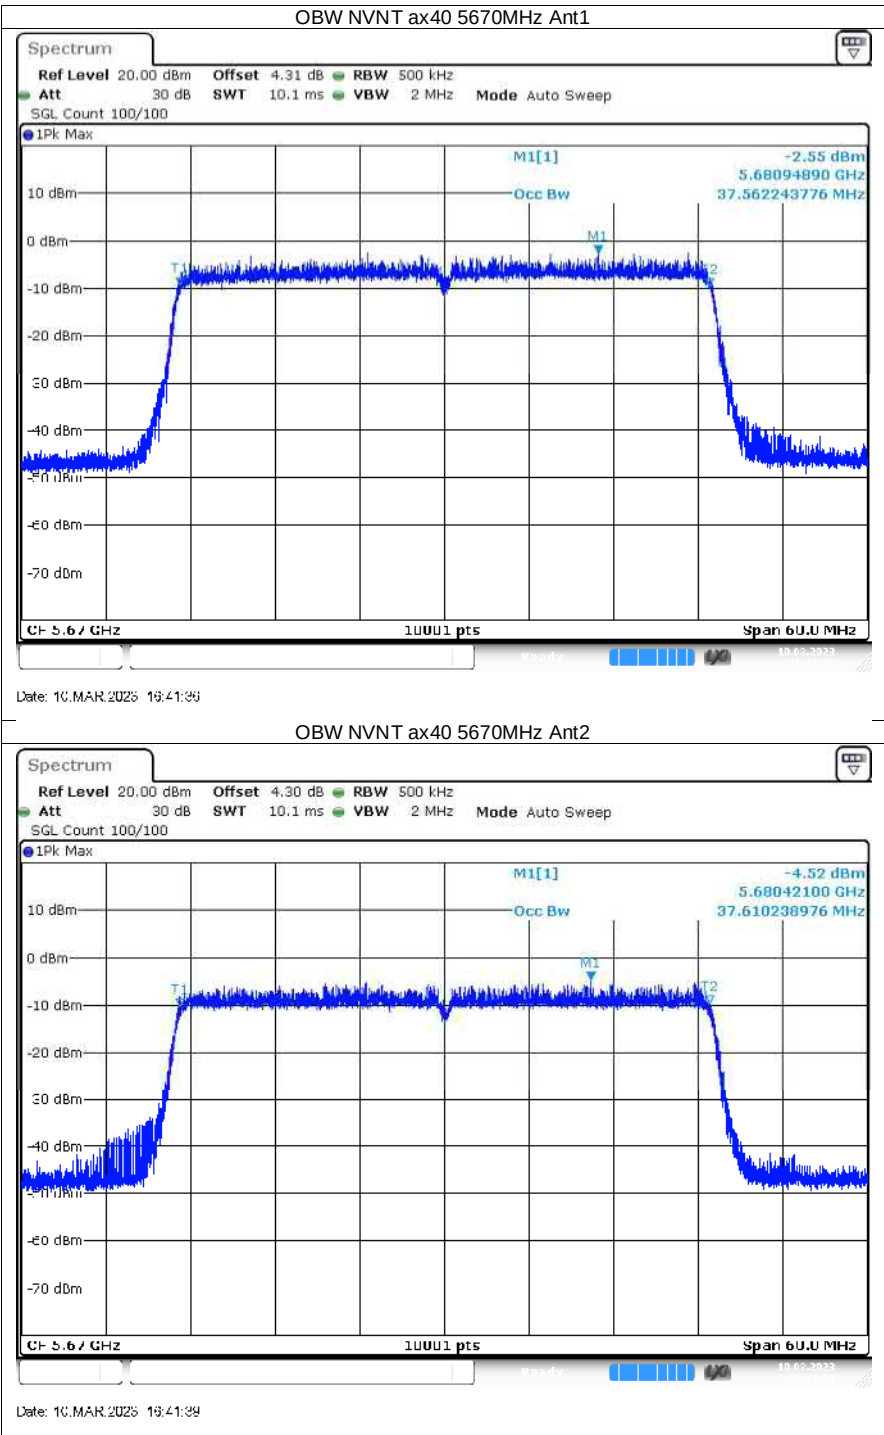


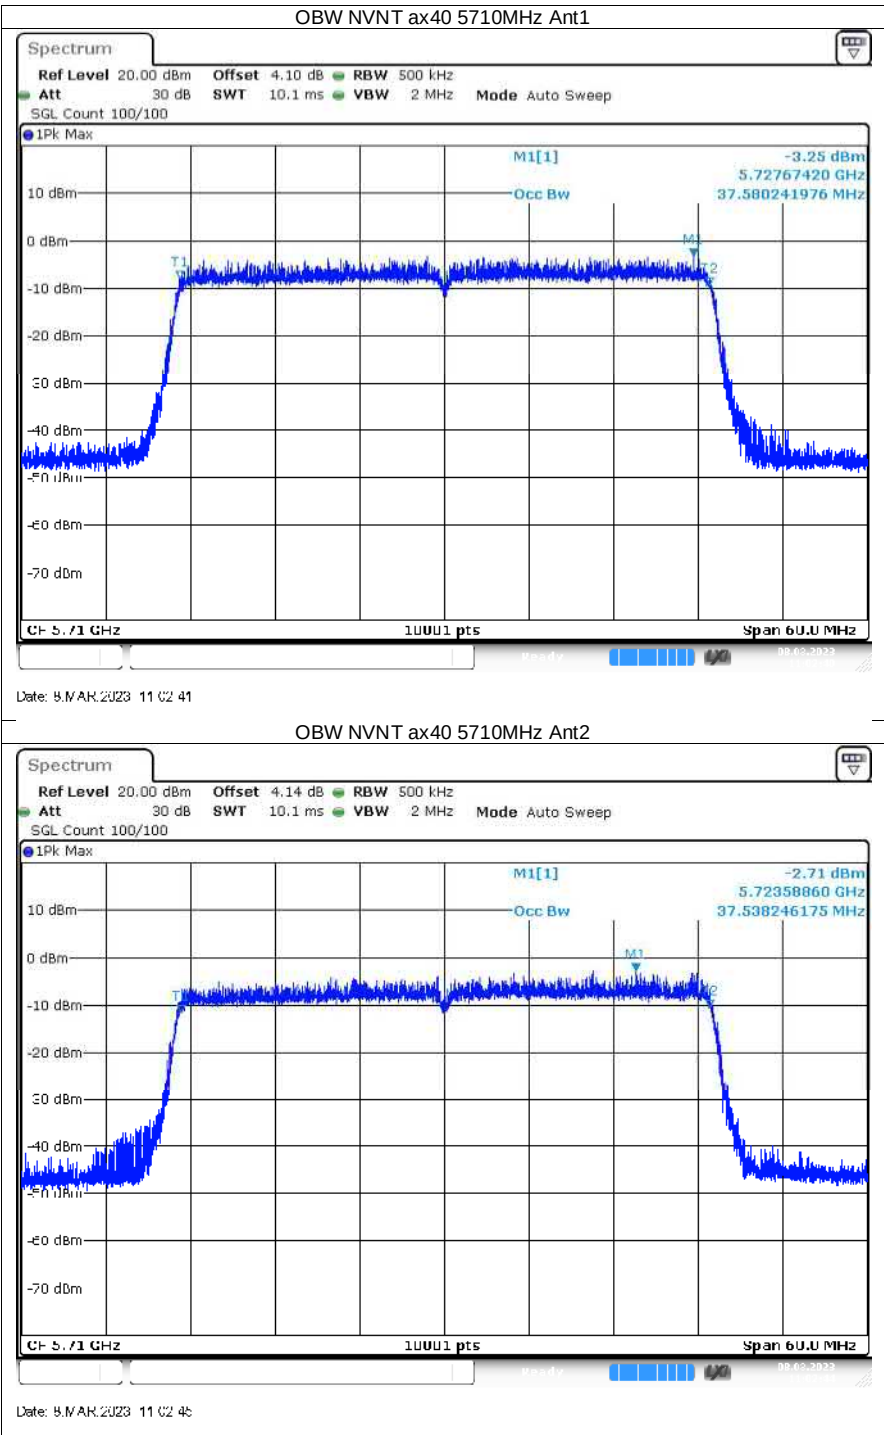


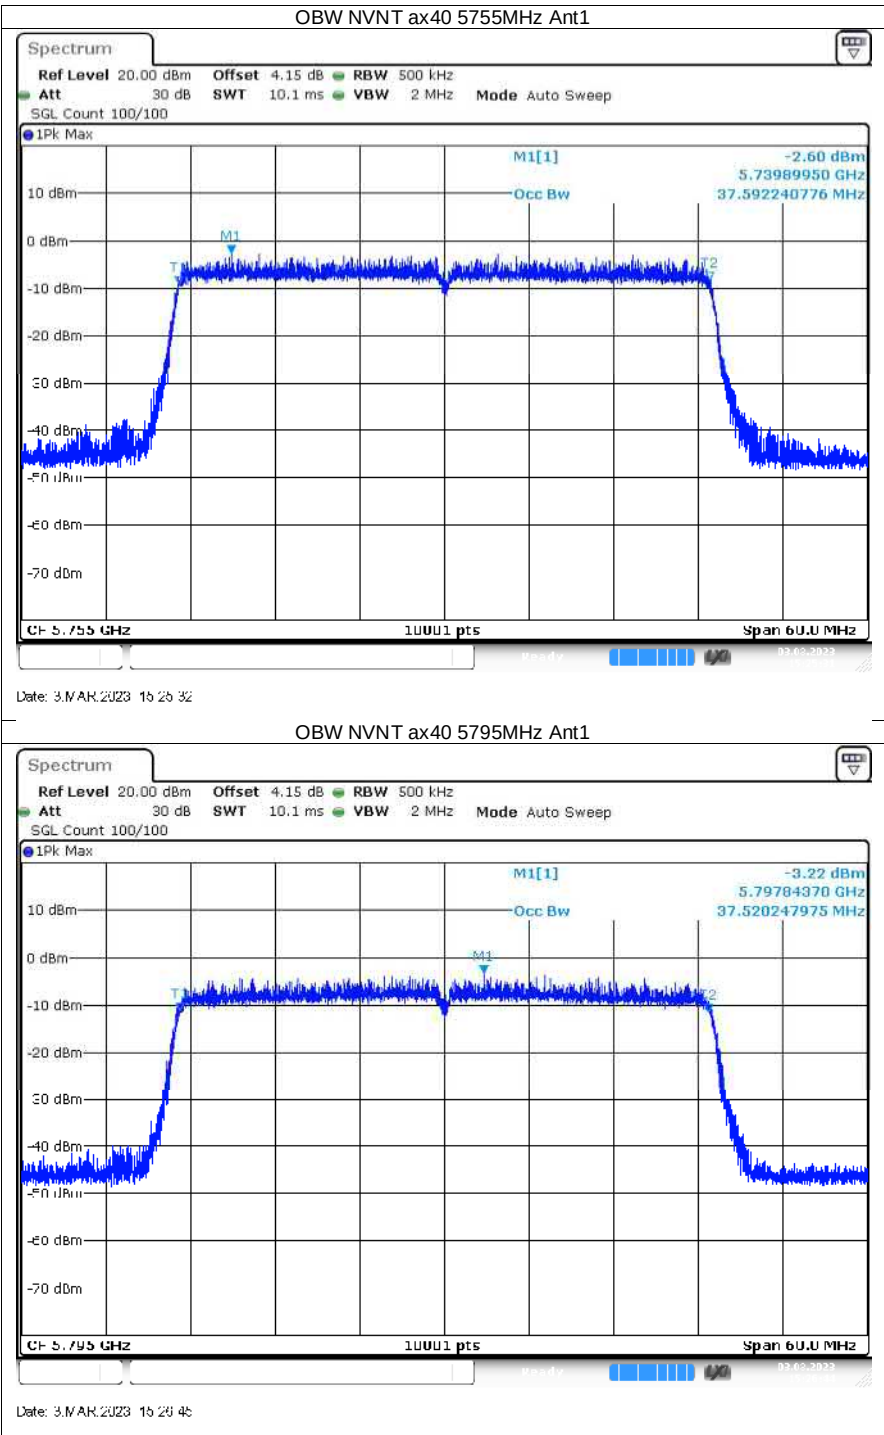


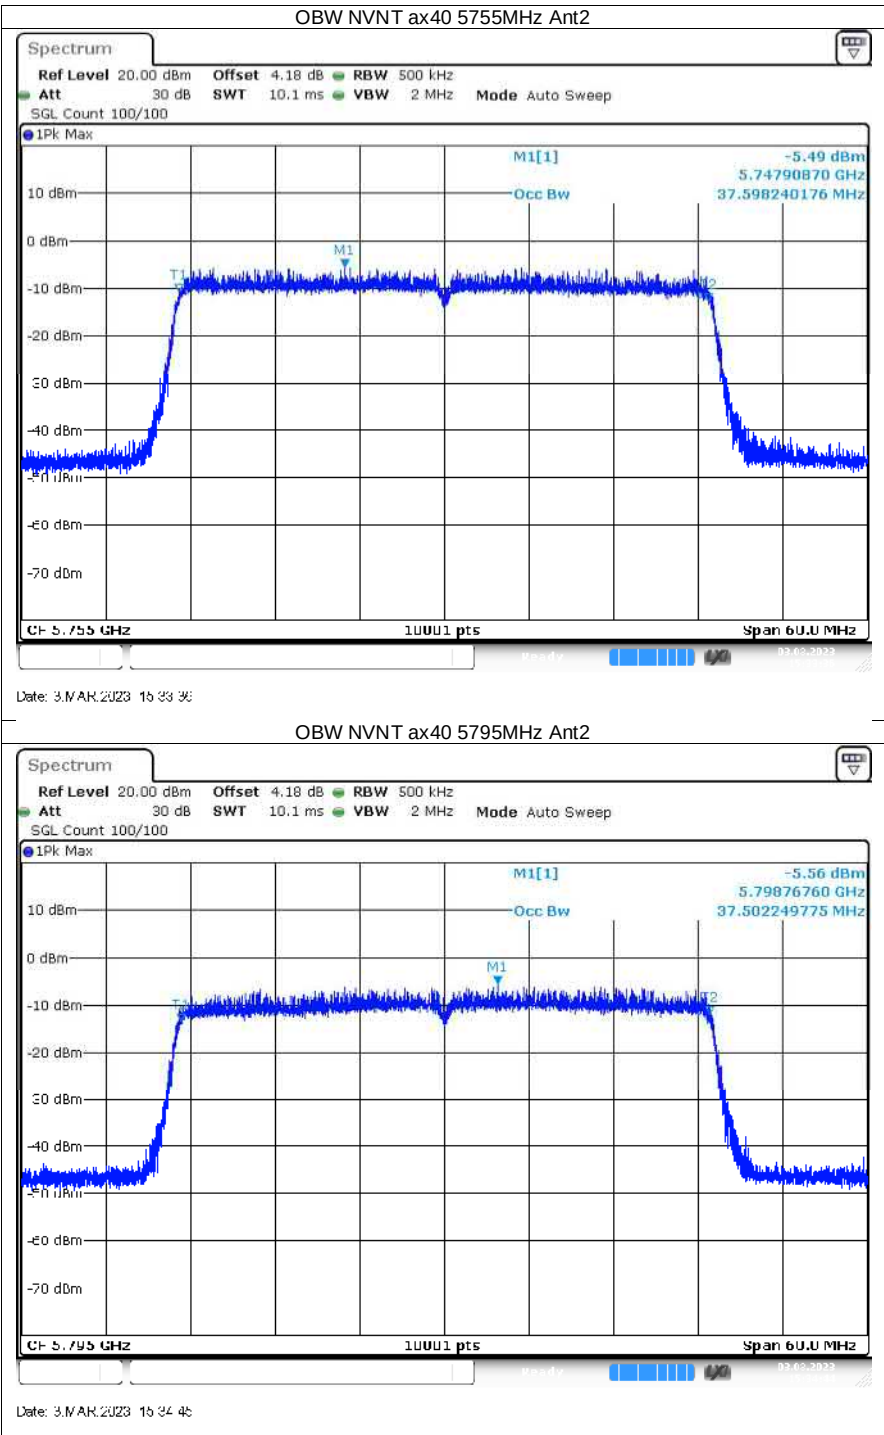

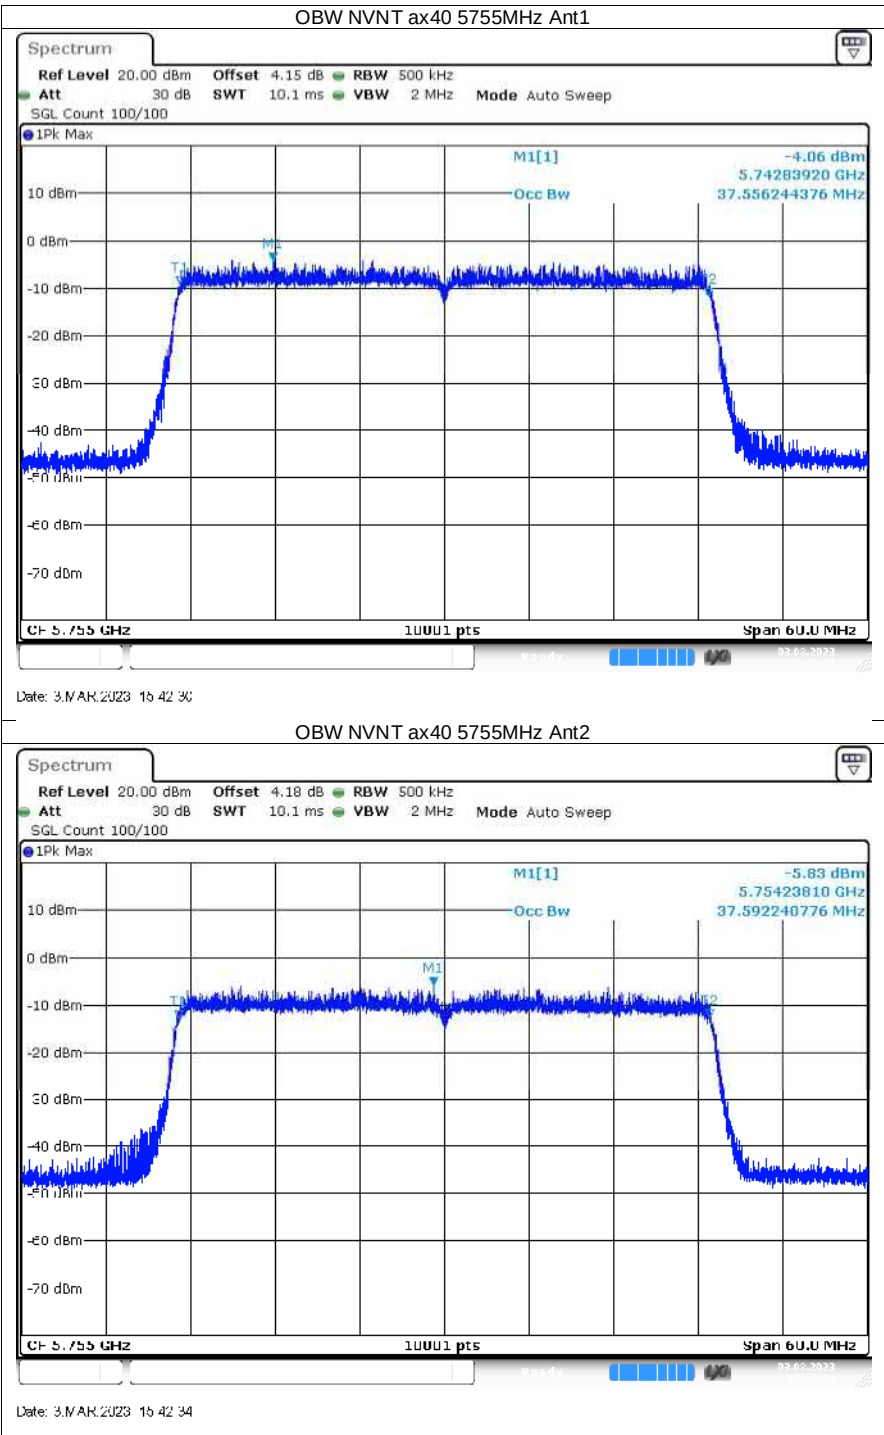

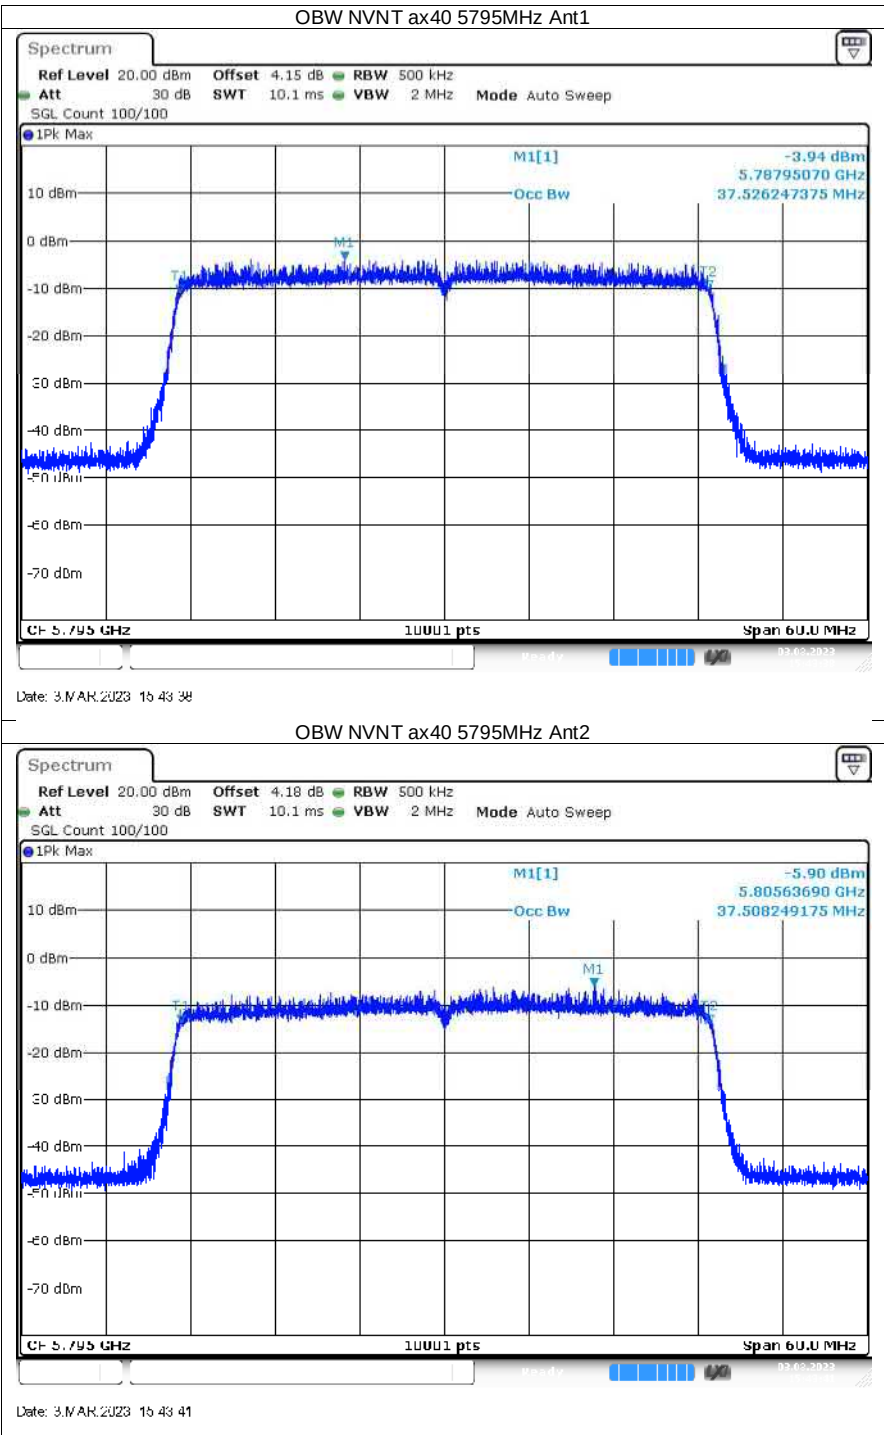


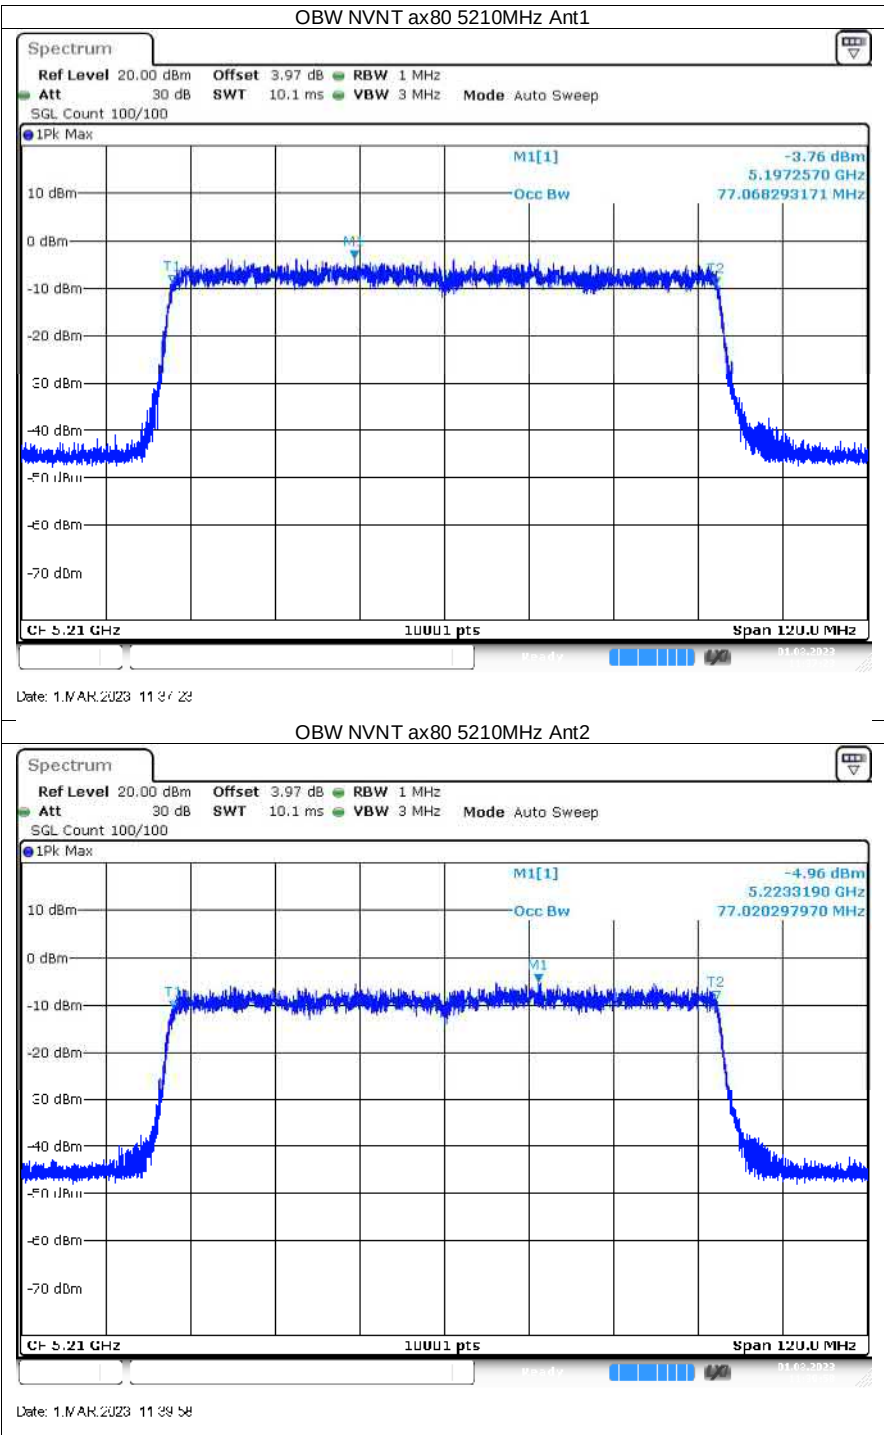

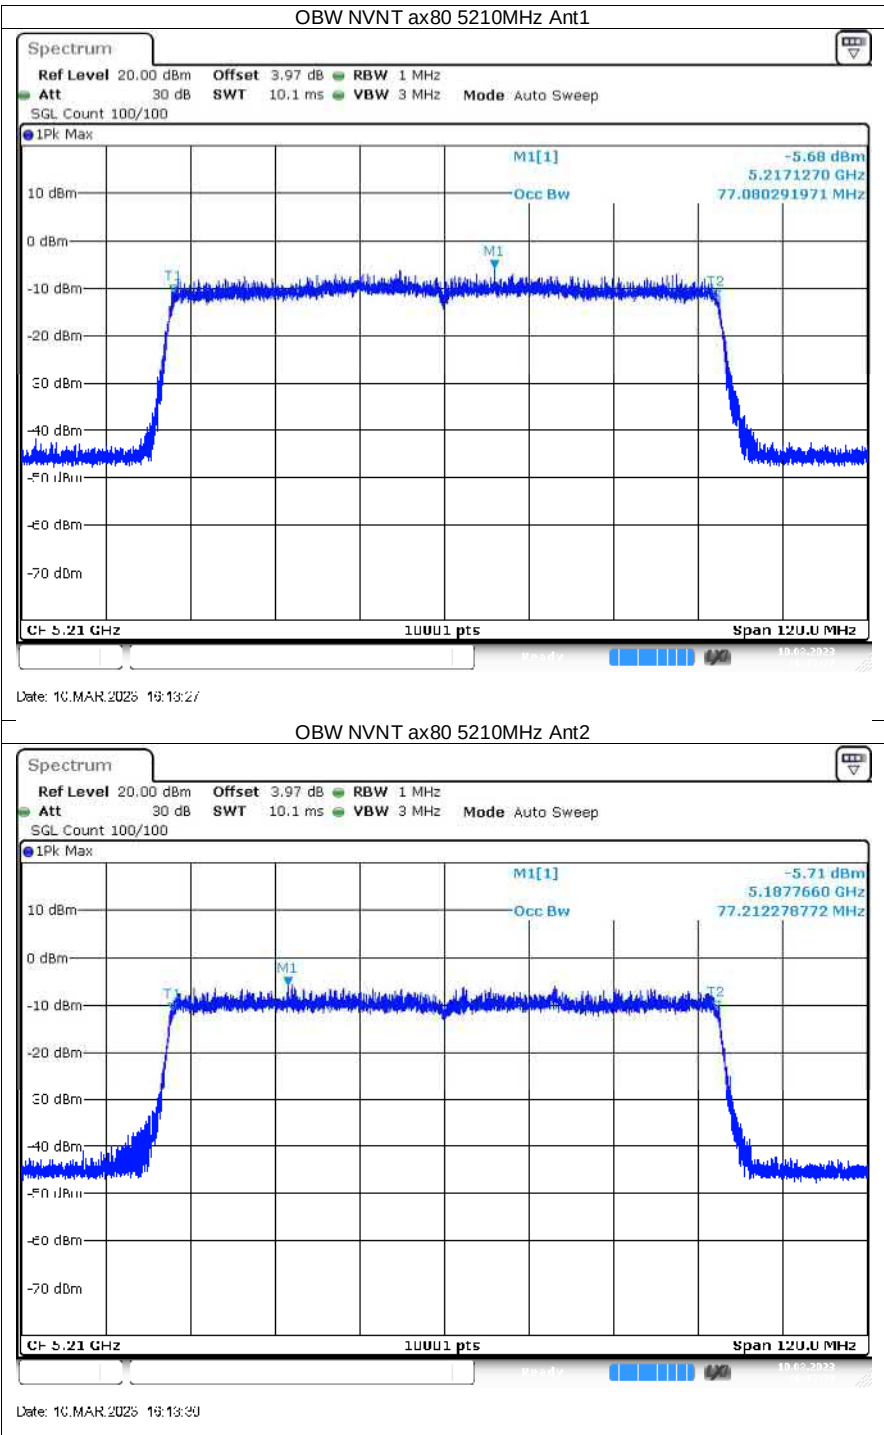




China

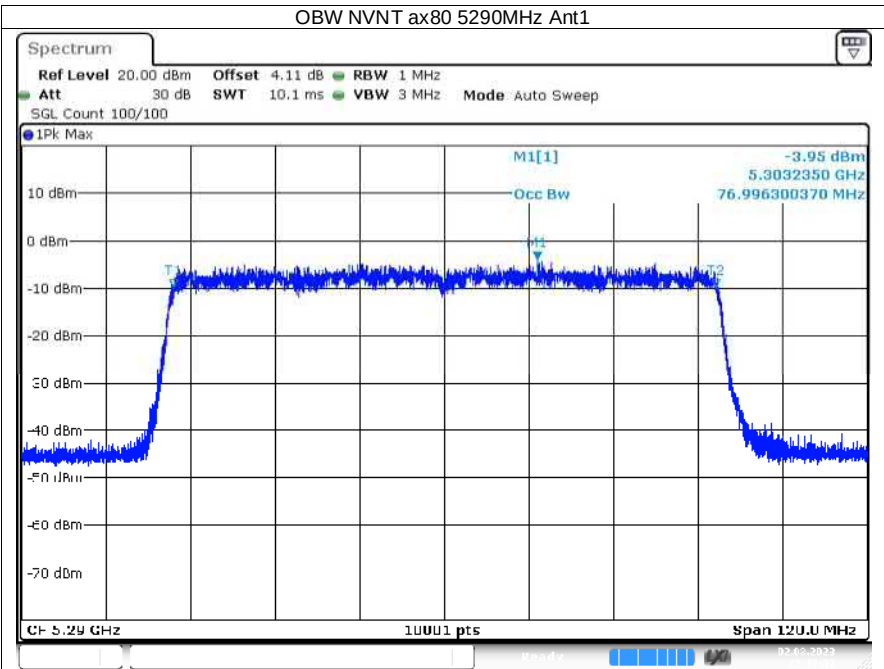


Date: 2/MAR/2023 12:17:32

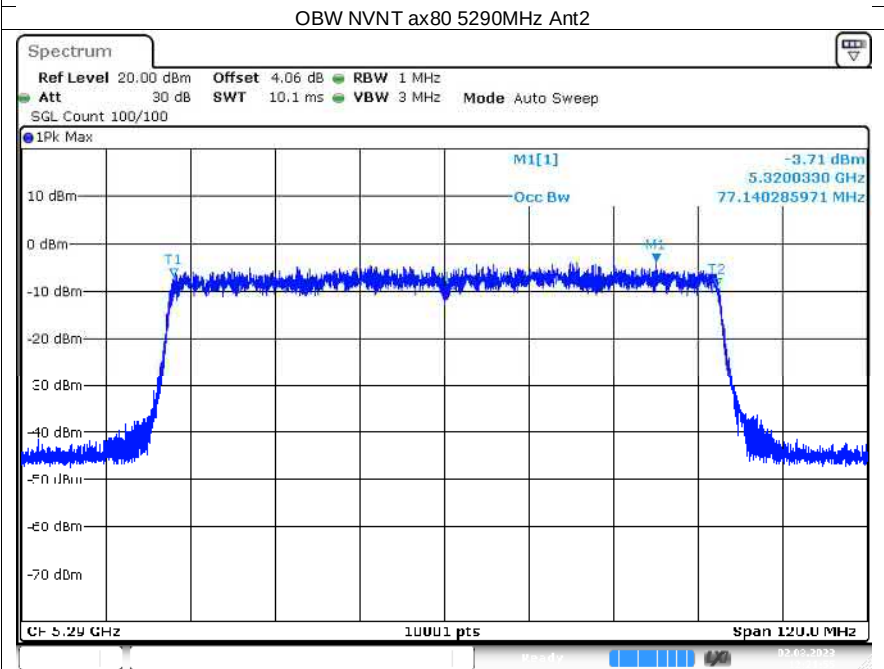



Date: 2/MAR/2023 12:21:56



China

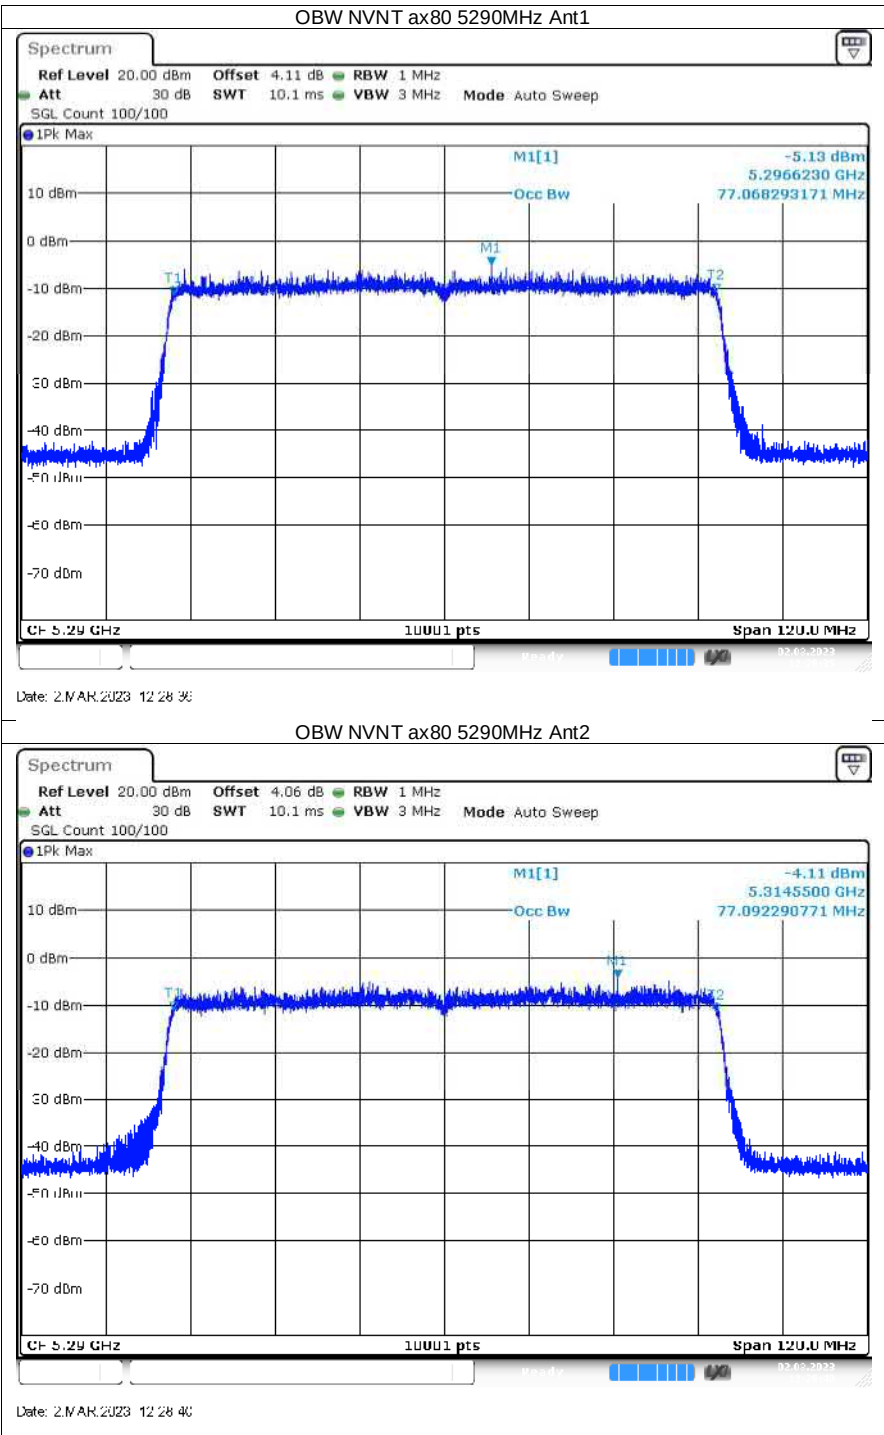


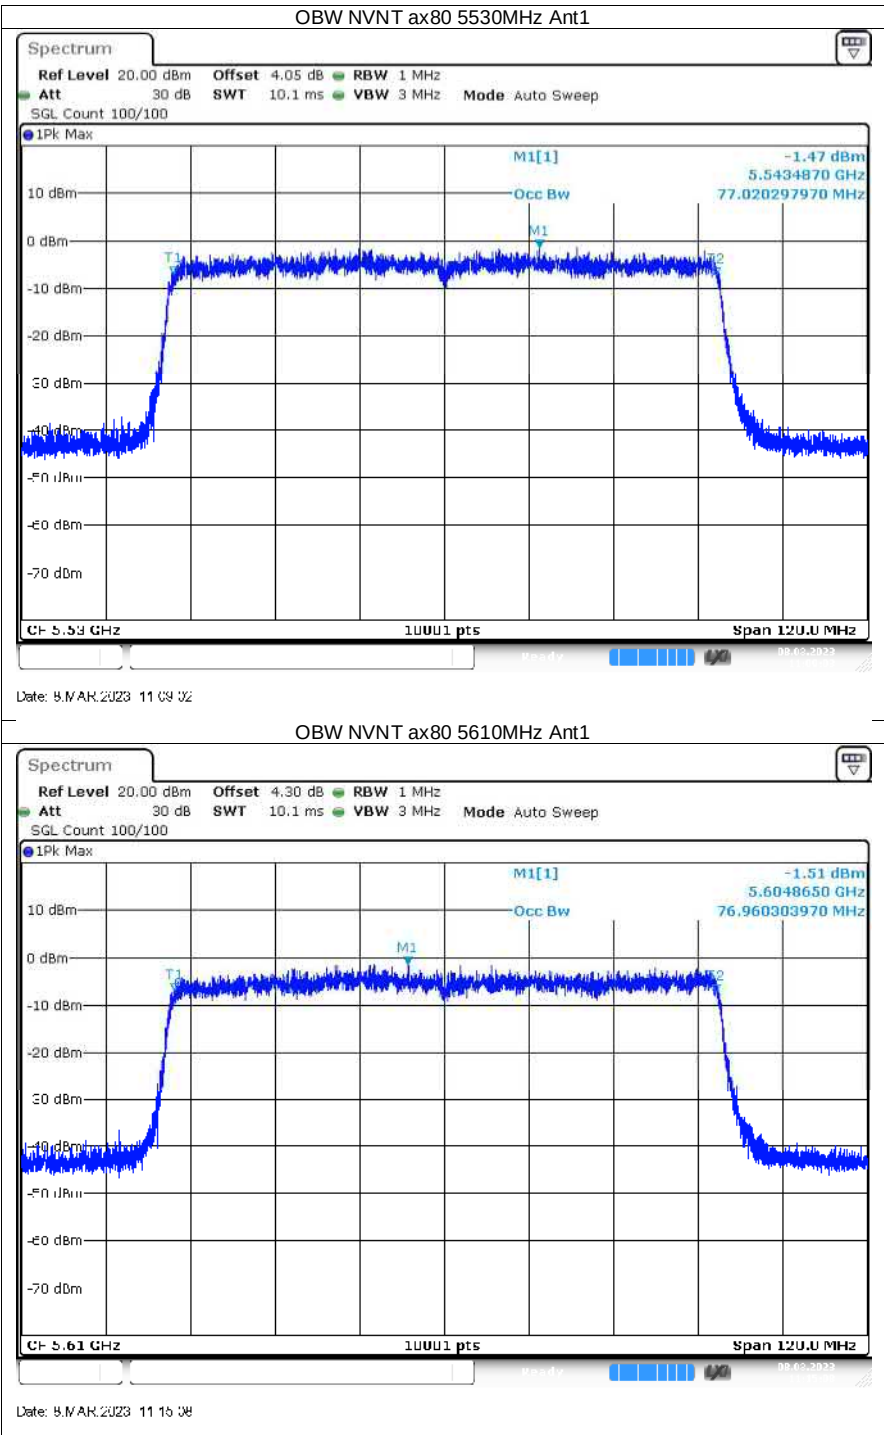

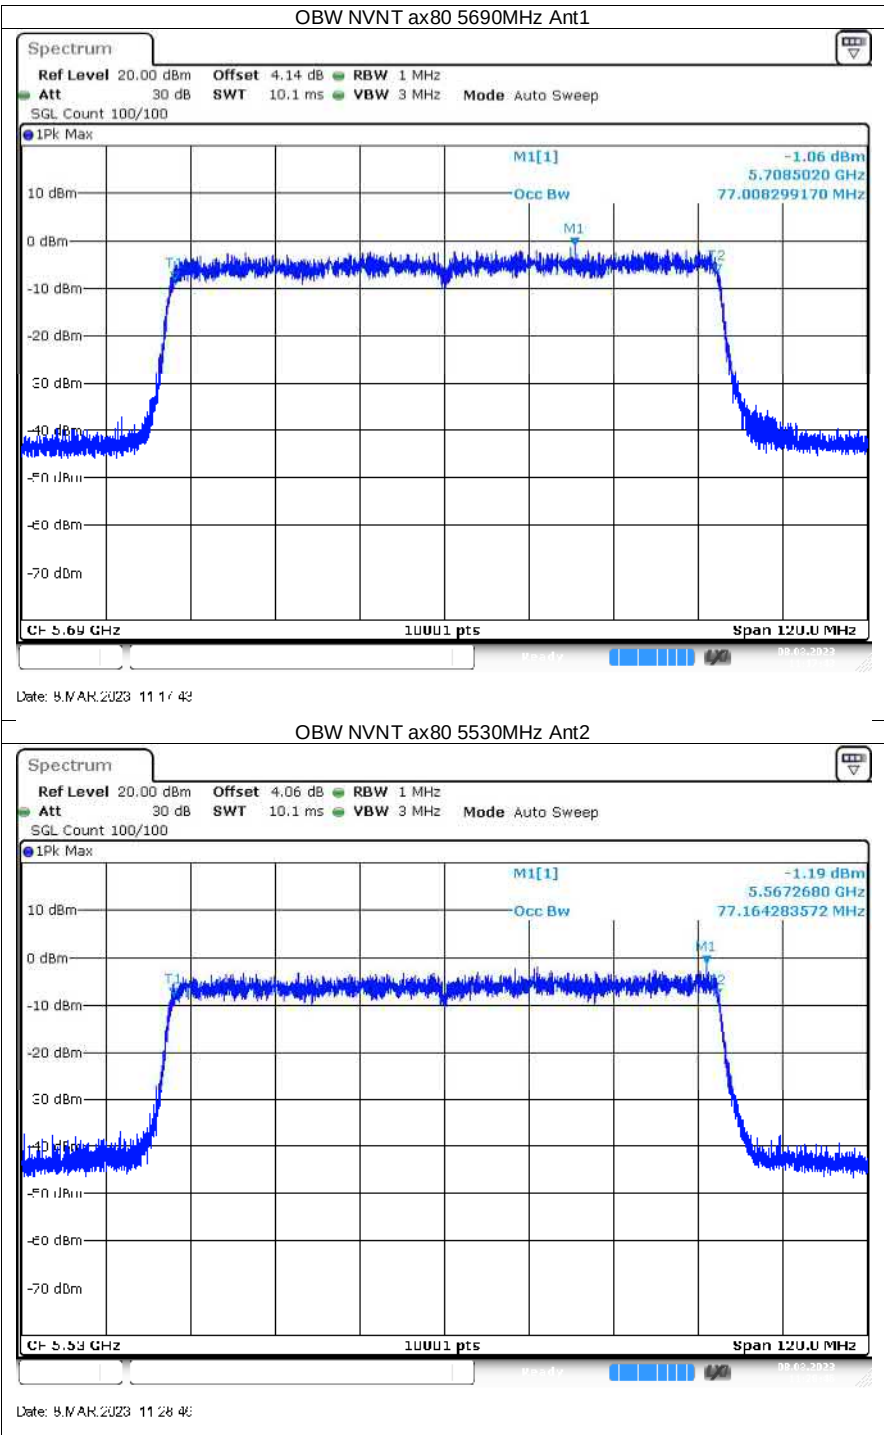





China

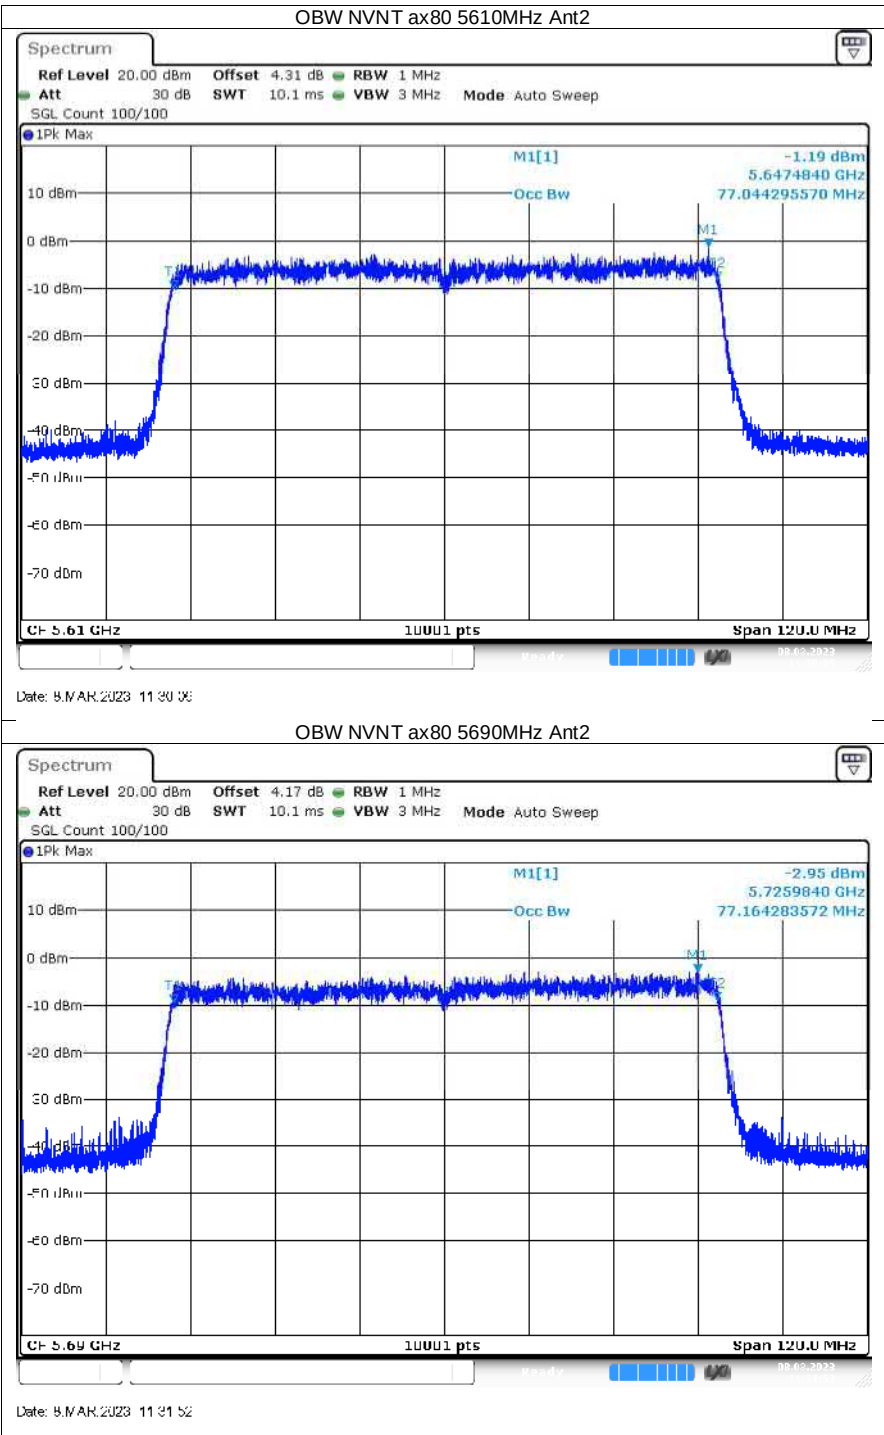




China

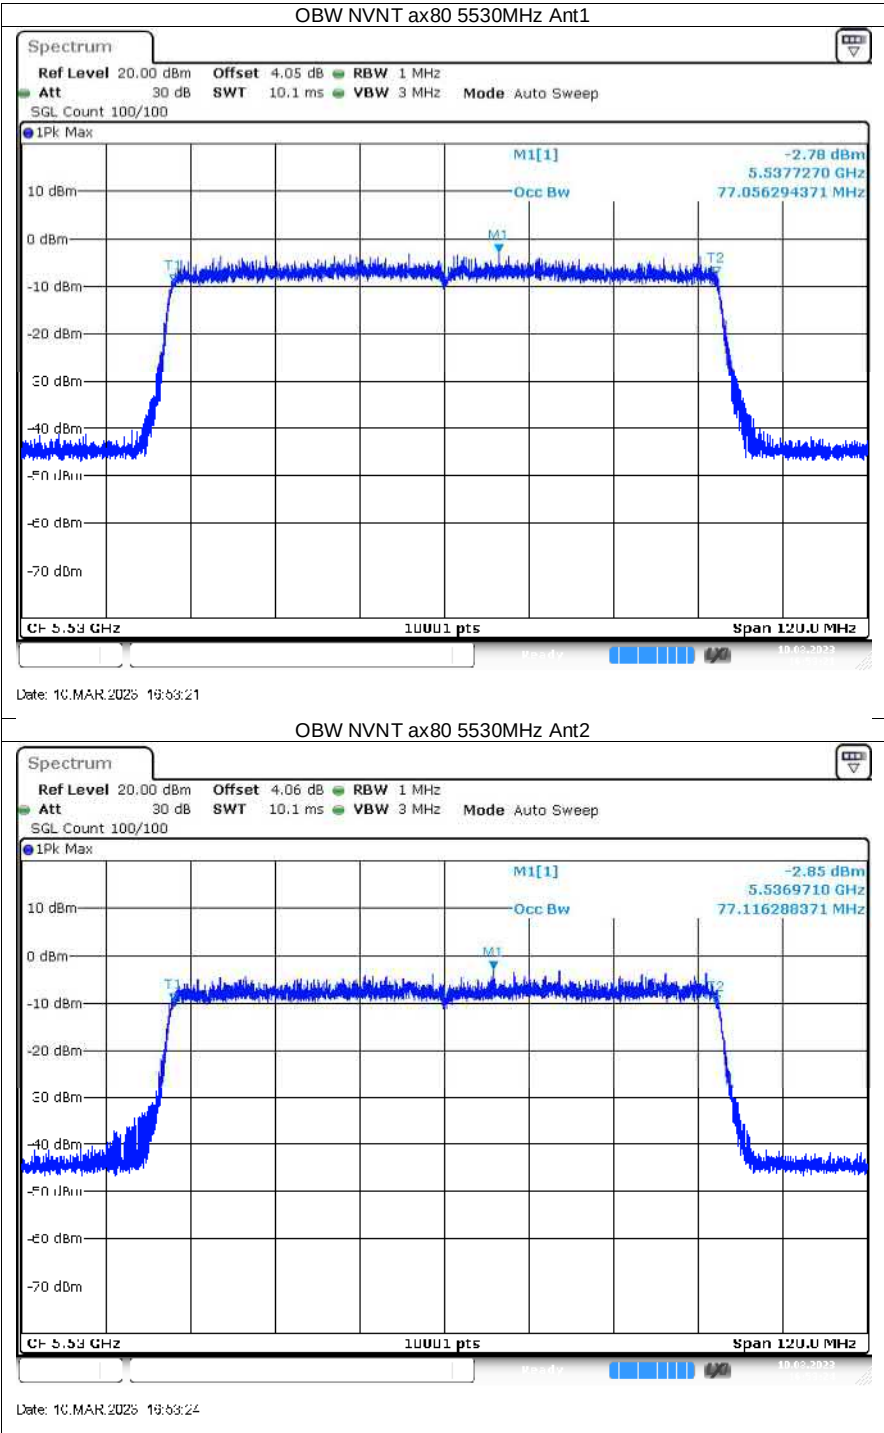


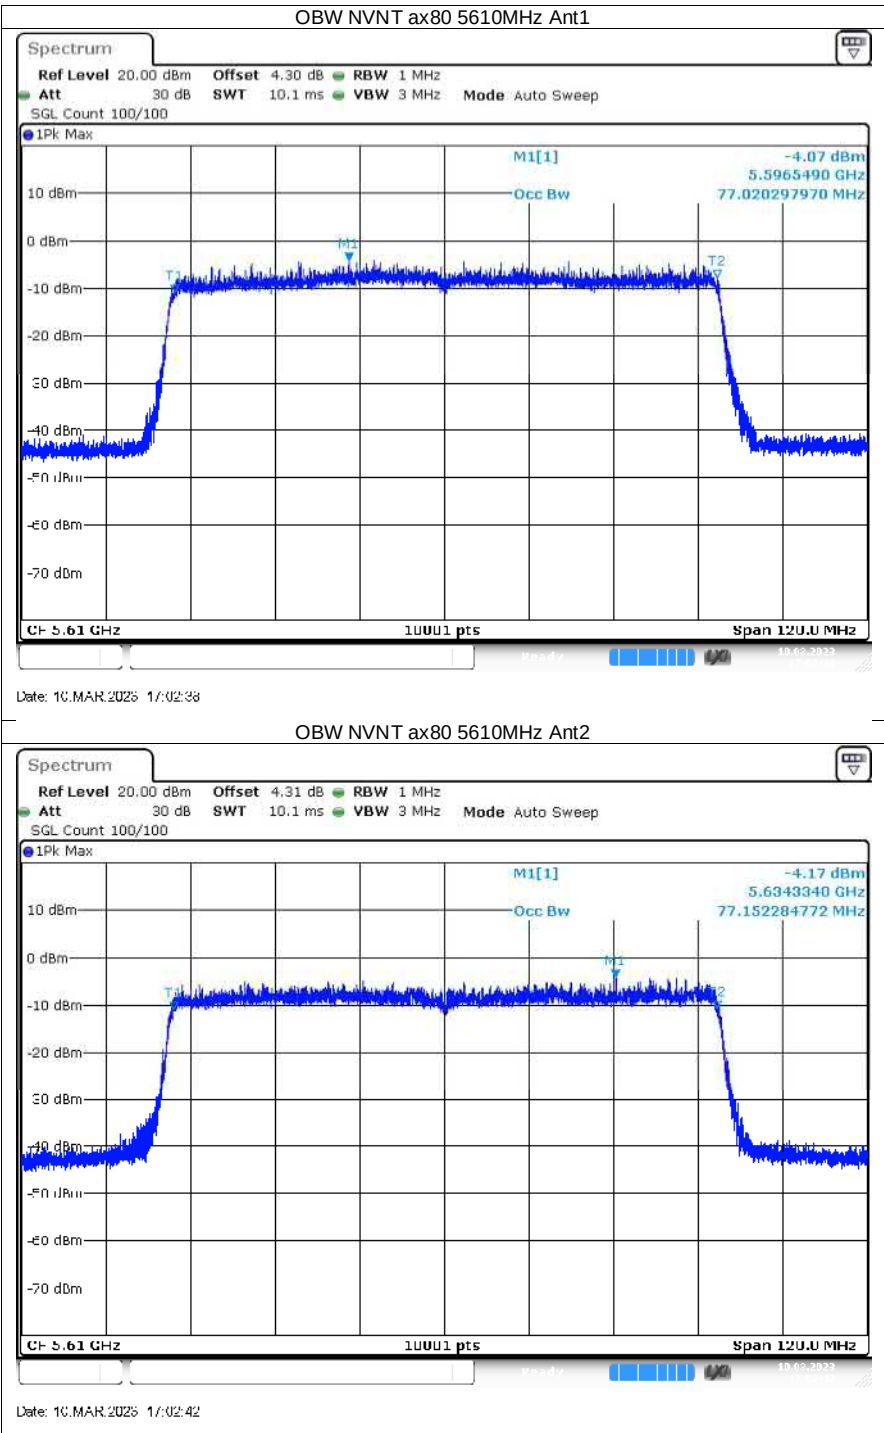




China

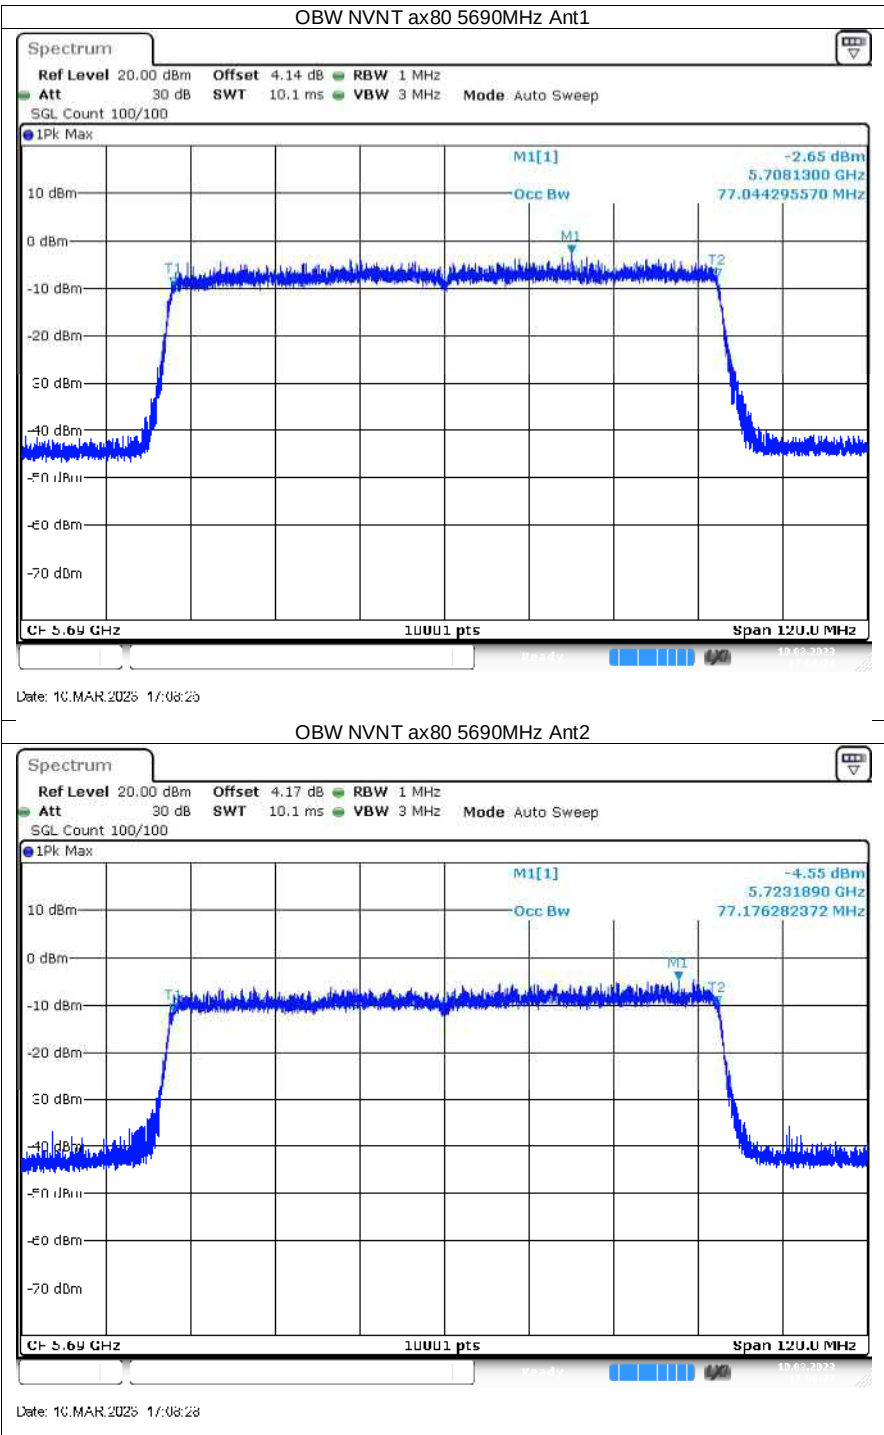

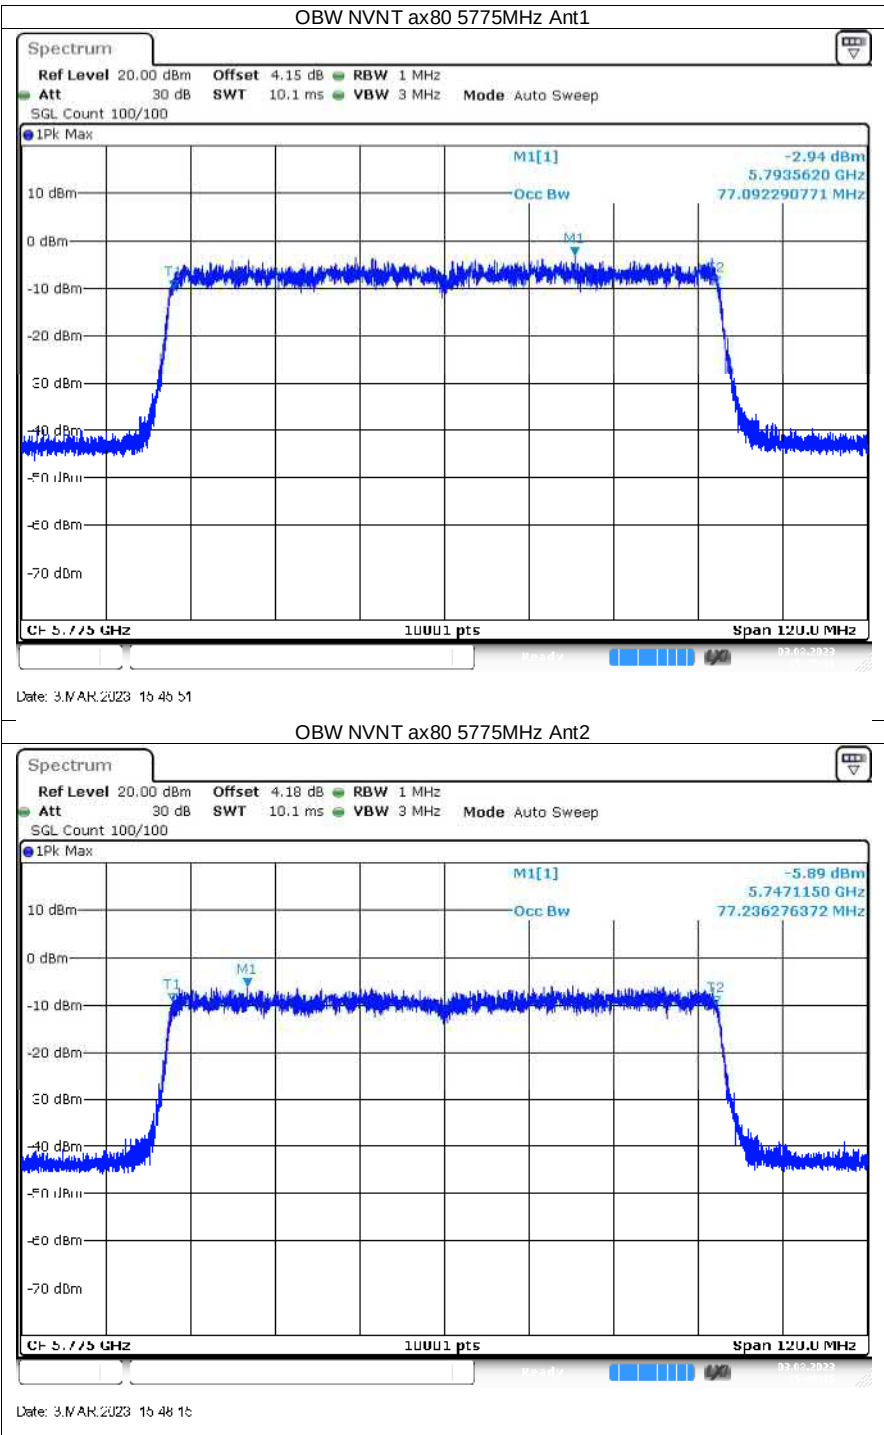



China

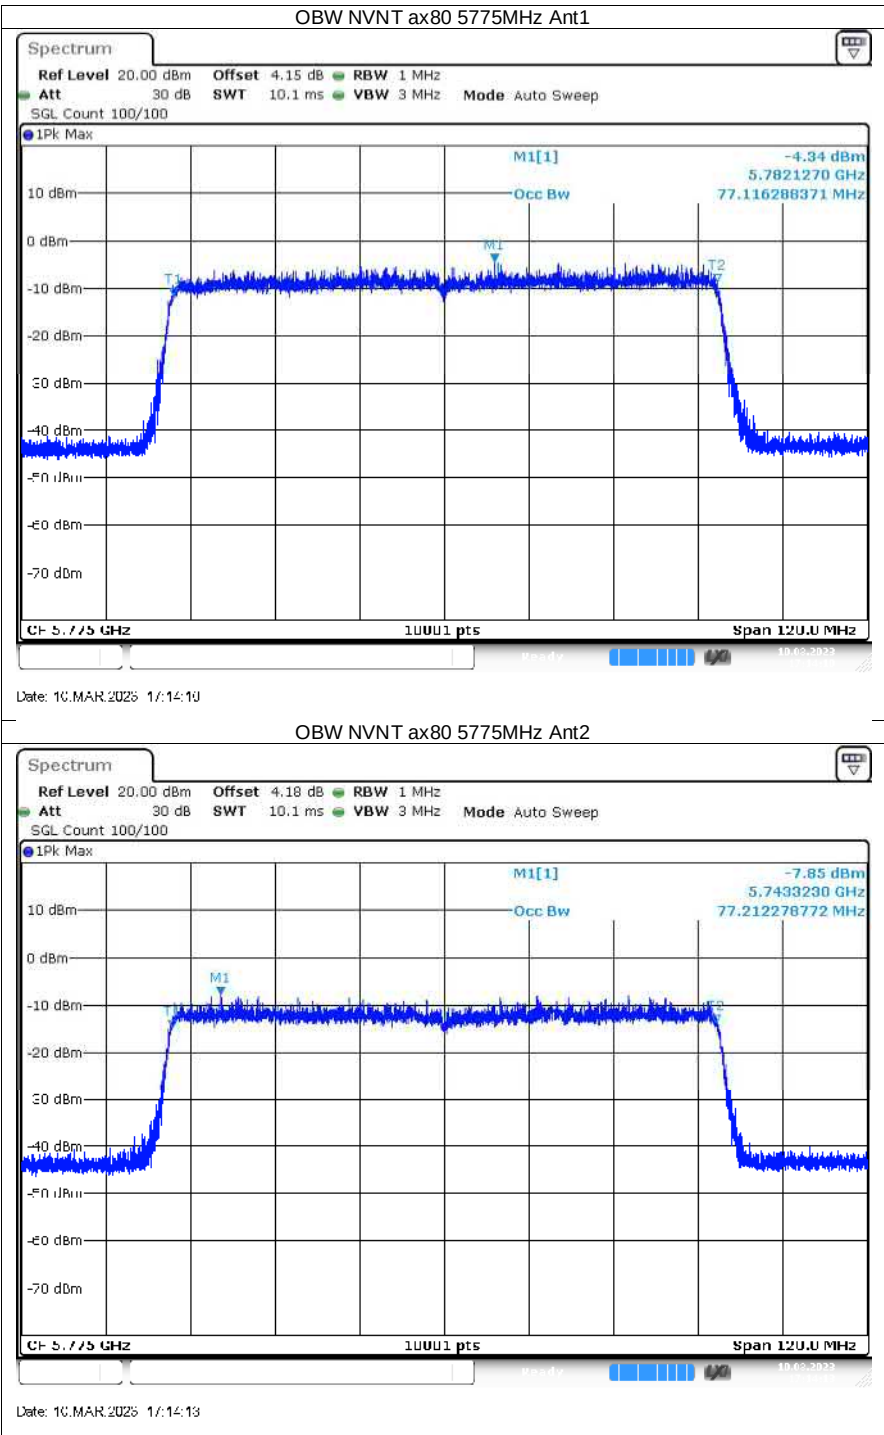

5 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	-6.42	1.26	-5.16	11	Pass
NVNT	a	5200	Ant1	-7.15	1.26	-5.89	11	Pass
NVNT	a	5240	Ant1	-7.02	1.26	-5.76	11	Pass
NVNT	a	5180	Ant2	-6.6	1.26	-5.34	11	Pass
NVNT	a	5200	Ant2	-8.33	1.26	-7.07	11	Pass
NVNT	a	5240	Ant2	-8.63	1.26	-7.37	11	Pass
NVNT	a	5180	Ant1	-6.74	1.68	-5.06	11	Pass
NVNT	a	5180	Ant2	-8.49	1.68	-6.81	11	Pass
NVNT	a	5180	Sum	-4.52	1.68	-2.84	11	Pass
NVNT	a	5200	Ant1	-6.37	1.68	-4.69	11	Pass
NVNT	a	5200	Ant2	-9.07	1.68	-7.39	11	Pass
NVNT	a	5200	Sum	-4.5	1.68	-2.82	11	Pass
NVNT	a	5240	Ant1	-8.78	1.68	-7.1	11	Pass
NVNT	a	5240	Ant2	-9.3	1.68	-7.62	11	Pass
NVNT	a	5240	Sum	-6.02	1.68	-4.34	11	Pass
NVNT	a	5260	Ant1	-6.97	1.26	-5.71	11	Pass
NVNT	a	5300	Ant1	-6.71	1.25	-5.46	11	Pass
NVNT	a	5320	Ant1	-6.95	1.26	-5.69	11	Pass
NVNT	a	5260	Ant2	-7.35	1.26	-6.09	11	Pass
NVNT	a	5300	Ant2	-7.23	1.28	-5.95	11	Pass
NVNT	a	5320	Ant2	-7	1.28	-5.72	11	Pass
NVNT	a	5260	Ant1	-7.01	1.68	-5.33	11	Pass
NVNT	a	5260	Ant2	-8.68	1.68	-7	11	Pass
NVNT	a	5260	Sum	-4.75	1.68	-3.07	11	Pass
NVNT	a	5300	Ant1	-8.64	1.68	-6.96	11	Pass
NVNT	a	5300	Ant2	-10.06	1.68	-8.38	11	Pass
NVNT	a	5300	Sum	-6.28	1.68	-4.6	11	Pass
NVNT	a	5320	Ant1	-8	1.68	-6.32	11	Pass
NVNT	a	5320	Ant2	-7.07	1.68	-5.39	11	Pass
NVNT	a	5320	Sum	-4.5	1.68	-2.82	11	Pass
NVNT	a	5500	Ant1	-5.02	1.25	-3.77	11	Pass
NVNT	a	5600	Ant1	-6.21	1.26	-4.95	11	Pass
NVNT	a	5700	Ant1	-6.5	1.26	-5.24	11	Pass
NVNT	a	5720	Ant1	-6	1.26	-4.74	11	Pass
NVNT	a	5500	Ant2	-3.8	1.25	-2.55	11	Pass
NVNT	a	5600	Ant2	-5.16	0.71	-4.45	11	Pass
NVNT	a	5700	Ant2	-6.61	1.26	-5.35	11	Pass
NVNT	a	5720	Ant2	-6.57	1.26	-5.31	11	Pass
NVNT	a	5500	Ant1	-5.85	1.68	-4.17	11	Pass
NVNT	a	5500	Ant2	-4.71	1.68	-3.03	11	Pass
NVNT	a	5500	Sum	-2.23	1.68	-0.55	11	Pass
NVNT	a	5600	Ant1	-5.26	1.68	-3.58	11	Pass
NVNT	a	5600	Ant2	-7.62	1.68	-5.94	11	Pass
NVNT	a	5600	Sum	-3.27	1.68	-1.59	11	Pass
NVNT	a	5700	Ant1	-7.27	0.28	-6.99	11	Pass
NVNT	a	5700	Ant2	-7.07	0.28	-6.79	11	Pass
NVNT	a	5700	Sum	-4.16	0.28	-3.88	11	Pass
NVNT	a	5720	Ant1	-51.36	0.28	-51.08	11	Pass
NVNT	a	5720	Ant2	-51.26	0.28	-50.98	11	Pass
NVNT	a	5720	Sum	-48.3	0.28	-48.02	11	Pass
NVNT	a	5745	Ant1	-7.66	1.26	-6.4	30	Pass



China

NVNT	a	5785	Ant1	-8.27	1.26	-7.01	30	Pass
NVNT	a	5825	Ant1	-8.79	1.26	-7.53	30	Pass
NVNT	a	5745	Ant2	-11.22	1.26	-9.96	30	Pass
NVNT	a	5785	Ant2	-11.97	1.26	-10.71	30	Pass
NVNT	a	5825	Ant2	-11.54	1.26	-10.28	30	Pass
NVNT	a	5745	Ant1	-8.86	1.26	-7.6	30	Pass
NVNT	a	5745	Ant2	-11.65	1.26	-10.39	30	Pass
NVNT	a	5745	Sum	-7.02	1.26	-5.76	30	Pass
NVNT	a	5785	Ant1	-9.89	1.26	-8.63	30	Pass
NVNT	a	5785	Ant2	-11.96	1.26	-10.7	30	Pass
NVNT	a	5785	Sum	-7.79	1.26	-6.53	30	Pass
NVNT	a	5825	Ant1	-10.06	1.26	-8.8	30	Pass
NVNT	a	5825	Ant2	-12.13	1.26	-10.87	30	Pass
NVNT	a	5825	Sum	-7.96	1.26	-6.7	30	Pass
NVNT	n20	5180	Ant1	-8.01	1.78	-6.23	11	Pass
NVNT	n20	5200	Ant1	-8.86	1.78	-7.08	11	Pass
NVNT	n20	5240	Ant1	-8.41	1.78	-6.63	11	Pass
NVNT	n20	5180	Ant2	-9.7	1.78	-7.92	11	Pass
NVNT	n20	5200	Ant2	-10.07	1.78	-8.29	11	Pass
NVNT	n20	5240	Ant2	-7.64	1.77	-5.87	11	Pass
NVNT	n20	5180	Ant1	-6.08	0.28	-5.8	11	Pass
NVNT	n20	5180	Ant2	-7.97	0.28	-7.69	11	Pass
NVNT	n20	5180	Sum	-3.91	0.28	-3.63	11	Pass
NVNT	n20	5200	Ant1	-9.85	0.28	-9.57	11	Pass
NVNT	n20	5200	Ant2	-6.91	0.28	-6.63	11	Pass
NVNT	n20	5200	Sum	-5.13	0.28	-4.85	11	Pass
NVNT	n20	5240	Ant1	-7.82	0.28	-7.54	11	Pass
NVNT	n20	5240	Ant2	-8.58	0.28	-8.3	11	Pass
NVNT	n20	5240	Sum	-5.17	0.28	-4.89	11	Pass
NVNT	n20	5260	Ant1	-9.46	1.78	-7.68	11	Pass
NVNT	n20	5300	Ant1	-9.37	1.78	-7.59	11	Pass
NVNT	n20	5320	Ant1	-9.35	1.78	-7.57	11	Pass
NVNT	n20	5260	Ant2	-9	1.78	-7.22	11	Pass
NVNT	n20	5300	Ant2	-8.61	1.78	-6.83	11	Pass
NVNT	n20	5320	Ant2	-8.57	1.77	-6.8	11	Pass
NVNT	n20	5260	Ant1	-7.52	0.28	-7.24	11	Pass
NVNT	n20	5260	Ant2	-7.26	0.28	-6.98	11	Pass
NVNT	n20	5260	Sum	-4.38	0.28	-4.1	11	Pass
NVNT	n20	5300	Ant1	-9.41	0.28	-9.13	11	Pass
NVNT	n20	5300	Ant2	-6.84	0.28	-6.56	11	Pass
NVNT	n20	5300	Sum	-4.93	0.28	-4.65	11	Pass
NVNT	n20	5320	Ant1	-7.35	0.28	-7.07	11	Pass
NVNT	n20	5320	Ant2	-6.92	0.28	-6.64	11	Pass
NVNT	n20	5320	Sum	-4.12	0.28	-3.84	11	Pass
NVNT	n20	5500	Ant1	-7.51	1.78	-5.73	11	Pass
NVNT	n20	5600	Ant1	-7.48	1.78	-5.7	11	Pass
NVNT	n20	5700	Ant1	-6.83	1.78	-5.05	11	Pass
NVNT	n20	5720	Ant1	-7.56	1.78	-5.78	11	Pass
NVNT	n20	5500	Ant2	-6.3	1.77	-4.53	11	Pass
NVNT	n20	5600	Ant2	-7.51	1.78	-5.73	11	Pass
NVNT	n20	5700	Ant2	-7.8	1.77	-6.03	11	Pass
NVNT	n20	5720	Ant2	-8.66	1.77	-6.89	11	Pass
NVNT	n20	5500	Ant1	-4.03	0.28	-3.75	11	Pass
NVNT	n20	5500	Ant2	-5.32	0.28	-5.04	11	Pass
NVNT	n20	5500	Sum	-1.62	0.28	-1.34	11	Pass
NVNT	n20	5600	Ant1	-5.9	0.28	-5.62	11	Pass



China

NVNT	n20	5600	Ant2	-5.15	0.28	-4.87	11	Pass
NVNT	n20	5600	Sum	-2.5	0.28	-2.22	11	Pass
NVNT	n20	5700	Ant1	-7.43	0.28	-7.15	11	Pass
NVNT	n20	5700	Ant2	-6.83	0.28	-6.55	11	Pass
NVNT	n20	5700	Sum	-4.11	0.28	-3.83	11	Pass
NVNT	n20	5720	Ant1	-5.38	0.28	-5.1	11	Pass
NVNT	n20	5720	Ant2	-6.88	0.28	-6.6	11	Pass
NVNT	n20	5720	Sum	-3.06	0.28	-2.78	11	Pass
NVNT	n20	5745	Ant1	-9.62	1.77	-7.85	30	Pass
NVNT	n20	5785	Ant1	-10.27	1.77	-8.5	30	Pass
NVNT	n20	5825	Ant1	-10.53	1.78	-8.75	30	Pass
NVNT	n20	5745	Ant2	-12.67	1.78	-10.89	30	Pass
NVNT	n20	5785	Ant2	-13.46	1.79	-11.67	30	Pass
NVNT	n20	5825	Ant2	-13.44	1.78	-11.66	30	Pass
NVNT	n20	5745	Ant1	-8.21	0.28	-7.93	30	Pass
NVNT	n20	5745	Ant2	-12.17	0.28	-11.89	30	Pass
NVNT	n20	5745	Sum	-6.74	0.28	-6.46	30	Pass
NVNT	n20	5785	Ant1	-9.01	0.28	-8.73	30	Pass
NVNT	n20	5785	Ant2	-12.39	0.28	-12.11	30	Pass
NVNT	n20	5785	Sum	-7.37	0.28	-7.09	30	Pass
NVNT	n20	5825	Ant1	-9.44	0.28	-9.16	30	Pass
NVNT	n20	5825	Ant2	-11.71	0.28	-11.43	30	Pass
NVNT	n20	5825	Sum	-7.42	0.28	-7.14	30	Pass
NVNT	n40	5190	Ant1	-12.55	2.56	-9.99	11	Pass
NVNT	n40	5230	Ant1	-12.53	2.57	-9.96	11	Pass
NVNT	n40	5190	Ant2	-13.58	2.57	-11.01	11	Pass
NVNT	n40	5230	Ant2	-13.54	2.59	-10.95	11	Pass
NVNT	n40	5190	Ant1	-10.65	0.96	-9.69	11	Pass
NVNT	n40	5190	Ant2	-12.37	0.96	-11.41	11	Pass
NVNT	n40	5190	Sum	-8.42	0.96	-7.46	11	Pass
NVNT	n40	5230	Ant1	-13.48	0.99	-12.49	11	Pass
NVNT	n40	5230	Ant2	-12.98	0.99	-11.99	11	Pass
NVNT	n40	5230	Sum	-10.21	0.99	-9.22	11	Pass
NVNT	n40	5270	Ant1	-11.26	2.57	-8.69	11	Pass
NVNT	n40	5310	Ant1	-13.21	2.57	-10.64	11	Pass
NVNT	n40	5270	Ant2	-12.04	2.59	-9.45	11	Pass
NVNT	n40	5310	Ant2	-13.15	2.57	-10.58	11	Pass
NVNT	n40	5270	Ant1	-11.07	0.96	-10.11	11	Pass
NVNT	n40	5270	Ant2	-12.8	0.96	-11.84	11	Pass
NVNT	n40	5270	Sum	-8.84	0.96	-7.88	11	Pass
NVNT	n40	5310	Ant1	-13.87	0.97	-12.9	11	Pass
NVNT	n40	5310	Ant2	-11.68	0.97	-10.71	11	Pass
NVNT	n40	5310	Sum	-9.63	0.97	-8.66	11	Pass
NVNT	n40	5510	Ant1	-10.74	2.56	-8.18	11	Pass
NVNT	n40	5590	Ant1	-10.68	2.56	-8.12	11	Pass
NVNT	n40	5670	Ant1	-10.15	2.56	-7.59	11	Pass
NVNT	n40	5710	Ant1	-10.96	2.56	-8.4	11	Pass
NVNT	n40	5510	Ant2	-10.88	2.57	-8.31	11	Pass
NVNT	n40	5590	Ant2	-10.91	2.56	-8.35	11	Pass
NVNT	n40	5670	Ant2	-11.8	2.56	-9.24	11	Pass
NVNT	n40	5710	Ant2	-12.52	2.57	-9.95	11	Pass
NVNT	n40	5510	Ant1	-10.06	0.96	-9.1	11	Pass
NVNT	n40	5510	Ant2	-11.57	0.96	-10.61	11	Pass
NVNT	n40	5510	Sum	-7.74	0.96	-6.78	11	Pass
NVNT	n40	5590	Ant1	-10.22	0.96	-9.26	11	Pass
NVNT	n40	5590	Ant2	-12.09	0.96	-11.13	11	Pass



China

NVNT	n40	5590	Sum	-8.04	0.96	-7.08	11	Pass
NVNT	n40	5670	Ant1	-10.27	0.96	-9.31	11	Pass
NVNT	n40	5670	Ant2	-11.99	0.96	-11.03	11	Pass
NVNT	n40	5670	Sum	-8.04	0.96	-7.08	11	Pass
NVNT	n40	5710	Ant1	-11.14	1.02	-10.12	11	Pass
NVNT	n40	5710	Ant2	-11.05	1.02	-10.03	11	Pass
NVNT	n40	5710	Sum	-8.08	1.02	-7.06	11	Pass
NVNT	n40	5755	Ant1	-15.02	2.6	-12.42	30	Pass
NVNT	n40	5795	Ant1	-15.17	2.88	-12.29	30	Pass
NVNT	n40	5755	Ant2	-17.27	2.6	-14.67	30	Pass
NVNT	n40	5795	Ant2	-16.58	2.89	-13.69	30	Pass
NVNT	n40	5755	Ant1	-14.79	1.06	-13.73	30	Pass
NVNT	n40	5755	Ant2	-16.53	1.06	-15.47	30	Pass
NVNT	n40	5755	Sum	-12.56	1.06	-11.5	30	Pass
NVNT	n40	5795	Ant1	-14.23	1.05	-13.18	30	Pass
NVNT	n40	5795	Ant2	-16.76	1.05	-15.71	30	Pass
NVNT	n40	5795	Sum	-12.3	1.05	-11.25	30	Pass
NVNT	ac20	5180	Ant1	-5.81	0.02	-5.79	11	Pass
NVNT	ac20	5200	Ant1	-6.41	0.02	-6.39	11	Pass
NVNT	ac20	5240	Ant1	-6.28	0.02	-6.26	11	Pass
NVNT	ac20	5180	Ant2	-7.28	0.28	-7	11	Pass
NVNT	ac20	5200	Ant2	-7.5	0.28	-7.22	11	Pass
NVNT	ac20	5240	Ant2	-7.7	0.28	-7.42	11	Pass
NVNT	ac20	5180	Ant1	-5.69	0.02	-5.67	11	Pass
NVNT	ac20	5180	Ant2	-7.5	0.02	-7.48	11	Pass
NVNT	ac20	5180	Sum	-3.49	0.02	-3.47	11	Pass
NVNT	ac20	5200	Ant1	-6.39	0.02	-6.37	11	Pass
NVNT	ac20	5200	Ant2	-8.51	0.02	-8.49	11	Pass
NVNT	ac20	5200	Sum	-4.31	0.02	-4.29	11	Pass
NVNT	ac20	5240	Ant1	-7.58	0.02	-7.56	11	Pass
NVNT	ac20	5240	Ant2	-8.1	0.02	-8.08	11	Pass
NVNT	ac20	5240	Sum	-4.82	0.02	-4.8	11	Pass
NVNT	ac20	5260	Ant1	-7.48	0.02	-7.46	11	Pass
NVNT	ac20	5300	Ant1	-6.98	0.02	-6.96	11	Pass
NVNT	ac20	5320	Ant1	-6.91	0.02	-6.89	11	Pass
NVNT	ac20	5260	Ant2	-6.99	0.28	-6.71	11	Pass
NVNT	ac20	5300	Ant2	-6.34	0.28	-6.06	11	Pass
NVNT	ac20	5320	Ant2	-6.87	0.28	-6.59	11	Pass
NVNT	ac20	5260	Ant1	-5.78	0.02	-5.76	11	Pass
NVNT	ac20	5260	Ant2	-7.26	0.02	-7.24	11	Pass
NVNT	ac20	5260	Sum	-3.45	0.02	-3.43	11	Pass
NVNT	ac20	5300	Ant1	-8.99	0.02	-8.97	11	Pass
NVNT	ac20	5300	Ant2	-6.84	0.02	-6.82	11	Pass
NVNT	ac20	5300	Sum	-4.77	0.02	-4.75	11	Pass
NVNT	ac20	5320	Ant1	-7.46	0.02	-7.44	11	Pass
NVNT	ac20	5320	Ant2	-6.61	0.02	-6.59	11	Pass
NVNT	ac20	5320	Sum	-4	0.02	-3.98	11	Pass
NVNT	ac20	5500	Ant1	-4.92	0.02	-4.9	11	Pass
NVNT	ac20	5600	Ant1	-4.94	0.02	-4.92	11	Pass
NVNT	ac20	5700	Ant1	-5.92	0.02	-5.9	11	Pass
NVNT	ac20	5720	Ant1	-6	0.02	-5.98	11	Pass
NVNT	ac20	5500	Ant2	-4.46	0.28	-4.18	11	Pass
NVNT	ac20	5600	Ant2	-5.2	0.28	-4.92	11	Pass
NVNT	ac20	5700	Ant2	-6.68	0.28	-6.4	11	Pass
NVNT	ac20	5720	Ant2	-6.68	0.28	-6.4	11	Pass
NVNT	ac20	5500	Ant1	-4.43	0.02	-4.41	11	Pass



China

NVNT	ac20	5500	Ant2	-3.77	0.02	-3.75	11	Pass
NVNT	ac20	5500	Sum	-1.08	0.02	-1.06	11	Pass
NVNT	ac20	5600	Ant1	-5.02	0.02	-5	11	Pass
NVNT	ac20	5600	Ant2	-6.95	0.02	-6.93	11	Pass
NVNT	ac20	5600	Sum	-2.87	0.02	-2.85	11	Pass
NVNT	ac20	5700	Ant1	-6.68	0.02	-6.66	11	Pass
NVNT	ac20	5700	Ant2	-5.97	0.02	-5.95	11	Pass
NVNT	ac20	5700	Sum	-3.3	0.02	-3.28	11	Pass
NVNT	ac20	5720	Ant1	-4.47	0.02	-4.45	11	Pass
NVNT	ac20	5720	Ant2	-6.51	0.02	-6.49	11	Pass
NVNT	ac20	5720	Sum	-2.36	0.02	-2.34	11	Pass
NVNT	ac20	5745	Ant1	-7.28	0.02	-7.26	30	Pass
NVNT	ac20	5785	Ant1	-8.05	0.02	-8.03	30	Pass
NVNT	ac20	5825	Ant1	-8.27	0.02	-8.25	30	Pass
NVNT	ac20	5745	Ant2	-10.58	0.28	-10.3	30	Pass
NVNT	ac20	5785	Ant2	-11.66	0.28	-11.38	30	Pass
NVNT	ac20	5825	Ant2	-11.63	0.28	-11.35	30	Pass
NVNT	ac20	5745	Ant1	-8.23	0.02	-8.21	30	Pass
NVNT	ac20	5745	Ant2	-12.23	0.02	-12.21	30	Pass
NVNT	ac20	5745	Sum	-6.77	0.02	-6.75	30	Pass
NVNT	ac20	5785	Ant1	-8.91	0.02	-8.89	30	Pass
NVNT	ac20	5785	Ant2	-12.63	0.02	-12.61	30	Pass
NVNT	ac20	5785	Sum	-7.37	0.02	-7.35	30	Pass
NVNT	ac20	5825	Ant1	-9.49	0.02	-9.47	30	Pass
NVNT	ac20	5825	Ant2	-11.63	0.02	-11.61	30	Pass
NVNT	ac20	5825	Sum	-7.42	0.02	-7.4	30	Pass
NVNT	ac40	5190	Ant1	-10.73	0.02	-10.71	11	Pass
NVNT	ac40	5230	Ant1	-11.22	0.02	-11.2	11	Pass
NVNT	ac40	5190	Ant2	-11.67	0.02	-11.65	11	Pass
NVNT	ac40	5230	Ant2	-11.78	0.02	-11.76	11	Pass
NVNT	ac40	5190	Ant1	-10.62	0.02	-10.6	11	Pass
NVNT	ac40	5190	Ant2	-12.54	0.02	-12.52	11	Pass
NVNT	ac40	5190	Sum	-8.46	0.02	-8.44	11	Pass
NVNT	ac40	5230	Ant1	-11.16	0.05	-11.11	11	Pass
NVNT	ac40	5230	Ant2	-13.25	0.05	-13.2	11	Pass
NVNT	ac40	5230	Sum	-9.07	0.05	-9.02	11	Pass
NVNT	ac40	5270	Ant1	-12.22	0.02	-12.2	11	Pass
NVNT	ac40	5310	Ant1	-11.93	0.03	-11.9	11	Pass
NVNT	ac40	5270	Ant2	-11.62	0.02	-11.6	11	Pass
NVNT	ac40	5310	Ant2	-11.01	0.03	-10.98	11	Pass
NVNT	ac40	5270	Ant1	-10.41	0.02	-10.39	11	Pass
NVNT	ac40	5270	Ant2	-11.55	0.02	-11.53	11	Pass
NVNT	ac40	5270	Sum	-7.93	0.02	-7.91	11	Pass
NVNT	ac40	5310	Ant1	-13.42	0.04	-13.38	11	Pass
NVNT	ac40	5310	Ant2	-11.15	0.04	-11.11	11	Pass
NVNT	ac40	5310	Sum	-9.13	0.04	-9.09	11	Pass
NVNT	ac40	5510	Ant1	-8.7	0.02	-8.68	11	Pass
NVNT	ac40	5590	Ant1	-10.39	0.02	-10.37	11	Pass
NVNT	ac40	5670	Ant1	-9.65	0.03	-9.62	11	Pass
NVNT	ac40	5710	Ant1	-9.46	0.05	-9.41	11	Pass
NVNT	ac40	5510	Ant2	-9.11	0.02	-9.09	11	Pass
NVNT	ac40	5590	Ant2	-8.87	0.02	-8.85	11	Pass
NVNT	ac40	5670	Ant2	-11.09	0.03	-11.06	11	Pass
NVNT	ac40	5710	Ant2	-10.25	0.02	-10.23	11	Pass
NVNT	ac40	5510	Ant1	-7.96	0.02	-7.94	11	Pass
NVNT	ac40	5510	Ant2	-9.03	0.02	-9.01	11	Pass



China

NVNT	ac40	5510	Sum	-5.45	0.02	-5.43	11	Pass
NVNT	ac40	5590	Ant1	-7.95	0.03	-7.92	11	Pass
NVNT	ac40	5590	Ant2	-9.43	0.03	-9.4	11	Pass
NVNT	ac40	5590	Sum	-5.62	0.03	-5.59	11	Pass
NVNT	ac40	5670	Ant1	-10.06	0.04	-10.02	11	Pass
NVNT	ac40	5670	Ant2	-12.44	0.04	-12.4	11	Pass
NVNT	ac40	5670	Sum	-8.08	0.04	-8.04	11	Pass
NVNT	ac40	5710	Ant1	-10.11	0.03	-10.08	11	Pass
NVNT	ac40	5710	Ant2	-10.71	0.03	-10.68	11	Pass
NVNT	ac40	5710	Sum	-7.39	0.03	-7.36	11	Pass
NVNT	ac40	5755	Ant1	-13.13	0.03	-13.1	30	Pass
NVNT	ac40	5795	Ant1	-13.53	0.05	-13.48	30	Pass
NVNT	ac40	5755	Ant2	-15.42	0.02	-15.4	30	Pass
NVNT	ac40	5795	Ant2	-15.45	0.05	-15.4	30	Pass
NVNT	ac40	5755	Ant1	-14.23	0.05	-14.18	30	Pass
NVNT	ac40	5755	Ant2	-16.15	0.05	-16.1	30	Pass
NVNT	ac40	5755	Sum	-12.07	0.05	-12.02	30	Pass
NVNT	ac40	5795	Ant1	-13.58	0.05	-13.53	30	Pass
NVNT	ac40	5795	Ant2	-16.46	0.05	-16.41	30	Pass
NVNT	ac40	5795	Sum	-11.78	0.05	-11.73	30	Pass
NVNT	ac80	5210	Ant1	-16.65	4.36	-12.29	11	Pass
NVNT	ac80	5210	Ant2	-17.45	4.36	-13.09	11	Pass
NVNT	ac80	5210	Ant1	-16.93	0.13	-16.8	11	Pass
NVNT	ac80	5210	Ant2	-17.08	0.13	-16.95	11	Pass
NVNT	ac80	5210	Sum	-13.99	0.13	-13.86	11	Pass
NVNT	ac80	5290	Ant1	-16.7	4.36	-12.34	11	Pass
NVNT	ac80	5290	Ant2	-16.58	3.96	-12.62	11	Pass
NVNT	ac80	5290	Ant1	-17.18	0.13	-17.05	11	Pass
NVNT	ac80	5290	Ant2	-15.57	0.13	-15.44	11	Pass
NVNT	ac80	5290	Sum	-13.29	0.13	-13.16	11	Pass
NVNT	ac80	5530	Ant1	-14.08	4.35	-9.73	11	Pass
NVNT	ac80	5610	Ant1	-14.4	4.22	-10.18	11	Pass
NVNT	ac80	5690	Ant1	-14.6	4.35	-10.25	11	Pass
NVNT	ac80	5530	Ant2	-14.99	4.35	-10.64	11	Pass
NVNT	ac80	5610	Ant2	-15.09	4.36	-10.73	11	Pass
NVNT	ac80	5690	Ant2	-14.99	3.92	-11.07	11	Pass
NVNT	ac80	5530	Ant1	-13.88	0.13	-13.75	11	Pass
NVNT	ac80	5530	Ant2	-14.55	0.13	-14.42	11	Pass
NVNT	ac80	5530	Sum	-11.19	0.13	-11.06	11	Pass
NVNT	ac80	5610	Ant1	-14.21	0.13	-14.08	11	Pass
NVNT	ac80	5610	Ant2	-14.54	0.13	-14.41	11	Pass
NVNT	ac80	5610	Sum	-11.36	0.13	-11.23	11	Pass
NVNT	ac80	5690	Ant1	-14.38	0.13	-14.25	11	Pass
NVNT	ac80	5690	Ant2	-15.63	0.13	-15.5	11	Pass
NVNT	ac80	5690	Sum	-11.95	0.13	-11.82	11	Pass
NVNT	ac80	5775	Ant1	-18.16	4.35	-13.81	30	Pass
NVNT	ac80	5775	Ant2	-20.25	4.37	-15.88	30	Pass
NVNT	ac80	5775	Ant1	-18.33	0.13	-18.2	30	Pass
NVNT	ac80	5775	Ant2	-21.91	0.13	-21.78	30	Pass
NVNT	ac80	5775	Sum	-16.75	0.13	-16.62	30	Pass
NVNT	ax20	5180	Ant1	-5.59	0.36	-5.23	11	Pass
NVNT	ax20	5200	Ant1	-6.3	0.36	-5.94	11	Pass
NVNT	ax20	5240	Ant1	-5.97	0.36	-5.61	11	Pass
NVNT	ax20	5180	Ant2	-7.13	0.36	-6.77	11	Pass
NVNT	ax20	5200	Ant2	-7.27	0.35	-6.92	11	Pass
NVNT	ax20	5240	Ant2	-7.49	0.35	-7.14	11	Pass



China

NVNT	ax20	5180	Ant1	-5.06	0.05	-5.01	11	Pass
NVNT	ax20	5180	Ant2	-7.25	0.05	-7.2	11	Pass
NVNT	ax20	5180	Sum	-3.01	0.05	-2.96	11	Pass
NVNT	ax20	5200	Ant1	-5.15	0.05	-5.1	11	Pass
NVNT	ax20	5200	Ant2	-8.07	0.05	-8.02	11	Pass
NVNT	ax20	5200	Sum	-3.36	0.05	-3.31	11	Pass
NVNT	ax20	5240	Ant1	-7.26	0.05	-7.21	11	Pass
NVNT	ax20	5240	Ant2	-7.78	0.05	-7.73	11	Pass
NVNT	ax20	5240	Sum	-4.5	0.05	-4.45	11	Pass
NVNT	ax20	5260	Ant1	-7.18	0.36	-6.82	11	Pass
NVNT	ax20	5300	Ant1	-6.92	0.36	-6.56	11	Pass
NVNT	ax20	5320	Ant1	-6.69	0.36	-6.33	11	Pass
NVNT	ax20	5260	Ant2	-6.55	0.36	-6.19	11	Pass
NVNT	ax20	5300	Ant2	-6.34	0.36	-5.98	11	Pass
NVNT	ax20	5320	Ant2	-6.1	0.35	-5.75	11	Pass
NVNT	ax20	5260	Ant1	-5.47	0.05	-5.42	11	Pass
NVNT	ax20	5260	Ant2	-6.69	0.05	-6.64	11	Pass
NVNT	ax20	5260	Sum	-3.03	0.05	-2.98	11	Pass
NVNT	ax20	5300	Ant1	-8.73	0.05	-8.68	11	Pass
NVNT	ax20	5300	Ant2	-6.2	0.05	-6.15	11	Pass
NVNT	ax20	5300	Sum	-4.27	0.05	-4.22	11	Pass
NVNT	ax20	5320	Ant1	-6.83	0.05	-6.78	11	Pass
NVNT	ax20	5320	Ant2	-6.07	0.05	-6.02	11	Pass
NVNT	ax20	5320	Sum	-3.42	0.05	-3.37	11	Pass
NVNT	ax20	5500	Ant1	-4.77	0.36	-4.41	11	Pass
NVNT	ax20	5600	Ant1	-5.03	0.35	-4.68	11	Pass
NVNT	ax20	5700	Ant1	-5.54	0.36	-5.18	11	Pass
NVNT	ax20	5720	Ant1	-5.89	0.35	-5.54	11	Pass
NVNT	ax20	5500	Ant2	-3.88	0.35	-3.53	11	Pass
NVNT	ax20	5600	Ant2	-4.71	0.35	-4.36	11	Pass
NVNT	ax20	5700	Ant2	-6.6	0.38	-6.22	11	Pass
NVNT	ax20	5720	Ant2	-6.47	0.36	-6.11	11	Pass
NVNT	ax20	5500	Ant1	-3.77	0.05	-3.72	11	Pass
NVNT	ax20	5500	Ant2	-4.83	0.05	-4.78	11	Pass
NVNT	ax20	5500	Sum	-1.26	0.05	-1.21	11	Pass
NVNT	ax20	5600	Ant1	-3.78	0.05	-3.73	11	Pass
NVNT	ax20	5600	Ant2	-5.56	0.05	-5.51	11	Pass
NVNT	ax20	5600	Sum	-1.57	0.05	-1.52	11	Pass
NVNT	ax20	5700	Ant1	-6.66	0.05	-6.61	11	Pass
NVNT	ax20	5700	Ant2	-7.14	0.05	-7.09	11	Pass
NVNT	ax20	5700	Sum	-3.88	0.05	-3.83	11	Pass
NVNT	ax20	5720	Ant1	-4.94	0.05	-4.89	11	Pass
NVNT	ax20	5720	Ant2	-3.65	0.05	-3.6	11	Pass
NVNT	ax20	5720	Sum	-1.24	0.05	-1.19	11	Pass
NVNT	ax20	5745	Ant1	-7.42	0.36	-7.06	30	Pass
NVNT	ax20	5785	Ant1	-8.1	0.36	-7.74	30	Pass
NVNT	ax20	5825	Ant1	-8.44	0.36	-8.08	30	Pass
NVNT	ax20	5745	Ant2	-10.72	0.36	-10.36	30	Pass
NVNT	ax20	5785	Ant2	-11.89	0.36	-11.53	30	Pass
NVNT	ax20	5825	Ant2	-10.91	0.36	-10.55	30	Pass
NVNT	ax20	5745	Ant1	-7.87	0.05	-7.82	30	Pass
NVNT	ax20	5745	Ant2	-10.96	0.05	-10.91	30	Pass
NVNT	ax20	5745	Sum	-6.14	0.05	-6.09	30	Pass
NVNT	ax20	5785	Ant1	-8.43	0.05	-8.38	30	Pass
NVNT	ax20	5785	Ant2	-11.67	0.05	-11.62	30	Pass
NVNT	ax20	5785	Sum	-6.74	0.05	-6.69	30	Pass



China

NVNT	ax20	5825	Ant1	-9.04	0.05	-8.99	30	Pass
NVNT	ax20	5825	Ant2	-11.77	0.05	-11.72	30	Pass
NVNT	ax20	5825	Sum	-7.18	0.05	-7.13	30	Pass
NVNT	ax40	5190	Ant1	-10.84	0.7	-10.14	11	Pass
NVNT	ax40	5230	Ant1	-11.26	0.69	-10.57	11	Pass
NVNT	ax40	5190	Ant2	-11.68	0.66	-11.02	11	Pass
NVNT	ax40	5230	Ant2	-11.99	0.65	-11.34	11	Pass
NVNT	ax40	5190	Ant1	-9.79	0.12	-9.67	11	Pass
NVNT	ax40	5190	Ant2	-11.97	0.12	-11.85	11	Pass
NVNT	ax40	5190	Sum	-7.73	0.12	-7.61	11	Pass
NVNT	ax40	5230	Ant1	-12.52	0.15	-12.37	11	Pass
NVNT	ax40	5230	Ant2	-12.15	0.15	-12	11	Pass
NVNT	ax40	5230	Sum	-9.32	0.15	-9.17	11	Pass
NVNT	ax40	5270	Ant1	-11.85	0.71	-11.14	11	Pass
NVNT	ax40	5310	Ant1	-11.6	0.65	-10.95	11	Pass
NVNT	ax40	5270	Ant2	-11.26	0.66	-10.6	11	Pass
NVNT	ax40	5310	Ant2	-10.76	0.65	-10.11	11	Pass
NVNT	ax40	5270	Ant1	-11.23	0.13	-11.1	11	Pass
NVNT	ax40	5270	Ant2	-11.74	0.13	-11.61	11	Pass
NVNT	ax40	5270	Sum	-8.47	0.13	-8.34	11	Pass
NVNT	ax40	5310	Ant1	-14.11	0.2	-13.91	11	Pass
NVNT	ax40	5310	Ant2	-11.63	0.2	-11.43	11	Pass
NVNT	ax40	5310	Sum	-9.69	0.2	-9.49	11	Pass
NVNT	ax40	5510	Ant1	-8.73	0.66	-8.07	11	Pass
NVNT	ax40	5590	Ant1	-8.58	0.69	-7.89	11	Pass
NVNT	ax40	5670	Ant1	-8.74	0.7	-8.04	11	Pass
NVNT	ax40	5710	Ant1	-9.03	0.71	-8.32	11	Pass
NVNT	ax40	5510	Ant2	-9.32	0.66	-8.66	11	Pass
NVNT	ax40	5590	Ant2	-9.37	0.65	-8.72	11	Pass
NVNT	ax40	5670	Ant2	-10.15	0.66	-9.49	11	Pass
NVNT	ax40	5710	Ant2	-9.87	0.67	-9.2	11	Pass
NVNT	ax40	5510	Ant1	-8.53	0.11	-8.42	11	Pass
NVNT	ax40	5510	Ant2	-9.76	0.11	-9.65	11	Pass
NVNT	ax40	5510	Sum	-6.09	0.11	-5.98	11	Pass
NVNT	ax40	5590	Ant1	-8.22	0.11	-8.11	11	Pass
NVNT	ax40	5590	Ant2	-10.09	0.11	-9.98	11	Pass
NVNT	ax40	5590	Sum	-6.04	0.11	-5.93	11	Pass
NVNT	ax40	5670	Ant1	-9.99	0.15	-9.84	11	Pass
NVNT	ax40	5670	Ant2	-12.19	0.15	-12.04	11	Pass
NVNT	ax40	5670	Sum	-7.94	0.15	-7.79	11	Pass
NVNT	ax40	5710	Ant1	-10.3	0.15	-10.15	11	Pass
NVNT	ax40	5710	Ant2	-10.71	0.15	-10.56	11	Pass
NVNT	ax40	5710	Sum	-7.49	0.15	-7.34	11	Pass
NVNT	ax40	5755	Ant1	-13.27	0.66	-12.61	30	Pass
NVNT	ax40	5795	Ant1	-14.08	0.71	-13.37	30	Pass
NVNT	ax40	5755	Ant2	-15.66	0.66	-15	30	Pass
NVNT	ax40	5795	Ant2	-16.19	0.71	-15.48	30	Pass
NVNT	ax40	5755	Ant1	-14.33	0.15	-14.18	30	Pass
NVNT	ax40	5755	Ant2	-16.07	0.15	-15.92	30	Pass
NVNT	ax40	5755	Sum	-12.1	0.15	-11.95	30	Pass
NVNT	ax40	5795	Ant1	-13.47	0.15	-13.32	30	Pass
NVNT	ax40	5795	Ant2	-16.36	0.15	-16.21	30	Pass
NVNT	ax40	5795	Sum	-11.67	0.15	-11.52	30	Pass
NVNT	ax80	5210	Ant1	-15.82	4.2	-11.62	11	Pass
NVNT	ax80	5210	Ant2	-17.45	3.91	-13.54	11	Pass
NVNT	ax80	5210	Ant1	-16.82	0.39	-16.43	11	Pass



China

NVNT	ax80	5210	Ant2	-16.66	0.39	-16.27	11	Pass
NVNT	ax80	5210	Sum	-13.73	0.39	-13.34	11	Pass
NVNT	ax80	5290	Ant1	-15.93	3.9	-12.03	11	Pass
NVNT	ax80	5290	Ant2	-16.24	3.35	-12.89	11	Pass
NVNT	ax80	5290	Ant1	-16.53	0.39	-16.14	11	Pass
NVNT	ax80	5290	Ant2	-15.64	0.39	-15.25	11	Pass
NVNT	ax80	5290	Sum	-13.05	0.39	-12.66	11	Pass
NVNT	ax80	5530	Ant1	-13.01	3.88	-9.13	11	Pass
NVNT	ax80	5610	Ant1	-13.5	3.9	-9.6	11	Pass
NVNT	ax80	5690	Ant1	-13.46	3.87	-9.59	11	Pass
NVNT	ax80	5530	Ant2	-14.29	3.89	-10.4	11	Pass
NVNT	ax80	5610	Ant2	-13.19	3.89	-9.3	11	Pass
NVNT	ax80	5690	Ant2	-14.77	3.3	-11.47	11	Pass
NVNT	ax80	5530	Ant1	-13.66	0.38	-13.28	11	Pass
NVNT	ax80	5530	Ant2	-14.37	0.38	-13.99	11	Pass
NVNT	ax80	5530	Sum	-10.99	0.38	-10.61	11	Pass
NVNT	ax80	5610	Ant1	-14.77	0.37	-14.4	11	Pass
NVNT	ax80	5610	Ant2	-14.9	0.37	-14.53	11	Pass
NVNT	ax80	5610	Sum	-11.82	0.37	-11.45	11	Pass
NVNT	ax80	5690	Ant1	-14.17	0.38	-13.79	11	Pass
NVNT	ax80	5690	Ant2	-15.39	0.38	-15.01	11	Pass
NVNT	ax80	5690	Sum	-11.73	0.38	-11.35	11	Pass
NVNT	ax80	5775	Ant1	-17.37	3.9	-13.47	30	Pass
NVNT	ax80	5775	Ant2	-19.66	3.92	-15.74	30	Pass
NVNT	ax80	5775	Ant1	-18.06	0.38	-17.68	30	Pass
NVNT	ax80	5775	Ant2	-21.86	0.38	-21.48	30	Pass
NVNT	ax80	5775	Sum	-16.55	0.38	-16.17	30	Pass