




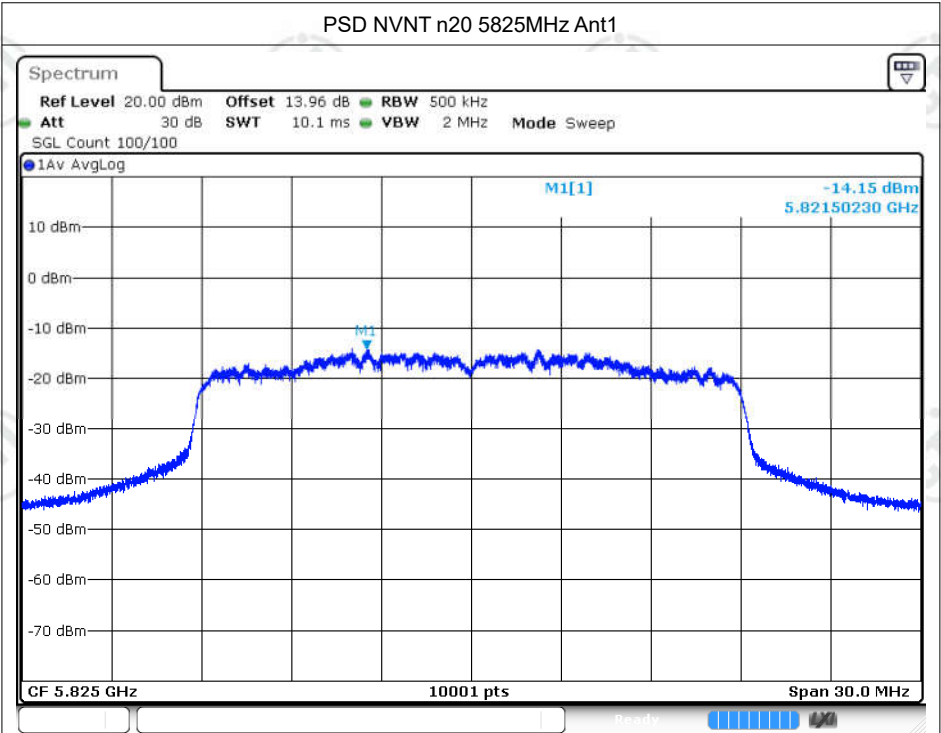


Date: 6 JAN.2025 13:39:53

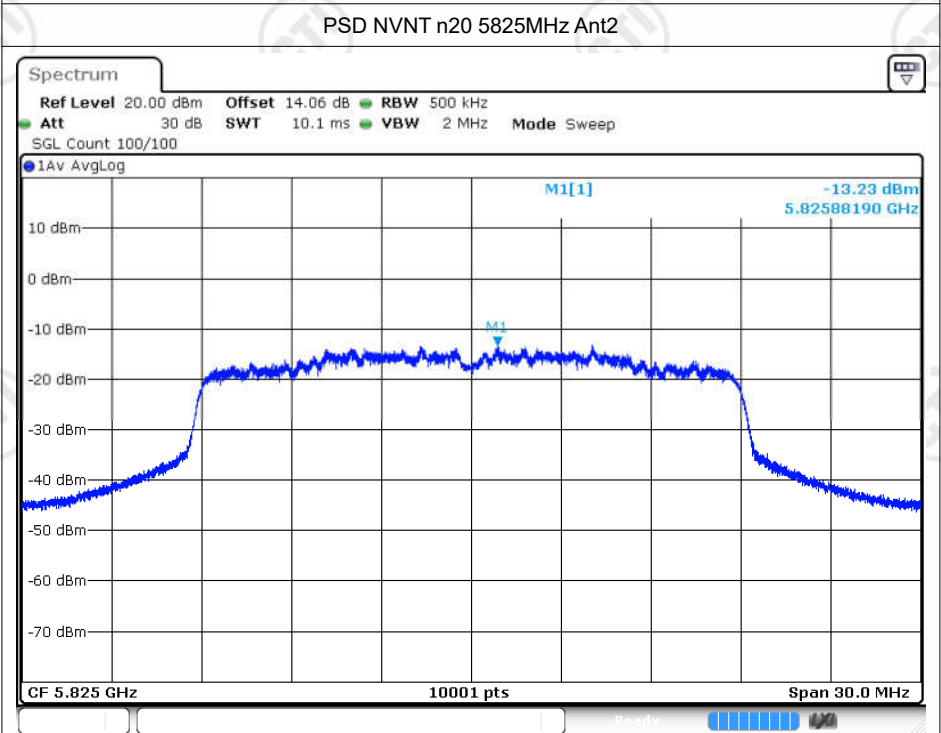


Date: 6 JAN.2025 13:39:56

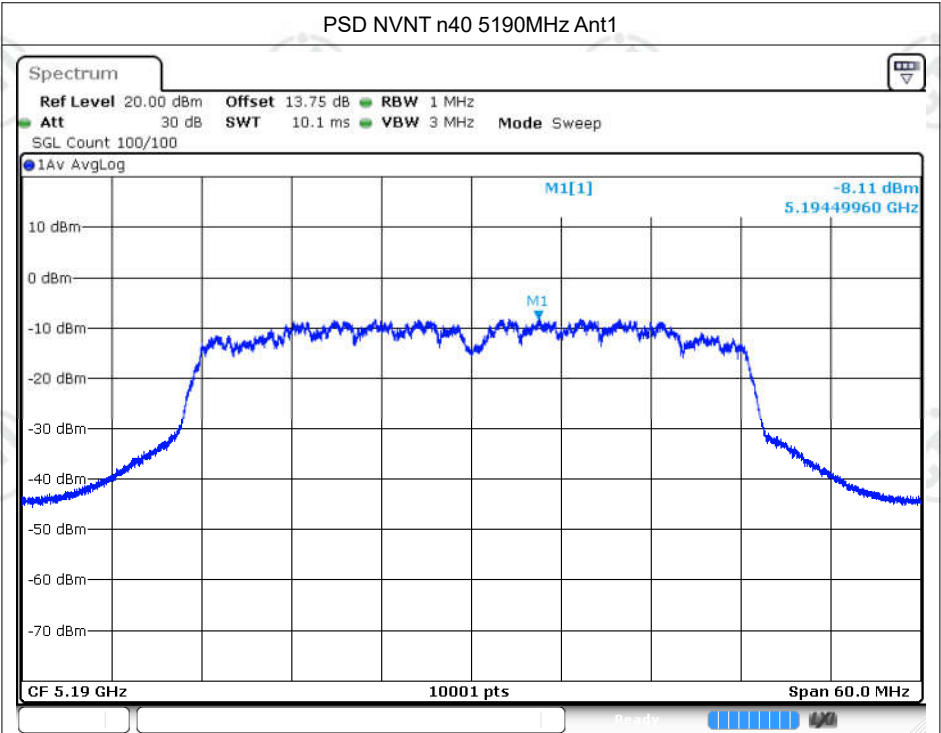


Date: 6 JAN.2025 10:38:33

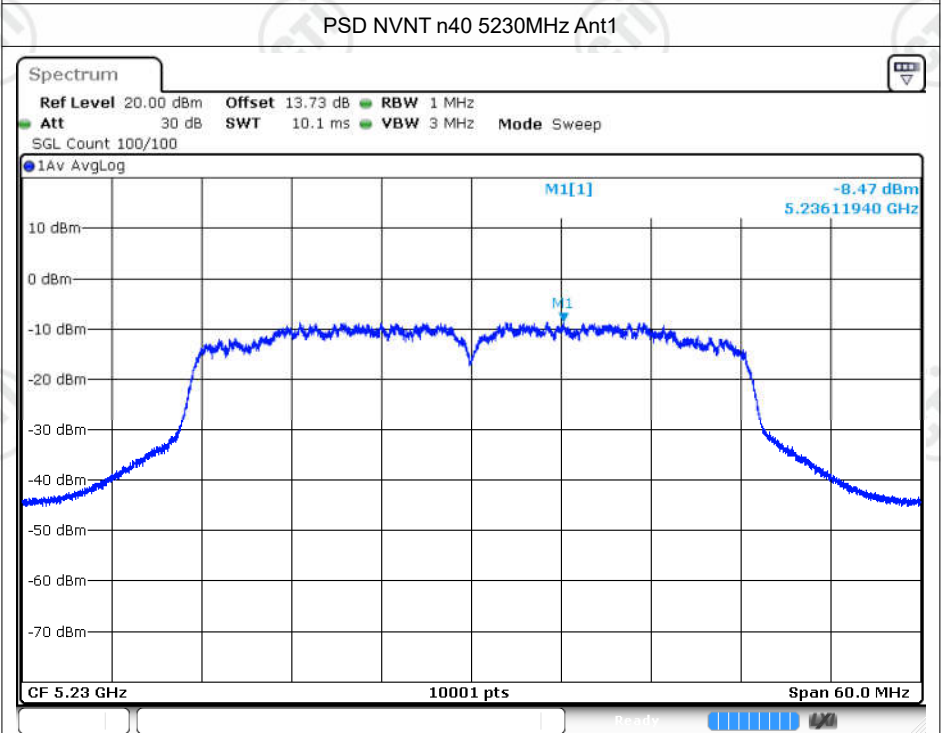


Date: 6 JAN.2025 10:40:07

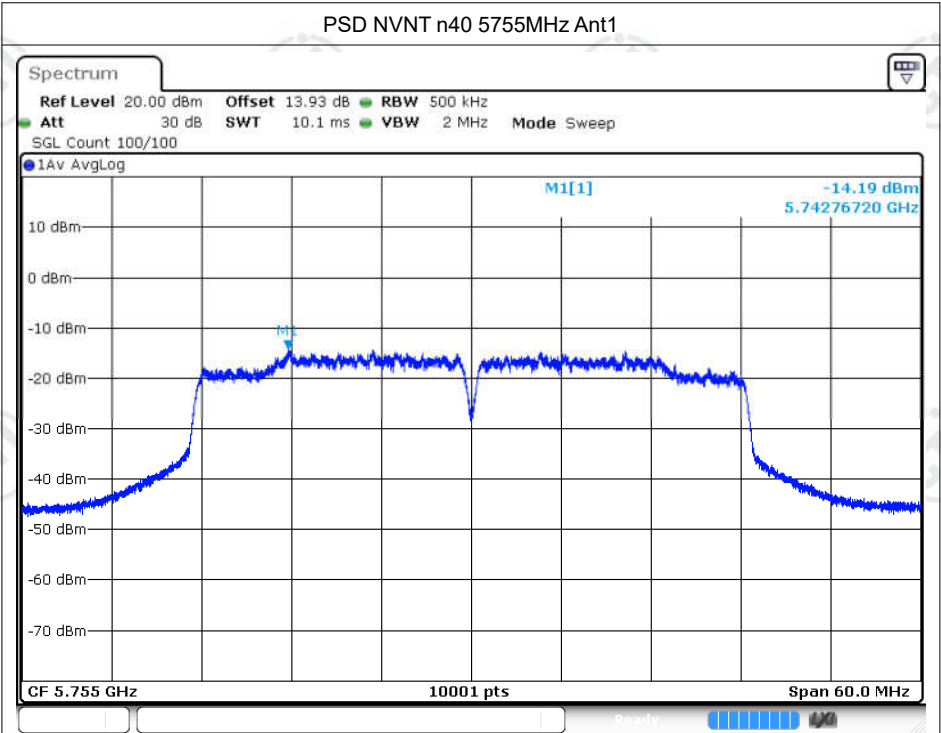


Date: 6 JAN 2025 13:00:00

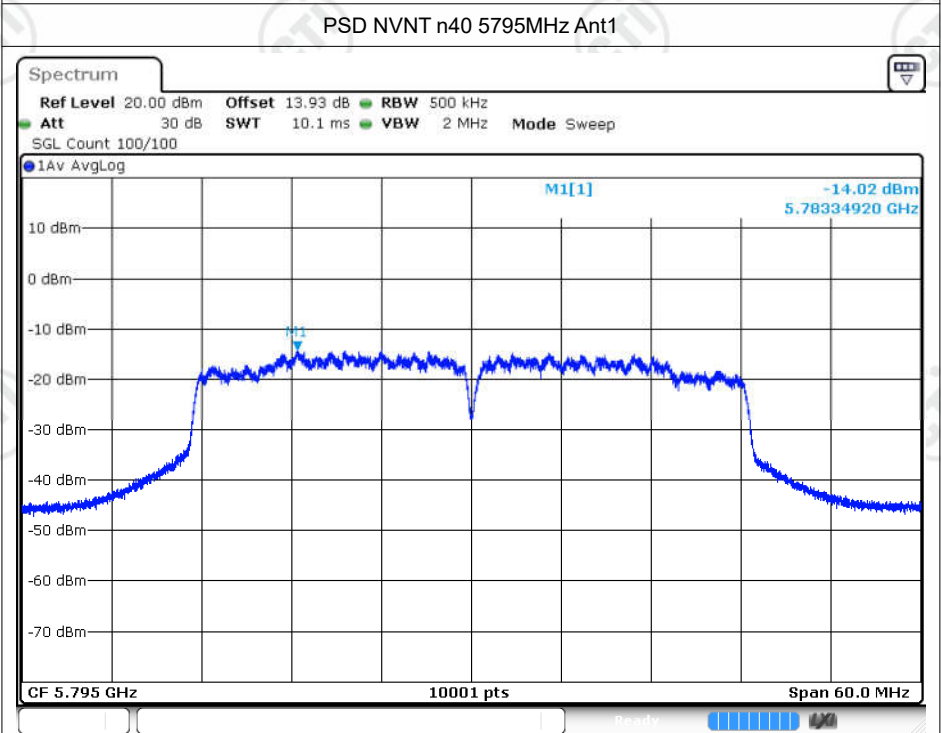


Date: 6 JAN 2025 13:01:30

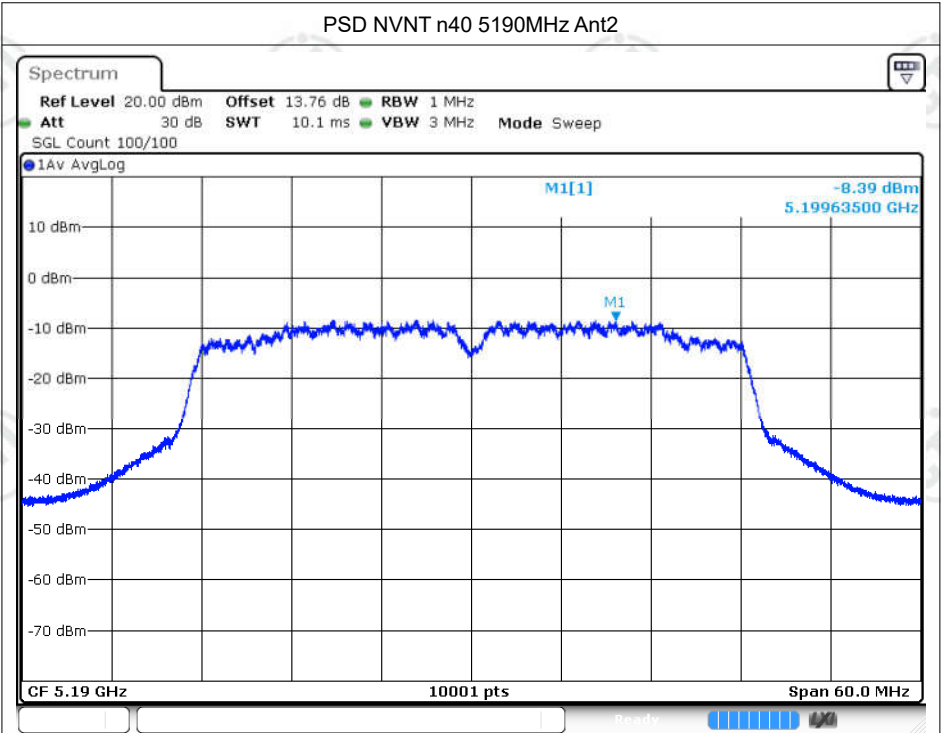


Date: 6 JAN 2025 11:05:06

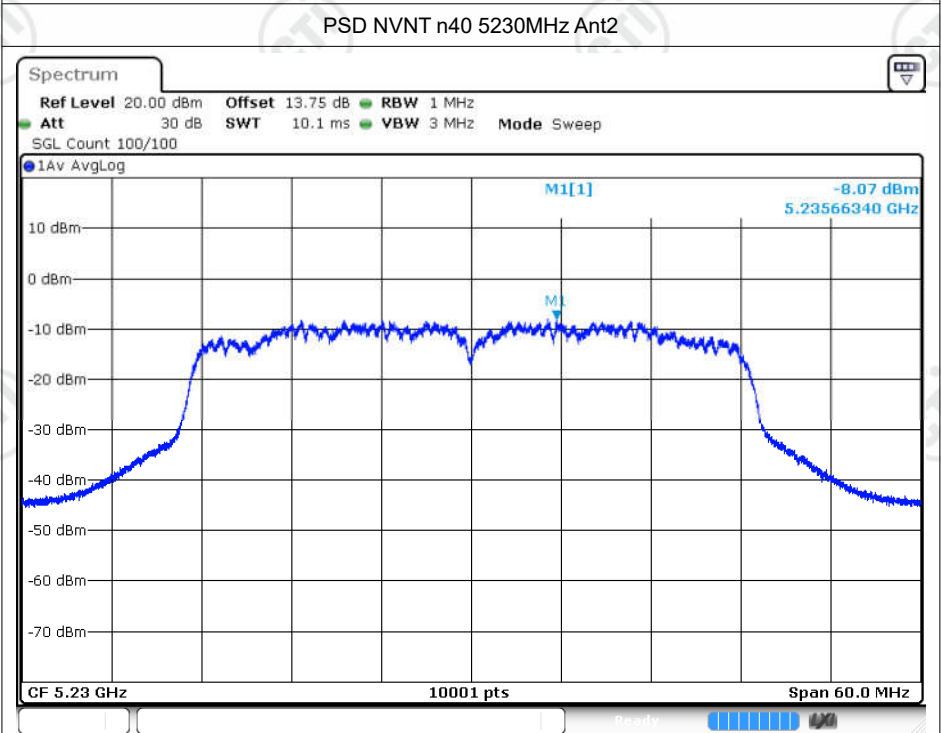


Date: 6 JAN 2025 11:07:02

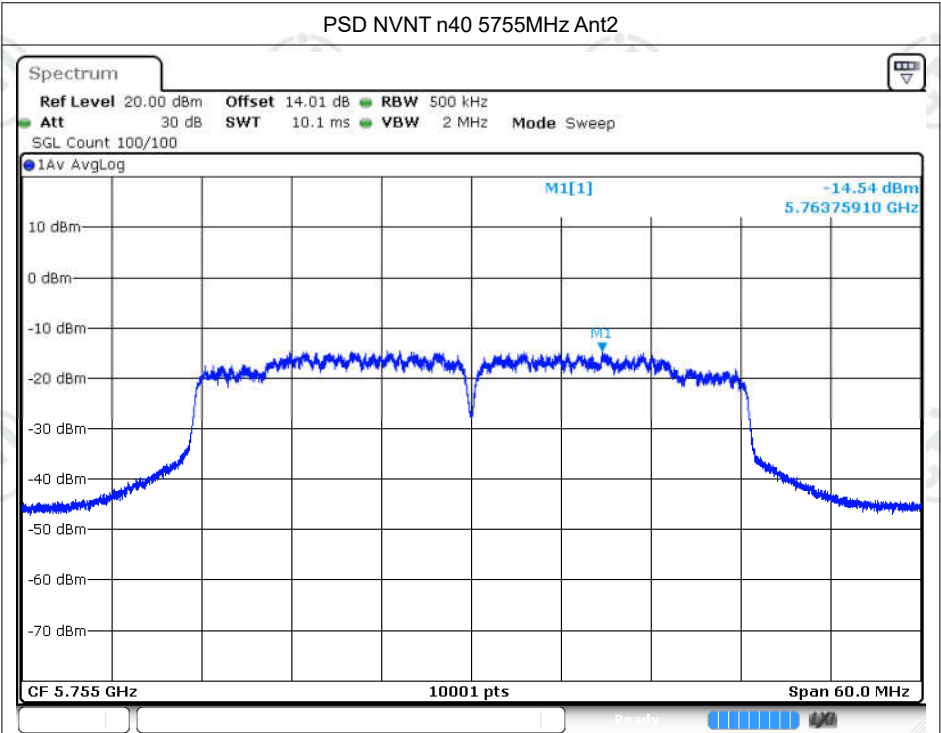


Date: 6 JAN 2025 13:25:03

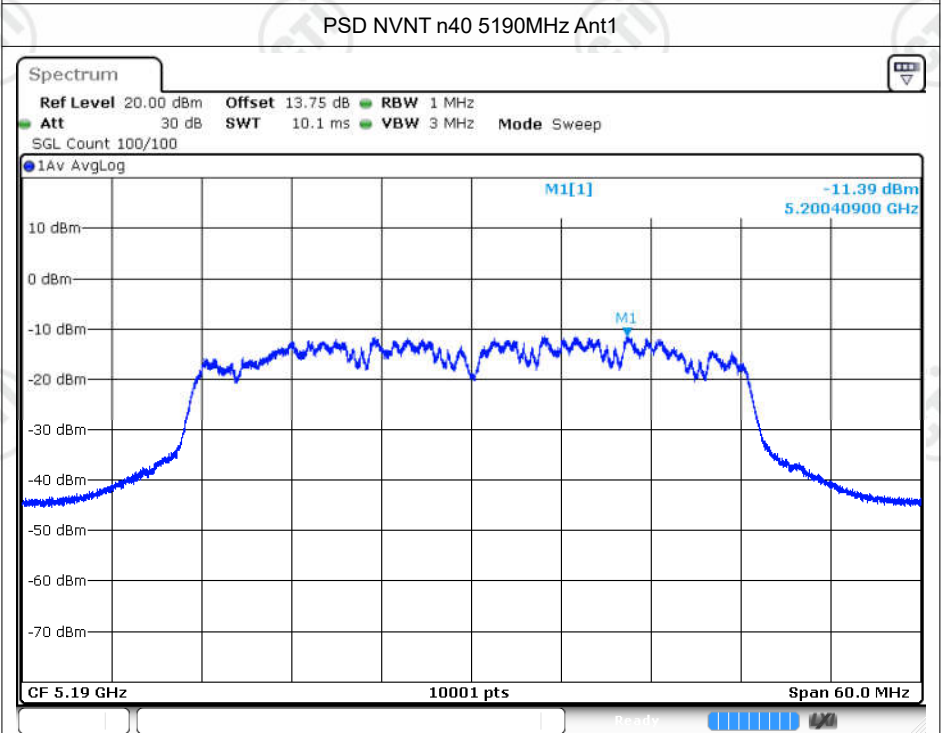


Date: 6 JAN 2025 14:06:33

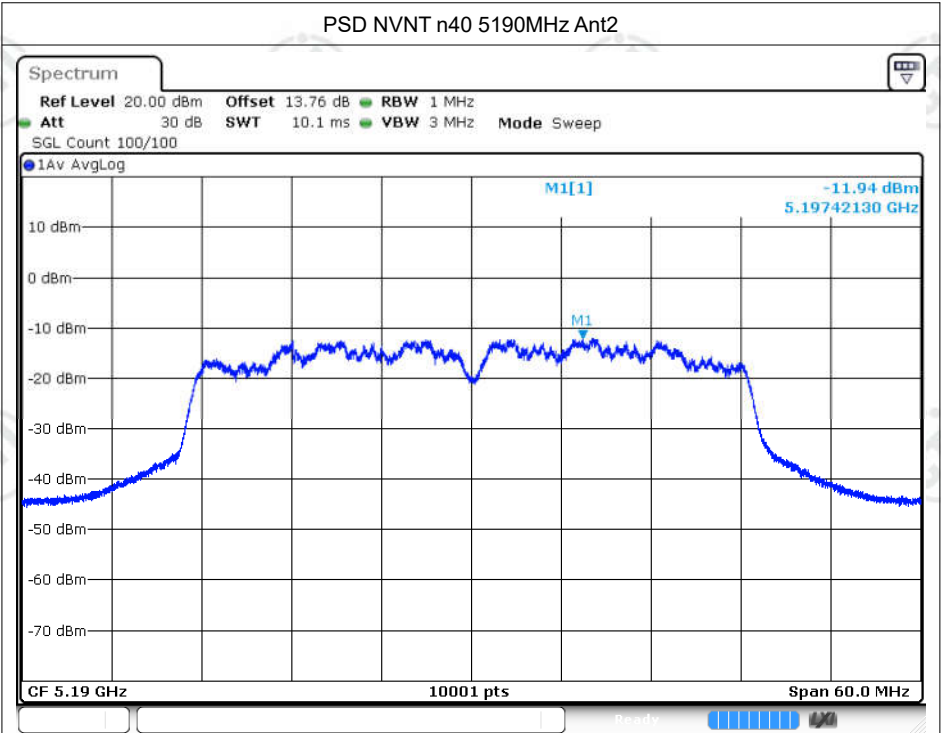


Date: 6 JAN.2025 14:06:37

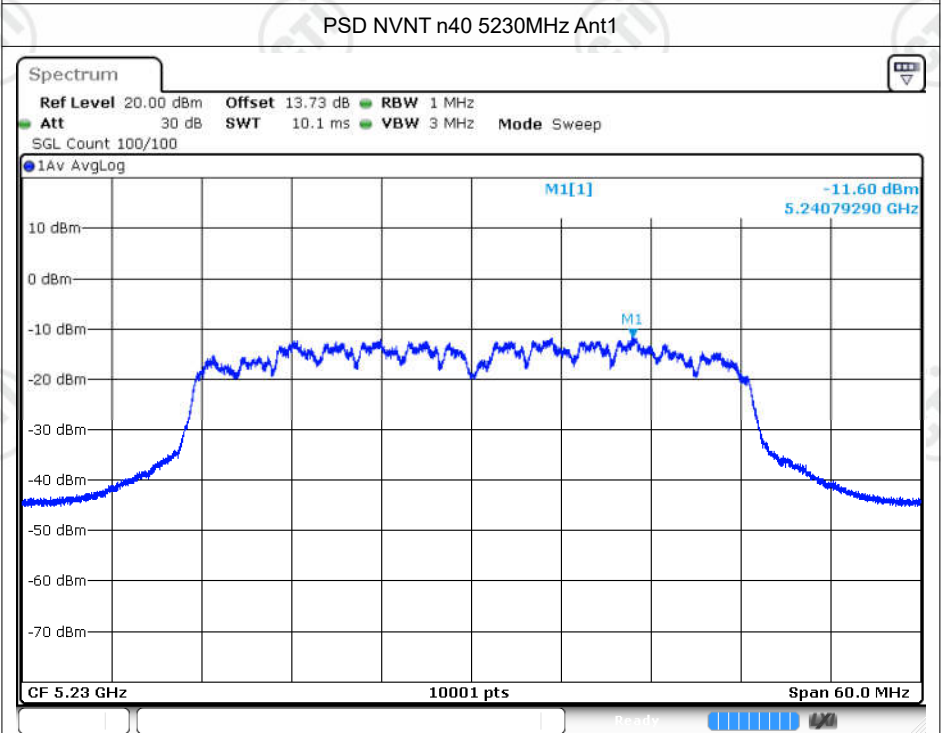


Date: 6 JAN.2025 14:06:57

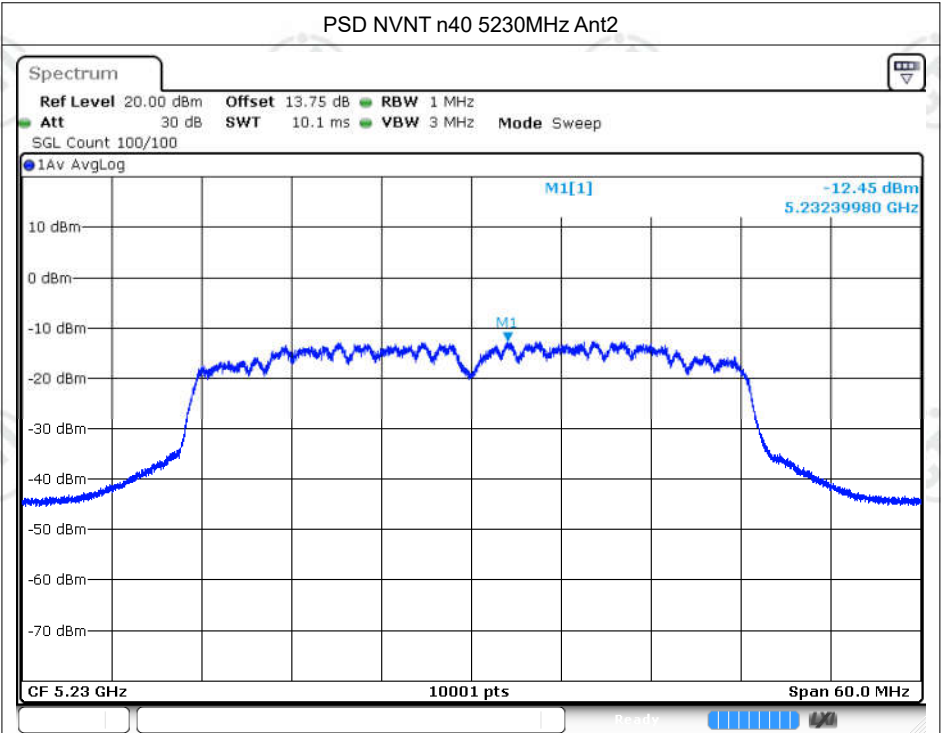


Date: 6 JAN 2025 14:07:00

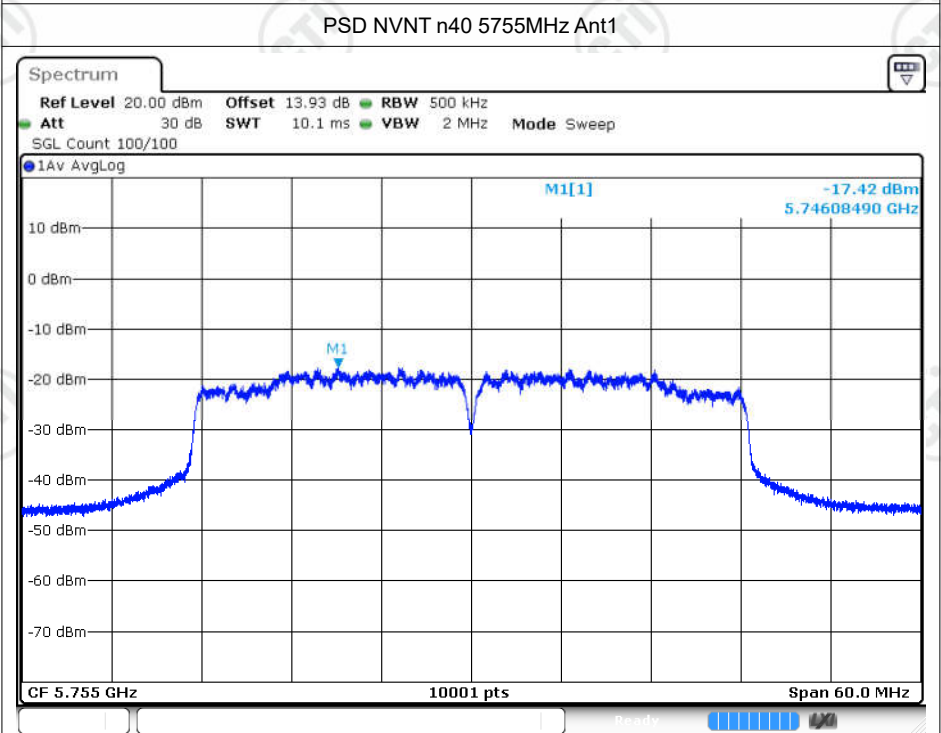



Date: 6 JAN 2025 13:45:18

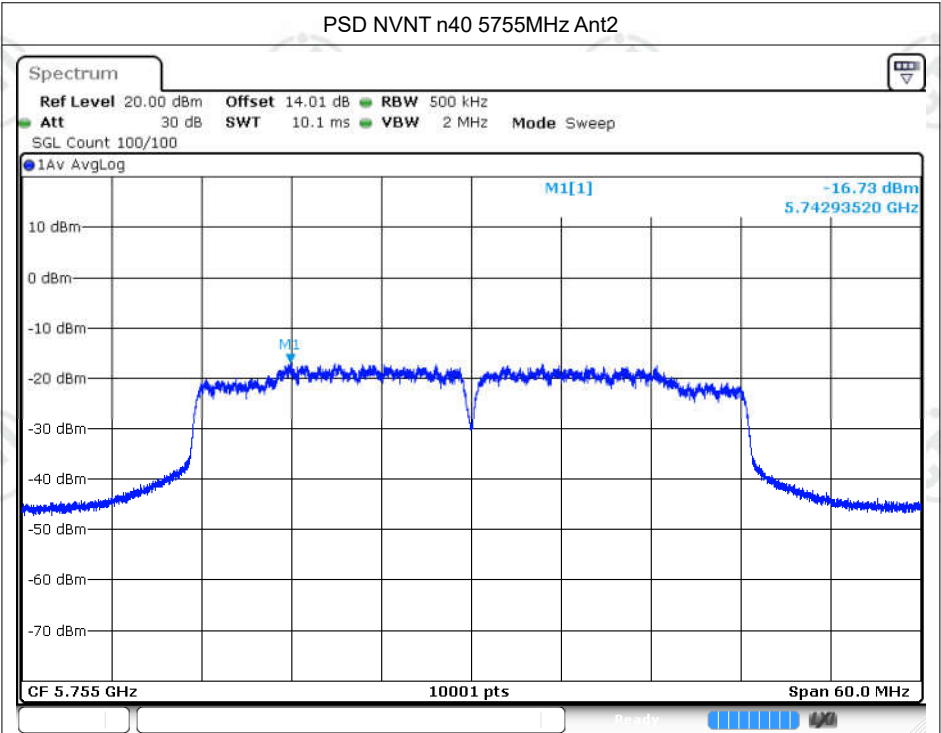


Date: 6 JAN 2025 13:45:21

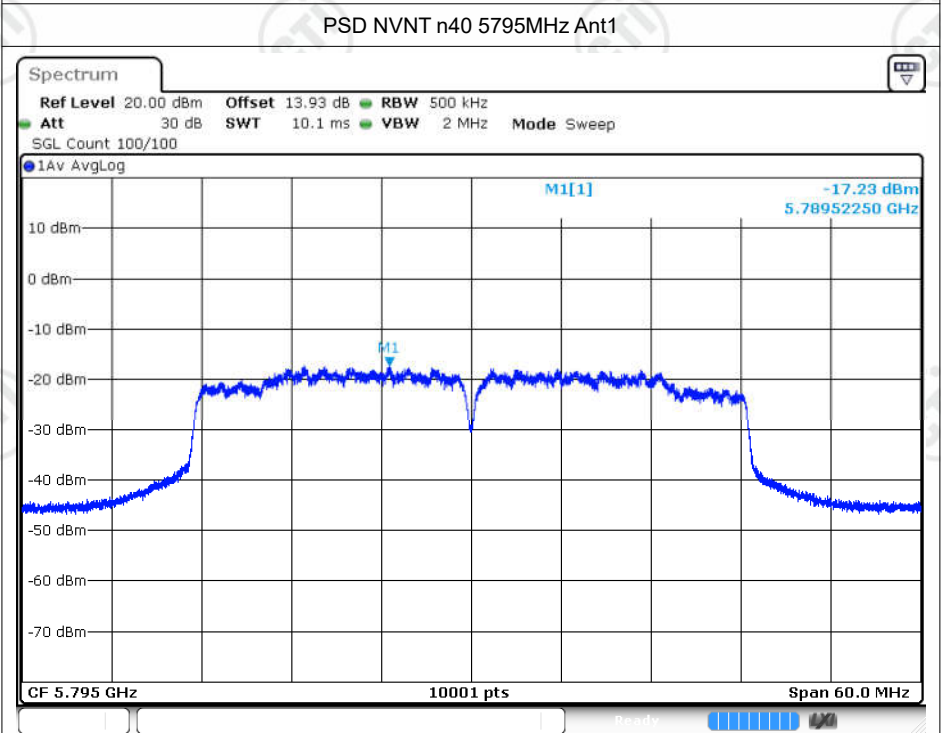


Date: 6 JAN 2025 13:46:22

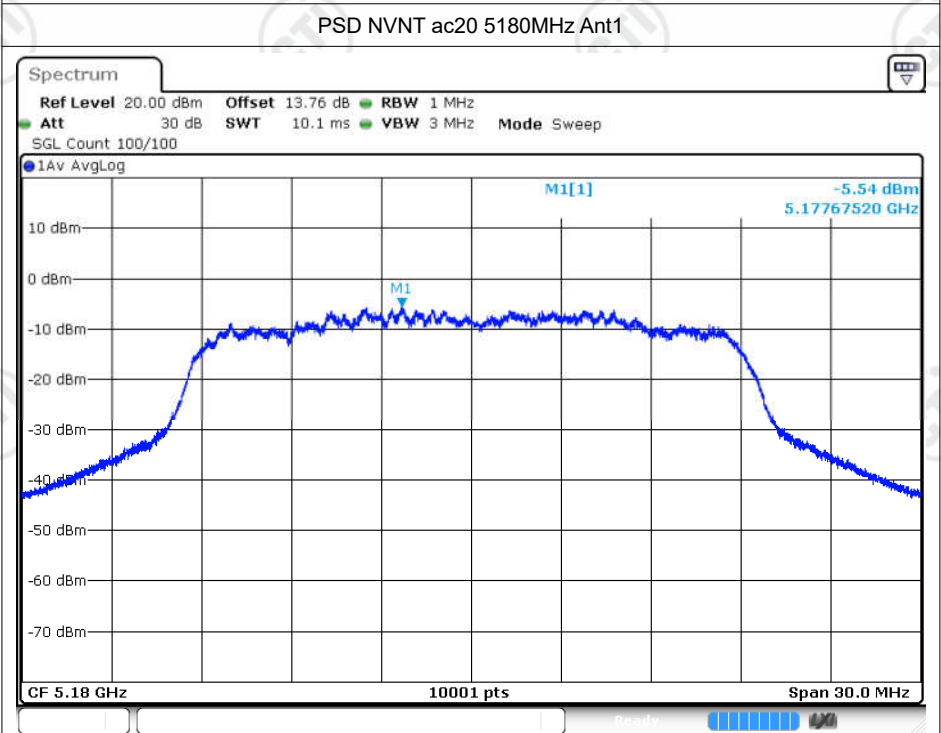
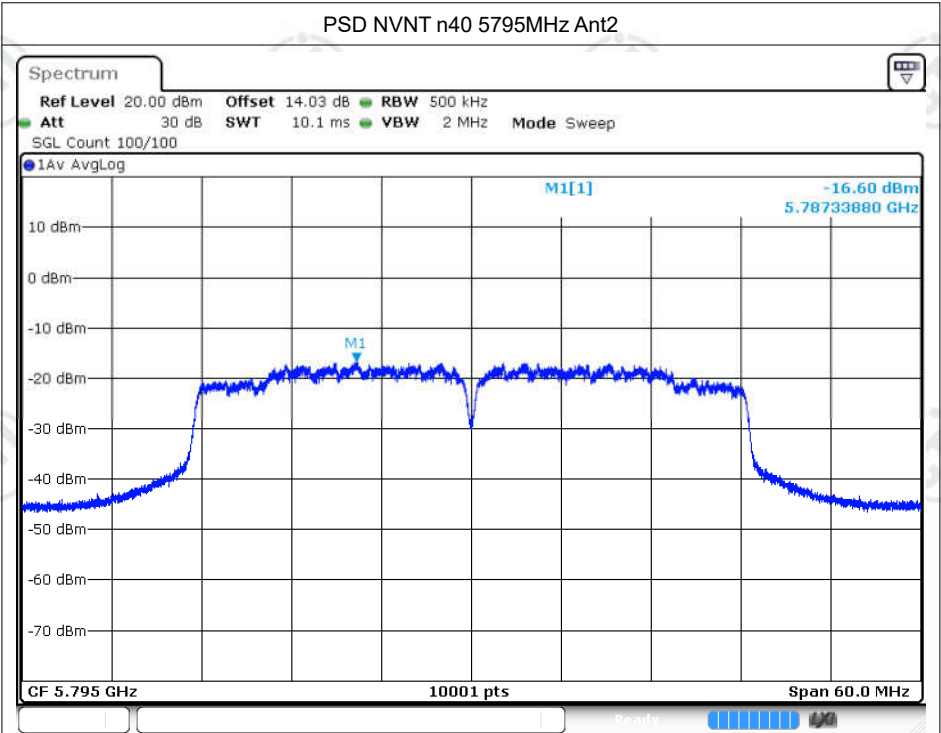


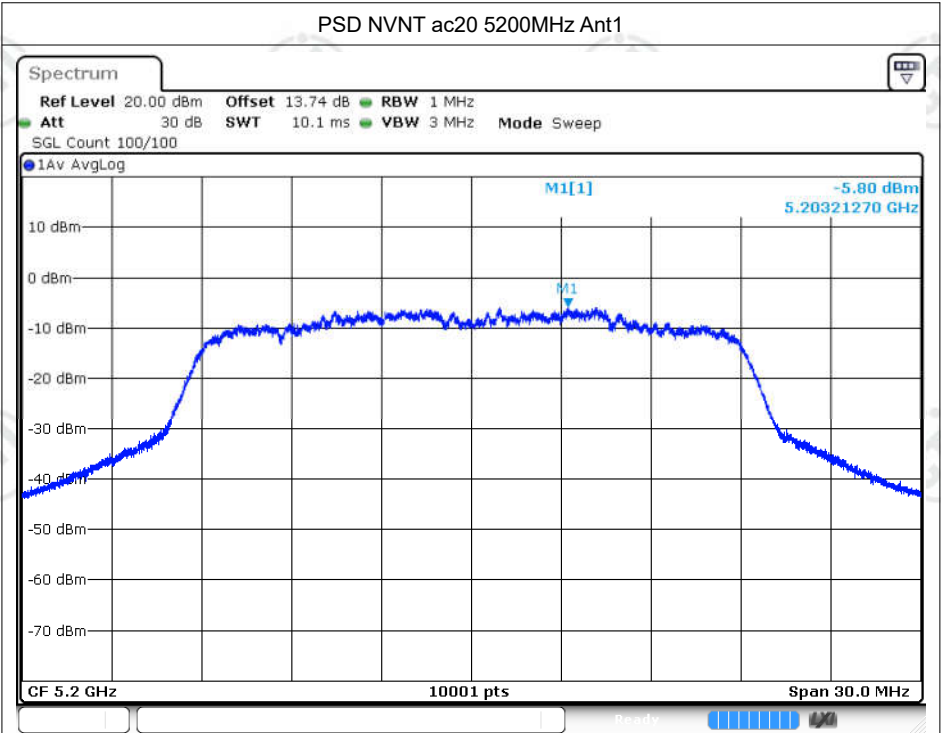


Date: 6 JAN 2025 10:43:25

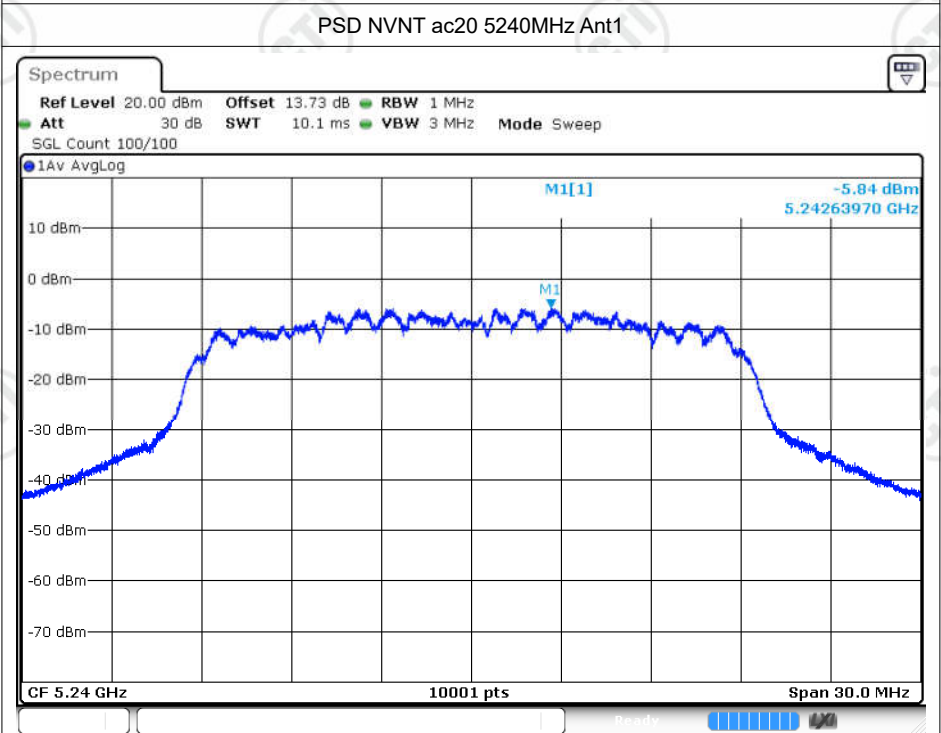


Date: 6 JAN 2025 10:44:02

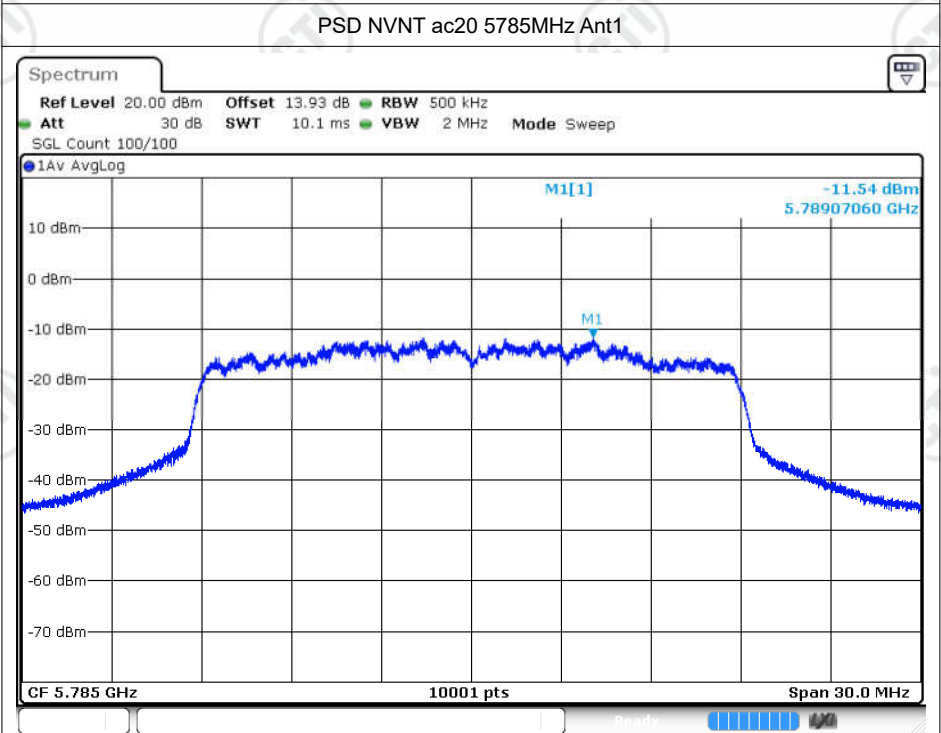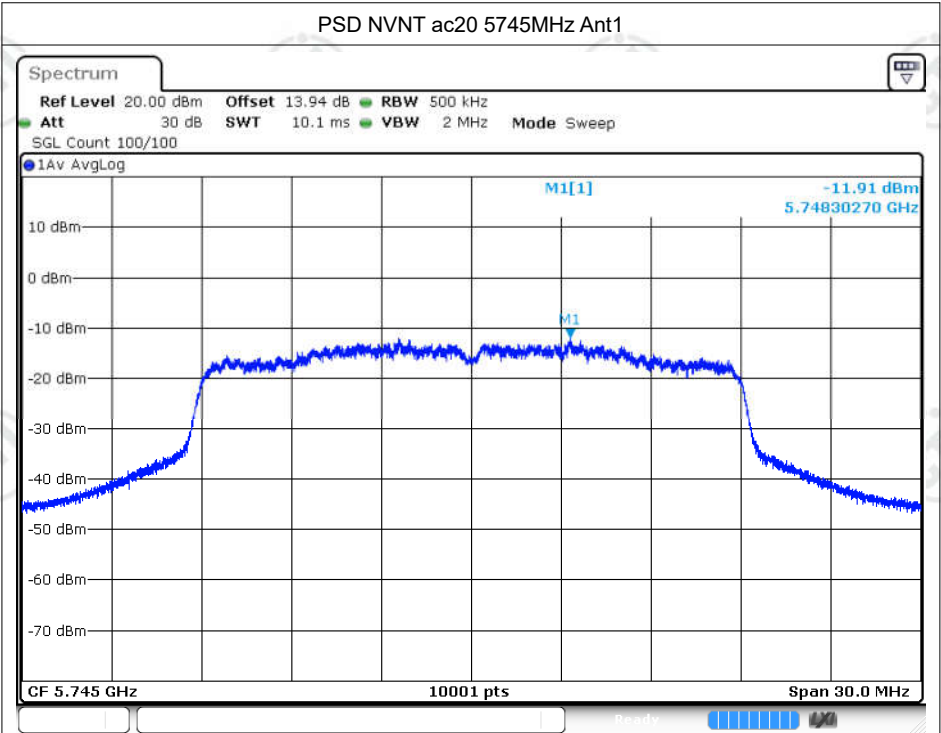


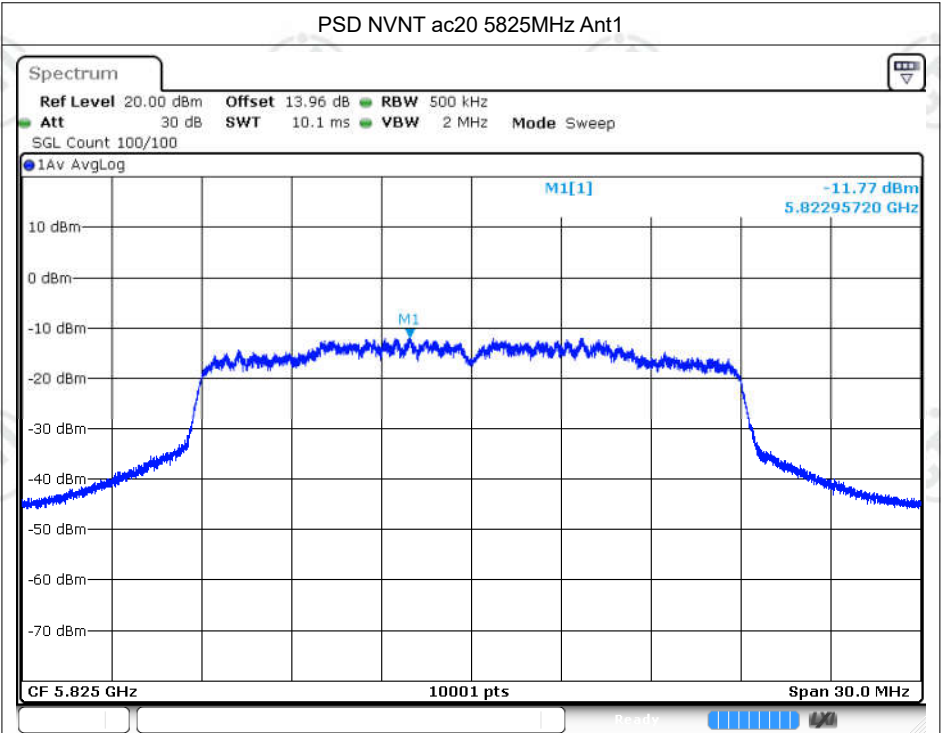


Date: 6 JAN 2025 13:06:18

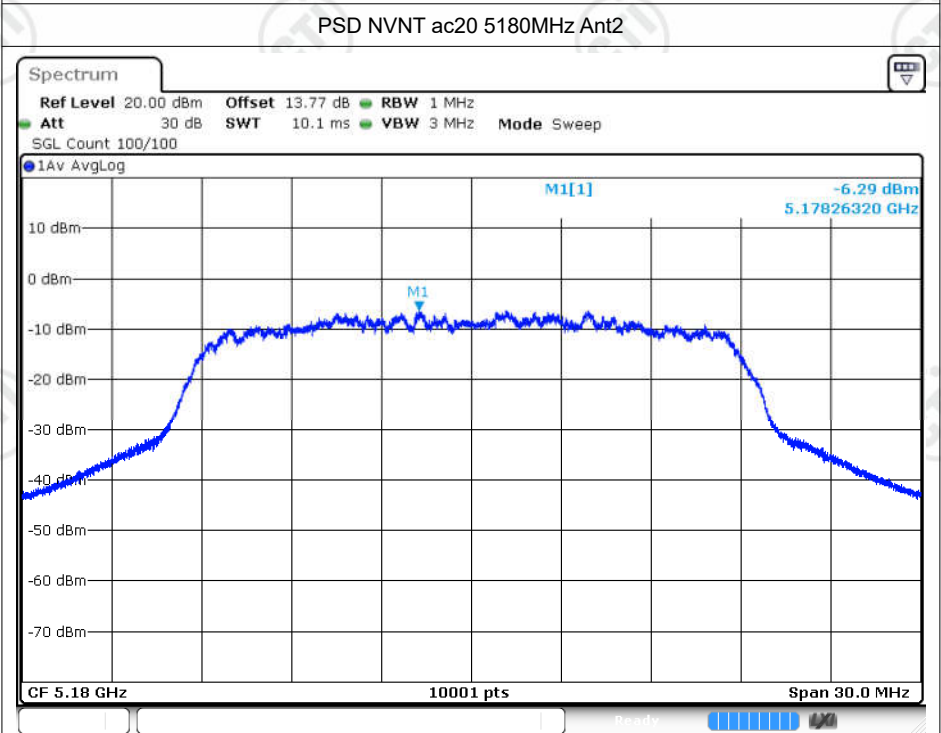


Date: 6 JAN 2025 11:09:08

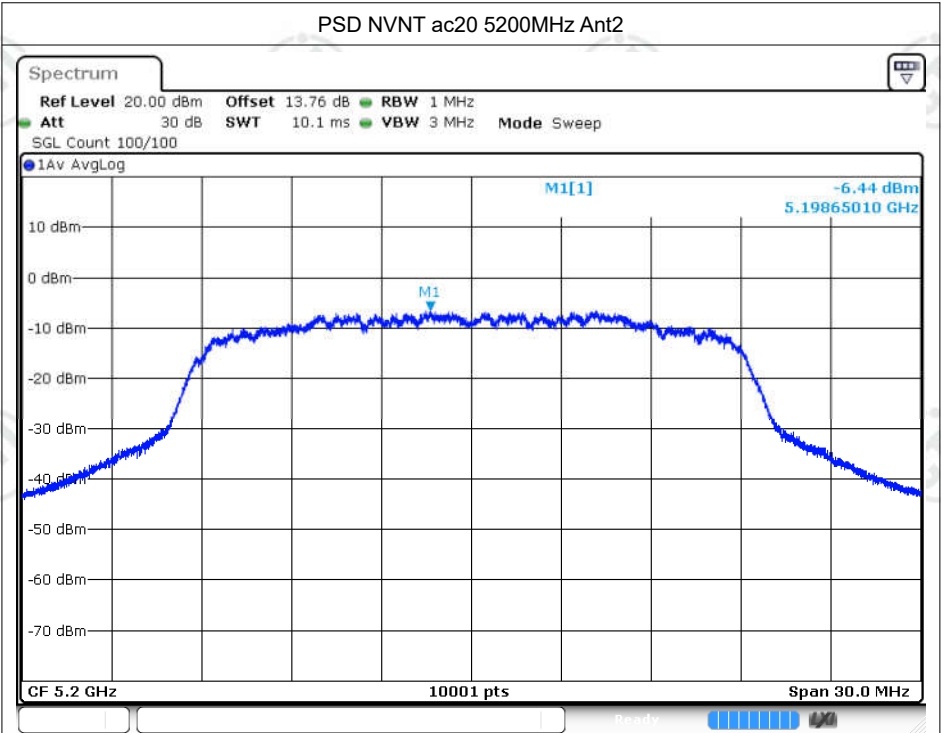


Date: 6 JAN 2025 11:10:39

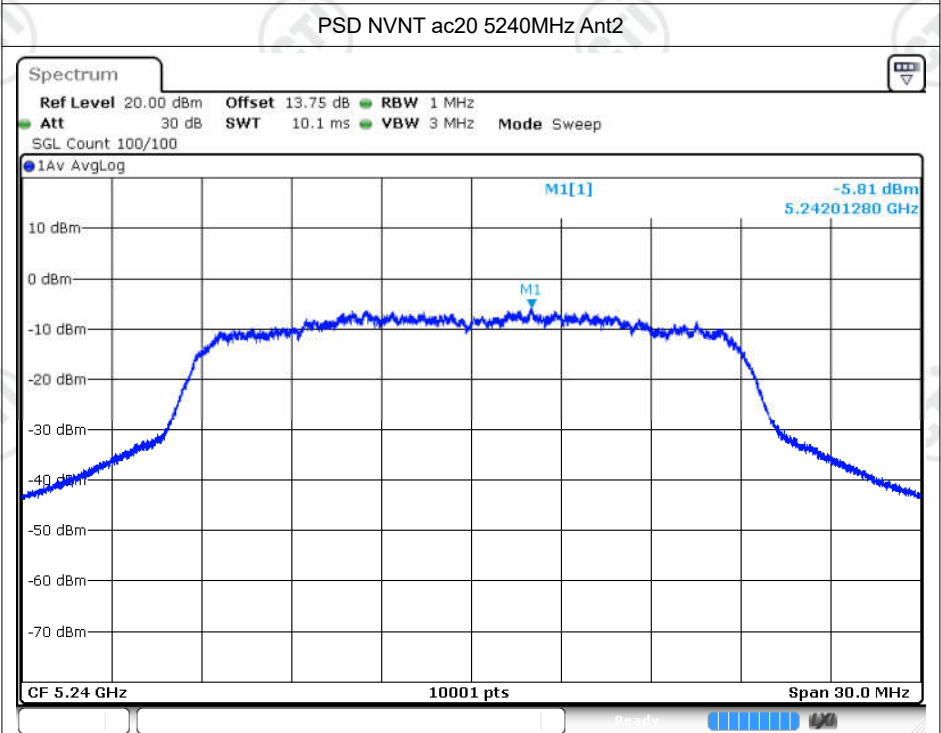



Date: 6 JAN 2025 11:12:12

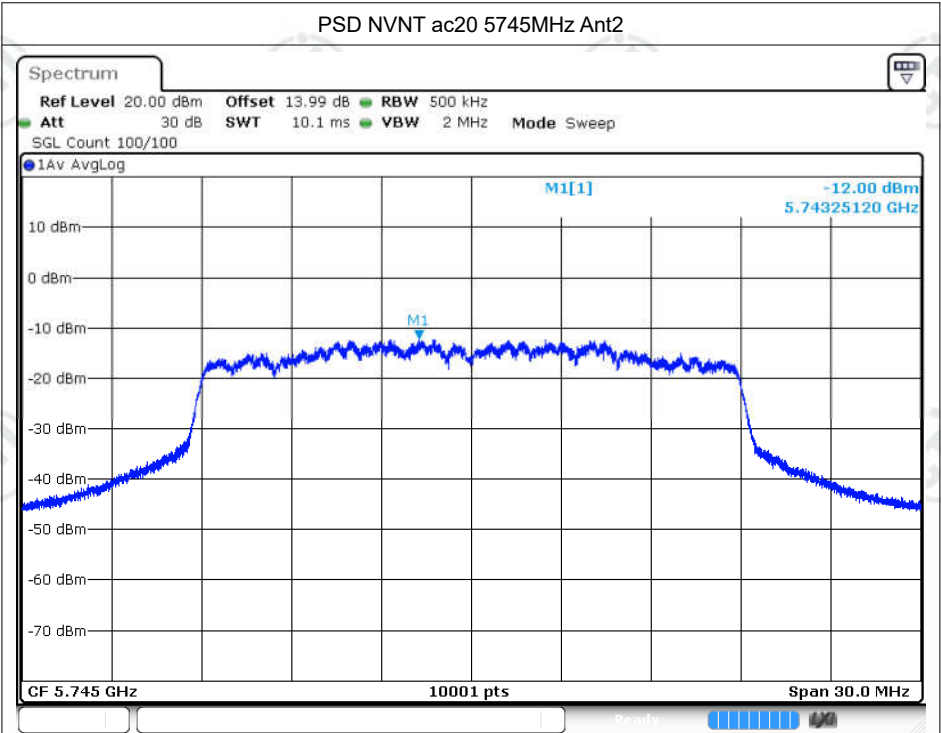


Date: 6 JAN 2025 13:28:40

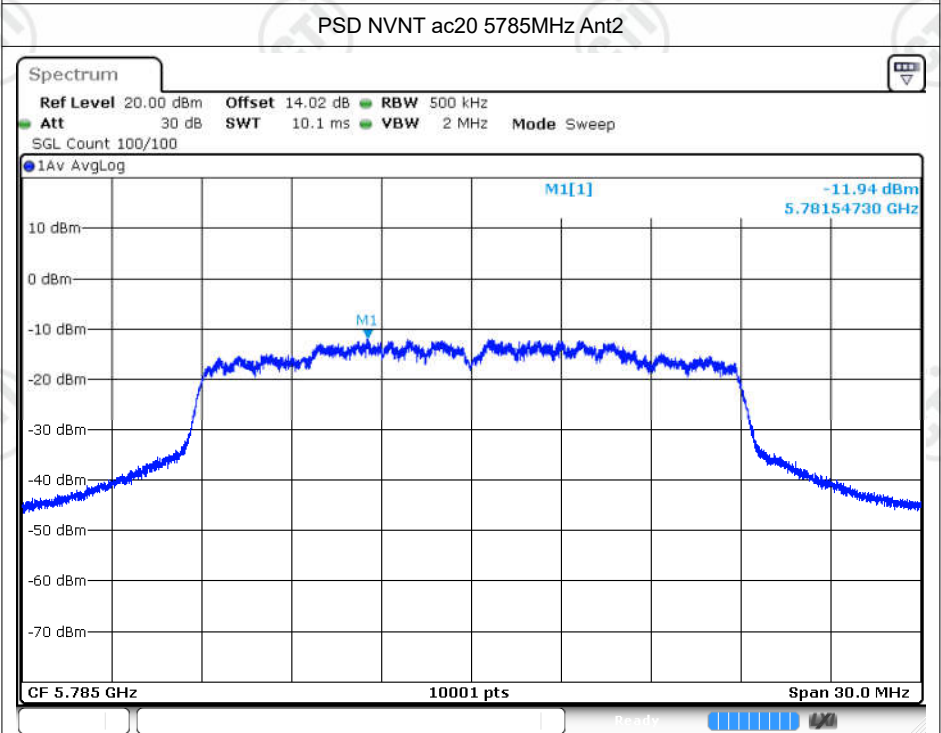


Date: 6 JAN 2025 13:30:01

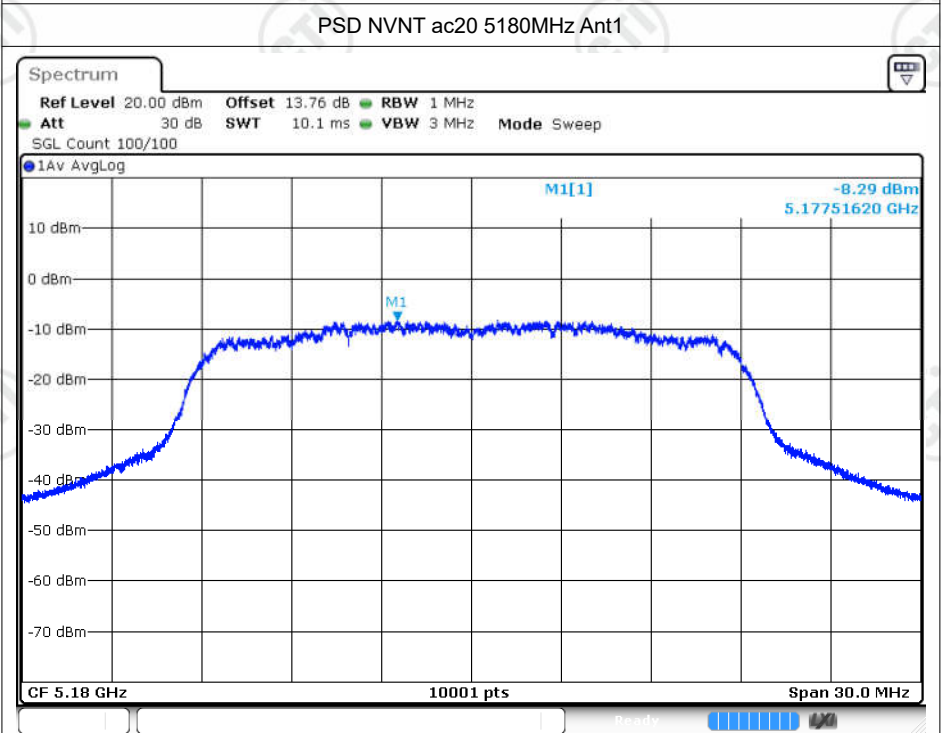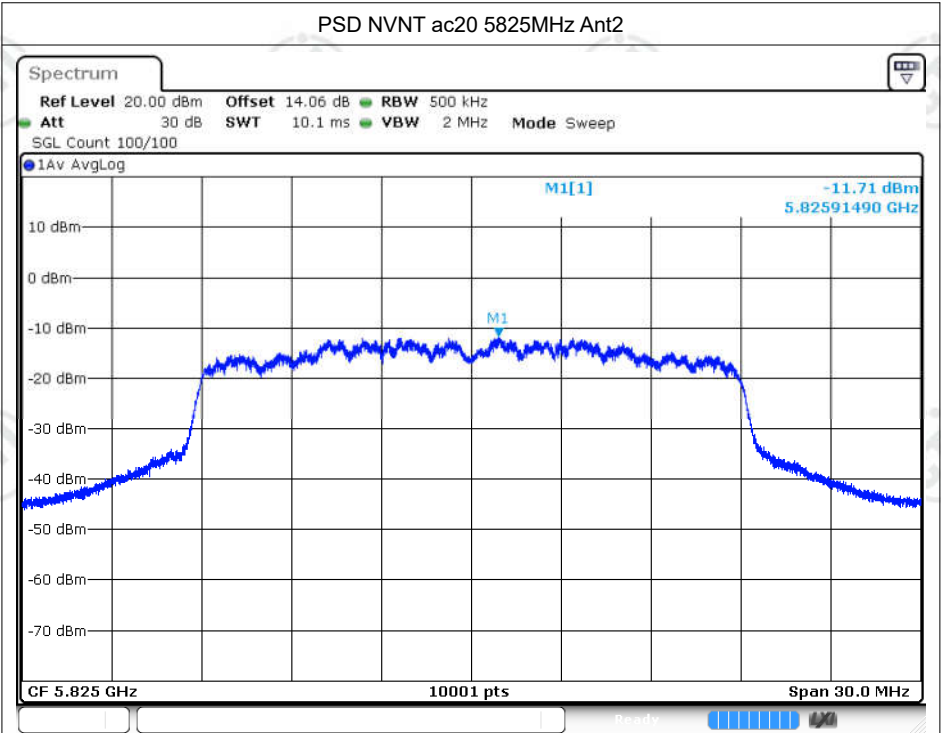


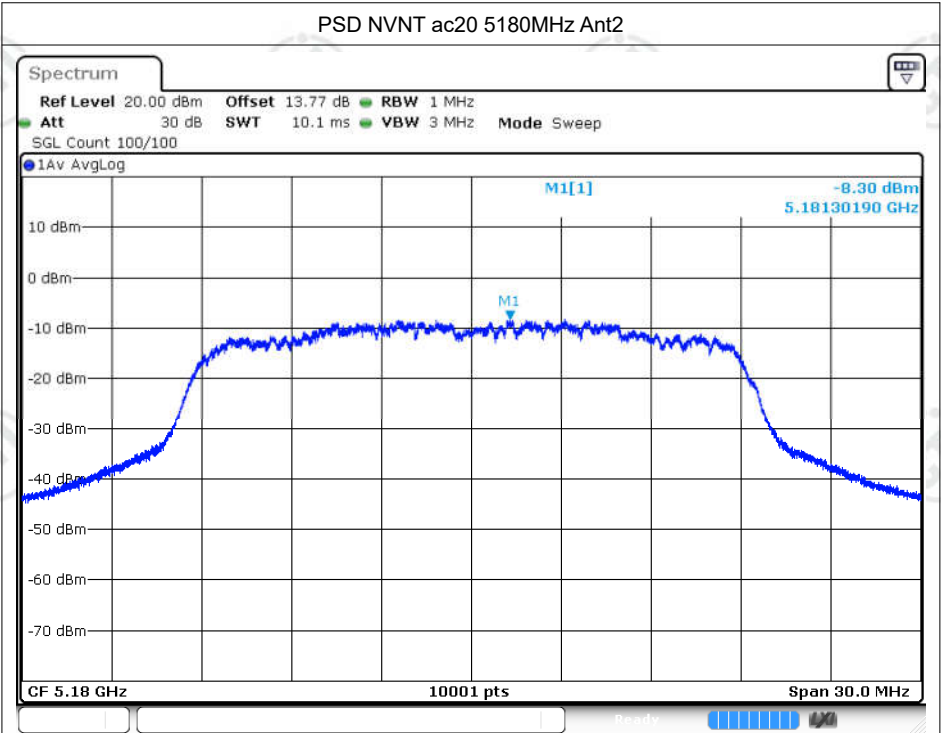


Date: 6 JAN 2025 11:25:52

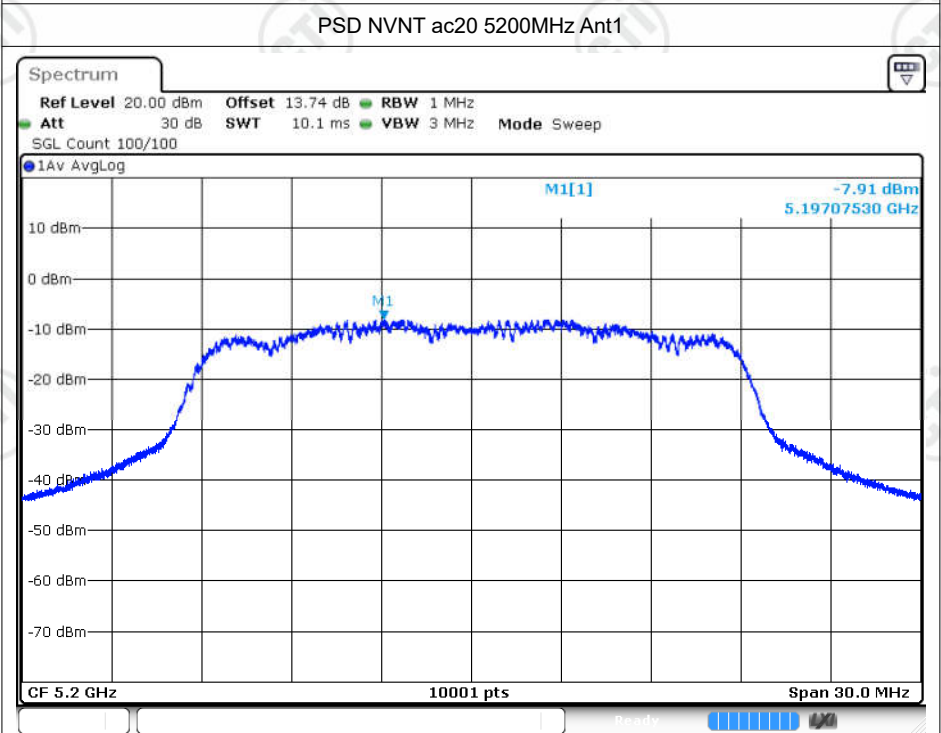


Date: 6 JAN 2025 11:26:40

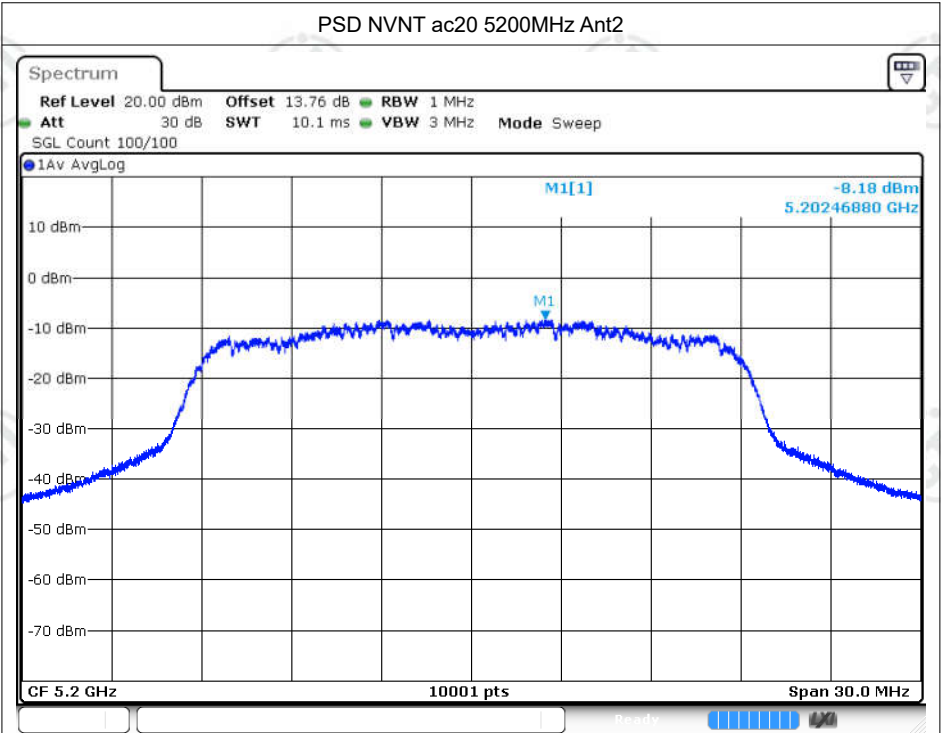


Date: 6 JAN 2025 11:26:43

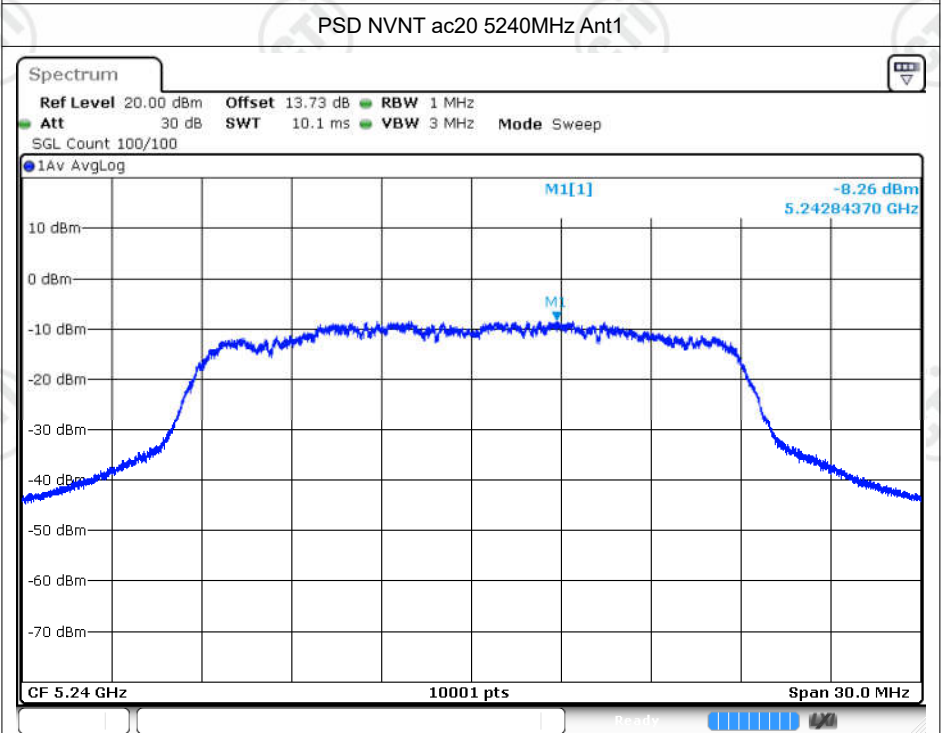



Date: 6 JAN 2025 11:27:16

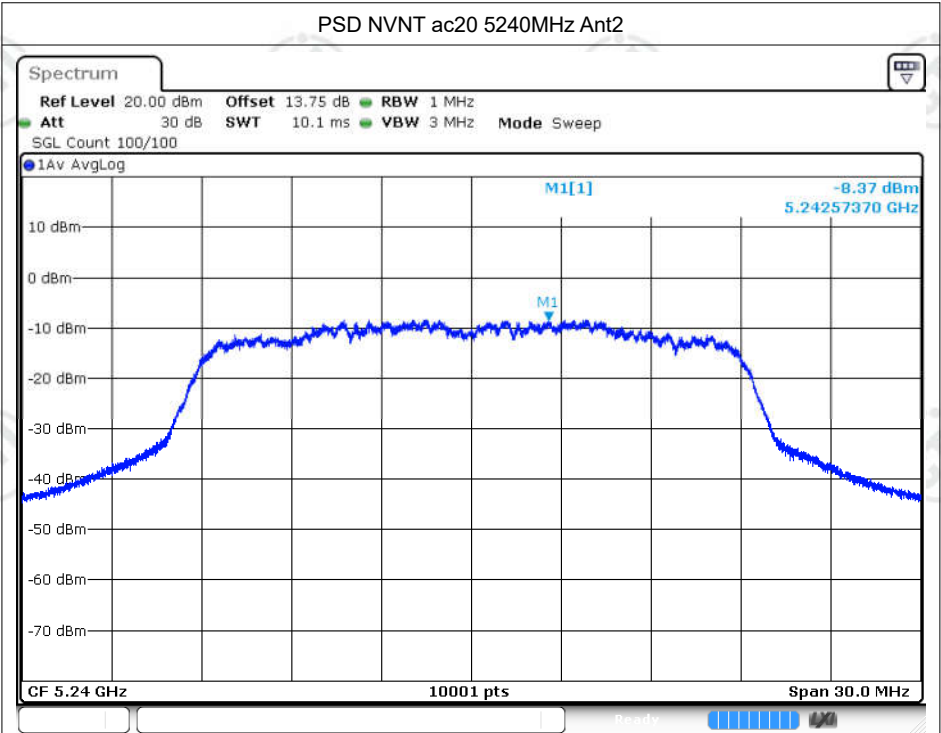


Date: 6 JAN.2025 11:27:19

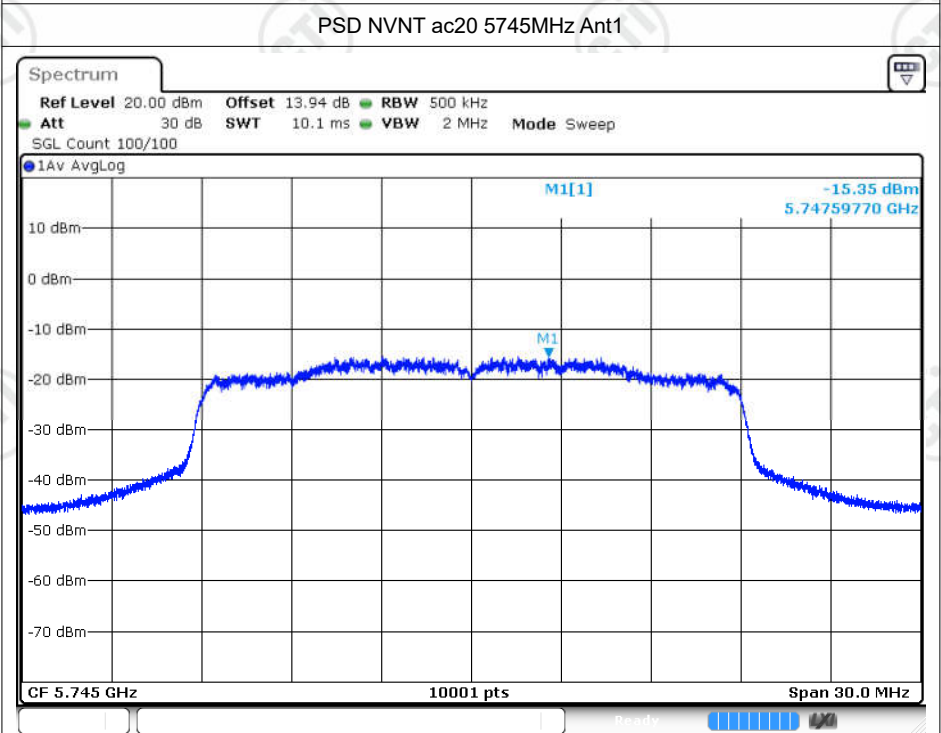


Date: 6 JAN.2025 13:48:23

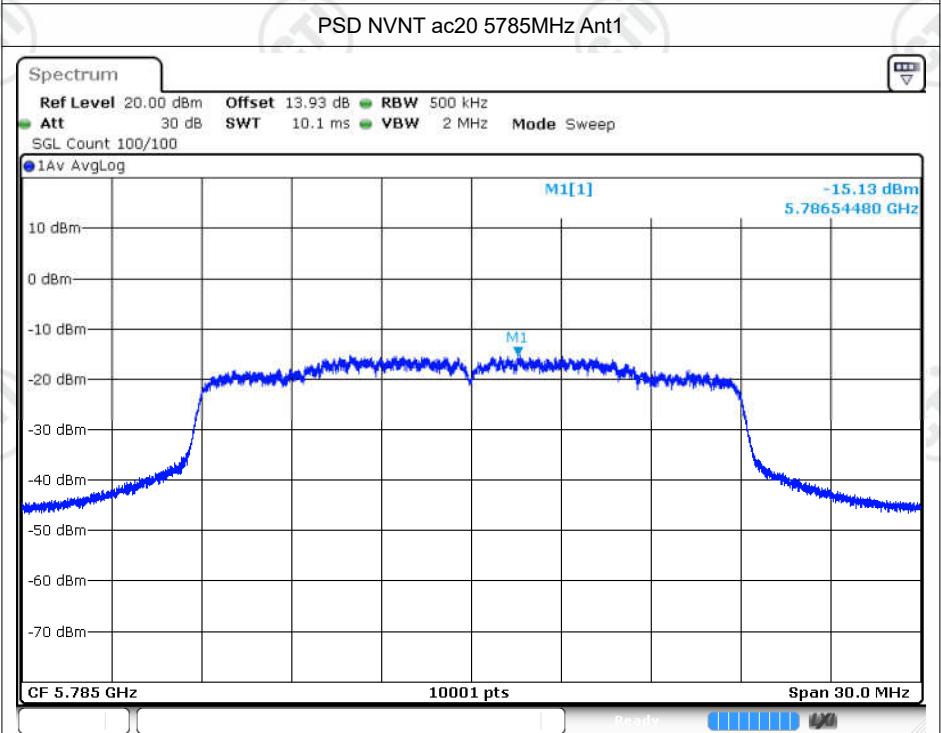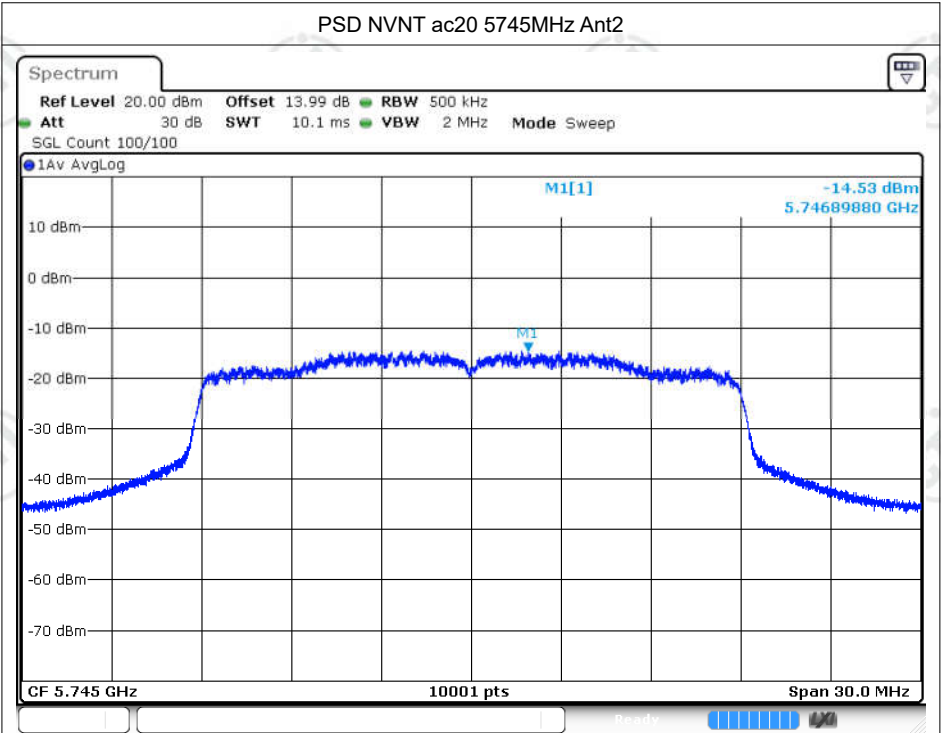


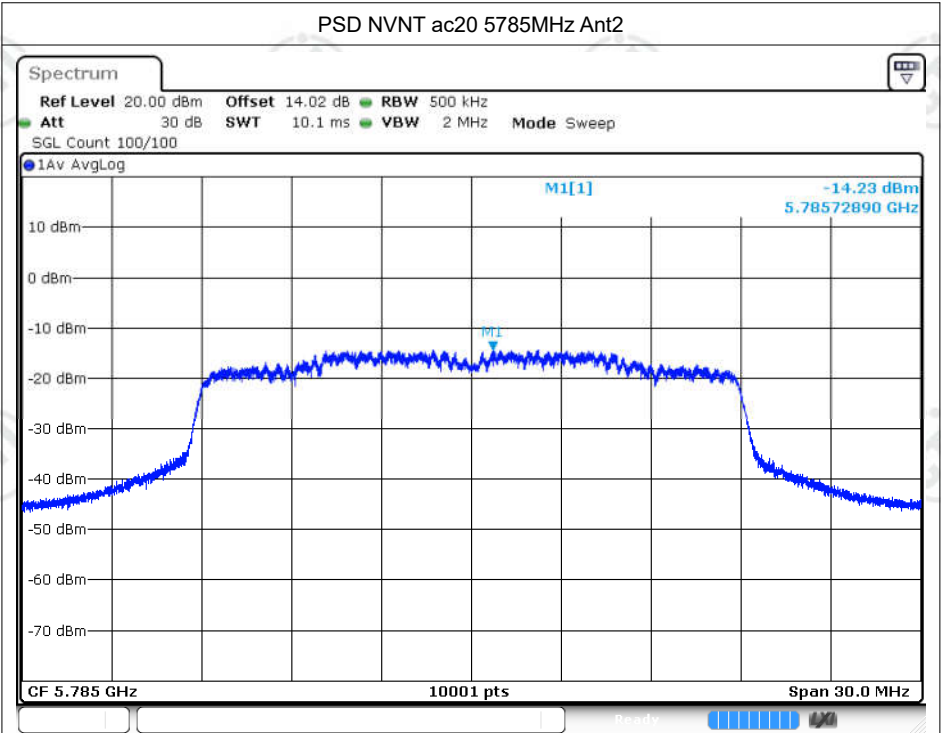


Date: 6 JAN 2025 13:49:42

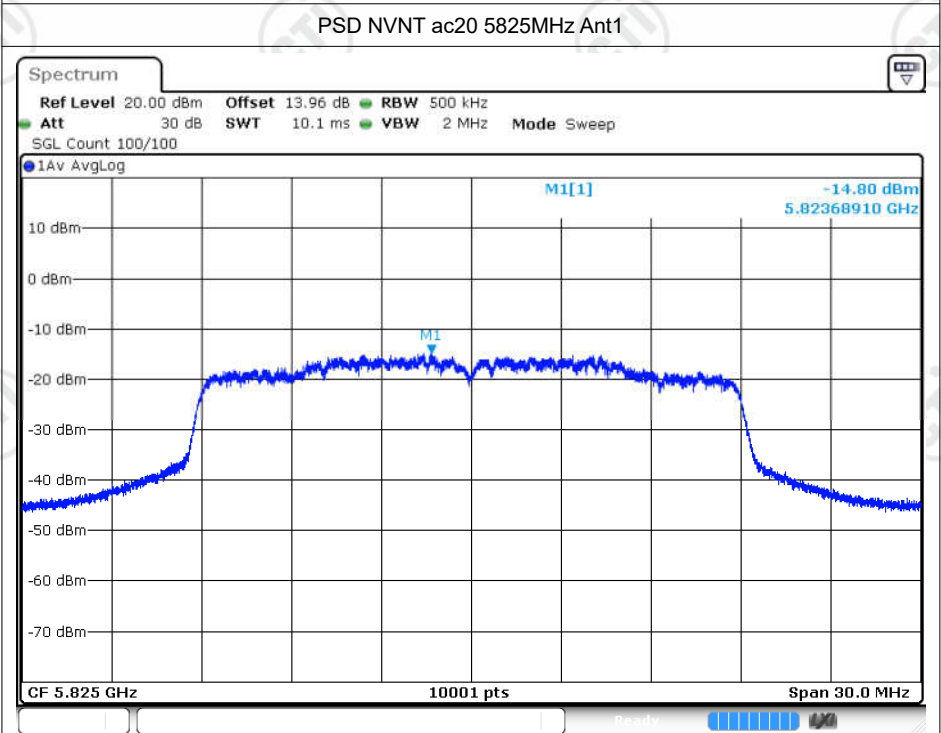


Date: 6 JAN 2025 13:50:22

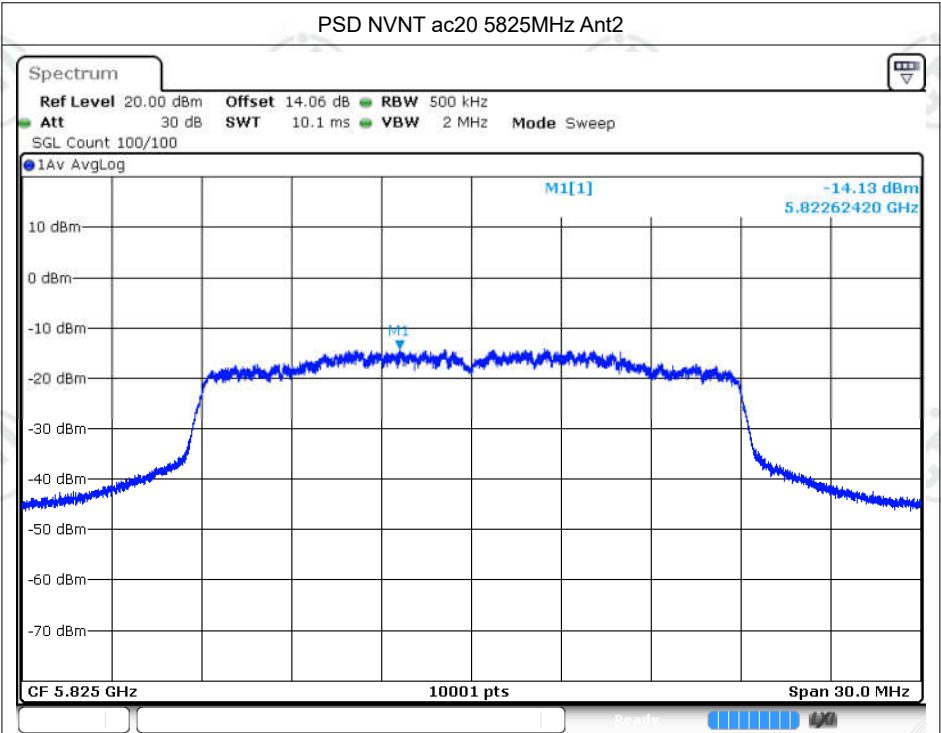


Date: 6 JAN 2025 13:50:25

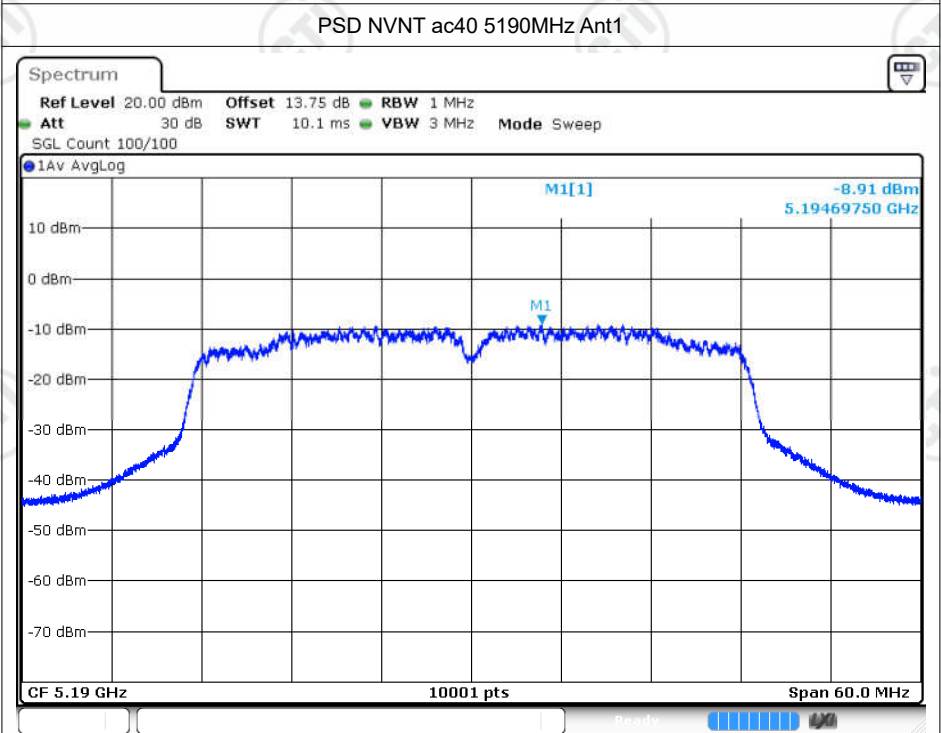


Date: 6 JAN 2025 10:46:10

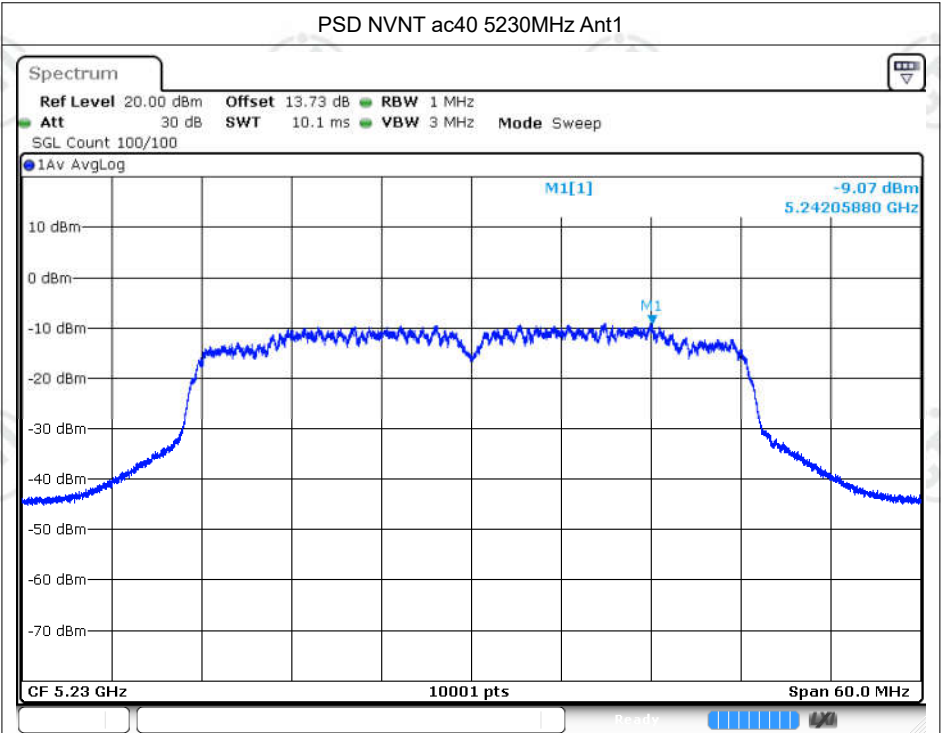


Date: 6 JAN 2025 10:47:40

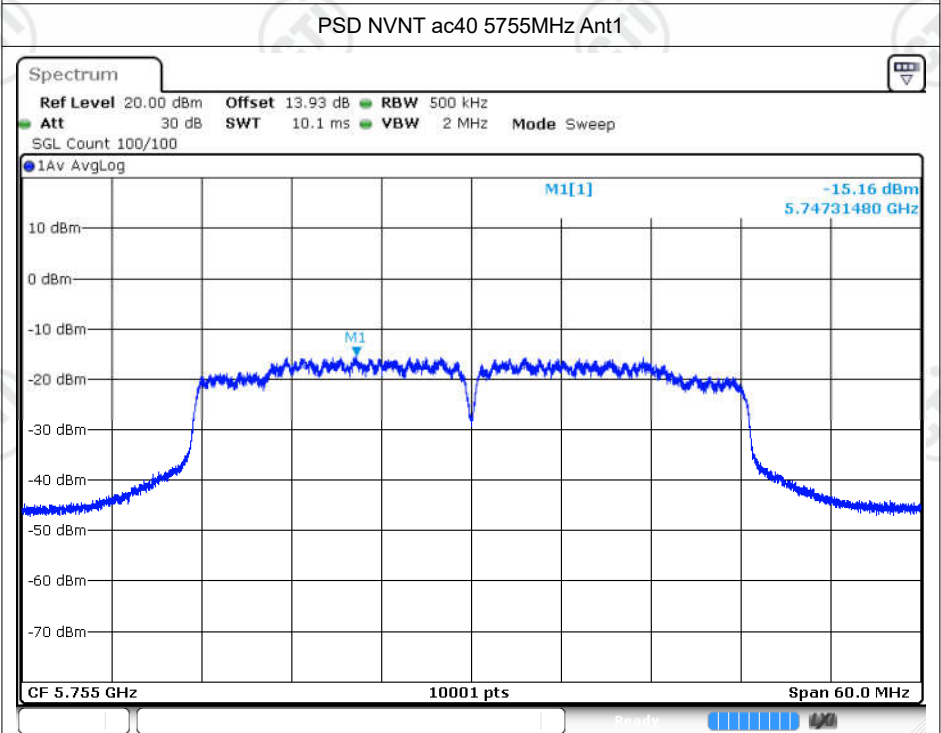


Date: 6 JAN 2025 13:08:10

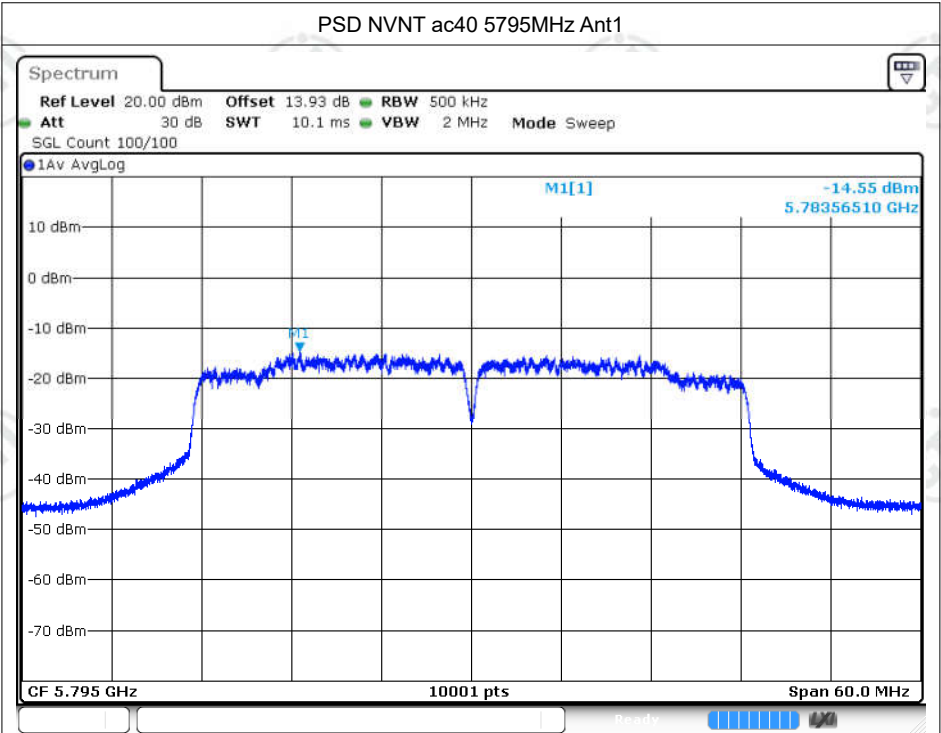


Date: 6.JAN.2025 13:11:09

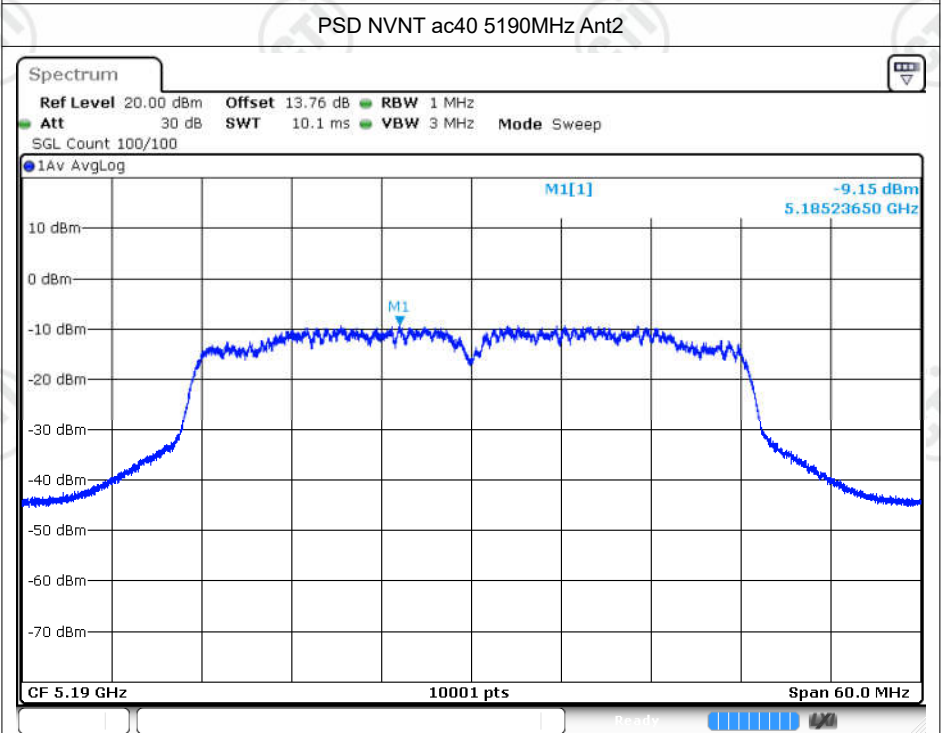


Date: 6.JAN.2025 11:13:45

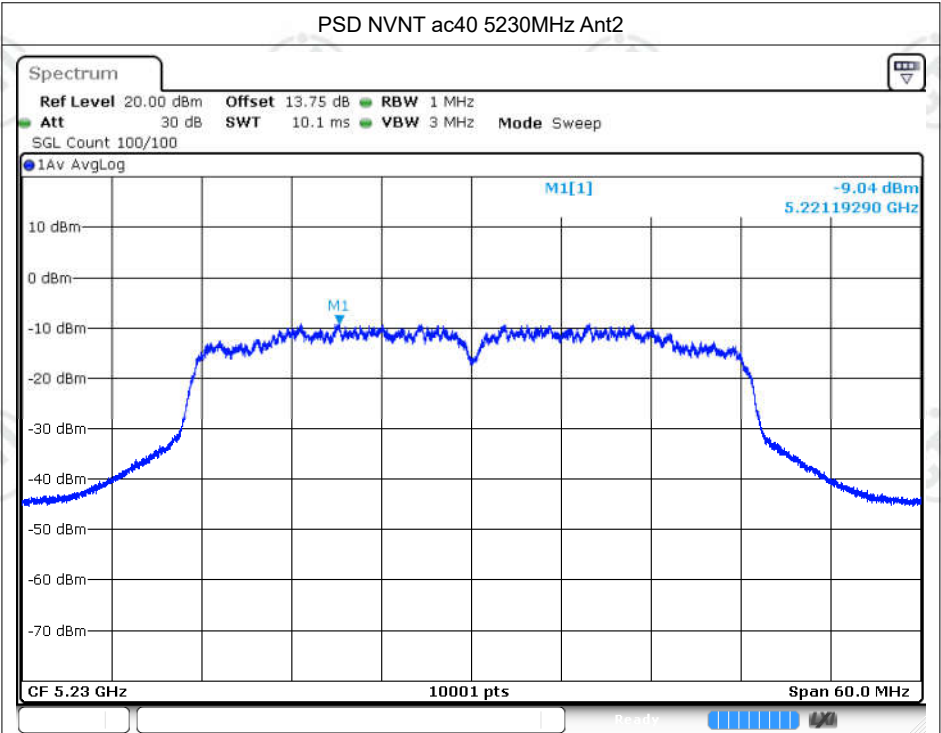


Date: 6 JAN 2025 11:15:15

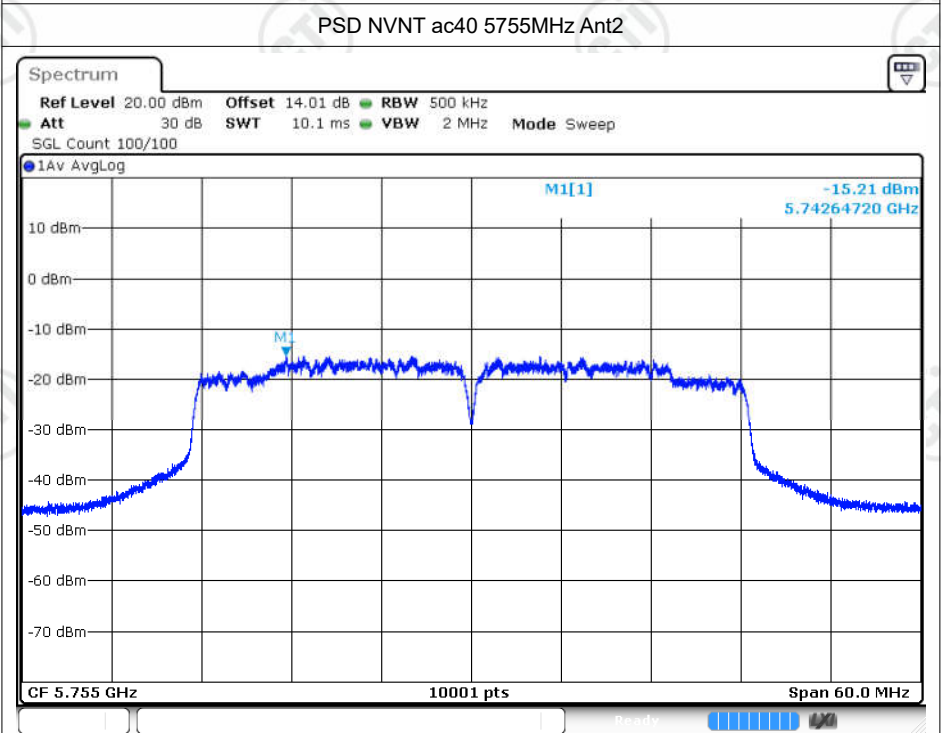



Date: 6 JAN 2025 13:32:12

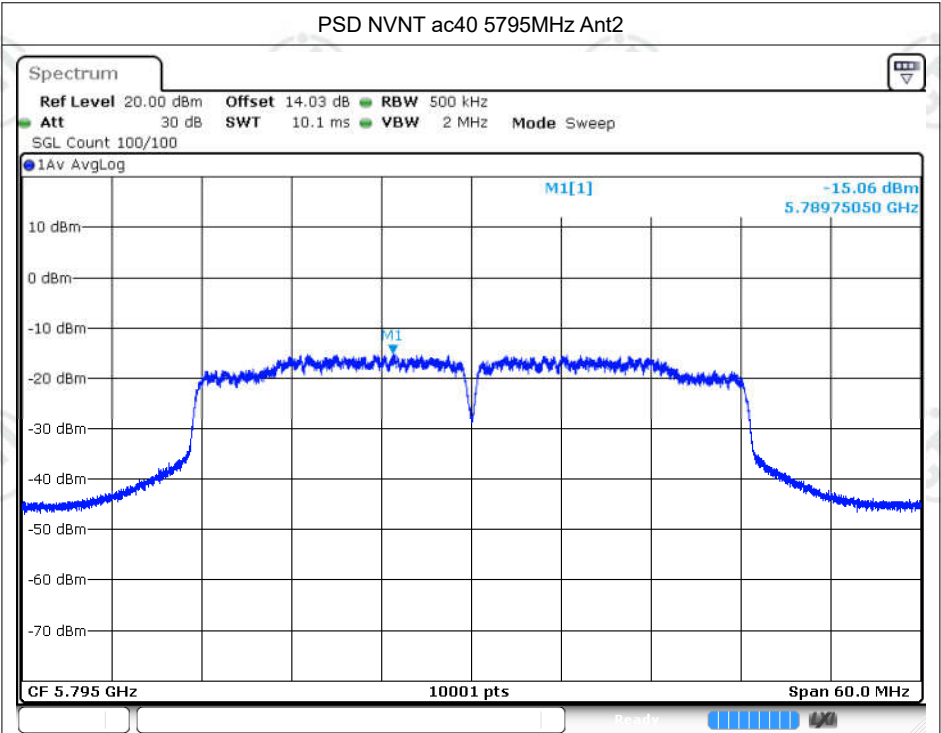


Date: 6 JAN 2025 13:33:40

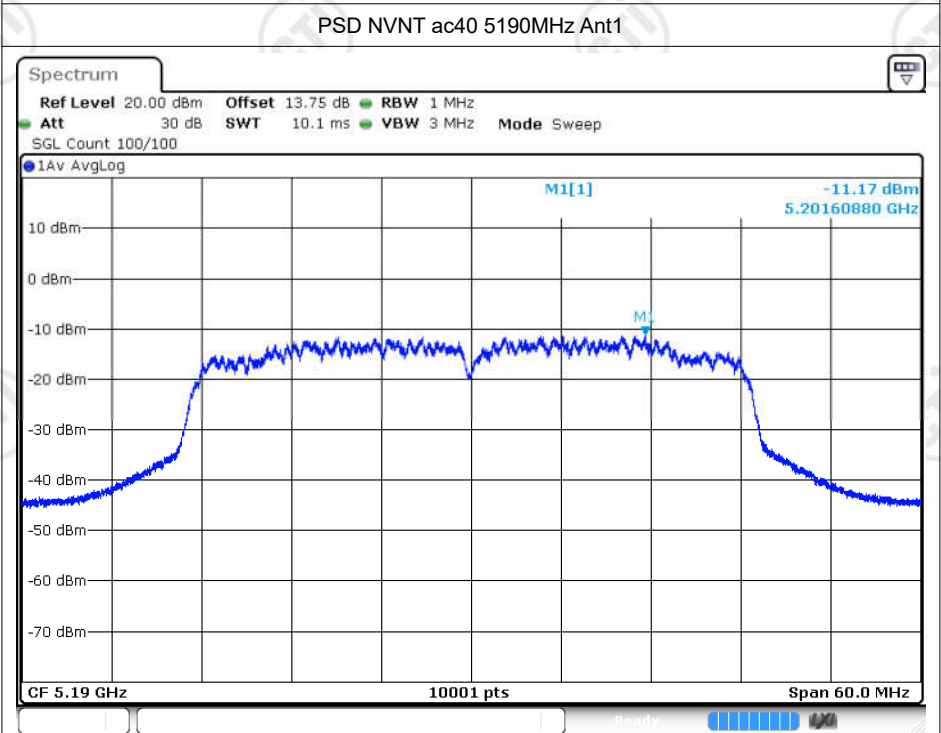


Date: 6 JAN 2025 11:28:36

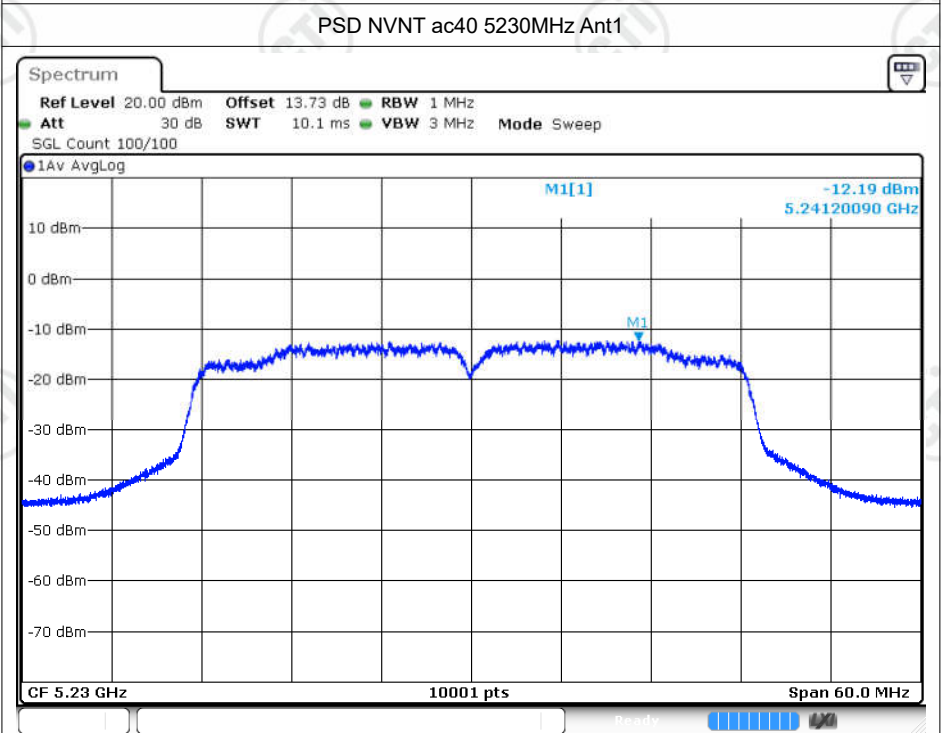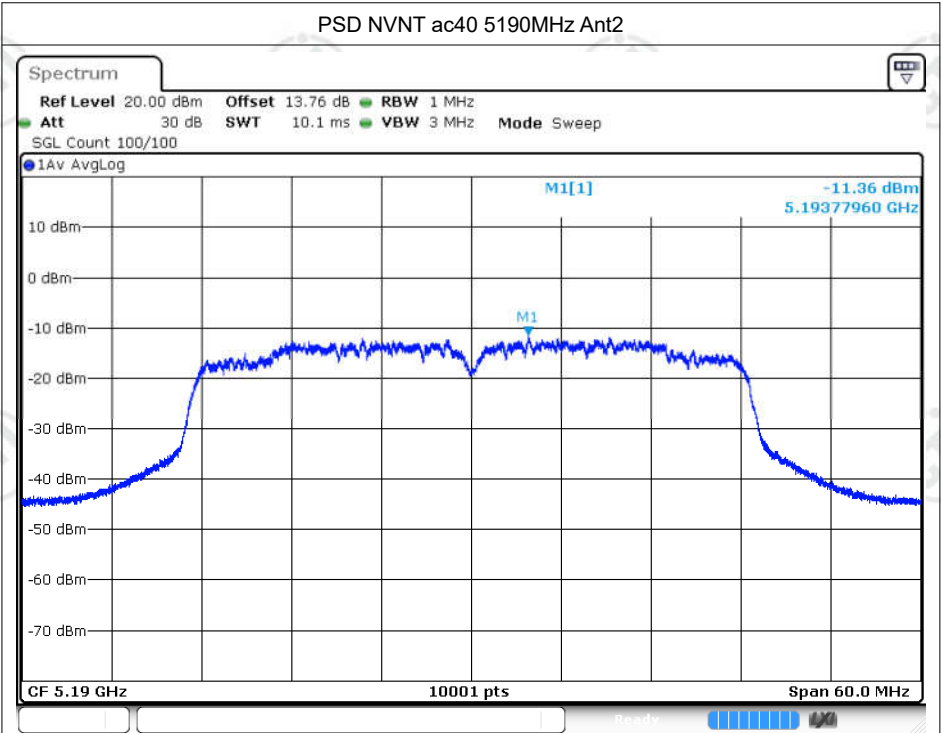


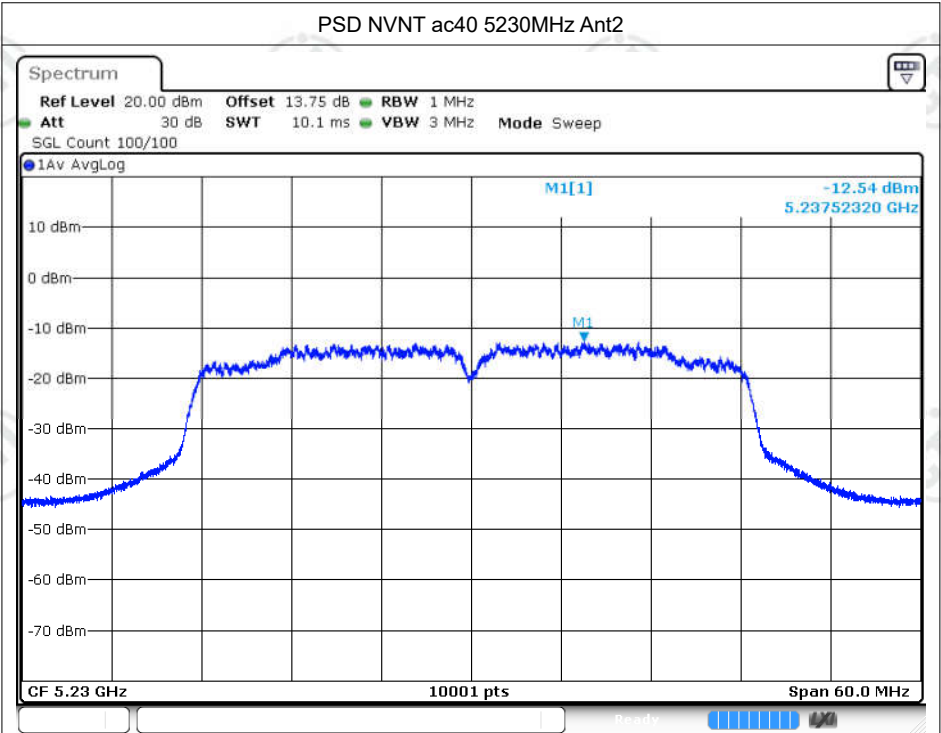


Date: 6 JAN 2025 11:30:29

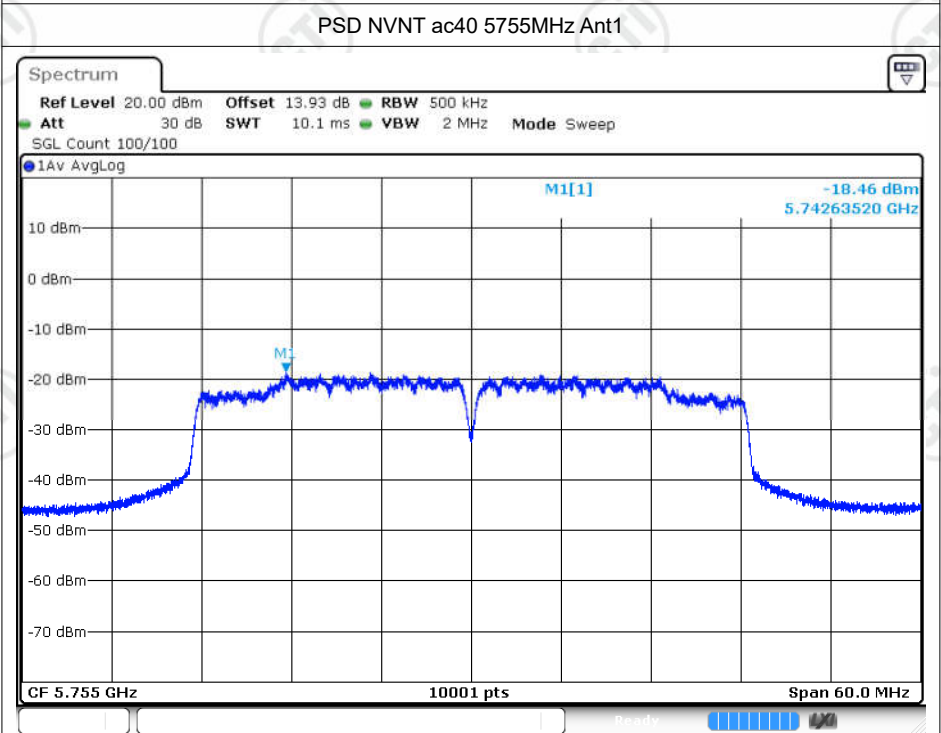


Date: 6 JAN 2025 13:51:47

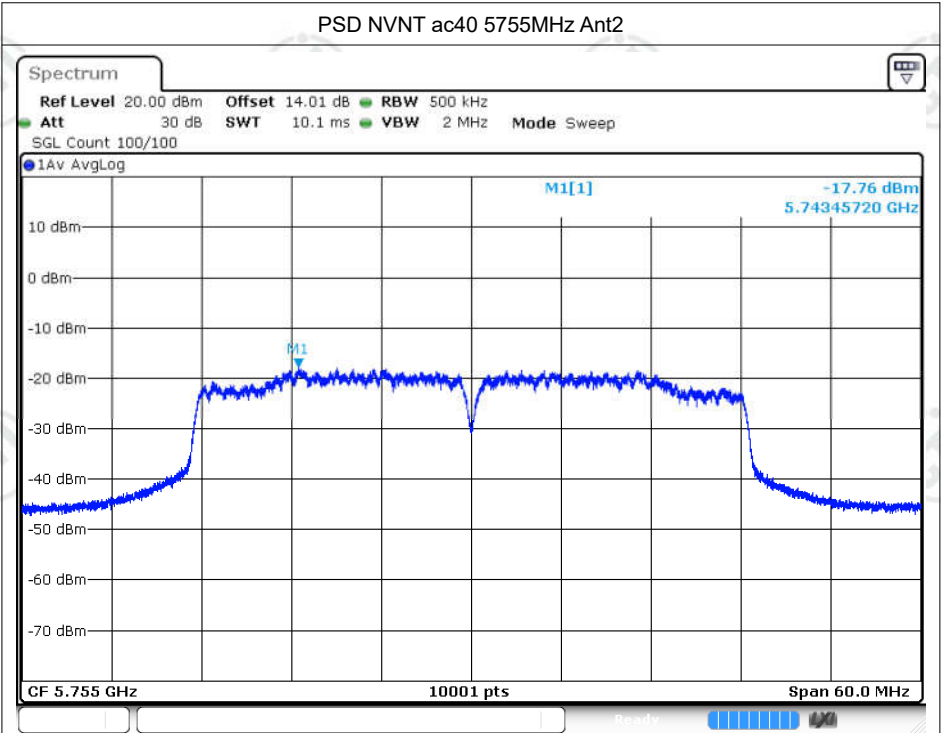


Date: 6 JAN 2025 13:51:50

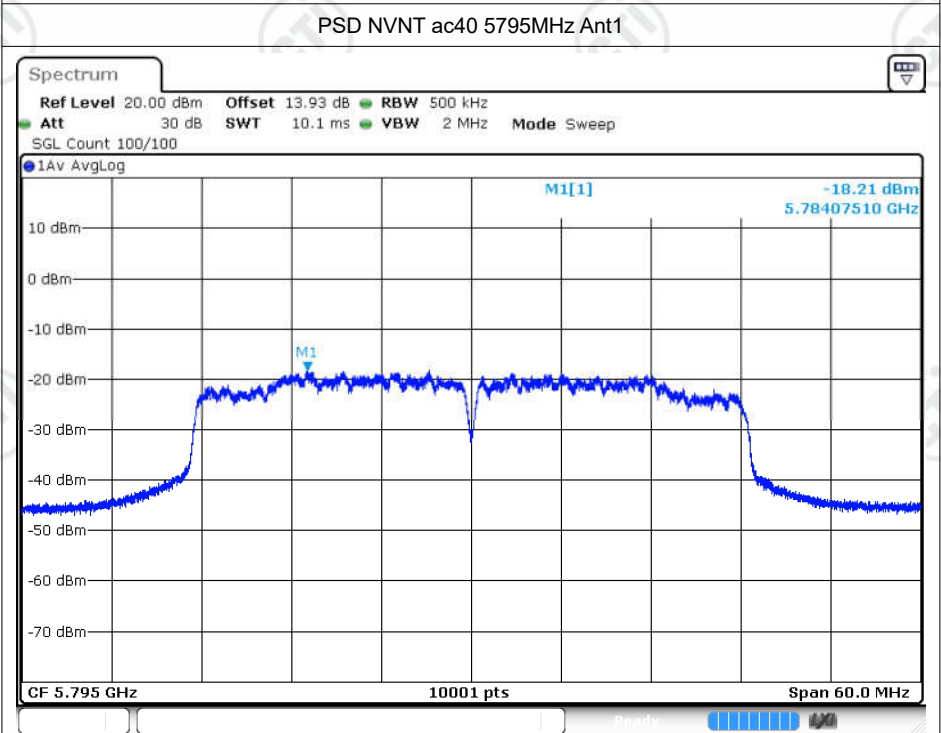



Date: 6 JAN 2025 13:52:48

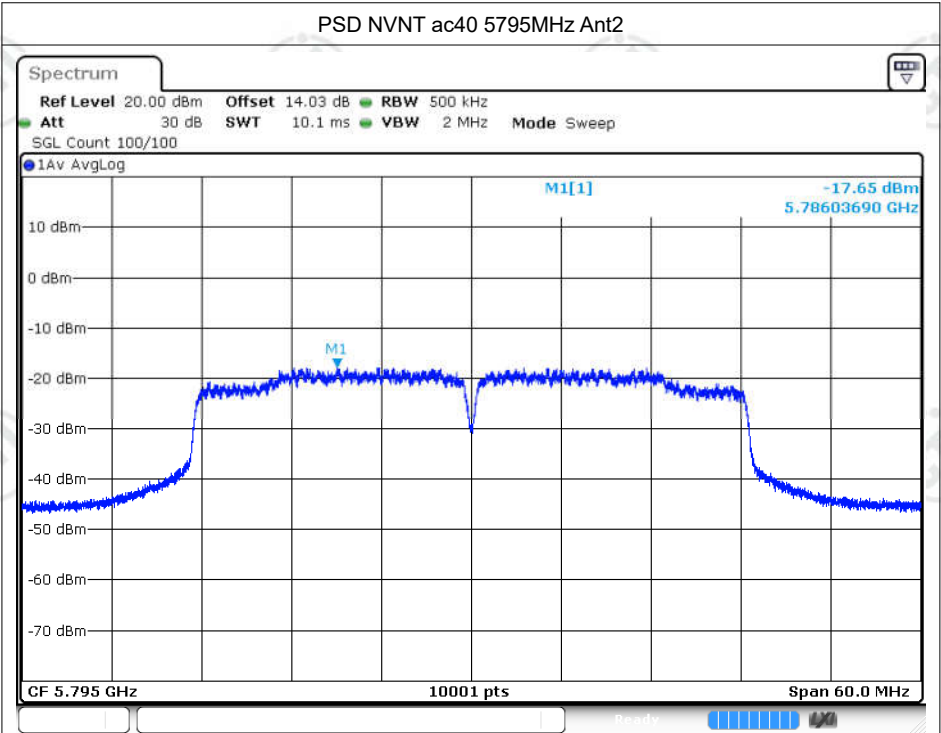


Date: 6 JAN 2025 13:52:51

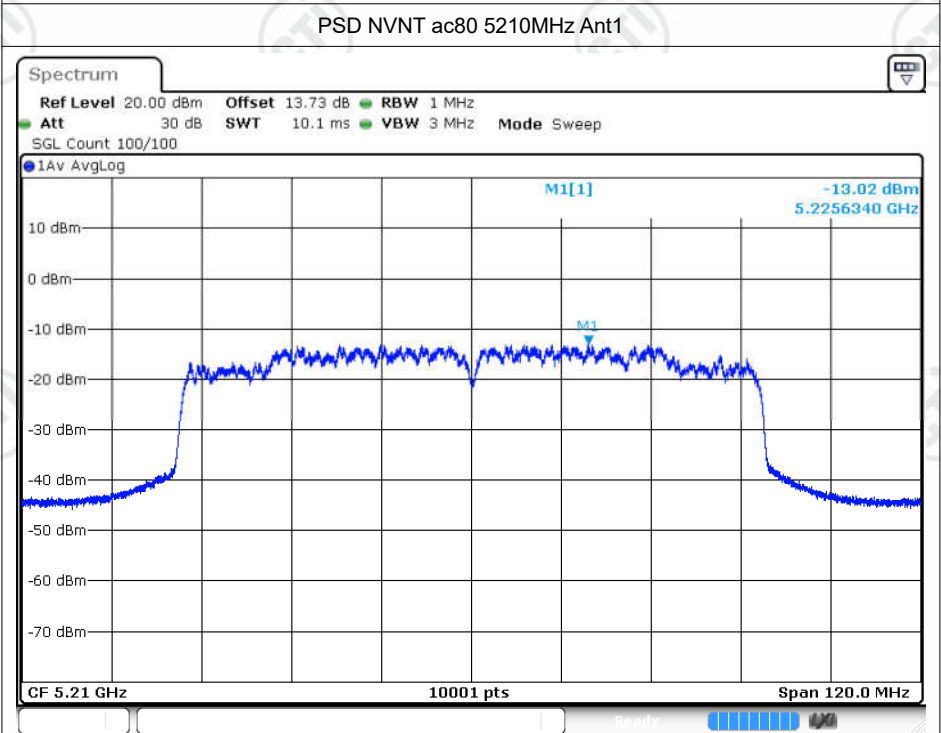


Date: 6 JAN 2025 10:49:30

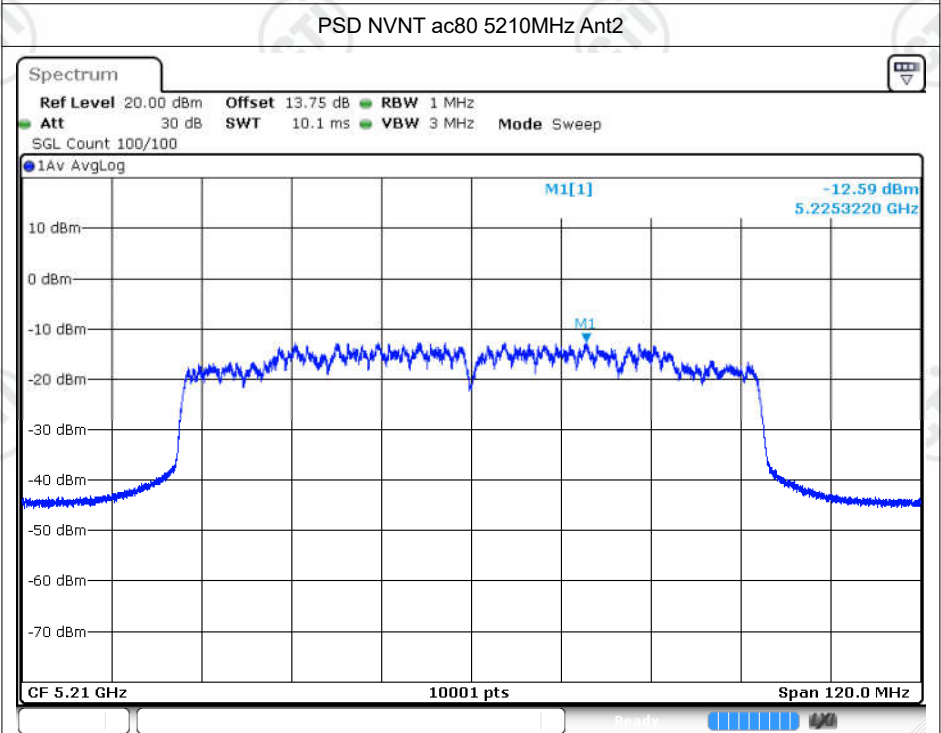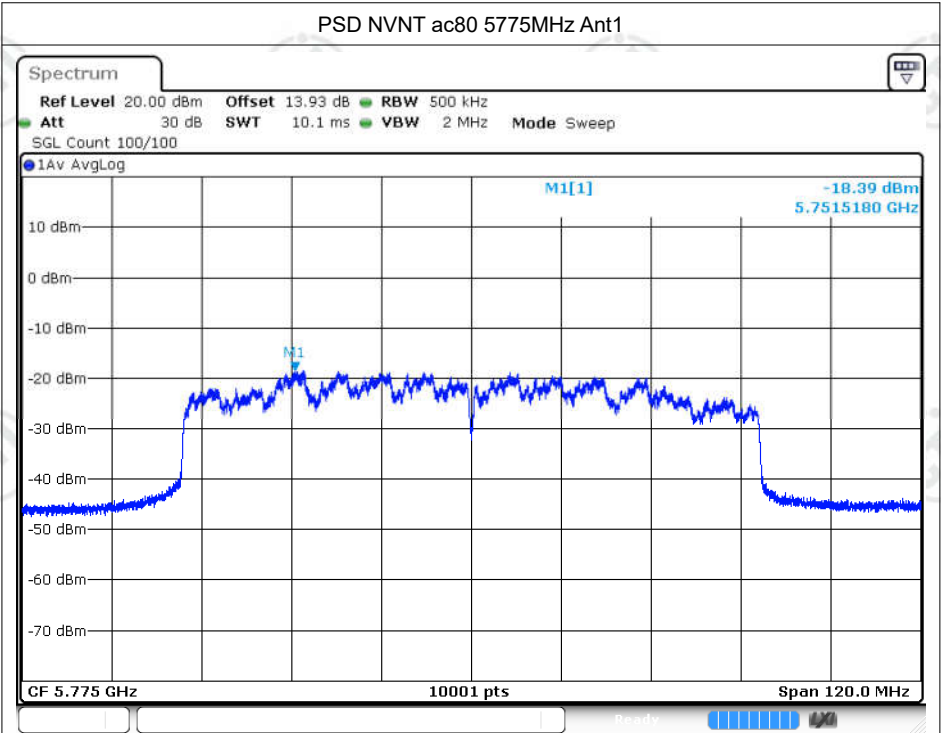


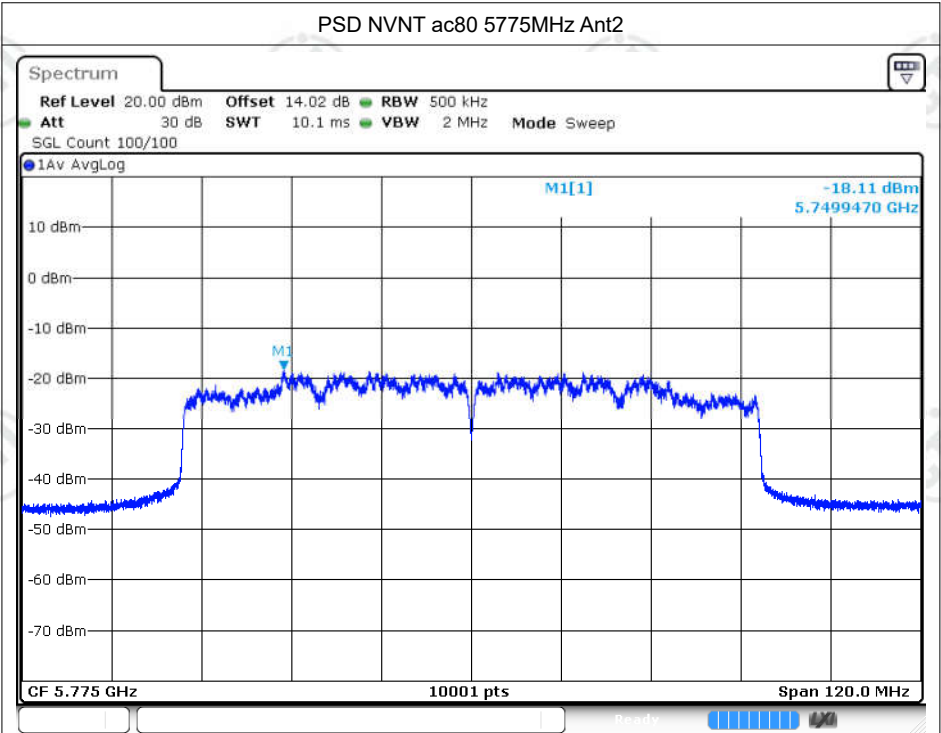


Date: 6 JAN 2025 13:35:20

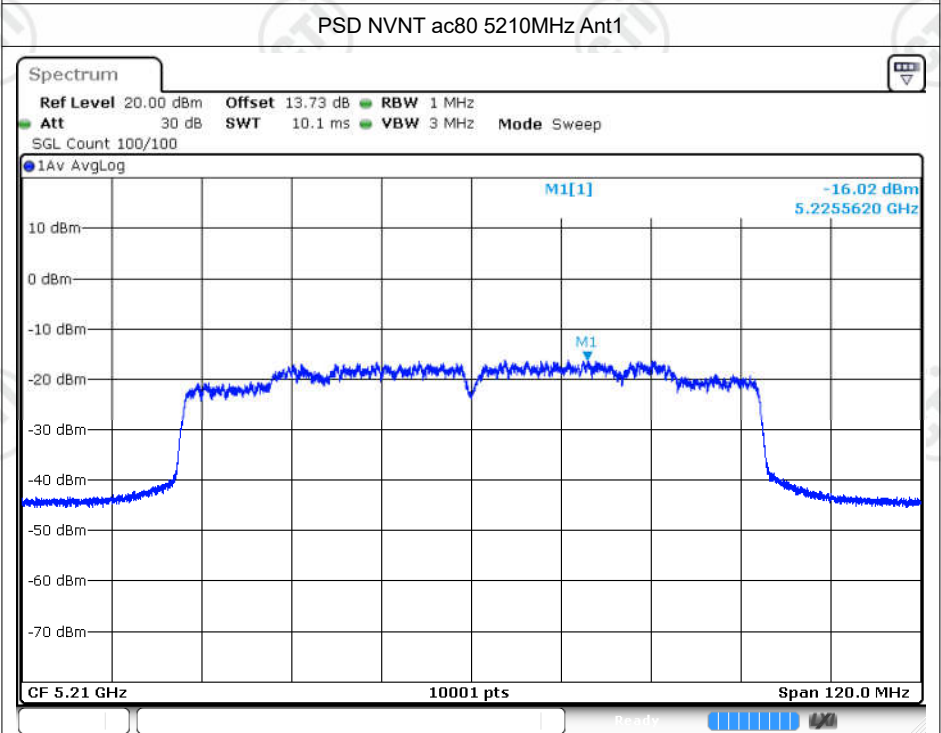


Date: 6 JAN 2025 11:32:38

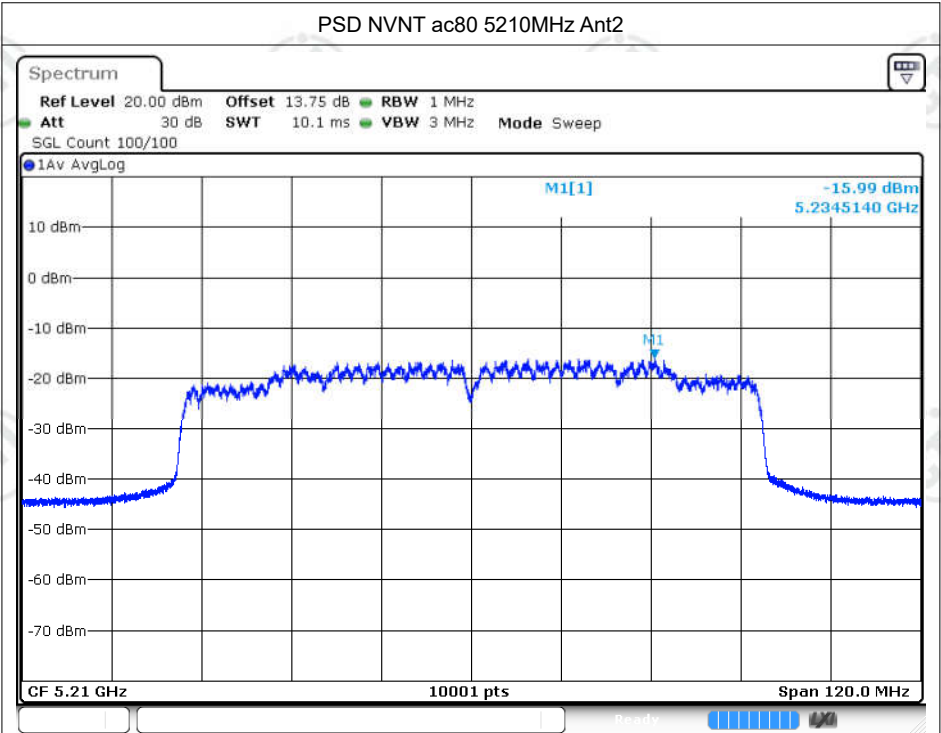

Date: 6 JAN 2025 11:32:41

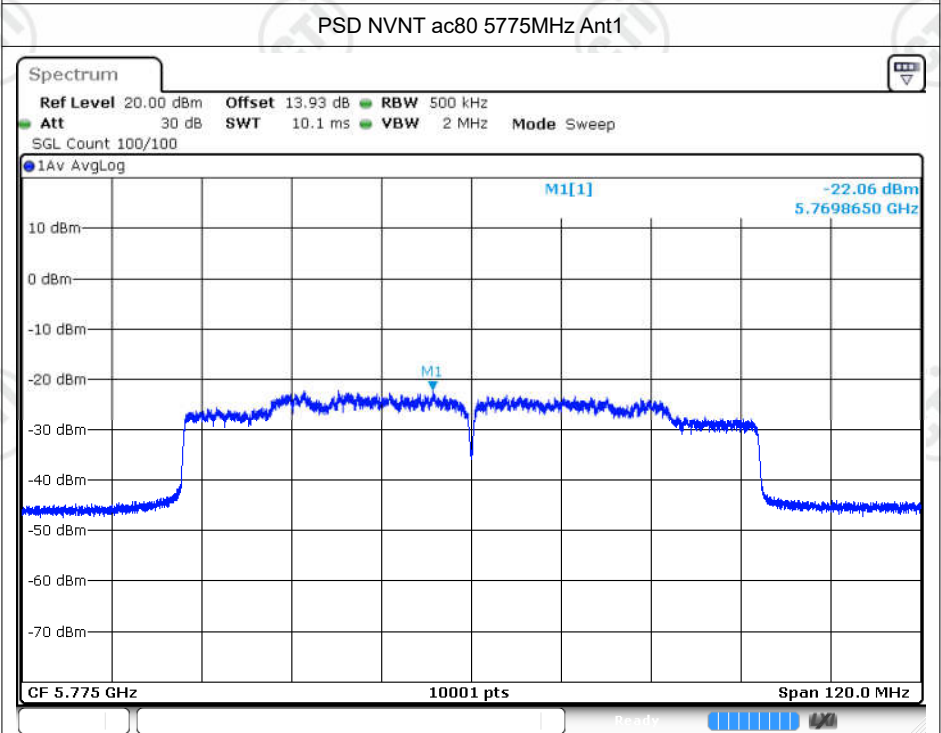

Date: 6 JAN 2025 13:57:03

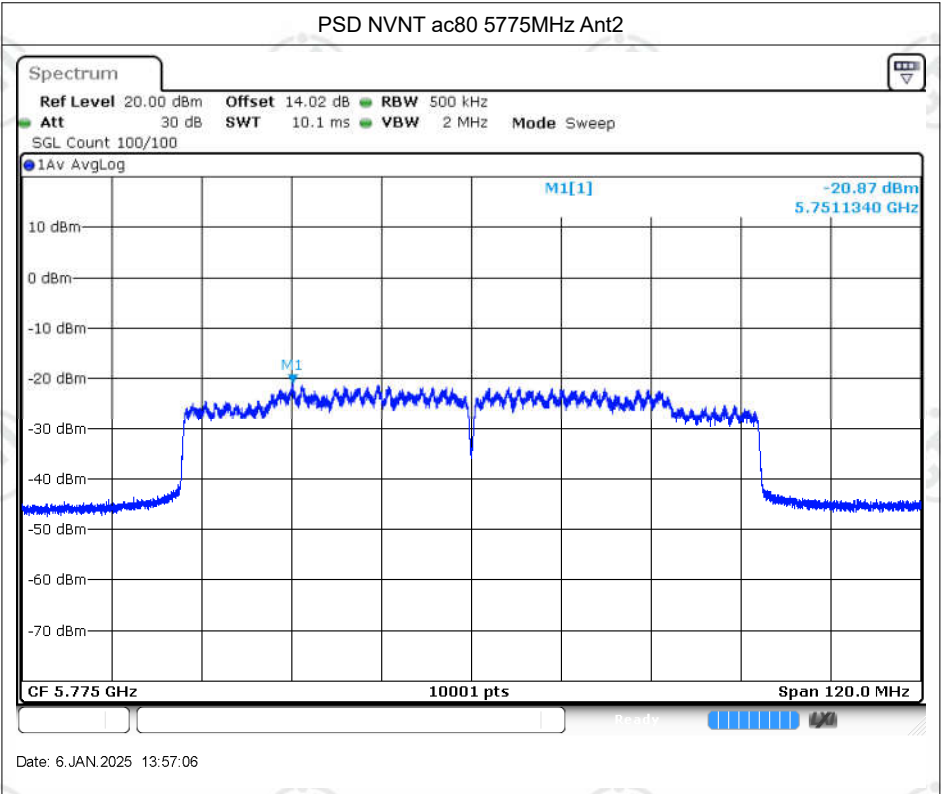

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	a	5180	Ant1	5180	0	0	25	Pass
-10C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	a	5180	Ant1	5180	0	0	25	Pass
10C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 120V	a	5180	Ant1	5180	0	0	25	Pass
20C 102V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	a	5240	Ant1	5240	0	0	25	Pass
-20C 120V	a	5240	Ant1	5240	0	0	25	Pass
-10C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	Ant1	5240	0	0	25	Pass
30C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	a	5745	Ant1	5745	0	0	25	Pass
20C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
20C 138V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	a	5745	Ant1	5745	0	0	25	Pass
-10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
30C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	a	5745	Ant1	5745	0	0	25	Pass
50C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 102V	a	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	5825	Ant1	5825	0	0	25	Pass
20C 138V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
0C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass

30C 120V	a	5825	Ant1	5825	0	0	25	Pass
40C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 120V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
20C 138V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
-20C 120V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
-10C 120V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 120V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 120V	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 120V	a	5180	Ant2	5180	0	0	25	Pass
40C 120V	a	5180	Ant2	5180	0	0	25	Pass
50C 120V	a	5180	Ant2	5180	0	0	25	Pass
20C 102V	a	5240	Ant2	5240	0	0	25	Pass
20C 120V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 138V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-20C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
-10C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
0C 120V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 120V	a	5240	Ant2	5240	0	0	25	Pass
50C 120V	a	5240	Ant2	5240	0	0	25	Pass
20C 102V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	a	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 138V	a	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-20C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	a	5745	Ant2	5745	0	0	25	Pass
10C 120V	a	5745	Ant2	5745	0	0	25	Pass
30C 120V	a	5745	Ant2	5745	0	0	25	Pass
40C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 120V	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	a	5825	Ant2	5825	0	0	25	Pass
20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant2	5825	0	0	25	Pass
0C 120V	a	5825	Ant2	5824.96	-40000	-6.87	25	Pass
10C 120V	a	5825	Ant2	5825	0	0	25	Pass
30C 120V	a	5825	Ant2	5825.02	20000	3.43	25	Pass
40C 120V	a	5825	Ant2	5824.96	-40000	-6.87	25	Pass

50C 120V	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	n20	5180	Ant1	5180	0	0	25	Pass
20C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	5180	Ant1	5180	0	0	25	Pass
30C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
50C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 102V	n20	5240	Ant1	5240	0	0	25	Pass
20C 120V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 120V	n20	5240	Ant1	5240	0	0	25	Pass
40C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	5745	Ant1	5745	0	0	25	Pass
20C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	n20	5745	Ant1	5745	0	0	25	Pass
50C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 102V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 102V	n20	5180	Ant2	5180	0	0	25	Pass

20C 120V	n20	5180	Ant2	5180	0	0	25	Pass
20C 138V	n20	5180	Ant2	5180	0	0	25	Pass
-20C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
-10C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
50C 120V	n20	5180	Ant2	5180	0	0	25	Pass
20C 102V	n20	5240	Ant2	5240	0	0	25	Pass
20C 120V	n20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 138V	n20	5240	Ant2	5240	0	0	25	Pass
-20C 120V	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
0C 120V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
10C 120V	n20	5240	Ant2	5240	0	0	25	Pass
30C 120V	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 120V	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
50C 120V	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	n20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-20C 120V	n20	5745	Ant2	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	n20	5745	Ant2	5745	0	0	25	Pass
10C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant2	5745	0	0	25	Pass
40C 120V	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 120V	n20	5745	Ant2	5745	0	0	25	Pass
20C 102V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	n20	5825	Ant2	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant2	5825	0	0	25	Pass
-10C 120V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
0C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
10C 120V	n20	5825	Ant2	5825	0	0	25	Pass
30C 120V	n20	5825	Ant2	5825	0	0	25	Pass
40C 120V	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
50C 120V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 102V	n40	5190	Ant1	5190	0	0	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass

-20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
0C 120V	n40	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5190	0	0	25	Pass
50C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant1	5230	0	0	25	Pass
20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 138V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
0C 120V	n40	5230	Ant1	5230	0	0	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230	0	0	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant1	5755	0	0	25	Pass
40C 120V	n40	5755	Ant1	5755	0	0	25	Pass
50C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 102V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	n40	5190	Ant2	5190	0	0	25	Pass
20C 120V	n40	5190	Ant2	5190	0	0	25	Pass
20C 138V	n40	5190	Ant2	5190	0	0	25	Pass
-20C 120V	n40	5190	Ant2	5190	0	0	25	Pass
-10C 120V	n40	5190	Ant2	5190	0	0	25	Pass

0C 120V	n40	5190	Ant2	5190	0	0	25	Pass
10C 120V	n40	5190	Ant2	5190	0	0	25	Pass
30C 120V	n40	5190	Ant2	5190	0	0	25	Pass
40C 120V	n40	5190	Ant2	5190	0	0	25	Pass
50C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant2	5230	0	0	25	Pass
20C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	5230	Ant2	5230	0	0	25	Pass
-20C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
-10C 120V	n40	5230	Ant2	5230	0	0	25	Pass
0C 120V	n40	5230	Ant2	5230	0	0	25	Pass
10C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant2	5230	0	0	25	Pass
40C 120V	n40	5230	Ant2	5230	0	0	25	Pass
50C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 102V	n40	5755	Ant2	5755	0	0	25	Pass
20C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant2	5755	0	0	25	Pass
0C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
10C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
40C 120V	n40	5755	Ant2	5755	0	0	25	Pass
50C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
20C 102V	n40	5795	Ant2	5795	0	0	25	Pass
20C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 138V	n40	5795	Ant2	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant2	5795	0	0	25	Pass
0C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	5795	Ant2	5795	0	0	25	Pass
40C 120V	n40	5795	Ant2	5795	0	0	25	Pass
50C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
-20C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
0C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass


30C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
40C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
50C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	ac20	5240	Ant1	5240	0	0	25	Pass
-20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
0C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 102V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
0C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 102V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 138V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
10C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
30C 120V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
50C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 120V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 138V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
-20C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
-10C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
0C 120V	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 120V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
40C 120V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass

50C 120V	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	5240	Ant2	5240	0	0	25	Pass
20C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 138V	ac20	5240	Ant2	5240	0	0	25	Pass
-20C 120V	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
0C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
10C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
50C 120V	ac20	5240	Ant2	5240	0	0	25	Pass
20C 102V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 138V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
0C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 120V	ac20	5745	Ant2	5745	0	0	25	Pass
30C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
50C 120V	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 102V	ac20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	5825	Ant2	5825	0	0	25	Pass
20C 138V	ac20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
-20C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 120V	ac20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
10C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
30C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 102V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
0C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant1	5230	0	0	25	Pass


20C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	ac40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
40C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
50C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 102V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-10C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
0C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
-10C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
50C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
20C 138V	ac40	5230	Ant2	5230	0	0	25	Pass

-20C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
0C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
10C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
40C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
50C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
20C 102V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant2	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
0C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
40C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-20C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
40C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5774.76	-240000	-41.56	25	Pass
20C 138V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5774.84	-160000	-27.71	25	Pass


0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 102V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant2	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
30C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 102V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 138V	ac80	5775	Ant2	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
0C 120V	ac80	5775	Ant2	5774.84	-160000	-27.71	25	Pass
10C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant2	5775	0	0	25	Pass

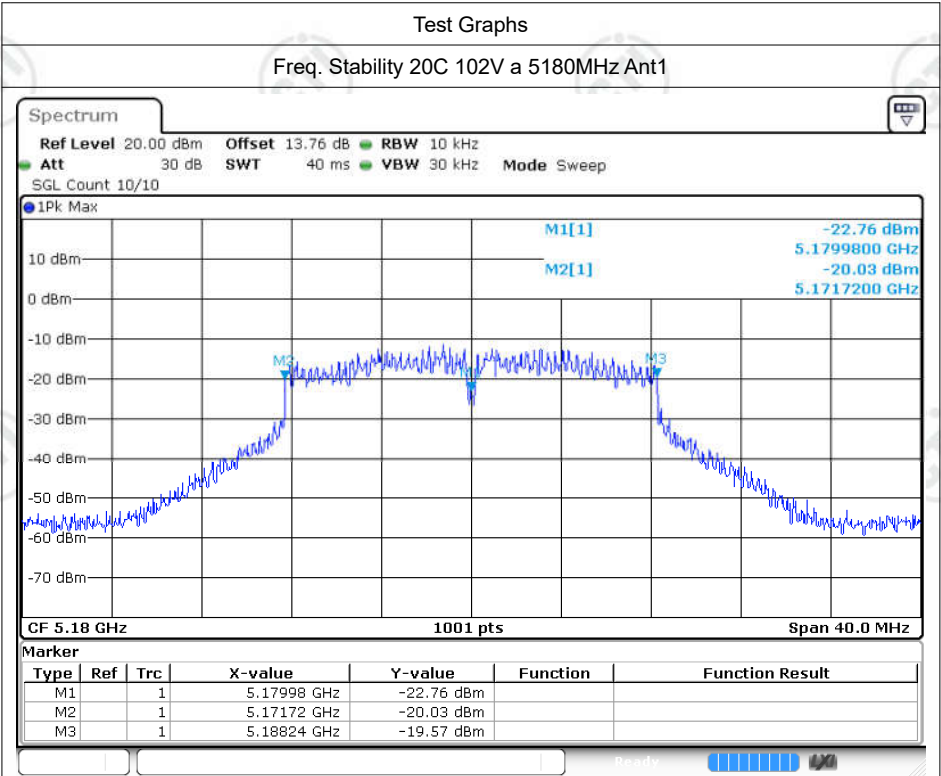


Date: 6 JAN.2025 10:29:00

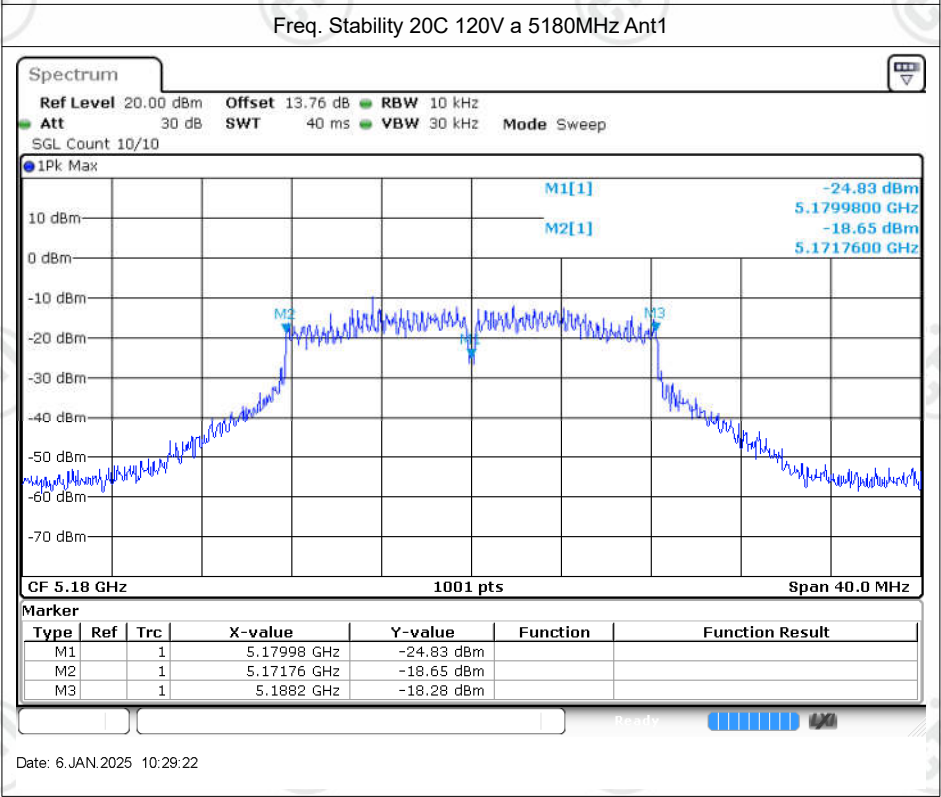


Date: 6 JAN.2025 10:29:22

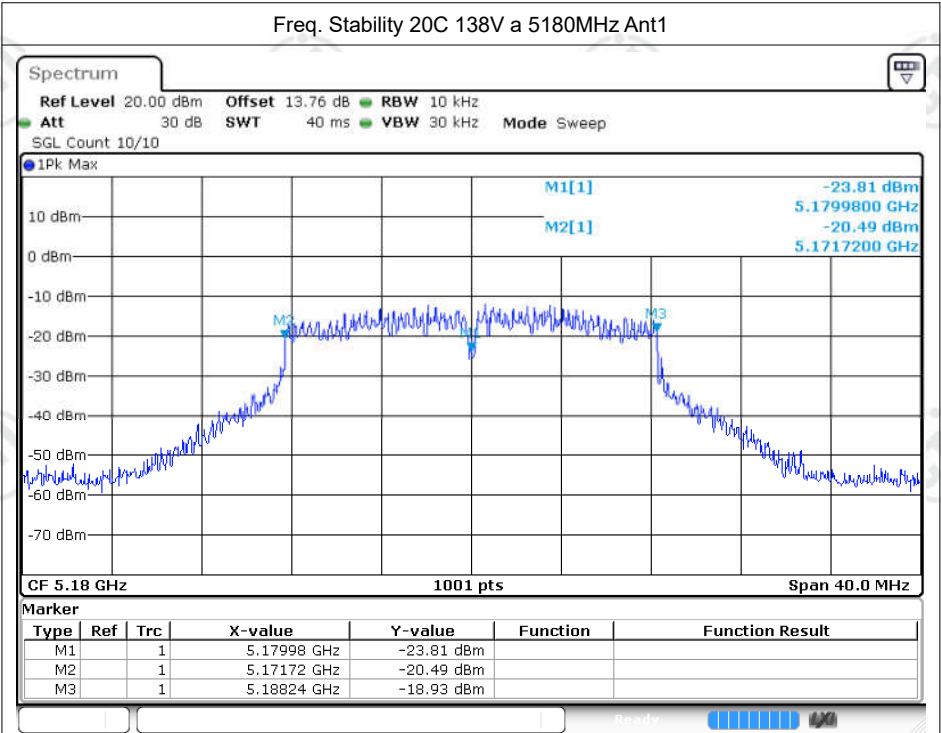


Date: 6 JAN 2025 10:29:06

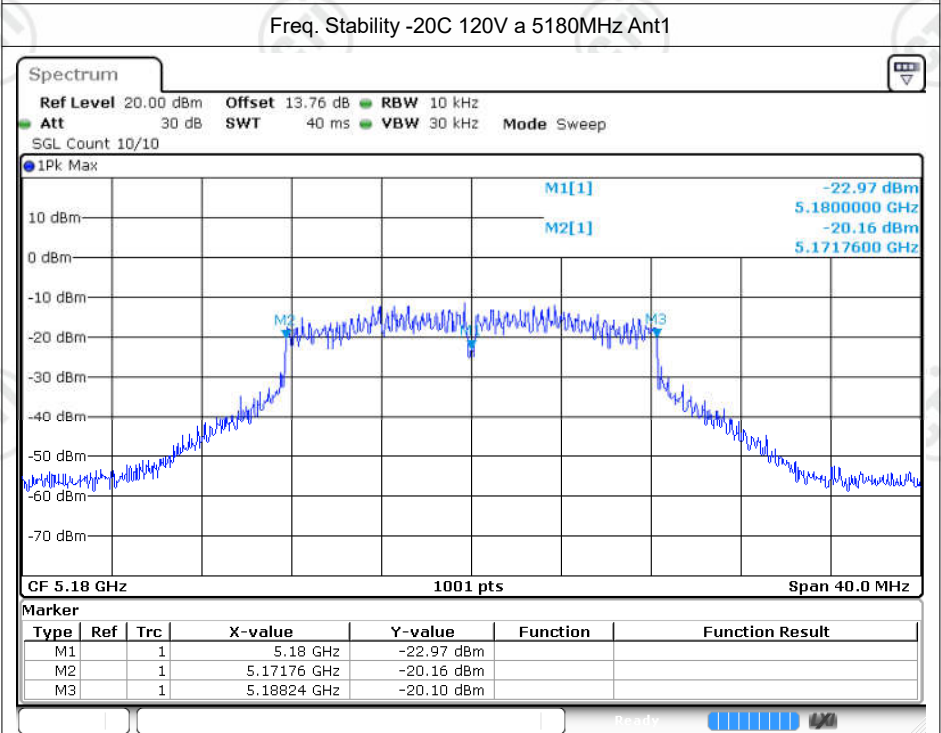


Date: 6 JAN 2025 10:29:09

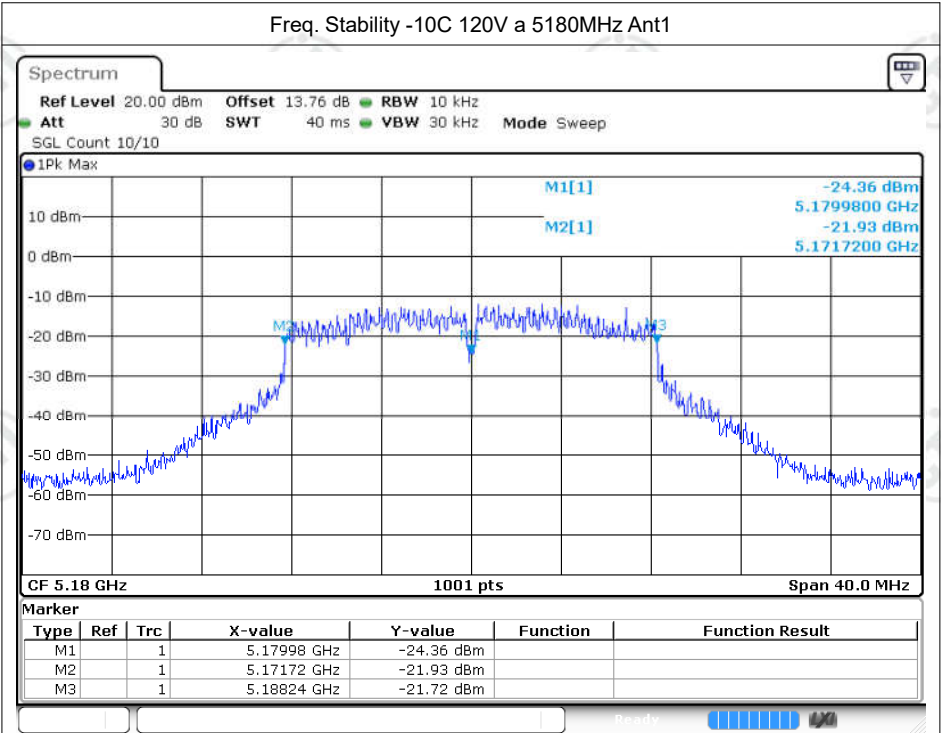


Date: 6 JAN.2025 10:29:12

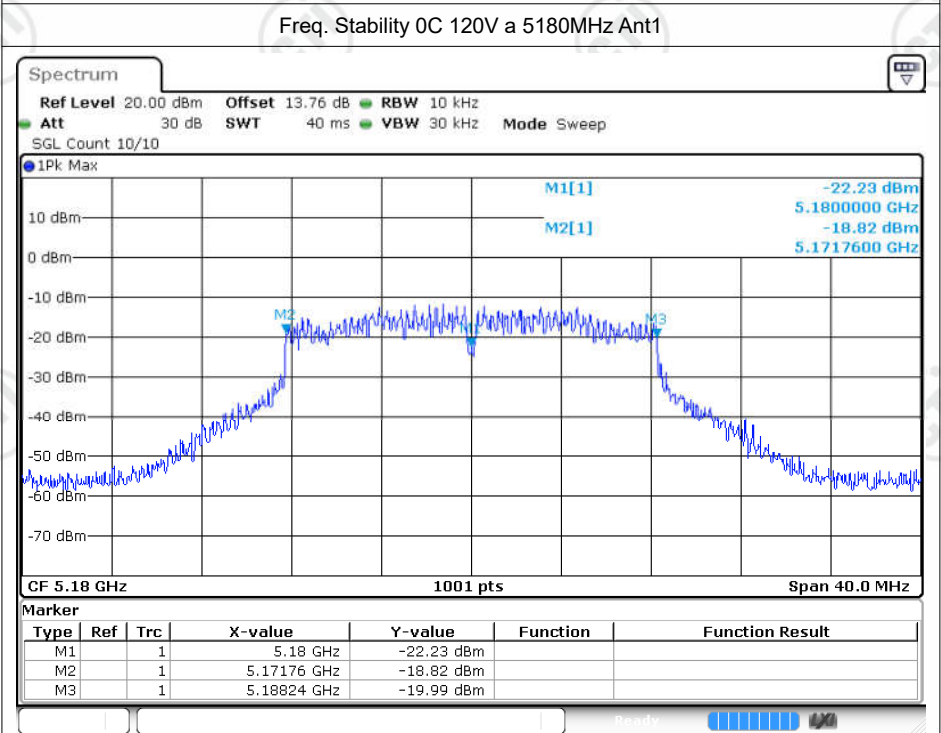


Date: 6 JAN.2025 10:29:15

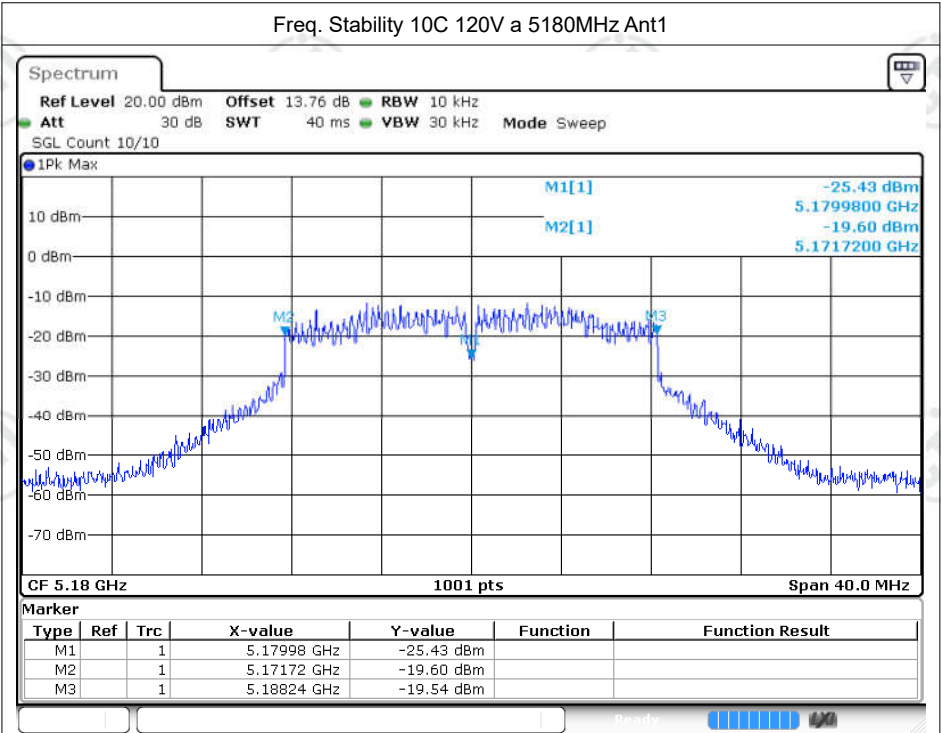


Date: 6 JAN 2025 10:29:18

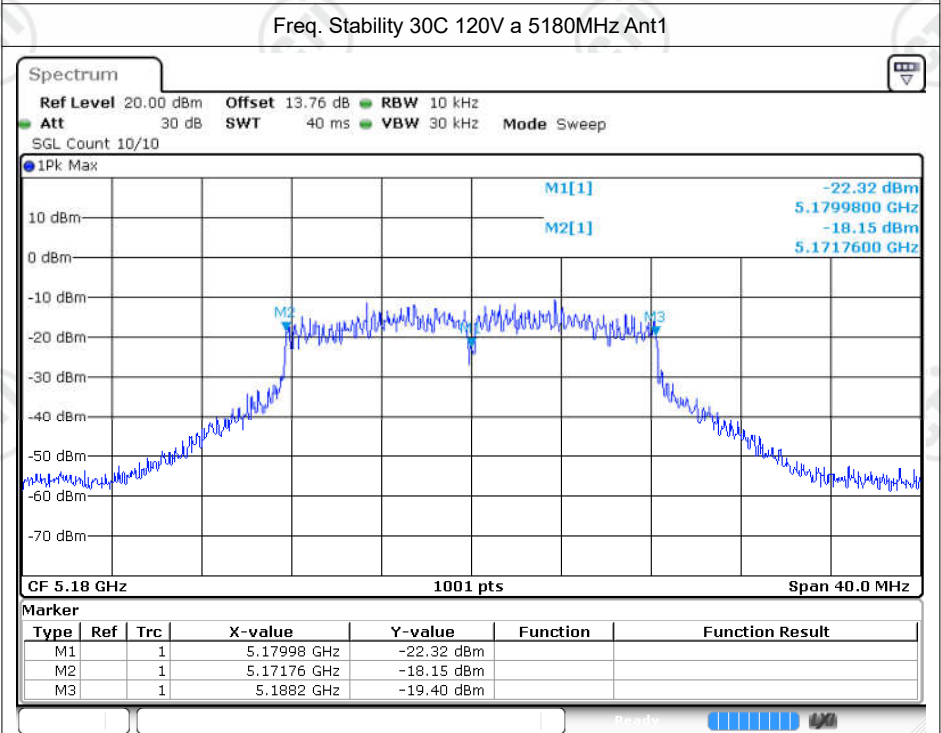


Date: 6 JAN 2025 10:29:25

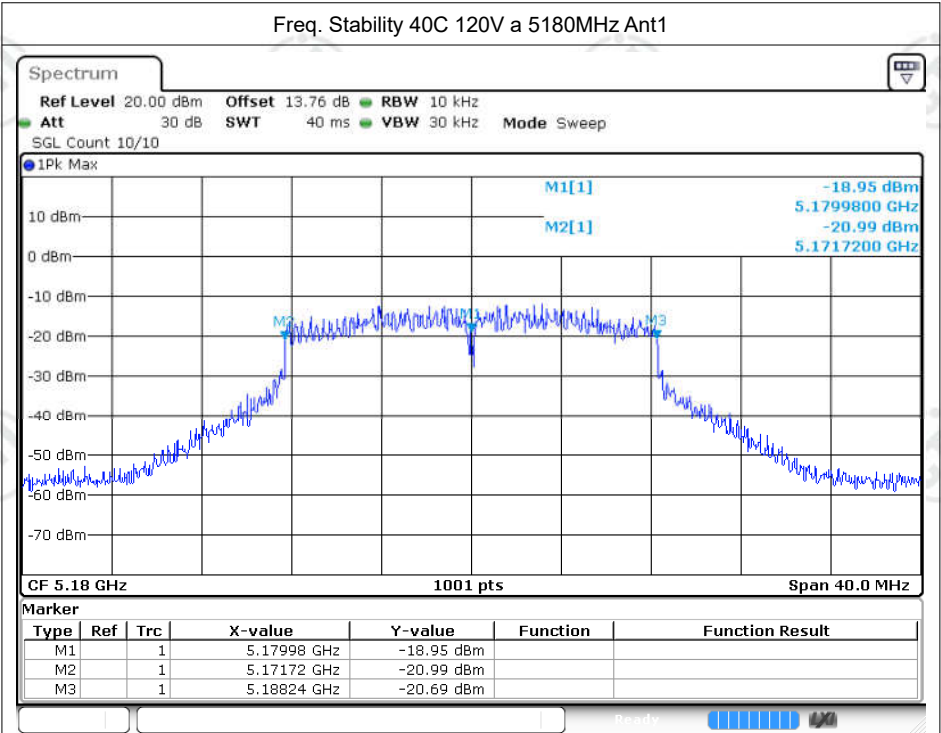


Date: 6 JAN 2025 10:29:28

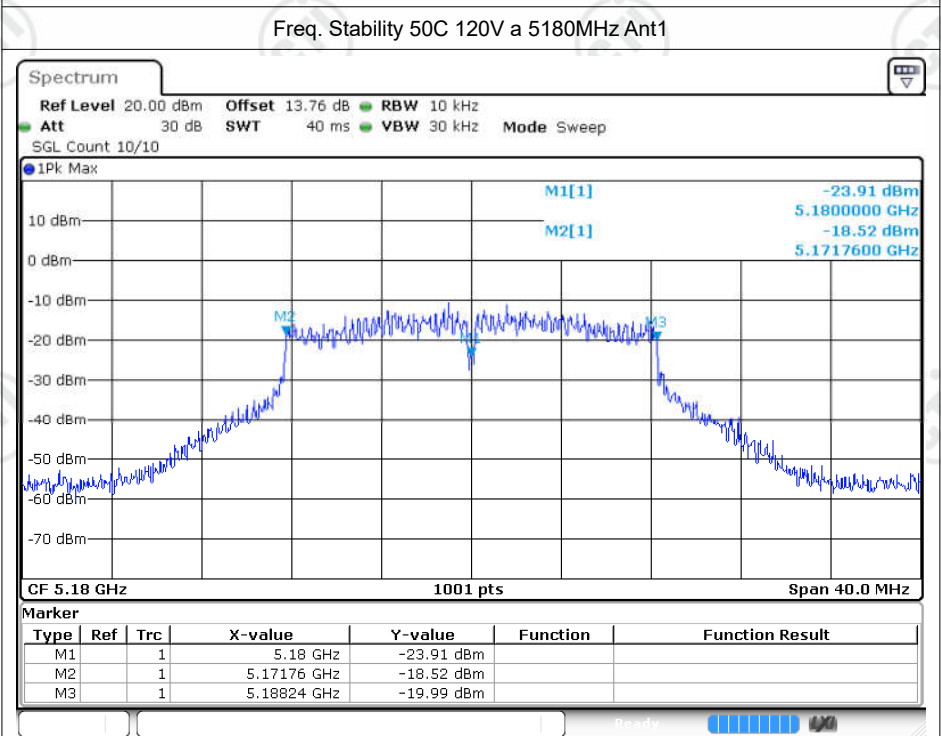



Date: 6 JAN 2025 10:29:31

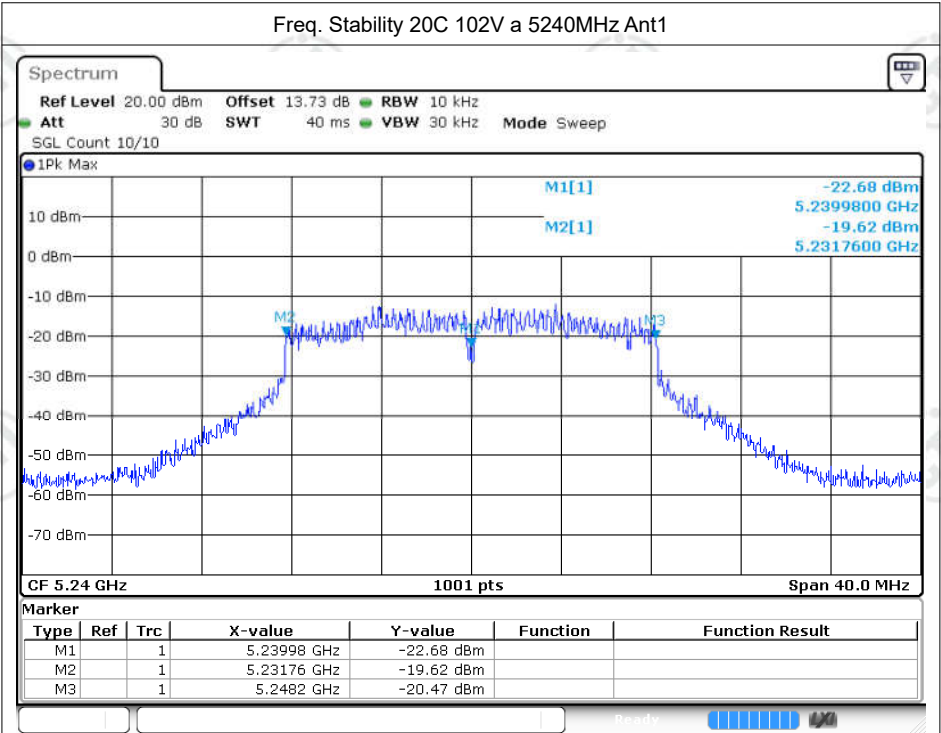


Date: 6 JAN 2025 10:32:42

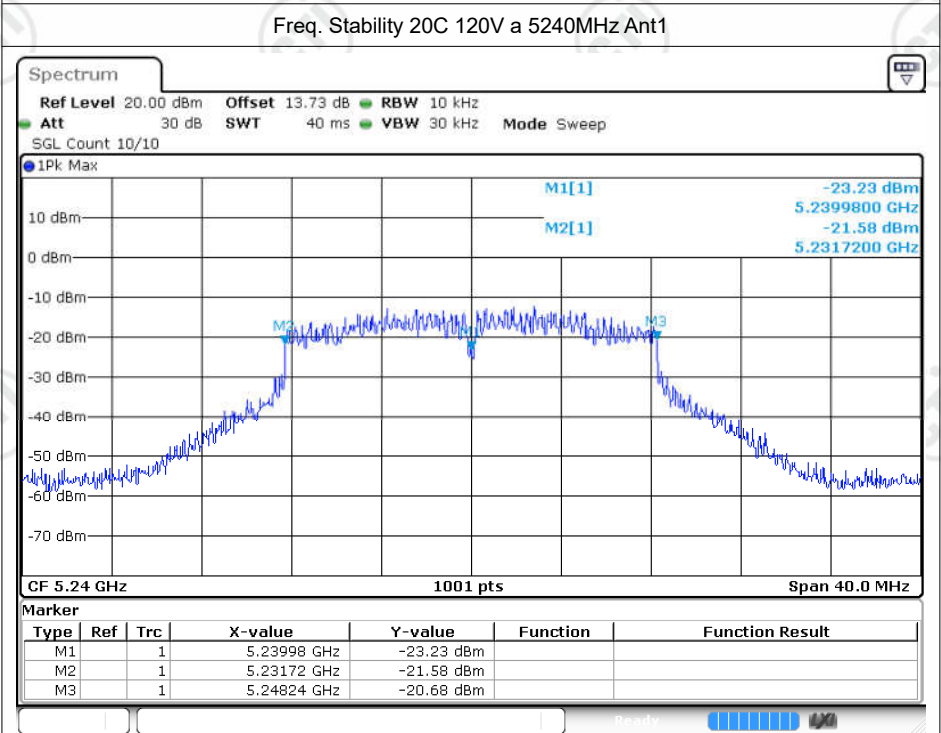


Date: 6 JAN 2025 10:33:03

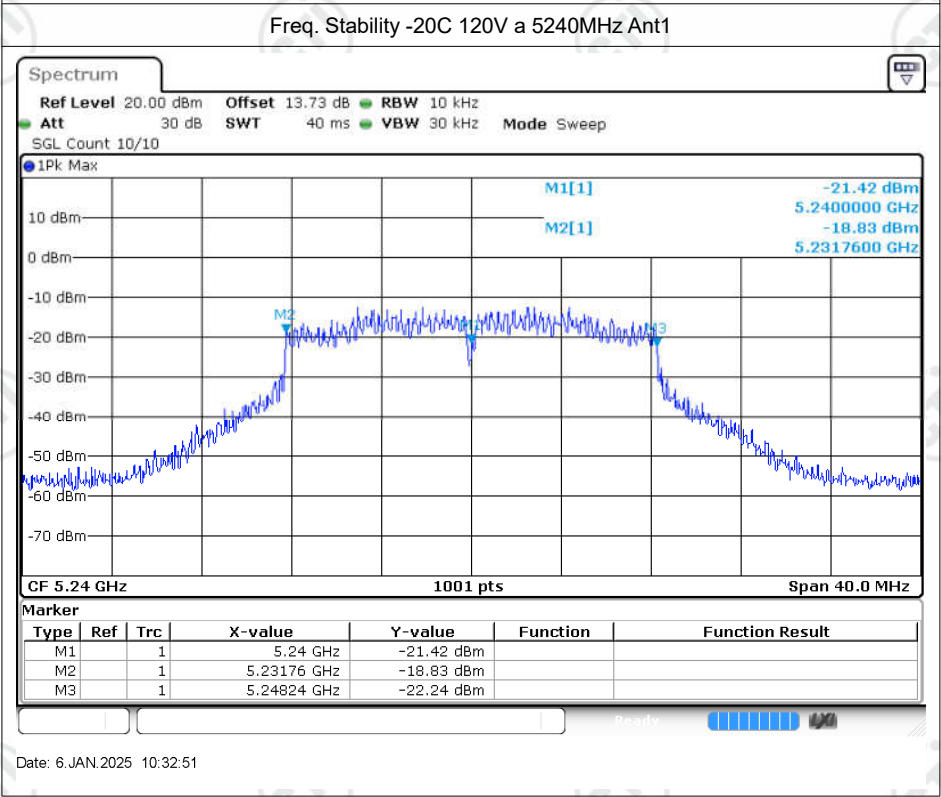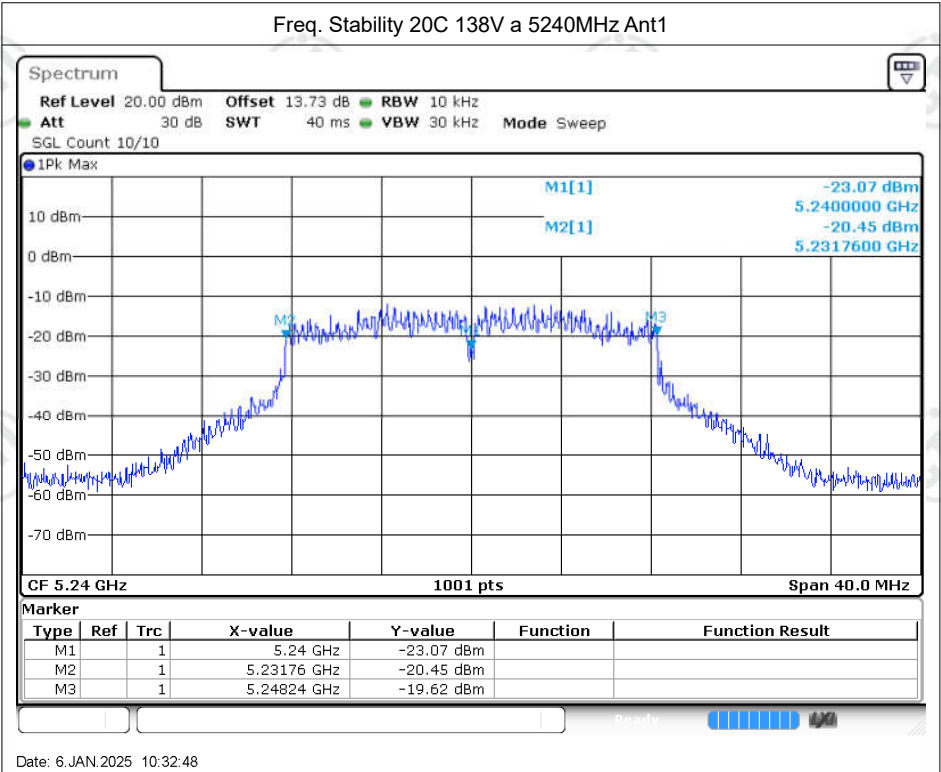


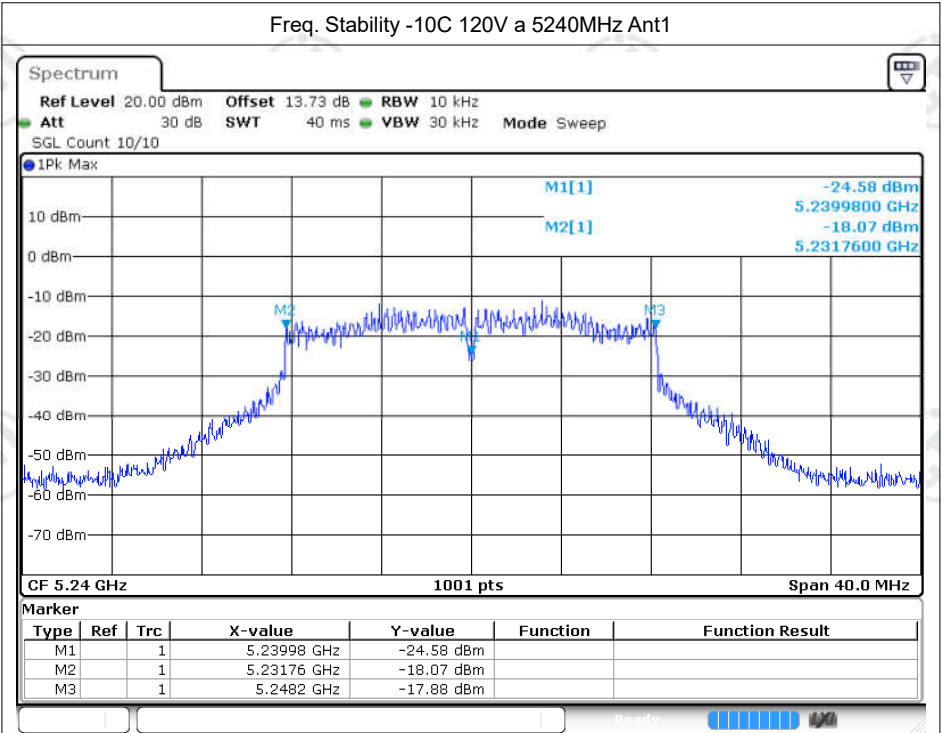


Date: 6 JAN 2025 10:32:54

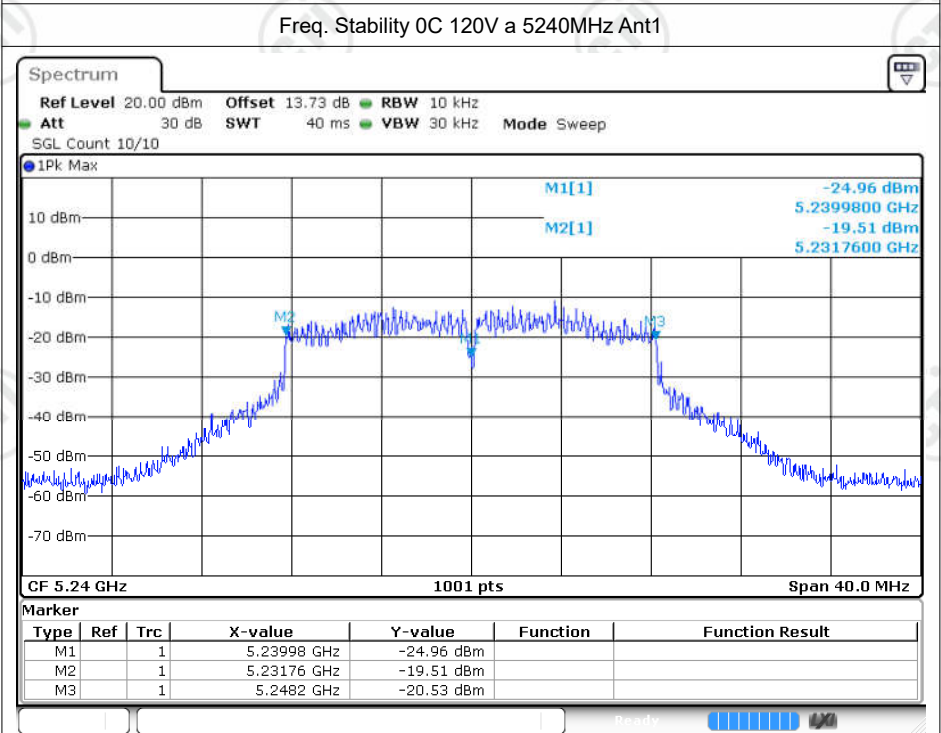


Date: 6 JAN 2025 10:32:57

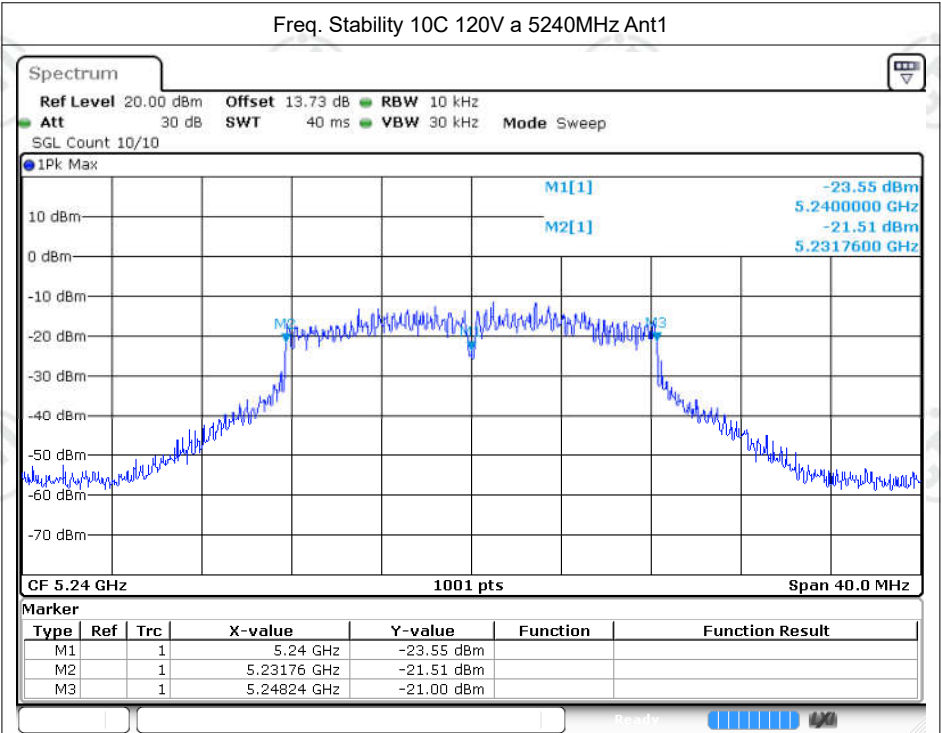


Date: 6 JAN 2025 10:33:00

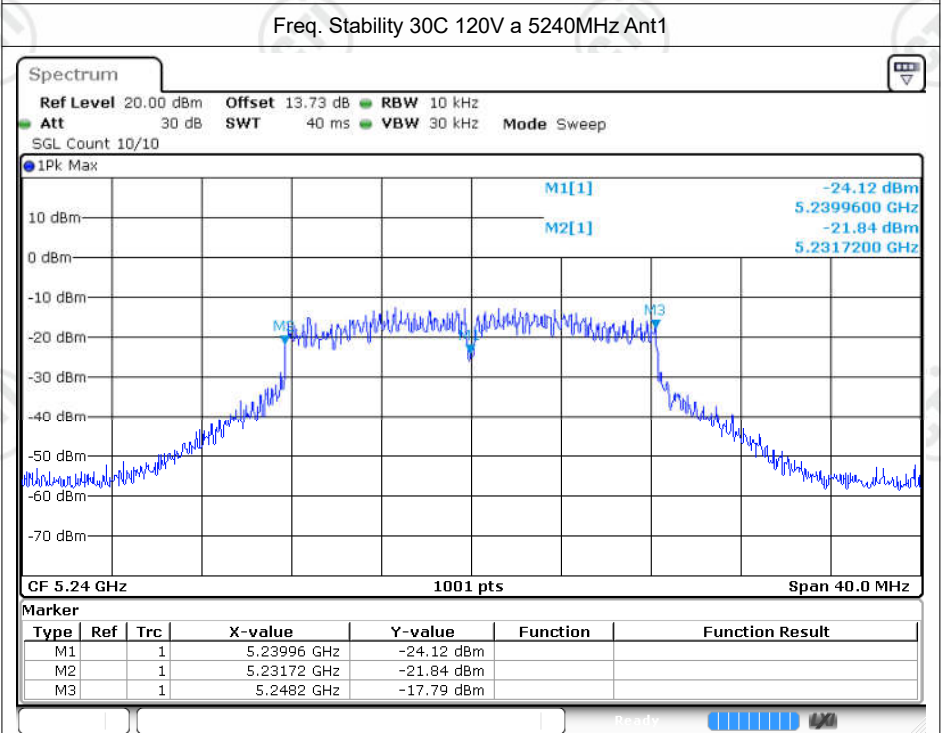


Date: 6 JAN 2025 10:33:06

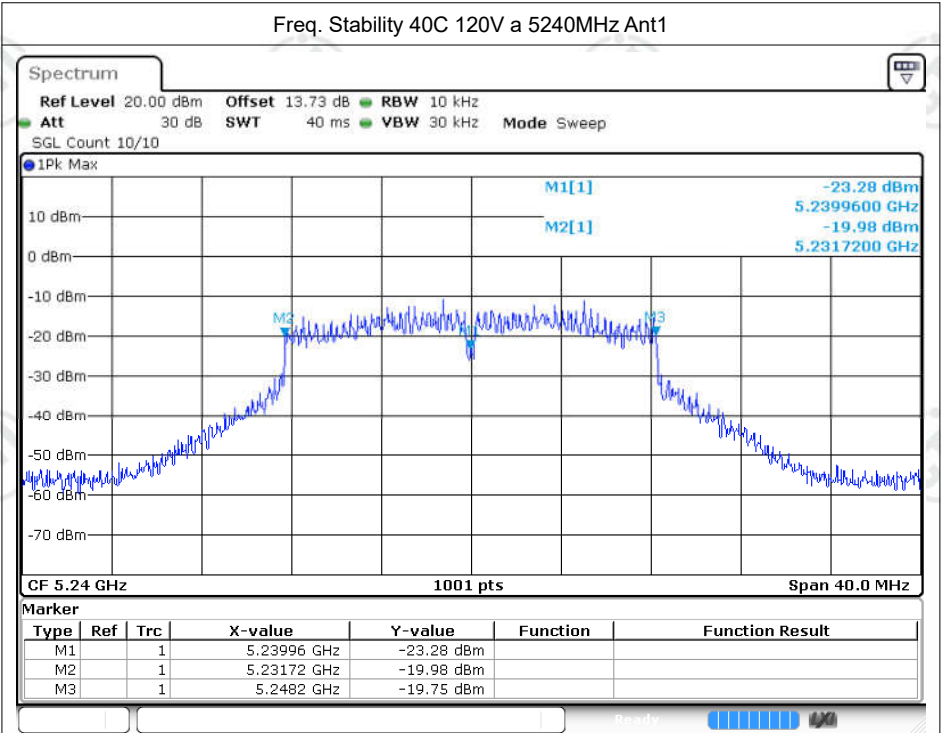


Date: 6 JAN 2025 10:33:09

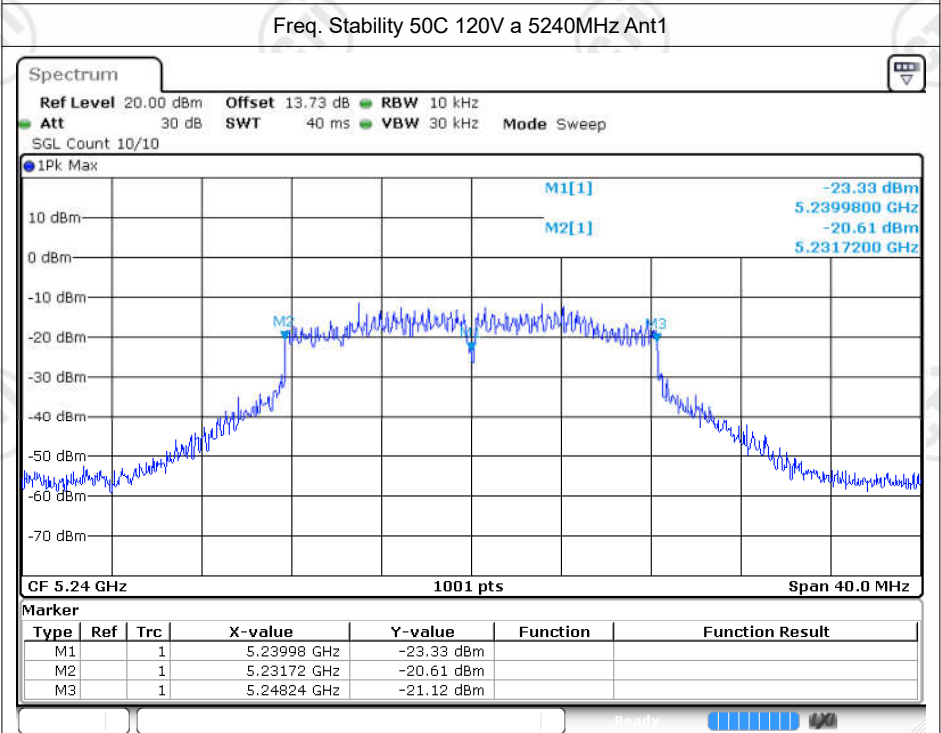


Date: 6 JAN 2025 10:33:12

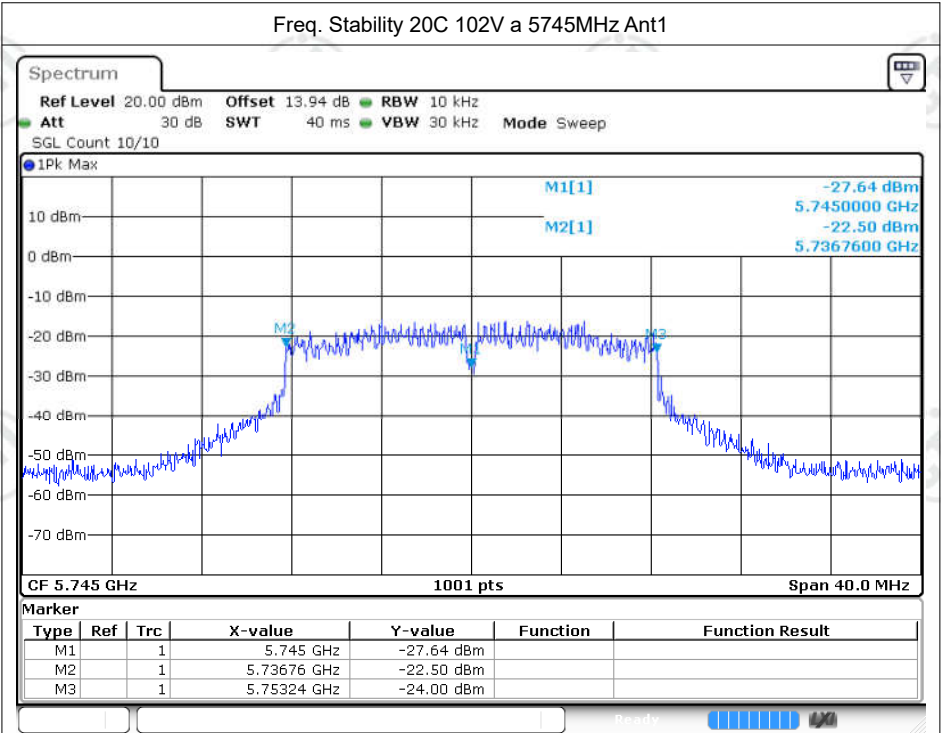


Date: 6 JAN 2025 12:52:34

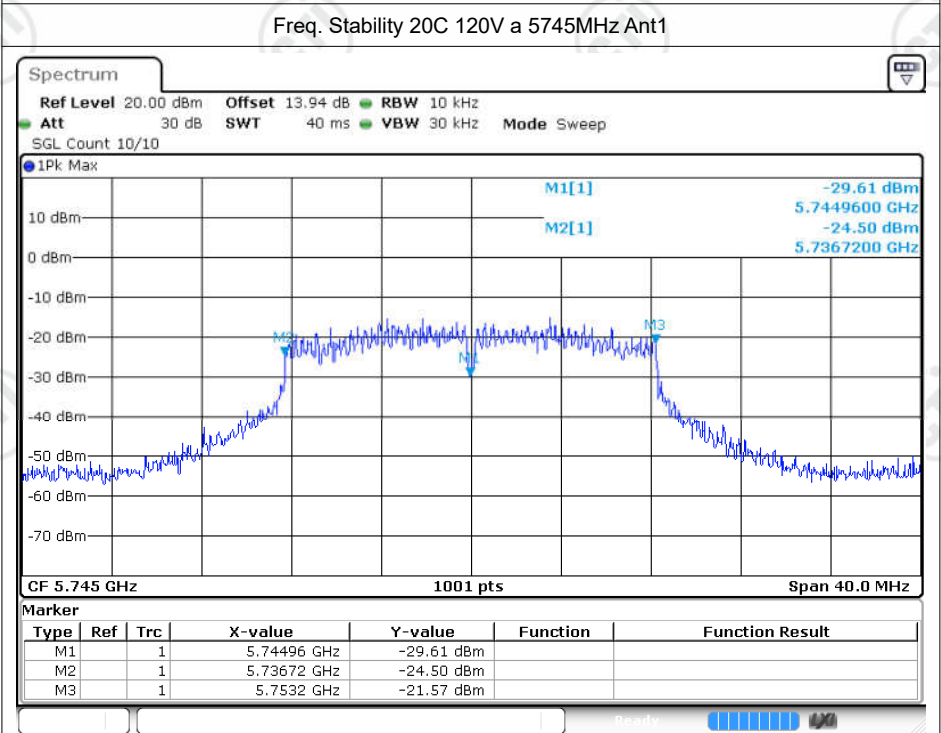

Date: 6 JAN 2025 12:52:55

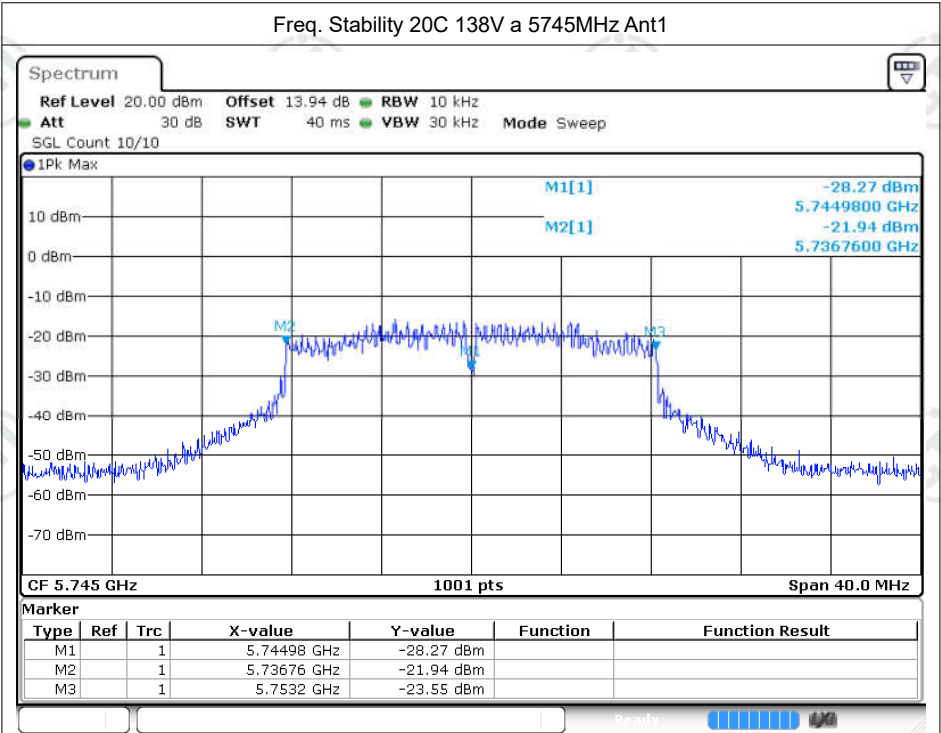

Date: 6 JAN.2025 12:52:40

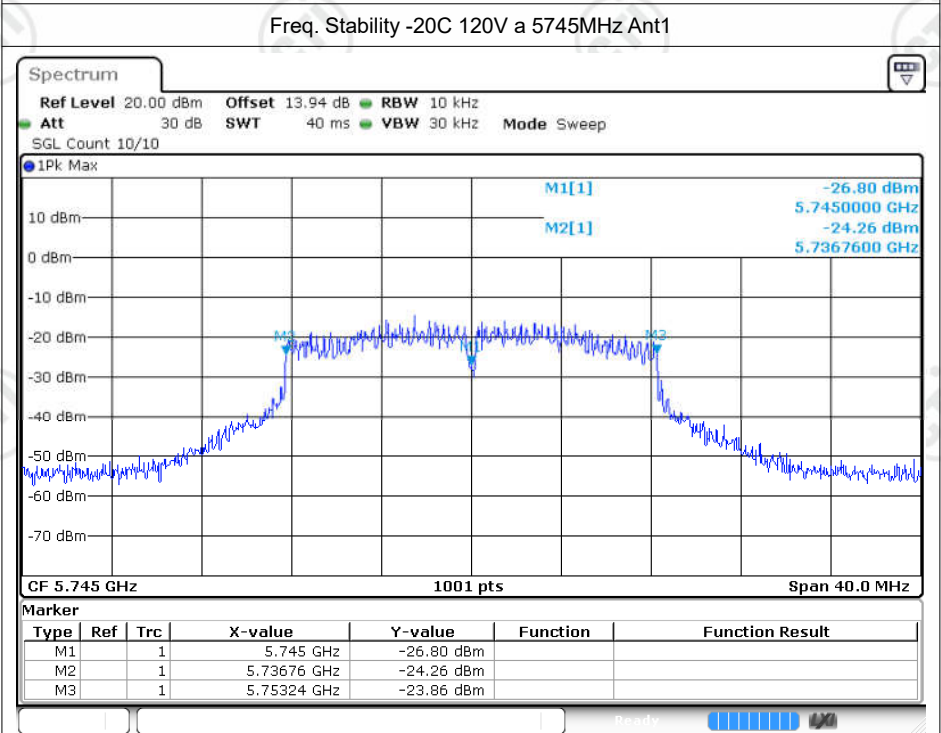

Date: 6 JAN.2025 12:52:43