




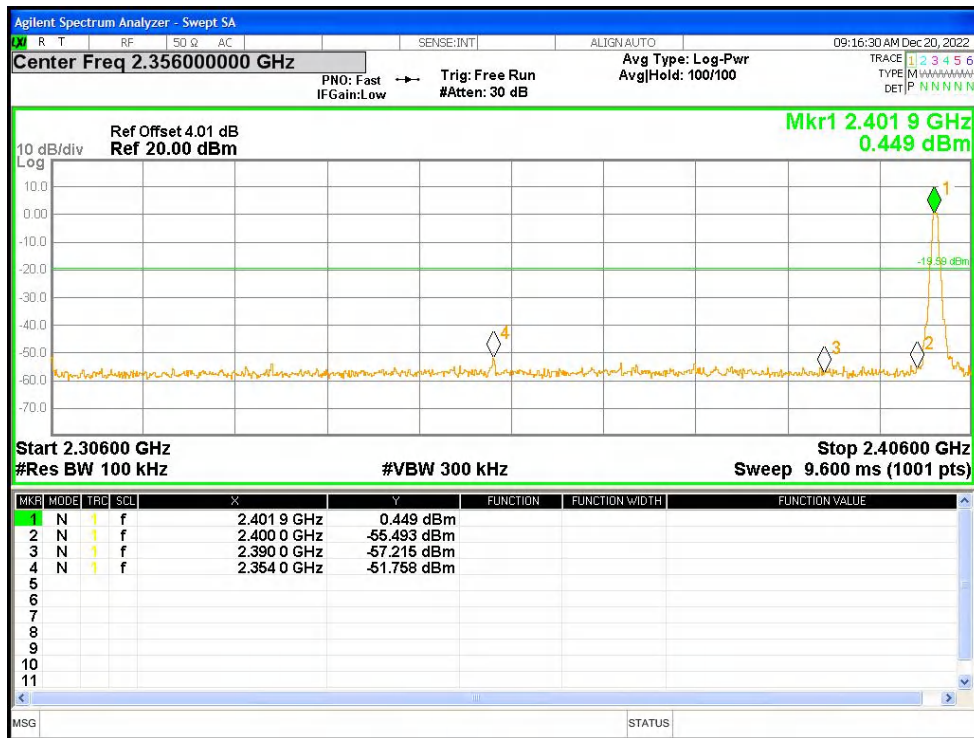

Band Edge NVNT 1-DH1 2480MHz Ant1 No-Hopping Ref

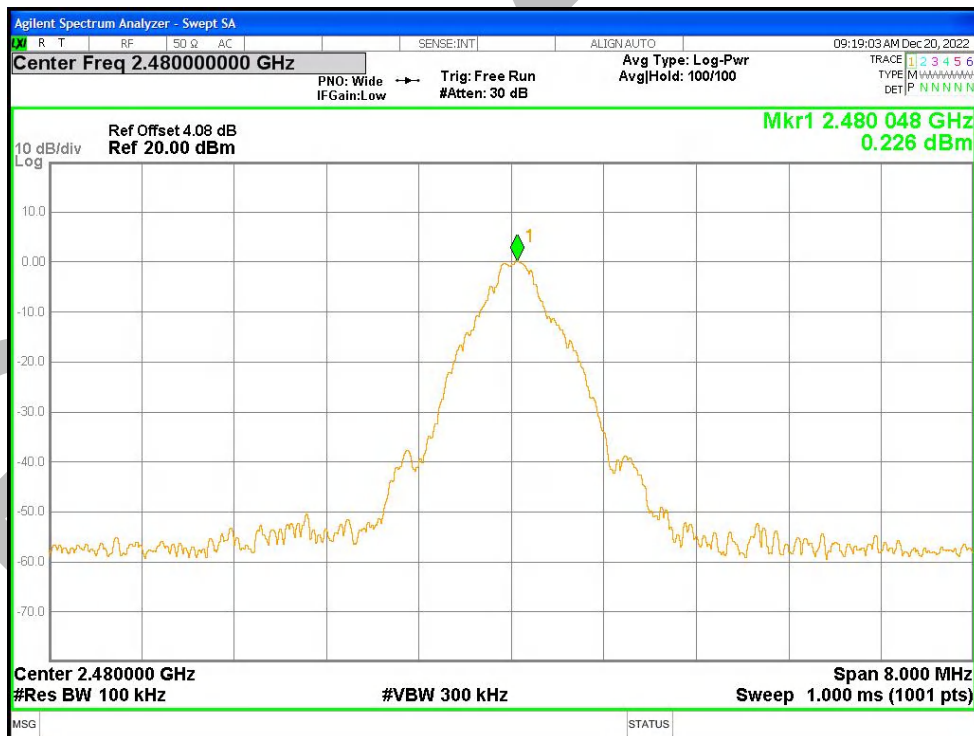


Band Edge NVNT 1-DH1 2480MHz Ant1 No-Hopping Emission

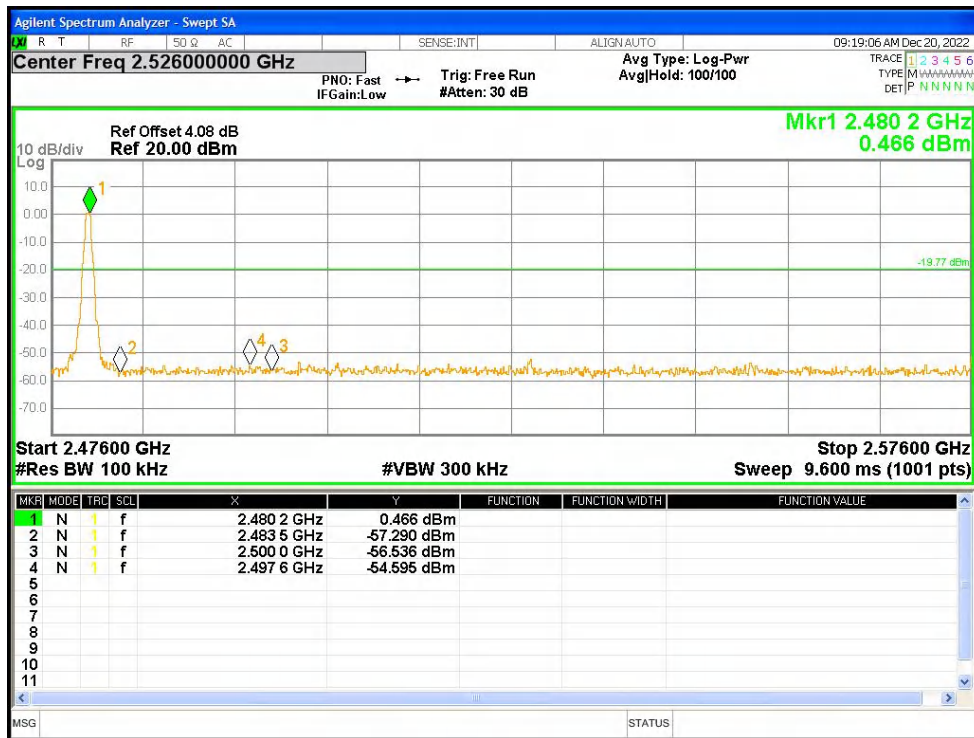

Band Edge NVNT 2-DH1 2402MHz Ant1 No-Hopping Ref




Band Edge NVNT 2-DH1 2402MHz Ant1 No-Hopping Emission

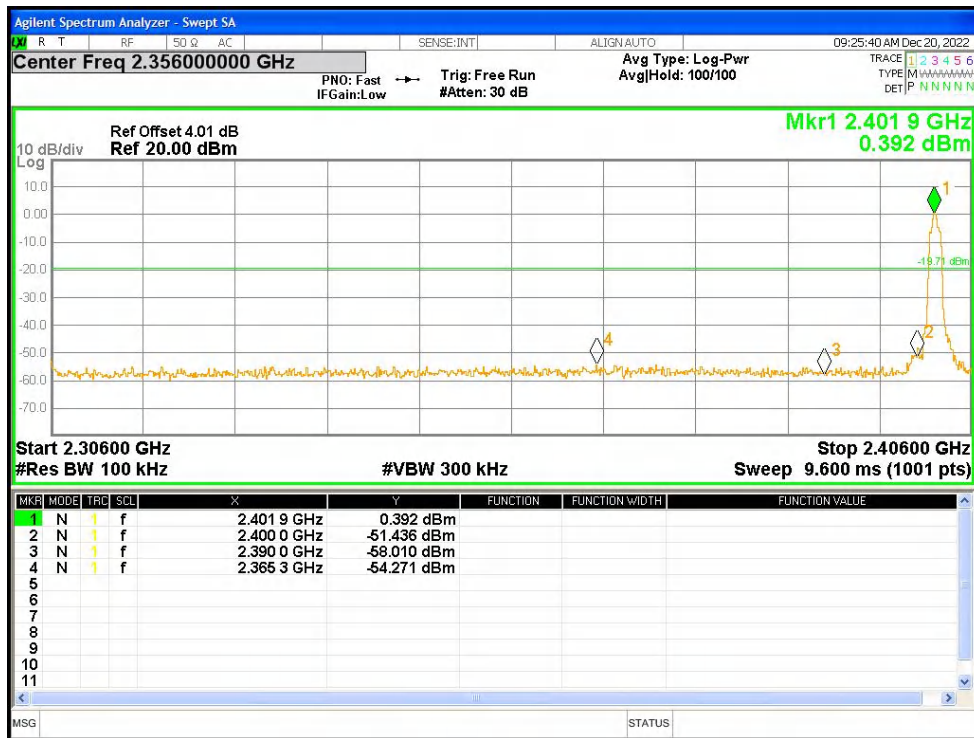

Band Edge NVNT 2-DH1 2480MHz Ant1 No-Hopping Ref



Band Edge NVNT 2-DH1 2480MHz Ant1 No-Hopping Emission

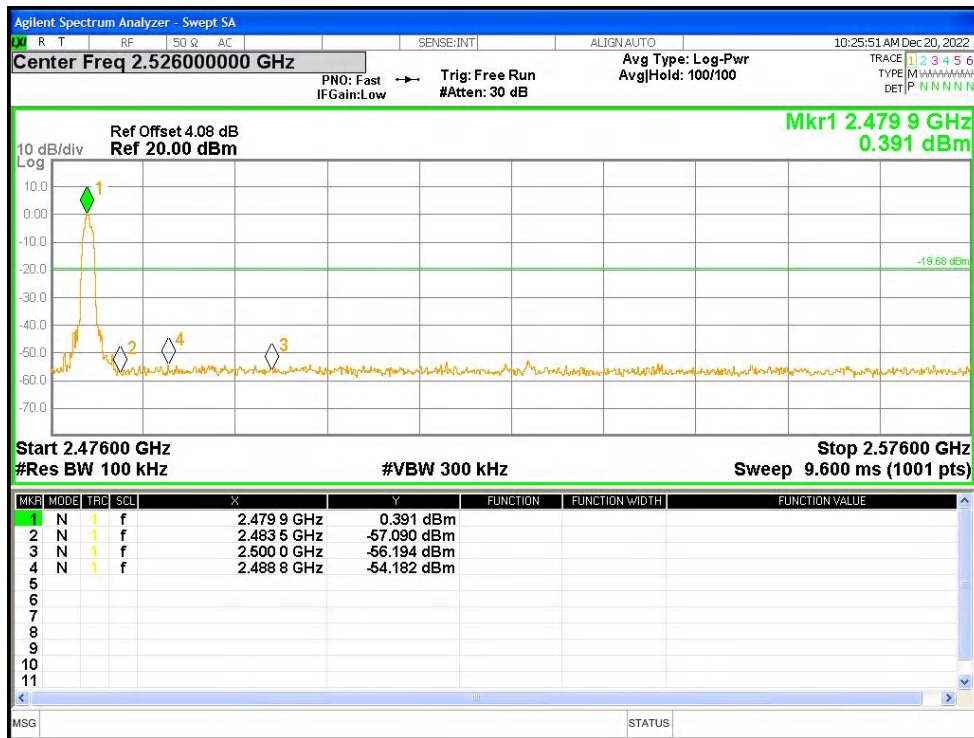


Band Edge(Hopping)

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH1	2402	Ant1	Hopping	-49.89	-20	Pass
NVNT	1-DH1	2480	Ant1	Hopping	-50.33	-20	Pass
NVNT	2-DH1	2402	Ant1	Hopping	-49.52	-20	Pass
NVNT	2-DH1	2480	Ant1	Hopping	-49.46	-20	Pass

Band Edge(Hopping) NVNT 1-DH1 2402MHz Ant1 Hopping Ref




Band Edge(Hopping) NVNT 1-DH1 2402MHz Ant1 Hopping Emission

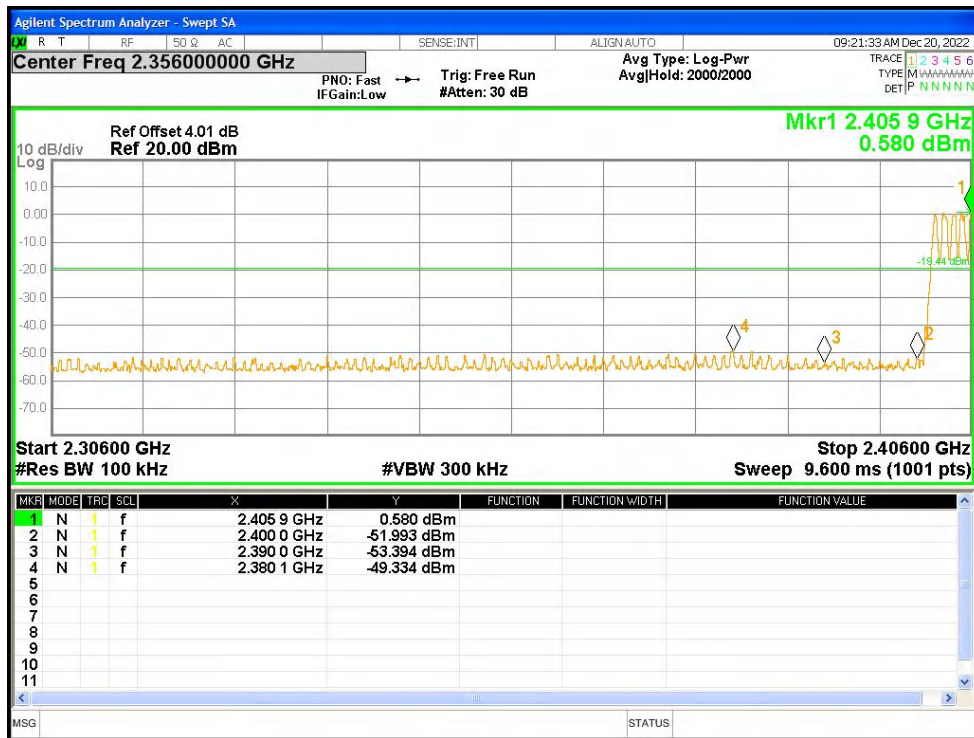

Band Edge(Hopping) NVNT 1-DH1 2480MHz Ant1 Hopping Ref




Band Edge(Hopping) NVNT 1-DH1 2480MHz Ant1 Hopping Emission

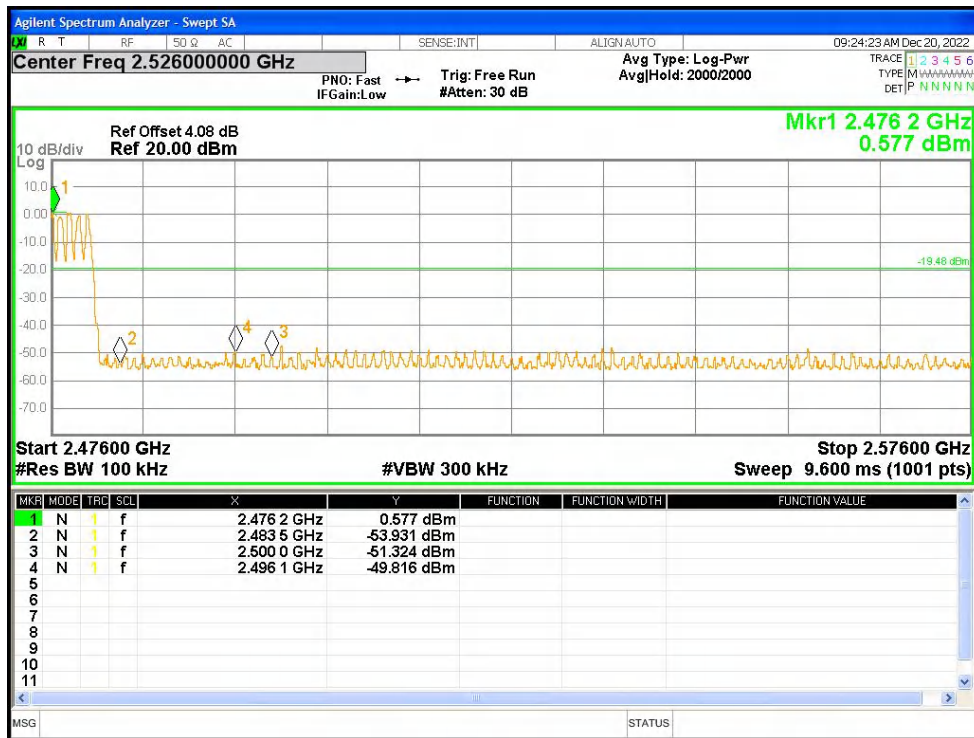

Band Edge(Hopping) NVNT 2-DH1 2402MHz Ant1 Hopping Ref




Band Edge(Hopping) NVNT 2-DH1 2402MHz Ant1 Hopping Emission

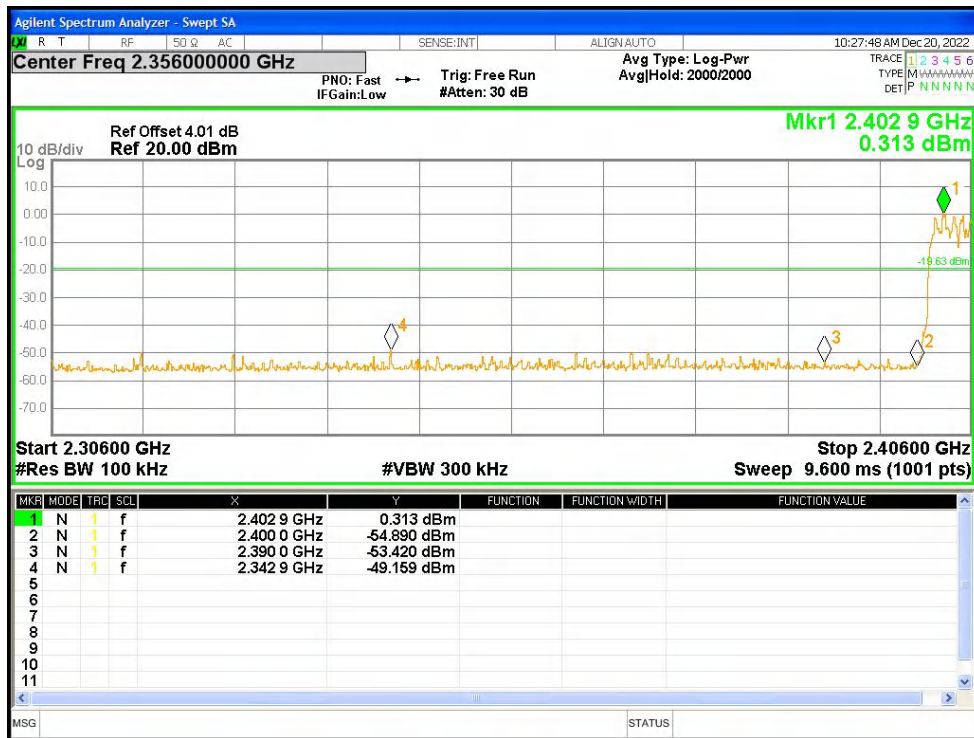

Band Edge(Hopping) NVNT 2-DH1 2480MHz Ant1 Hopping Ref




Band Edge(Hopping) NVNT 2-DH1 2480MHz Ant1 Hopping Emission

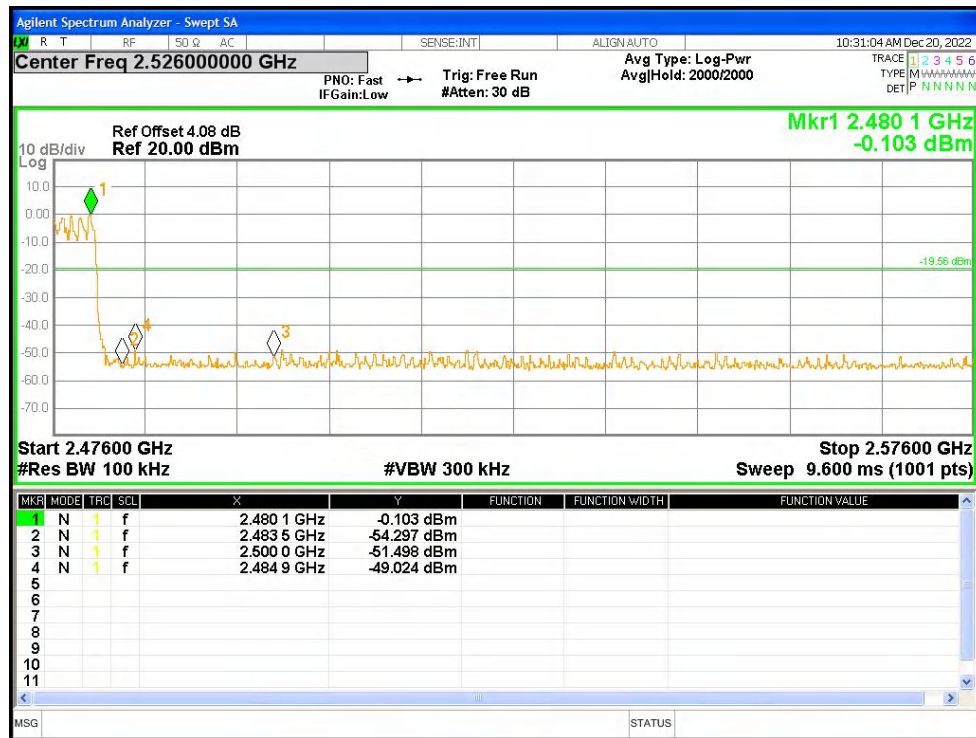


Conducted RF Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH1	2402	Ant1	-43.6	-20	Pass
NVNT	1-DH1	2441	Ant1	-44.61	-20	Pass
NVNT	1-DH1	2480	Ant1	-44.94	-20	Pass
NVNT	2-DH1	2402	Ant1	-44.35	-20	Pass
NVNT	2-DH1	2441	Ant1	-44.22	-20	Pass
NVNT	2-DH1	2480	Ant1	-44.45	-20	Pass


Tx. Spurious NVNT 1-DH1 2402MHz Ant1 Ref

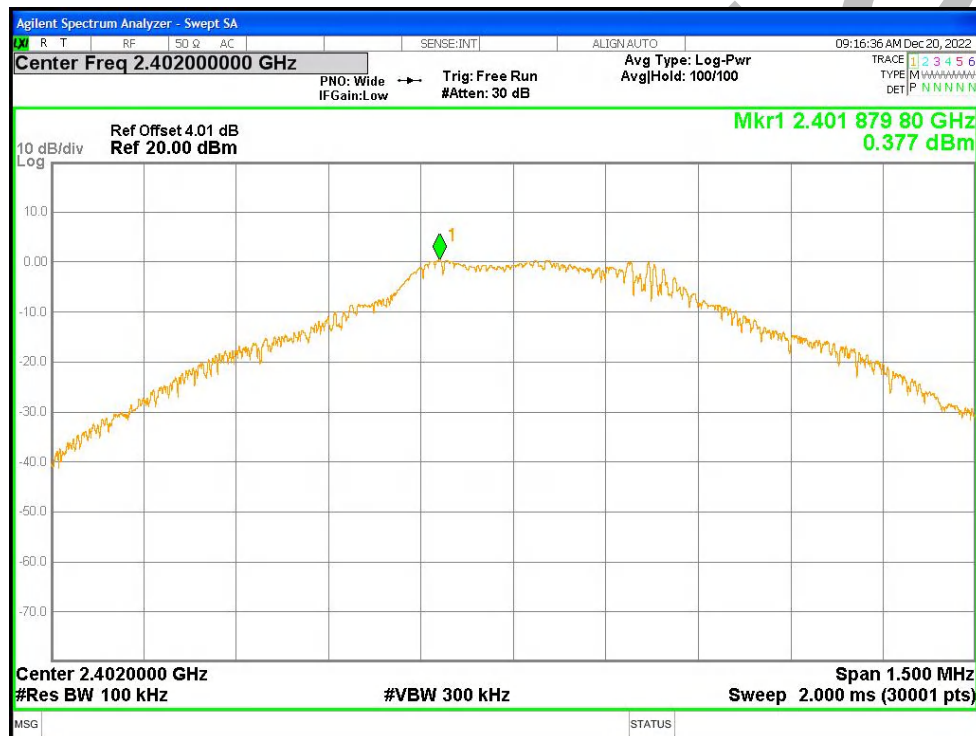


Tx. Spurious NVNT 1-DH1 2402MHz Ant1 Emission

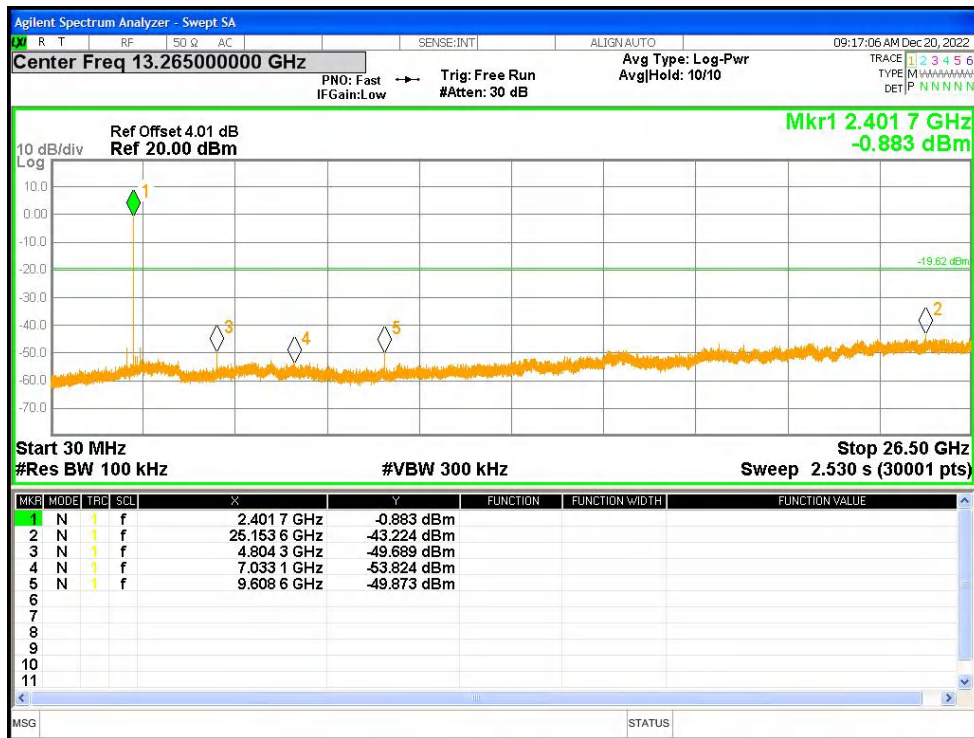


Tx. Spurious NVNT 1-DH1 2441MHz Ant1 Ref

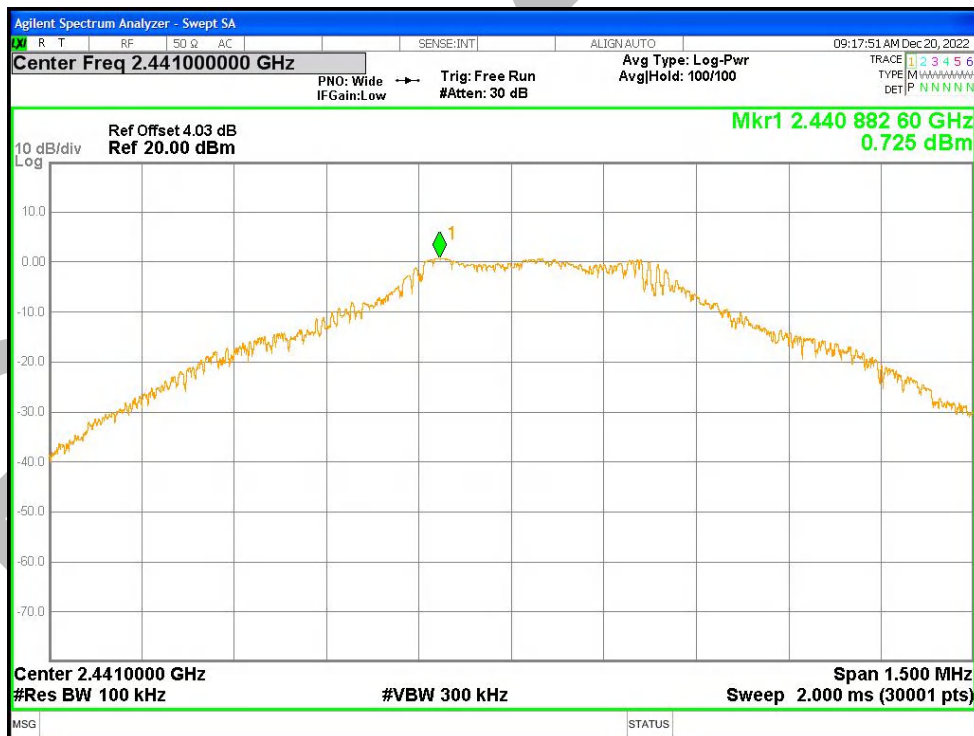


Tx. Spurious NVNT 1-DH1 2441MHz Ant1 Emission

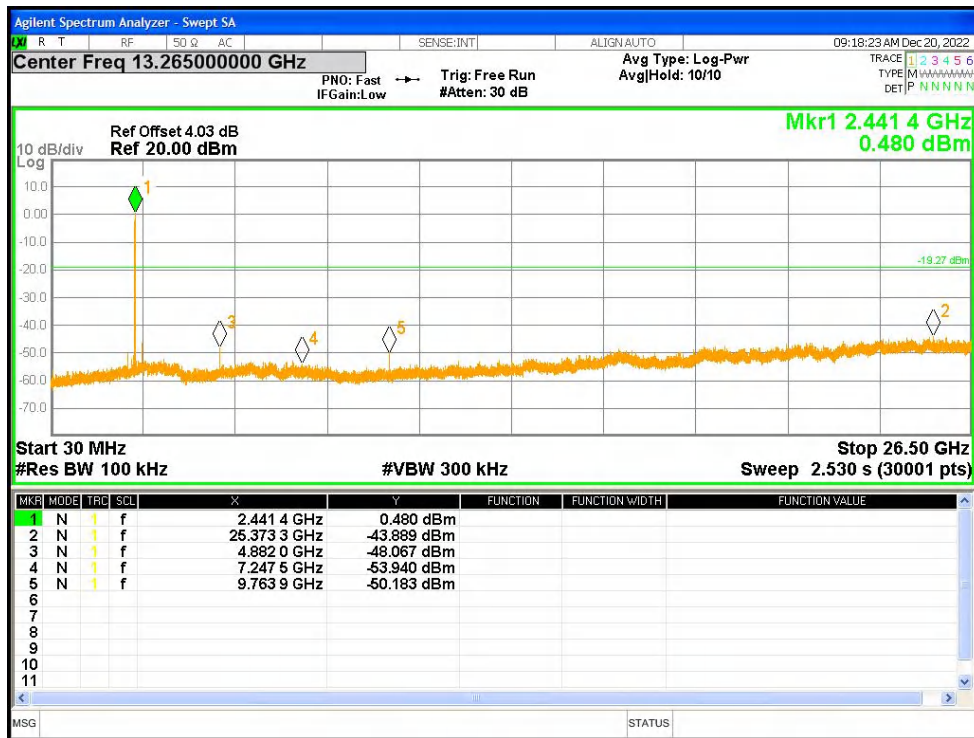

Tx. Spurious NVNT 1-DH1 2480MHz Ant1 Ref

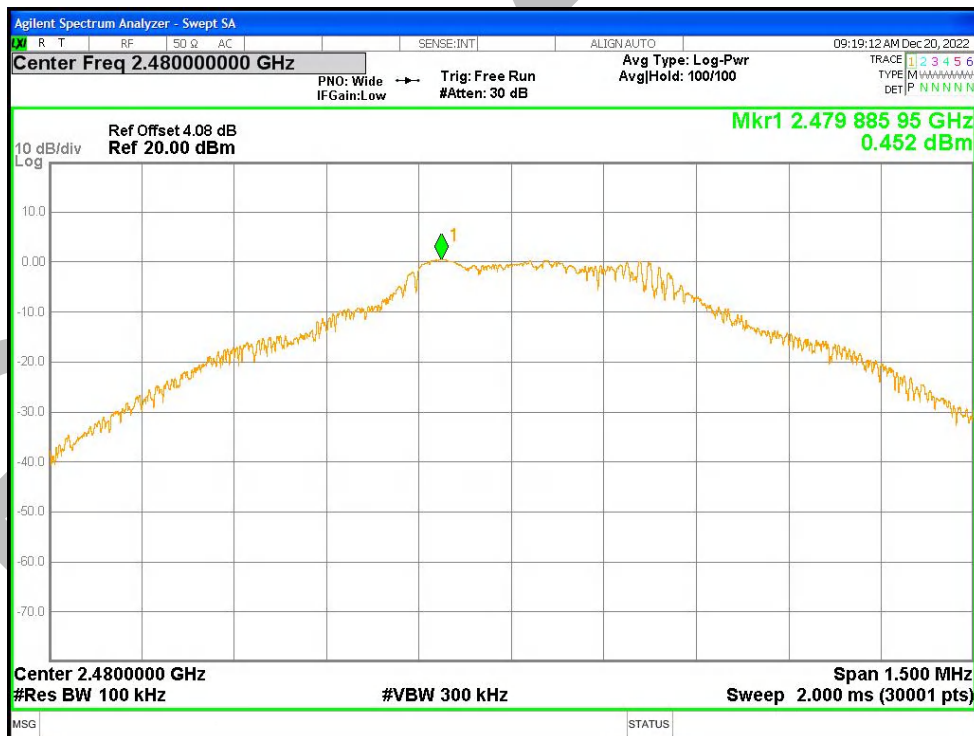


Tx. Spurious NVNT 1-DH1 2480MHz Ant1 Emission

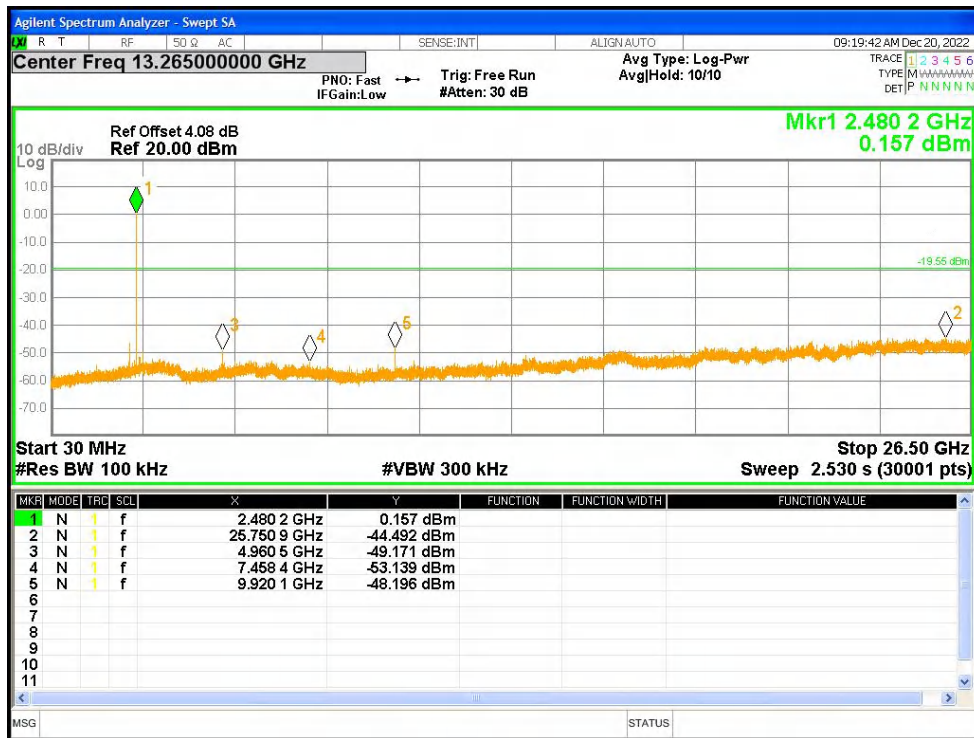


Tx. Spurious NVNT 2-DH1 2402MHz Ant1 Ref




Tx. Spurious NVNT 2-DH1 2402MHz Ant1 Emission

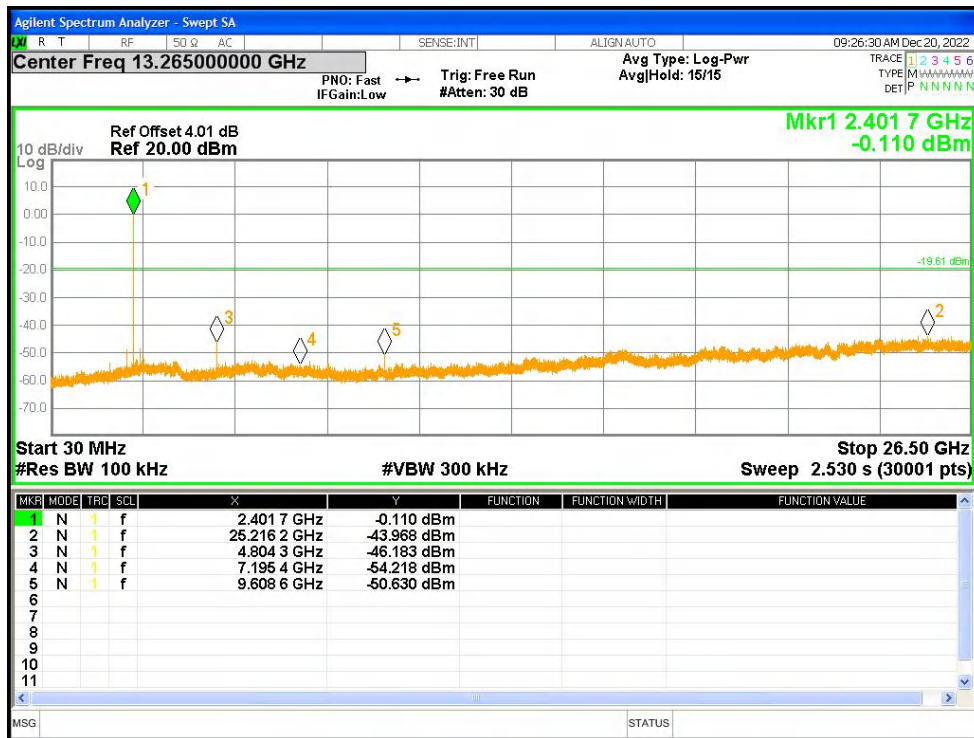


Tx. Spurious NVNT 2-DH1 2441MHz Ant1 Ref

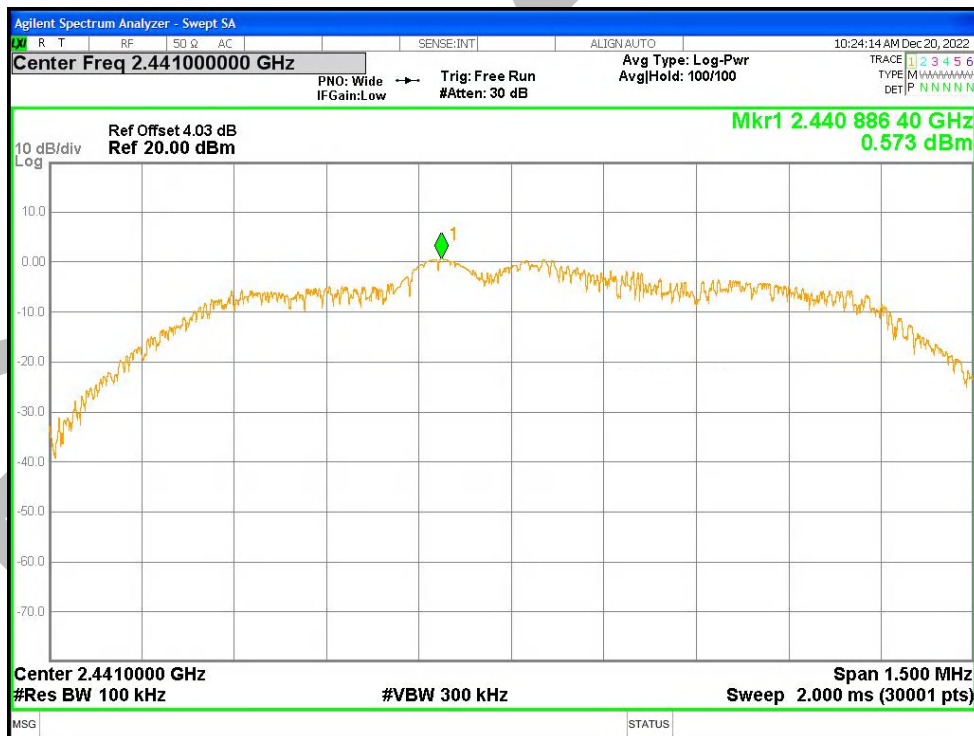


Tx. Spurious NVNT 2-DH1 2441MHz Ant1 Emission

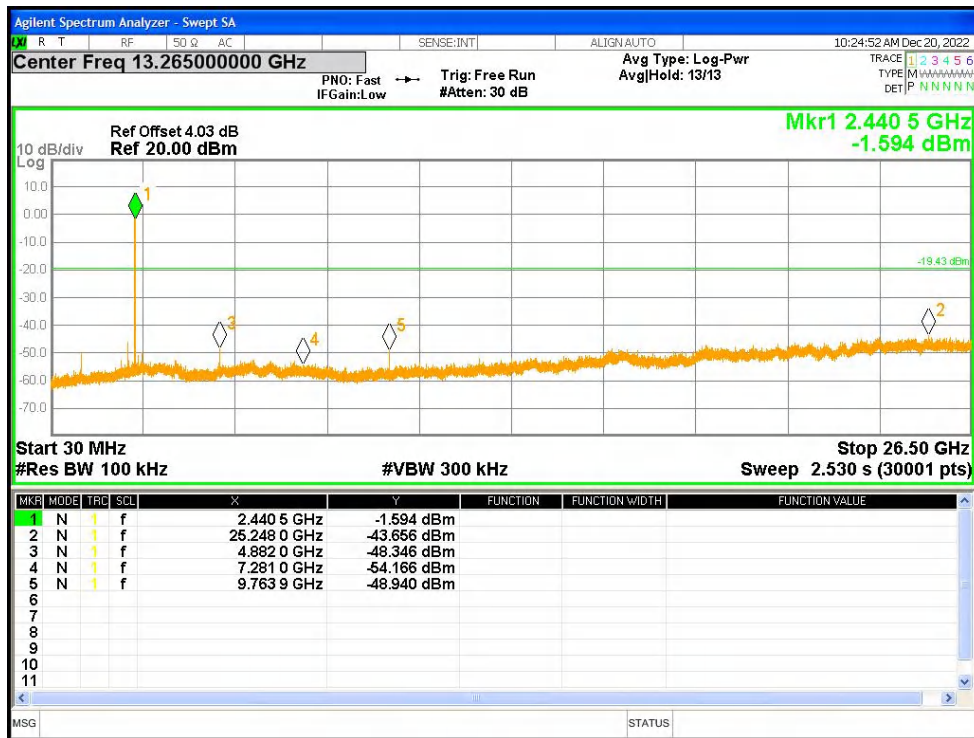

Tx. Spurious NVNT 2-DH1 2480MHz Ant1 Ref

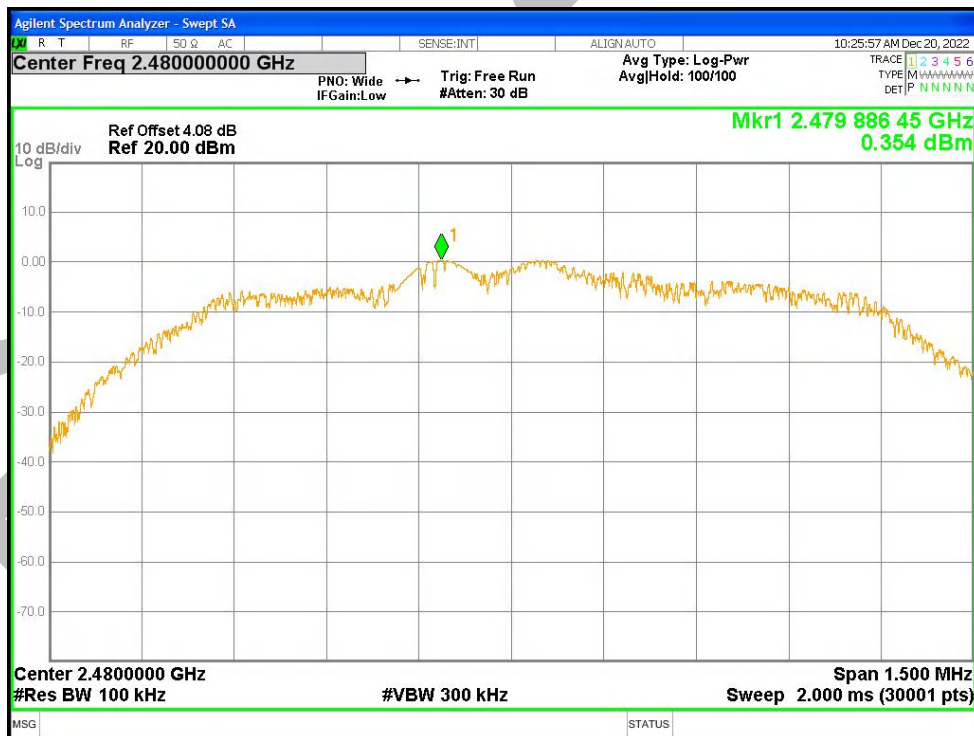


Tx. Spurious NVNT 2-DH1 2480MHz Ant1 Emission

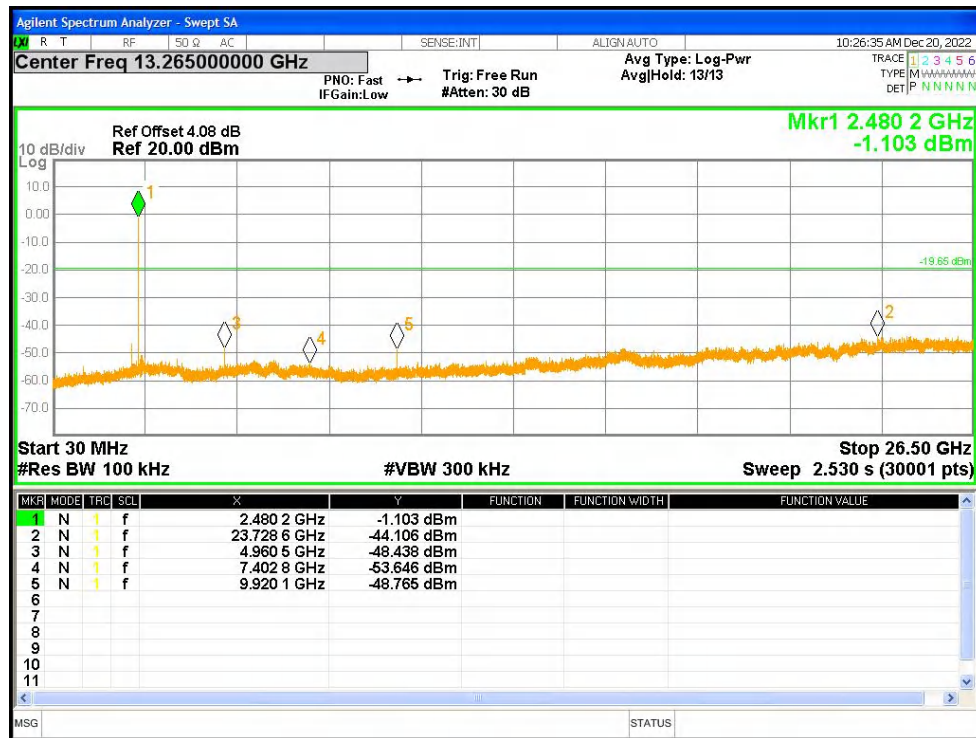

Carrier Frequencies Separation

Condition	Mode	Antenna	Hopping Freq1 (MHz)	Hopping Freq2 (MHz)	HFS (MHz)	Limit (MHz)	Verdict
NVNT	1-DH1	Ant1	2441.02	2442.0205	1.0005	0.610	Pass
NVNT	2-DH1	Ant1	2440.9825	2442.07	1.0875	0.841	Pass

CFS NVNT 1-DH1 2441MHz Ant1

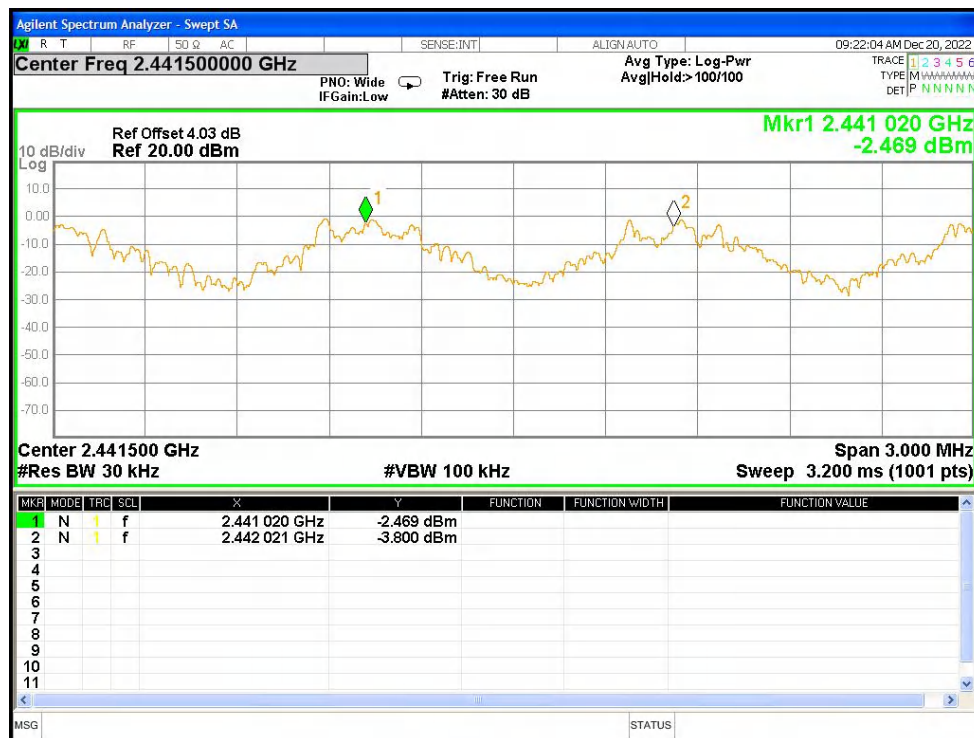


CFS NVNT 2-DH1 2441MHz Ant1



Number of Hopping Channel

Condition	Mode	Antenna	Hopping Number	Limit	Verdict
NVNT	1-DH1	Ant1	79	15	Pass
NVNT	2-DH1	Ant1	79	15	Pass

Hopping No. NVNT 1-DH1 2441MHz Ant1

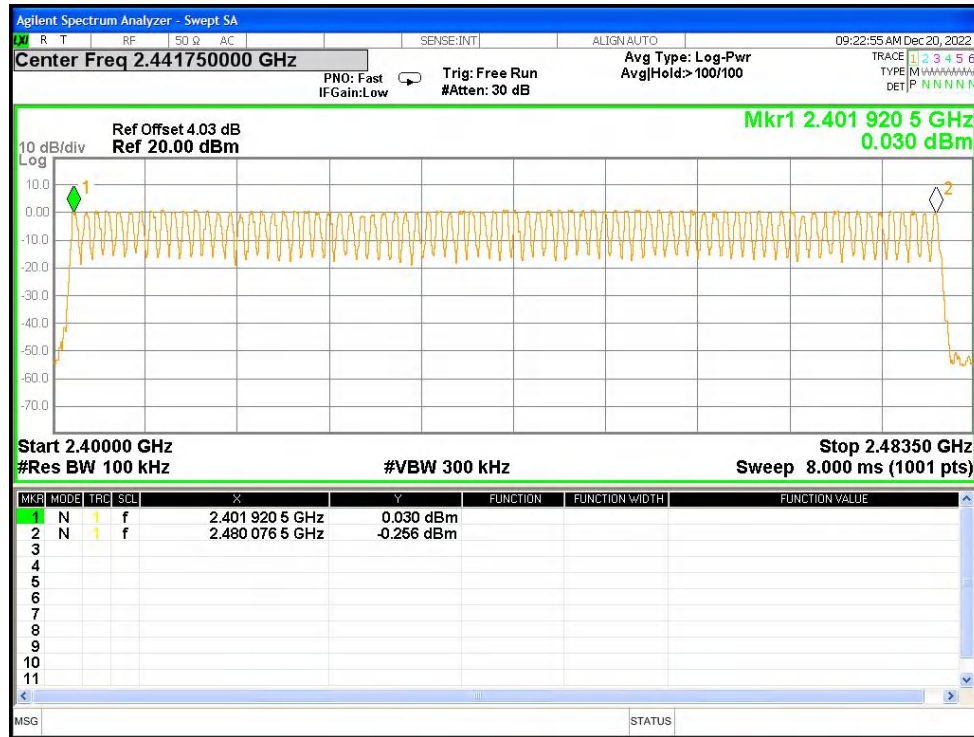

Hopping No. NVNT 2-DH1 2441MHz Ant1



Dwell Time

Condition	Mode	Frequency (MHz)	Antenna	Pulse Time (ms)	Total Dwell Time (ms)	Burst Count	Period Time (ms)	Limit (ms)	Verdict
NVNT	1-DH1	2441	Ant1	0.383	121.411	317	31600	400	Pass
NVNT	1-DH3	2441	Ant1	1.639	275.352	168	31600	400	Pass
NVNT	1-DH5	2441	Ant1	2.887	297.361	103	31600	400	Pass
NVNT	2-DH5	2441	Ant1	2.891	318.01	110	31600	400	Pass


Dwell NVNT 1-DH1 2441MHz Ant1 One Burst



Dwell NVNT 1-DH1 2441MHz Ant1 Accumulated




Dwell NVNT 1-DH3 2441MHz Ant1 One Burst

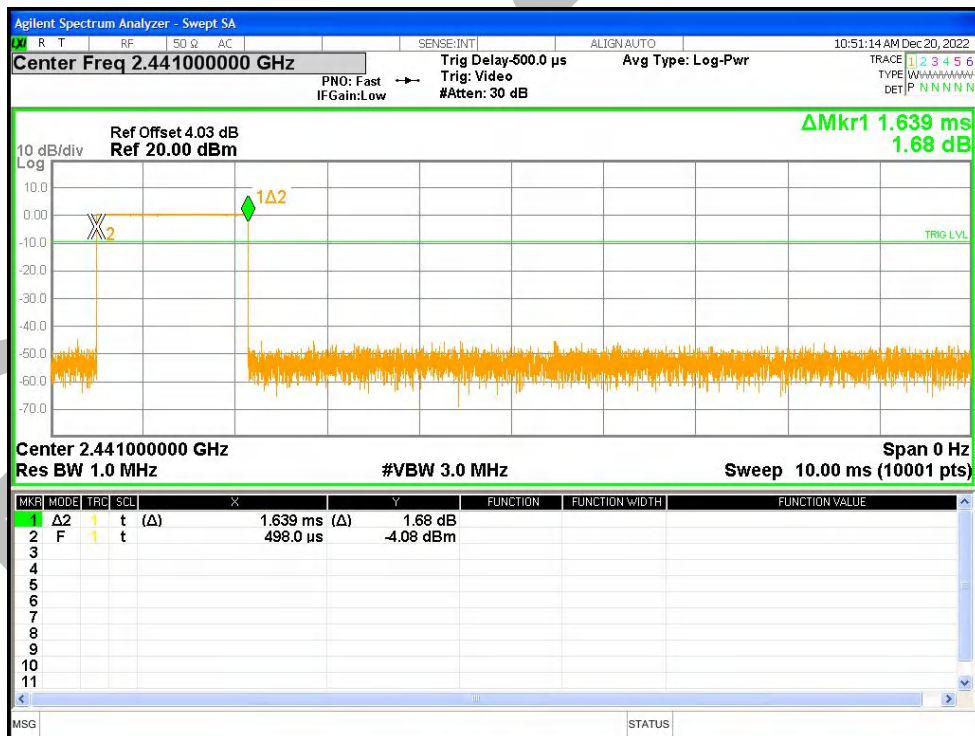


Dwell NVNT 1-DH3 2441MHz Ant1 Accumulated




Dwell NVNT 1-DH5 2441MHz Ant1 One Burst

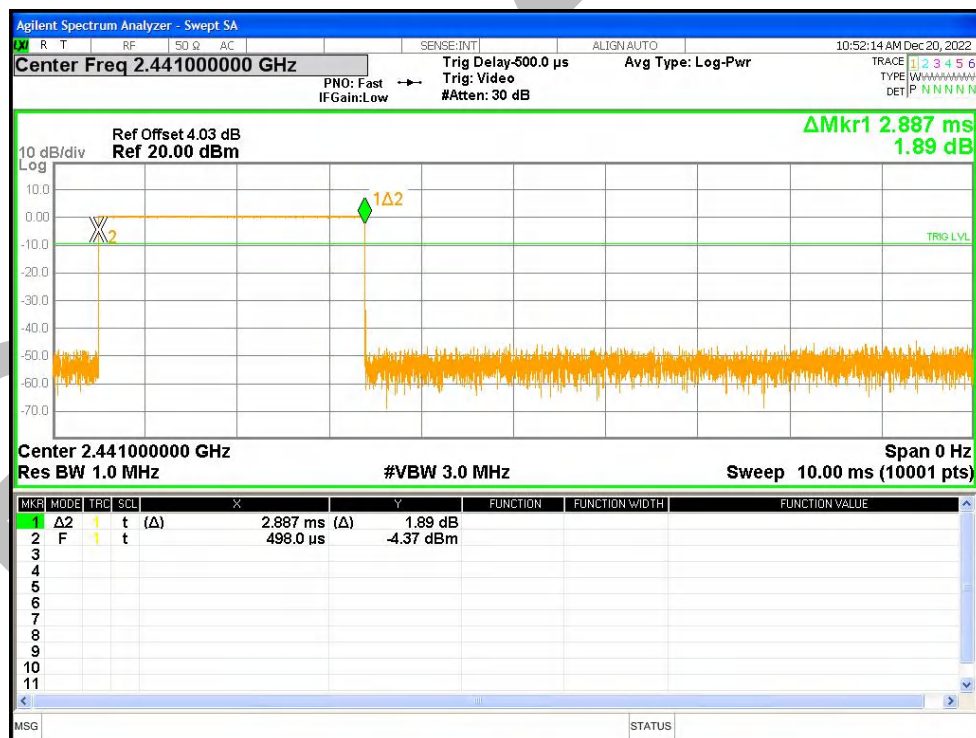


Dwell NVNT 1-DH5 2441MHz Ant1 Accumulated

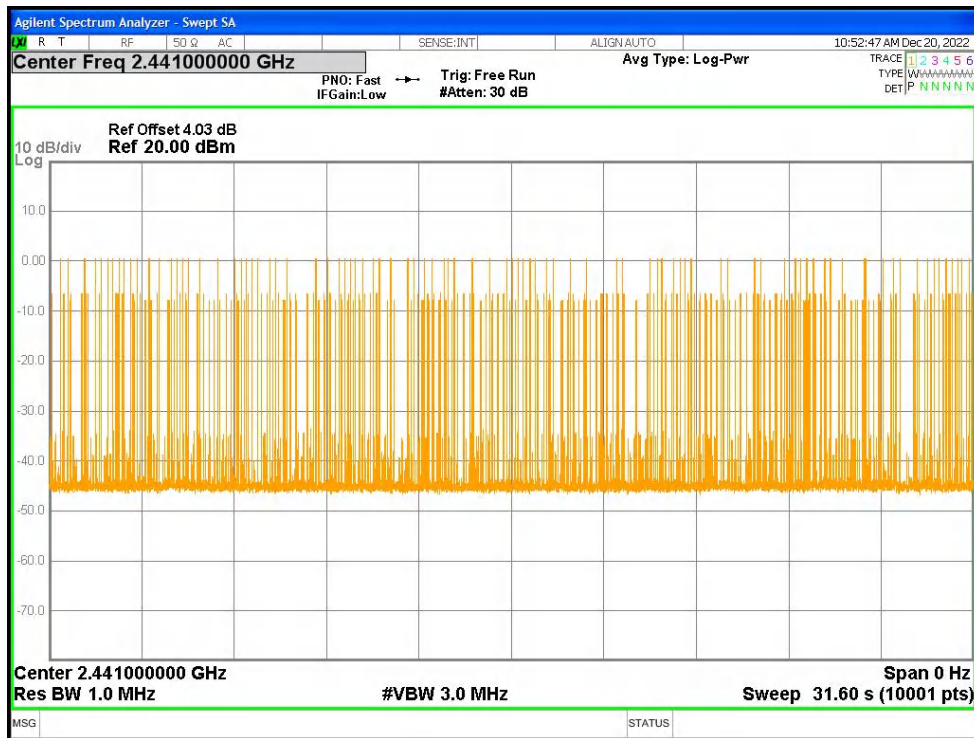

Dwell NVNT 2-DH5 2441MHz Ant1 One Burst

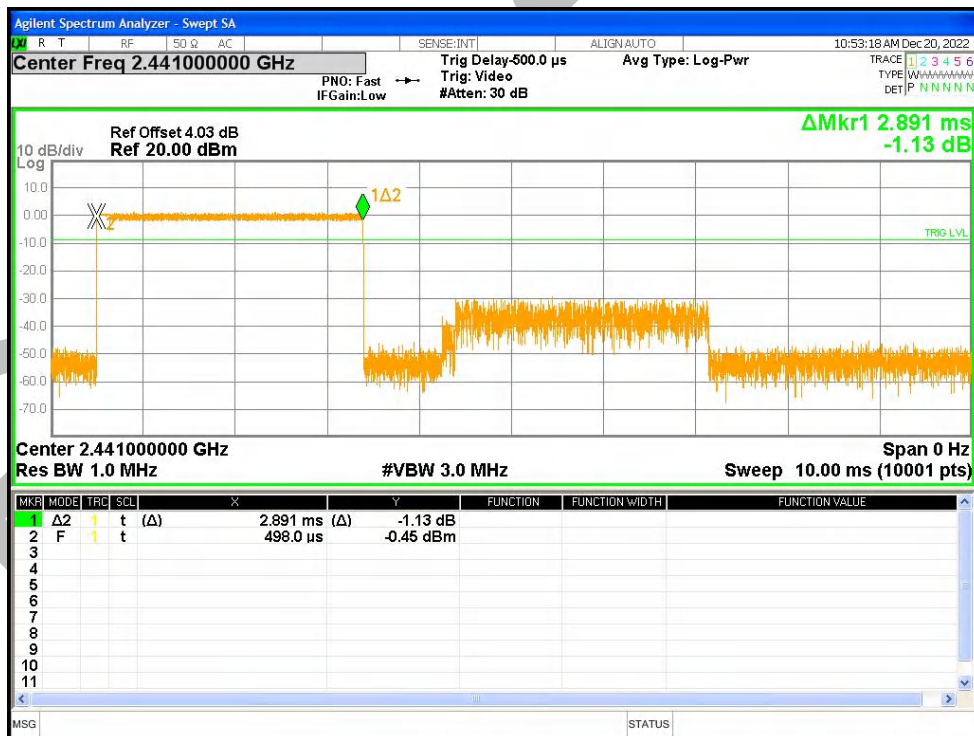


Dwell NVNT 2-DH5 2441MHz Ant1 Accumulated

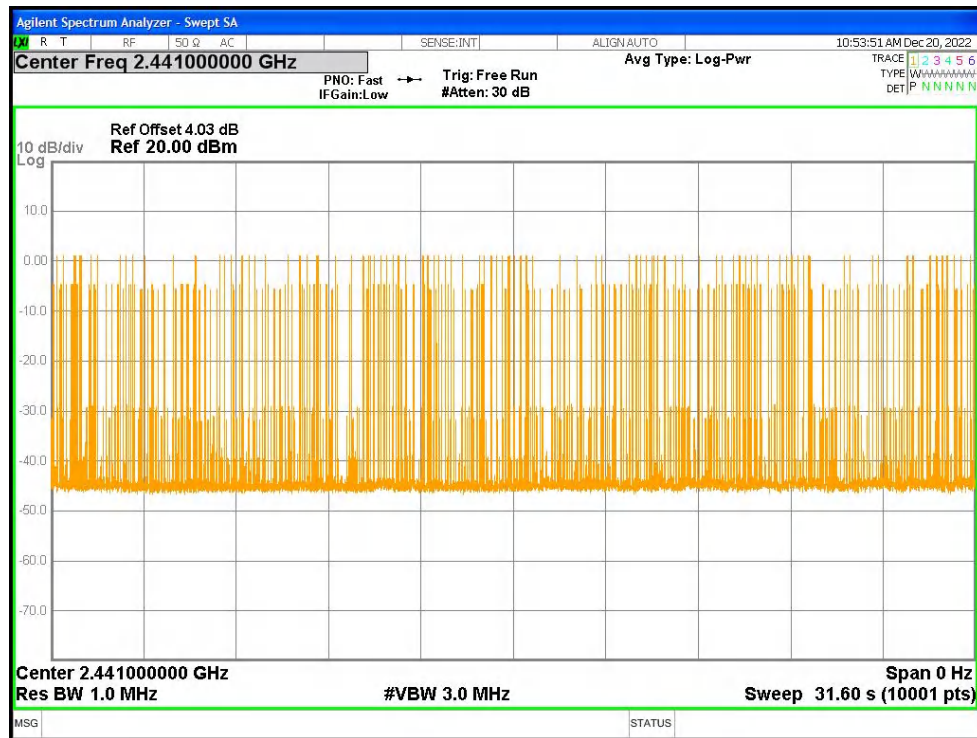

APPENDIX A: PHOTOGRAPHS OF TEST SETUP

Radiated Spurious Emissions

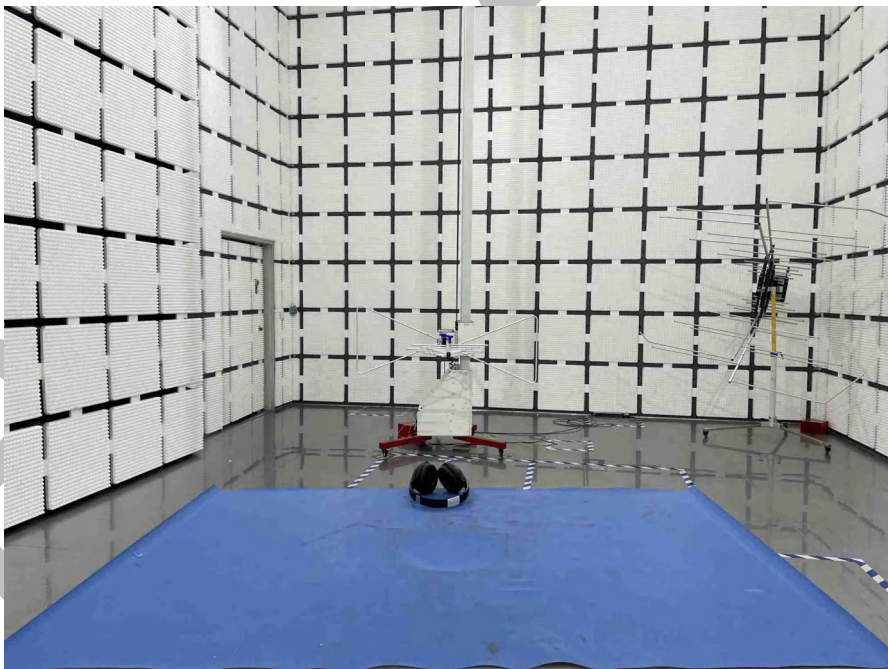

Conducted Emissions at AC Power Line (150kHz-30MHz)



APPENDIX B: PHOTOGRAPHS OF EUT

Reference to the test report No. BLA-EMC-202212-A7001

----END OF REPORT----

The test report is effective only with both signature and specialized stamp, The result(s) shown in this report refer only to the sample(s) tested. Without written approval of BlueAsia, this report can't be reproduced except in full.