

FCC LISTED, REGISTRATION
NUMBER: 2764.01

Test report No:

ISED LISTED REGISTRATION
NUMBER: 23595-1

NIE: 02209CBRS.001A2

Test report

Citizen Broadband Radio Service Test report as per WINNForum Test Specification WINNF-TS-0122-V1.0.0

Identification of item tested.....:	CPE8100-PRO-1D-3.x
Trademark	
CBSD Identifier	CPE8100-PRO-1D-3.x
CBSD Final HW version	NA
CBSD Final SW version	TELRAD_SQN3220SC_V1.3.OP0_R1178
Domain Proxy Identifier	BreezeVIEW
Domain Proxy Final HW version	NA
Domain Proxy Final SW version	7.0.0.028
Features	CPE, CBSD, Domain Proxy, LTE-TDD 48
Manufacturer	Telrad Networks Ltd. 1 Bat Sheva Street, P.O.B. 6118, Lod 711600, Israel
Test method requested, standard.....:	WinnForum TEST SPECIFICATION WINNF-TS-0122-V1.0.0
Summary	IN COMPLIANCE
Approved by (name / position & signature)	Bryan Mikesh, Chief Operating Officer, DEKRA Certification Inc. <i>Bryan Mikesh - COO</i>
Date of issue.....:	2018-12-14
Report template No.....:	FDT08_20



Index

Contents

Competences and guarantees3

General conditions3

Uncertainty3

Usage of samples3

Test sample description4

Testing period4

Environmental conditions4

Modifications to the reference test report4

Remarks and comments4

Testing verdicts.....4

Appendix A – Test result.....5

Appendix B – Test Systems.....10

Appendix C – CBSD/ DP Supported Features12

Appendix D – Reference Standards and Procedures14

Appendix E – Photographs16

Competences and guarantees

DEKRA Certification Inc. is a testing laboratory accredited by A2LA (The American Association for Laboratory Accreditation), to perform the tests indicated in the Certificate 2764.01.

DEKRA Certification, Inc. is a CTIA authorized testing laboratory with lab code 20131104-01.

DEKRA Certification, Inc. is a CBRS Alliance authorized test laboratory.

DEKRA Certification, Inc. is a WinnForum Approved CBSD test laboratory.

In order to assure the traceability to other national and international laboratories, DEKRA Certification Inc. has a calibration and maintenance program for its measurement equipment.

DEKRA Certification Inc. Guarantees the reliability of the data presented in this report, which is the result of the measurements and the tests performed to the item under test on the date and under the conditions stated on the report and, it is based on the knowledge and technical facilities available at DEKRA Certification Inc. at the time of performance of the test.

DEKRA Certification Inc. is liable to the client for the maintenance of the confidentiality of all information related to the item under test and the results of the test.

The results presented in this Test Report apply only to the particular item under test established in this document.

IMPORTANT: No parts of this report may be reproduced or quoted out of context, in any form or by any means, except in full, without the previous written permission of DEKRA Certification Inc.

General conditions

1. This report is only referred to the item that has undergone the test.
2. This report does not constitute or imply on its own an approval of the product by the Certification Bodies or competent Authorities.
3. This document is only valid if complete; no partial reproduction can be made without previous written permission of DEKRA Certification Inc.
4. This test report cannot be used partially or in full for publicity and/or promotional purposes without previous written permission of DEKRA Certification Inc. and the Accreditation Bodies.

Uncertainty

Uncertainty (factor $k=2$) was calculated according to the DEKRA Certification Inc. internal document PODT000.

Usage of samples

Samples undergoing test have been selected by: **the client**

Sample S/01 is composed of the following elements:

Control N°	Description	Model	Serial N°	Date of reception
02209.001	CPE 8100	CPE8100-PRO-1D-3.x	TLR41DFE970B	05/11/2018
NA	Domain Proxy Software	BreezeVIEW version 7.0.0.028	NA	05/11/2018

Test sample description

The test sample is a CPE. The unit connects to the Domain Proxy via the base station over a radio interface and hence is not always connected to the SAS system. The unit is activated by a Commercial Professional Installer. The CPI activates the radio interface on the unit so that it can connect to the Domain Proxy over LTE TDD 48 band. After this connection is established the Unit starts its communication with the Domain Proxy server and accepts instructions that the Domain proxy relays based on its communication with the SAS. Testing was performed using the CPE8100-PRO-1D-3.x as CBSD in combination with BreezeVIEW version 7.0.0.028 as the Domain Proxy software and the radio link connecting the two was manually initiated by the CPI every single time as expressed in this description. The combination of the Domain Proxy and the CPE unit was considered as the Unit Under Test.

Testing period

2018-05-23 to 2018-06-26

Environmental conditions

In the shielded chamber, the following limits were not exceeded during the test.

Temperature	Min. = 15 °C Max. = 35 °C
Relative humidity	Min. = 20 % Max. = 75 %
Air pressure	Min. = 860 mbar Max. = 1060 mbar

Remarks and comments

1: The tests have been performed by the technical personnel: Vinayak Thotton Veetil

Modifications to the reference test report

Following editorial modifications are introduced with respect to the test report number 2209CBRS.001A1 related with the same samples, in the next clauses and sub-clauses:

Clauses / Sub-clauses	Modification	Justification
Test Results	Test results table was updated to include HW version	Editorial

This modification test report cancels and replaces the test report 02209CBRS.001A1

Testing verdicts

Not applicable..... :	N/A
Pass..... :	P
Fail..... :	F
Inconclusive :	I

Appendix A – Test result

Summary of Test Results

	PASS VERDICT
	TDD
Standard	48
WINNF-TS-0122	33
Total	33

Test Results

Test Spec	Ref	Name	Condition	Date	Test sample	Result	SAS version	SW Version	HW Version
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.2	Domain Proxy Multi-Step registration	Normal	6/21/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.REG.7	Registration due to change of an installation parameter	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.9	Domain Proxy Missing Required parameters (responseCode 102)	Normal	6/21/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.11	Domain Proxy Pending registration (responseCode 200)	Normal	6/21/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.13	Domain Proxy Invalid parameters (responseCode 103)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.15	Domain Proxy Blacklisted CBSD (responseCode 101)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.17	Domain Proxy Unsupported SAS protocol version (responseCode 100)	Normal	6/21/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.REG.19	Domain Proxy Group Error (responseCode 201)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.GRA.1	Unsuccessful Grant responseCode=400 (INTERFERENCE)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.GRA.2	Unsuccessful Grant responseCode=401 (GRANT_CONFLICT)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.HBT.2	Domain Proxy Heartbeat Success Case (first Heartbeat Response)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D

Test Spec	Ref	Name	Condition	Date	Test sample	Result	SAS version	SW Version	HW Version
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.3	Heartbeat responseCode=105 (DEREGISTER)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.4	Heartbeat responseCode=500 (TERMINATED_GRANTED)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.5	Heartbeat responseCode=501 (SUSPENDED_GRANTED) in First Heartbeat Response	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.6	Heartbeat responseCode=501 (SUSPENDED_GRANTED) in Subsequent Heartbeat Response	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.7	Heartbeat responseCode=502 (UNSYNC_OP_PARAMETER)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.D.HBT.8	Domain Proxy Heartbeat responseCode=500 (TERMINATED_GRANTED)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.9	Heartbeat Response Absent (First Heartbeat)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.10	Heartbeat Response Absent (Subsequent Heartbeat)	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.HBT.11	Successful Grant Renewal in Heartbeat Test Case	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.C.MES.3	Grant Response contains measReportConfig	Normal	6/26/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINNF-TS-0122-V1.0.0	WINNF.FT.D.MES.5	Domain Proxy Heartbeat Response contains measReportConfig	Normal	6/26/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D

Test Spec	Ref	Name	Condition	Date	Test sample	Result	SAS version	SW Version	HW Version
WINN F-TS-0122-V1.0.0	WINNF.FT.D.RLQ.2	Domain Proxy Successful Relinquishment	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.RLQ.4	Domain Proxy Unsuccessful Relinquishment, responseCode=102	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.RLQ.6	Domain Proxy Unsuccessful Relinquishment, responseCode=103	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.DRG.2	Domain Proxy Successful Deregistration	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.D.DRG.4	Domain Proxy Deregistration responseCode=102	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.DRG.5	Deregistration responseCode=103	Normal	6/22/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.SCS.1	Successful TLS connection between UUT and SAS Test Harness	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.SCS.2	TLS failure due to revoked certificate	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.SCS.3	TLS failure due to expired server certificate	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.SCS.4	TLS failure when SAS Test Harness certificate is issue by unknown CA	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.FT.C.SCS.5	TLS failure when certificate at the SAS Test Harness is corrupted	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D
WINN F-TS-0122-V1.0.0	WINNF.PT.C.HBT	UUT RF Transmit Power Measurement	Normal	5/23/2018	02209.001	P	1.0.0.2	TELRAD_SQN3220SC_V1.3.0P0_R1178	AM4100D

Appendix B – Test Systems

Test System Used

Model	Description	Control Number	Uncertainties
Dell Latitude, Windows 7, 64-bit	Laptop with SAS harness	CTC-5233-K	NA
EXA N9010A	Signal Analyzer	0018	NA
MXA N9020A	Signal Analyzer	0382	NA
HWg-STE Plain	Ethernet SNMP Thermometer	1107	NA
DR-4X7S201-LH	Shielded Chamber	0131	NA

Appendix C – CBSD/ DP Supported Features

Condition	Feature Description	Supported
C1	Mandatory for UUT which supports multi-step registration message.	Y
C2	Mandatory for UUT which supports single-step registration with no CPI-signed data in the registration message. By definition, this is a subset of Category A devices which determine all registration information, including location, without CPI intervention.	N
C3	Mandatory for UUT which supports single-step registration containing CPI-signed data in the registration message.	N
C4	Mandatory for UUT which supports RECEIVED_POWER_WITHOUT_GRANT measurement report type.	N
C5	Mandatory for UUT which supports RECEIVED_POWER_WITH_GRANT measurement report type.	Y
C6	Mandatory for UUT which supports parameter change being made at the UUT and prior to sending a deregistration.	N

Appendix D – Reference Standards and Procedures

Reference Standards

Test and Certification for Citizens Broadband Radio Service (CBRS); Conformance and Performance Test Technical Specification; CBSD/DP as Unit Under Test (UUT) Working Document WINNF-TS-0122	V1.0.0
---	--------

Test Procedures


PECB001_00: CBRS Alliance Certification Testing Based On WINN Forum CBRS CBSD Test Specification "WINNF-TS-0122"
--

Appendix E – Photographs

FRONT VIEW



REAR VIEW

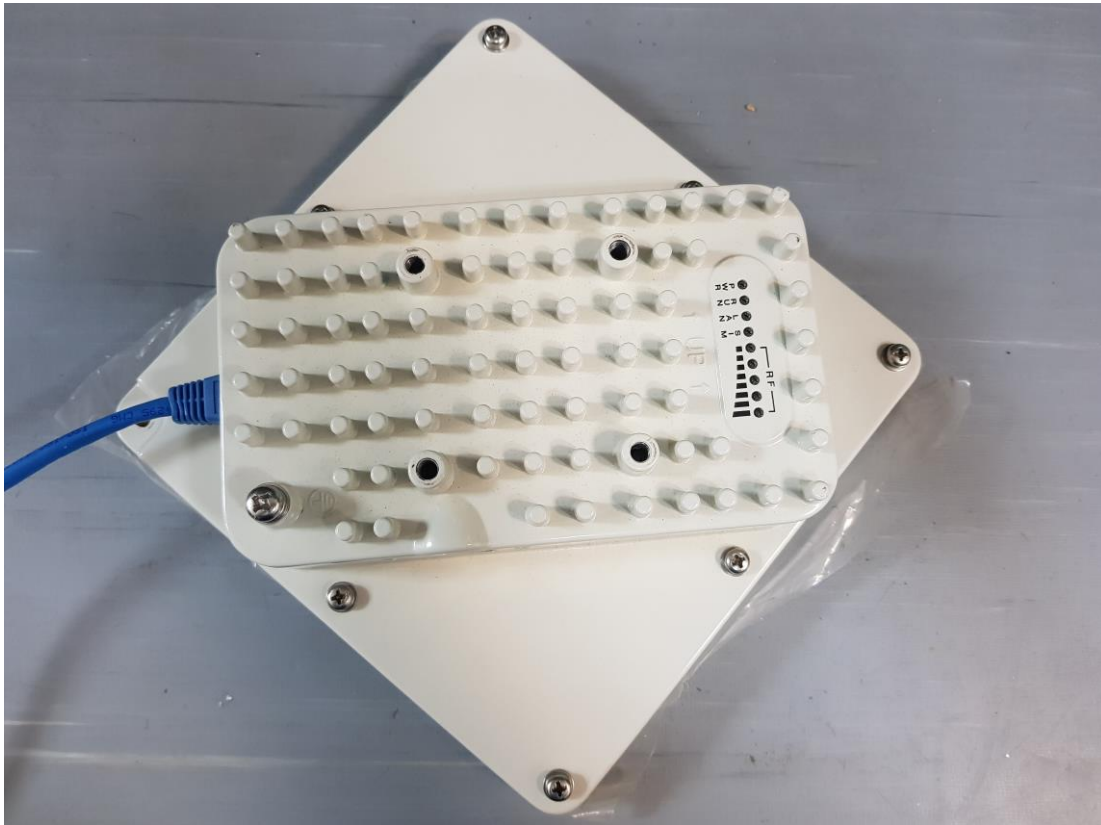

SIDE VIEW



INTERNAL VIEW

