



Report No.: FG380306H

# FCC Part 96.47 TEST REPORT

FCC ID : A4RG8HHN

Equipment : Phone Model Name : G8HHN

Applicant : Google LLC

1600 Amphitheatre Parkway,

Mountain View, California, 94043 USA

Standard : FCC Part 96.47

RF Interface : LTE B48

The product was received on Aug. 25, 2023, and testing was performed from Sep. 20, 2023 to Sep. 21, 2023. We, Sporton International Inc. Wensan Laboratory, would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. Wensan Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai

TEL: 886-3-327-0868

FAX: 886-3-327-0855

Sporton International Inc. Wensan Laboratory

No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.)

Report Template No.: BU5- CR247WL5G AC MA Version 2.1 Report Version

Page Number : 1 of 11 Issue Date : Nov. 14, 2023

eport Version : 01

## **Table of Contents**

Report No. : FG380306H

: 01

His	story o	of this test report			
	-	ry of Test Result			
1		eral Description			
		Product Feature of Equipment Under Test			
	1.2	Modification of EUT			
	1.3	Testing Location			
	1.4	Applicable Standards	6		
2	Test Configuration of Equipment Under Test				
		Connection Diagram of Test System			
3	End	User Device additional requirement	8		
		Test Requirement			
	3.2	Test Procedure	8		
		Test Result			
4	List	of Measuring Equipment	11		
Аp	pendi	ix A. Setup Photographs			

TEL: 886-3-327-0868 Page Number : 2 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## History of this test report

Report No. : FG380306H

Report No.	Version	Description	Issue Date
FG380306H	01	Initial issue of report	Nov. 14, 2023

TEL: 886-3-327-0868 Page Number : 3 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## **Summary of Test Result**

Report No.: FG380306H

Report Clause	Ref Std. Clause	Test Items	Result (PASS/FAIL)	Remark
3	96.47	End User Device additional requirement	Pass	-

#### **Conformity Assessment Condition:**

The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or in accordance with the requirements stipulated by the applicant/manufacturer who shall bear all the risks of non-compliance that may potentially occur if measurement uncertainty is taken into account.

#### Disclaimer:

The product specifications of the EUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

Reviewed by: William Chen
Report Producer: Ming Chen

TEL: 886-3-327-0868 Page Number : 4 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## 1 General Description

## 1.1 Product Feature of Equipment Under Test

#### **Product Feature**

Report No.: FG380306H

#### **General Specs**

GSM/WCDMA/LTE/5G NR, Bluetooth, BLE, BLE channel sounding, Wi-Fi 2.4GHz 802.11b/g/n/ac/ax, Wi-Fi 5GHz 802.11a/n/ac/ax, Wi-Fi 6GHz 802.11a/ax, NFC, WPC Rx and GNSS Rx.

#### **Antenna Type**

WWAN:

<Ant. 0>: ILA Antenna <Ant. 1>: ILA Antenna <Ant. 2>: IFA Antenna <Ant. 5>: IFA Antenna <Ant. 6>: IFA Antenna

**Remark:** The above EUT's information was declared by manufacturer. Please refer to Disclaimer in report summary.

EUT Information List			
S/N	Performed Test Item		
38011JEKB00251	Conducted Measurement		

#### 1.2 Modification of EUT

No modifications are made to the EUT during all test items.

TEL: 886-3-327-0868 Page Number : 5 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## 1.3 Testing Location

Test Site	Sporton International Inc. Wensan Laboratory		
Test Site Location	No.58, Aly. 75, Ln. 564, Wenhua 3rd, Rd., Guishan Dist., Taoyuan City 333010, Taiwan (R.O.C.) TEL: +886-3-327-0868 FAX: +886-3-327-0855		
Test Site No.	Sporton Site No.		
rest Site No.	TH05-HY		
Test Engineer	Leon Huang		
Temperature	22 ~ 25 °C		
Relative Humidity	41 ~ 45 %		

Report No.: FG380306H

FCC designation No.: TW3786

## 1.4 Applicable Standards

- FCC Part 96.47
- FCC KDB 940660 D01 Part 96 CBRS Eqpt v03
- WINNF-TS-0122-V1.0.2 CBRS CBSD Test Specification


#### Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. The TAF code is not including all the FCC KDB listed without accreditation.

TEL: 886-3-327-0868 Page Number : 6 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## 2 Test Configuration of Equipment Under Test

# 2.1 Connection Diagram of Test System

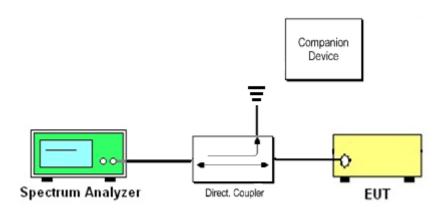

Report No.: FG380306H

The companion device is certified CBSD (FCC ID: S9GQ710US02)

TEL: 886-3-327-0868 Page Number : 7 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

## 3 End User Device additional requirement

## 3.1 Test Requirement

FCC Part 96.47

(a) End User Devices may operate only if they can positively receive and decode an authorization signal transmitted by a CBSD, including the frequencies and power limits for their operation.

Report No.: FG380306H

(1) An End User Device must discontinue operations, change frequencies, or change its operational power level within 10 seconds of receiving instructions from its associated CBSD.

#### 3.2 Test Procedure

Following procedure can be done by applying WINNF-TS-0122-V1.0.2 CBRS CBSD Test Specification, use the certified Ruckus CBSD (FCC ID: S9GQ710US02) as companion device to show compliance with Part 96.47 requirement for End User Device (EUD):

- 1. Configure SAS granted CBSD to operate at frequency 3600-3620 MHz and power level 20 dBm/MHz
- 2. Enable AP service from Ruckus Cloud management
- 3. Check EUD Tx Frequency and power
- 4. Disable AP service from Ruckus Cloud management
  - a. Check EUD stops transmission within 10 seconds.
- 5. Configure SAS granted CBSD to operate at frequency 3670-3690 MHz & power level 10 dBm/MHz
- 6. Enable AP service from Ruckus Cloud management
- 7. Check EUD Tx Frequency and power
- 8. Disable AP service from Ruckus Cloud management
  - a. Check EUD stops transmission within 10 seconds.


TEL: 886-3-327-0868 Page Number : 8 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

### 3.3 Test Result


# [Step 1] Configure SAS granted CBSD to operate at frequency 3600-3620 MHz and power level 20 dBm/MHz

Report No.: FG380306H

[Step 3] Check EUD Tx Frequency and power

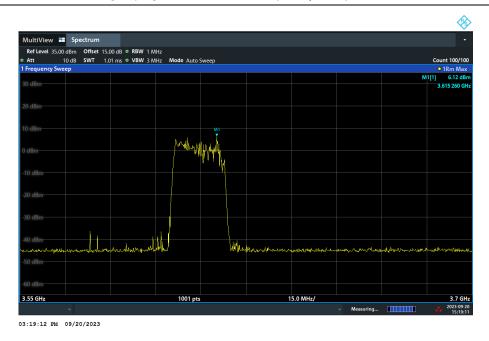

[Step 4.a.] EUD stops transmission within 10 seconds of receiving instructions from its associated CBSD.

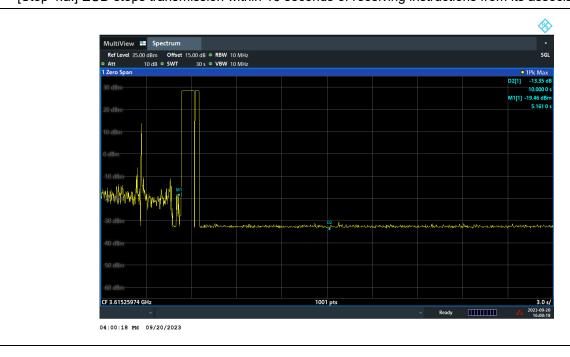

TEL: 886-3-327-0868 Page Number : 9 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

# [Step 5] Configure SAS granted CBSD to operate at frequency 3670-3690 MHz & power level 10 dBm/MHz

Report No.: FG380306H


: 01

[Step 7] Check EUD Tx Frequency and power



[Step 8.a.] After changing the frequency and power level,

The module (EUT) discontinues operations, change frequencies, or change its operational power level within 10 seconds of receiving instructions from its associated CBSD. Test result is PASS.

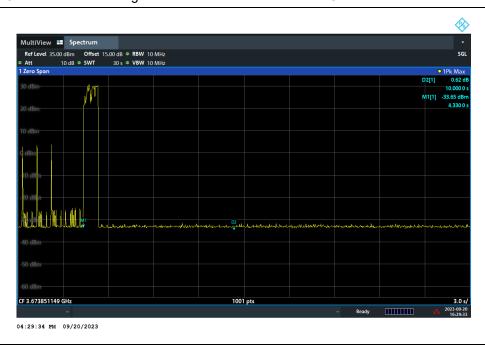

TEL: 886-3-327-0868 Page Number : 10 of 11
FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023

# 4 List of Measuring Equipment

Instrument	Brand Name	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV3044	101467	10Hz~44GHz	Feb. 01, 2023	Sep. 20, 2023~ Sep. 21, 2023	Jan. 31, 2024	Conducted (TH05-HY)
Programmable Power Supply	GW Instek	PSS-2005	EL890001	1V~20V 0.5A~4A	Sep. 12, 2023	Sep. 20, 2023~ Sep. 21, 2023	Sep. 11, 2024	Conducted (TH05-HY)

Report No.: FG380306H



TEL: 886-3-327-0868 Page Number : 11 of 11 FAX: 886-3-327-0855 Issue Date : Nov. 14, 2023