




Test report No. : 4790224862-US-R1-V0
Page : 197 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5536	45.23	19.81	65.04	68.2	-3.16	PK
		5679.5	40.94	19.7	60.64	90.07	-29.43	PK
	@	5745	91.96	20.15	112.11	N/A	N/A	PK
		7660	41.43	10.75	52.18	74	-21.82	PK
	*	11490	29.5	19.33	48.83	74	-25.17	PK
Vertical		5588.5	41.14	19.74	60.88	68.2	-7.32	PK
		5668	40.81	19.69	60.5	81.56	-21.06	PK
	@	5745	87.35	20.15	107.5	N/A	N/A	PK
		7660	35.49	10.75	46.24	74	-27.76	PK
	*	11490	29.94	19.33	49.27	74	-24.73	PK

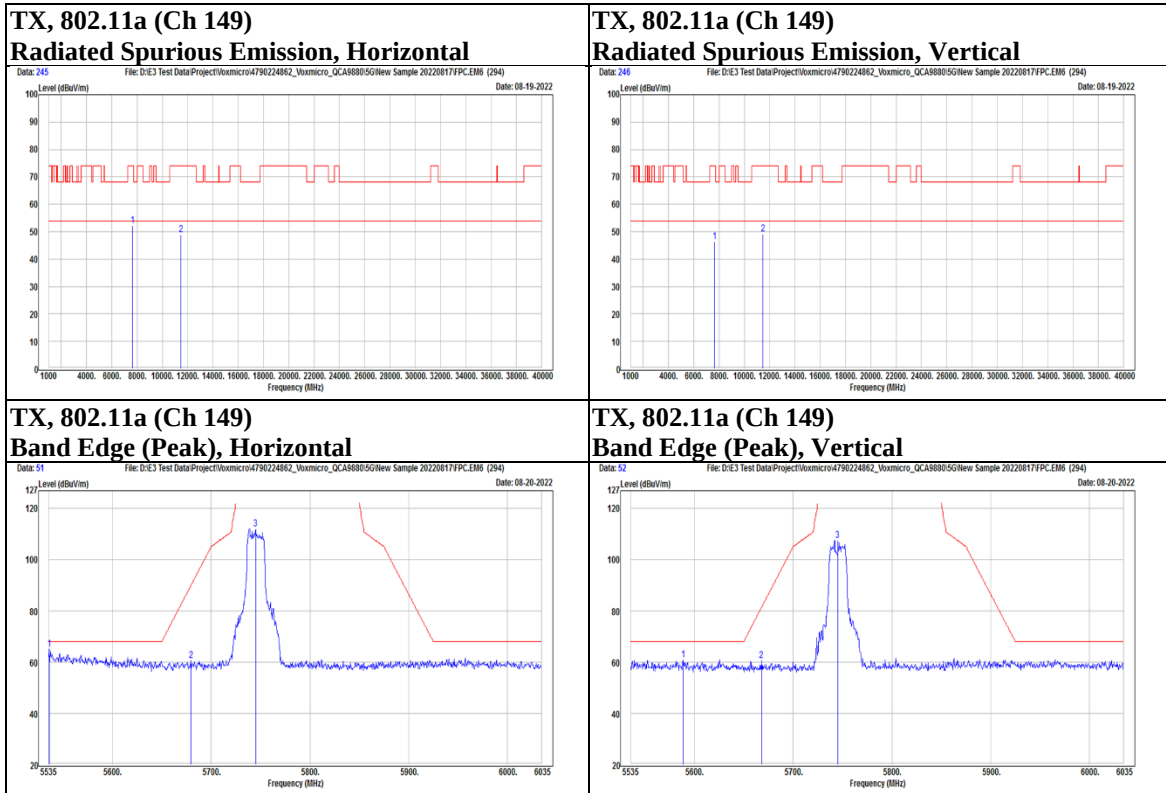

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 198 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5549.5	44.66	19.83	64.49	68.2	-3.71	PK
		5681	41.03	19.7	60.73	91.18	-30.45	PK
	@	5785	91.42	20.45	111.87	N/A	N/A	PK
		5875	41.28	20.8	62.08	105.2	-43.12	PK
		5939.5	39.78	20.95	60.73	68.2	-7.47	PK
		7713.3	38.12	10.69	48.81	74	-25.19	PK
	*	11570	29.23	19.07	48.3	74	-25.7	PK
Vertical		5636.5	41.22	19.68	60.9	68.2	-7.3	PK
		5666.5	40.32	19.69	60.01	80.45	-20.44	PK
	@	5785	86.22	20.45	106.67	N/A	N/A	PK
		5911	40.57	20.97	61.54	78.53	-16.99	PK
		5988	41.16	20.98	62.14	68.2	-6.06	PK
		7713.3	33.4	10.69	44.09	74	-29.91	PK
	*	11570	29.56	19.07	48.63	74	-25.37	PK

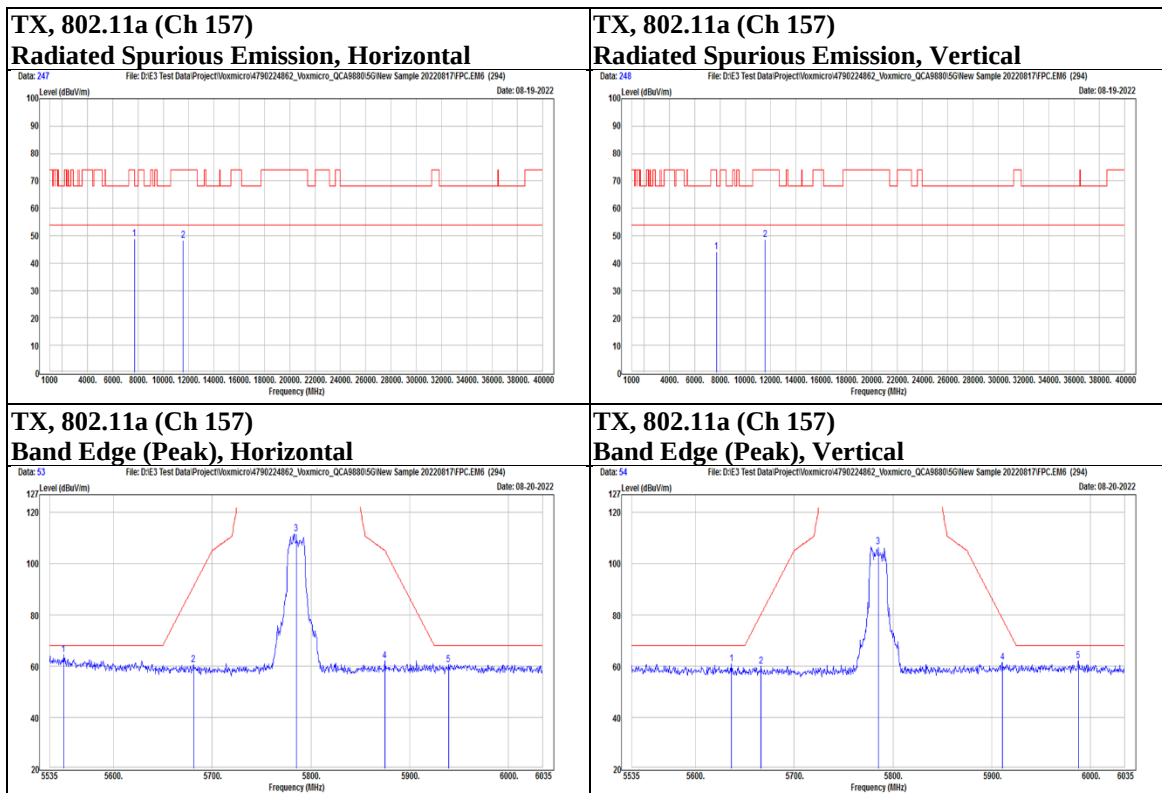

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5537.5	44.1	19.81	63.91	68.2	-4.29	PK
		5663	42.27	19.68	61.95	77.85	-15.9	PK
	@	5825	88.59	20.58	109.17	N/A	N/A	PK
		5894	40.58	20.93	61.51	91.1	-29.59	PK
		5949	40.57	20.94	61.51	68.2	-6.69	PK
		7766.7	38.21	10.9	49.11	68.2	-19.09	PK
	*	11650	29.61	18.83	48.44	74	-25.56	PK
Vertical		5552.5	41.12	19.83	60.95	68.2	-7.25	PK
		5674	39.79	19.7	59.49	86	-26.51	PK
	@	5825	82.08	20.58	102.66	N/A	N/A	PK
		5911.5	39.91	20.97	60.88	78.16	-17.28	PK
		5952	40.9	20.95	61.85	68.2	-6.35	PK
		7766.7	32.85	10.9	43.75	68.2	-24.45	PK
	*	11650	30.26	18.83	49.09	74	-24.91	PK

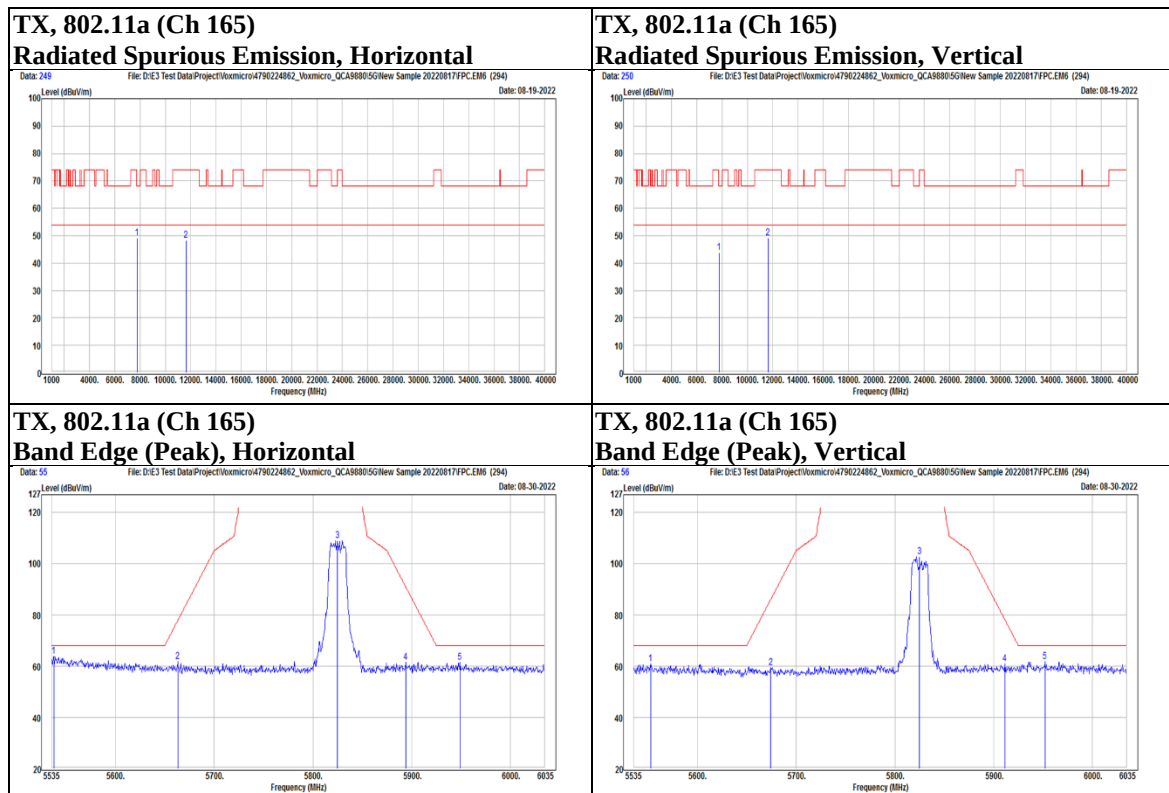

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 200 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5086.1	30.82	19.35	50.17	54	-3.83	AVG
		5149.1	42.18	19.4	61.58	74	-12.42	PK
	@	5180	86.85	19.31	106.16	N/A	N/A	PK
	@	5180	78.68	19.31	97.99	N/A	N/A	AVG
		6906.7	56.43	8.36	64.79	68.2	-3.41	PK
	*	10360	29.54	17.51	47.05	68.2	-21.15	PK
Vertical		5026.25	42.3	18.87	61.17	74	-12.83	PK
		5117.25	30.49	19.44	49.93	54	-4.07	AVG
	@	5180	81.84	19.31	101.15	N/A	N/A	PK
	@	5180	74.1	19.31	93.41	N/A	N/A	AVG
		6906.7	50.29	8.36	58.65	68.2	-9.55	PK
	*	10360	30.11	17.51	47.62	68.2	-20.58	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 201 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

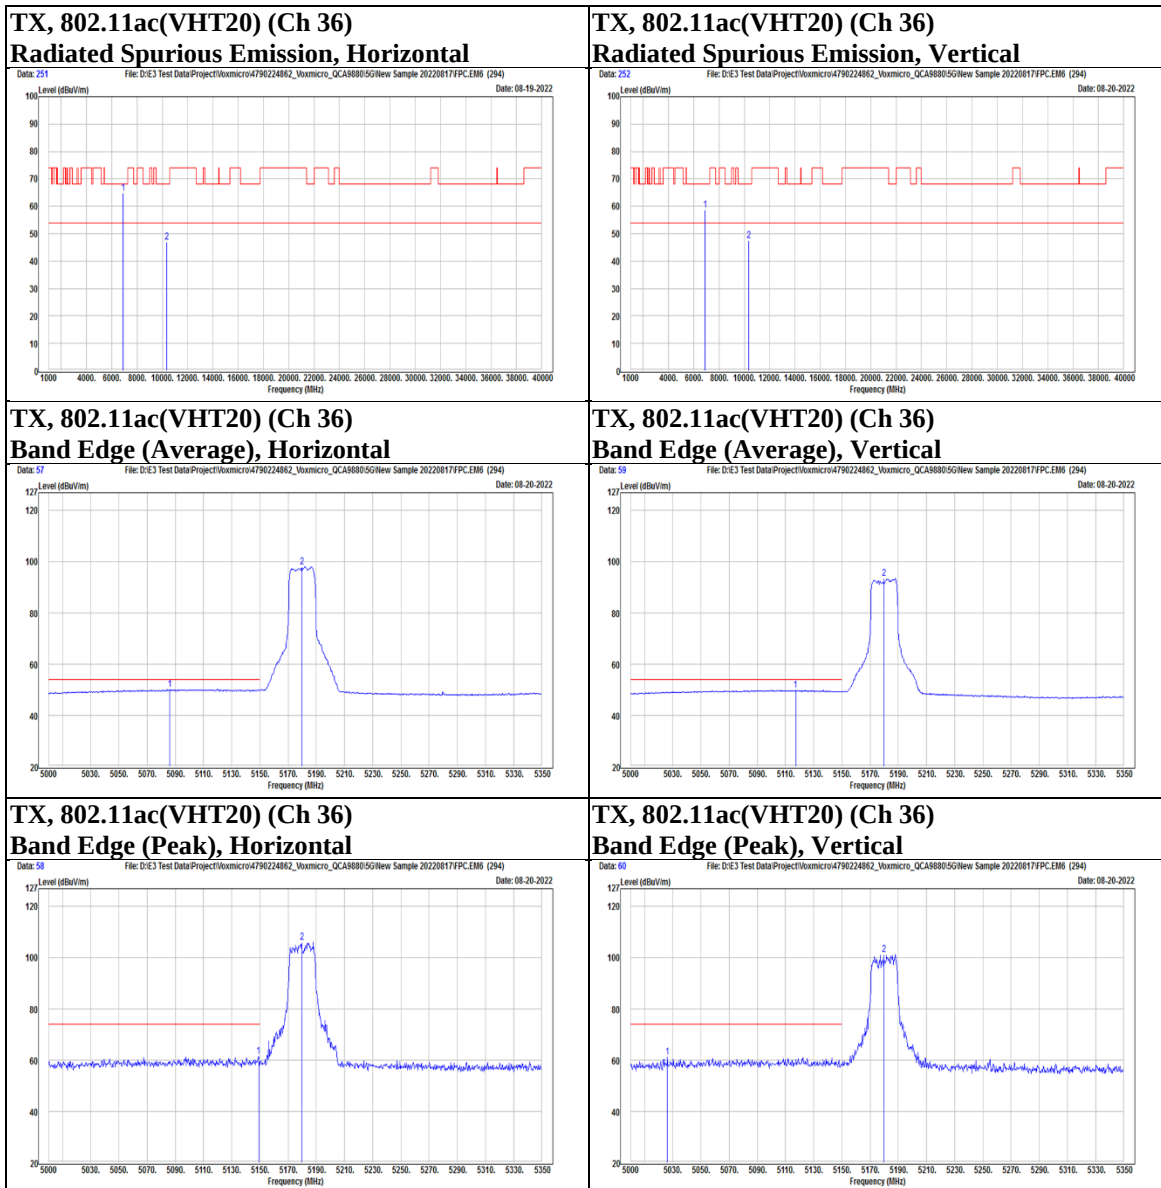

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 202 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5100.8	30.69	19.44	50.13	54	-3.87	AVG
		5103.95	42.14	19.44	61.58	74	-12.42	PK
	@	5220	88.32	19.12	107.44	N/A	N/A	PK
	@	5220	79.77	19.12	98.89	N/A	N/A	AVG
		6960	56.19	8.61	64.8	68.2	-3.4	PK
	*	10440	30.43	17.81	48.24	68.2	-19.96	PK
Vertical		5108.85	30.39	19.43	49.82	54	-4.18	AVG
		5117.95	41.65	19.43	61.08	74	-12.92	PK
	@	5220	84.96	19.12	104.08	N/A	N/A	PK
	@	5220	77.62	19.12	96.74	N/A	N/A	AVG
		6960	45.17	8.61	53.78	68.2	-14.42	PK
	*	10440	30.66	17.81	48.47	68.2	-19.73	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 203 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

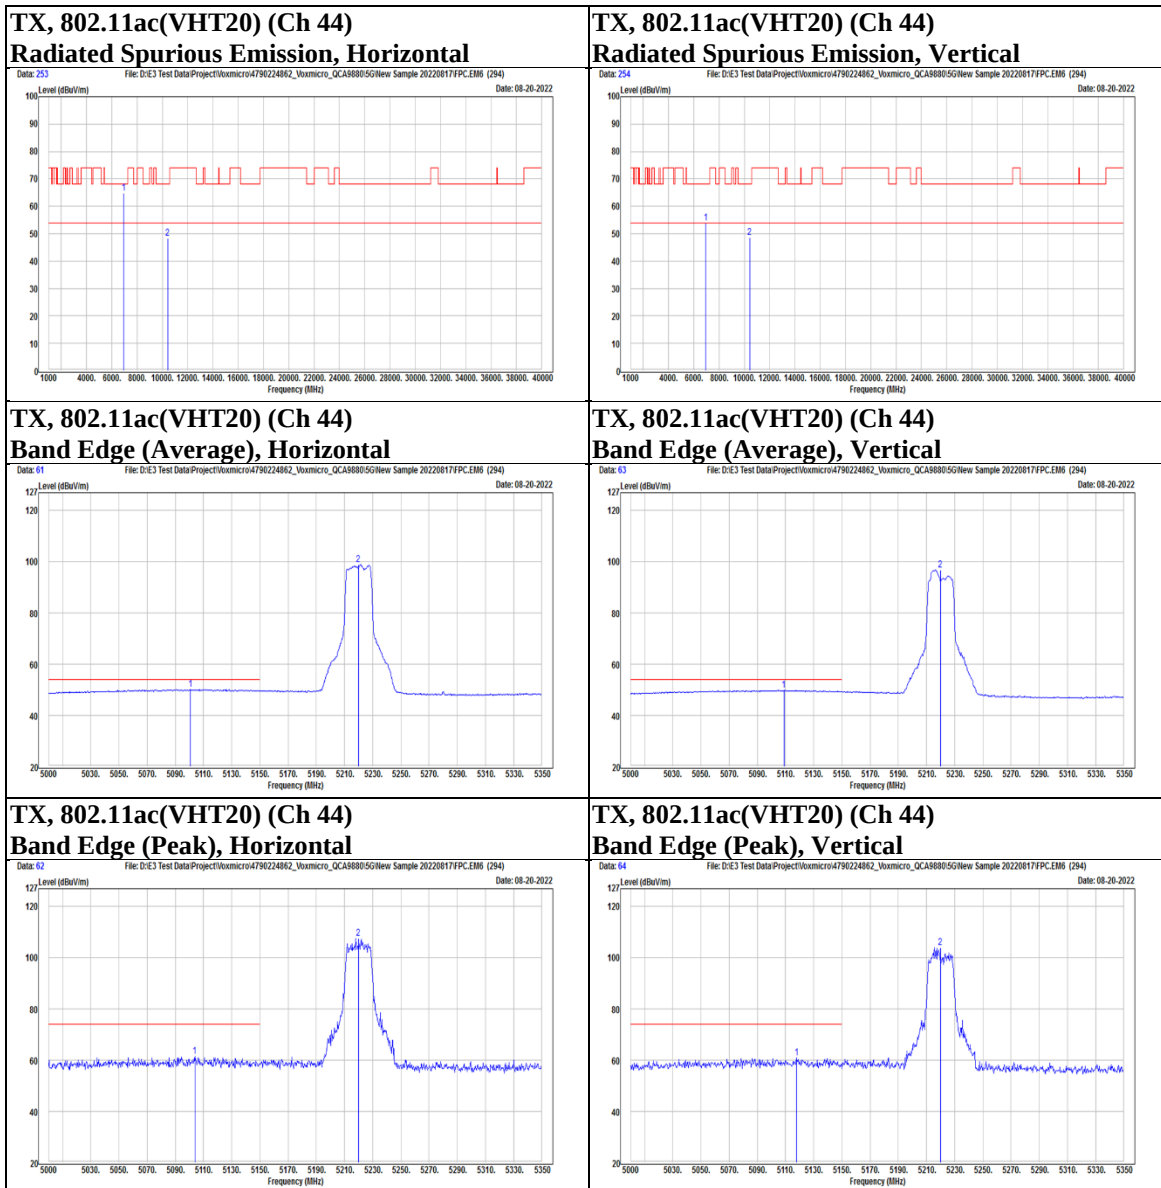

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 204 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5100.8	30.76	19.44	50.2	54	-3.8	AVG
		5146.65	42.12	19.41	61.53	74	-12.47	PK
	@	5240	88.98	18.97	107.95	N/A	N/A	PK
	@	5240	79.87	18.97	98.84	N/A	N/A	AVG
		6986.7	53.75	8.69	62.44	68.2	-5.76	PK
	*	10480	30.95	17.92	48.87	68.2	-19.33	PK
Vertical		5115.5	30.4	19.43	49.83	54	-4.17	AVG
		5125.65	41.6	19.42	61.02	74	-12.98	PK
	@	5240	86.35	18.97	105.32	N/A	N/A	PK
	@	5240	77.27	18.97	96.24	N/A	N/A	AVG
		6986.7	43.22	8.69	51.91	68.2	-16.29	PK
	*	10480	30.75	17.92	48.67	68.2	-19.53	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 205 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

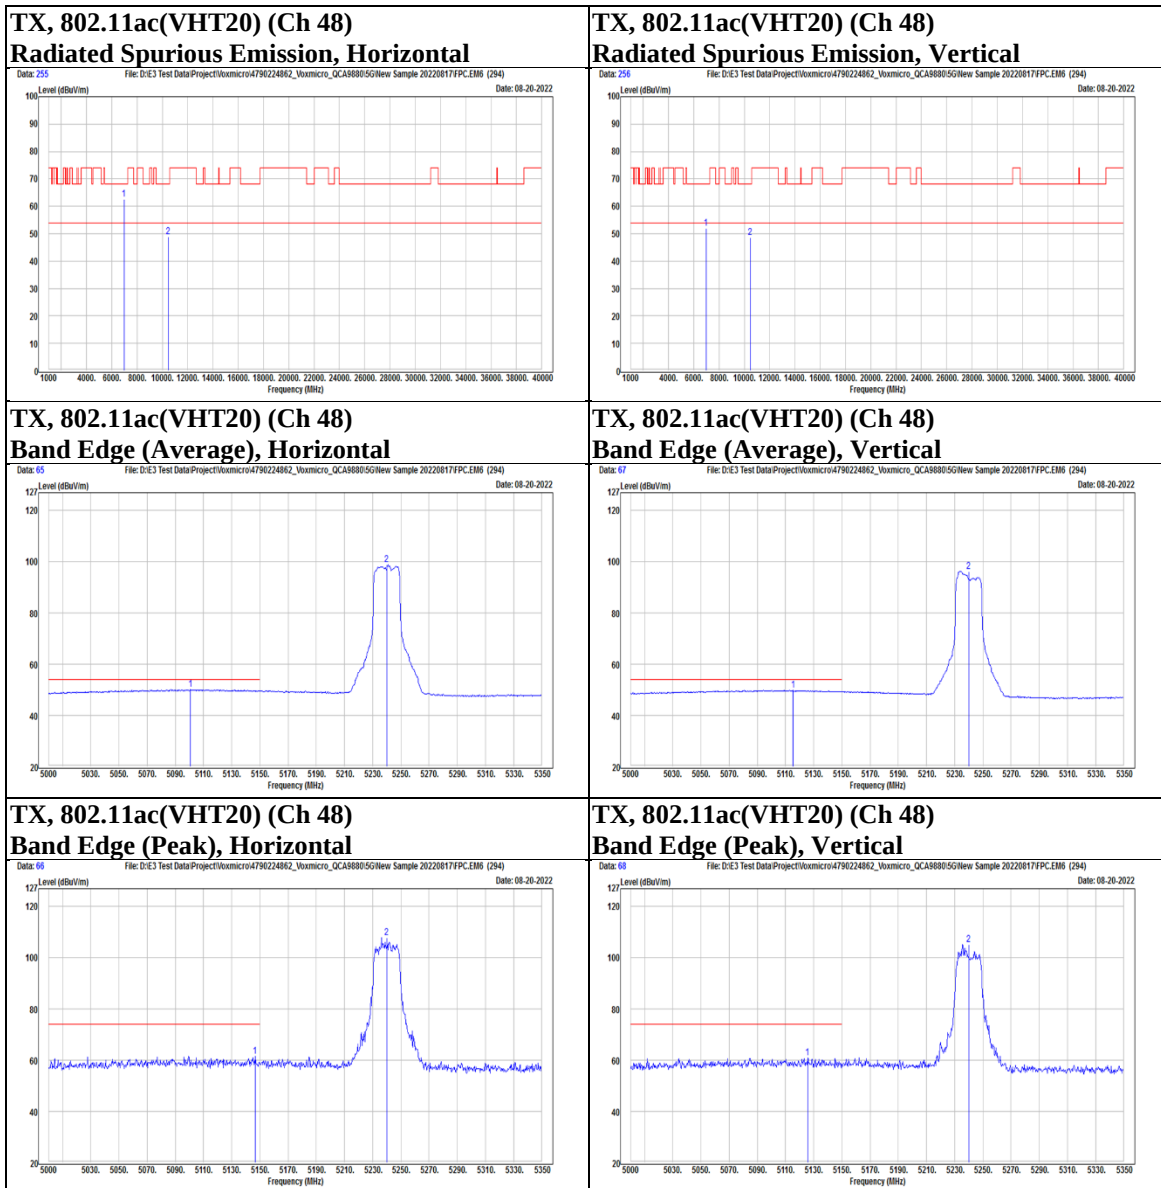

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 206 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5260	88.26	18.88	107.14	N/A	N/A	PK
	@	5260	81.18	18.88	100.06	N/A	N/A	AVG
		5419.2	39.94	19.36	59.3	74	-14.7	PK
		5439.9	29.24	19.47	48.71	54	-5.29	AVG
		7013.3	52.08	8.86	60.94	68.2	-7.26	PK
	*	10520	30.13	17.99	48.12	68.2	-20.08	PK
Vertical	@	5260	86.44	18.88	105.32	N/A	N/A	PK
	@	5260	78.49	18.88	97.37	N/A	N/A	AVG
		5427	39.02	19.4	58.42	74	-15.58	PK
		5457.3	28.54	19.55	48.09	54	-5.91	AVG
		7013.3	44.5	8.86	53.36	68.2	-14.84	PK
	*	10520	30.92	17.99	48.91	68.2	-19.29	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 207 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

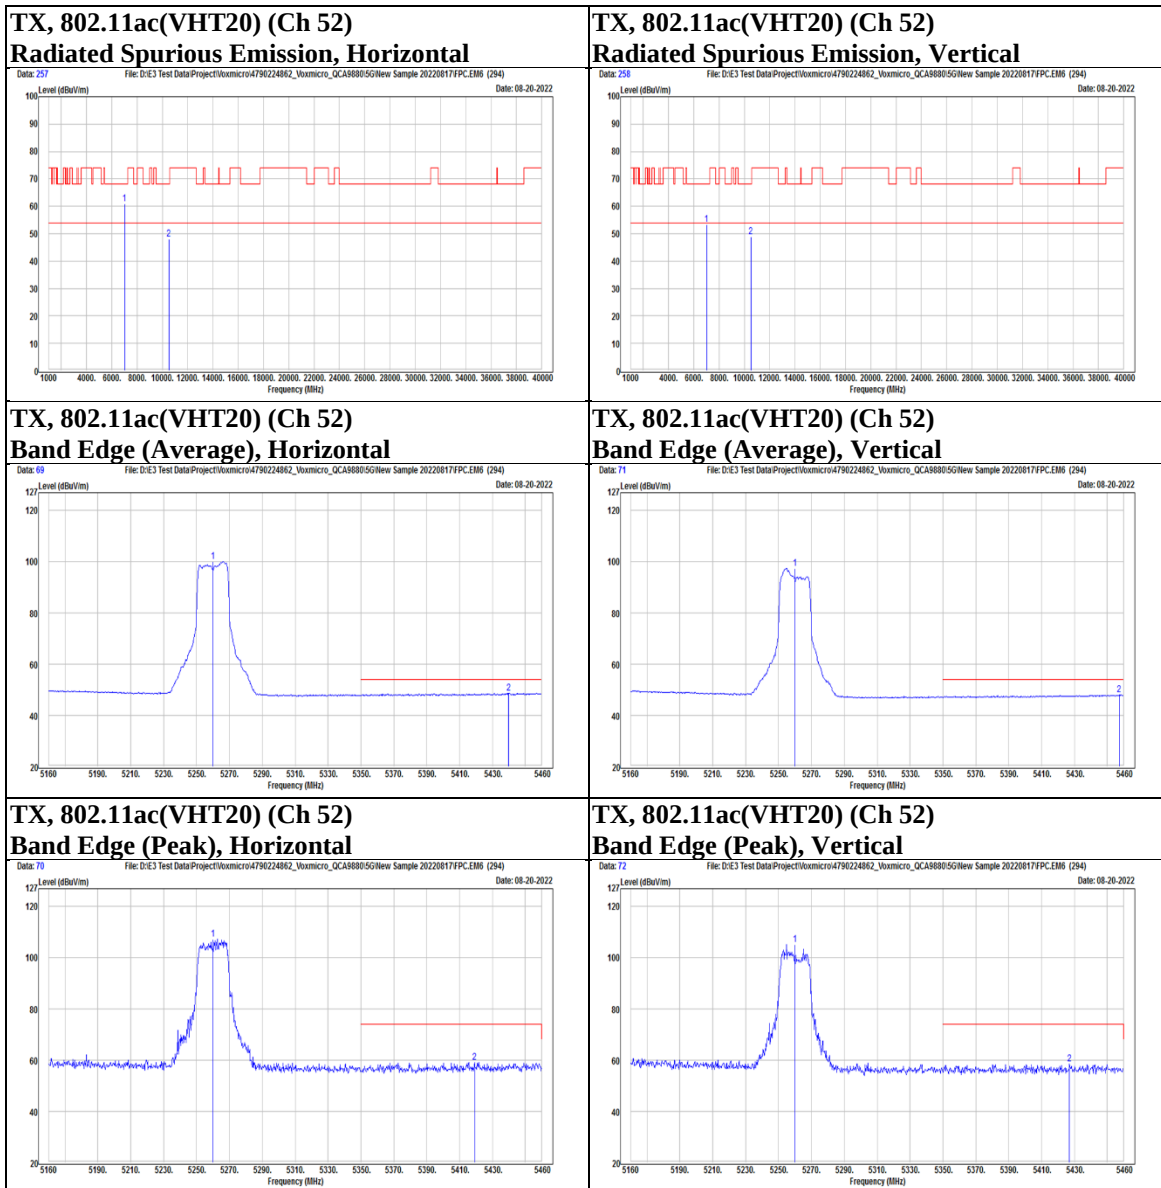

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 208 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5300	88.71	18.77	107.48	N/A	N/A	PK
	@	5300	81.36	18.77	100.13	N/A	N/A	AVG
		5388.6	40.64	19.2	59.84	74	-14.16	PK
		5457.6	29.48	19.55	49.03	54	-4.97	AVG
		7066.7	49.23	9.33	58.56	68.2	-9.64	PK
	*	10600	31.11	18.04	49.15	68.2	-19.05	PK
Vertical	@	5300	85.02	18.77	103.79	N/A	N/A	PK
	@	5300	77.17	18.77	95.94	N/A	N/A	AVG
		5368.5	39.73	19.11	58.84	74	-15.16	PK
		5439.9	28.56	19.47	48.03	54	-5.97	AVG
		7066.7	43.15	9.33	52.48	68.2	-15.72	PK
	*	10600	30.88	18.04	48.92	68.2	-19.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 209 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

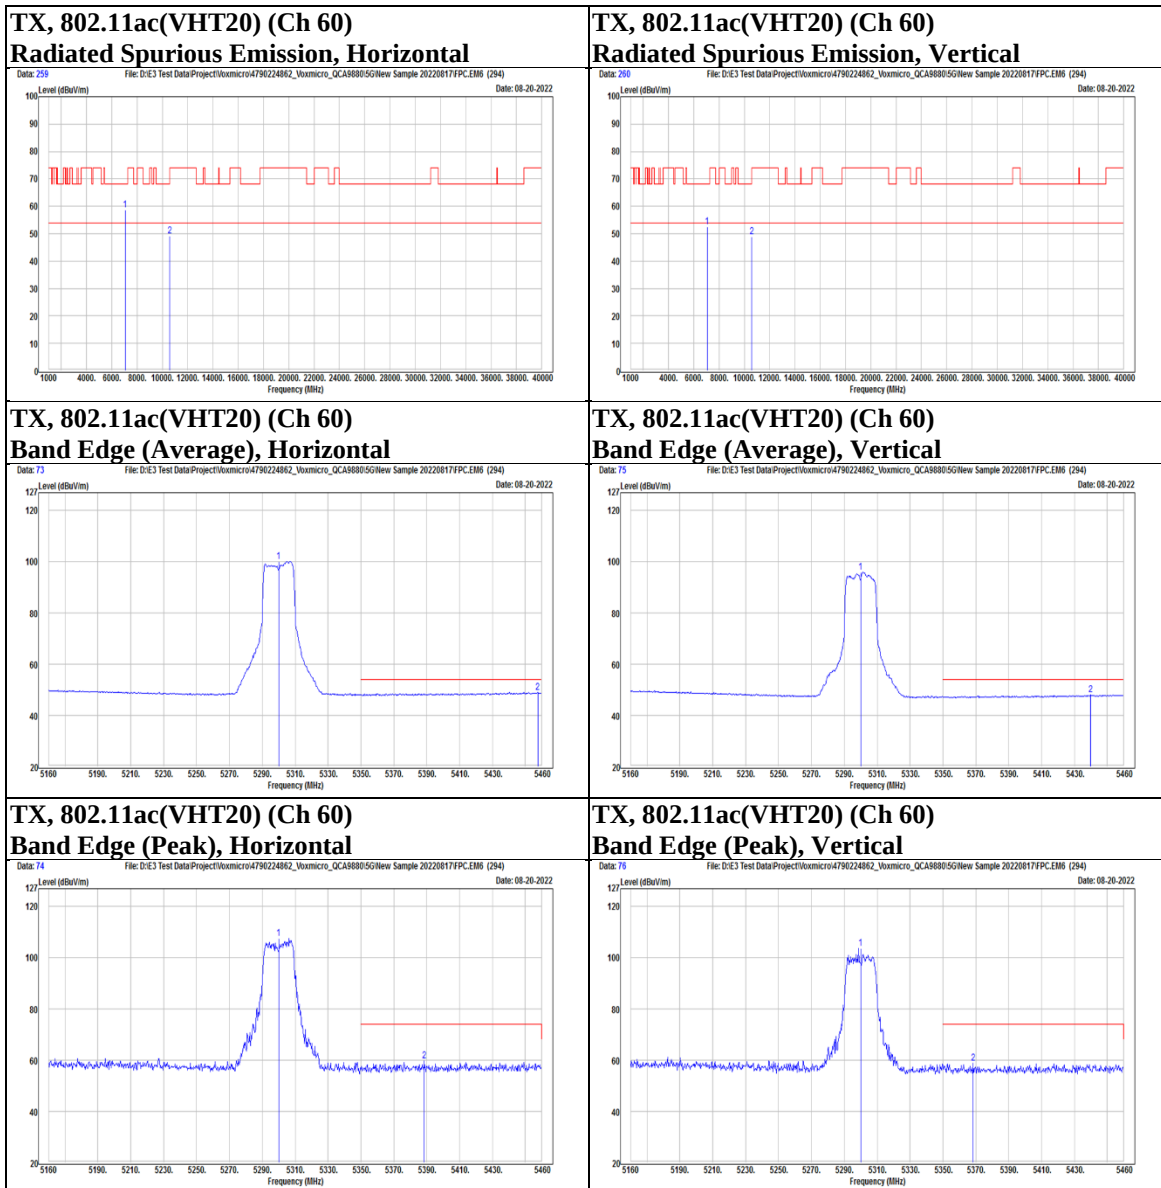

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 210 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5320	91.01	18.86	109.87	N/A	N/A	PK
	@	5320	82.42	18.86	101.28	N/A	N/A	AVG
		5394.3	40.83	19.24	60.07	74	-13.93	PK
		5439.9	29.37	19.47	48.84	54	-5.16	AVG
		7093.3	47.68	9.53	57.21	68.2	-10.99	PK
	*	10640	30.26	18.03	48.29	74	-25.71	PK
Vertical	@	5320	85.1	18.86	103.96	N/A	N/A	PK
	@	5320	77.15	18.86	96.01	N/A	N/A	AVG
		5428.5	39.71	19.41	59.12	74	-14.88	PK
		5459.7	28.45	19.57	48.02	54	-5.98	AVG
		7093.3	38.89	9.53	48.42	68.2	-19.78	PK
	*	10640	30.49	18.03	48.52	74	-25.48	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 211 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

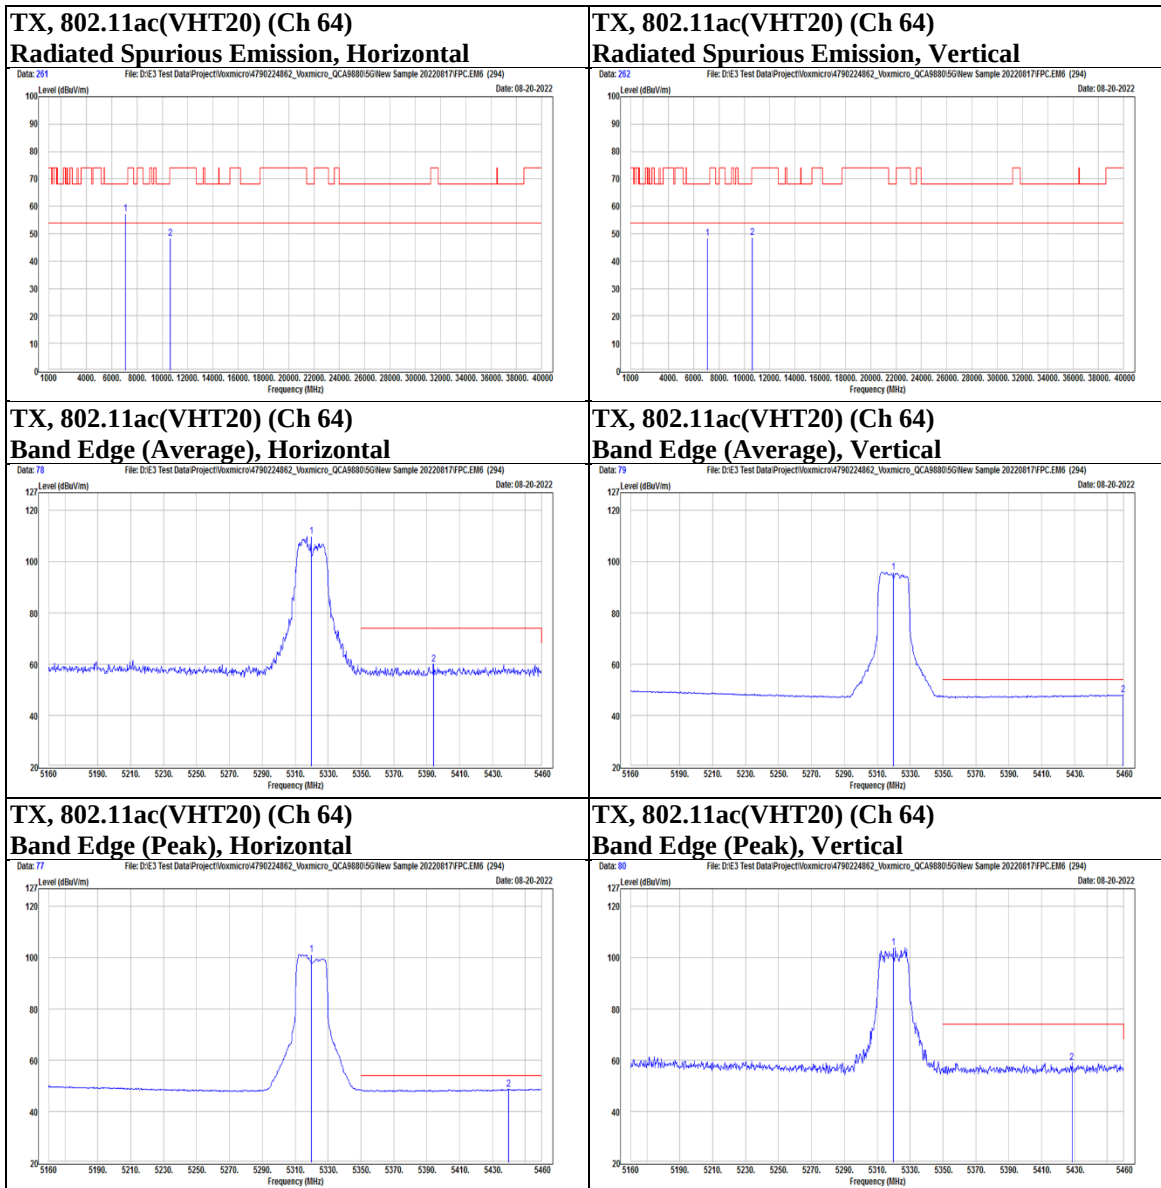

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 212 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5447.25	39.84	19.5	59.34	74	-14.66	PK
		5455.65	29.56	19.54	49.1	54	-4.9	AVG
		5461.95	40	19.58	59.58	68.2	-8.62	PK
	@	5500	89.79	19.77	109.56	N/A	N/A	PK
	@	5500	81.64	19.77	101.41	N/A	N/A	AVG
		7333.3	40.08	10.32	50.4	74	-23.6	PK
	*	11000	30.61	18.41	49.02	74	-24.98	PK
Vertical		5446.9	39.96	19.5	59.46	74	-14.54	PK
		5447.6	28.59	19.5	48.09	54	-5.91	AVG
		5464.4	39.19	19.59	58.78	68.2	-9.42	PK
	@	5500	88.58	19.77	108.35	N/A	N/A	PK
	@	5500	79.65	19.77	99.42	N/A	N/A	AVG
		7333.3	33.9	10.32	44.22	74	-29.78	PK
	*	11000	30.91	18.41	49.32	74	-24.68	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 213 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

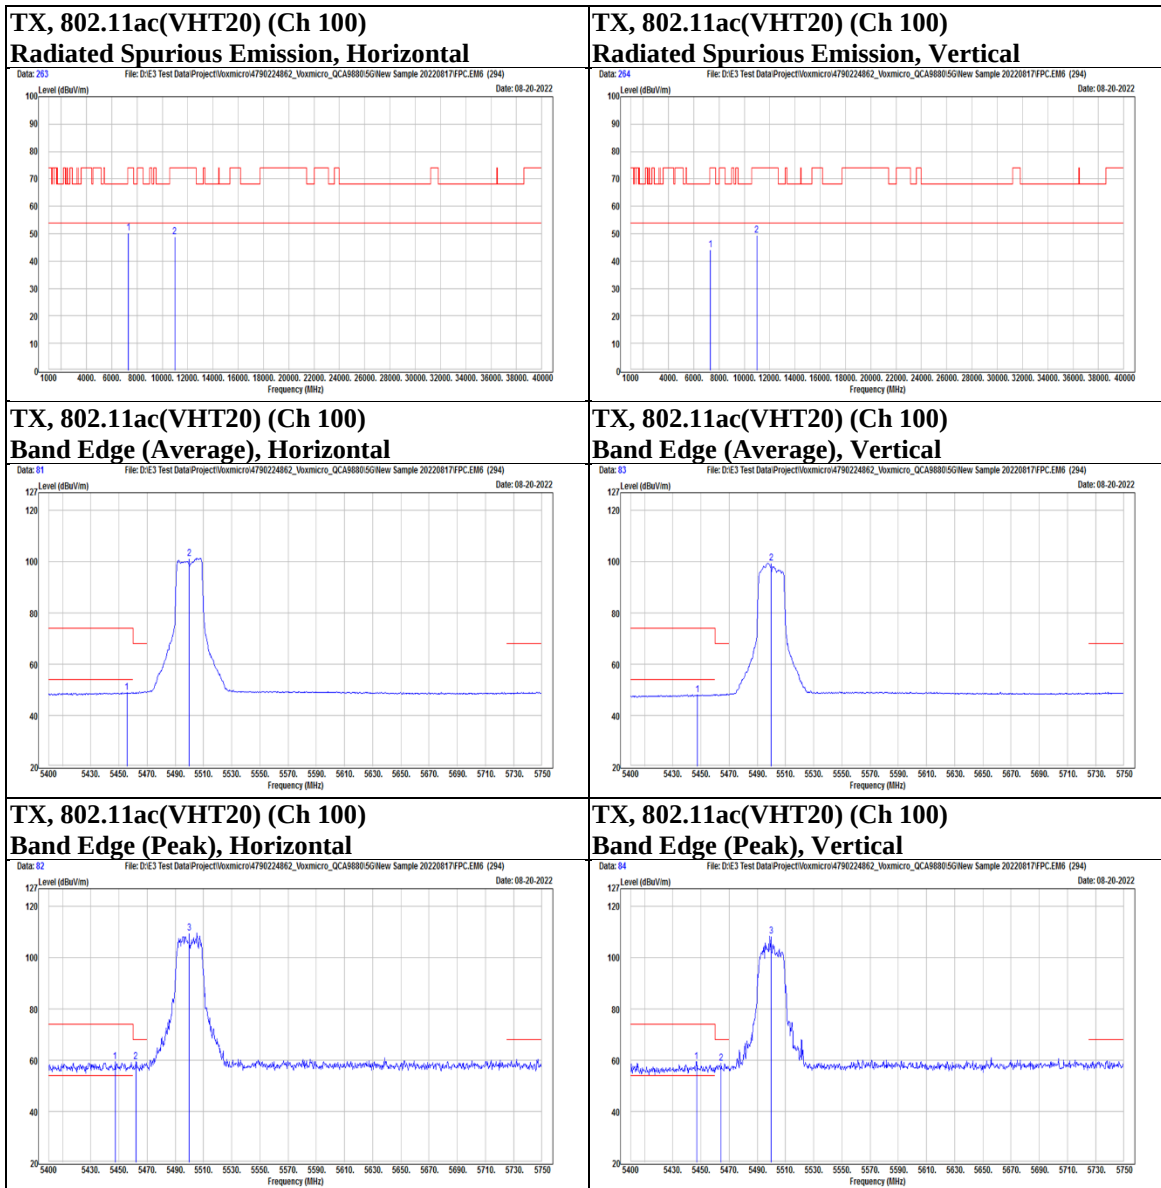

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 214 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5407	41.49	19.31	60.8	74	-13.2	PK
		5439.9	32.58	19.47	52.05	54	-1.95	AVG
		5464.05	42.41	19.59	62	68.2	-6.2	PK
	@	5580	88.54	19.76	108.3	N/A	N/A	PK
	@	5580	80.69	19.76	100.45	N/A	N/A	AVG
		5736	40.23	20.07	60.3	68.2	-7.9	PK
		7440	38.39	10.73	49.12	74	-24.88	PK
	*	11160	30.58	18.47	49.05	74	-24.95	PK
Vertical		5433.95	40.05	19.44	59.49	74	-14.51	PK
		5439.9	30.2	19.47	49.67	54	-4.33	AVG
		5465.1	38.88	19.59	58.47	68.2	-9.73	PK
	@	5580	82.06	19.76	101.82	N/A	N/A	PK
	@	5580	74.42	19.76	94.18	N/A	N/A	AVG
		5727.25	40.08	19.99	60.07	68.2	-8.13	PK
		7440	33.63	10.73	44.36	74	-29.64	PK
	*	11160	31.25	18.47	49.72	74	-24.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 215 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

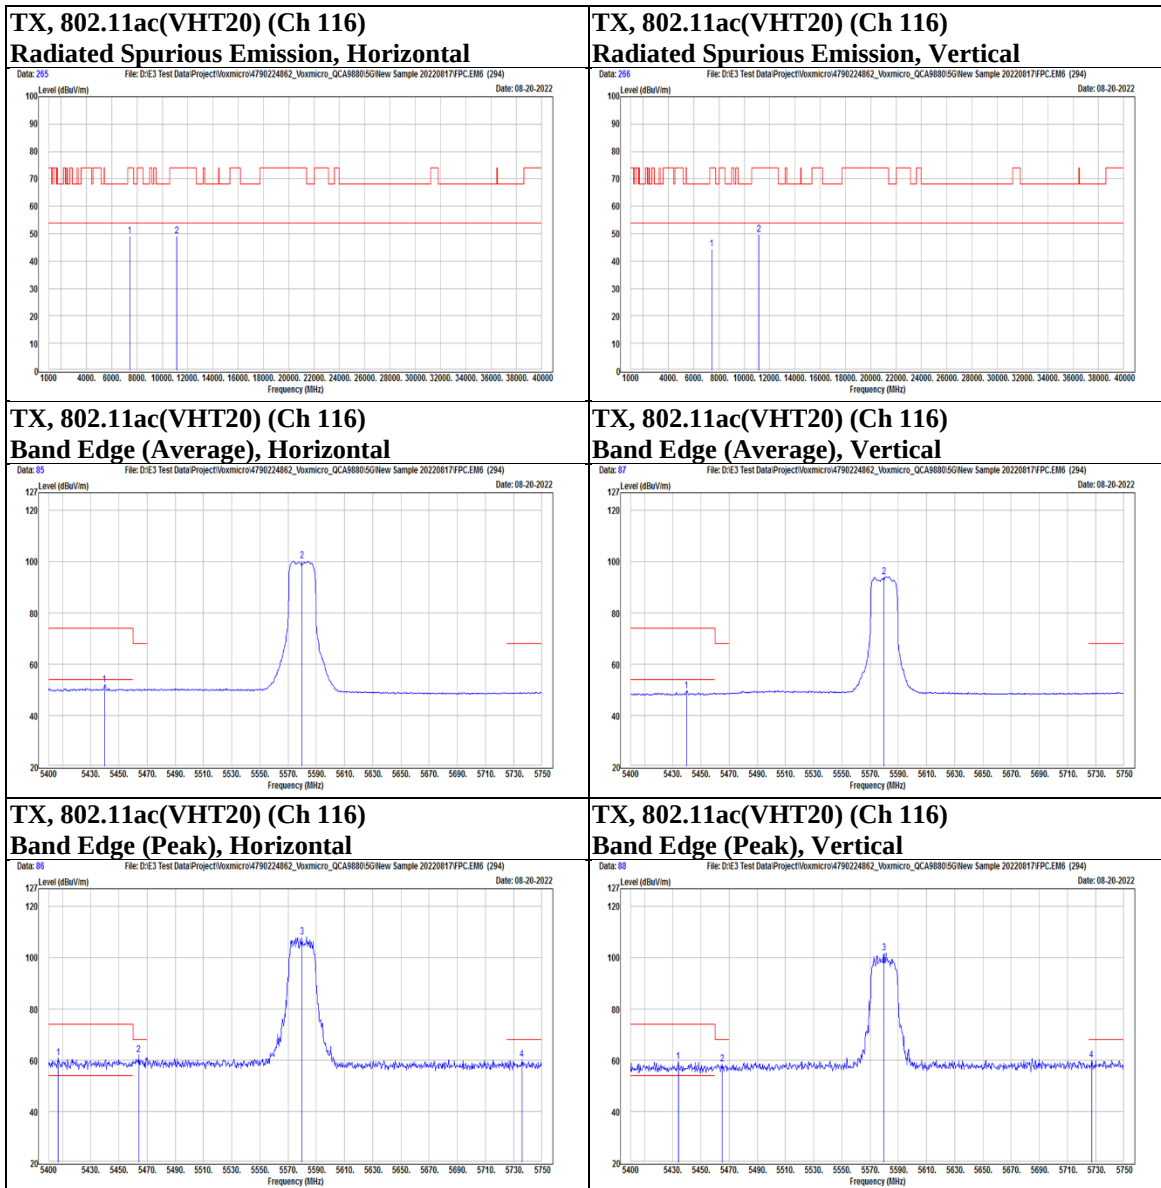

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 216 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5439.9	33.31	19.47	52.78	54	-1.22	AVG
	@	5700	89.28	19.73	109.01	N/A	N/A	PK
	@	5700	81.58	19.73	101.31	N/A	N/A	AVG
		5725	41.25	19.96	61.21	68.2	-6.99	PK
		7600	37.87	10.89	48.76	74	-25.24	PK
	*	11400	29.77	18.85	48.62	74	-25.38	PK
Vertical		5439.9	30.81	19.47	50.28	54	-3.72	AVG
	@	5700	83.46	19.73	103.19	N/A	N/A	PK
	@	5700	75.3	19.73	95.03	N/A	N/A	AVG
		5725	40.13	19.96	60.09	68.2	-8.11	PK
		7600	32.9	10.89	43.79	74	-30.21	PK
	*	11400	29.98	18.85	48.83	74	-25.17	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 217 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

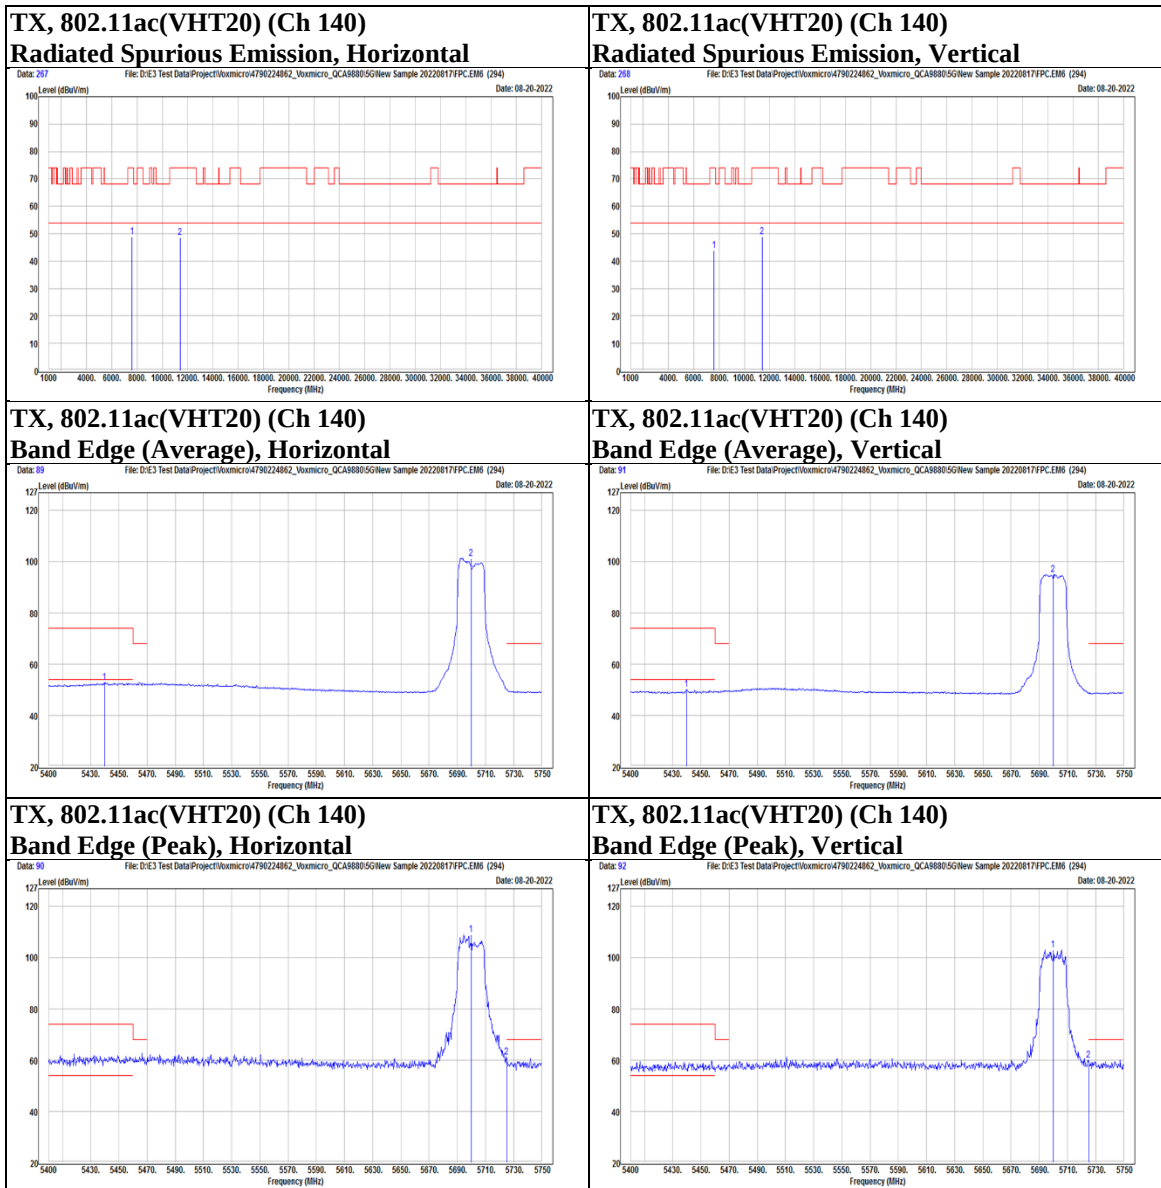

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 218 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5538	43.49	19.82	63.31	68.2	-4.89	PK
		5693.5	40.61	19.72	60.33	100.41	-40.08	PK
	@	5745	91.6	20.15	111.75	N/A	N/A	PK
		7660	40.96	10.75	51.71	74	-22.29	PK
	*	11490	30.03	19.33	49.36	74	-24.64	PK
Vertical		5548	42.04	19.83	61.87	68.2	-6.33	PK
		5666	39.88	19.69	59.57	80.08	-20.51	PK
	@	5745	86.18	20.15	106.33	N/A	N/A	PK
		7660	33.16	10.75	43.91	74	-30.09	PK
	*	11490	29.95	19.33	49.28	74	-24.72	PK

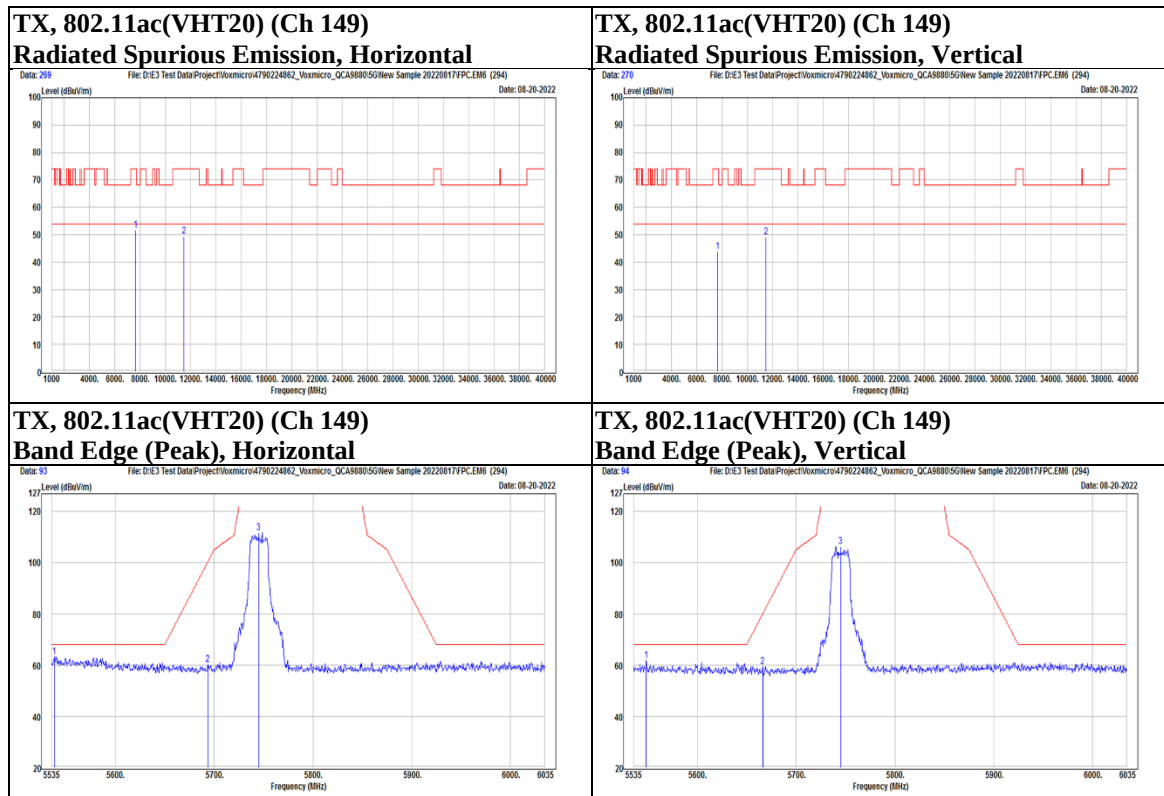

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 219 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5555	44.82	19.82	64.64	68.2	-3.56	PK
		5652	41.13	19.67	60.8	69.69	-8.89	PK
	@	5785	91.49	20.45	111.94	N/A	N/A	PK
		5876	40.59	20.81	61.4	104.46	-43.06	PK
		6011.5	40.68	20.99	61.67	68.2	-6.53	PK
		7713.3	38.07	10.69	48.76	74	-25.24	PK
	*	11570	30.59	19.07	49.66	74	-24.34	PK
Vertical		5535.5	41.85	19.82	61.67	68.2	-6.53	PK
		5679.5	40.89	19.7	60.59	90.07	-29.48	PK
	@	5785	85	20.45	105.45	N/A	N/A	PK
		5913	39.67	20.96	60.63	77.05	-16.42	PK
		5936	40.73	20.95	61.68	68.2	-6.52	PK
		7713.3	33.64	10.69	44.33	74	-29.67	PK
	*	11570	31.14	19.07	50.21	74	-23.79	PK

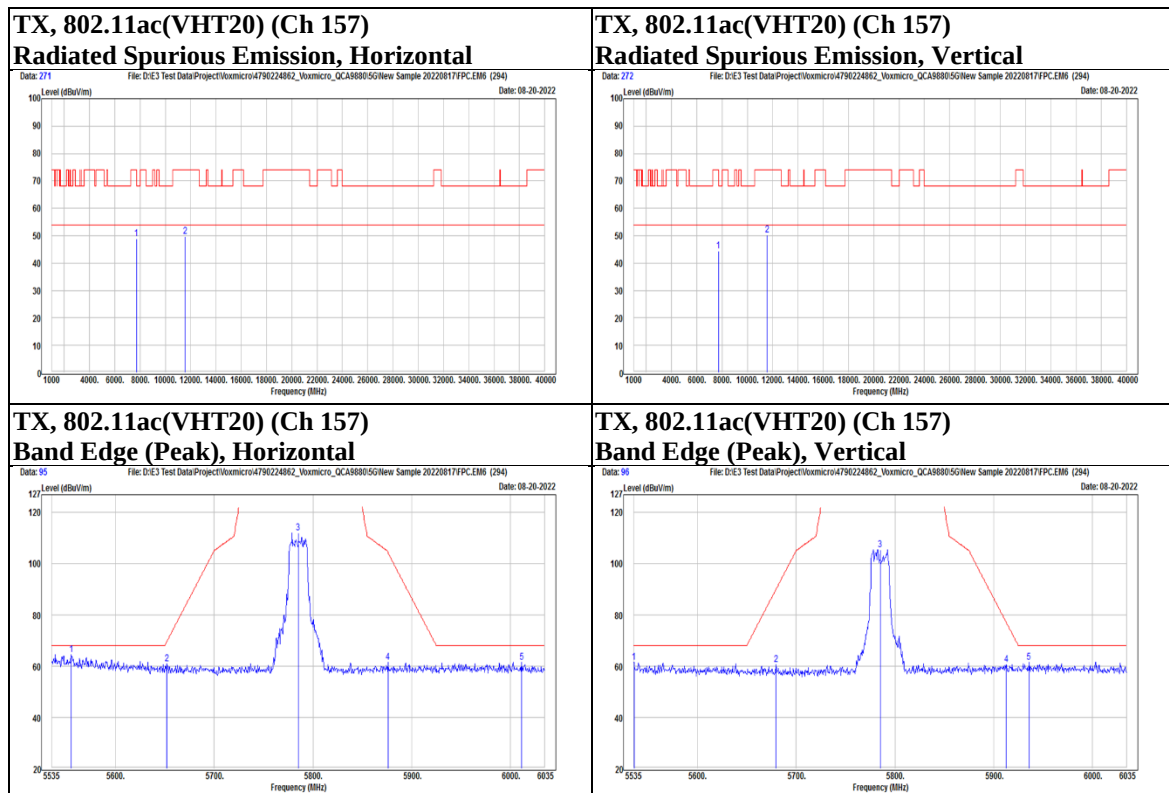

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 220 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5547	43.73	19.83	63.56	68.2	-4.64	PK
		5698	40.77	19.72	60.49	103.73	-43.24	PK
	@	5825	88.68	20.58	109.26	N/A	N/A	PK
		5878.5	40.04	20.83	60.87	102.6	-41.73	PK
		5985	41.64	20.98	62.62	68.2	-5.58	PK
		7766	36.53	10.89	47.42	68.2	-20.78	PK
	*	11650	29.73	18.83	48.56	74	-25.44	PK
Vertical		5581	41.58	19.76	61.34	68.2	-6.86	PK
		5697.5	40.41	19.72	60.13	103.36	-43.23	PK
	@	5825	82.37	20.58	102.95	N/A	N/A	PK
		5876.5	40.32	20.81	61.13	104.09	-42.96	PK
		5980.5	40.26	20.97	61.23	68.2	-6.97	PK
		7766.7	33.17	10.9	44.07	68.2	-24.13	PK
	*	11650	29.16	18.83	47.99	74	-26.01	PK

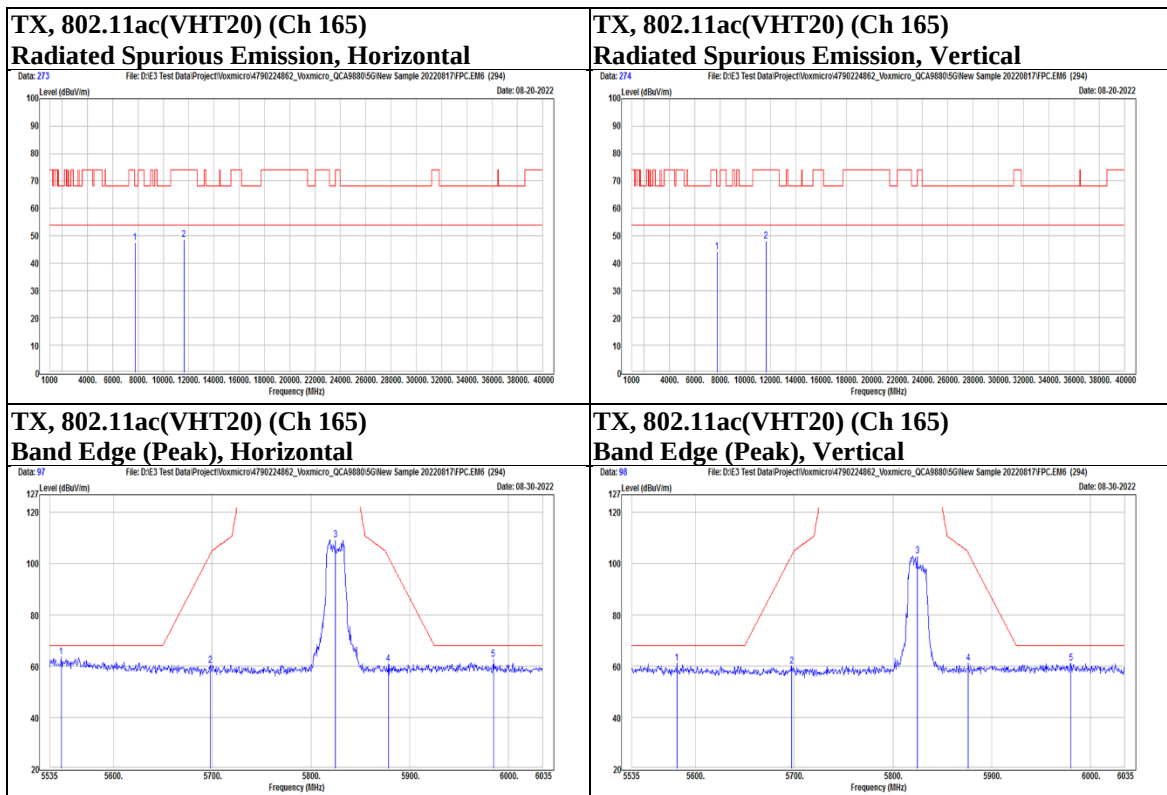

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 221 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5147.7	42.08	19.4	61.48	74	-12.52	PK
		5149.8	33.78	19.4	53.18	54	-0.82	AVG
	@	5190	84.12	19.29	103.41	N/A	N/A	PK
	@	5190	75.58	19.29	94.87	N/A	N/A	AVG
		6920	52.65	8.42	61.07	68.2	-7.13	PK
	*	10380	30.47	17.61	48.08	68.2	-20.12	PK
Vertical		5112	42.11	19.44	61.55	74	-12.45	PK
		5149.45	31.9	19.4	51.3	54	-2.7	AVG
	@	5190	80.39	19.29	99.68	N/A	N/A	PK
	@	5190	71.96	19.29	91.25	N/A	N/A	AVG
		6920	44.43	8.42	52.85	68.2	-15.35	PK
	*	10380	30.54	17.61	48.15	68.2	-20.05	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 222 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

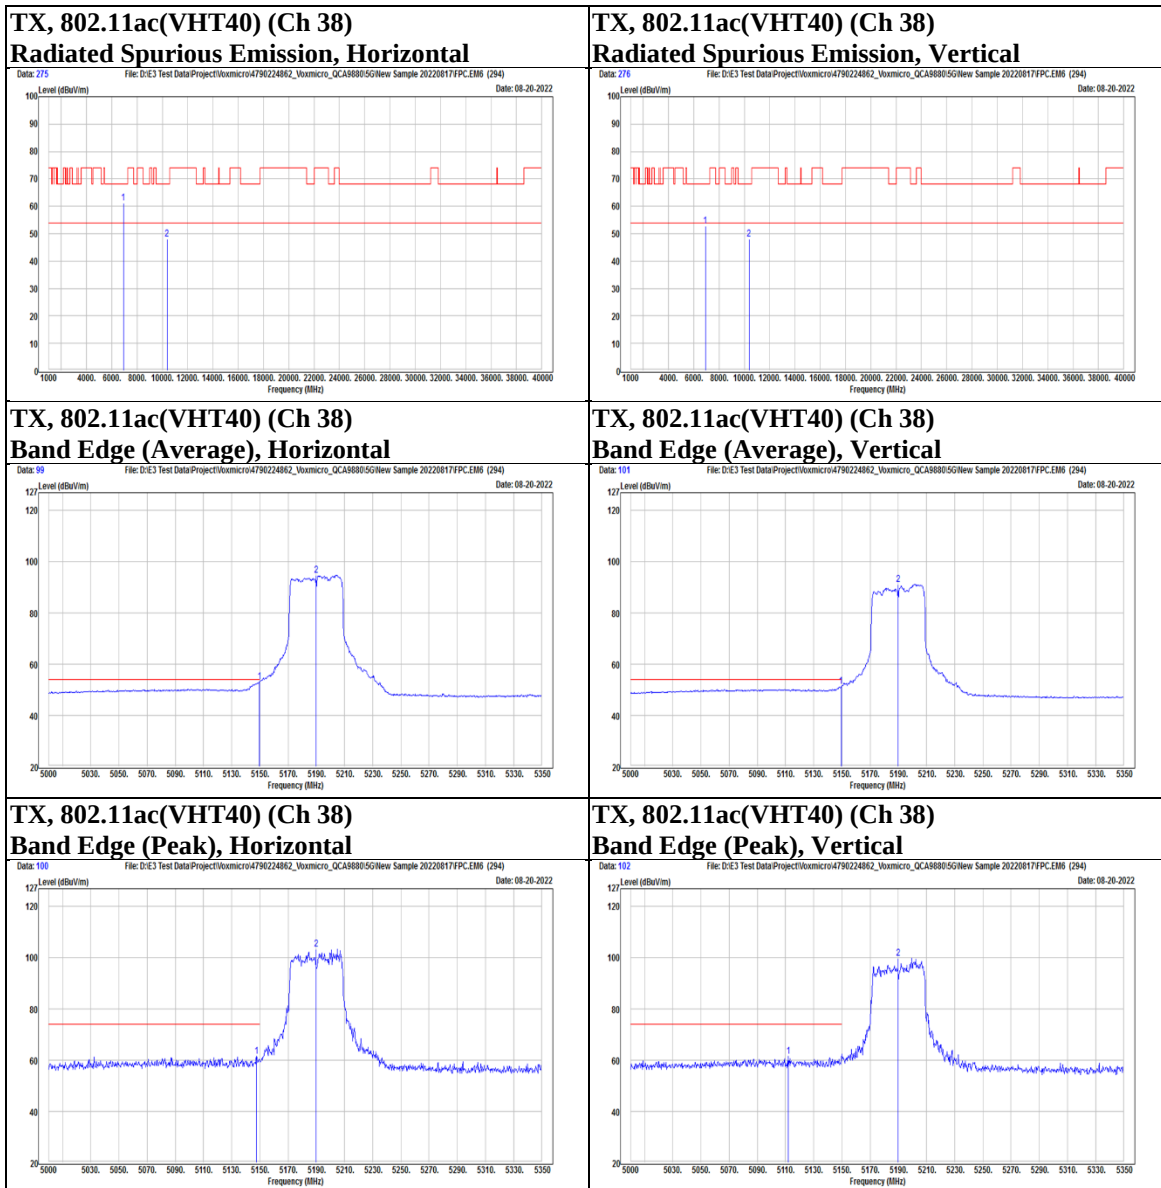

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 223 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5022.05	42.79	18.83	61.62	74	-12.38	PK
		5125.65	31.04	19.42	50.46	54	-3.54	AVG
	@	5230	88.55	19.05	107.6	N/A	N/A	PK
	@	5230	80.75	19.05	99.8	N/A	N/A	AVG
		6973.3	55.55	8.65	64.2	68.2	-4	PK
	*	10460	32.37	17.87	50.24	68.2	-17.96	PK
Vertical		5062.3	42.03	19.17	61.2	74	-12.8	PK
		5131.6	30.88	19.42	50.3	54	-3.7	AVG
	@	5230	86.97	19.05	106.02	N/A	N/A	PK
	@	5230	79.01	19.05	98.06	N/A	N/A	AVG
		6973.3	45.01	8.65	53.66	68.2	-14.54	PK
	*	10460	29.61	17.87	47.48	68.2	-20.72	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 224 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

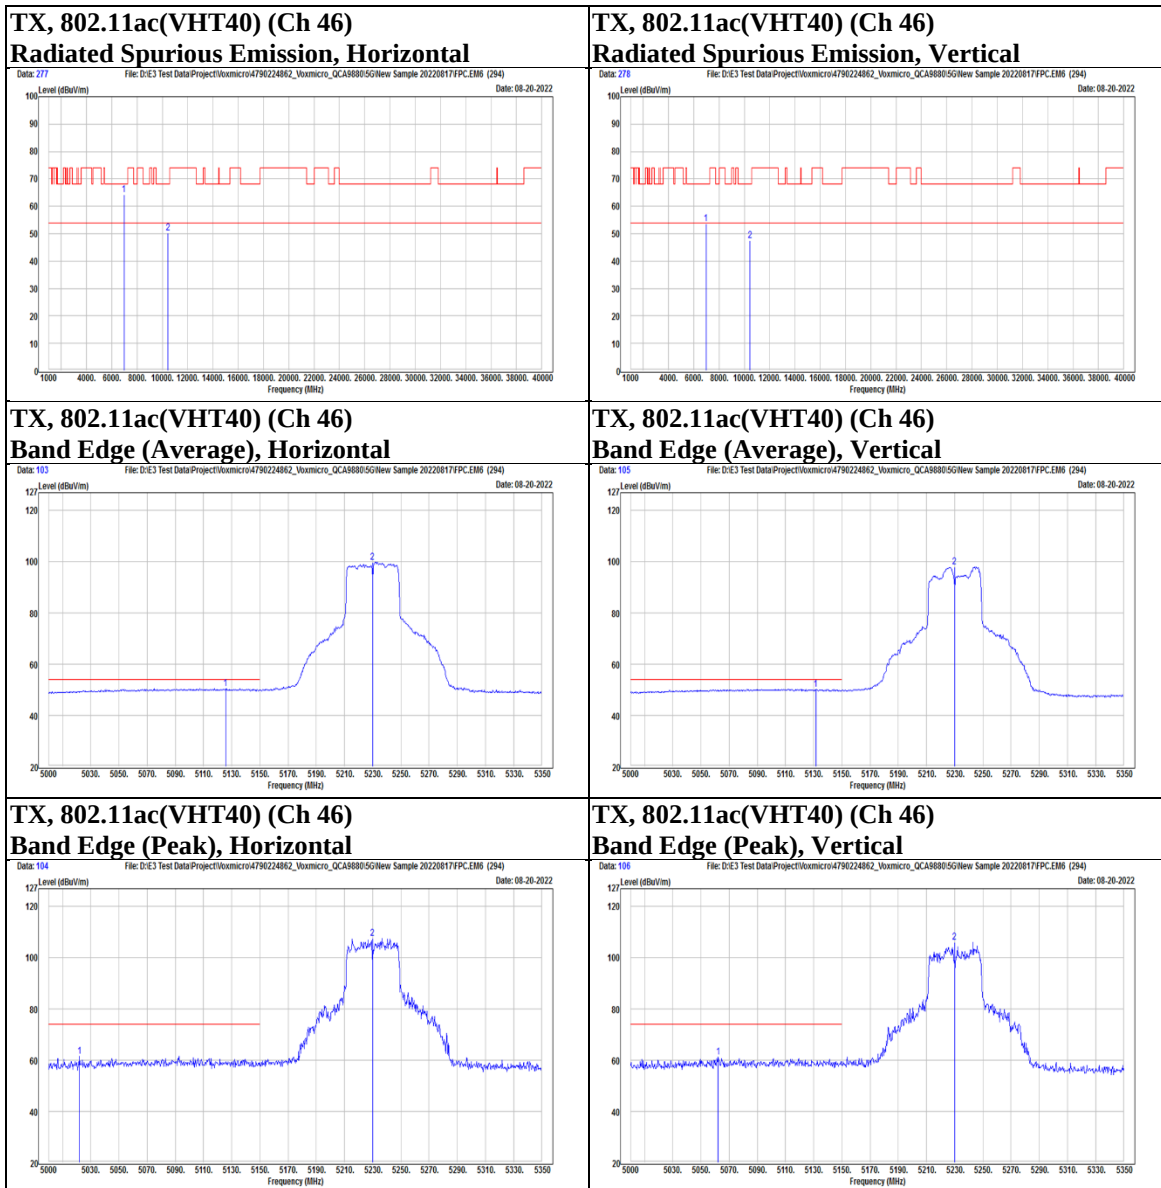

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 225 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5270	89.64	18.85	108.49	N/A	N/A	PK
	@	5270	81.75	18.85	100.6	N/A	N/A	AVG
		5394	41.28	19.24	60.52	74	-13.48	PK
		5439.9	32.46	19.47	51.93	54	-2.07	AVG
		7026.7	54.13	8.98	63.11	68.2	-5.09	PK
	*	10540	30.01	18.01	48.02	68.2	-20.18	PK
Vertical	@	5270	86.77	18.85	105.62	N/A	N/A	PK
	@	5270	77.57	18.85	96.42	N/A	N/A	AVG
		5397.6	29.67	19.26	48.93	54	-5.07	AVG
		5442.3	39.92	19.48	59.4	74	-14.6	PK
		7026.7	47.51	8.98	56.49	68.2	-11.71	PK
	*	10540	30.22	18.01	48.23	68.2	-19.97	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 226 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

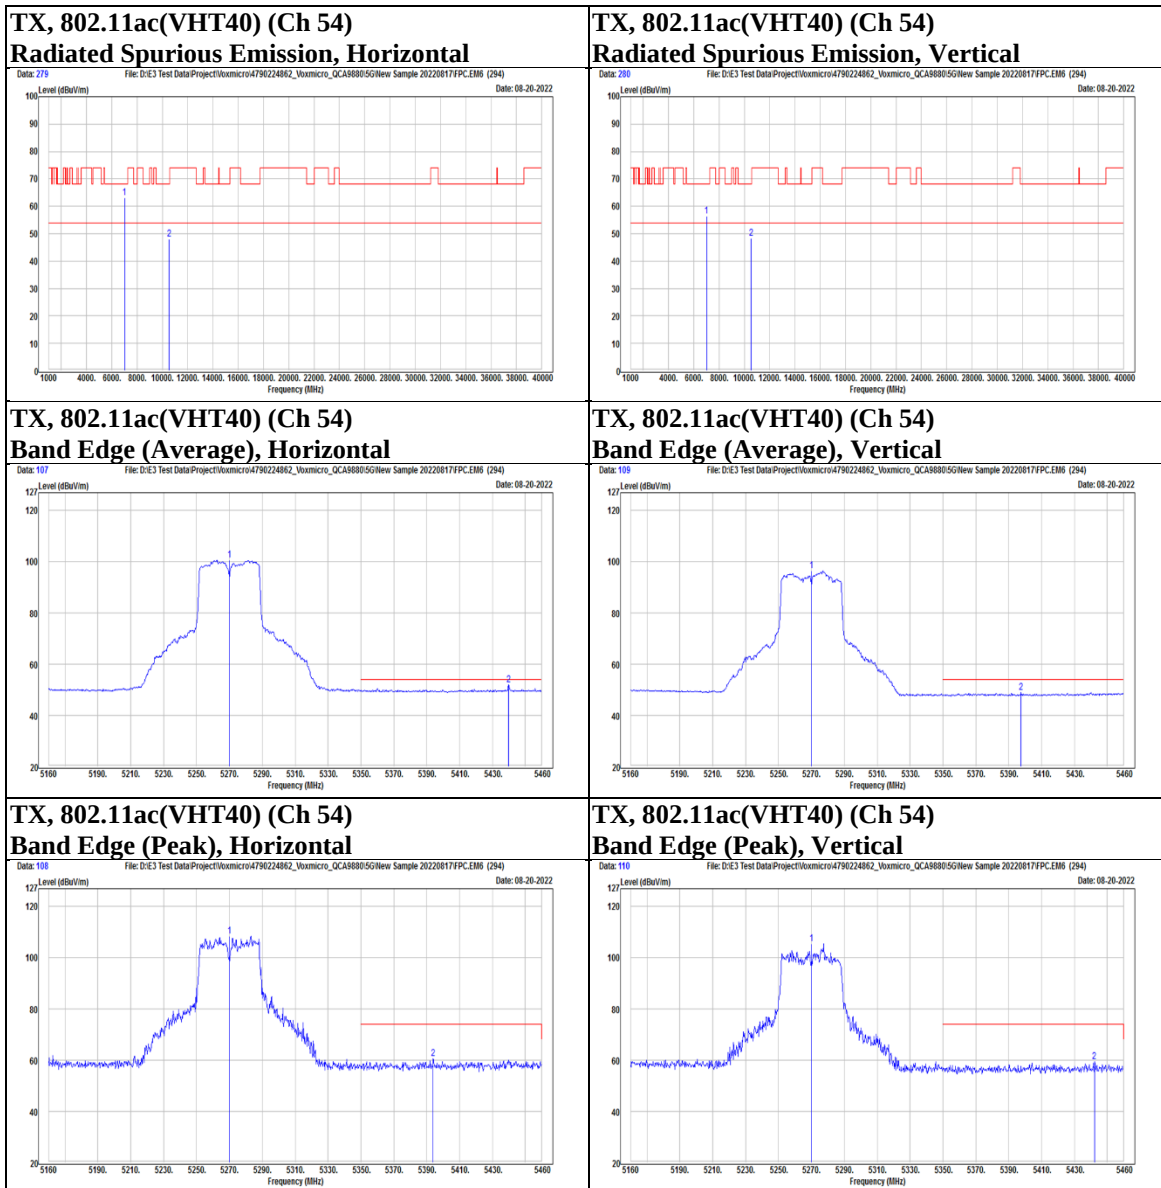

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 227 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5310	88.3	18.81	107.11	N/A	N/A	PK
	@	5310	79.71	18.81	98.52	N/A	N/A	AVG
		5350.2	34.28	19.01	53.29	54	-0.71	AVG
		5357.1	43.57	19.05	62.62	74	-11.38	PK
		7080	43.56	9.43	52.99	68.2	-15.21	PK
	*	10620	30.6	18.04	48.64	74	-25.36	PK
Vertical	@	5310	82.67	18.81	101.48	N/A	N/A	PK
	@	5310	73.98	18.81	92.79	N/A	N/A	AVG
		5350.2	31.91	19.01	50.92	54	-3.08	AVG
		5428.2	39.97	19.41	59.38	74	-14.62	PK
		7080	36.49	9.43	45.92	68.2	-22.28	PK
	*	10620	31.18	18.04	49.22	74	-24.78	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 228 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

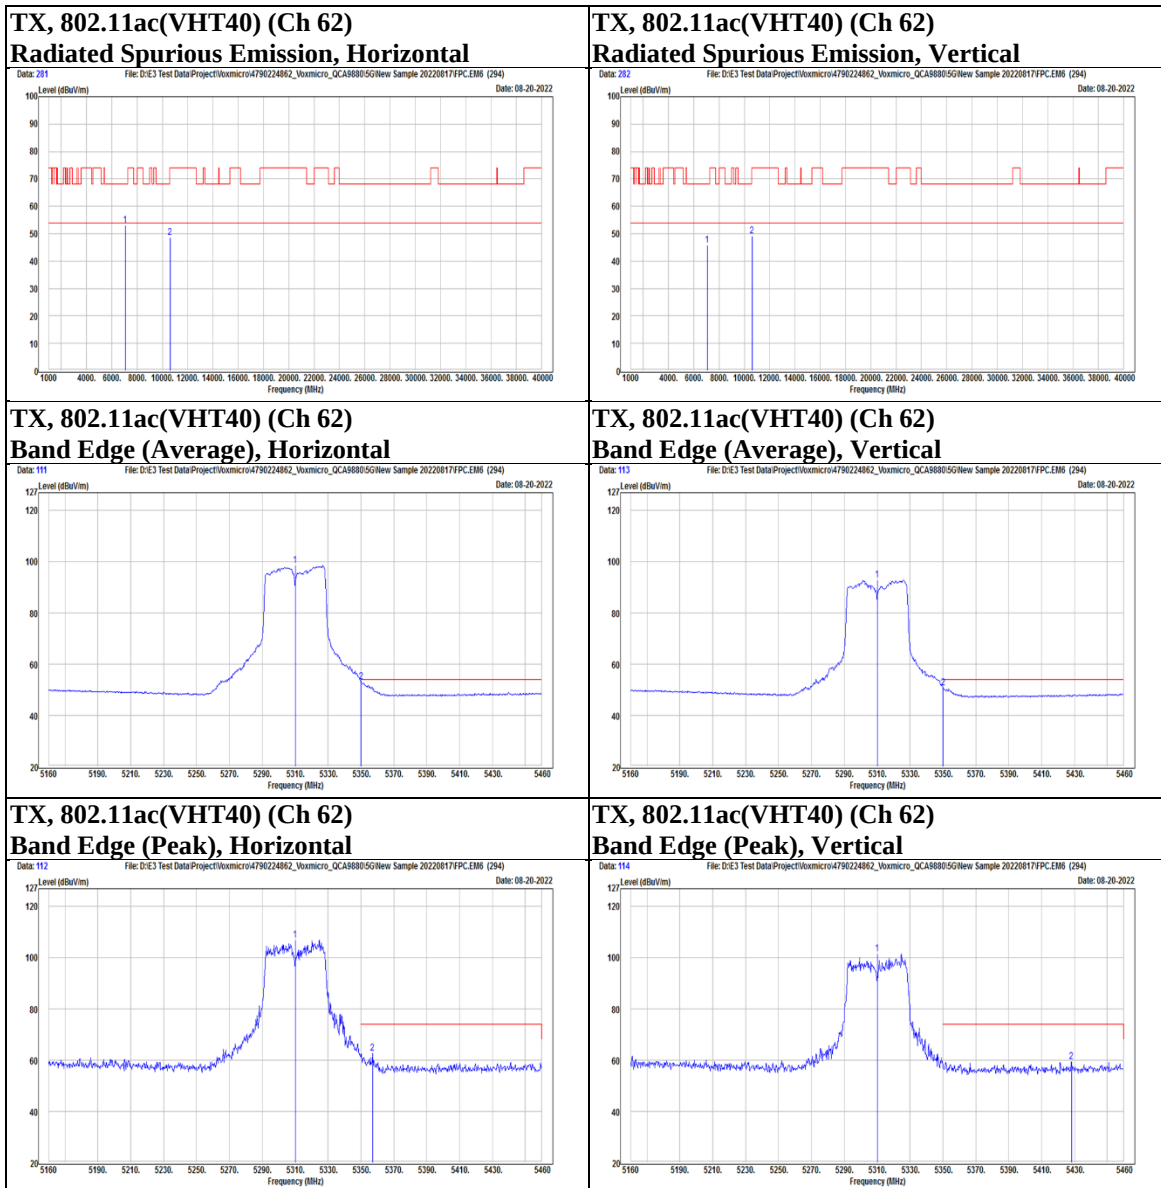

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 229 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5432.2	40.09	19.43	59.52	74	-14.48	PK
		5459.85	31.55	19.57	51.12	54	-2.88	AVG
		5466.85	46.05	19.61	65.66	68.2	-2.54	PK
	@	5510	87.75	19.78	107.53	N/A	N/A	PK
	@	5510	79.79	19.78	99.57	N/A	N/A	AVG
		7346.7	38.81	10.33	49.14	74	-24.86	PK
	*	11020	31.45	18.42	49.87	74	-24.13	PK
Vertical		5430.8	39.86	19.42	59.28	74	-14.72	PK
		5459.5	29.42	19.57	48.99	54	-5.01	AVG
		5469.65	43.64	19.62	63.26	68.2	-4.94	PK
	@	5510	84.23	19.78	104.01	N/A	N/A	PK
	@	5510	77.16	19.78	96.94	N/A	N/A	AVG
		7346.7	33.58	10.33	43.91	74	-30.09	PK
	*	11020	29.94	18.42	48.36	74	-25.64	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0