



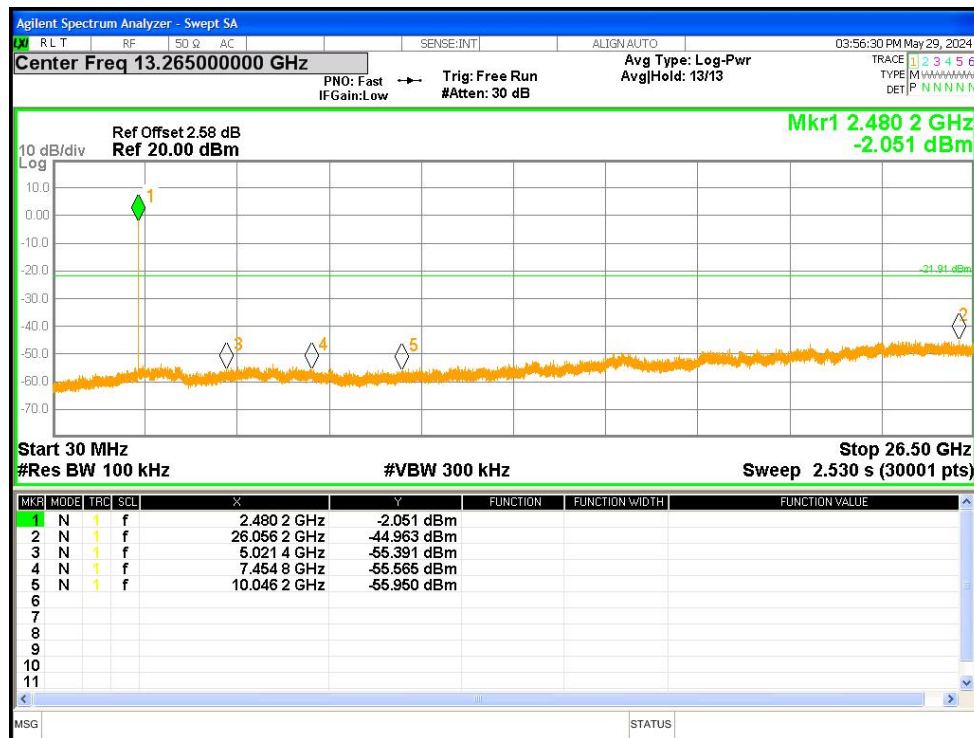


Carrier Frequencies Separation

Condition	Mode	Antenna	Hopping Freq1 (MHz)	Hopping Freq2 (MHz)	HFS (MHz)	Limit (MHz)	Verdict
NVNT	1-DH1	Ant1	2440.951	2441.971	1.02	0.961	Pass
NVNT	2-DH1	Ant1	2440.9465	2441.9155	0.969	0.91	Pass
NVNT	3-DH1	Ant1	2440.9615	2441.953	0.9915	0.899	Pass


CFS NVNT 1-DH1 2441MHz Ant1

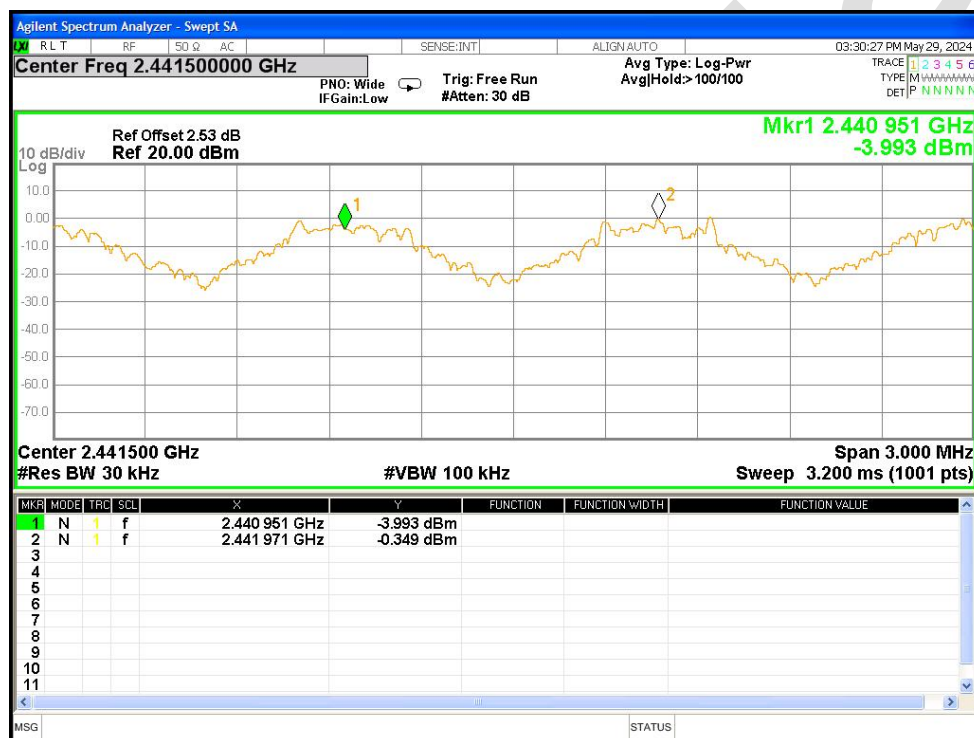

CFS NVNT 2-DH1 2441MHz Ant1

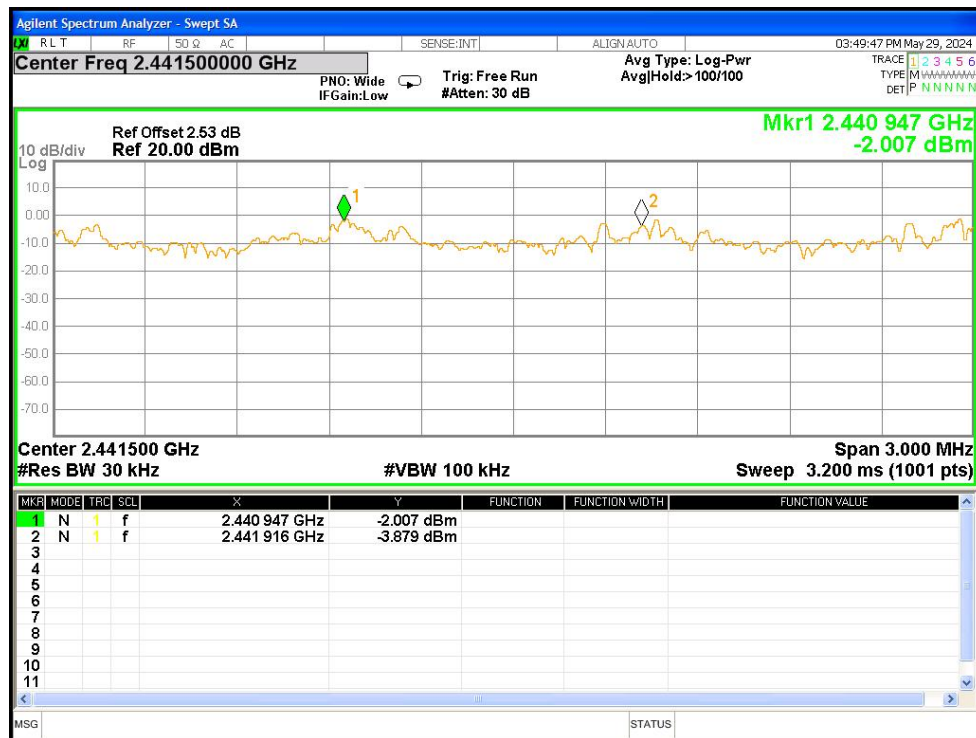


CFS NVNT 3-DH1 2441MHz Ant1

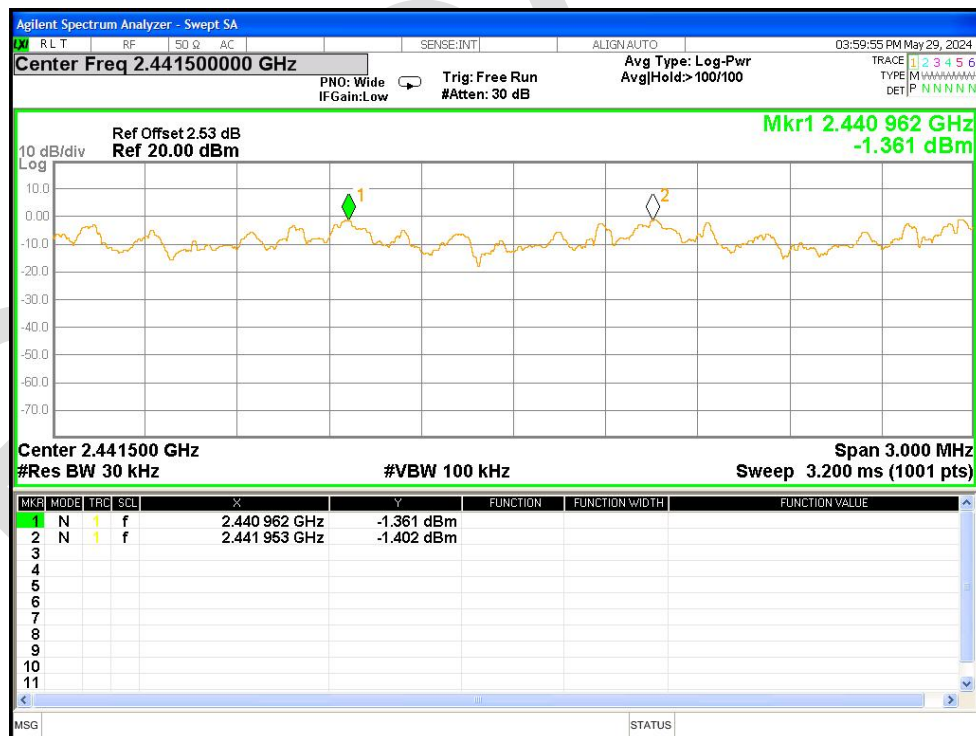


Number of Hopping Channel

Condition	Mode	Antenna	Hopping Number	Limit	Verdict
NVNT	1-DH1	Ant1	79	15	Pass
NVNT	2-DH1	Ant1	79	15	Pass
NVNT	3-DH1	Ant1	79	15	Pass


Hopping No. NVNT 1-DH1 2441MHz Ant1

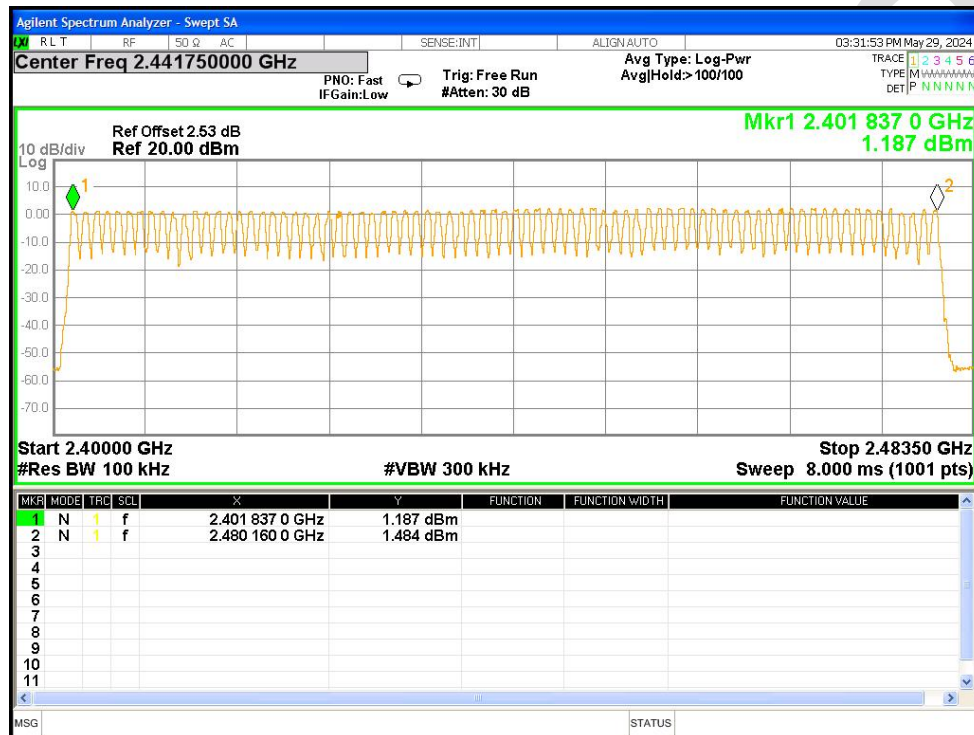

Hopping No. NVNT 2-DH1 2441MHz Ant1

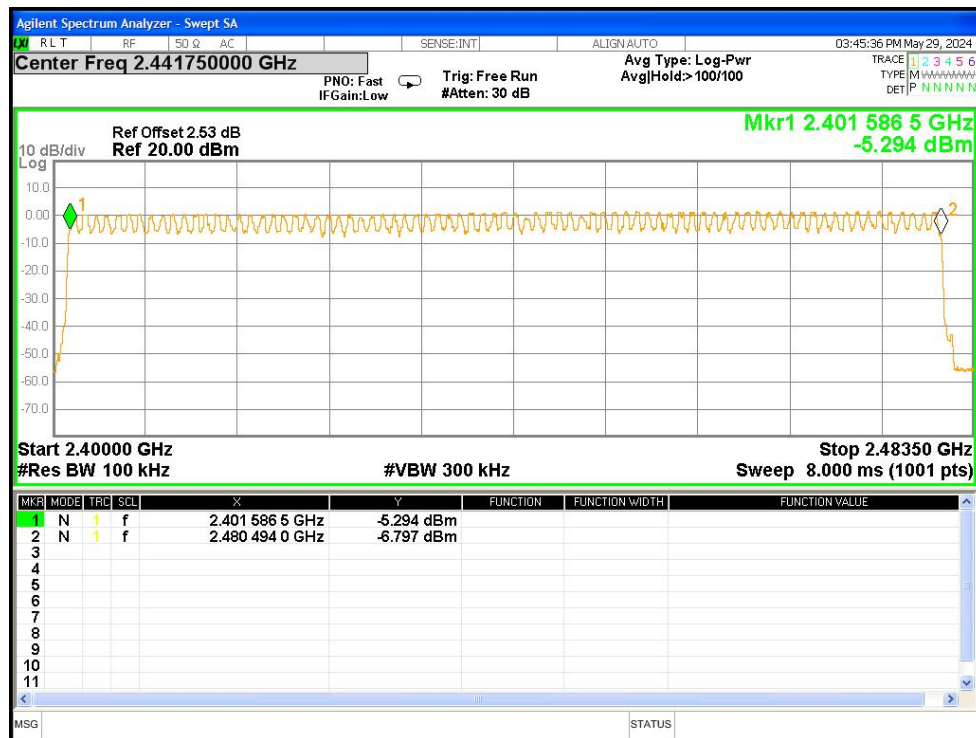


Hopping No. NVNT 3-DH1 2441MHz Ant1

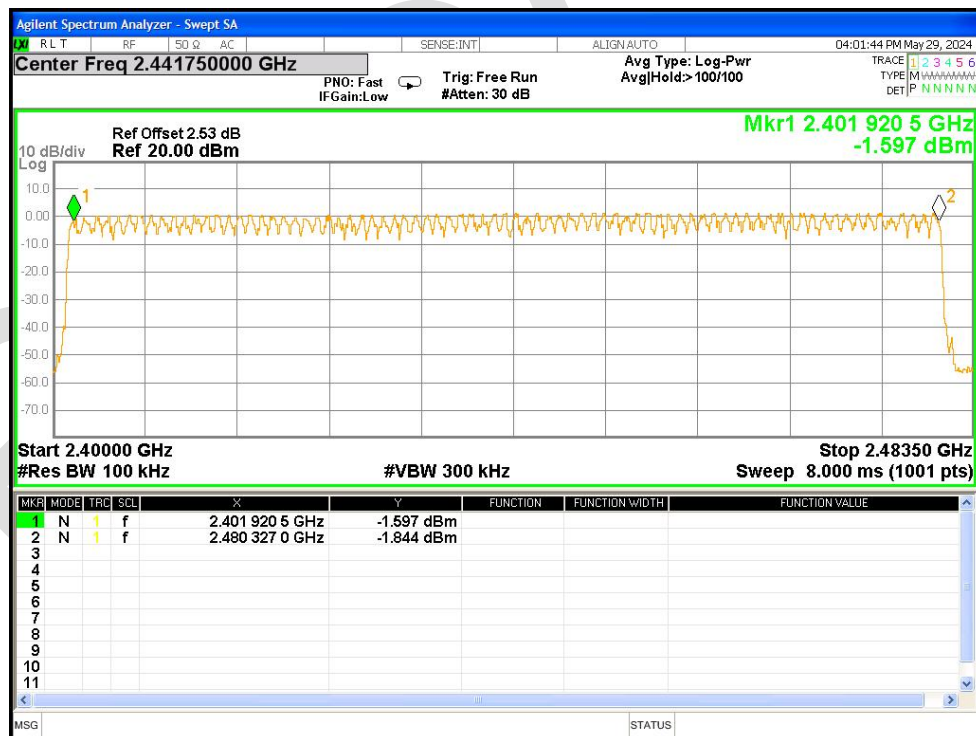


Dwell Time

Condition	Mode	Frequency (MHz)	Antenna	Pulse Time (ms)	Total Dwell Time (ms)	Burst Count	Period Time (ms)	Limit (ms)	Verdict
NVNT	1-DH1	2441	Ant1	0.383	121.794	318	31600	400	Pass
NVNT	1-DH3	2441	Ant1	1.639	255.684	156	31600	400	Pass
NVNT	1-DH5	2441	Ant1	2.887	323.344	112	31600	400	Pass
NVNT	2-DH5	2441	Ant1	2.891	286.209	99	31600	400	Pass
NVNT	3-DH5	2441	Ant1	2.894	318.34	110	31600	400	Pass


Dwell NVNT 1-DH1 2441MHz Ant1 One Burst

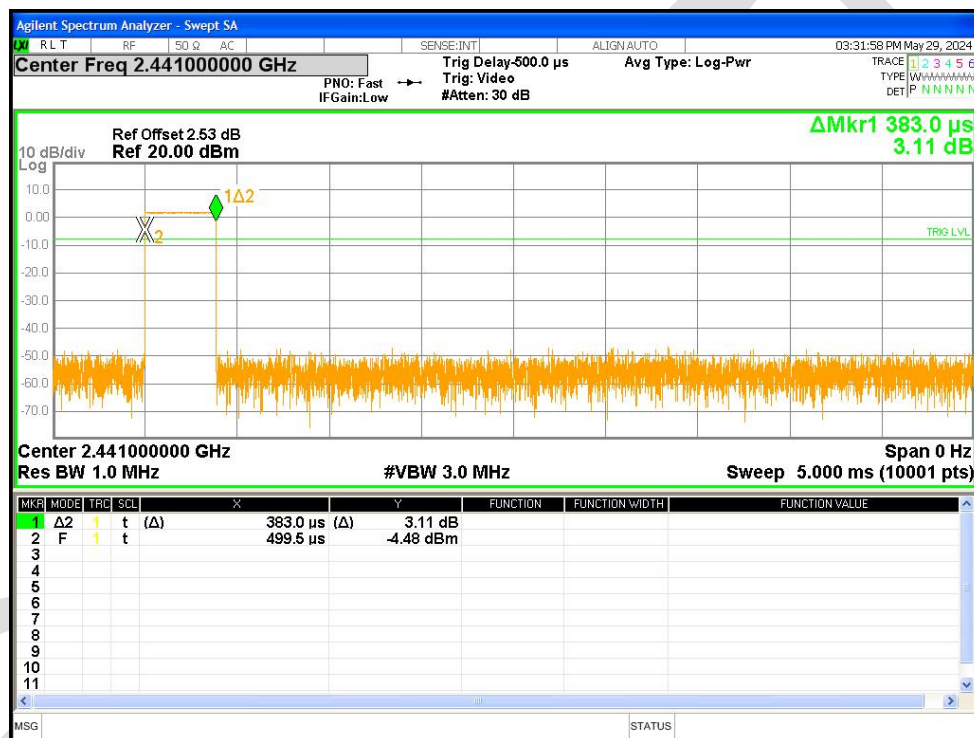


Dwell NVNT 1-DH1 2441MHz Ant1 Accumulated

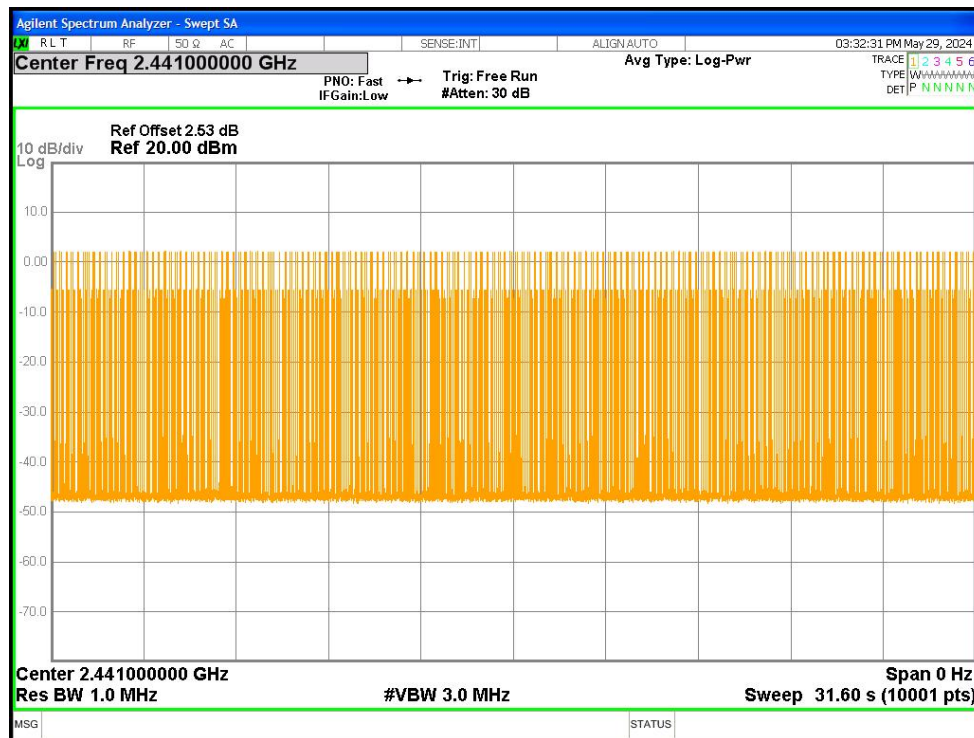


Dwell NVNT 1-DH3 2441MHz Ant1 One Burst

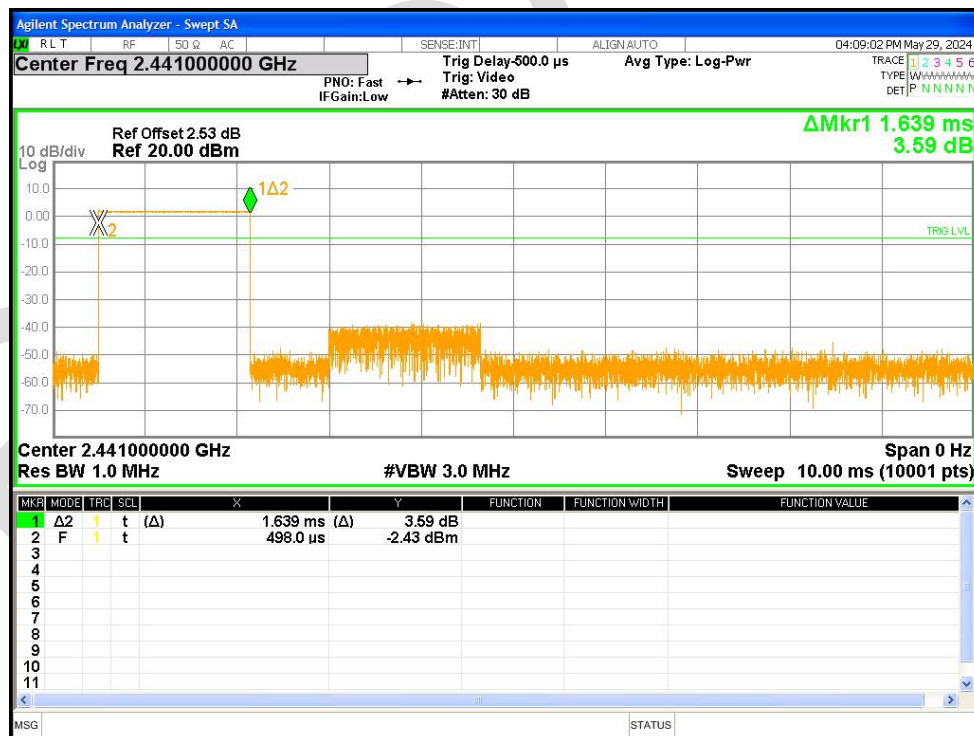


Dwell NVNT 1-DH3 2441MHz Ant1 Accumulated

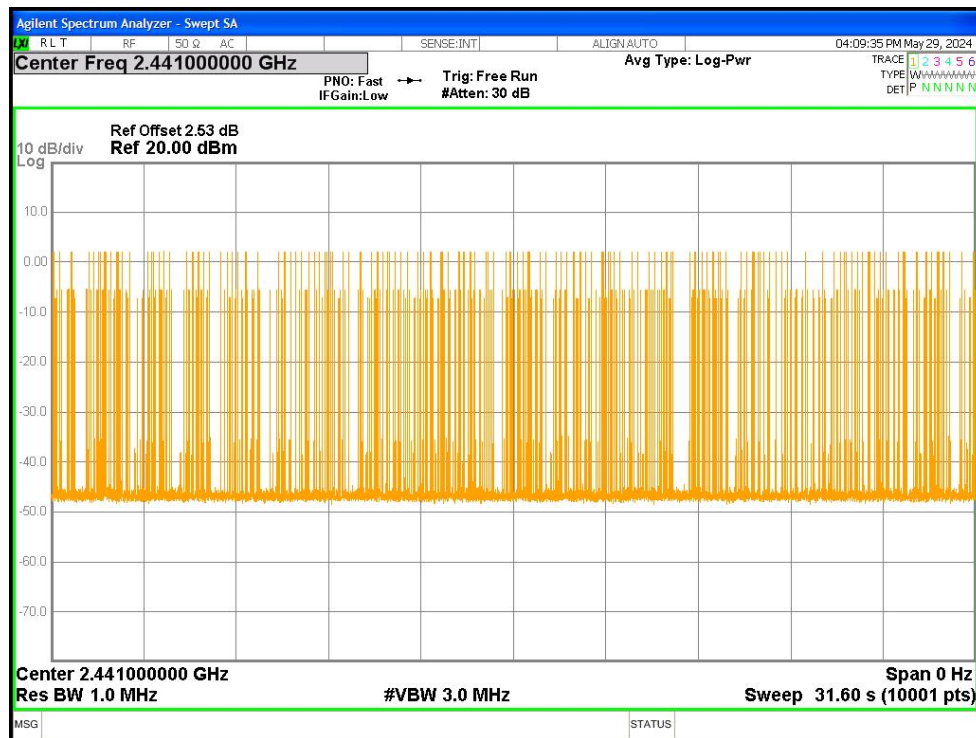


Dwell NVNT 1-DH5 2441MHz Ant1 One Burst

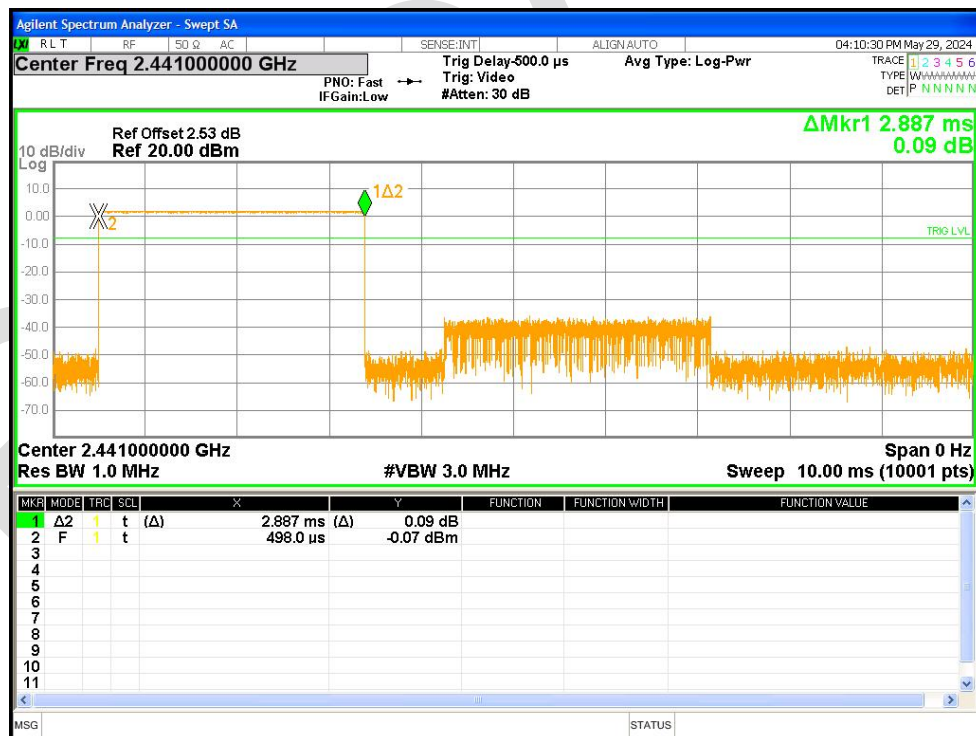


Dwell NVNT 1-DH5 2441MHz Ant1 Accumulated

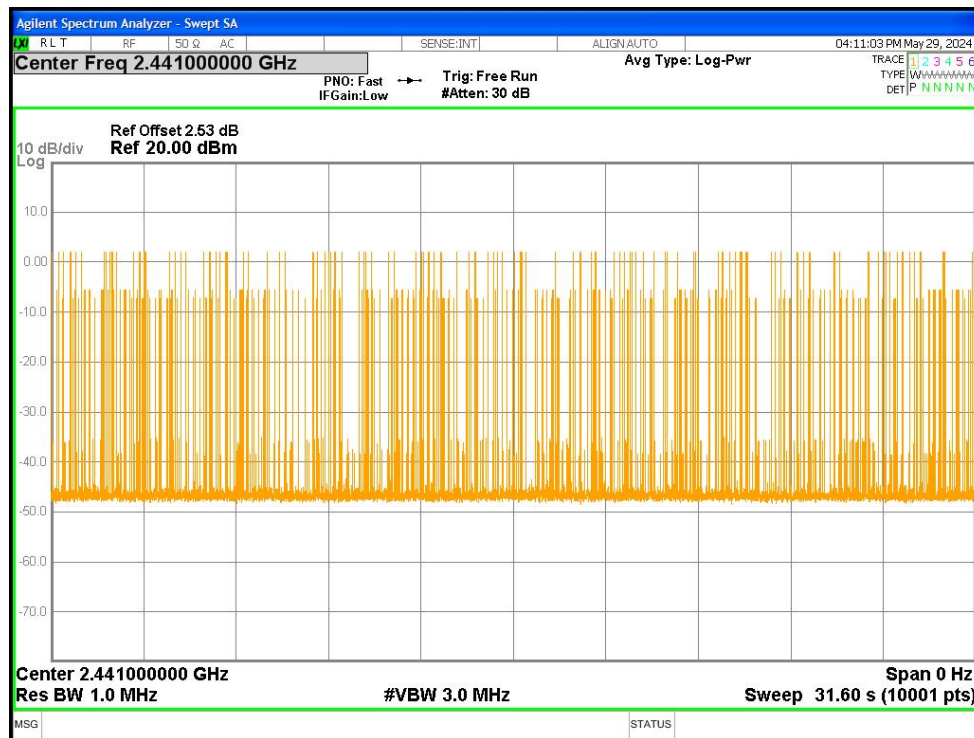


Dwell NVNT 2-DH5 2441MHz Ant1 One Burst

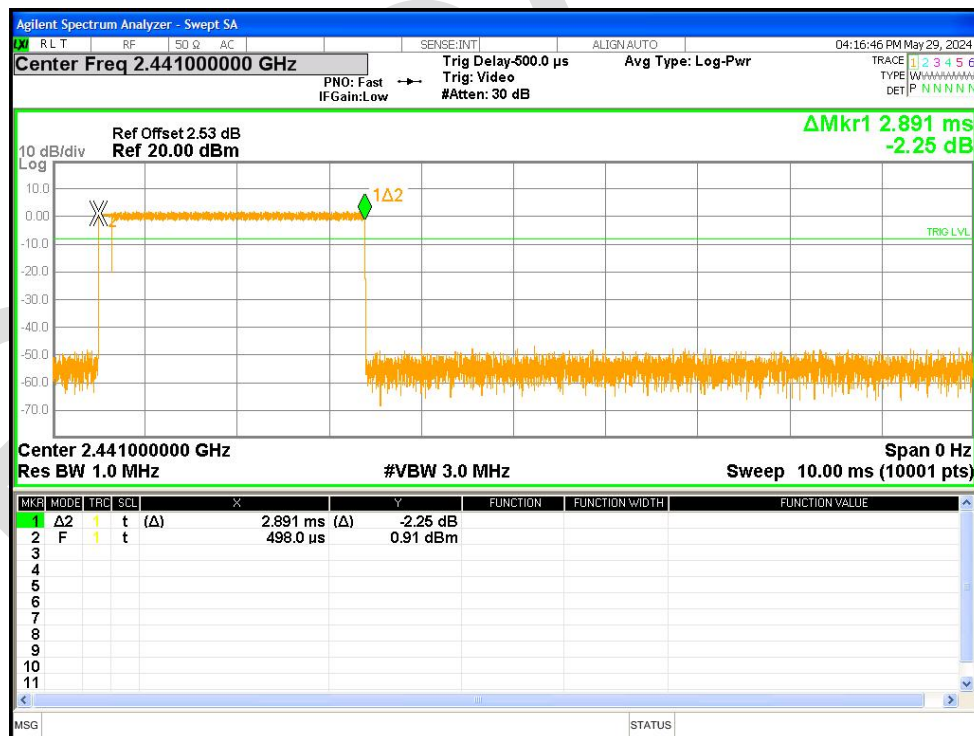


Dwell NVNT 2-DH5 2441MHz Ant1 Accumulated

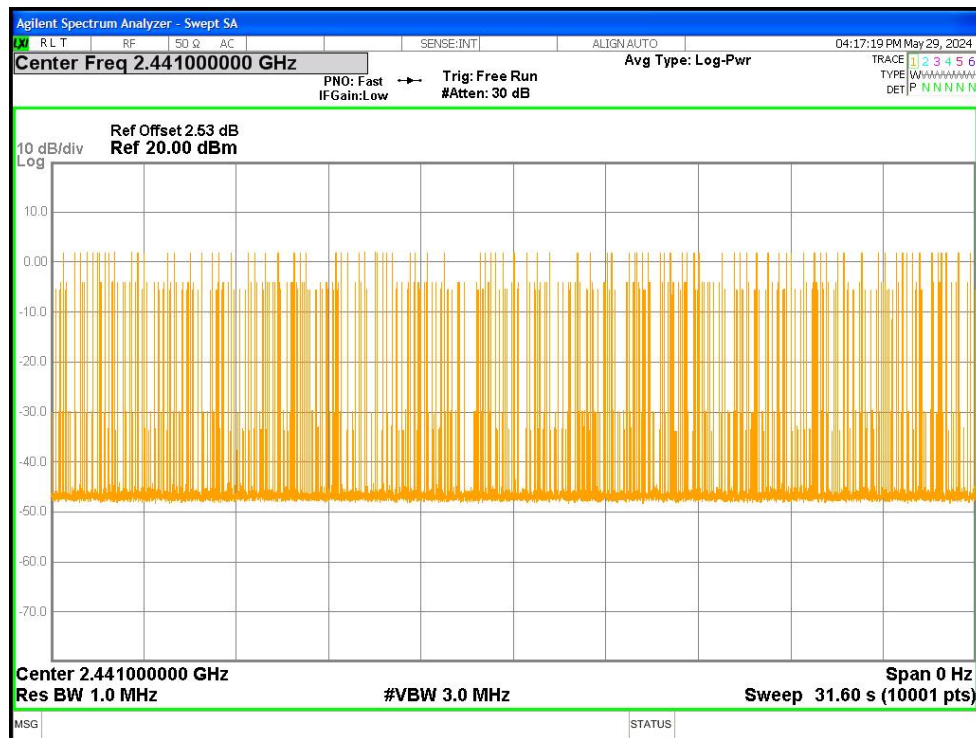

Dwell NVNT 3-DH5 2441MHz Ant1 One Burst

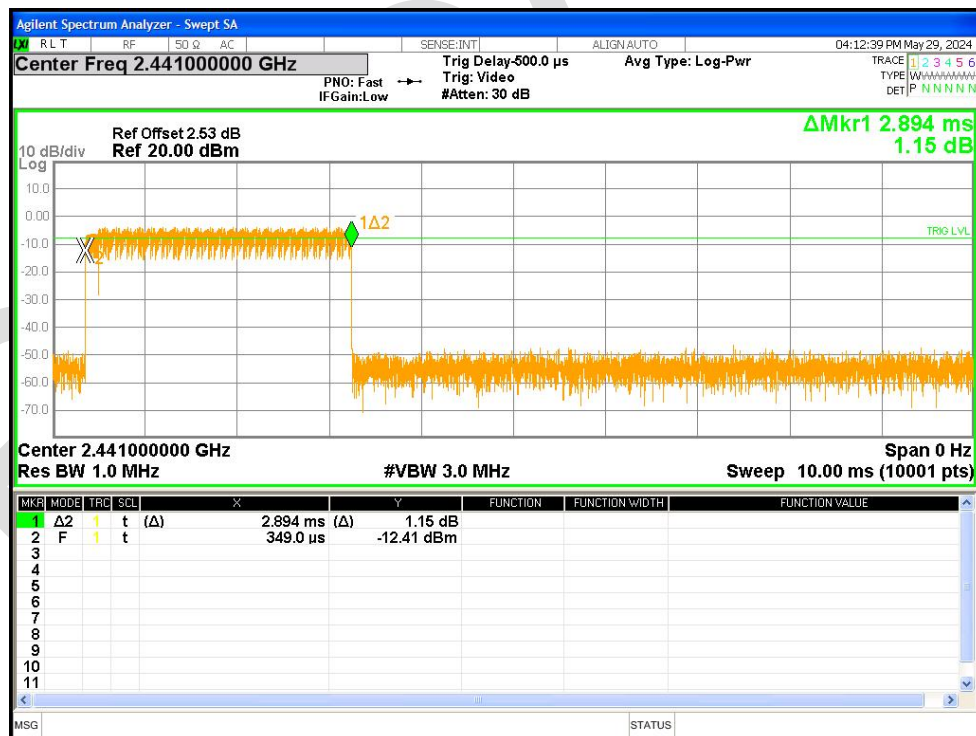

Dwell NVNT 3-DH5 2441MHz Ant1 Accumulated

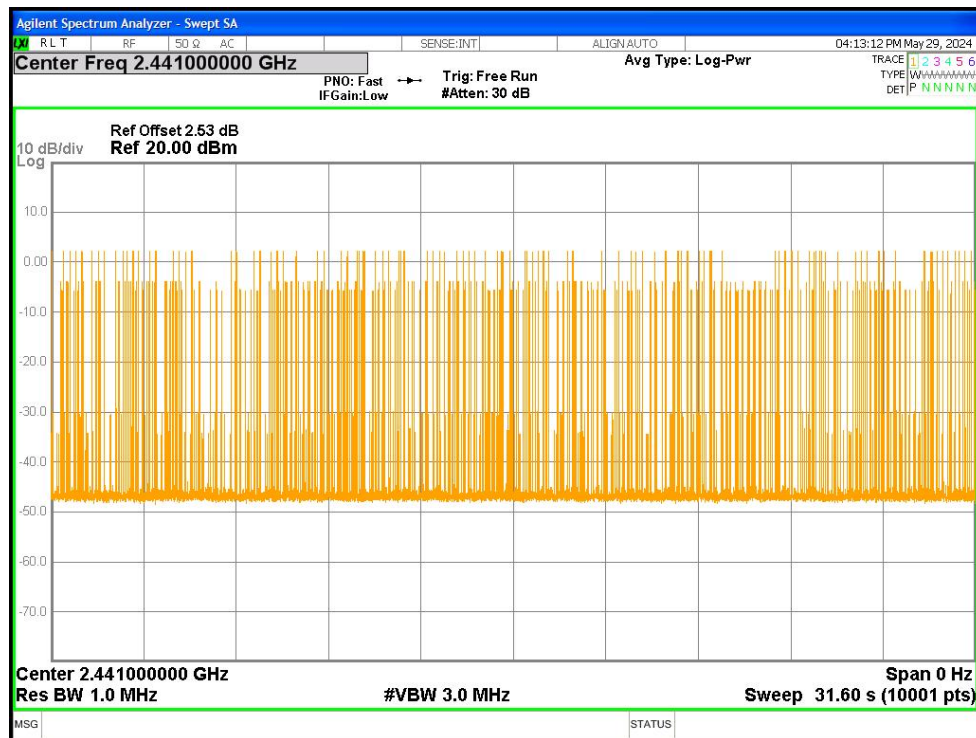


Appendix B: photographs of test setup

Conducted emissions at AC power line (150kHz-30MHz)



Radiated Emissions (30MHz-1GHz)

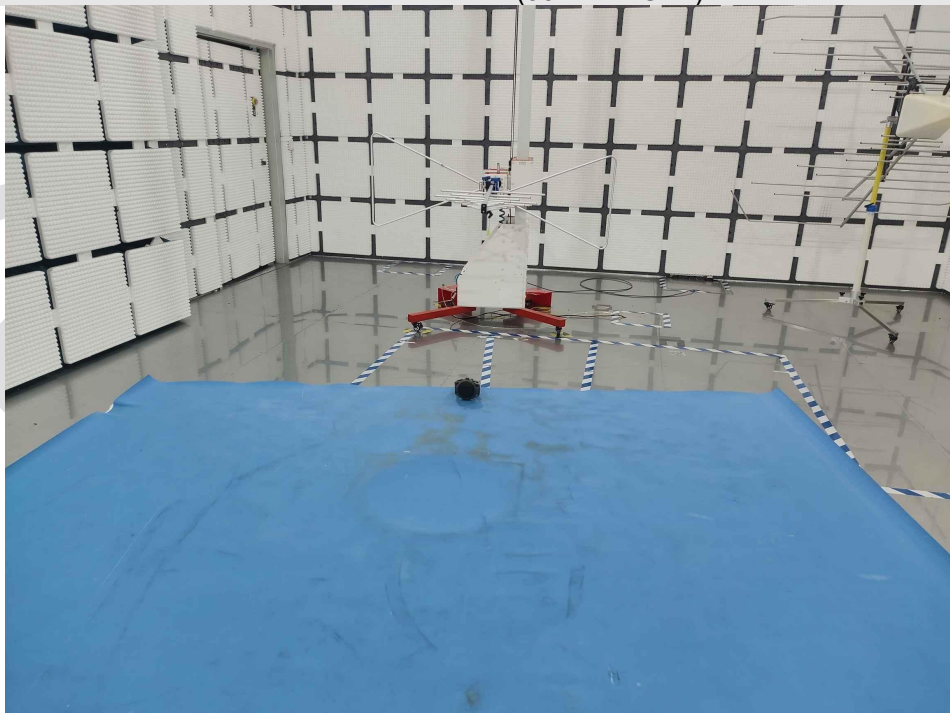

Radiated Emissions (above 1GHz)



Appendix C: photographs of EUT

Reference to the test report no. BLA-EMC-202404-A10901

----END OF REPORT----

The test report is effective only with both signature and specialized stamp, the result(s) shown in this report refer only to the sample(s) tested. Without written approval of BlueAsia, this report can't be reproduced except in full.