




PSD n20 5200MHz Ant1

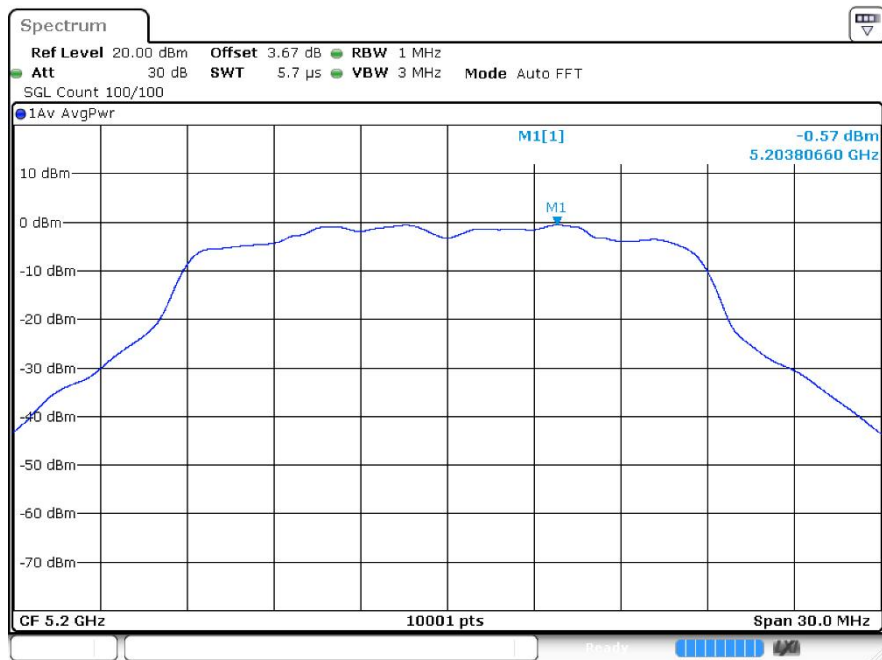


PSD n20 5240MHz Ant1

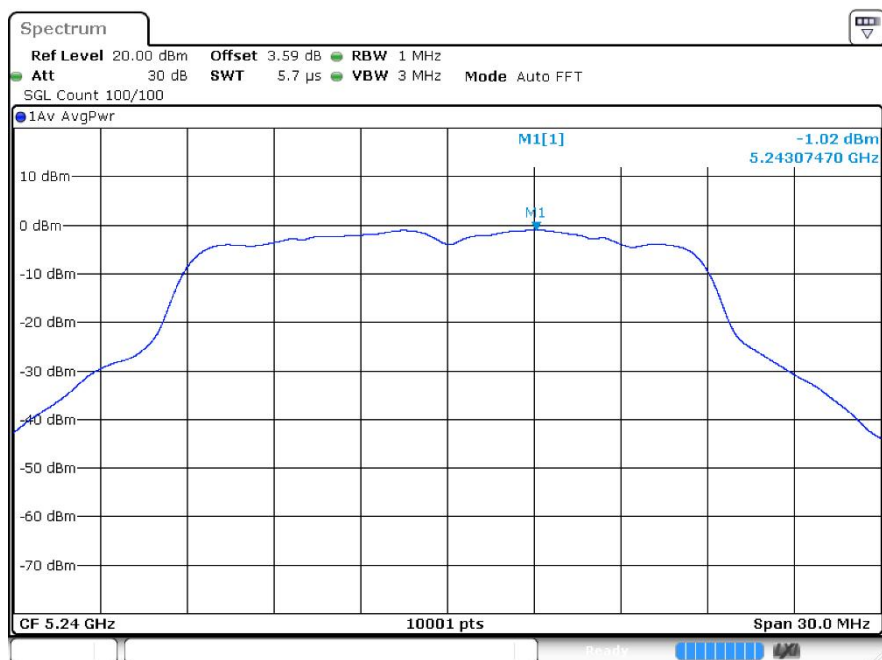


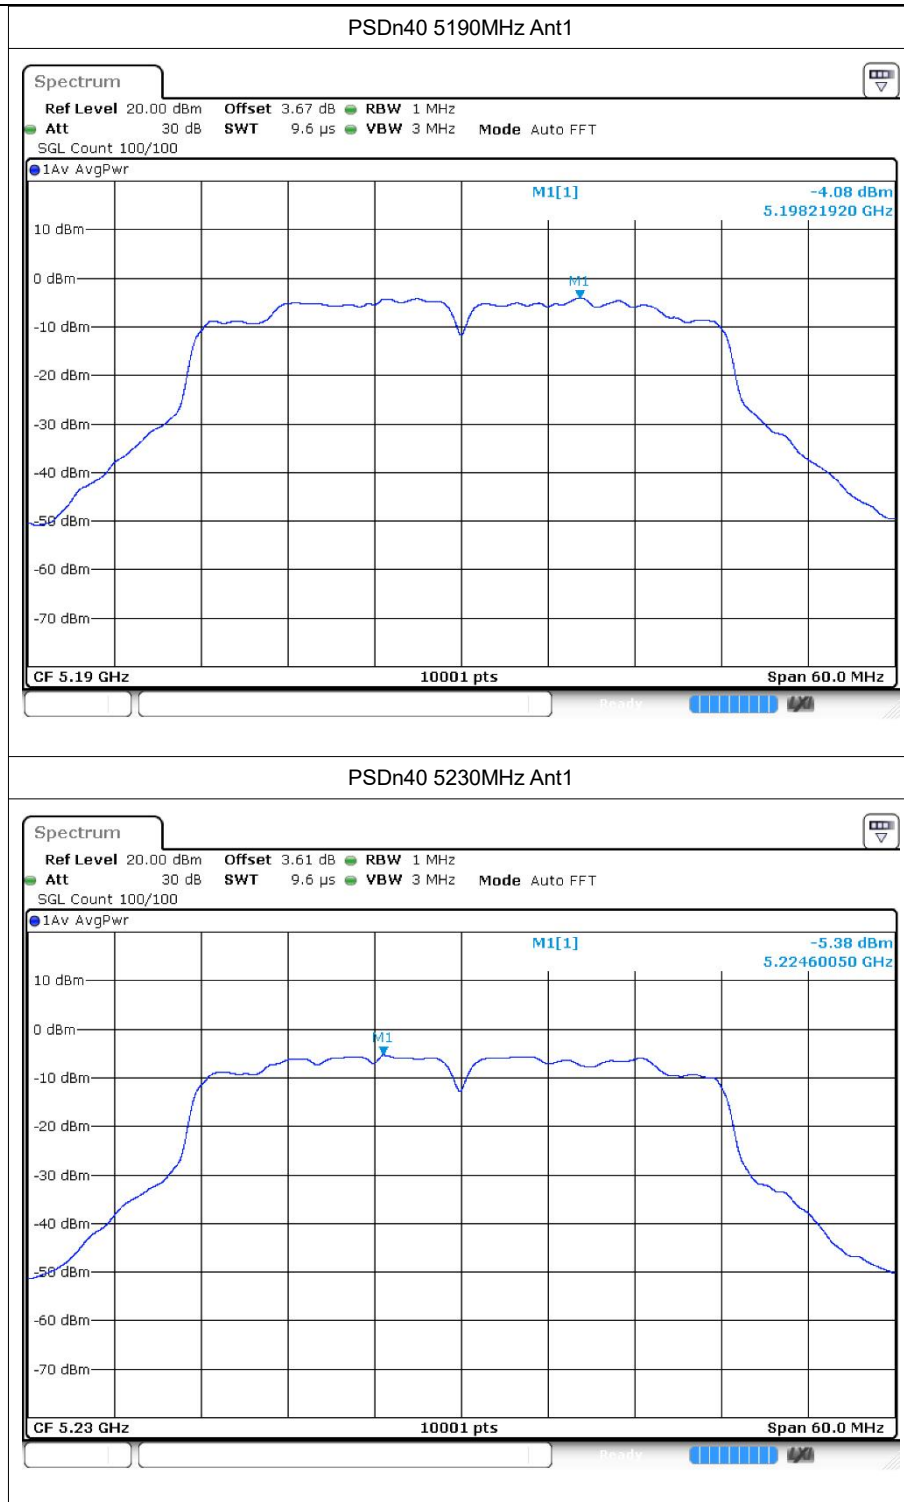


PSD ac20 5180MHz Ant1

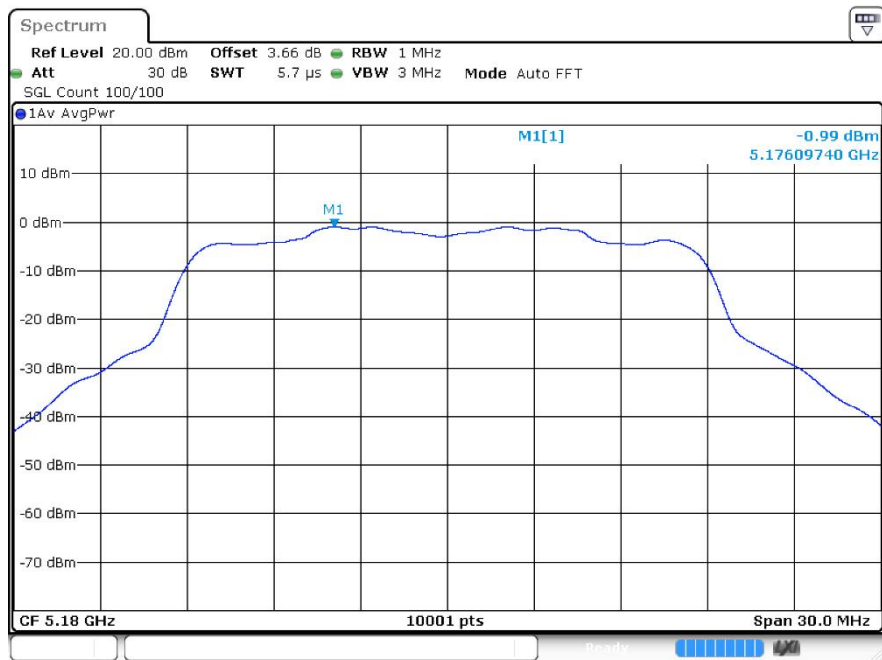


PSD ac20 5200MHz Ant1

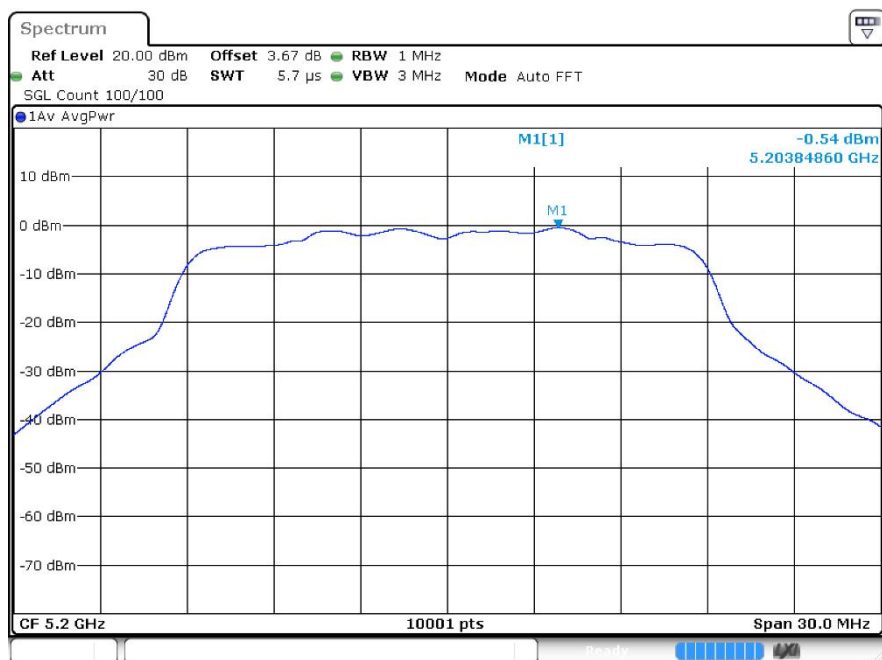


PSD ac20 5240MHz Ant1

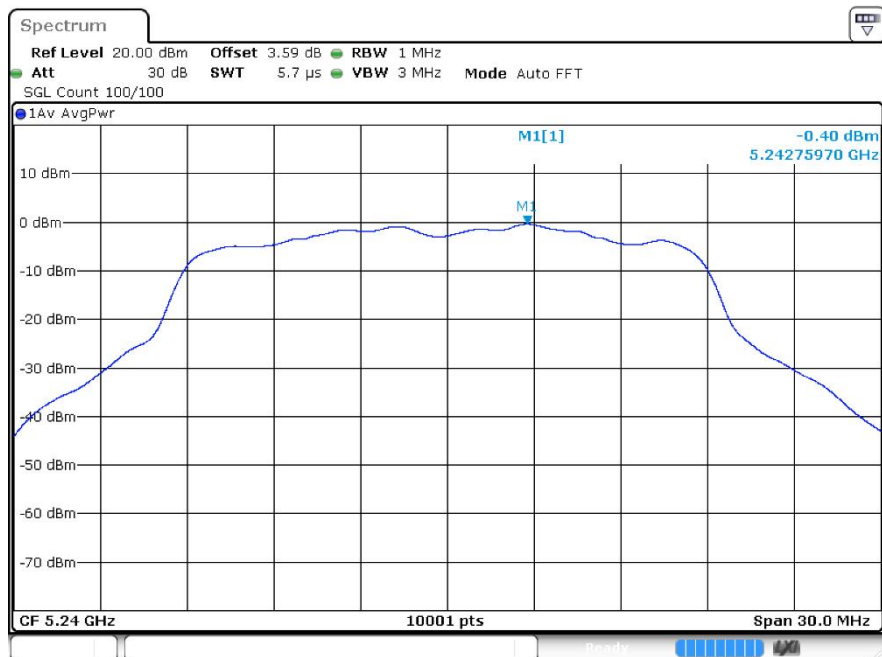


PSDac40 5190MHz Ant1

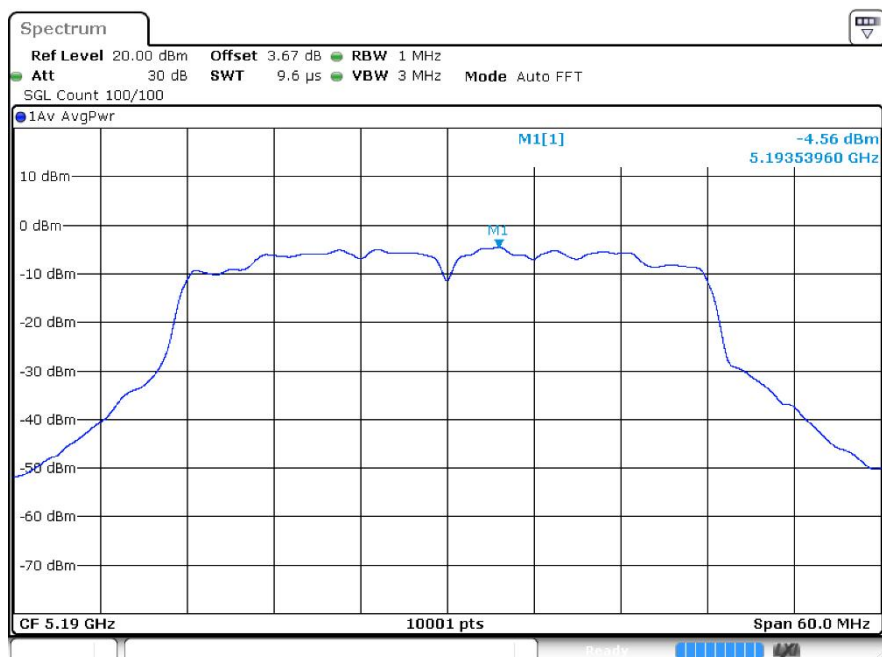

PSDac40 5230MHz Ant1

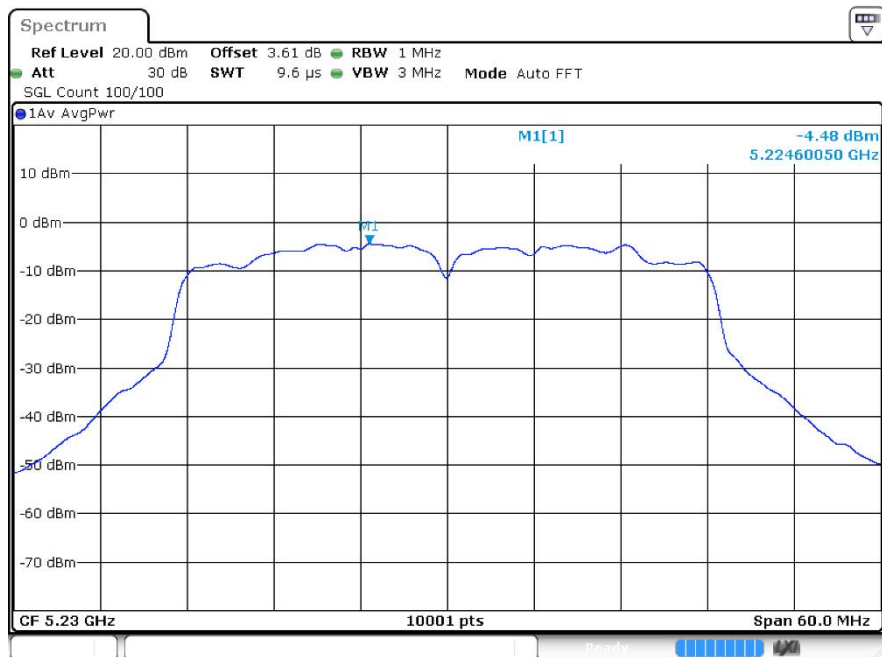

PSDac80 5210MHz Ant1

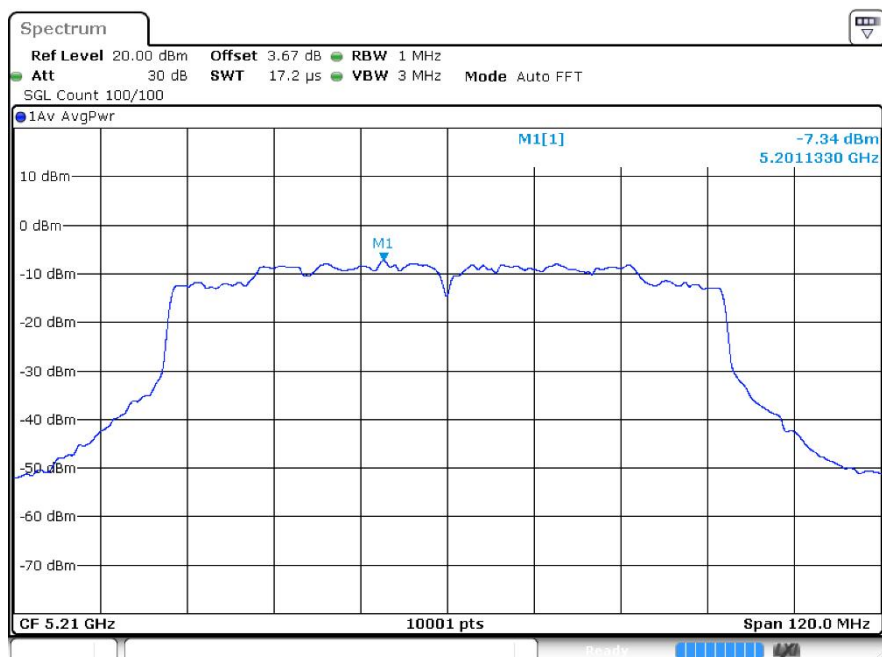



6 Frequency Stability

6.1 Test Result

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 120V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-20C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
0C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
10C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
30C 120V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 102V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 138V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
-20C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	a	5200	Ant1	5199.92	-80000	-15.38	25	Pass
10C 120V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
30C 120V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
40C 120V	a	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 102V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 102V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-10C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
0C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
10C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
30C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass



0C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
10C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
30C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 120V	n20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 102V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	n20	5200	Ant1	5199.92	-80000	-15.38	25	Pass
20C 138V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
10C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
30C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
50C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 102V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-10C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
40C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	n20	5240	Ant1	5239.9	-100000	-19.08	25	Pass
20C 102V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
0C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
10C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
50C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
-20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass



40C 120V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
50C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 138V	ac20	5180	Ant1	5179.9	-100000	-19.31	25	Pass
-20C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 138V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
-20C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
-10C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
10C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
30C 120V	ac20	5200	Ant1	5199.92	-80000	-15.38	25	Pass
40C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
50C 120V	ac20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 102V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-10C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
0C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
10C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
40C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 102V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
0C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
10C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
50C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 102V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass



20C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 138V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
-20C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
-10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
40C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
50C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 102V	ac80	5210	Ant1	5210.04	40000	7.68	25	Pass
20C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 138V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
-20C 120V	ac80	5210	Ant1	5209.96	-40000	-7.68	25	Pass
-10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
10C 120V	ac80	5210	Ant1	5209.94	-60000	-11.52	25	Pass
30C 120V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
40C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass




7 Conducted RF Spurious Emission

7.1 Test Result


Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
a	5180	Ant1	-35.83	-27	Pass
a	5200	Ant1	-35.86	-27	Pass
a	5240	Ant1	-35.69	-27	Pass
n20	5180	Ant1	-35.48	-27	Pass
n20	5200	Ant1	-36.69	-27	Pass
n20	5240	Ant1	-36.23	-27	Pass
n40	5190	Ant1	-35.75	-27	Pass
n40	5230	Ant1	-34.64	-27	Pass
ac20	5180	Ant1	-36.14	-27	Pass
ac20	5200	Ant1	-35.86	-27	Pass
ac20	5240	Ant1	-36.21	-27	Pass
ac40	5190	Ant1	-35.92	-27	Pass
ac40	5230	Ant1	-35.53	-27	Pass
ac80	5210	Ant1	-36.49	-27	Pass

7.2 Test Graphs

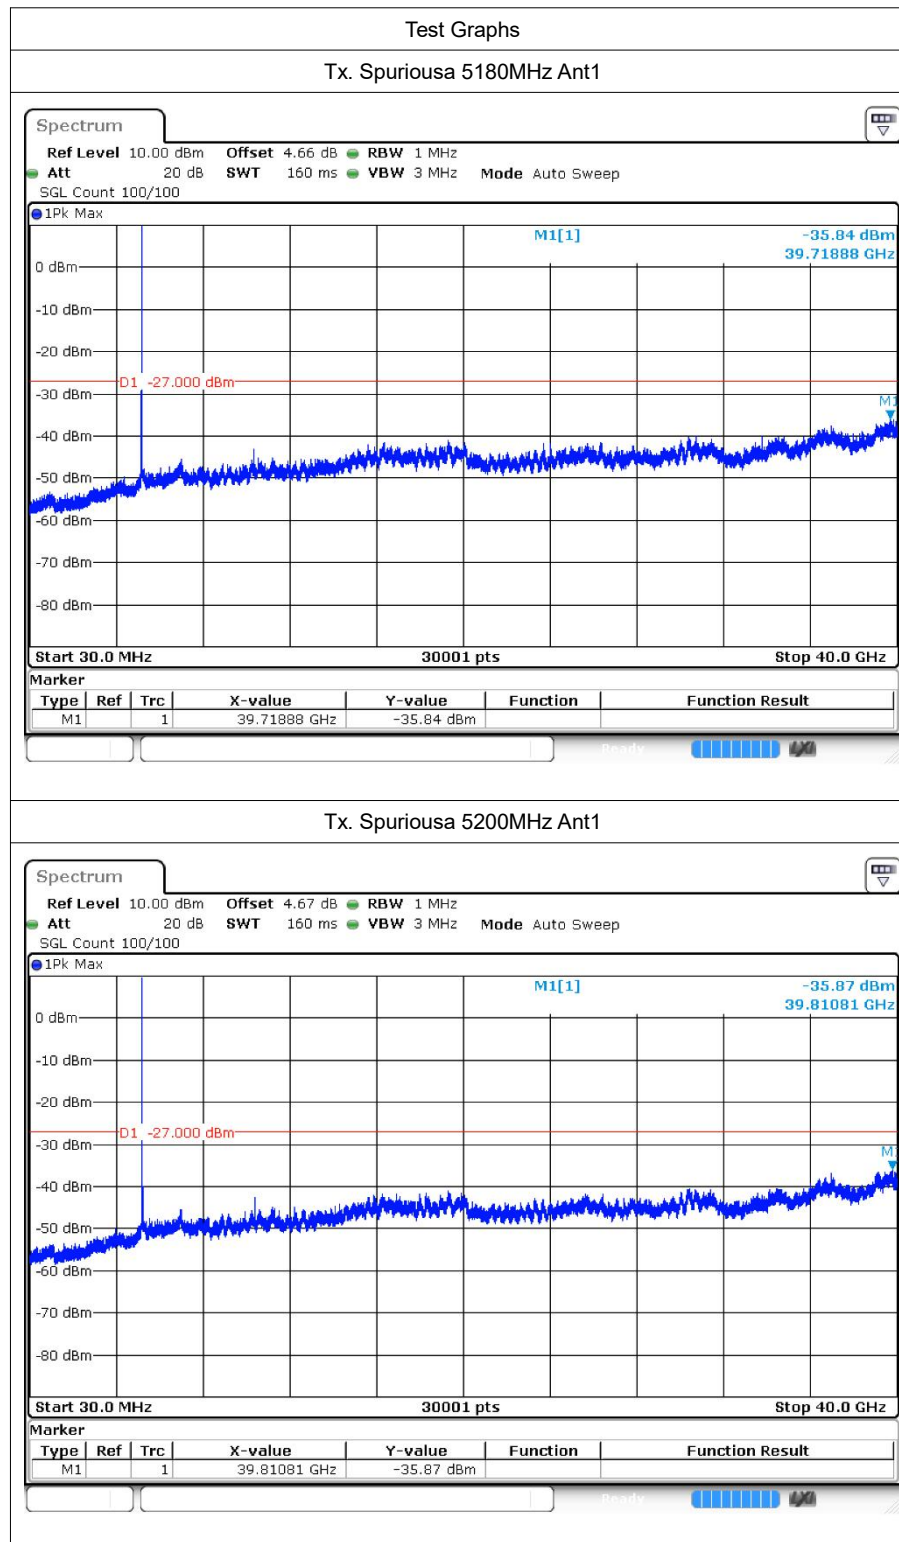




Tx. Spurious 5240MHz Ant1

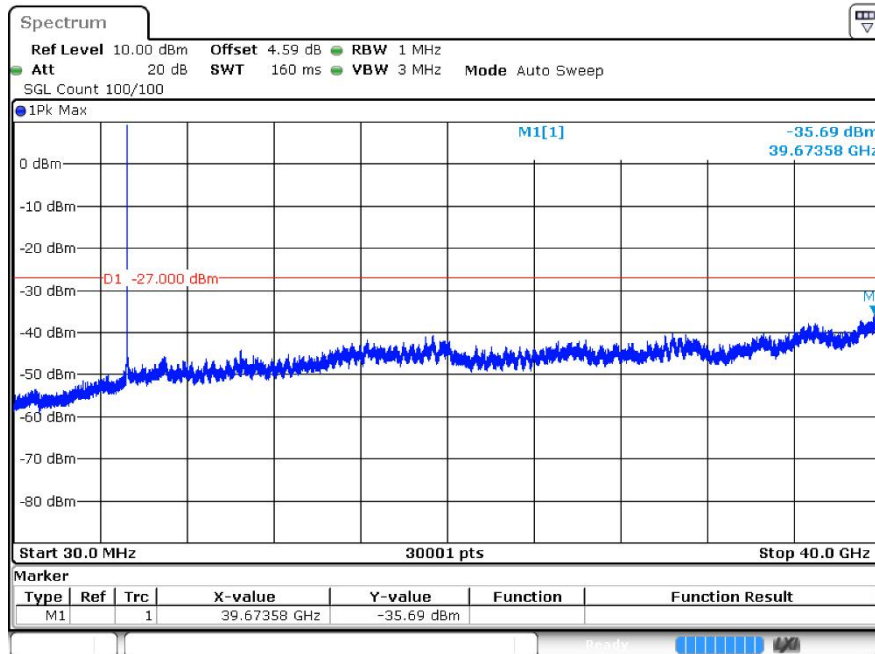


Tx. Spurious n20 5180MHz Ant1

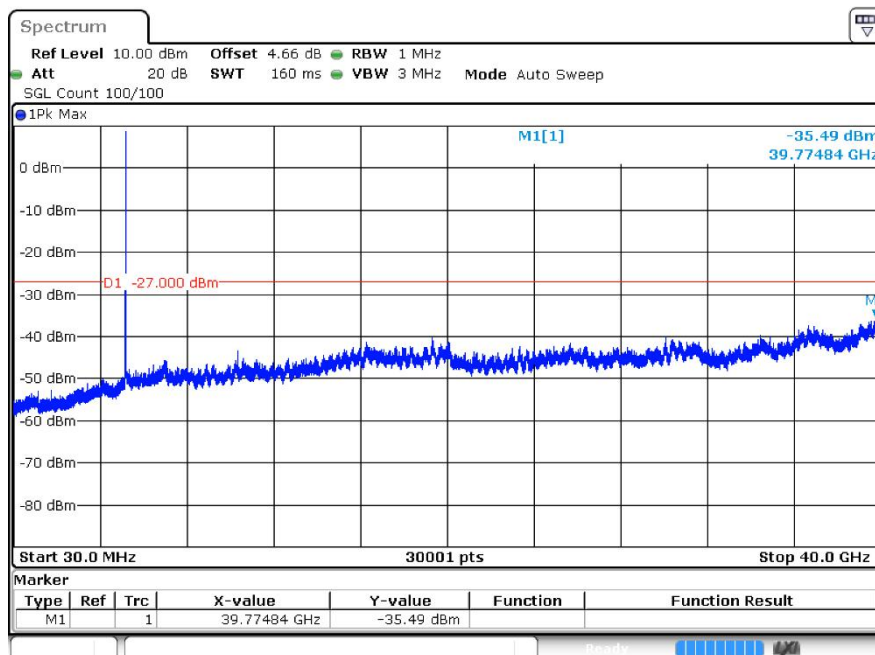




Tx. Spurious n20 5200MHz Ant1

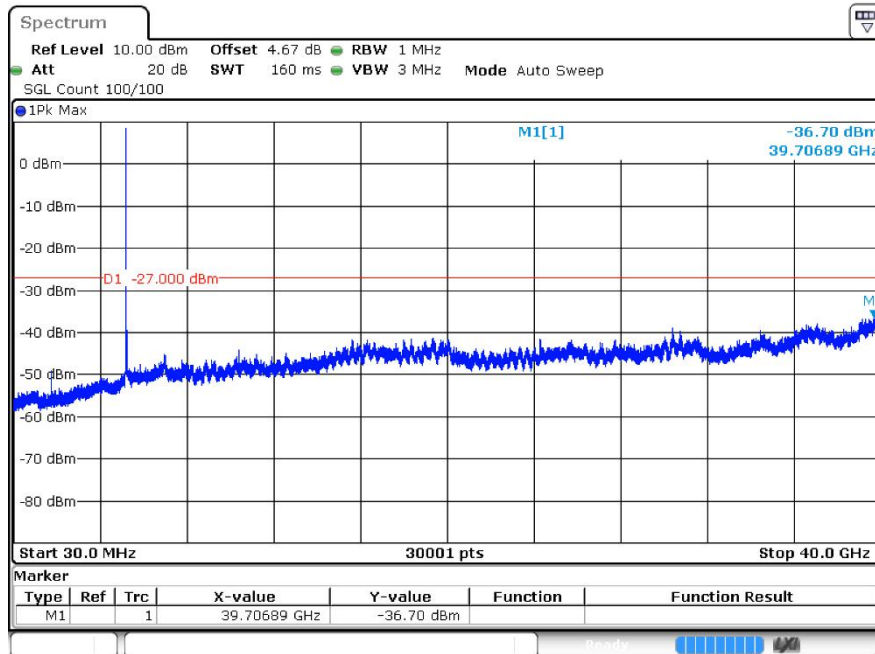


Tx. Spurious n20 5240MHz Ant1

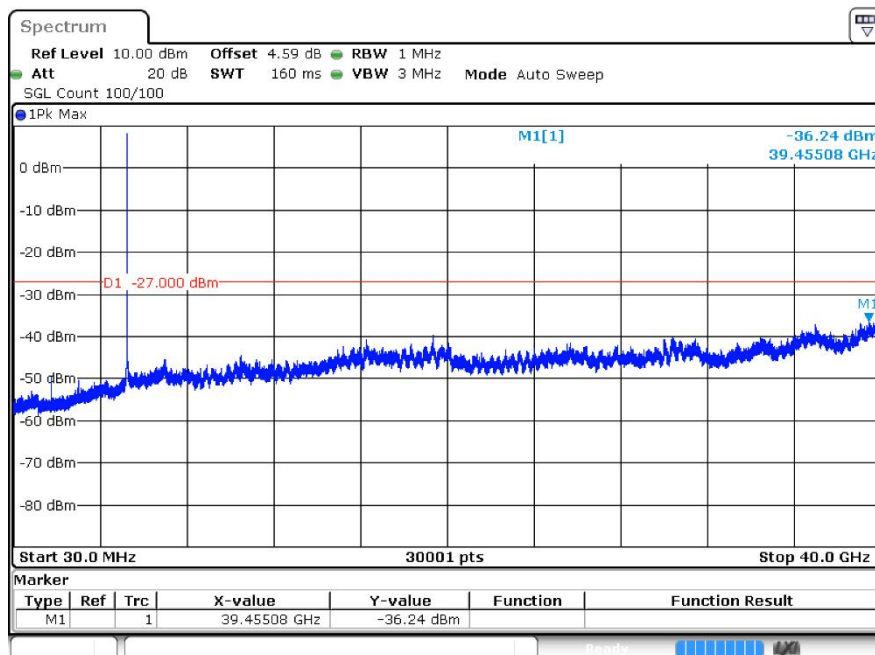




Tx. Spuriousn40 5190MHz Ant1

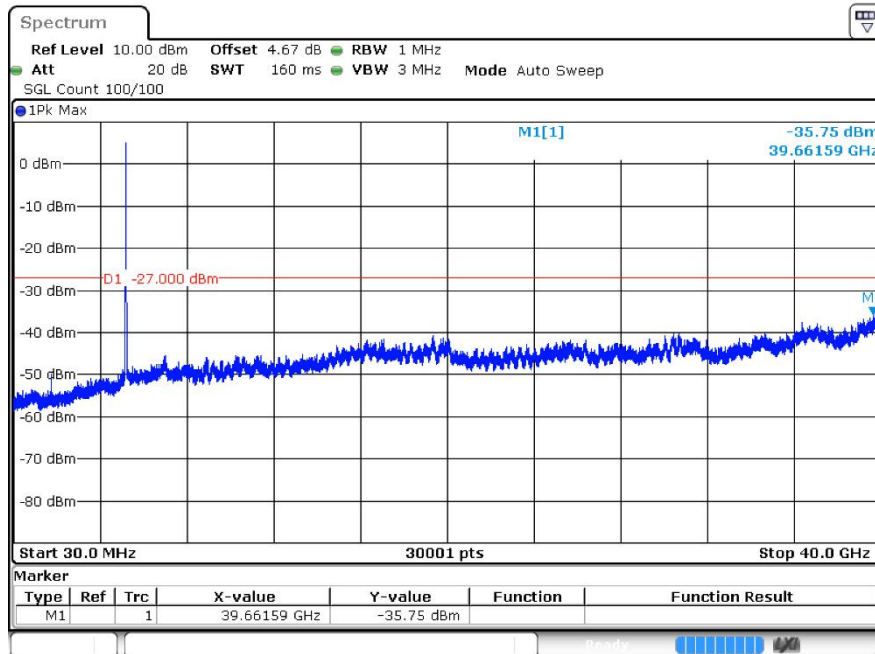


Tx. Spuriousn40 5230MHz Ant1

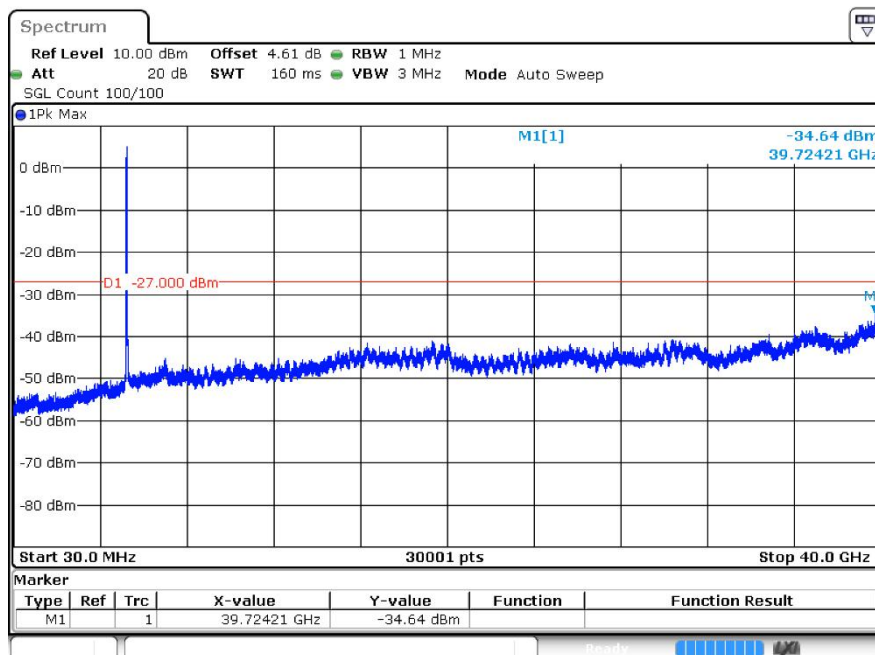




Tx. Spurious ac20 5180MHz Ant1

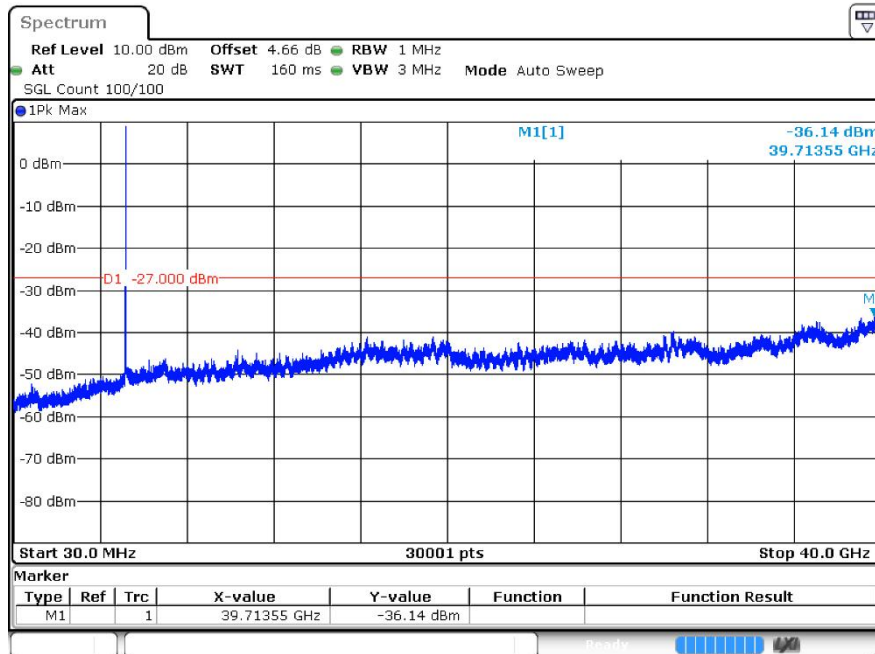


Tx. Spurious ac20 5200MHz Ant1

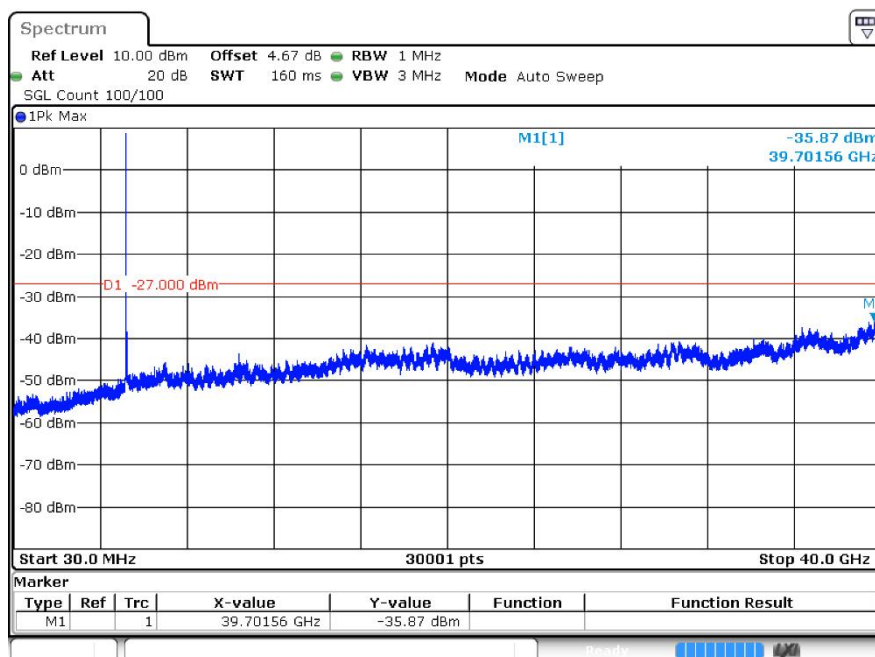




Tx. Spurious ac20 5240MHz Ant1

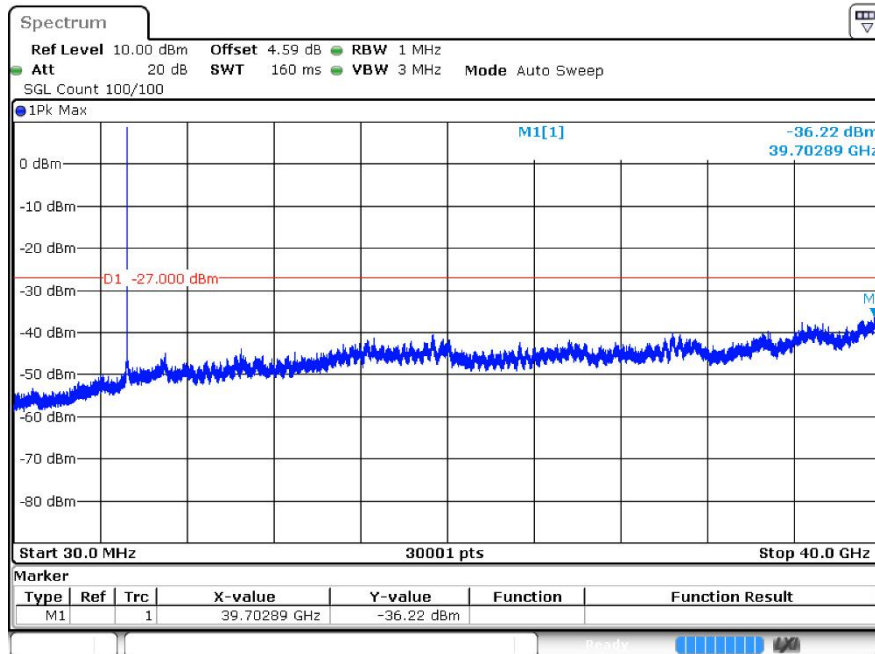


Tx. Spuriousac40 5190MHz Ant1

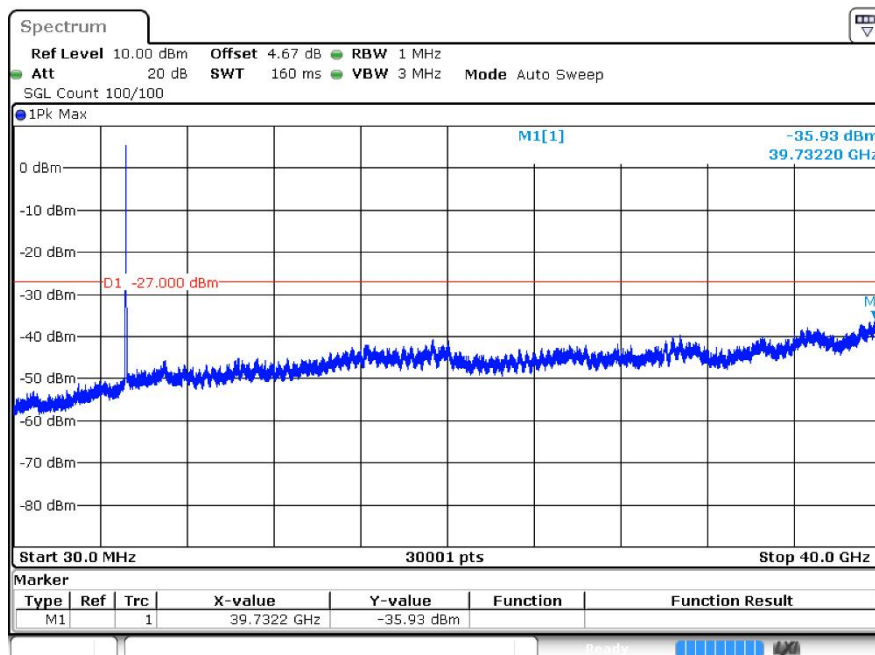




Tx. Spuriousac40 5230MHz Ant1

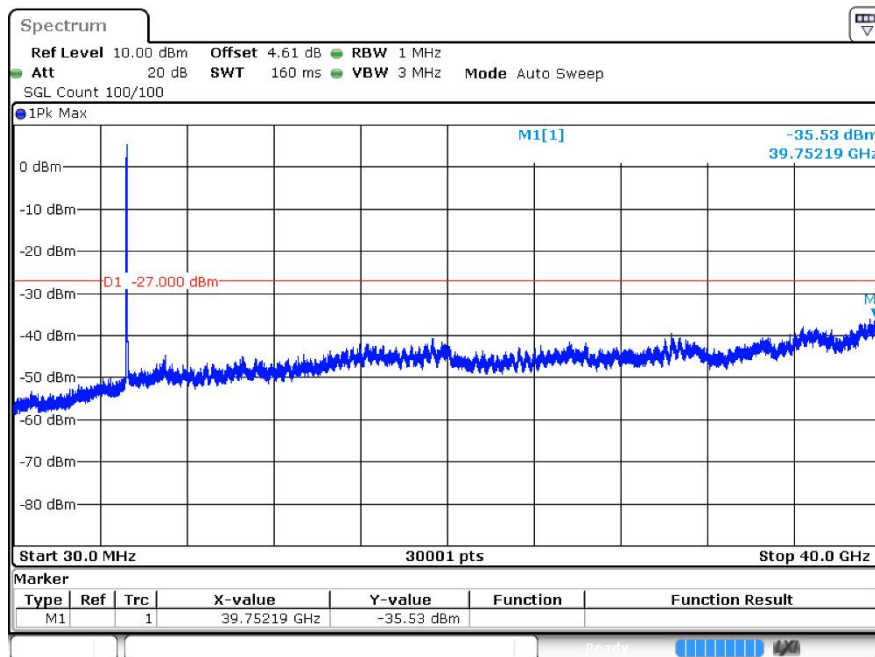

Tx. Spuriousac80 5210MHz Ant1

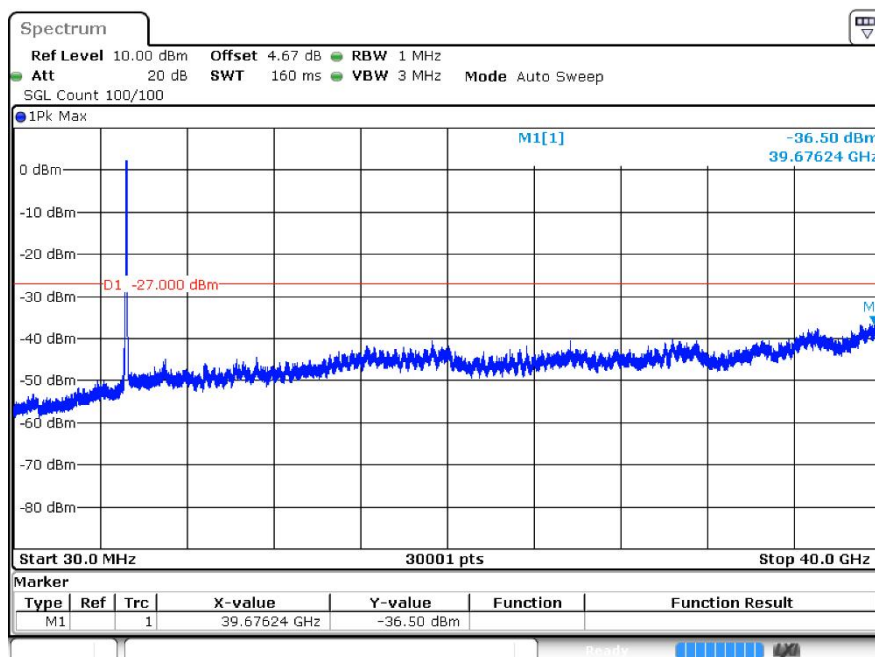



8 Restrict Band


8.1 Test Result

Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
a	5180	Ant1	4500	-45.3	5.0	-	54.93	Peak	68.2	Pass
a	5180	Ant1	4500	-53.27	5.0	0.6	47.56	Average	54	Pass
a	5180	Ant1	5078.9	-42.41	5.0	-	57.82	Peak	68.2	Pass
a	5180	Ant1	4958.5	-51.72	5.0	0.6	49.11	Average	54	Pass
a	5180	Ant1	5150	-45.77	5.0	-	54.46	Peak	68.2	Pass
a	5180	Ant1	5150	-52.68	5.0	0.6	48.15	Average	54	Pass
a	5240	Ant1	5350	-46.11	5.0	-	54.12	Peak	68.2	Pass
a	5240	Ant1	5350	-52.73	5.0	0.6	48.1	Average	54	Pass
a	5240	Ant1	5447.28	-41.55	5.0	-	58.68	Peak	68.2	Pass
a	5240	Ant1	5448.24	-50.21	5.0	0.6	50.62	Average	54	Pass
a	5240	Ant1	5460	-45.34	5.0	-	54.89	Peak	68.2	Pass
a	5240	Ant1	5460	-51.76	5.0	0.6	49.07	Average	54	Pass
n20	5180	Ant1	4500	-46.36	5.0	-	53.87	Peak	68.2	Pass
n20	5180	Ant1	4500	-53.44	5.0	0.57	47.36	Average	54	Pass
n20	5180	Ant1	4882.9	-42.18	5.0	-	58.05	Peak	68.2	Pass
n20	5180	Ant1	5149.6	-51.84	5.0	0.57	48.96	Average	54	Pass
n20	5180	Ant1	5150	-45.66	5.0	-	54.57	Peak	68.2	Pass
n20	5180	Ant1	5150	-52.08	5.0	0.57	48.72	Average	54	Pass
n20	5240	Ant1	5350	-46.46	5.0	-	53.77	Peak	68.2	Pass
n20	5240	Ant1	5350	-52.45	5.0	0.57	48.35	Average	54	Pass
n20	5240	Ant1	5355.36	-42.36	5.0	-	57.87	Peak	68.2	Pass
n20	5240	Ant1	5451.84	-50.54	5.0	0.57	50.26	Average	54	Pass
n20	5240	Ant1	5460	-44.9	5.0	-	55.33	Peak	68.2	Pass
n20	5240	Ant1	5460	-52.46	5.0	0.57	48.34	Average	54	Pass
n40	5190	Ant1	4500	-45.21	5.0	-	55.02	Peak	68.2	Pass
n40	5190	Ant1	4500	-54.1	5.0	0.55	46.68	Average	54	Pass
n40	5190	Ant1	4947.49	-41.68	5.0	-	58.55	Peak	68.2	Pass
n40	5190	Ant1	5149.7	-51.68	5.0	0.55	49.1	Average	54	Pass
n40	5190	Ant1	5150	-42.6	5.0	-	57.63	Peak	68.2	Pass
n40	5190	Ant1	5150	-52.56	5.0	0.55	48.22	Average	54	Pass
n40	5230	Ant1	5350	-45.66	5.0	-	54.57	Peak	68.2	Pass
n40	5230	Ant1	5350	-52.09	5.0	0.55	48.69	Average	54	Pass
n40	5230	Ant1	5450.28	-42.22	5.0	-	58.01	Peak	68.2	Pass
n40	5230	Ant1	5447.31	-50.17	5.0	0.55	50.61	Average	54	Pass
n40	5230	Ant1	5460	-43.45	5.0	-	56.78	Peak	68.2	Pass




n40	5230	Ant1	5460	-51.92	5.0	0.55	48.86	Average	54	Pass
ac20	5180	Ant1	4500	-46.06	5.0	-	54.17	Peak	68.2	Pass
ac20	5180	Ant1	4500	-53.88	5.0	0.6	46.95	Average	54	Pass
ac20	5180	Ant1	5087.3	-41.48	5.0	-	58.75	Peak	68.2	Pass
ac20	5180	Ant1	4974.6	-51.77	5.0	0.6	49.06	Average	54	Pass
ac20	5180	Ant1	5150	-42.77	5.0	-	57.46	Peak	68.2	Pass
ac20	5180	Ant1	5150	-52.43	5.0	0.6	48.4	Average	54	Pass
ac20	5240	Ant1	5350	-44.82	5.0	-	55.41	Peak	68.2	Pass
ac20	5240	Ant1	5350	-52.41	5.0	0.6	48.42	Average	54	Pass
ac20	5240	Ant1	5454	-41.06	5.0	-	59.17	Peak	68.2	Pass
ac20	5240	Ant1	5449.2	-50.11	5.0	0.6	50.72	Average	54	Pass
ac20	5240	Ant1	5460	-43.91	5.0	-	56.32	Peak	68.2	Pass
ac20	5240	Ant1	5460	-52.05	5.0	0.6	48.78	Average	54	Pass
ac40	5190	Ant1	4500	-44.98	5.0	-	55.25	Peak	68.2	Pass
ac40	5190	Ant1	4500	-53.15	5.0	0.6	47.68	Average	54	Pass
ac40	5190	Ant1	5048.96	-42.54	5.0	-	57.69	Peak	68.2	Pass
ac40	5190	Ant1	5059.18	-51.47	5.0	0.6	49.36	Average	54	Pass
ac40	5190	Ant1	5150	-42.78	5.0	-	57.45	Peak	68.2	Pass
ac40	5190	Ant1	5150	-51.97	5.0	0.6	48.86	Average	54	Pass
ac40	5230	Ant1	5350	-45.56	5.0	-	54.67	Peak	68.2	Pass
ac40	5230	Ant1	5350	-52.4	5.0	0.6	48.43	Average	54	Pass
ac40	5230	Ant1	5447.31	-42.28	5.0	-	57.95	Peak	68.2	Pass
ac40	5230	Ant1	5448.93	-50.17	5.0	0.6	50.66	Average	54	Pass
ac40	5230	Ant1	5460	-44.45	5.0	-	55.78	Peak	68.2	Pass
ac40	5230	Ant1	5460	-52.09	5.0	0.6	48.74	Average	54	Pass
ac80	5210	Ant1	4500	-45.3	5.0	-	54.93	Peak	68.2	Pass
ac80	5210	Ant1	4500	-52.99	5.0	0.59	47.83	Average	54	Pass
ac80	5210	Ant1	5130.42	-40.72	5.0	-	59.51	Peak	68.2	Pass
ac80	5210	Ant1	5143.85	-51.53	5.0	0.59	49.29	Average	54	Pass
ac80	5210	Ant1	5150	-43.13	5.0	-	57.1	Peak	68.2	Pass
ac80	5210	Ant1	5150	-51.26	5.0	0.59	49.56	Average	54	Pass


8.2 Test Graphs

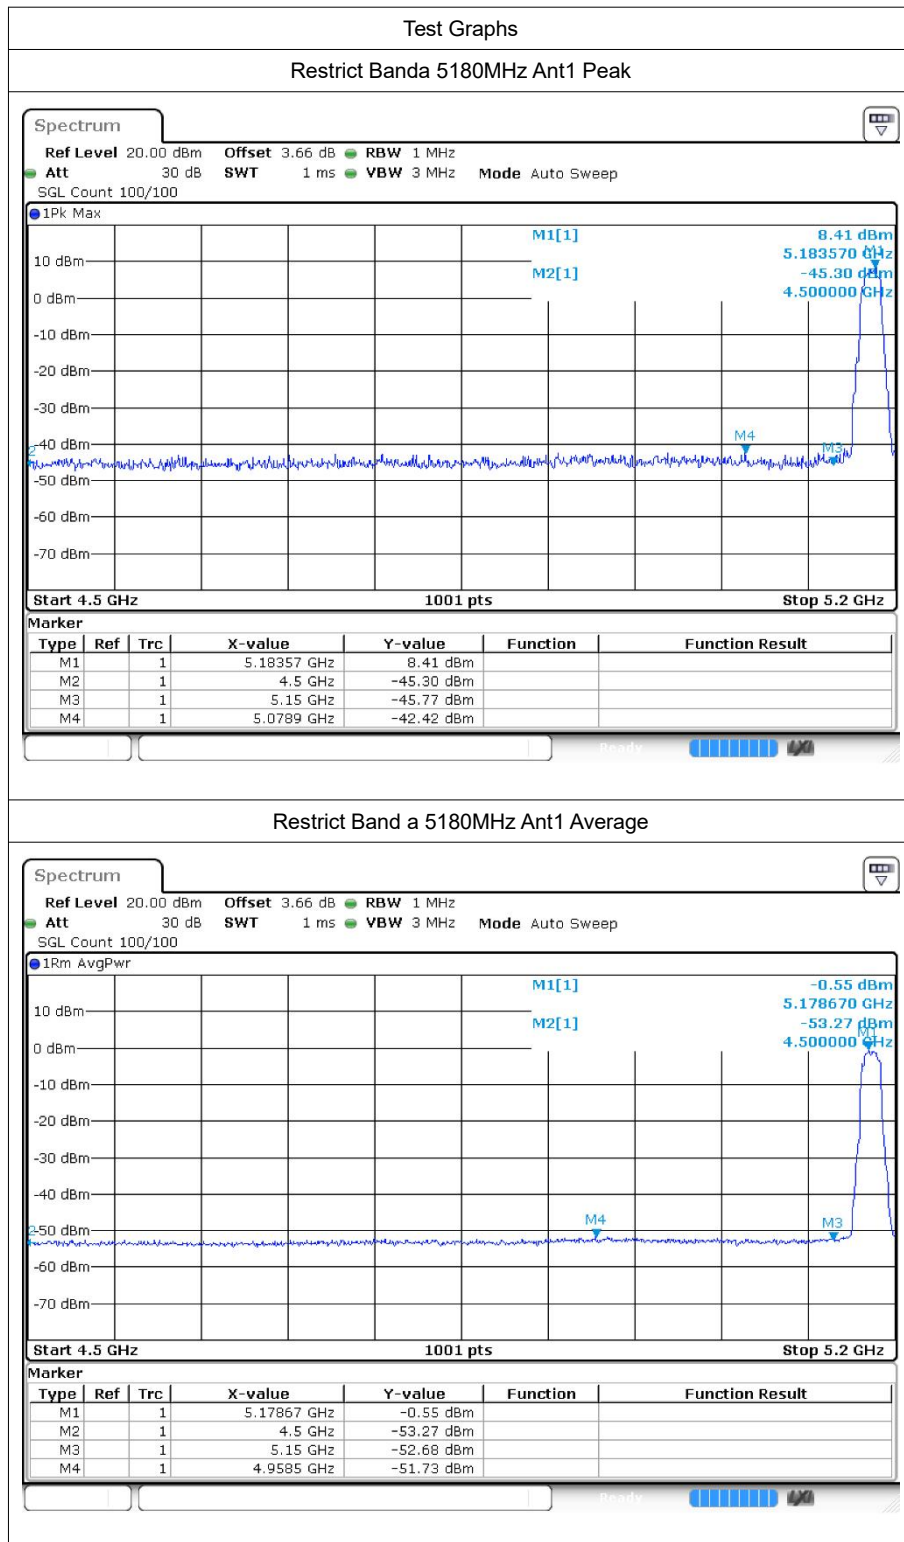


Restrict Banda 5240MHz Ant1 Peak

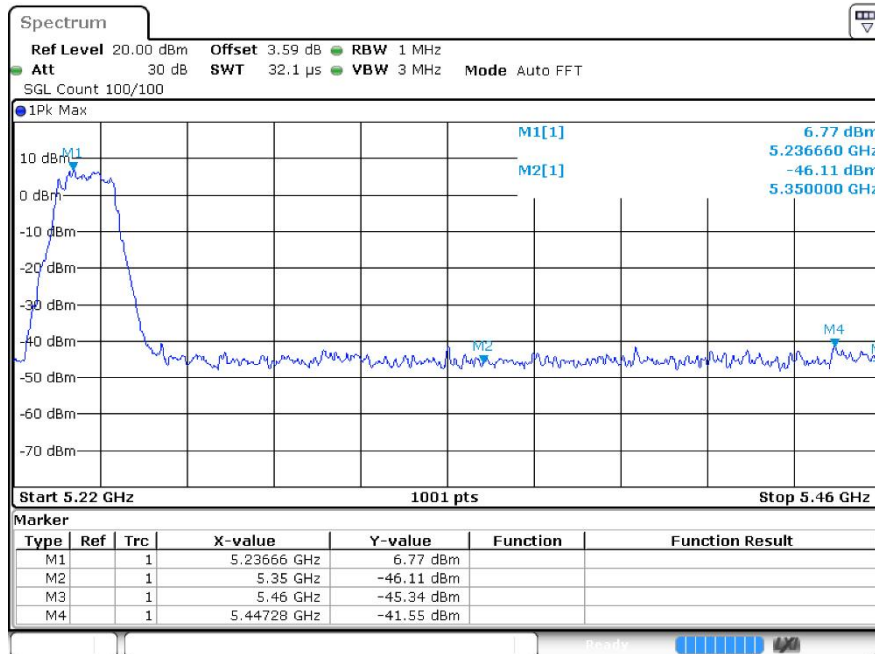


Restrict Band a 5240MHz Ant1 Average

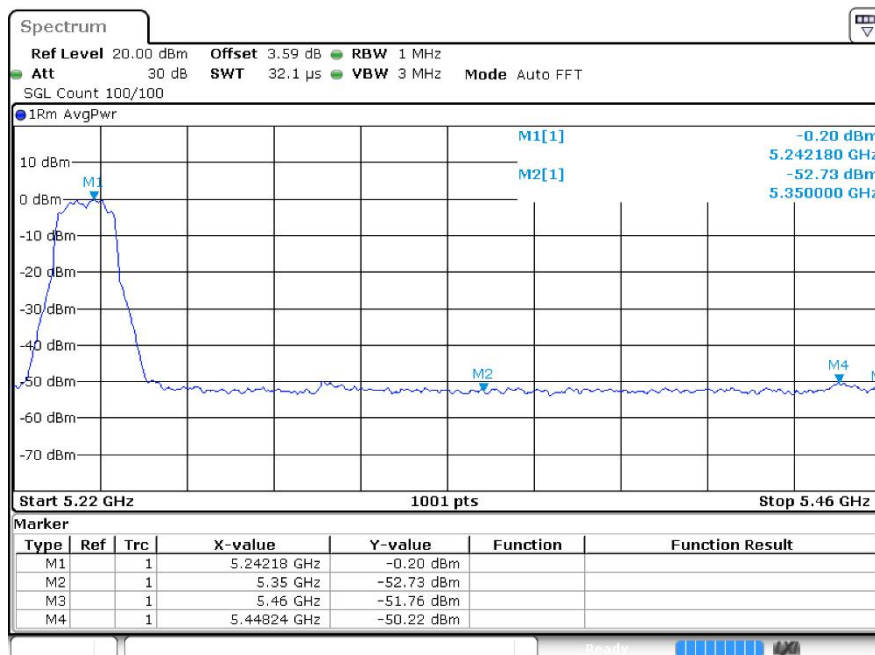


Restrict Bandn20 5180MHz Ant1 Peak

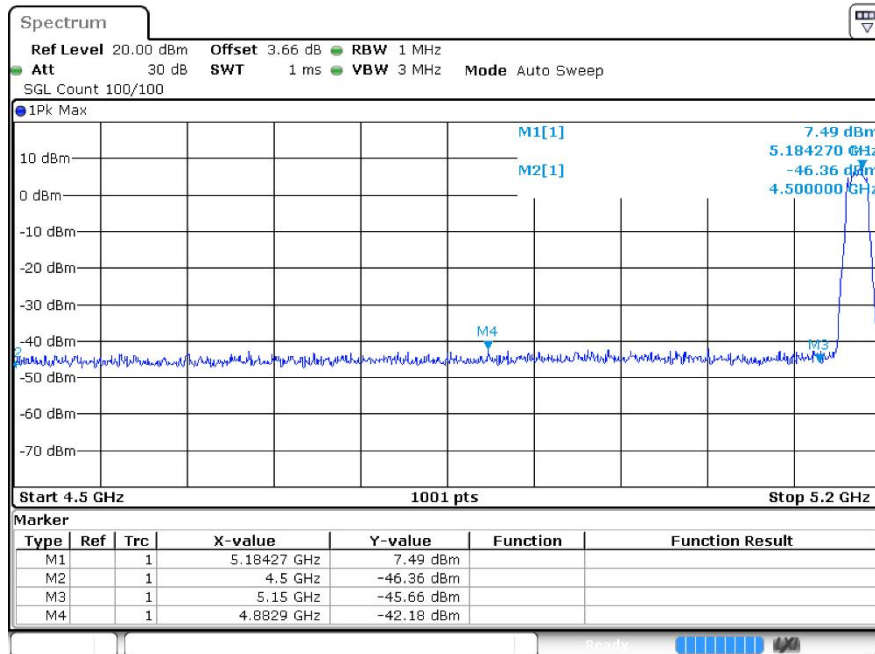


Restrict Band n20 5180MHz Ant1 Average

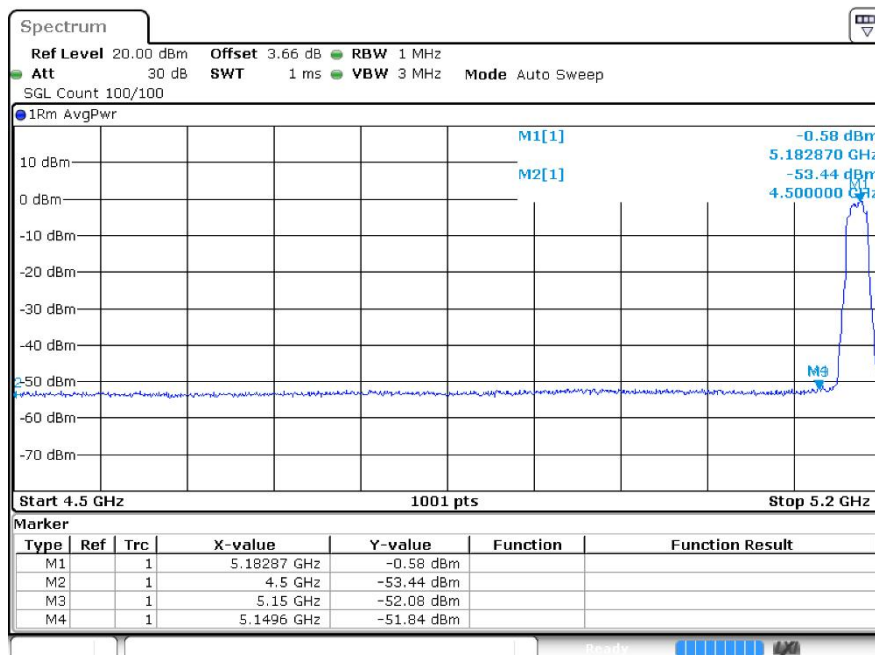


Restrict Bandn20 5240MHz Ant1 Peak

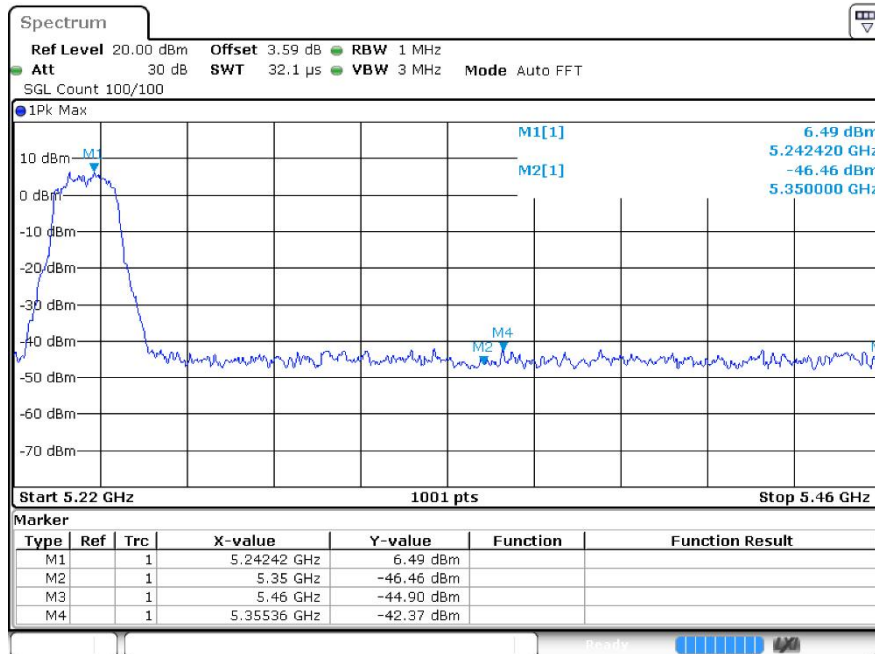


Restrict Band n20 5240MHz Ant1 Average

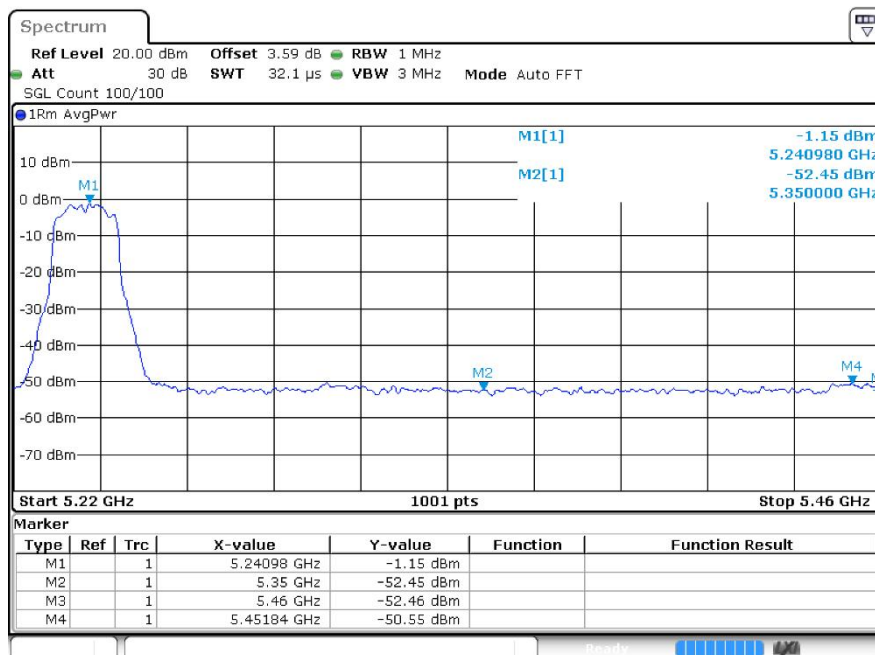


Restrict Bandn40 5190MHz Ant1 Peak

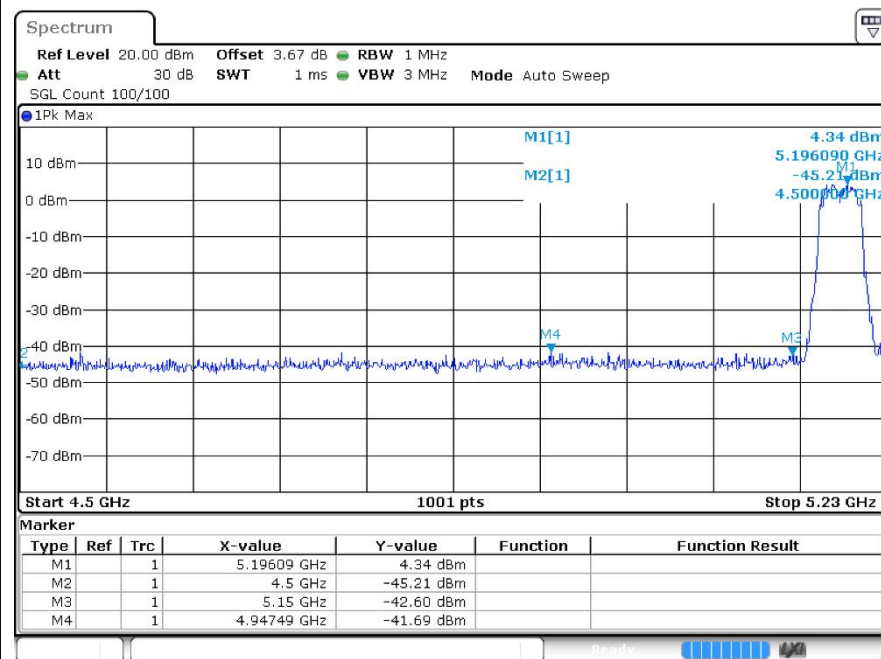


Restrict Band n40 5190MHz Ant1 Average

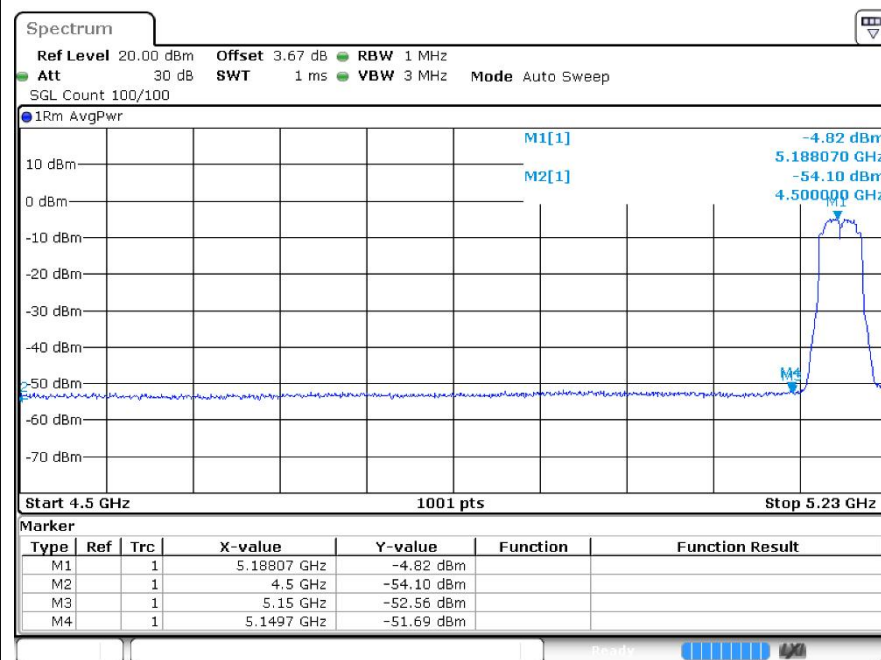

Restrict Bandn40 5230MHz Ant1 Peak

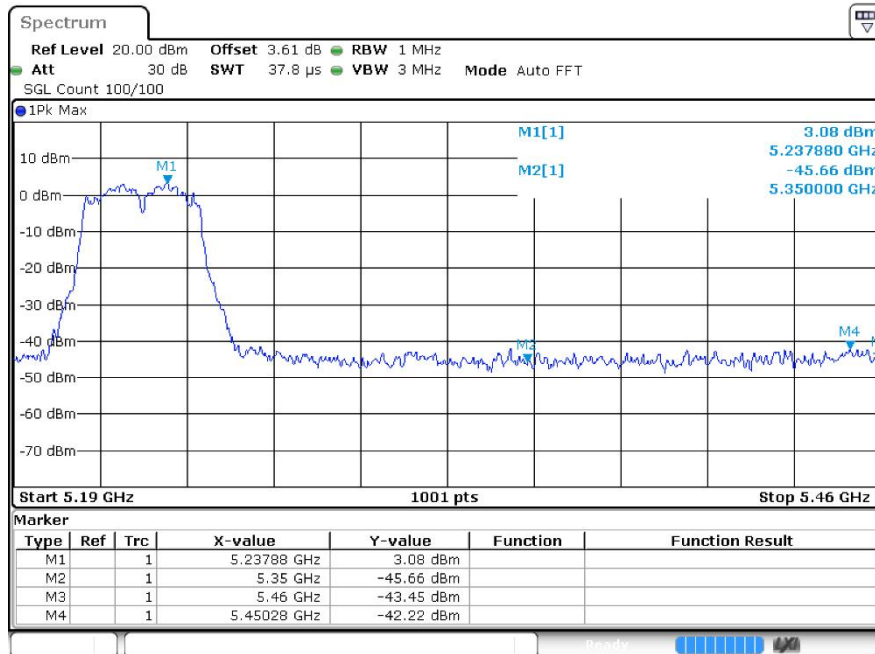


Restrict Band n40 5230MHz Ant1 Average

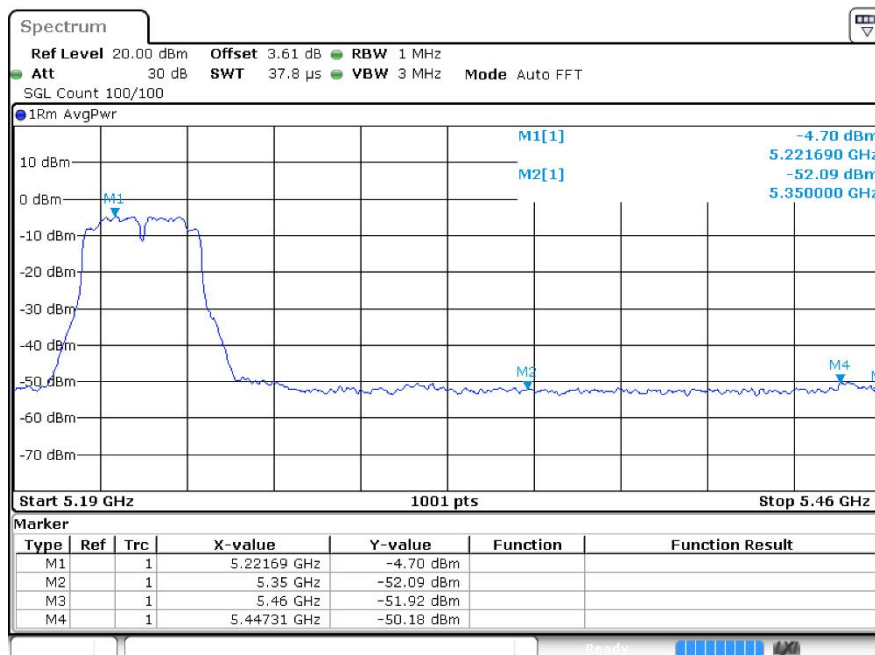




Restrict Bandac20 5180MHz Ant1 Peak

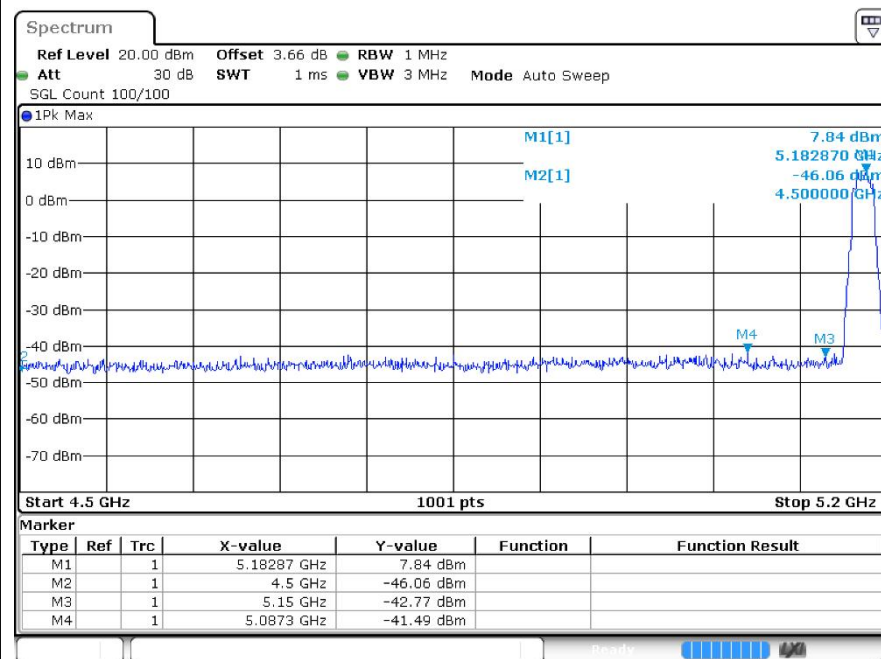


Restrict Band ac20 5180MHz Ant1 Average

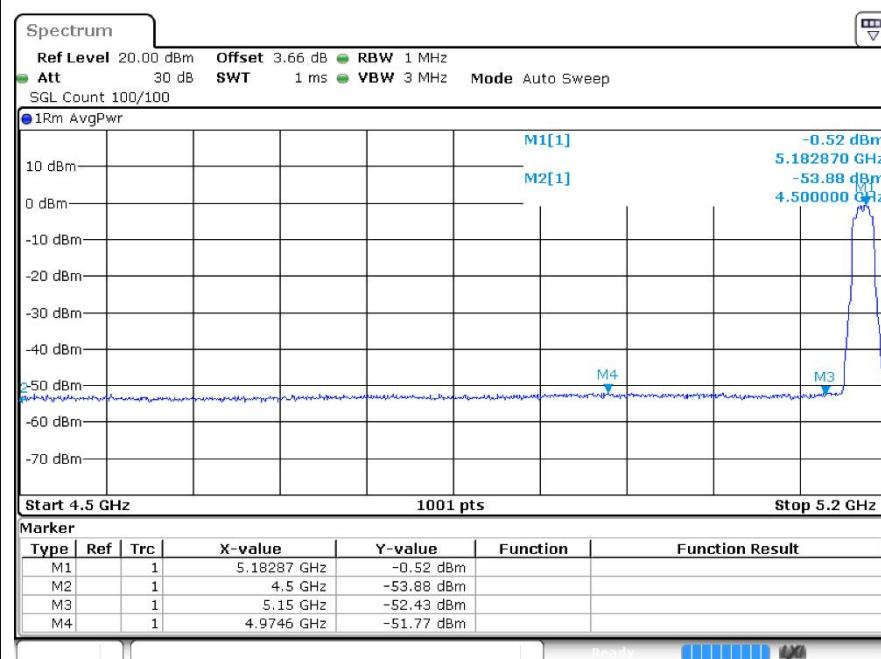




Restrict Bandac20 5240MHz Ant1 Peak

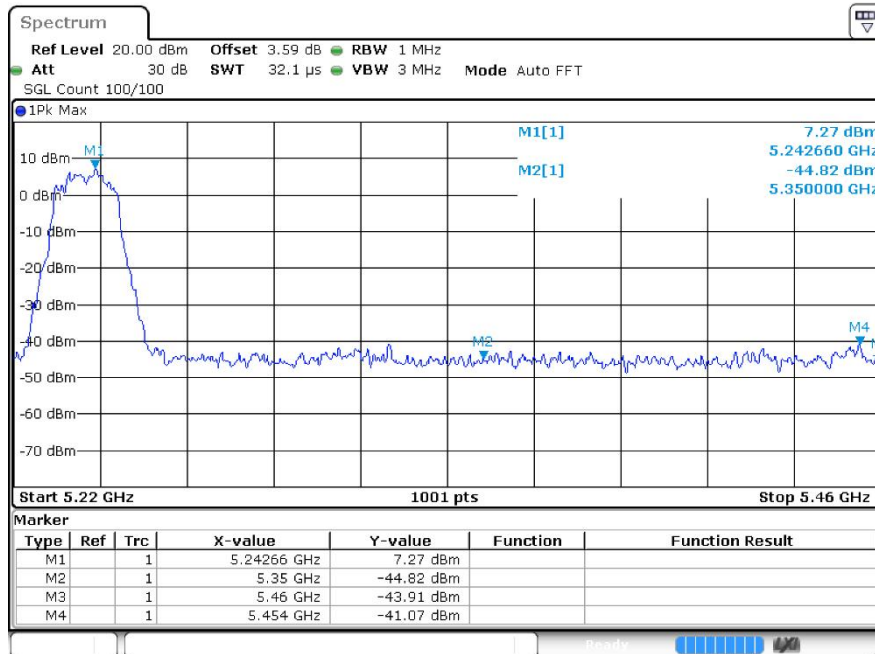


Restrict Band ac20 5240MHz Ant1 Average

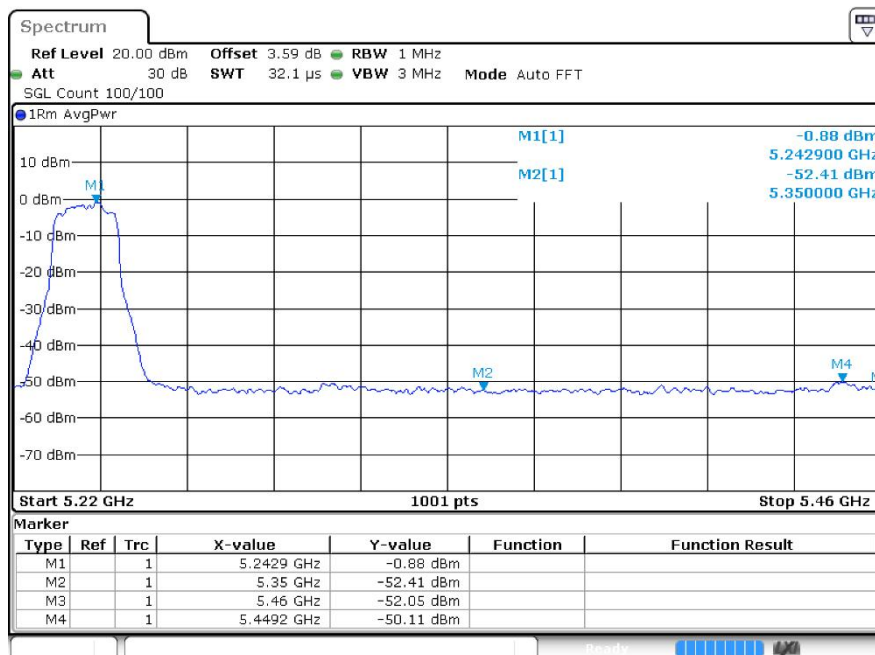





Restrict Bandac40 5190MHz Ant1 Peak

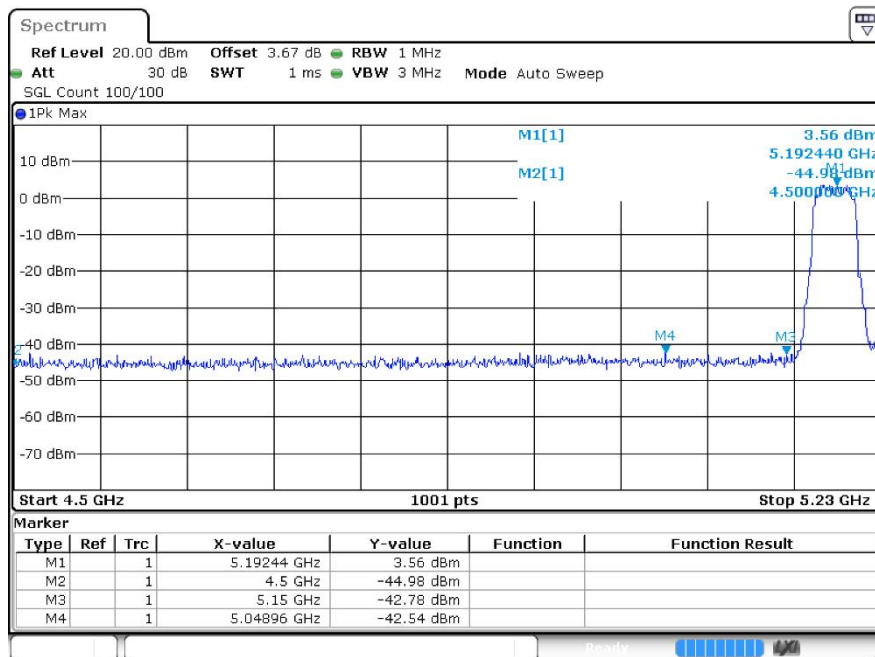


Restrict Band ac40 5190MHz Ant1 Average

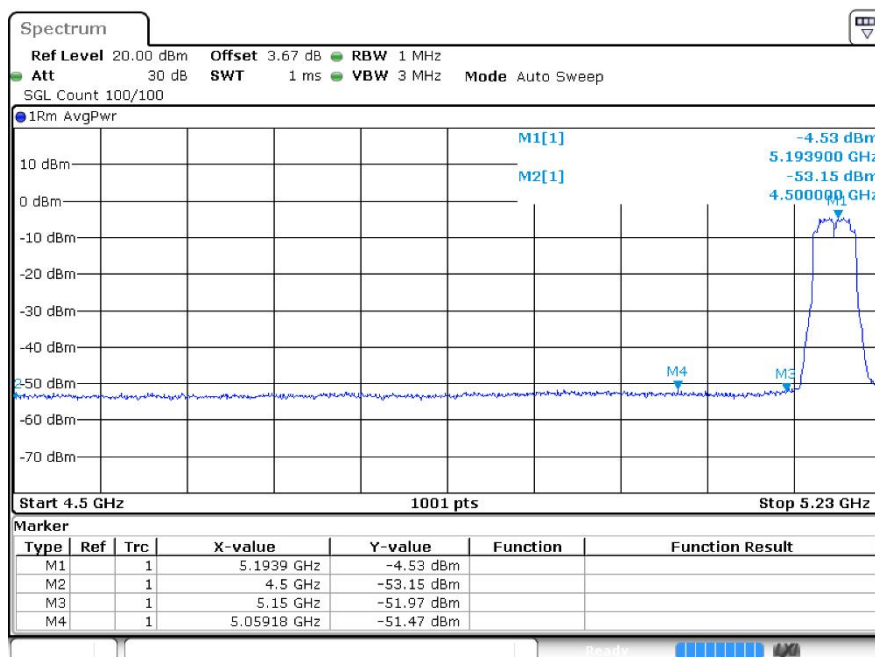


Restrict Bandac40 5230MHz Ant1 Peak

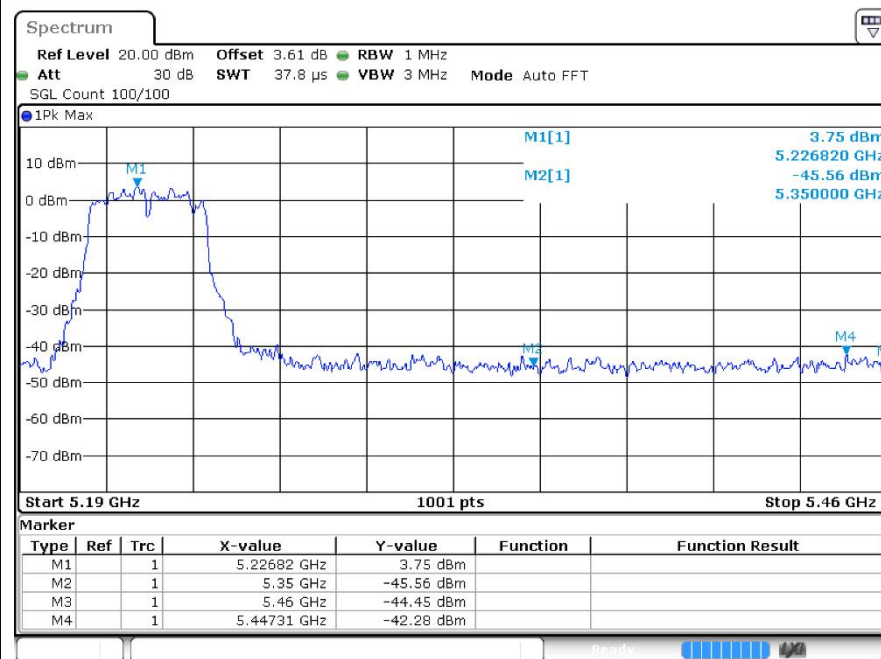

Restrict Band ac40 5230MHz Ant1 Average

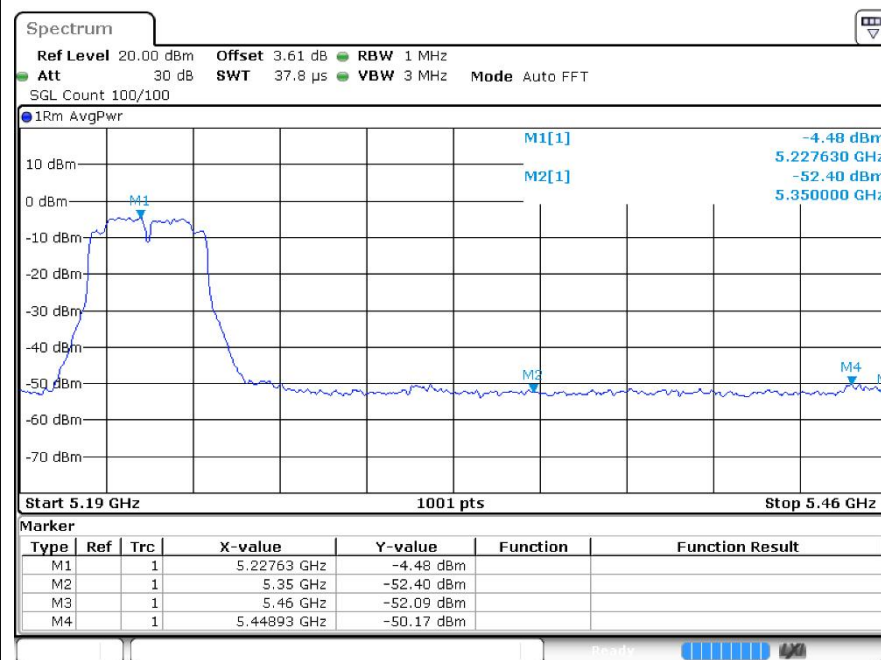

Restrict Bandac80 5210MHz Ant1 Peak

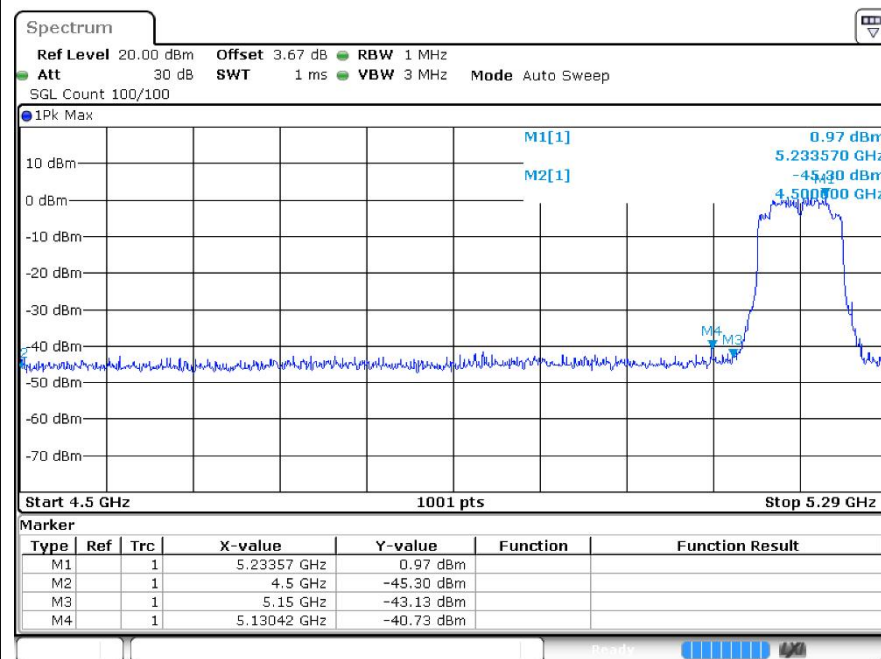

Restrict Band ac80 5210MHz Ant1 Average

