


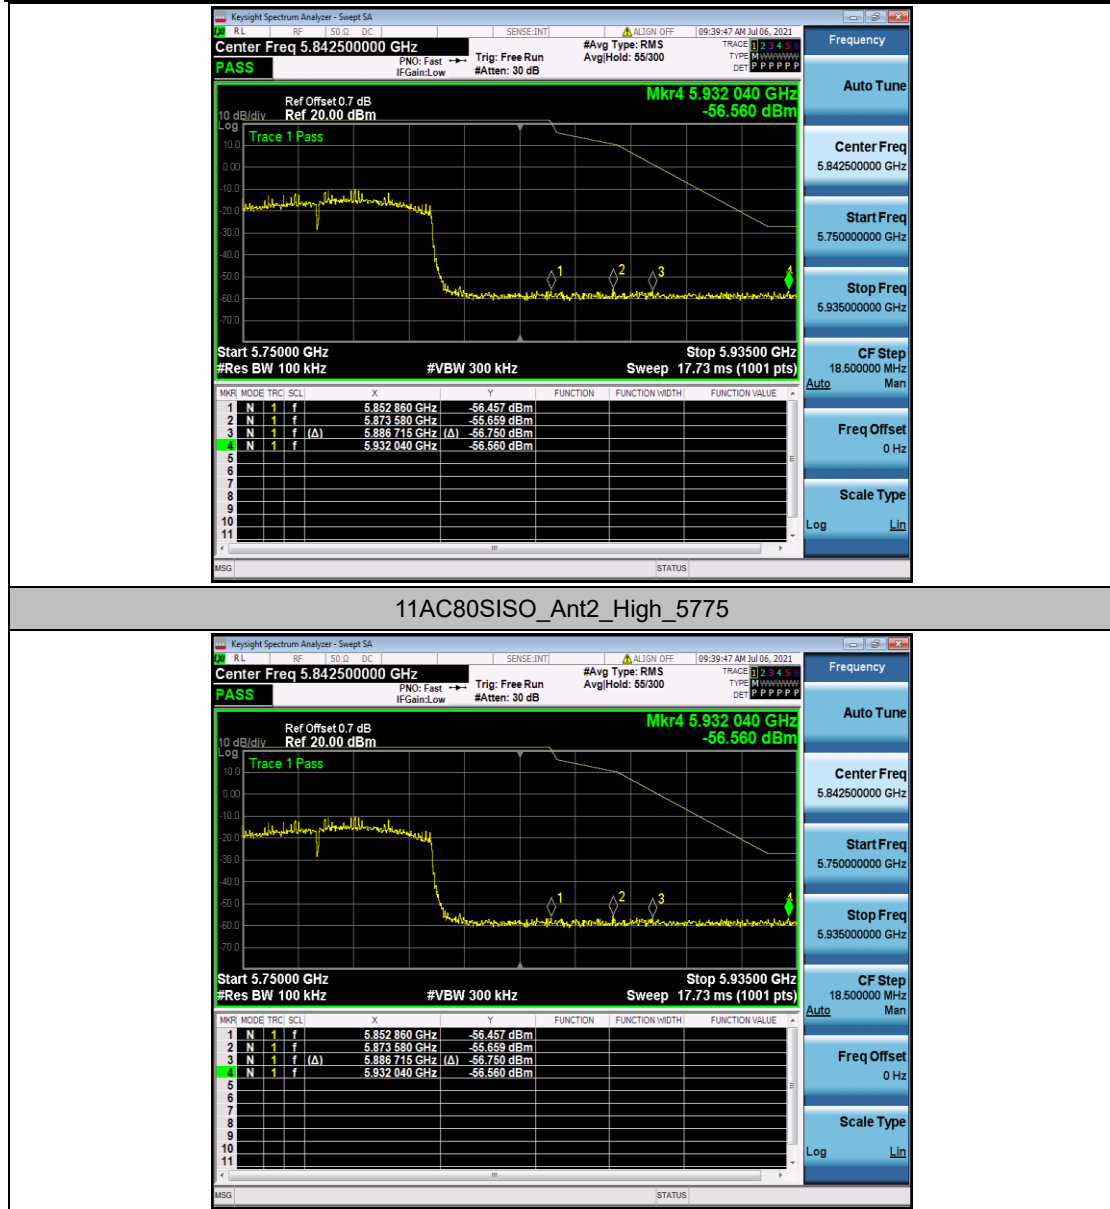

Appendix E: Conducted Spurious Emission

Test Result

TestMode	Antenna	Channel	FreqRange [MHz]	Max. Fre [MHz]	Max. Level [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	30~5140	30~5140	-54.219	<=-27	PASS
			5360~40000	5360~40000	-48.954	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-55.095	<=-27	PASS
			5360~40000	5360~40000	-48.047	<=-27	PASS
	Ant1	5220	30~5140	30~5140	-54.935	<=-27	PASS
			5360~40000	5360~40000	-48.281	<=-27	PASS
	Ant2	5220	30~5140	30~5140	-55.586	<=-27	PASS
			5360~40000	5360~40000	-48.554	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-54.234	<=-27	PASS
			5360~40000	5360~40000	-48.953	<=-27	PASS
	Ant2	5240	30~5140	30~5140	-55.826	<=-27	PASS
			5360~40000	5360~40000	-48.254	<=-27	PASS
	Ant1	5260	30~5140	30~5140	-55.47	<=-27	PASS
			5360~40000	5360~40000	-48.128	<=-27	PASS
	Ant2	5260	30~5140	30~5140	-55.632	<=-27	PASS
			5360~40000	5360~40000	-49.029	<=-27	PASS
	Ant1	5300	30~5140	30~5140	-54.762	<=-27	PASS
			5360~40000	5360~40000	-48.043	<=-27	PASS
	Ant2	5300	30~5140	30~5140	-54.714	<=-27	PASS
			5360~40000	5360~40000	-48.178	<=-27	PASS
	Ant1	5320	30~5140	30~5140	-54.63	<=-27	PASS
			5360~40000	5360~40000	-48.755	<=-27	PASS
	Ant2	5320	30~5140	30~5140	-55.027	<=-27	PASS
			5360~40000	5360~40000	-47.843	<=-27	PASS
	Ant1	5500	30~5460	30~5460	-56.082	<=-27	PASS
			5735~40000	5735~40000	-48.352	<=-27	PASS
	Ant2	5500	30~5460	30~5460	-55.828	<=-27	PASS
			5735~40000	5735~40000	-48.561	<=-27	PASS
	Ant1	5580	30~5460	30~5460	-55.319	<=-27	PASS
			5735~40000	5735~40000	-48.78	<=-27	PASS
	Ant2	5580	30~5460	30~5460	-54.789	<=-27	PASS
			5735~40000	5735~40000	-49.045	<=-27	PASS

	Ant1	5700	30~5460	30~5460	-55.494	<=-27	PASS
			5735~40000	5735~40000	-48.708	<=-27	PASS
	Ant2	5700	30~5460	30~5460	-56.128	<=-27	PASS
			5735~40000	5735~40000	-48.574	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-54.546	<=-27	PASS
			5925~40000	5925~40000	-47.466	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-54.858	<=-27	PASS
			5925~40000	5925~40000	-48.384	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-53.418	<=-27	PASS
			5925~40000	5925~40000	-48.704	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-55.393	<=-27	PASS
			5925~40000	5925~40000	-48.748	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-55.644	<=-27	PASS
			5925~40000	5925~40000	-48.316	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-54.998	<=-27	PASS
			5925~40000	5925~40000	-49.193	<=-27	PASS
11N20SISO	Ant1	5180	30~5140	30~5140	-54.822	<=-27	PASS
			5360~40000	5360~40000	-48.686	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-55.966	<=-27	PASS
			5360~40000	5360~40000	-49.202	<=-27	PASS
	Ant1	5220	30~5140	30~5140	-54.436	<=-27	PASS
			5360~40000	5360~40000	-48.721	<=-27	PASS
	Ant2	5220	30~5140	30~5140	-55.031	<=-27	PASS
			5360~40000	5360~40000	-48.962	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-54.915	<=-27	PASS
			5360~40000	5360~40000	-48.439	<=-27	PASS
	Ant2	5240	30~5140	30~5140	-56.192	<=-27	PASS
			5360~40000	5360~40000	-48.823	<=-27	PASS
	Ant1	5260	30~5140	30~5140	-53.859	<=-27	PASS
			5360~40000	5360~40000	-48.176	<=-27	PASS
	Ant2	5260	30~5140	30~5140	-56.008	<=-27	PASS
			5360~40000	5360~40000	-47.992	<=-27	PASS
	Ant1	5300	30~5140	30~5140	-54.523	<=-27	PASS
			5360~40000	5360~40000	-48.227	<=-27	PASS
	Ant2	5300	30~5140	30~5140	-56.074	<=-27	PASS
			5360~40000	5360~40000	-48.207	<=-27	PASS
	Ant1	5320	30~5140	30~5140	-55.372	<=-27	PASS
			5360~40000	5360~40000	-48.552	<=-27	PASS

	Ant2	5320	30~5140	30~5140	-54.684	<=-27	PASS
			5360~40000	5360~40000	-48.712	<=-27	PASS
	Ant1	5500	30~5460	30~5460	-55.069	<=-27	PASS
			5735~40000	5735~40000	-49.315	<=-27	PASS
	Ant2	5500	30~5460	30~5460	-55.405	<=-27	PASS
			5735~40000	5735~40000	-48.805	<=-27	PASS
	Ant1	5580	30~5460	30~5460	-55.677	<=-27	PASS
			5735~40000	5735~40000	-48.42	<=-27	PASS
	Ant2	5580	30~5460	30~5460	-55.85	<=-27	PASS
			5735~40000	5735~40000	-48.171	<=-27	PASS
	Ant1	5700	30~5460	30~5460	-55.429	<=-27	PASS
			5735~40000	5735~40000	-48.727	<=-27	PASS
	Ant2	5700	30~5460	30~5460	-55.517	<=-27	PASS
			5735~40000	5735~40000	-48.221	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-54.27	<=-27	PASS
			5925~40000	5925~40000	-48.991	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-55.09	<=-27	PASS
			5925~40000	5925~40000	-47.755	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-54.526	<=-27	PASS
			5925~40000	5925~40000	-48.157	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-54.769	<=-27	PASS
			5925~40000	5925~40000	-47.784	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-56.04	<=-27	PASS
			5925~40000	5925~40000	-48.553	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-55.315	<=-27	PASS
			5925~40000	5925~40000	-48.975	<=-27	PASS
11N40SISO	Ant1	5190	30~5140	30~5140	-54.276	<=-27	PASS
			5360~40000	5360~40000	-48.703	<=-27	PASS
	Ant2	5190	30~5140	30~5140	-55.212	<=-27	PASS
			5360~40000	5360~40000	-47.596	<=-27	PASS
	Ant1	5230	30~5140	30~5140	-53.678	<=-27	PASS
			5360~40000	5360~40000	-49.201	<=-27	PASS
	Ant2	5230	30~5140	30~5140	-55.676	<=-27	PASS
			5360~40000	5360~40000	-48.612	<=-27	PASS
	Ant1	5270	30~5140	30~5140	-54.835	<=-27	PASS
			5360~40000	5360~40000	-48.699	<=-27	PASS
	Ant2	5270	30~5140	30~5140	-54.987	<=-27	PASS
			5360~40000	5360~40000	-47.616	<=-27	PASS

	Ant1	5310	30~5140	30~5140	-55.503	<=-27	PASS
			5360~40000	5360~40000	-48.491	<=-27	PASS
	Ant2	5310	30~5140	30~5140	-56.135	<=-27	PASS
			5360~40000	5360~40000	-48.694	<=-27	PASS
	Ant1	5510	30~5460	30~5460	-55.673	<=-27	PASS
			5735~40000	5735~40000	-48.441	<=-27	PASS
	Ant2	5510	30~5460	30~5460	-55.268	<=-27	PASS
			5735~40000	5735~40000	-48.819	<=-27	PASS
	Ant1	5550	30~5460	30~5460	-55.682	<=-27	PASS
			5735~40000	5735~40000	-48.597	<=-27	PASS
	Ant2	5550	30~5460	30~5460	-56.096	<=-27	PASS
			5735~40000	5735~40000	-48.471	<=-27	PASS
	Ant1	5670	30~5460	30~5460	-55.482	<=-27	PASS
			5735~40000	5735~40000	-48.436	<=-27	PASS
	Ant2	5670	30~5460	30~5460	-55.881	<=-27	PASS
			5735~40000	5735~40000	-48.226	<=-27	PASS
	Ant1	5755	30~5650	30~5650	-54.526	<=-27	PASS
			5925~40000	5925~40000	-48.31	<=-27	PASS
	Ant2	5755	30~5650	30~5650	-54.926	<=-27	PASS
			5925~40000	5925~40000	-48.054	<=-27	PASS
	Ant1	5795	30~5650	30~5650	-55.886	<=-27	PASS
			5925~40000	5925~40000	-47.444	<=-27	PASS
	Ant2	5795	30~5650	30~5650	-55.549	<=-27	PASS
			5925~40000	5925~40000	-48.494	<=-27	PASS
11AC20SISO	Ant1	5180	30~5140	30~5140	-54.268	<=-27	PASS
			5360~40000	5360~40000	-48.759	<=-27	PASS
	Ant2	5180	30~5140	30~5140	-54.493	<=-27	PASS
			5360~40000	5360~40000	-48.257	<=-27	PASS
	Ant1	5220	30~5140	30~5140	-54.888	<=-27	PASS
			5360~40000	5360~40000	-48.956	<=-27	PASS
	Ant2	5220	30~5140	30~5140	-55.337	<=-27	PASS
			5360~40000	5360~40000	-48.768	<=-27	PASS
	Ant1	5240	30~5140	30~5140	-54.491	<=-27	PASS
			5360~40000	5360~40000	-49.174	<=-27	PASS
	Ant2	5240	30~5140	30~5140	-55.629	<=-27	PASS
			5360~40000	5360~40000	-47.681	<=-27	PASS
	Ant1	5260	30~5140	30~5140	-55.534	<=-27	PASS
			5360~40000	5360~40000	-47.919	<=-27	PASS

	Ant2	5260	30~5140	30~5140	-55.726	<=-27	PASS
			5360~40000	5360~40000	-47.502	<=-27	PASS
	Ant1	5300	30~5140	30~5140	-56.132	<=-27	PASS
			5360~40000	5360~40000	-47.878	<=-27	PASS
	Ant2	5300	30~5140	30~5140	-55.256	<=-27	PASS
			5360~40000	5360~40000	-48.15	<=-27	PASS
	Ant1	5320	30~5140	30~5140	-55.297	<=-27	PASS
			5360~40000	5360~40000	-48.993	<=-27	PASS
	Ant2	5320	30~5140	30~5140	-55.111	<=-27	PASS
			5360~40000	5360~40000	-49.213	<=-27	PASS
	Ant1	5500	30~5460	30~5460	-54.99	<=-27	PASS
			5735~40000	5735~40000	-48.396	<=-27	PASS
	Ant2	5500	30~5460	30~5460	-55.807	<=-27	PASS
			5735~40000	5735~40000	-48.16	<=-27	PASS
	Ant1	5580	30~5460	30~5460	-55.224	<=-27	PASS
			5735~40000	5735~40000	-47.966	<=-27	PASS
	Ant2	5580	30~5460	30~5460	-55.347	<=-27	PASS
			5735~40000	5735~40000	-48.144	<=-27	PASS
	Ant1	5700	30~5460	30~5460	-55.732	<=-27	PASS
			5735~40000	5735~40000	-48.787	<=-27	PASS
	Ant2	5700	30~5460	30~5460	-54.09	<=-27	PASS
			5735~40000	5735~40000	-47.958	<=-27	PASS
	Ant1	5745	30~5650	30~5650	-53.096	<=-27	PASS
			5925~40000	5925~40000	-48.639	<=-27	PASS
	Ant2	5745	30~5650	30~5650	-55.898	<=-27	PASS
			5925~40000	5925~40000	-48.768	<=-27	PASS
	Ant1	5785	30~5650	30~5650	-53.592	<=-27	PASS
			5925~40000	5925~40000	-48.331	<=-27	PASS
	Ant2	5785	30~5650	30~5650	-54.856	<=-27	PASS
			5925~40000	5925~40000	-47.308	<=-27	PASS
	Ant1	5825	30~5650	30~5650	-54.33	<=-27	PASS
			5925~40000	5925~40000	-48.66	<=-27	PASS
	Ant2	5825	30~5650	30~5650	-56.285	<=-27	PASS
			5925~40000	5925~40000	-48.946	<=-27	PASS
11AC40SISO	Ant1	5190	30~5140	30~5140	-55.271	<=-27	PASS
			5360~40000	5360~40000	-48.756	<=-27	PASS
	Ant2	5190	30~5140	30~5140	-55.67	<=-27	PASS
			5360~40000	5360~40000	-48.846	<=-27	PASS

	Ant1	5230	30~5140	30~5140	-51.057	<=-27	PASS
			5360~40000	5360~40000	-49.386	<=-27	PASS
	Ant2	5230	30~5140	30~5140	-55.29	<=-27	PASS
			5360~40000	5360~40000	-47.808	<=-27	PASS
	Ant1	5270	30~5140	30~5140	-52.674	<=-27	PASS
			5360~40000	5360~40000	-48.729	<=-27	PASS
	Ant2	5270	30~5140	30~5140	-55.945	<=-27	PASS
			5360~40000	5360~40000	-48.743	<=-27	PASS
	Ant1	5310	30~5140	30~5140	-55.052	<=-27	PASS
			5360~40000	5360~40000	-48.749	<=-27	PASS
	Ant2	5310	30~5140	30~5140	-56.041	<=-27	PASS
			5360~40000	5360~40000	-48.701	<=-27	PASS
	Ant1	5510	30~5460	30~5460	-55.678	<=-27	PASS
			5735~40000	5735~40000	-48.944	<=-27	PASS
	Ant2	5510	30~5460	30~5460	-55.823	<=-27	PASS
			5735~40000	5735~40000	-49.015	<=-27	PASS
	Ant1	5550	30~5460	30~5460	-55.735	<=-27	PASS
			5735~40000	5735~40000	-48.589	<=-27	PASS
	Ant2	5550	30~5460	30~5460	-55.285	<=-27	PASS
			5735~40000	5735~40000	-48.485	<=-27	PASS
	Ant1	5670	30~5460	30~5460	-55.601	<=-27	PASS
			5735~40000	5735~40000	-48.513	<=-27	PASS
	Ant2	5670	30~5460	30~5460	-55.521	<=-27	PASS
			5735~40000	5735~40000	-49.123	<=-27	PASS
	Ant1	5755	30~5650	30~5650	-53.509	<=-27	PASS
			5925~40000	5925~40000	-48.827	<=-27	PASS
	Ant2	5755	30~5650	30~5650	-55.235	<=-27	PASS
			5925~40000	5925~40000	-47.546	<=-27	PASS
	Ant1	5795	30~5650	30~5650	-53.445	<=-27	PASS
			5925~40000	5925~40000	-48.236	<=-27	PASS
	Ant2	5795	30~5650	30~5650	-55.419	<=-27	PASS
			5925~40000	5925~40000	-48.583	<=-27	PASS
11AC80SISO	Ant1	5210	30~5140	30~5140	-50.448	<=-27	PASS
			5360~40000	5360~40000	-47.949	<=-27	PASS
	Ant2	5210	30~5140	30~5140	-55.238	<=-27	PASS
			5360~40000	5360~40000	-48.574	<=-27	PASS
	Ant1	5290	30~5140	30~5140	-55.257	<=-27	PASS
			5360~40000	5360~40000	-47.703	<=-27	PASS





SGS-CSTC Standards Technical Services Co., Ltd.
Guangzhou Branch

Page: 315 of 496
Report No.: GZCR210502031703
FCC ID: 2AWD4-ECHTES101


	Ant2	5290	30~5140	30~5140	-56.196	<=-27	PASS
			5360~40000	5360~40000	-49.065	<=-27	PASS
	Ant1	5530	30~5460	30~5460	-54.764	<=-27	PASS
			5735~40000	5735~40000	-49.017	<=-27	PASS
	Ant2	5530	30~5460	30~5460	-55.646	<=-27	PASS
			5735~40000	5735~40000	-48.45	<=-27	PASS
	Ant1	5610	30~5460	30~5460	-55.581	<=-27	PASS
			5735~40000	5735~40000	-47.337	<=-27	PASS
	Ant2	5610	30~5460	30~5460	-55.57	<=-27	PASS
			5735~40000	5735~40000	-48.188	<=-27	PASS
	Ant1	5775	30~5650	30~5650	-55.214	<=-27	PASS
			5925~40000	5925~40000	-48.132	<=-27	PASS
	Ant2	5775	30~5650	30~5650	-54.596	<=-27	PASS
			5925~40000	5925~40000	-48.637	<=-27	PASS

Test Graphs

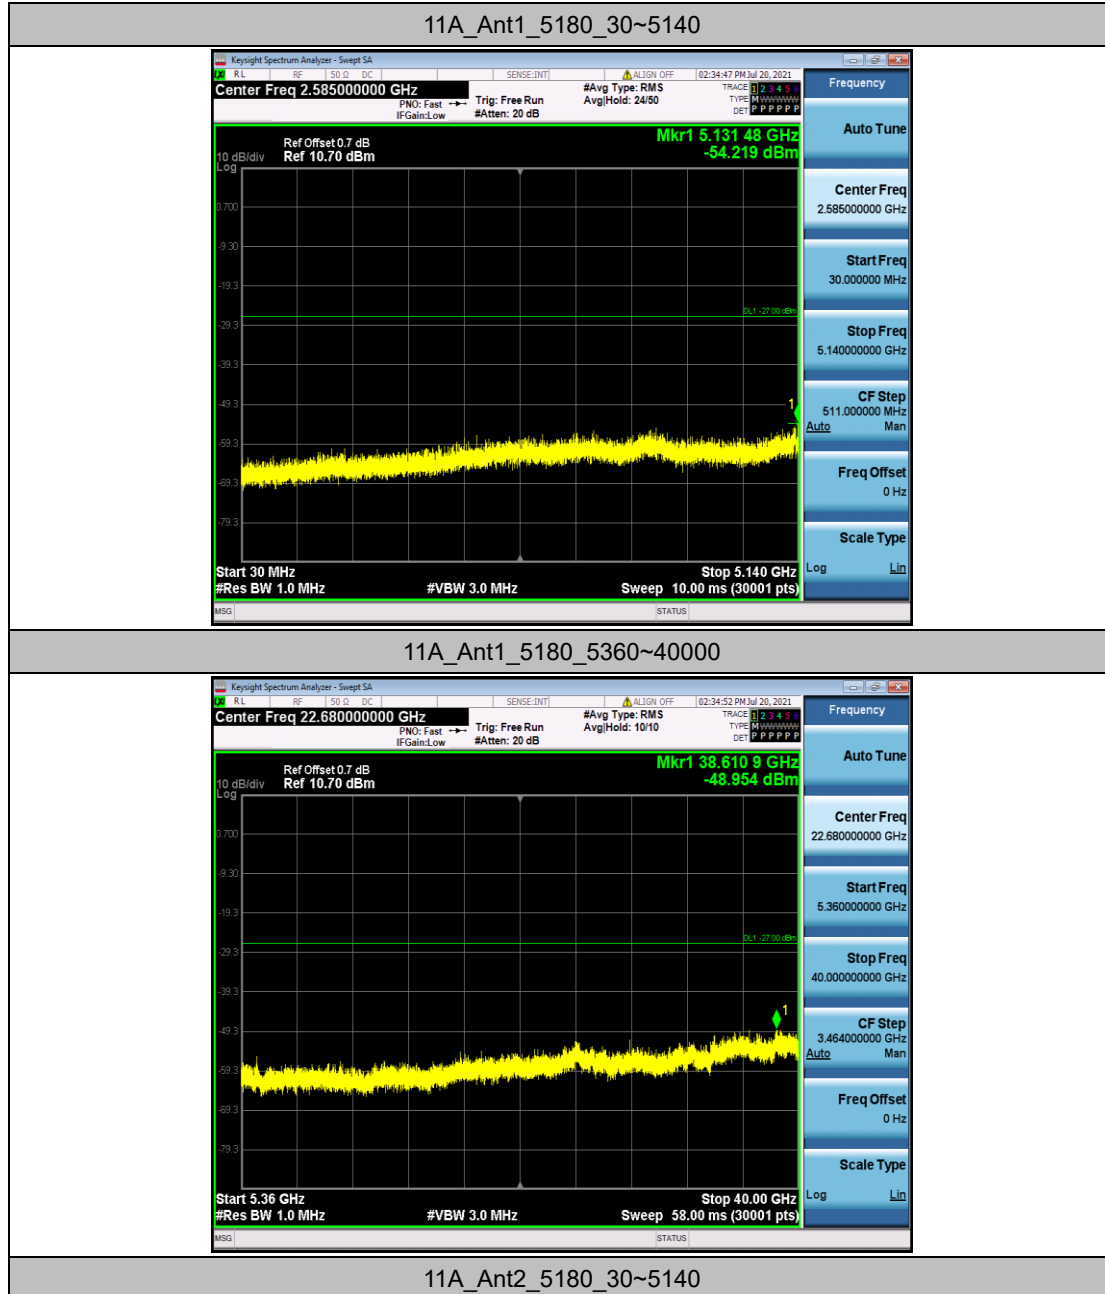


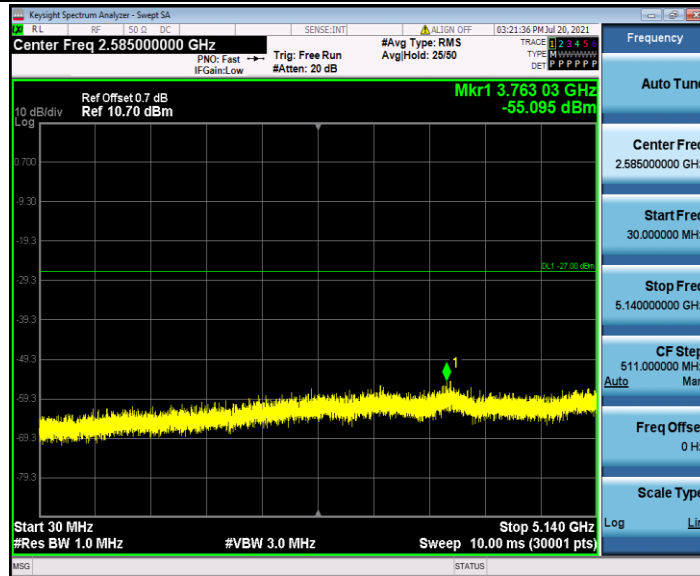


11A_Ant2_5180_5360~40000

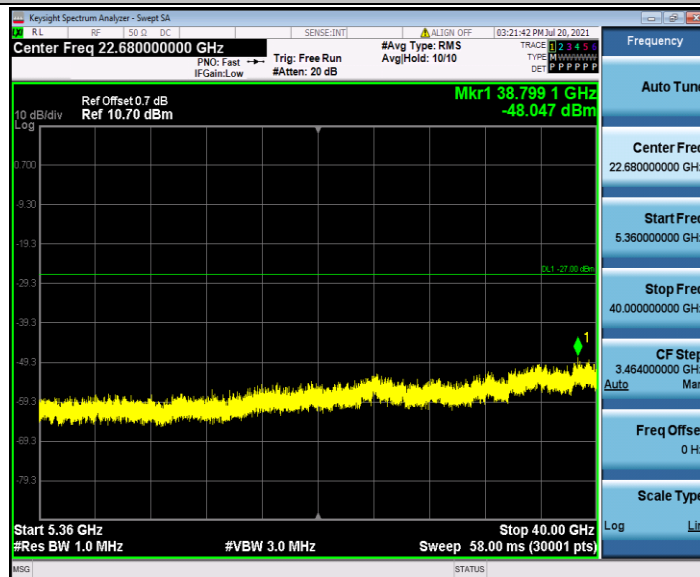


11A_Ant1_5220_30~5140

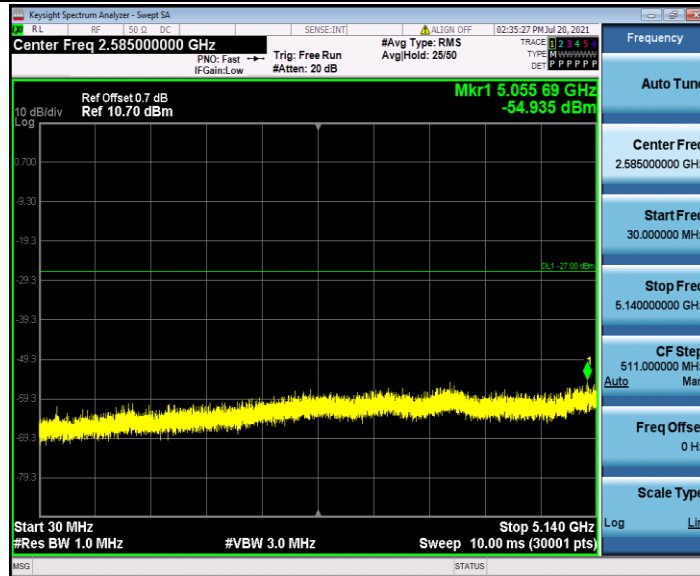


11A_Ant1_5220_5360~40000

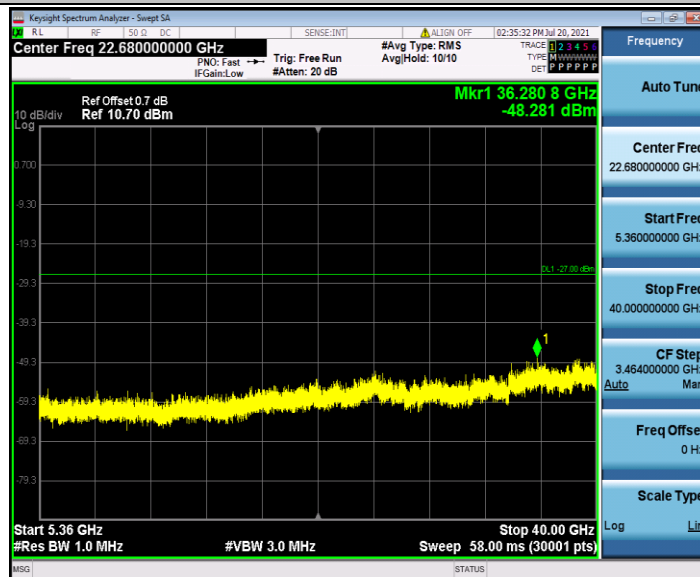


11A_Ant2_5220_30~5140

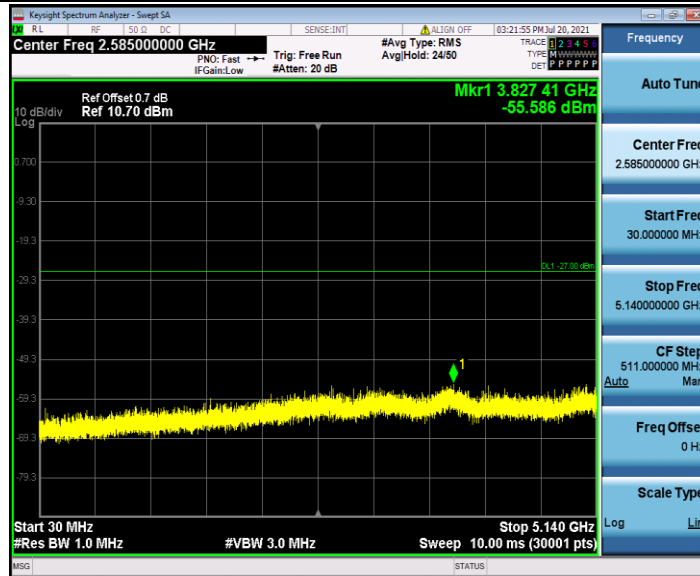


11A_Ant2_5220_5360~40000

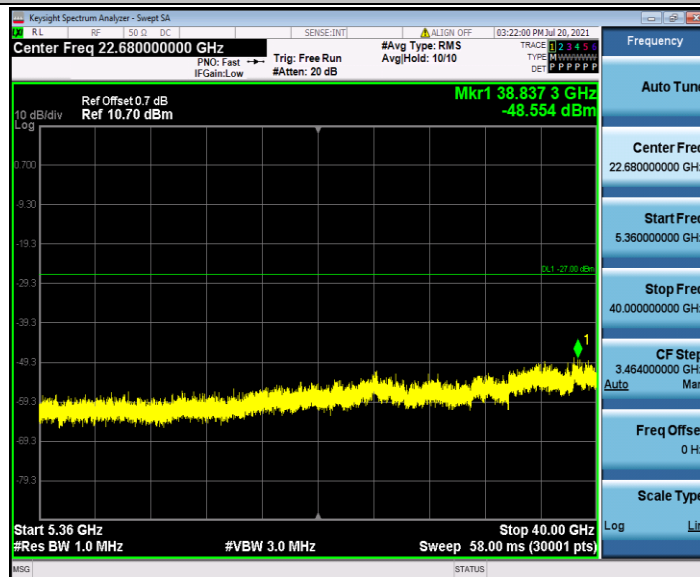


11A_Ant1_5240_30~5140

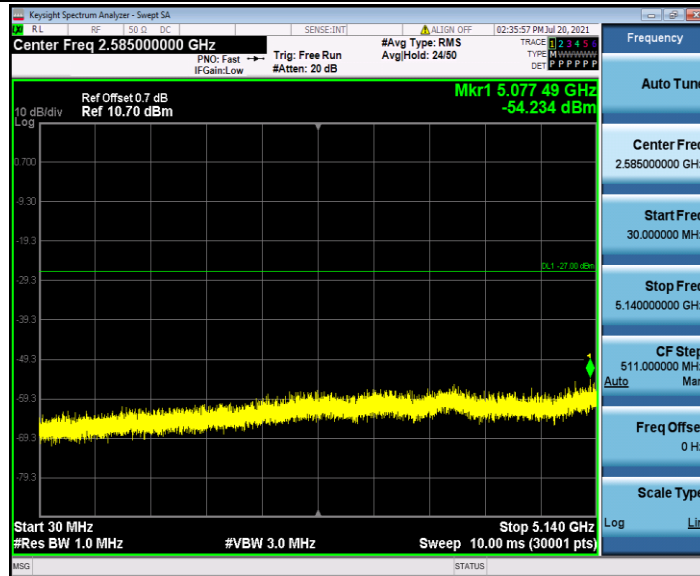


11A_Ant1_5240_5360~40000

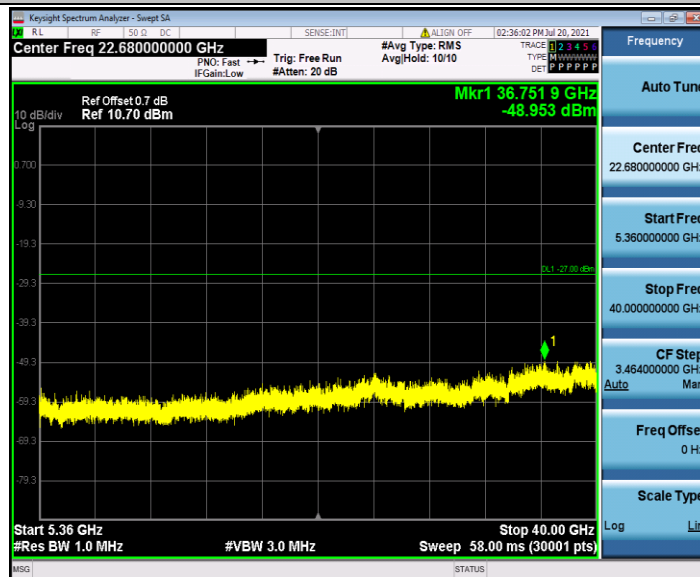


11A_Ant2_5240_30~5140

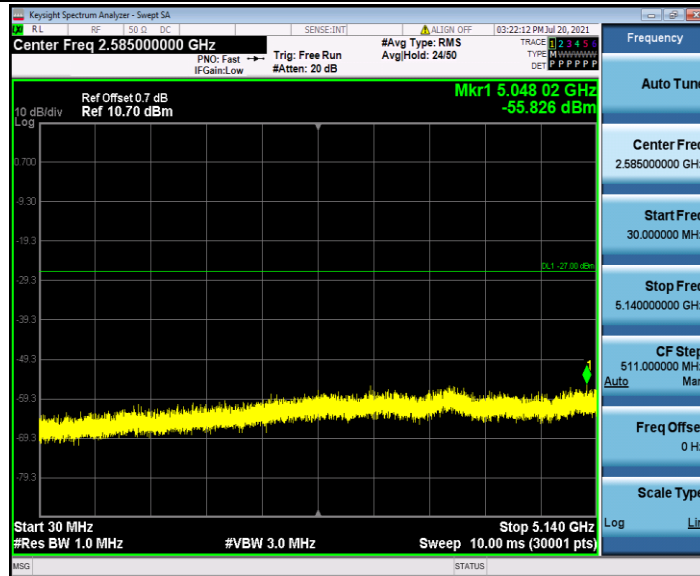


11A_Ant2_5240_5360~40000

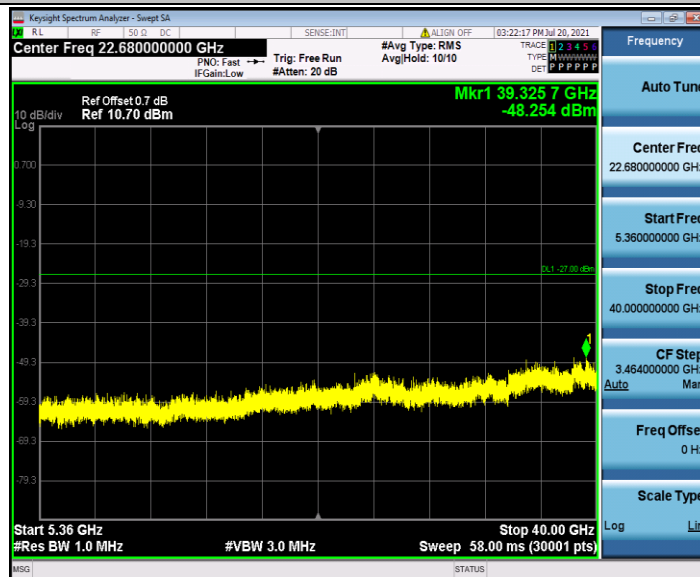


11A_Ant1_5260_30~5140

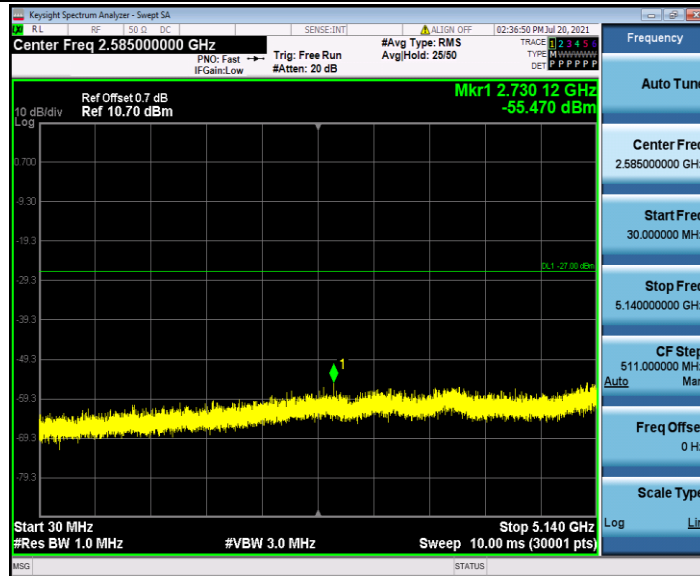


11A_Ant1_5260_5360~40000

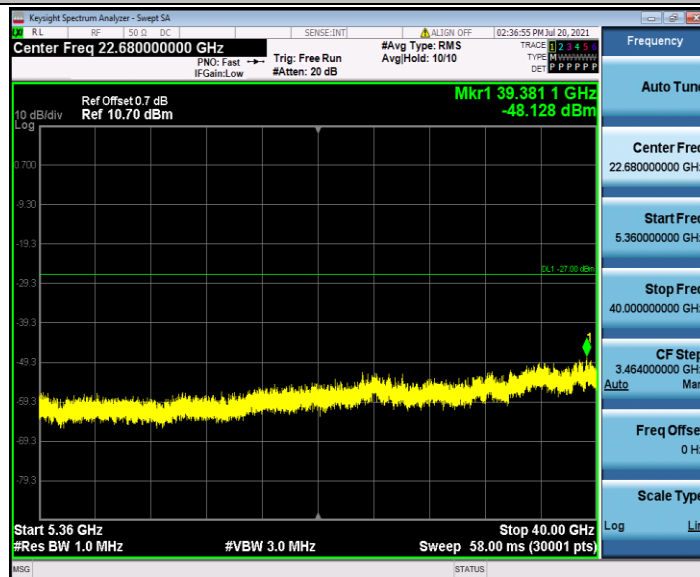


11A_Ant2_5260_30~5140

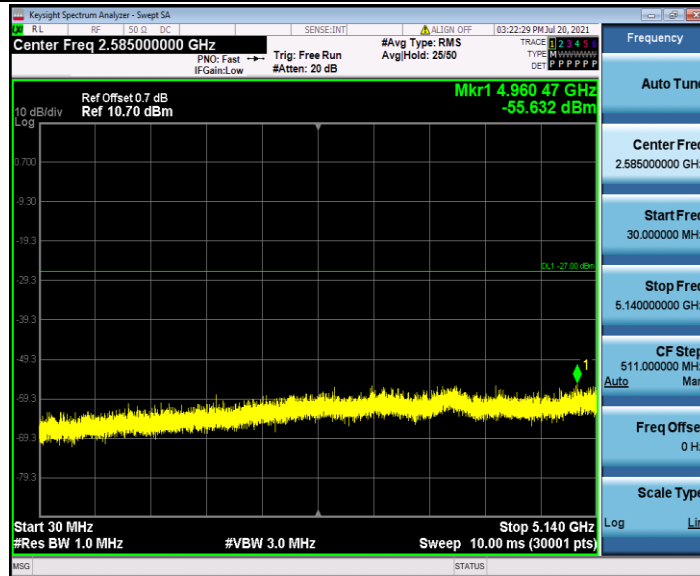


11A_Ant2_5260_5360~40000

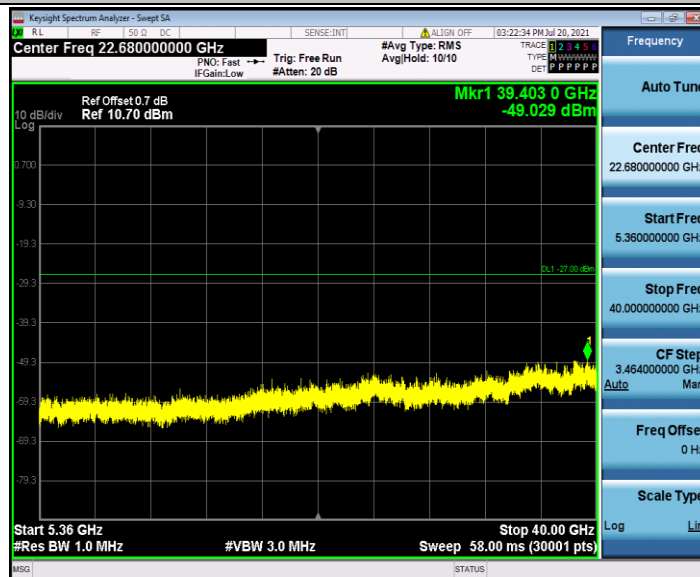


11A_Ant1_5300_30~5140

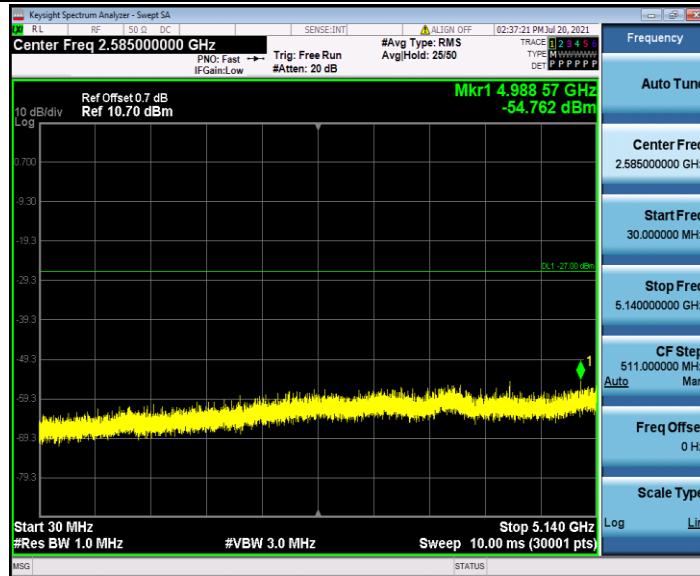


11A_Ant1_5300_5360~40000

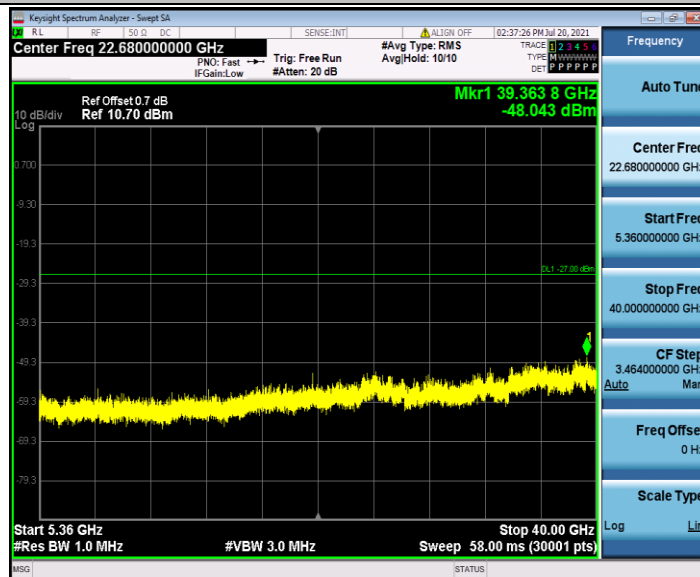


11A_Ant2_5300_30~5140

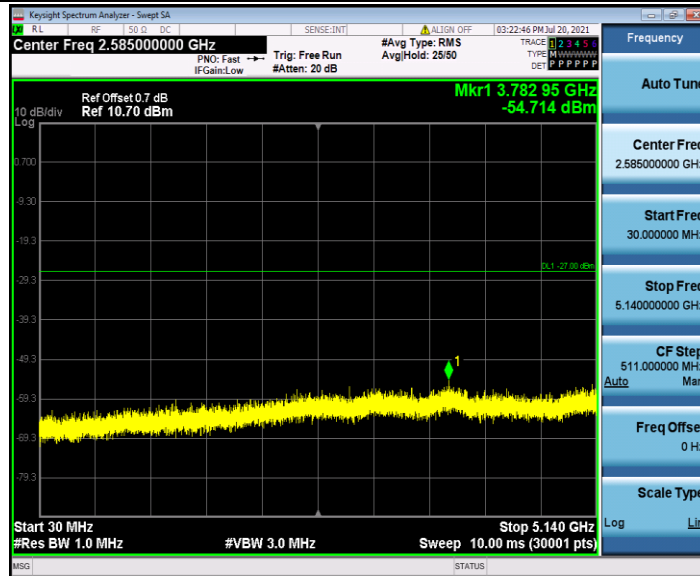


11A_Ant2_5300_5360~40000

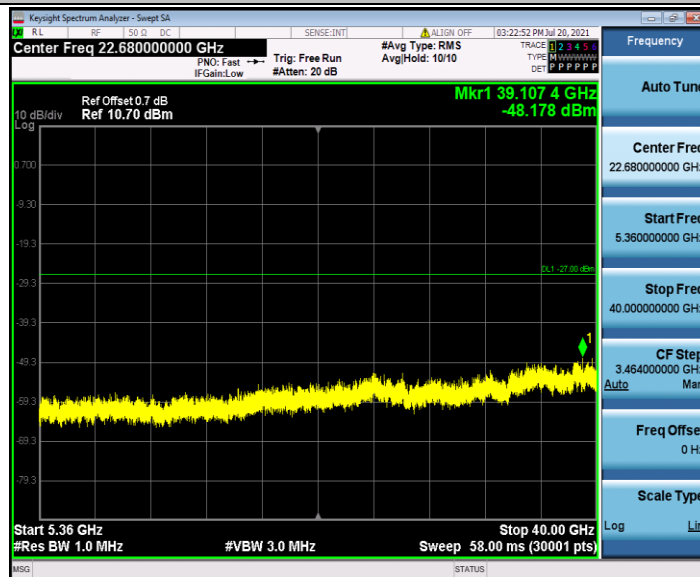


11A_Ant1_5320_30~5140

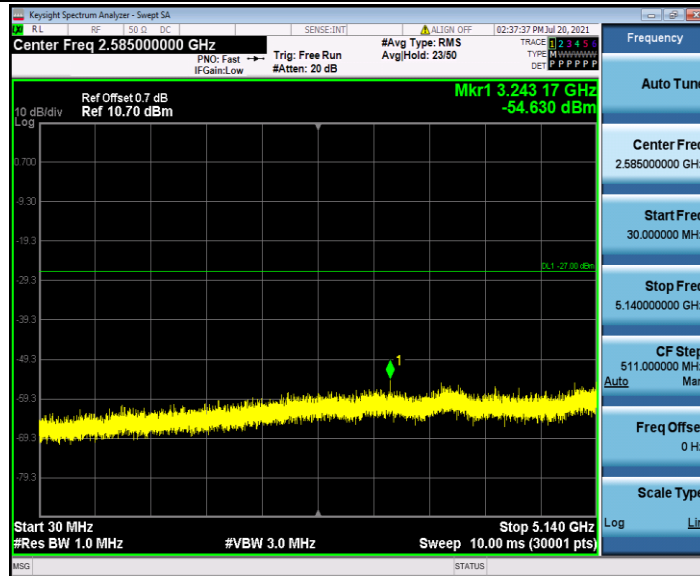


11A_Ant1_5320_5360~40000

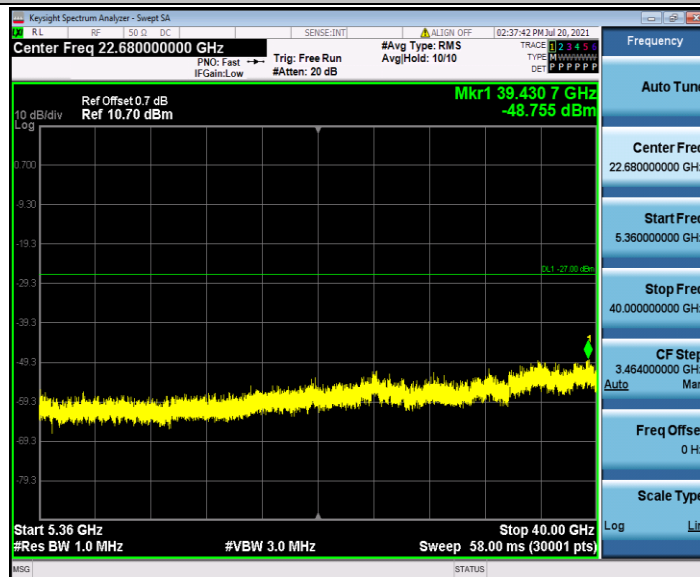


11A_Ant2_5320_30~5140

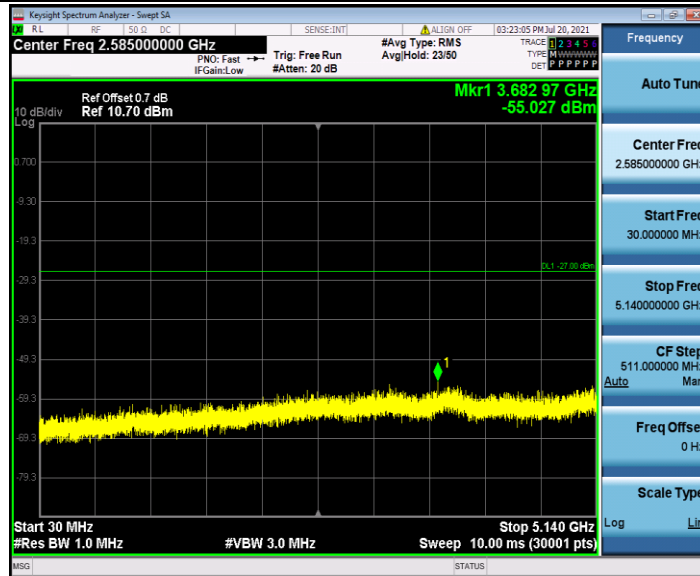


11A_Ant2_5320_5360~40000

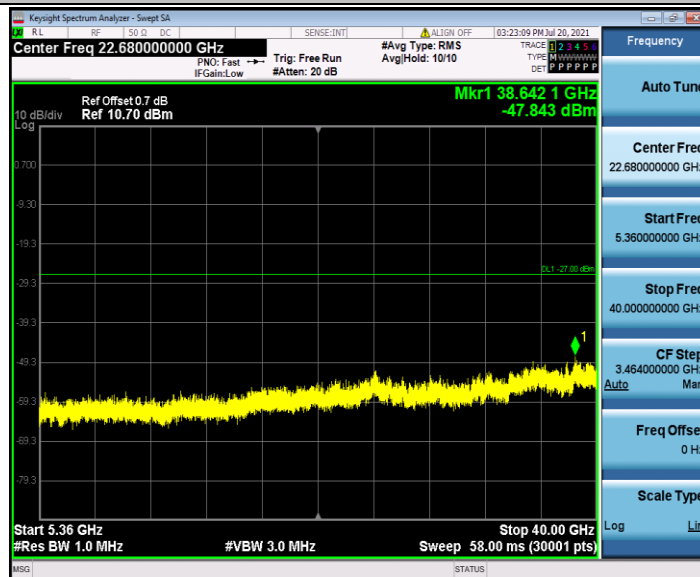


11A_Ant1_5500_30~5460

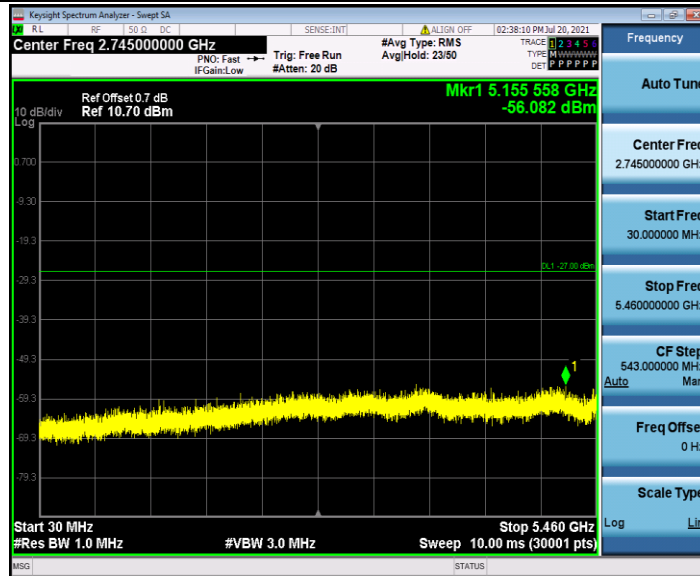


11A_Ant1_5500_5735~40000

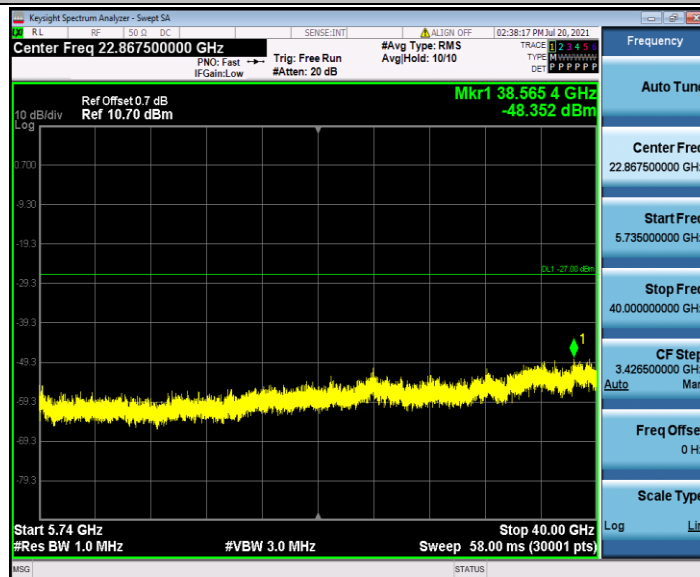


11A_Ant2_5500_30~5460

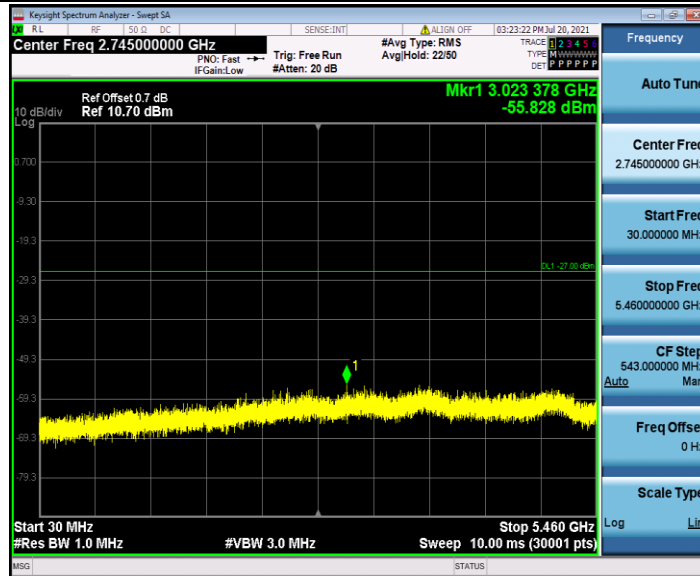

11A_Ant2_5500_5735~40000

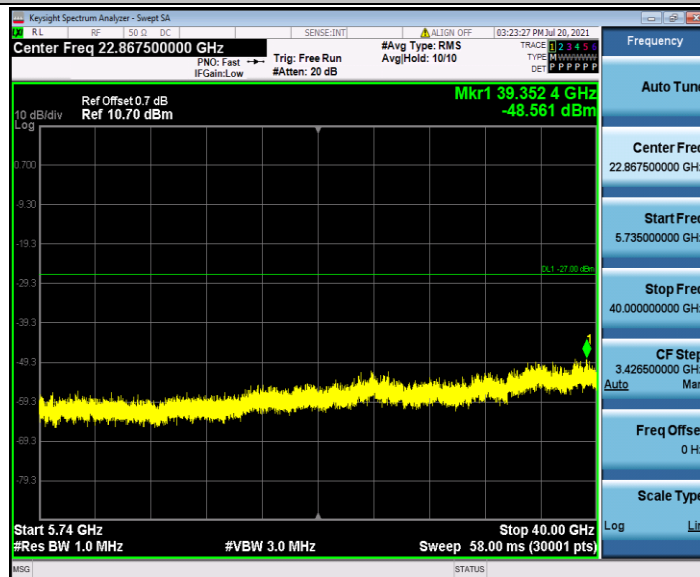


11A_Ant1_5580_30~5460

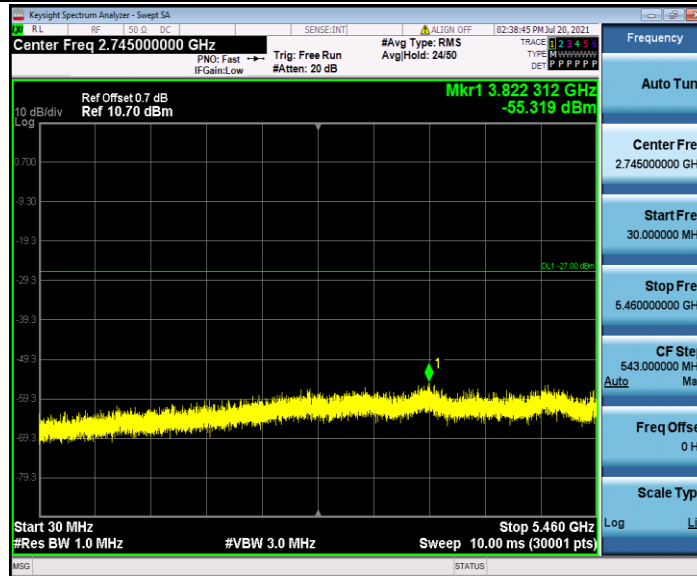


11A_Ant1_5580_5735~40000




11A_Ant2_5580_30~5460

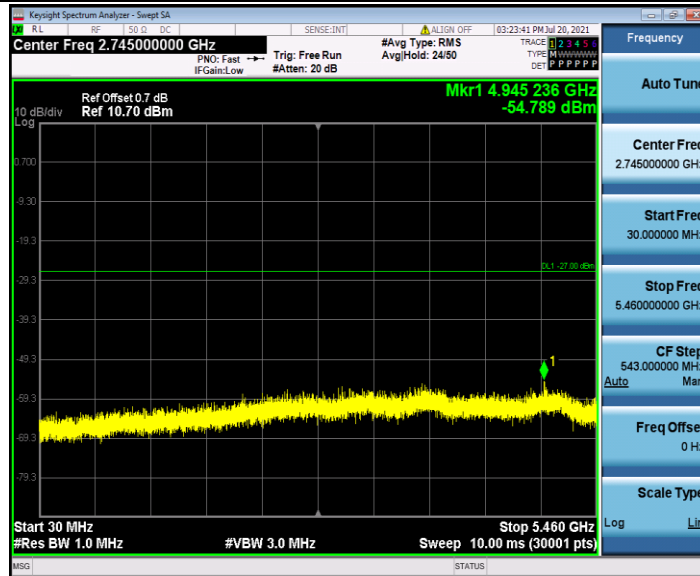


11A_Ant2_5580_5735~40000

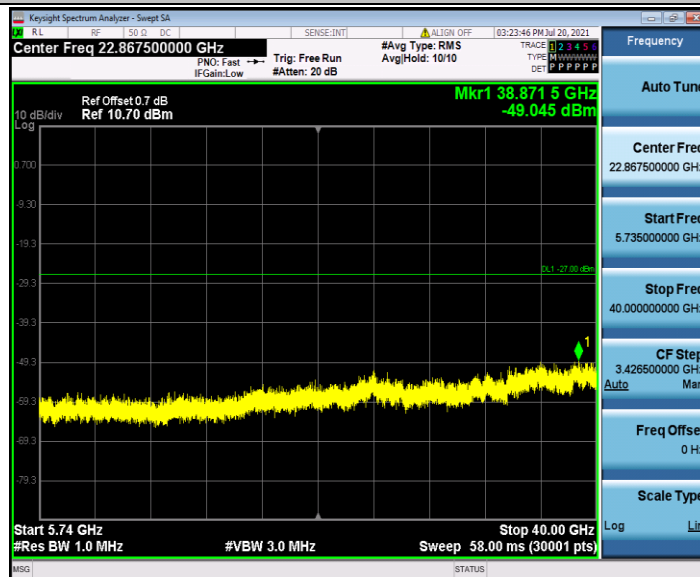


11A_Ant1_5700_30~5460

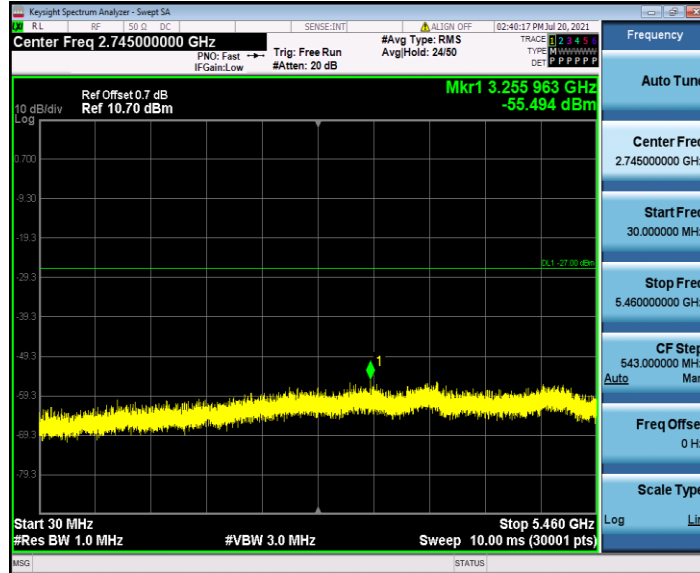


11A_Ant1_5700_5735~40000

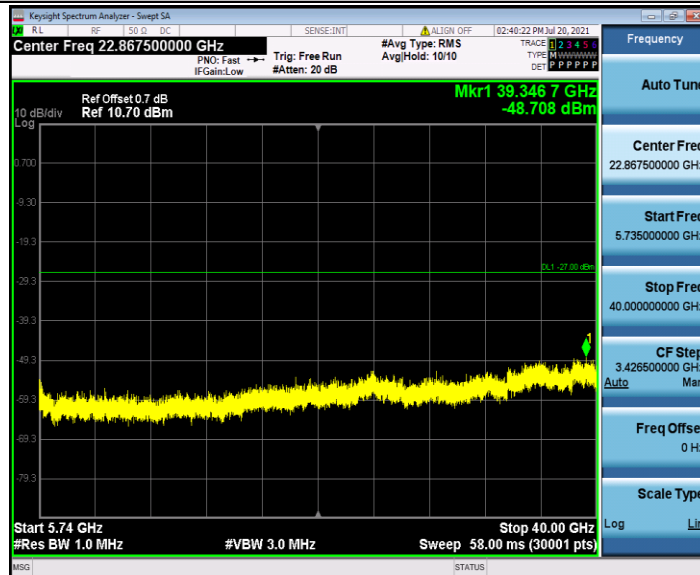


11A_Ant2_5700_30~5460

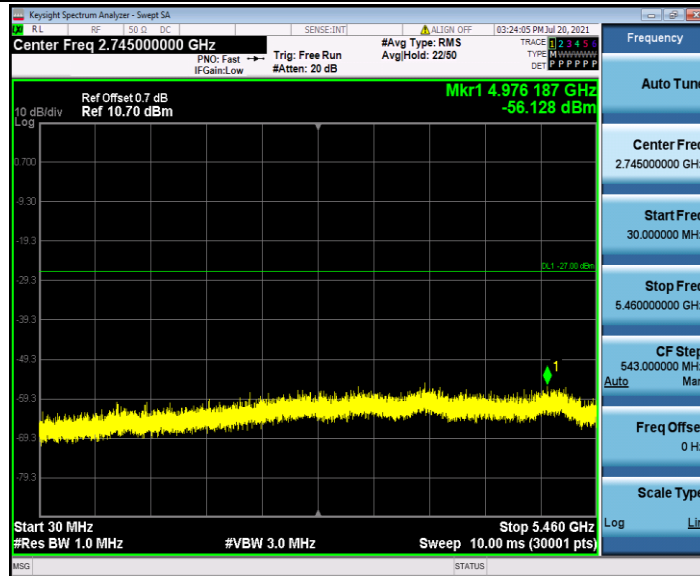


11A_Ant2_5700_5735~40000

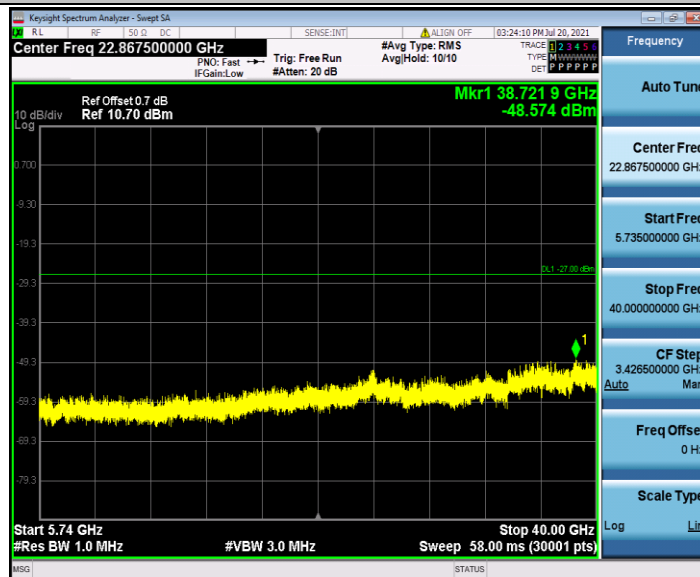


11A_Ant1_5745_30~5650

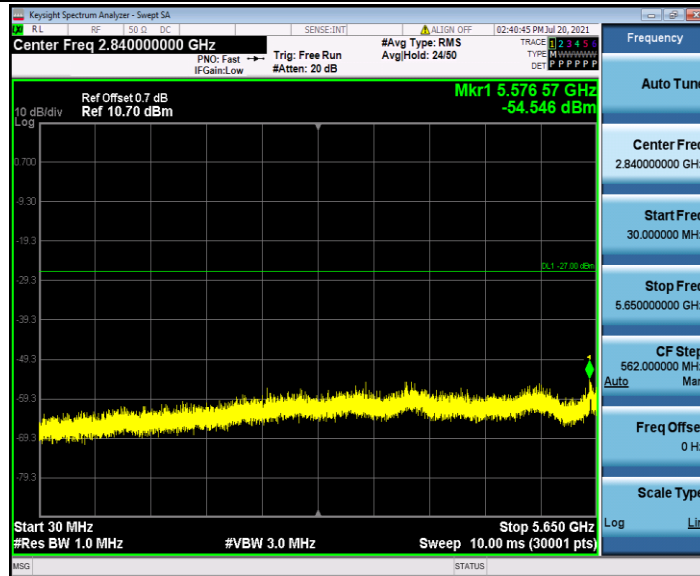


11A_Ant1_5745_5925~40000

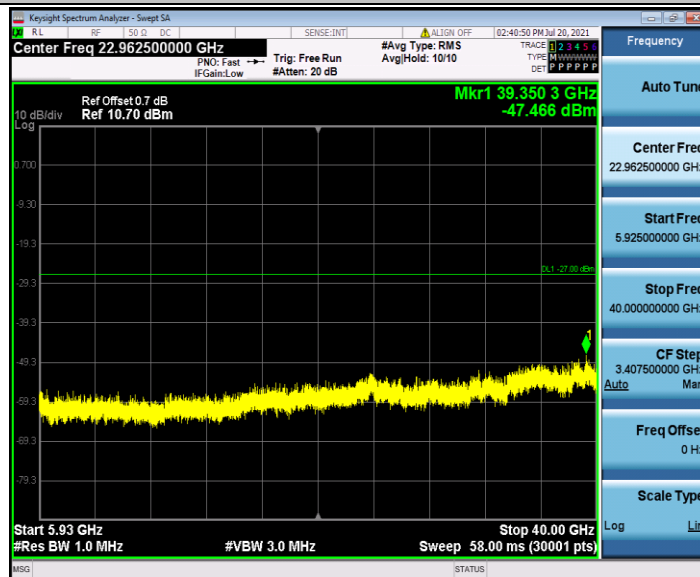

11A_Ant2_5745_30~5650

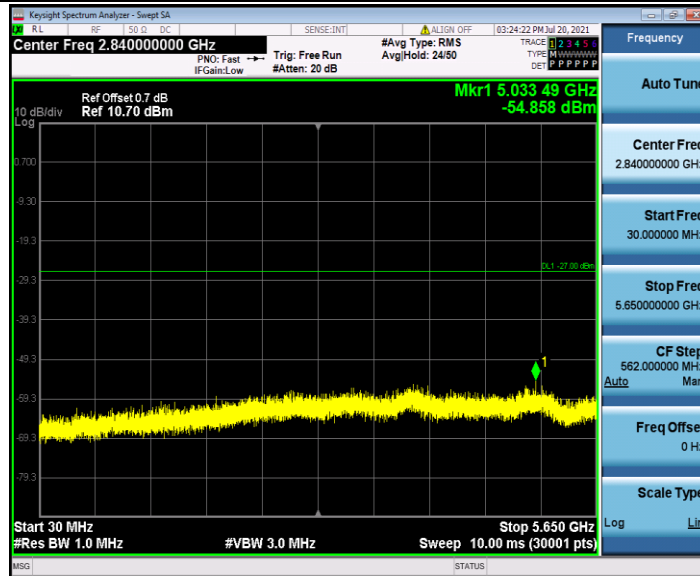

11A_Ant2_5745_5925~40000

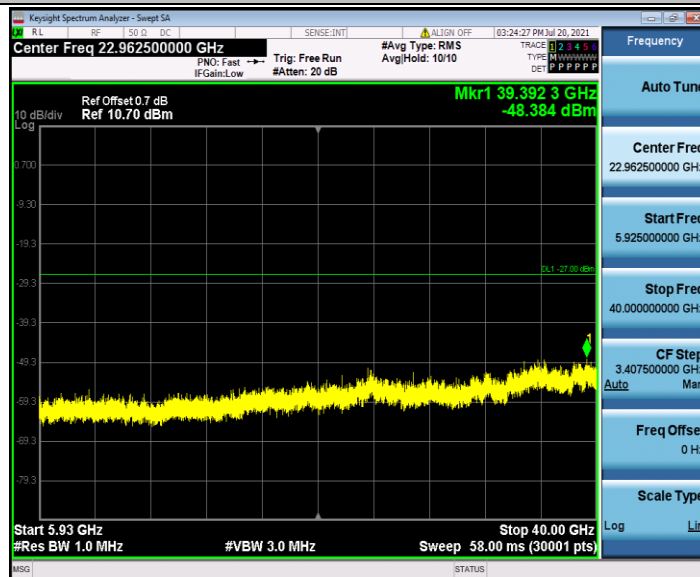

11A_Ant1_5785_30~5650