



Appendix F

RF Test Data for 5.5GWIFI (Conducted Measurement)

Product Name: CART S+

Test Model: 900.0055.01

Environmental Conditions

Temperature:	24.5° C
Relative Humidity:	53.6%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



F.1 -26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5500	Ant0	26.26	---	Pass
NVNT	a	5580	Ant0	25.739	---	Pass
NVNT	a	5700	Ant0	26.005	---	Pass
NVNT	n20	5500	Ant0	27.801	---	Pass
NVNT	n20	5580	Ant0	28.486	---	Pass
NVNT	n20	5700	Ant0	27.497	---	Pass
NVNT	n40	5510	Ant0	44.503	---	Pass
NVNT	n40	5550	Ant0	42.46	---	Pass
NVNT	n40	5670	Ant0	39.354	---	Pass
NVNT	ac20	5500	Ant0	25.667	---	Pass
NVNT	ac20	5580	Ant0	27.001	---	Pass
NVNT	ac20	5700	Ant0	29.175	---	Pass
NVNT	ac40	5510	Ant0	39.944	---	Pass
NVNT	ac40	5550	Ant0	39.249	---	Pass
NVNT	ac40	5670	Ant0	45.017	---	Pass
NVNT	ac80	5530	Ant0	79.274	---	Pass
NVNT	ac80	5610	Ant0	78.178	---	Pass
NVNT	ax20	5500	Ant0	26.882	---	Pass
NVNT	ax20	5580	Ant0	28.947	---	Pass
NVNT	ax20	5700	Ant0	27.266	---	Pass
NVNT	ax40	5510	Ant0	41.322	---	Pass
NVNT	ax40	5550	Ant0	41.348	---	Pass
NVNT	ax40	5670	Ant0	44.222	---	Pass
NVNT	ax80	5530	Ant0	78.299	---	Pass
NVNT	ax80	5610	Ant0	78.336	---	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

-26dB Bandwidth NVNT a 5500MHz Ant0

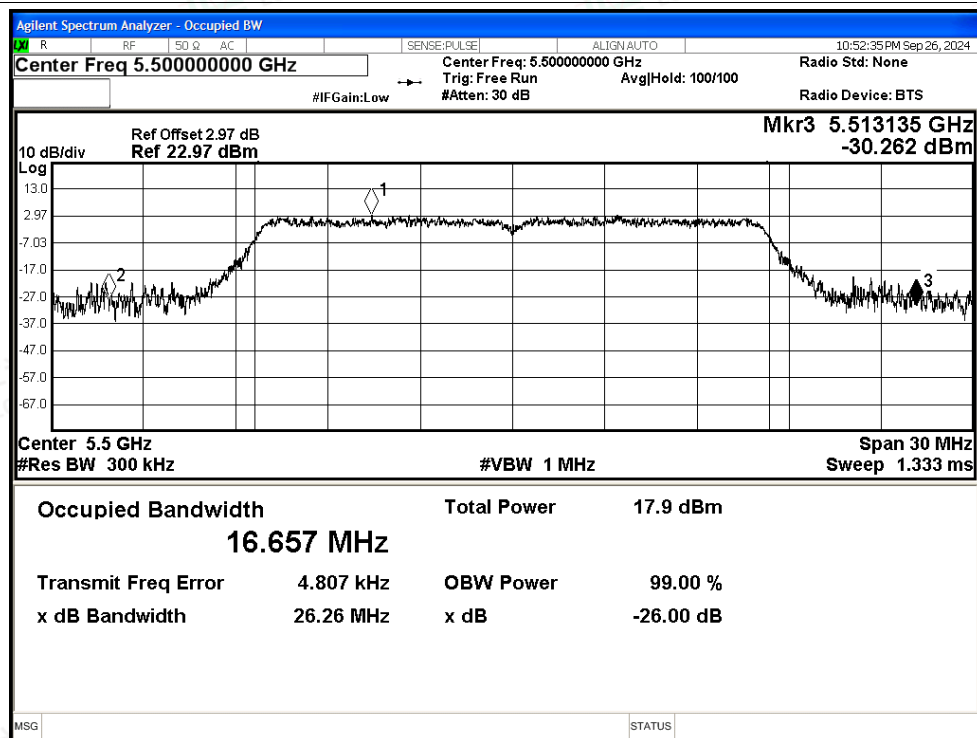

-26dB Bandwidth NVNT a 5580MHz Ant0

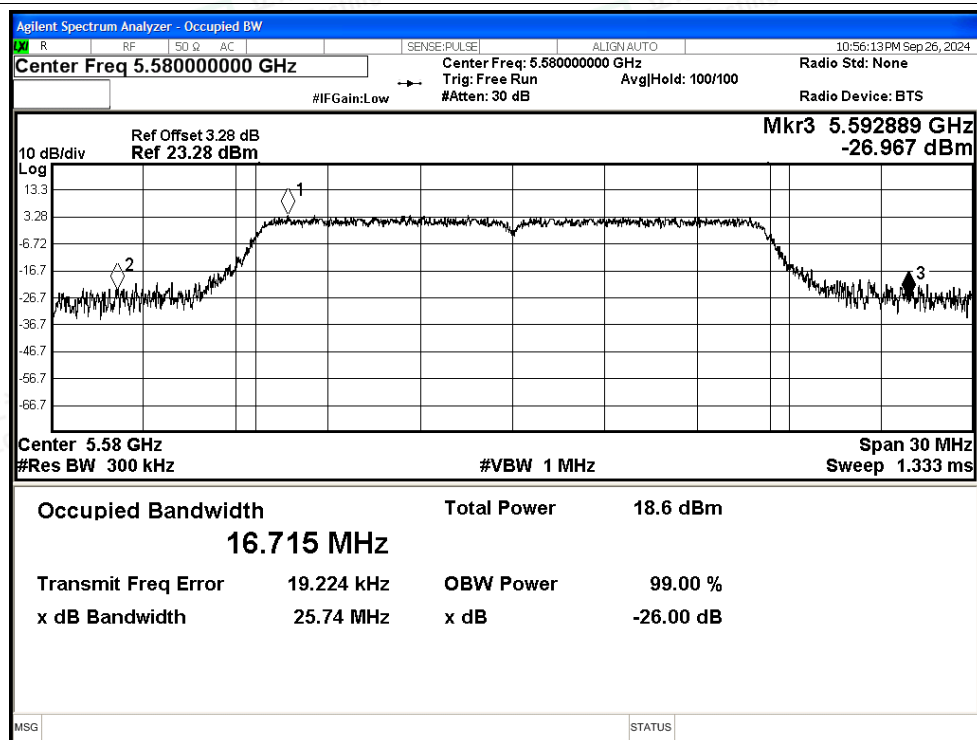

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT a 5700MHz Ant0

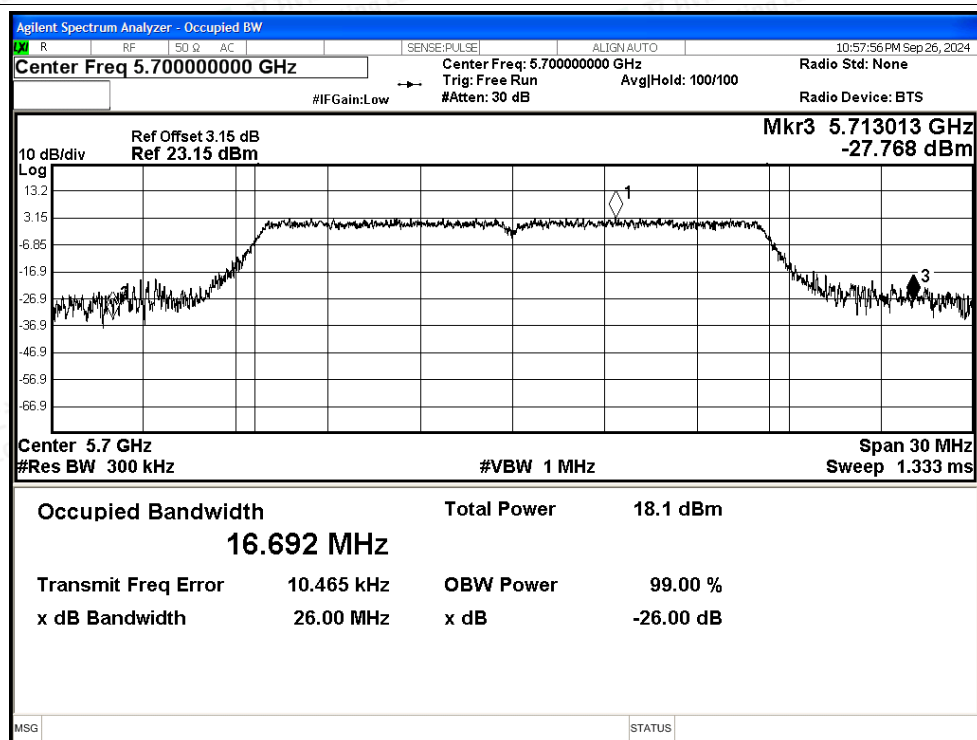

-26dB Bandwidth NVNT n20 5500MHz Ant0

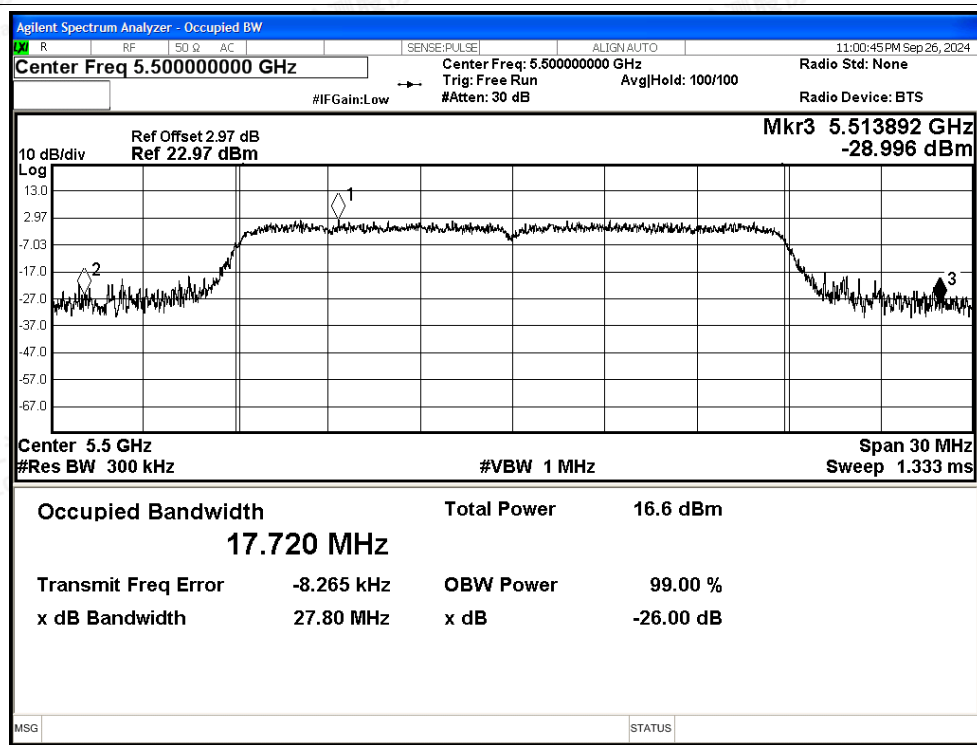

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n20 5580MHz Ant0

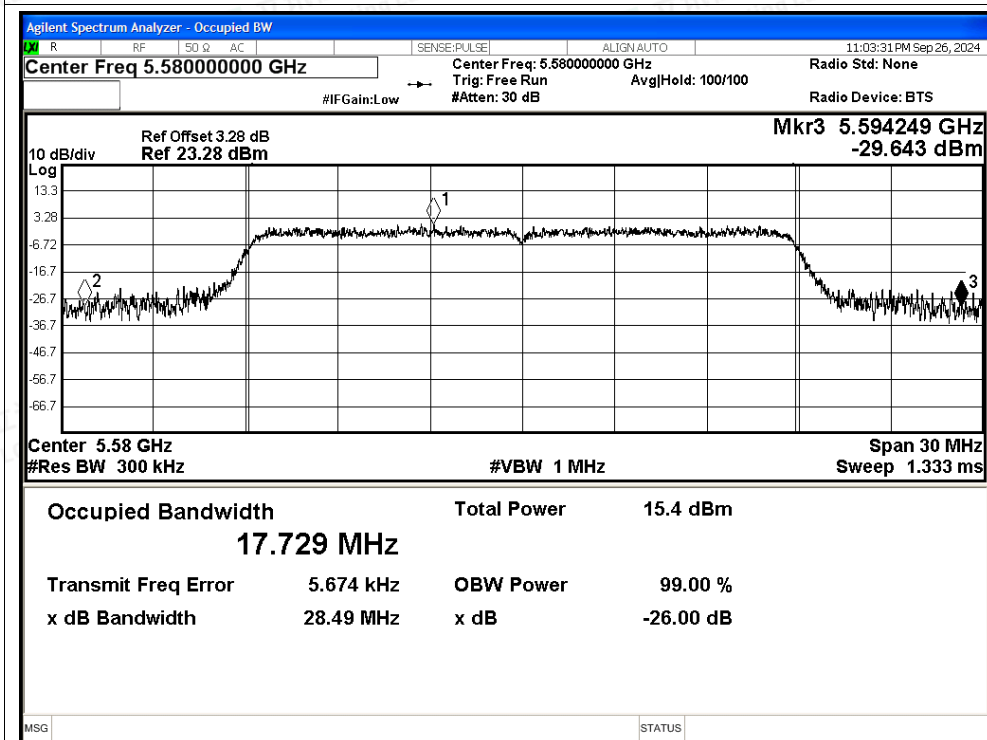

-26dB Bandwidth NVNT n20 5700MHz Ant0

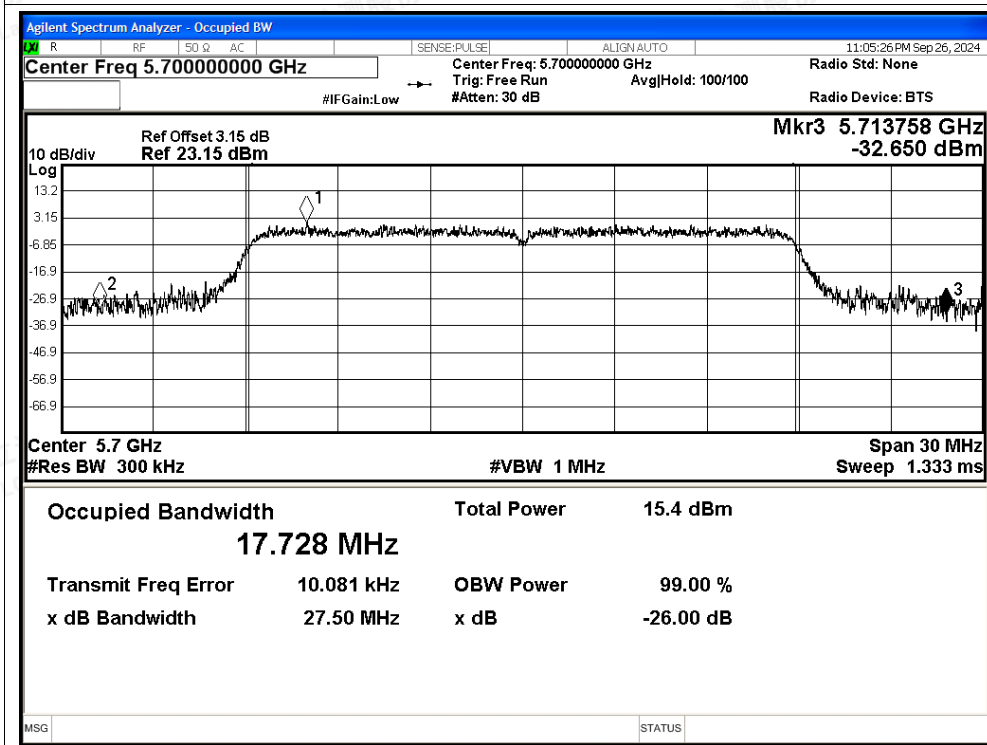

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5510MHz Ant0

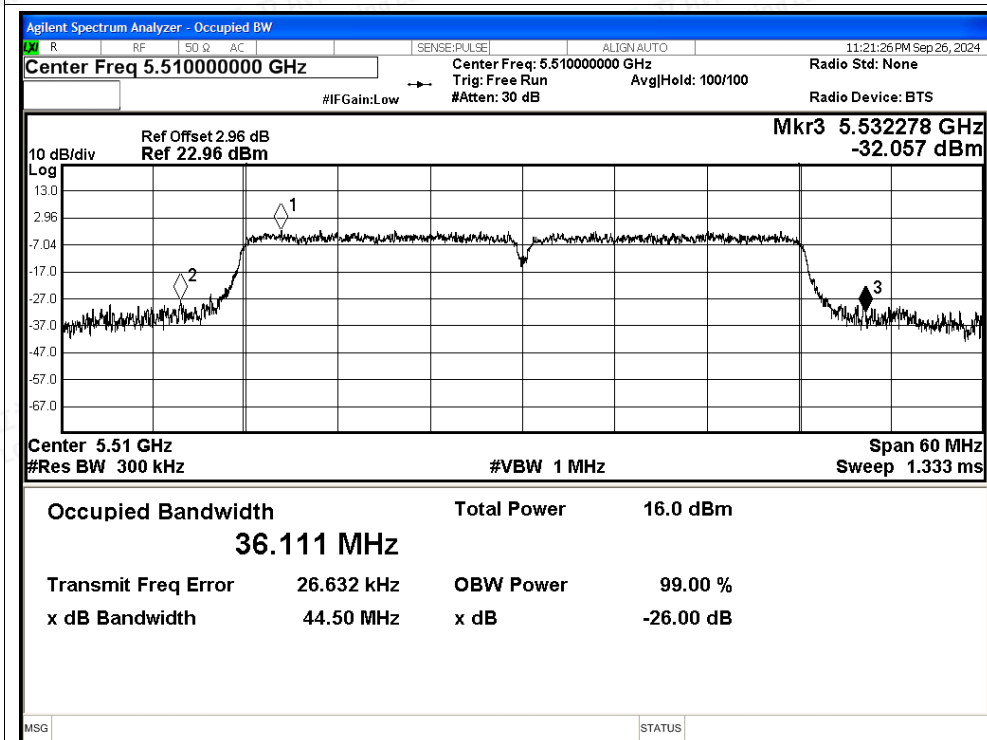

-26dB Bandwidth NVNT n40 5550MHz Ant0

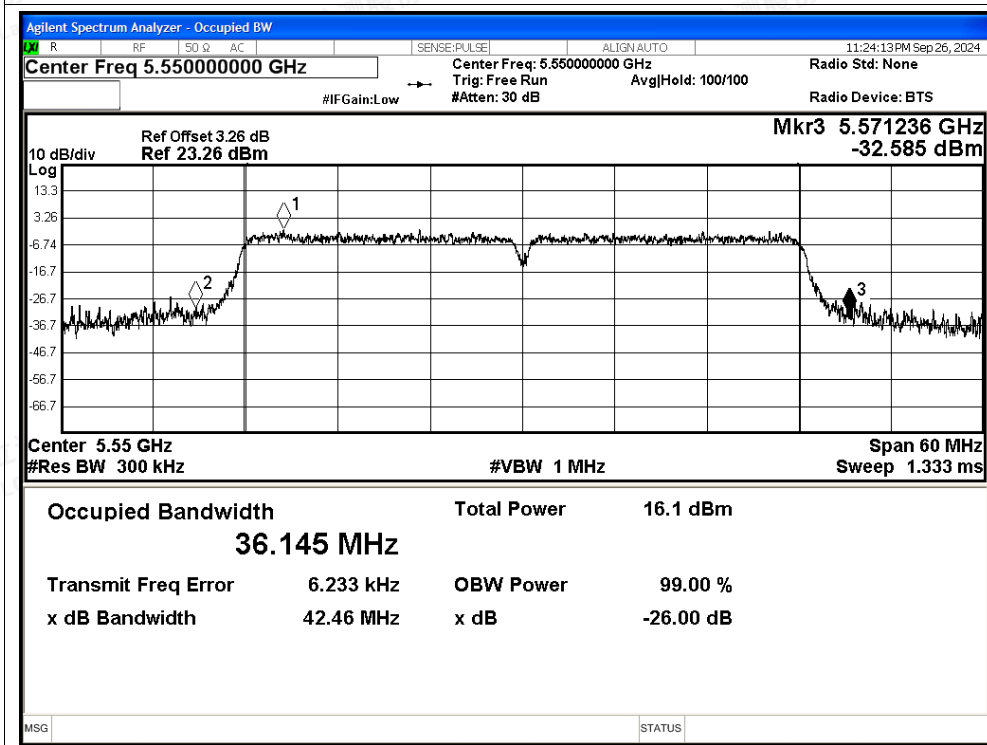

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5670MHz Ant0

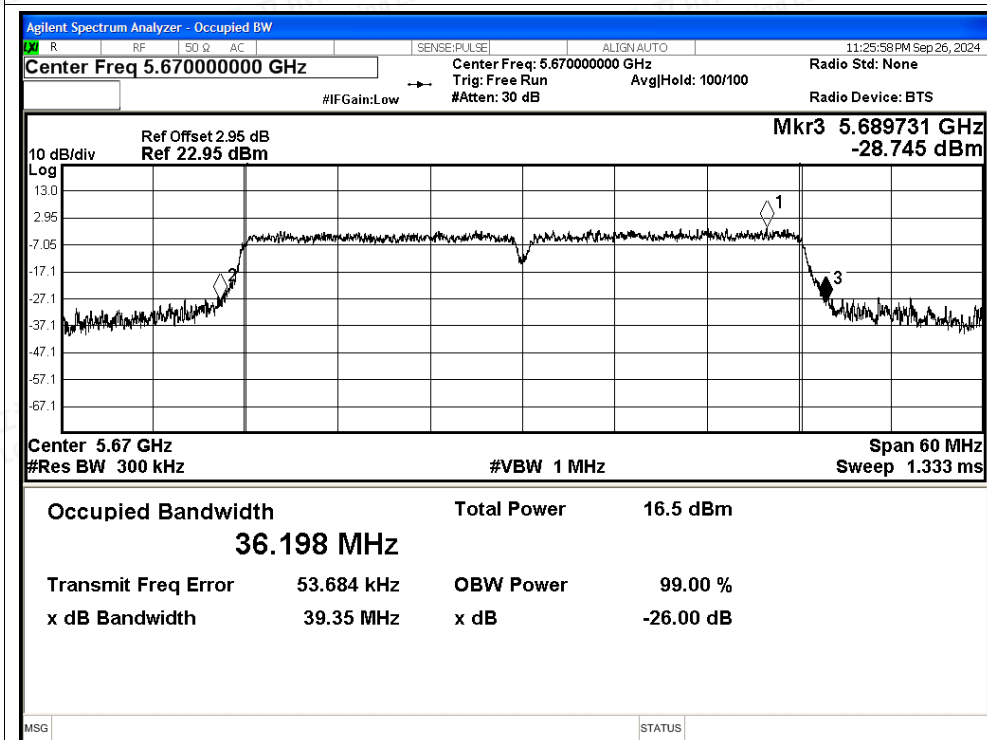

-26dB Bandwidth NVNT ac20 5500MHz Ant0

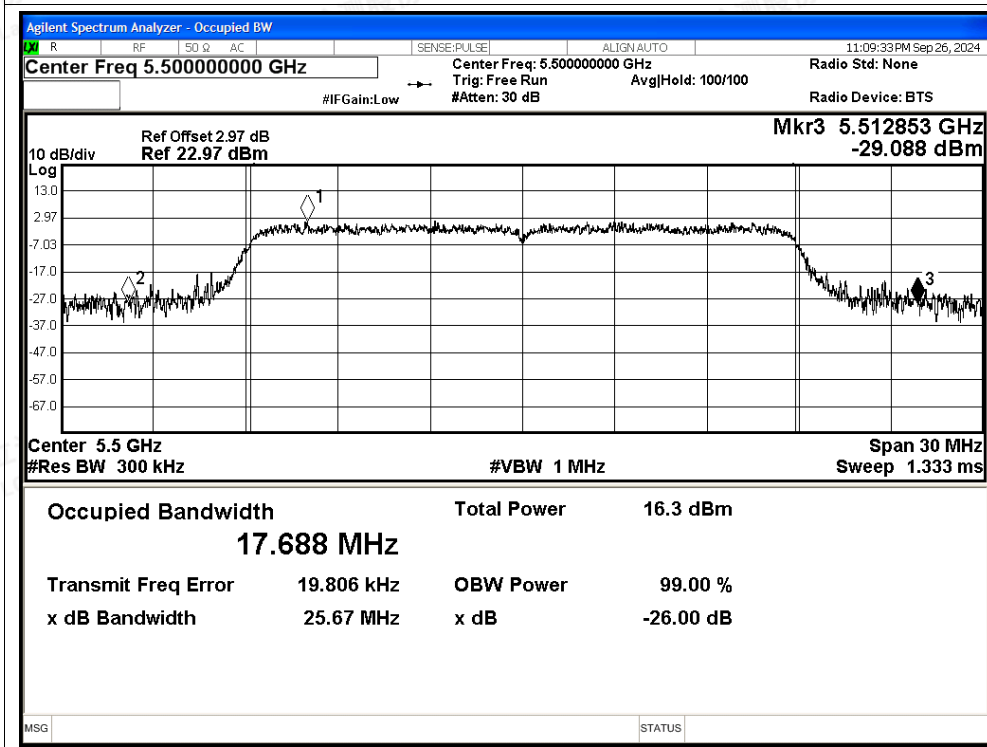

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5580MHz Ant0

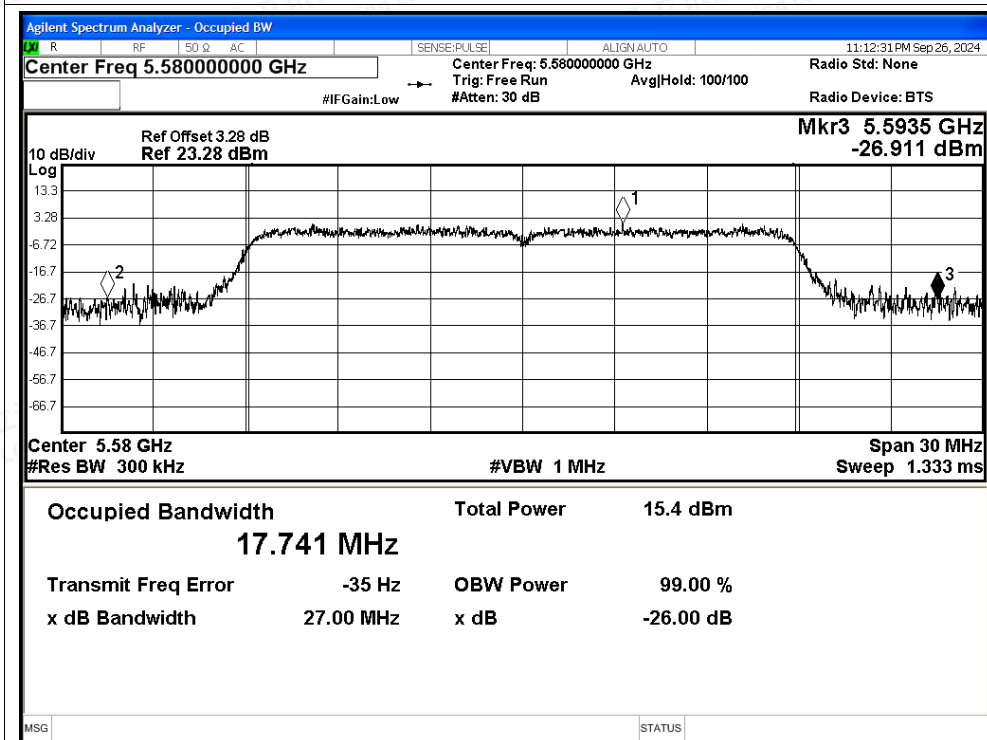

-26dB Bandwidth NVNT ac20 5700MHz Ant0

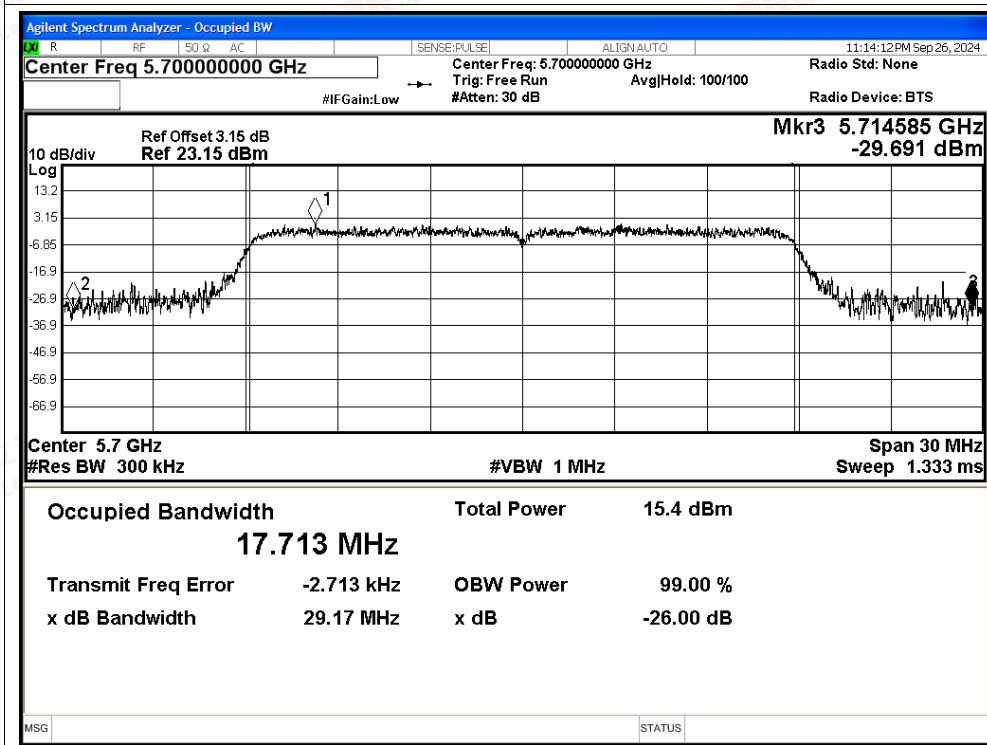

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5510MHz Ant0

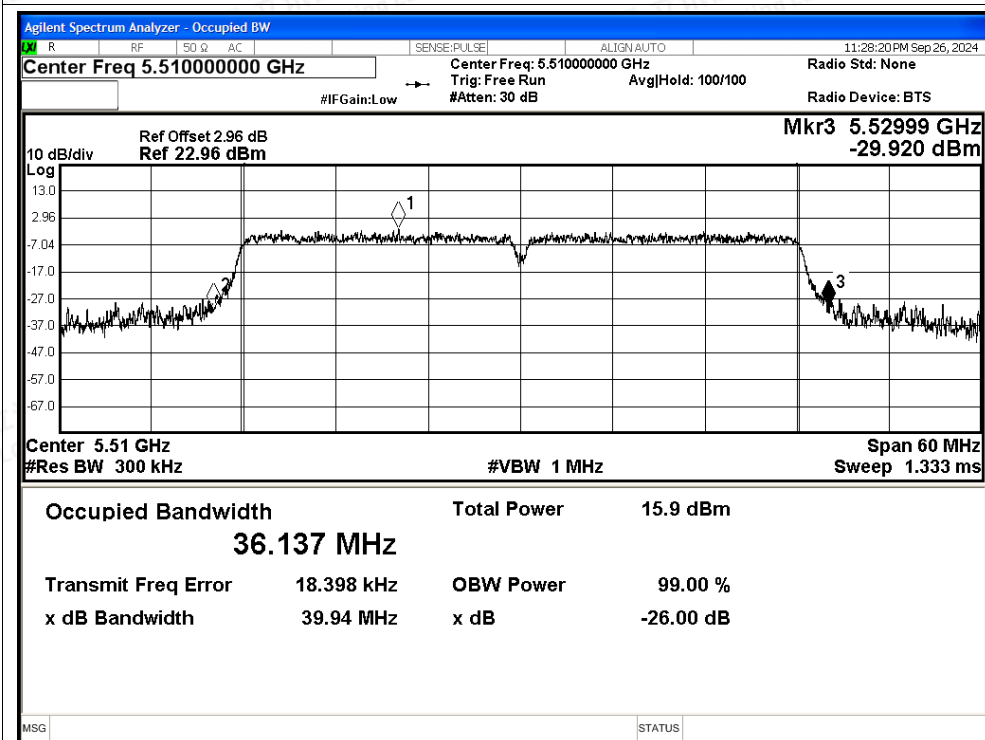

-26dB Bandwidth NVNT ac40 5550MHz Ant0

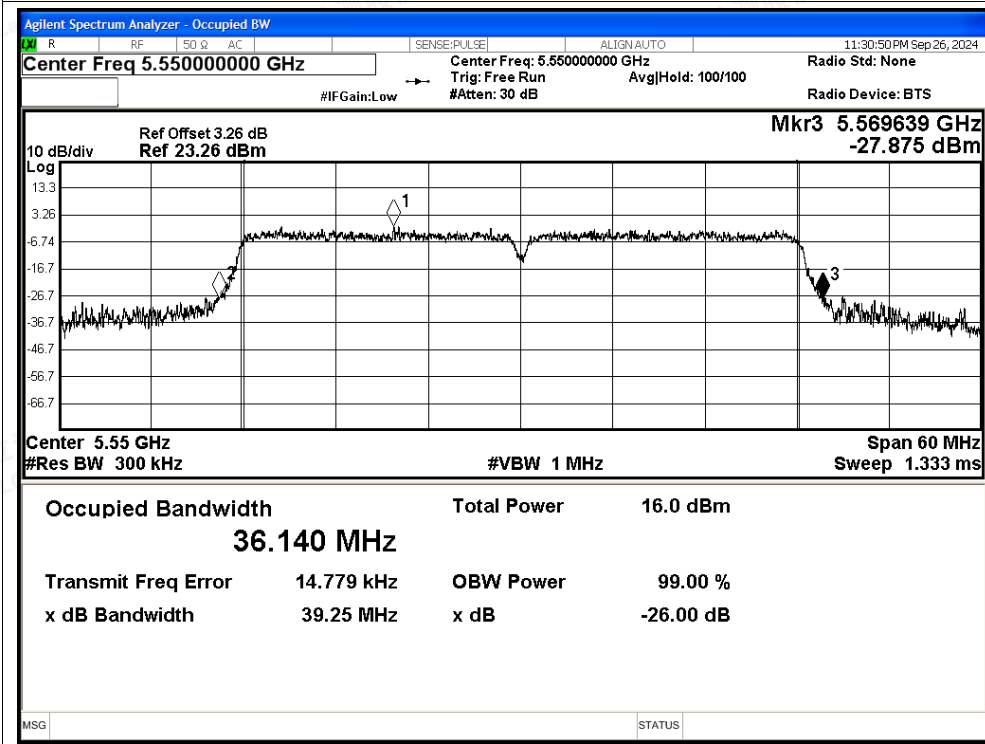

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5670MHz Ant0

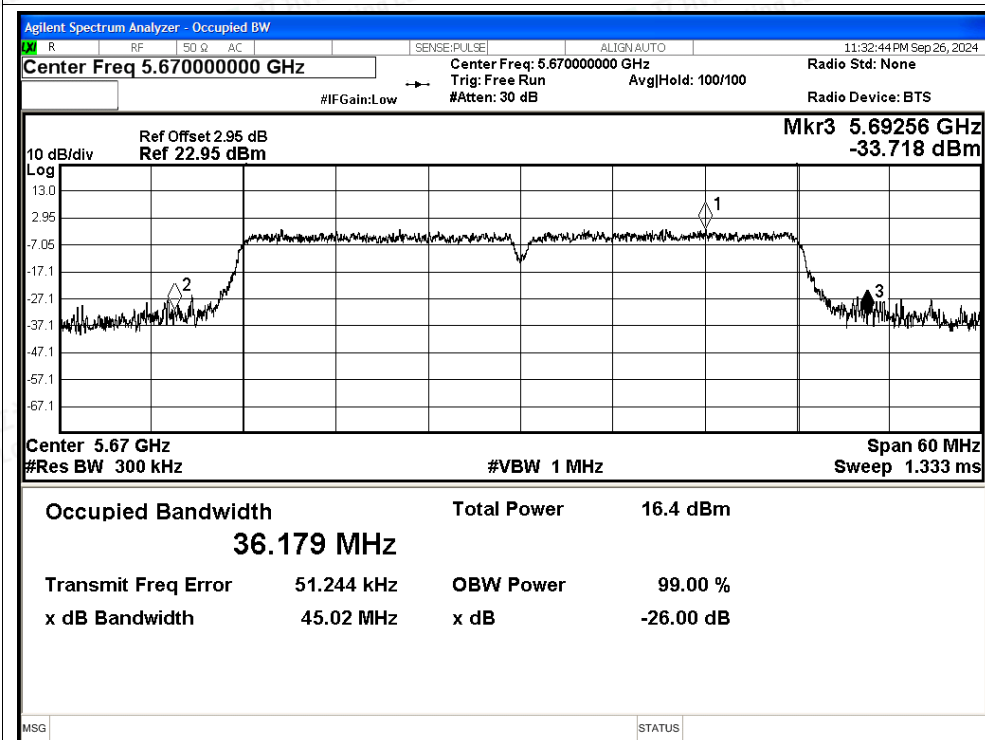

-26dB Bandwidth NVNT ac80 5530MHz Ant0

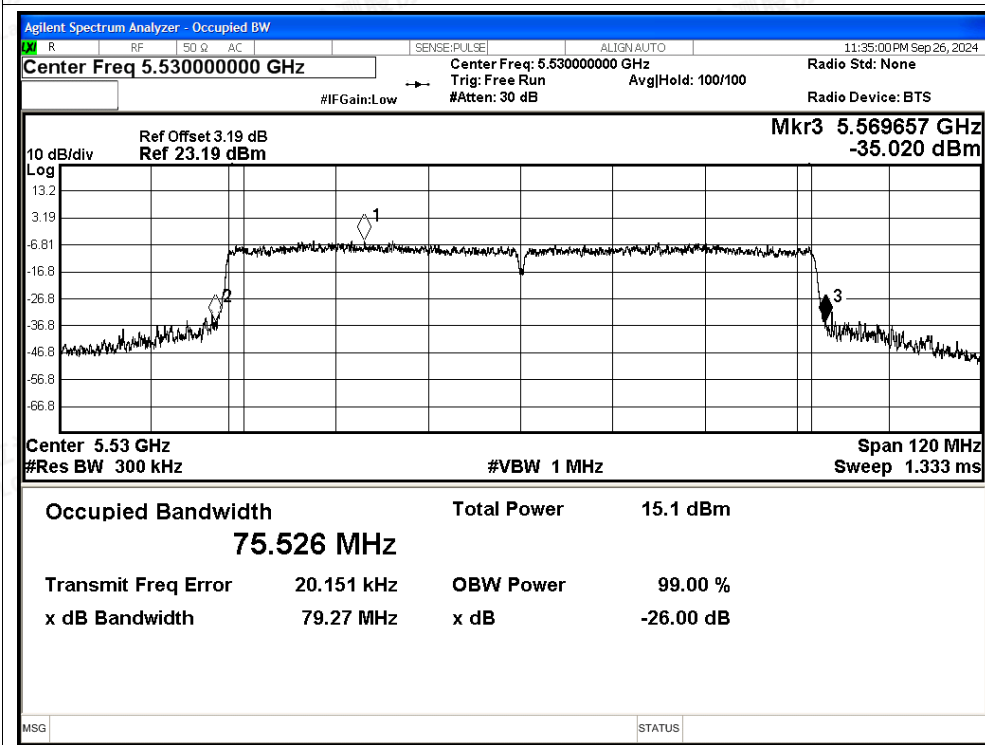

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac80 5610MHz Ant0

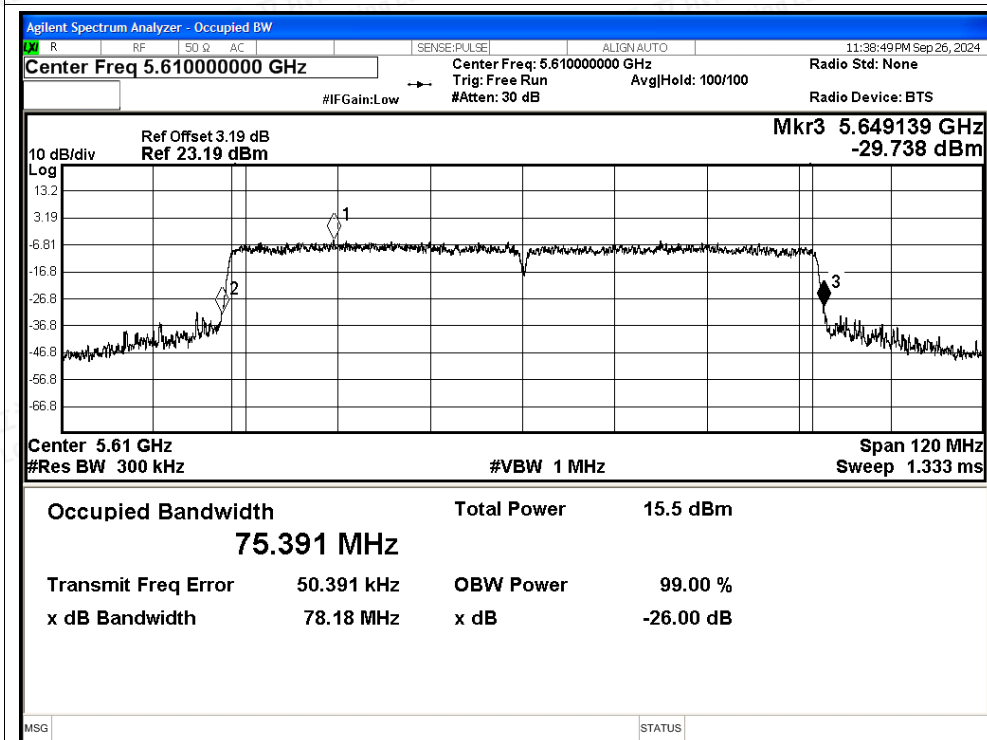

-26dB Bandwidth NVNT ax20 5500MHz Ant0

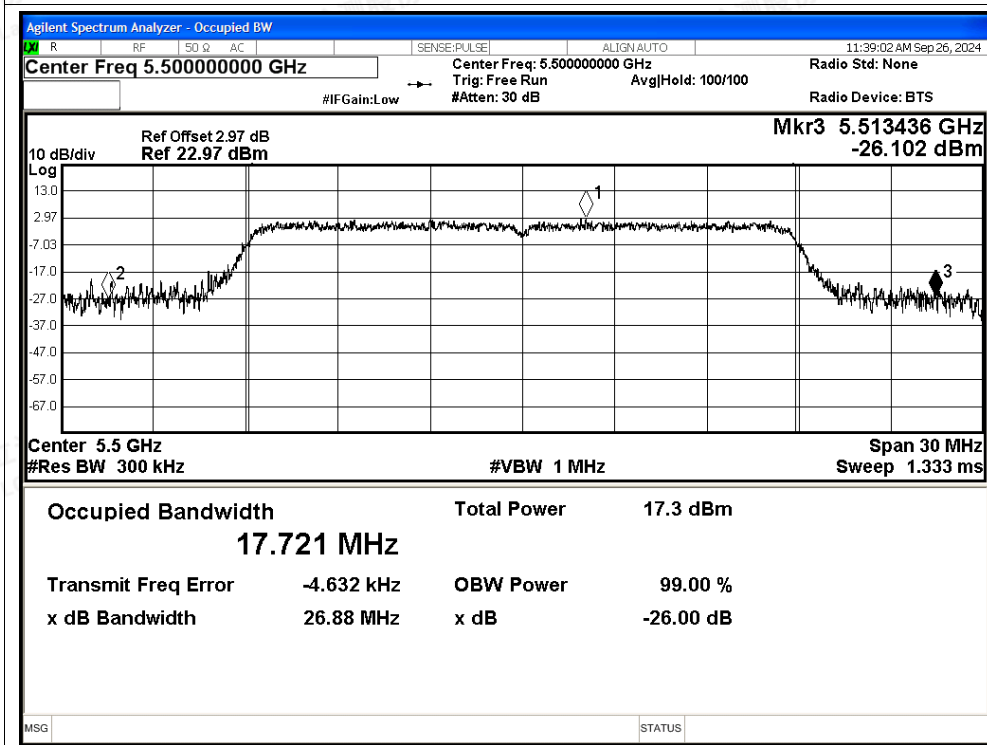

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5580MHz Ant0

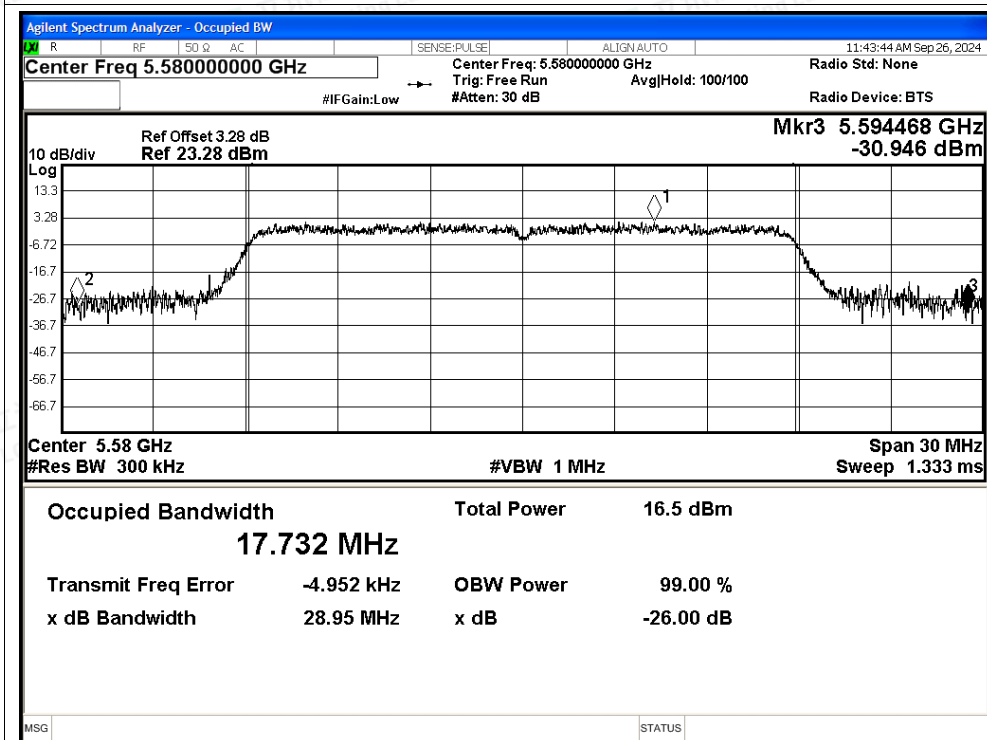

-26dB Bandwidth NVNT ax20 5700MHz Ant0

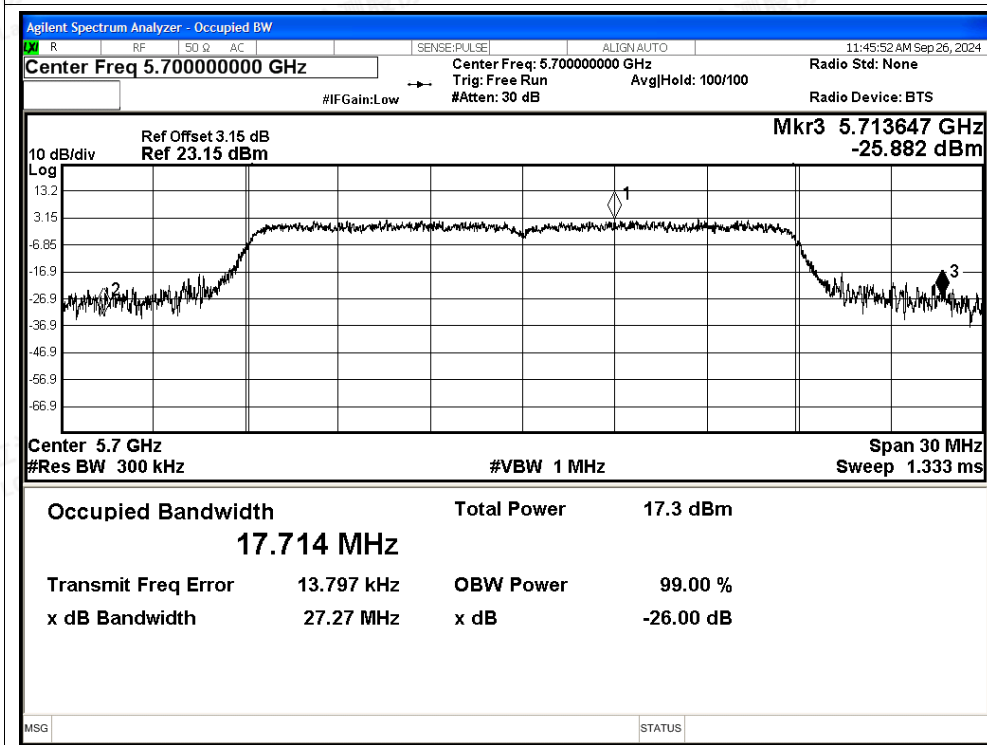

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5510MHz Ant0

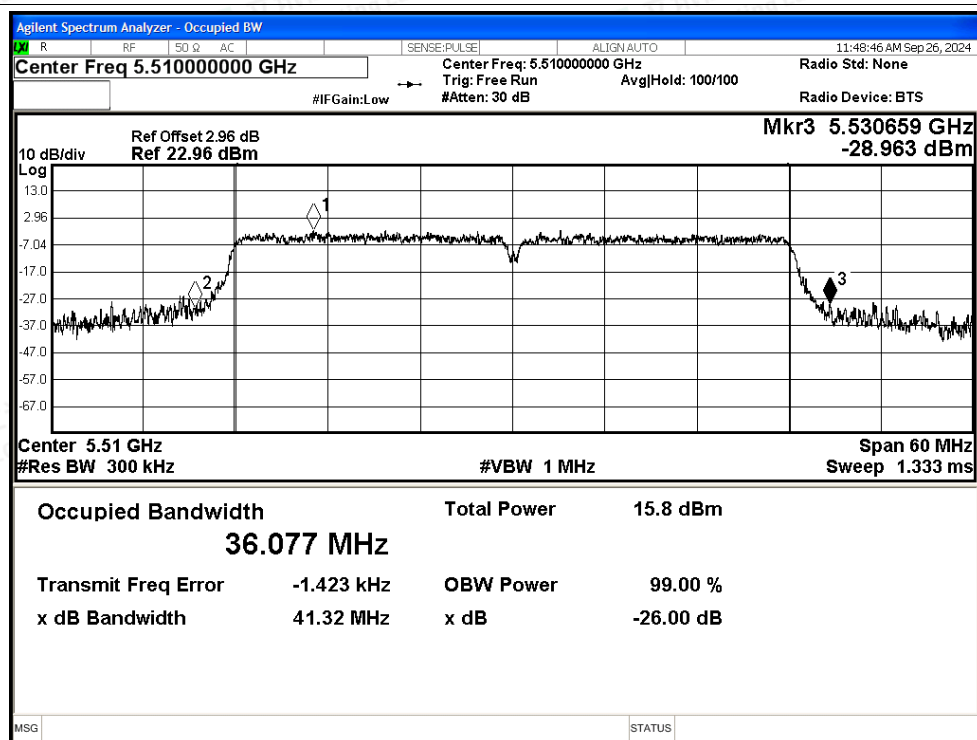

-26dB Bandwidth NVNT ax40 5550MHz Ant0

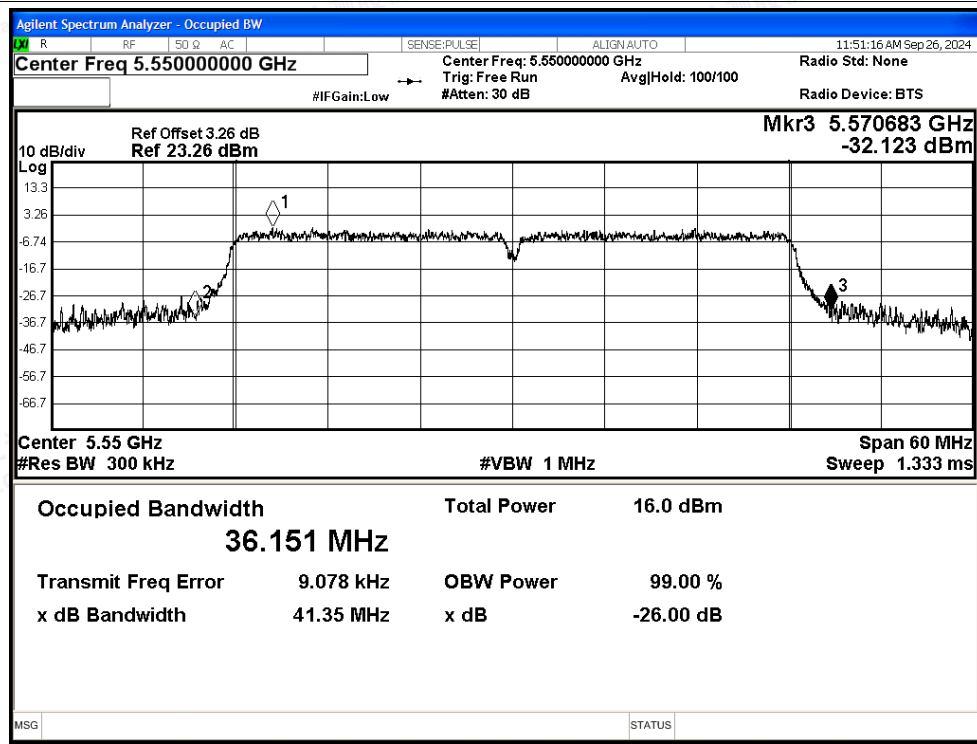

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5670MHz Ant0

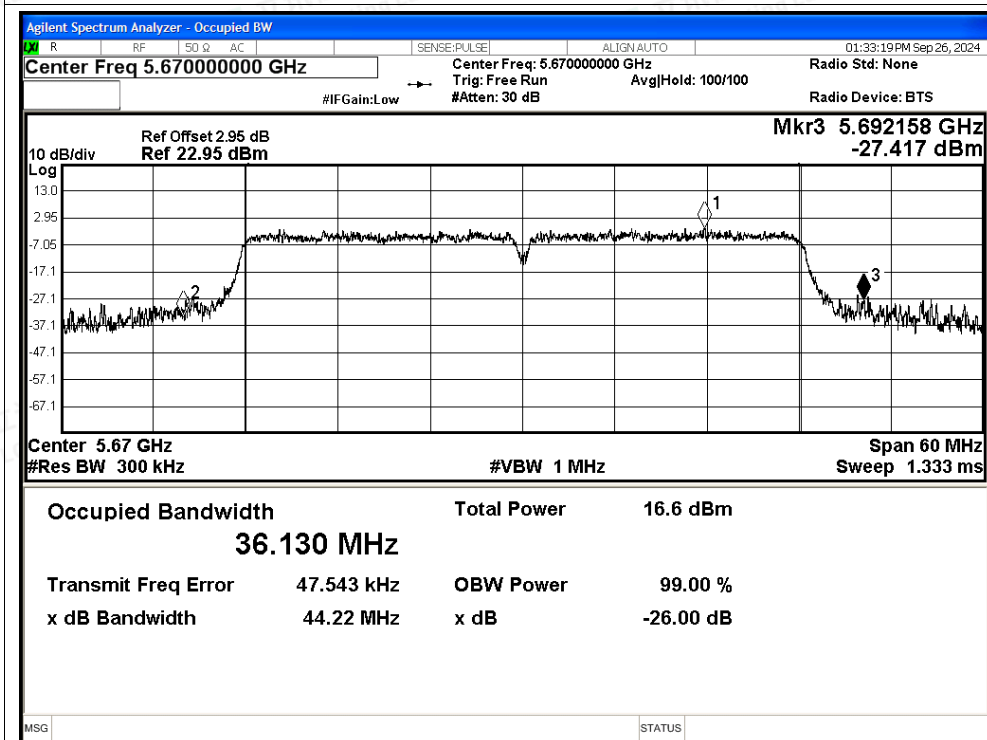

-26dB Bandwidth NVNT ax80 5530MHz Ant0

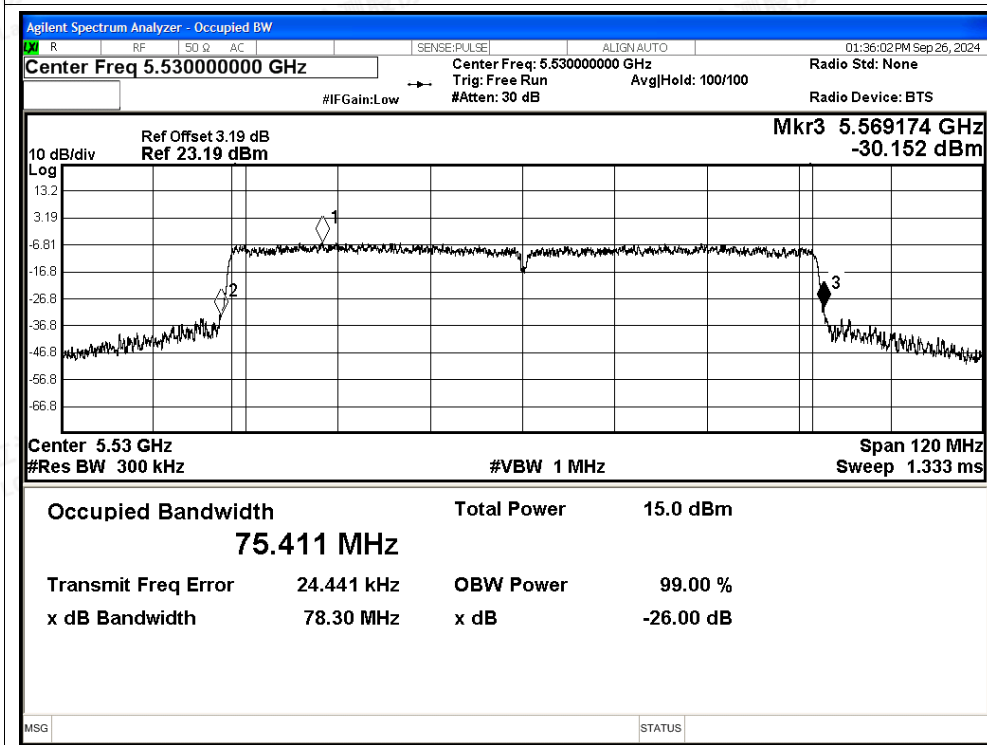


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

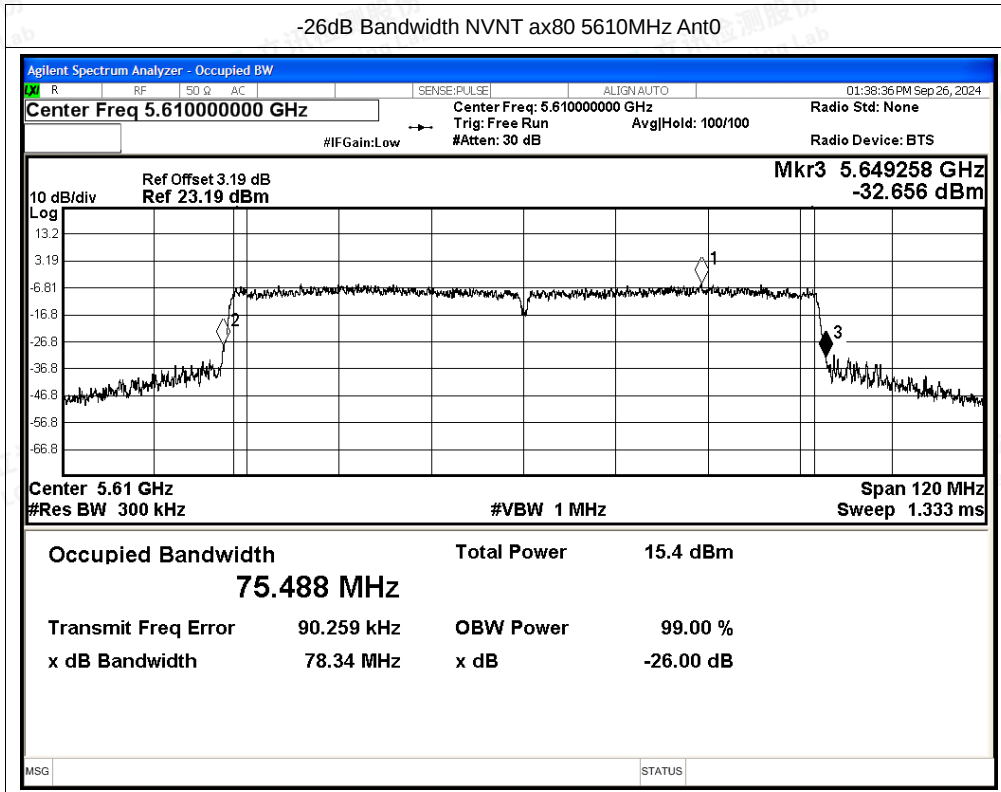




Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5500	Ant1	27.518	---	Pass
NVNT	a	5580	Ant1	26.444	---	Pass
NVNT	a	5700	Ant1	26.862	---	Pass
NVNT	n20	5500	Ant1	28.731	---	Pass
NVNT	n20	5580	Ant1	28.785	---	Pass
NVNT	n20	5700	Ant1	29.098	---	Pass
NVNT	n40	5510	Ant1	42.266	---	Pass
NVNT	n40	5550	Ant1	40.706	---	Pass
NVNT	n40	5670	Ant1	39.936	---	Pass
NVNT	ac20	5500	Ant1	28.82	---	Pass
NVNT	ac20	5580	Ant1	29.776	---	Pass
NVNT	ac20	5700	Ant1	26.7	---	Pass
NVNT	ac40	5510	Ant1	44.706	---	Pass
NVNT	ac40	5550	Ant1	39.231	---	Pass
NVNT	ac40	5670	Ant1	39.33	---	Pass
NVNT	ac80	5530	Ant1	78.254	---	Pass
NVNT	ac80	5610	Ant1	78.446	---	Pass
NVNT	ax20	5500	Ant1	28.778	---	Pass
NVNT	ax20	5580	Ant1	25.713	---	Pass
NVNT	ax20	5700	Ant1	28.823	---	Pass
NVNT	ax40	5510	Ant1	42.232	---	Pass
NVNT	ax40	5550	Ant1	43.627	---	Pass
NVNT	ax40	5670	Ant1	39.391	---	Pass
NVNT	ax80	5530	Ant1	78.491	---	Pass
NVNT	ax80	5610	Ant1	79.175	---	Pass






Test Graphs

-26dB Bandwidth NVNT a 5500MHz Ant1

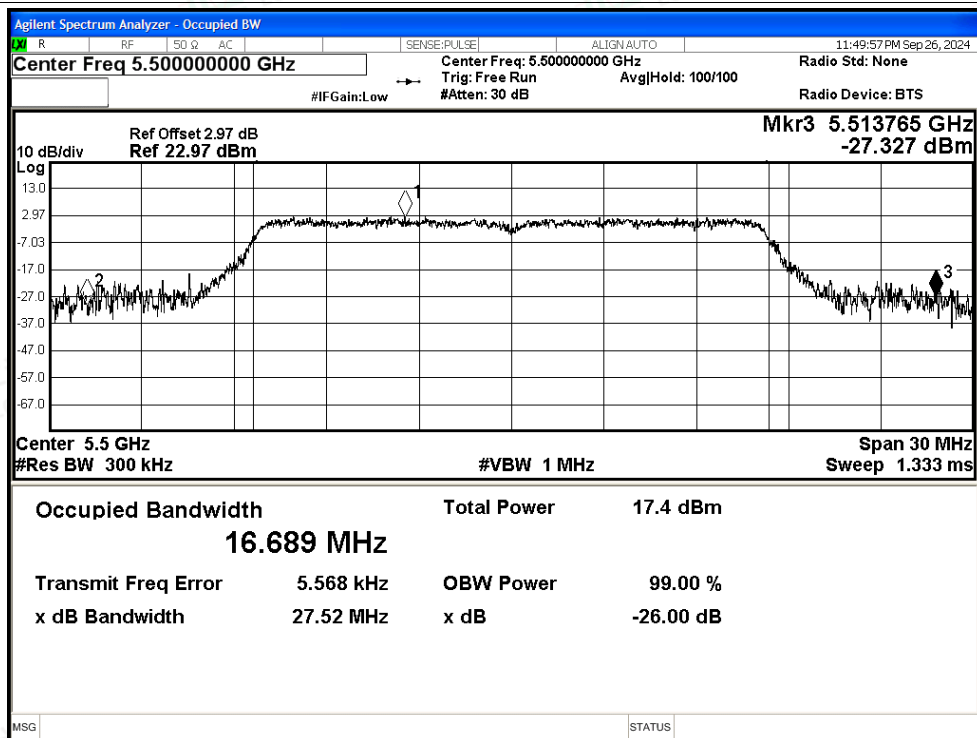

-26dB Bandwidth NVNT a 5580MHz Ant1

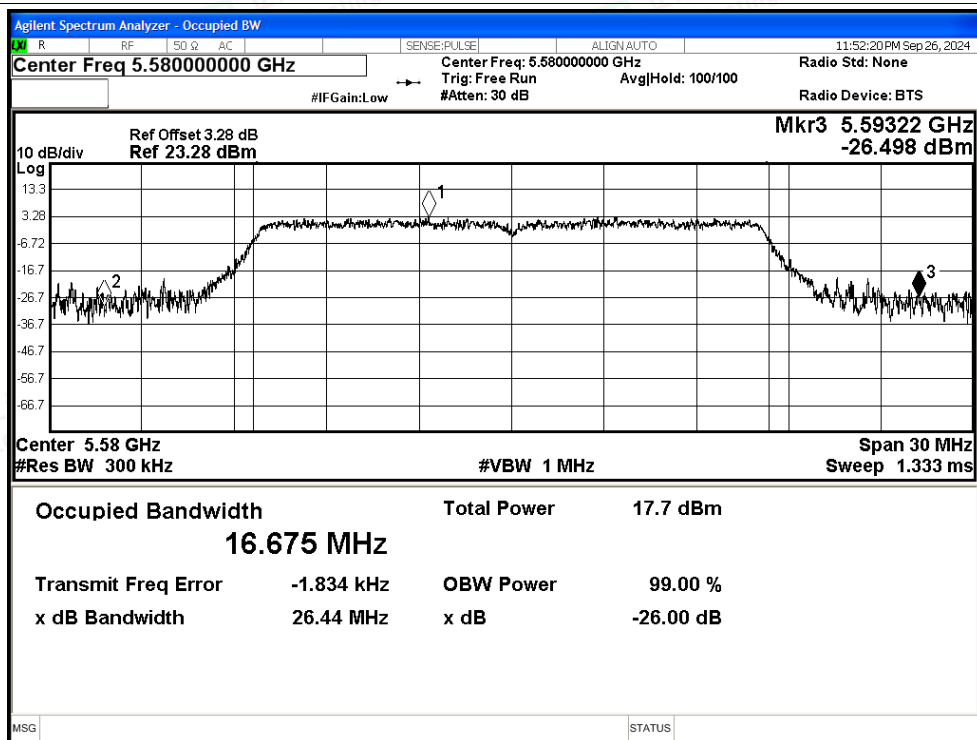

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT a 5700MHz Ant1

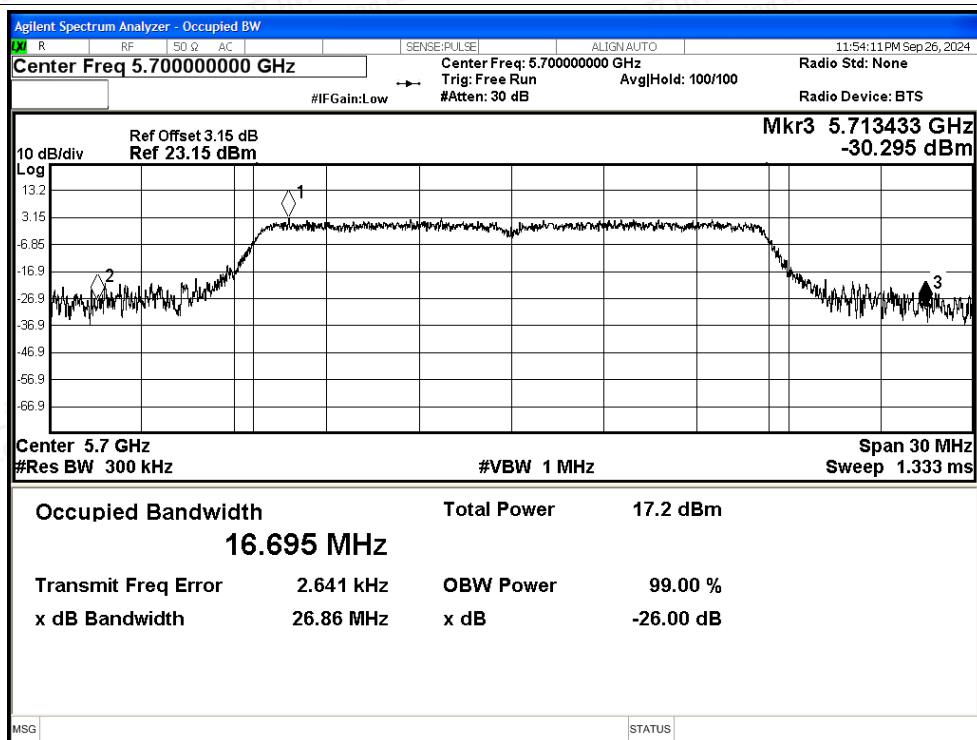

-26dB Bandwidth NVNT n20 5500MHz Ant1

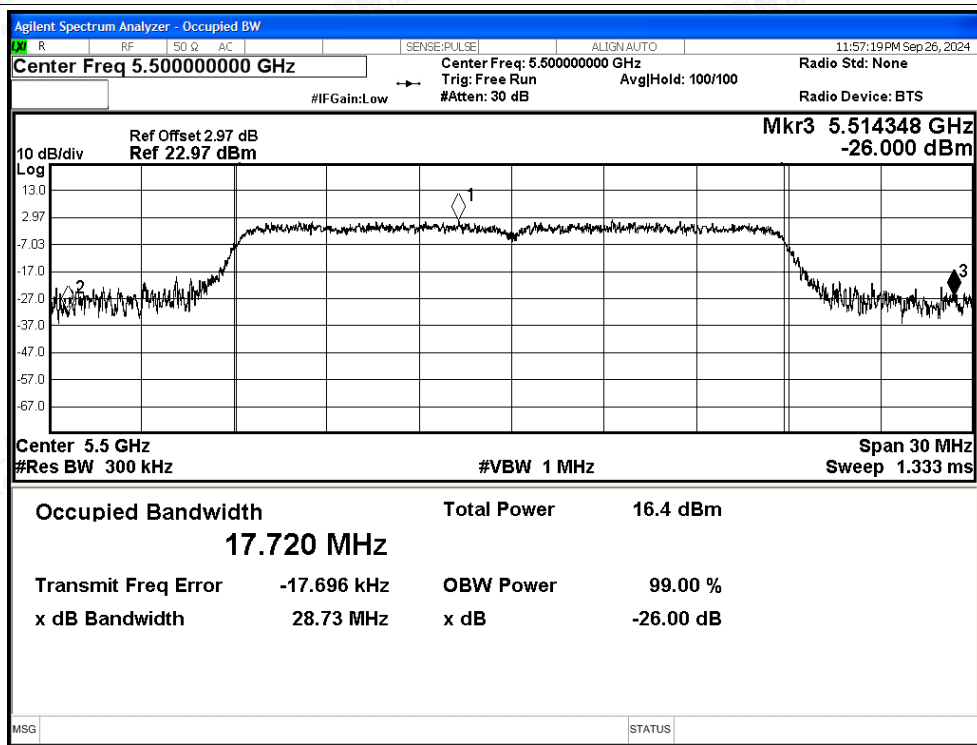

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n20 5580MHz Ant1

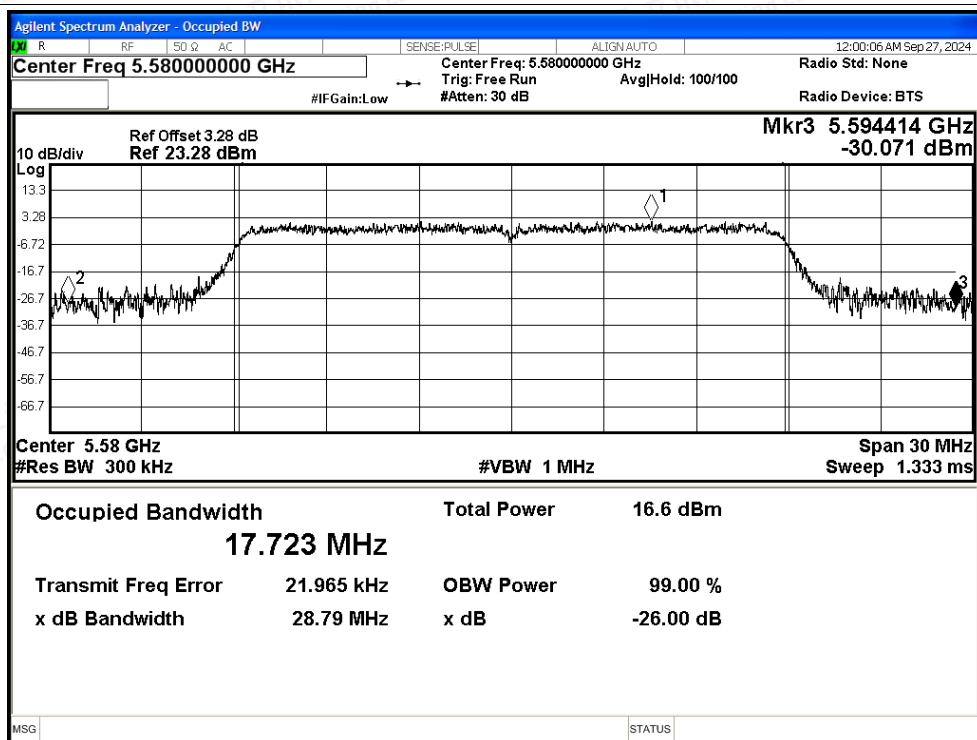

-26dB Bandwidth NVNT n20 5700MHz Ant1

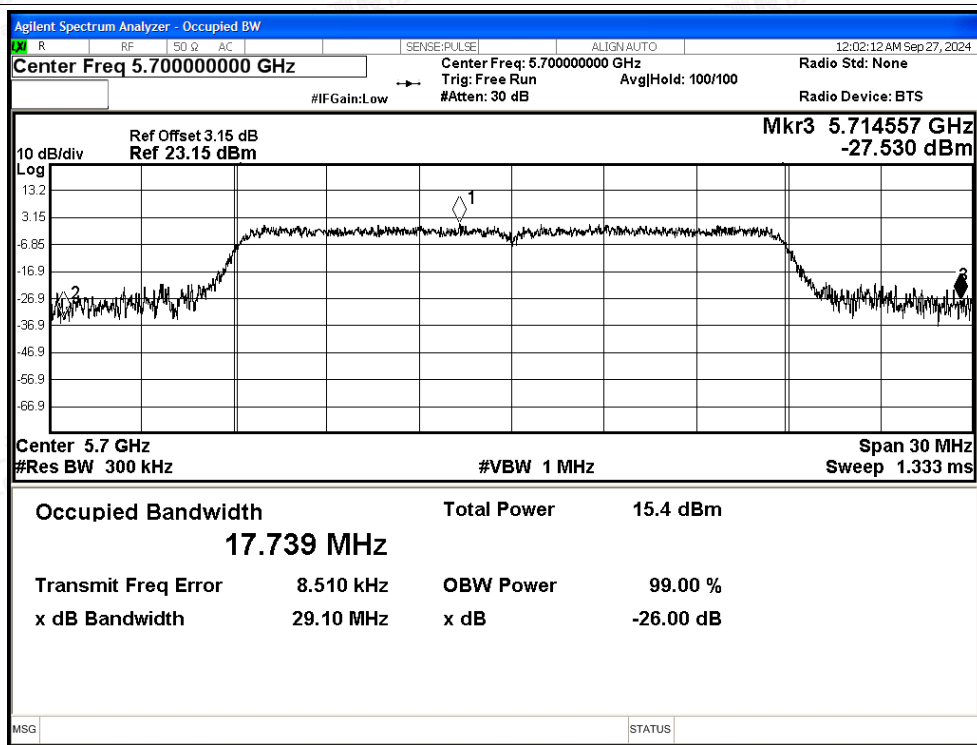

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5510MHz Ant1

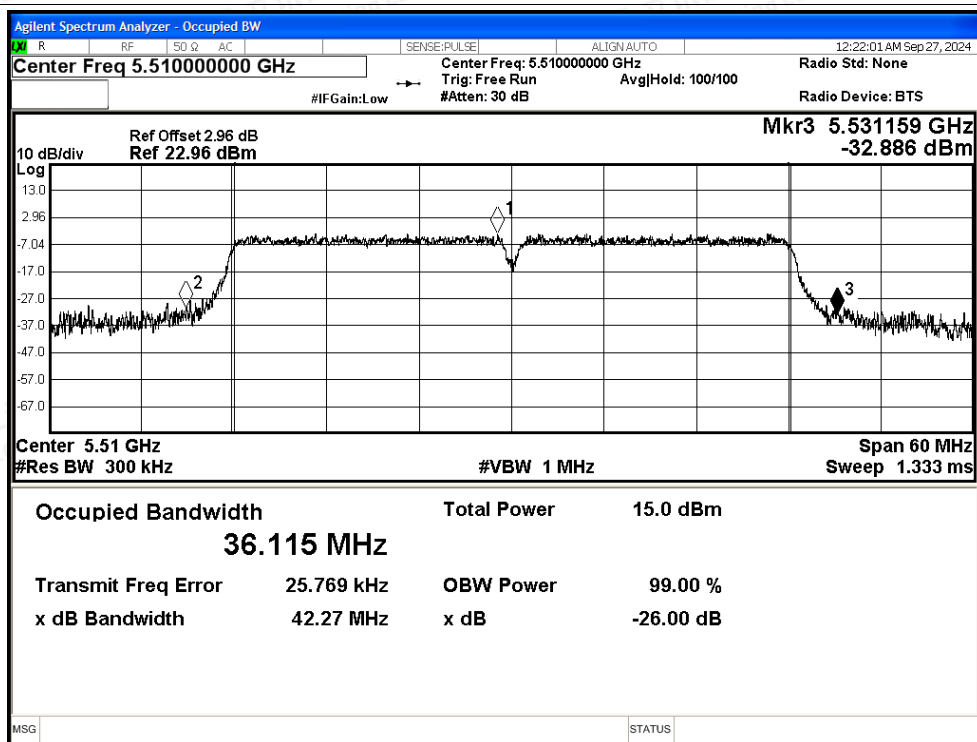

-26dB Bandwidth NVNT n40 5550MHz Ant1

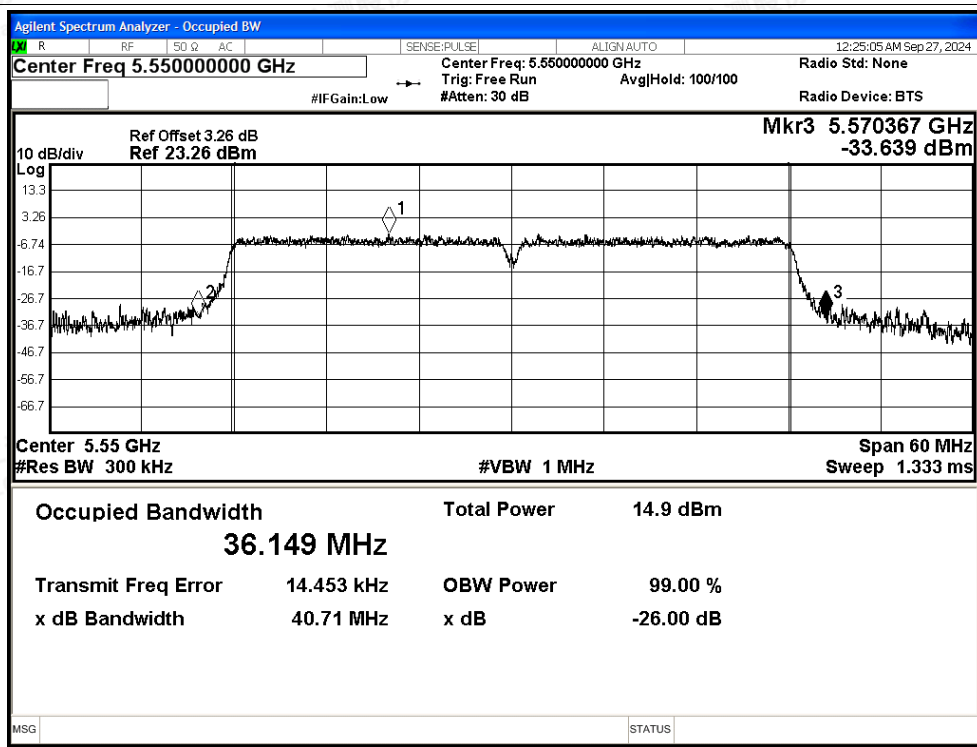

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n40 5670MHz Ant1

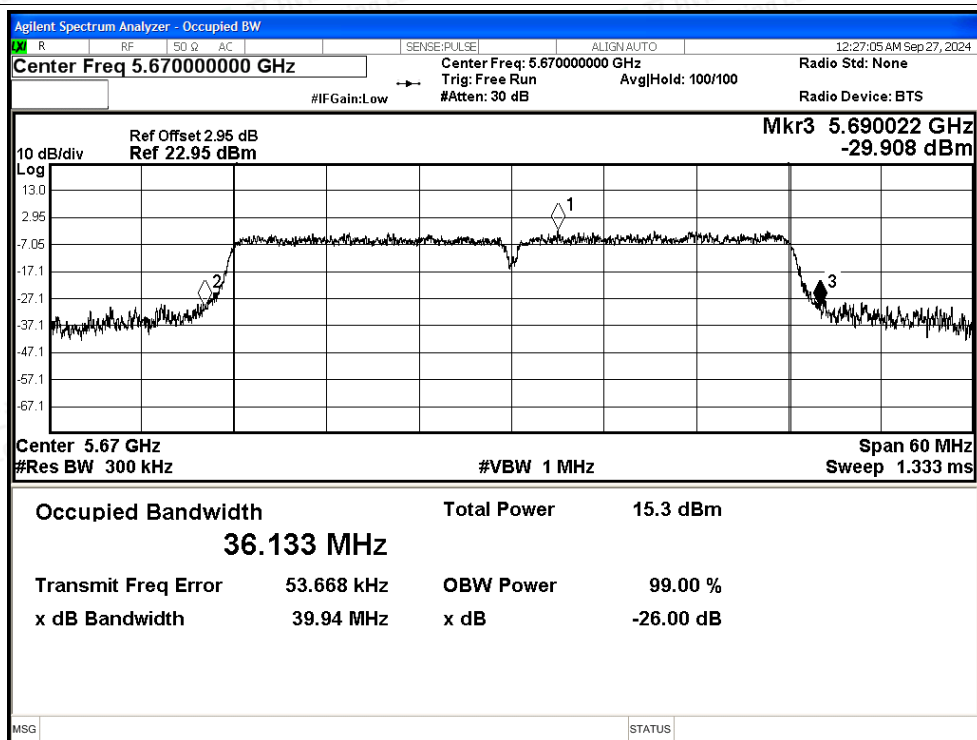

-26dB Bandwidth NVNT ac20 5500MHz Ant1

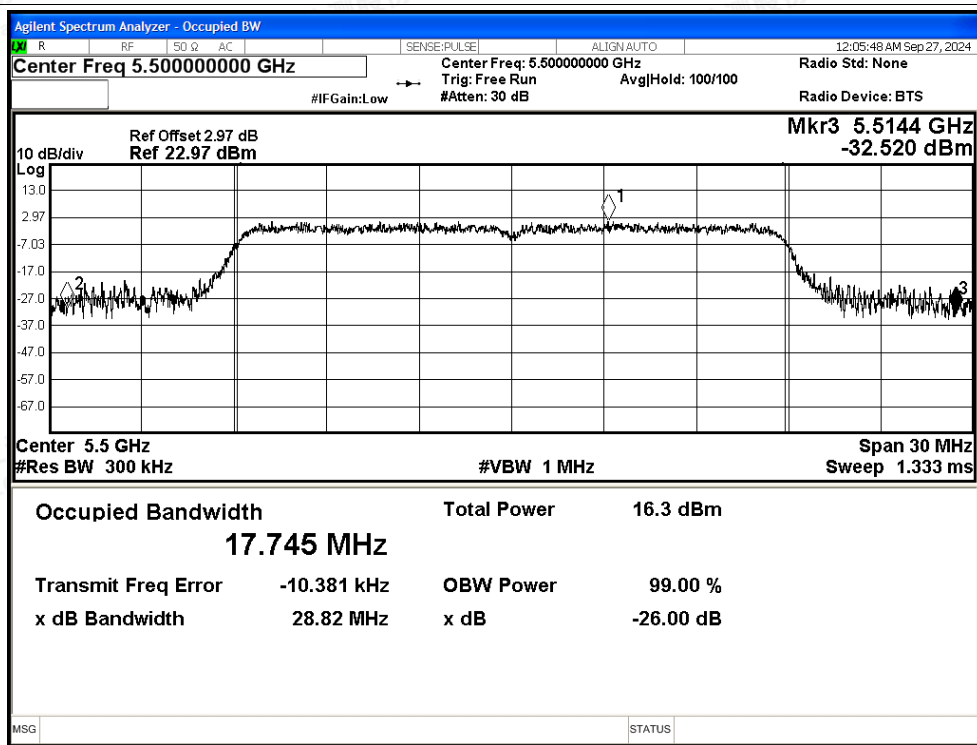

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5580MHz Ant1

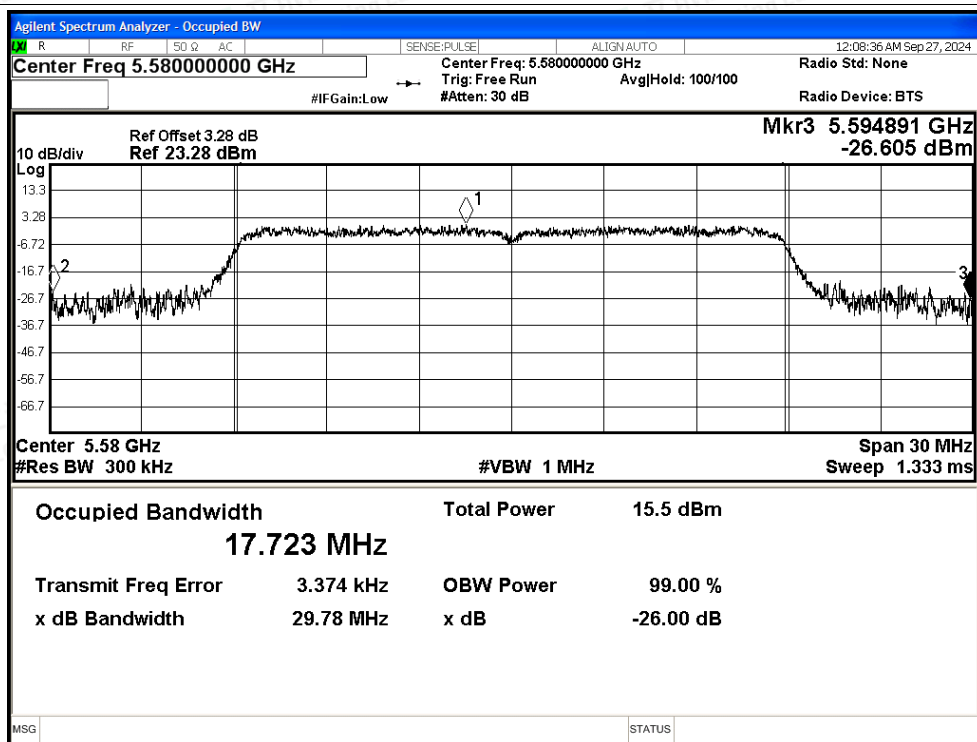

-26dB Bandwidth NVNT ac20 5700MHz Ant1

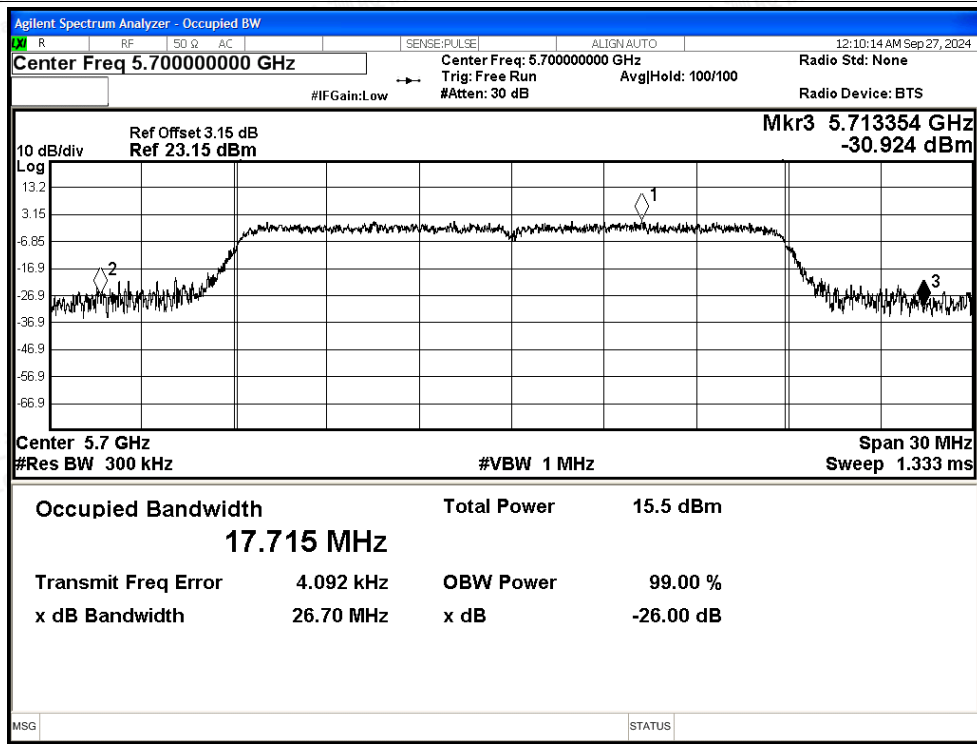

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5510MHz Ant1

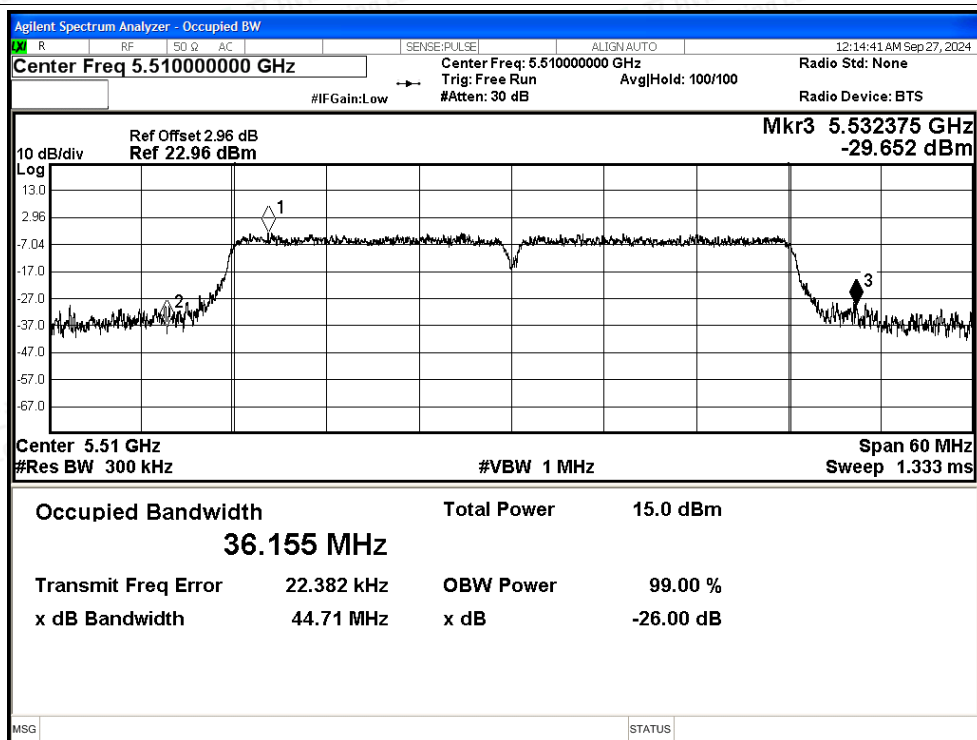

-26dB Bandwidth NVNT ac40 5550MHz Ant1

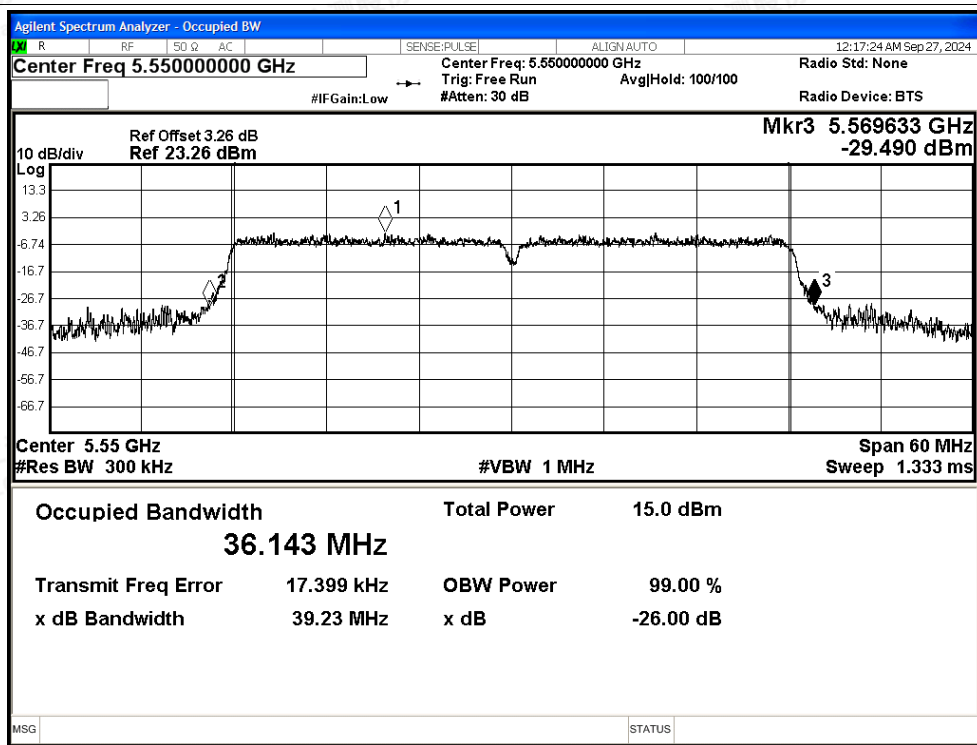

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5670MHz Ant1

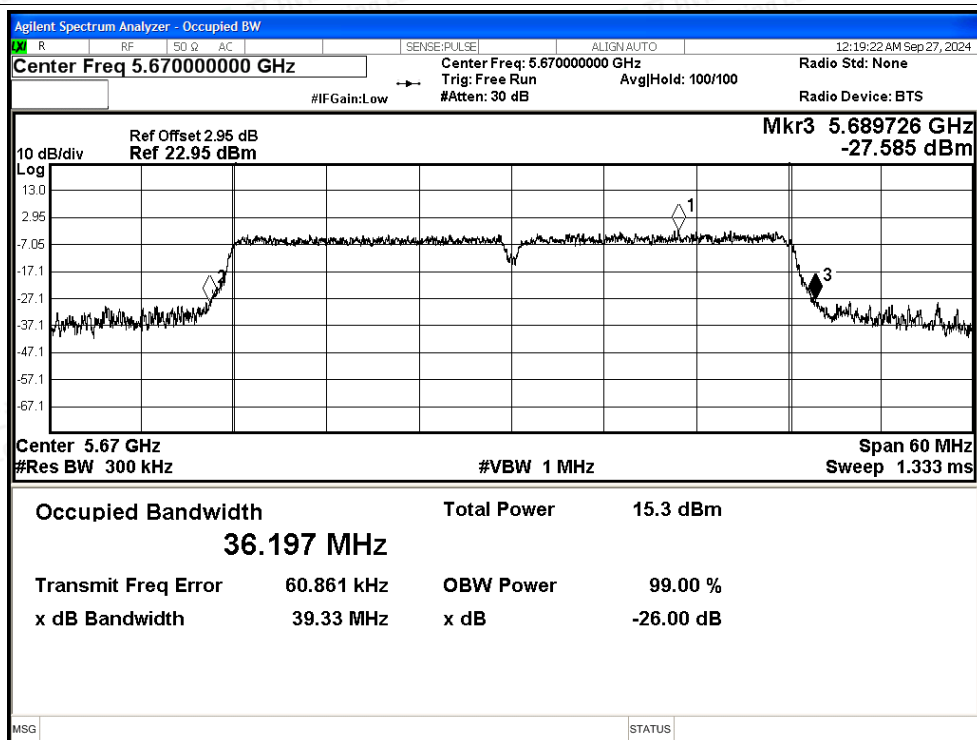

-26dB Bandwidth NVNT ac80 5530MHz Ant1

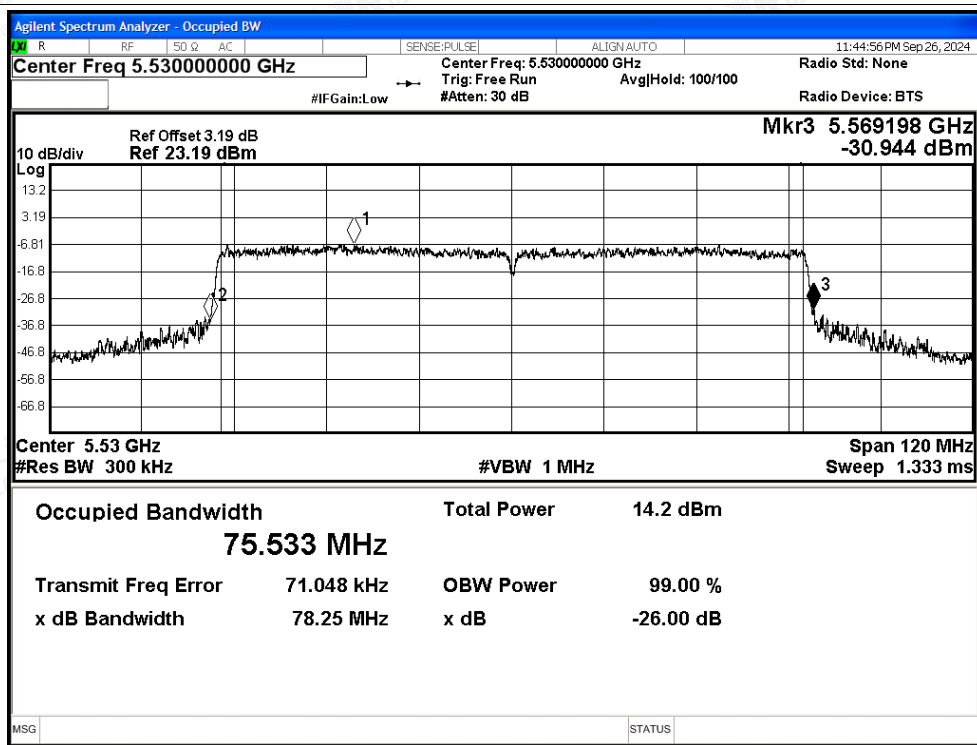

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac80 5610MHz Ant1

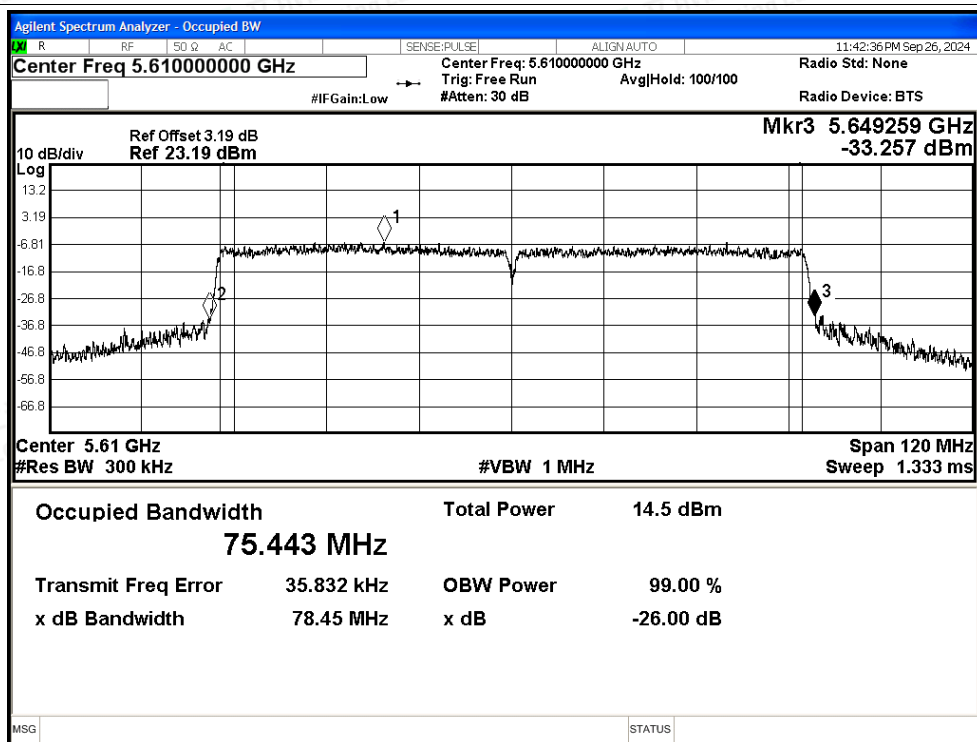

-26dB Bandwidth NVNT ax20 5500MHz Ant1

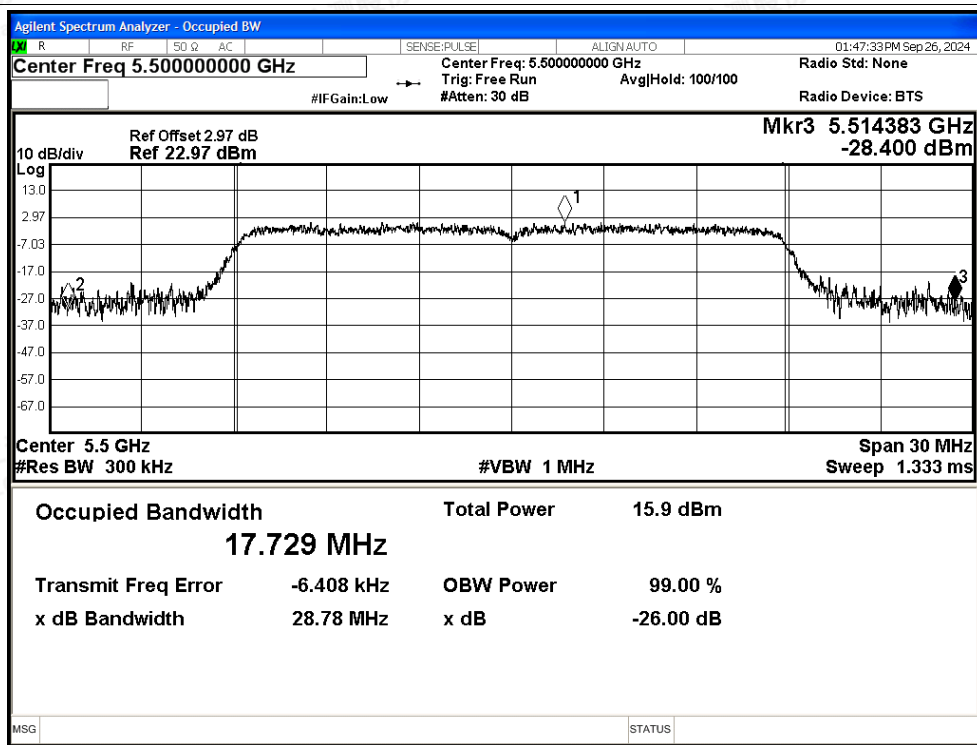

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5580MHz Ant1

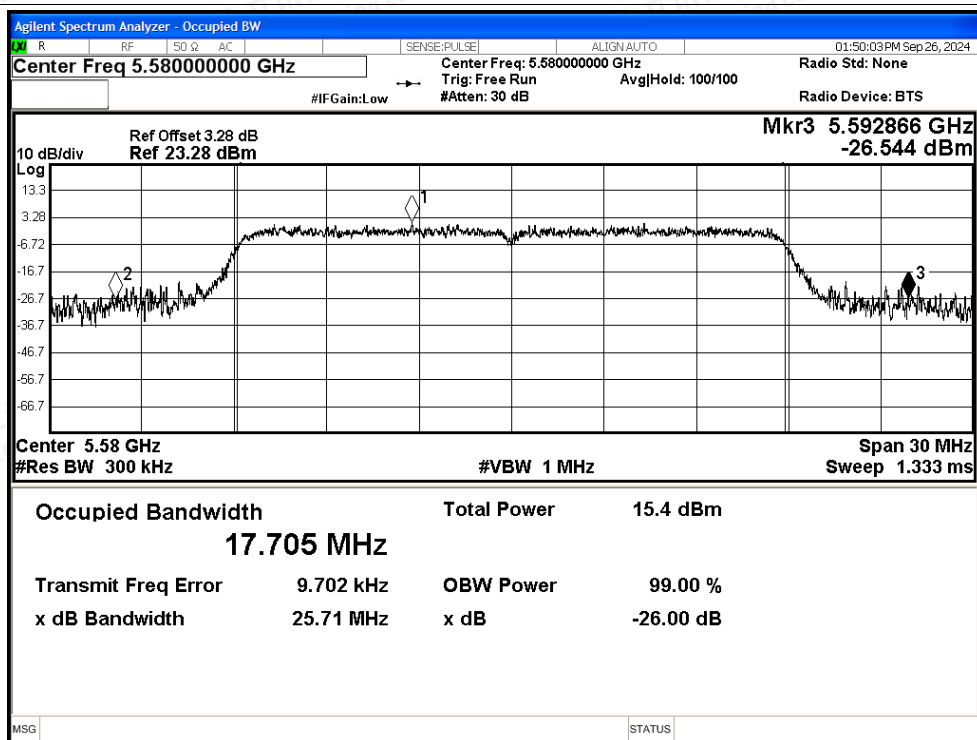

-26dB Bandwidth NVNT ax20 5700MHz Ant1

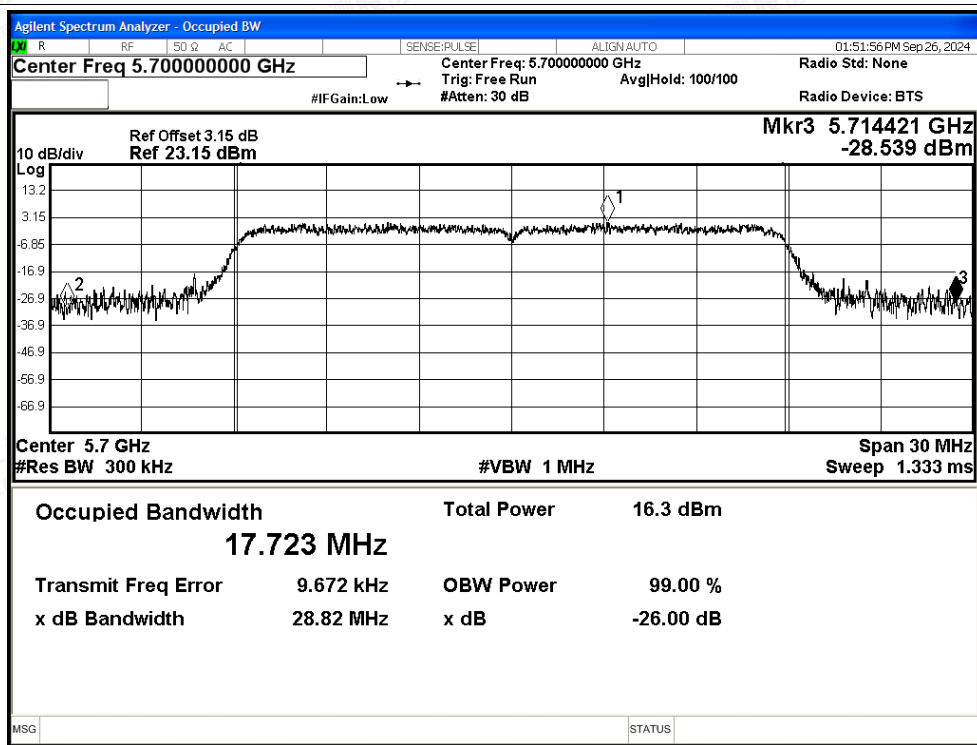

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5510MHz Ant1

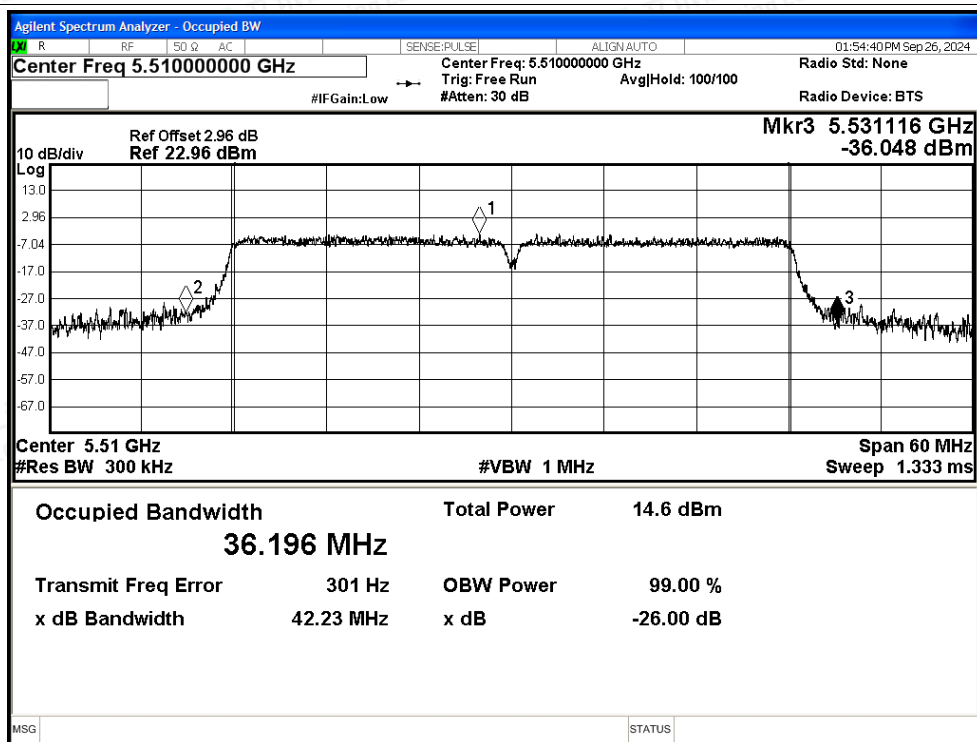

-26dB Bandwidth NVNT ax40 5550MHz Ant1

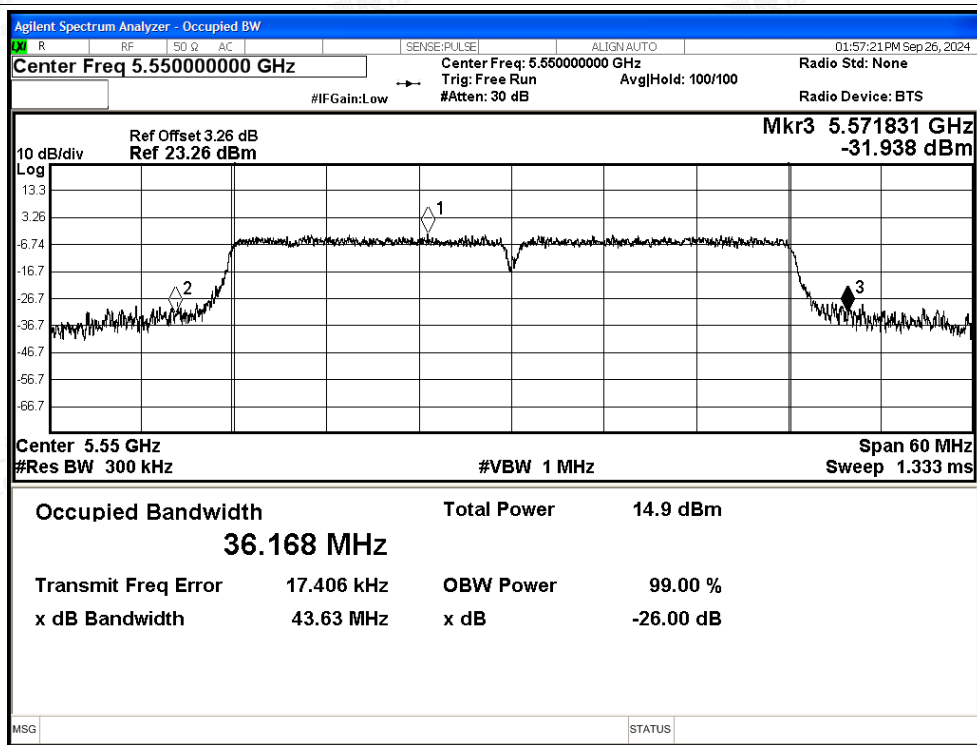

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5670MHz Ant1

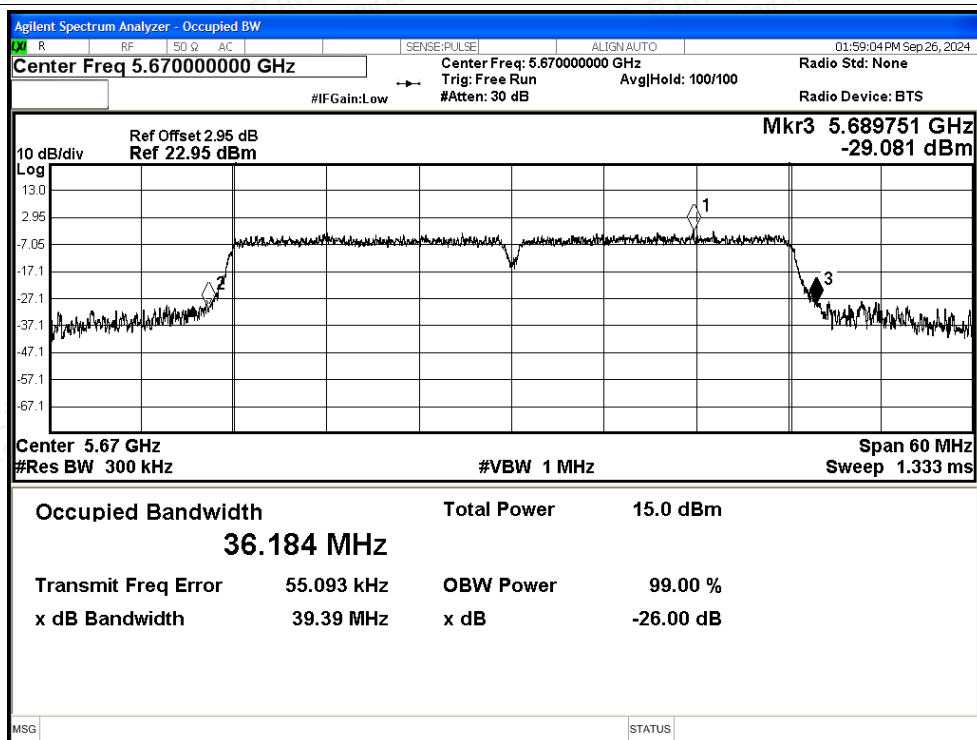

-26dB Bandwidth NVNT ax80 5530MHz Ant1

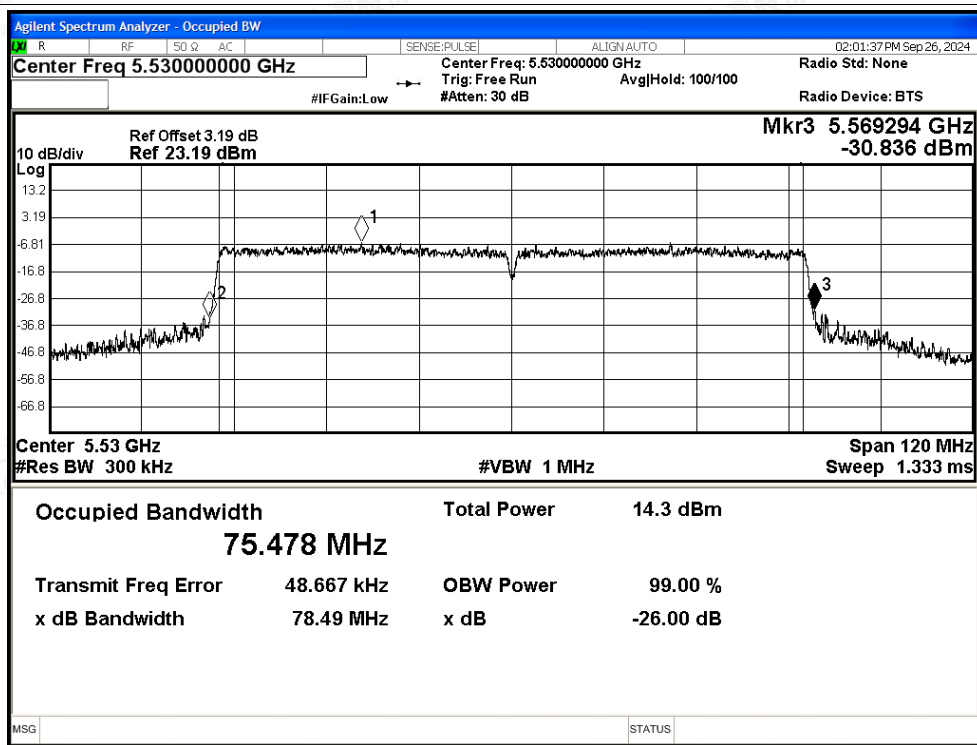


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

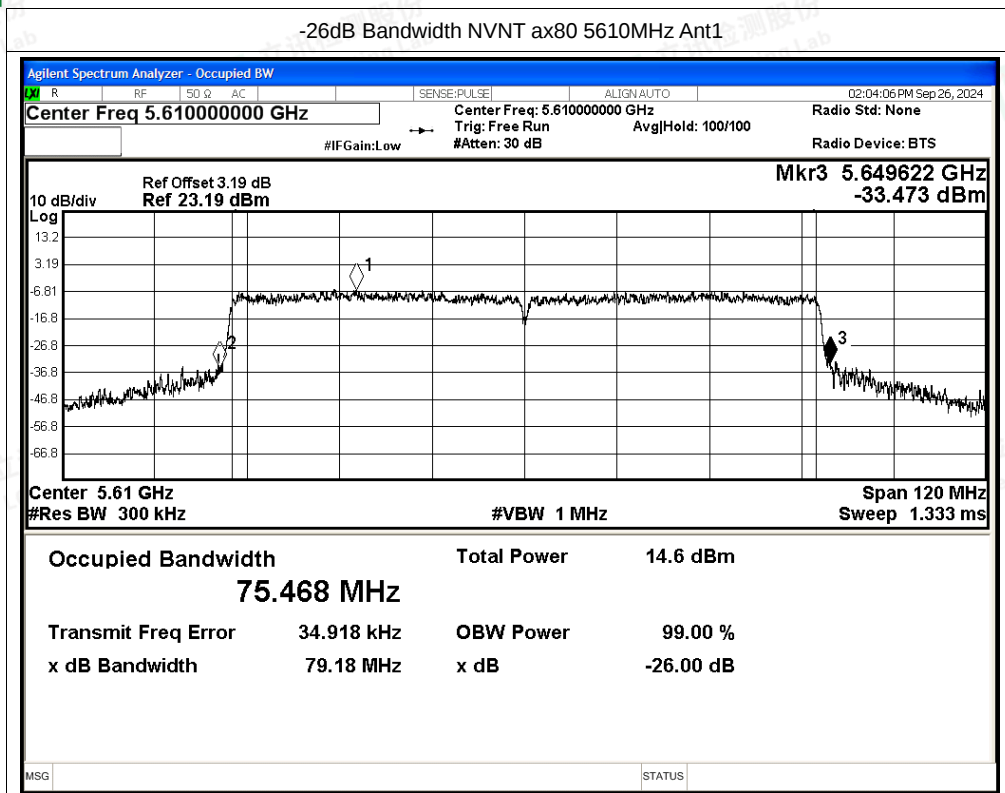

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5500	Ant0	12.17	0.24	12.41	23.7	Pass
NVNT	a	5580	Ant0	12.46	0.24	12.7	23.7	Pass
NVNT	a	5700	Ant0	12.35	0.24	12.59	23.7	Pass
NVNT	n20	5500	Ant0	11.72	0.12	11.84	23.7	Pass
NVNT	n20	5580	Ant0	11.09	0.12	11.21	23.7	Pass
NVNT	n20	5700	Ant0	10.99	0.12	11.11	23.7	Pass
NVNT	n40	5510	Ant0	10.36	0.12	10.48	23.7	Pass
NVNT	n40	5550	Ant0	10.51	0.12	10.63	23.7	Pass
NVNT	n40	5670	Ant0	10.83	0.12	10.95	23.7	Pass
NVNT	ac20	5500	Ant0	10.76	0.12	10.88	23.7	Pass
NVNT	ac20	5580	Ant0	11.06	0.12	11.18	23.7	Pass
NVNT	ac20	5700	Ant0	11	0.12	11.12	23.7	Pass
NVNT	ac40	5510	Ant0	10.25	0.12	10.37	23.7	Pass
NVNT	ac40	5550	Ant0	10.47	0.12	10.59	23.7	Pass
NVNT	ac40	5670	Ant0	10.76	0.12	10.88	23.7	Pass
NVNT	ac80	5530	Ant0	9.17	0.25	9.42	23.7	Pass
NVNT	ac80	5610	Ant0	9.46	0.25	9.71	23.7	Pass
NVNT	ax20	5500	Ant0	11.43	0.12	11.55	23.7	Pass
NVNT	ax20	5580	Ant0	10.99	0.12	11.11	23.7	Pass
NVNT	ax20	5700	Ant0	11.78	0.12	11.9	23.7	Pass
NVNT	ax40	5510	Ant0	10.17	0.12	10.29	23.7	Pass
NVNT	ax40	5550	Ant0	10.46	0.12	10.58	23.7	Pass
NVNT	ax40	5670	Ant0	10.93	0.12	11.05	23.7	Pass
NVNT	ax80	5530	Ant0	9.07	0.25	9.32	23.7	Pass
NVNT	ax80	5610	Ant0	9.24	0.25	9.49	23.7	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5500	Ant1	11.66	0.24	11.9	23.7	Pass
NVNT	a	5580	Ant1	11.91	0.24	12.15	23.7	Pass
NVNT	a	5700	Ant1	11.46	0.24	11.7	23.7	Pass
NVNT	n20	5500	Ant1	10.91	0.12	11.03	23.7	Pass
NVNT	n20	5580	Ant1	10.02	0.12	10.14	23.7	Pass
NVNT	n20	5700	Ant1	9.95	0.12	10.07	23.7	Pass
NVNT	n40	5510	Ant1	9.21	0.12	9.33	23.7	Pass
NVNT	n40	5550	Ant1	9.35	0.12	9.47	23.7	Pass
NVNT	n40	5670	Ant1	9.69	0.12	9.81	23.7	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5500	Ant1	10.79	0.12	10.91	23.7	Pass
NVNT	ac20	5580	Ant1	9.95	0.12	10.07	23.7	Pass
NVNT	ac20	5700	Ant1	9.96	0.12	10.08	23.7	Pass
NVNT	ac40	5510	Ant1	9.21	0.12	9.33	23.7	Pass
NVNT	ac40	5550	Ant1	9.46	0.12	9.58	23.7	Pass
NVNT	ac40	5670	Ant1	9.71	0.12	9.83	23.7	Pass
NVNT	ac80	5530	Ant1	8.22	0.25	8.47	23.7	Pass
NVNT	ac80	5610	Ant1	8.34	0.25	8.59	23.7	Pass
NVNT	ax20	5500	Ant1	10.44	0.12	10.56	23.7	Pass
NVNT	ax20	5580	Ant1	9.9	0.12	10.02	23.7	Pass
NVNT	ax20	5700	Ant1	10.77	0.12	10.89	23.7	Pass
NVNT	ax40	5510	Ant1	8.86	0.24	9.1	23.7	Pass
NVNT	ax40	5550	Ant1	9.26	0.24	9.5	23.7	Pass
NVNT	ax40	5670	Ant1	9.19	0.24	9.43	23.7	Pass
NVNT	ax80	5530	Ant1	8.29	0.25	8.54	23.7	Pass
NVNT	ax80	5610	Ant1	8.46	0.25	8.71	23.7	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)			Limit (dBm)	Verdict
			Ant0	Ant1	Ant0+Ant1		
NVNT	n20	5500	11.84	11.03	14.46	23.7	Pass
NVNT	n20	5580	11.21	10.14	13.72	23.7	Pass
NVNT	n20	5700	11.11	10.07	13.63	23.7	Pass
NVNT	n40	5510	10.48	9.33	12.95	23.7	Pass
NVNT	n40	5550	10.63	9.47	13.10	23.7	Pass
NVNT	n40	5670	10.95	9.81	13.43	23.7	Pass
NVNT	ac20	5500	10.88	10.91	13.91	23.7	Pass
NVNT	ac20	5580	11.18	10.07	13.67	23.7	Pass
NVNT	ac20	5700	11.12	10.08	13.64	23.7	Pass
NVNT	ac40	5510	10.37	9.33	12.89	23.7	Pass
NVNT	ac40	5550	10.59	9.58	13.12	23.7	Pass
NVNT	ac40	5670	10.88	9.83	13.40	23.7	Pass
NVNT	ac80	5530	9.42	8.47	11.98	23.7	Pass
NVNT	ac80	5610	9.71	8.59	12.20	23.7	Pass
NVNT	ax20	5500	11.55	10.56	14.09	23.7	Pass
NVNT	ax20	5580	11.11	10.02	13.61	23.7	Pass
NVNT	ax20	5700	11.9	10.89	14.43	23.7	Pass
NVNT	ax40	5510	10.29	9.1	12.75	23.7	Pass
NVNT	ax40	5550	10.58	9.5	13.08	23.7	Pass
NVNT	ax40	5670	11.05	9.43	13.33	23.7	Pass
NVNT	ax80	5530	9.32	8.54	11.96	23.7	Pass
NVNT	ax80	5610	9.49	8.71	12.13	23.7	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5500	Ant0	1.69	0.24	1.93	10.7	Pass
NVNT	a	5580	Ant0	2.46	0.24	2.7	10.7	Pass
NVNT	a	5700	Ant0	1.68	0.24	1.92	10.7	Pass
NVNT	n20	5500	Ant0	0.59	0.12	0.71	10.7	Pass
NVNT	n20	5580	Ant0	-1.06	0.12	-0.94	10.7	Pass
NVNT	n20	5700	Ant0	-1.07	0.12	-0.95	10.7	Pass
NVNT	n40	5510	Ant0	-3.62	0.12	-3.5	10.7	Pass
NVNT	n40	5550	Ant0	-3.46	0.12	-3.34	10.7	Pass
NVNT	n40	5670	Ant0	-2.75	0.12	-2.63	10.7	Pass
NVNT	ac20	5500	Ant0	-0.28	0.12	-0.16	10.7	Pass
NVNT	ac20	5580	Ant0	-0.89	0.12	-0.77	10.7	Pass
NVNT	ac20	5700	Ant0	-1.07	0.12	-0.95	10.7	Pass
NVNT	ac40	5510	Ant0	-3.49	0.12	-3.37	10.7	Pass
NVNT	ac40	5550	Ant0	-3.6	0.12	-3.48	10.7	Pass
NVNT	ac40	5670	Ant0	-3.19	0.12	-3.07	10.7	Pass
NVNT	ac80	5530	Ant0	-7.34	0.25	-7.09	10.7	Pass
NVNT	ac80	5610	Ant0	-7.18	0.25	-6.93	10.7	Pass
NVNT	ax20	5500	Ant0	1.13	0.12	1.25	10.7	Pass
NVNT	ax20	5580	Ant0	0.27	0.12	0.39	10.7	Pass
NVNT	ax20	5700	Ant0	1.25	0.12	1.37	10.7	Pass
NVNT	ax40	5510	Ant0	-3.48	0.12	-3.36	10.7	Pass
NVNT	ax40	5550	Ant0	-3.53	0.12	-3.41	10.7	Pass
NVNT	ax40	5670	Ant0	-2.71	0.12	-2.59	10.7	Pass
NVNT	ax80	5530	Ant0	-7.25	0.25	-7	10.7	Pass
NVNT	ax80	5610	Ant0	-7.13	0.25	-6.88	10.7	Pass





Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5500	Ant1	1.05	0.24	1.29	10.7	Pass
NVNT	a	5580	Ant1	1.27	0.24	1.51	10.7	Pass
NVNT	a	5700	Ant1	0.79	0.24	1.03	10.7	Pass
NVNT	n20	5500	Ant1	0.46	0.12	0.58	10.7	Pass
NVNT	n20	5580	Ant1	0.3	0.12	0.42	10.7	Pass
NVNT	n20	5700	Ant1	-1.09	0.12	-0.97	10.7	Pass
NVNT	n40	5510	Ant1	-4.58	0.12	-4.46	10.7	Pass
NVNT	n40	5550	Ant1	-4.49	0.12	-4.37	10.7	Pass
NVNT	n40	5670	Ant1	-3.81	0.12	-3.69	10.7	Pass
NVNT	ac20	5500	Ant1	0.27	0.12	0.39	10.7	Pass
NVNT	ac20	5580	Ant1	-0.76	0.12	-0.64	10.7	Pass
NVNT	ac20	5700	Ant1	-0.95	0.12	-0.83	10.7	Pass
NVNT	ac40	5510	Ant1	-4.75	0.12	-4.63	10.7	Pass
NVNT	ac40	5550	Ant1	-4.57	0.12	-4.45	10.7	Pass
NVNT	ac40	5670	Ant1	-3.86	0.12	-3.74	10.7	Pass
NVNT	ac80	5530	Ant1	-8.59	0.25	-8.34	10.7	Pass
NVNT	ac80	5610	Ant1	-7.97	0.25	-7.72	10.7	Pass
NVNT	ax20	5500	Ant1	-0.51	0.12	-0.39	10.7	Pass
NVNT	ax20	5580	Ant1	-1.02	0.12	-0.9	10.7	Pass
NVNT	ax20	5700	Ant1	-0.06	0.12	0.06	10.7	Pass
NVNT	ax40	5510	Ant1	-4.85	0.24	-4.61	10.7	Pass
NVNT	ax40	5550	Ant1	-4.37	0.24	-4.13	10.7	Pass
NVNT	ax40	5670	Ant1	-4.43	0.24	-4.19	10.7	Pass
NVNT	ax80	5530	Ant1	-8.21	0.25	-7.96	10.7	Pass
NVNT	ax80	5610	Ant1	-8.17	0.25	-7.92	10.7	Pass





MIMO

Condition	Mode	Frequency (MHz)	Conducted PSD (dBm/MHz)		Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
			Duty Factor (dB)				
			Ant0	Ant1			
NVNT	n20	5500	0.71	0.58	3.66	7.69	Pass
NVNT	n20	5580	-0.94	0.42	2.80	7.69	Pass
NVNT	n20	5700	-0.95	-0.97	2.05	7.69	Pass
NVNT	n40	5510	-3.5	-4.46	-0.94	7.69	Pass
NVNT	n40	5550	-3.34	-4.37	-0.81	7.69	Pass
NVNT	n40	5670	-2.63	-3.69	-0.12	7.69	Pass
NVNT	ac20	5500	-0.16	0.39	3.13	7.69	Pass
NVNT	ac20	5580	-0.77	-0.64	2.31	7.69	Pass
NVNT	ac20	5700	-0.95	-0.83	2.12	7.69	Pass
NVNT	ac40	5510	-3.37	-4.63	-0.94	7.69	Pass
NVNT	ac40	5550	-3.48	-4.45	-0.93	7.69	Pass
NVNT	ac40	5670	-3.07	-3.74	-0.38	7.69	Pass
NVNT	ac80	5530	-7.09	-8.34	-4.66	7.69	Pass
NVNT	ac80	5610	-6.93	-7.72	-4.30	7.69	Pass
NVNT	ax20	5500	1.25	-0.39	3.52	7.69	Pass
NVNT	ax20	5580	0.39	-0.9	2.80	7.69	Pass
NVNT	ax20	5700	1.37	0.06	3.77	7.69	Pass
NVNT	ax40	5510	-3.36	-4.61	-0.93	7.69	Pass
NVNT	ax40	5550	-3.41	-4.13	-0.74	7.69	Pass
NVNT	ax40	5670	-2.59	-4.19	-0.31	7.69	Pass
NVNT	ax80	5530	-7	-7.96	-4.44	7.69	Pass
NVNT	ax80	5610	-6.88	-7.92	-4.36	7.69	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

PSD NVNT a 5500MHz Ant0

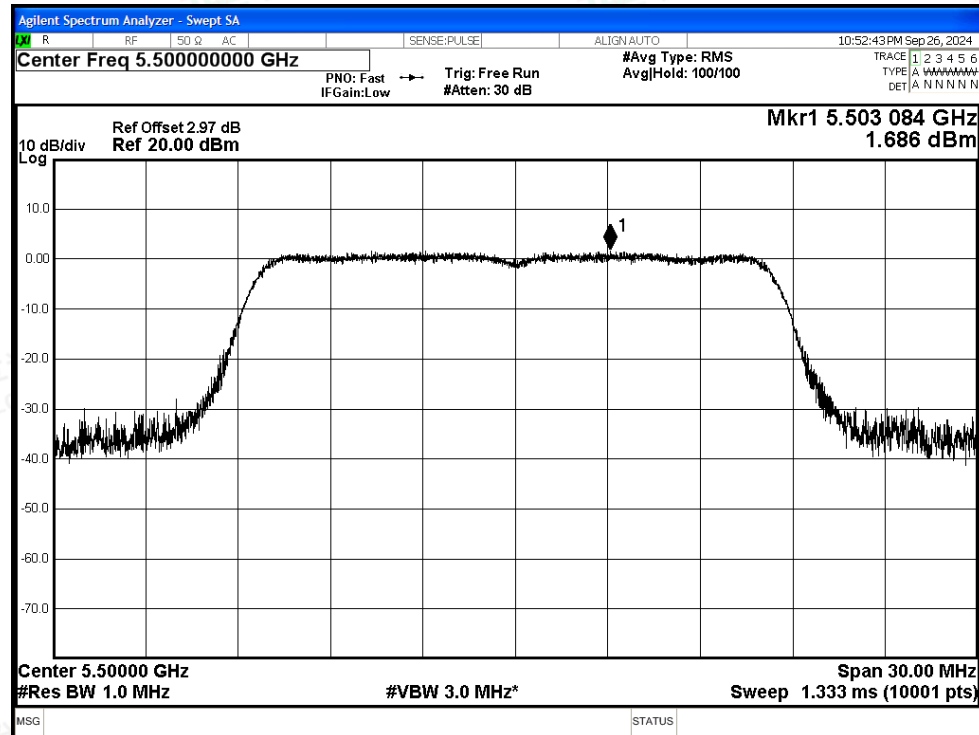


PSD NVNT a 5580MHz Ant0

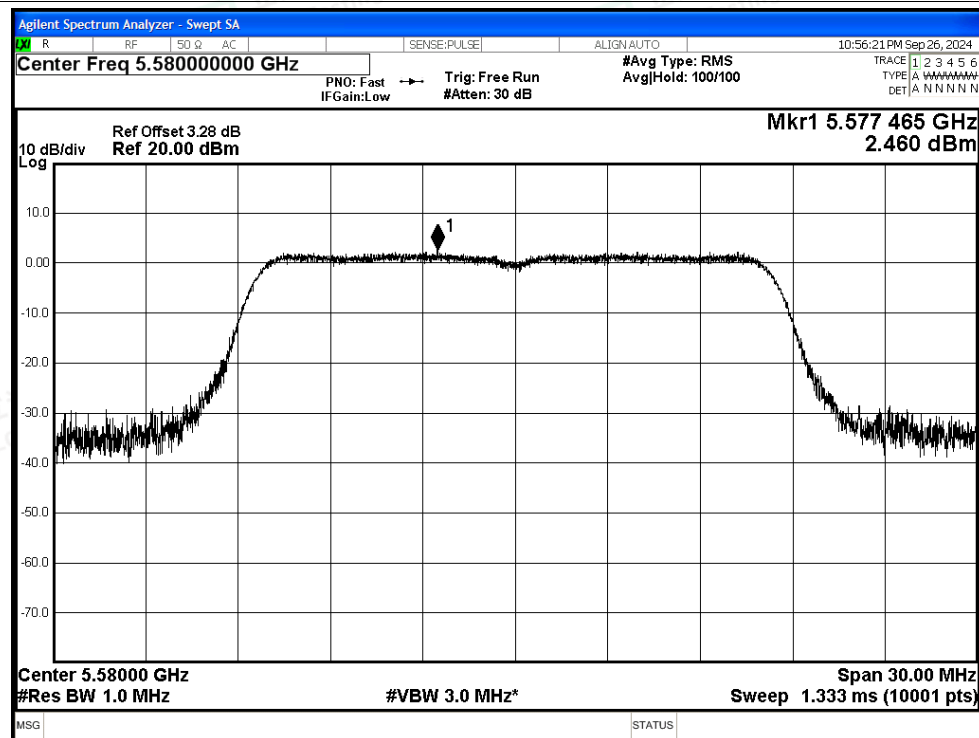








PSD NVNT a 5700MHz Ant0


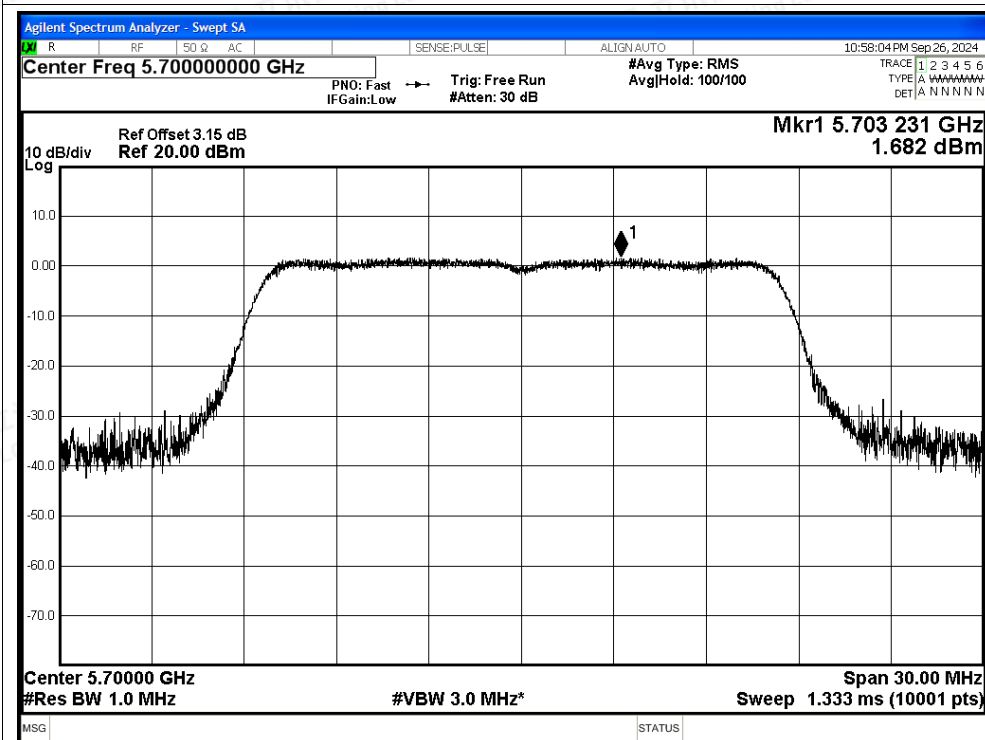




PSD NVNT n20 5500MHz Ant0

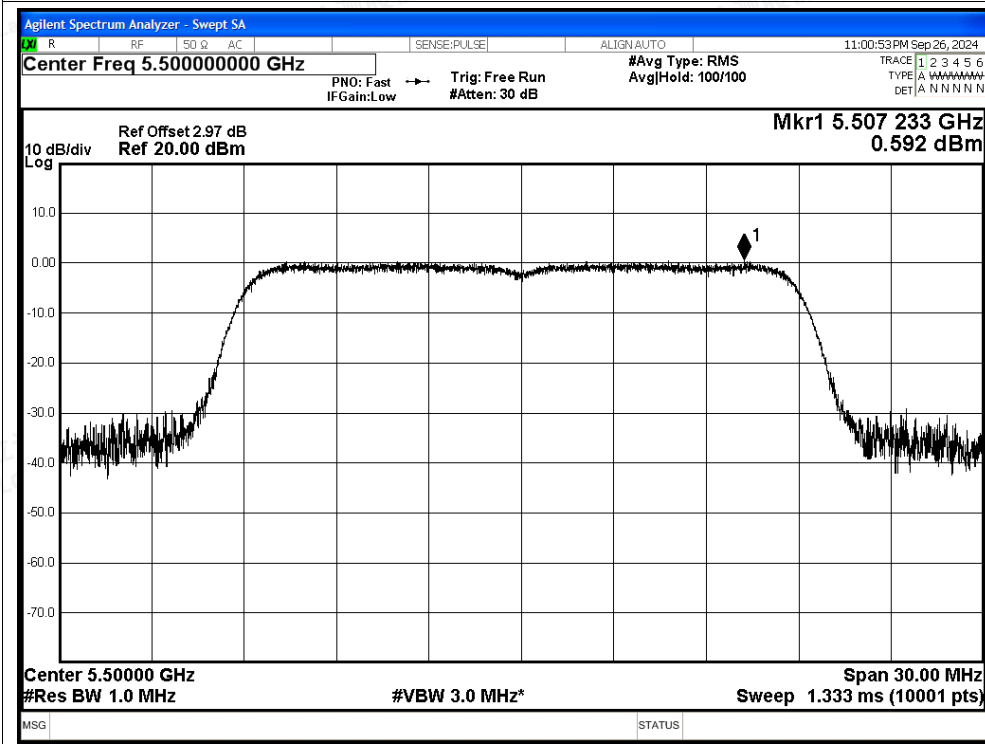

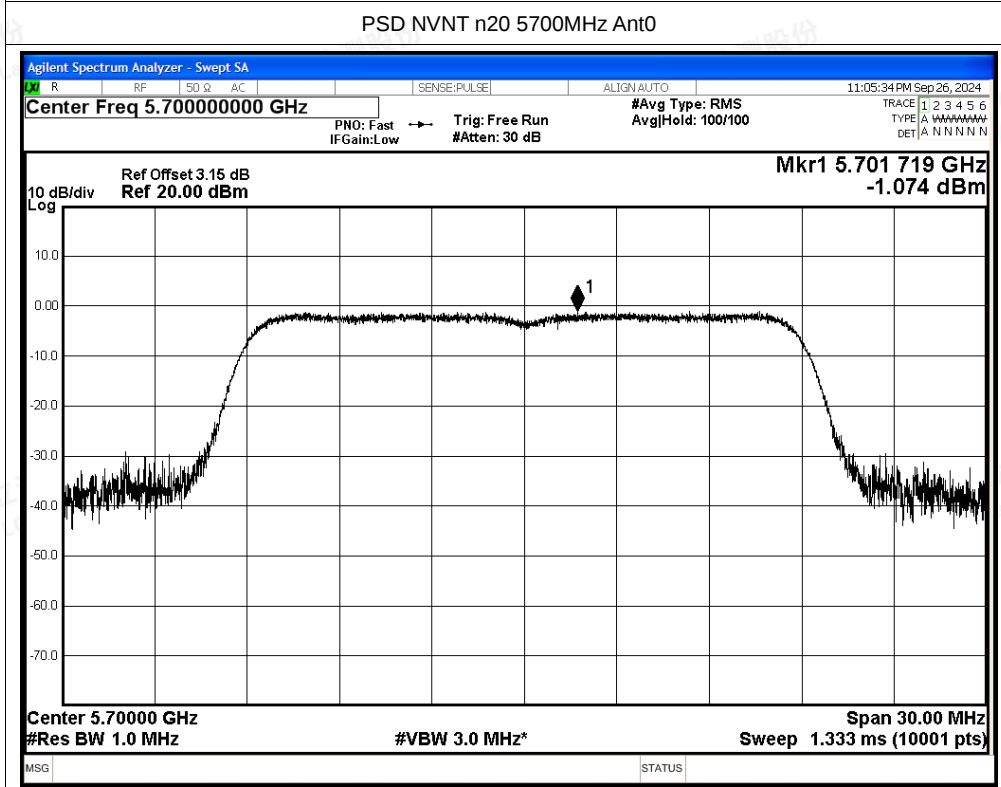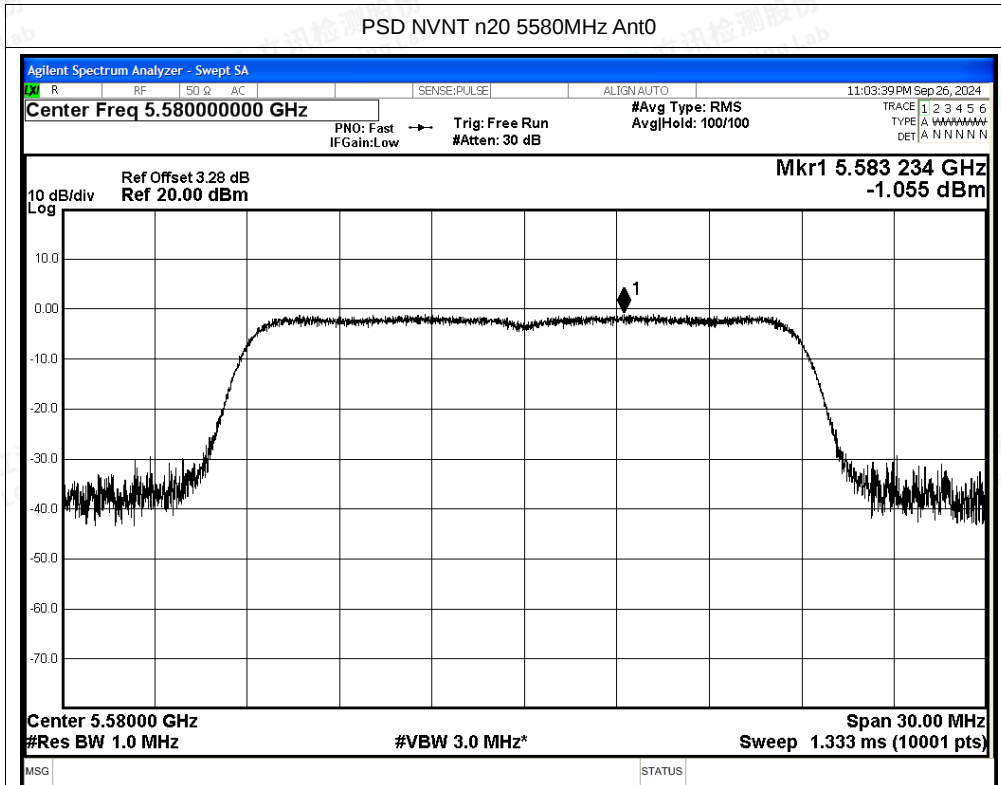

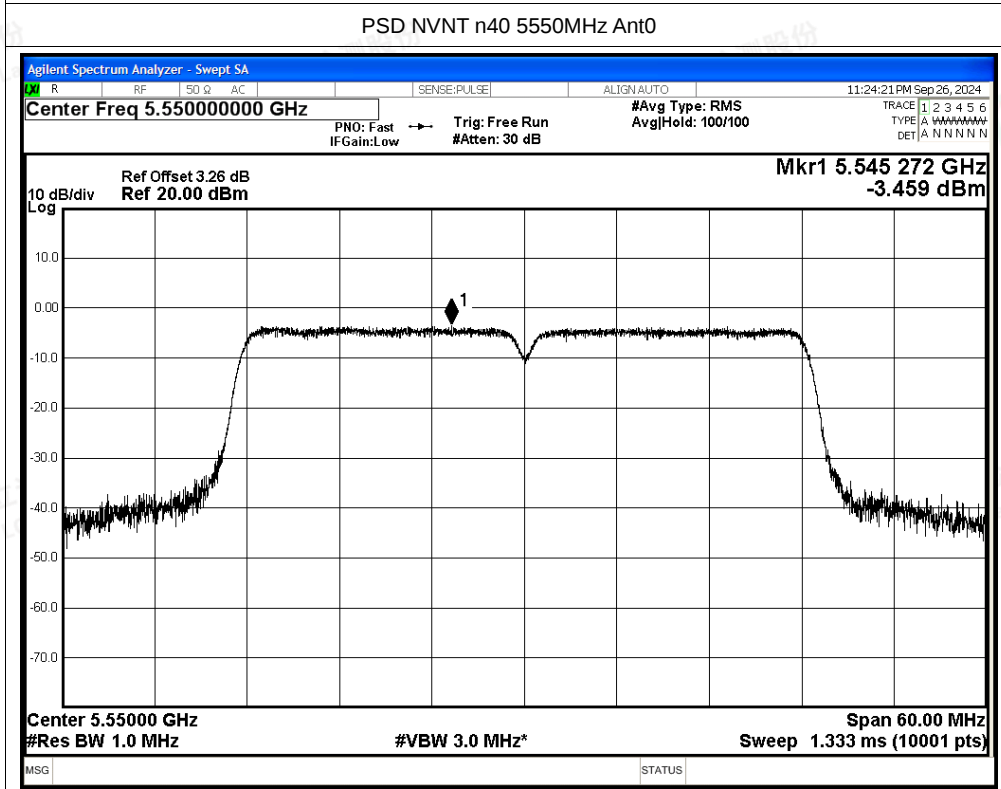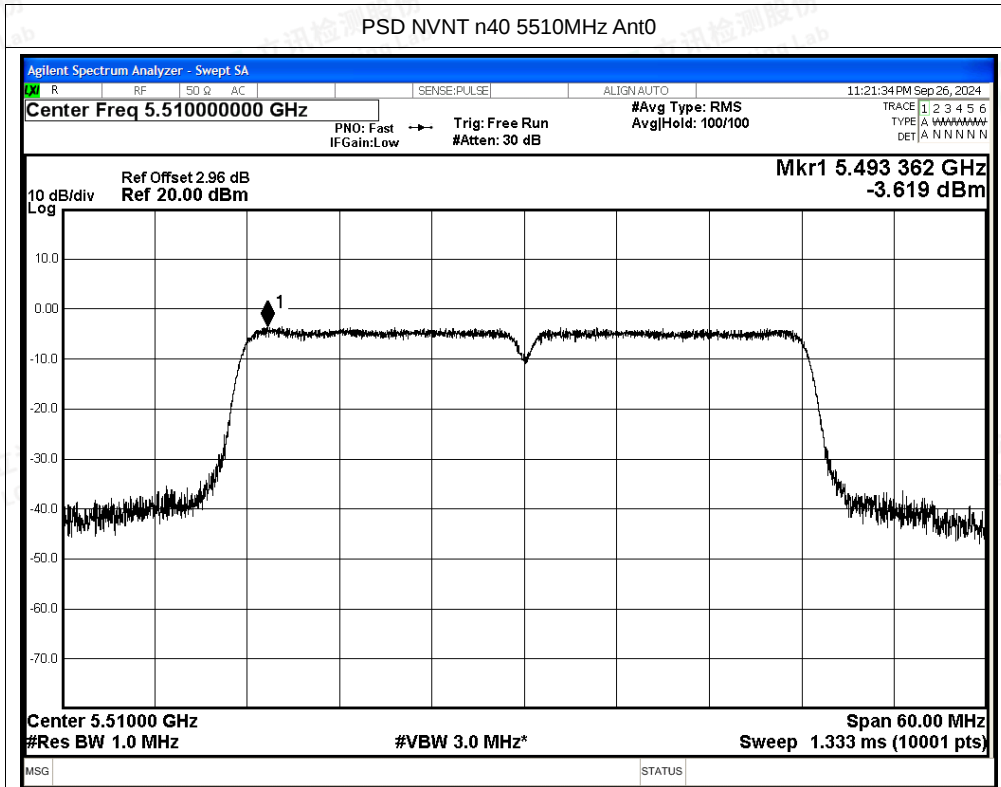


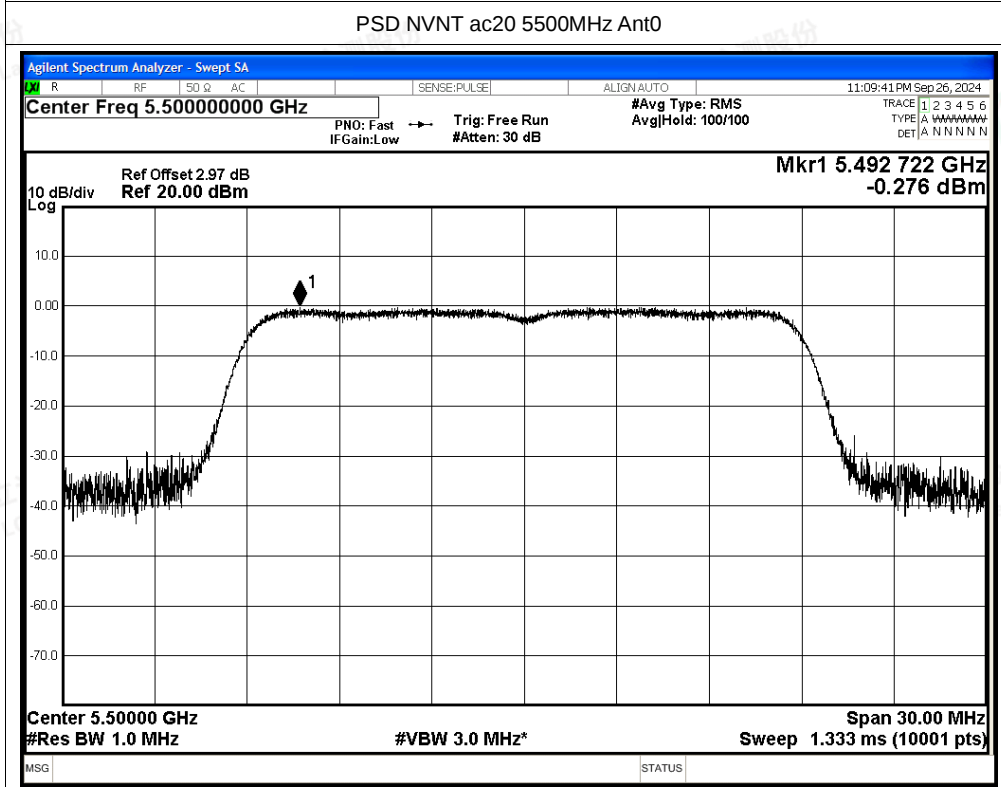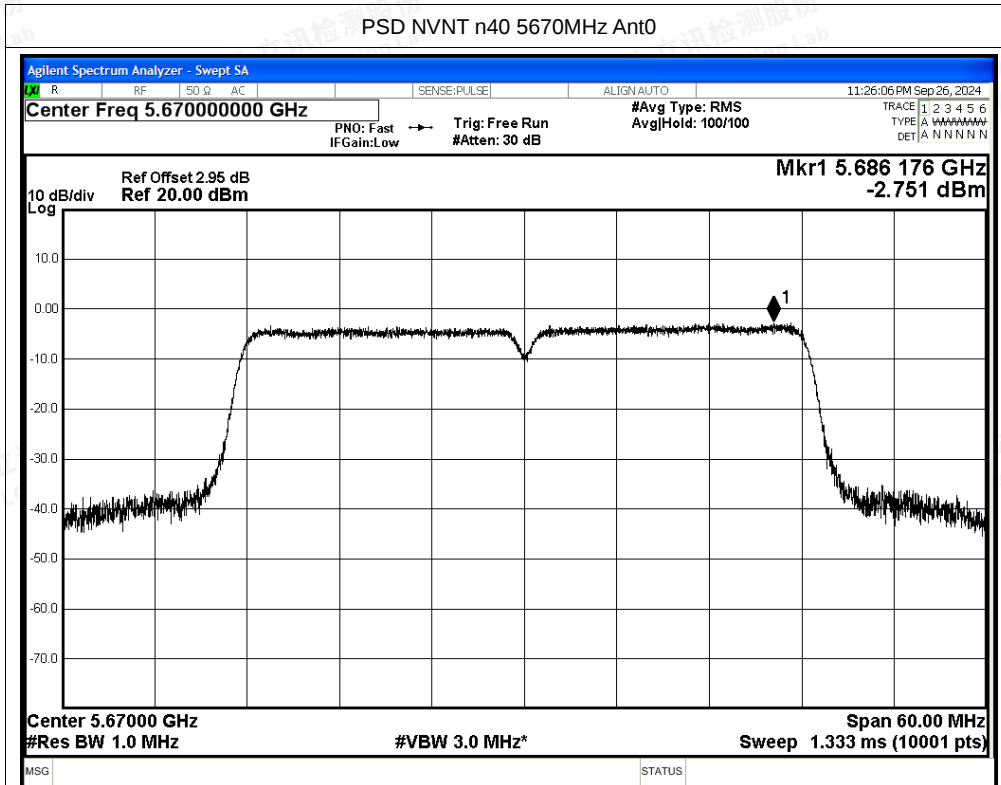

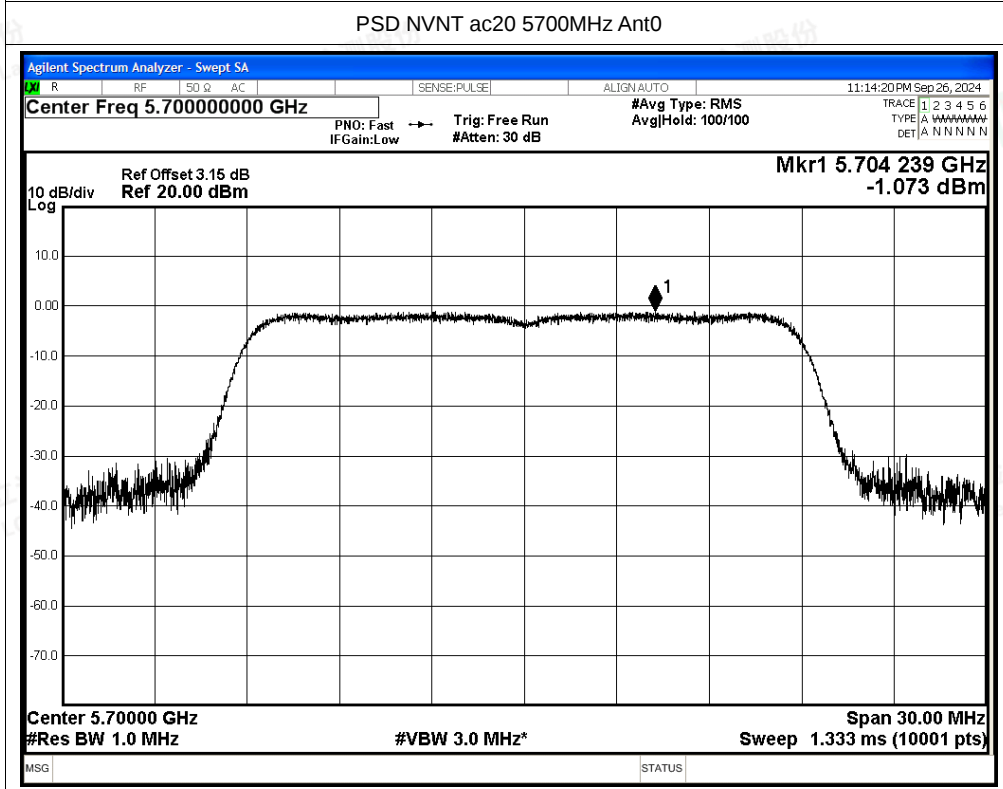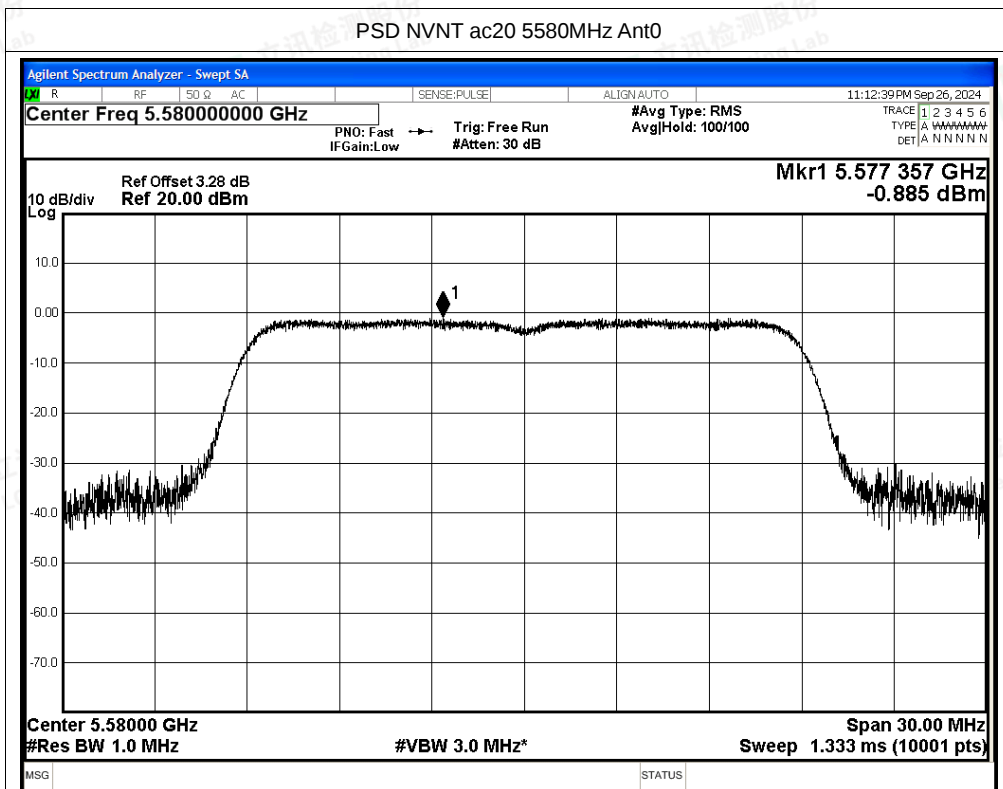




PSD NVNT ac40 5510MHz Ant0

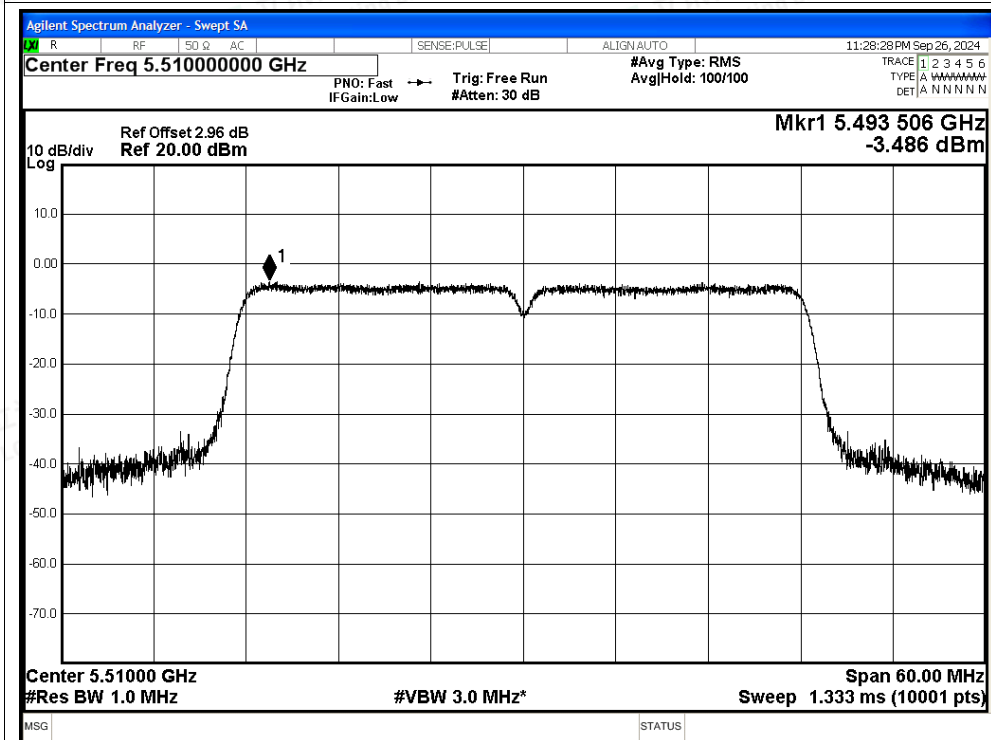


PSD NVNT ac40 5550MHz Ant0

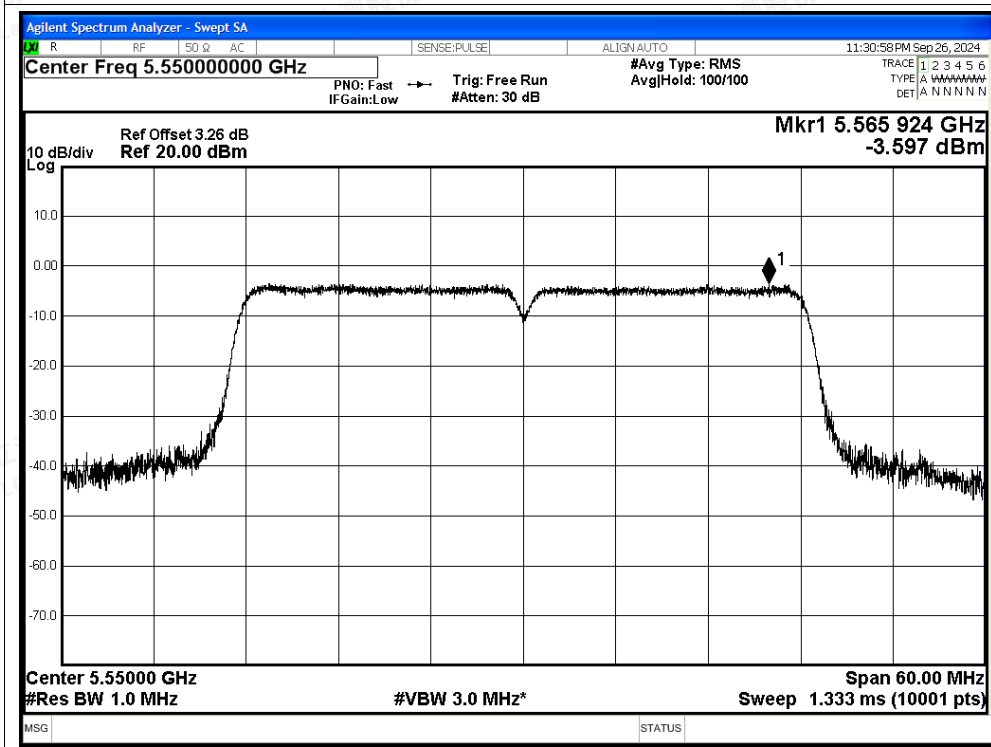




PSD NVNT ac40 5670MHz Ant0

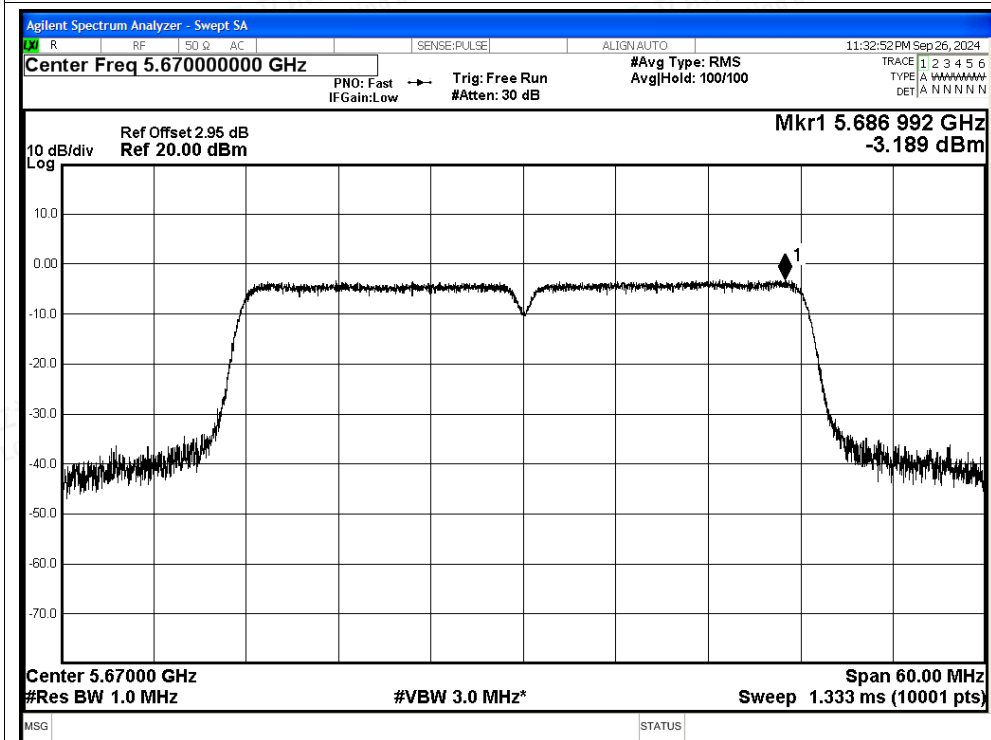


PSD NVNT ac80 5530MHz Ant0

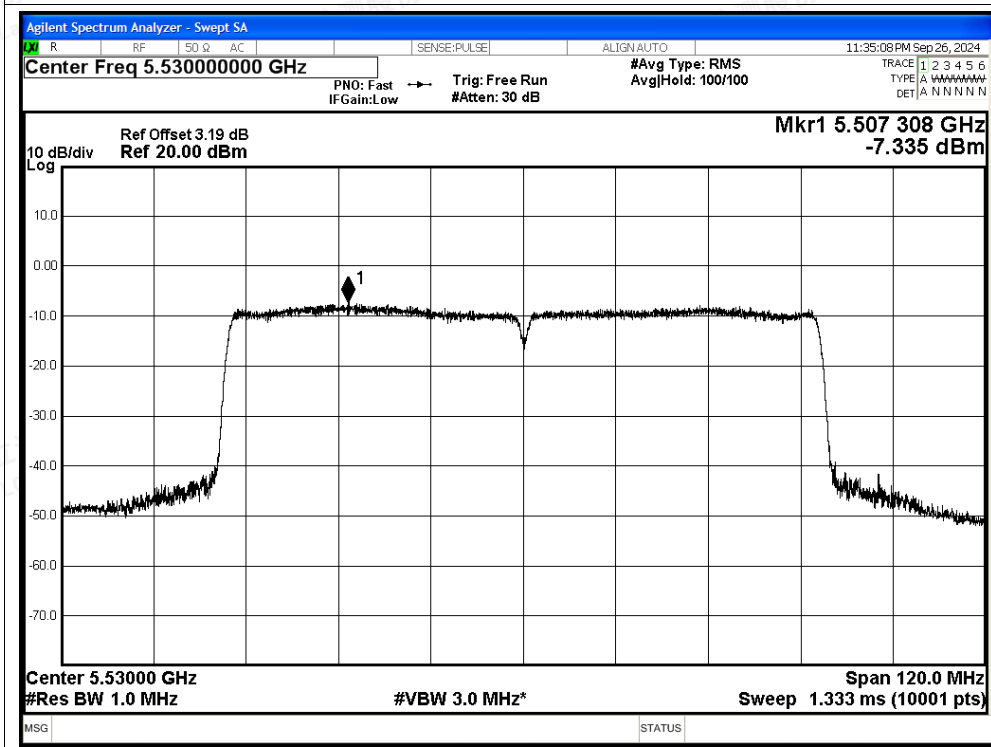






PSD NVNT ac80 5610MHz Ant0

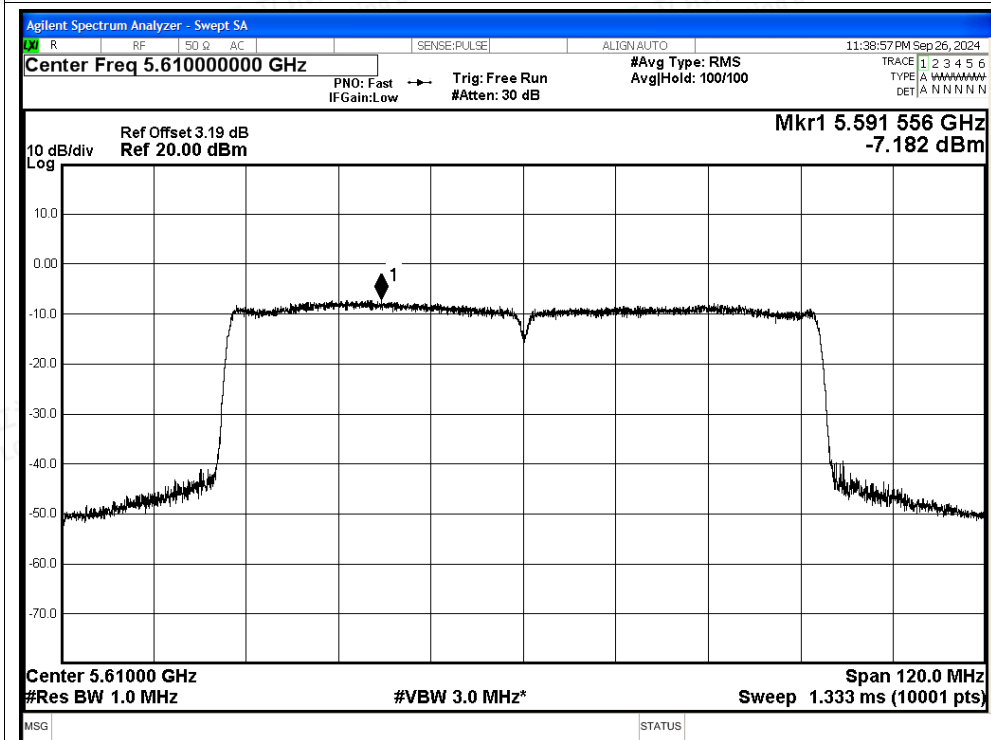


PSD NVNT ax20 5500MHz Ant0

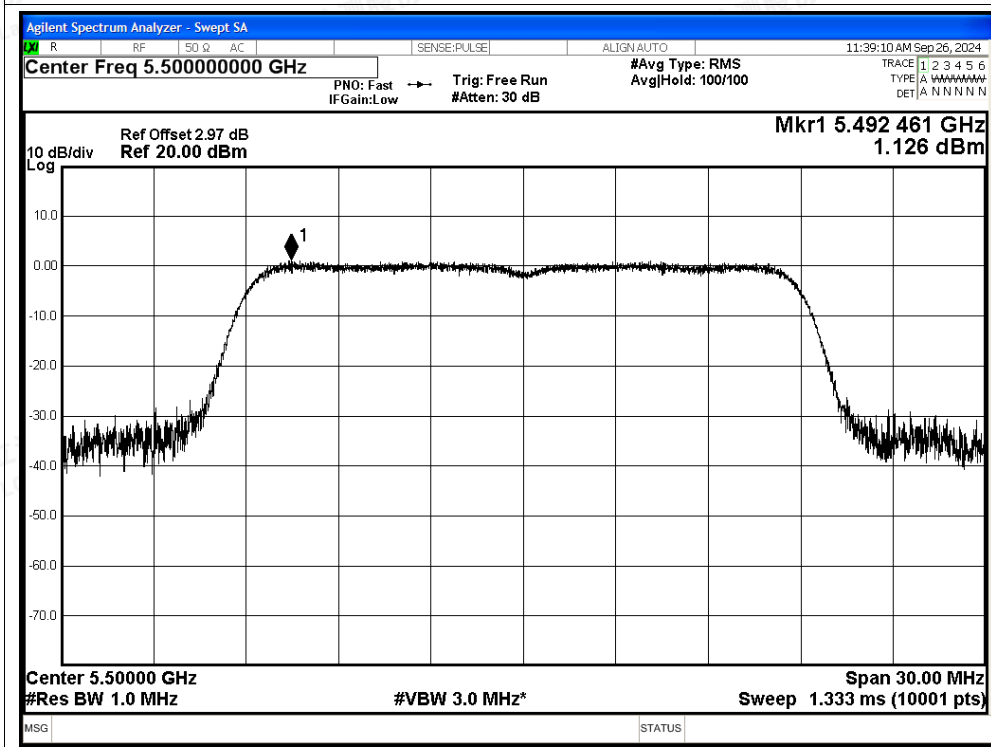

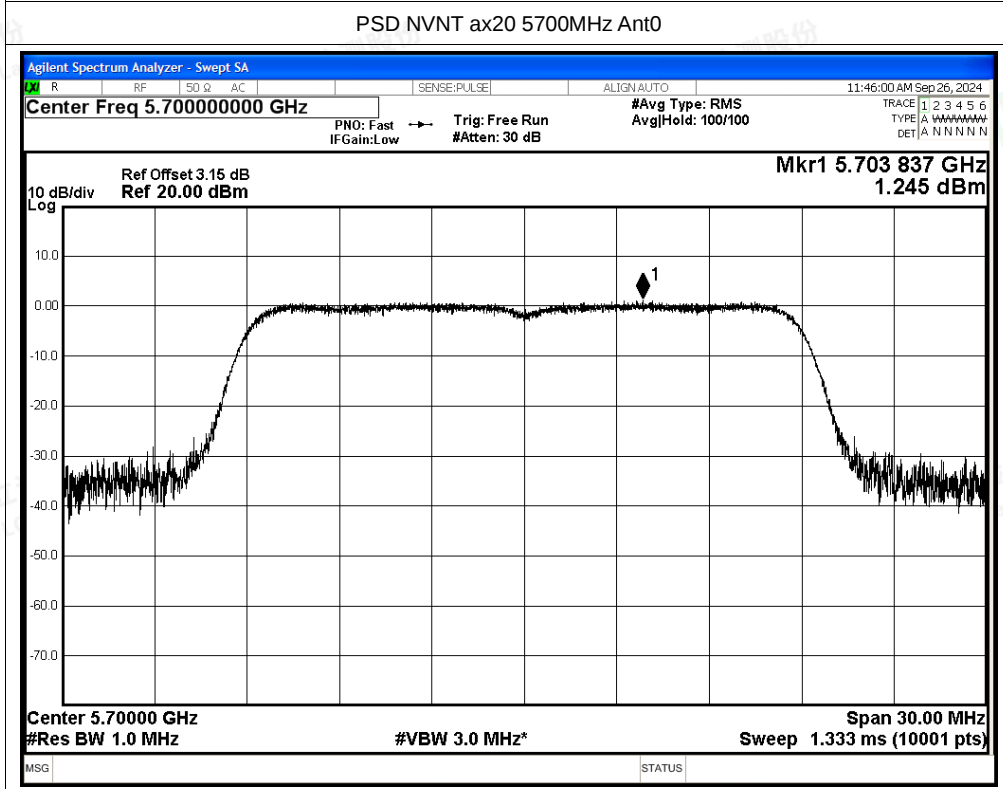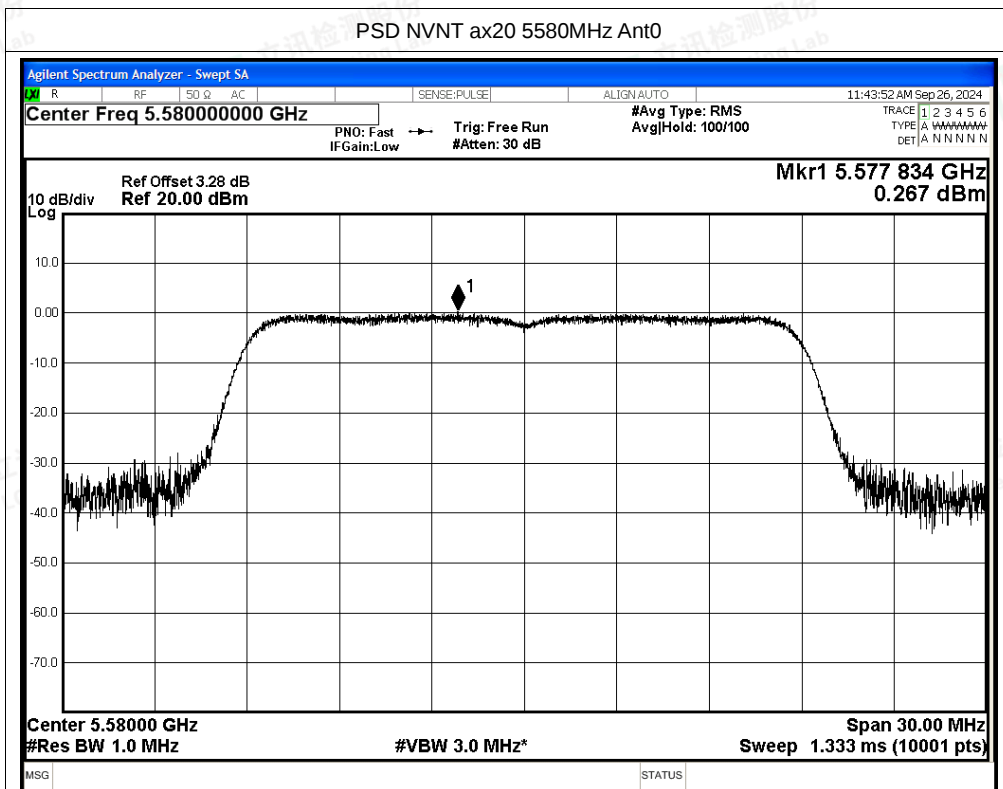




PSD NVNT ax40 5510MHz Ant0

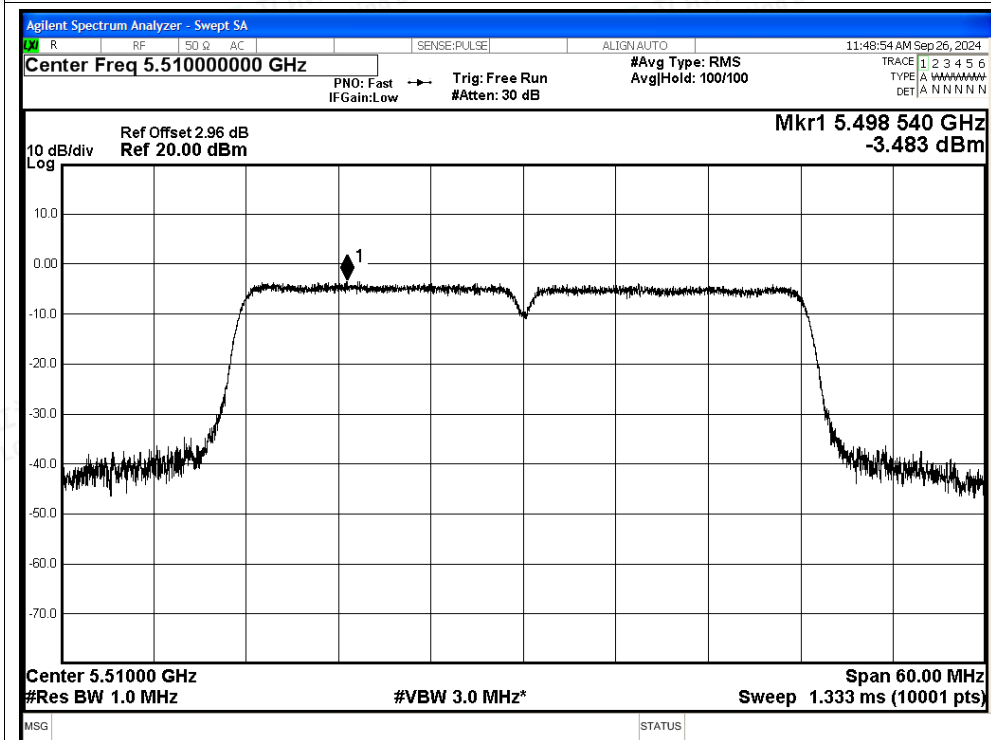


PSD NVNT ax40 5550MHz Ant0

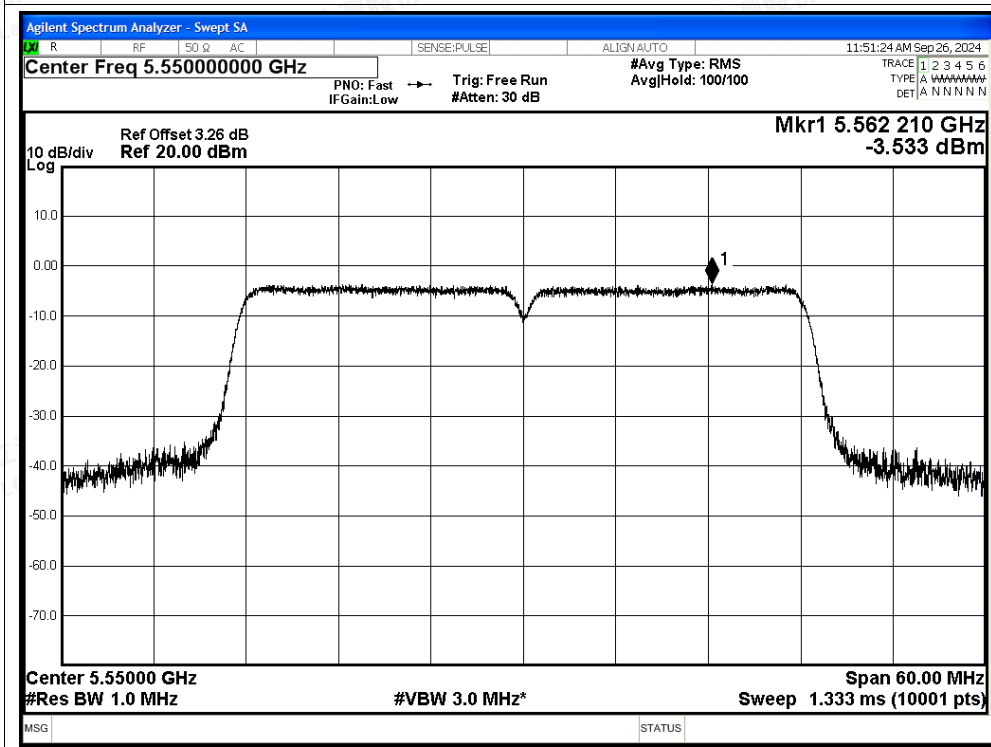





PSD NVNT ax40 5670MHz Ant0

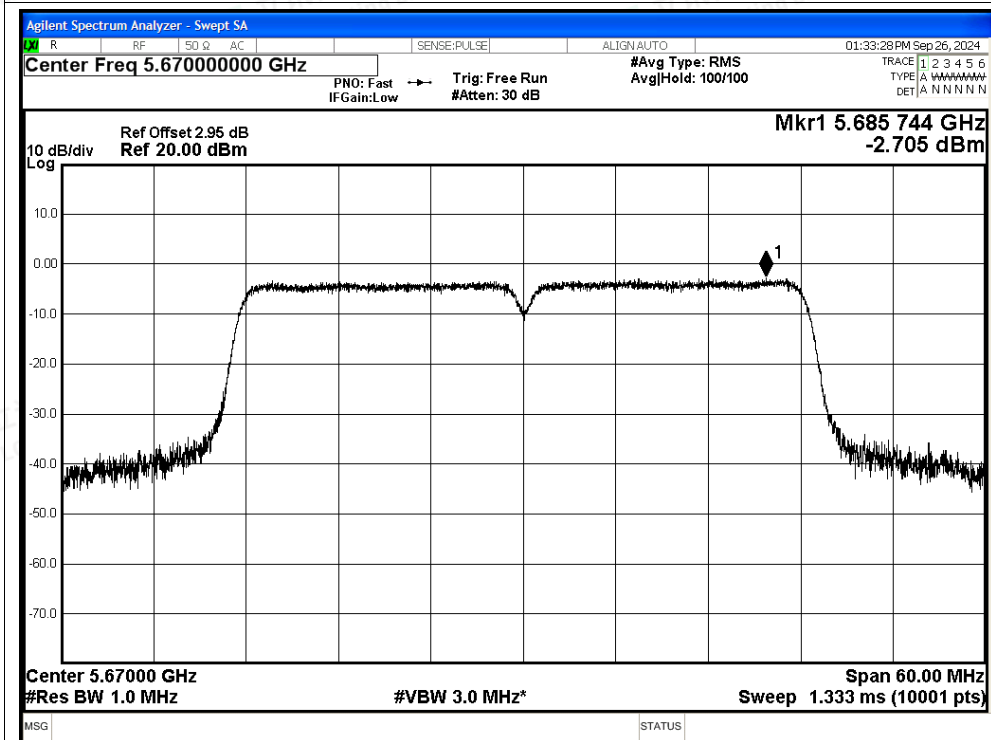

PSD NVNT ax80 5530MHz Ant0

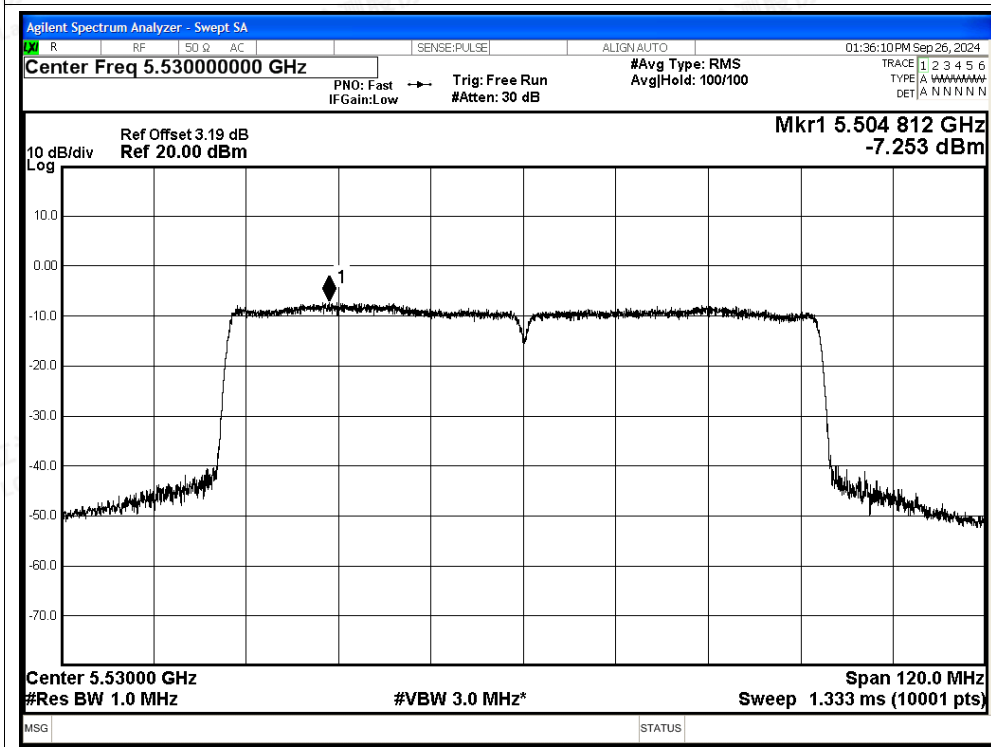


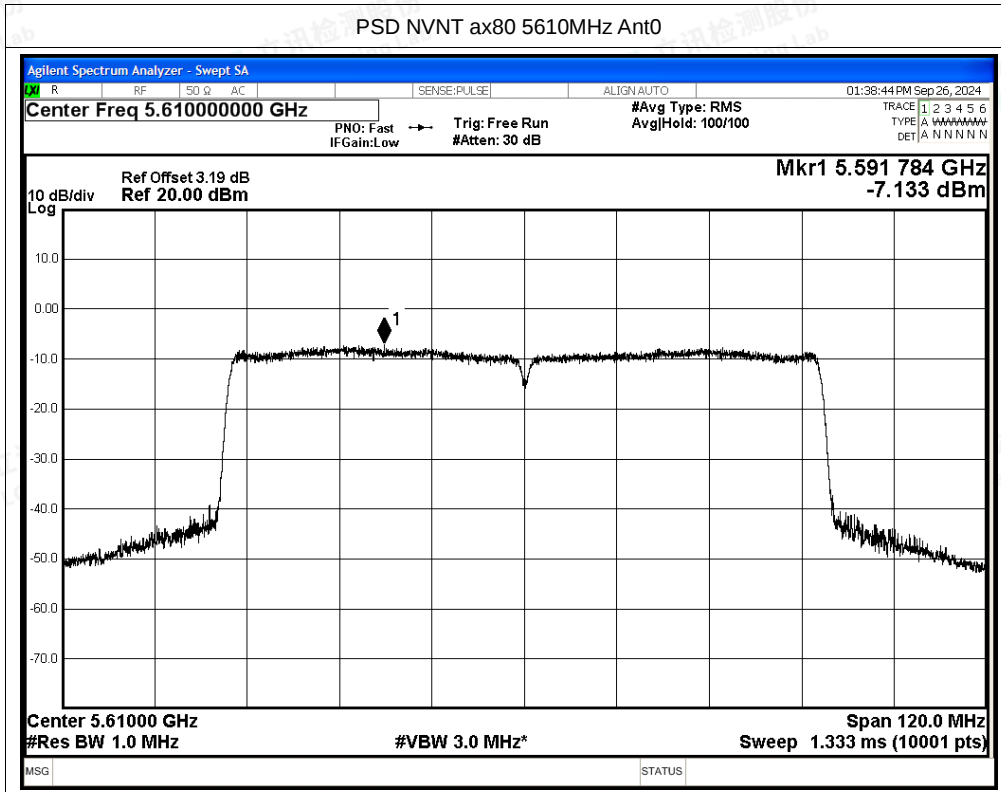




Test Graphs

PSD NVNT a 5500MHz Ant1

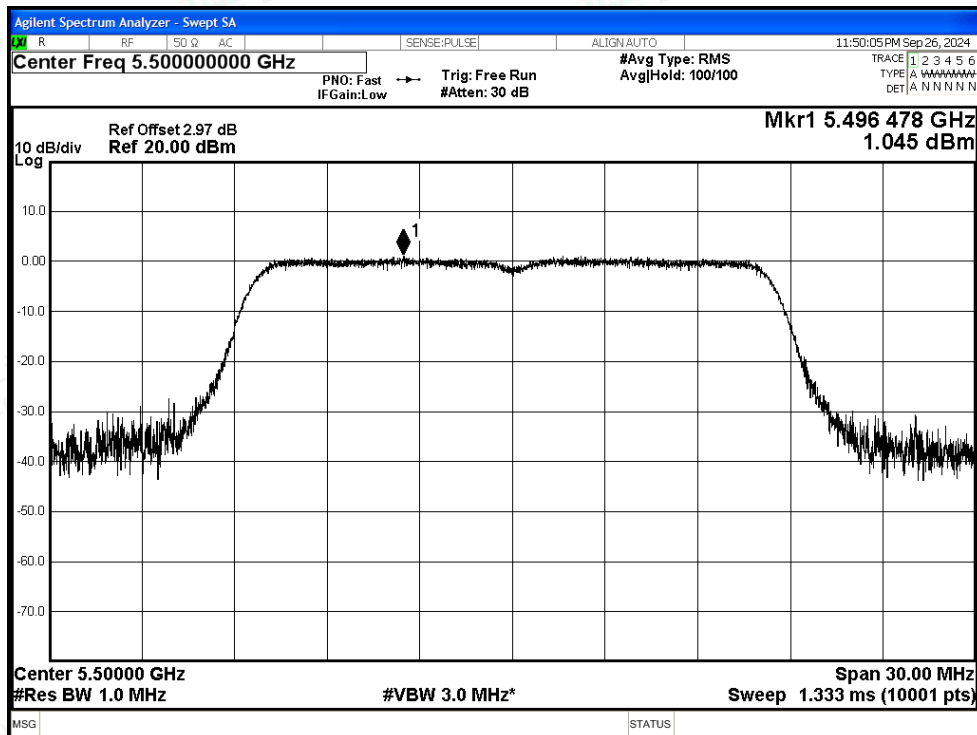

PSD NVNT a 5580MHz Ant1

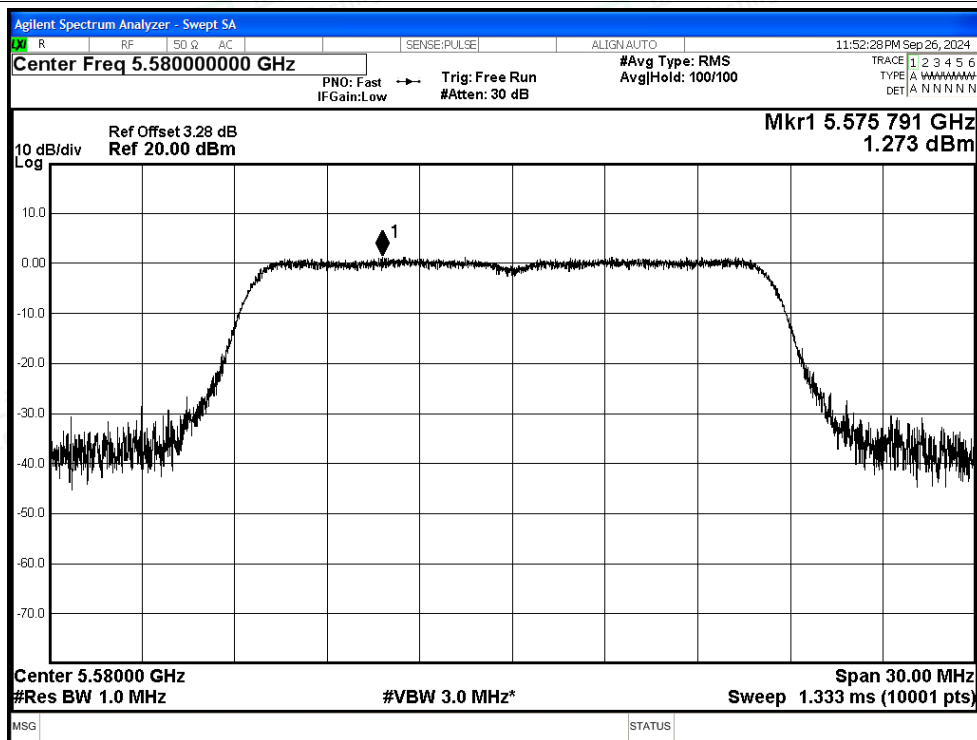

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity







PSD NVNT a 5700MHz Ant1


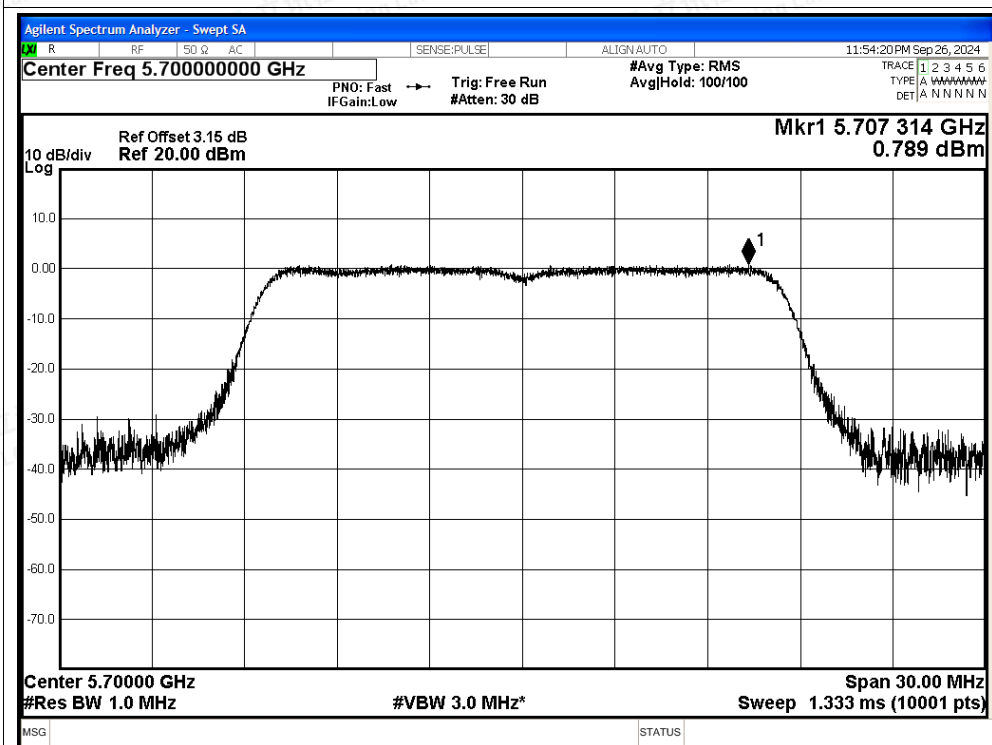




PSD NVNT n20 5500MHz Ant1


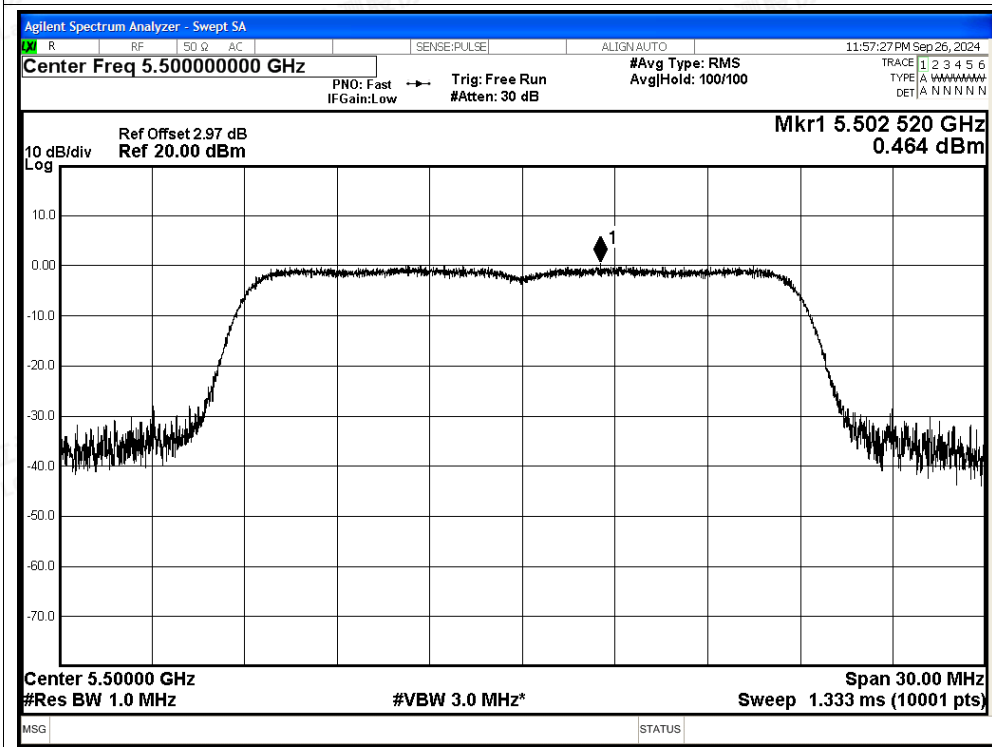


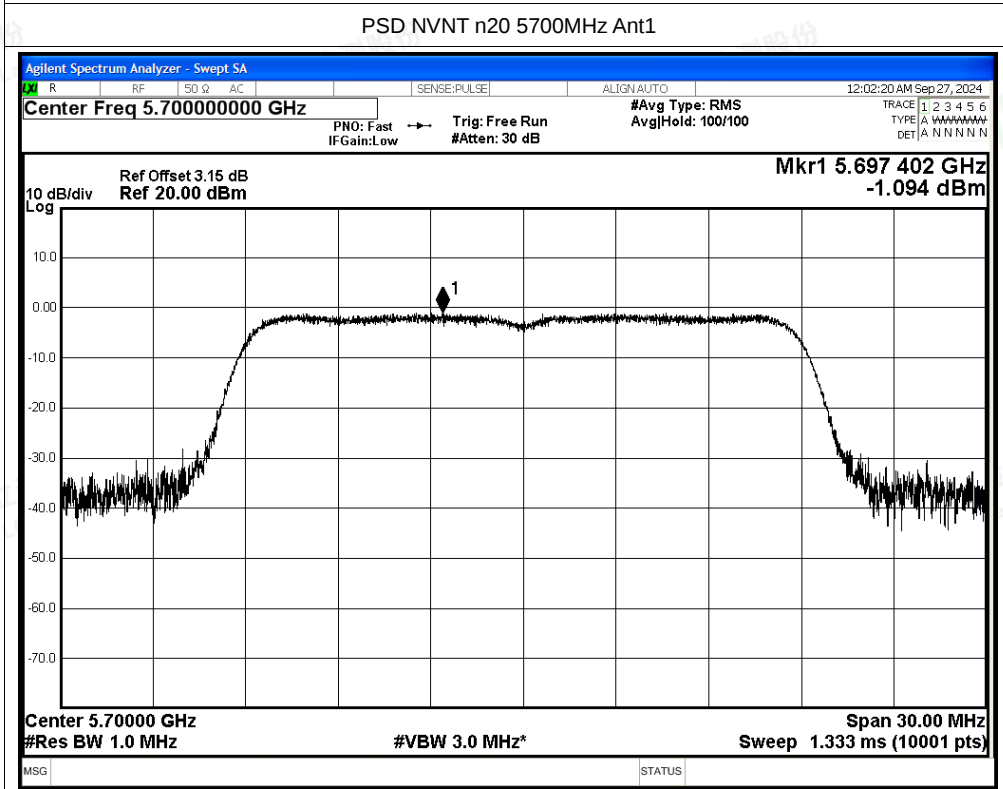
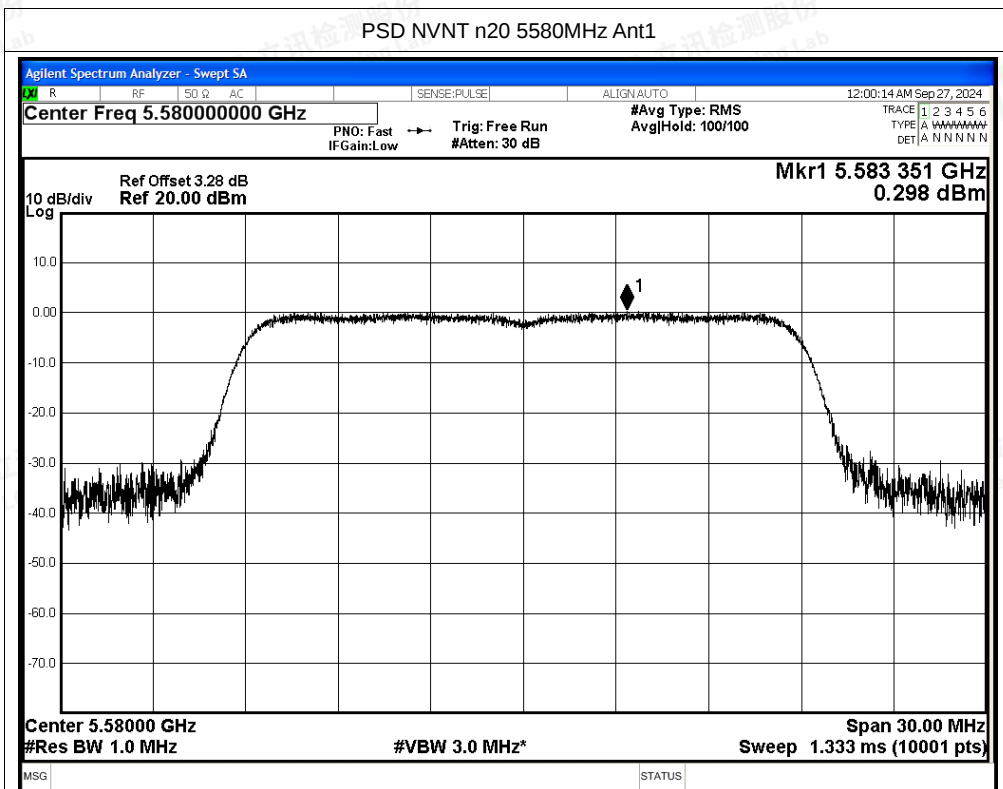


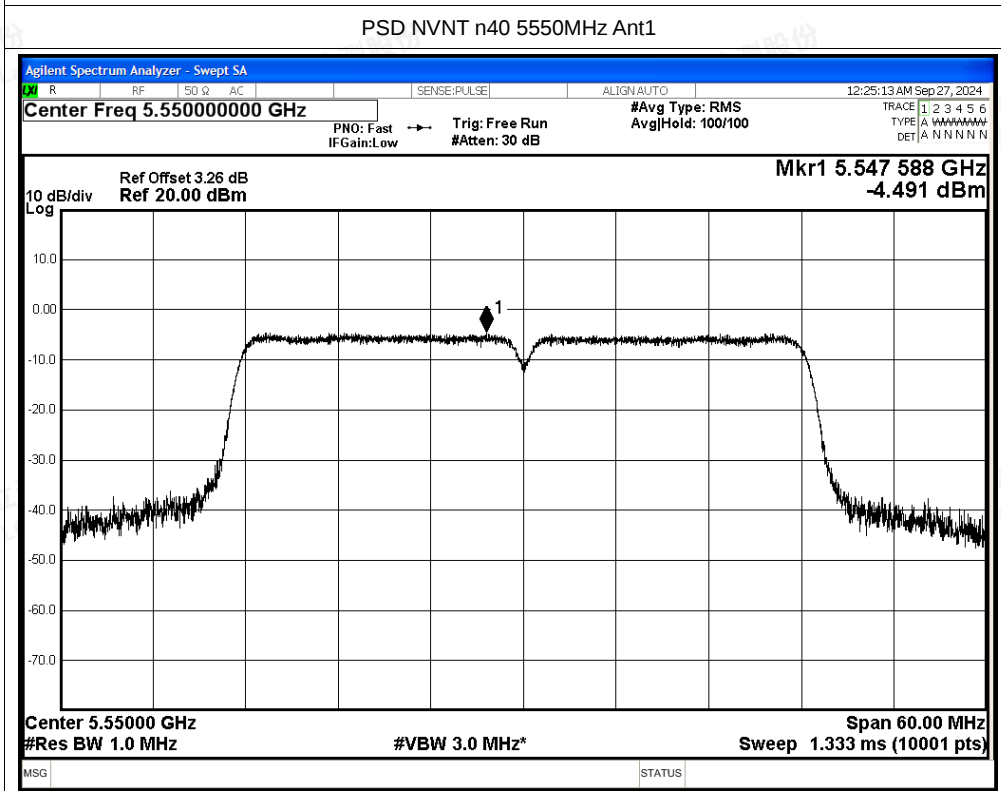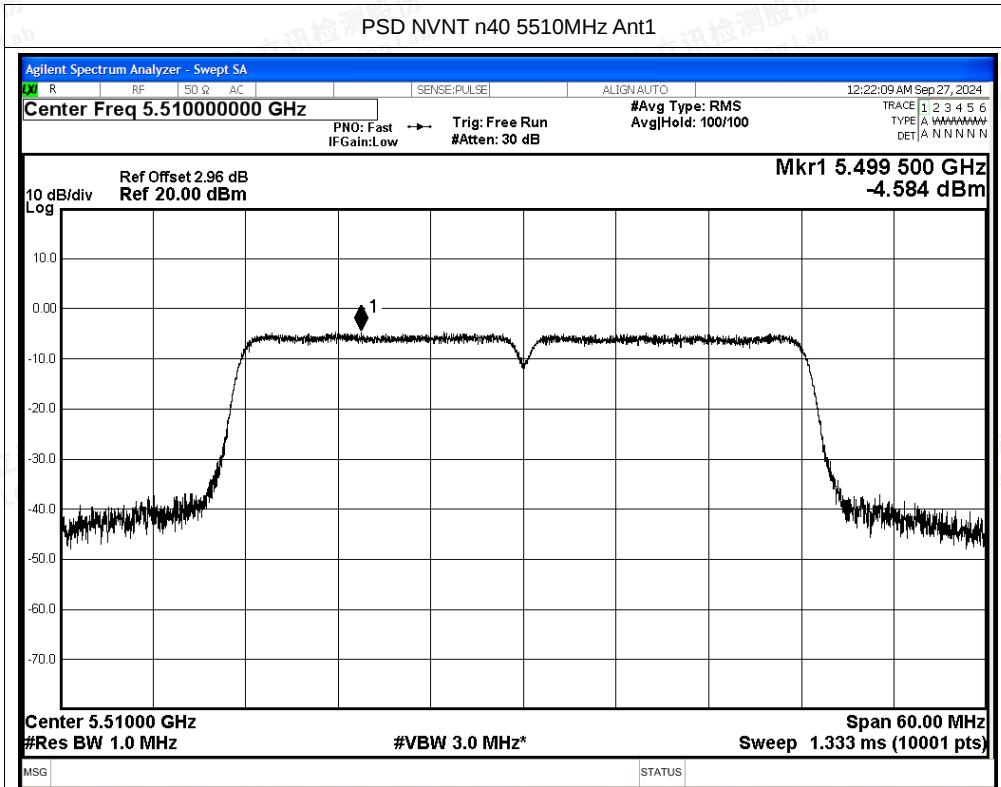

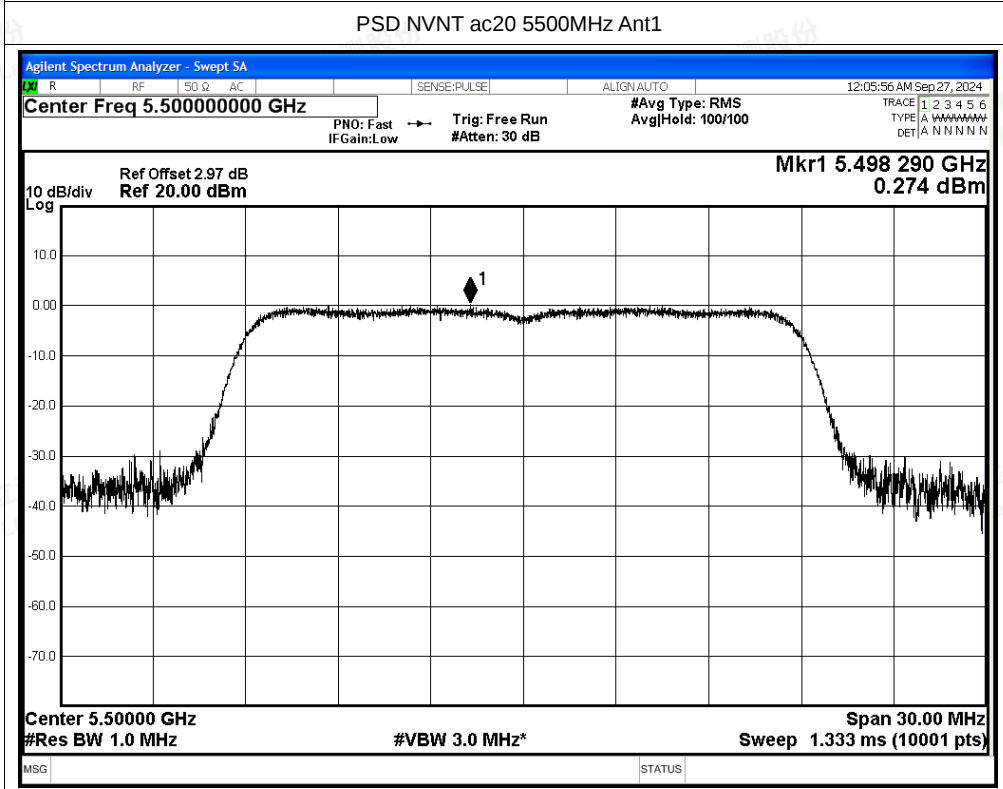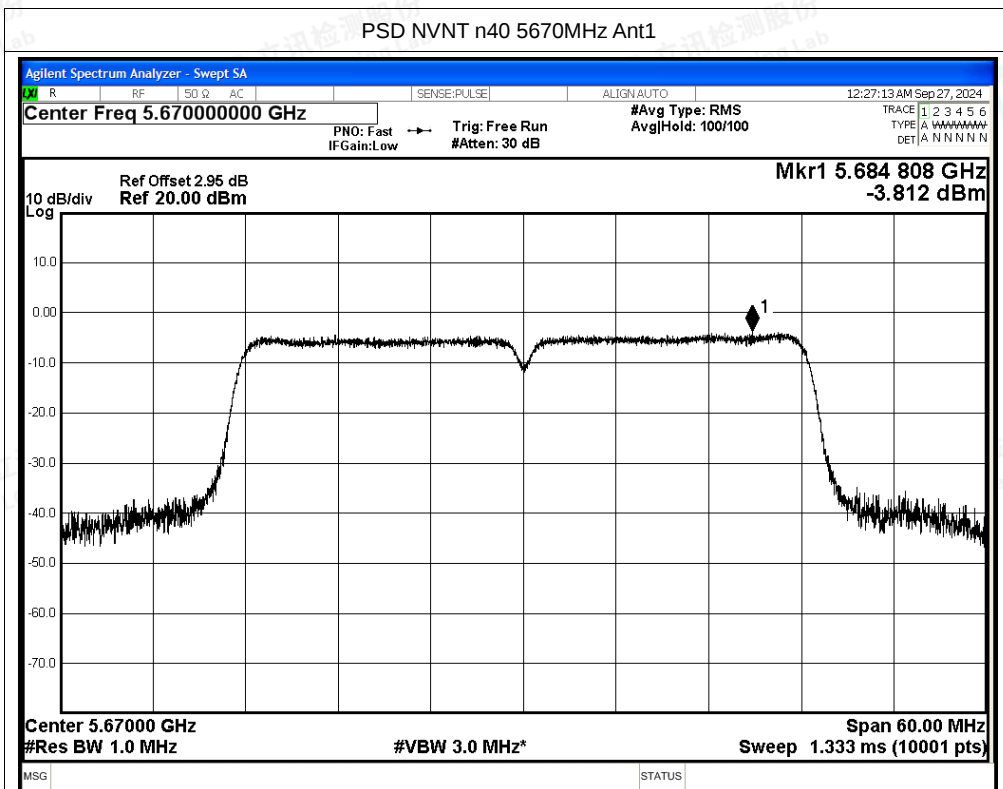

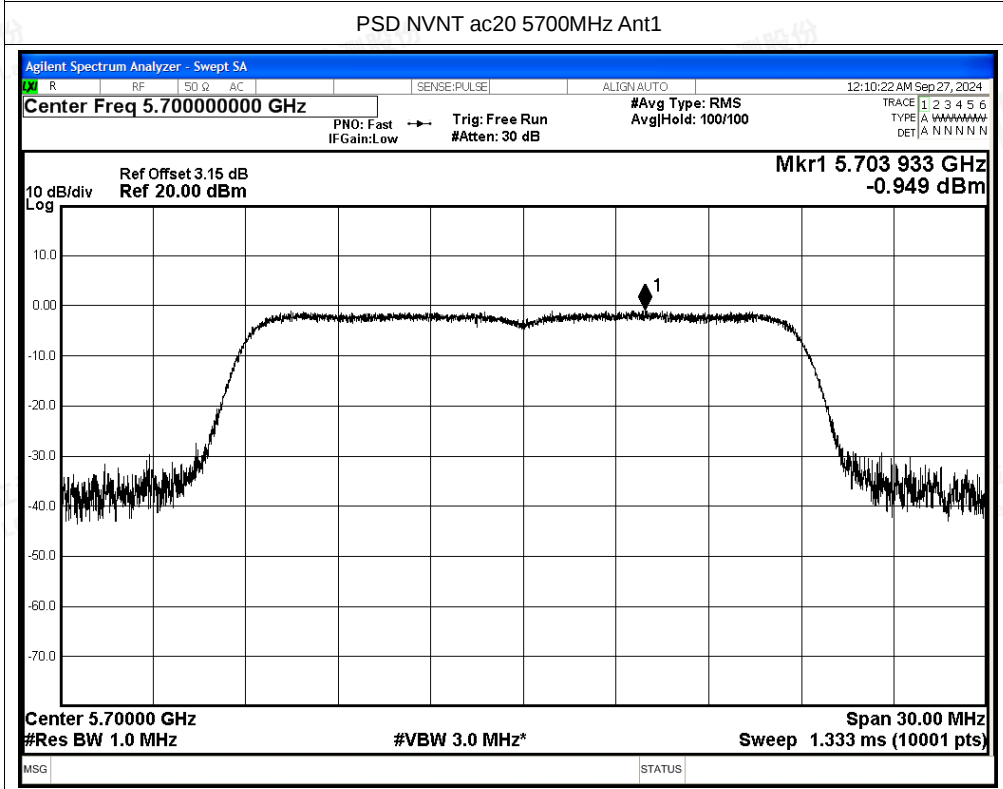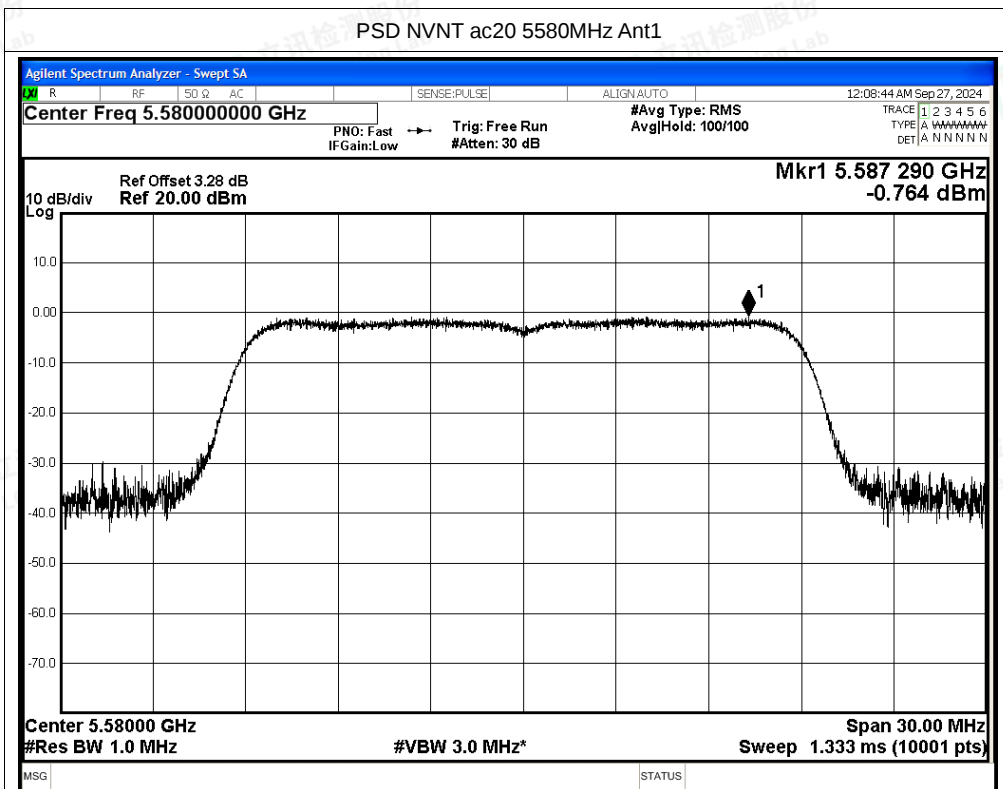


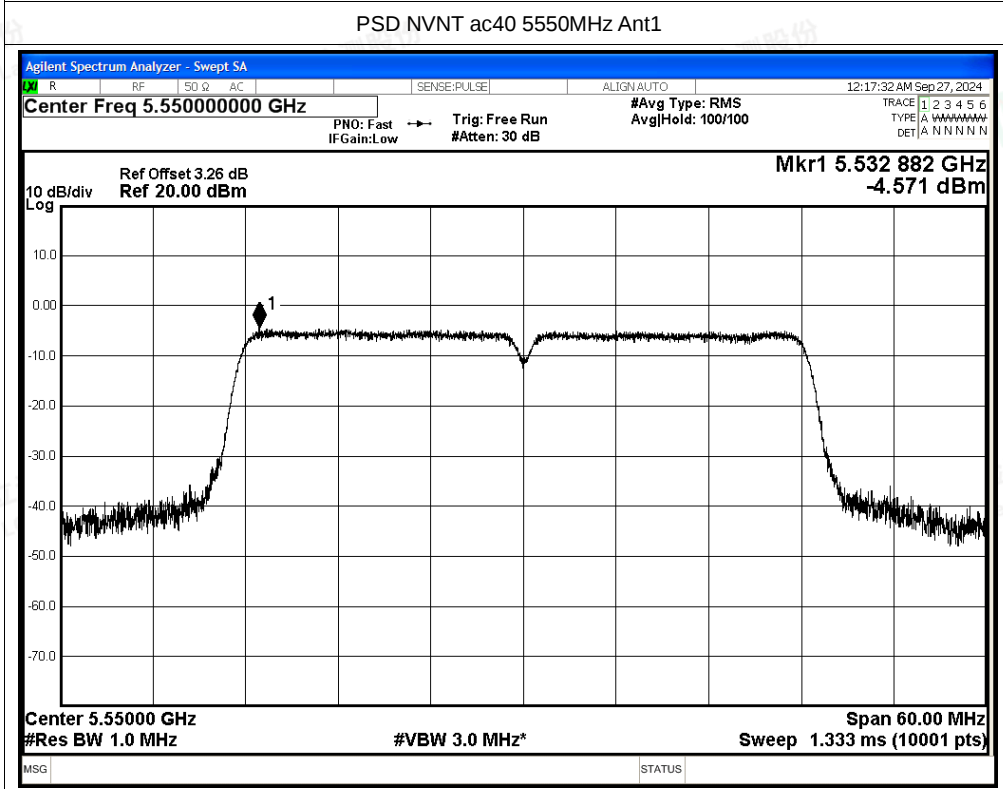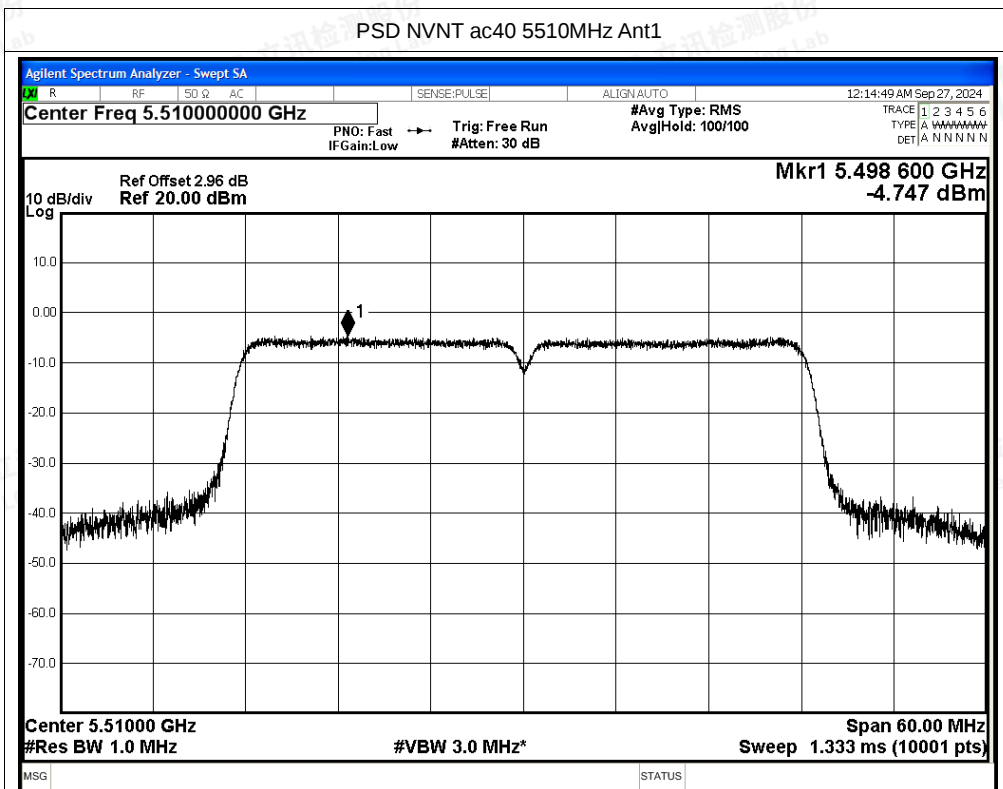

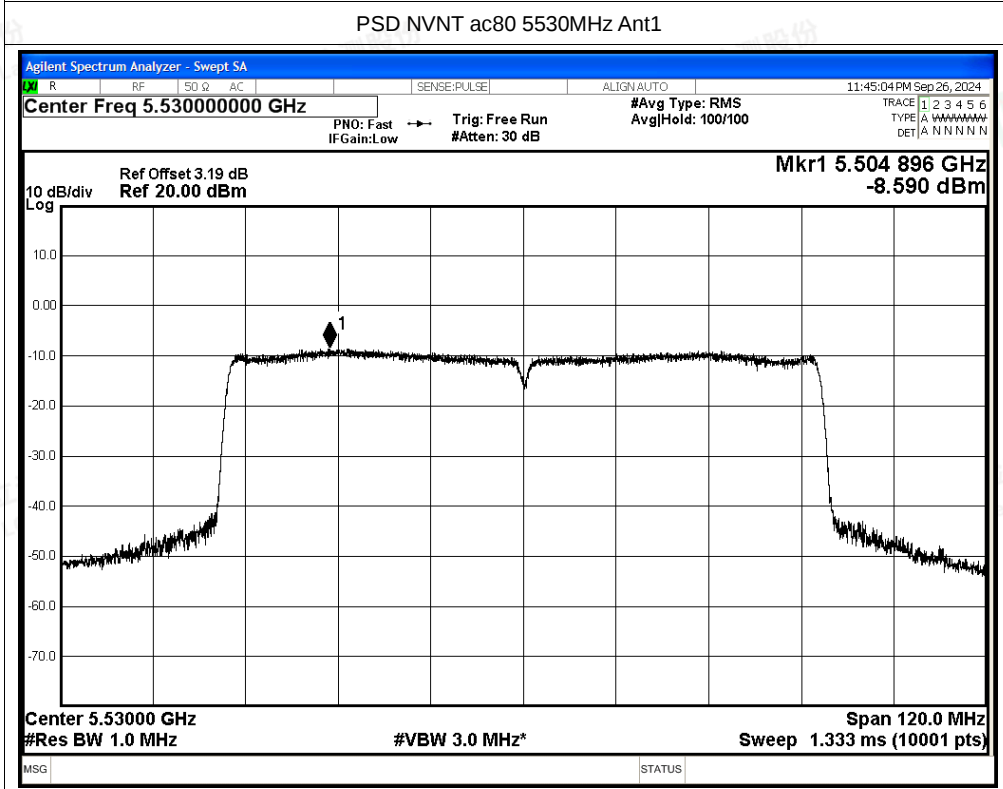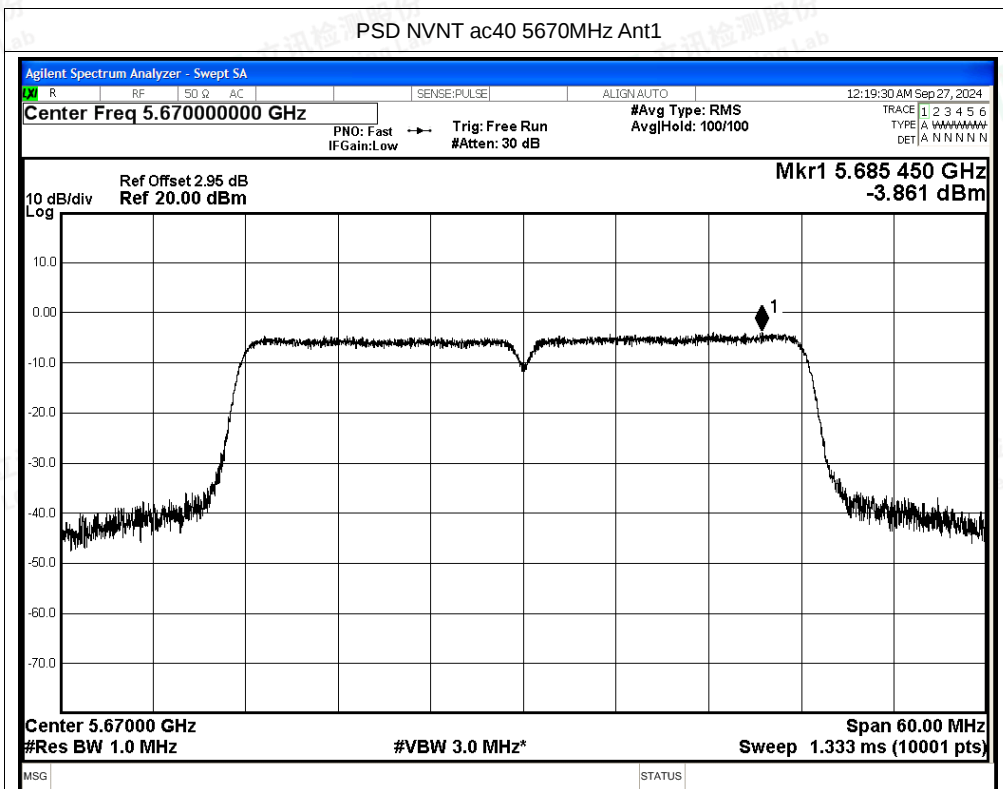








PSD NVNT ac80 5610MHz Ant1

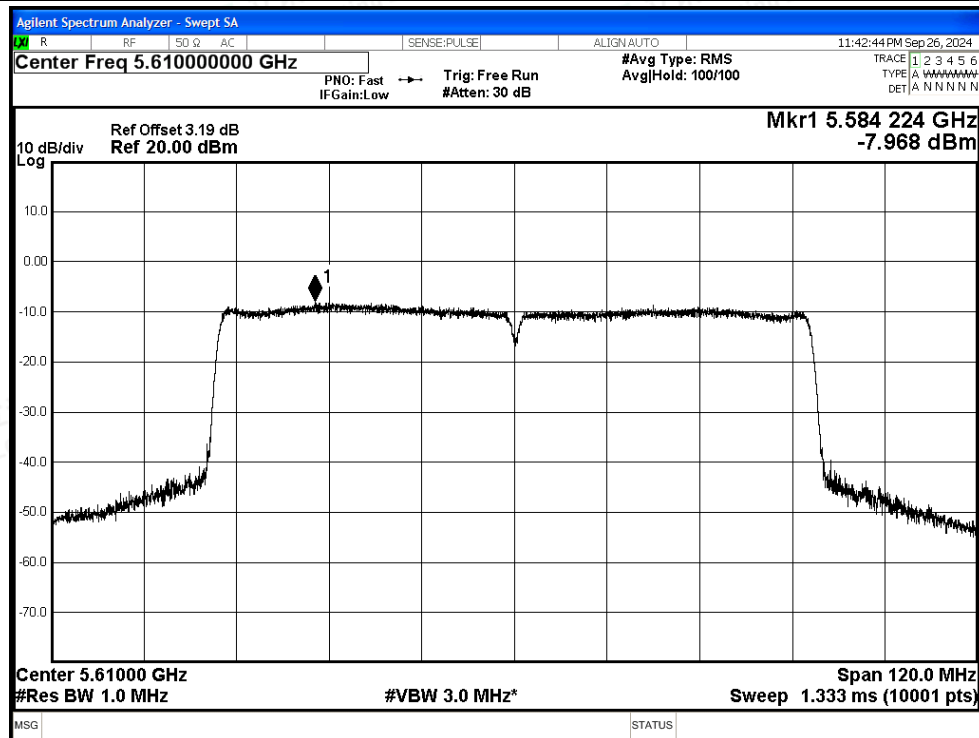

PSD NVNT ax20 5500MHz Ant1

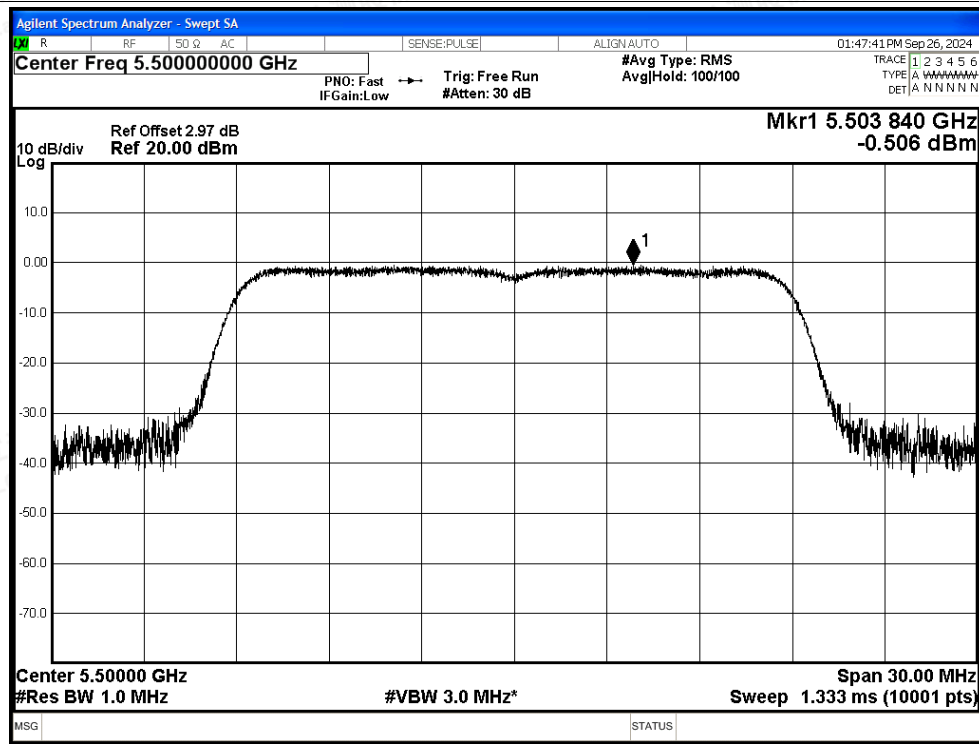


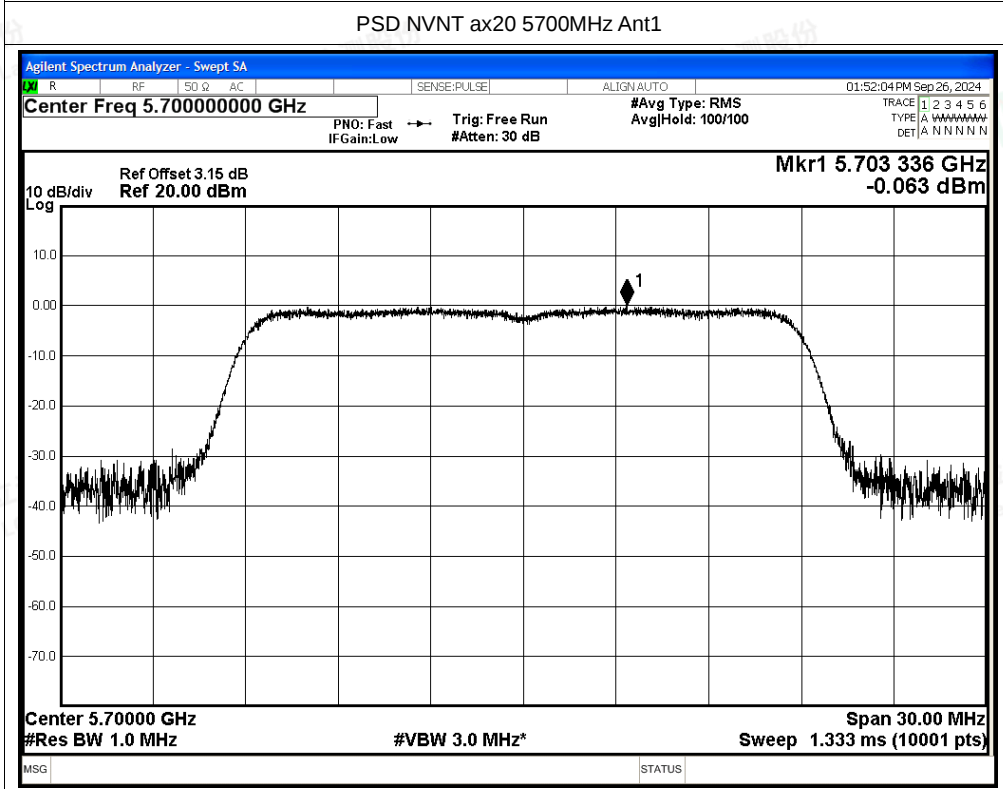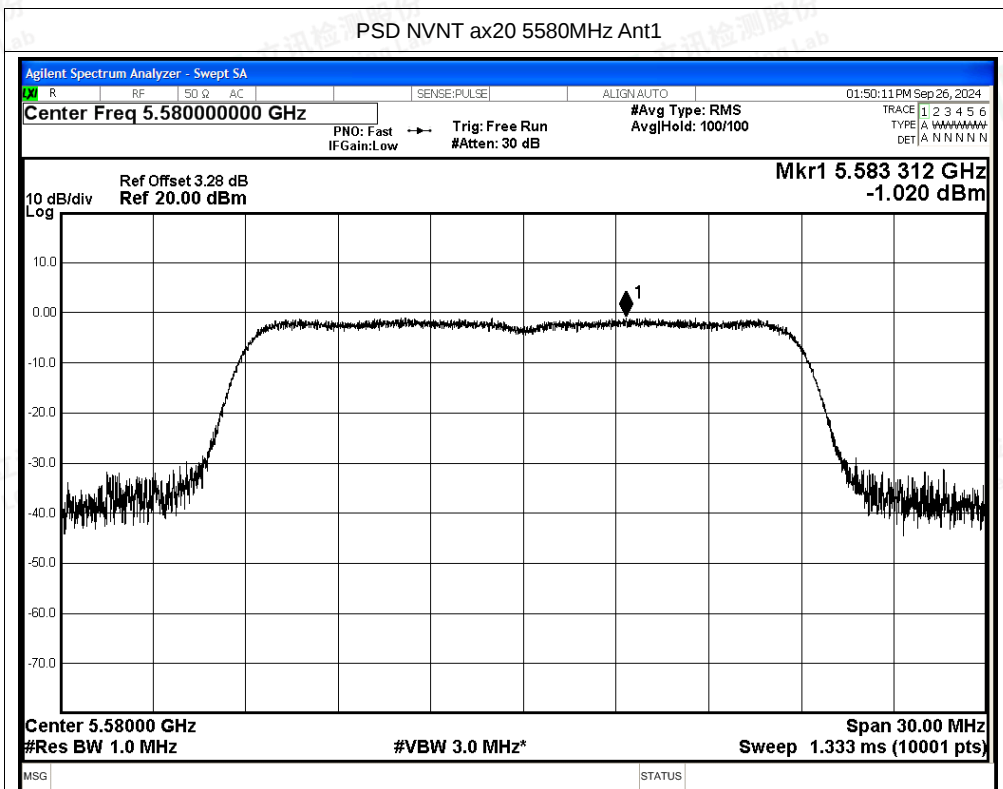

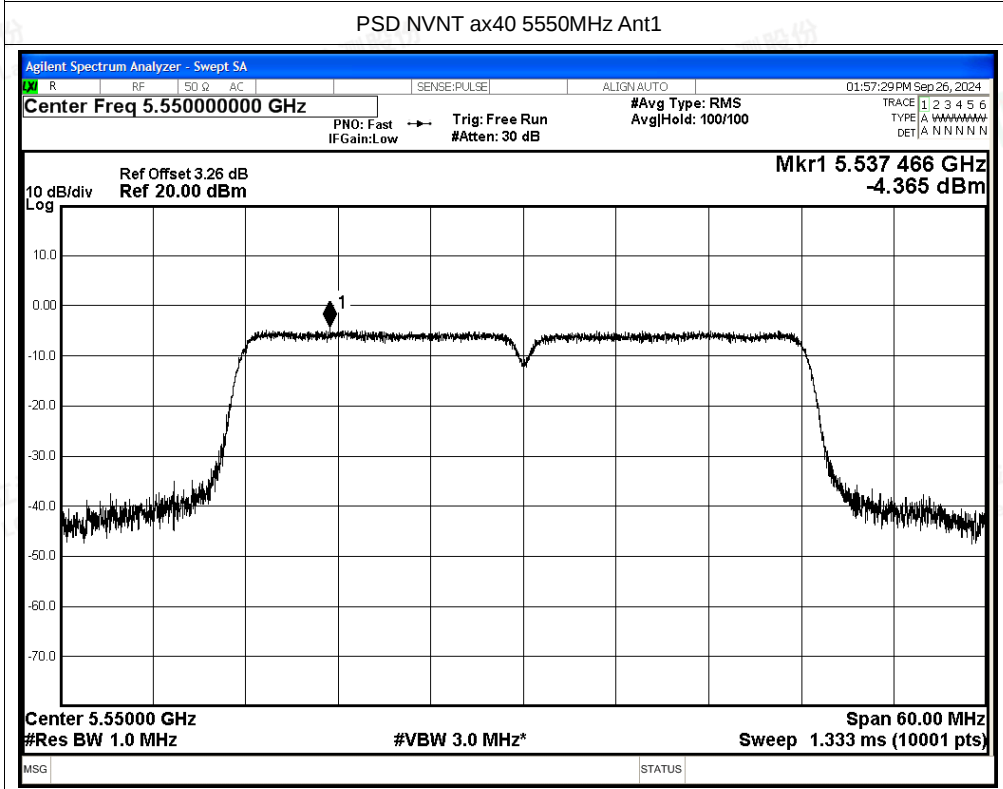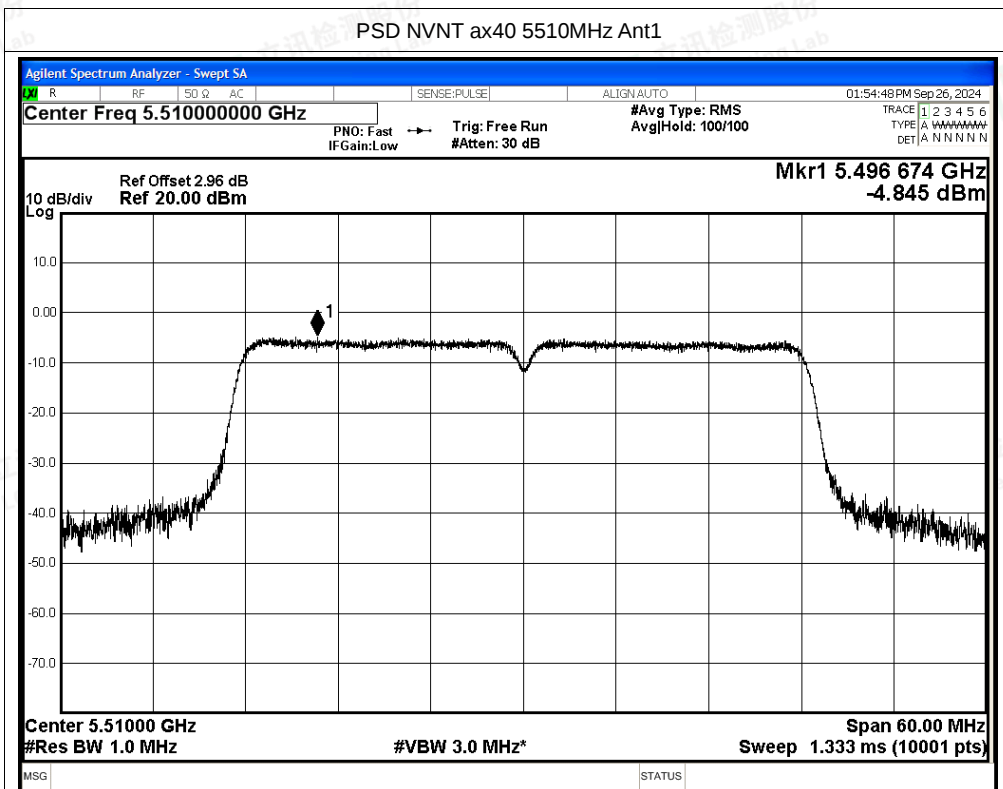





PSD NVNT ax40 5670MHz Ant1

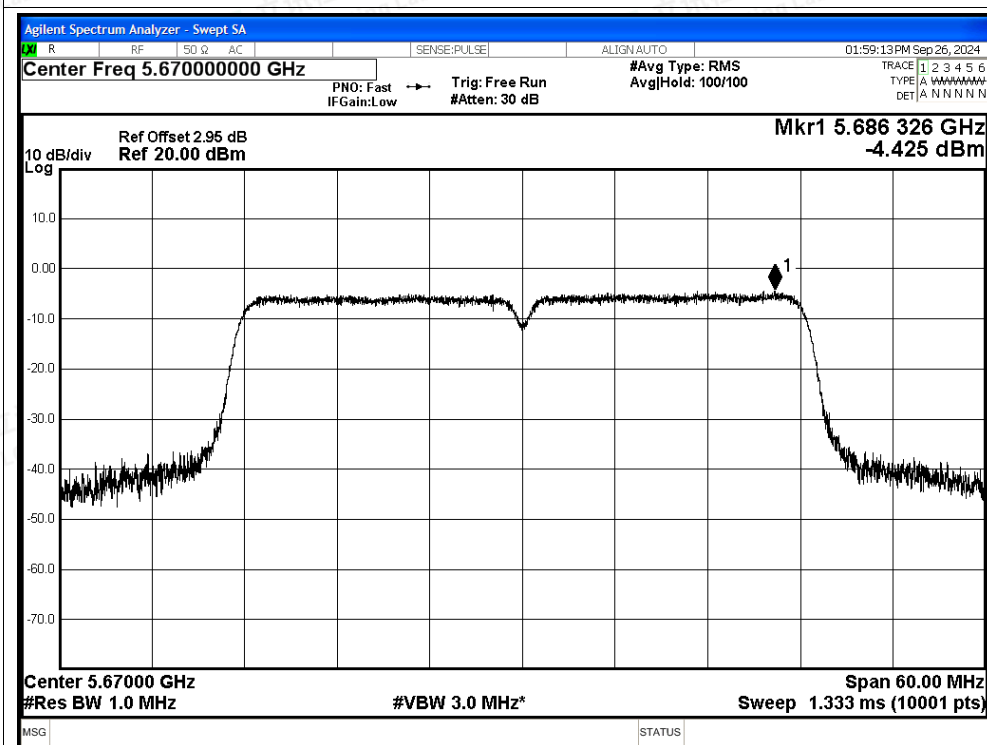

PSD NVNT ax80 5530MHz Ant1

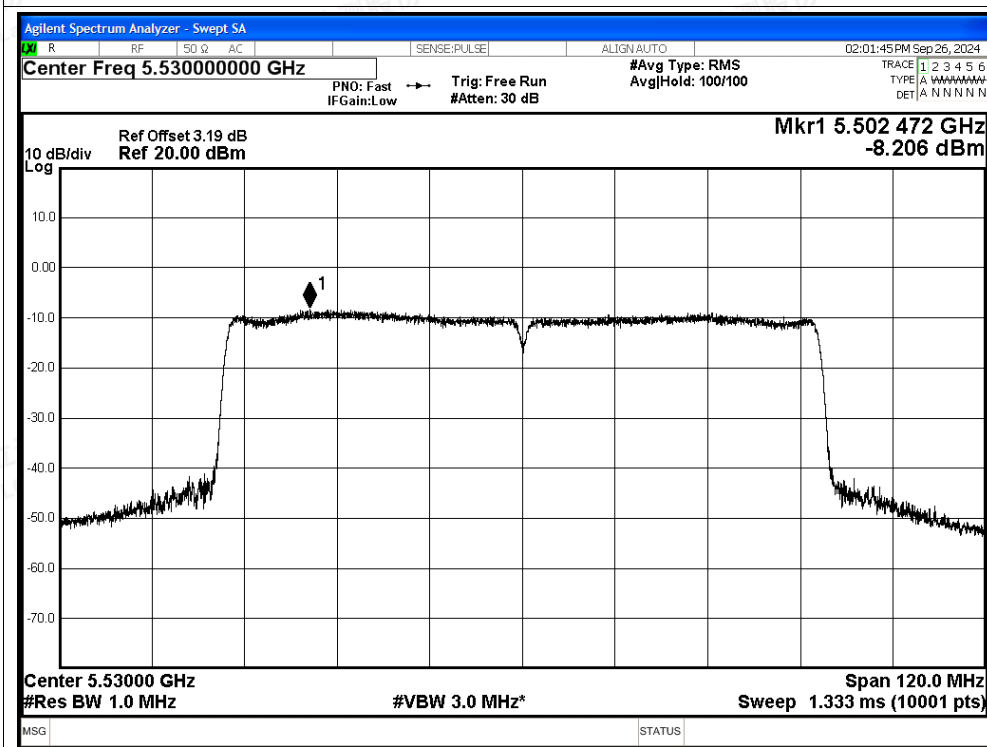

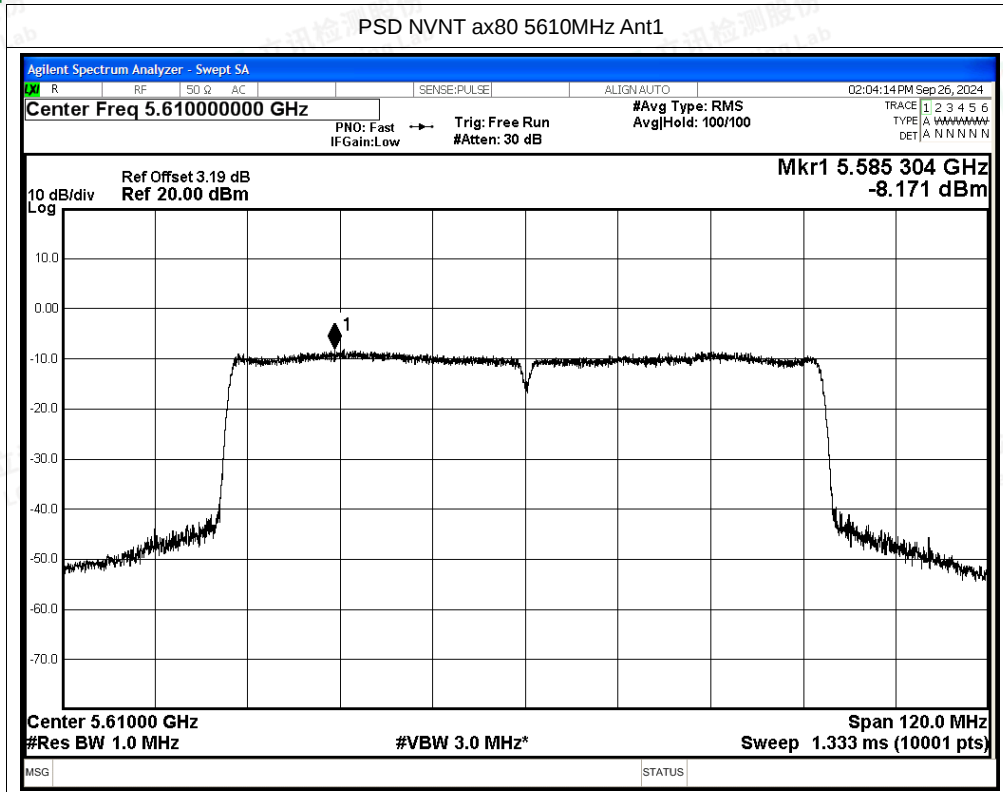



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant0	5460	-47.64	6.3	-	53.89	Peak	68.2	Pass
NVNT	a	5500	Ant0	5460	-57.72	6.3	0.24	44.05	Average	54	Pass
NVNT	a	5500	Ant0	5469	-41.63	6.3	-	59.90	Peak	68.2	Pass
NVNT	a	5500	Ant0	5469.6	-56.08	6.3	0.24	45.69	Average	54	Pass
NVNT	a	5500	Ant0	5470	-46.67	6.3	-	54.86	Peak	68.2	Pass
NVNT	a	5500	Ant0	5470	-56.81	6.3	0.24	44.96	Average	54	Pass
NVNT	a	5700	Ant0	5725	-43.99	6.3	-	57.54	Peak	68.2	Pass
NVNT	a	5700	Ant0	5725	-54.88	6.3	0.24	46.89	Average	54	Pass
NVNT	a	5700	Ant0	5726.8	-39.09	6.3	-	62.44	Peak	68.2	Pass
NVNT	a	5700	Ant0	5725.6	-54.41	6.3	0.24	47.36	Average	54	Pass
NVNT	a	5700	Ant0	5735	-48.89	6.3	-	52.64	Peak	68.2	Pass
NVNT	a	5700	Ant0	5735	-57.96	6.3	0.24	43.81	Average	54	Pass
NVNT	n20	5500	Ant0	5460	-48.7	6.3	-	52.83	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5460	-58.29	6.3	0.12	43.36	Average	54	Pass
NVNT	n20	5500	Ant0	5470	-43.33	6.3	-	58.20	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5470	-55.82	6.3	0.12	45.83	Average	54	Pass
NVNT	n20	5500	Ant0	5470	-43.33	6.3	-	58.20	Peak	68.2	Pass
NVNT	n20	5500	Ant0	5469.4	-55.24	6.3	0.12	46.41	Average	54	Pass
NVNT	n20	5700	Ant0	5725	-39.36	6.3	-	62.17	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5725	-52.7	6.3	0.12	48.95	Average	54	Pass
NVNT	n20	5700	Ant0	5735	-50.54	6.3	-	50.99	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5735	-56.71	6.3	0.12	44.94	Average	54	Pass
NVNT	n20	5700	Ant0	5725	-38.96	6.3	-	62.57	Peak	68.2	Pass
NVNT	n20	5700	Ant0	5725	-53.7	6.3	0.12	47.95	Average	54	Pass
NVNT	n40	5510	Ant0	5460	-48.99	6.3	-	52.54	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5460	-57.57	6.3	0.12	44.08	Average	54	Pass
NVNT	n40	5510	Ant0	5469	-41.54	6.3	-	59.99	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5469.8	-53.9	6.3	0.12	47.75	Average	54	Pass
NVNT	n40	5510	Ant0	5470	-45.22	6.3	-	56.31	Peak	68.2	Pass
NVNT	n40	5510	Ant0	5470	-54.72	6.3	0.12	46.93	Average	54	Pass
NVNT	n40	5670	Ant0	5725	-48.57	6.3	-	52.96	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5725	-55.09	6.3	0.12	46.56	Average	54	Pass
NVNT	n40	5670	Ant0	5726	-46.56	6.3	-	54.97	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5725	-55.09	6.3	0.12	46.56	Average	54	Pass
NVNT	n40	5670	Ant0	5735	-48.4	6.3	-	53.13	Peak	68.2	Pass
NVNT	n40	5670	Ant0	5735	-56.28	6.3	0.12	45.37	Average	54	Pass





NVNT	ac20	5500	Ant0	5460	-49.91	6.3	-	51.62	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5460	-57.55	6.3	0.12	44.10	Average	54	Pass
NVNT	ac20	5500	Ant0	5470	-40.8	6.3	-	60.73	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5470	-55.06	6.3	0.12	46.59	Average	54	Pass
NVNT	ac20	5500	Ant0	5470	-40.8	6.3	-	60.73	Peak	68.2	Pass
NVNT	ac20	5500	Ant0	5469.4	-54.99	6.3	0.12	46.66	Average	54	Pass
NVNT	ac20	5700	Ant0	5725	-38.7	6.3	-	62.83	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5725	-53.95	6.3	0.12	47.70	Average	54	Pass
NVNT	ac20	5700	Ant0	5735	-48.83	6.3	-	52.70	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5735	-57.47	6.3	0.12	44.18	Average	54	Pass
NVNT	ac20	5700	Ant0	5725	-38.7	6.3	-	62.83	Peak	68.2	Pass
NVNT	ac20	5700	Ant0	5725	-52.45	6.3	0.12	49.20	Average	54	Pass
NVNT	ac40	5510	Ant0	5460	-48.31	6.3	-	53.22	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5460	-57.26	6.3	0.12	44.39	Average	54	Pass
NVNT	ac40	5510	Ant0	5468.8	-39.06	6.3	-	62.47	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5470	-53.57	6.3	0.12	48.08	Average	54	Pass
NVNT	ac40	5510	Ant0	5470	-43.6	6.3	-	57.93	Peak	68.2	Pass
NVNT	ac40	5510	Ant0	5470	-53.57	6.3	0.12	48.08	Average	54	Pass
NVNT	ac40	5670	Ant0	5725	-48.8	6.3	-	52.73	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5725	-55.59	6.3	0.12	46.06	Average	54	Pass
NVNT	ac40	5670	Ant0	5729.2	-46.12	6.3	-	55.41	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5726.6	-55.12	6.3	0.12	46.53	Average	54	Pass
NVNT	ac40	5670	Ant0	5735	-46.97	6.3	-	54.56	Peak	68.2	Pass
NVNT	ac40	5670	Ant0	5735	-56.42	6.3	0.12	45.23	Average	54	Pass
NVNT	ac80	5530	Ant0	5460	-46.7	6.3	-	54.83	Peak	68.2	Pass
NVNT	ac80	5530	Ant0	5460	-55.68	6.3	0.25	46.10	Average	54	Pass
NVNT	ac80	5530	Ant0	5469.2	-41.93	6.3	-	59.60	Peak	68.2	Pass
NVNT	ac80	5530	Ant0	5470	-53.98	6.3	0.25	47.80	Average	54	Pass
NVNT	ac80	5530	Ant0	5470	-44.32	6.3	-	57.21	Peak	68.2	Pass
NVNT	ac80	5530	Ant0	5470	-53.98	6.3	0.25	47.80	Average	54	Pass
NVNT	ac80	5610	Ant0	5725	-49.32	6.3	-	52.21	Peak	68.2	Pass
NVNT	ac80	5610	Ant0	5725	-57.31	6.3	0.25	44.47	Average	54	Pass
NVNT	ac80	5610	Ant0	5729.67	-47.25	6.3	-	54.28	Peak	68.2	Pass
NVNT	ac80	5610	Ant0	5732.54	-56.39	6.3	0.25	45.39	Average	54	Pass
NVNT	ac80	5610	Ant0	5735	-50.75	6.3	-	50.78	Peak	68.2	Pass
NVNT	ac80	5610	Ant0	5735	-57.46	6.3	0.25	44.32	Average	54	Pass
NVNT	ax20	5500	Ant0	5460	-51.22	6.3	-	50.31	Peak	68.2	Pass
NVNT	ax20	5500	Ant0	5460	-57.79	6.3	0.12	43.86	Average	54	Pass
NVNT	ax20	5500	Ant0	5469	-42.74	6.3	-	58.79	Peak	68.2	Pass
NVNT	ax20	5500	Ant0	5469.8	-55.98	6.3	0.12	45.67	Average	54	Pass
NVNT	ax20	5500	Ant0	5470	-46.64	6.3	-	54.89	Peak	68.2	Pass





NVNT	ax20	5500	Ant0	5470	-56.43	6.3	0.12	45.22	Average	54	Pass
NVNT	ax20	5700	Ant0	5725	-40.67	6.3	-	60.86	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5725	-53.7	6.3	0.12	47.95	Average	54	Pass
NVNT	ax20	5700	Ant0	5726.8	-39.21	6.3	-	62.32	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5725.2	-53.59	6.3	0.12	48.06	Average	54	Pass
NVNT	ax20	5700	Ant0	5735	-49.32	6.3	-	52.21	Peak	68.2	Pass
NVNT	ax20	5700	Ant0	5735	-56.82	6.3	0.12	44.83	Average	54	Pass
NVNT	ax40	5510	Ant0	5460	-50.01	6.3	-	51.52	Peak	68.2	Pass
NVNT	ax40	5510	Ant0	5460	-57.53	6.3	0.12	44.12	Average	54	Pass
NVNT	ax40	5510	Ant0	5470	-43.51	6.3	-	58.02	Peak	68.2	Pass
NVNT	ax40	5510	Ant0	5469.8	-55.77	6.3	0.12	45.88	Average	54	Pass
NVNT	ax40	5510	Ant0	5470	-43.51	6.3	-	58.02	Peak	68.2	Pass
NVNT	ax40	5510	Ant0	5470	-56.14	6.3	0.12	45.51	Average	54	Pass
NVNT	ax40	5670	Ant0	5725	-50.16	6.3	-	51.37	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5725	-58.16	6.3	0.12	43.49	Average	54	Pass
NVNT	ax40	5670	Ant0	5728.4	-48.56	6.3	-	52.97	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5730.6	-57.66	6.3	0.12	43.99	Average	54	Pass
NVNT	ax40	5670	Ant0	5735	-49.6	6.3	-	51.93	Peak	68.2	Pass
NVNT	ax40	5670	Ant0	5735	-58.18	6.3	0.12	43.47	Average	54	Pass
NVNT	ax80	5530	Ant0	5460	-46.29	6.3	-	55.24	Peak	68.2	Pass
NVNT	ax80	5530	Ant0	5460	-56.96	6.3	0.25	44.82	Average	54	Pass
NVNT	ax80	5530	Ant0	5469.8	-42.56	6.3	-	58.97	Peak	68.2	Pass
NVNT	ax80	5530	Ant0	5469.4	-54.76	6.3	0.25	47.02	Average	54	Pass
NVNT	ax80	5530	Ant0	5470	-46.07	6.3	-	55.46	Peak	68.2	Pass
NVNT	ax80	5530	Ant0	5470	-55.15	6.3	0.25	46.63	Average	54	Pass
NVNT	ax80	5610	Ant0	5725	-49.1	6.3	-	52.43	Peak	68.2	Pass
NVNT	ax80	5610	Ant0	5725	-57.47	6.3	0.25	44.31	Average	54	Pass
NVNT	ax80	5610	Ant0	5728.645	-48.05	6.3	-	53.48	Peak	68.2	Pass
NVNT	ax80	5610	Ant0	5734.18	-57.42	6.3	0.25	44.36	Average	54	Pass
NVNT	ax80	5610	Ant0	5735	-49.95	6.3	-	51.58	Peak	68.2	Pass
NVNT	ax80	5610	Ant0	5735	-58.12	6.3	0.25	43.66	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant0 Peak

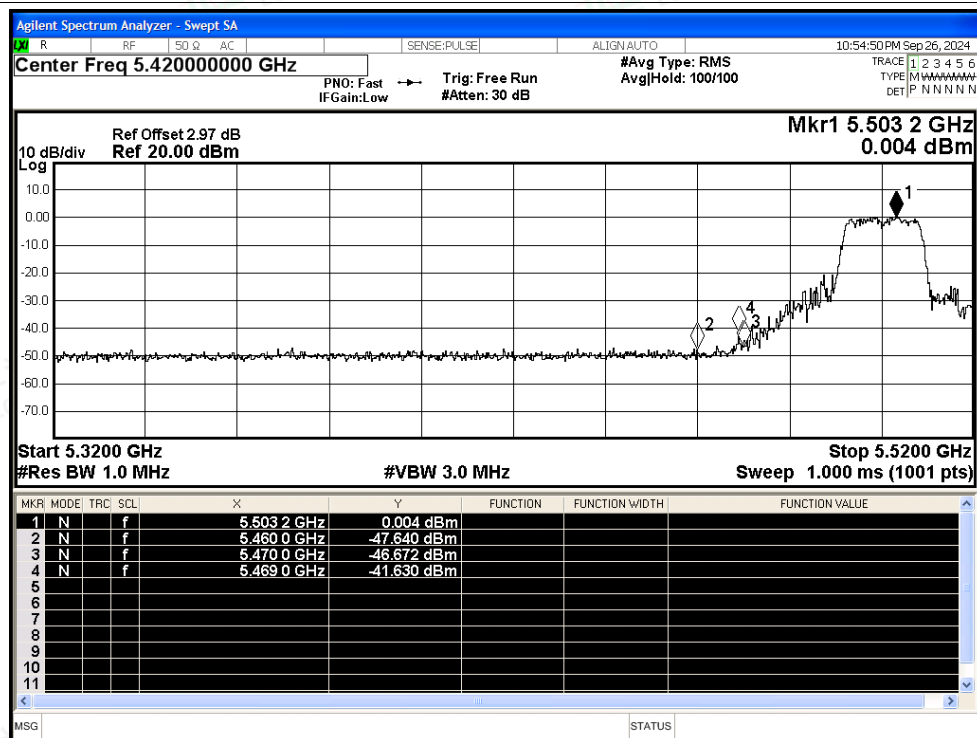

Restrict Band NVNT a 5500MHz Ant0 Average

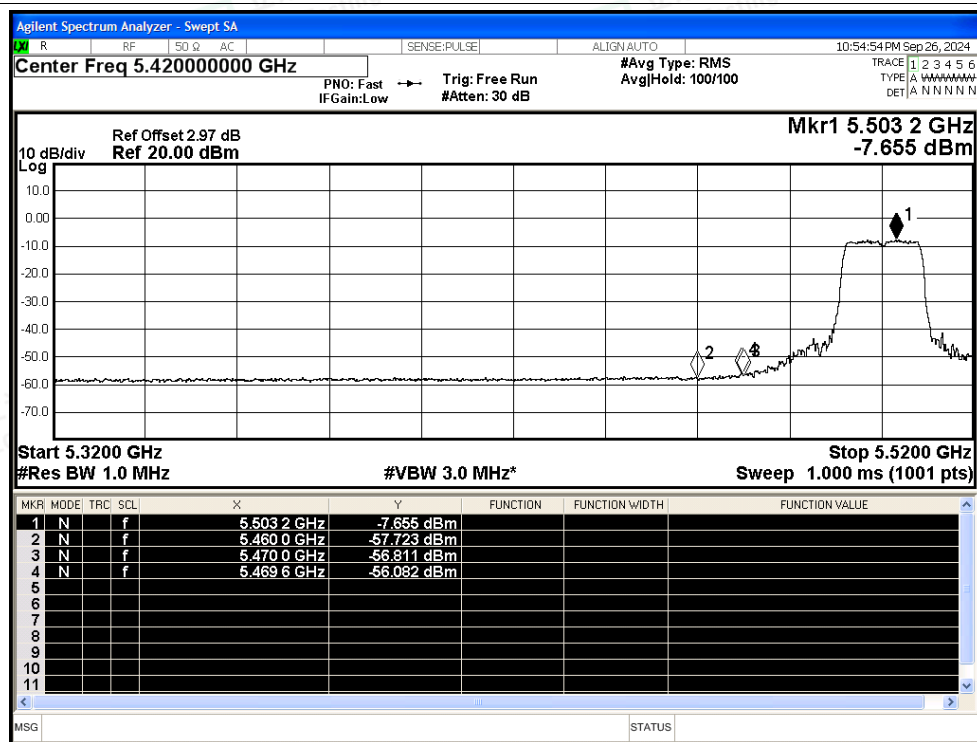

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant0 Peak

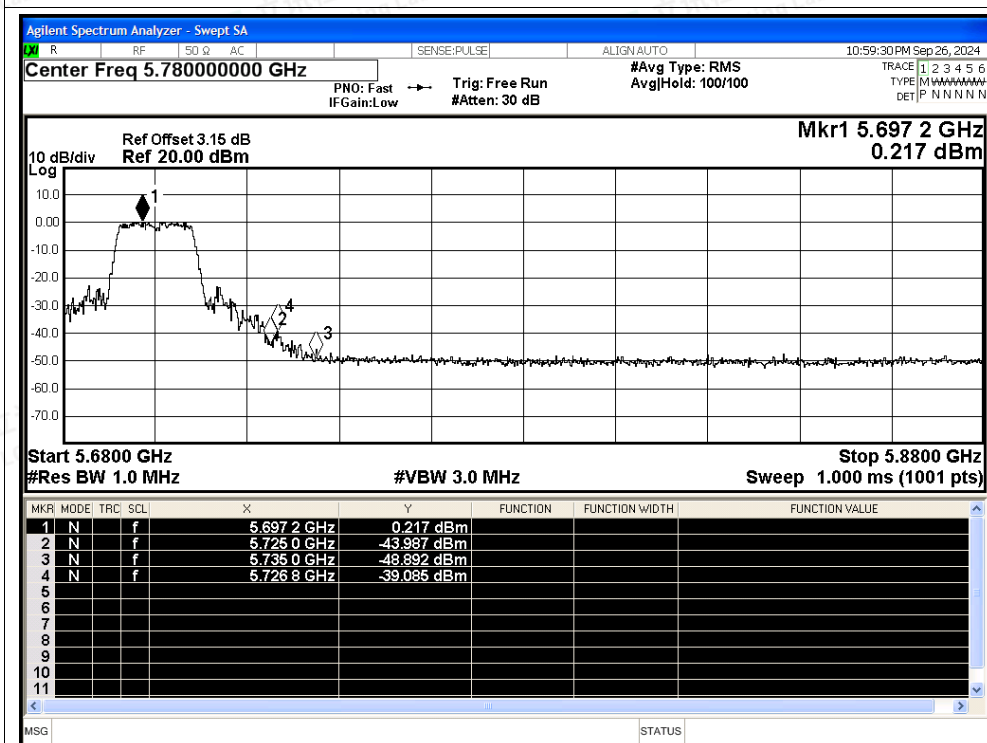

Restrict Band NVNT a 5700MHz Ant0 Average

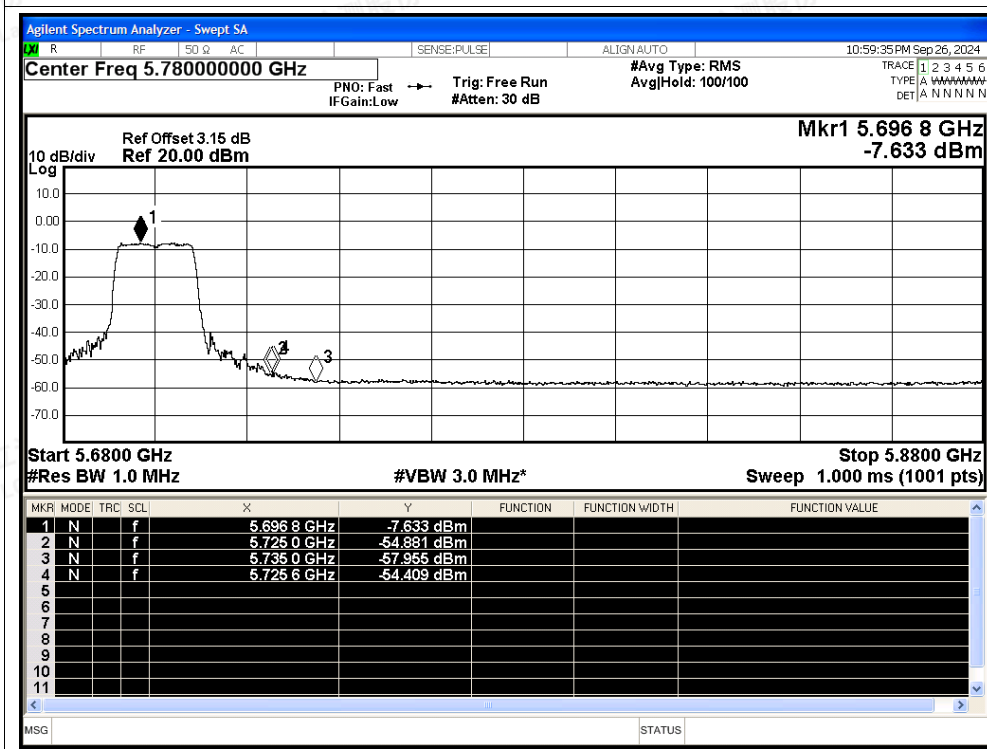

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant0 Peak

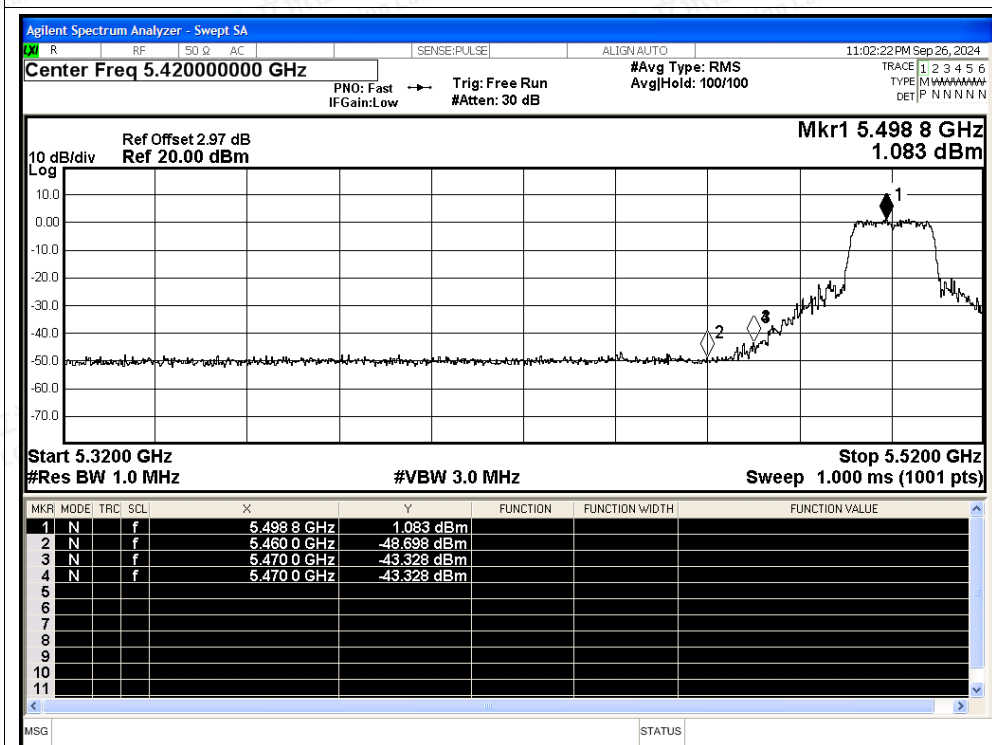

Restrict Band NVNT n20 5500MHz Ant0 Average

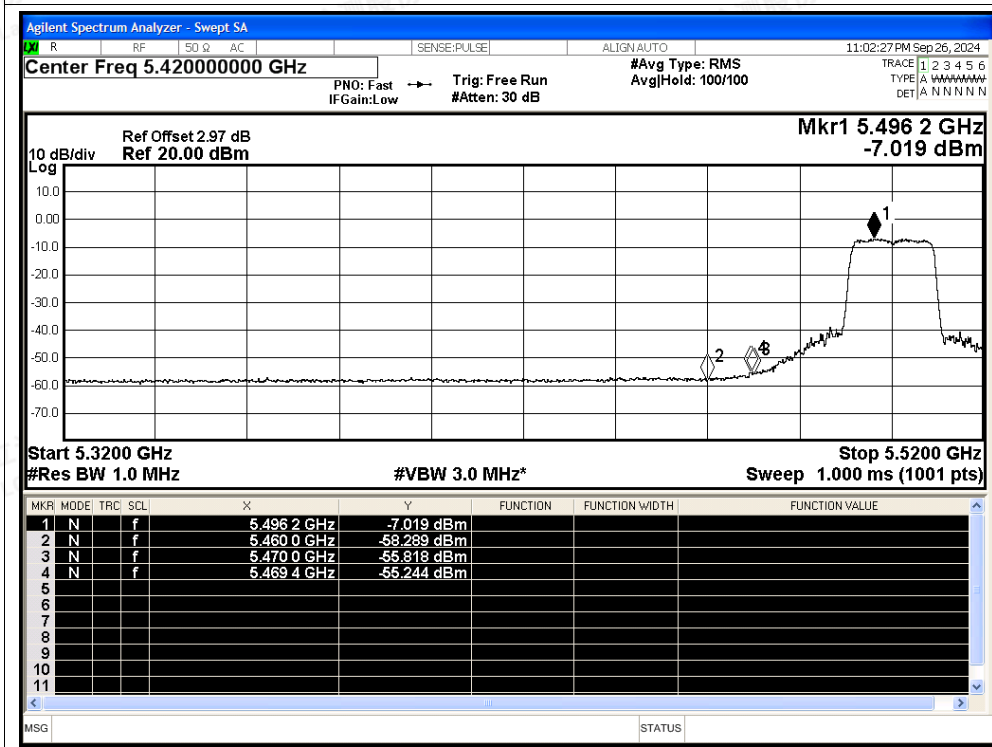

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant0 Peak

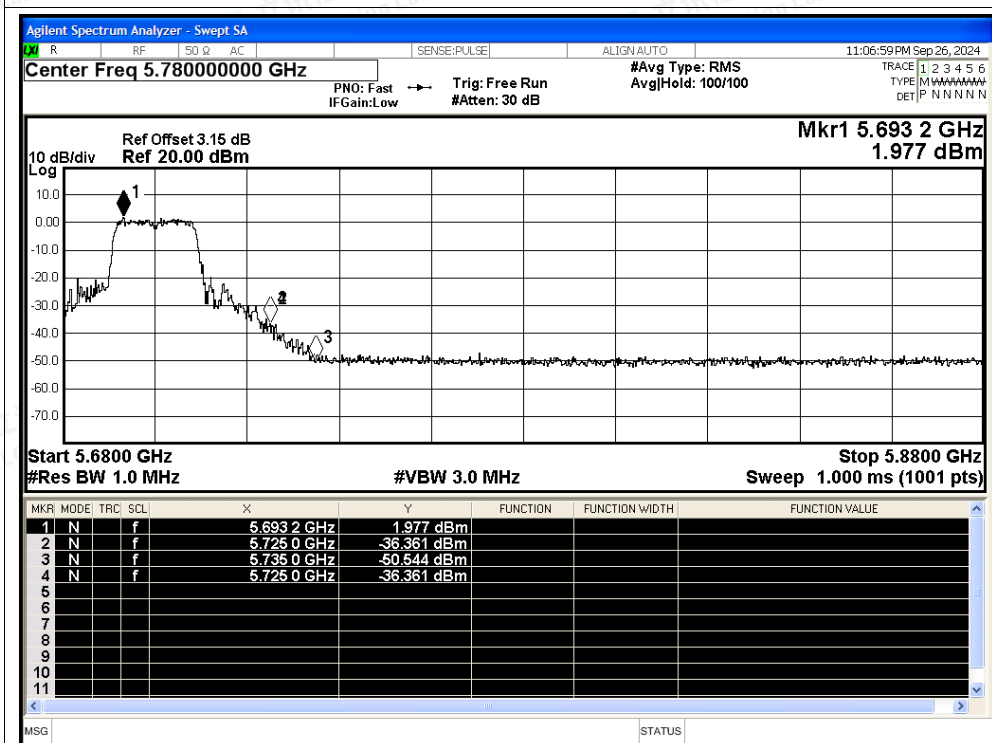

Restrict Band NVNT n20 5700MHz Ant0 Average

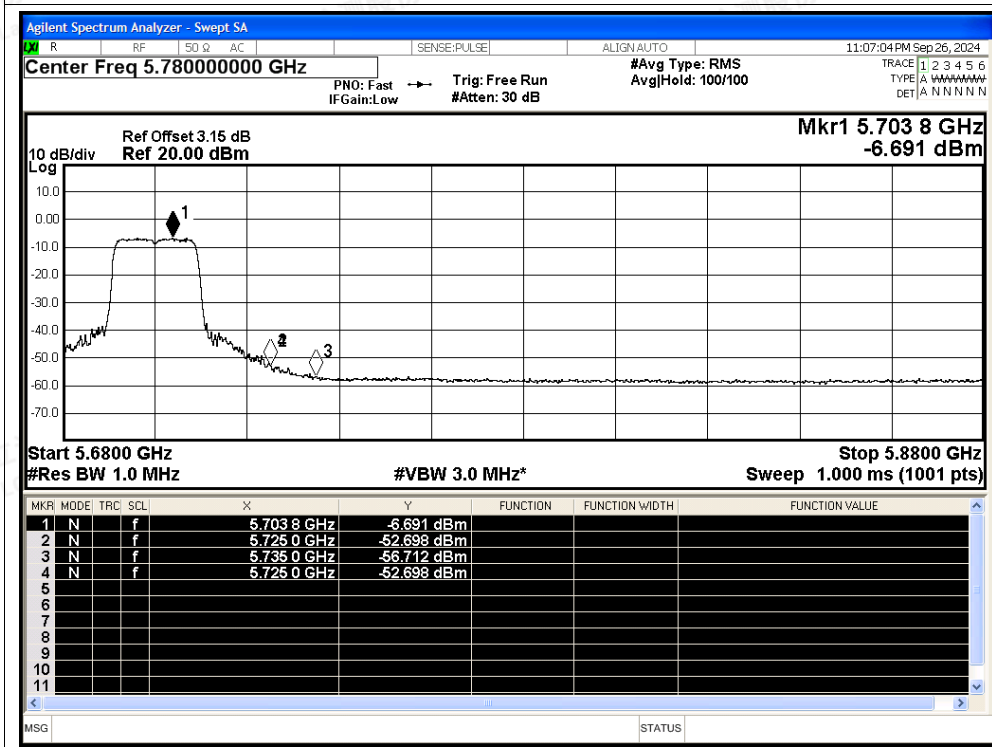

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant0 Peak



Restrict Band NVNT n40 5510MHz Ant0 Average

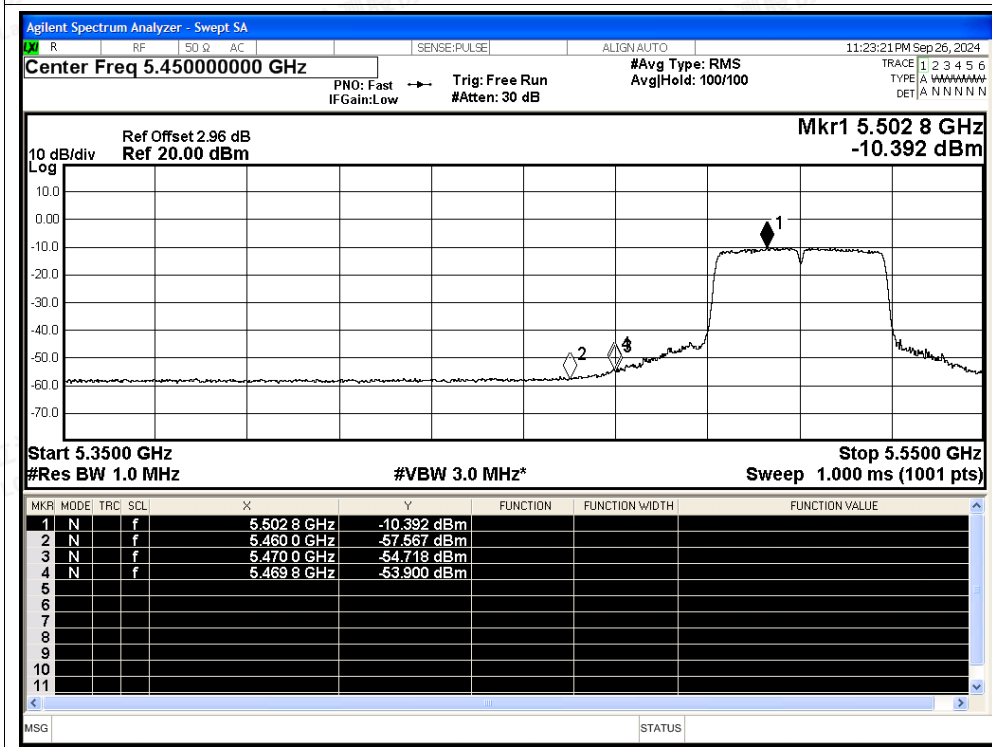

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant0 Peak

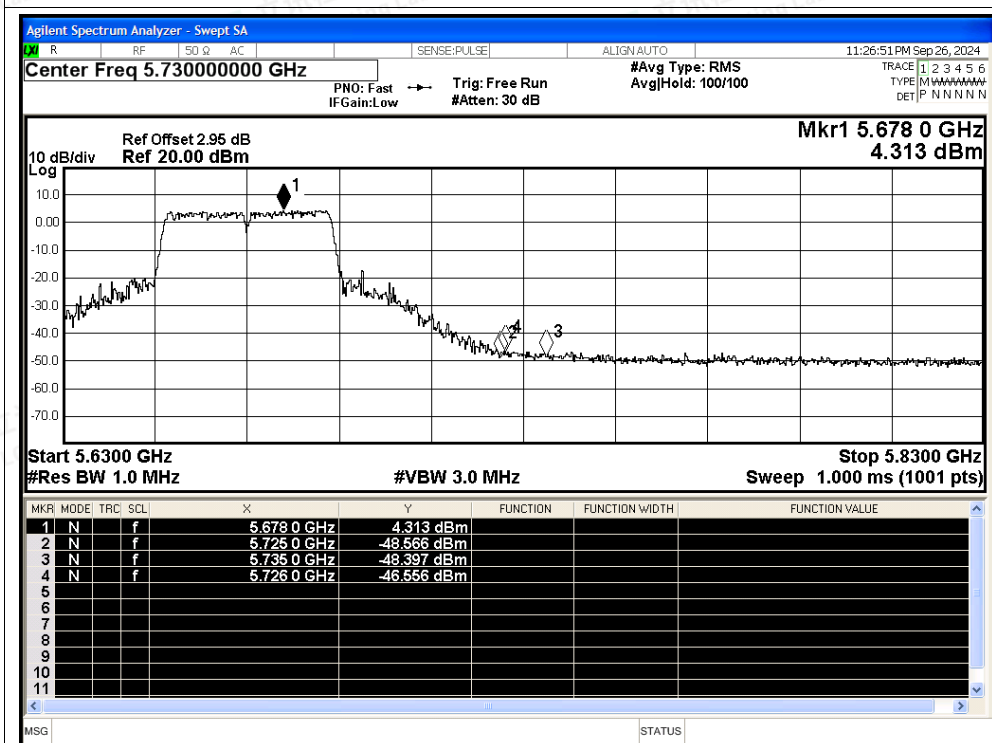

Restrict Band NVNT n40 5670MHz Ant0 Average

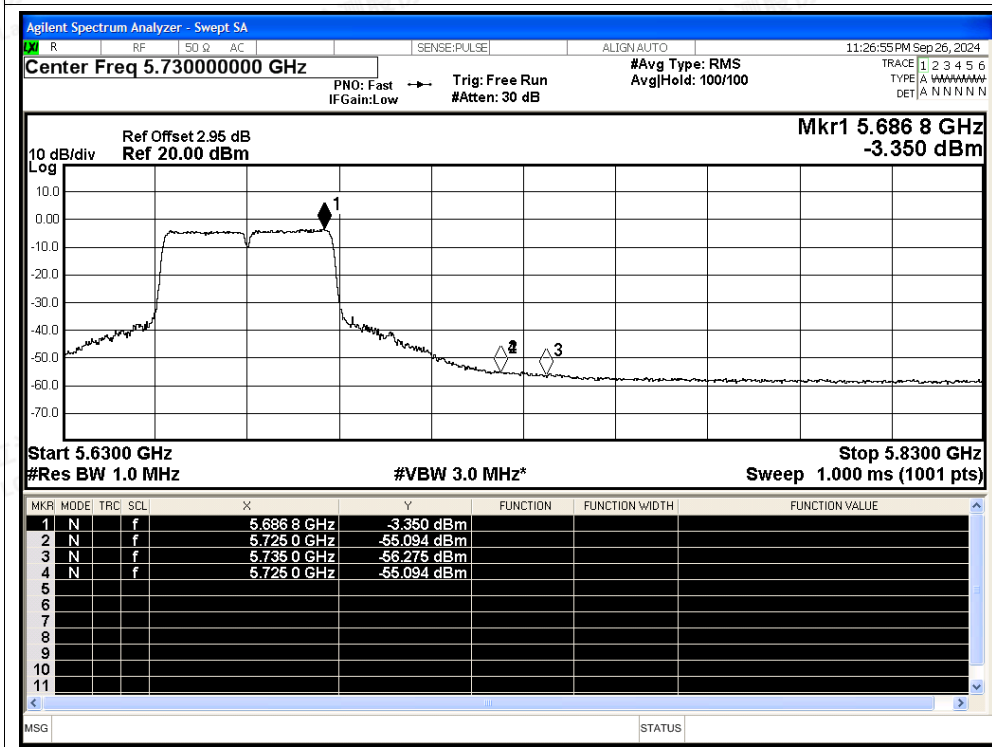

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant0 Peak

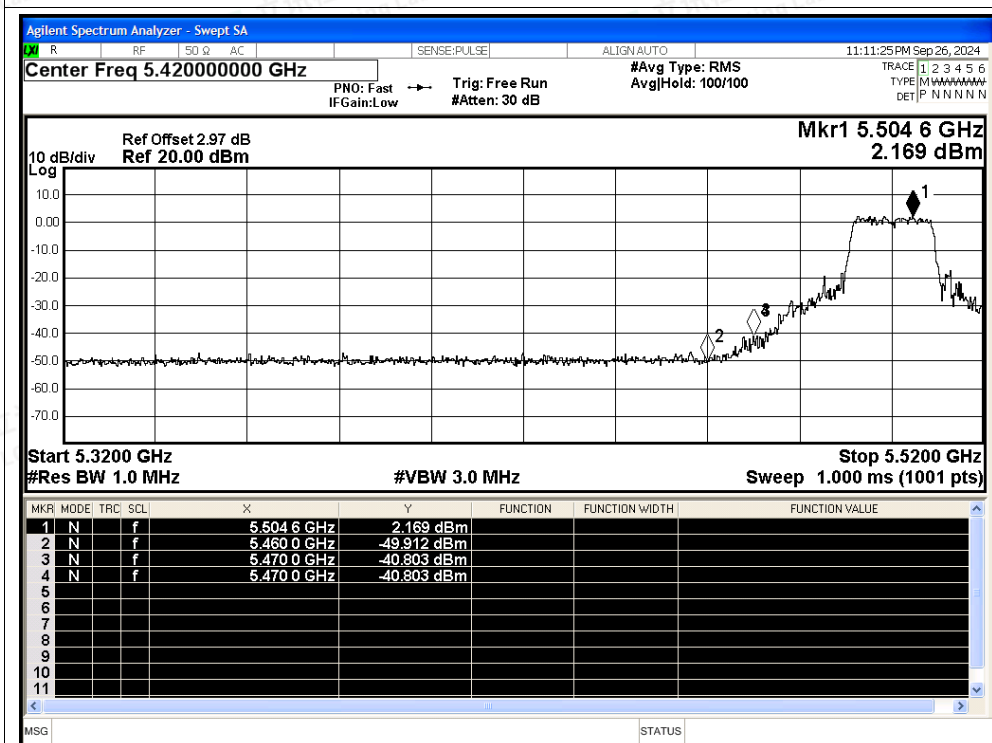

Restrict Band NVNT ac20 5500MHz Ant0 Average

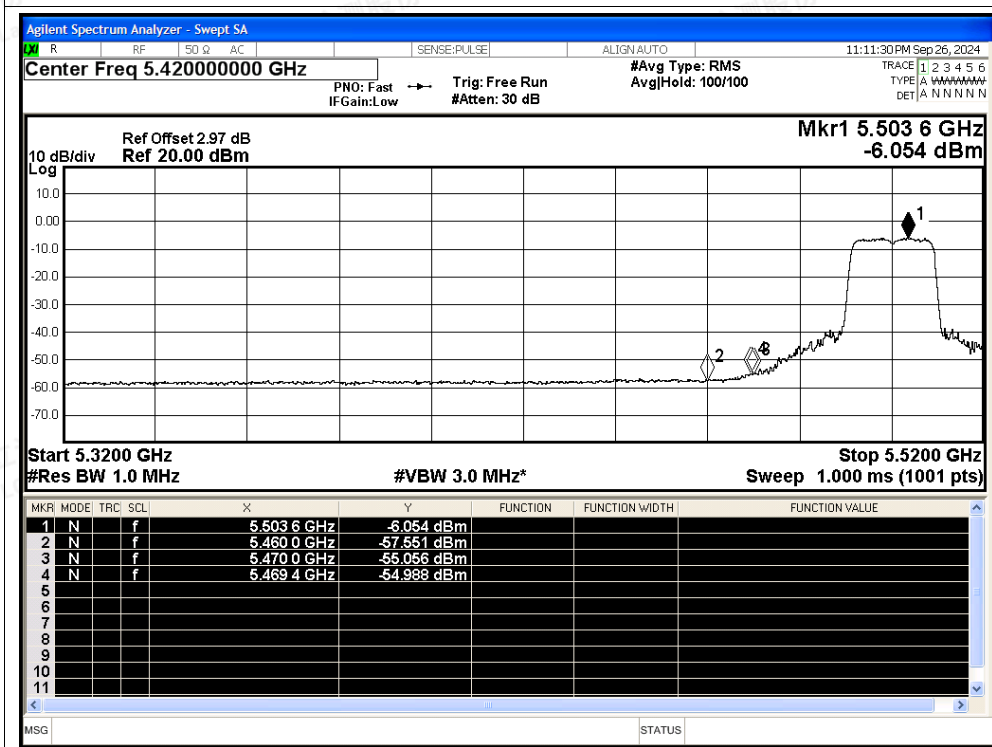

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant0 Peak

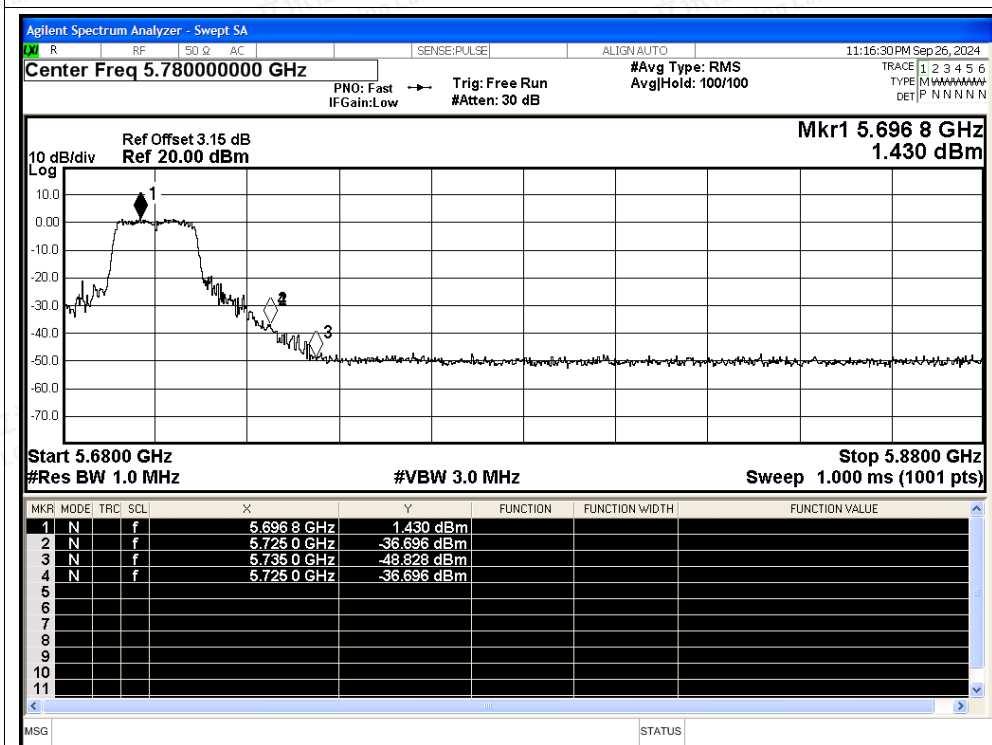

Restrict Band NVNT ac20 5700MHz Ant0 Average

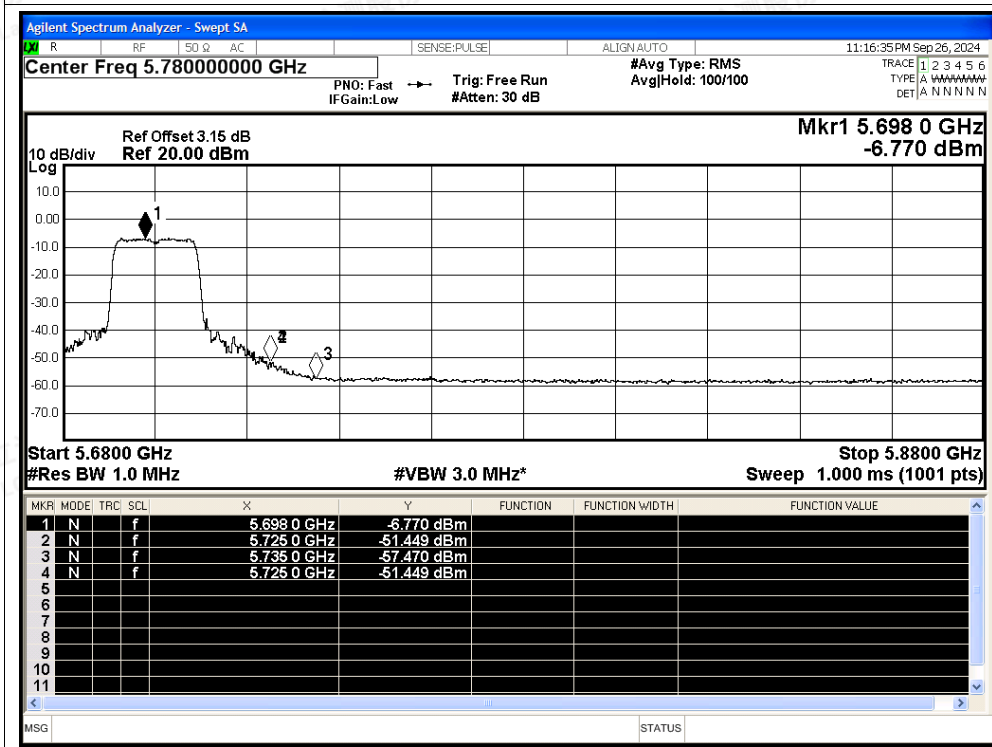

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant0 Peak

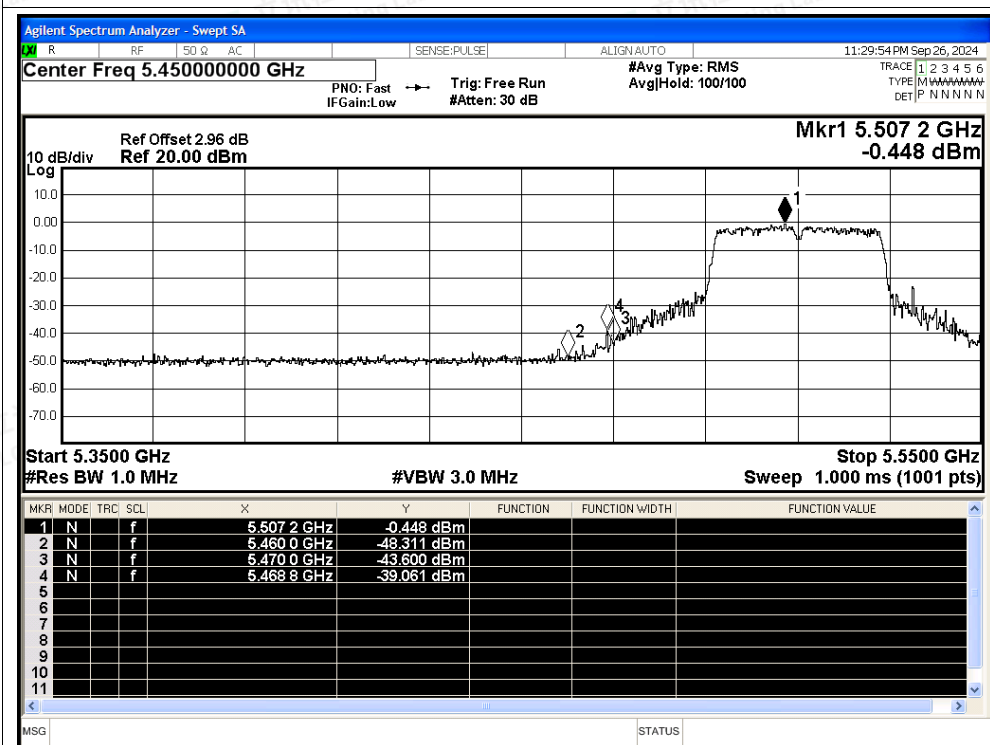

Restrict Band NVNT ac40 5510MHz Ant0 Average

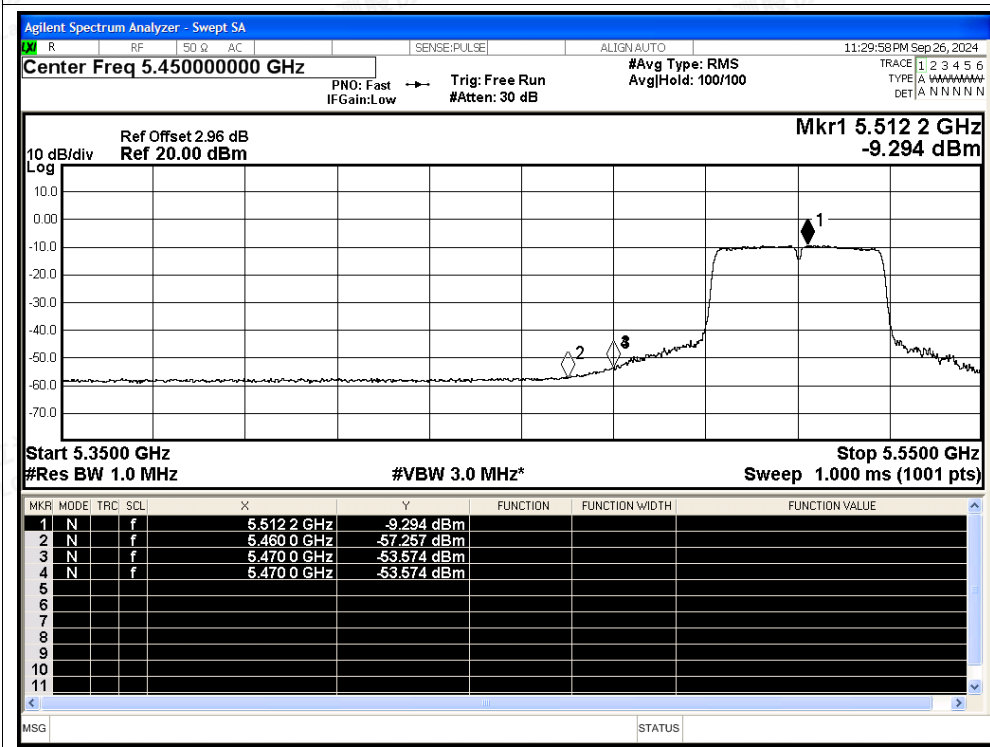

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant0 Peak

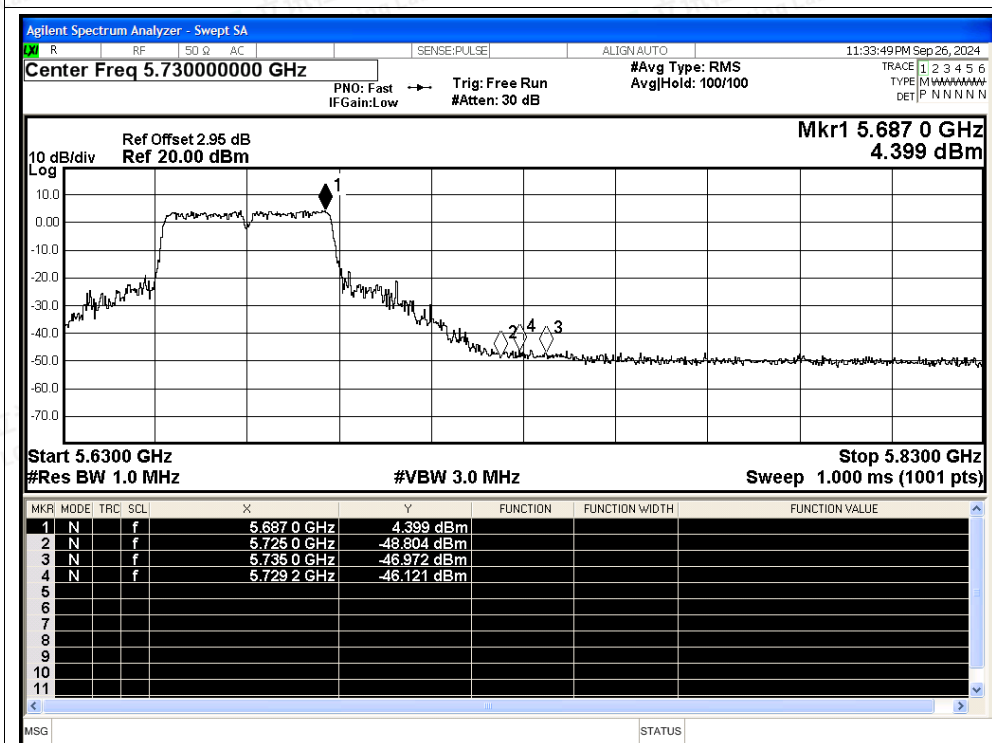

Restrict Band NVNT ac40 5670MHz Ant0 Average

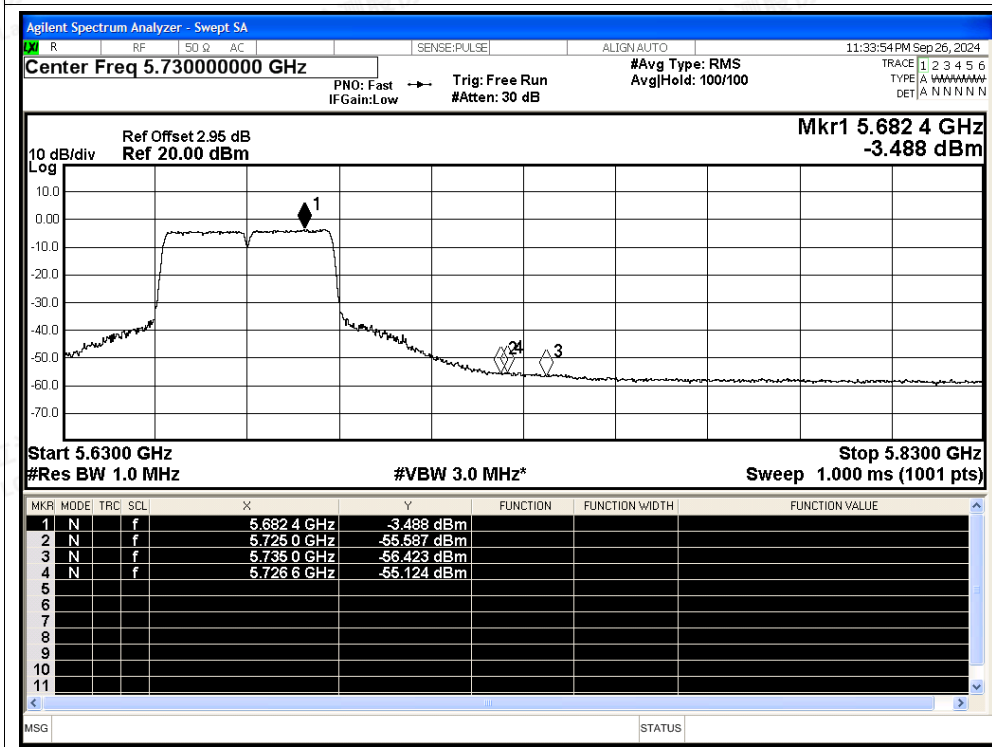

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant0 Peak

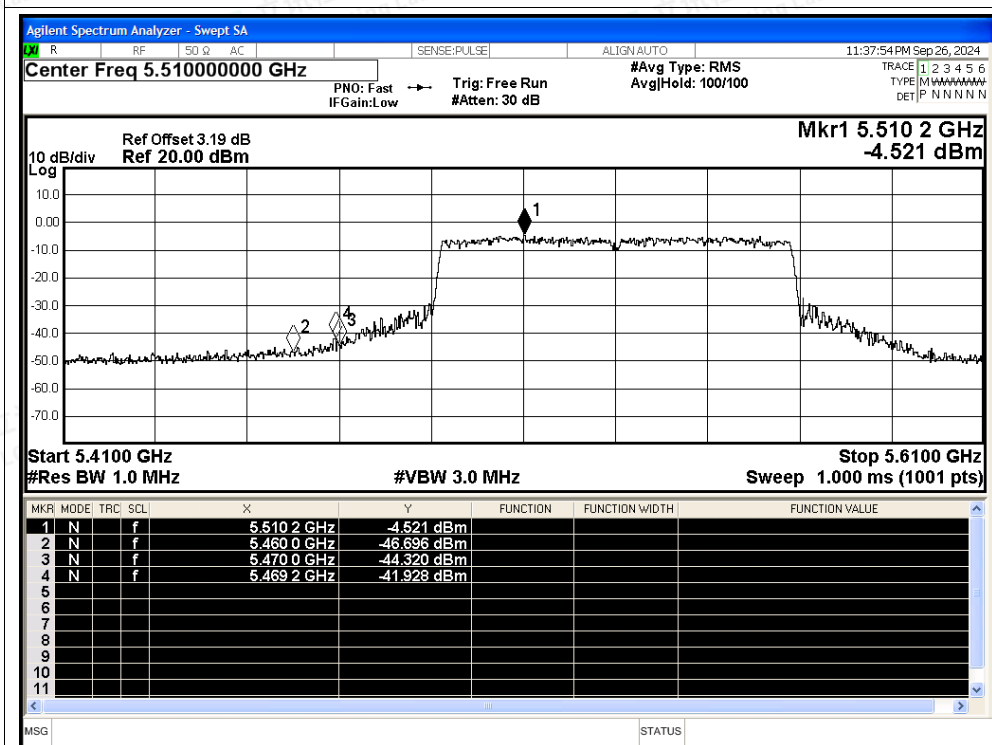

Restrict Band NVNT ac80 5530MHz Ant0 Average

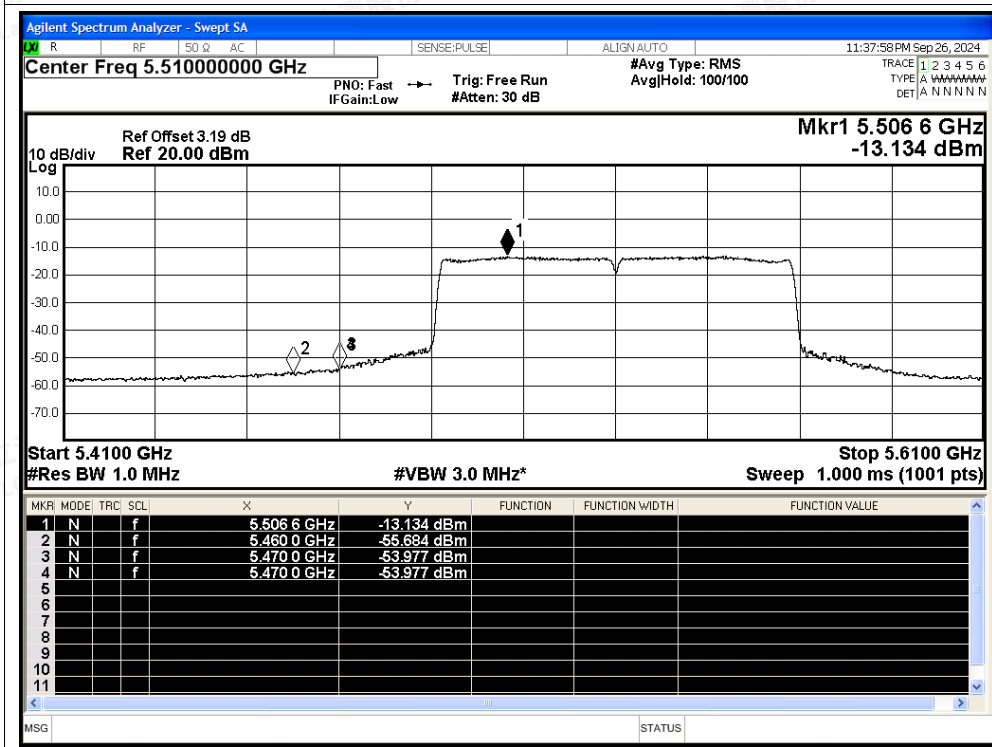

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant0 Peak

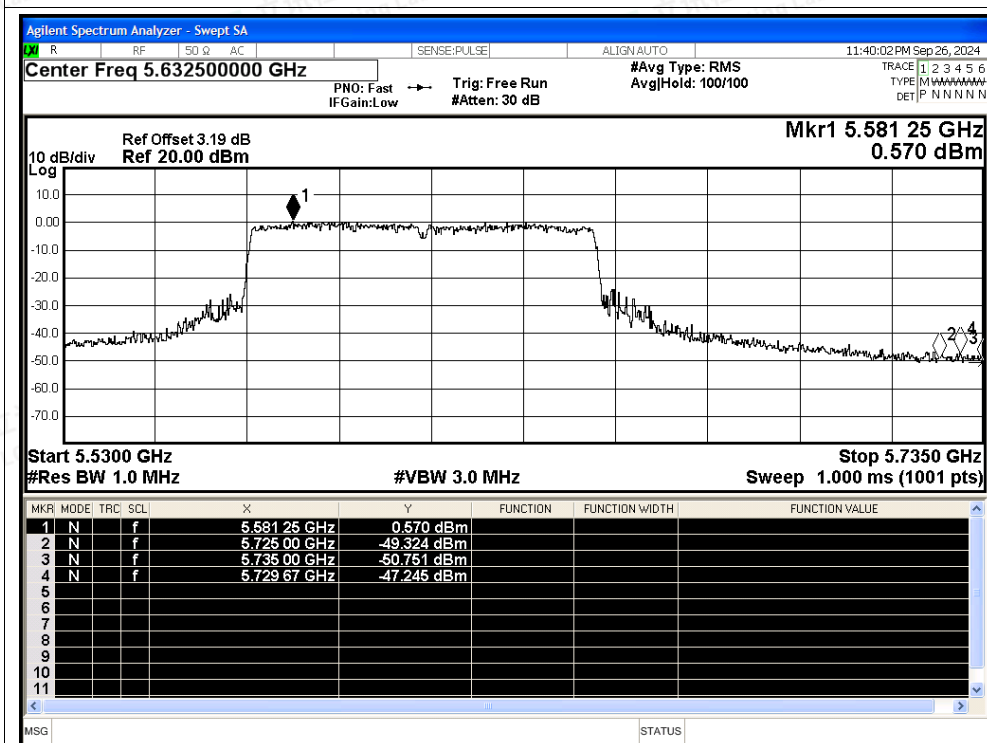

Restrict Band NVNT ac80 5610MHz Ant0 Average

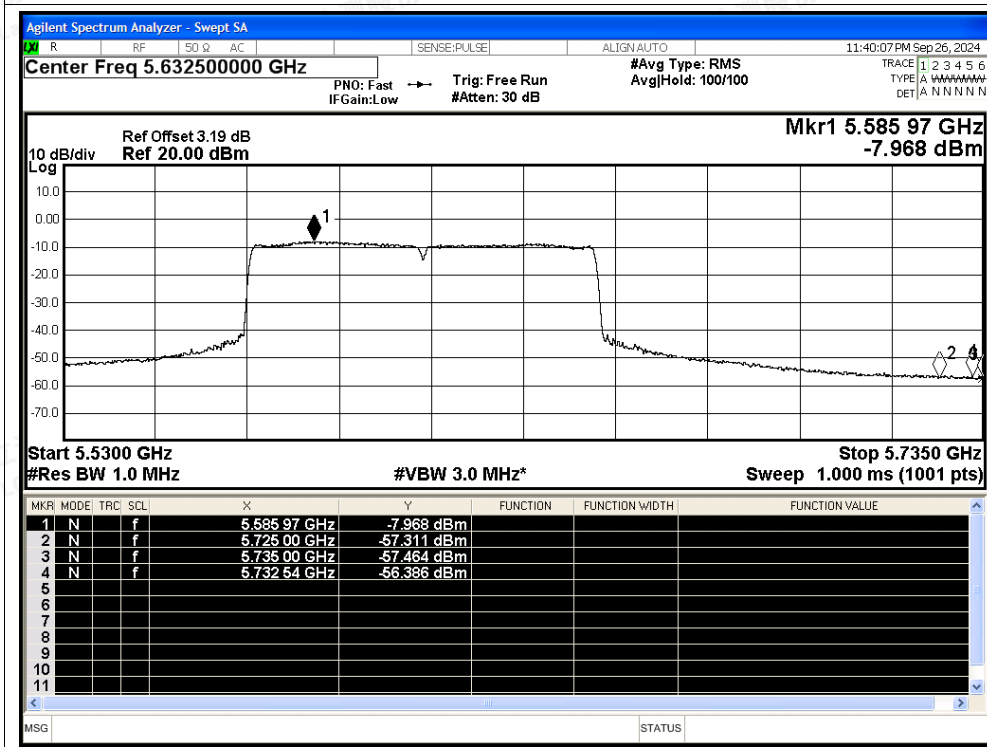

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant0 Peak

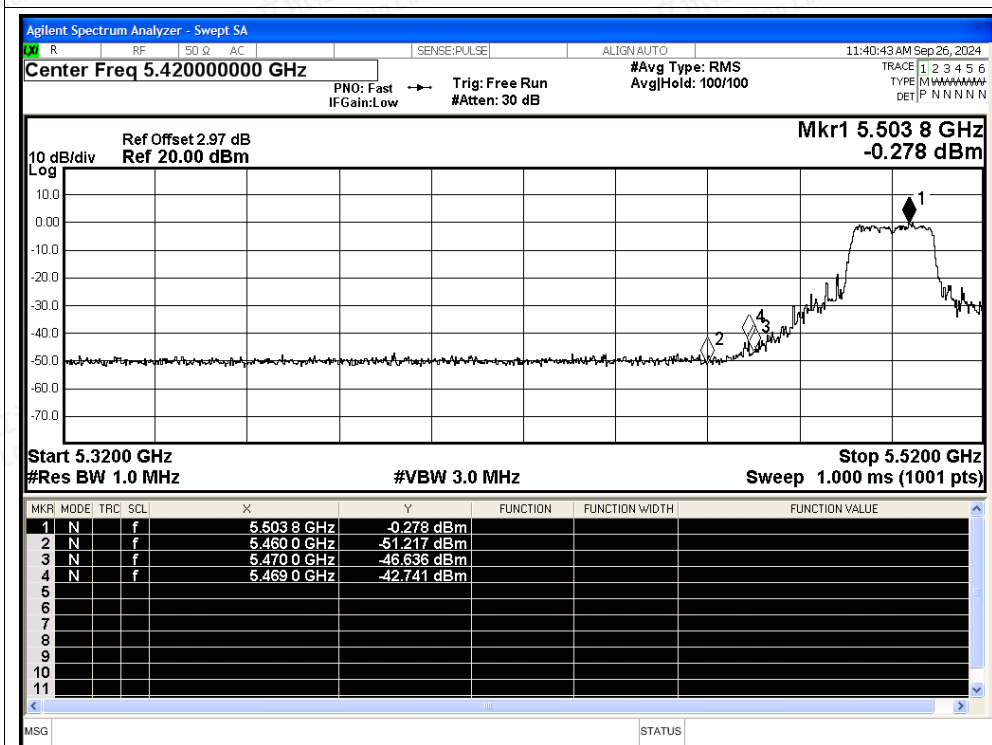

Restrict Band NVNT ax20 5500MHz Ant0 Average

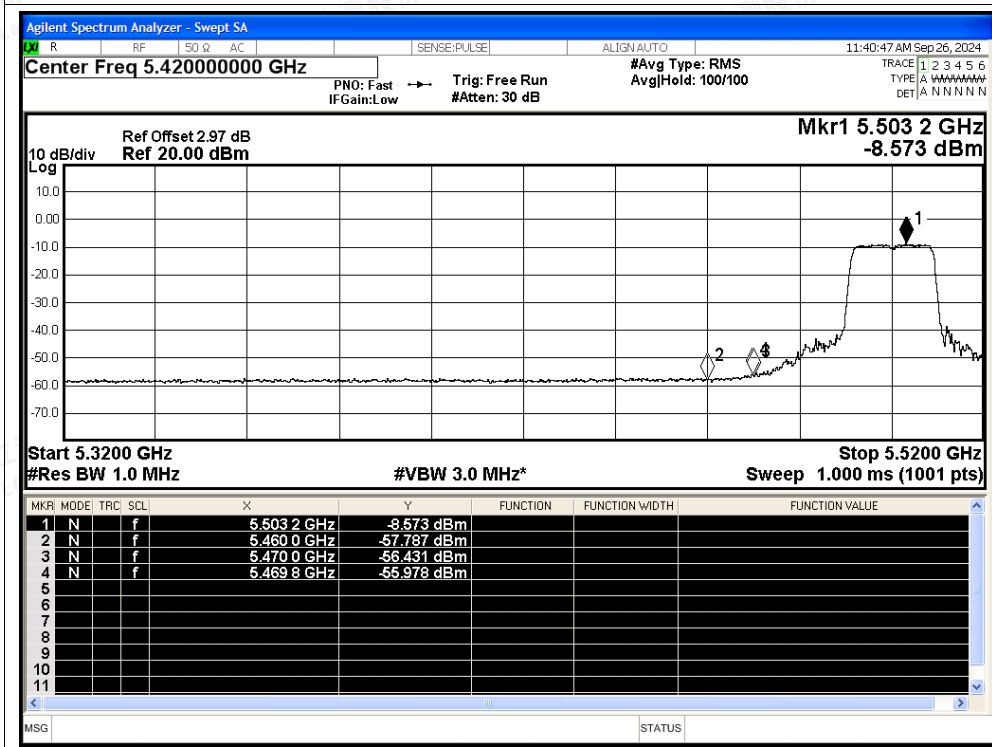

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant0 Peak

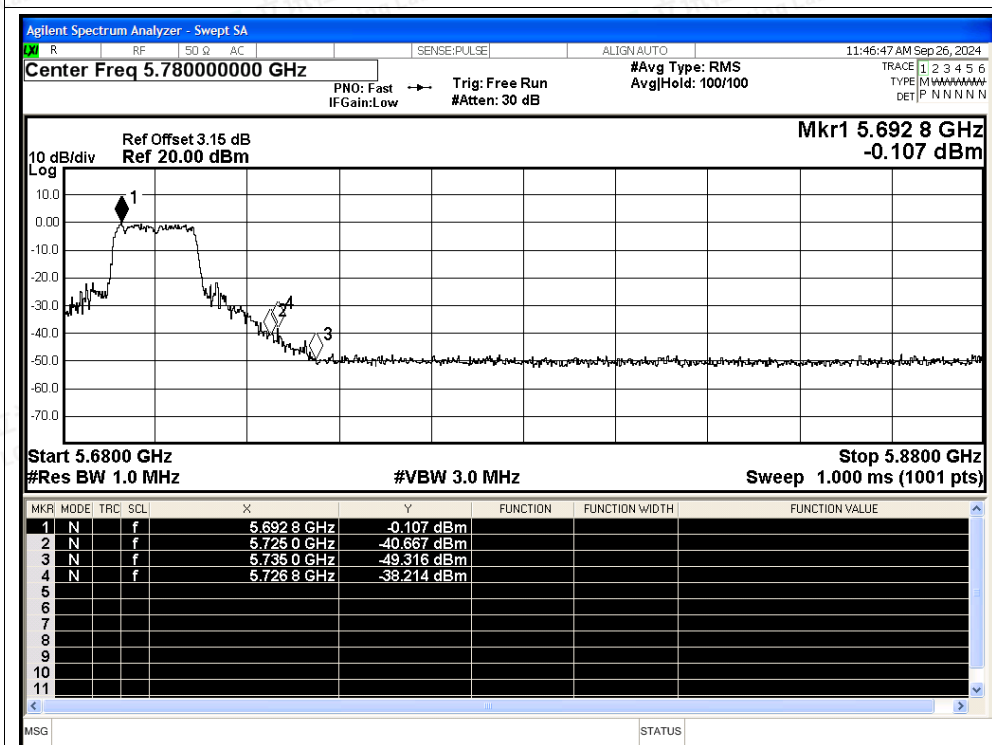

Restrict Band NVNT ax20 5700MHz Ant0 Average

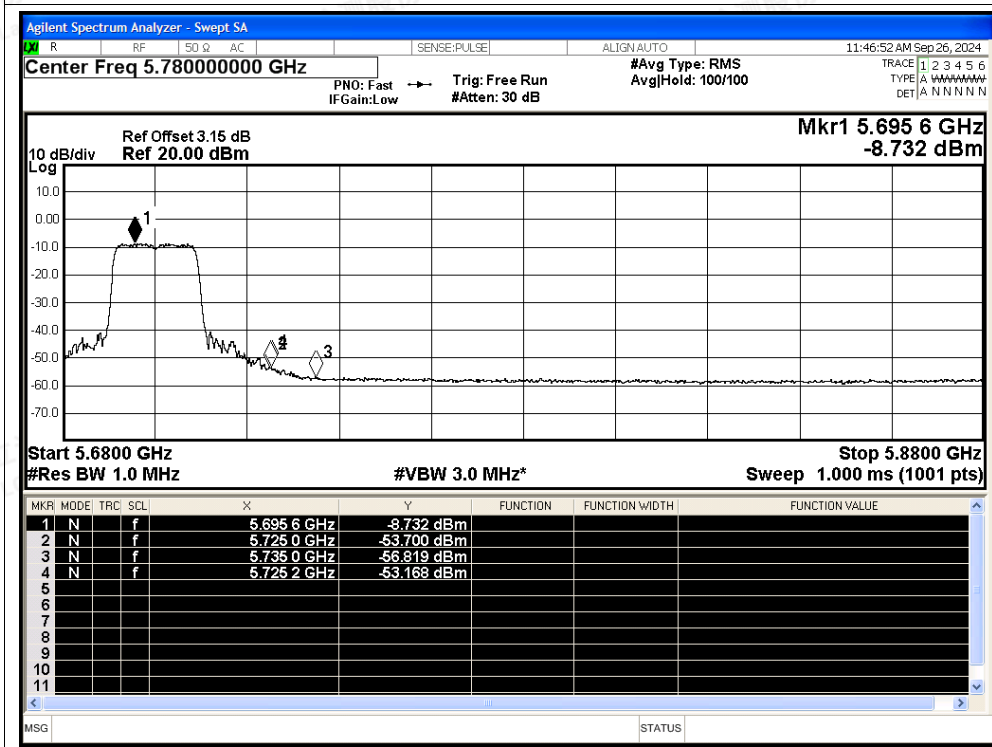

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant0 Peak

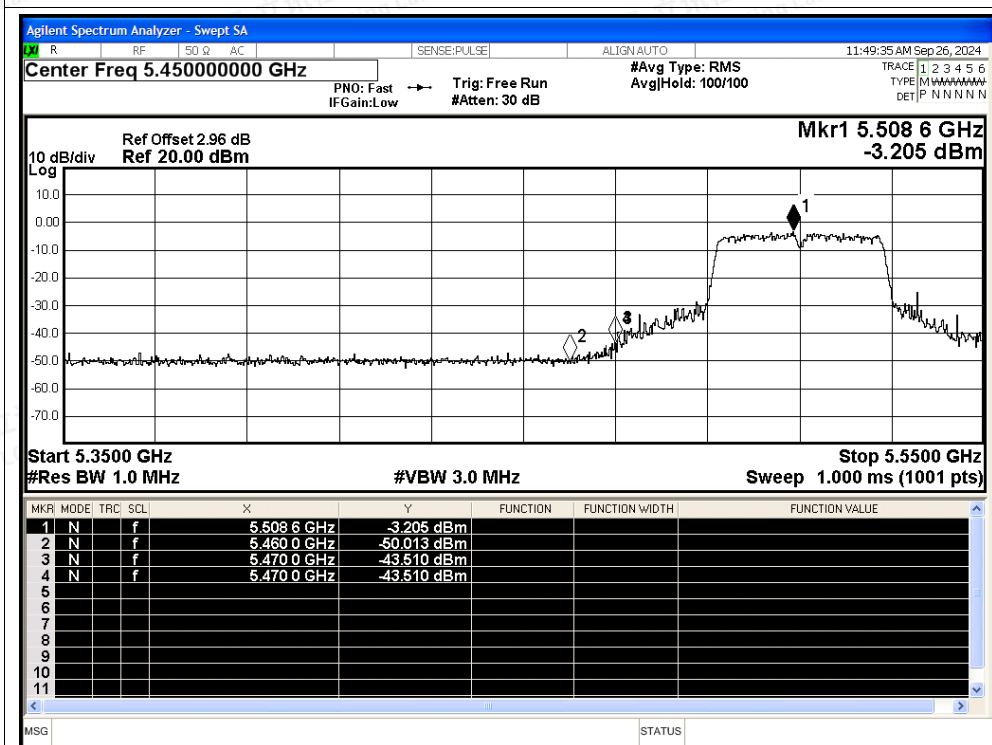

Restrict Band NVNT ax40 5510MHz Ant0 Average

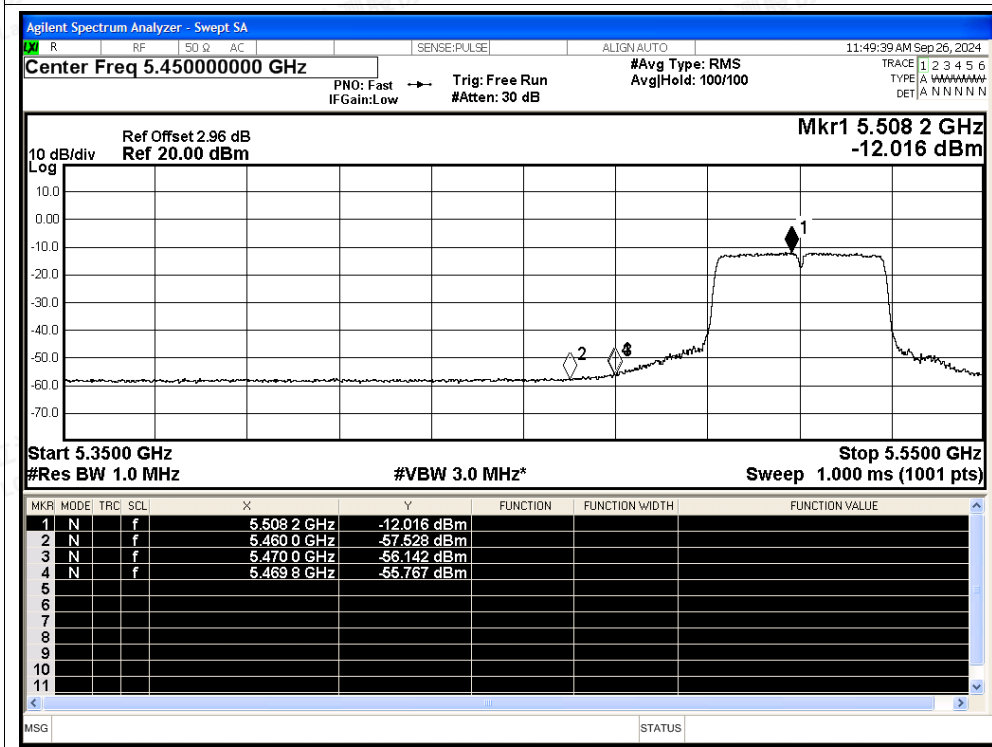

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant0 Peak

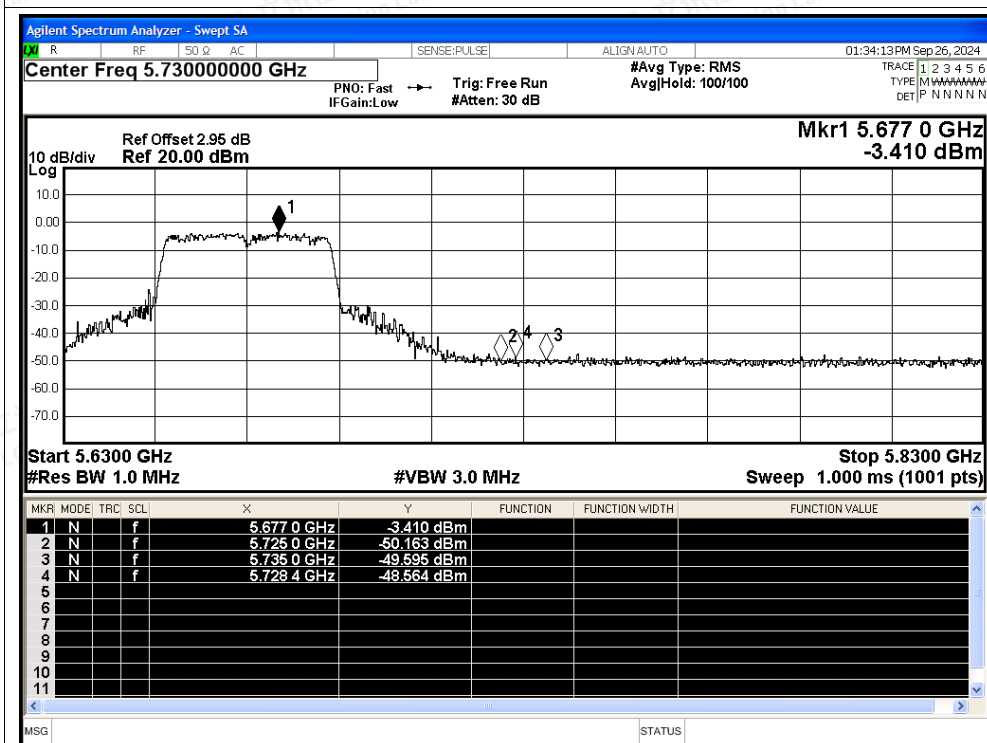

Restrict Band NVNT ax40 5670MHz Ant0 Average

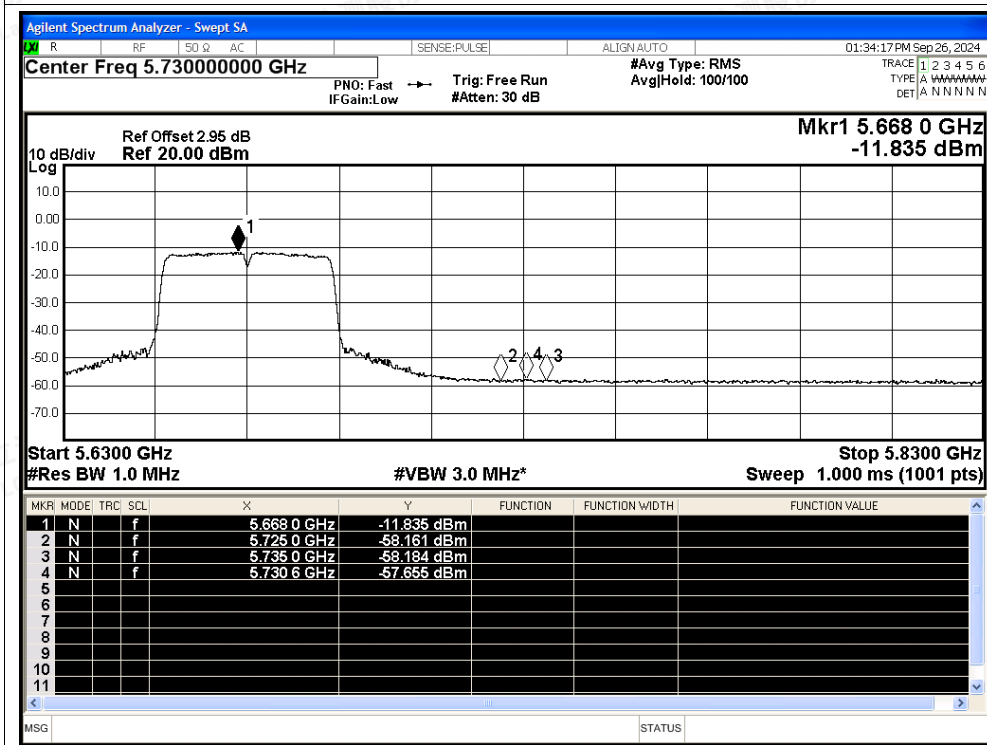

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz Ant0 Peak

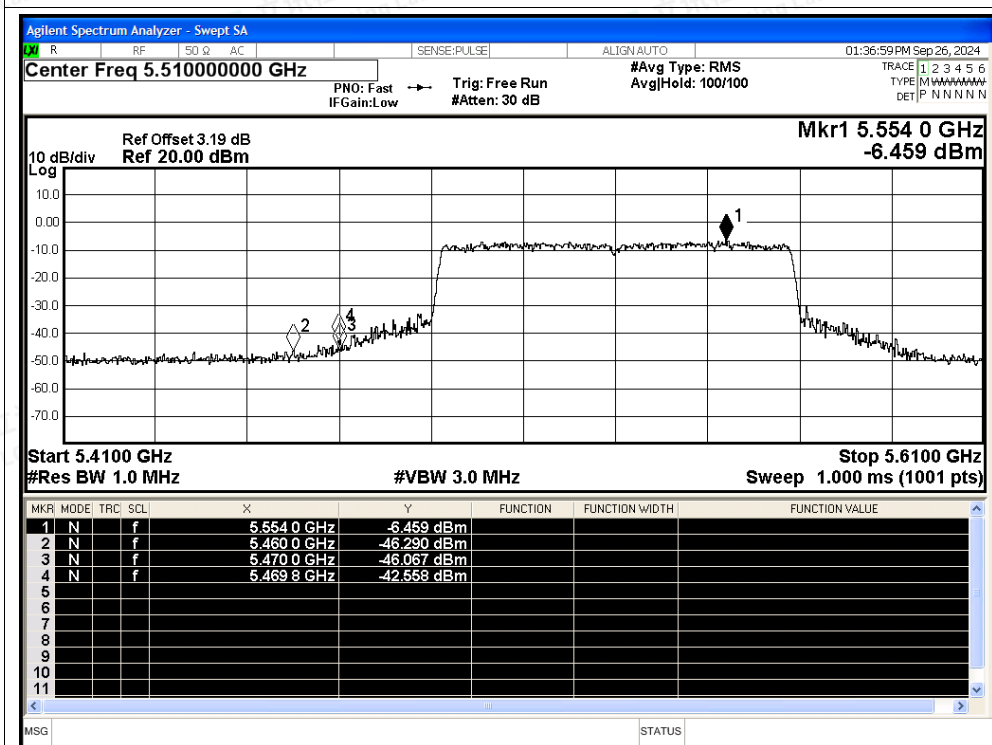

Restrict Band NVNT ax80 5530MHz Ant0 Average

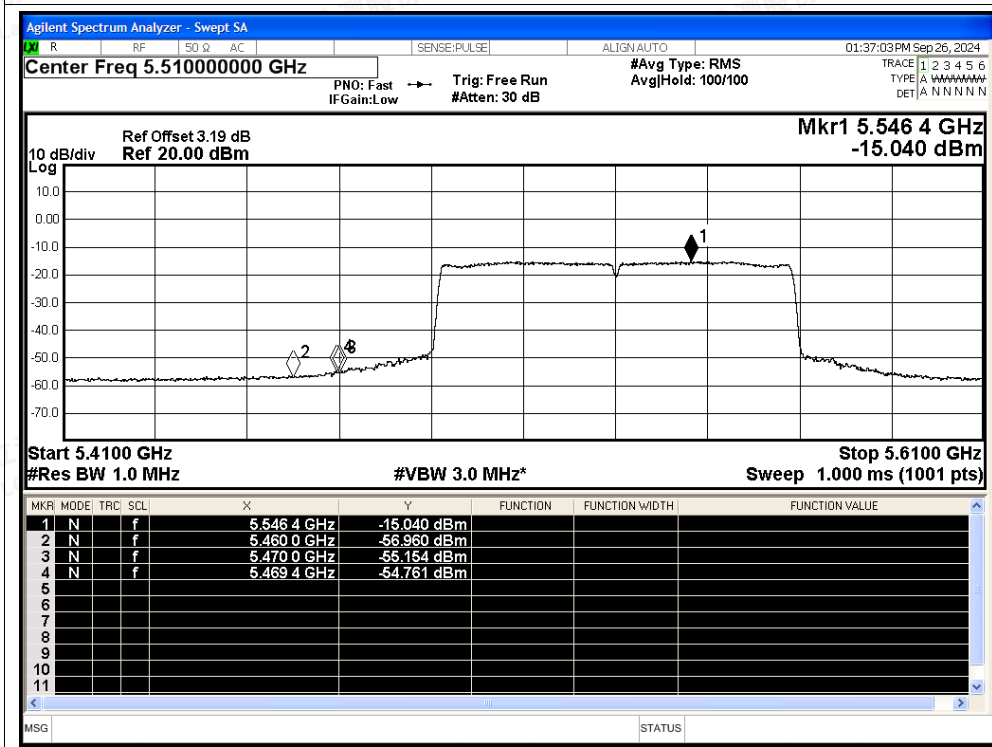

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz Ant0 Peak

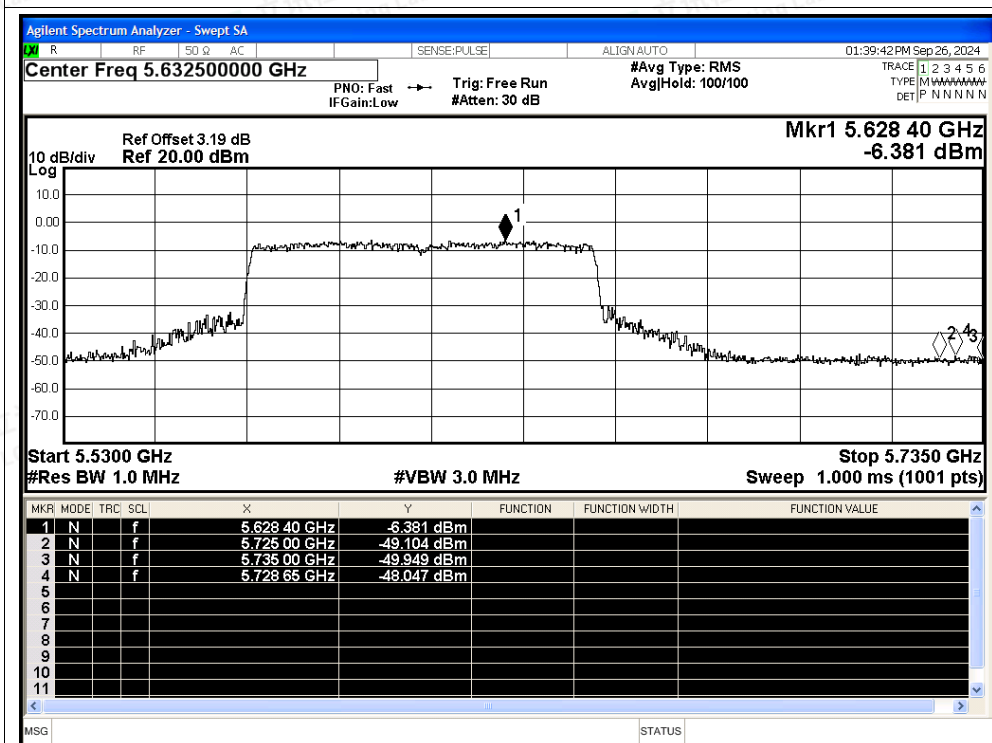

Restrict Band NVNT ax80 5610MHz Ant0 Average

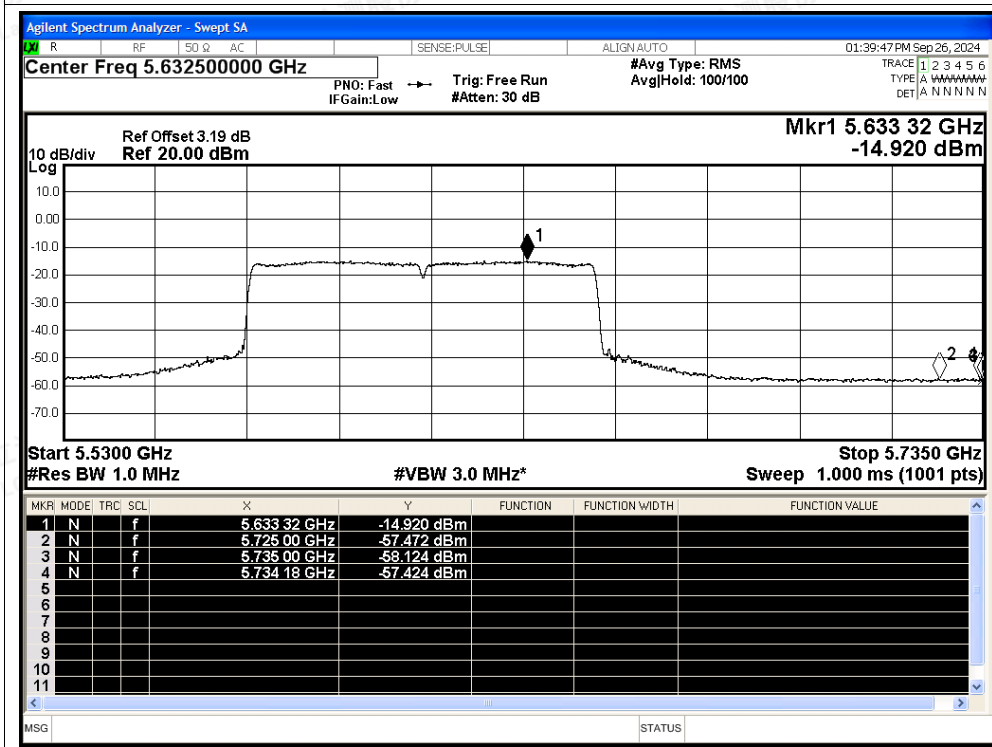

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-49.17	6.3	-	52.36	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.74	6.3	0.24	44.03	Average	54	Pass
NVNT	a	5500	Ant1	5468.8	-46.13	6.3	-	55.40	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-56.3	6.3	0.24	45.47	Average	54	Pass
NVNT	a	5500	Ant1	5470	-47.24	6.3	-	54.29	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-56.3	6.3	-	45.23	Average	54	Pass
NVNT	a	5700	Ant1	5725	-39.57	6.3	0.24	62.20	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-53.87	6.3	-	47.66	Average	54	Pass
NVNT	a	5700	Ant1	5725.6	-38.5	6.3	-	63.03	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-53.87	6.3	0.24	47.90	Average	54	Pass
NVNT	a	5700	Ant1	5735	-47.38	6.3	-	54.15	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.68	6.3	0.12	43.97	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-50.03	6.3	-	51.50	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-57.66	6.3	0.12	43.99	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-44.52	6.3	-	57.01	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-54.97	6.3	-	46.56	Average	54	Pass
NVNT	n20	5500	Ant1	5725	-40.72	6.3	0.12	60.93	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-54.97	6.3	-	46.56	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-40.72	6.3	-	60.81	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-55.45	6.3	0.12	46.20	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-48.55	6.3	-	52.98	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-57.27	6.3	0.12	44.38	Average	54	Pass
NVNT	n20	5700	Ant1	5725.6	-39.89	6.3	-	61.64	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.45	6.3	0.12	48.20	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-50.59	6.3	-	50.94	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-57.44	6.3	0.12	44.21	Average	54	Pass
NVNT	n40	5510	Ant1	5469.4	-40.77	6.3	-	60.76	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.2	-54.21	6.3	0.12	47.44	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-41.3	6.3	-	60.23	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-55.02	6.3	-	46.51	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-48.94	6.3	0.12	52.71	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.91	6.3	-	45.62	Average	54	Pass
NVNT	n40	5670	Ant1	5728.6	-45.66	6.3	0.12	55.99	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-55.91	6.3	-	45.62	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-49.56	6.3	-	51.97	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-56.58	6.3	0.12	45.07	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-51.09	6.3	-	50.44	Peak	68.2	Pass





NVNT	ac20	5500	Ant1	5460	-57.86	6.3	0.12	43.79	Average	54	Pass
NVNT	ac20	5500	Ant1	5469.2	-44.49	6.3	-	57.04	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5469.8	-55.01	6.3	0.12	46.64	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-44.92	6.3	-	56.61	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-55.58	6.3	-	45.95	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-40.35	6.3	0.12	61.30	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-53.96	6.3	-	47.57	Average	54	Pass
NVNT	ac20	5700	Ant1	5728.4	-37.93	6.3	0.12	63.72	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-51.96	6.3	-	49.57	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-47.23	6.3	0.12	54.42	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.3	6.3	0.12	44.35	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-50.16	6.3	-	51.37	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-57.48	6.3	0.12	44.17	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-41.98	6.3	-	59.55	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5469.8	-54.01	6.3	0.12	47.64	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-41.98	6.3	-	59.55	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-54.19	6.3	-	47.34	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-48.34	6.3	0.12	53.31	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-56.49	6.3	-	45.04	Average	54	Pass
NVNT	ac40	5670	Ant1	5729.6	-46.76	6.3	0.25	55.02	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.2	-55.61	6.3	-	45.92	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-49.12	6.3	0.25	52.66	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-56.1	6.3	-	45.43	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-47.55	6.3	0.25	54.23	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-55.9	6.3	-	45.63	Average	54	Pass
NVNT	ac80	5530	Ant1	5463.8	-41.13	6.3	0.25	60.65	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5469.6	-53.36	6.3	-	48.17	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-42.82	6.3	0.25	58.96	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-53.83	6.3	-	47.70	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-50.36	6.3	0.25	51.42	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-57.79	6.3	-	43.74	Average	54	Pass
NVNT	ac80	5610	Ant1	5725.365	-46.82	6.3	0.12	54.83	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5732.95	-56.68	6.3	-	44.85	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-49.09	6.3	0.12	52.56	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-57.11	6.3	-	44.42	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-50.98	6.3	0.12	50.67	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-57.88	6.3	-	43.65	Average	54	Pass
NVNT	ax20	5500	Ant1	5468.2	-42.29	6.3	0.12	59.36	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5469.8	-56.17	6.3	-	45.36	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-42.82	6.3	0.12	58.83	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-56.71	6.3	-	44.82	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax20	5700	Ant1	5725	-39.96	6.3	0.12	61.69	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-53.61	6.3	-	47.92	Average	54	Pass
NVNT	ax20	5700	Ant1	5726.2	-39.68	6.3	0.24	62.09	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725.6	-53.52	6.3	-	48.01	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-49.2	6.3	0.24	52.57	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-57.05	6.3	-	44.48	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-49.69	6.3	0.24	52.08	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-58.3	6.3	-	43.23	Average	54	Pass
NVNT	ax40	5510	Ant1	5467	-41.94	6.3	0.24	59.83	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5469.8	-55.22	6.3	-	46.31	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-43.42	6.3	-	58.11	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-55.59	6.3	0.24	46.18	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-45.97	6.3	-	55.56	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-54.78	6.3	0.25	47.00	Average	54	Pass
NVNT	ax40	5670	Ant1	5727.8	-44.37	6.3	-	57.16	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-54.78	6.3	0.25	47.00	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-48.39	6.3	0.25	53.39	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-57.16	6.3	-	44.37	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-48.7	6.3	-	52.83	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-57.08	6.3	0.25	44.70	Average	54	Pass
NVNT	ax80	5530	Ant1	5469.6	-42.95	6.3	-	58.58	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-54.11	6.3	0.25	47.67	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-44.63	6.3	-	56.90	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-54.11	6.3	0.25	47.67	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-49.68	6.3	-	51.85	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-57.61	6.3	0.25	44.17	Average	54	Pass
NVNT	ax80	5610	Ant1	5730.49	-48.77	6.3	-	52.76	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5726.185	-57.47	6.3	0.25	44.31	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-50.06	6.3	-	51.47	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-58.18	6.3	0.25	43.60	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

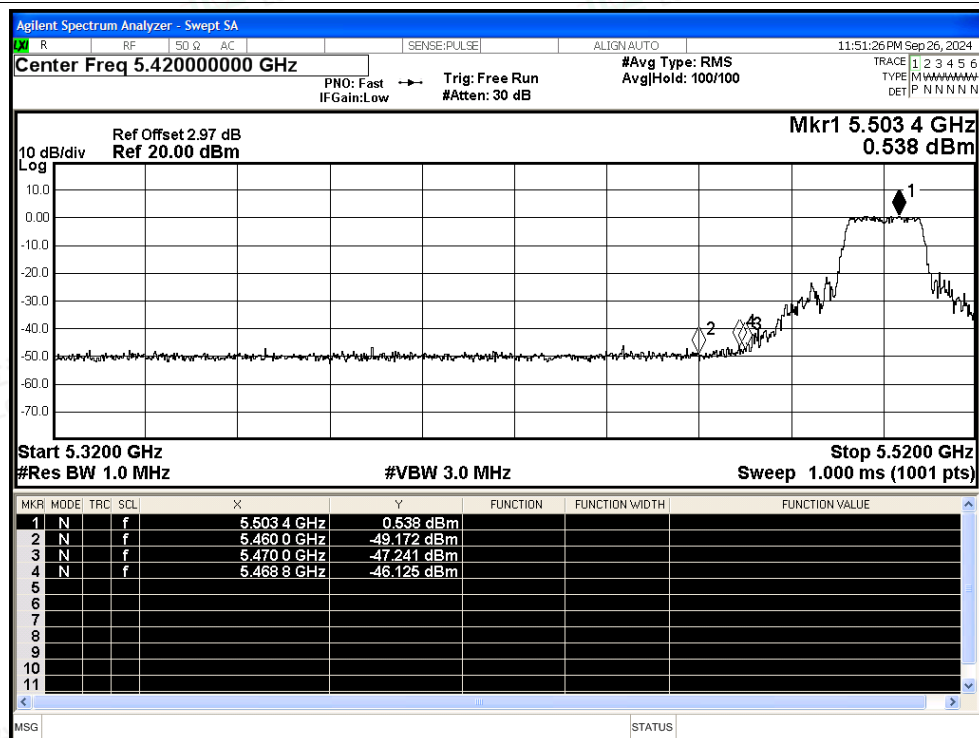

Restrict Band NVNT a 5500MHz Ant1 Average

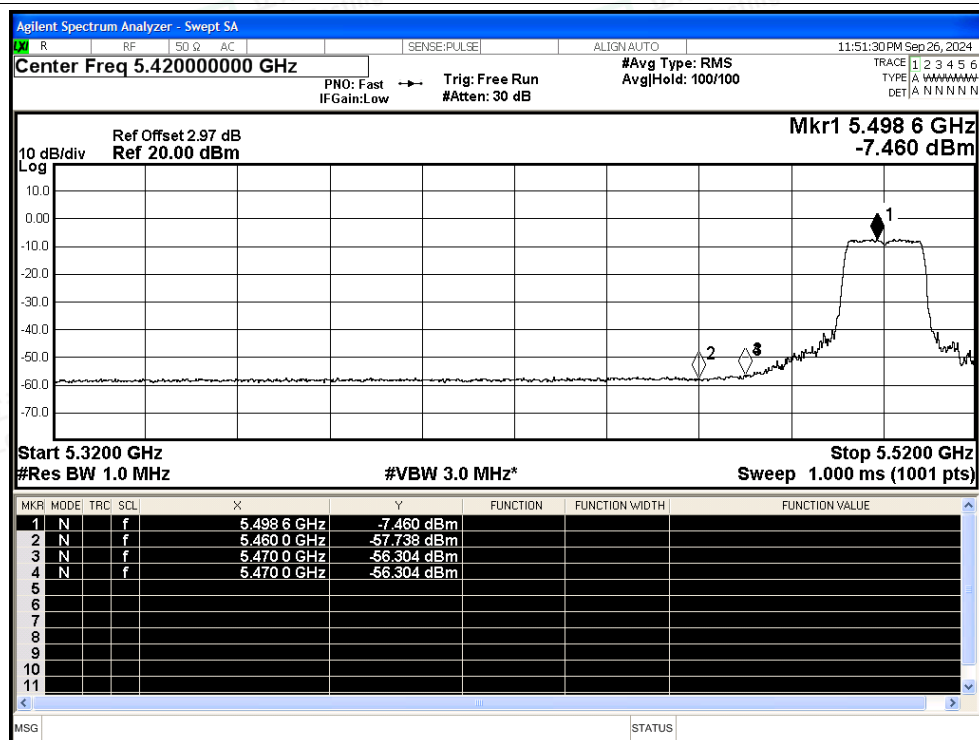

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

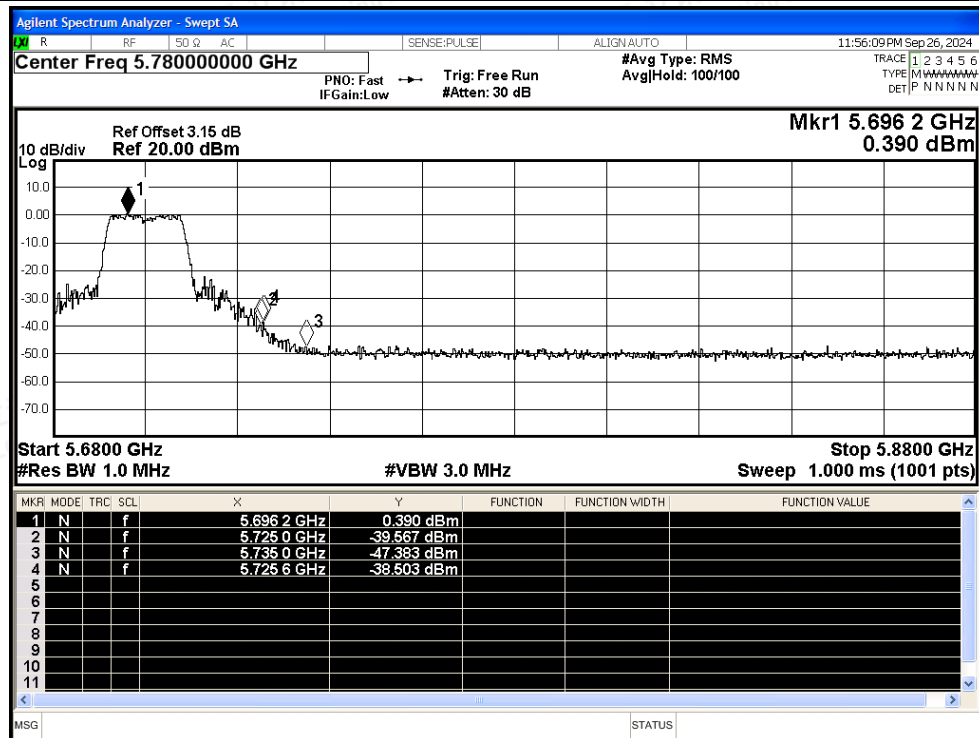

Restrict Band NVNT a 5700MHz Ant1 Average

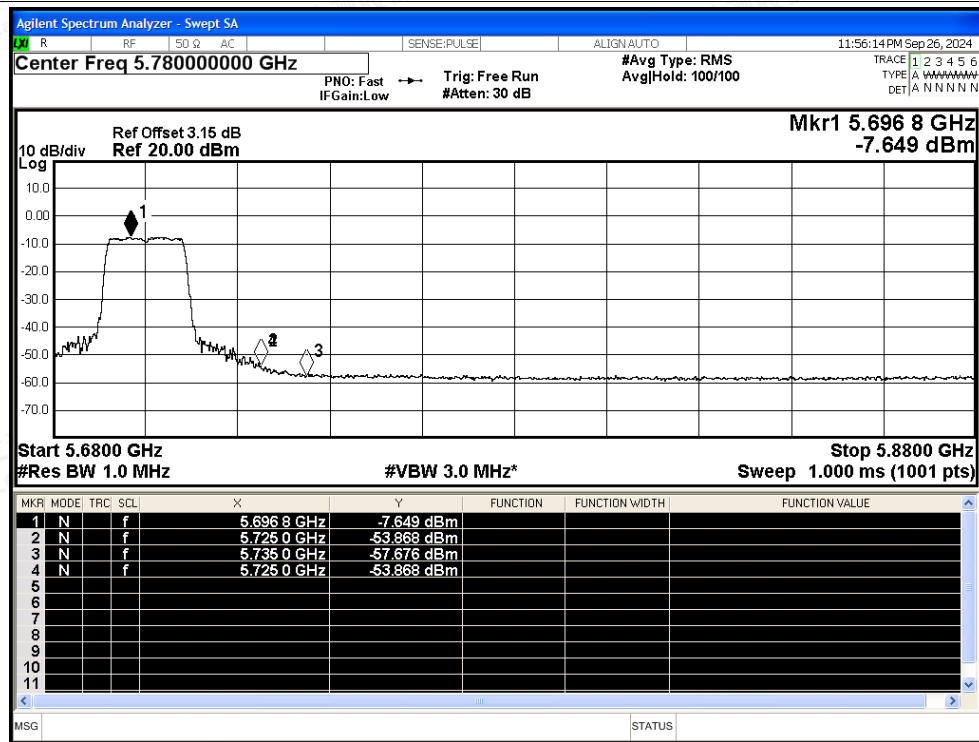

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak

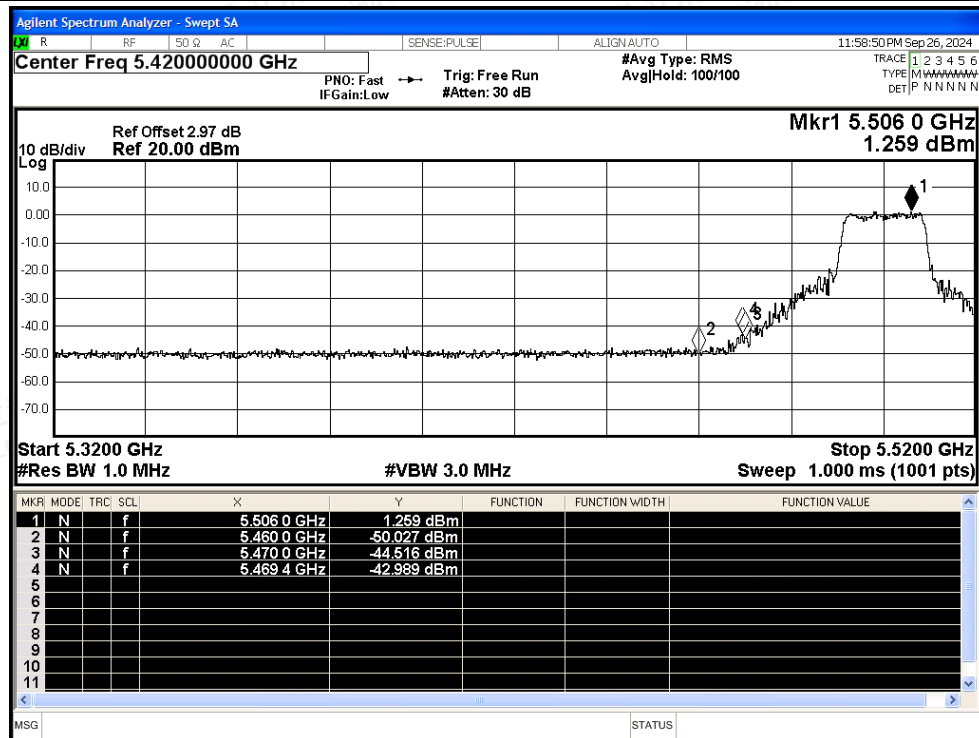


Restrict Band NVNT n20 5500MHz Ant1 Average

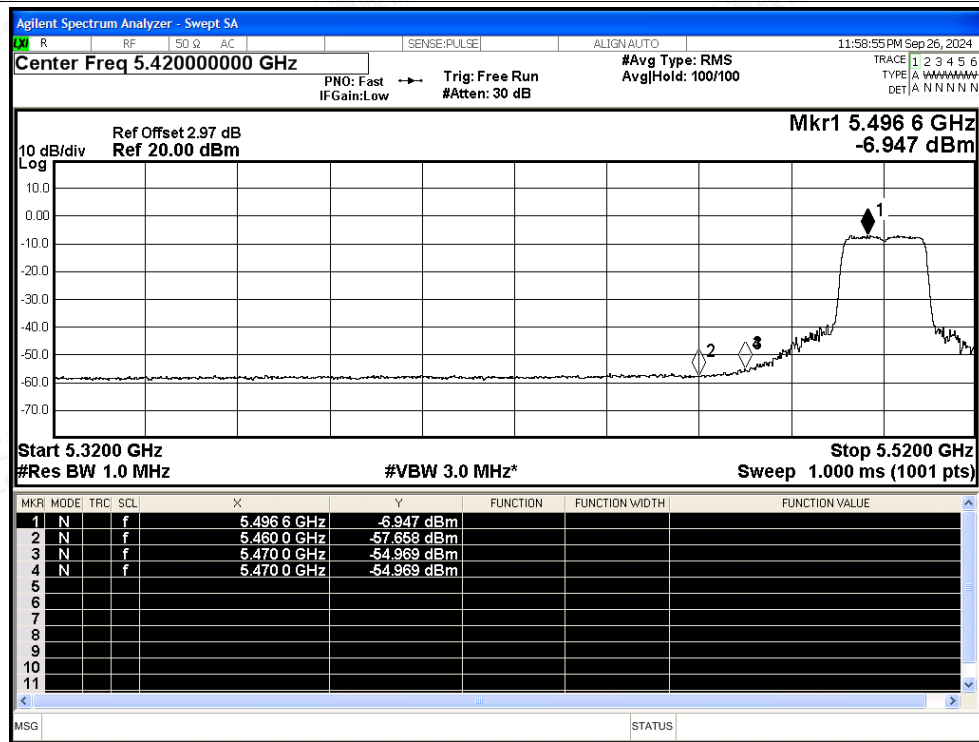




Restrict Band NVNT n20 5700MHz Ant1 Peak

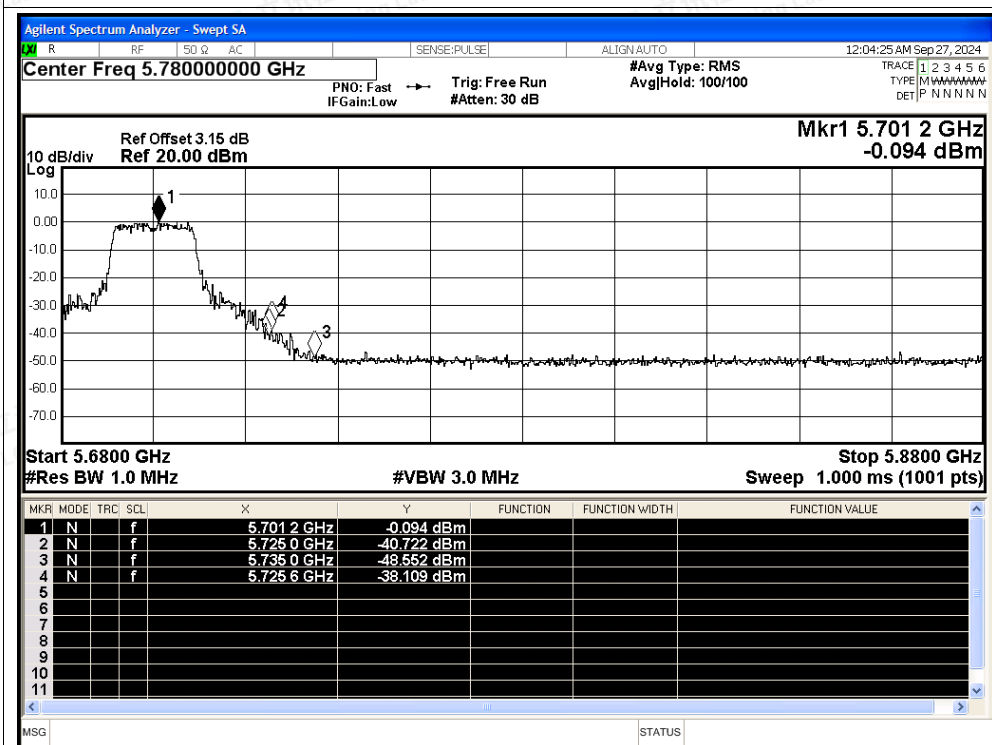

Restrict Band NVNT n20 5700MHz Ant1 Average

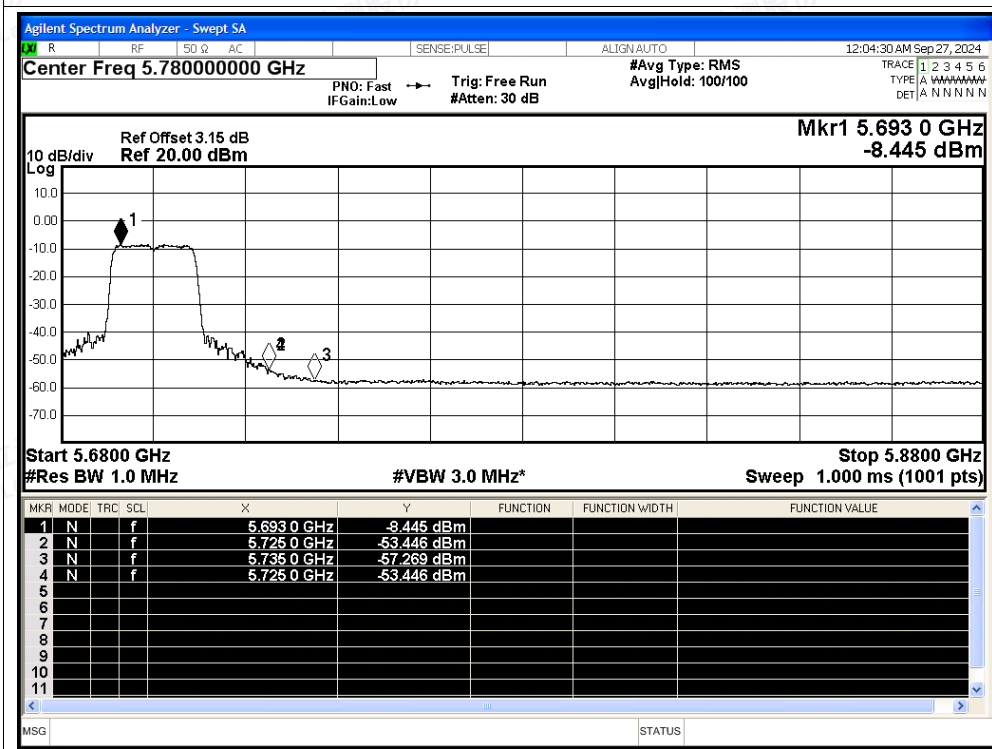

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

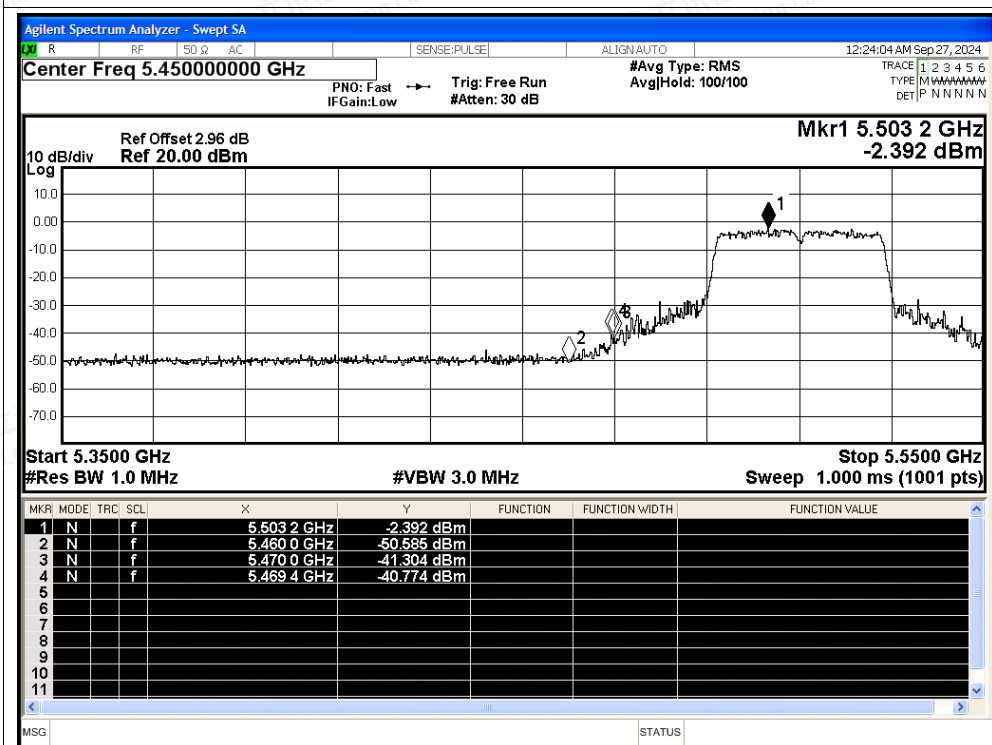

Restrict Band NVNT n40 5510MHz Ant1 Average

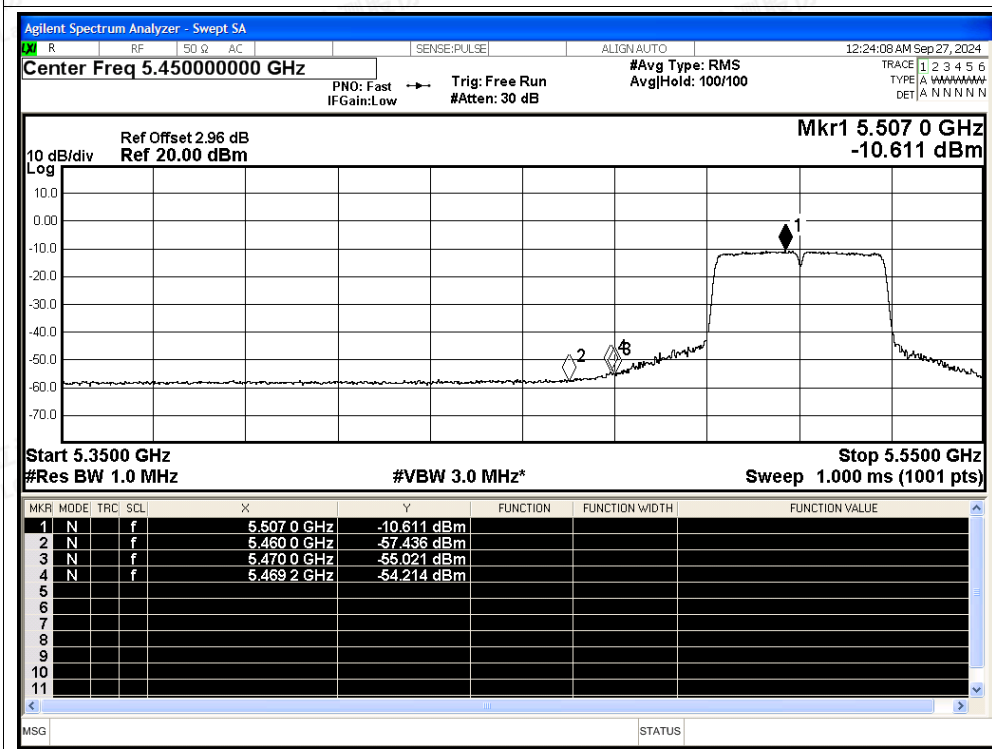

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

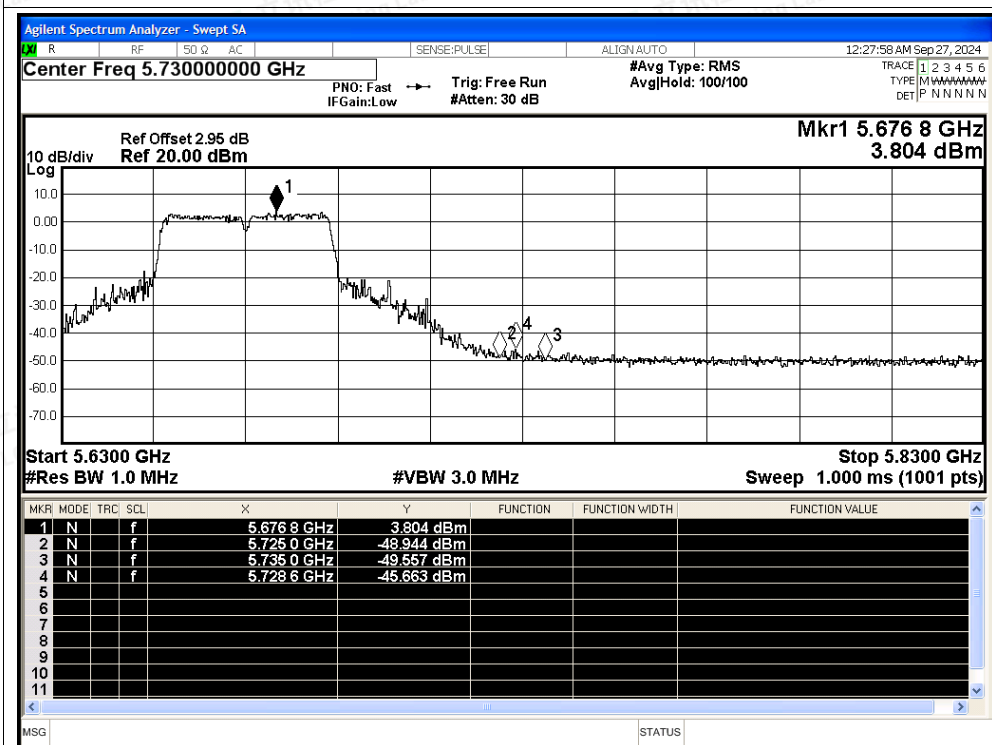

Restrict Band NVNT n40 5670MHz Ant1 Average

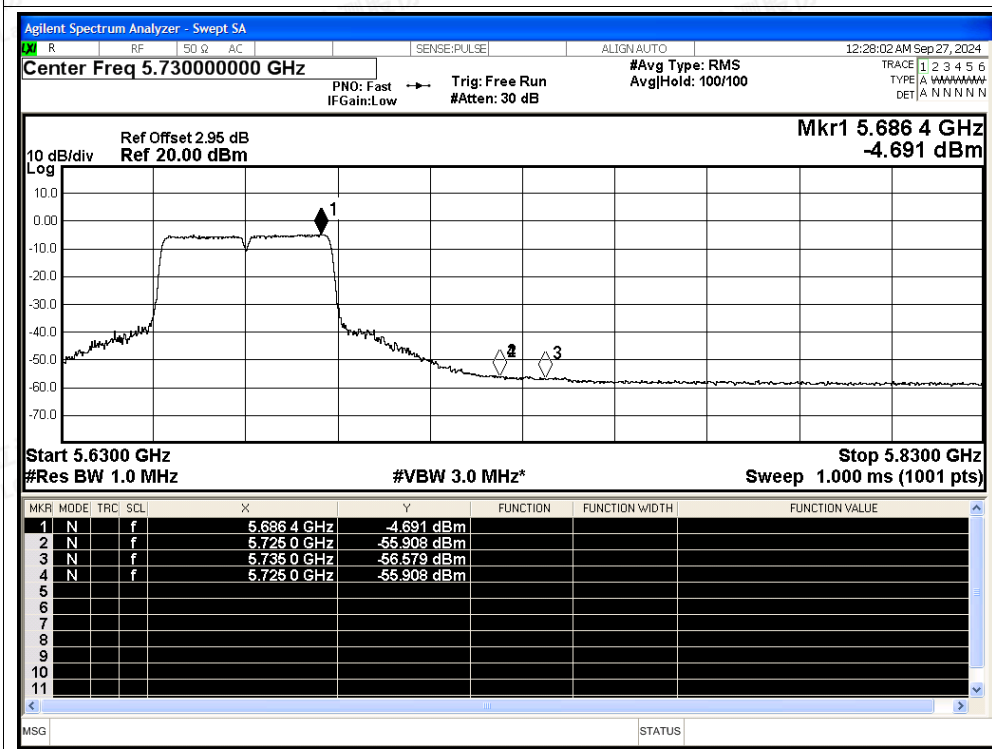

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity