# **FCC RF Test Report**

APPLICANT : Thundercomm Technology Co., Ltd

**EQUIPMENT**: Calculation Module

BRAND NAME : TurboX MODEL NAME : C6125

FCC ID : 2AOHHTURBOXC6125

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

TEST DATE(S) : Aug. 25, 2021 ~ Sep. 21, 2021

We, Sporton International (Shenzhen) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International (Shenzhen) Inc., the test report shall not be reproduced except in full.

Reviewed by: Derreck Chen / Supervisor

Frie Shih

Donale Chen

Approved by: Eric Shih / Manager

Sporton International (ShenZhen) Inc.

1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055

People's Republic of China

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 1 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Cert #5145.01

Report No.: FR180601A

## **TABLE OF CONTENTS**

RE	VISIO	N HISTORY	3
SU	MMAR	RY OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	5
	1.5	Modification of EUT	5
	1.6	Testing Location	6
	1.7	Test Software	6
	1.8	Applicable Standards	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Carrier Frequency Channel	8
	2.2	Test Mode	
	2.3	Connection Diagram of Test System	10
	2.4	Support Unit used in test configuration and system	
	2.5	EUT Operation Test Setup	
	2.6	Measurement Results Explanation Example	
3	TEST	RESULT	
	3.1	Number of Channel Measurement	
	3.2	Hopping Channel Separation Measurement	
	3.3	Dwell Time Measurement	
	3.4	20dB Bandwidth Measurement	
	3.5	Output Power Measurement	
	3.6	Conducted Band Edges Measurement	
	3.7	Conducted Spurious Emission Measurement	
	3.8	Radiated Band Edges and Spurious Emission Measurement	
	3.9	AC Conducted Emission Measurement	
		Antenna Requirements	
4		OF MEASURING EQUIPMENT	
		ERTAINTY OF EVALUATION	54
		IX A. CONDUCTED TEST RESULTS	
		IX B. AC CONDUCTED EMISSION TEST RESULT	
		IX C. RADIATED SPURIOUS EMISSION	
		IX D. DUTY CYCLE PLOTS	
ΑP	PENDI	IX E. SETUP PHOTOGRAPHS	

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 2 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR180601A

## **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR180601A	Rev. 01	Initial issue of report	Oct. 08, 2021

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 3 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## **SUMMARY OF TEST RESULT**

Report Section	FCC Rule Description		Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	-	Report only	-
3.5	3.5 15.247(b)(1) Peak Output Power		≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	3.7 Conducted Spurious Emission		≤ 20dBc	Pass	-
Radiated Band Edges 3.8 15.247(d) and Radiated Spurious Emission		15.209(a) & 15.247(d)	Pass	Under limit 11.97 dB at 2483.560 MHz	
3.9 AC Conducted Emission		15.207(a)	Pass	Under limit 12.79 dB at 0.420 MHz	
3.10	15.203 & 15.247(b)	Antenna Requirement	15.203 & 15.247(b)	Pass	-

## Declaration of Conformity:

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

## **Comments and Explanations:**

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 4 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 1 General Description

## 1.1 Applicant

## Thundercomm Technology Co., Ltd

Building 4, No. 99, Data Valley Middle Road, Xiantao District, Yubei District Chongqing, China

## 1.2 Manufacturer

## Thundercomm Technology Co., Ltd

Building 4, No. 99, Data Valley Middle Road, Xiantao District, Yubei District Chongqing, China

## 1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment Calculation Module					
Brand Name	TurboX				
Model Name	C6125				
FCC ID	2AOHHTURBOXC6125				
SN Code	Radiation/Conducted:				
Siv Code	MTR27M14003G				
HW Version	DVT V03				
SW Version	Turbox_C6125_LA1.0.FC.r001				
EUT Stage	Identical Prototype				

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

## 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 11.10 dBm (0.0129 W) Bluetooth EDR (2Mbps) : 10.60 dBm (0.0115 W) Bluetooth EDR (3Mbps) : 10.90 dBm (0.0123 W)			
Antenna Type / Gain	Dipole Antenna type with gain 3.20 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) :π/4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

## 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 5 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 1.6 Testing Location

Sporton International (Shenzhen) Inc. is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Test Firm	Sporton International (Shenzhen) Inc.						
Test Site Location	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595						
	Sporton Site No.	FCC Designation No.	FCC Test Firm				
Test Site No.	Sporton Site No.	rec Designation No.	Registration No.				
	CO01-SZ TH01-SZ	CN1256	421272				

Test Firm	Sporton International (Shenzhen) Inc.					
Test Site Location	101, 1st Floor, Block B, Building 1, No. 2, Tengfeng 4th Road, Fenghuang Community, Fuyong Street, Baoan District, Shenzhen City Guangdong Province China 518103 TEL: +86-755-33202398					
Test Site No.	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.			
	03CH01-SZ	CN1256	421272			

## 1.7 Test Software

I	tem	Site	Manufacturer	Name	Version
	1.	03CH01-SZ	AUDIX	E3	6.2009-8-24
	2.	CO01-SZ	AUDIX	E3	6.120613b

Sporton International (Shenzhen) Inc.
TEL: 86-755-8637-9589

FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 6 of 54

Report Issued Date : Oct. 08, 2021

Report Version : Rev. 01

Report No.: FR180601A

## 1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 7 of 54

Report Issued Date : Oct. 08, 2021

Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR180601A

## 2 Test Configuration of Equipment Under Test

## 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 8 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (X plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases							
	Data Rate / Modulation							
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps					
	GFSK	π/4-DQPSK	8-DPSK					
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz					
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz					
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz					
		Bluetooth BR 1Mbps GFSK						
Radiated	Mode 1: CH00_2402 MHz							
Test Cases		Mode 2: CH39_2441 MHz						
		Mode 3: CH78_2480 MHz						
AC	AC							
Conducted Mode 1 : Bluetooth Link + WLAN Link (2.4G) + Powered by Adapter  Emission								

#### Remark:

- 1. For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 9 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

## 2.3 Connection Diagram of Test System

#### <For Radiated Emission >

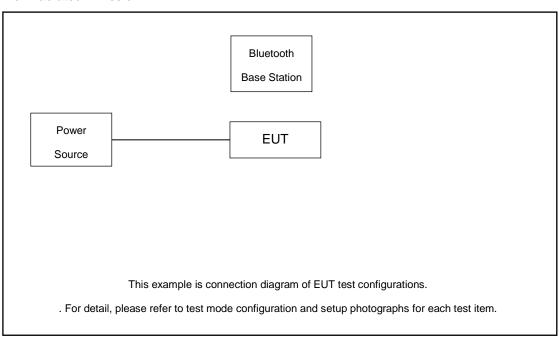

#### <For Conducted Emission >

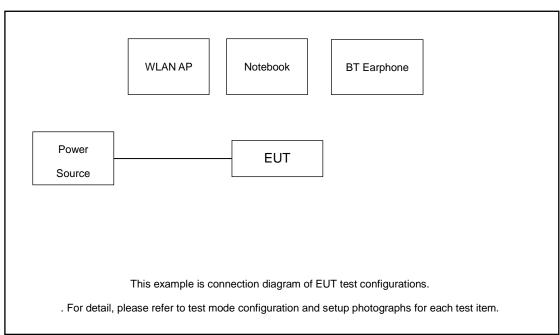

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 10 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Base Station	R&S	CBT32	N/A	N/A	Unshielded,1.8m
2.	WLAN AP	D-Link	DIR-820L	KA2IR820LA1	N/A	Unshielded,1.8m
3.	Notebook	Lenovo	E540	FCC DoC	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
4.	Bluetooth Earphone	Samsung	MG900	N/A	N/A	N/A
5.	Adapter	N/A	N/A	N/A	Shielded,1.2m	N/A
6.	Test Jig	N/A	N/A	N/A	N/A	N/A

## 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

## 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 1.20 dB and 10dB attenuator.

 $Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$ 

= 1.20 + 10 = 11.20 (dB)

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 11 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3 Test Result

## 3.1 Number of Channel Measurement

## 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


## 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

## 3.1.4 Test Setup



## 3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 12 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## Number of Hopping Channel Plot on Channel 00 - 78



Date: 5.SEP.2021 08:52:34

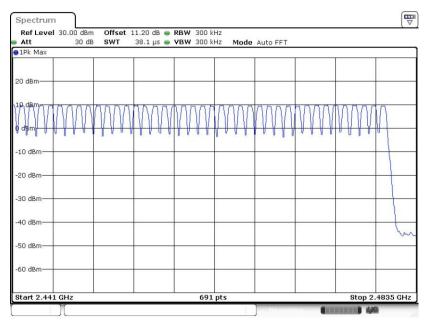

Date: 5.SEP.2021 08:53:14

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 13 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.2 Hopping Channel Separation Measurement

## 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


## 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:
   Span = wide enough to capture the peaks of two adjacent channels;
   RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

## 3.2.4 Test Setup



## 3.2.5 Test Result of Hopping Channel Separation

Please refer to Appendix A.


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 14 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <1Mbps>

## Channel Separation Plot on Channel 00 - 01

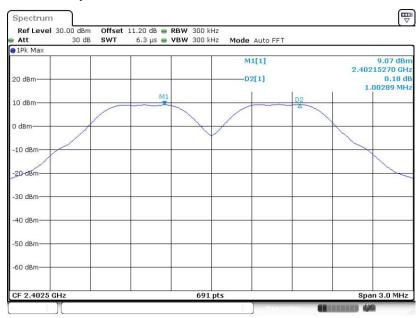

Date: 5.SEP.2021 08:45:43

## Channel Separation Plot on Channel 39 - 40

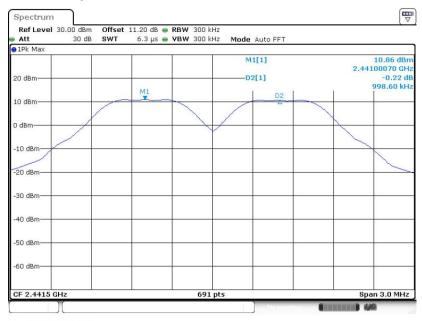


Date: 5.SEP.2021 09:06:00

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 15 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## Channel Separation Plot on Channel 77 - 78

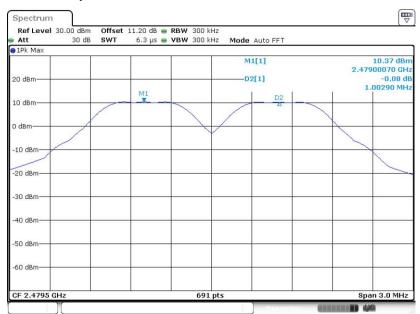

Date: 5.SEP.2021 09:02:05

## <2Mbps>

## Channel Separation Plot on Channel 00 - 01

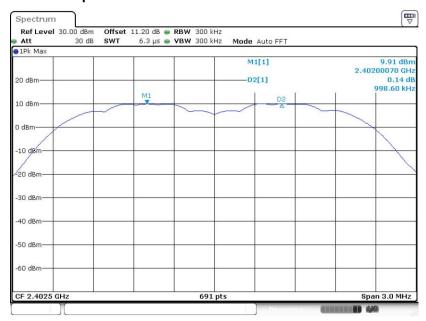


Date: 5.SEP.2021 09:26:12

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 16 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

## Channel Separation Plot on Channel 39 - 40

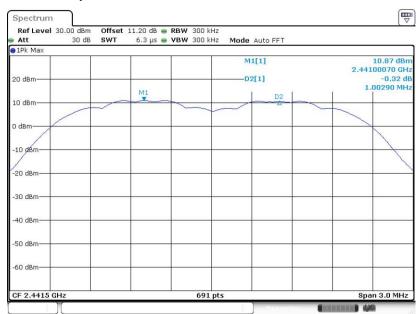

Date: 5.SEP.2021 09:37:02

## Channel Separation Plot on Channel 77 - 78

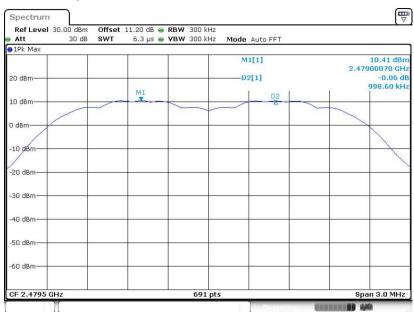

Date: 5.SEP.2021 09:40:48


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 17 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <3Mbps>

## Channel Separation Plot on Channel 00 - 01

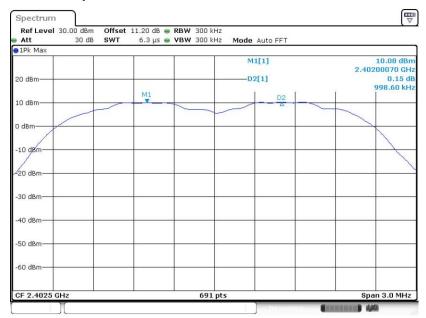

Date: 5.SEP.2021 09:50:09

## Channel Separation Plot on Channel 39 - 40

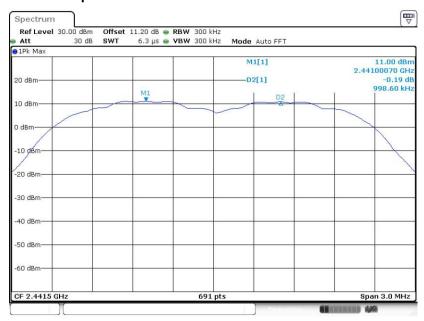


Date: 5.SEP.2021 10:25:48

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 18 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## **Channel Separation Plot on Channel 77 - 78**

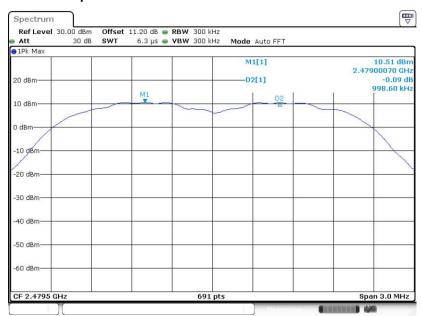

Date: 5.SEP.2021 10:26:43

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 19 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


## 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

## 3.3.4 Test Setup

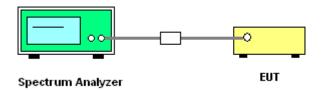

Sporton International (Shenzhen) Inc.

FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125

TEL: 86-755-8637-9589

Page Number : 20 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

#### 3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

#### **Package Transfer Time Plot** Spectrum Offset 11.80 dB - RBW 1 MHz Att 30 dB . SWT 10 ms VBW 1 MHz ●1Pk Max D3[1] 20 dBm M1[1] 8.85 dBr 10 dBm M1 826.1 µs 0 dBm -10 dBm -20 dBm ACAR SAID who the total -50 dBm CF 2.441 GHz 1.0 ms/ 691 pts Marker Type | Ref | Trc Y-value 8.85 dBm **Function Result** -0.04 dB 2.9 ms 3.7493 ms

#### Date: 25.AUG.2021 17:25:20

## Remark:

In normal mode, hopping rate is 1600 hops/s with 6 slots (5 Transmit and 1 Receive slot)
 in 79 hopping channels.

With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit  $(0.4 \times 79)$  (s), Hops Over Occupancy Time comes to  $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$  hops.

- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
  With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
  Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 21 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.4 20dB Bandwidth Measurement

#### 3.4.1 Limit of 20dB Bandwidth

Reporting only

## 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.

Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;


The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace =  $\max$  hold.

5. Measure and record the results in the test report.

## 3.4.4 Test Setup



#### 3.4.5 Test Result of 20dB Bandwidth


Please refer to Appendix A.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 22 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <1Mbps>

## 20 dB Bandwidth Plot on Channel 00

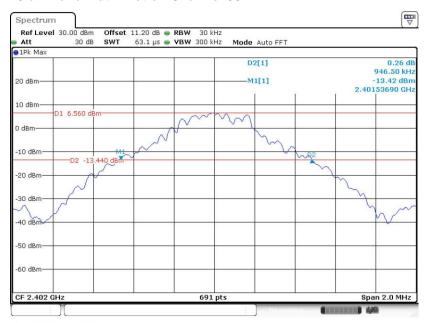

Date: 5.SEP.2021 08:48:04

#### 20 dB Bandwidth Plot on Channel 39

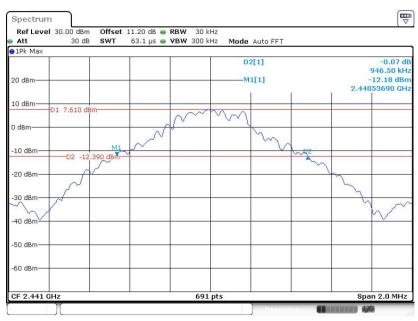

Date: 5.SEP.2021 08:58;47

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 23 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


#### 20 dB Bandwidth Plot on Channel 78



Date: 5.SEP.2021 09:03:07

## <2Mbps>

## 20 dB Bandwidth Plot on Channel 00

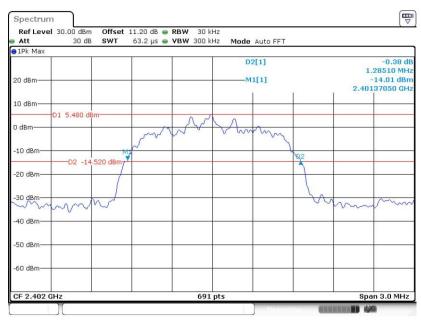


Date: 5.SEP.2021 09:27:24

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 24 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

#### 20 dB Bandwidth Plot on Channel 39

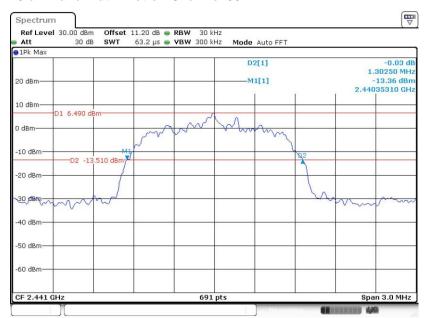

Date: 5.SEP.2021 09:33:53

#### 20 dB Bandwidth Plot on Channel 78

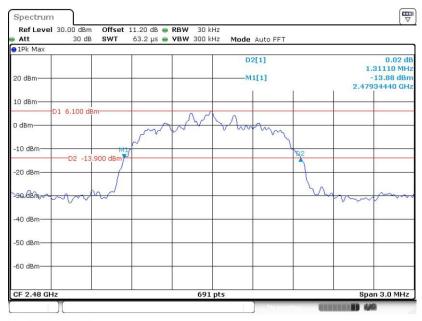

Date: 5.SEP.2021 09:45:22


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 25 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <3Mbps>

## 20 dB Bandwidth Plot on Channel 00

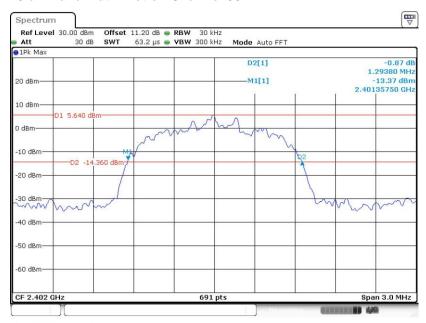

Date: 5.SEP.2021 09:51:12

#### 20 dB Bandwidth Plot on Channel 39

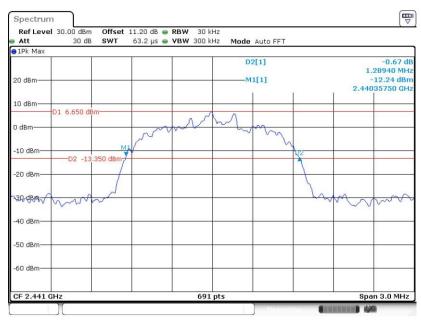


Date: 5.SEP.2021 10:22:13

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 26 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 20 dB Bandwidth Plot on Channel 78

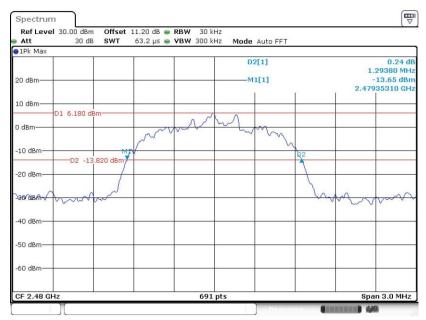

Date: 5.SEP.2021 10:28:15

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 27 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.5 Output Power Measurement

## 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following:

(1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


## 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

## 3.5.4 Test Setup

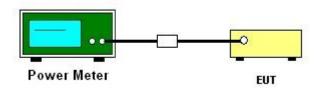

## 3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

## 3.5.6 Test Result of Average Output Power (Reporting Only)

Please refer to Appendix A.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 28 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.6 Conducted Band Edges Measurement

## 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


## 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

## 3.6.4 Test Setup

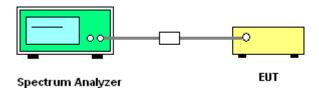

Sporton International (Shenzhen) Inc.

FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125

TEL: 86-755-8637-9589


Page Number : 29 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.6.5 Test Result of Conducted Band Edges


## <1Mbps>

## Low Band Edge Plot on Channel 00

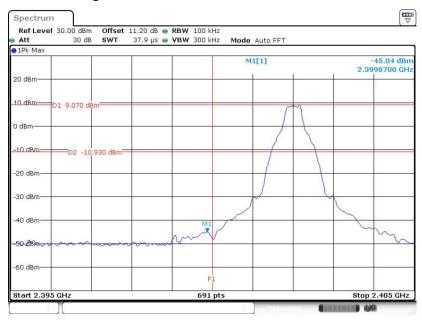

#### Date: 5.SEP.2021 08:48:23

## **High Band Edge Plot on Channel 78**

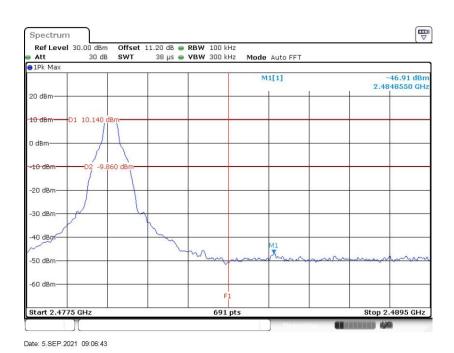


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 30 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <2Mbps>

## Low Band Edge Plot on Channel 00

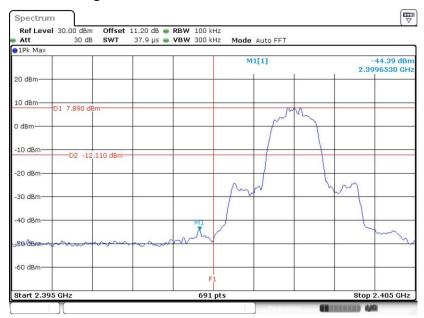

Date: 5.SEP.2021 09:27:43

## **High Band Edge Plot on Channel 78**

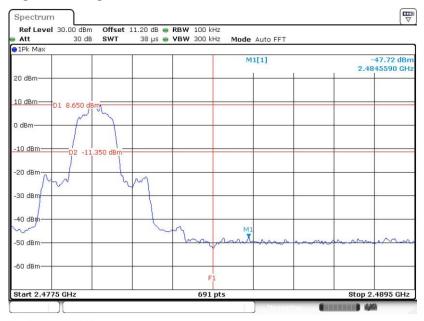

Date: 5.SEP.2021 09:45:41


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 31 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <3Mbps>

## Low Band Edge Plot on Channel 00

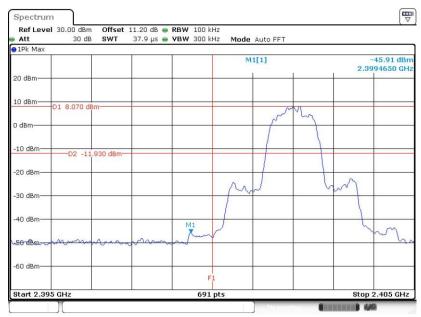

Date: 5.SEP.2021 09:51:31

## **High Band Edge Plot on Channel 78**

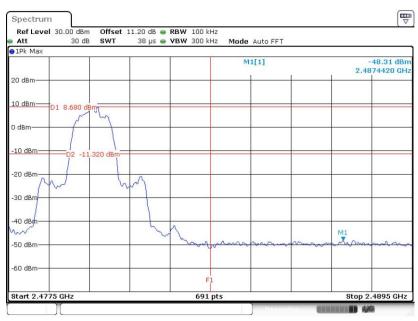

Date: 5.SEP.2021 10:28:34

Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 32 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.6.6 Test Result of Conducted Hopping Mode Band Edges


## <1Mbps>

## **Hopping Mode Low Band Edge Plot**

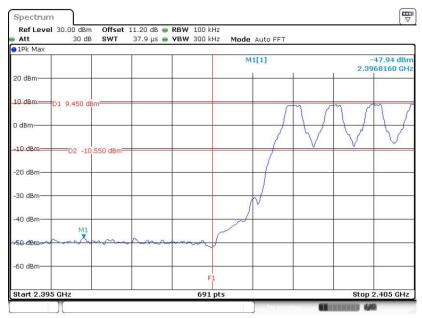

#### Date: 5.SEP.2021 08:54:08

## **Hopping Mode High Band Edge Plot**

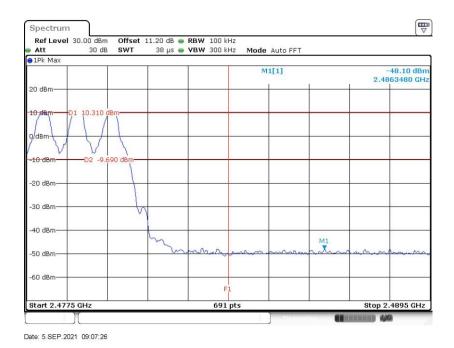


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 33 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <2Mbps>

## **Hopping Mode Low Band Edge Plot**

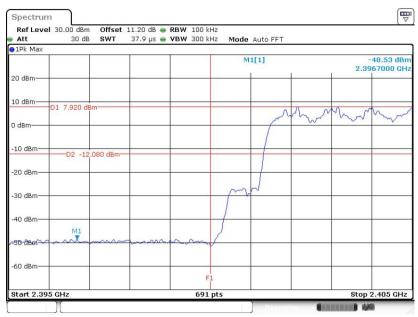

Date: 5.SEP.2021 09:20:57

## **Hopping Mode High Band Edge Plot**

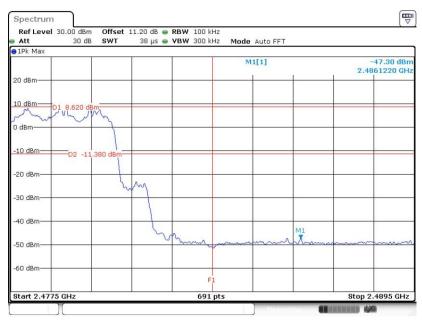

Date: 5.SEP.2021 09:22:33


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 34 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <3Mbps>

## **Hopping Mode Low Band Edge Plot**

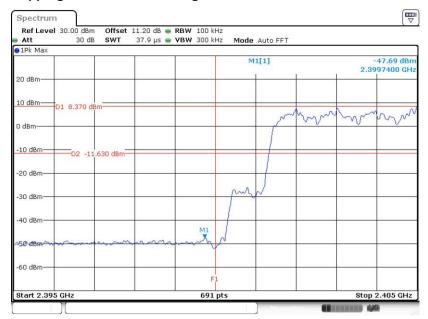

Date: 5.SEP.2021 10:34:39

## **Hopping Mode High Band Edge Plot**

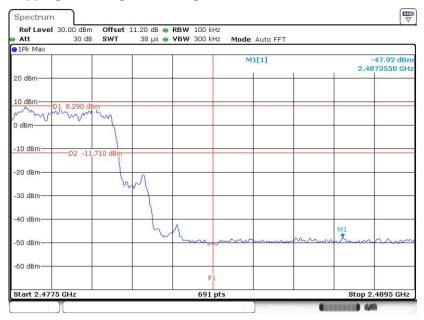

Date: 5.SEP.2021 10:33:33

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 35 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.7 Conducted Spurious Emission Measurement

## 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


## 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

## 3.7.4 Test Setup

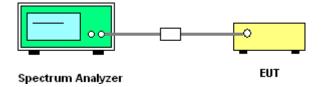

Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 36 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.7.5 Test Result of Conducted Spurious Emission


## <1Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

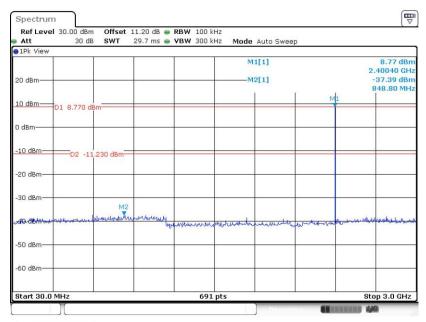

Date: 5.SEP.2021 08:49:31

### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

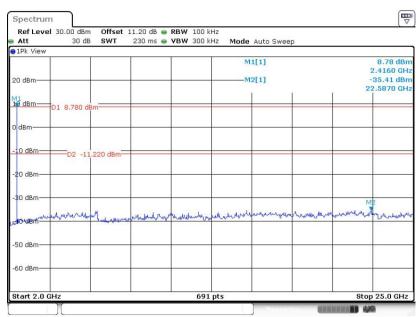


Date: 5.SEP.2021 08:50:03

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 37 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

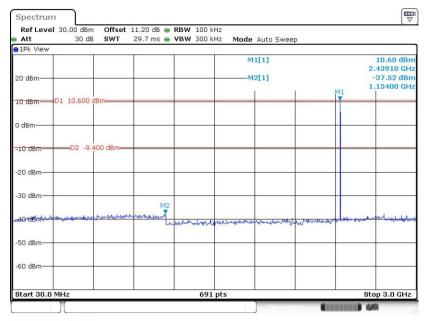

Date: 5.SEP.2021 08:59:54

### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

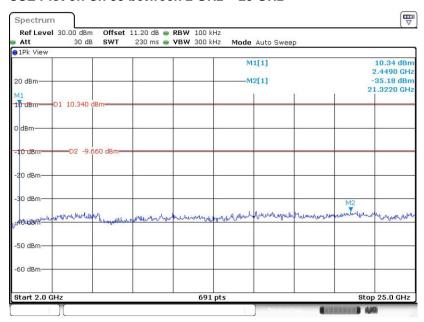


Date: 5.SEP.2021 09:00:24

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 38 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

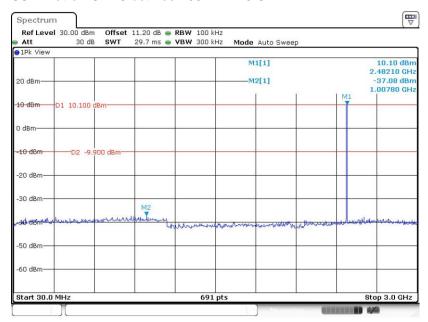

Date: 5.SEP.2021 09:04:12

### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

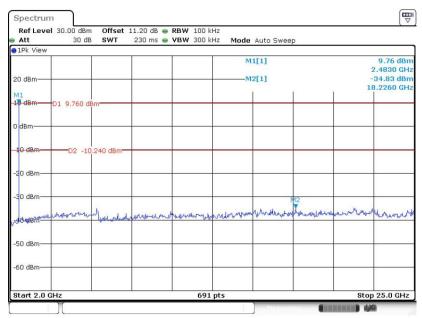

Date: 5.SEP.2021 09:04:42


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 39 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <2Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

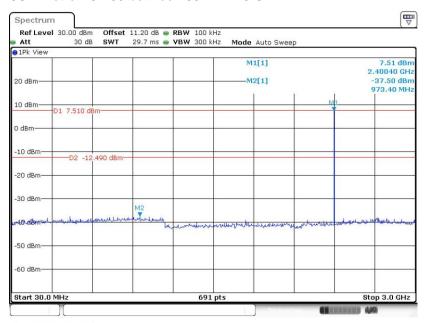

Date: 5.SEP.2021 09:28:48

### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

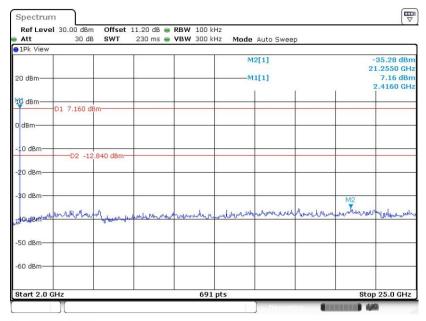


Date: 5.SEP.2021 09:30:20

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 40 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

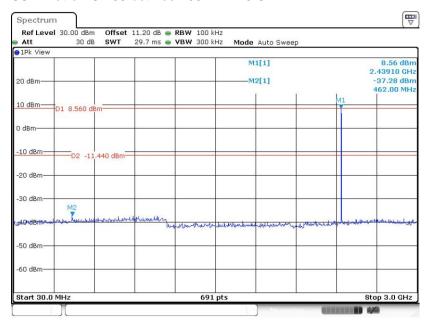

Date: 5.SEP.2021 09:35:00

### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

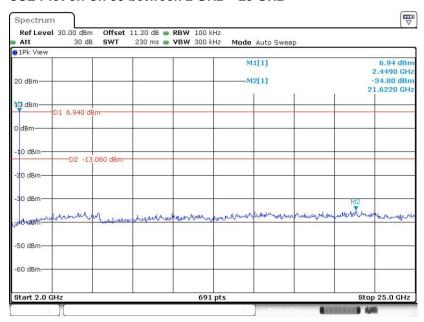


Date: 5.SEP.2021 09:35:29

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 41 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

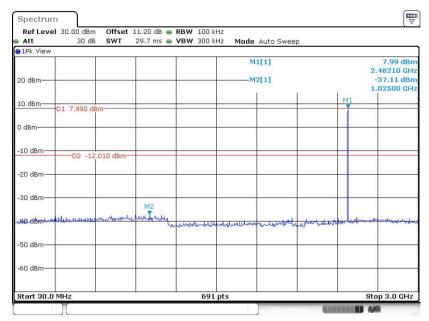

Date: 5.SEP.2021 09:46:46

### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

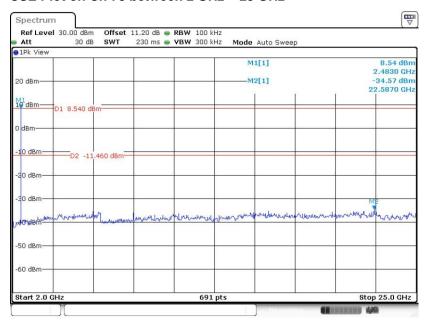

Date: 5.SEP.2021 09:47:15


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 42 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A


## <3Mbps>

## CSE Plot on Ch 00 between 30MHz ~ 3 GHz

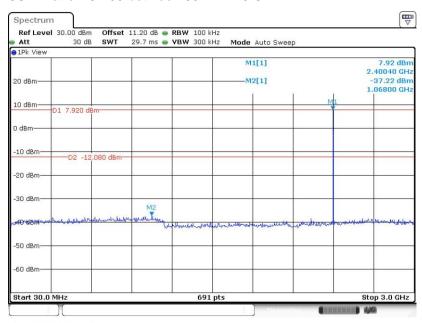

Date: 5.SEP.2021 09:52:44

### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

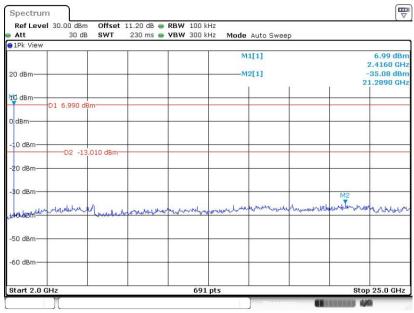


Date: 5.SEP.2021 09:53:18

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 43 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

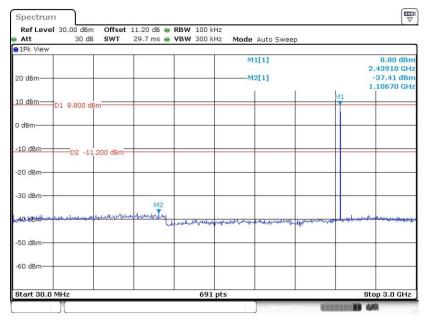

Date: 5.SEP.2021 10:23:18

### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

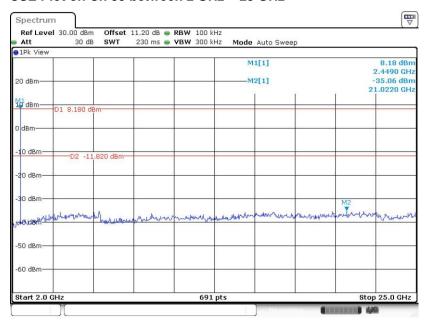


Date: 5.SEP.2021 10:23:49

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 44 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01


Report No.: FR180601A

### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

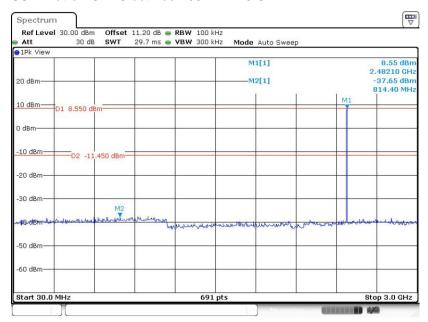

Date: 5.SEP.2021 10:30:45

### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

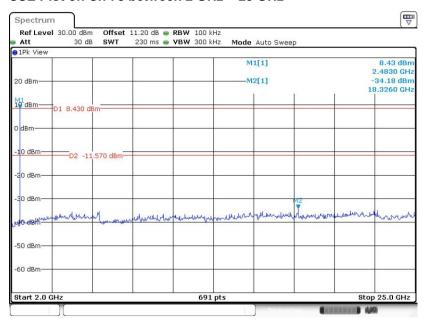

Date: 5.SEP.2021 10:31:22

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 45 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

## 3.8 Radiated Band Edges and Spurious Emission Measurement

## 3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

## 3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 46 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than peak limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Report Issued Date: Oct. 08, 2021

: 47 of 54


: Rev. 01

Page Number


Report Version

## 3.8.4 Test Setup


#### For radiated emissions below 30MHz

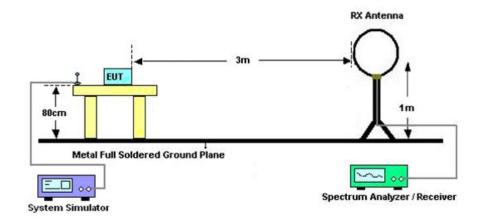

#### For radiated emissions from 30MHz to 1GHz

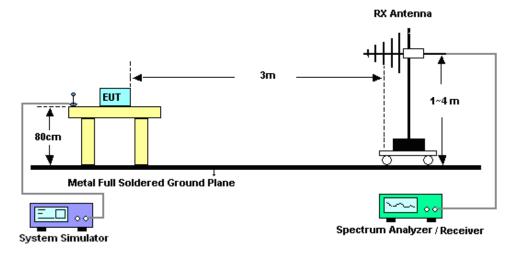

#### For radiated emissions above 1GHz

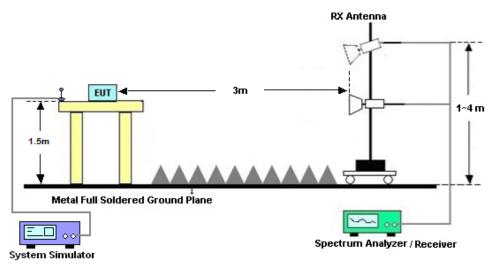

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 48 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

## 3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C.

# 3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic or 40GHz, whichever is lower)

Please refer to Appendix C.

## 3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix D.

**Sporton International (Shenzhen) Inc.** TEL: 86-755-8637-9589

FAX: 86-755-8637-9595

FCC ID: 2AOHHTURBOXC6125

Page Number : 49 of 54
Report Issued Date : Oct. 08, 2021

Report No.: FR180601A

Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

## 3.9 AC Conducted Emission Measurement

## 3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBμV)				
Frequency of emission (MHz)	Quasi-peak	Average			
0.15-0.5	66 to 56*	56 to 46*			
0.5-5	56	46			
5-30	60	50			

<sup>\*</sup>Decreases with the logarithm of the frequency.

## 3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

## 3.9.3 Test Procedures

- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

Sporton International (Shenzhen) Inc.


FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125

TEL: 86-755-8637-9589

Page Number : 50 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.9.4 Test Setup

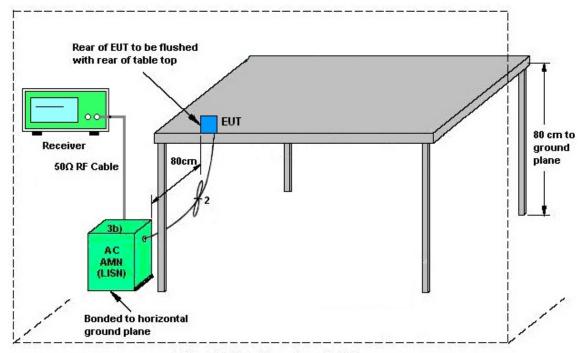

AMN = Artificial mains network (LISN)

AE = Associated equipment

EUT = Equipment under test

ISN = Impedance stabilization network

## 3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix B.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 51 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 3.10 Antenna Requirements

## 3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

## 3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

### 3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595

FCC ID: 2AOHHTURBOXC6125

Page Number : 52 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101078	10Hz~40GHz	Apr. 08, 2021	Aug. 25, 2021~ Sep, 05, 2021	Apr. 07, 2022	Conducted (TH01-SZ)
Pulse Power Senor	Anritsu	MA2411B	1207253	30MHz~40GHz	Dec. 25, 2020	Aug. 25, 2021~ Sep, 05, 2021	Dec. 24, 2021	Conducted (TH01-SZ)
Power Meter	Anritsu	ML2495A	1218010	50MHz Bandwidth	Dec. 25, 2020	Aug. 25, 2021~ Sep, 05, 2021	Dec. 24, 2021	Conducted (TH01-SZ)
EMI Test Receiver&SA	Agilent	N9038A	MY522601 85	20Hz~26.5GHz	Dec. 03, 2020	Sep. 21, 2021	Dec. 02, 2021	Radiation (03CH01-SZ)
EXA Spectrum Analyzer	KEYSIGHT	N9010A	MY551502 13	10Hz~44GHz	Jul. 21, 2021	Sep. 21, 2021	Jul. 20, 2022	Radiation (03CH01-SZ)
Loop Antenna	R&S	HFH2-Z2	100354	9kHz~30MHz	Jun. 22, 2021	Sep. 21, 2021	Jun. 21, 2022	Radiation (03CH01-SZ)
Bilog Antenna	TeseQ	CBL6112D	35407	30MHz-2GHz	Jul. 15, 2021	Sep. 21, 2021	Jul. 14, 2022	Radiation (03CH01-SZ)
Double Ridge Horn Antenna	ETS-Lindgren	3117	00119436	1GHz~18GHz	Jul. 25, 2021	Sep. 21, 2021	Jul. 24, 2022	Radiation (03CH01-SZ)
SHF-EHF Horn	com-power	AH-840	101071	18Ghz-40GHz	Apr. 11, 2021	Sep. 21, 2021	Apr. 10, 2022	Radiation (03CH01-SZ)
LF Amplifier	Burgeon	BPA-530	102209	0.01~3000Mhz	Apr. 07, 2021	Sep. 21, 2021	Apr. 06, 2022	Radiation (03CH01-SZ)
HF Amplifier	MITEQ	AMF-7D-0010 1800-30-10P-	1943528	1GHz~18GHz	Oct. 16, 2020	Sep. 21, 2021	Oct. 15, 2021	Radiation (03CH01-SZ)
HF Amplifier	KEYSIGHT	83017A	MY532701 05	0.5GHz~26.5Gh z	Oct. 16, 2020	Sep. 21, 2021	Oct. 15, 2021	Radiation (03CH01-SZ)
HF Amplifier	MITEQ	TTA1840-35- HG	1871923	18GHz~40GHz	Jul. 21. 2021	Sep. 21, 2021	Jul. 20. 2022	Radiation (03CH01-SZ)
AC Power Source	Chroma	61601	616010001 985	N/A	NCR	Sep. 21, 2021	NCR	Radiation (03CH01-SZ)
Turn Table	EM	EM1000	N/A	0~360 degree	NCR	Sep. 21, 2021	NCR	Radiation (03CH01-SZ)
Antenna Mast	EM	EM1000	N/A	1 m~4 m	NCR	Sep. 21, 2021	NCR	Radiation (03CH01-SZ)
EMI Receiver	R&S	ESR7	101630	9kHz~7GHz;	Mar. 08, 2021	Sep. 06, 2021	Mar. 07, 2022	Conduction (CO01-SZ)
AC LISN	EMCO	3816/2 LISN	00103912	9kHz~30MHz	Dec. 25, 2020	Sep. 06, 2021	Dec. 24, 2021	Conduction (CO01-SZ)
AC LISN (for auxiliary	EMCO	3816/2SH	00103892	9kHz~30MHz	Oct. 15, 2020	Sep. 06, 2021	Oct. 14, 2021	Conduction (CO01-SZ)
AC Power Source	Chroma	61602	616020000 891	100Vac~250Vac	Jul. 14, 2021	Sep. 06, 2021	Jul. 13, 2022	Conduction (CO01-SZ)

NCR: No Calibration Required

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : 53 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report No.: FR180601A

## 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

## <u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

Measuring Uncertainty for a Level of Confidence	2 24B
of 95% (U = 2Uc(y))	2.2dB

### Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	4.0.40
of 95% (U = 2Uc(y))	4.2dB

## Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measurin	g Uncertainty for a Level of Confidence	5.0dB
	of 95% (U = 2Uc(y))	5.00B

### Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

	<del>-</del>
Measuring Uncertainty for a Level of Confidence	4.3dB
of 95% (U = 2Uc(y))	4.305

Sporton International (Shenzhen) Inc.

FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125

TEL: 86-755-8637-9589

Page Number : 54 of 54
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

## **Appendix A. Conducted Test Results**

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : A1 of A1
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

Report Number : FR180601A

## Appendix A. Test Result of Conducted Test Items

Test Engineer:	Chen Hong	Temperature:	21~25	°C
Test Date:	2021/8/25~2021/09/05	Relative Humidity:	51~54	%

<u>TEST RESULTS DATA</u>
20dB and 99% Occupied Bandwidth and Hopping Channel Separation

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (MHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.947	0.865	1.003	0.6310	Pass
DH	1Mbps	1	39	2441	0.947	0.863	0.999	0.6310	Pass
DH	1Mbps	1	78	2480	0.947	0.863	1.003	0.6310	Pass
2DH	2Mbps	1	0	2402	1.285	1.178	0.999	0.8567	Pass
2DH	2Mbps	1	39	2441	1.303	1.184	1.003	0.8683	Pass
2DH	2Mbps	1	78	2480	1.311	1.181	0.999	0.8741	Pass
3DH	3Mbps	1	0	2402	1.294	1.181	0.999	0.8625	Pass
3DH	3Mbps	1	39	2441	1.289	1.184	0.999	0.8596	Pass
3DH	3Mbps	1	78	2480	1.294	1.187	0.999	0.8625	Pass

## TEST RESULTS DATA

### Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.90	0.31	0.4	Pass
AFH	20	53.33	2.90	0.15	0.4	Pass

## TEST RESULTS DATA Peak Power Table

DH	CH.	NTX	Peak Power	Power Limit	Test
DIT	CI I.	INIA	(dBm)	(dBm)	Result
	0	1	10.20	20.97	Pass
DH5	39	1	11.10	20.97	Pass
	78	1	10.50	20.97	Pass
	0	1	9.50	20.97	Pass
2DH5	39	1	10.60	20.97	Pass
	78	1	10.00	20.97	Pass
	0	1	9.90	20.97	Pass
3DH5	39	1	10.90	20.97	Pass
	78	1	10.40	20.97	Pass

## TEST RESULTS DATA Average Power Table

## (Reporting Only)


DH	CH.	NTX	Average Power (dBm)	Duty Factor (dB)		
	0	1	9.90	1.14		
DH5	39	1	10.90	1.14		
	78	1	10.30	1.14		
	0	1	7.60	1.12		
2DH5	39	1	8.70	1.12		
	78	1	8.20	1.12		
	0	1	7.60	1.14		
3DH5	39	1	8.70	1.14		
	78	1	8.20	1.14		

## TEST RESULTS DATA

### Number of Hopping Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

## **Appendix B. AC Conducted Emission Test Results**

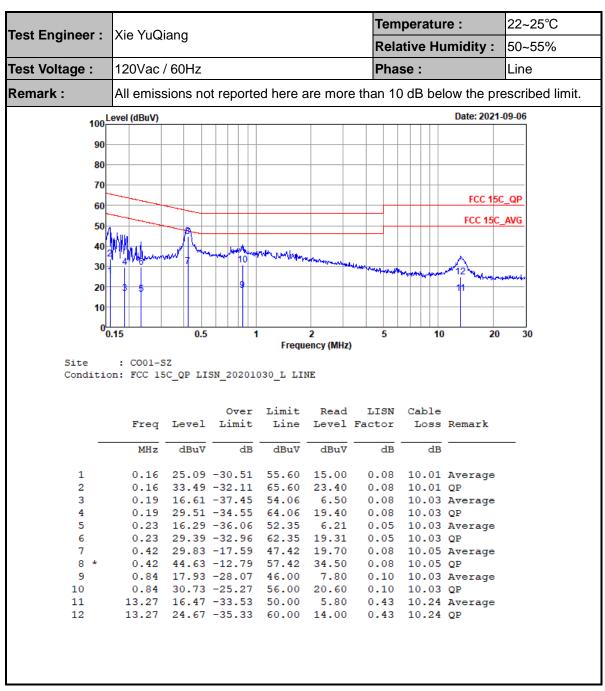

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : B1 of B2
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01



ast Fusiness	Via Via					Tem	peratu	re :	22~25°C
est Engineer :	Xie YuQi	ang		Relative Hu			ımidity :	50~55%	
est Voltage :	oltage: 120Vac / 60Hz				Phase :				
Remark :	All emiss	sions no	t reporte	ed here a	e than 10	than 10 dB below the pr			
100	evel (dBuV)							Date: 2021	-09-06
90									
80									
70									
60								FCC 150	C_QP
								FCC 15C	ΔVG
50		-						. 50 100	
40		19							
20	1		- Japanes	Aug Bu				4	
	1 7 g' """	9		A WARRING WARREN	man super-year	ALL THE PROPERTY OF THE PROPERTY OF	application of the	" I Z WWWY	waterpark.
30	3   ĭ						$\rightarrow$		
20	3   ĭ   5								I
20	5 7								
20 10	5 7								
20 10 0 Site	0.15 : COO1-S		1	Frequ	2 ency (MHz)	5	10	20	30
20 10 0 Site		Z		Frequ	ency (MHz)	_	10	20	30
20 10 0 Site	: CO01-S	Z C_QP LI	SN_20201	Frequ 030_N NE	ency (MHz)  JTRAL  Read		Cable	20 Remark	30
20 10 0 Site	: CO01-S on: FCC 15	Z C_QP LI	SN_202010	Frequ 030_N NE	ency (MHz)  JTRAL  Read	LISN	Cable		30
20 10 0 Site	: COO1-S on: FCC 15 Freq	Z C_QP LI: Level	SN_202010 Over Limit —dB	Frequ 030_N NE Limit Line	TRAL  Read  Level	LISN Factor	Cable Loss dB		30
20 10 0 Site Condition  1 2	: CO01-S on: FCC 15 Freq MHz 0.15 0.15	Level dBuV 28.89 34.29	Over Limit dB -27.11	Limit Line dBuV 56.00 66.00	Read Level dBuV	LISN Factor  dB 0.08 0.08	Cable Loss  dB  10.01 10.01	Remark Average QP	30
20 10 0 Site Condition 1 2 3	: CO01-S on: FCC 15  Freq  MHz  0.15 0.15 0.16	Z C_QP LI dBuV 28.89 34.29 21.79	Over Limit dB -27.11 -31.71 -33.73	Limit Line dBuV 56.00 66.00 55.52	Read Level dBuV 18.80 24.20 11.70	LISN Factor dB 0.08 0.08 0.08	Cable Loss  dB  10.01 10.01 10.01	Remark Average QP Average	30
20 10 0 Site Condition	: COO1-S on: FCC 15  Freq  MHz  0.15 0.15 0.16 0.16	Level dBuV 28.89 34.29 21.79 33.59	Over Limit dB -27.11 -31.71 -33.73 -31.93	Limit Line dBuV 56.00 66.00 55.52 65.52	Read Level dBuV 18.80 24.20 11.70 23.50	LISN Factor  dB  0.08 0.08 0.08 0.08	Cable Loss  dB  10.01 10.01 10.01 10.01	Remark  Average QP Average QP	30
20 10 0 Site Condition	: CO01-S on: FCC 15  Freq  MHz  0.15 0.15 0.16 0.16 0.20	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31	Over Limit ———————————————————————————————————	Freque 030_N NE Limit Line  dBuV  56.00 66.00 55.52 65.52 53.62	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.08	Cable Loss  dB  10.01 10.01 10.01 10.01 10.03	Remark  Average QP Average QP Average	30
20 10 0 Site Condition	: CO01-S on: FCC 15  Freq  MHz  0.15 0.16 0.16 0.20 0.20	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31 27.51	Over Limit dB -27.11 -31.71 -33.73 -31.93 -39.31 -36.11	Freque 030_N NE Limit Line  dBuV  56.00 66.00 55.52 65.52 53.62 63.62	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20 17.40	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.08 0.08	Cable Loss  dB  10.01 10.01 10.01 10.03 10.03	Remark  Average QP Average QP Average QP	30
20 10 0 Site Condition	: CO01-S on: FCC 15  Freq  MHz  0.15 0.16 0.16 0.20 0.20 0.23	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31 27.51 11.29	Over Limit dB -27.11 -31.71 -33.73 -31.93 -39.31 -36.11 -41.06	Limit Line dBuV 56.00 66.00 55.52 65.52 53.62 63.62 52.35	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20 17.40 1.21	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.08 0.08 0.	Cable Loss  dB  10.01 10.01 10.01 10.03 10.03 10.03	Remark  Average QP Average QP Average QP Average QP	30
20 10 0 Site Condition	: CO01-S on: FCC 15  Freq  MHz  0.15 0.16 0.16 0.20 0.20 0.23 0.23	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31 27.51 11.29 24.79	Over Limit dB -27.11 -31.71 -33.73 -31.93 -39.31 -36.11 -41.06 -37.56	Limit Line dBuV 56.00 66.00 55.52 65.52 53.62 63.62 52.35 62.35	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20 17.40 1.21 14.71	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.08 0.08 0.	Cable Loss  dB  10.01 10.01 10.01 10.03 10.03 10.03 10.03	Remark  Average QP Average QP Average QP Average QP	30
20 10 0 Site Condition	: CO01-S on: FCC 15  Freq  MHz  0.15 0.16 0.16 0.20 0.20 0.23 0.23 0.42	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31 27.51 11.29 24.79 23.93	Over Limit dB -27.11 -31.71 -33.73 -31.93 -39.31 -36.11 -41.06	Frequence of the control of the cont	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20 17.40 1.21 14.71	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.08 0.08 0.	Cable Loss  dB  10.01 10.01 10.01 10.03 10.03 10.03 10.03	Remark  Average QP Average QP Average QP Average QP Average QP	30
20 10 0 Site Condition	: COO1-S on: FCC 15  Freq  MHz  0.15 0.16 0.16 0.20 0.20 0.23 0.23 0.42 0.42	Z C_QP LI dBuV 28.89 34.29 21.79 33.59 14.31 27.51 11.29 24.79 23.93 36.63	Over Limit  -27.11 -31.71 -33.73 -31.93 -36.11 -41.06 -37.56 -23.44 -20.74	Frequence   Section   Sect	Read Level  dBuV  18.80 24.20 11.70 23.50 4.20 17.40 1.21 14.71 13.79 26.49	LISN Factor  dB  0.08 0.08 0.08 0.08 0.08 0.05 0.05 0.0	Cable Loss  dB  10.01 10.01 10.01 10.03 10.03 10.03 10.03 10.05 10.05	Remark  Average QP Average QP Average QP Average QP Average QP	30

## Note:

- 1. Level(dB $\mu$ V) = Read Level(dB $\mu$ V) + LISN Factor(dB) + Cable Loss(dB)
- 2. Over Limit(dB) = Level(dB $\mu$ V) Limit Line(dB $\mu$ V)

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : B2 of B2 Report Issued Date: Oct. 08, 2021 Report Version : Rev. 01

## Appendix C. Radiated Spurious Emission

Tast Engineer	Zhao hui Liang	Temperature :	24~25 °C
Test Engineer :	Zriao nui Liang	Relative Humidity :	48~49%

## 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over Limit	Limit Line	Read Level	Antenna Factor	Cable Loss	Preamp Factor	Ant Pos	Table Pos	Peak Avg.	Pol
		( MHz )	( dBµV/m )	(dB)	(dBµV/m)	( dBµV )	(dB/m)	(dB)	(dB)	(cm)	( deg )	(P/A)	(H/\
		2344.54	49.05	-24.95	74	40.07	32.1	9.58	32.7	306	94	Р	Н
		2344.54	24.26	-29.74	54	-	-	-	-	-	-	Α	Н
	*	2402	108.01	-	-	99.06	32	9.65	32.7	306	94	Р	Н
вт	*	2402	83.22	-	-	-	-	-	-	-	-	Α	Н
CH00		2366.59	48.7	-25.3	74	39.72	32.07	9.61	32.7	345	315	Р	V
2402MHz		2366.59	23.91	-30.09	54	-	-	-	_			Α	V
	*	2402	107.21	-	-	98.26	32	9.65	32.7	345	315	Р	V
	*	2402	82.42	_	-	_	-	-	_	-	-	Α	V
		2344.44	49.64	-24.36	74	40.66	32.1	9.58	32.7	323	53	Р	Н
		2344.44	24.85	-29.15	54	-	-	-	-	-	-	Α	Н
	*	2441	109.44	-	-	100.14	32.3	9.7	32.7	323	53	Р	Н
	*	2441	84.65	-	-	-	-	-	-	_	-	Α	Н
		2495.8	49.96	-24.04	74	40.8	32.1	9.76	32.7	323	53	Р	Н
вт		2495.8	25.17	-28.83	54	-	-	-	-	-	-	Α	Н
CH 39		2375.1	50.38	-23.62	74	41.43	32.03	9.62	32.7	331	313	Р	V
2441MHz		2375.1	25.59	-28.41	54	-	-	-	-	-	-	Α	V
	*	2441	108.11	-	-	98.81	32.3	9.7	32.7	331	313	Р	V
	*	2441	83.32	-	-	-	-	-	-	-	-	Α	V
		2489.71	49.83	-24.17	74	40.67	32.1	9.76	32.7	331	313	Р	V
		2489.71	25.04	-28.96	54	-	-	-	-	-	-	Α	V
	*	2480	108.21	-	-	98.99	32.17	9.75	32.7	346	255	Р	Н
	*	2480	83.42	-	-	-	-	-	-	-	-	Α	Н
		2483.56	62.03	-11.97	74	52.81	32.17	9.75	32.7	346	255	Р	Н
ВТ		2483.56	37.24	-16.76	54	-	-	-	-	-	-	Α	Н
CH 78 2480MHz	*	2480	102.15	-	-	92.93	32.17	9.75	32.7	329	69	Р	V
∠+ovi¥i∏∠	*	2480	77.36	-	-	-	-	-	-	-	-	Α	V
		2483.68	55.95	-18.05	74	46.73	32.17	9.75	32.7	329	69	Р	V
		2483.68	31.16	-22.84	54	-	-	-	-	-	-	Α	V

d. All results are PASS against Peak and Average limit line.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : C1 of C5 Report Issued Date : Oct. 08, 2021

Report No.: FR180601A

Report Version : Rev. 01

## 2.4GHz 2400~2483.5MHz

## BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		, <b></b> . ,		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	( dB )	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	( deg )	(P/A)	
DT		4804	44.96	-29.04	74	51.21	33.9	12	52.15	-	-	Р	Н
BT CH 00		4804	20.17	-33.83	54	-	-	-	-	-	-	Α	Н
2402MHz		4804	45.03	-28.97	74	51.28	33.9	12	52.15	-	-	Р	V
		4804	20.24	-33.76	54	-	=	-	-	-	-	Α	V
		4882	47.75	-26.25	74	54.07	33.73	12.05	52.1	-	-	Р	Н
		4882	22.96	-31.04	54	-	-	-	-	-	-	Α	Н
		7323	47.79	-26.21	74	49.62	35.77	14.17	51.77	-	-	Р	Н
ВТ		7323	23	-31	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		4882	46.74	-27.26	74	53.06	33.73	12.05	52.1	-	-	Р	V
244111112		4882	21.95	-32.05	54	-	-	-	-	-	-	Α	V
		7323	48.33	-25.67	74	50.16	35.77	14.17	51.77	-	-	Р	V
		7323	23.54	-30.46	54	-	-	-	-	-	-	Α	V
		4960	50.16	-23.84	74	56.37	33.73	12.09	52.03	-	-	Р	Н
		4960	25.37	-28.63	54	-	-	-	-	-	-	Α	Н
		7440	49.31	-24.69	74	50.93	35.79	14.24	51.65	-	-	Р	Н
ВТ		7440	24.52	-29.48	54	-	-	-	-	-	-	Α	Н
CH 78 2480MHz		4960	47.15	-26.85	74	53.36	33.73	12.09	52.03	-	-	Р	V
2400WI112		4960	22.36	-31.64	54	-	-	-	-	-	-	Α	V
		7440	48.51	-25.49	74	50.13	35.79	14.24	51.65	-	-	Р	V
		7440	23.72	-30.28	54	-	-	-	-	-	-	Α	V
Remark		other spurious f		and Ave	rage limit line.				,		,	•	

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : C2 of C5
Report Issued Date : Oct. 08, 2021

Report No. : FR180601A

Report Version : Rev. 01

## **Emission below 1GHz**

## 2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	( dB )	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	( deg )	(P/A)	(H/V)
		30	23.39	-16.61	40	30.06	25.2	0.53	32.4	-	-	Р	Н
		101.78	19.11	-24.39	43.5	33.98	16.3	1.03	32.2	-	-	Р	Н
		148.34	19.36	-24.14	43.5	33.12	17.2	1.24	32.2	-	-	Р	Н
		431.58	25.71	-20.29	46	32.06	22.83	2.16	31.34	-	-	Р	Н
		565.44	29.02	-16.98	46	30.87	26.5	2.49	30.84	-	-	Р	Н
2.4GHz		988.36	34.51	-19.49	54	31.72	30.62	3.29	31.12	-	-	Р	Н
BT LF		30.97	25.87	-14.13	40	33.03	24.7	0.54	32.4	-	-	Р	V
		64.92	25.75	-14.25	40	45.24	12.1	0.81	32.4	-	-	Р	V
		139.61	22.27	-21.23	43.5	35.76	17.5	1.21	32.2	-	-	Р	V
		464.56	25.75	-20.25	46	31.38	23.4	2.24	31.27	-	-	Р	V
		728.4	30.87	-15.13	46	31.4	27.63	2.81	30.97	-	-	Р	V
		988.36	33.72	-20.28	54	30.93	30.62	3.29	31.12	-	-	Р	V
Remark		other spurious f		line.									

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : C3 of C5
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01

## Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is <b>over limit</b> line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : C4 of C5 Report Issued Date : Oct. 08, 2021

Report No. : FR180601A

Report Version : Rev. 01

## A calculation example for radiated spurious emission is shown as below:

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	( dB )	(dB)	( cm )	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

## For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : C5 of C5
Report Issued Date : Oct. 08, 2021


Report Version : Rev. 01

## Appendix D. Duty Cycle Plots

## DH5 on time (One Pulse) Plot on Channel 39



## DH5 on time (Count Pulses) Plot on Channel 39

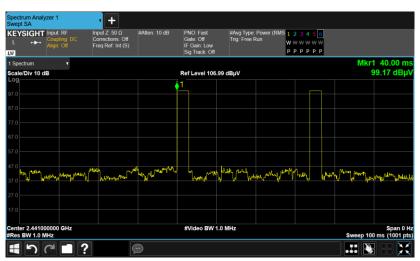

### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds =  $2 \times 2.88 / 100 = 5.76 \%$
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- DH5 has the highest duty cycle worst case and is reported.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2AOHHTURBOXC6125 Page Number : D-1 of D1
Report Issued Date : Oct. 08, 2021
Report Version : Rev. 01