





Restrict Band NVNT ac40 5230MHz Ant1 Peak

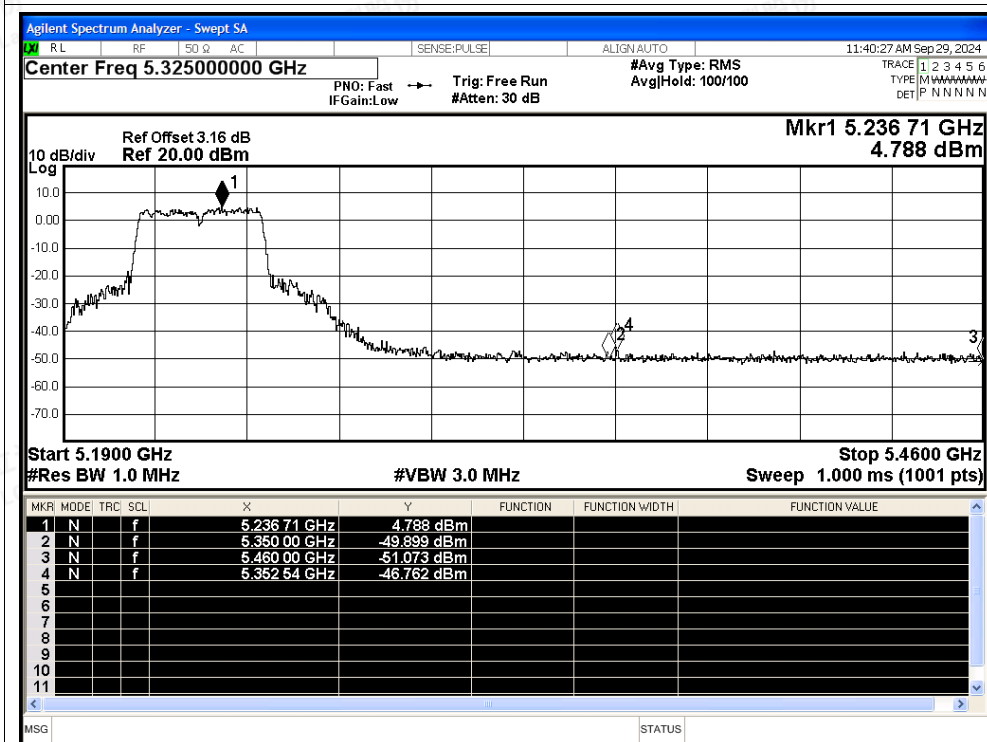

Restrict Band NVNT ac40 5230MHz Ant1 Average

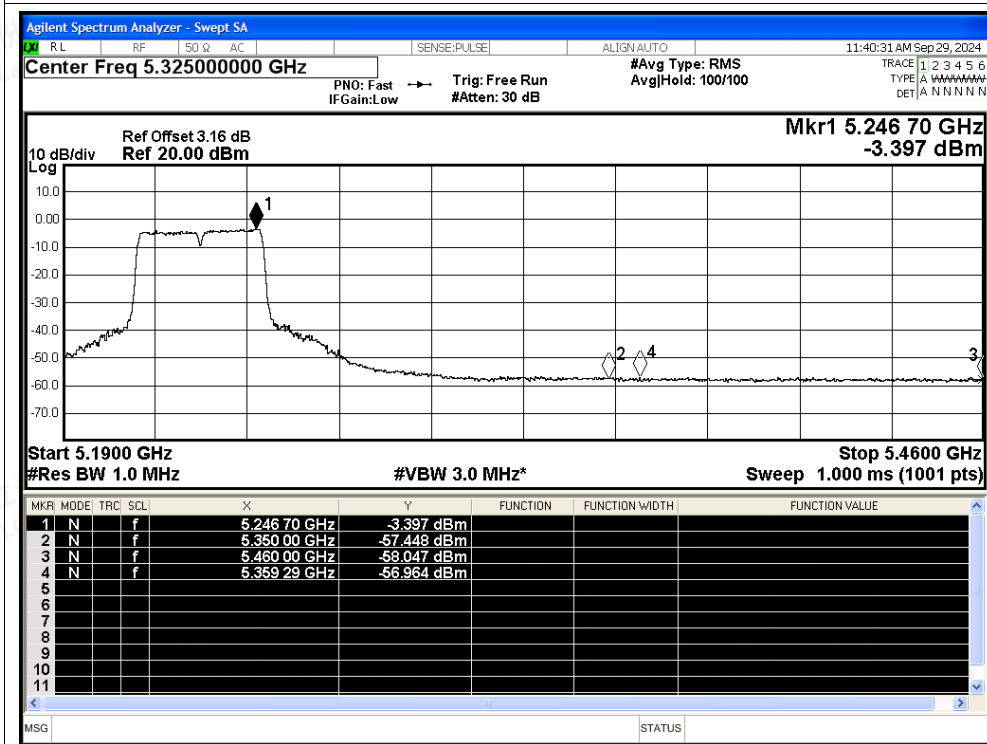

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

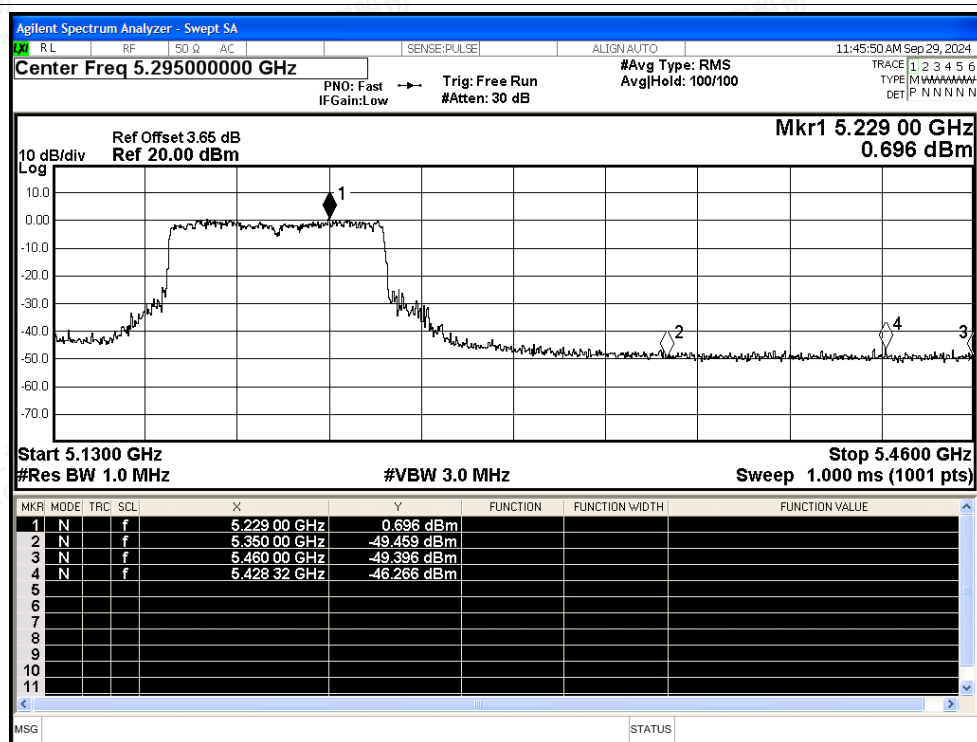

Restrict Band NVNT ac80 5210MHz Ant1 Average

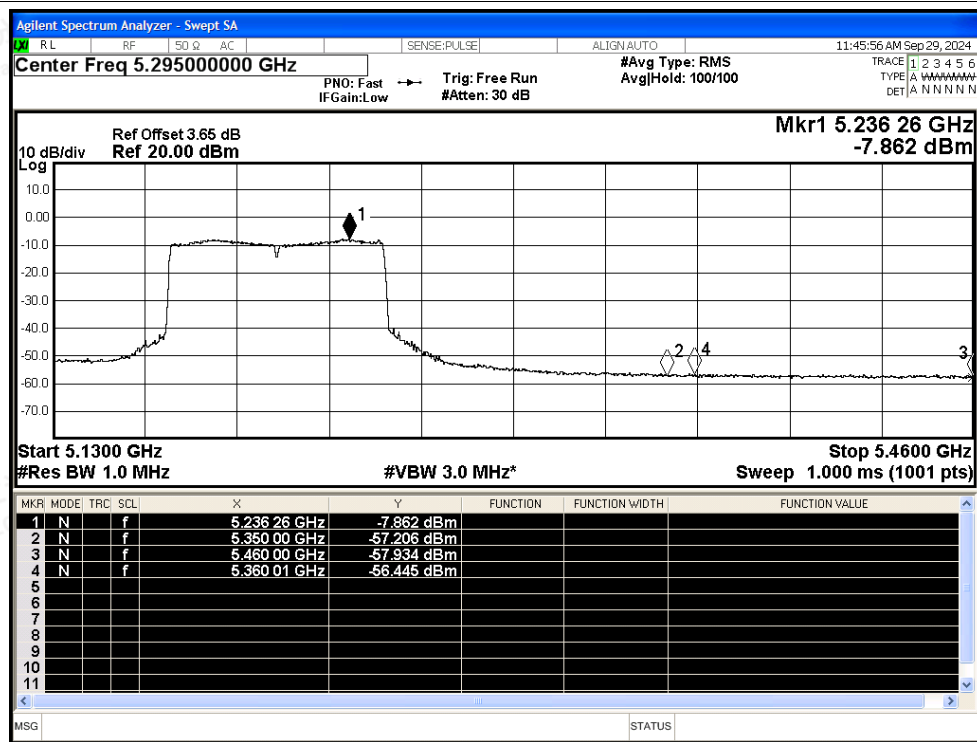

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

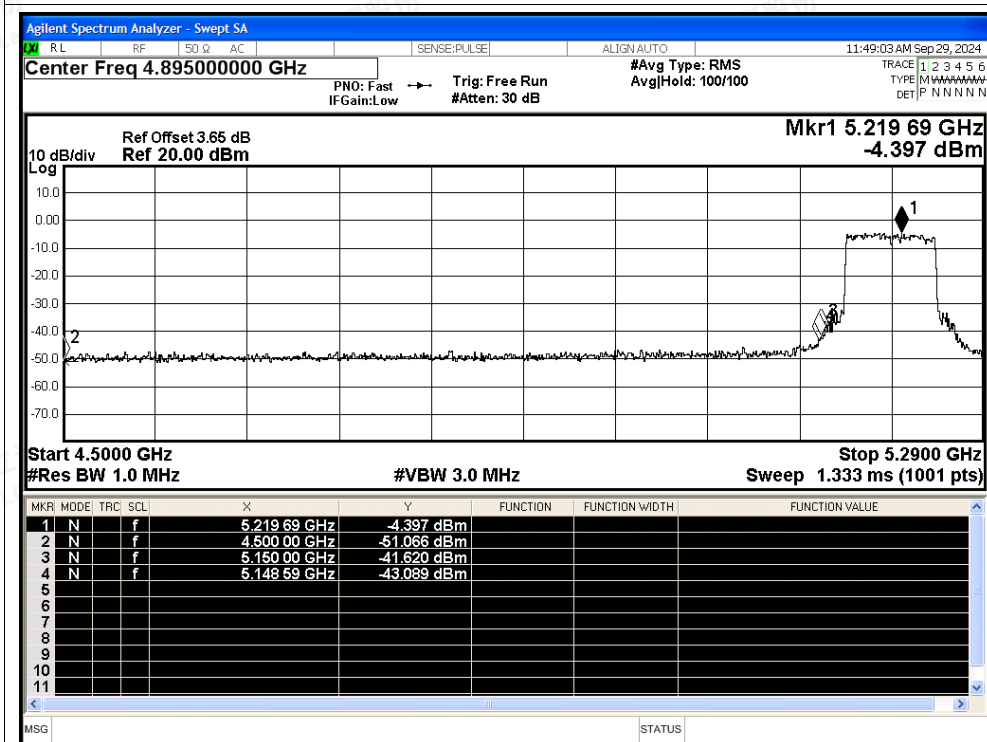

Restrict Band NVNT ac80 5210MHz Ant1 Average


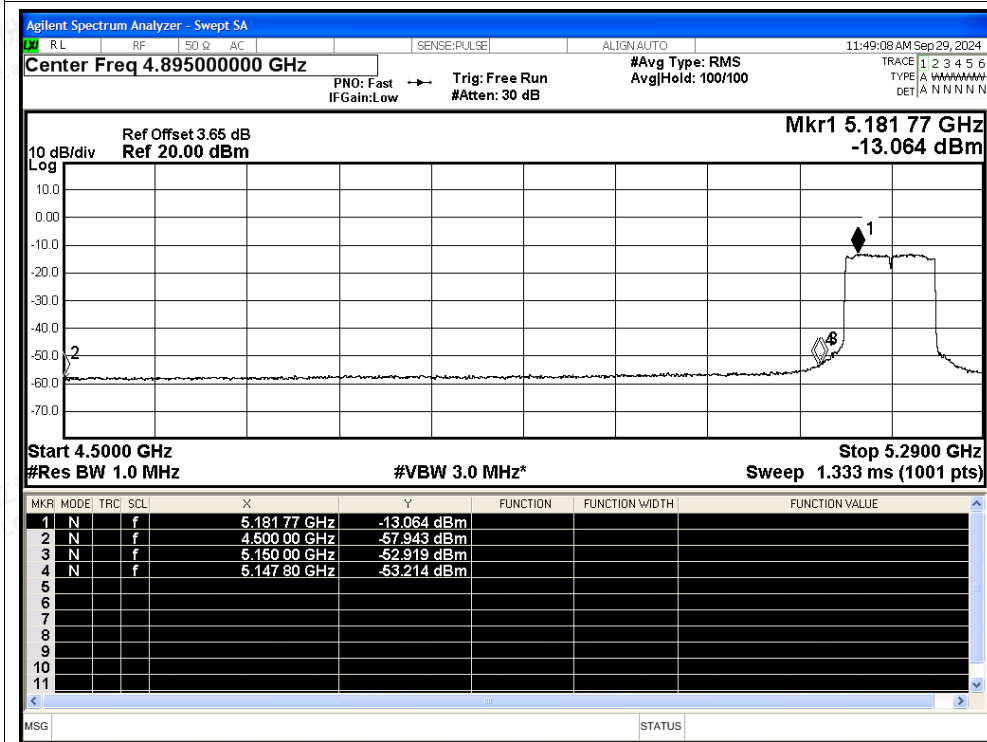


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

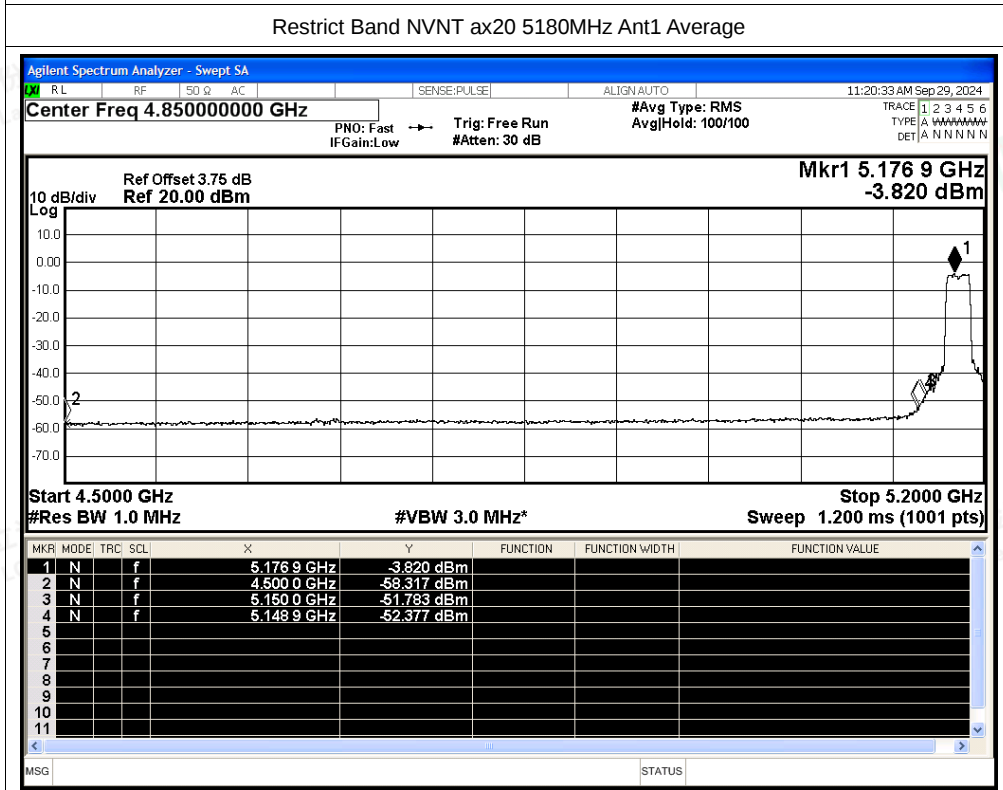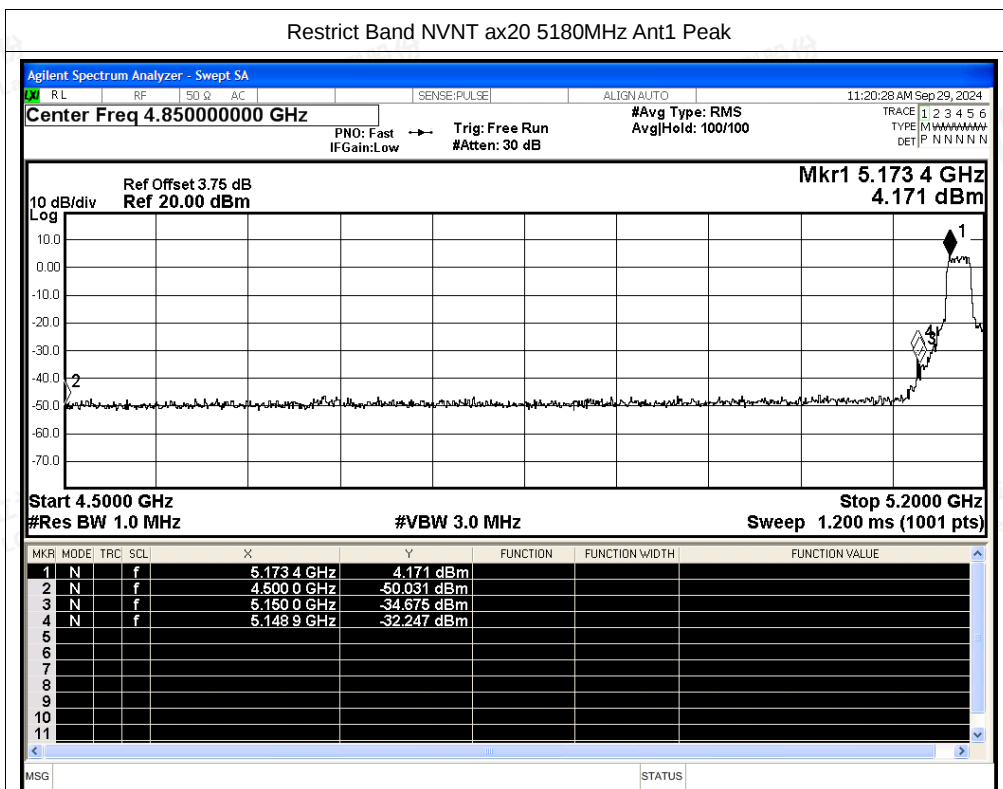

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

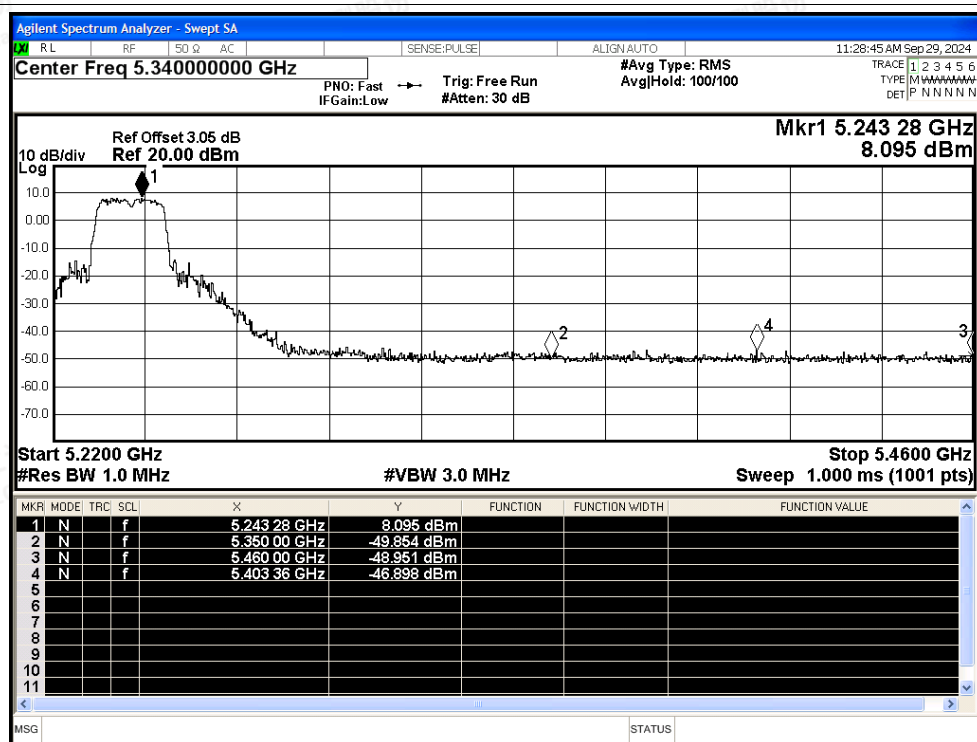

Restrict Band NVNT ax20 5240MHz Ant1 Average

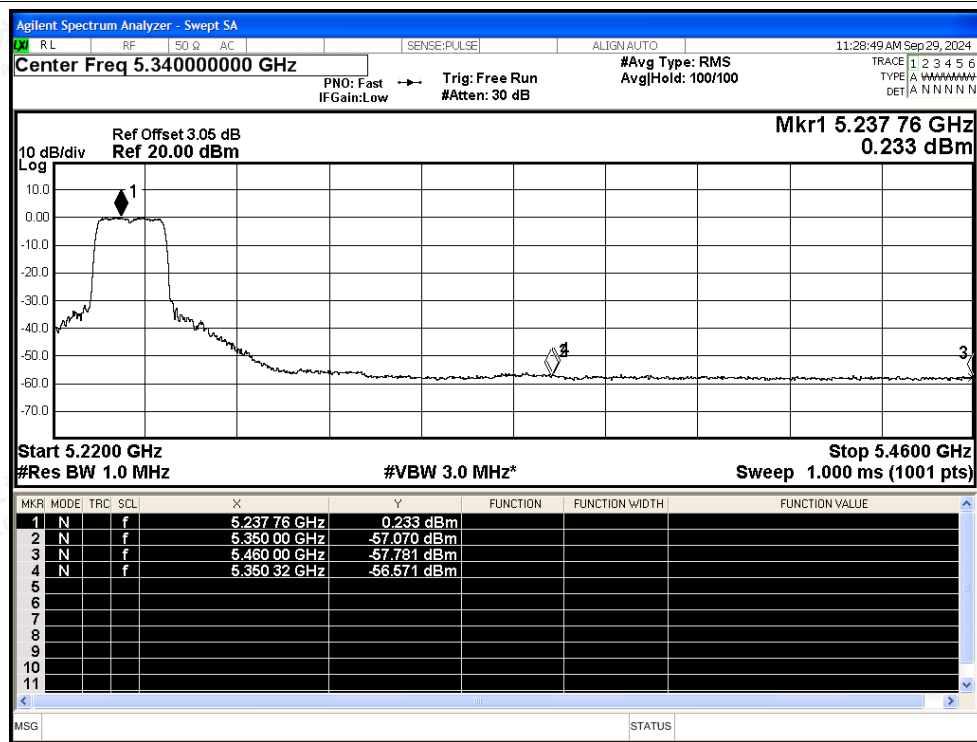

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

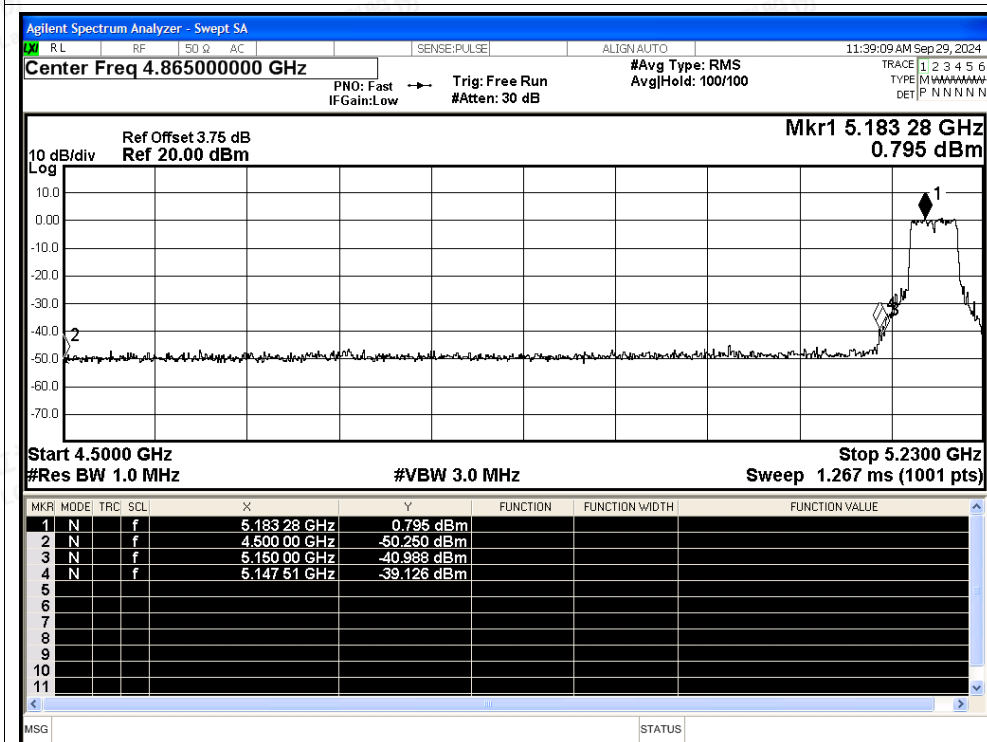

Restrict Band NVNT ax40 5190MHz Ant1 Average

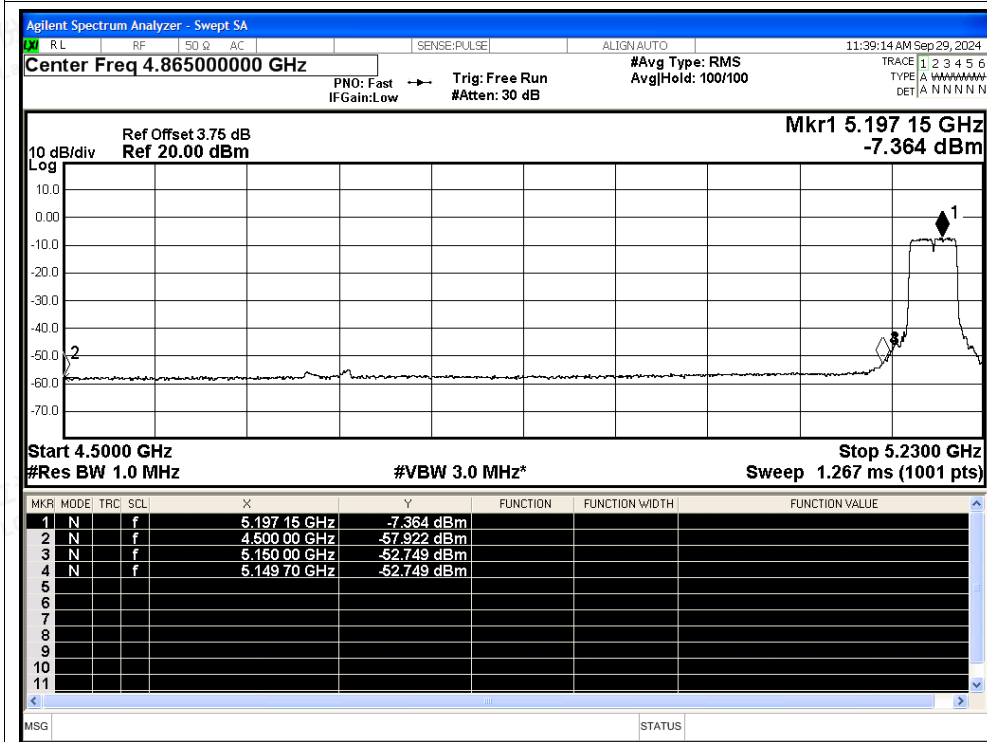

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

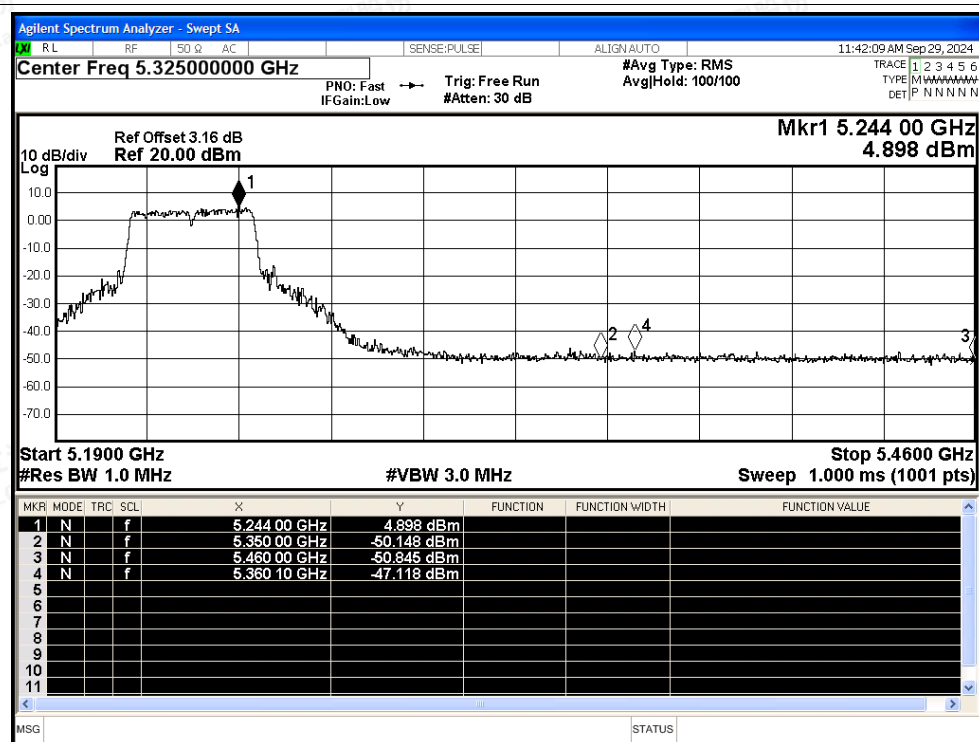

Restrict Band NVNT ax40 5230MHz Ant1 Average

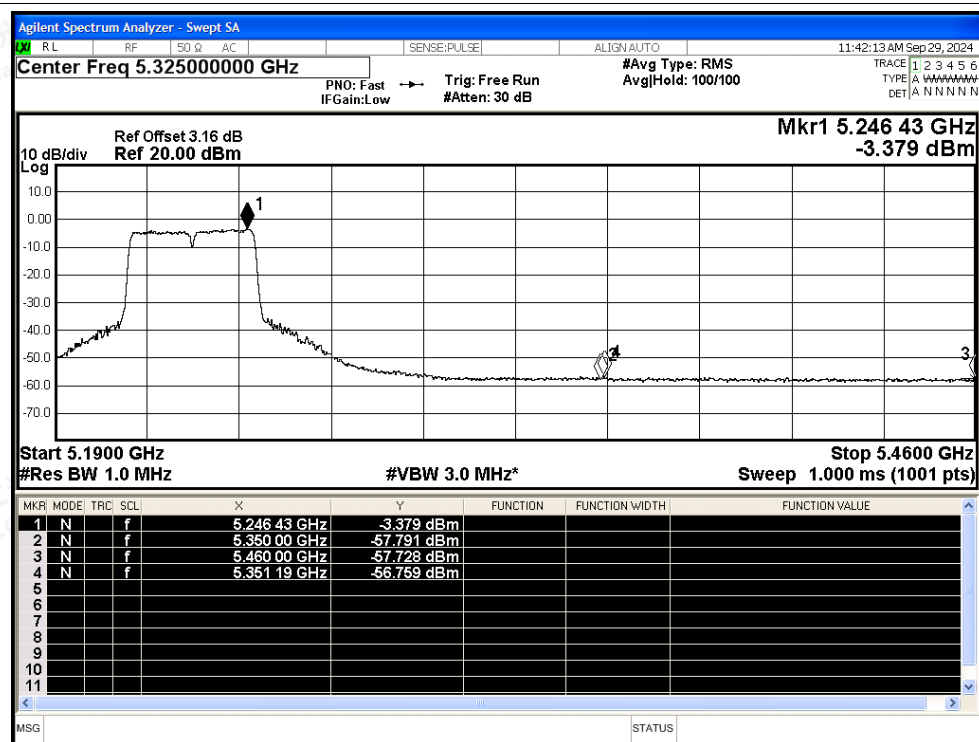

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

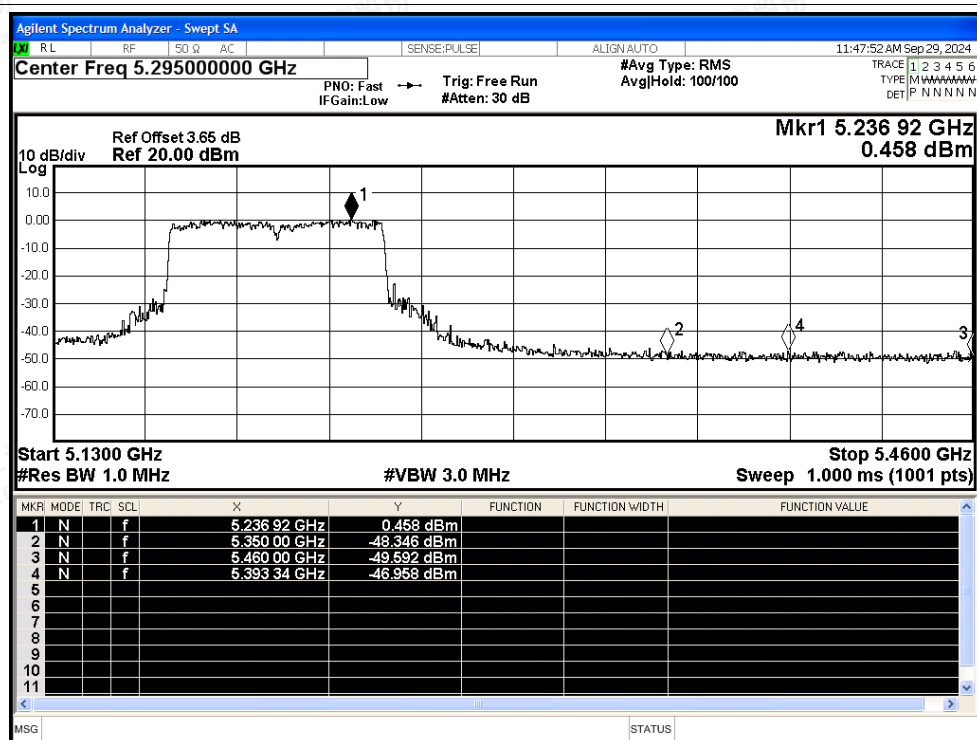

Restrict Band NVNT ax80 5210MHz Ant1 Average


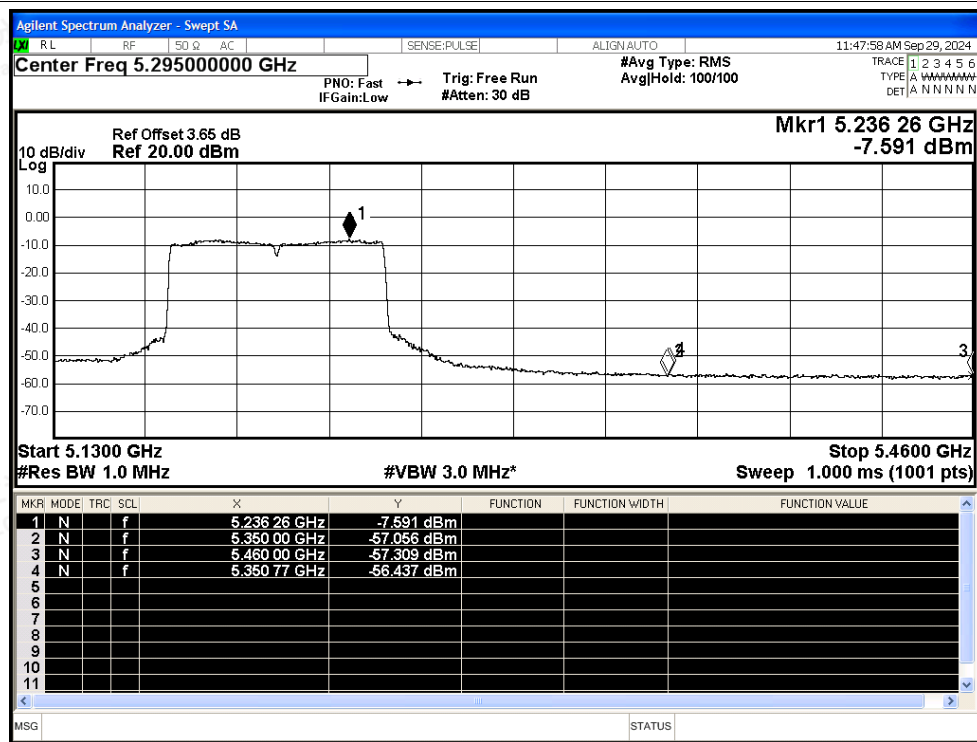


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

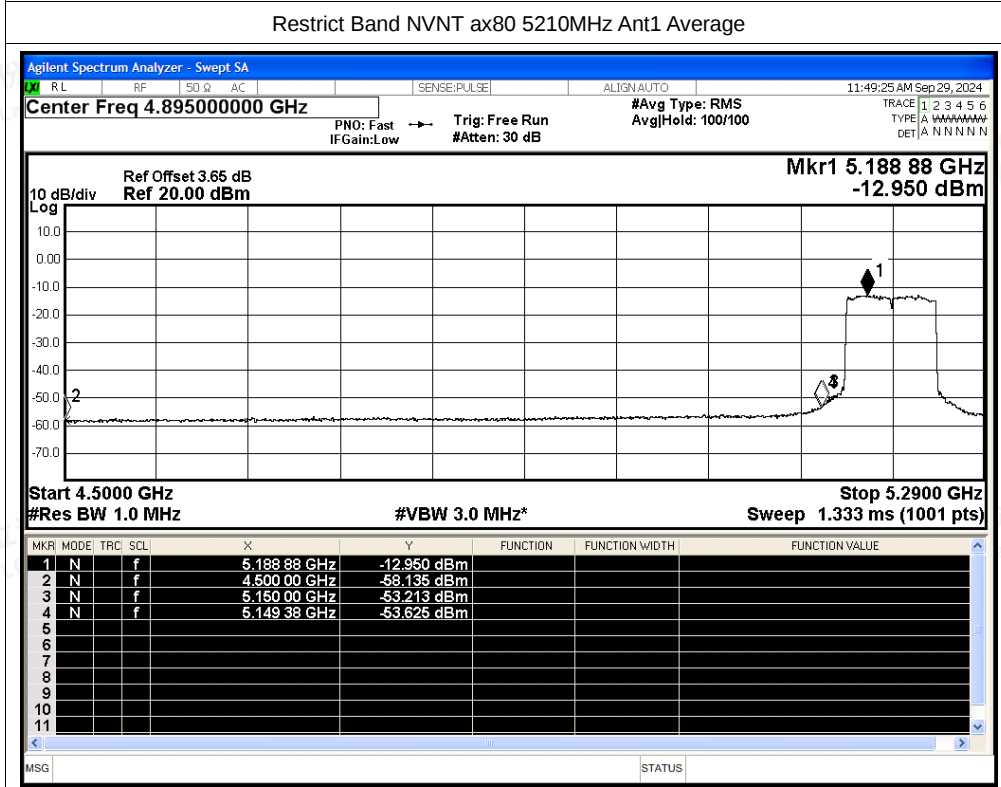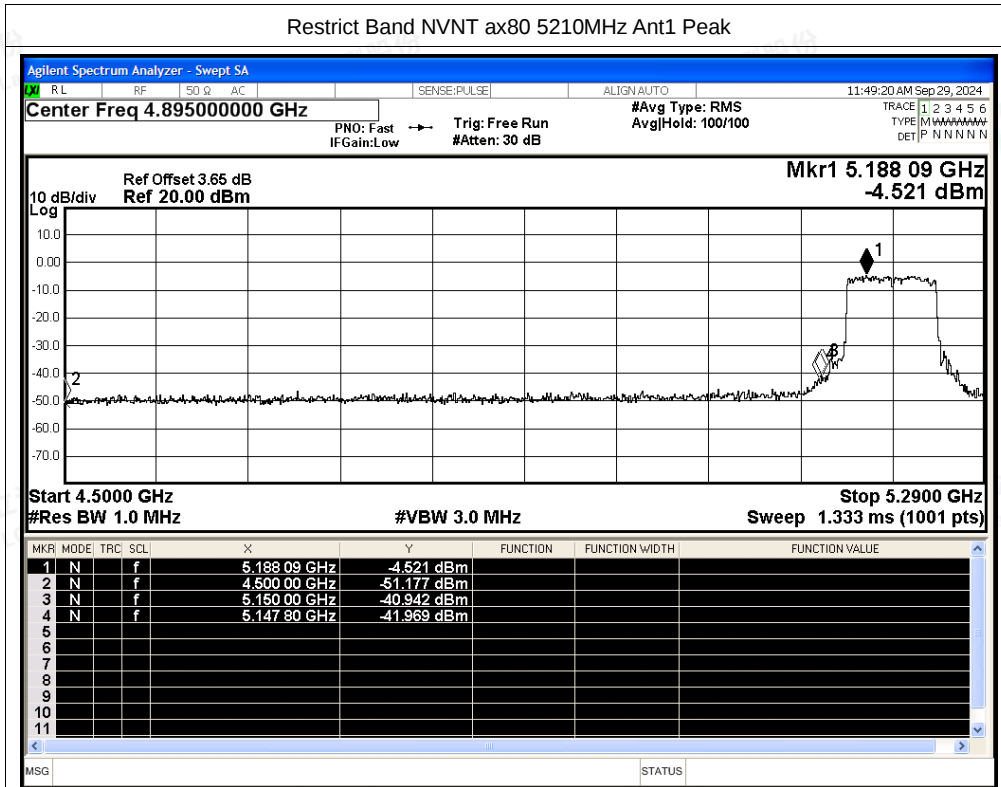

MIMO



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT0 Power (dBm)	ANT1 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-50.82	-49.79	4.62	52.58	Peak	68.2	Pass
NVNT	n20	5180	4500	-58.17	-58.04	4.62	44.75	Average	54	Pass
NVNT	n20	5180	5148.9	-39.97	-42.4	4.62	61.84	Peak	68.2	Pass
NVNT	n20	5180	5149.6	-50.53	-53.43	4.62	51.12	Average	54	Pass
NVNT	n20	5180	5150	-39.65	-41.42	4.62	62.41	Peak	68.2	Pass
NVNT	n20	5180	5150	-50.51	-52.71	4.62	51.39	Average	54	Pass
NVNT	n20	5240	5350	-49.06	-49.94	4.62	53.38	Peak	68.2	Pass
NVNT	n20	5240	5350	-57.64	-56.79	4.62	45.66	Average	54	Pass
NVNT	n20	5240	5352.48	-46.84	-46.61	4.62	56.13	Peak	68.2	Pass
NVNT	n20	5240	5350.56	-56.98	-56.63	4.62	46.06	Average	54	Pass
NVNT	n20	5240	5460	-49.23	-49.54	4.62	53.48	Peak	68.2	Pass
NVNT	n20	5240	5460	-58.93	-58.19	4.62	44.31	Average	54	Pass
NVNT	n40	5190	4500	-49.68	-50.07	4.62	52.99	Peak	68.2	Pass
NVNT	n40	5190	4500	-58.25	-58.23	4.62	44.62	Average	54	Pass
NVNT	n40	5190	5149.7	-40.26	-35.54	4.62	65.57	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-52.31	-52.42	4.62	50.49	Average	54	Pass
NVNT	n40	5190	5150	-42.47	-40.42	4.62	61.53	Peak	68.2	Pass
NVNT	n40	5190	5150	-52.31	-52.42	4.62	50.49	Average	54	Pass
NVNT	n40	5230	5350	-49.97	-50.66	4.62	52.56	Peak	68.2	Pass
NVNT	n40	5230	5350	-57.07	-57.27	4.62	45.69	Average	54	Pass
NVNT	n40	5230	5426.79	-46.29	-47.04	4.62	56.21	Peak	68.2	Pass
NVNT	n40	5230	5354.43	-56.99	-56.97	4.62	45.88	Average	54	Pass
NVNT	n40	5230	5460	-49.07	-49.25	4.62	53.70	Peak	68.2	Pass
NVNT	n40	5230	5460	-58.15	-57.85	4.62	44.86	Average	54	Pass
NVNT	ac20	5180	4500	-49.44	-49.71	4.62	53.28	Peak	68.2	Pass
NVNT	ac20	5180	4500	-57.91	-58.16	4.62	44.82	Average	54	Pass
NVNT	ac20	5180	5149.6	-45.42	-33.64	4.62	66.49	Peak	68.2	Pass
NVNT	ac20	5180	5147.5	-56.06	-52.91	4.62	48.65	Average	54	Pass
NVNT	ac20	5180	5150	-48.9	-32.56	4.62	67.39	Peak	68.2	Pass
NVNT	ac20	5180	5150	-56.99	-53.14	4.62	48.21	Average	54	Pass
NVNT	ac20	5240	5350	-50.02	-49.18	4.62	53.28	Peak	68.2	Pass
NVNT	ac20	5240	5350	-57.36	-57.44	4.62	45.46	Average	54	Pass
NVNT	ac20	5240	5401.68	-47.23	-46.45	4.62	56.04	Peak	68.2	Pass
NVNT	ac20	5240	5372.4	-56.9	-57.02	4.62	45.90	Average	54	Pass
NVNT	ac20	5240	5460	-51.41	-51.04	4.62	51.64	Peak	68.2	Pass
NVNT	ac20	5240	5460	-57.57	-58.1	4.62	45.03	Average	54	Pass
NVNT	ac40	5190	4500	-50.48	-49.71	4.62	52.78	Peak	68.2	Pass
NVNT	ac40	5190	4500	-58.45	-58.27	4.62	44.50	Average	54	Pass
NVNT	ac40	5190	5149.7	-41.95	-42.22	4.62	60.77	Peak	68.2	Pass
NVNT	ac40	5190	5148.97	-54.23	-52.03	4.62	49.87	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	5150	-41.95	-43.98	4.62	60.01	Peak	68.2	Pass
NVNT	ac40	5190	5150	-54.23	-52.03	4.62	49.87	Average	54	Pass
NVNT	ac40	5230	5350	-49.32	-49.9	4.62	53.26	Peak	68.2	Pass
NVNT	ac40	5230	5350	-57.4	-57.45	4.62	45.43	Average	54	Pass
NVNT	ac40	5230	5364.96	-46.99	-46.76	4.62	55.98	Peak	68.2	Pass
NVNT	ac40	5230	5357.4	-57	-56.96	4.62	45.88	Average	54	Pass
NVNT	ac40	5230	5460	-50.61	-51.07	4.62	52.02	Peak	68.2	Pass
NVNT	ac40	5230	5460	-58.19	-58.05	4.62	44.74	Average	54	Pass
NVNT	ac80	5210	5350	-48.01	-49.46	4.62	54.18	Peak	68.2	Pass
NVNT	ac80	5210	5350	-56.82	-57.21	4.62	45.85	Average	54	Pass
NVNT	ac80	5210	5357.04	-46.02	-46.27	4.62	56.71	Peak	68.2	Pass
NVNT	ac80	5210	5350.11	-56.38	-56.45	4.62	46.44	Average	54	Pass
NVNT	ac80	5210	5460	-48.47	-49.4	4.62	53.95	Peak	68.2	Pass
NVNT	ac80	5210	5460	-57.91	-57.93	4.62	44.94	Average	54	Pass
NVNT	ac80	5210	4500	-51.75	-51.07	4.62	51.46	Peak	68.2	Pass
NVNT	ac80	5210	4500	-58.87	-57.94	4.62	44.48	Average	54	Pass
NVNT	ac80	5210	5147.8	-42.95	-43.09	4.62	59.84	Peak	68.2	Pass
NVNT	ac80	5210	5143.85	-53.42	-53.21	4.62	49.54	Average	54	Pass
NVNT	ac80	5210	5150	-41.59	-41.62	4.62	61.25	Peak	68.2	Pass
NVNT	ac80	5210	5150	-54.12	-52.92	4.62	49.38	Average	54	Pass
NVNT	ax20	5180	4500	-50.01	-50.03	4.62	52.84	Peak	68.2	Pass
NVNT	ax20	5180	4500	-58.31	-58.32	4.62	44.54	Average	54	Pass
NVNT	ax20	5180	5148.2	-41.09	-32.25	4.62	68.13	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	-54.99	-52.38	4.62	49.37	Average	54	Pass
NVNT	ax20	5180	5150	-44.05	-34.67	4.62	65.65	Peak	68.2	Pass
NVNT	ax20	5180	5150	-54.2	-51.78	4.62	50.03	Average	54	Pass
NVNT	ax20	5240	5350	-49.7	-49.85	4.62	53.08	Peak	68.2	Pass
NVNT	ax20	5240	5350	-57.47	-57.07	4.62	45.59	Average	54	Pass
NVNT	ax20	5240	5376.72	-47.31	-46.9	4.62	55.76	Peak	68.2	Pass
NVNT	ax20	5240	5351.28	-56.79	-56.57	4.62	46.18	Average	54	Pass
NVNT	ax20	5240	5460	-49.39	-48.95	4.62	53.69	Peak	68.2	Pass
NVNT	ax20	5240	5460	-58.84	-57.78	4.62	44.58	Average	54	Pass
NVNT	ax40	5190	4500	-48.65	-50.25	4.62	53.48	Peak	68.2	Pass
NVNT	ax40	5190	4500	-58.62	-57.92	4.62	44.60	Average	54	Pass
NVNT	ax40	5190	5147.51	-41.94	-39.13	4.62	62.55	Peak	68.2	Pass
NVNT	ax40	5190	5149.7	-52.01	-52.75	4.62	50.49	Average	54	Pass
NVNT	ax40	5190	5150	-43.4	-40.99	4.62	60.83	Peak	68.2	Pass
NVNT	ax40	5190	5150	-52.01	-52.75	4.62	50.49	Average	54	Pass
NVNT	ax40	5230	5350	-48.3	-50.15	4.62	53.73	Peak	68.2	Pass
NVNT	ax40	5230	5350	-57.48	-57.79	4.62	45.23	Average	54	Pass
NVNT	ax40	5230	5393.04	-47.33	-47.12	4.62	55.63	Peak	68.2	Pass
NVNT	ax40	5230	5352	-56.84	-56.76	4.62	46.06	Average	54	Pass
NVNT	ax40	5230	5460	-48.31	-50.85	4.62	53.46	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5460	-57.89	-57.73	4.62	45.05	Average	54	Pass
NVNT	ax80	5210	5350	-47.81	-48.35	4.62	54.79	Peak	68.2	Pass
NVNT	ax80	5210	5350	-56.33	-57.06	4.62	46.18	Average	54	Pass
NVNT	ax80	5210	5365.62	-46.11	-46.96	4.62	56.34	Peak	68.2	Pass
NVNT	ax80	5210	5358.36	-56.26	-56.44	4.62	46.51	Average	54	Pass
NVNT	ax80	5210	5460	-50.53	-49.59	4.62	52.82	Peak	68.2	Pass
NVNT	ax80	5210	5460	-57.4	-57.31	4.62	45.50	Average	54	Pass
NVNT	ax80	5210	4500	-50.62	-51.18	4.62	51.97	Peak	68.2	Pass
NVNT	ax80	5210	4500	-58.02	-58.14	4.62	44.78	Average	54	Pass
NVNT	ax80	5210	5148.59	-42.18	-41.97	4.62	60.78	Peak	68.2	Pass
NVNT	ax80	5210	5141.48	-53.49	-53.63	4.62	49.30	Average	54	Pass
NVNT	ax80	5210	5150	-43.99	-40.94	4.62	60.66	Peak	68.2	Pass
NVNT	ax80	5210	5150	-53.23	-53.21	4.62	49.64	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant0	5200	0	0	25	Pass
NVNT	a	5240	Ant0	5240	0	0	25	Pass
NVNT	n20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant0	5200	0	0	25	Pass
NVNT	n20	5240	Ant0	5239.96	-40000	-7.63	25	Pass
NVNT	n40	5190	Ant0	5190	0	0	25	Pass
NVNT	n40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac20	5180	Ant0	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant0	5200	0	0	25	Pass
NVNT	ac20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant0	5190	0	0	25	Pass
NVNT	ac40	5230	Ant0	5230	0	0	25	Pass
NVNT	ac80	5210	Ant0	5210	0	0	25	Pass
NVNT	ax20	5180	Ant0	5180.02	20000	3.86	25	Pass
NVNT	ax20	5200	Ant0	5200	0	0	25	Pass
NVNT	ax20	5240	Ant0	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant0	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant0	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant0	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant0

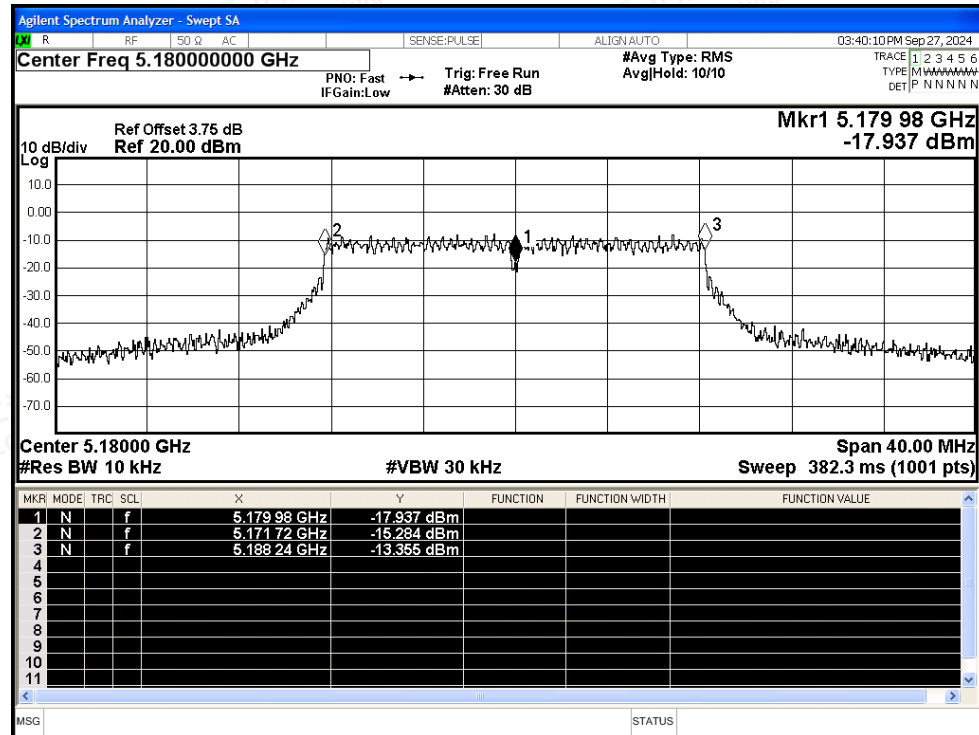

Freq. Stability NVNT a 5200MHz Ant0

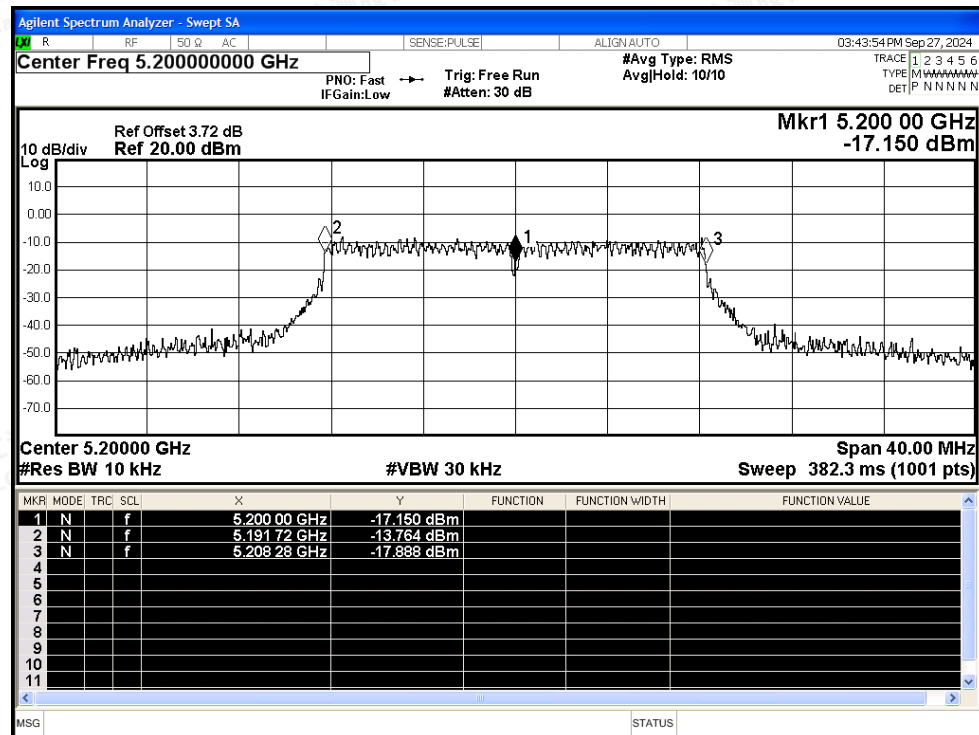

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant0

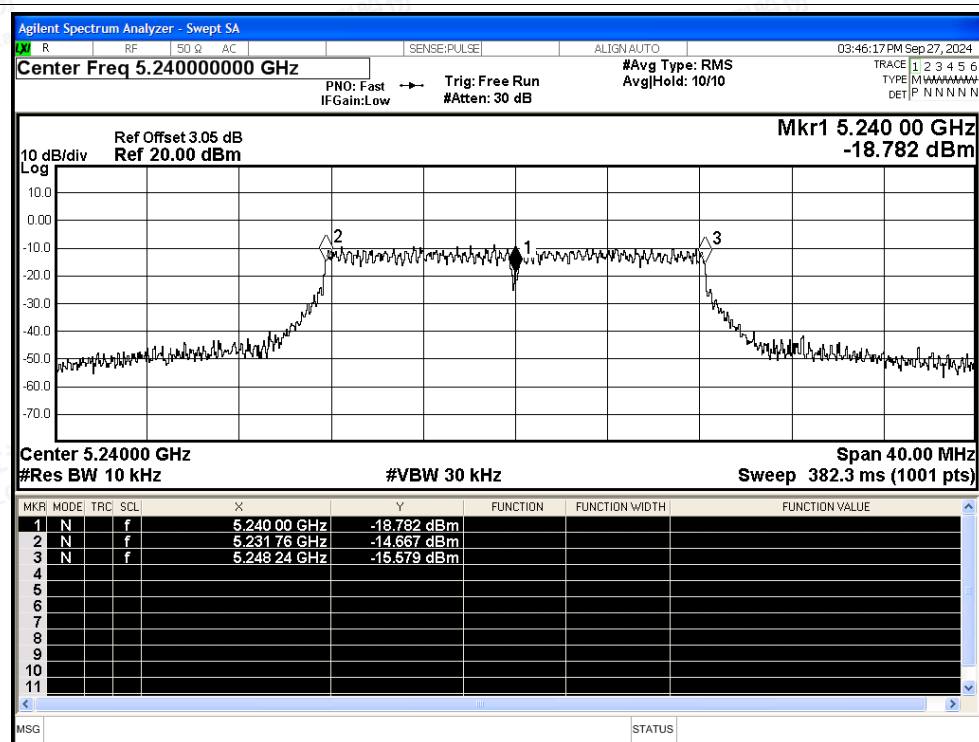

Freq. Stability NVNT n20 5180MHz Ant0

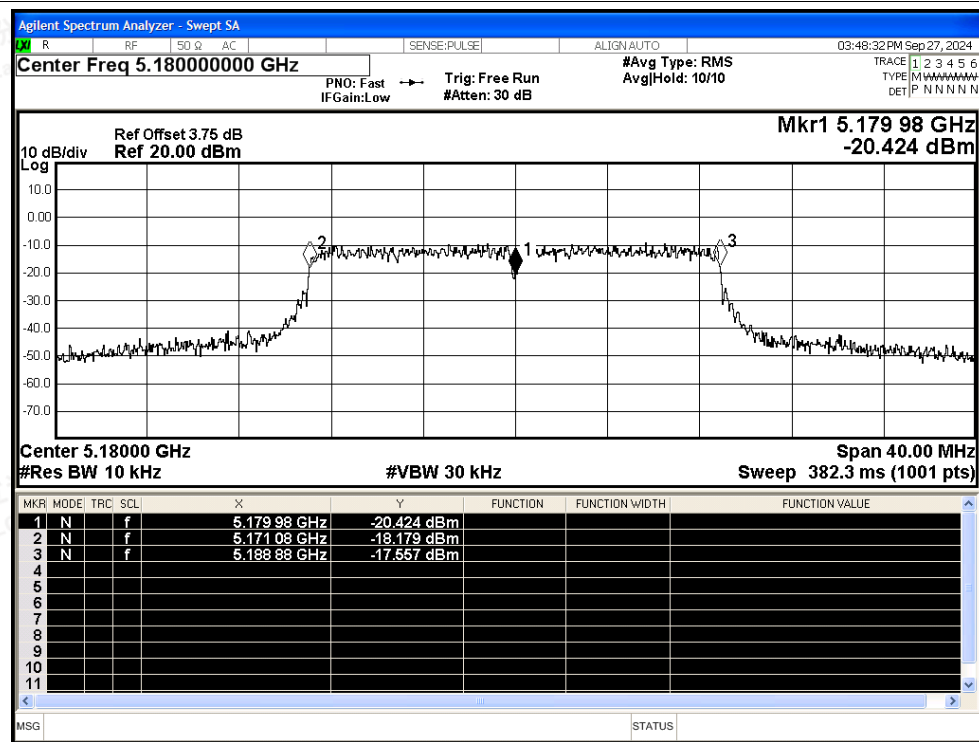

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant0

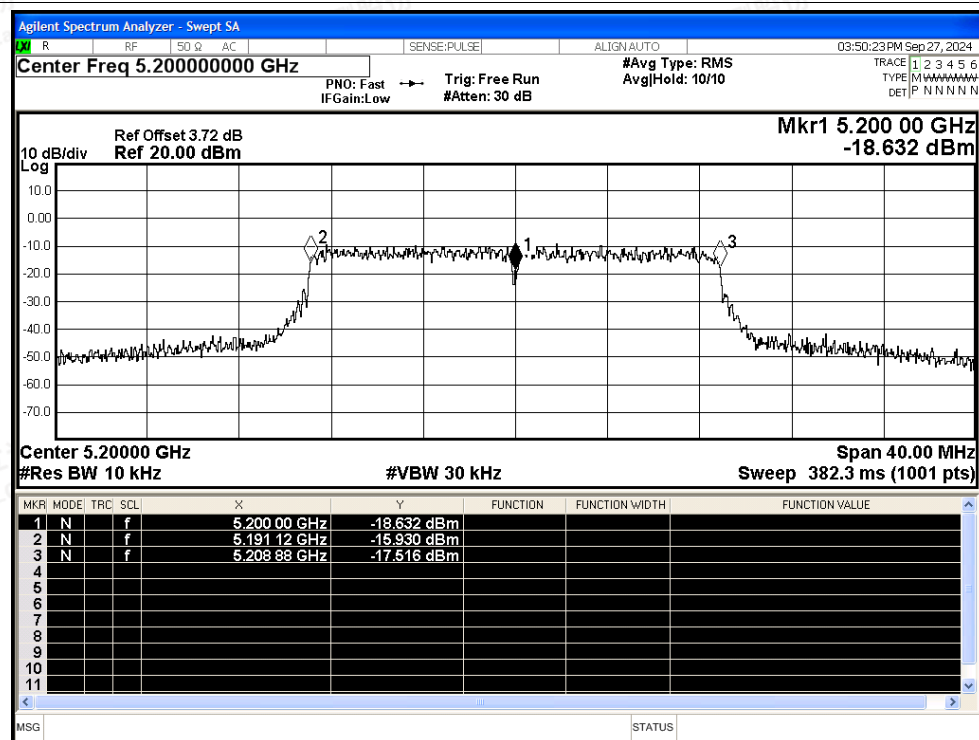

Freq. Stability NVNT n20 5240MHz Ant0

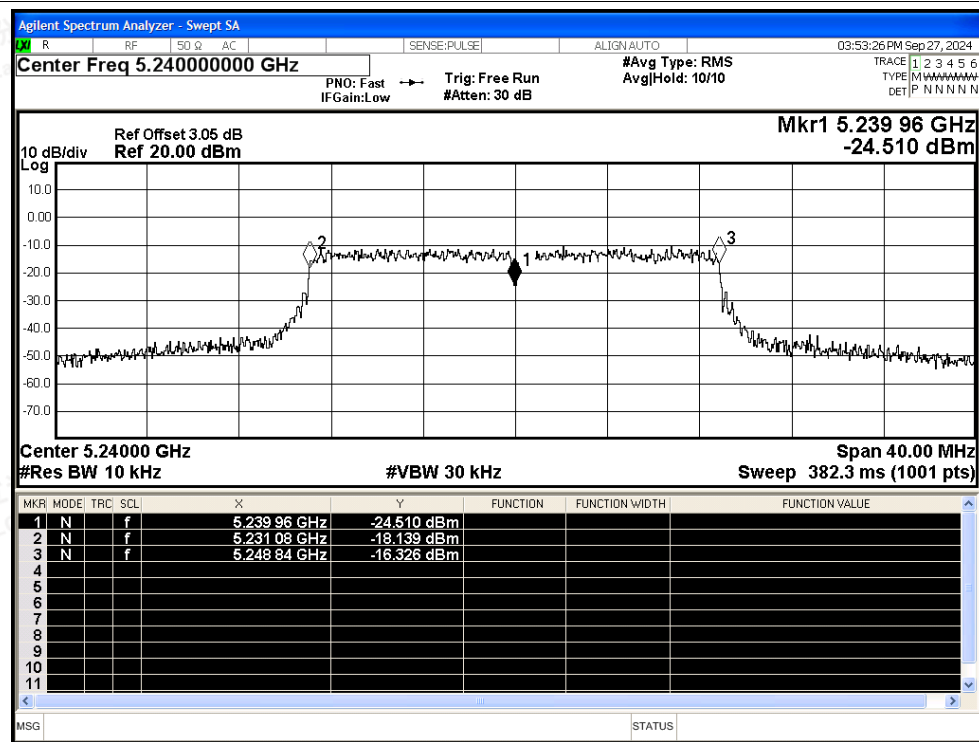

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant0

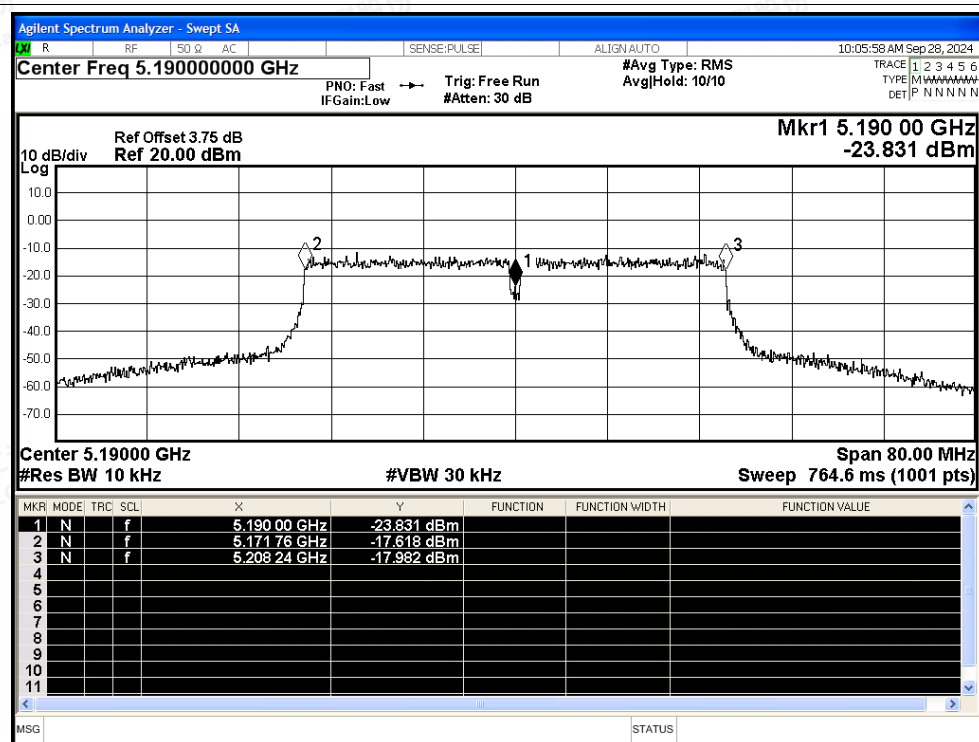

Freq. Stability NVNT n40 5230MHz Ant0


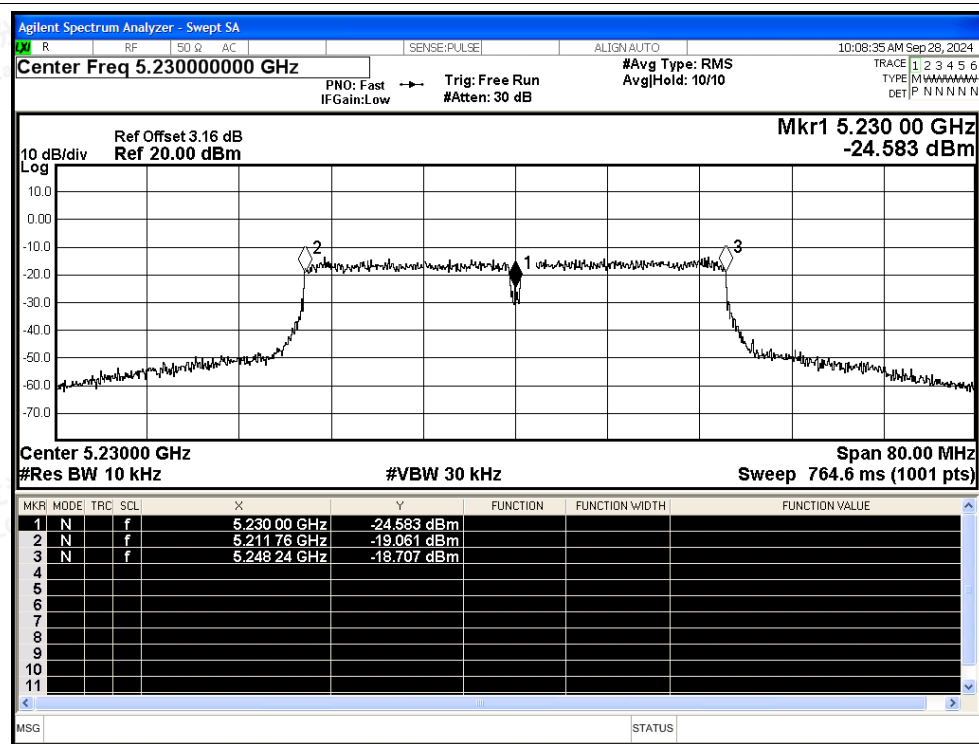


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

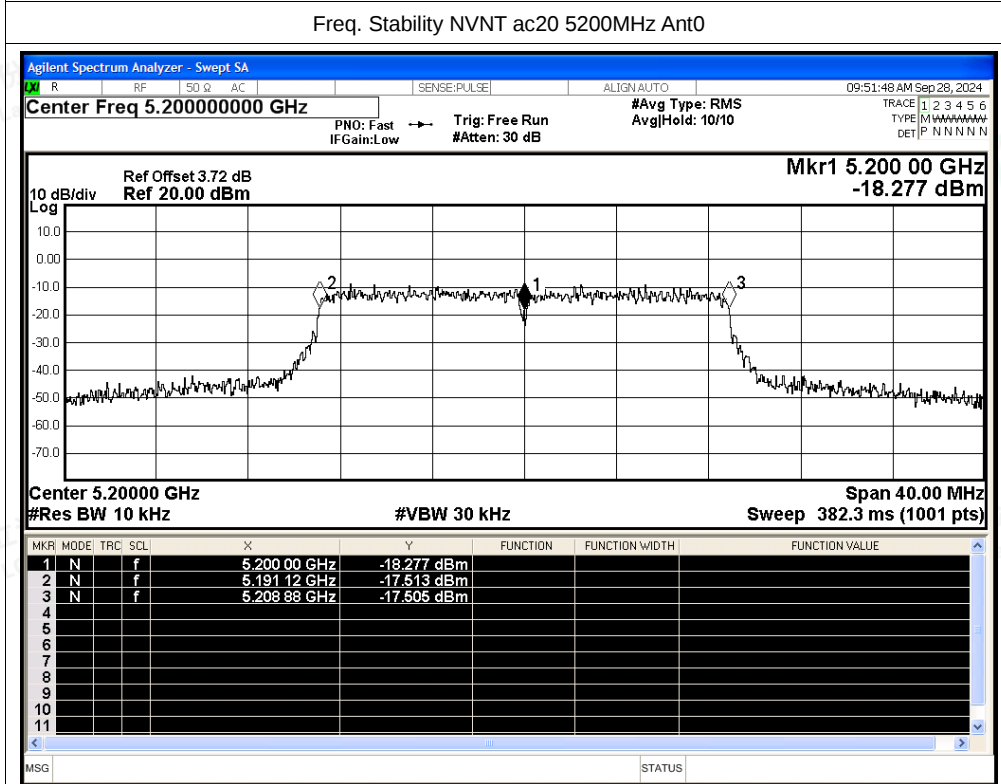
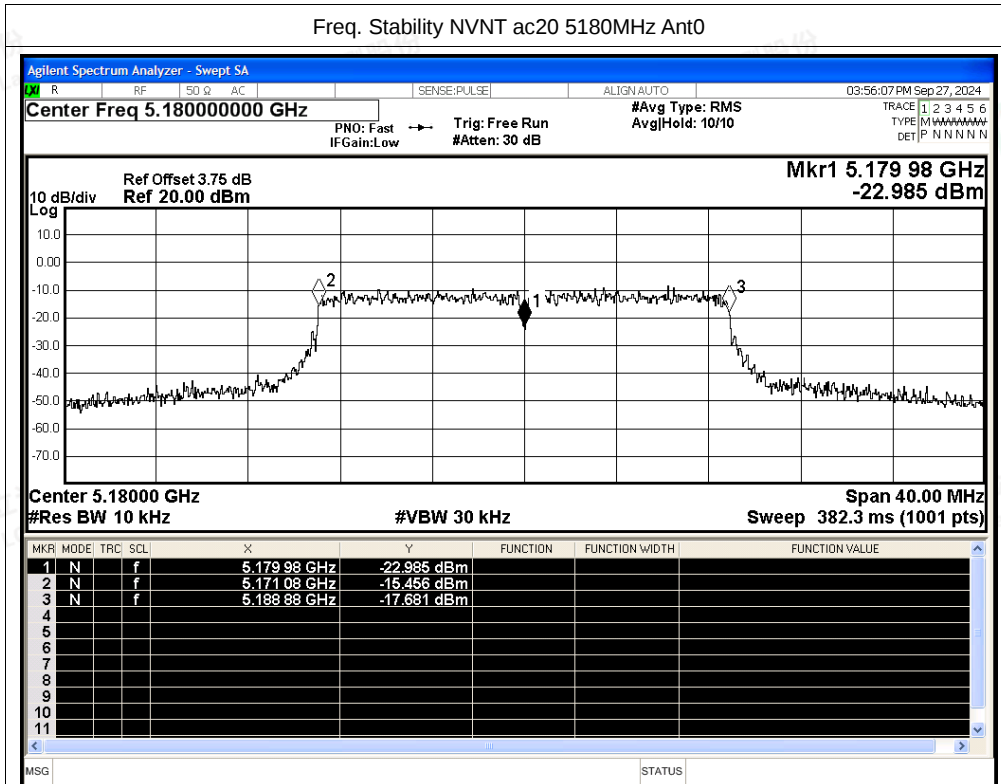


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

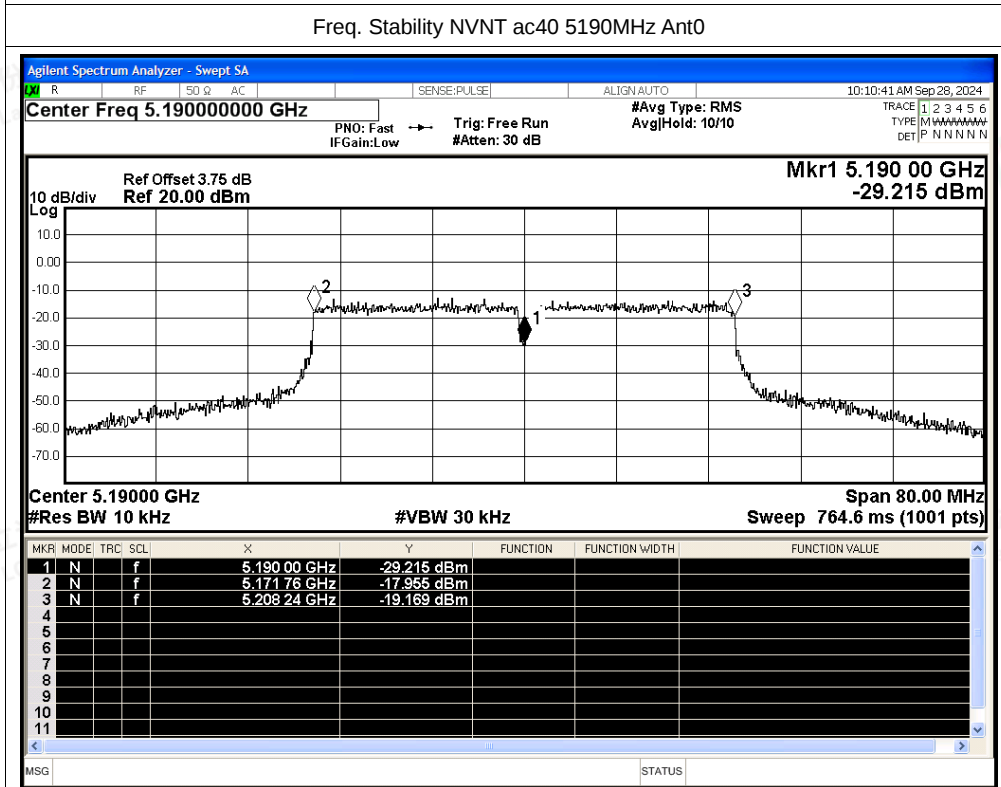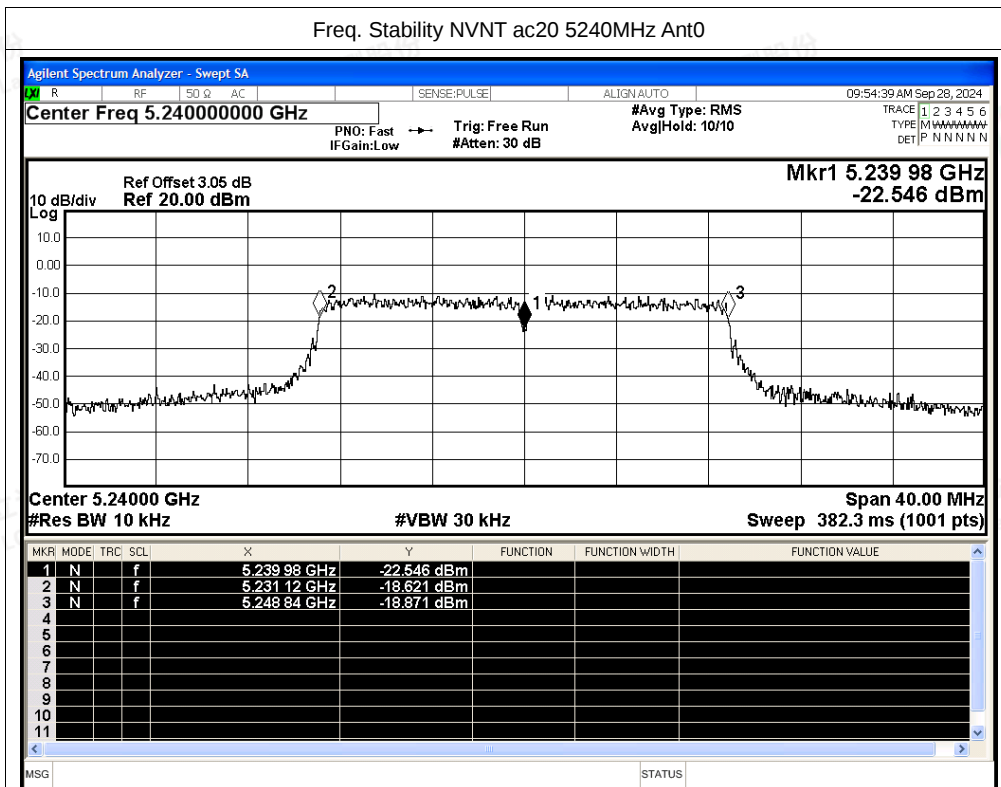

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant0

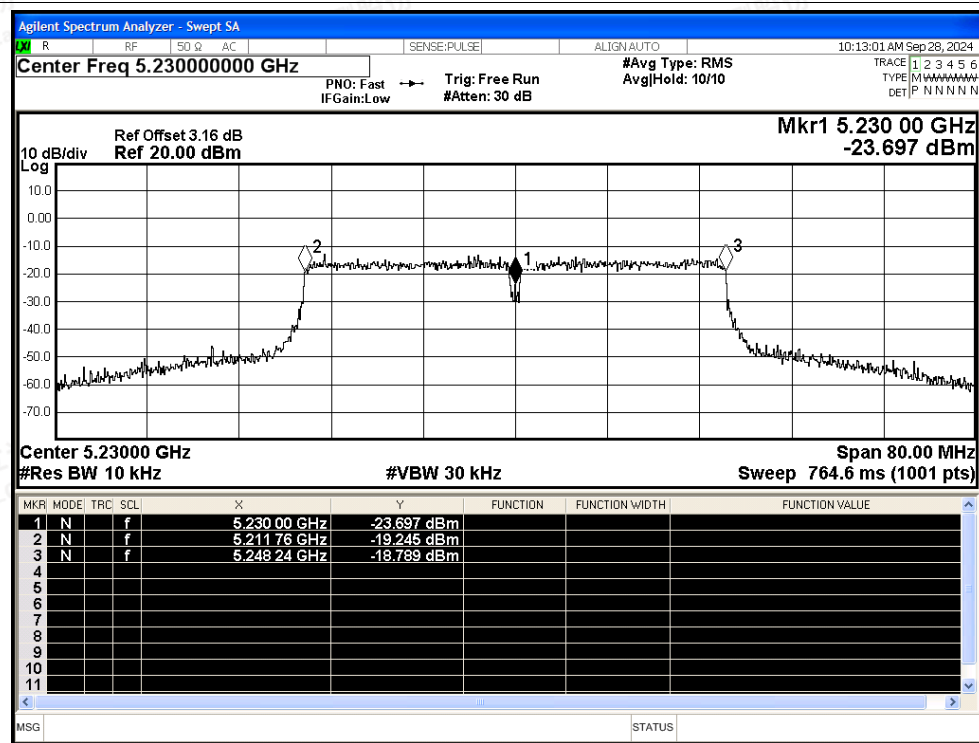

Freq. Stability NVNT ac80 5210MHz Ant0


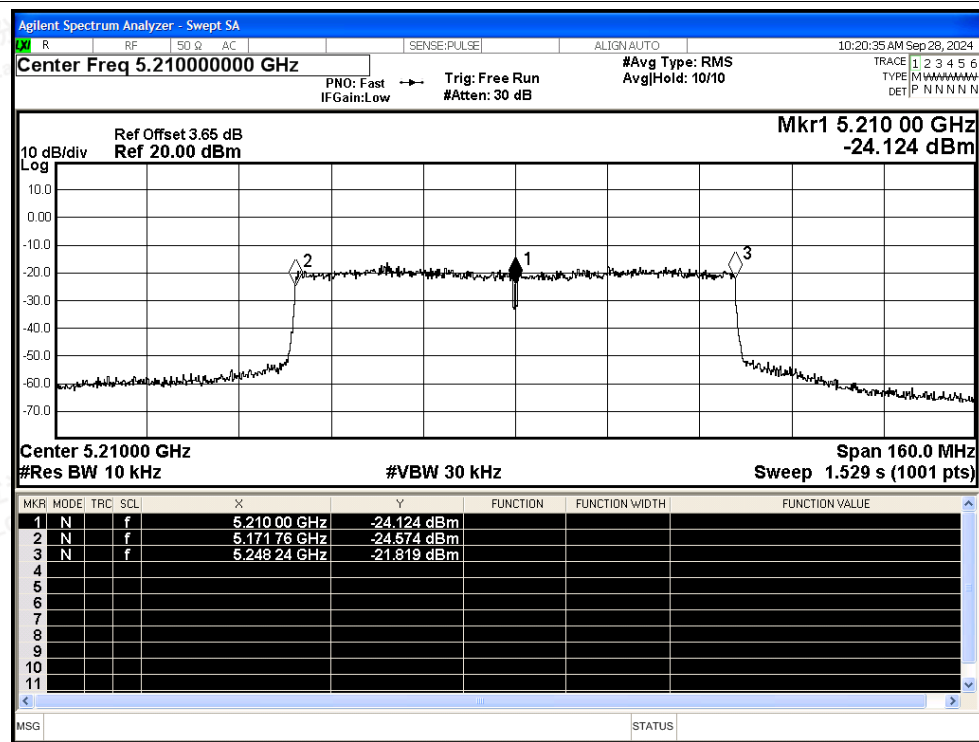


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

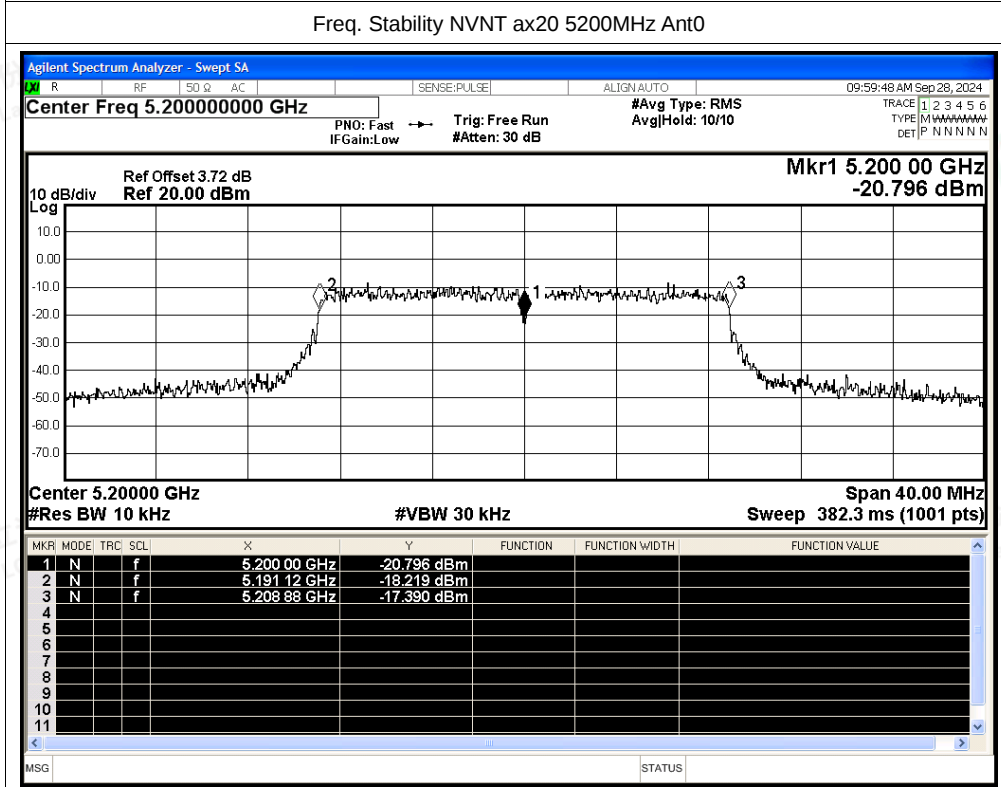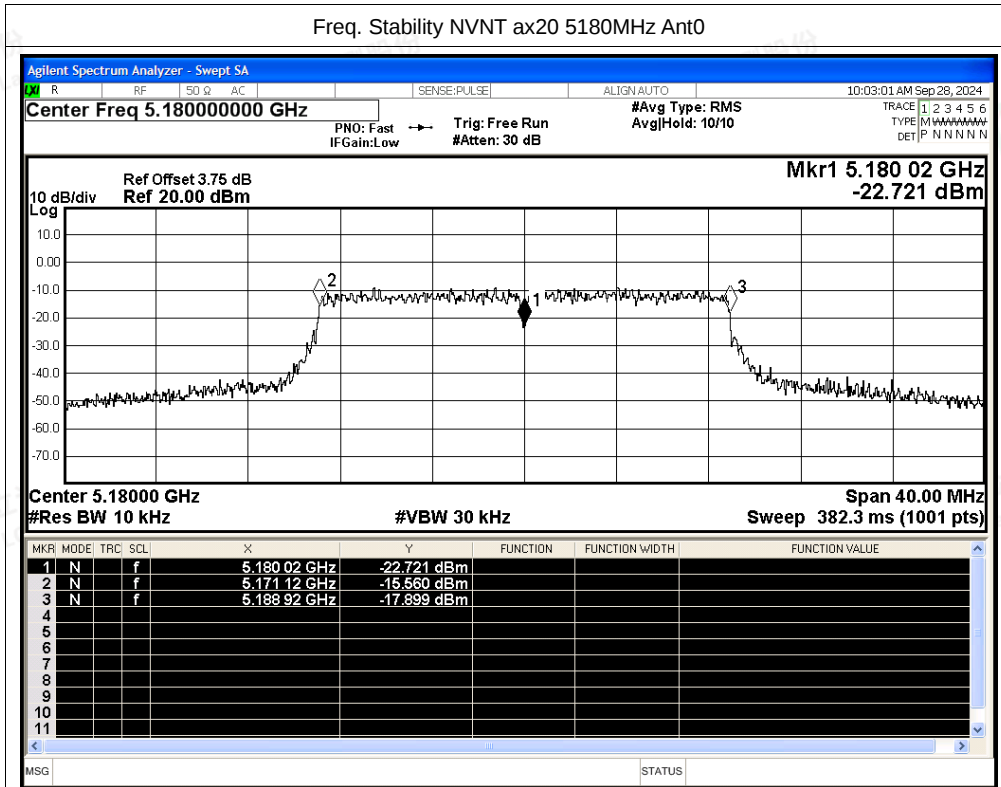

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant0

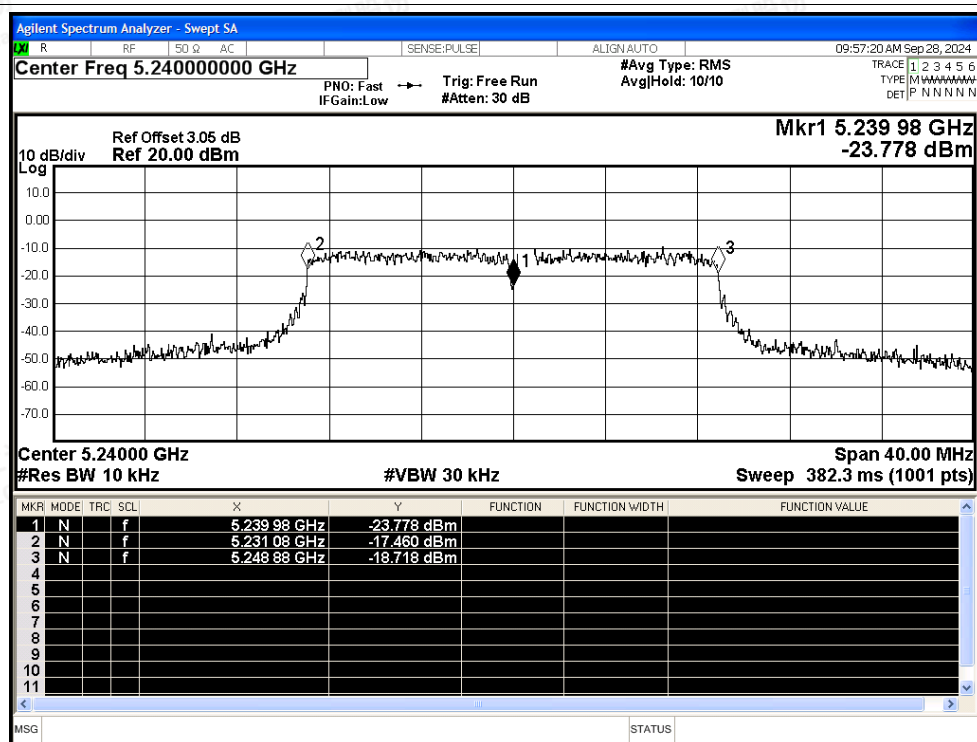

Freq. Stability NVNT ax40 5190MHz Ant0

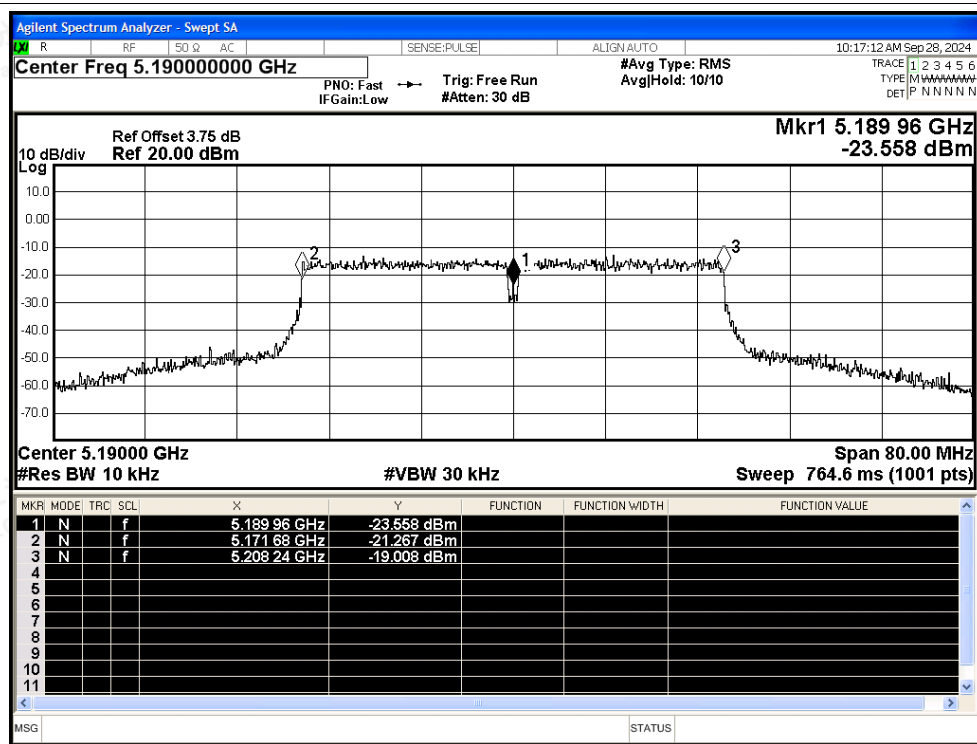

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant0

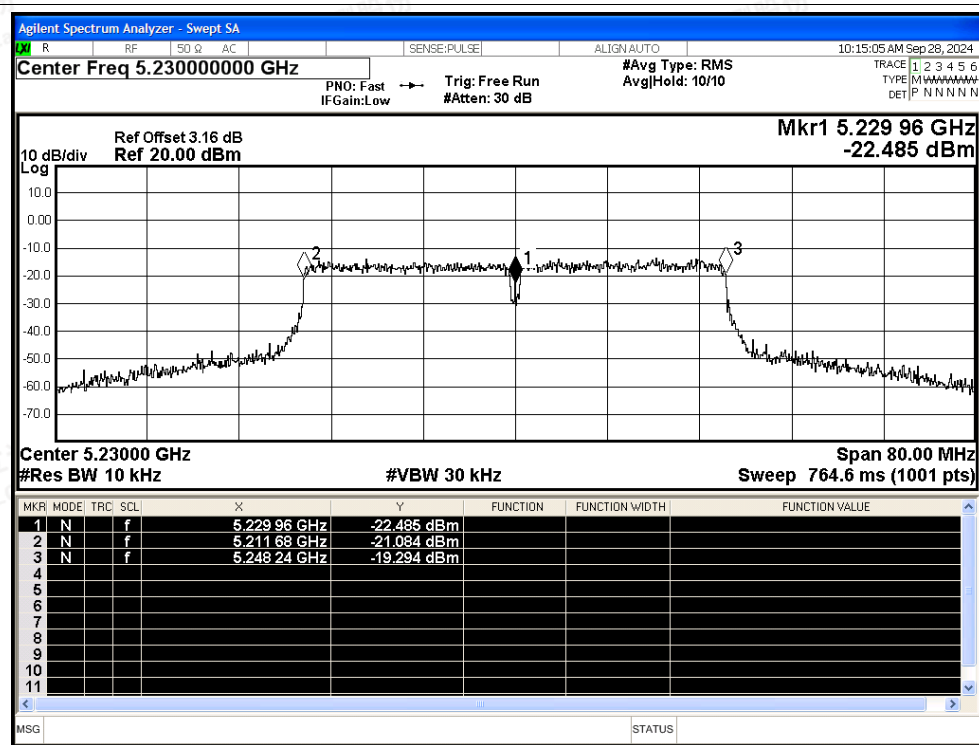

Freq. Stability NVNT ax80 5210MHz Ant0

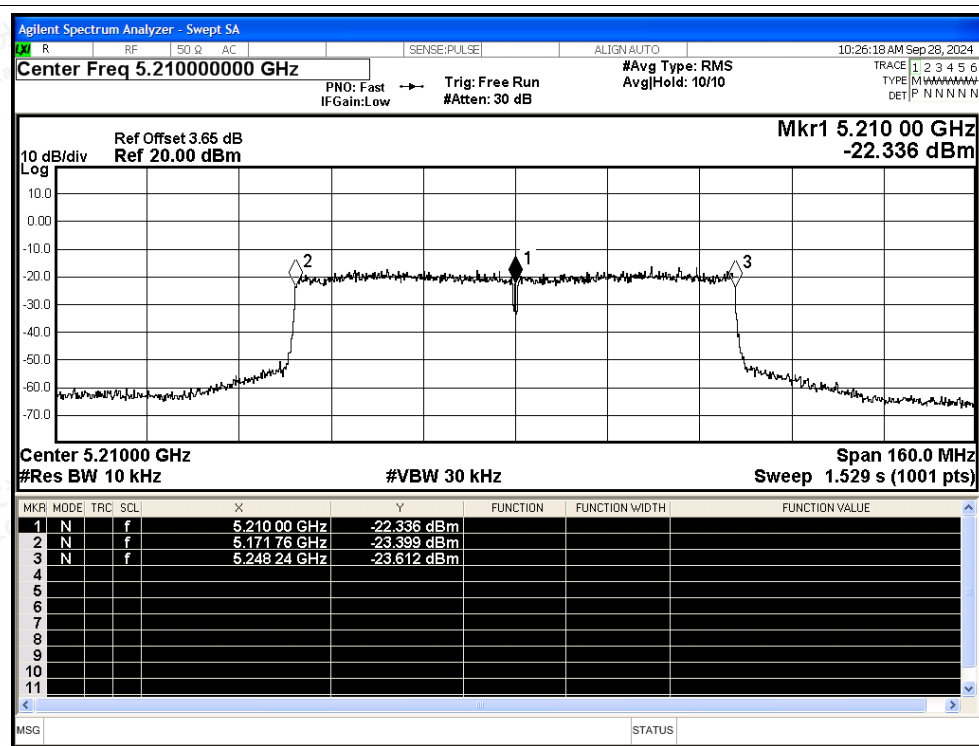

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5200	0	0	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5240	0	0	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5180	0	0	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

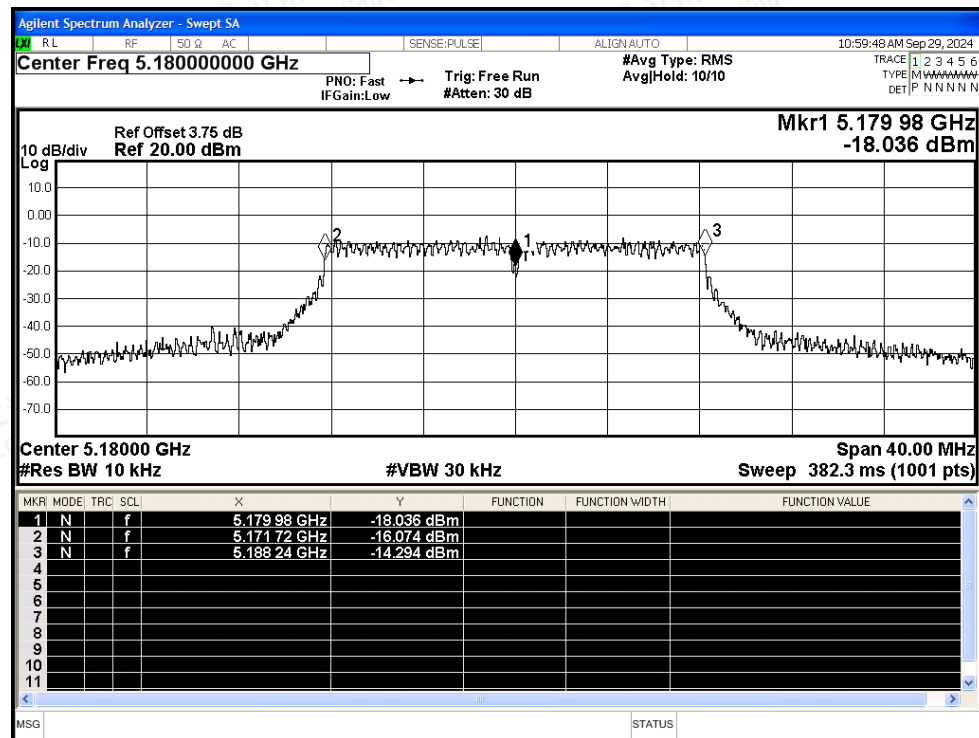

Freq. Stability NVNT a 5200MHz Ant1

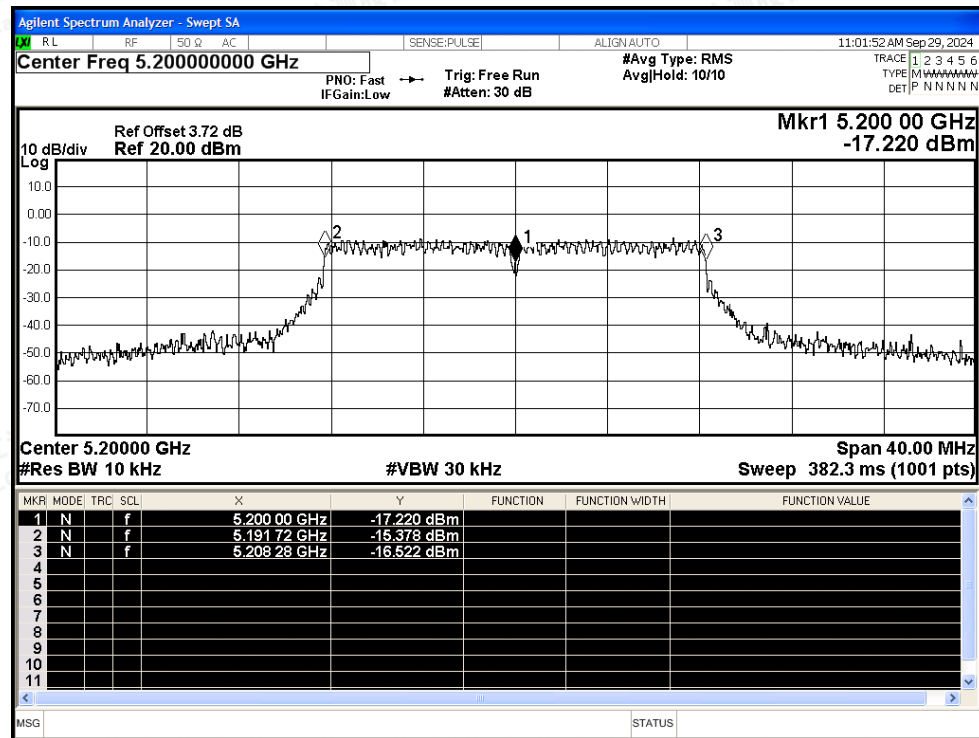

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

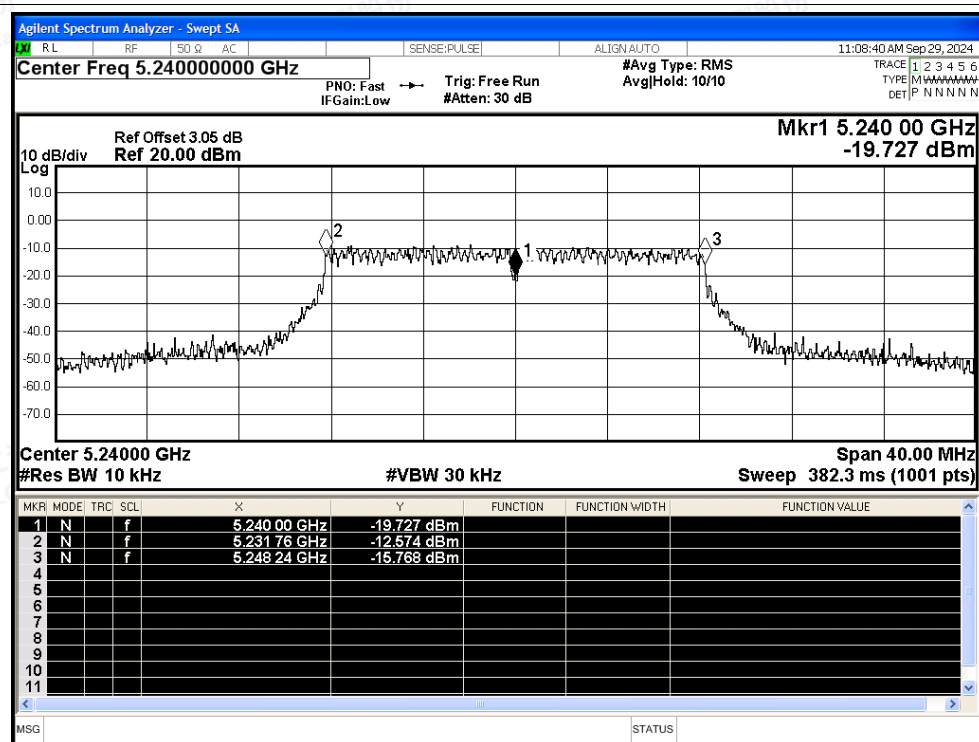

Freq. Stability NVNT n20 5180MHz Ant1

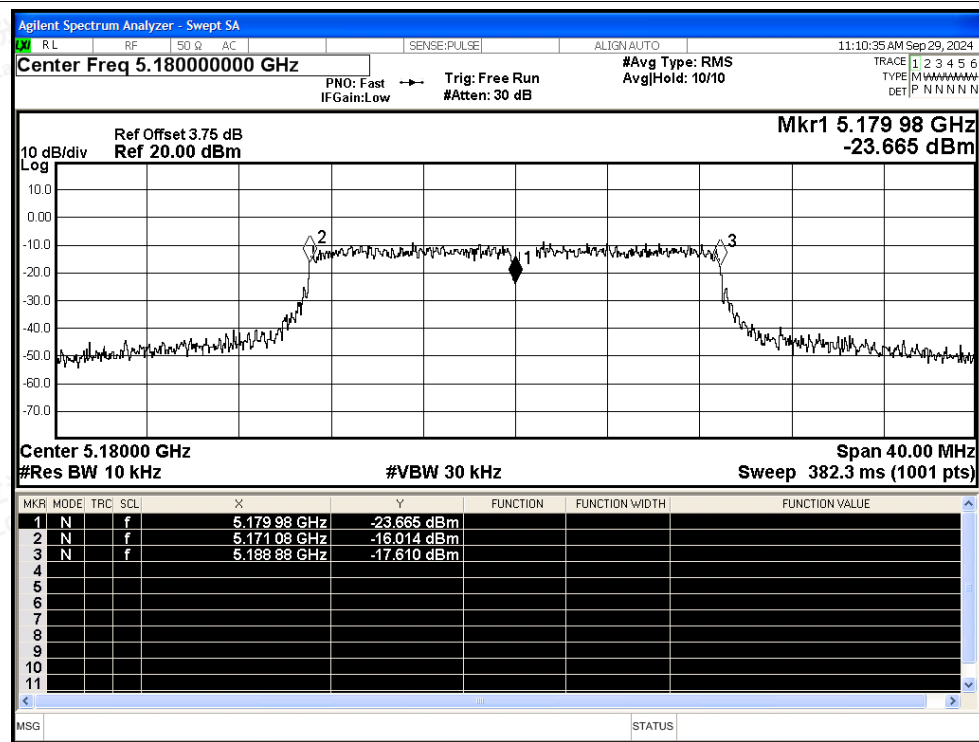

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

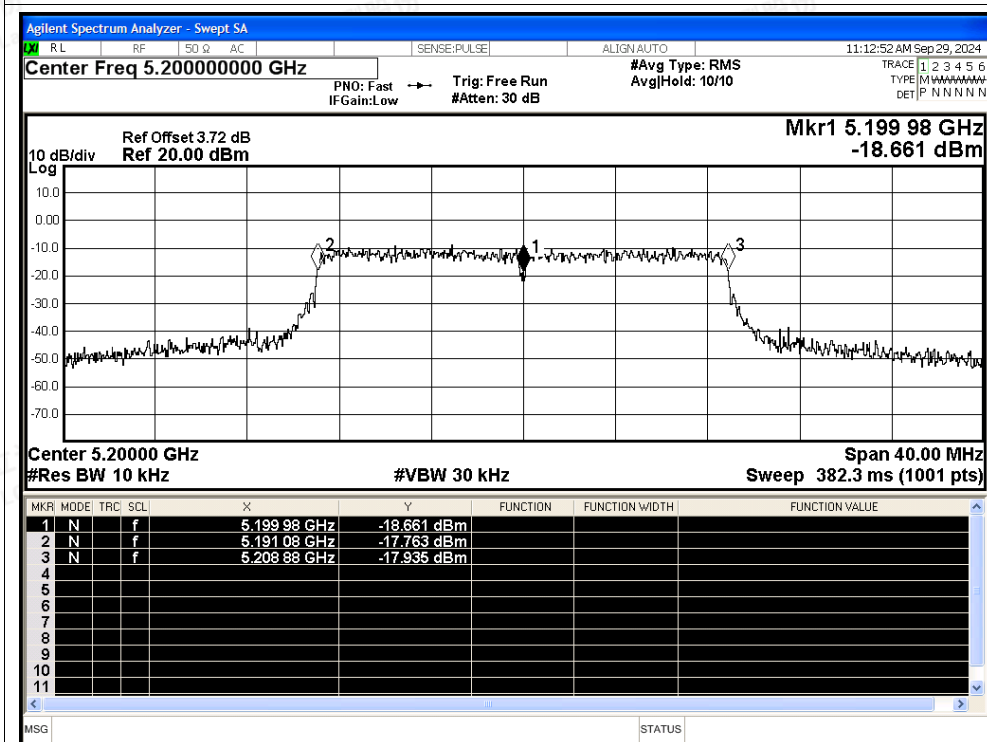

Freq. Stability NVNT n20 5240MHz Ant1

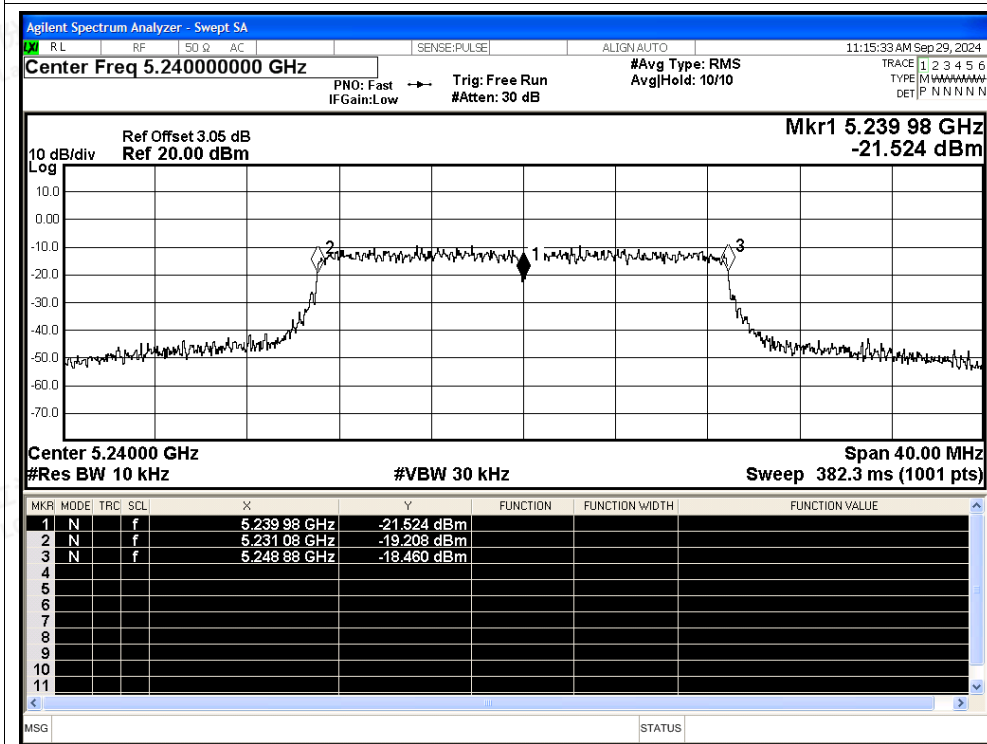

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

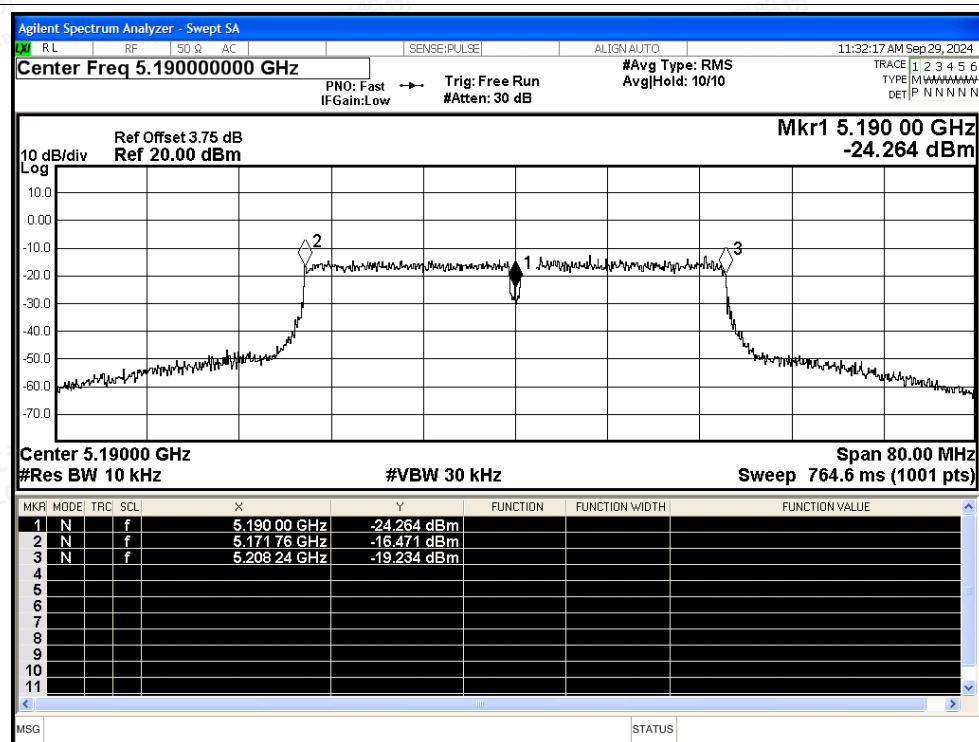

Freq. Stability NVNT n40 5230MHz Ant1

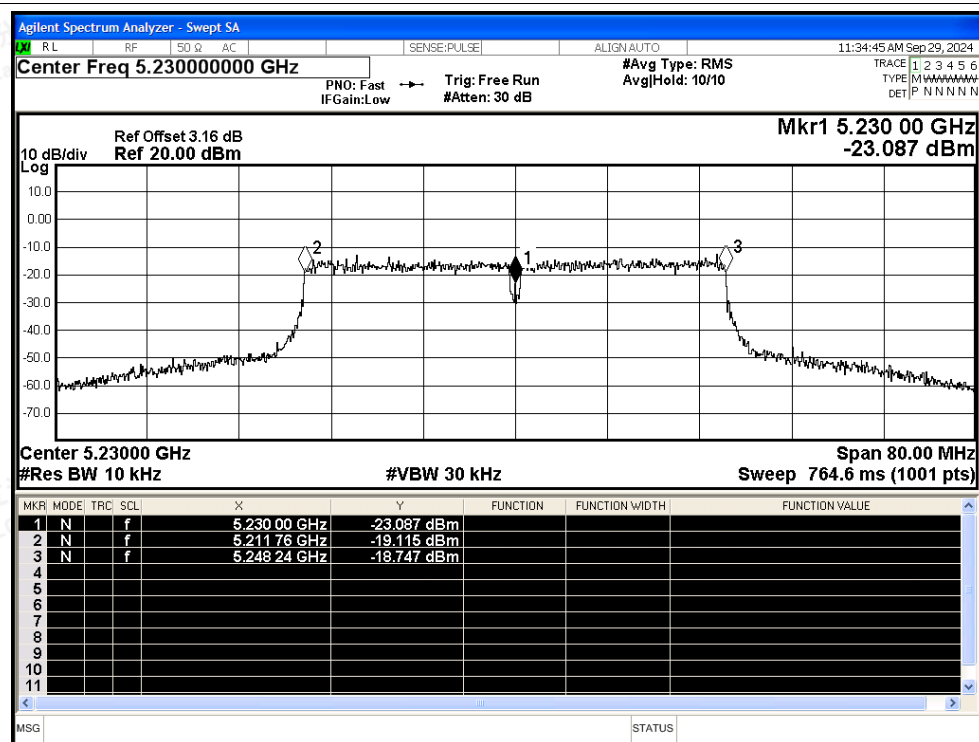

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

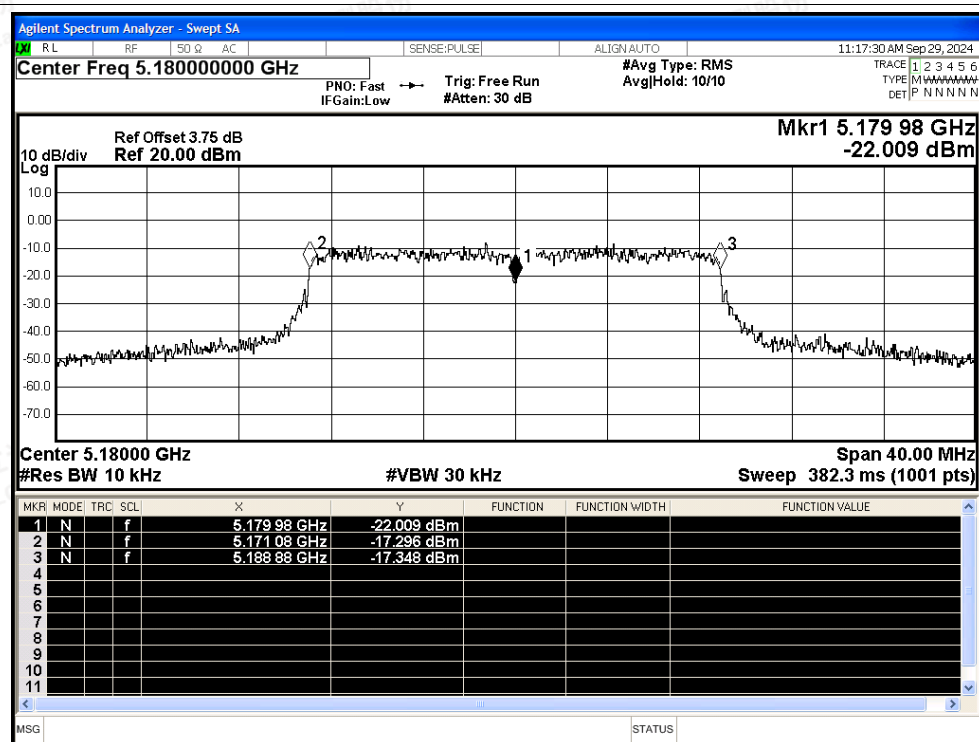

Freq. Stability NVNT ac20 5200MHz Ant1

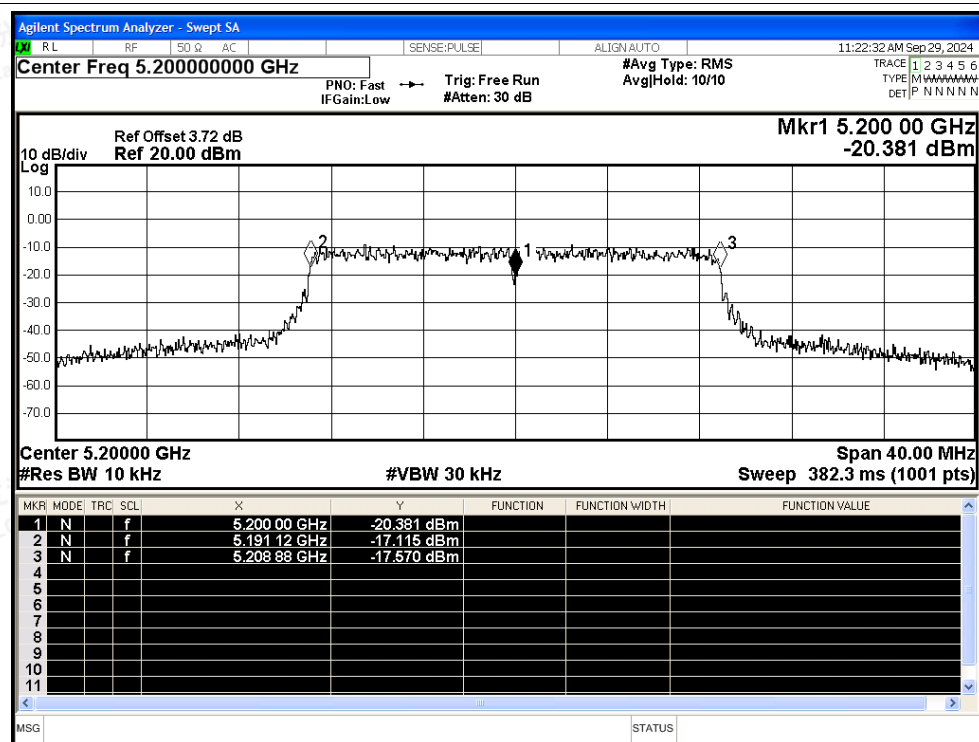

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

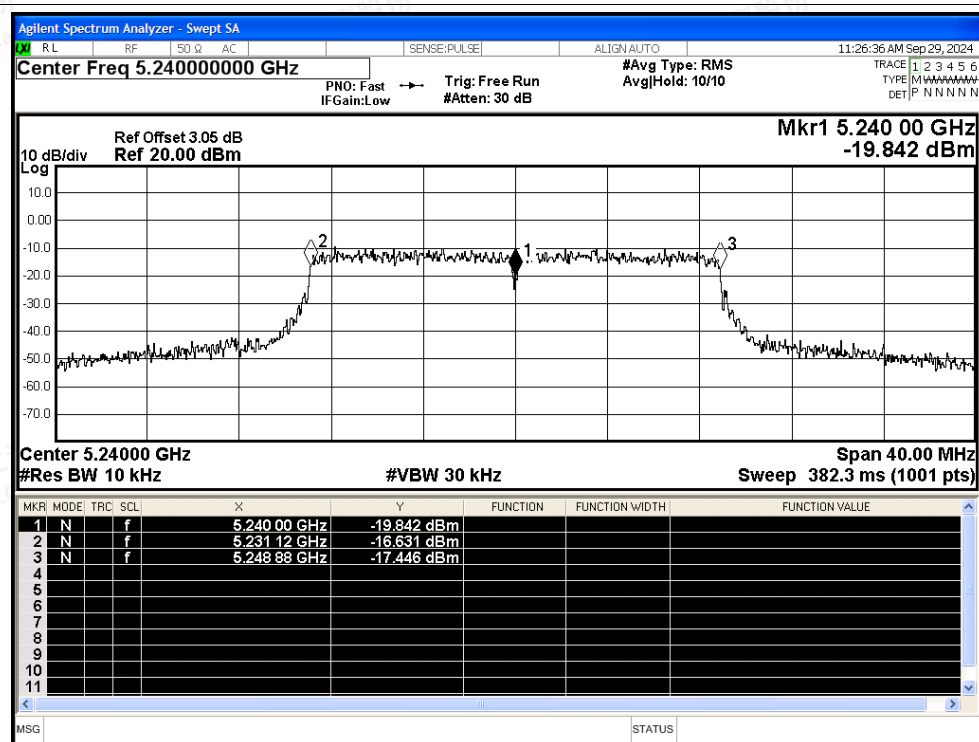

Freq. Stability NVNT ac40 5190MHz Ant1

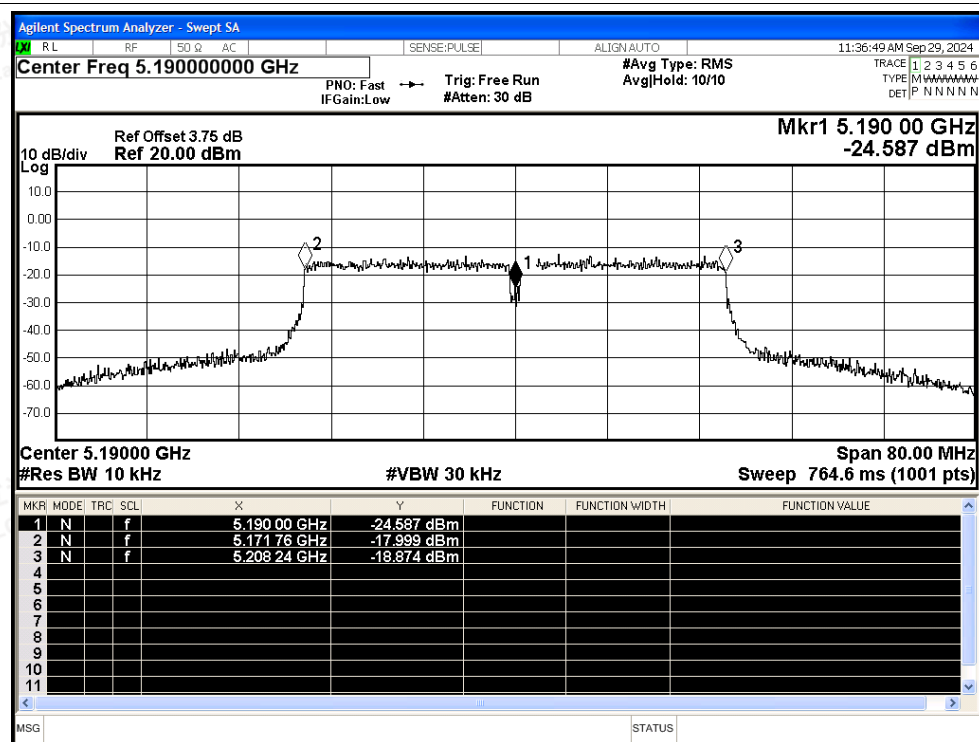

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

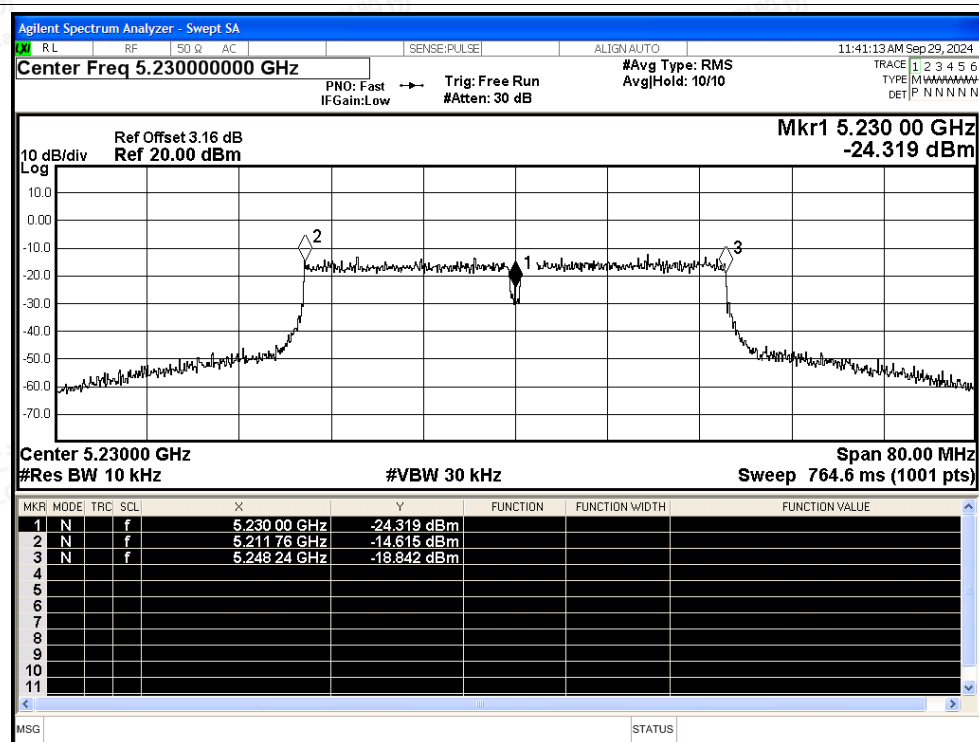

Freq. Stability NVNT ac80 5210MHz Ant1

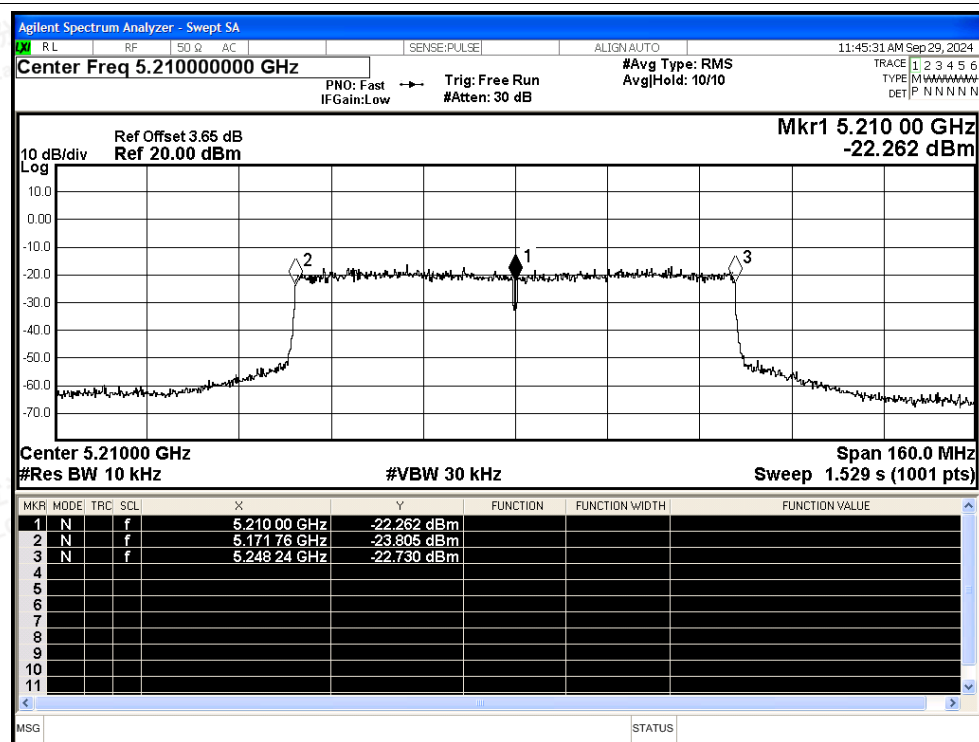

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant1

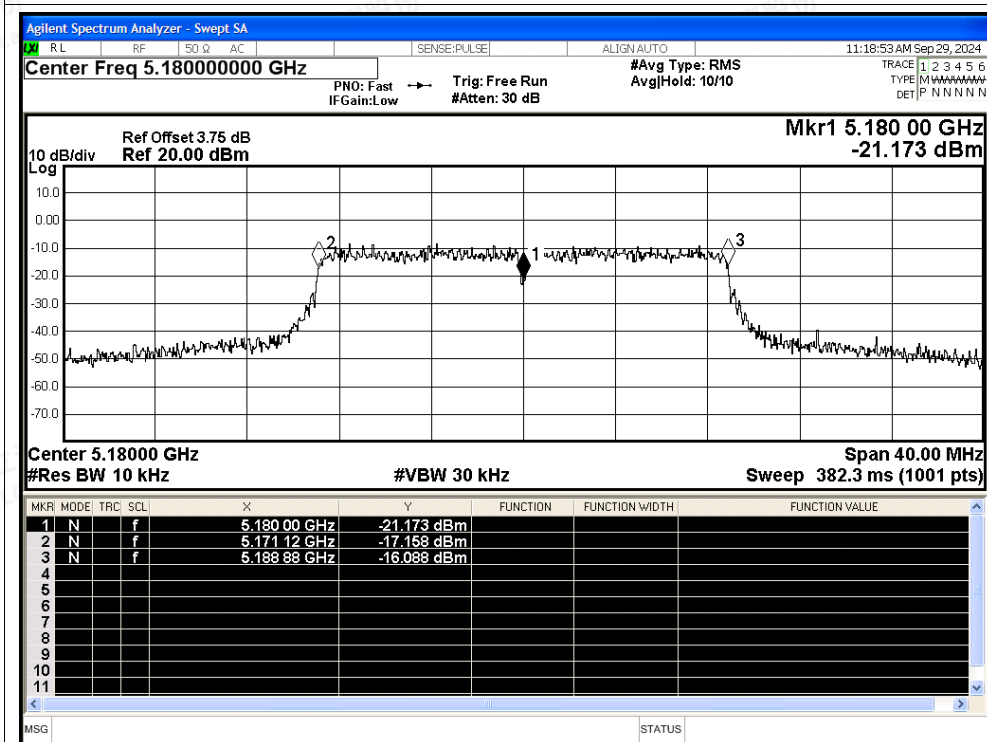

Freq. Stability NVNT ax20 5200MHz Ant1

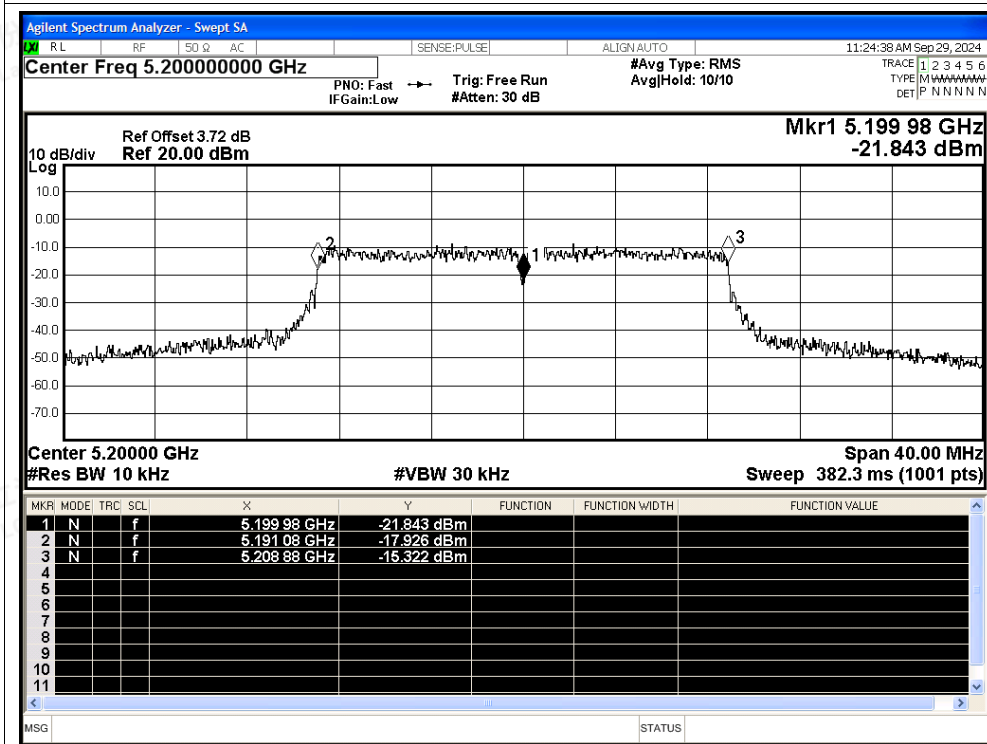

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant1

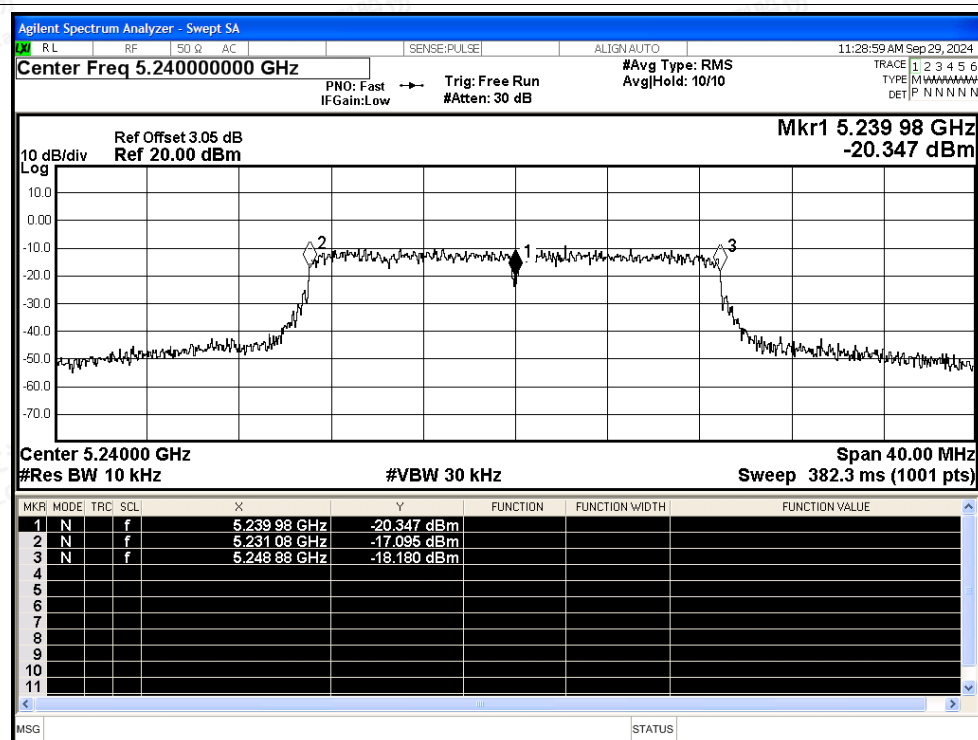

Freq. Stability NVNT ax40 5190MHz Ant1

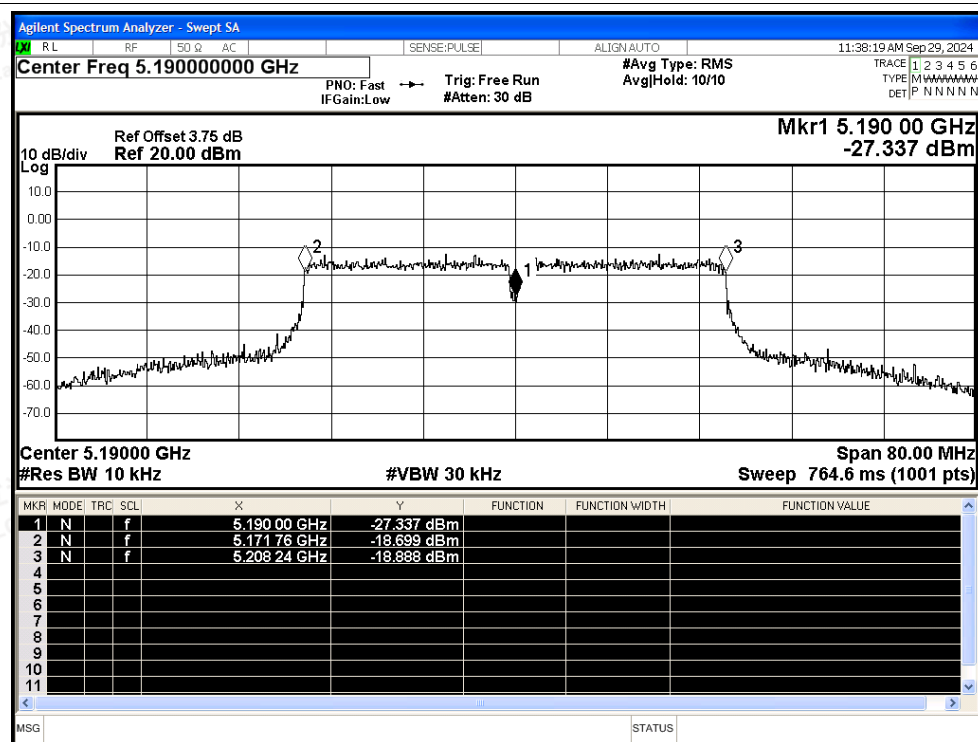

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant1

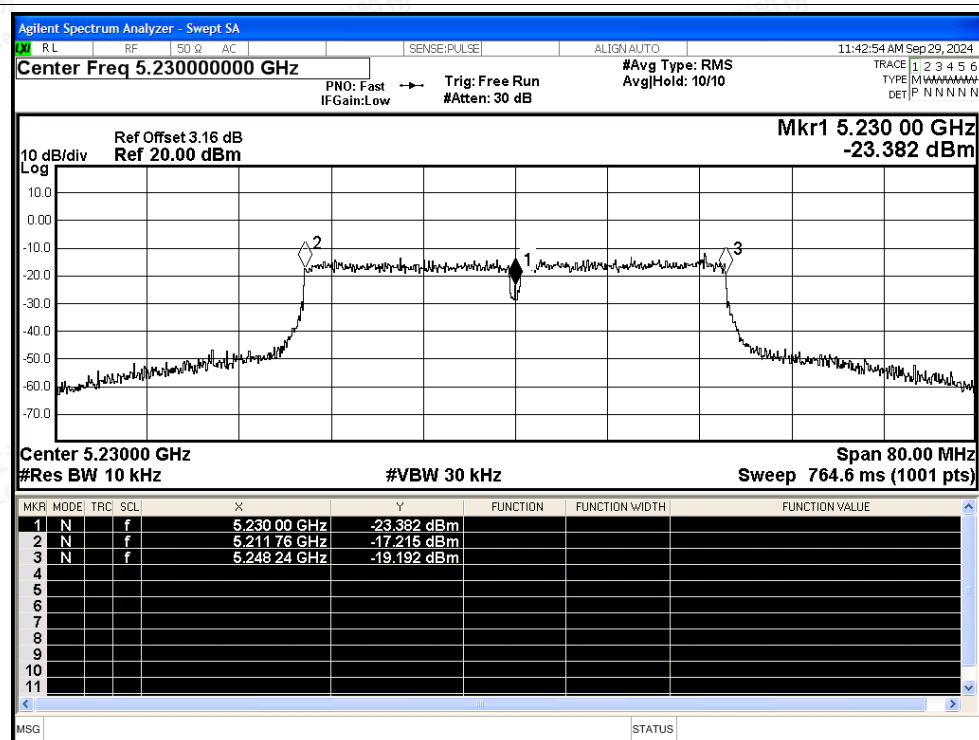

Freq. Stability NVNT ax80 5210MHz Ant1

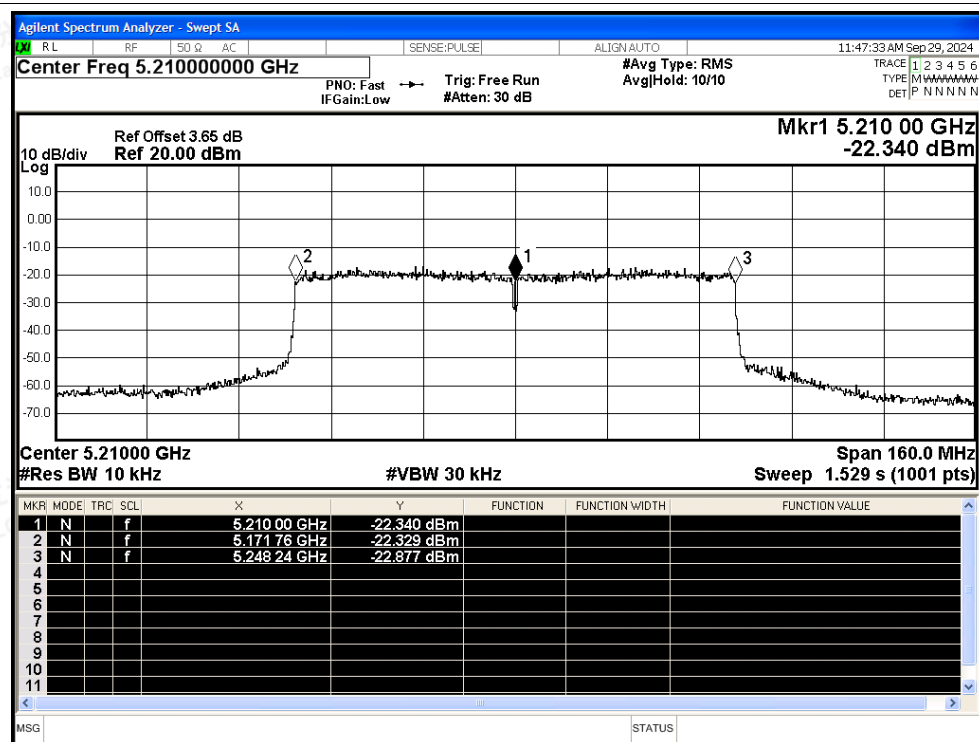

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant0	94.56	0.24	0.91
NVNT	a	5200	Ant0	94.56	0.24	0.91
NVNT	a	5240	Ant0	94.65	0.24	0.91
NVNT	n20	5180	Ant0	93.77	0.28	1.07
NVNT	n20	5200	Ant0	93.67	0.28	1.07
NVNT	n20	5240	Ant0	93.67	0.28	1.07
NVNT	n40	5190	Ant0	97.18	0.12	0.46
NVNT	n40	5230	Ant0	97.18	0.12	0.46
NVNT	ac20	5180	Ant0	93.82	0.28	1.06
NVNT	ac20	5200	Ant0	93.72	0.28	1.06
NVNT	ac20	5240	Ant0	93.82	0.28	1.06
NVNT	ac40	5190	Ant0	97.19	0.12	0.46
NVNT	ac40	5230	Ant0	97.24	0.12	0.46
NVNT	ac80	5210	Ant0	94.41	0.25	0.97
NVNT	ax20	5180	Ant0	93.82	0.28	1.06
NVNT	ax20	5200	Ant0	93.72	0.28	1.06
NVNT	ax20	5240	Ant0	93.72	0.28	1.06
NVNT	ax40	5190	Ant0	97.24	0.12	0.46
NVNT	ax40	5230	Ant0	97.19	0.12	0.46
NVNT	ax80	5210	Ant0	94.41	0.25	0.97



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant0

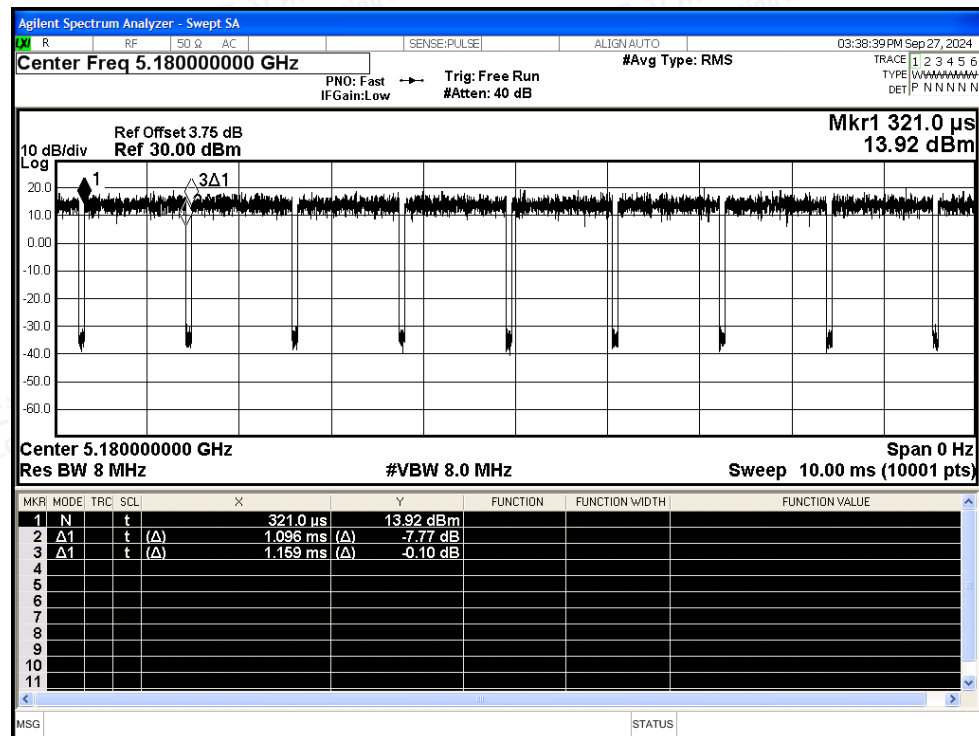

Duty Cycle NVNT a 5200MHz Ant0


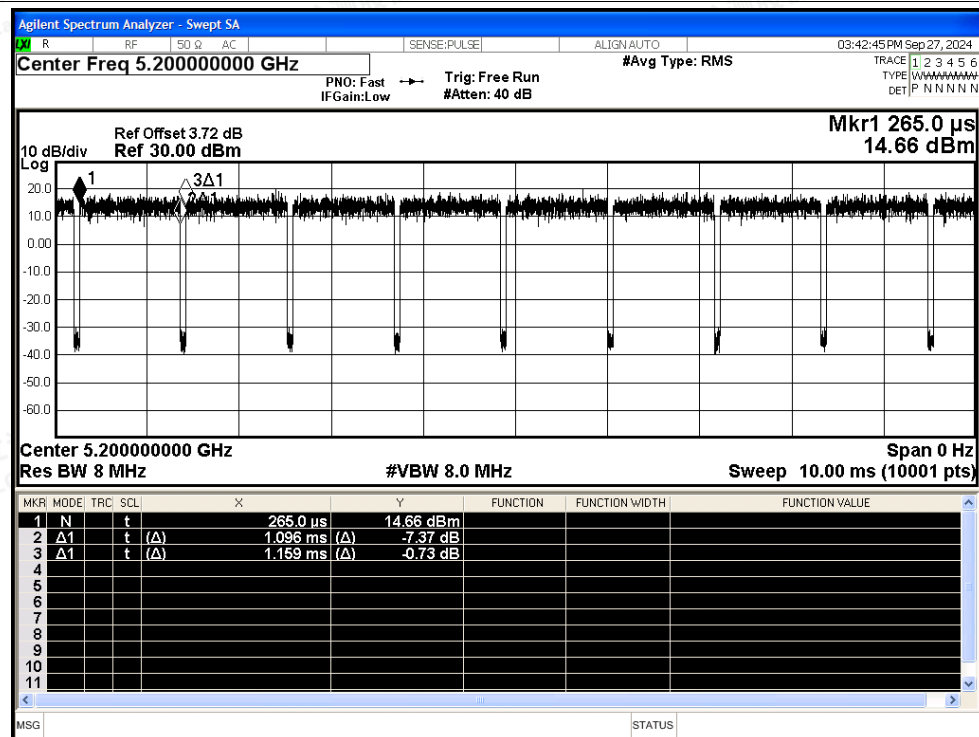


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

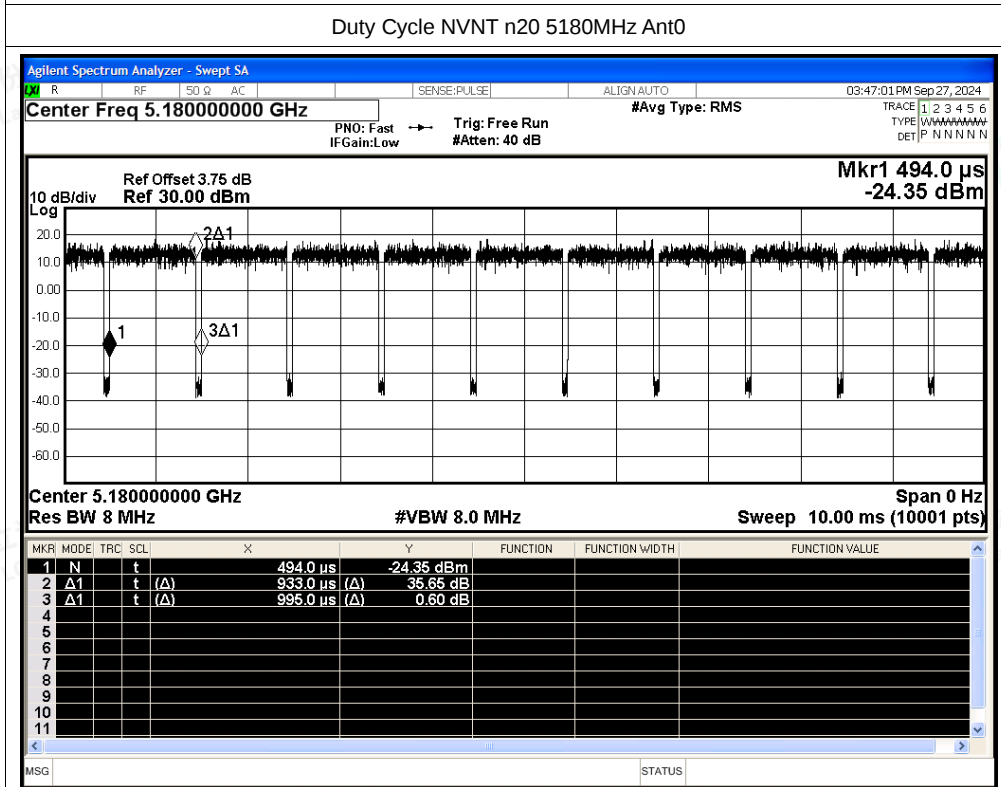
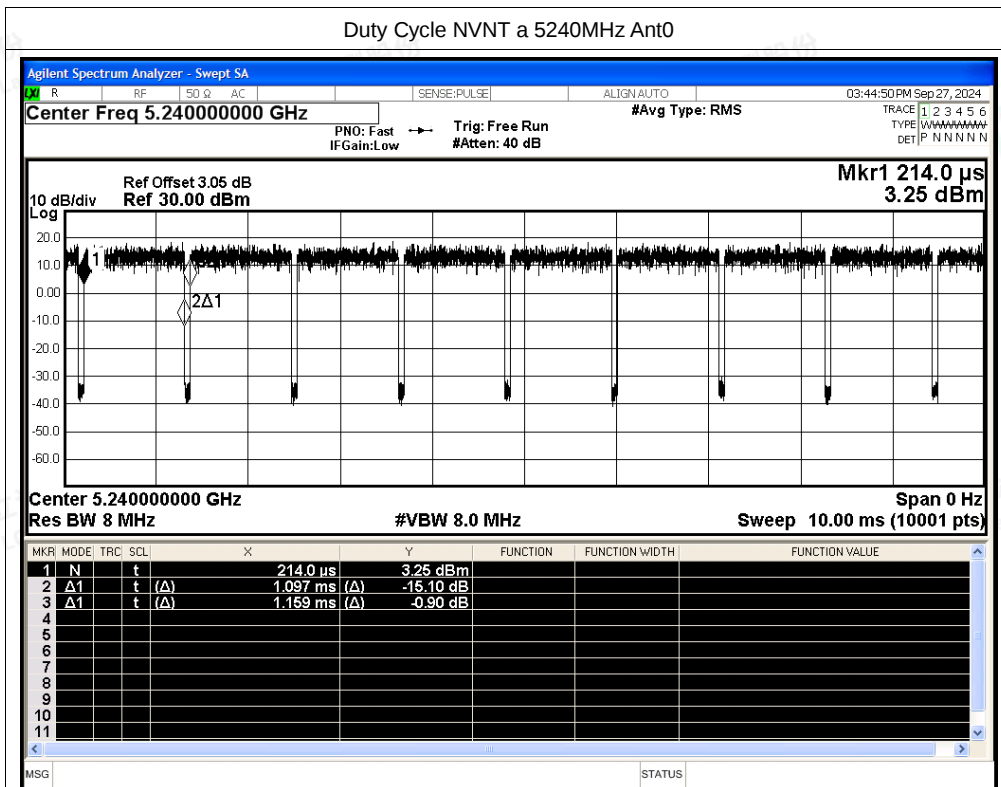


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

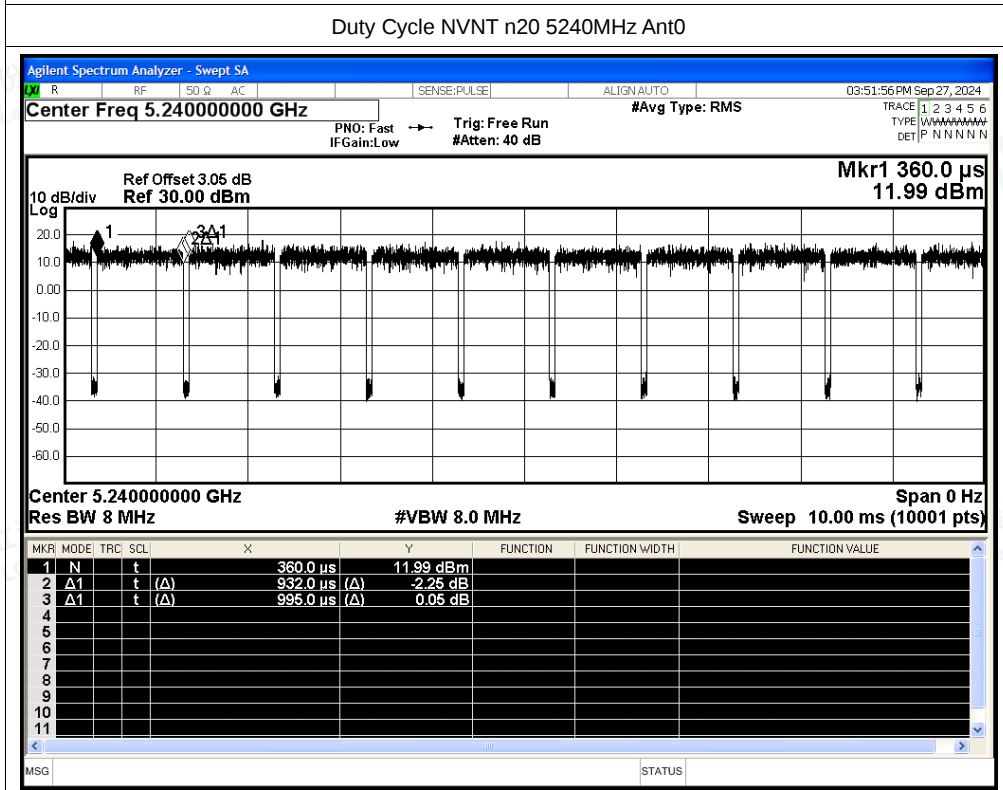
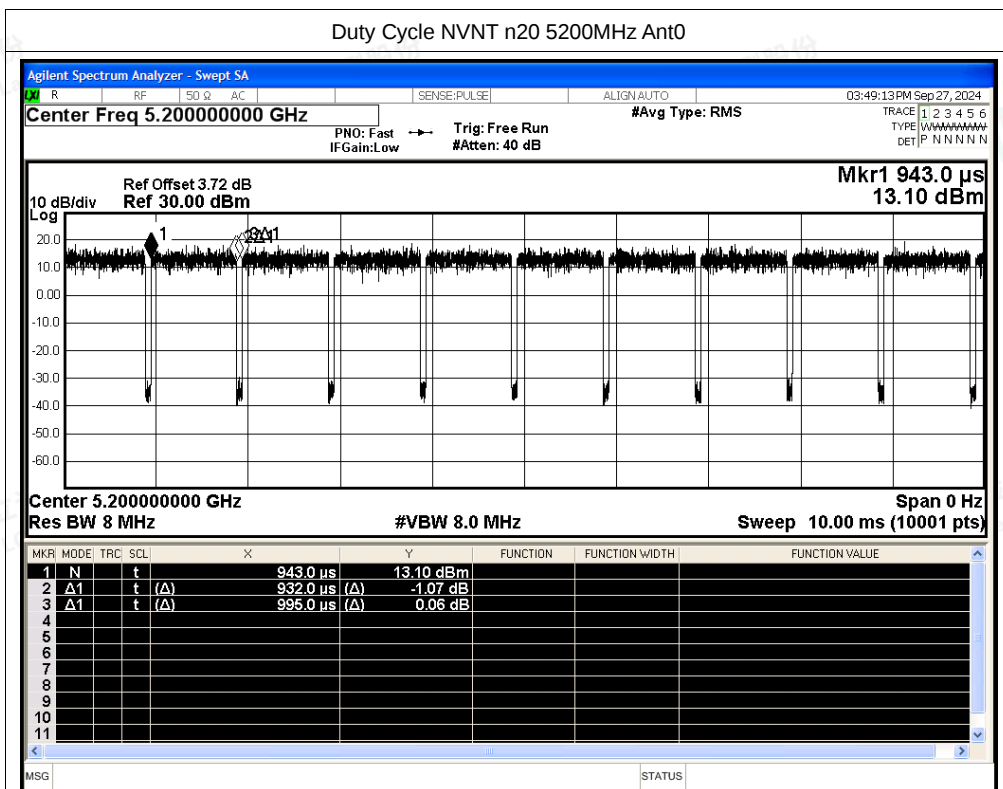


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

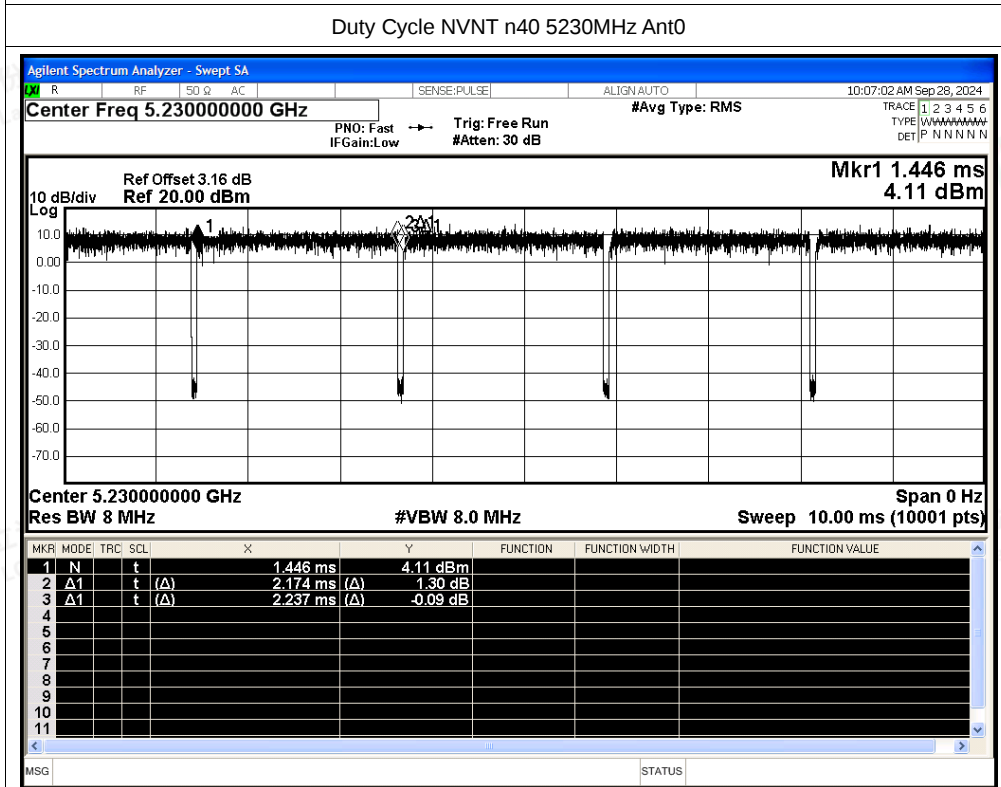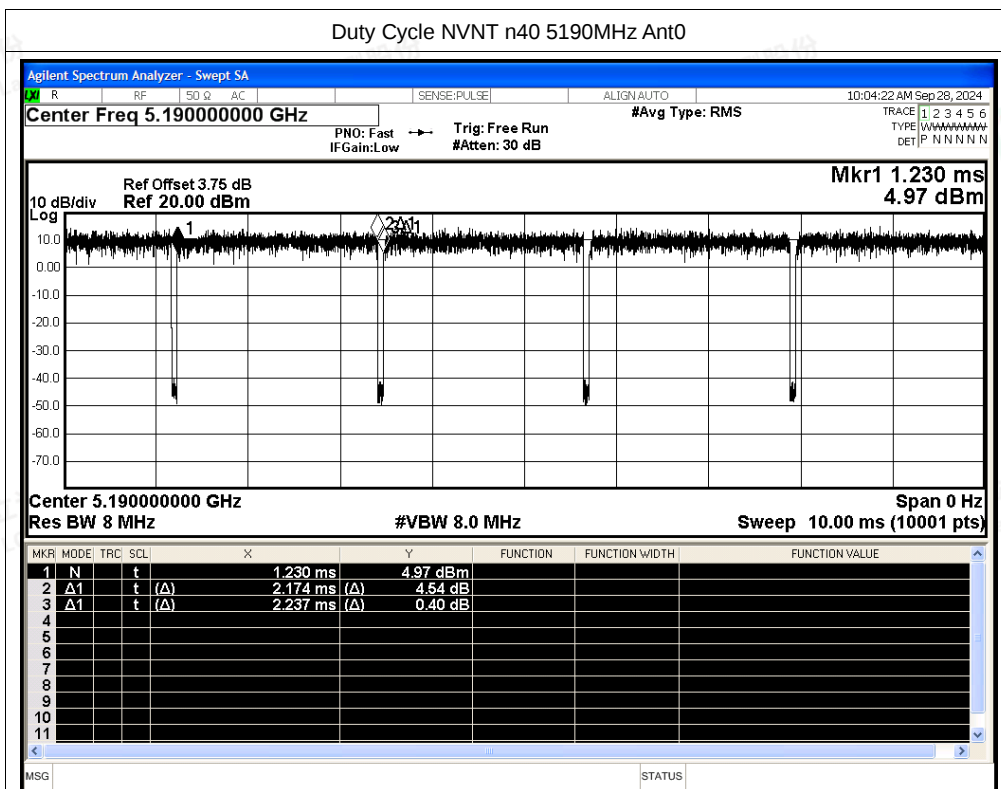

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant0

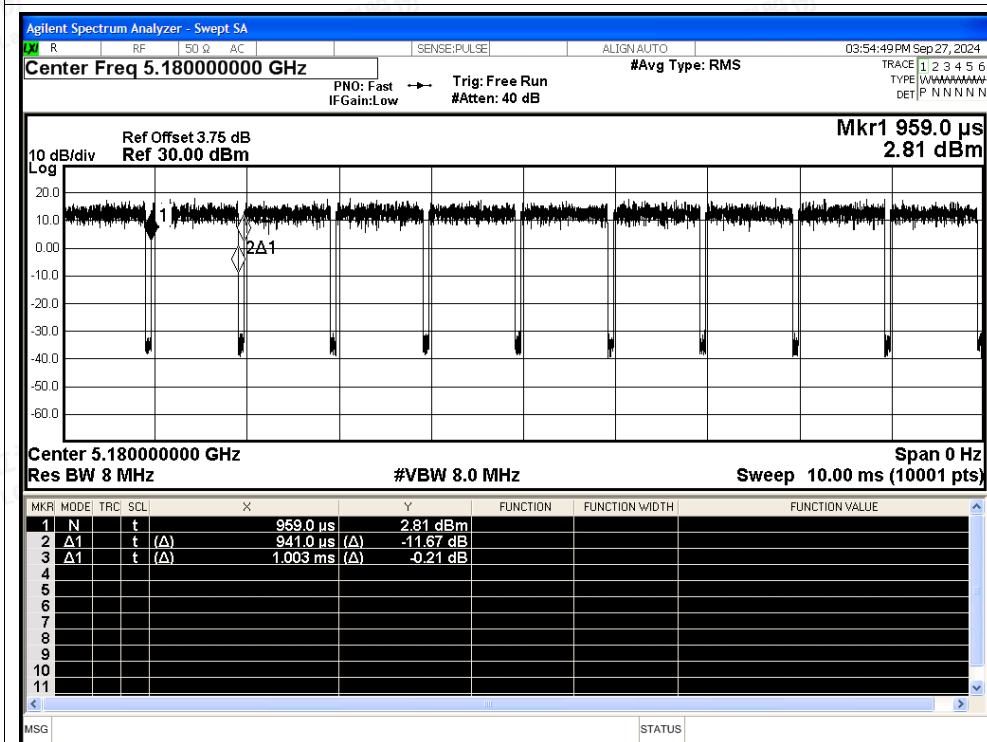

Duty Cycle NVNT ac20 5200MHz Ant0

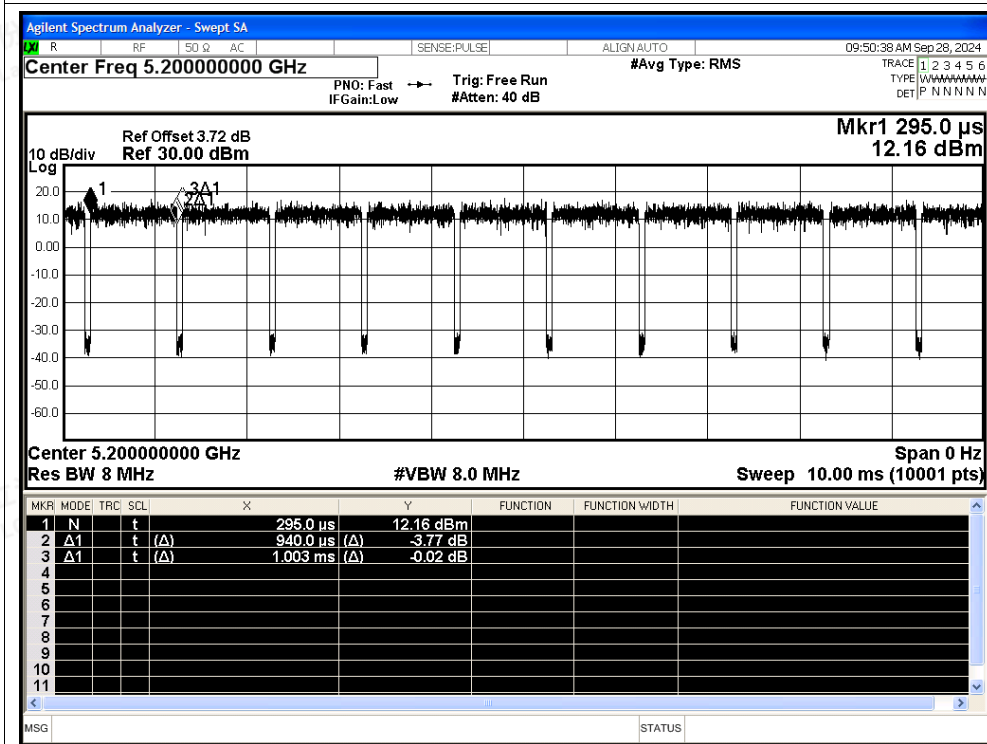

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant0

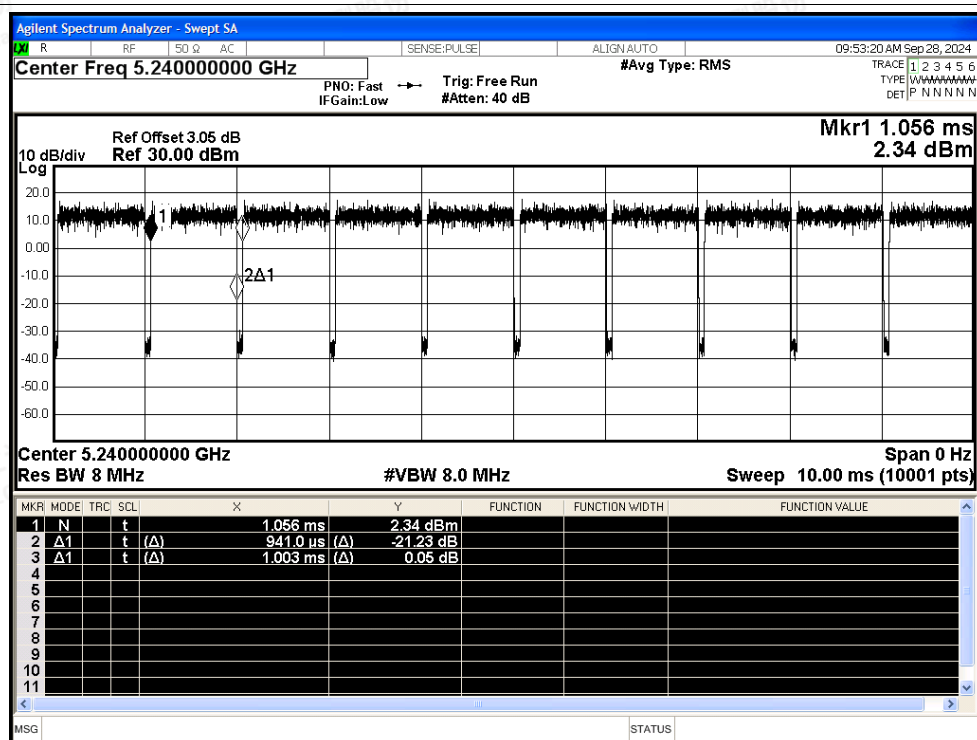

Duty Cycle NVNT ac40 5190MHz Ant0

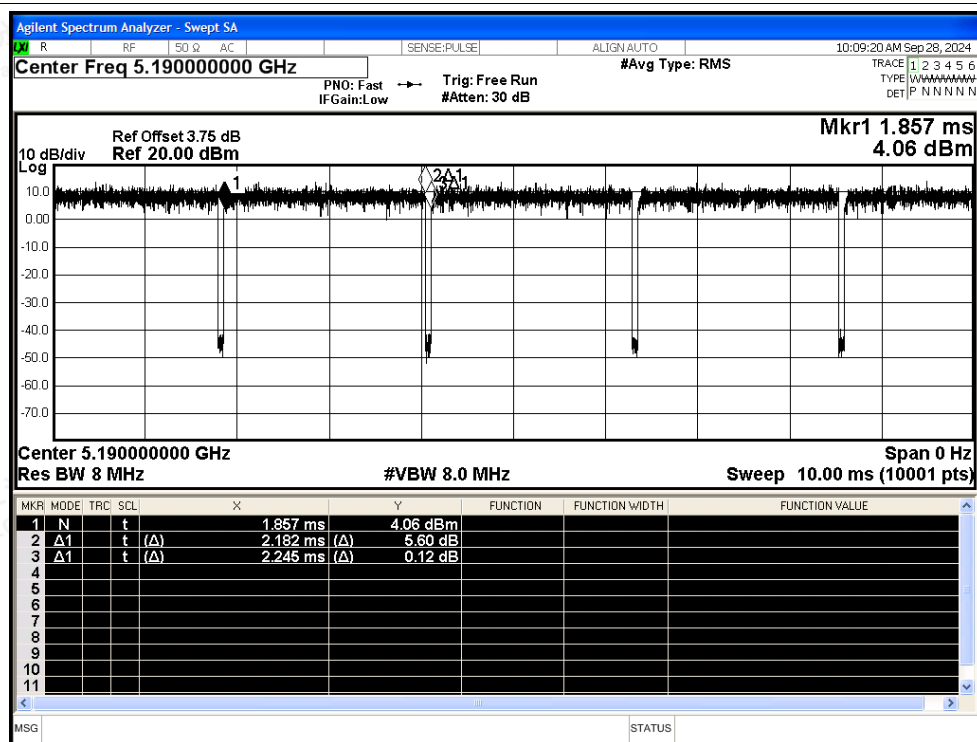

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant0

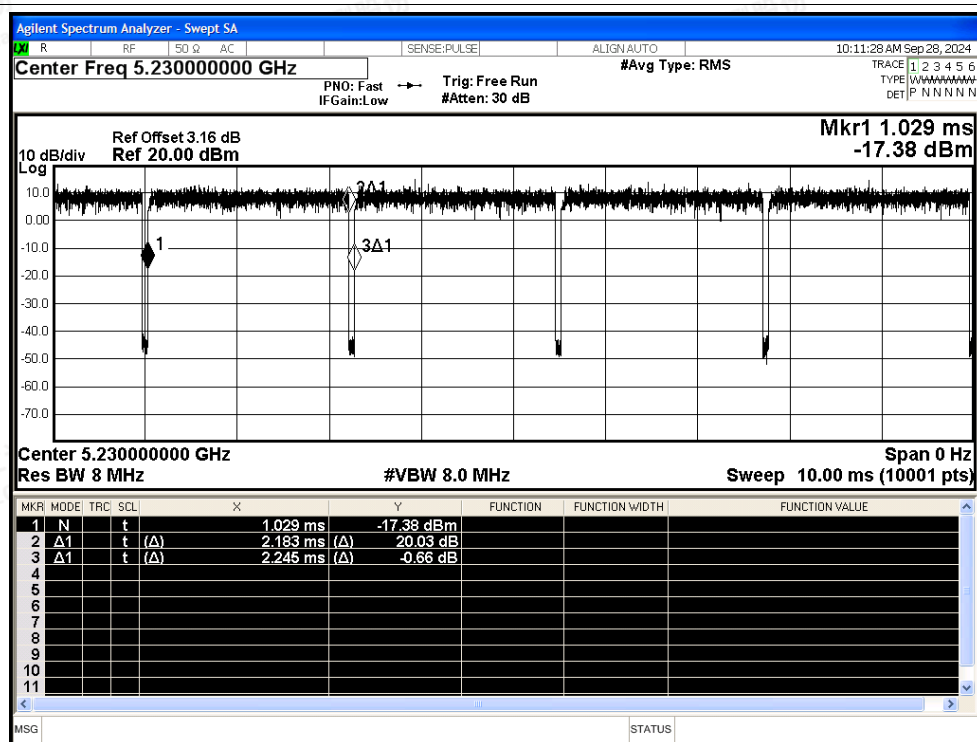

Duty Cycle NVNT ac80 5210MHz Ant0

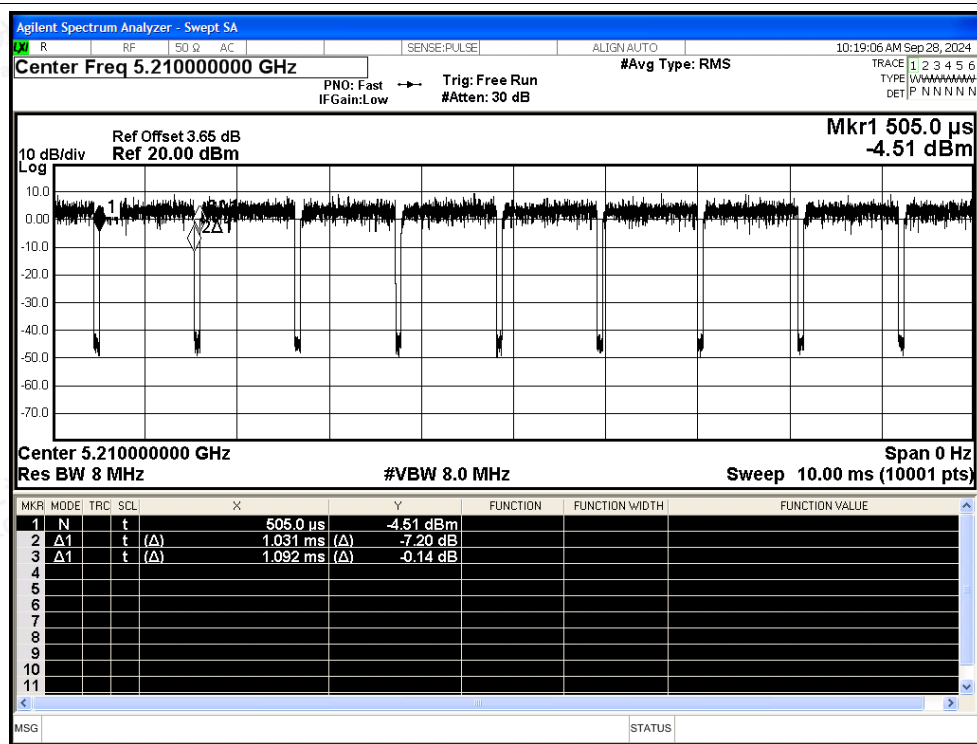

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant0

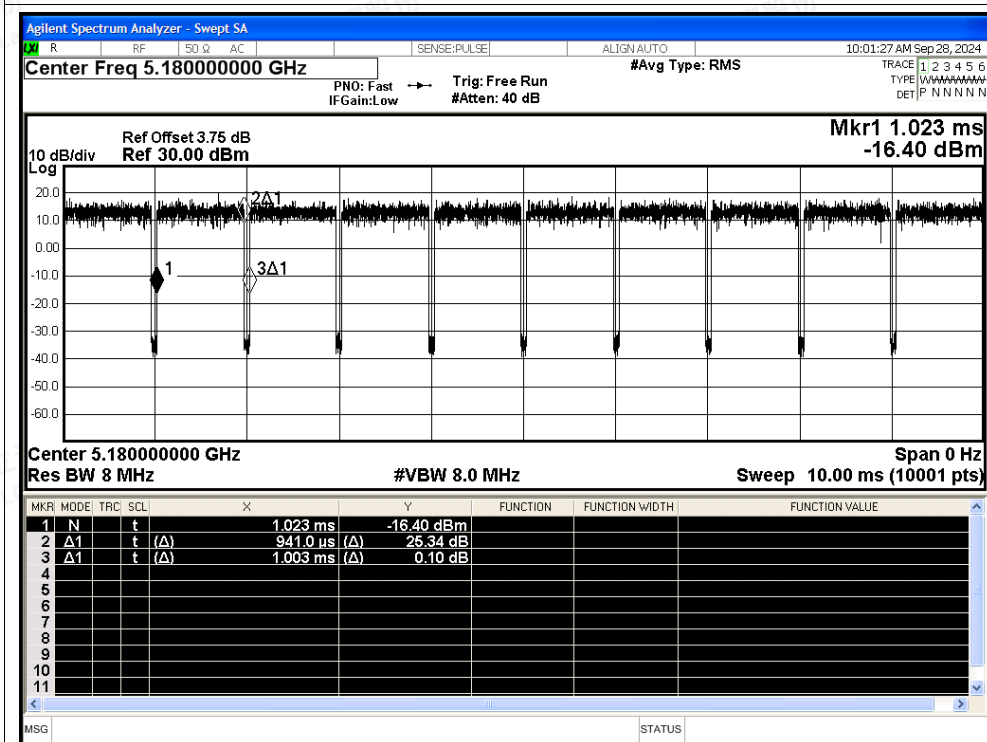

Duty Cycle NVNT ax20 5200MHz Ant0

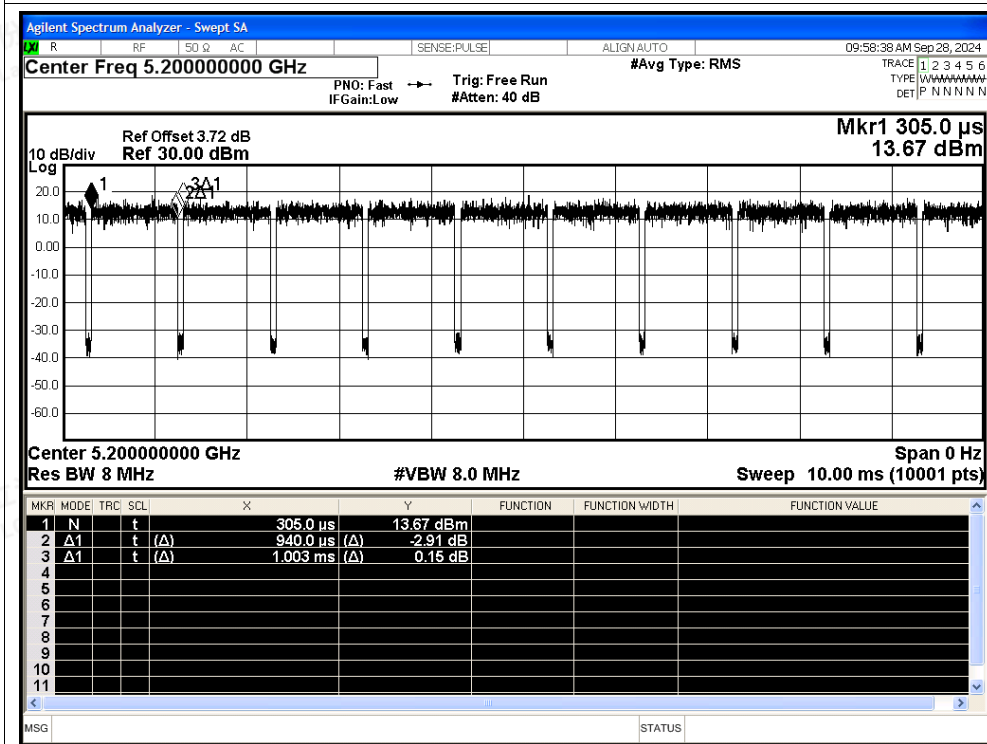

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant0

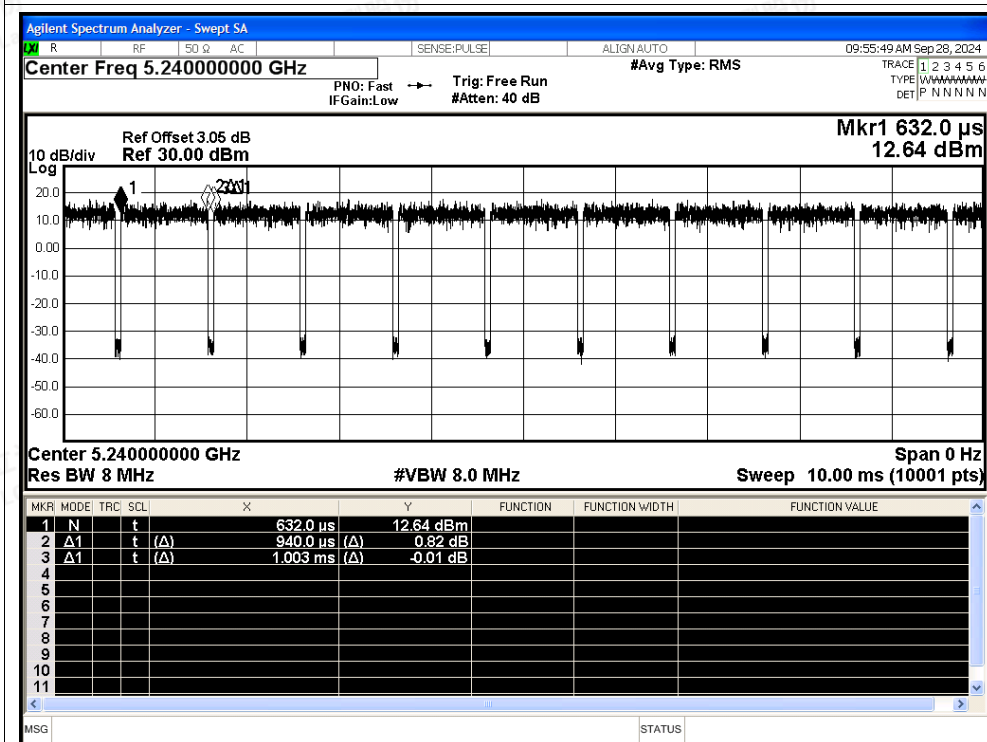

Duty Cycle NVNT ax40 5190MHz Ant0

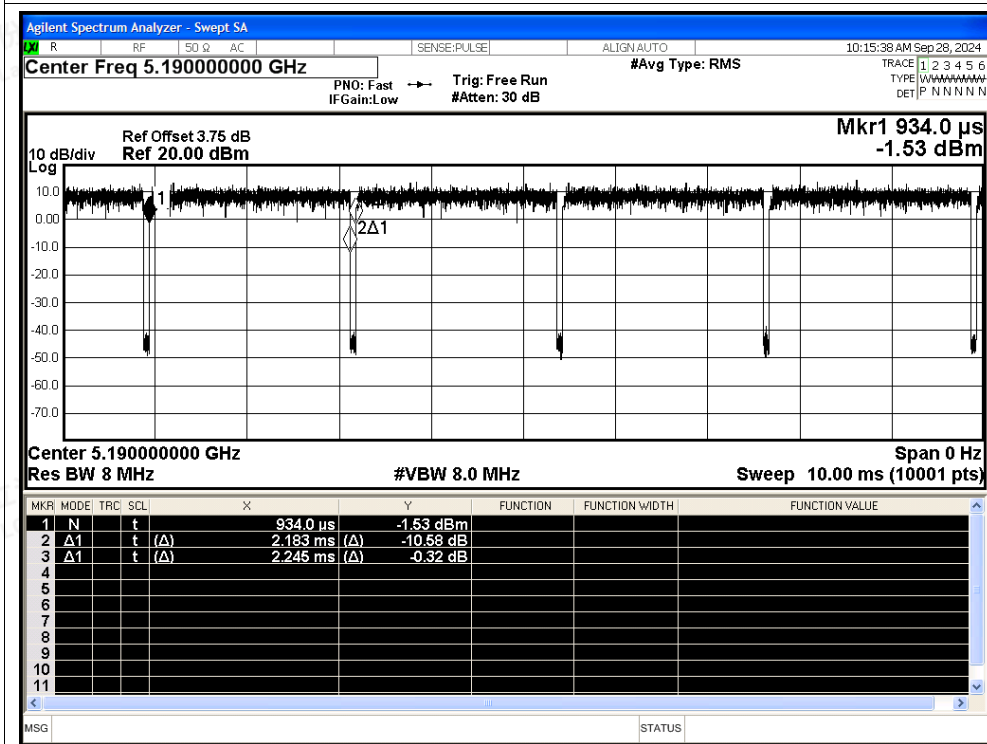

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant0

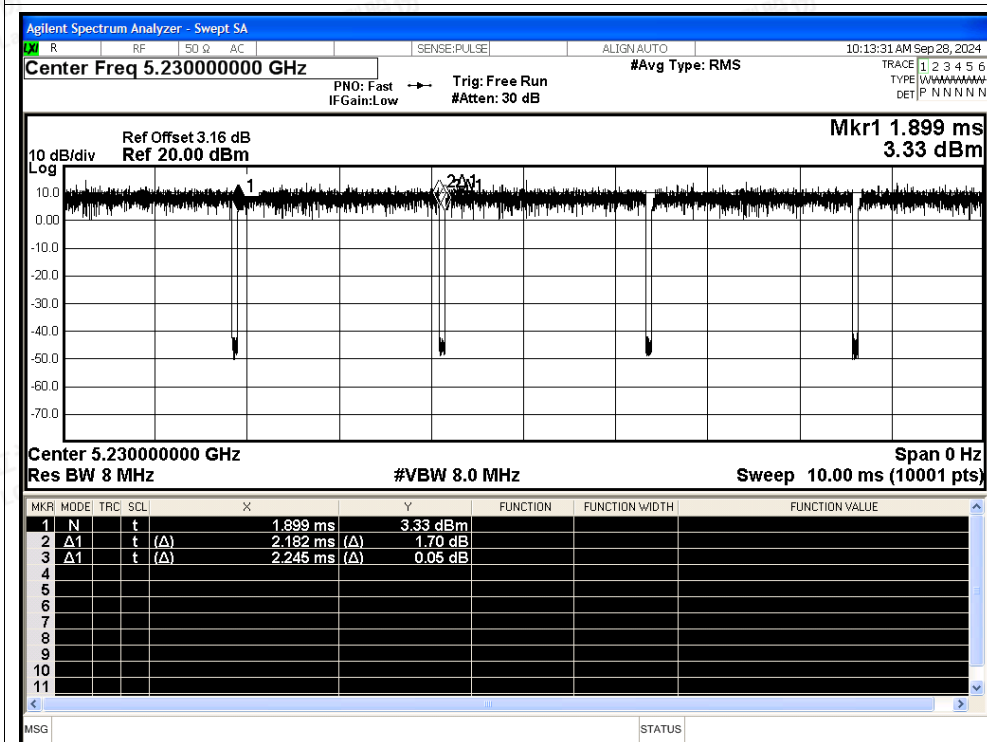

Duty Cycle NVNT ax80 5210MHz Ant0

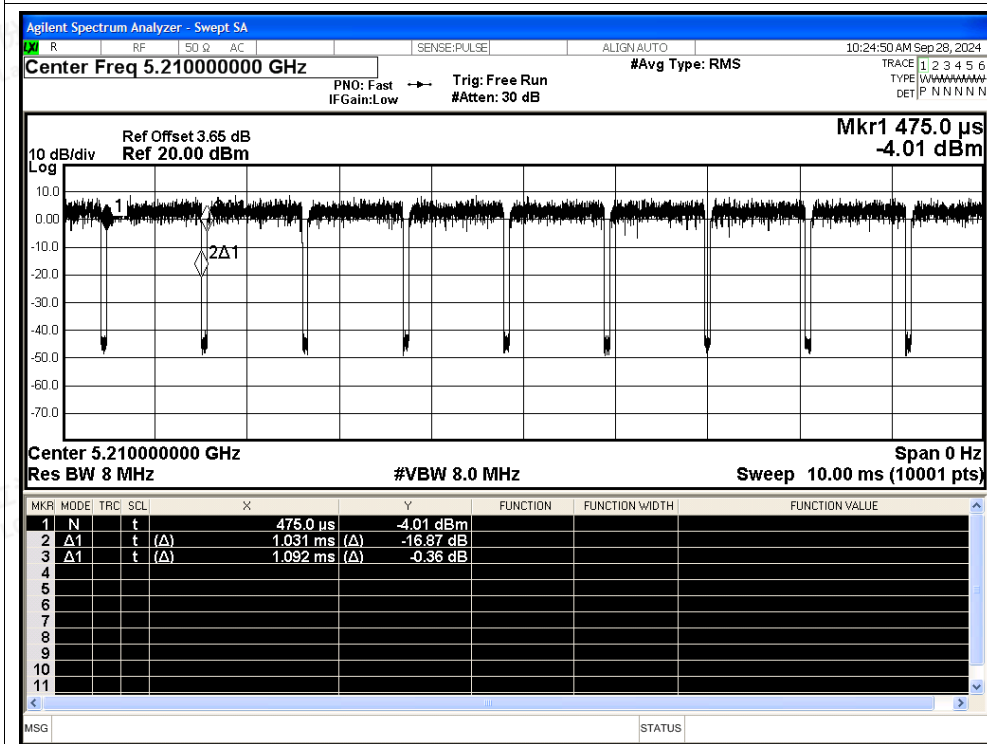

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.65	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	93.77	0.28	1.07
NVNT	n20	5200	Ant1	93.67	0.28	1.07
NVNT	n20	5240	Ant1	93.77	0.28	1.07
NVNT	n40	5190	Ant1	97.23	0.12	0.46
NVNT	n40	5230	Ant1	97.23	0.12	0.46
NVNT	ac20	5180	Ant1	93.72	0.28	1.06
NVNT	ac20	5200	Ant1	93.72	0.28	1.06
NVNT	ac20	5240	Ant1	93.72	0.28	1.06
NVNT	ac40	5190	Ant1	97.19	0.12	0.46
NVNT	ac40	5230	Ant1	97.19	0.12	0.46
NVNT	ac80	5210	Ant1	94.32	0.25	0.97
NVNT	ax20	5180	Ant1	93.72	0.28	1.06
NVNT	ax20	5200	Ant1	93.82	0.28	1.06
NVNT	ax20	5240	Ant1	93.82	0.28	1.06
NVNT	ax40	5190	Ant1	97.19	0.12	0.46
NVNT	ax40	5230	Ant1	97.24	0.12	0.46
NVNT	ax80	5210	Ant1	94.32	0.25	0.97



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

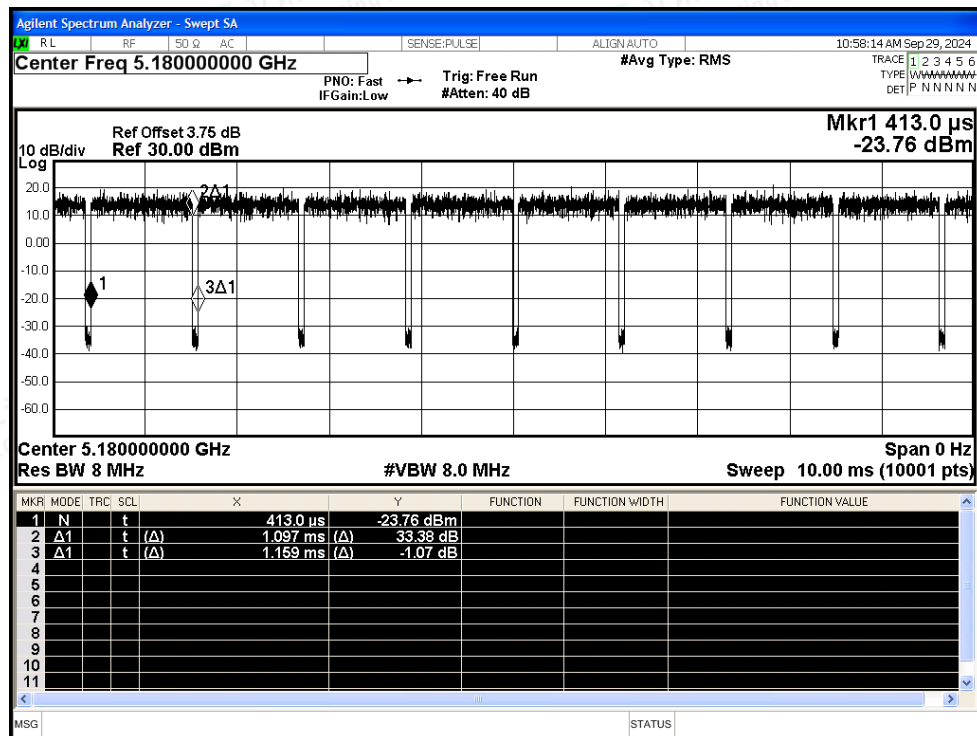

Duty Cycle NVNT a 5200MHz Ant1

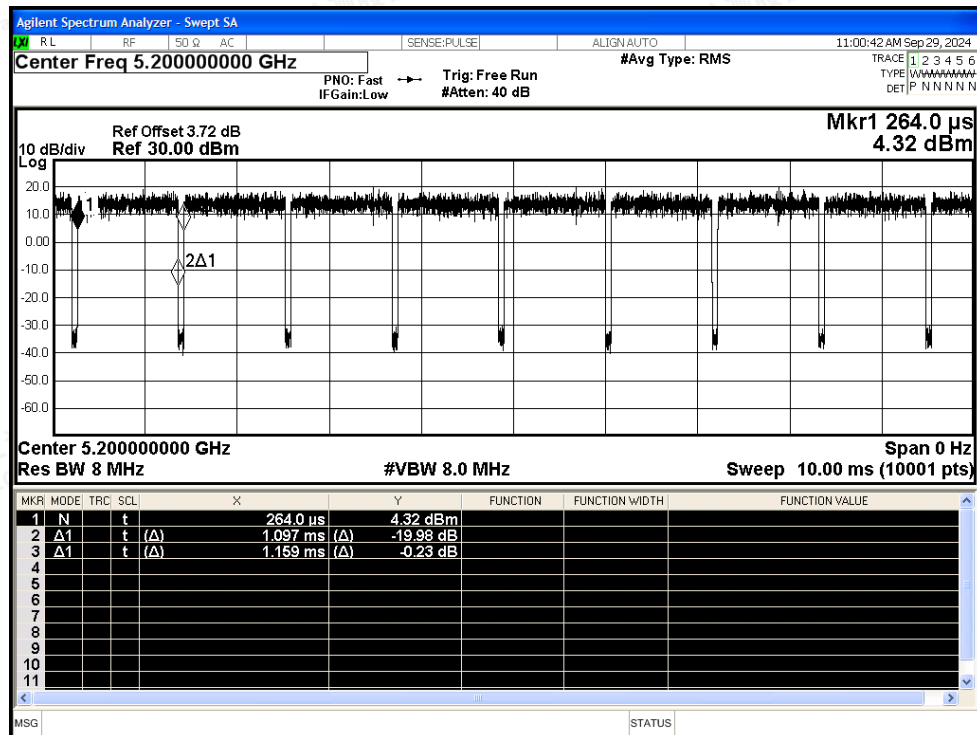

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

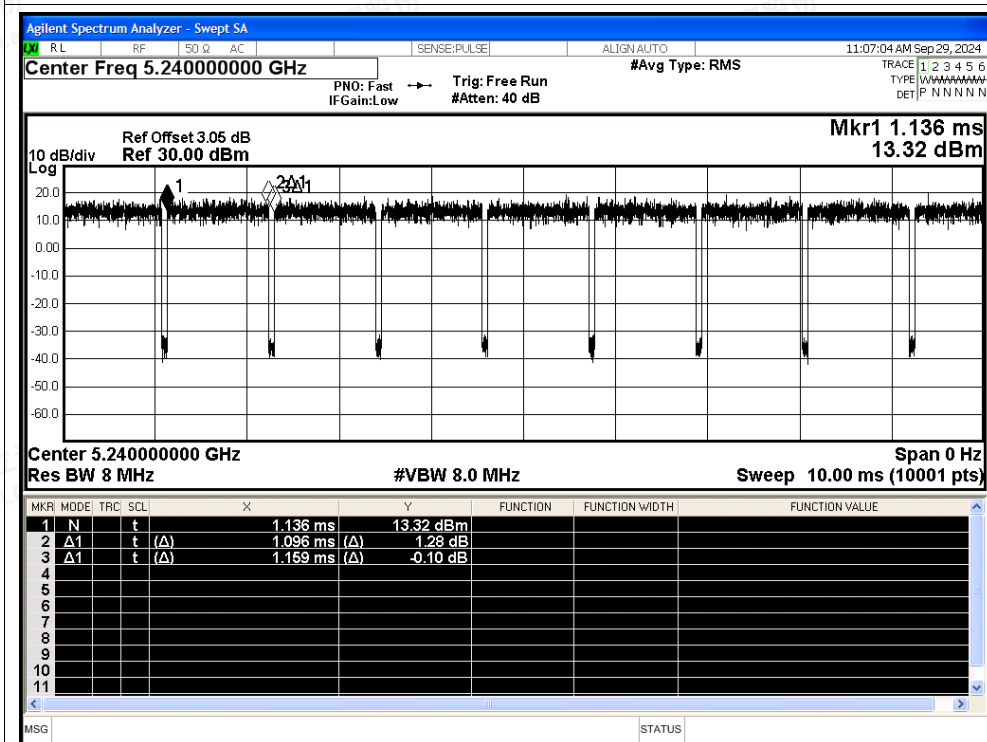

Duty Cycle NVNT n20 5180MHz Ant1


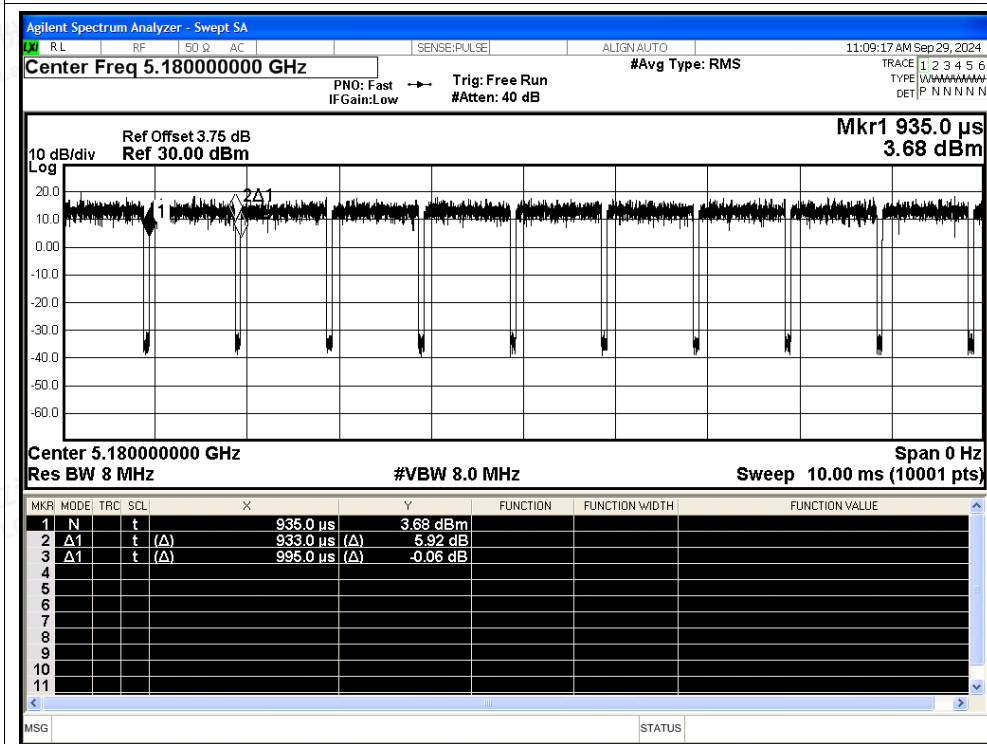


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

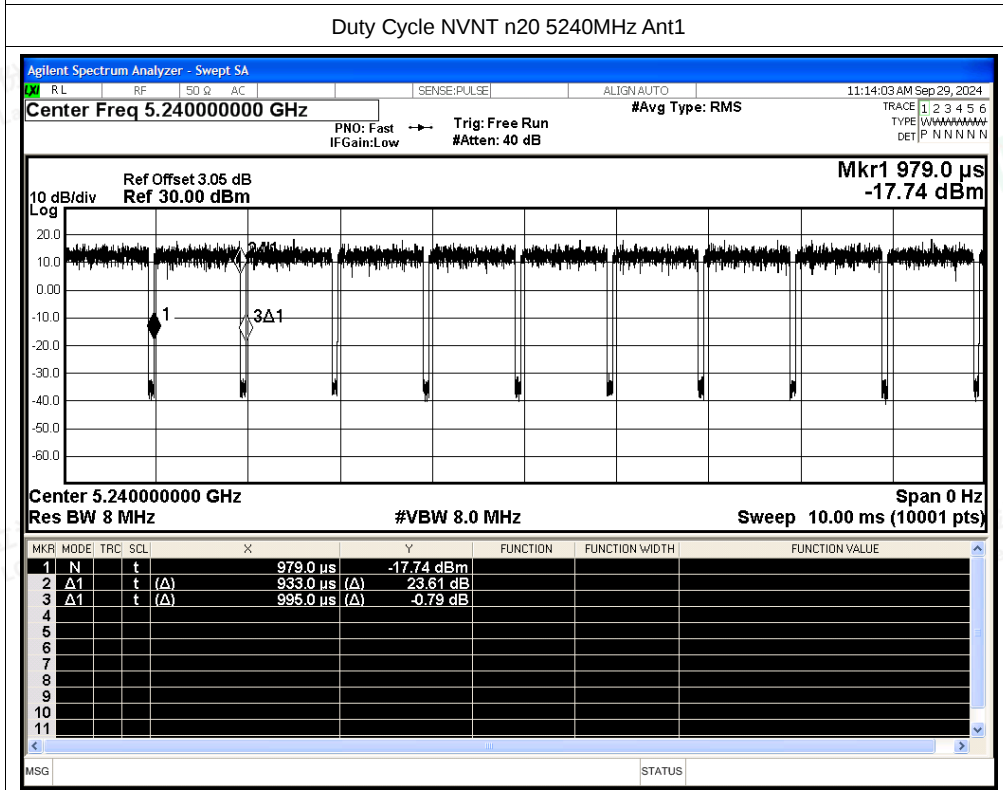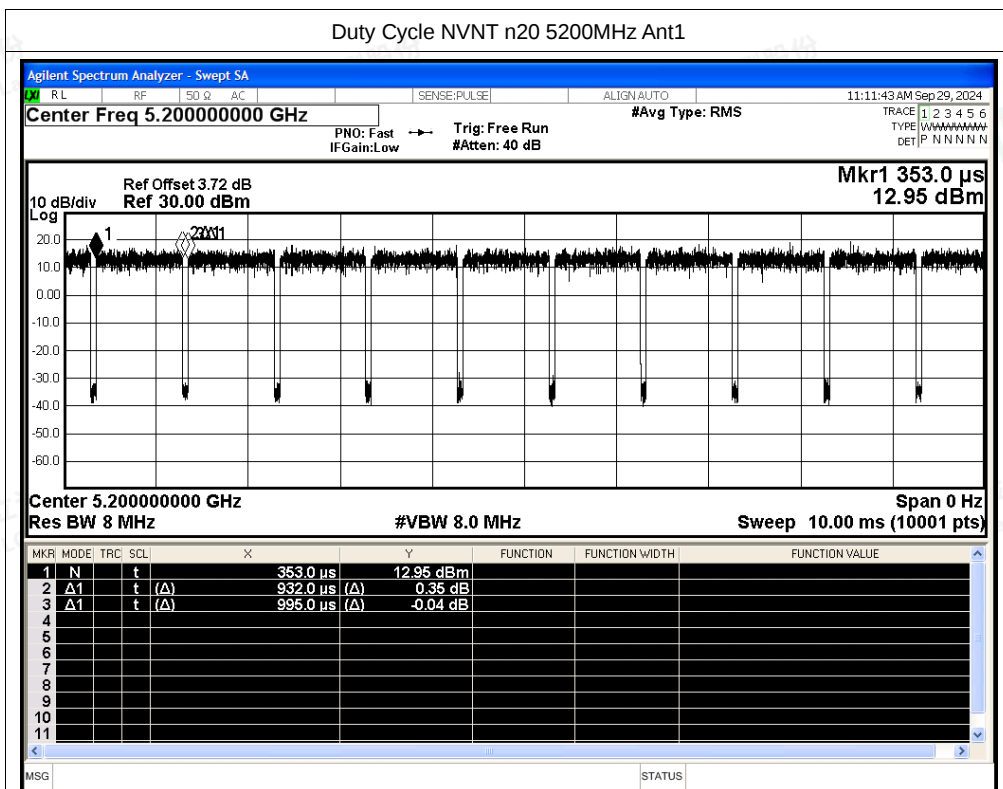

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

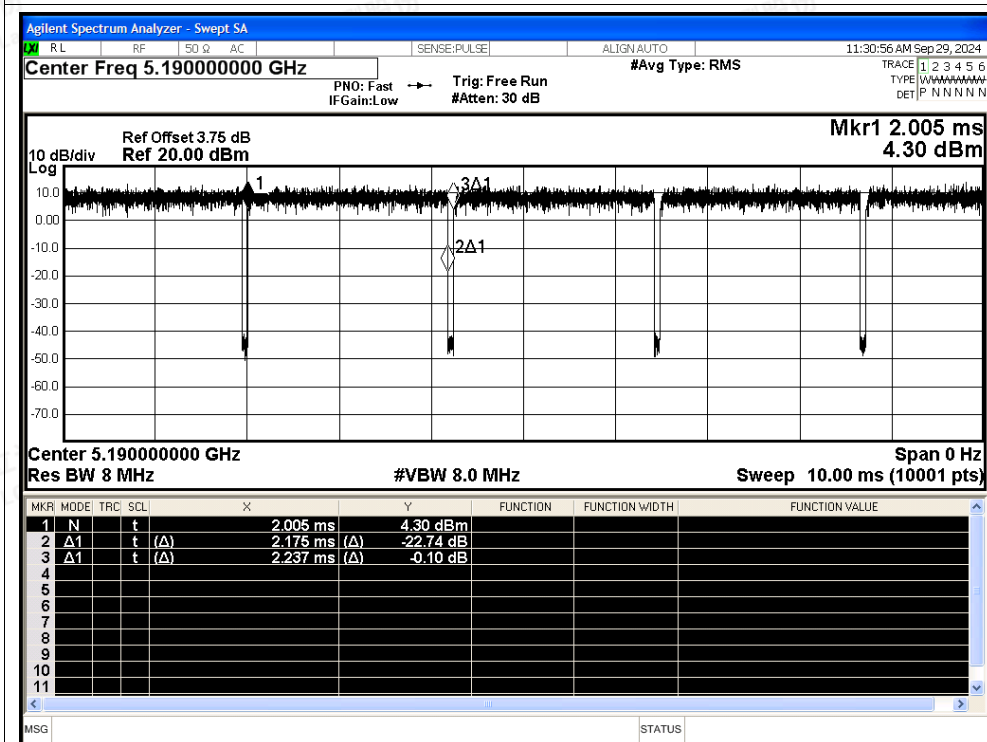

Duty Cycle NVNT n40 5230MHz Ant1

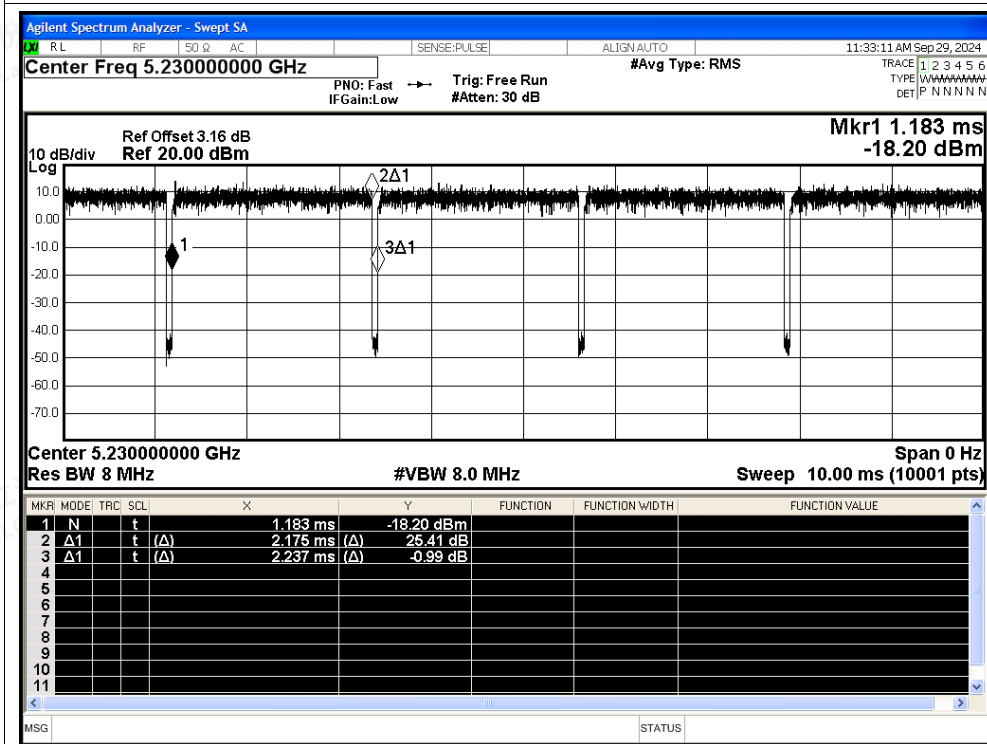

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant1

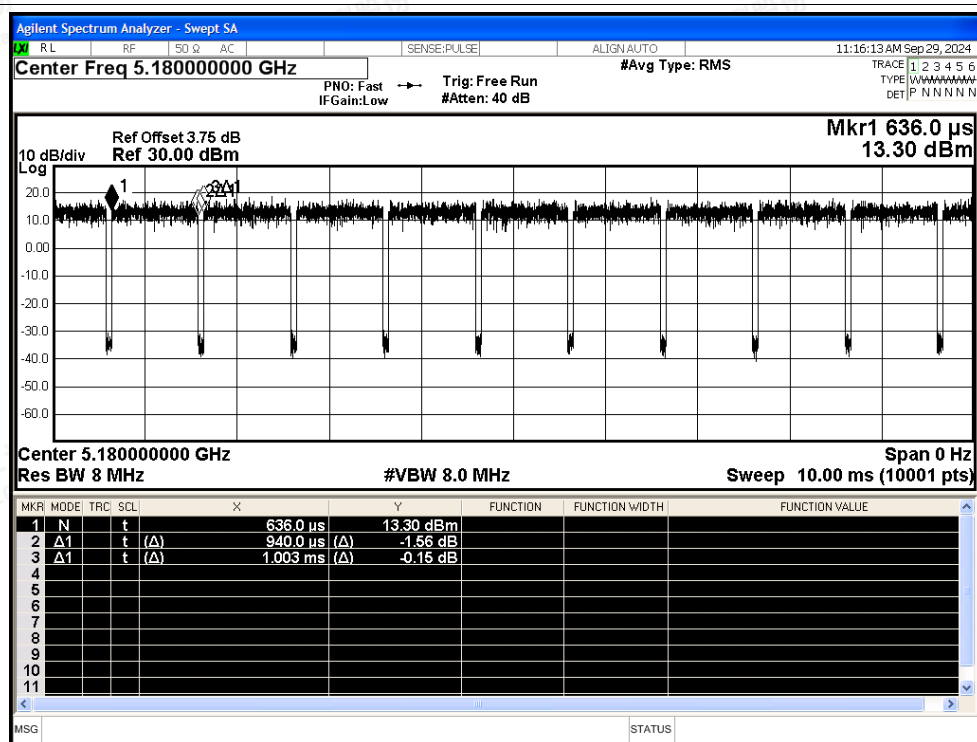

Duty Cycle NVNT ac20 5200MHz Ant1

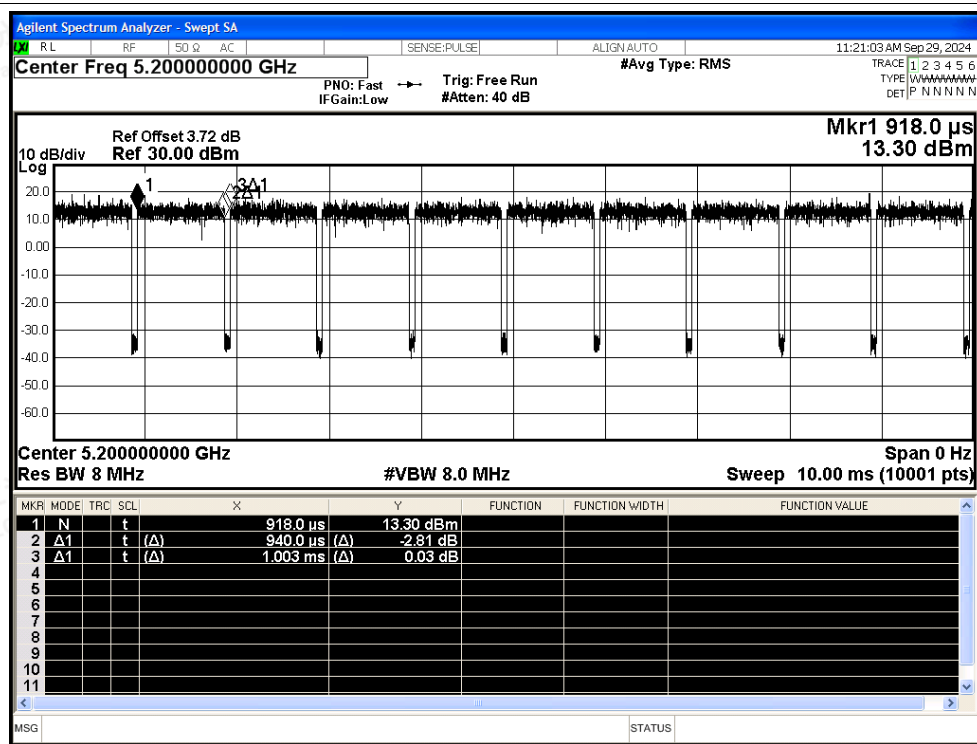

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

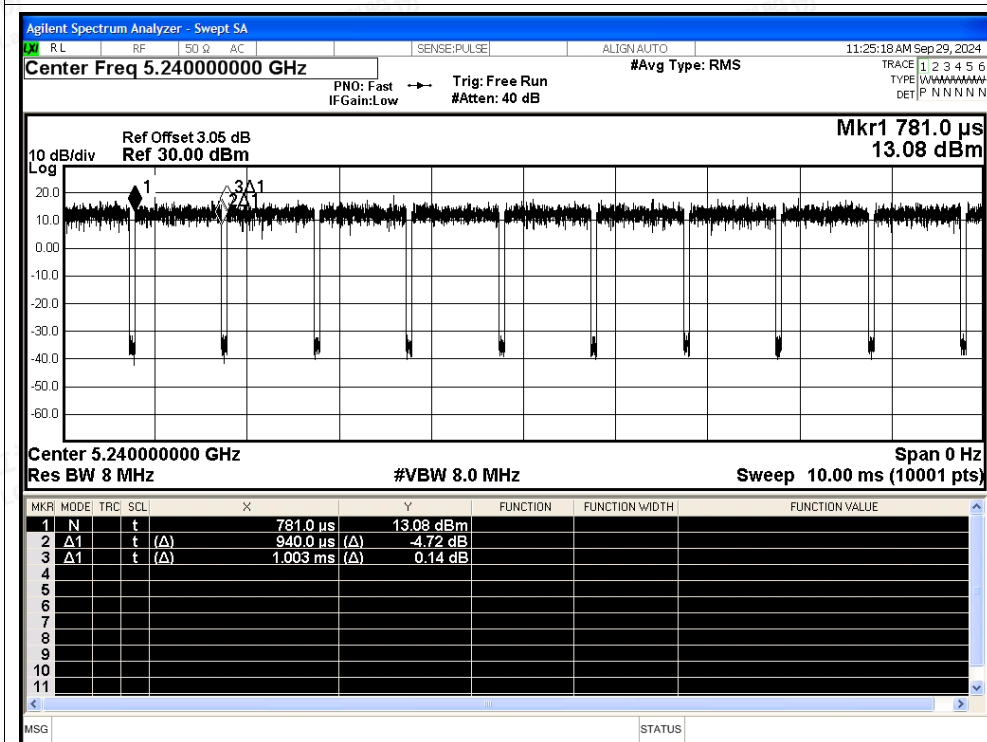

Duty Cycle NVNT ac40 5190MHz Ant1

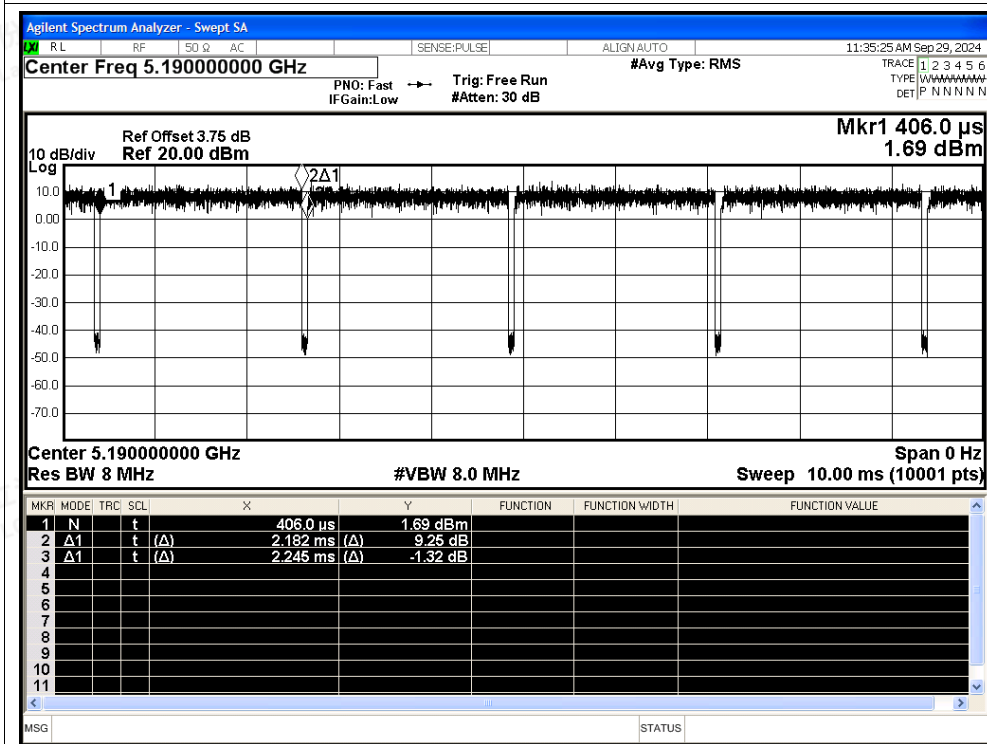

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

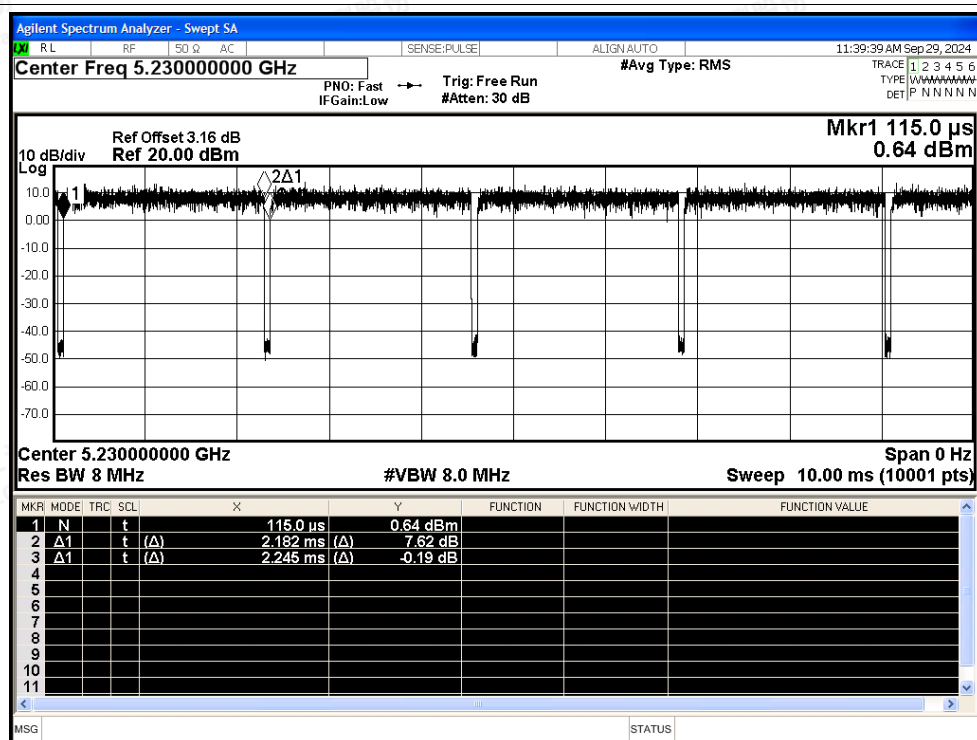

Duty Cycle NVNT ac80 5210MHz Ant1

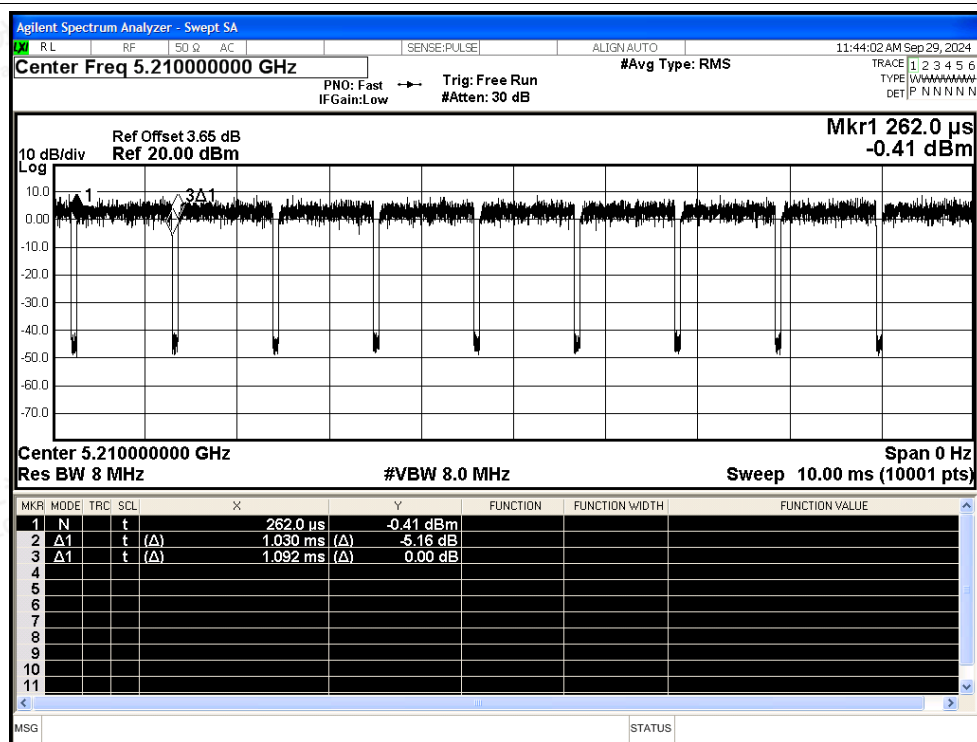

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant1

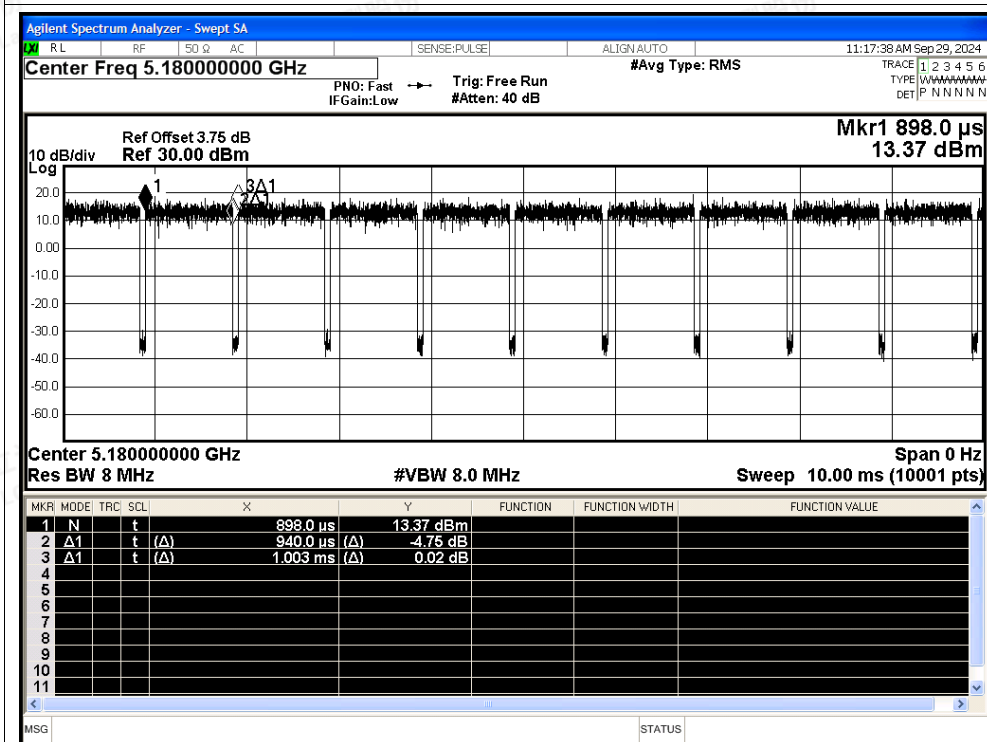

Duty Cycle NVNT ax20 5200MHz Ant1

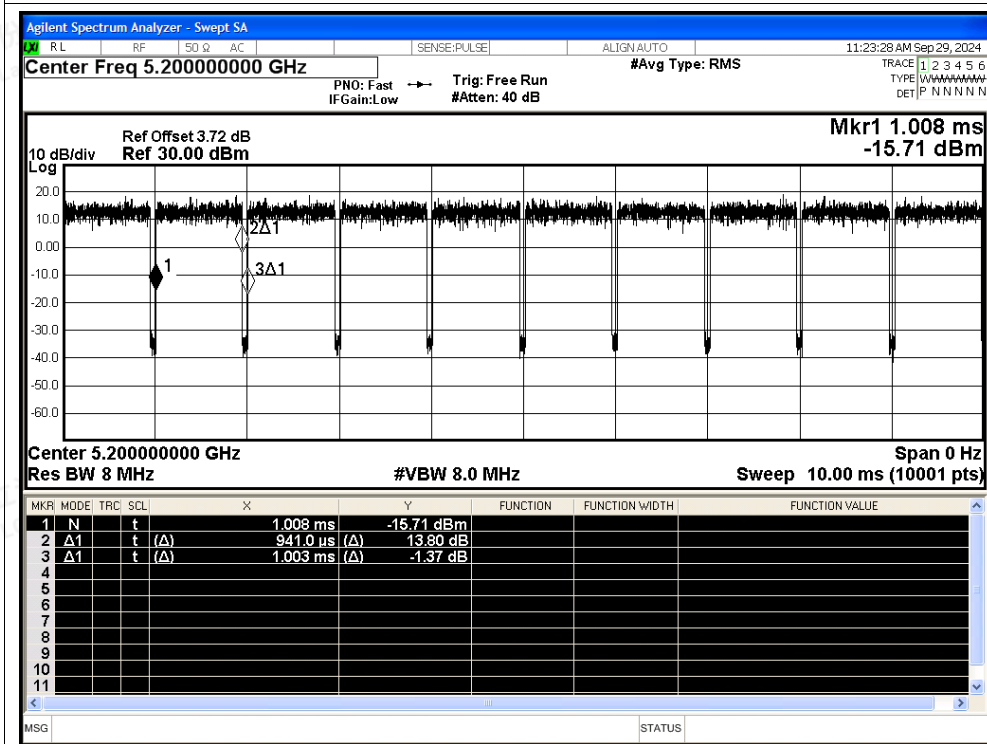

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant1

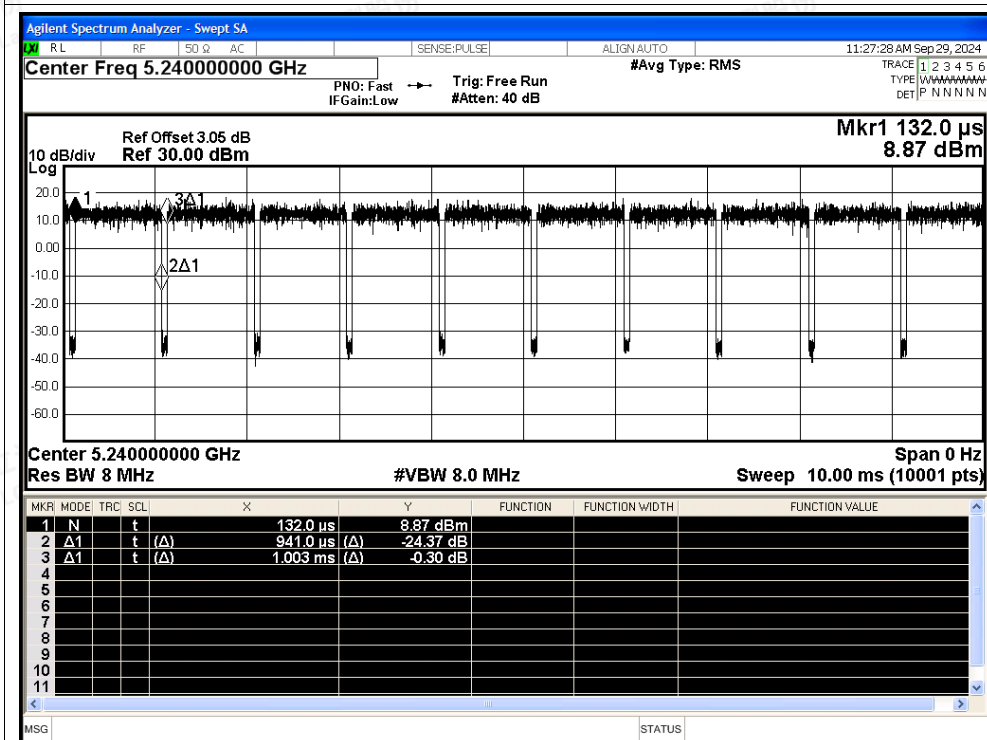

Duty Cycle NVNT ax40 5190MHz Ant1

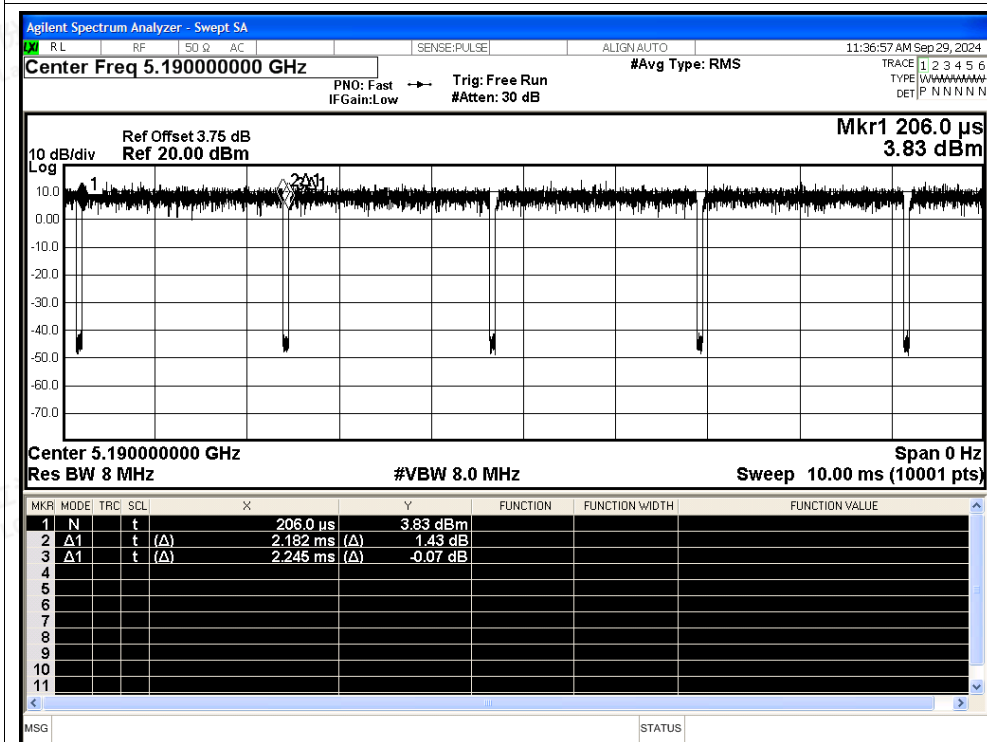

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant1

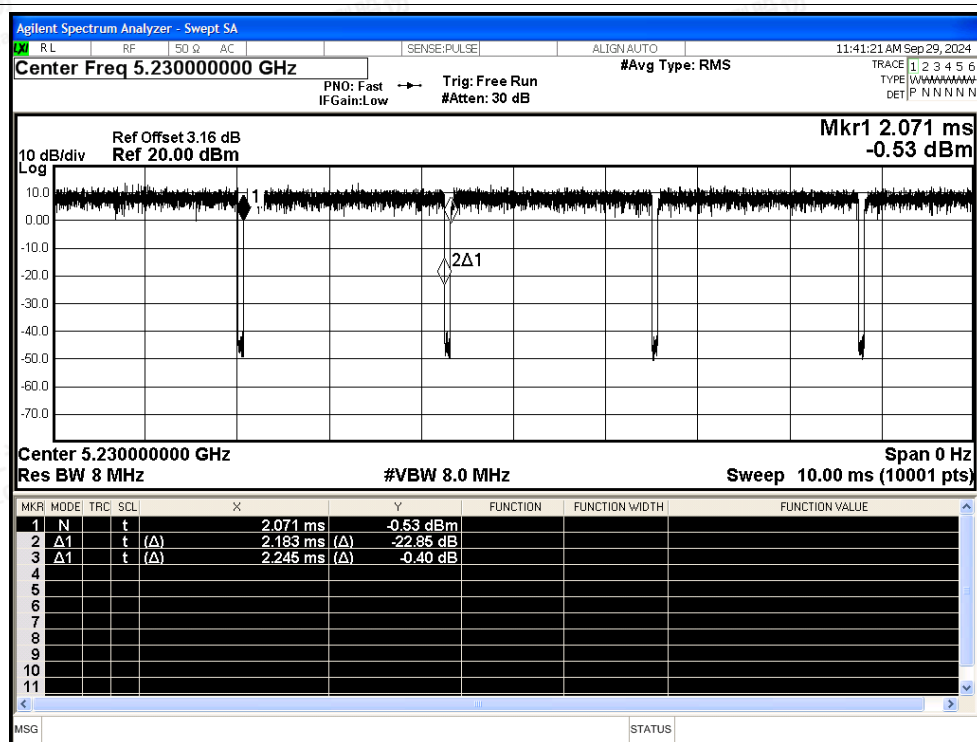

Duty Cycle NVNT ax80 5210MHz Ant1

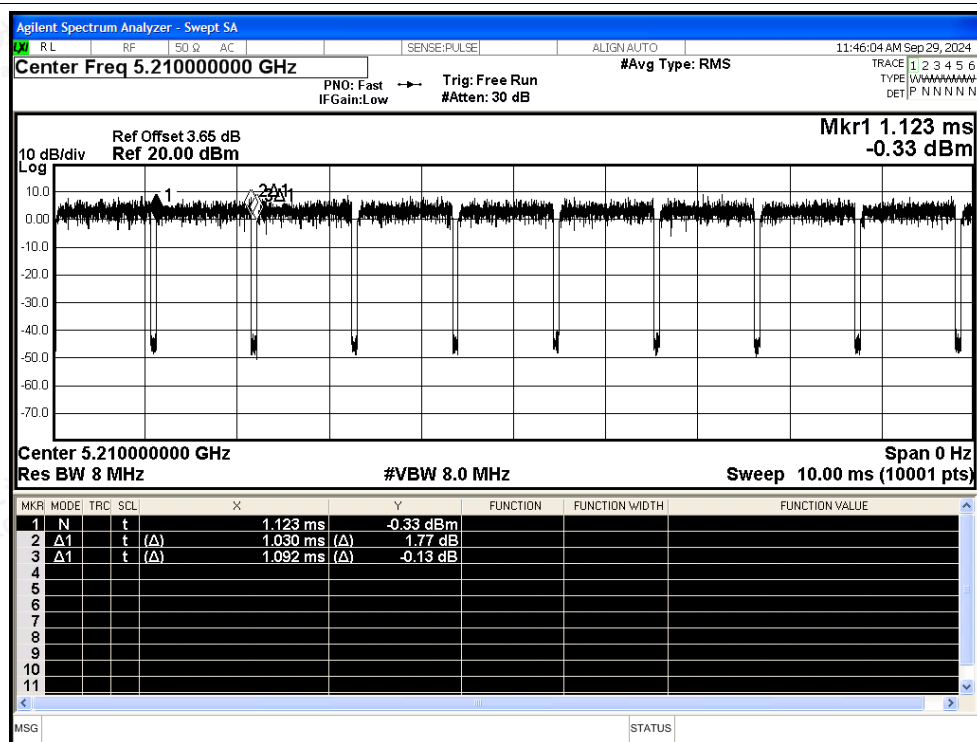

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity