


4.2 Test Graph

4.2.1 PSD

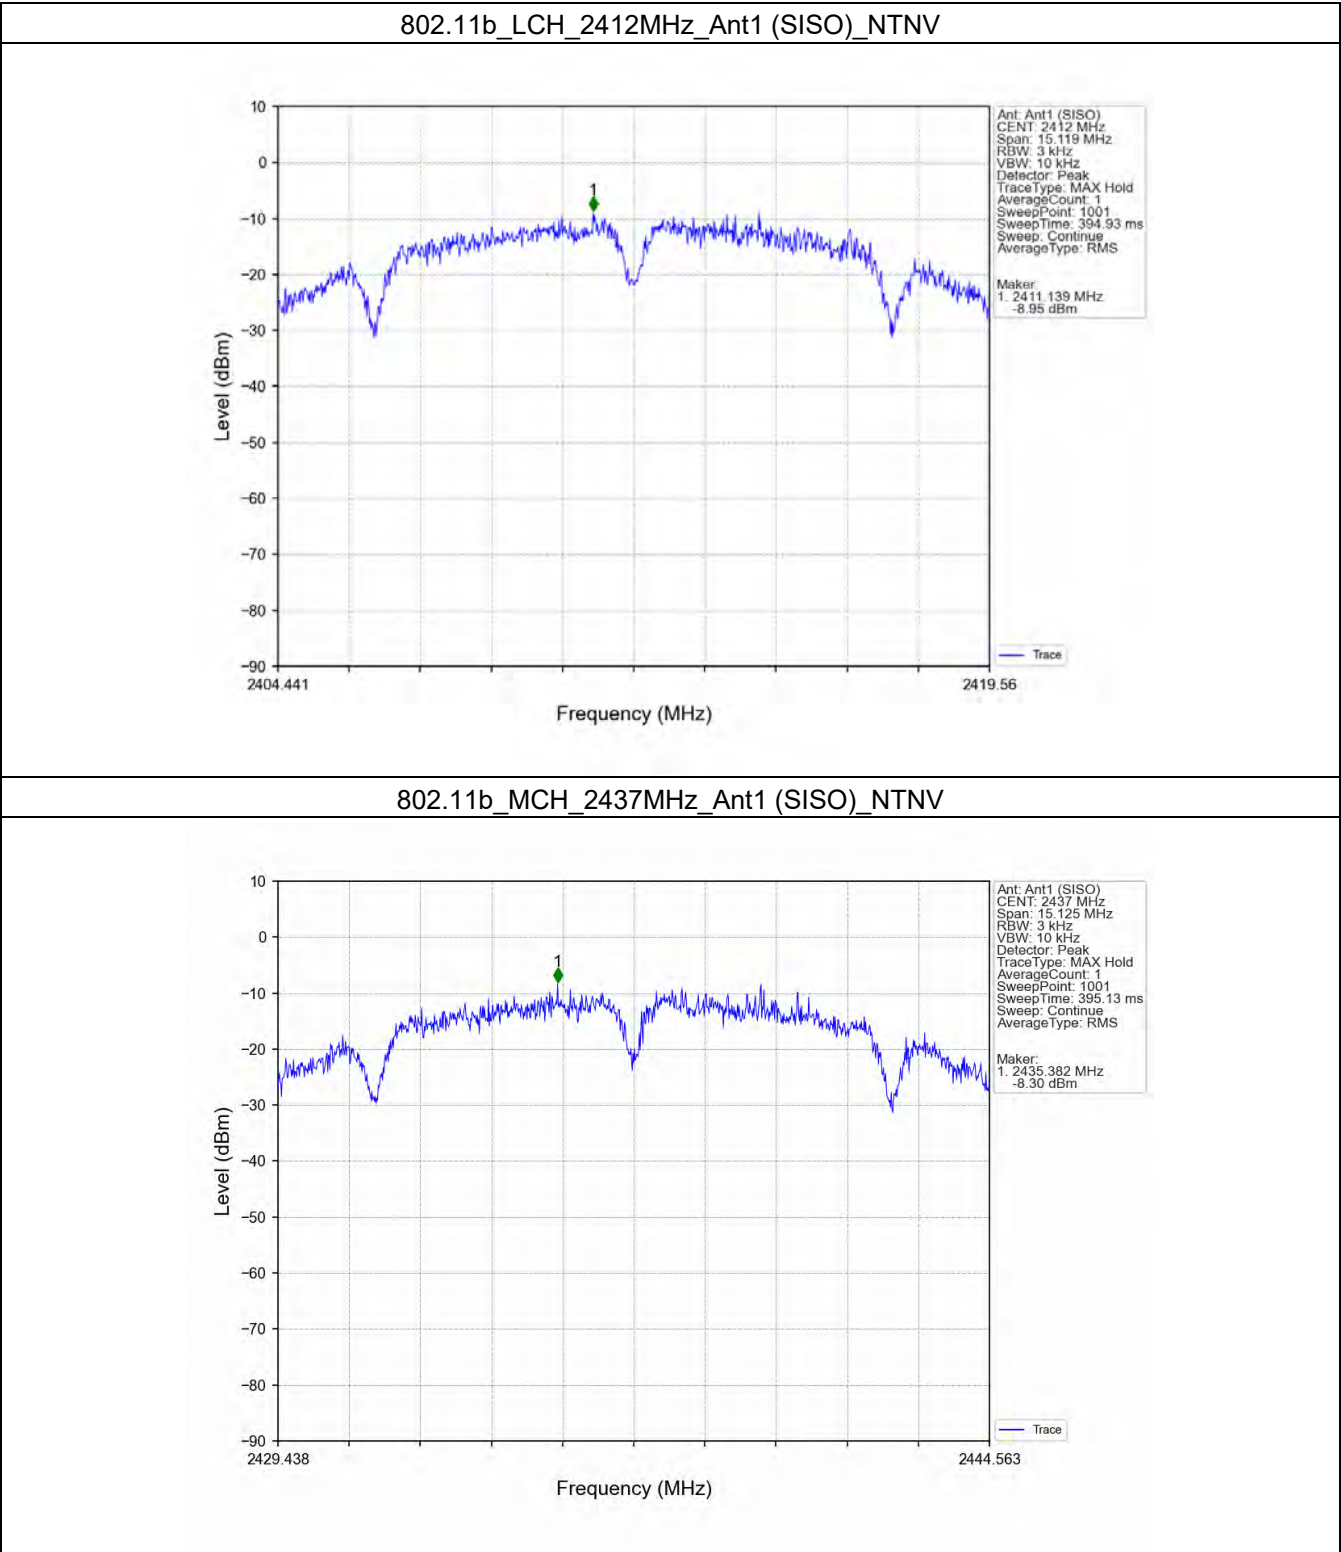


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 159 of 192

802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

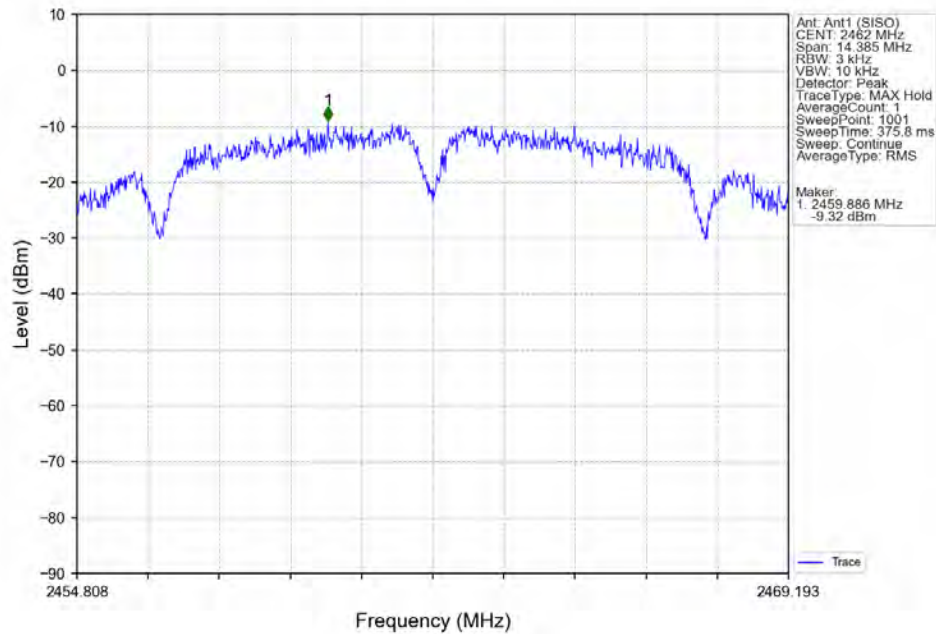

802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

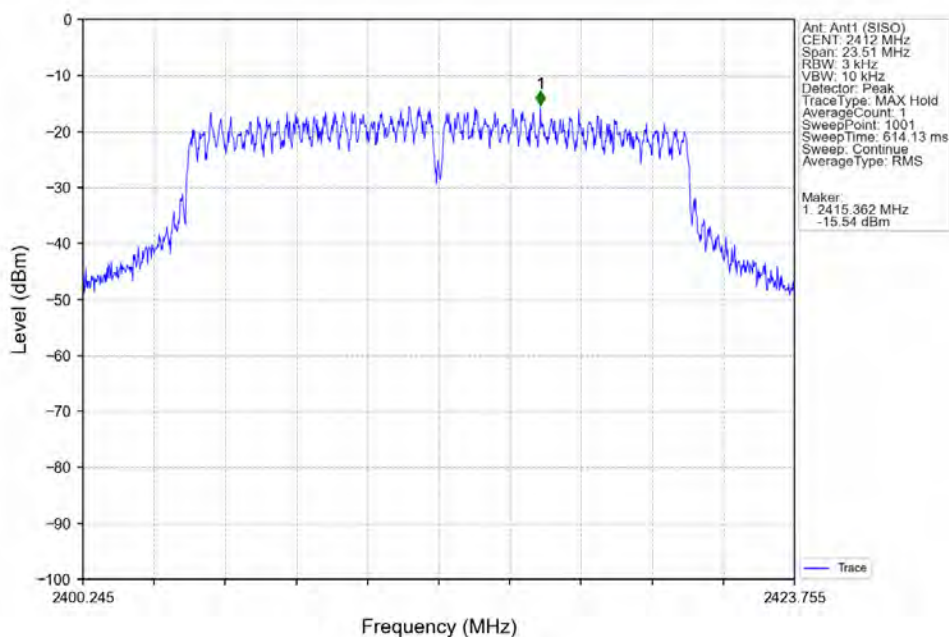


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 160 of 192

802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

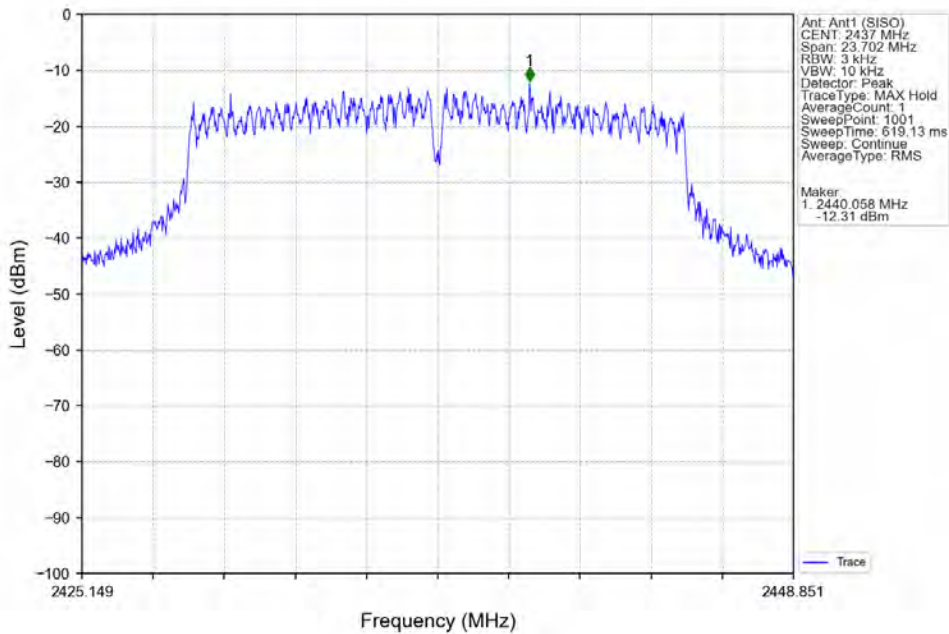

802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

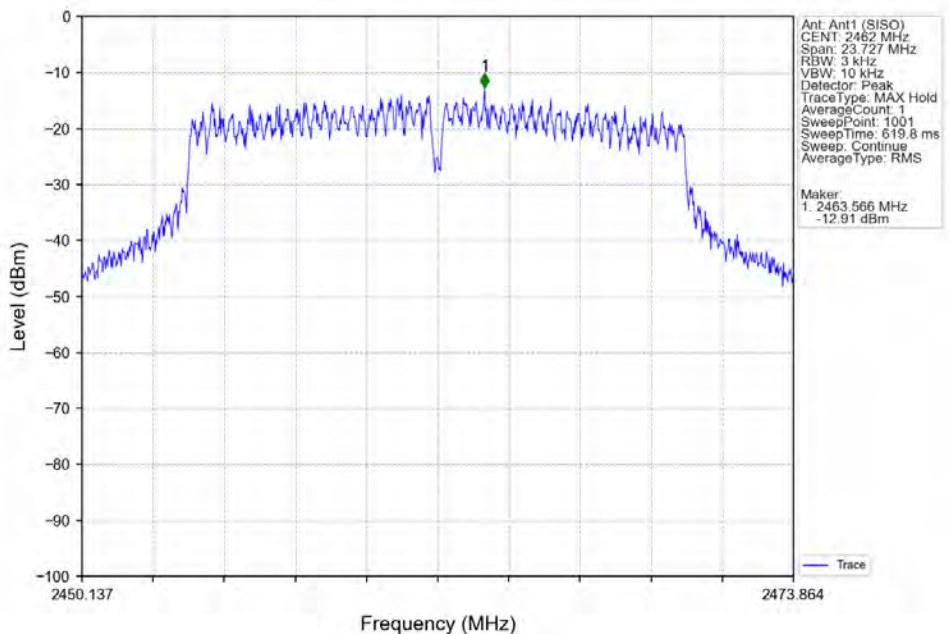


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 161 of 192

802.11n(HT20)_LCH_2412MHz_Ant1 (SISO)_NTNV

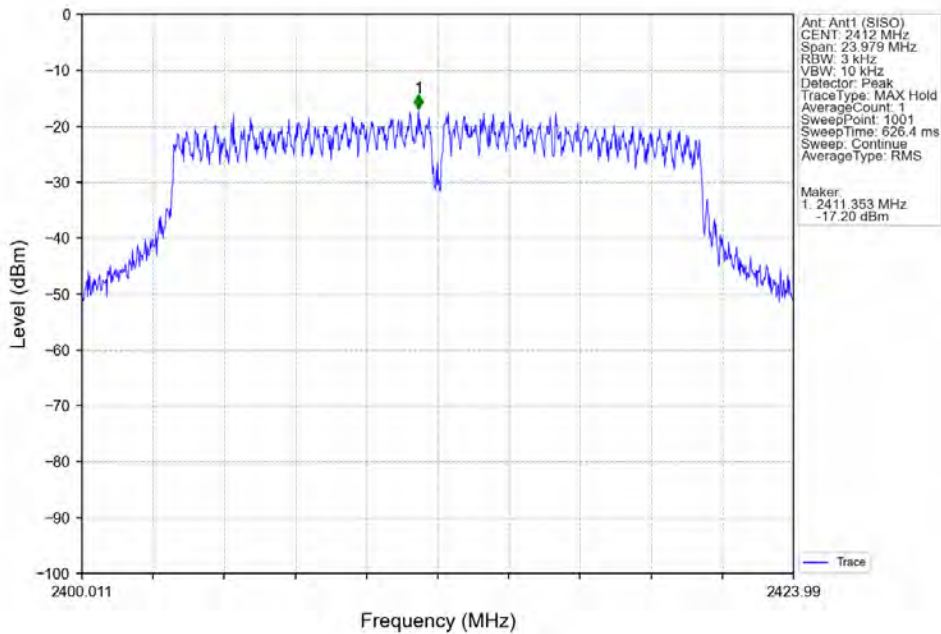

802.11n(HT20)_MCH_2437MHz_Ant1 (SISO)_NTNV

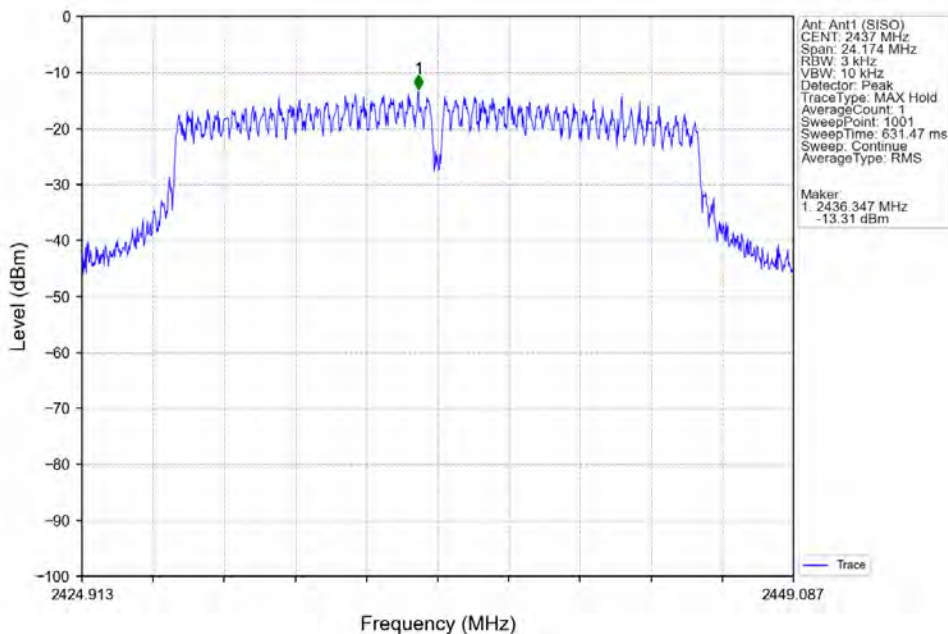


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 162 of 192

802.11n(HT20)_HCH_2462MHz_Ant1 (SISO)_NTNV

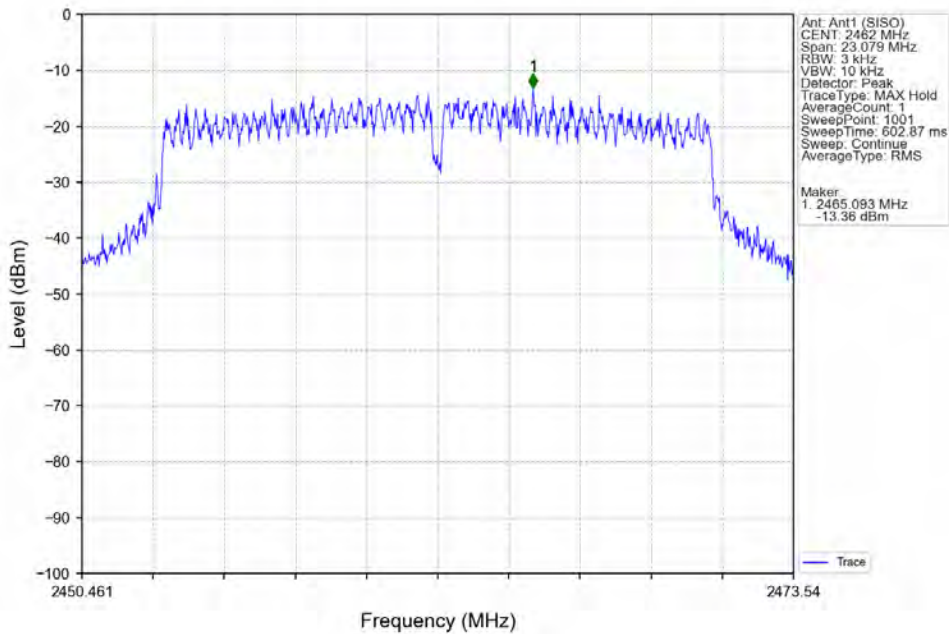

802.11n(HT40)_LCH_2422MHz_Ant1 (SISO)_NTNV

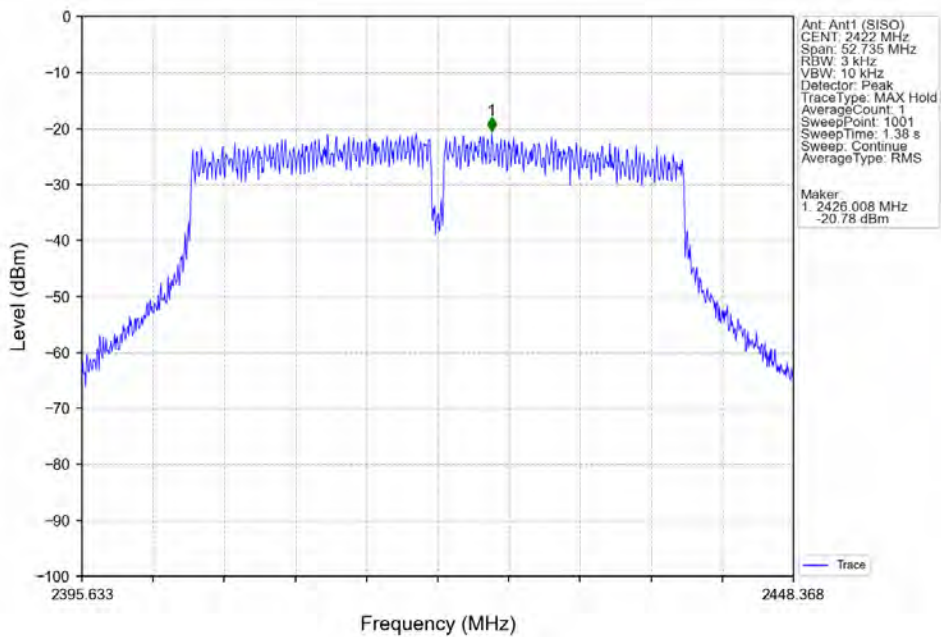


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 163 of 192

802.11n(HT40)_MCH_2437MHz_Ant1 (SISO)_NTNV

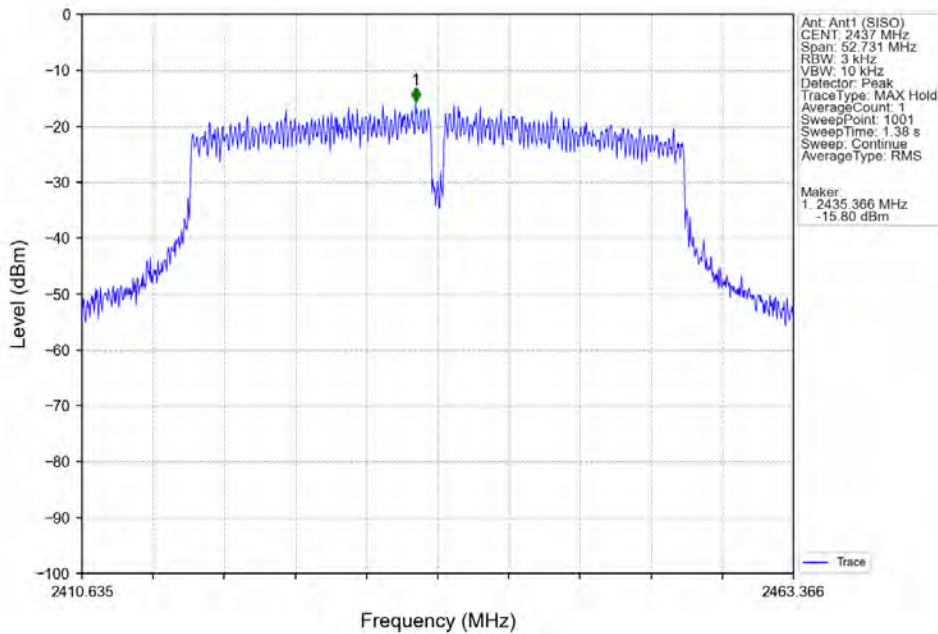

802.11n(HT40)_HCH_2452MHz_Ant1 (SISO)_NTNV

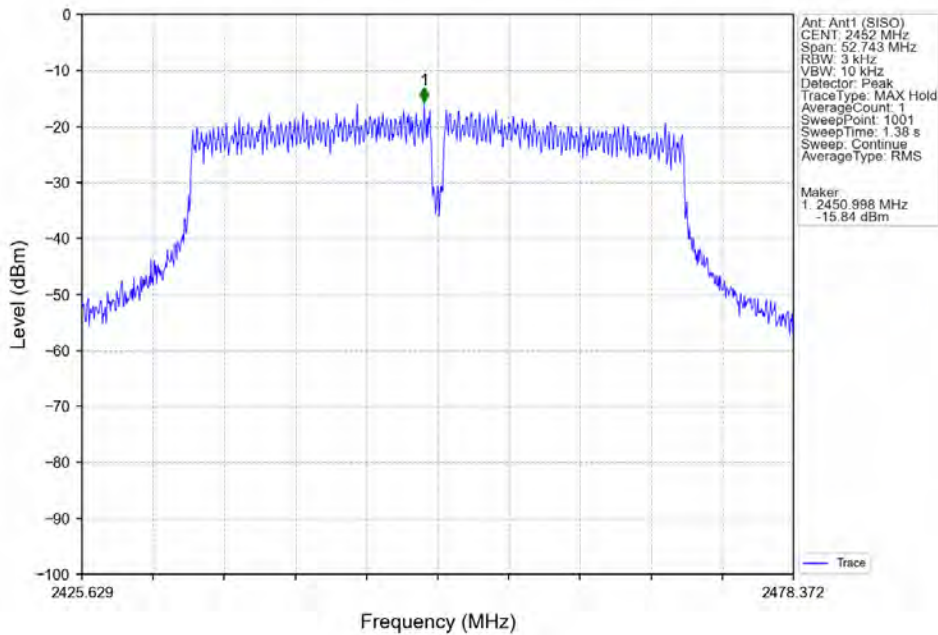


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 164 of 192

802.11ax(HE20)_LCH_2412MHz_RU242_Left_Ant1 (SISO)_NTNV

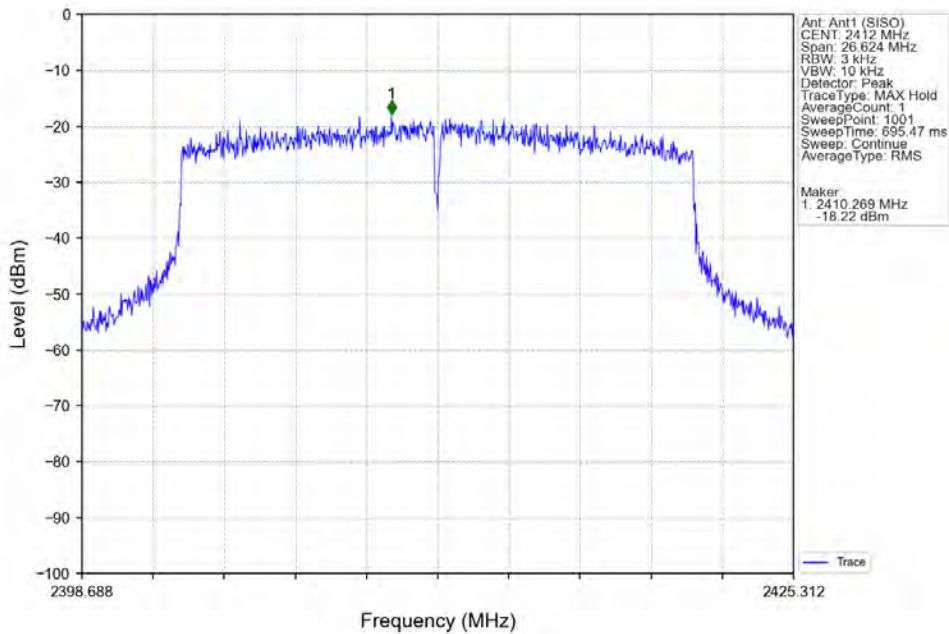

802.11ax(HE20)_MCH_2437MHz_RU242_Left_Ant1 (SISO)_NTNV

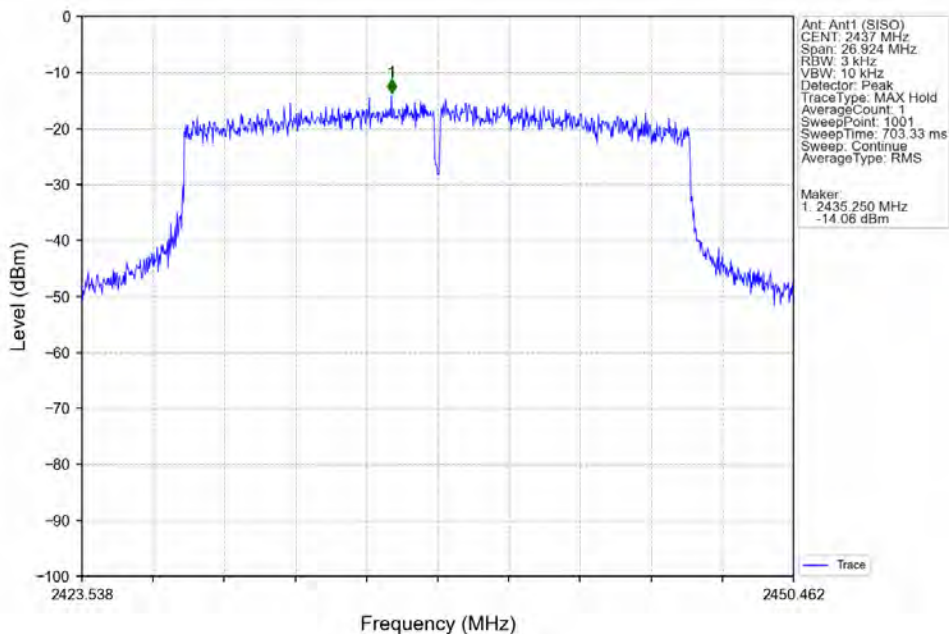


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 165 of 192

802.11ax(HE20)_HCH_2462MHz_RU242_Left_Ant1 (SISO)_NTNV

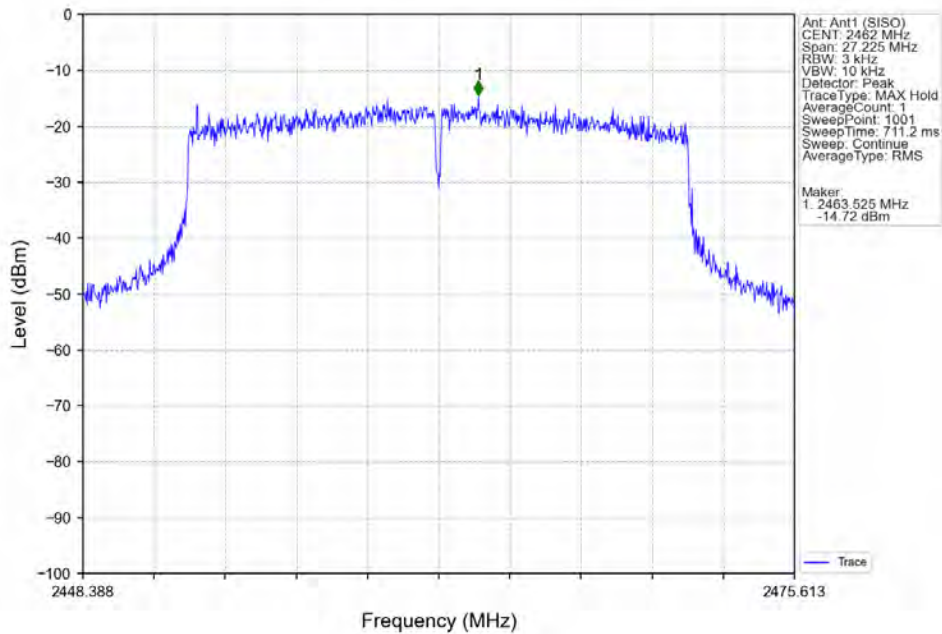

802.11ax(HE40)_LCH_2422MHz_RU484_Left_Ant1 (SISO)_NTNV

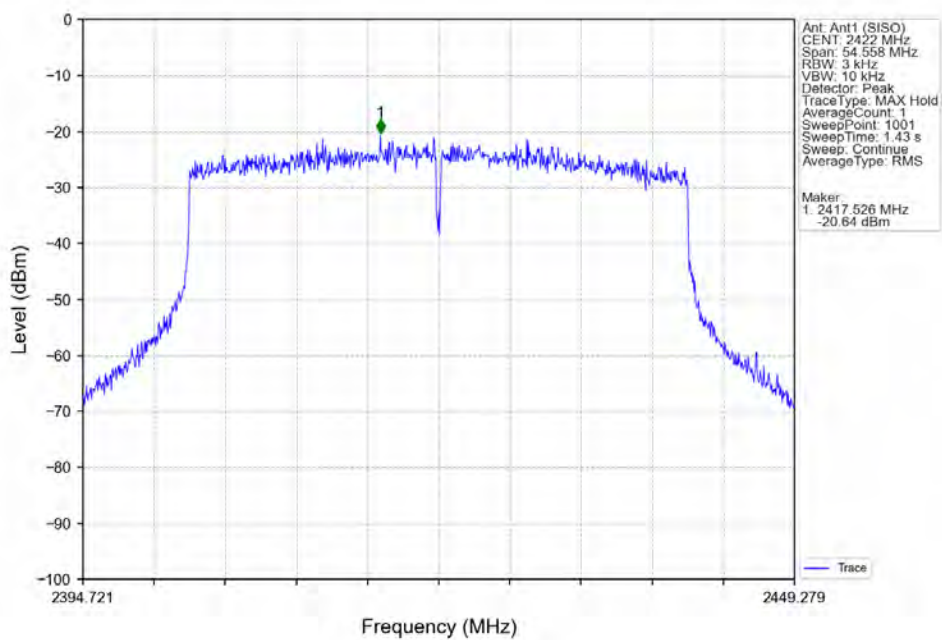


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 166 of 192

802.11ax(HE40)_MCH_2437MHz_RU484_Left_Ant1 (SISO)_NTNV

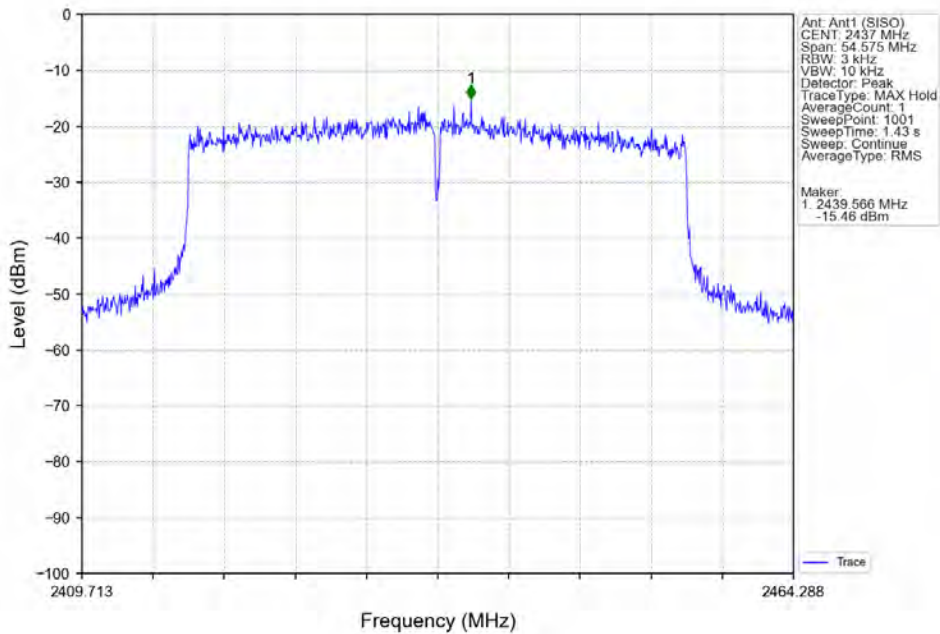

802.11ax(HE40)_HCH_2452MHz_RU484_Left_Ant1 (SISO)_NTNV

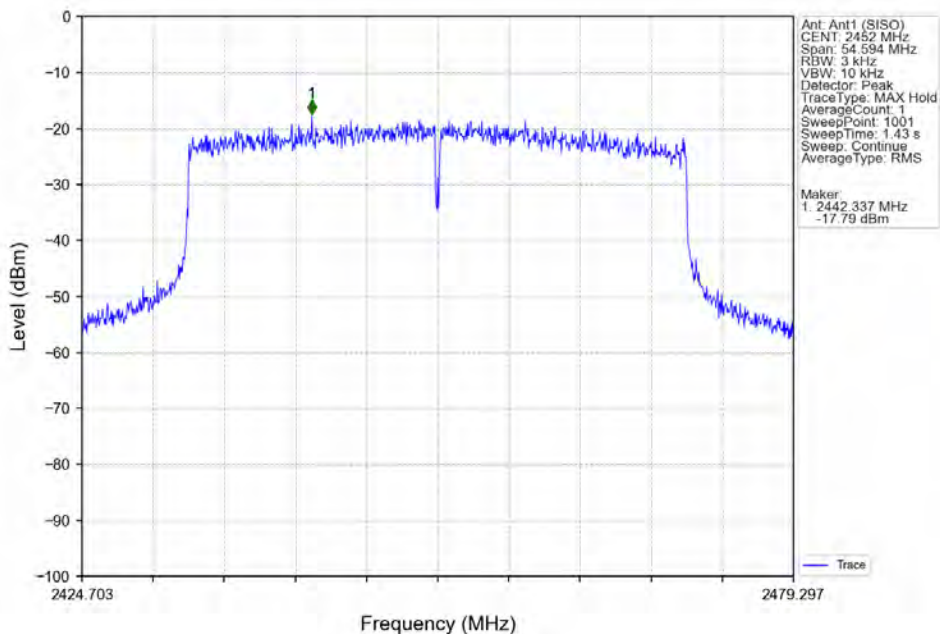

5. Unwanted Emissions In Non-restricted Frequency Bands

5.1 Test Result

5.1.1 Ref

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	Level of Reference (dBm)
802.11b	SISO	2412	/	/	1	6.16
		2437	/	/	1	6.09
		2462	/	/	1	6.08
802.11g	SISO	2412	/	/	1	-0.09
		2437	/	/	1	1.93
		2462	/	/	1	1.17
802.11n (HT20)	SISO	2412	/	/	1	-2.29
		2437	/	/	1	1.90
		2462	/	/	1	1.05
802.11n (HT40)	SISO	2422	/	/	1	-4.89
		2437	/	/	1	-0.82
		2452	/	/	1	-1.26
802.11ax (HE20)	SISO	2412	RU242	Left	1	-1.98
		2437	RU242	Left	1	1.99
		2462	RU242	Left	1	1.29
802.11ax (HE40)	SISO	2422	RU484	Left	1	-4.82
		2437	RU484	Left	1	-0.78
		2452	RU484	Left	1	-1.46

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

5.1.2 CSE

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
802.11b	SISO	2412	/	/	1	6.16	-23.84	Pass
		2437	/	/	1	6.16	-23.84	Pass
		2462	/	/	1	6.16	-23.84	Pass
802.11g	SISO	2412	/	/	1	1.93	-28.07	Pass
		2437	/	/	1	1.93	-28.07	Pass
		2462	/	/	1	1.93	-28.07	Pass



Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240800162403


Page: 168 of 192

802.11n (HT20)	SISO	2412	/	/	1	1.90	-28.10	Pass
		2437	/	/	1	1.90	-28.10	Pass
		2462	/	/	1	1.90	-28.10	Pass
802.11n (HT40)	SISO	2422	/	/	1	-0.82	-30.82	Pass
		2437	/	/	1	-0.82	-30.82	Pass
		2452	/	/	1	-0.82	-30.82	Pass
802.11ax (HE20)	SISO	2412	RU242	Left	1	1.99	-28.01	Pass
		2437	RU242	Left	1	1.99	-28.01	Pass
		2462	RU242	Left	1	1.99	-28.01	Pass
802.11ax (HE40)	SISO	2422	RU484	Left	1	-0.78	-30.78	Pass
		2437	RU484	Left	1	-0.78	-30.78	Pass
		2452	RU484	Left	1	-0.78	-30.78	Pass


Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

5.2 Test Graph


5.2.1 Ref

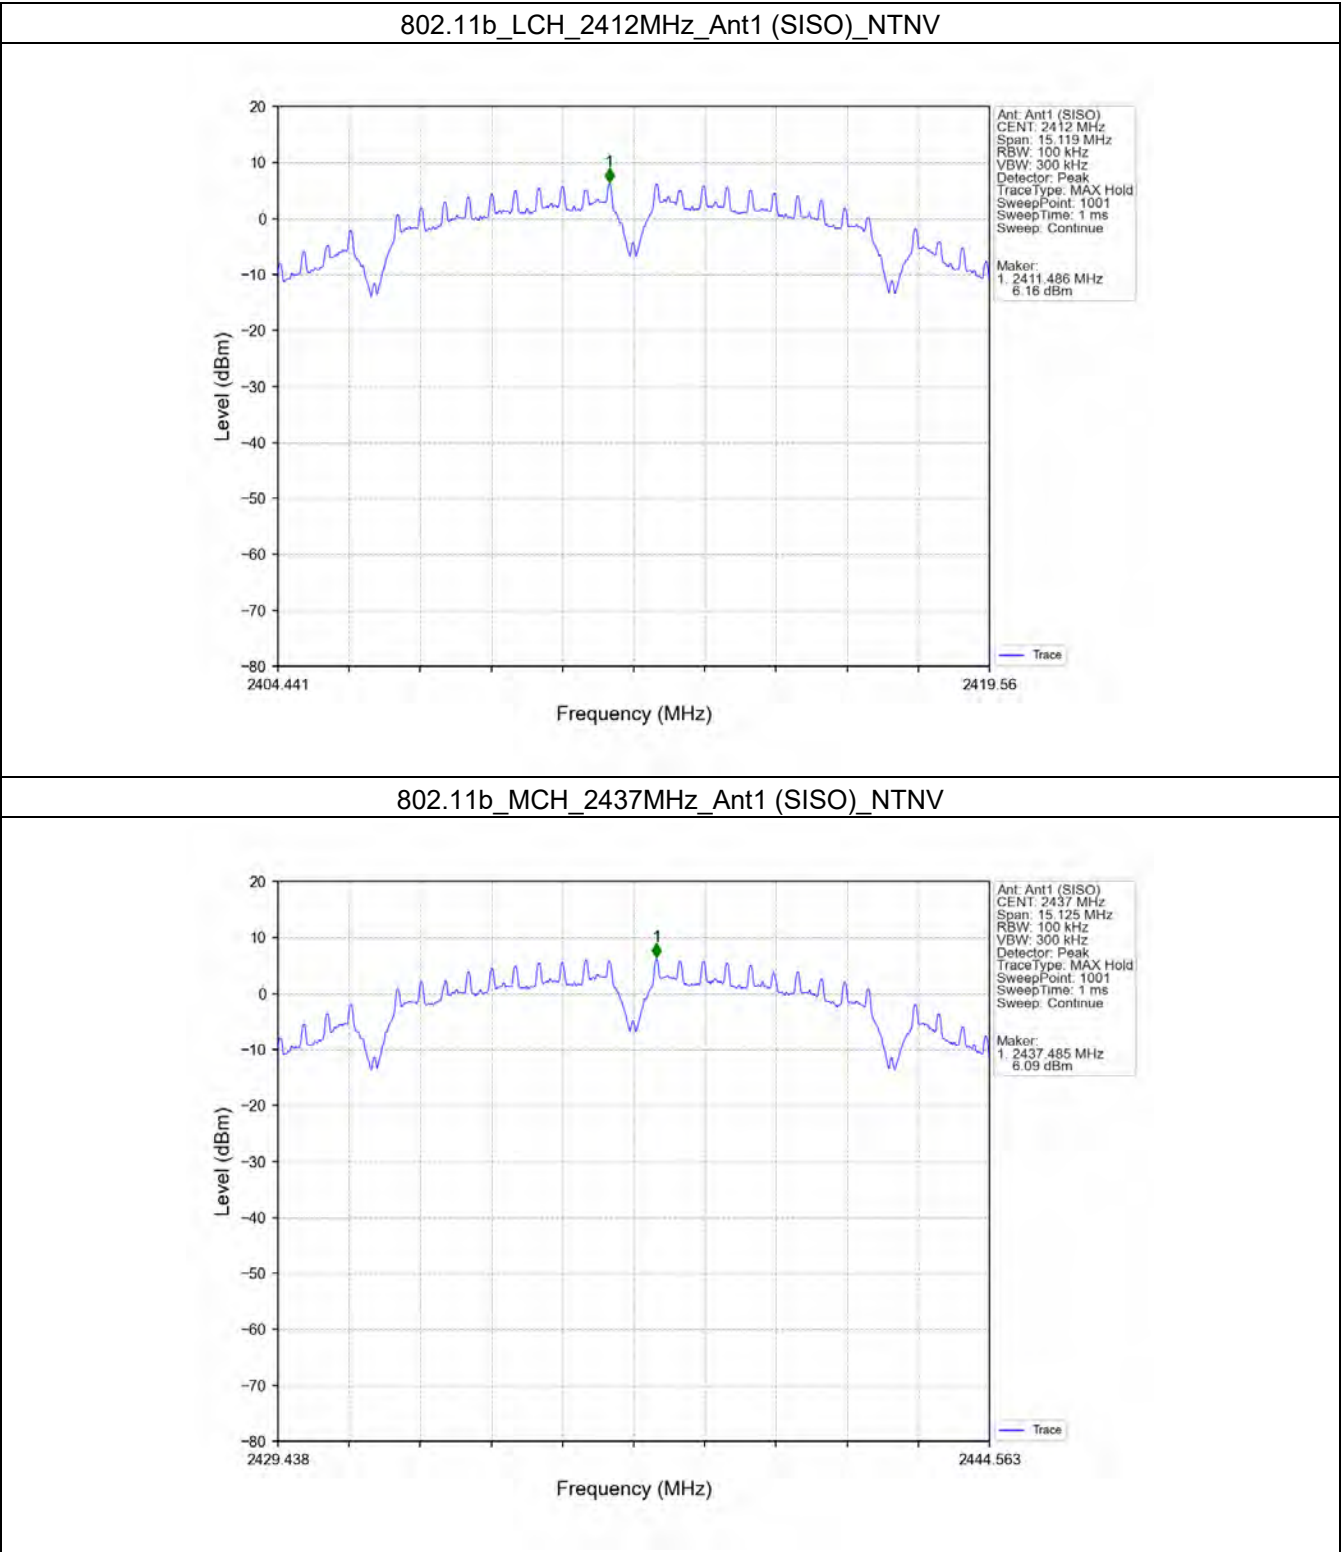


802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

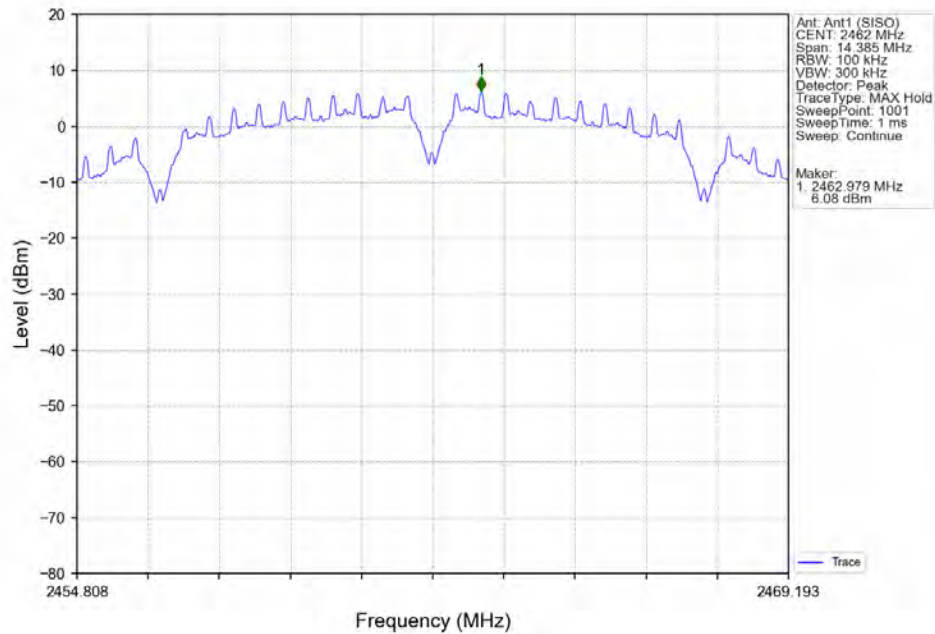


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

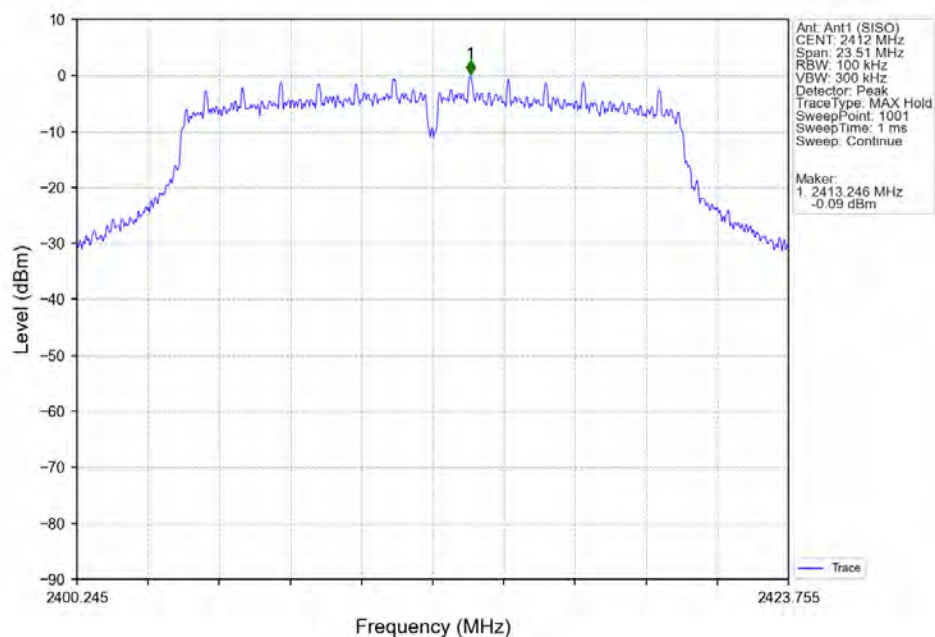

802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

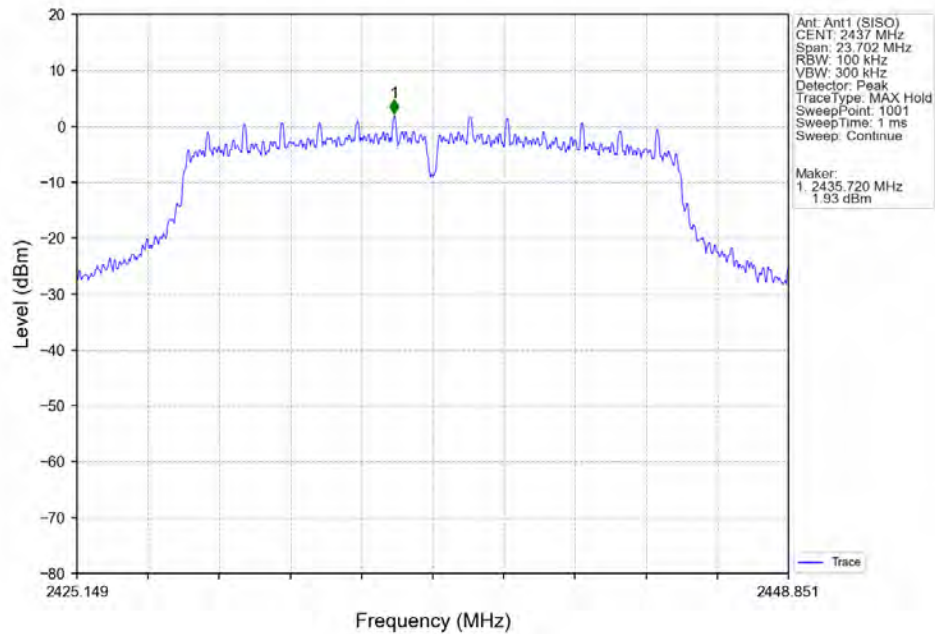

802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

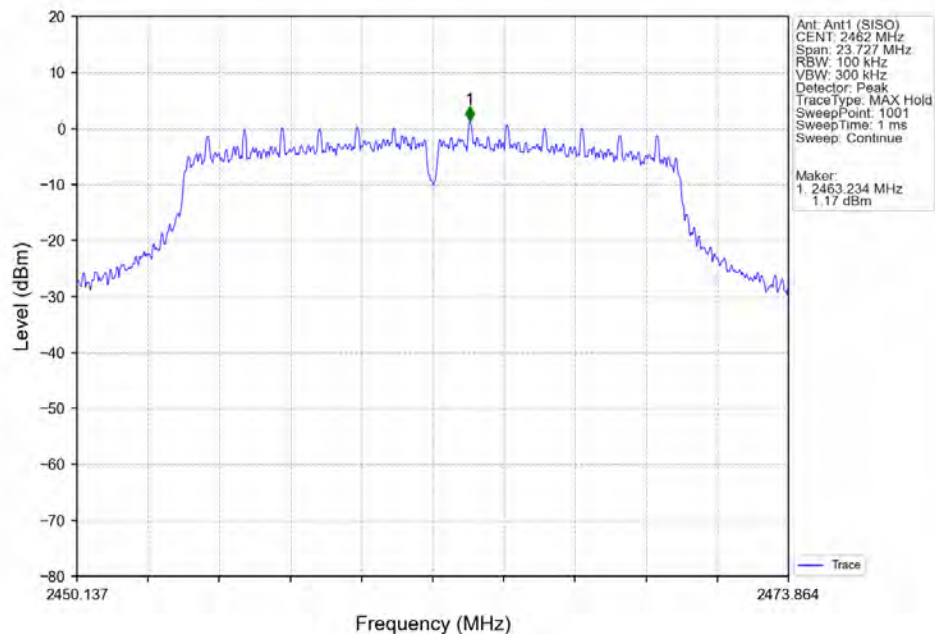


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 172 of 192

802.11n(HT20)_LCH_2412MHz_Ant1 (SISO)_NTNV

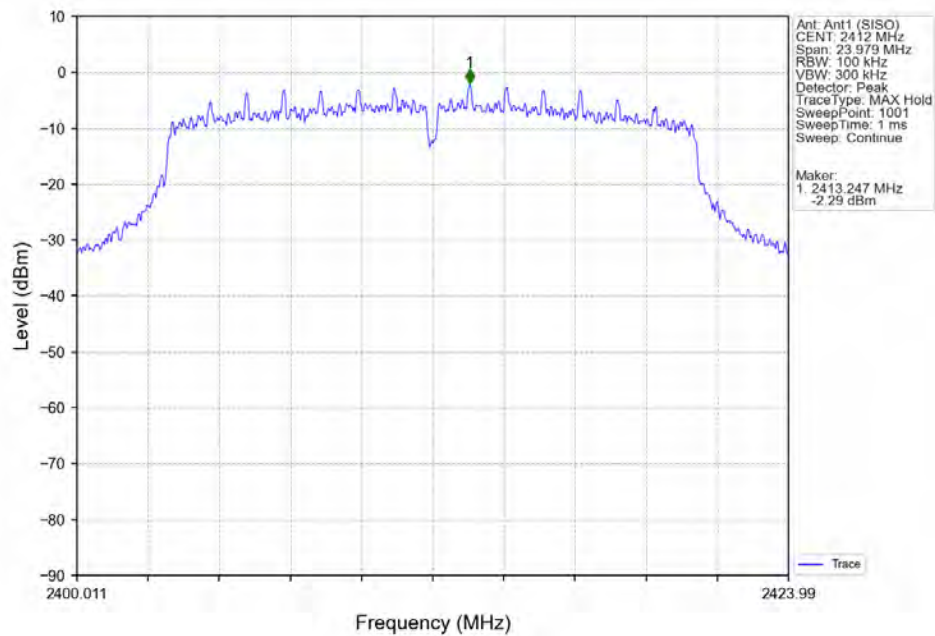

802.11n(HT20)_MCH_2437MHz_Ant1 (SISO)_NTNV

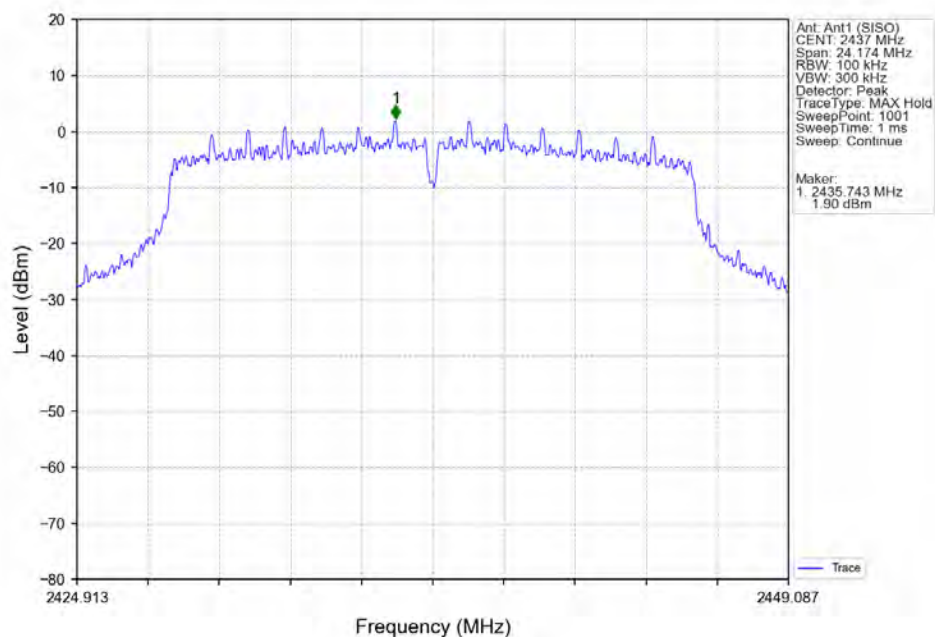


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 173 of 192

802.11n(HT20)_HCH_2462MHz_Ant1 (SISO)_NTNV

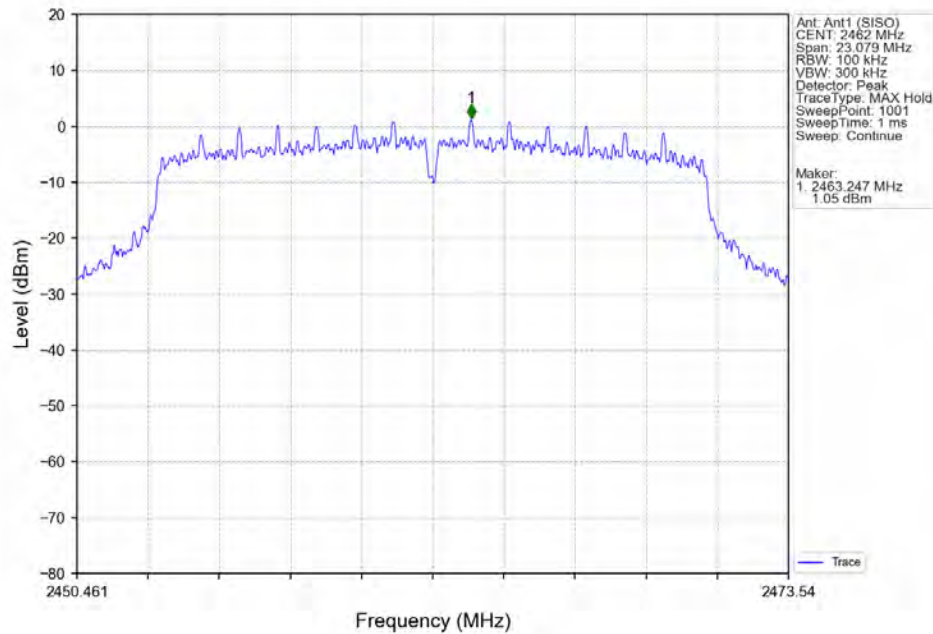

802.11n(HT40)_LCH_2422MHz_Ant1 (SISO)_NTNV

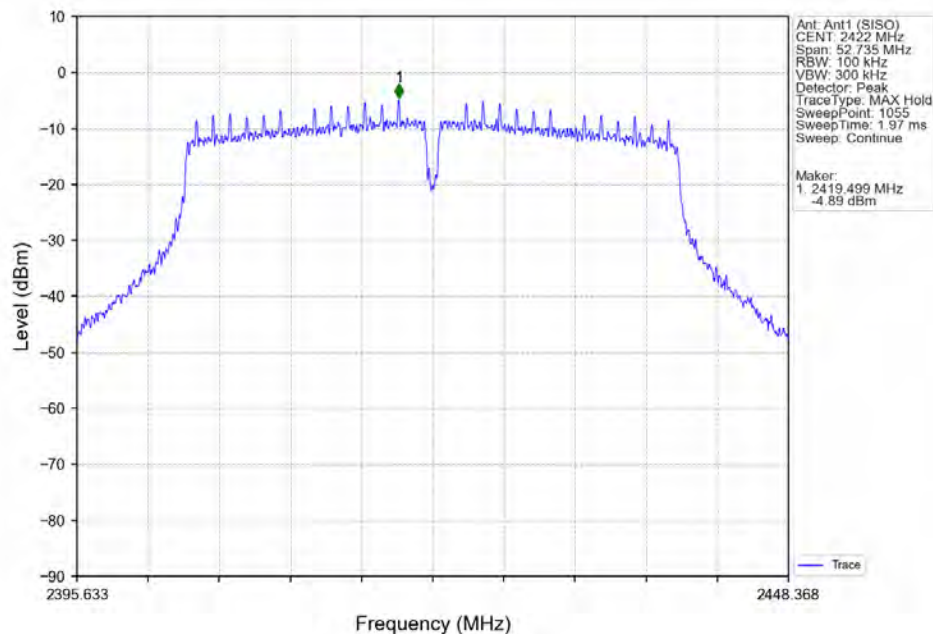


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 174 of 192

802.11n(HT40)_MCH_2437MHz_Ant1 (SISO)_NTNV

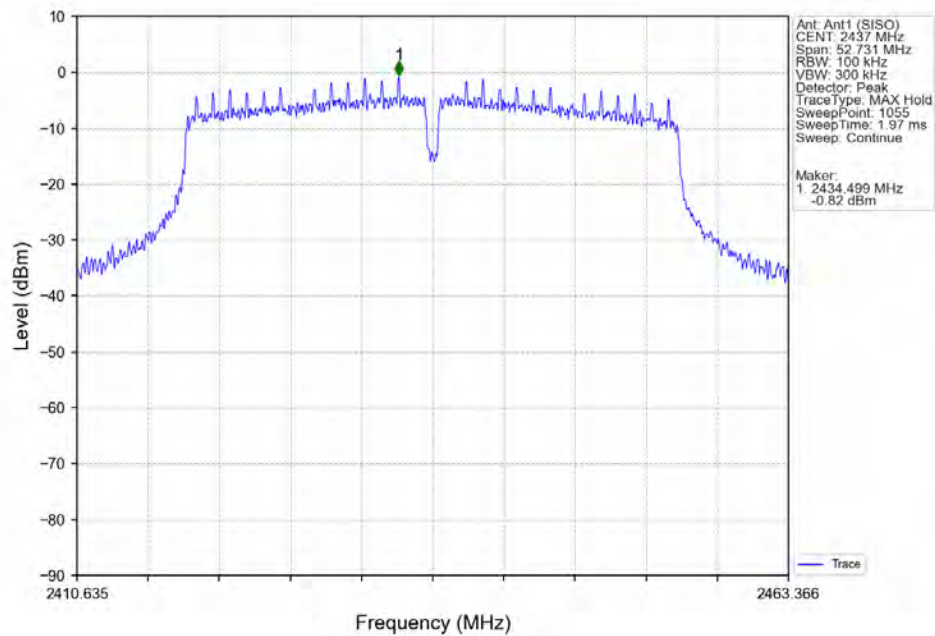

802.11n(HT40)_HCH_2452MHz_Ant1 (SISO)_NTNV

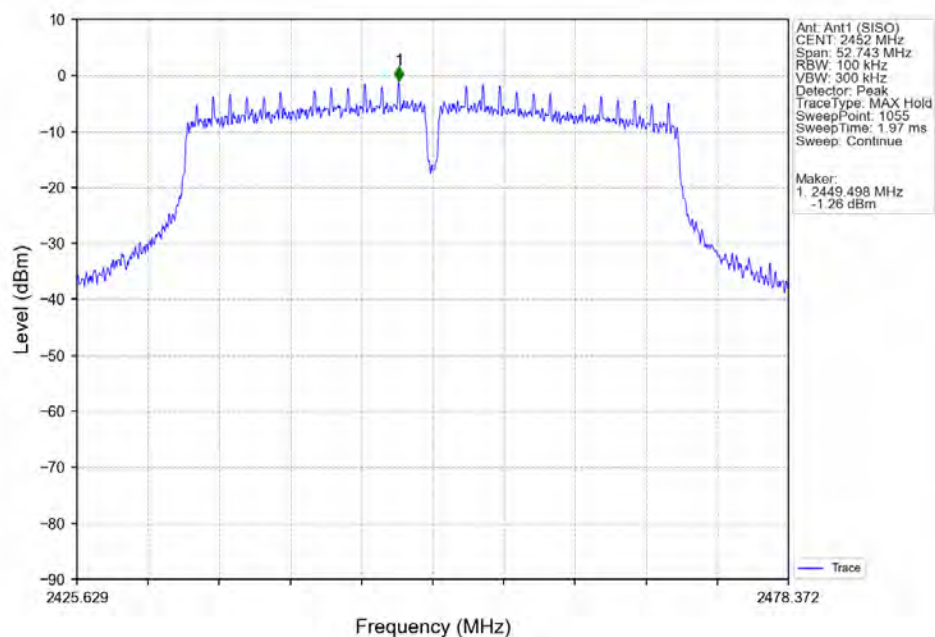


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 175 of 192

802.11ax(HE20)_LCH_2412MHz_RU242_Left_Ant1 (SISO)_NTNV

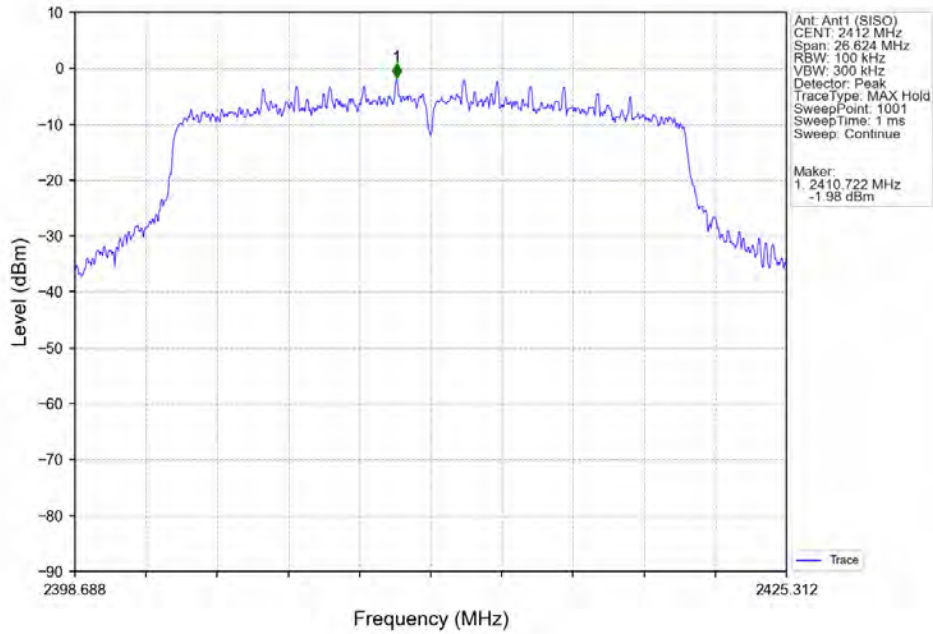

802.11ax(HE20)_MCH_2437MHz_RU242_Left_Ant1 (SISO)_NTNV

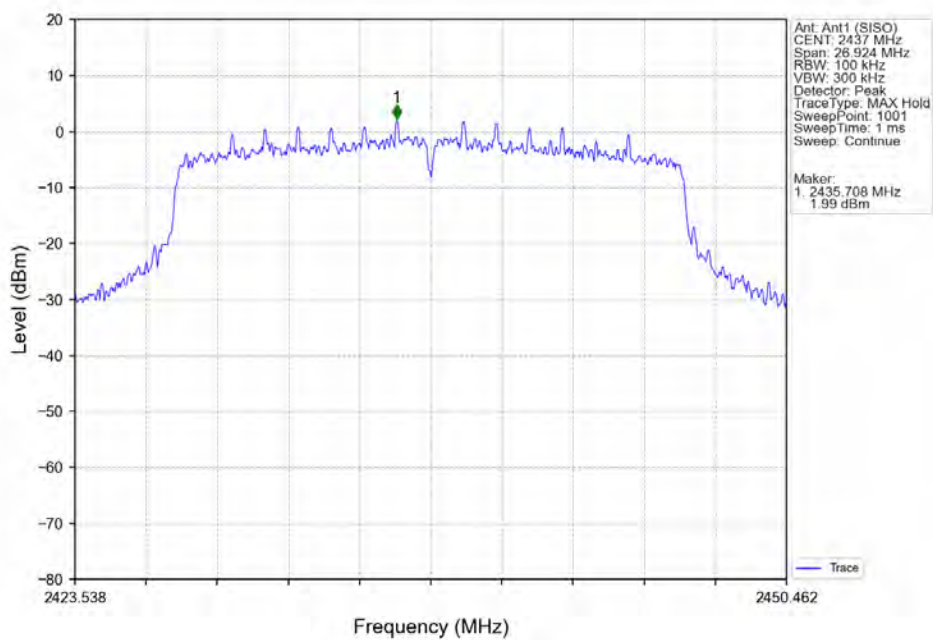


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 176 of 192

802.11ax(HE20)_HCH_2462MHz_RU242_Left_Ant1 (SISO)_NTNV

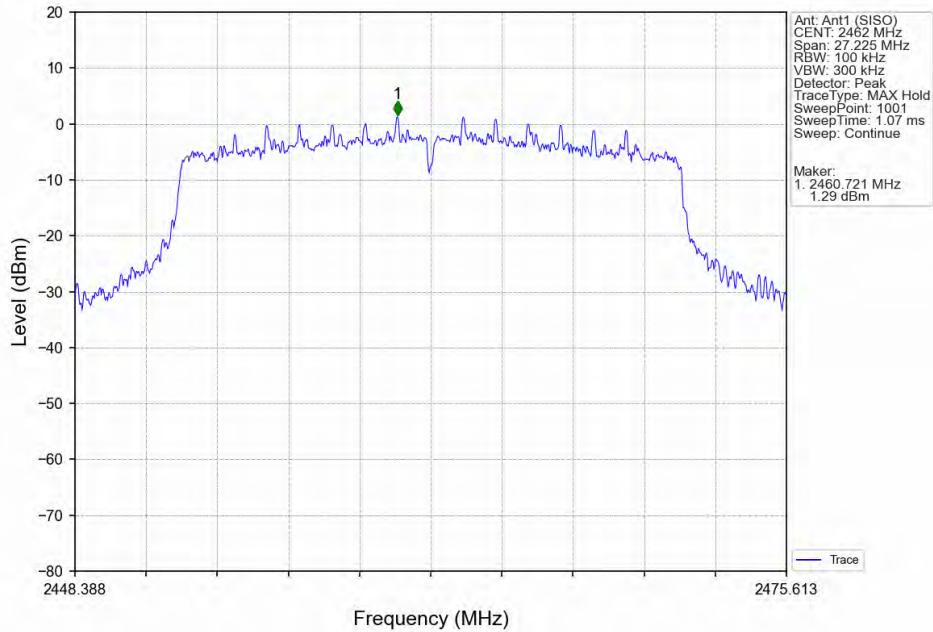

802.11ax(HE40)_LCH_2422MHz_RU484_Left_Ant1 (SISO)_NTNV

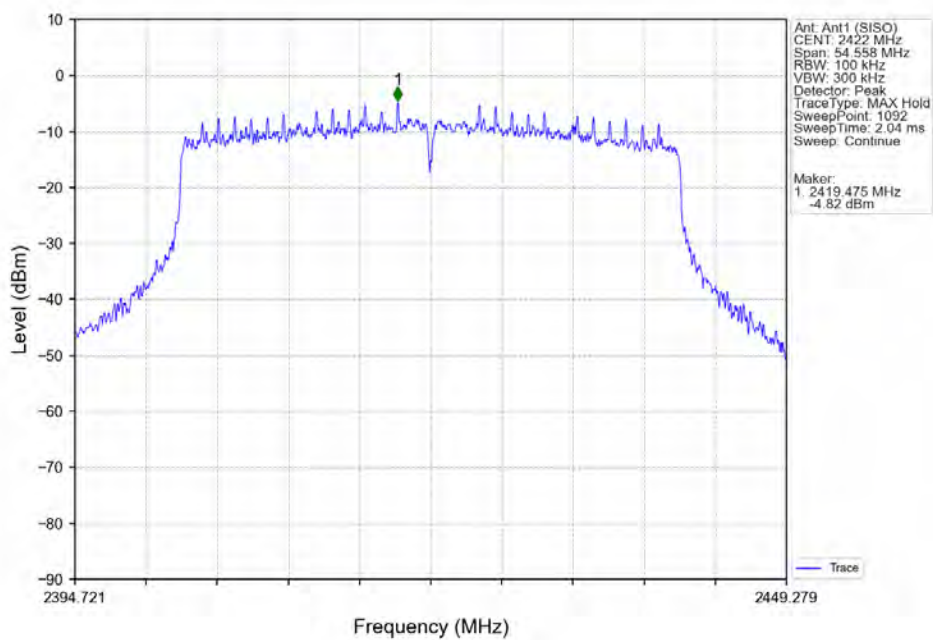


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 177 of 192


802.11ax(HE40)_MCH_2437MHz_RU484_Left_Ant1 (SISO)_NTNV

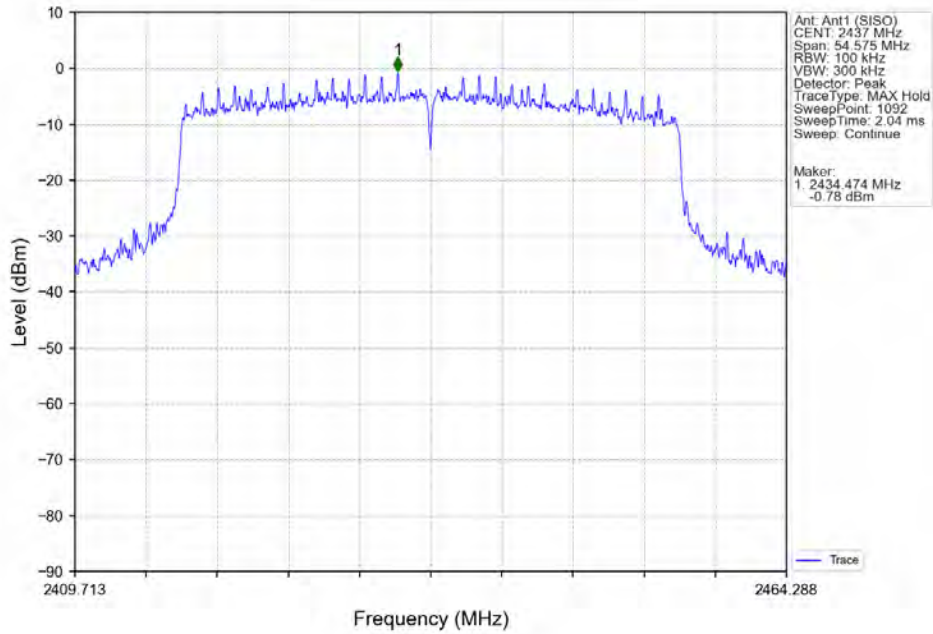


802.11ax(HE40)_HCH_2452MHz_RU484_Left_Ant1 (SISO)_NTNV

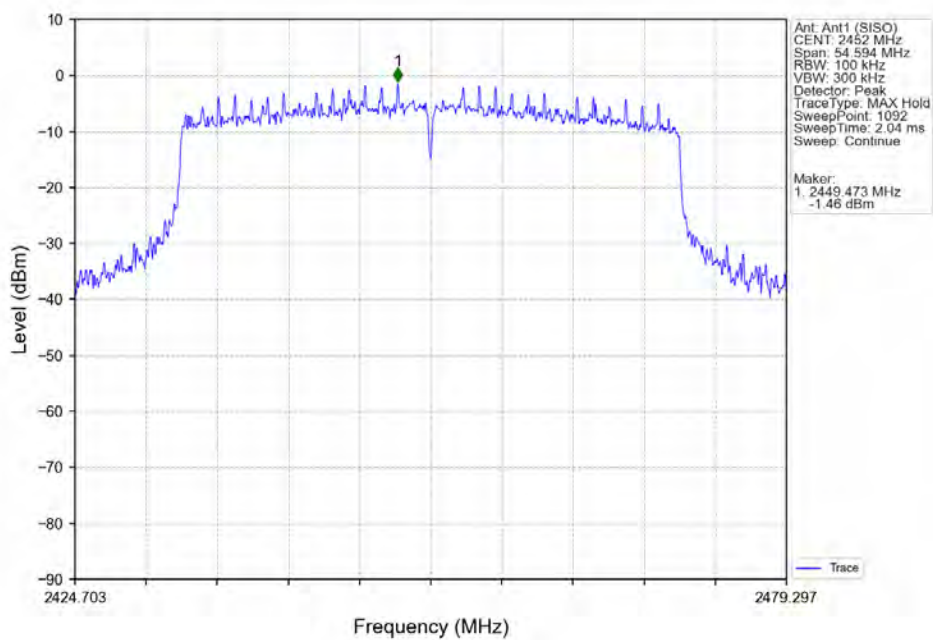


5.2.2 CSE

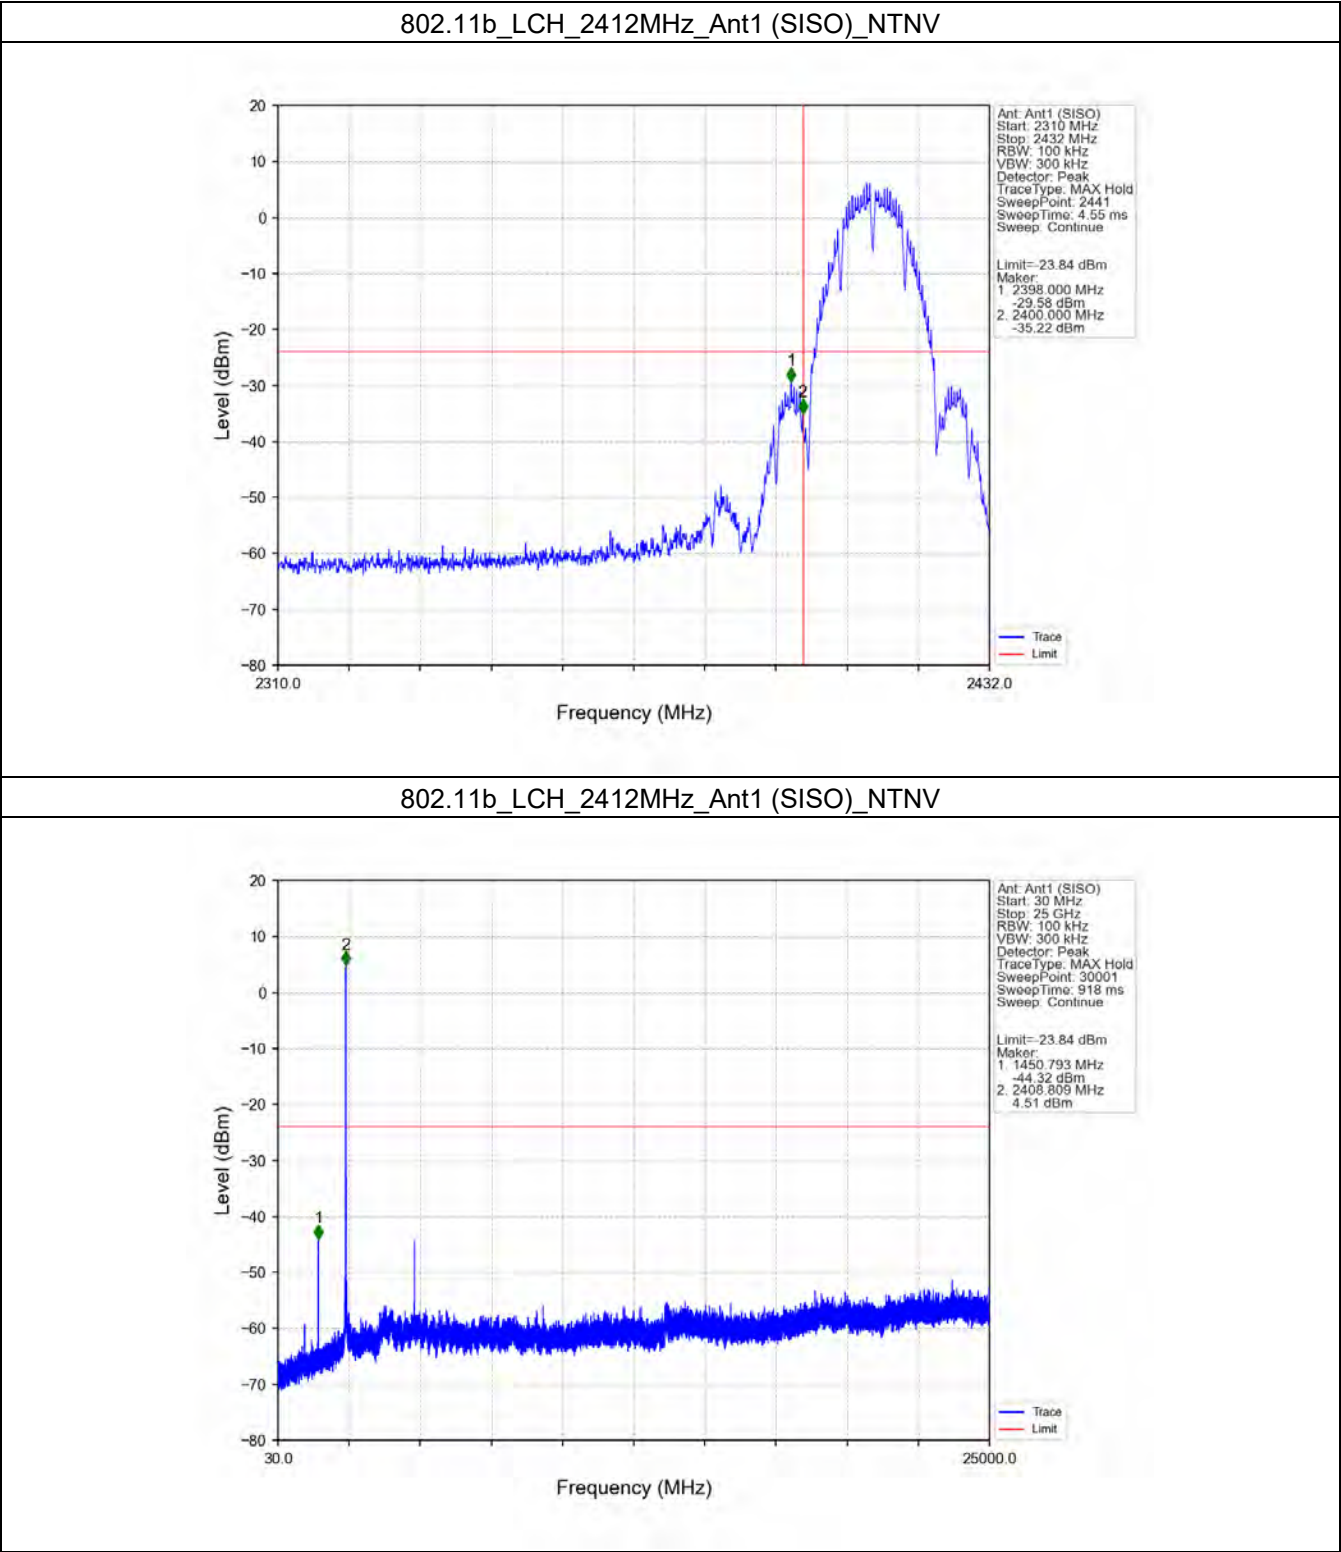


802.11b_MCH_2437MHz_Ant1 (SISO)_NTNV

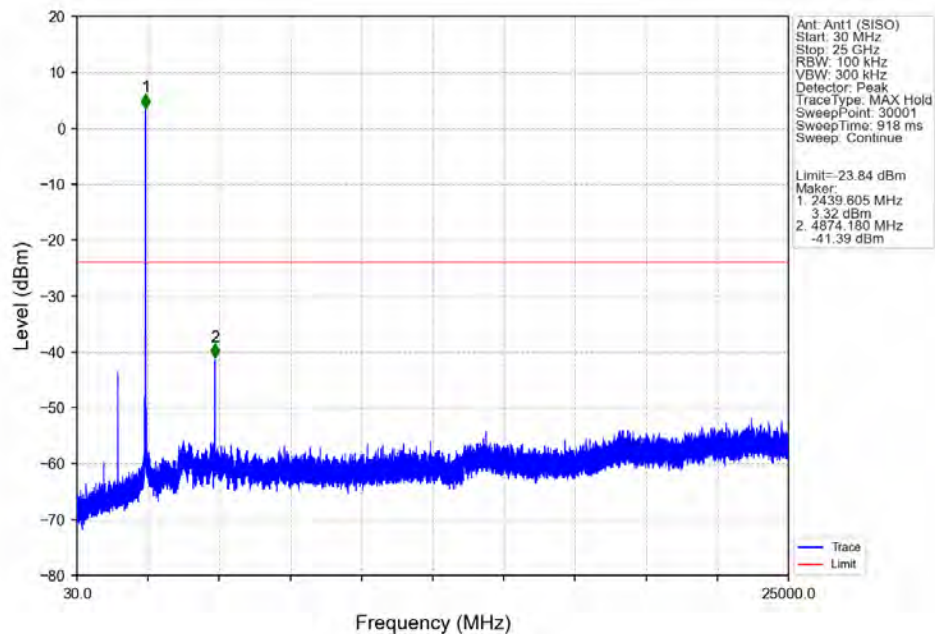


802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

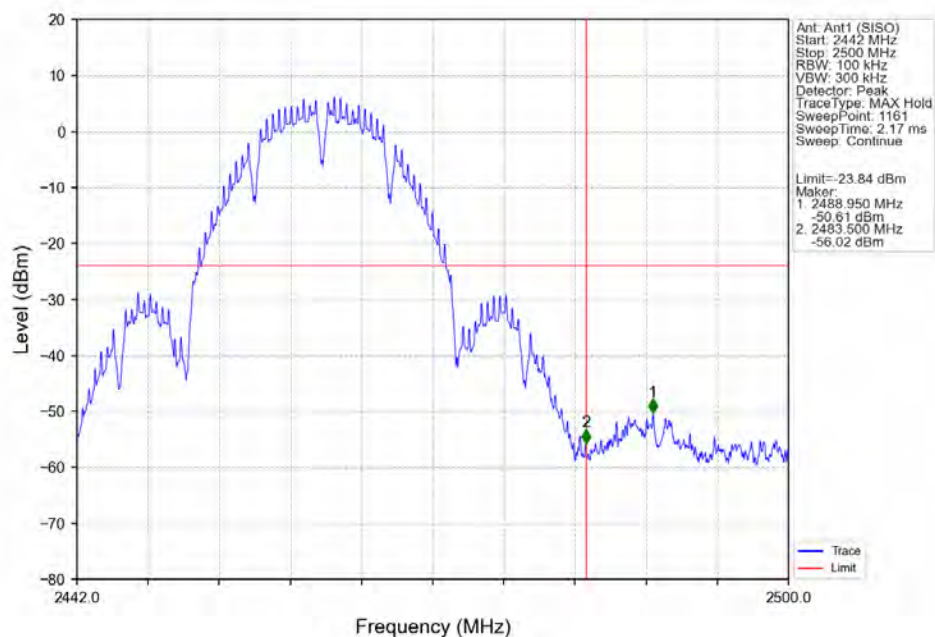


802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

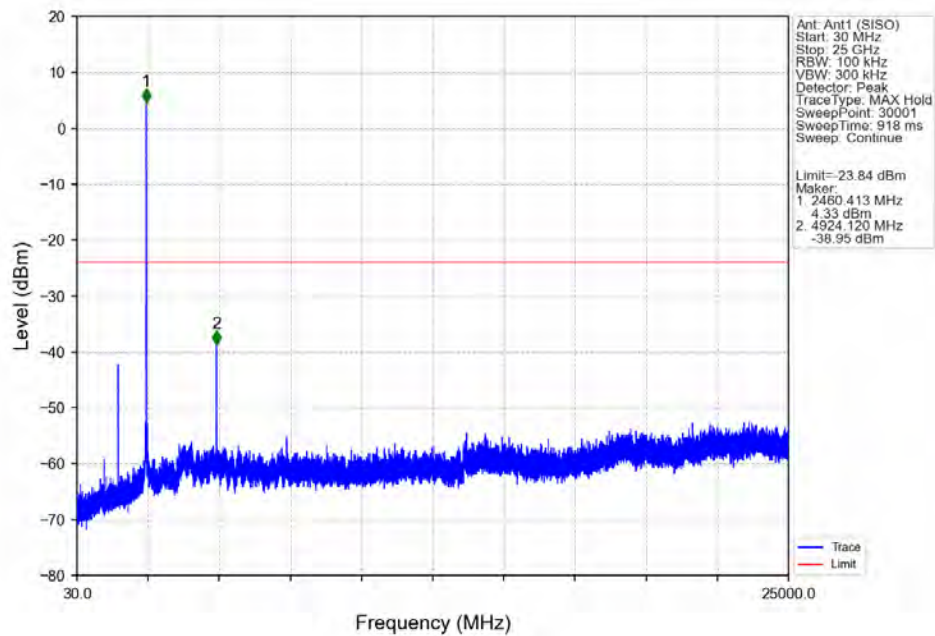


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

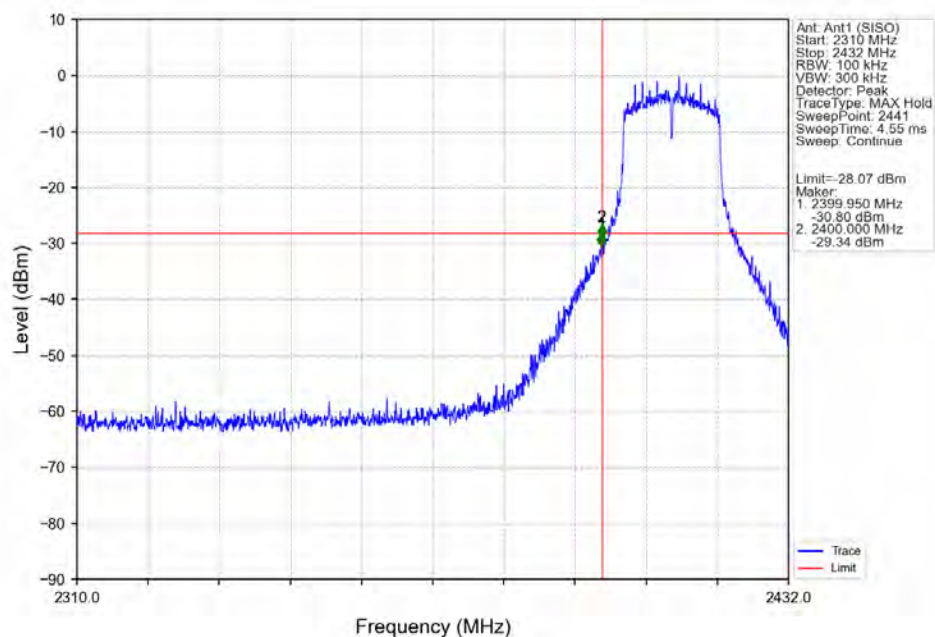


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

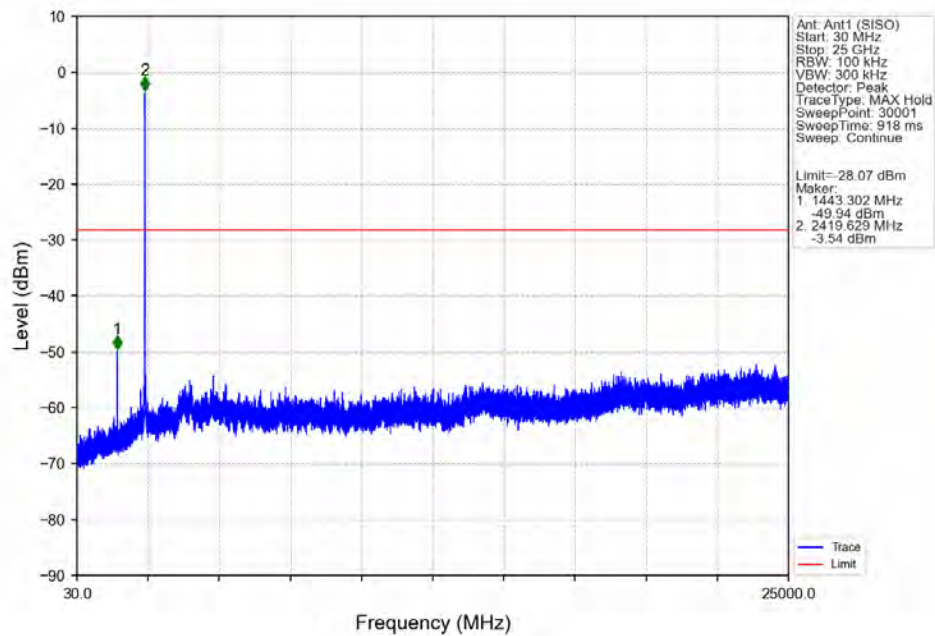


802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

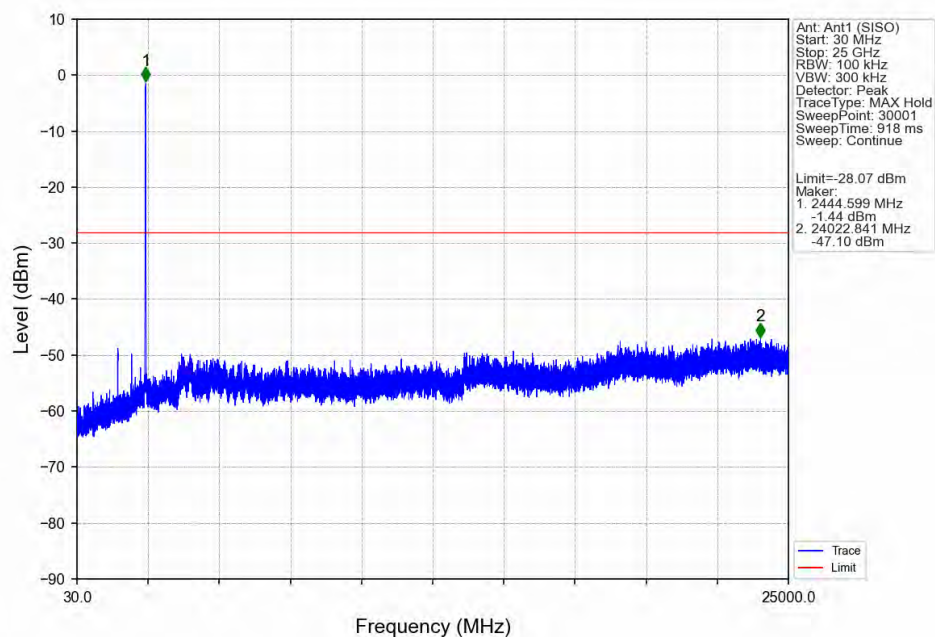


802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

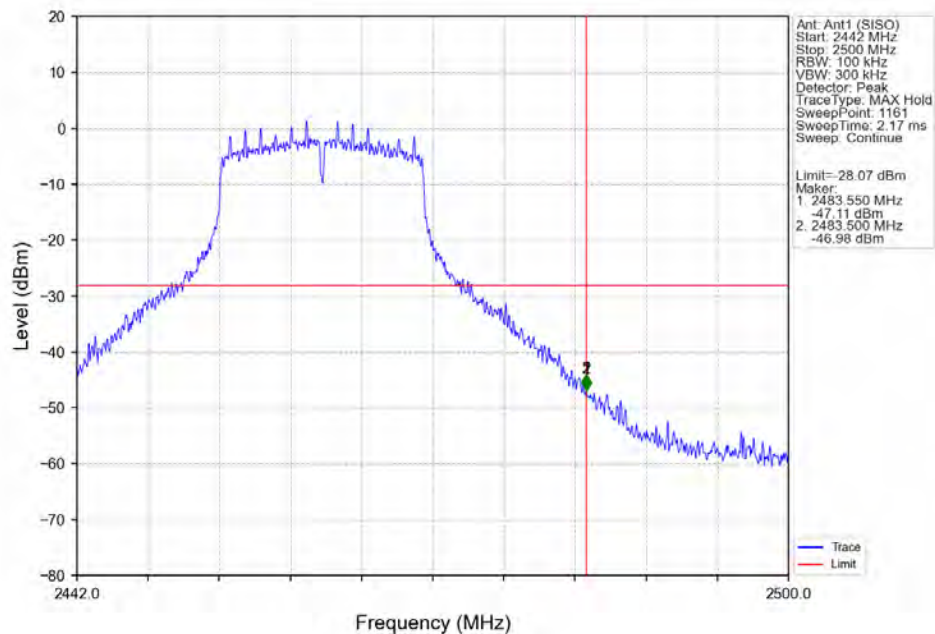


802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

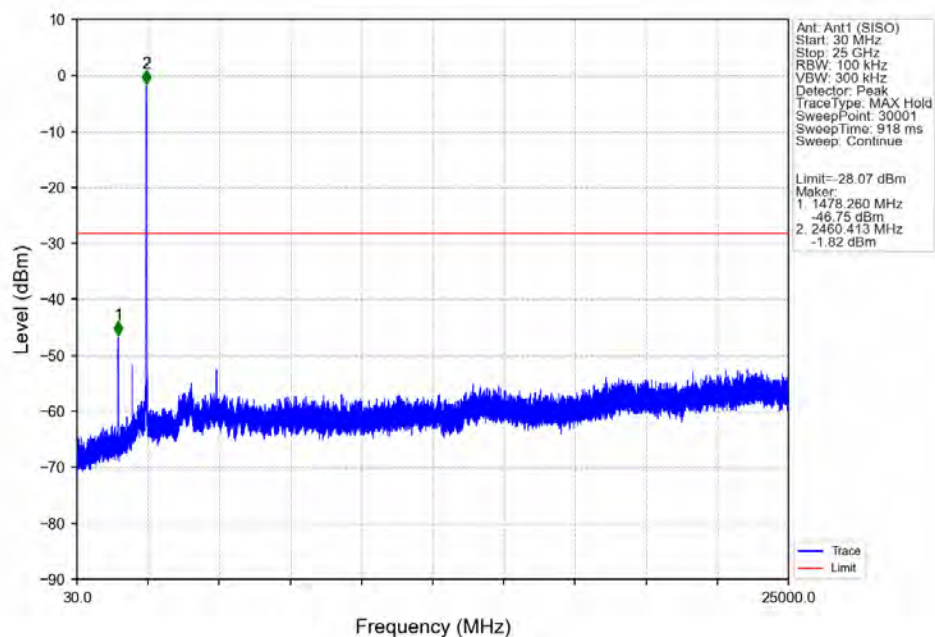


802.11n(HT20)_LCH_2412MHz_Ant1 (SISO)_NTNV

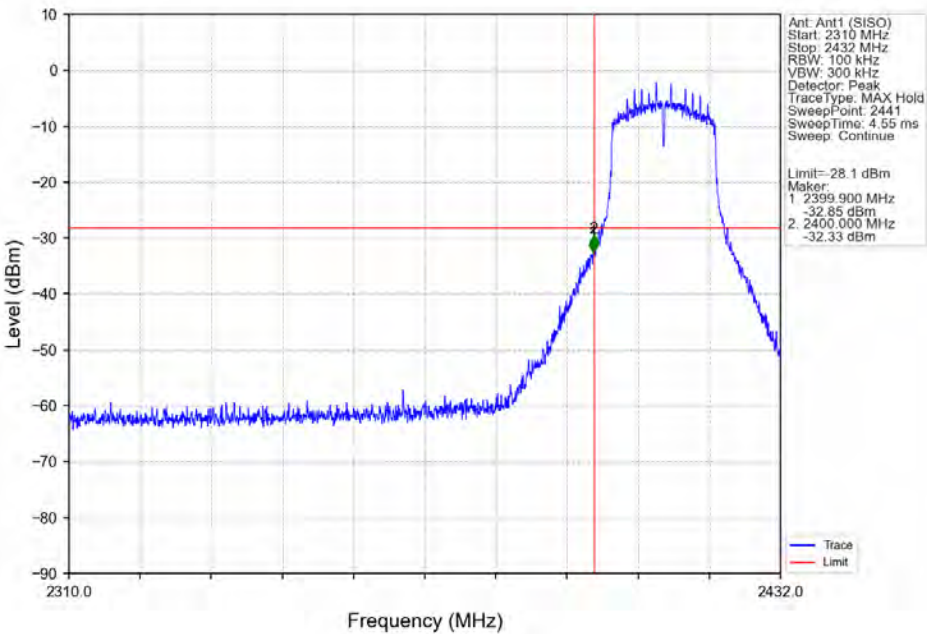


802.11n(HT20)_LCH_2412MHz_Ant1 (SISO)_NTNV

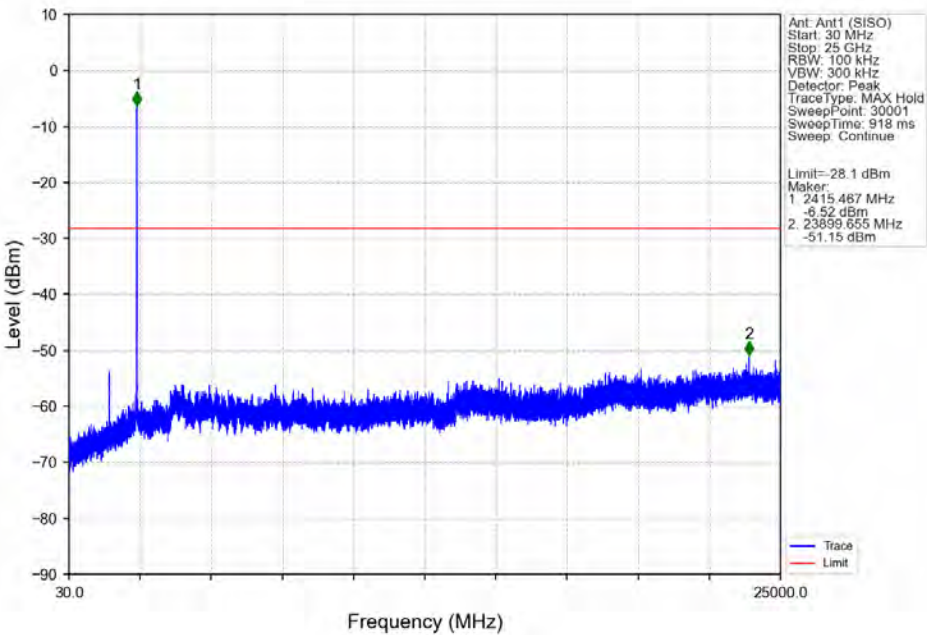


802.11n(HT20)_MCH_2437MHz_Ant1 (SISO)_NTNV

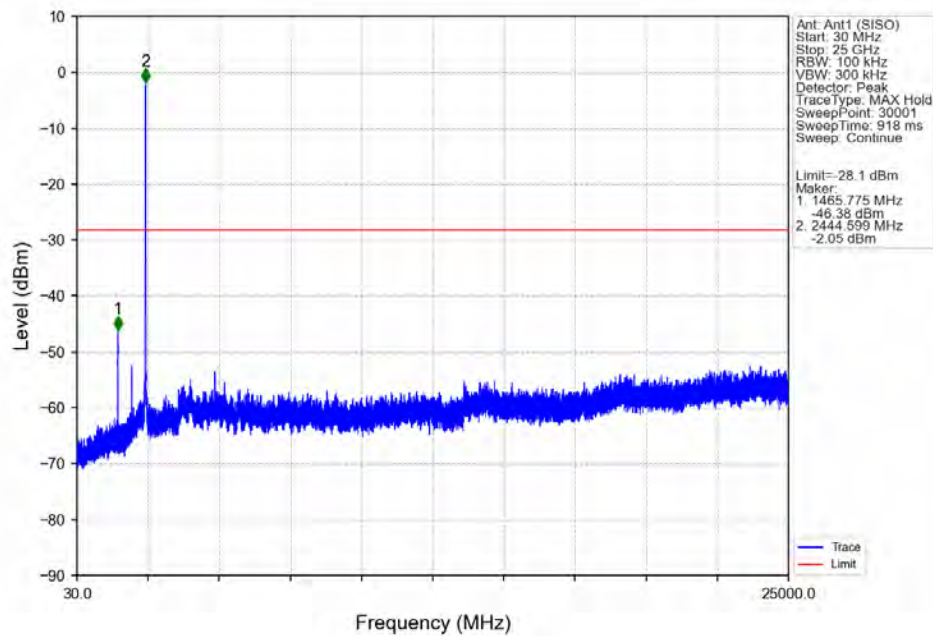


802.11n(HT20)_HCH_2462MHz_Ant1 (SISO)_NTNV

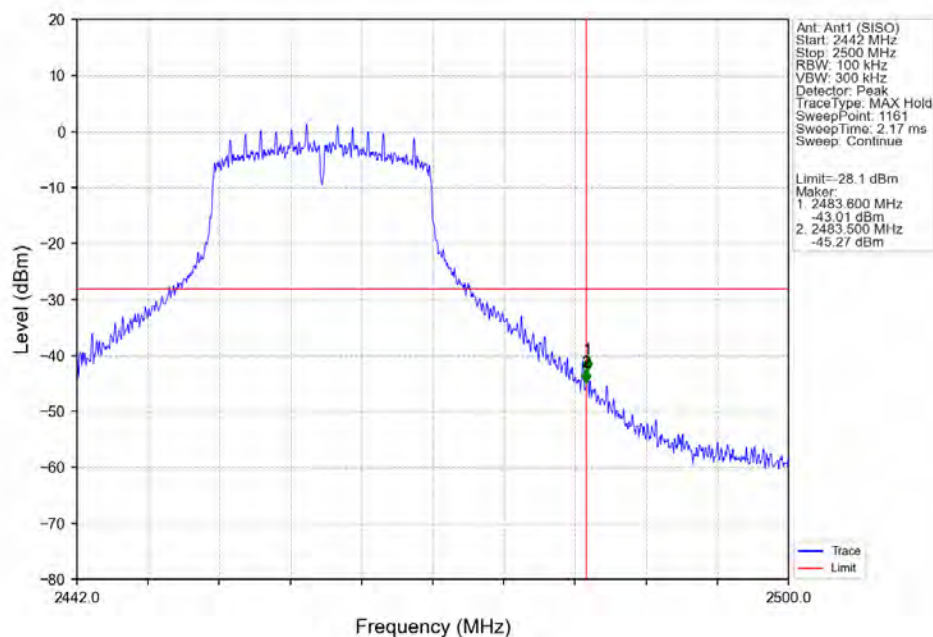

802.11n(HT20)_HCH_2462MHz_Ant1 (SISO)_NTNV

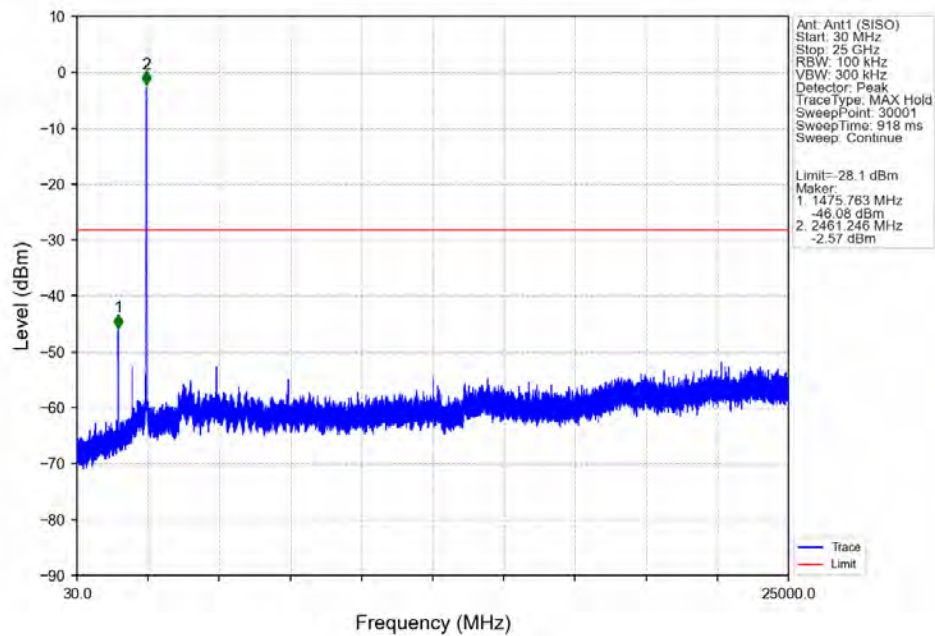

802.11n(HT40)_LCH_2422MHz_Ant1 (SISO)_NTNV

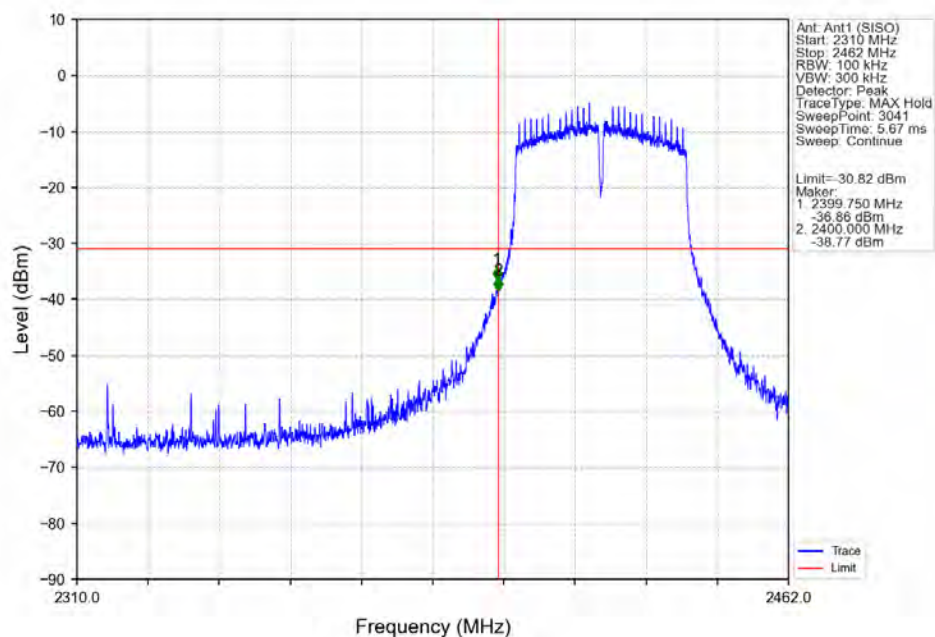


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240800162403

Page: 186 of 192


802.11n(HT40)_LCH_2422MHz_Ant1 (SISO)_NTNV

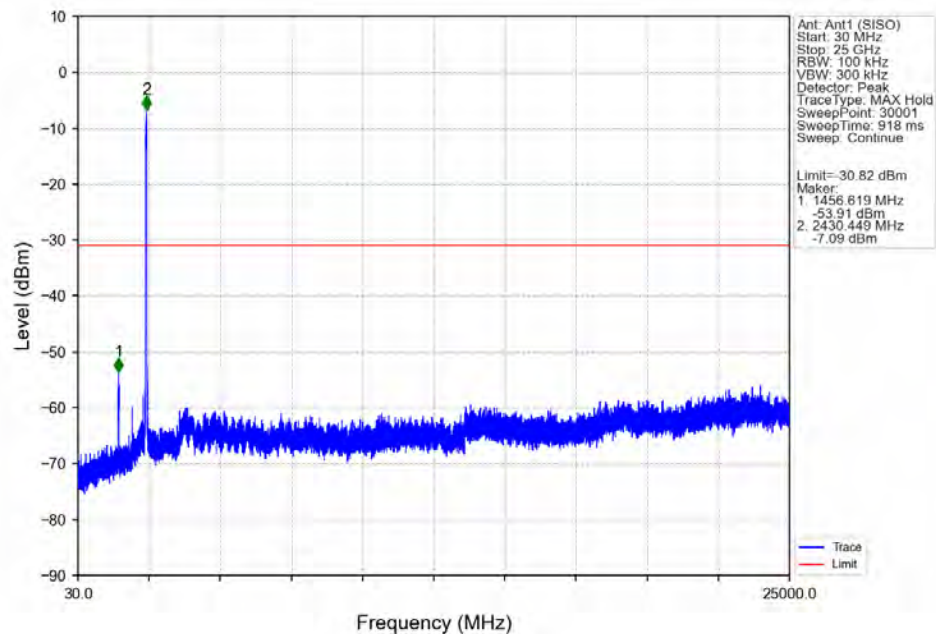


802.11n(HT40)_MCH_2437MHz_Ant1 (SISO)_NTNV

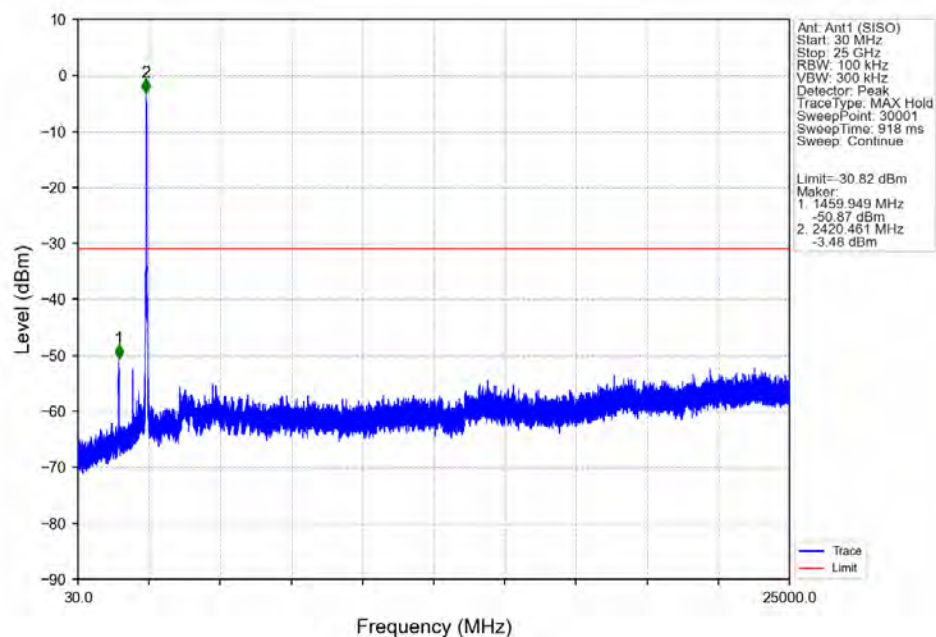


802.11n(HT40)_HCH_2452MHz_Ant1 (SISO)_NTNV

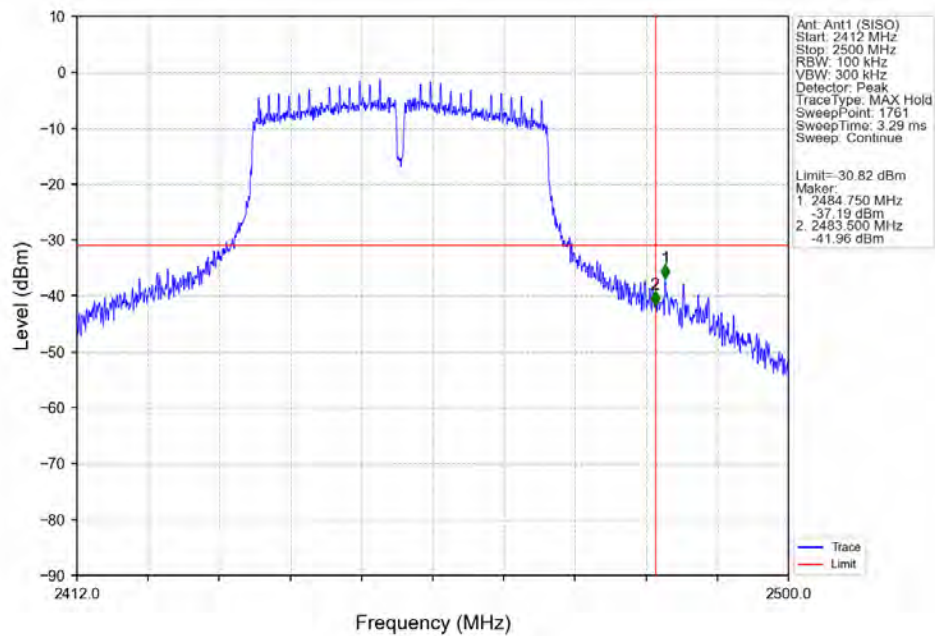


802.11n(HT40)_HCH_2452MHz_Ant1 (SISO)_NTNV

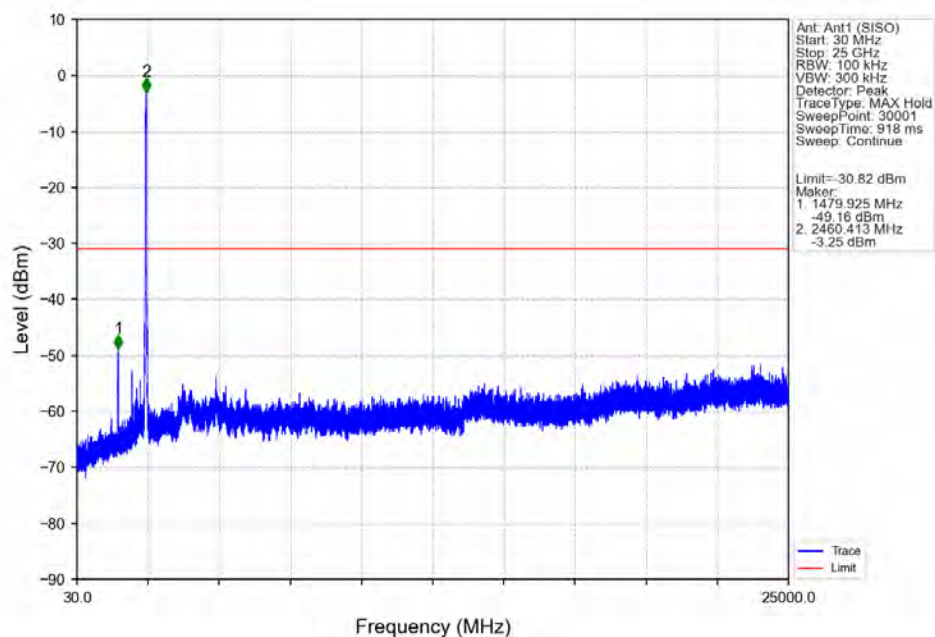


802.11ax(HE20)_LCH_2412MHz_RU242_Left_Ant1 (SISO)_NTNV

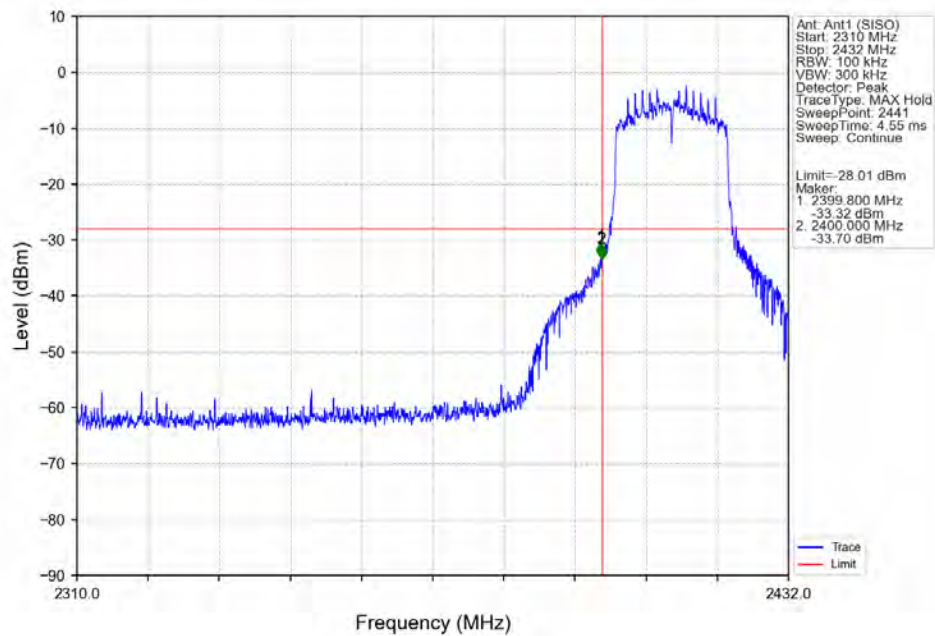


802.11ax(HE20)_LCH_2412MHz_RU242_Left_Ant1 (SISO)_NTNV

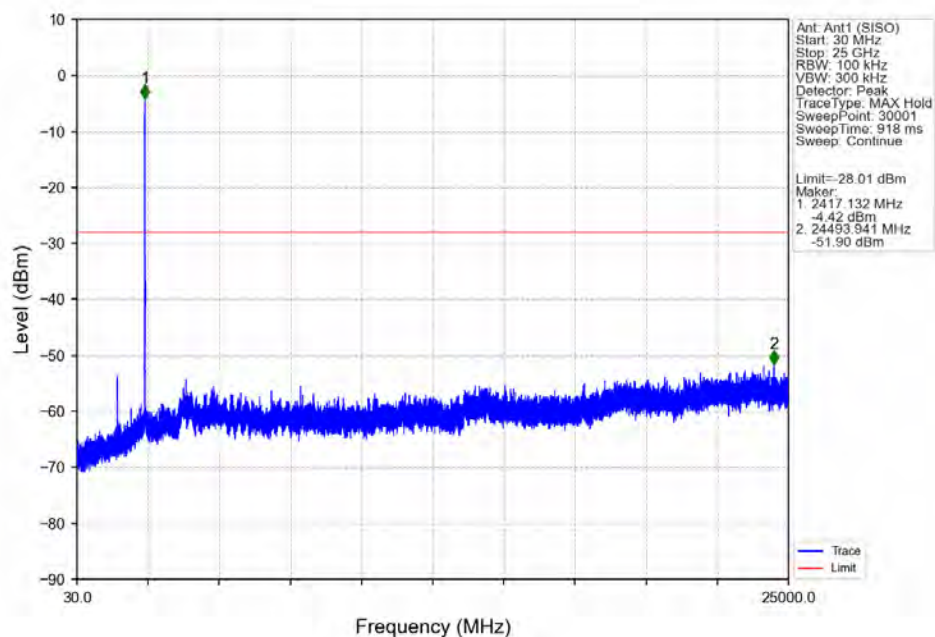


802.11ax(HE20)_MCH_2437MHz_RU242_Left_Ant1 (SISO)_NTNV

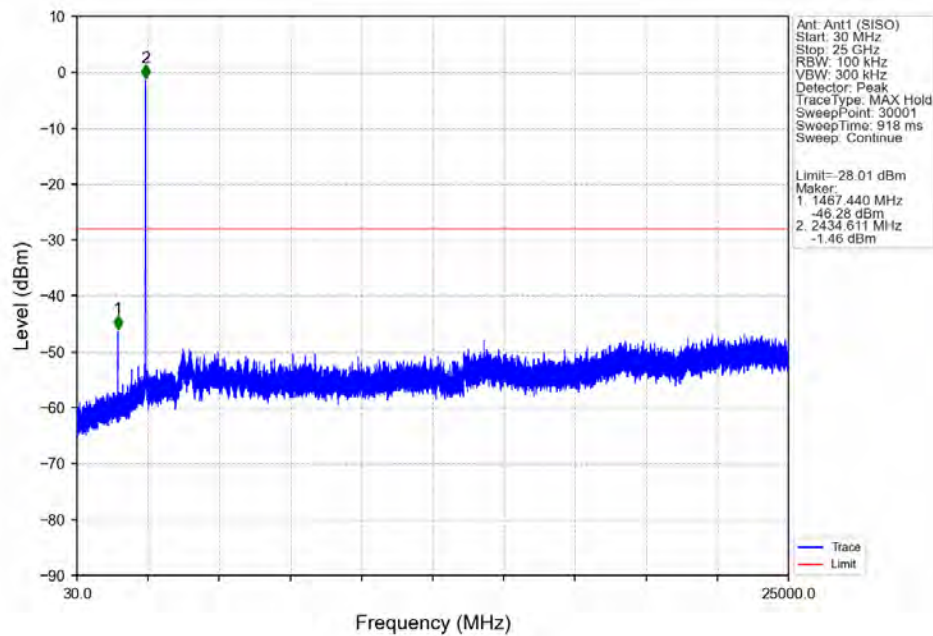


802.11ax(HE20)_HCH_2462MHz_RU242_Left_Ant1 (SISO)_NTNV

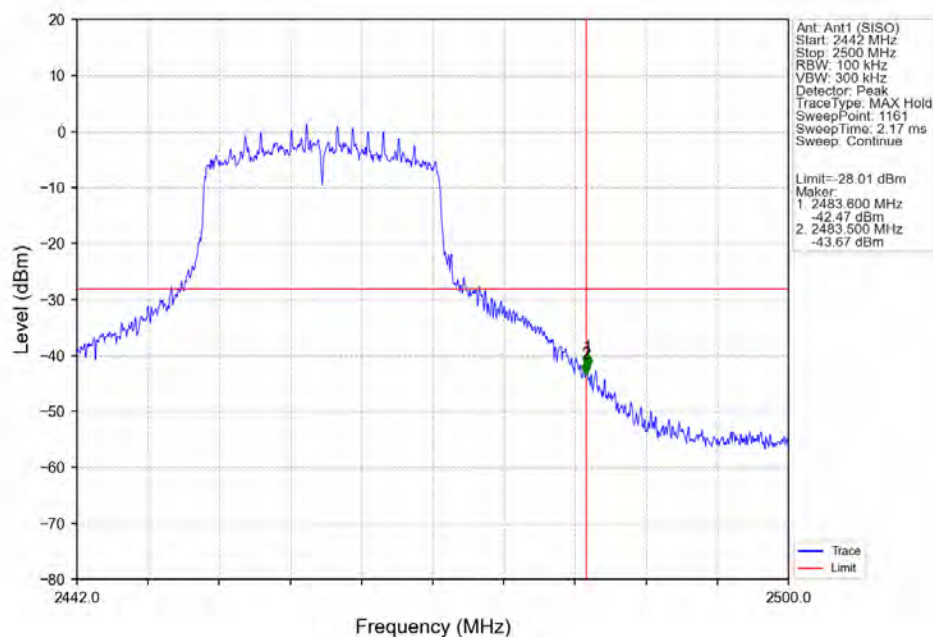


802.11ax(HE20)_HCH_2462MHz_RU242_Left_Ant1 (SISO)_NTNV

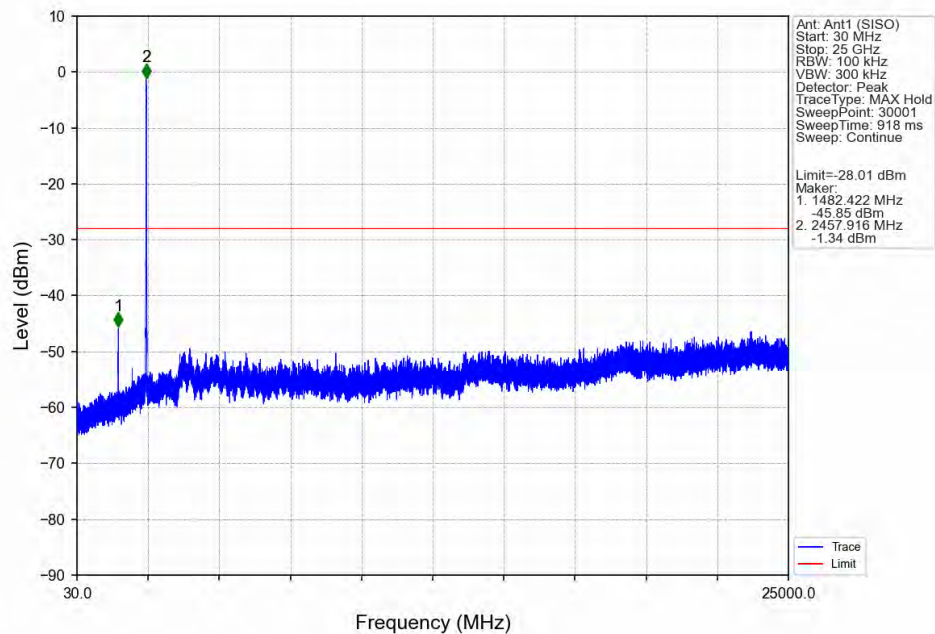


802.11ax(HE40)_LCH_2422MHz_RU484_Left_Ant1 (SISO)_NTNV

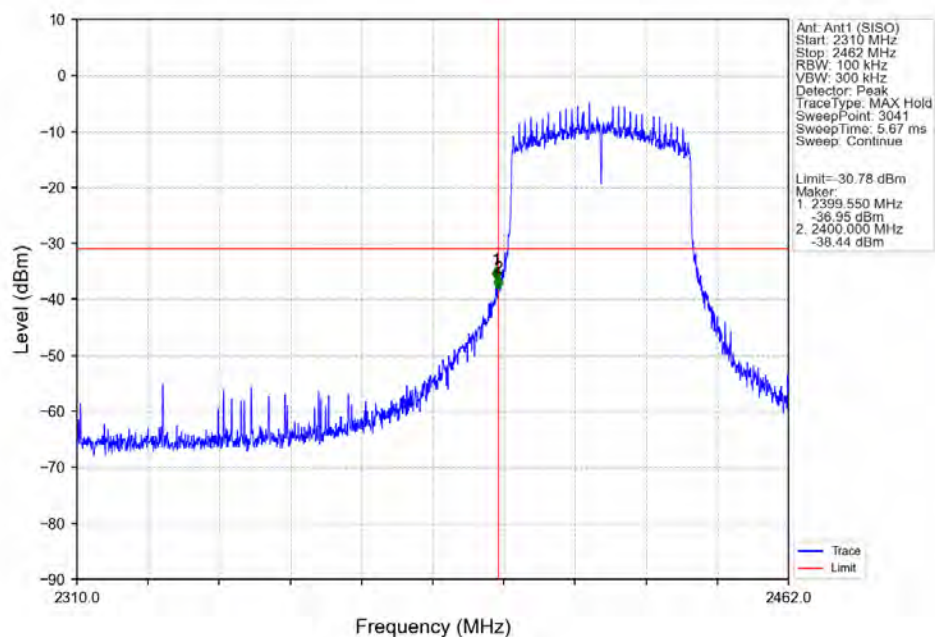


802.11ax(HE40)_LCH_2422MHz_RU484_Left_Ant1 (SISO)_NTNV

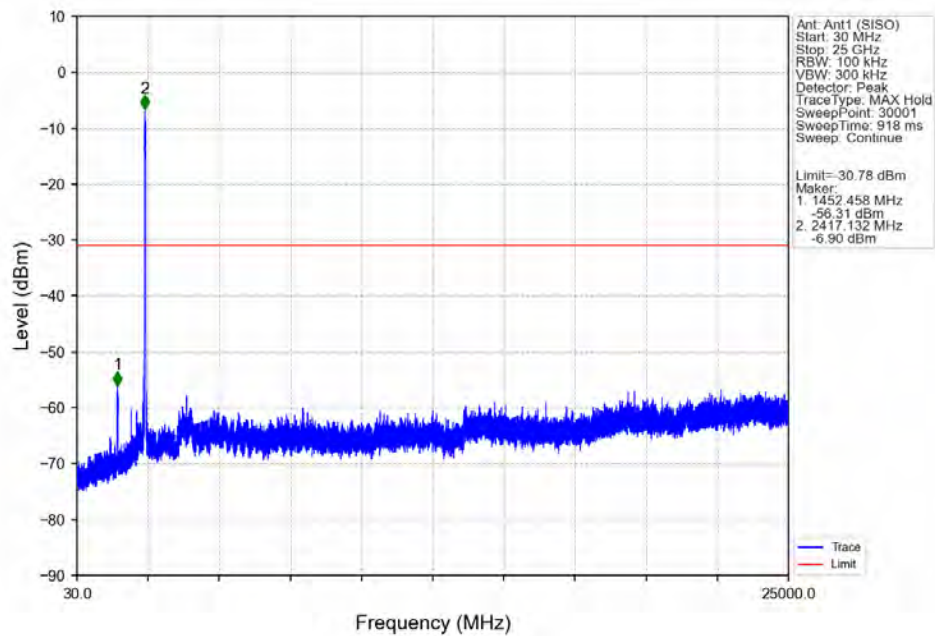

802.11ax(HE40)_MCH_2437MHz_RU484_Left_Ant1 (SISO)_NTNV

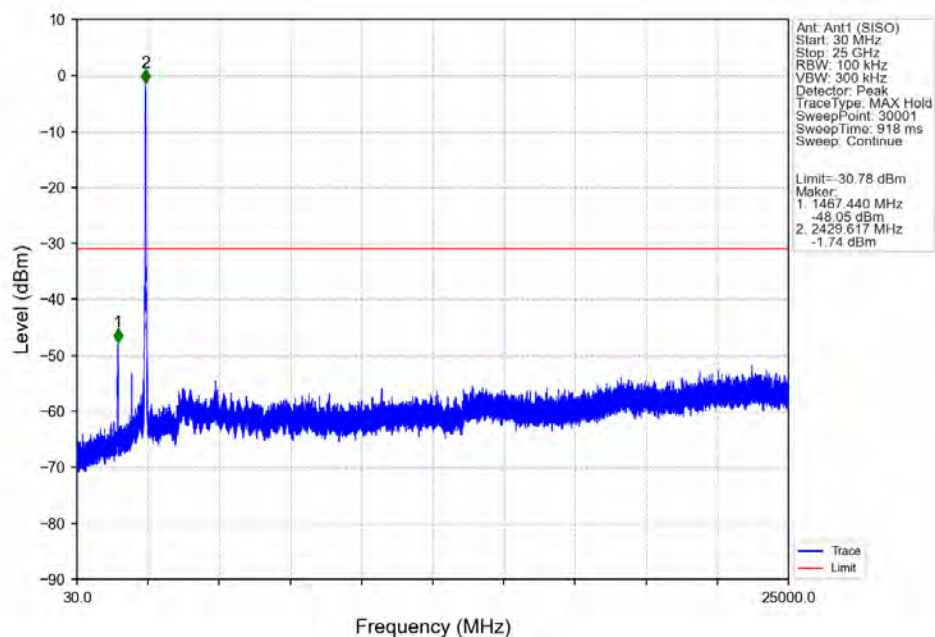

802.11ax(HE40)_HCH_2452MHz_RU484_Left_Ant1 (SISO)_NTNV

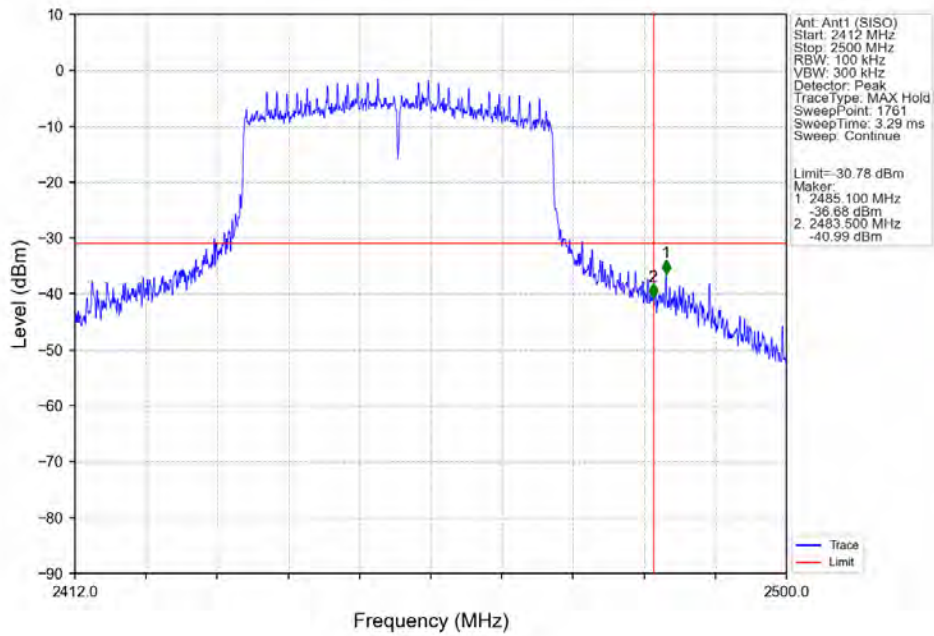

802.11ax(HE40)_HCH_2452MHz_RU484_Left_Ant1 (SISO)_NTNV

