



Appendix O: Test Data for E-UTRA Band 41

Product Name: Handheld Data Terminal

Test Model: HT330

Environmental Conditions

Temperature:	23.6° C
Relative Humidity:	52.3%
ATM Pressure:	100.0 kPa
Test Engineer:	Ling Zhu
Supervised by:	Li huan





O.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.91	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.90	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.95	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.13	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.04	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.08	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.13	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.02	PASS
Band41	5MHz	QPSK	40620	1RB#12	22.18	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.04	PASS
Band41	5MHz	QPSK	40620	12RB#0	21.26	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.23	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.32	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.25	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.88	PASS
Band41	5MHz	QPSK	41565	1RB#12	22.78	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.67	PASS
Band41	5MHz	QPSK	41565	12RB#0	21.90	PASS
Band41	5MHz	QPSK	41565	12RB#6	21.87	PASS
Band41	5MHz	QPSK	41565	12RB#13	21.80	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.82	PASS
Band41	5MHz	16QAM	39675	1RB#0	20.81	PASS
Band41	5MHz	16QAM	39675	1RB#12	20.71	PASS
Band41	5MHz	16QAM	39675	1RB#24	20.66	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.01	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.99	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.04	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.05	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.08	PASS
Band41	5MHz	16QAM	40620	1RB#12	20.96	PASS





Band41	5MHz	16QAM	40620	1RB#24	21.05	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.24	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.22	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.23	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.40	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.64	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.57	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.33	PASS
Band41	5MHz	16QAM	41565	12RB#0	20.91	PASS
Band41	5MHz	16QAM	41565	12RB#6	20.88	PASS
Band41	5MHz	16QAM	41565	12RB#13	20.76	PASS
Band41	5MHz	16QAM	41565	25RB#0	20.86	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.07	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.25	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.33	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.39	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.38	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.37	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.36	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.17	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.38	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.19	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.55	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.53	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.45	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.48	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.68	PASS
Band41	10MHz	QPSK	41540	1RB#24	23.00	PASS
Band41	10MHz	QPSK	41540	1RB#49	22.78	PASS
Band41	10MHz	QPSK	41540	25RB#0	22.01	PASS
Band41	10MHz	QPSK	41540	25RB#12	22.02	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.92	PASS
Band41	10MHz	QPSK	41540	50RB#0	22.03	PASS
Band41	10MHz	16QAM	39700	1RB#0	21.18	PASS
Band41	10MHz	16QAM	39700	1RB#24	21.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#49	21.27	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.27	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.26	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.36	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.37	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.28	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.30	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.24	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.43	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.42	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.36	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.59	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.72	PASS
Band41	10MHz	16QAM	41540	1RB#24	22.01	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.65	PASS
Band41	10MHz	16QAM	41540	25RB#0	21.05	PASS
Band41	10MHz	16QAM	41540	25RB#12	21.01	PASS
Band41	10MHz	16QAM	41540	25RB#25	20.84	PASS
Band41	10MHz	16QAM	41540	50RB#0	21.13	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.95	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.18	PASS
Band41	15MHz	QPSK	39725	1RB#74	22.35	PASS
Band41	15MHz	QPSK	39725	38RB#0	20.88	PASS
Band41	15MHz	QPSK	39725	38RB#18	21.66	PASS
Band41	15MHz	QPSK	39725	38RB#37	21.37	PASS
Band41	15MHz	QPSK	39725	75RB#0	21.35	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.20	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.50	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.20	PASS
Band41	15MHz	QPSK	40620	38RB#0	21.76	PASS
Band41	15MHz	QPSK	40620	38RB#18	21.82	PASS
Band41	15MHz	QPSK	40620	38RB#37	21.74	PASS
Band41	15MHz	QPSK	40620	75RB#0	21.47	PASS
Band41	15MHz	QPSK	41515	1RB#0	22.95	PASS
Band41	15MHz	QPSK	41515	1RB#38	23.20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	1RB#74	23.06	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.92	PASS
Band41	15MHz	QPSK	41515	38RB#18	22.53	PASS
Band41	15MHz	QPSK	41515	38RB#37	22.32	PASS
Band41	15MHz	QPSK	41515	75RB#0	22.17	PASS
Band41	15MHz	16QAM	39725	1RB#0	20.96	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.62	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.12	PASS
Band41	15MHz	16QAM	39725	38RB#0	21.40	PASS
Band41	15MHz	16QAM	39725	38RB#18	21.41	PASS
Band41	15MHz	16QAM	39725	38RB#37	21.74	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.38	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.77	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.58	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.75	PASS
Band41	15MHz	16QAM	40620	38RB#0	21.77	PASS
Band41	15MHz	16QAM	40620	38RB#18	21.81	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.97	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.50	PASS
Band41	15MHz	16QAM	41515	1RB#0	22.41	PASS
Band41	15MHz	16QAM	41515	1RB#38	22.48	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.73	PASS
Band41	15MHz	16QAM	41515	38RB#0	22.41	PASS
Band41	15MHz	16QAM	41515	38RB#18	23.02	PASS
Band41	15MHz	16QAM	41515	38RB#37	22.34	PASS
Band41	15MHz	16QAM	41515	75RB#0	21.15	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.99	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.45	PASS
Band41	20MHz	QPSK	39750	1RB#99	22.47	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.35	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.33	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.42	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.37	PASS
Band41	20MHz	QPSK	40620	1RB#0	22.25	PASS
Band41	20MHz	QPSK	40620	1RB#49	22.40	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	1RB#99	22.19	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.44	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.47	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.46	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.54	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.97	PASS
Band41	20MHz	QPSK	41490	1RB#49	23.19	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.65	PASS
Band41	20MHz	QPSK	41490	50RB#0	22.16	PASS
Band41	20MHz	QPSK	41490	50RB#25	22.15	PASS
Band41	20MHz	QPSK	41490	50RB#50	22.18	PASS
Band41	20MHz	QPSK	41490	100RB#0	22.14	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.47	PASS
Band41	20MHz	16QAM	39750	1RB#49	22.09	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.65	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.42	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.34	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.41	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.38	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.29	PASS
Band41	20MHz	16QAM	40620	1RB#49	22.34	PASS
Band41	20MHz	16QAM	40620	1RB#99	20.99	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.51	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.52	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.54	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.57	PASS
Band41	20MHz	16QAM	41490	1RB#0	22.44	PASS
Band41	20MHz	16QAM	41490	1RB#49	22.25	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.64	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.26	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.21	PASS
Band41	20MHz	16QAM	41490	50RB#50	21.38	PASS
Band41	20MHz	16QAM	41490	100RB#0	21.10	PASS





O.2 Peak-to-Average Ratio(CCDF)

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	5.15	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	5.12	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	5.17	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	6.19	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	6.10	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	6.17	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	5.11	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	5.08	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	5.08	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	5.93	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	5.94	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	5.95	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	5.29	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	5.26	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	5.27	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	6.01	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	5.99	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	6.00	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	5.08	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	5.05	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	5.08	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	5.93	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	6.13	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	7.43	13	PASS






Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

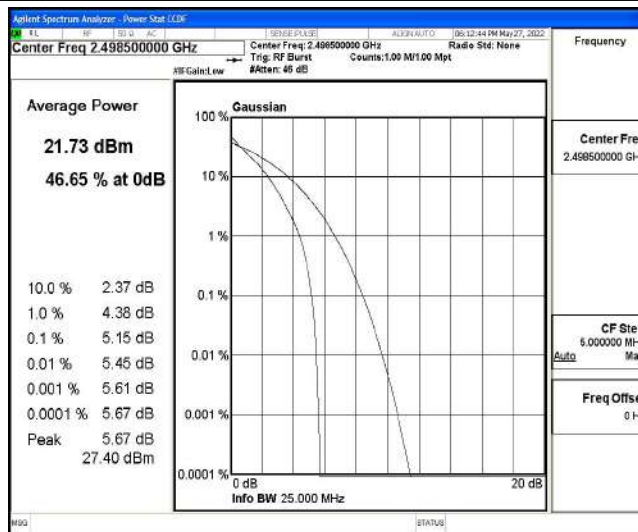


Band41-5MHz-QPSK-40620-25RB#0

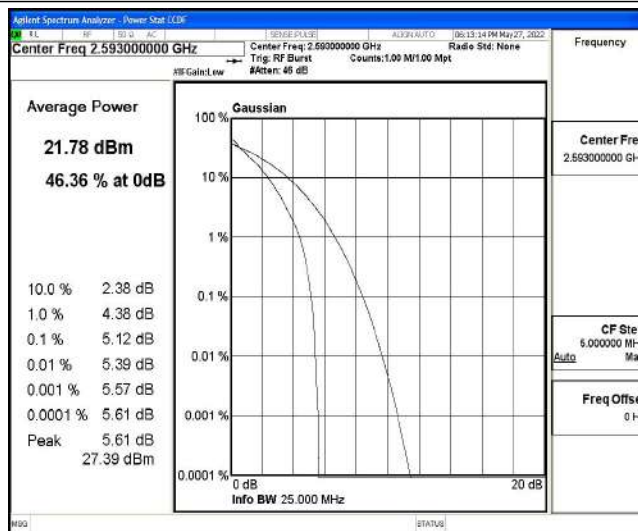


Band41-5MHz-QPSK-41565-25RB#0




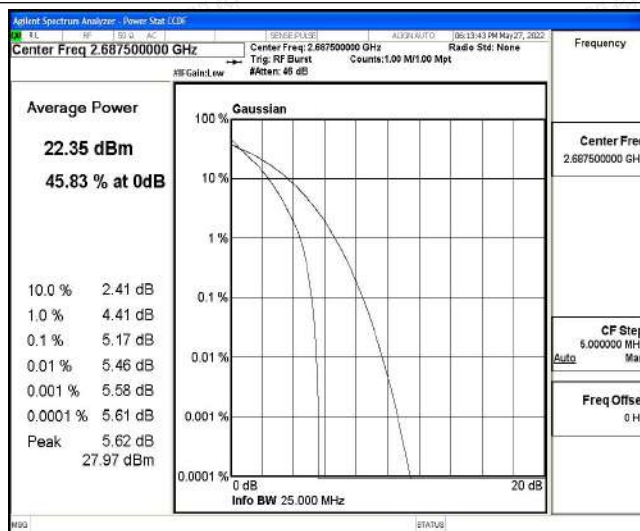

Band41-5MHz-16QAM-39675-25RB#0

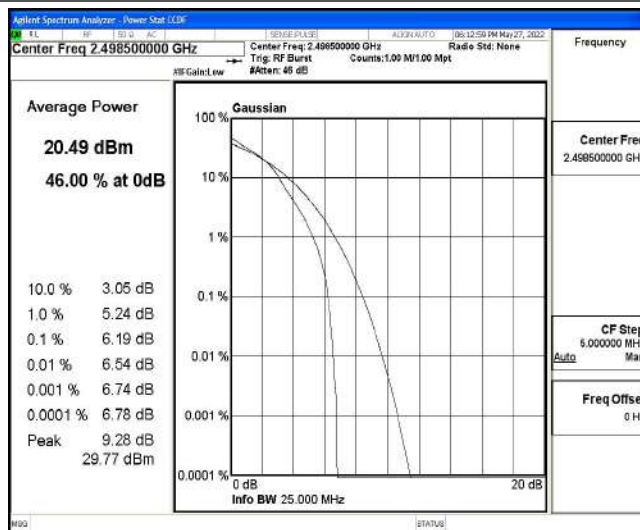

Band41-5MHz-16QAM-40620-25RB#0

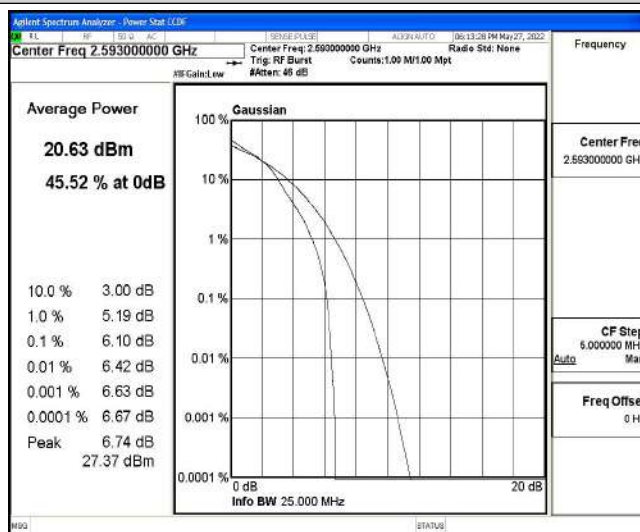

Band41-5MHz-16QAM-41565-25RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

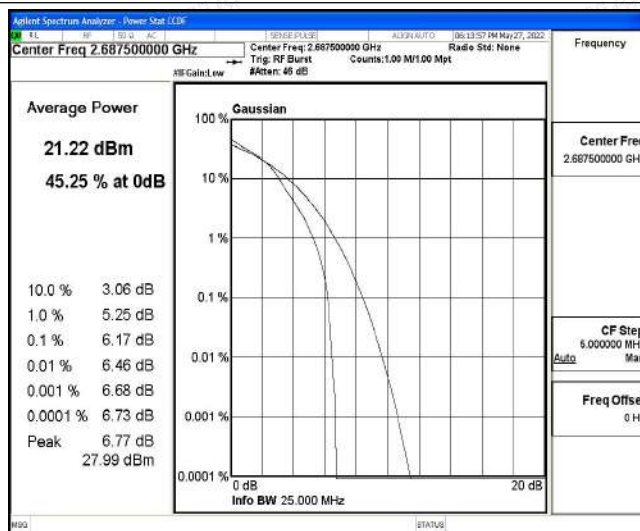

Band41-10MHz-QPSK-39700-50RB#0

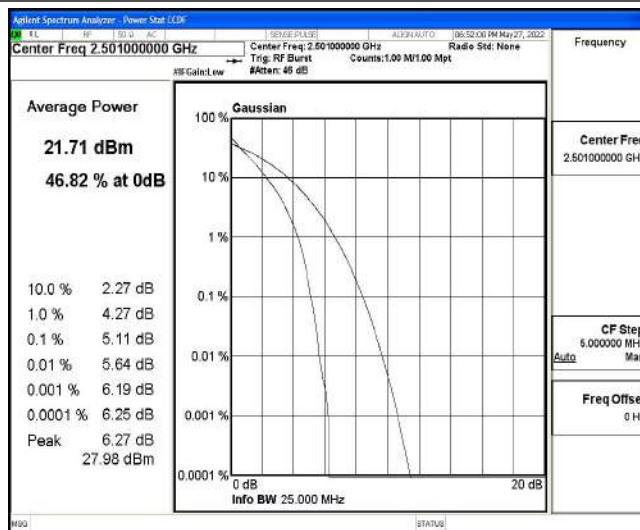


Band41-10MHz-QPSK-40620-50RB#0

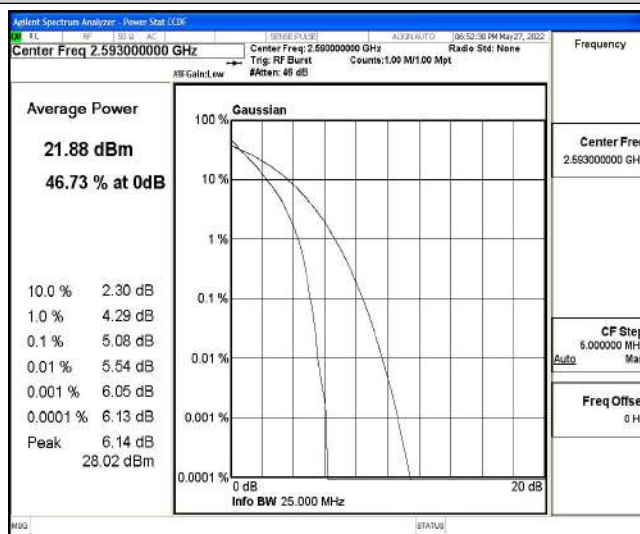


Band41-10MHz-QPSK-41540-50RB#0




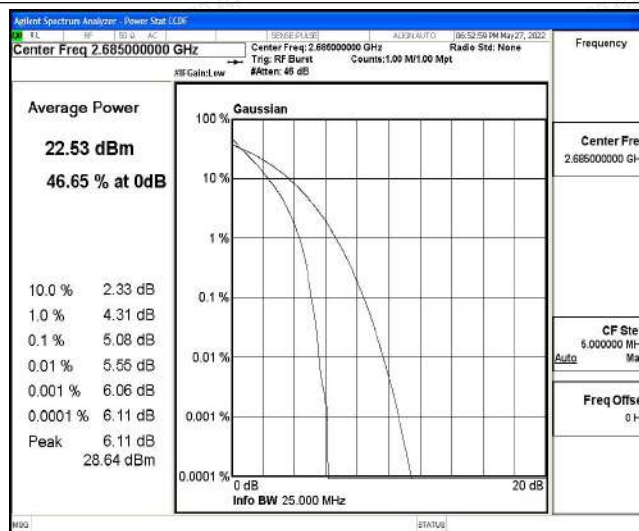

Band41-10MHz-16QAM-39700-50RB#0

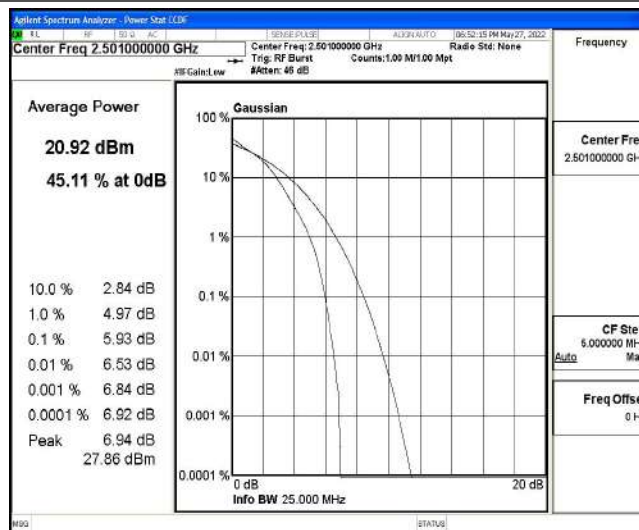


Band41-10MHz-16QAM-40620-50RB#0

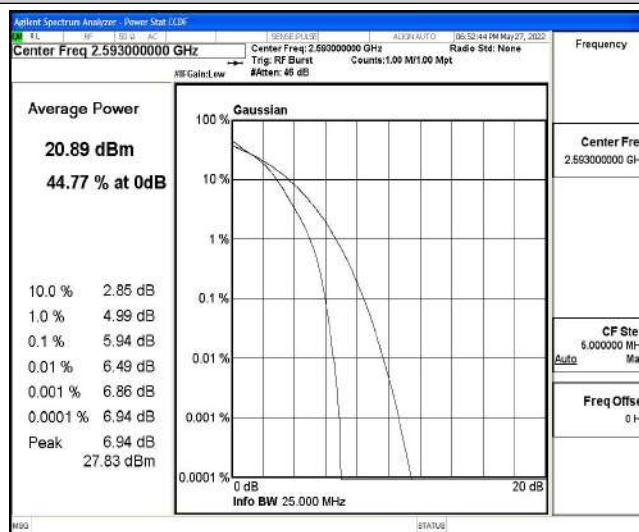


Band41-10MHz-16QAM-41540-50RB#0




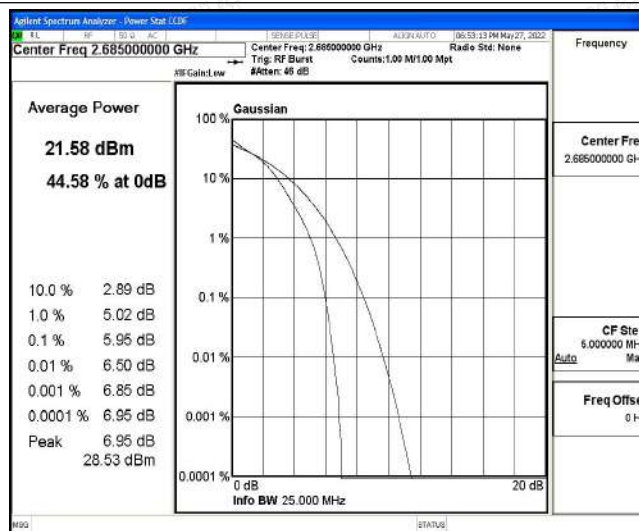

Band41-15MHz-QPSK-39725-75RB#0

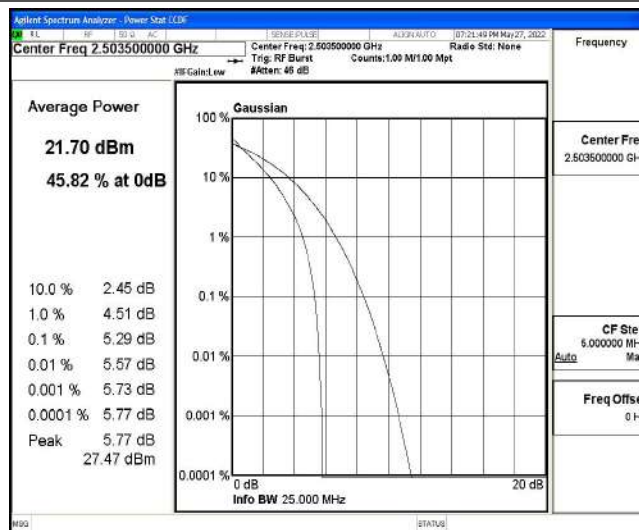


Band41-15MHz-QPSK-40620-75RB#0

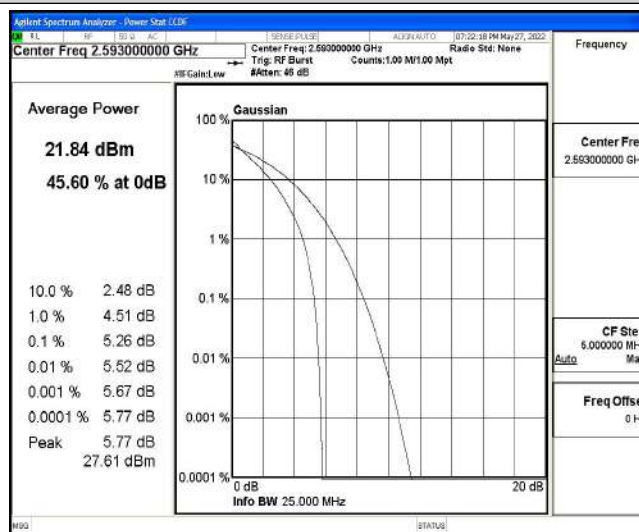


Band41-15MHz-QPSK-41515-75RB#0




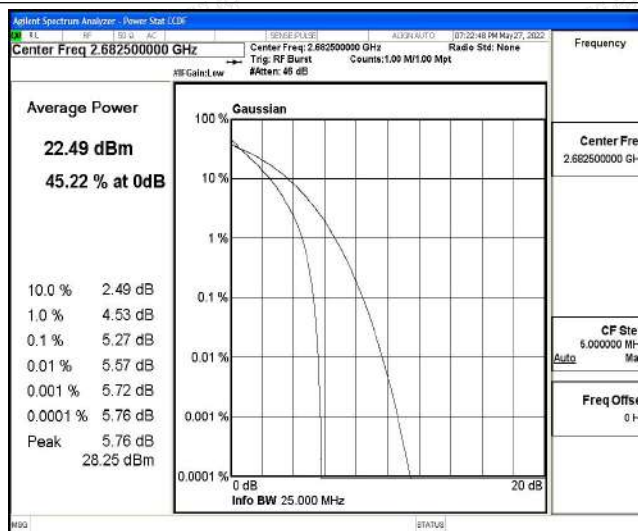

Band41-15MHz-16QAM-39725-75RB#0

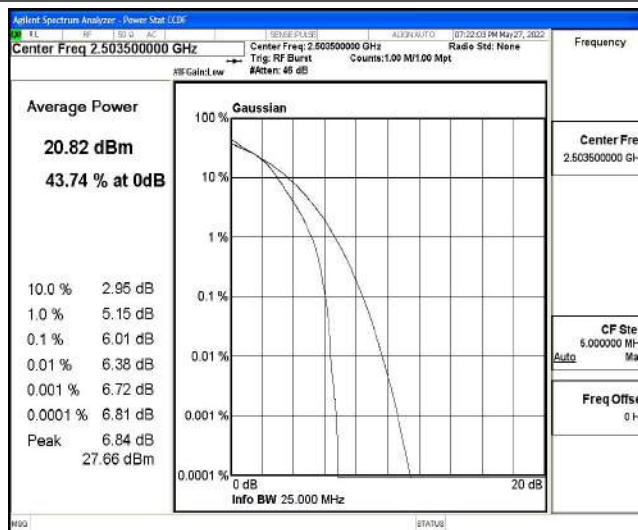


Band41-15MHz-16QAM-40620-75RB#0

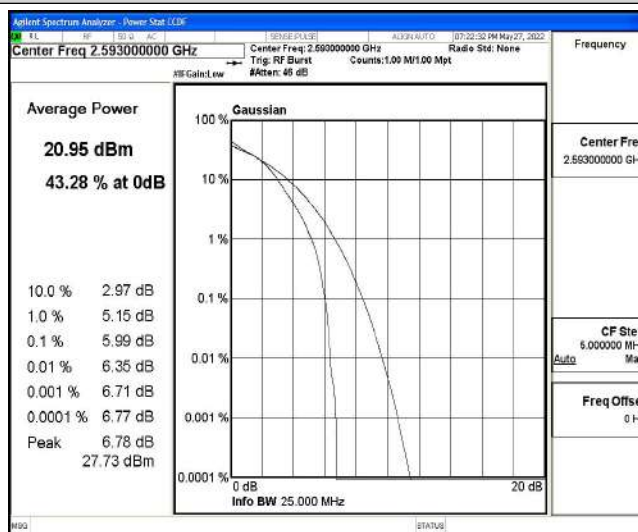


Band41-15MHz-16QAM-41515-75RB#0




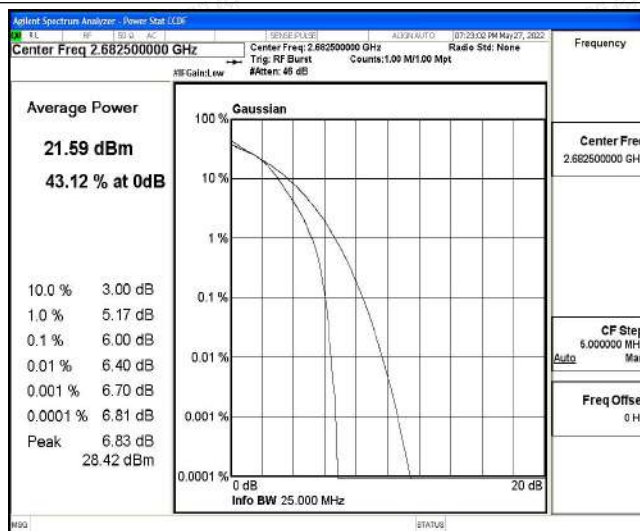

Band41-20MHz-QPSK-39750-100RB#0

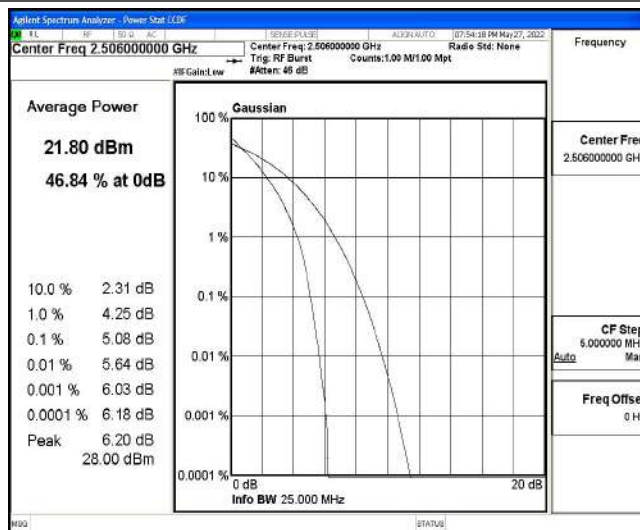


Band41-20MHz-QPSK-40620-100RB#0

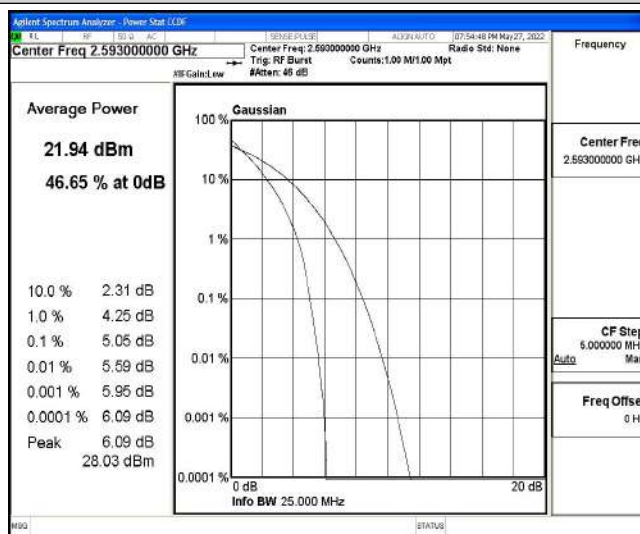


Band41-20MHz-QPSK-41490-100RB#0




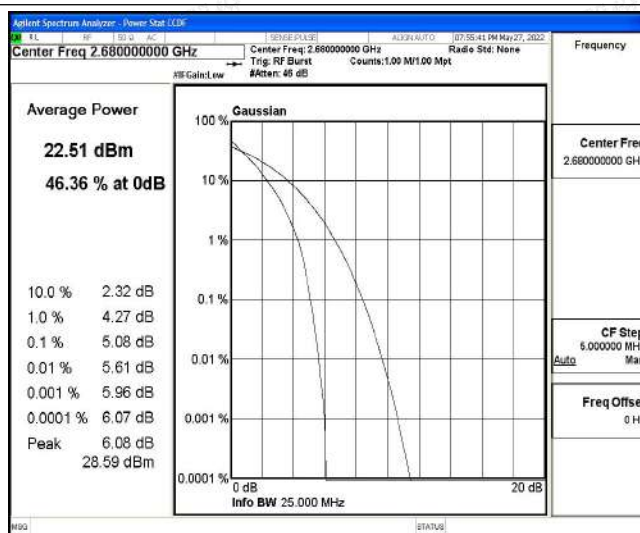

Band41-20MHz-16QAM-39750-100RB#0

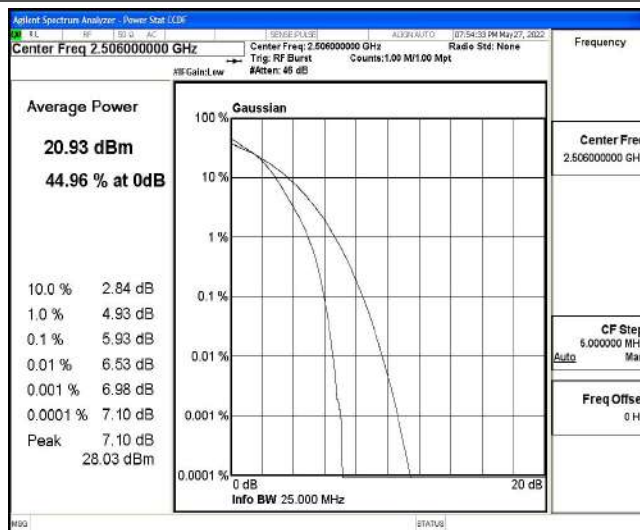


Band41-20MHz-16QAM-40620-100RB#0

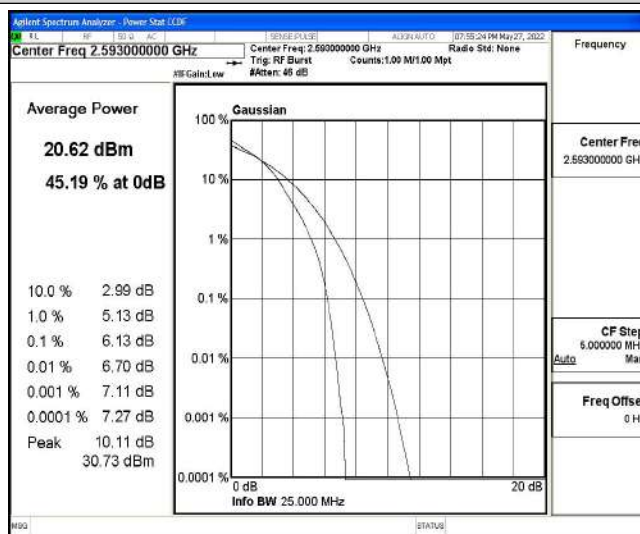

Band41-20MHz-16QAM-41490-100RB#0



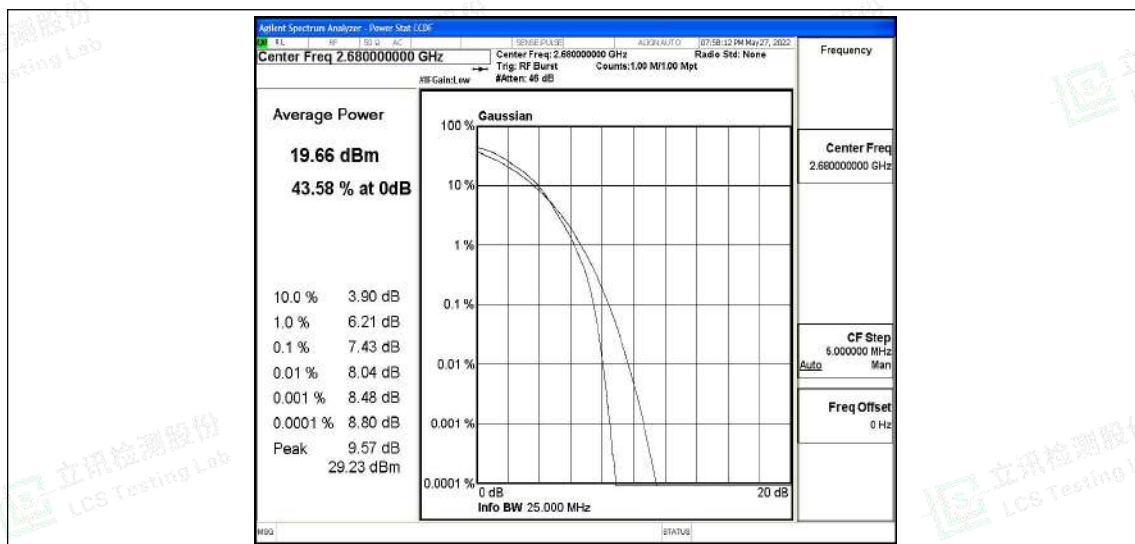



O.3 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5031	4.973	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5059	4.990	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.5084	5.012	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5016	5.271	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.4912	5.375	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5031	5.109	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9672	10.77	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9790	10.77	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9748	10.52	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9452	9.847	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9523	9.862	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9641	9.865	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.440	15.33	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.469	16.23	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.374	15.28	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.426	15.54	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.490	16.02	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.495	15.32	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.832	19.30	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.950	19.23	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.836	19.43	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.870	19.90	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.918	19.24	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.830	19.38	PASS






Test Graphs

Band41-5MHz-QPSK-39675-25RB#0

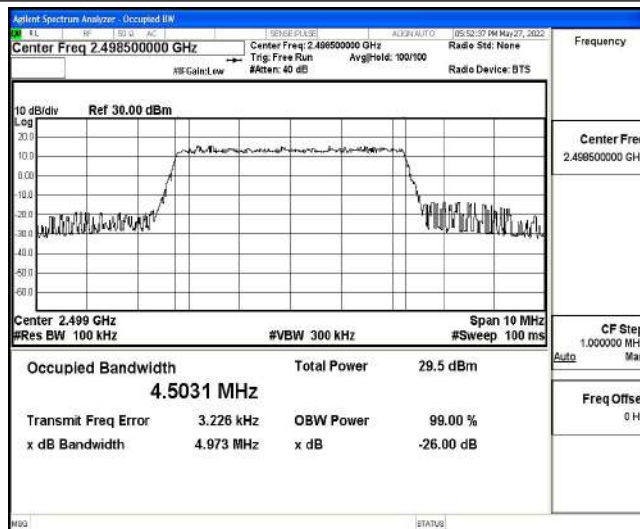


Band41-5MHz-QPSK-40620-25RB#0

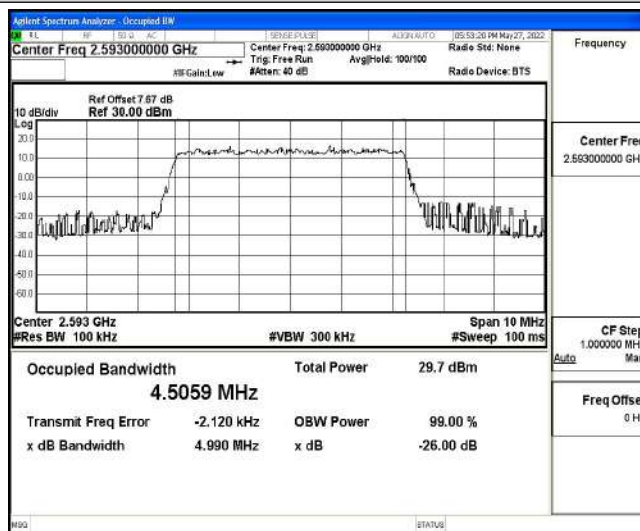


Band41-5MHz-QPSK-41565-25RB#0




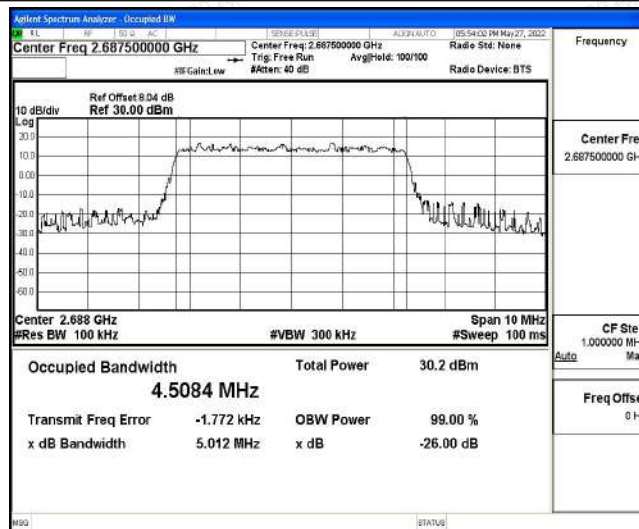

Band41-5MHz-16QAM-39675-25RB#0

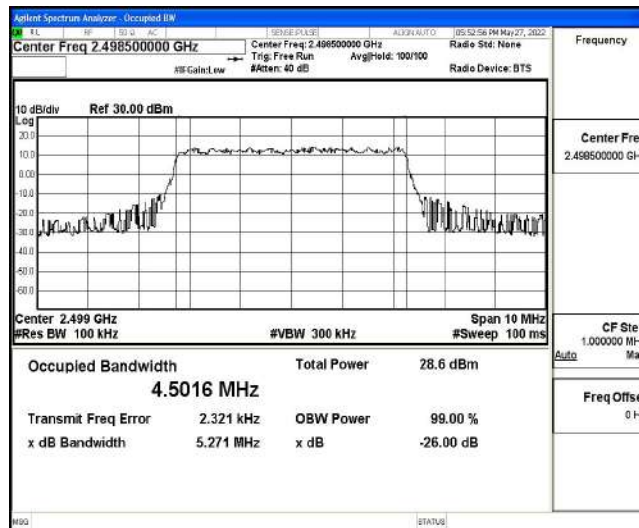


Band41-5MHz-16QAM-40620-25RB#0

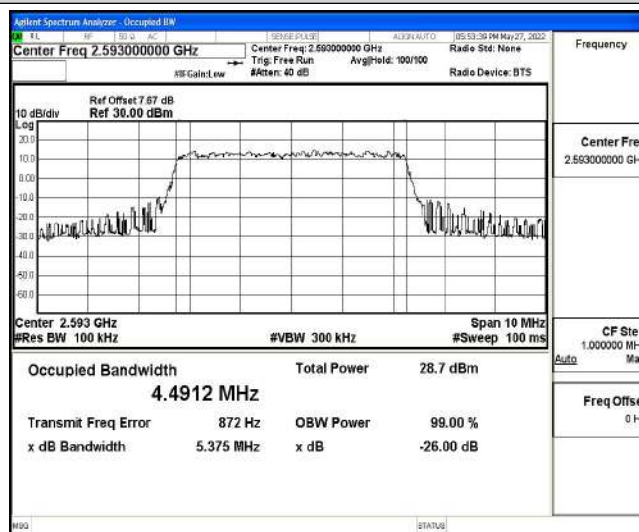


Band41-5MHz-16QAM-41565-25RB#0




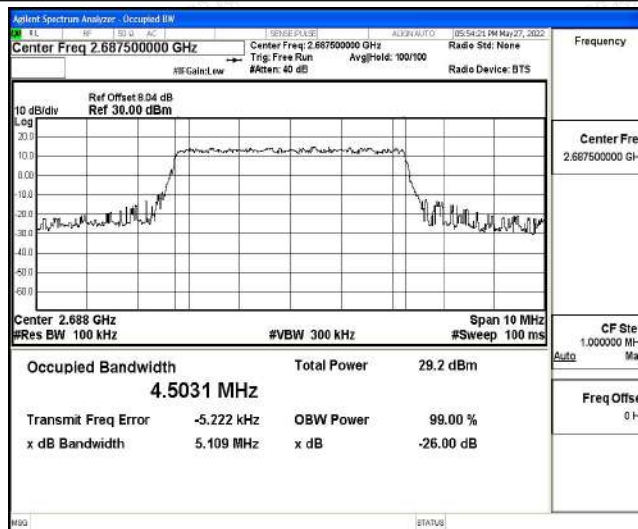

Band41-10MHz-QPSK-39700-50RB#0

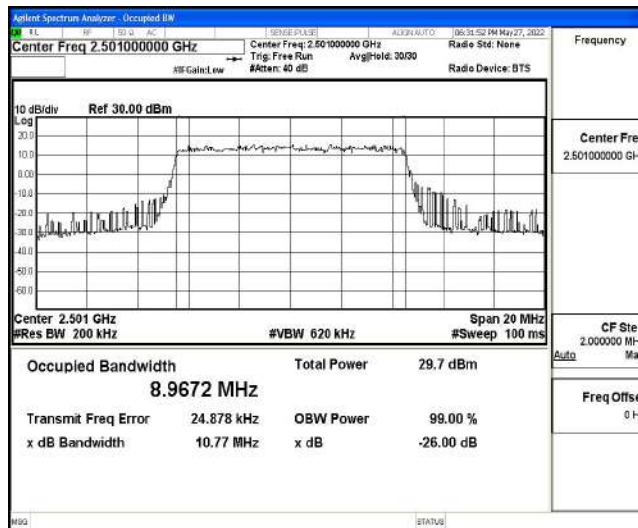


Band41-10MHz-QPSK-40620-50RB#0

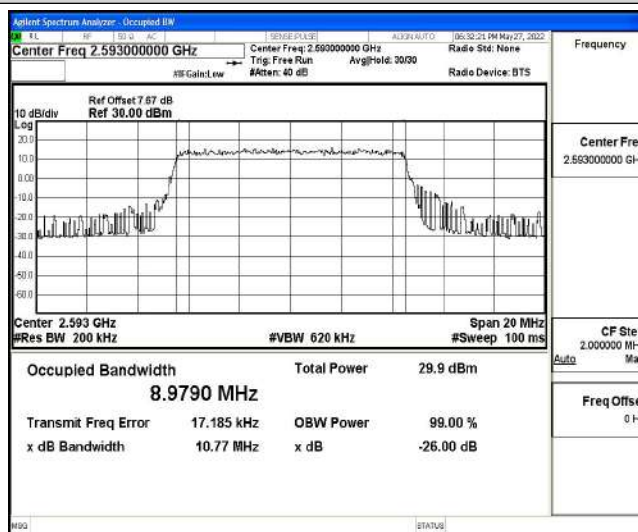


Band41-10MHz-QPSK-41540-50RB#0




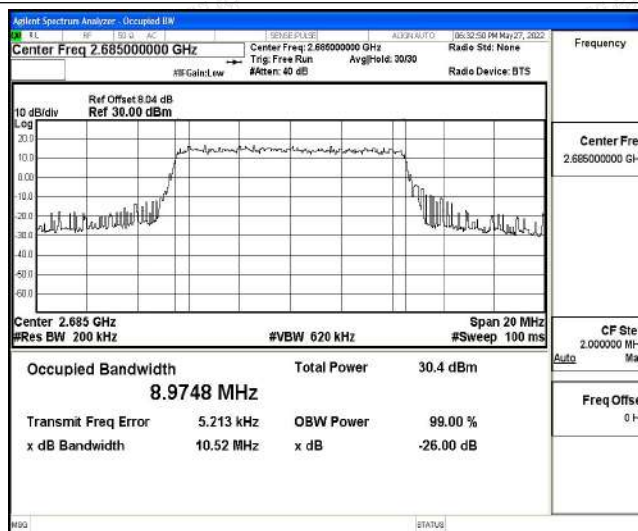

Band41-10MHz-16QAM-39700-50RB#0

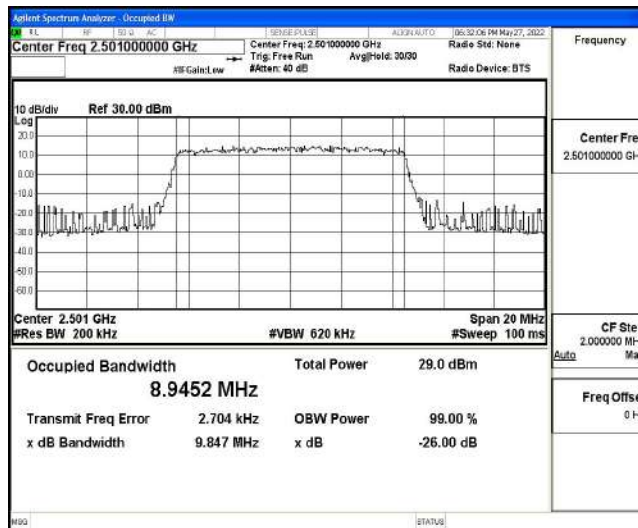

Band41-10MHz-16QAM-40620-50RB#0

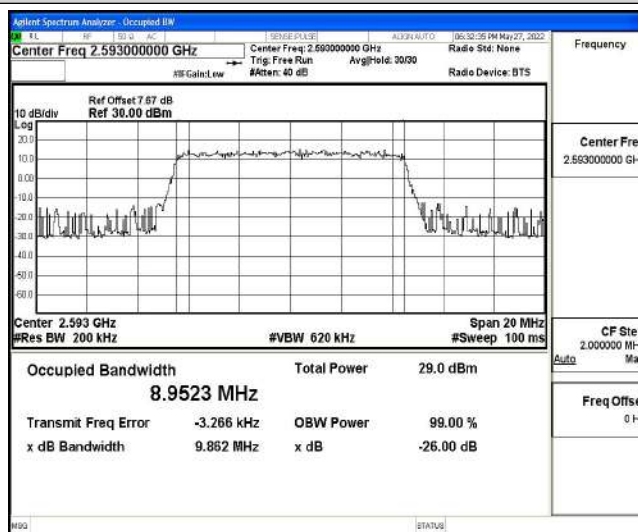

Band41-10MHz-16QAM-41540-50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

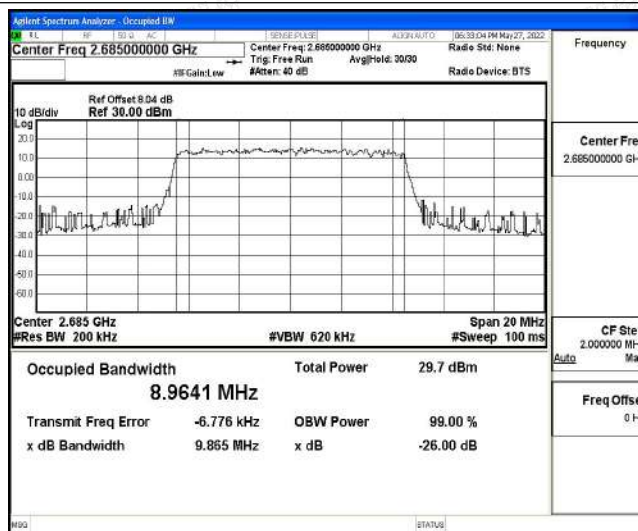

Band41-15MHz-QPSK-39725-75RB#0

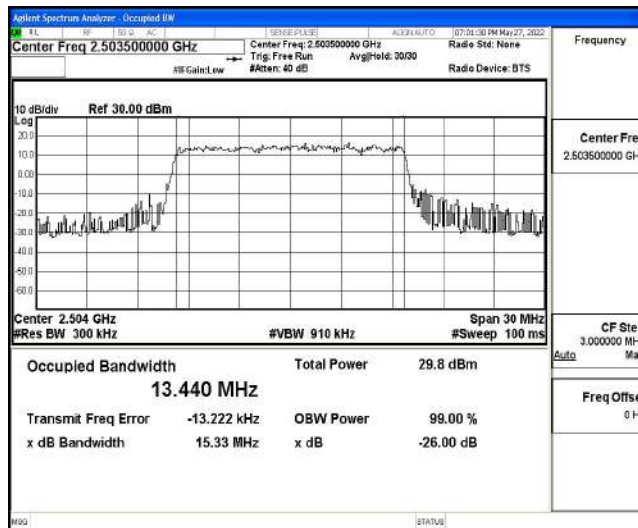


Band41-15MHz-QPSK-40620-75RB#0

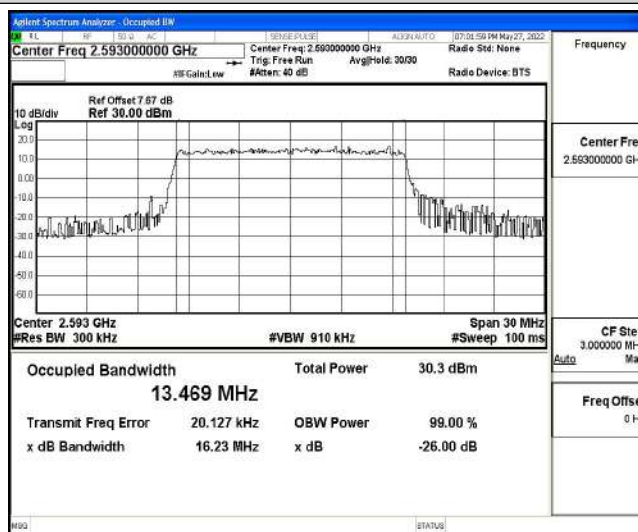


Band41-15MHz-QPSK-41515-75RB#0




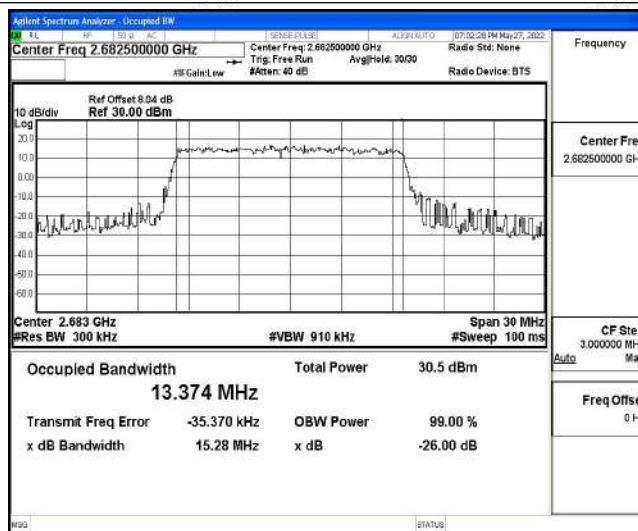

Band41-15MHz-16QAM-39725-75RB#0

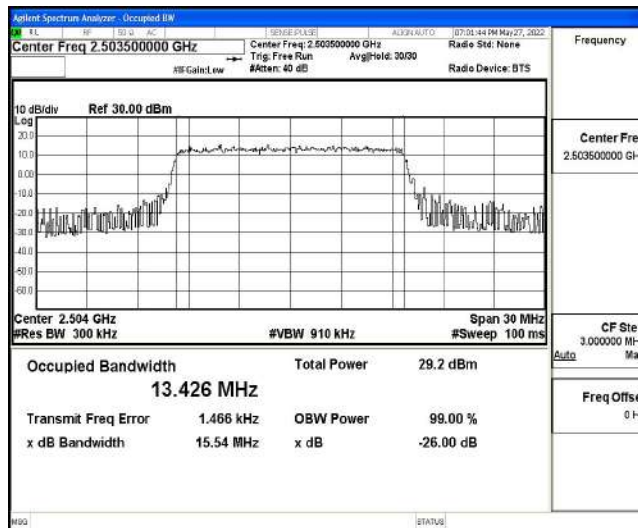


Band41-15MHz-16QAM-40620-75RB#0

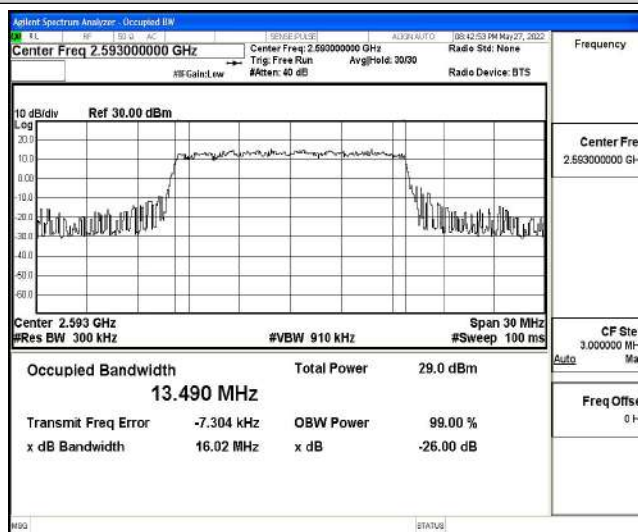


Band41-15MHz-16QAM-41515-75RB#0




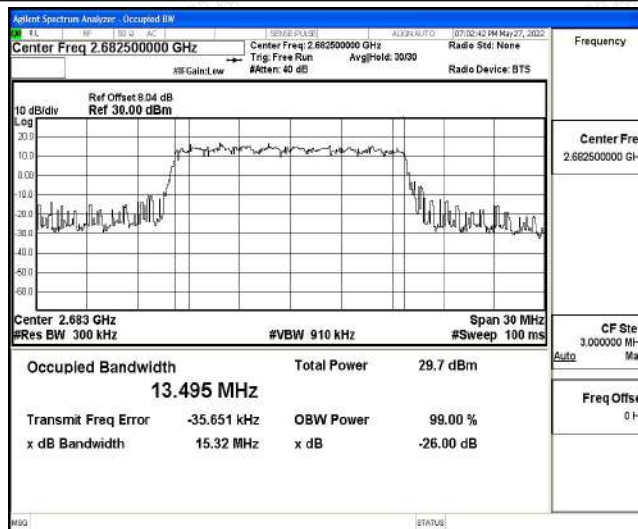

Band41-20MHz-QPSK-39750-100RB#0

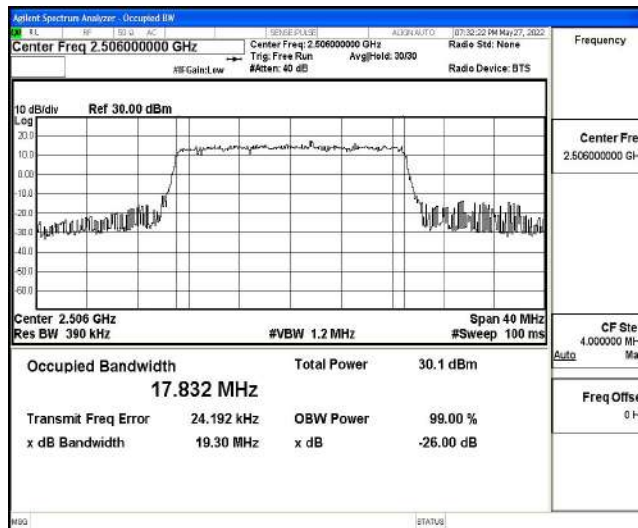


Band41-20MHz-QPSK-40620-100RB#0

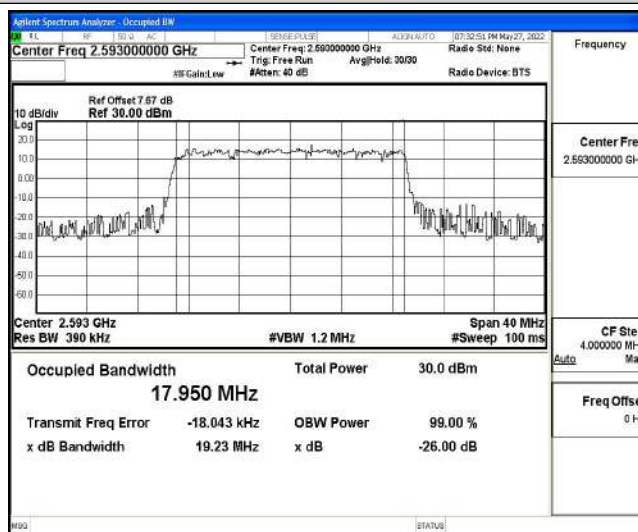


Band41-20MHz-QPSK-41490-100RB#0




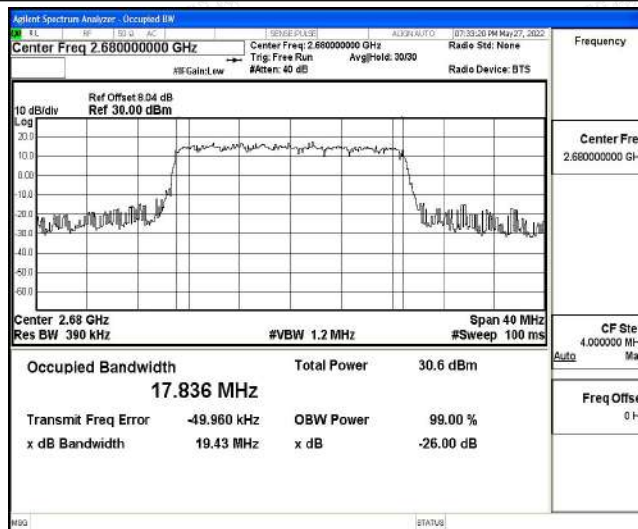

Band41-20MHz-16QAM-39750-100RB#0

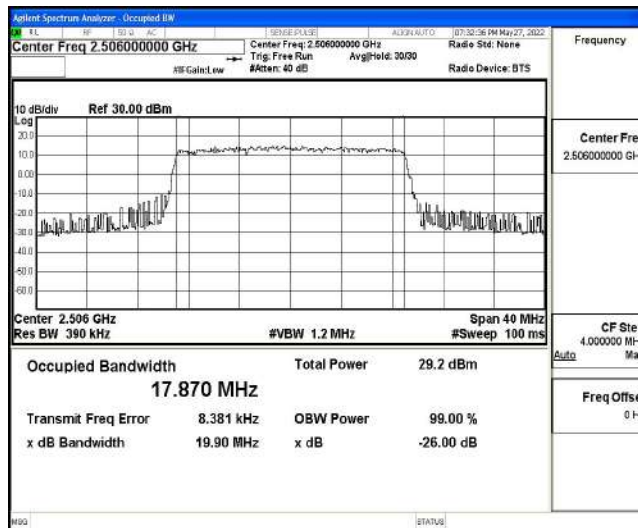


Band41-20MHz-16QAM-40620-100RB#0

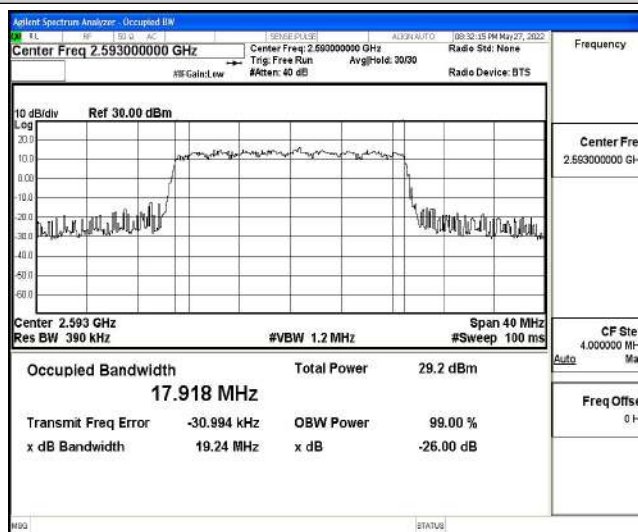

Band41-20MHz-16QAM-41490-100RB#0



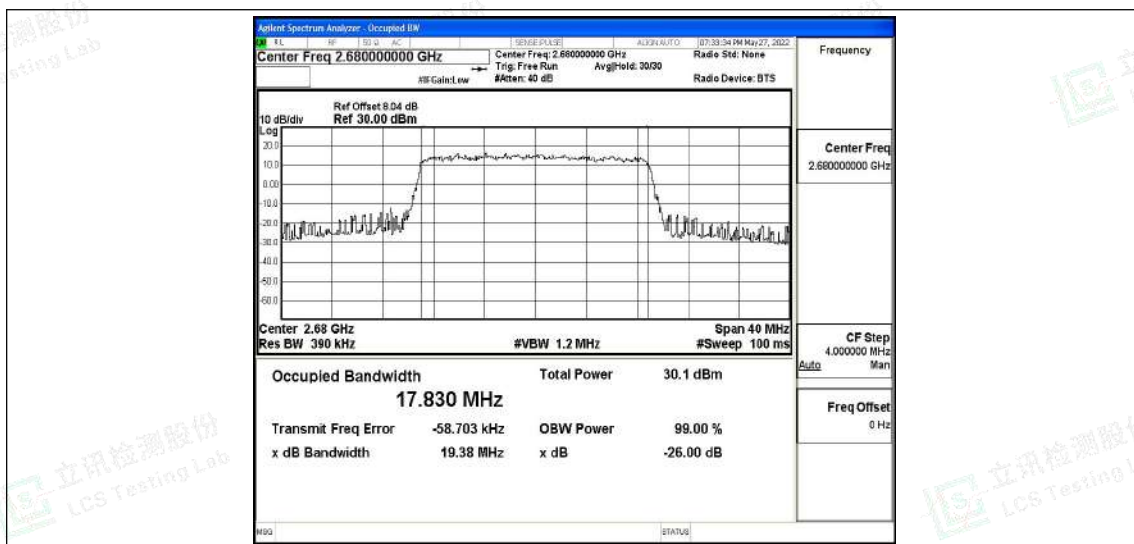





O.4 Band Edge

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-48.46,-40.34,-30.45	PASS
Band41	5MHz	QPSK	41565	25RB#0	-28.94,-36.76,-45.76,-45.63	PASS
Band41	5MHz	16QAM	39675	25RB#0	-48.75,-40.06,-33.04	PASS
Band41	5MHz	16QAM	41565	25RB#0	-31.14,-38.32,-45.53,-46.21	PASS
Band41	10MHz	QPSK	39700	50RB#0	-47.19,-38.40,-32.67	PASS
Band41	10MHz	QPSK	41540	50RB#0	-31.84,-36.59,-41.34,-45.61	PASS
Band41	10MHz	16QAM	39700	50RB#0	-47.36,-39.55,-33.97	PASS
Band41	10MHz	16QAM	41540	50RB#0	-33.14,-37.41,-41.64,-44.92	PASS
Band41	15MHz	QPSK	39725	75RB#0	-46.55,-36.52,-34.40	PASS
Band41	15MHz	QPSK	41515	75RB#0	-32.23,-33.87,-38.73,-44.13	PASS
Band41	15MHz	16QAM	39725	75RB#0	-46.32,-37.17,-36.59	PASS
Band41	15MHz	16QAM	41515	75RB#0	-34.87,-35.81,-39.62,-44.52	PASS
Band41	20MHz	QPSK	39750	100RB#0	-46.34,-37.23,-37.14	PASS
Band41	20MHz	QPSK	41490	100RB#0	-34.62,-37.03,-39.54,-44.66	PASS
Band41	20MHz	16QAM	39750	100RB#0	-46.41,-38.75,-36.91	PASS
Band41	20MHz	16QAM	41490	100RB#0	-35.38,-37.79,-39.14,-44.49	PASS

Test Graphs

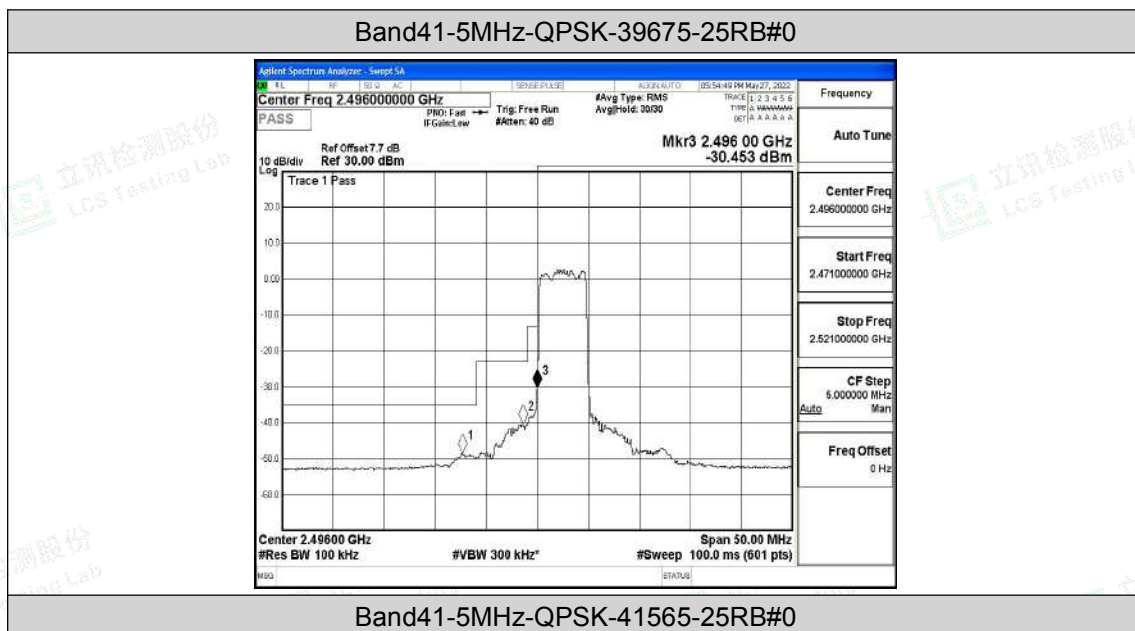


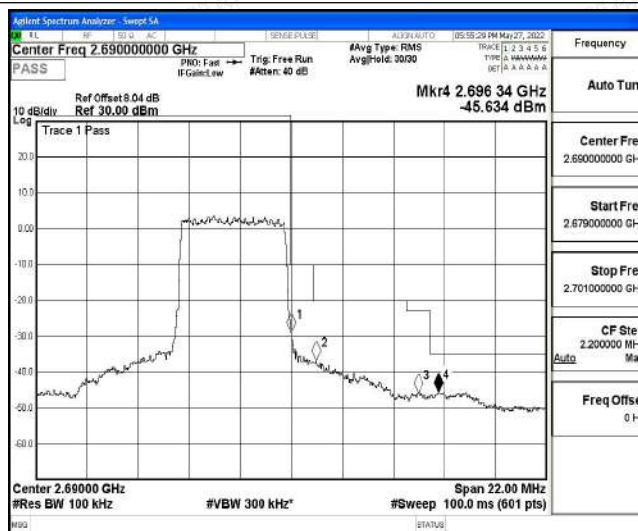

Band41-5MHz-16QAM-39675-25RB#0

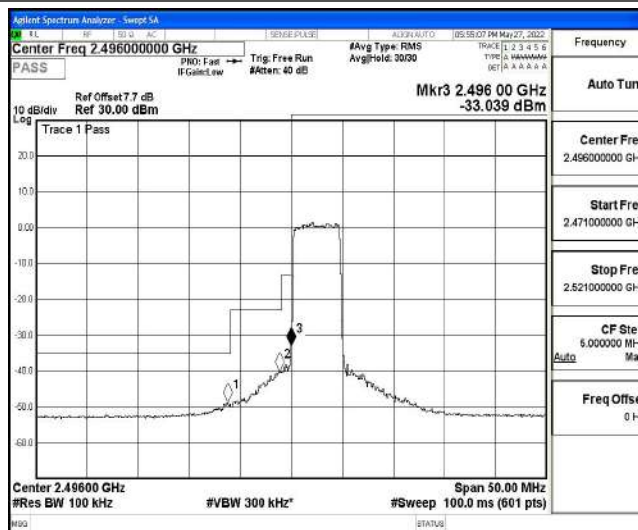

Band41-5MHz-16QAM-41565-25RB#0

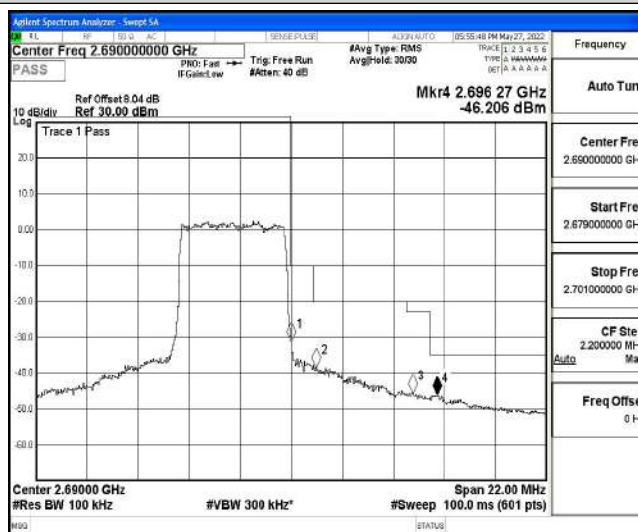

Band41-10MHz-QPSK-39700-50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

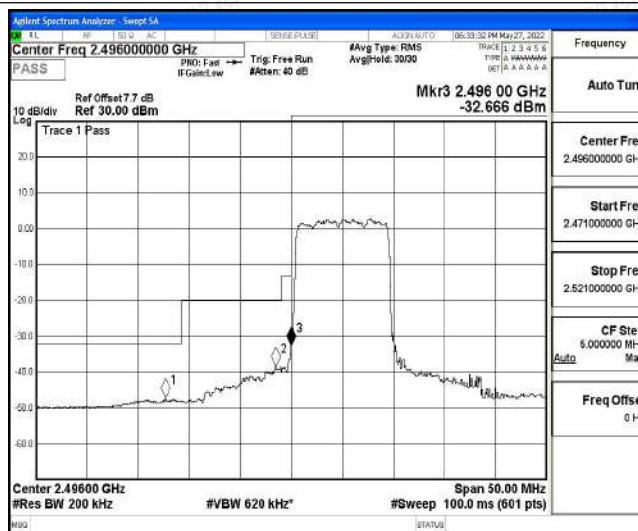

Band41-10MHz-QPSK-41540-50RB#0

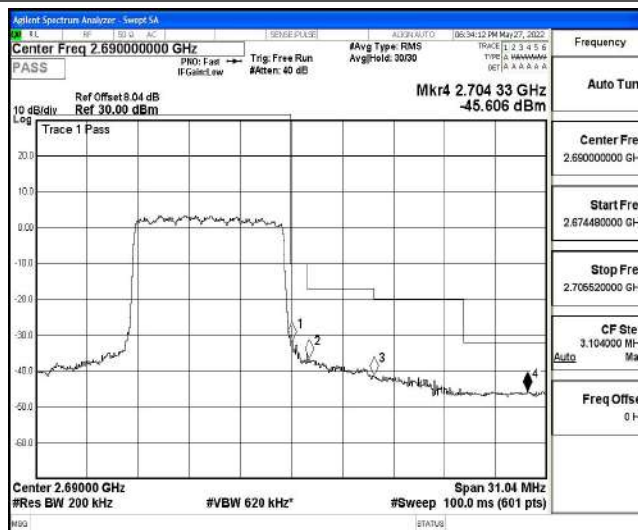


Band41-10MHz-16QAM-39700-50RB#0

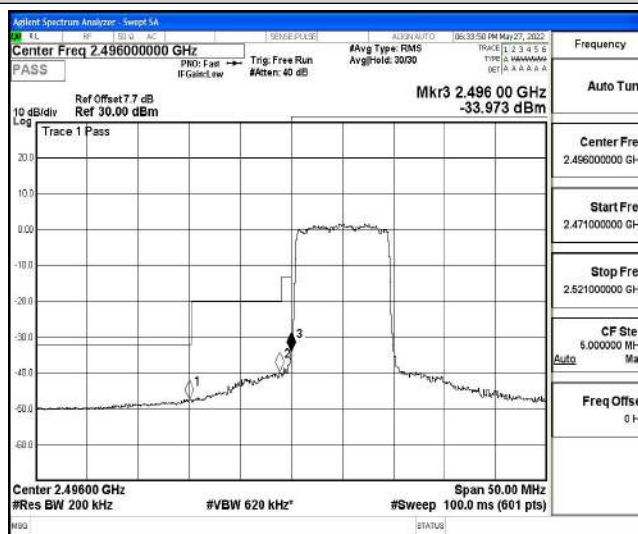


Band41-10MHz-16QAM-41540-50RB#0




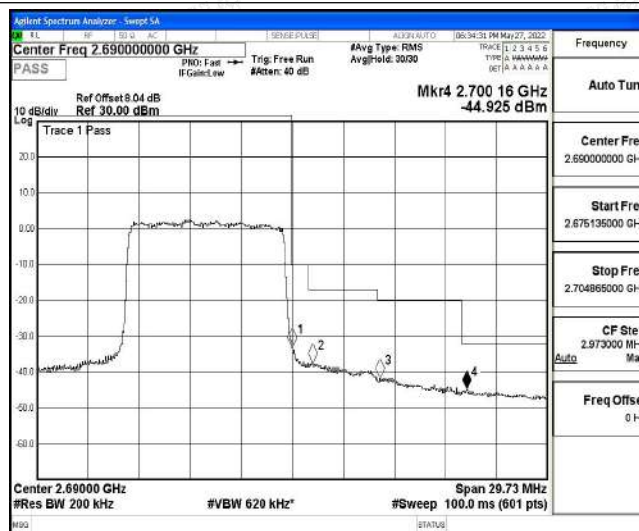

Band41-15MHz-QPSK-39725-75RB#0

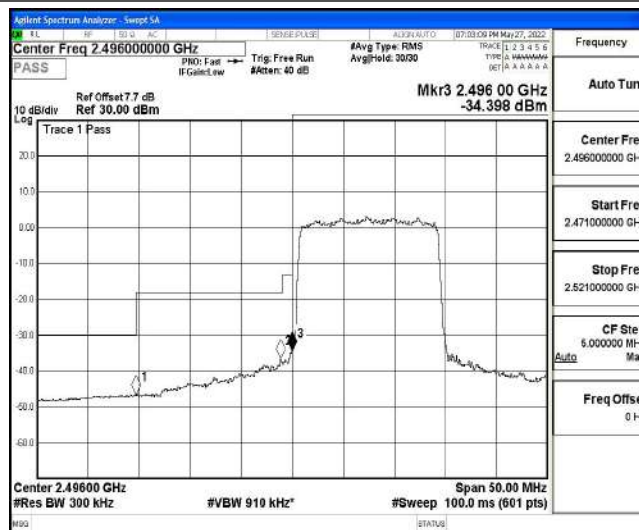


Band41-15MHz-QPSK-41515-75RB#0

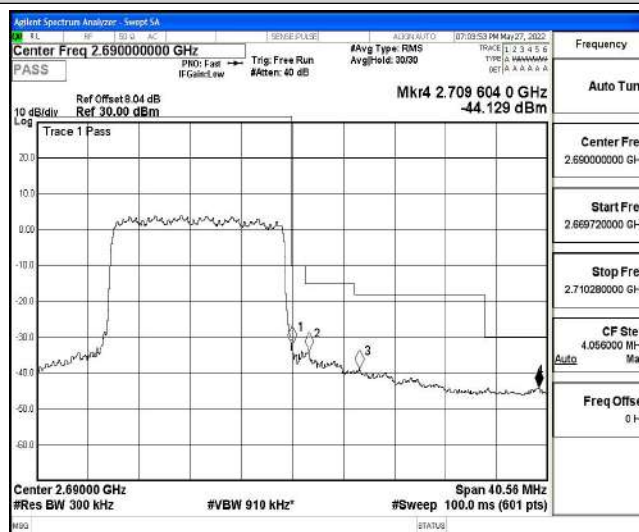


Band41-15MHz-16QAM-39725-75RB#0




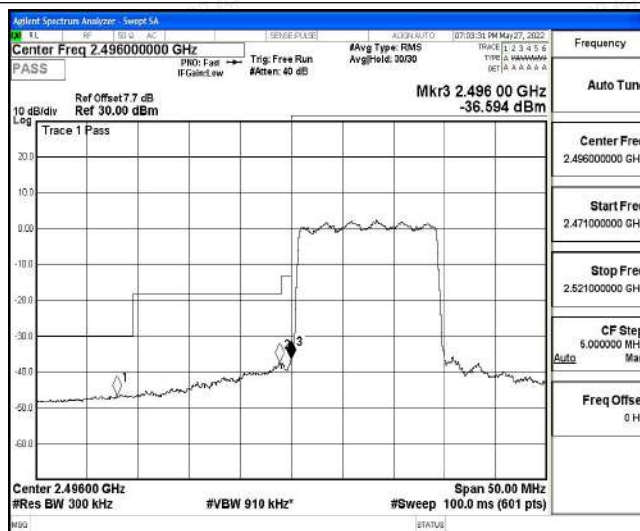

Band41-15MHz-16QAM-41515-75RB#0

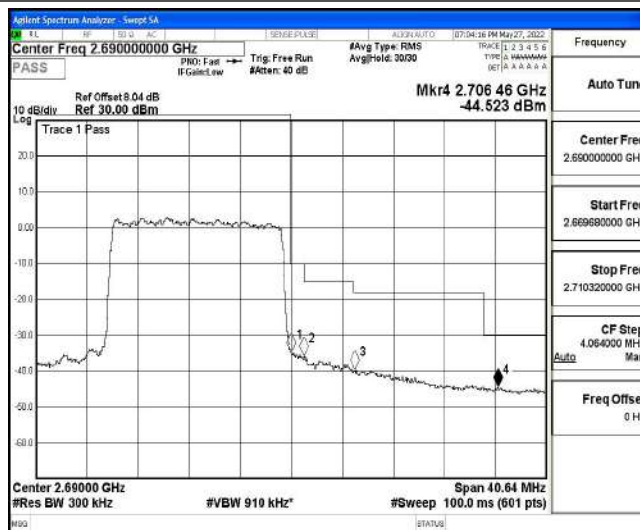


Band41-20MHz-QPSK-39750-100RB#0

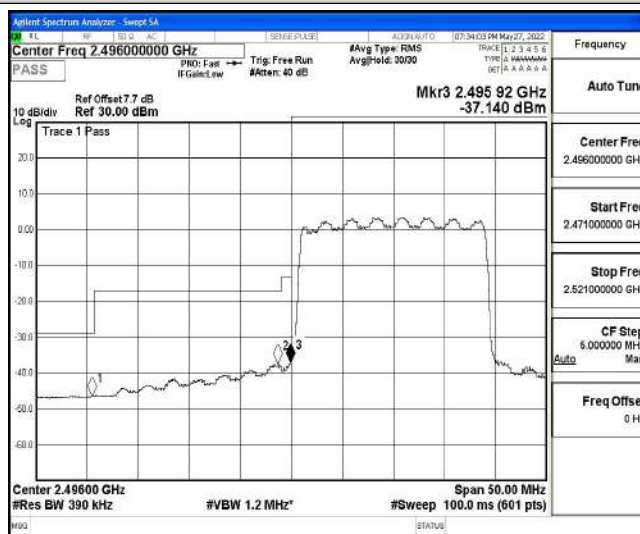


Band41-20MHz-QPSK-41490-100RB#0




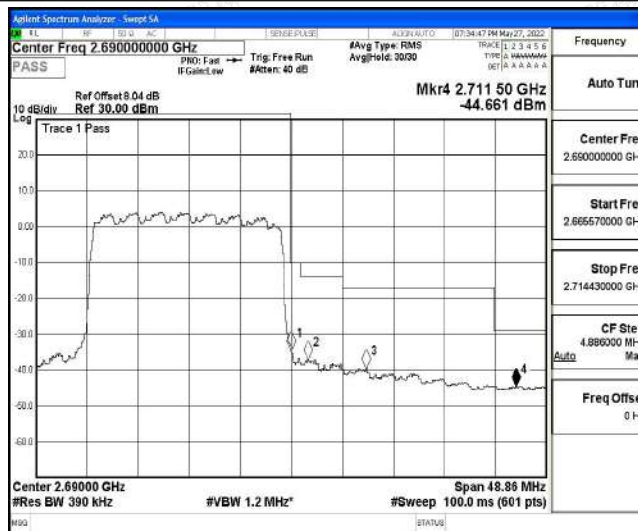

Band41-20MHz-16QAM-39750-100RB#0

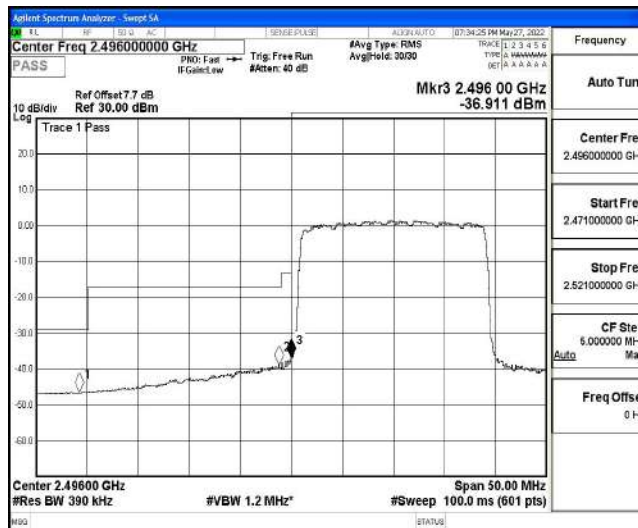

Band41-20MHz-16QAM-41490-100RB#0

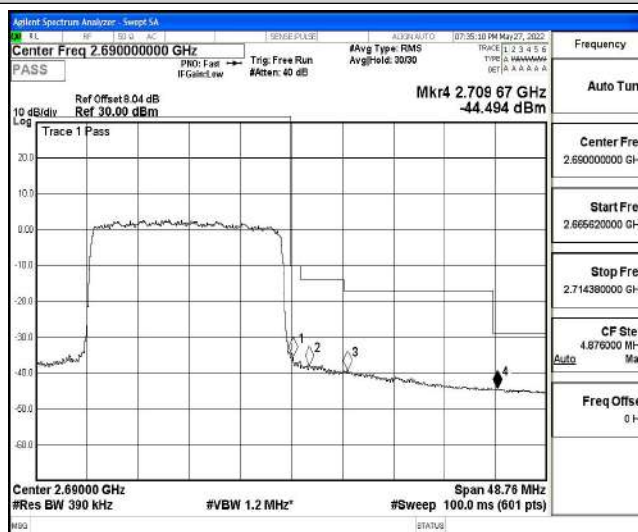

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



O.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	Range1:0.009~0.15MHz	-65.94	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range2:0.15~30MHz	-50.86	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range3:30~1000MHz	-41.76	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range4:1000~10000MHz	-44.91	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range5:10000~20000MHz	-49.18	PASS
Band41	5MHz	QPSK	39675	1RB#0	Range6:20000~26500MHz	-37.19	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-66.8	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-50.21	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.13	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.87	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.2	PASS
Band41	5MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-36.98	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range1:0.009~0.15MHz	-63.78	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range2:0.15~30MHz	-51.4	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range3:30~1000MHz	-42.05	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range4:1000~10000MHz	-44.7	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range5:10000~20000MHz	-49.3	PASS
Band41	5MHz	QPSK	41565	1RB#0	Range6:20000~26500MHz	-37.13	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range1:0.009~0.15MHz	-66.13	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range2:0.15~30MHz	-49.95	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range3:30~1000MHz	-41.71	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range4:1000~10000MHz	-45.09	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range5:10000~20000MHz	-49.23	PASS
Band41	5MHz	16QAM	39675	1RB#0	Range6:20000~26500MHz	-37.16	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-63.12	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-48.88	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-41.77	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.1	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.01	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range1:0.009~0.15MHz	-63.75	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range2:0.15~30MHz	-52.92	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range3:30~1000MHz	-41.22	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	Range4:1000~10000MHz	-44.89	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	5MHz	16QAM	41565	1RB#0	Range6:20000~26500MHz	-37	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range1:0.009~0.15MHz	-63.97	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range2:0.15~30MHz	-50.51	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range3:30~1000MHz	-42.3	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range4:1000~10000MHz	-44.93	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range5:10000~20000MHz	-49.32	PASS
Band41	10MHz	QPSK	39700	1RB#0	Range6:20000~26500MHz	-37.15	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-65.88	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-49.12	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.59	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-45.03	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.17	PASS
Band41	10MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.08	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range1:0.009~0.15MHz	-63.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range2:0.15~30MHz	-52.09	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range3:30~1000MHz	-42.24	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range4:1000~10000MHz	-44.85	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range5:10000~20000MHz	-49.22	PASS
Band41	10MHz	QPSK	41540	1RB#0	Range6:20000~26500MHz	-37.1	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range1:0.009~0.15MHz	-66.05	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range2:0.15~30MHz	-52	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range3:30~1000MHz	-41.27	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range4:1000~10000MHz	-44.88	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range5:10000~20000MHz	-49.12	PASS
Band41	10MHz	16QAM	39700	1RB#0	Range6:20000~26500MHz	-37.09	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-64.97	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-51.22	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.92	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-45.03	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.35	PASS
Band41	10MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-36.99	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range1:0.009~0.15MHz	-66.02	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range2:0.15~30MHz	-50.77	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range3:30~1000MHz	-41.36	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range4:1000~10000MHz	-45.08	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range5:10000~20000MHz	-49.12	PASS
Band41	10MHz	16QAM	41540	1RB#0	Range6:20000~26500MHz	-37.12	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range1:0.009~0.15MHz	-65.87	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	Range2:0.15~30MHz	-51.24	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range3:30~1000MHz	-40.98	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range4:1000~10000MHz	-45	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range5:10000~20000MHz	-49.24	PASS
Band41	15MHz	QPSK	39725	1RB#0	Range6:20000~26500MHz	-37.16	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-67.13	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-50.34	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.44	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.94	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	15MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.05	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range1:0.009~0.15MHz	-64.21	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range2:0.15~30MHz	-50.16	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range3:30~1000MHz	-40.79	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range4:1000~10000MHz	-44.99	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range5:10000~20000MHz	-49.05	PASS
Band41	15MHz	QPSK	41515	1RB#0	Range6:20000~26500MHz	-36.9	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range1:0.009~0.15MHz	-65.62	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range2:0.15~30MHz	-52.1	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range3:30~1000MHz	-40.7	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range5:10000~20000MHz	-49.15	PASS
Band41	15MHz	16QAM	39725	1RB#0	Range6:20000~26500MHz	-37.03	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-64.88	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-52.01	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-42.13	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.83	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-49.21	PASS
Band41	15MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.16	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range1:0.009~0.15MHz	-65.11	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range2:0.15~30MHz	-52.74	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range3:30~1000MHz	-40.57	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range4:1000~10000MHz	-44.93	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range5:10000~20000MHz	-49.13	PASS
Band41	15MHz	16QAM	41515	1RB#0	Range6:20000~26500MHz	-36.89	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range1:0.009~0.15MHz	-67.77	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range2:0.15~30MHz	-51.27	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range3:30~1000MHz	-42.14	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range4:1000~10000MHz	-44.92	PASS
Band41	20MHz	QPSK	39750	1RB#0	Range5:10000~20000MHz	-49.16	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	20MHz	QPSK	39750	1RB#0	Range6:20000~26500MHz	-37.05	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range1:0.009~0.15MHz	-64.7	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range2:0.15~30MHz	-51.68	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range3:30~1000MHz	-41.75	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range4:1000~10000MHz	-44.97	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range5:10000~20000MHz	-49.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	Range6:20000~26500MHz	-37.13	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range1:0.009~0.15MHz	-66.58	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range2:0.15~30MHz	-50.63	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range3:30~1000MHz	-40.95	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range4:1000~10000MHz	-45.02	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range5:10000~20000MHz	-49.17	PASS
Band41	20MHz	QPSK	41490	1RB#0	Range6:20000~26500MHz	-37.16	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range1:0.009~0.15MHz	-65.86	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range2:0.15~30MHz	-50.3	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range3:30~1000MHz	-41.75	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range4:1000~10000MHz	-44.87	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range5:10000~20000MHz	-49.07	PASS
Band41	20MHz	16QAM	39750	1RB#0	Range6:20000~26500MHz	-37.1	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range1:0.009~0.15MHz	-65.94	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range2:0.15~30MHz	-50.97	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range3:30~1000MHz	-41.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range4:1000~10000MHz	-44.9	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range5:10000~20000MHz	-48.97	PASS
Band41	20MHz	16QAM	40620	1RB#0	Range6:20000~26500MHz	-37.05	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range1:0.009~0.15MHz	-65.61	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range2:0.15~30MHz	-50.31	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range3:30~1000MHz	-41.89	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range4:1000~10000MHz	-44.98	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range5:10000~20000MHz	-49.27	PASS
Band41	20MHz	16QAM	41490	1RB#0	Range6:20000~26500MHz	-37.01	PASS

Test Graphs

Band41-5MHz-QPSK-39675-1RB#0-Range1:0.009~0.15MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

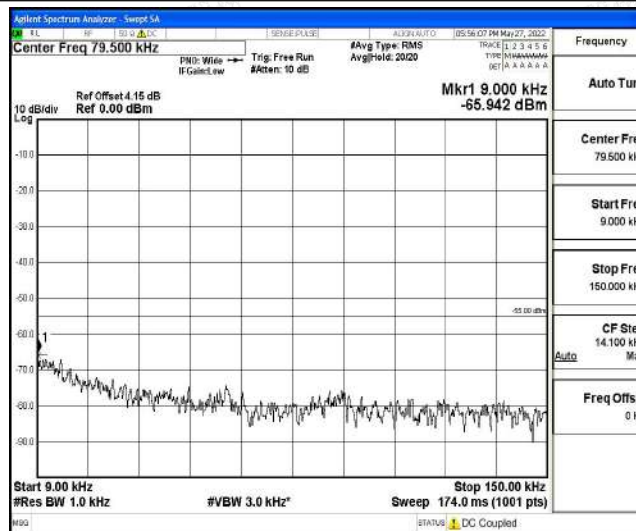

Band41-5MHz-QPSK-39675-1RB#0-Range2:0.15~30MHz




Band41-5MHz-QPSK-39675-1RB#0-Range3:30~1000MHz

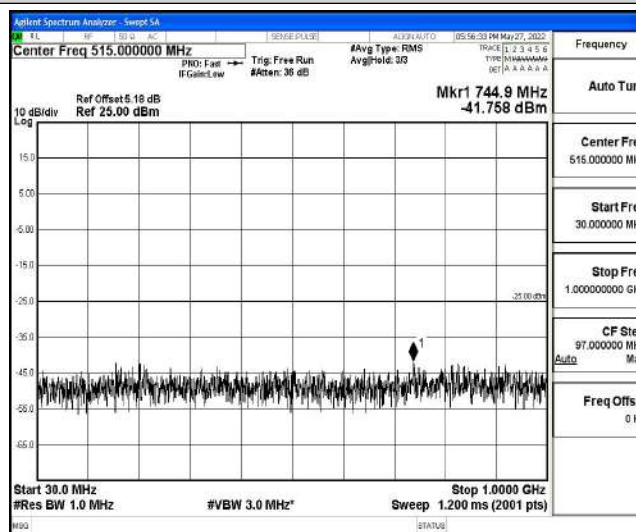


Band41-5MHz-QPSK-39675-1RB#0-Range4:1000~10000MHz




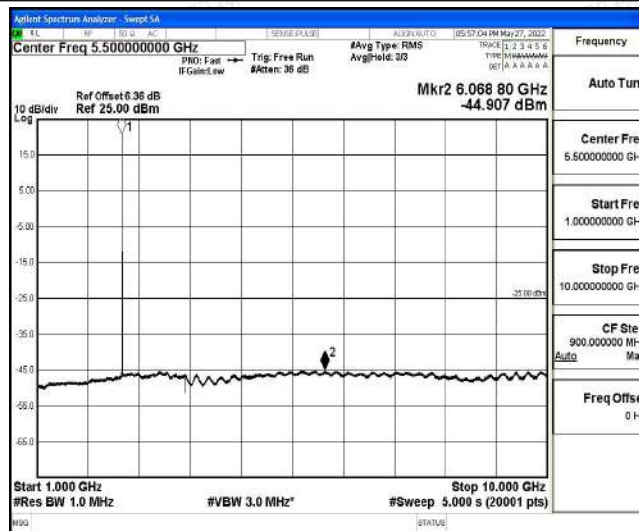

Band41-5MHz-QPSK-39675-1RB#0-Range5:10000~20000MHz

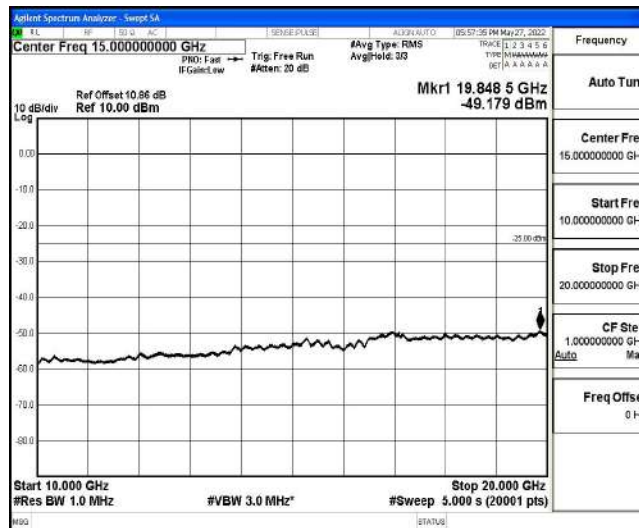


Band41-5MHz-QPSK-39675-1RB#0-Range6:20000~26500MHz

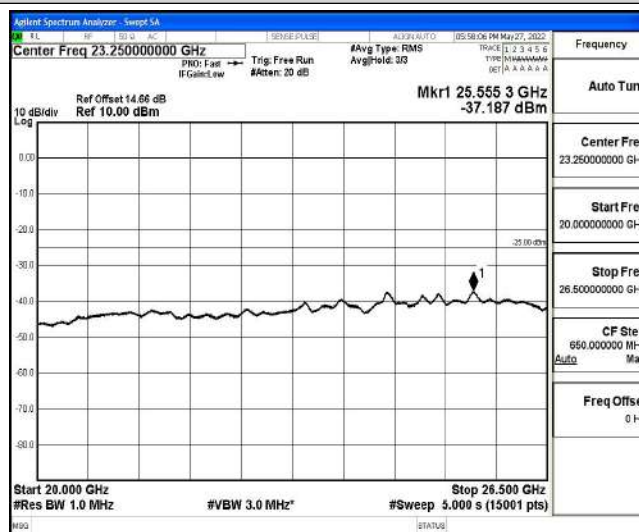


Band41-5MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz




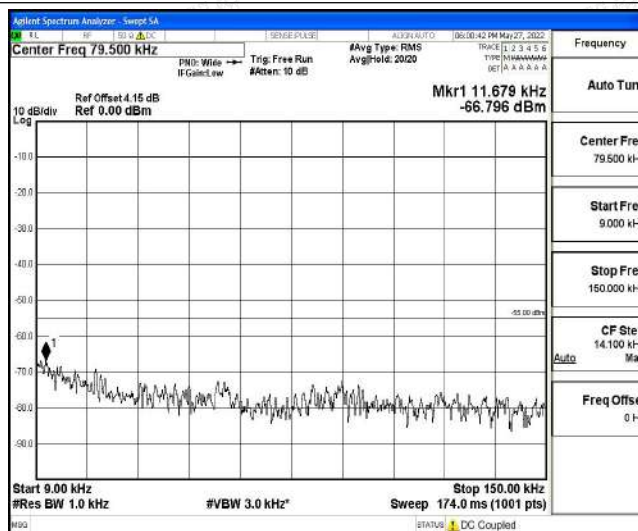

Band41-5MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

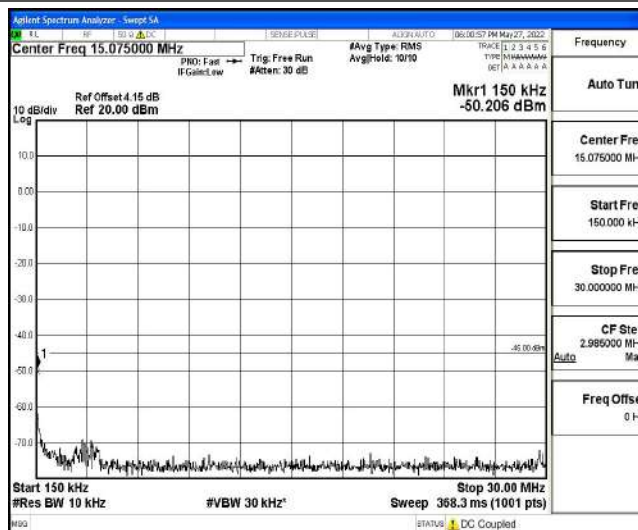

Band41-5MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

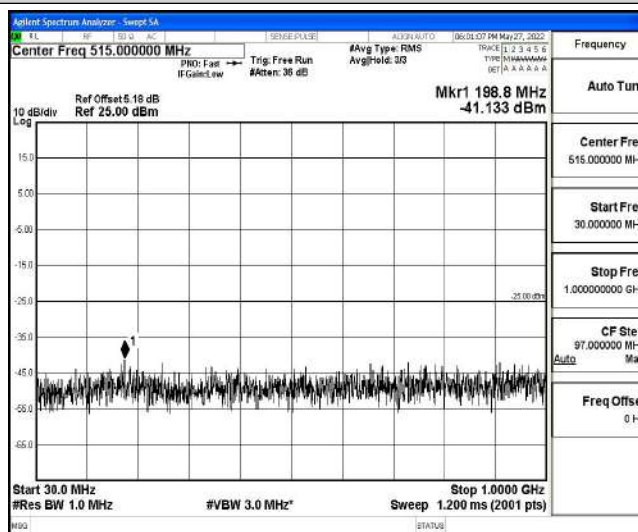

Band41-5MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

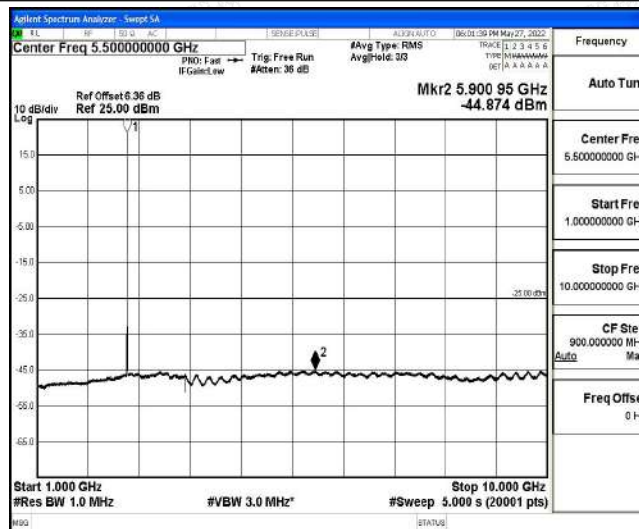

Band41-5MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

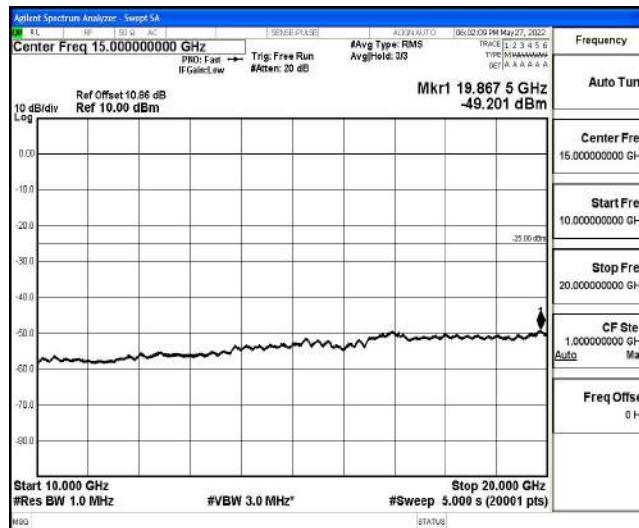


Band41-5MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

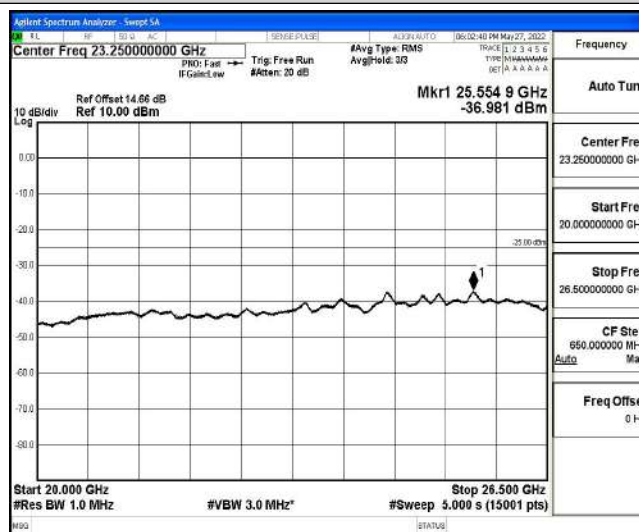


Band41-5MHz-QPSK-41565-1RB#0-Range1:0.009~0.15MHz




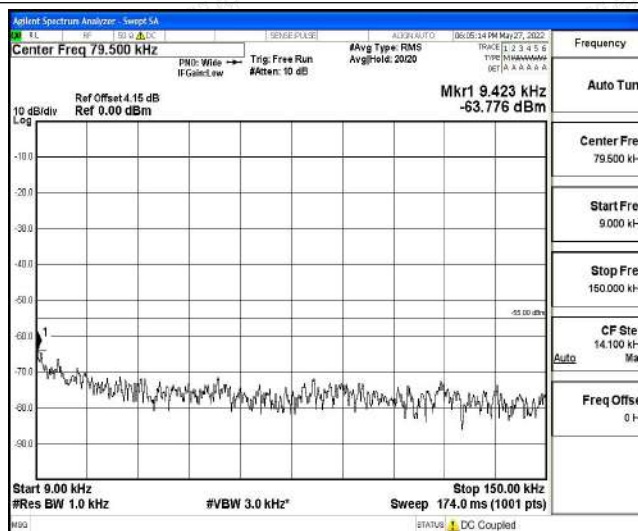

Band41-5MHz-QPSK-41565-1RB#0-Range2:0.15~30MHz

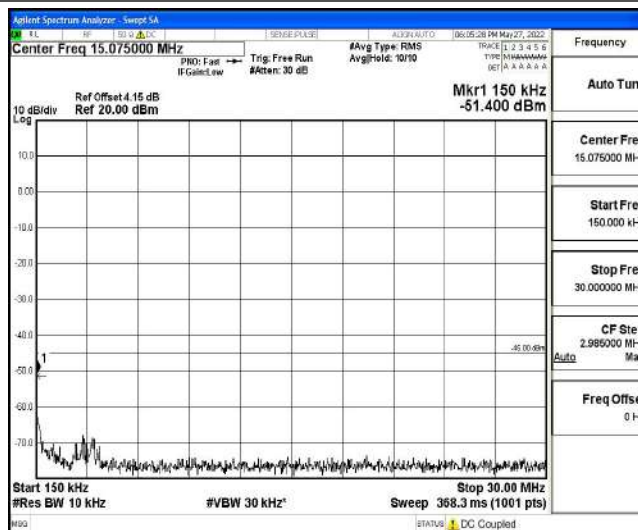


Band41-5MHz-QPSK-41565-1RB#0-Range3:30~1000MHz

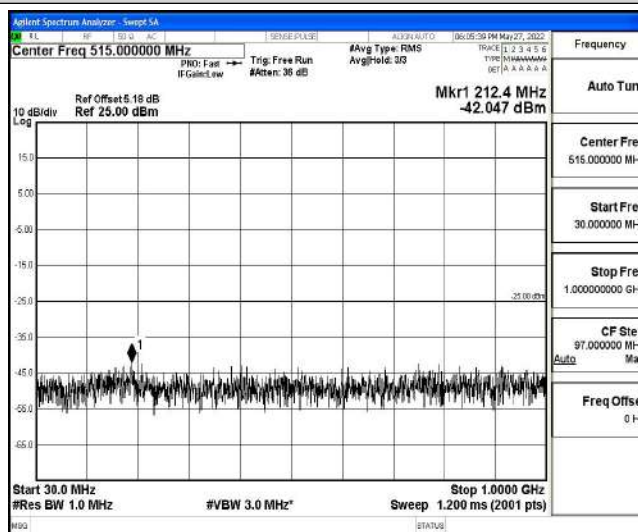


Band41-5MHz-QPSK-41565-1RB#0-Range4:1000~10000MHz




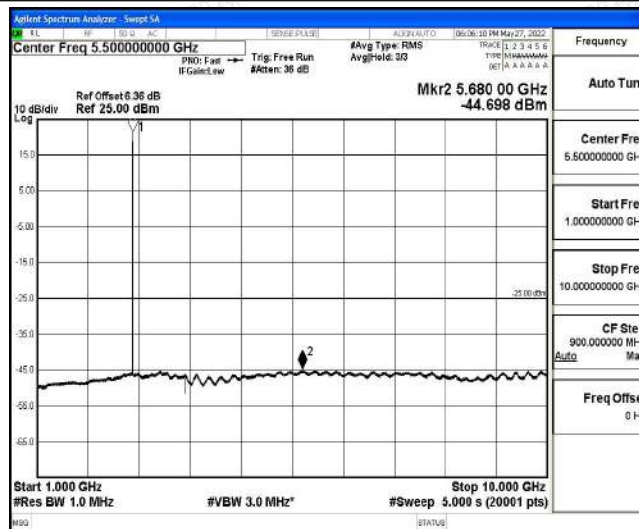

Band41-5MHz-QPSK-41565-1RB#0-Range5:10000~20000MHz

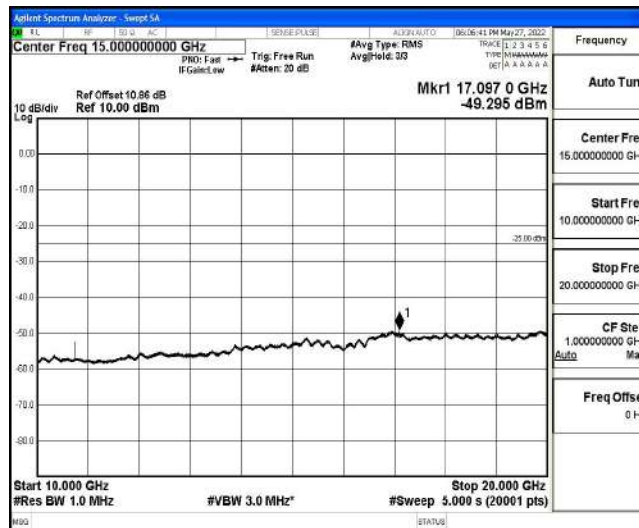


Band41-5MHz-QPSK-41565-1RB#0-Range6:20000~26500MHz

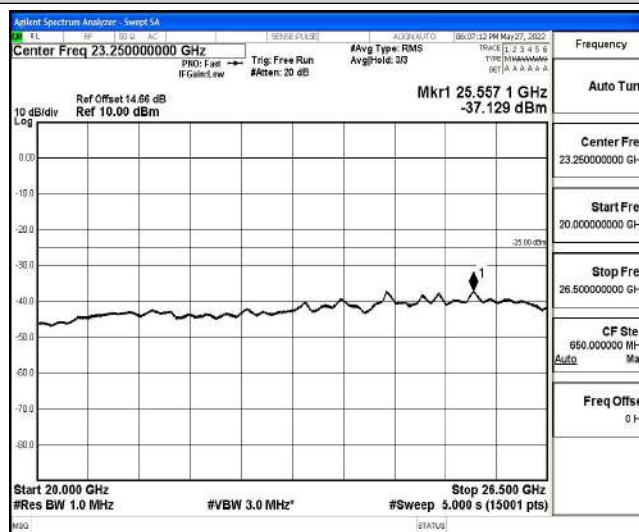


Band41-5MHz-16QAM-39675-1RB#0-Range1:0.009~0.15MHz




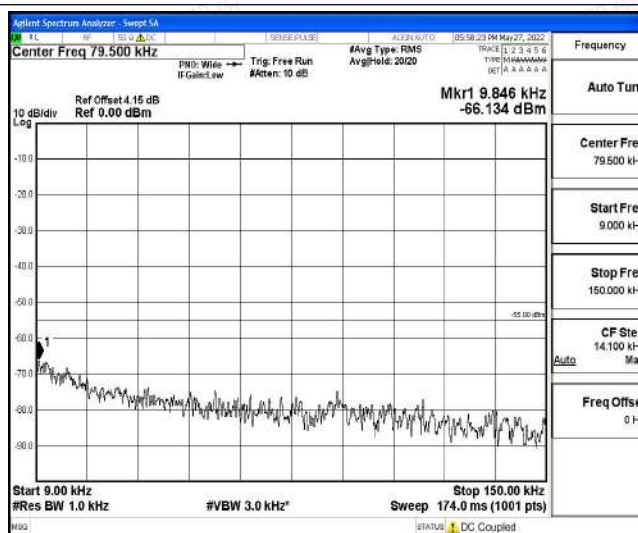

Band41-5MHz-16QAM-39675-1RB#0-Range2:0.15~30MHz

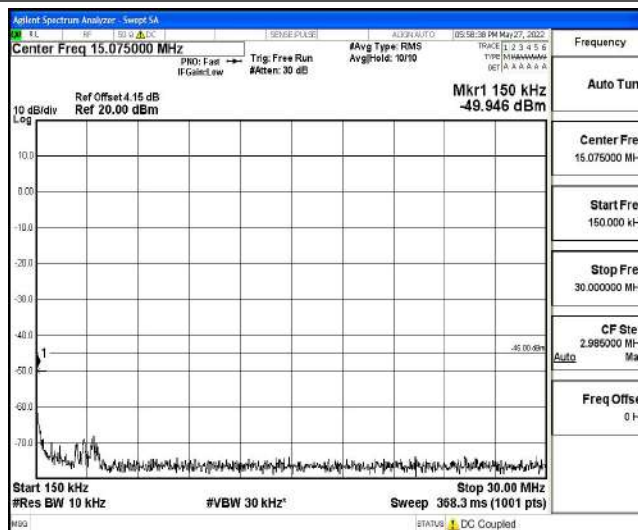


Band41-5MHz-16QAM-39675-1RB#0-Range3:30~1000MHz

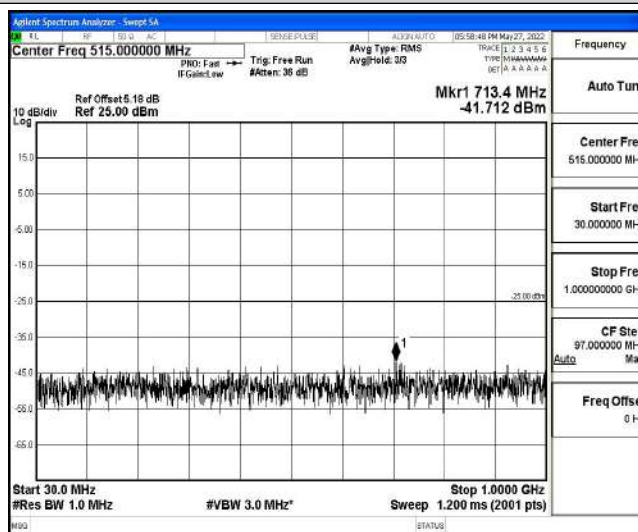


Band41-5MHz-16QAM-39675-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

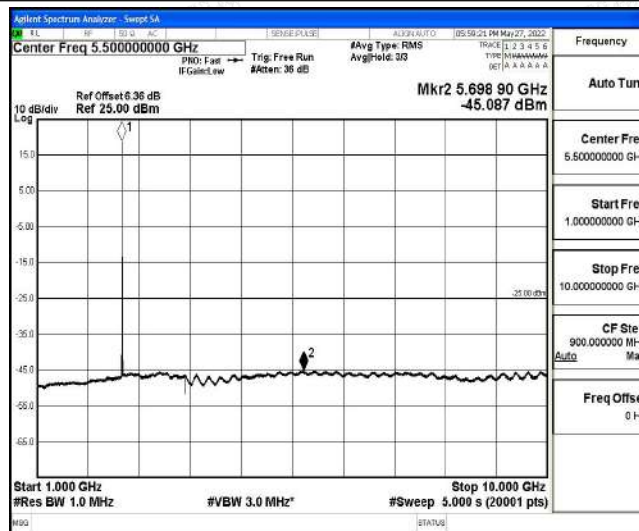

Band41-5MHz-16QAM-39675-1RB#0-Range5:10000~20000MHz

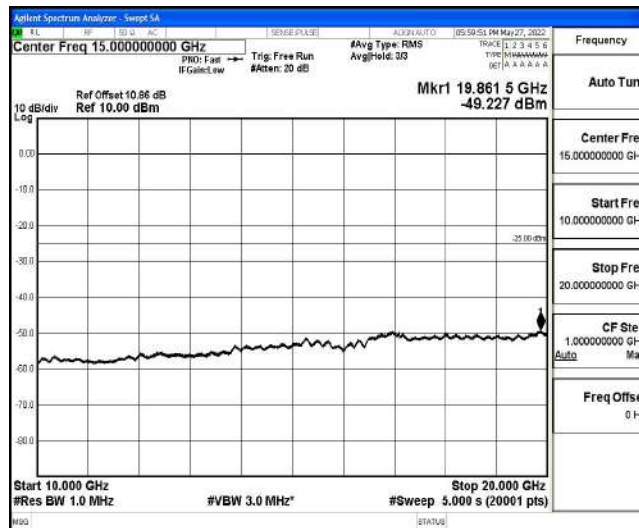


Band41-5MHz-16QAM-39675-1RB#0-Range6:20000~26500MHz

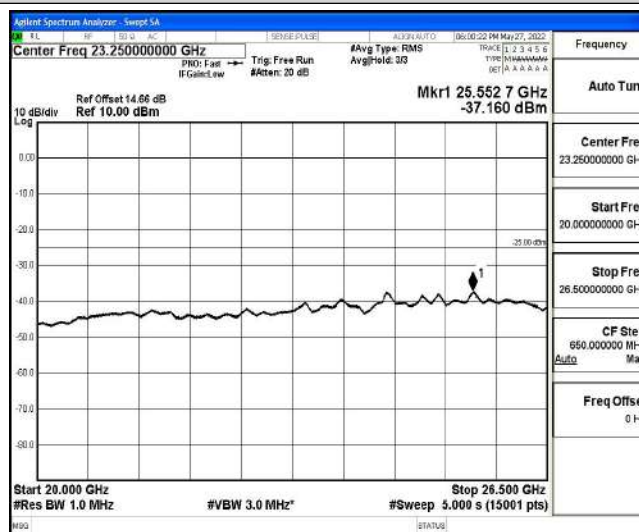


Band41-5MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz




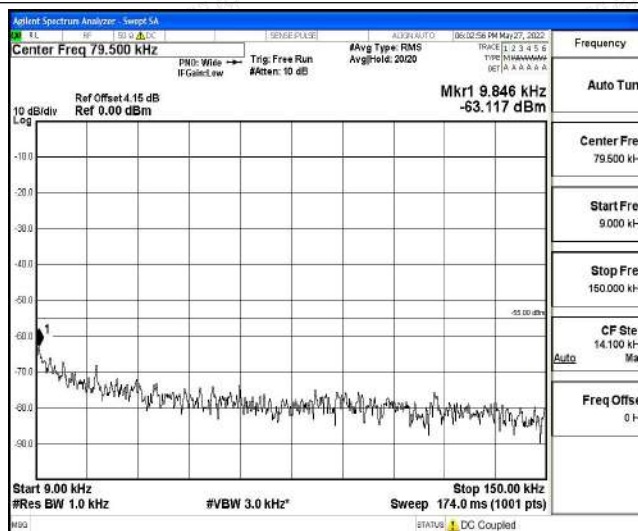

Band41-5MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

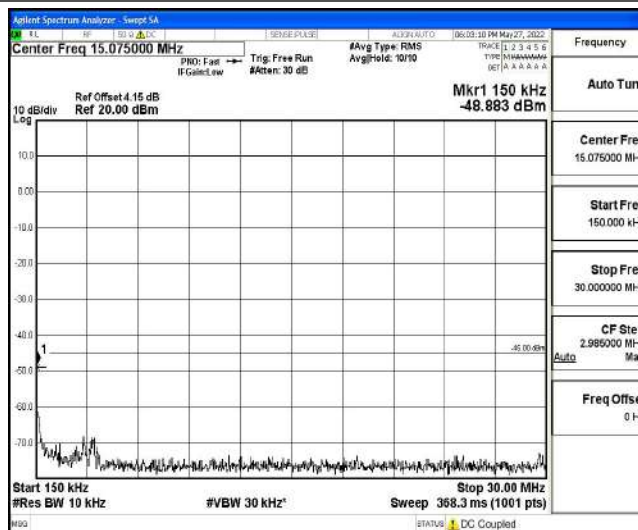

Band41-5MHz-16QAM-40620-1RB#0-Range3:30~1000MHz

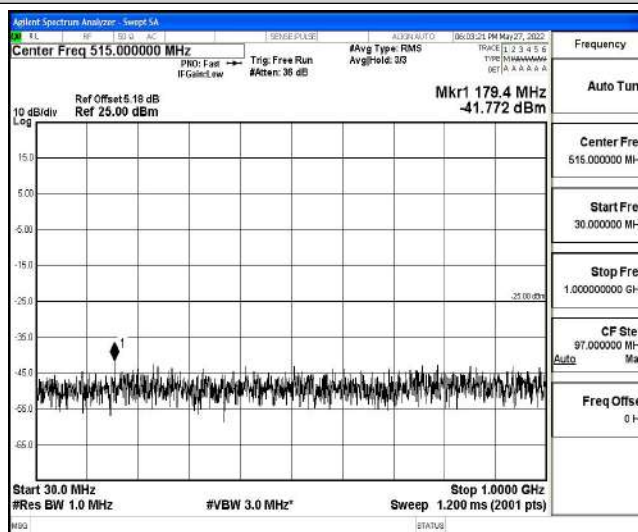

Band41-5MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

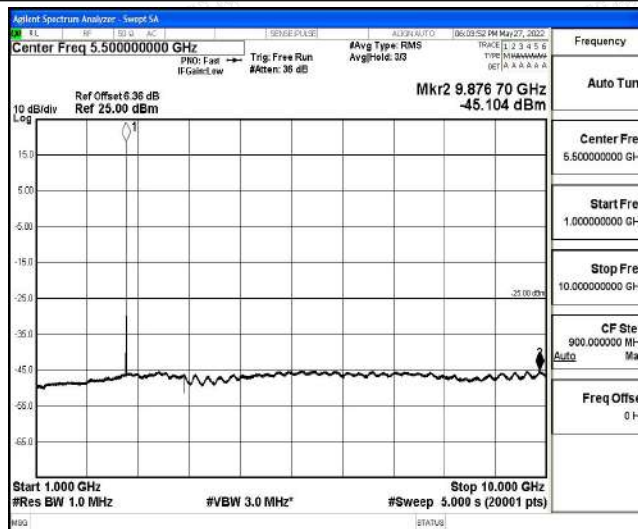

Band41-5MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

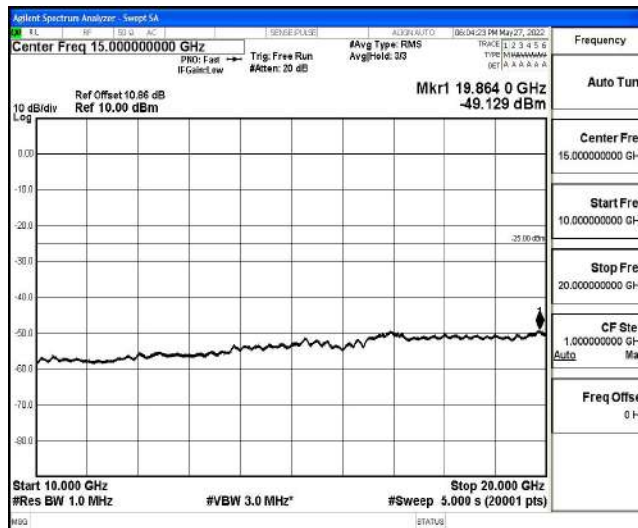


Band41-5MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz

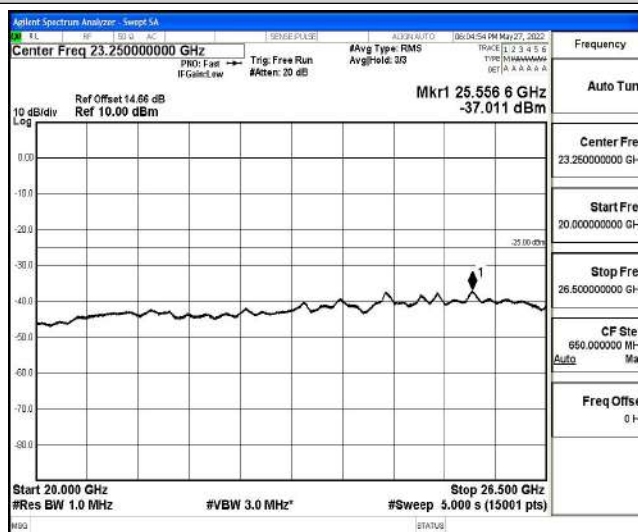


Band41-5MHz-16QAM-41565-1RB#0-Range1:0.009~0.15MHz




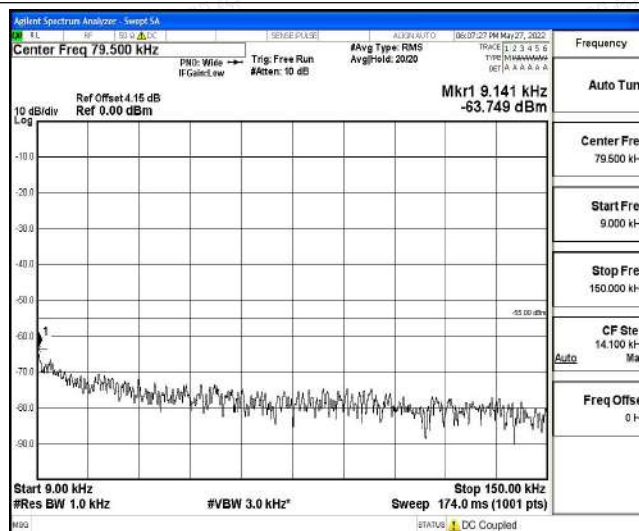

Band41-5MHz-16QAM-41565-1RB#0-Range2:0.15~30MHz

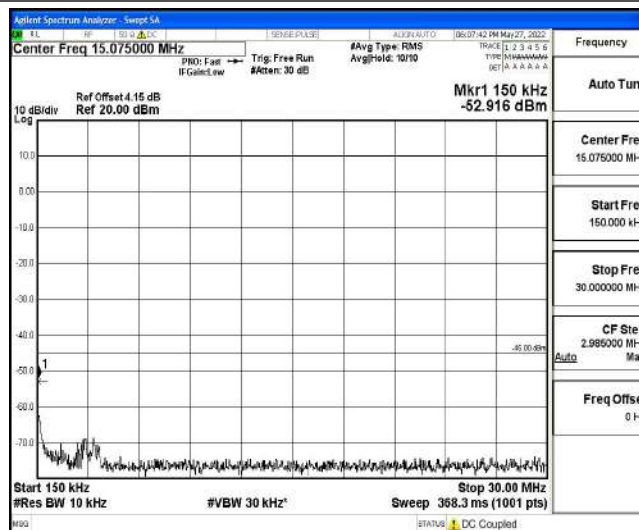

Band41-5MHz-16QAM-41565-1RB#0-Range3:30~1000MHz

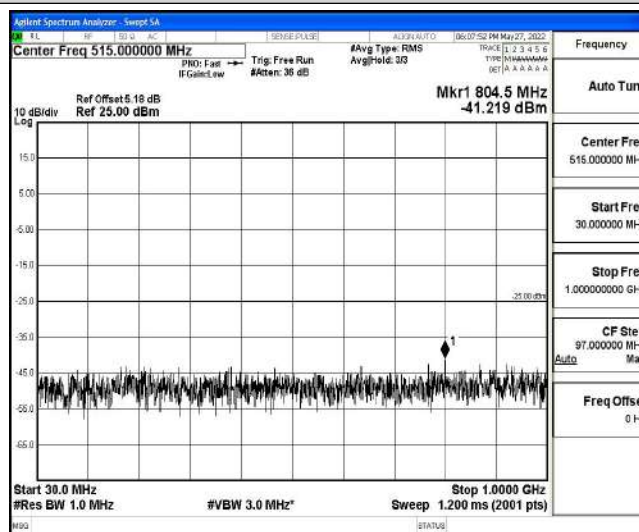

Band41-5MHz-16QAM-41565-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

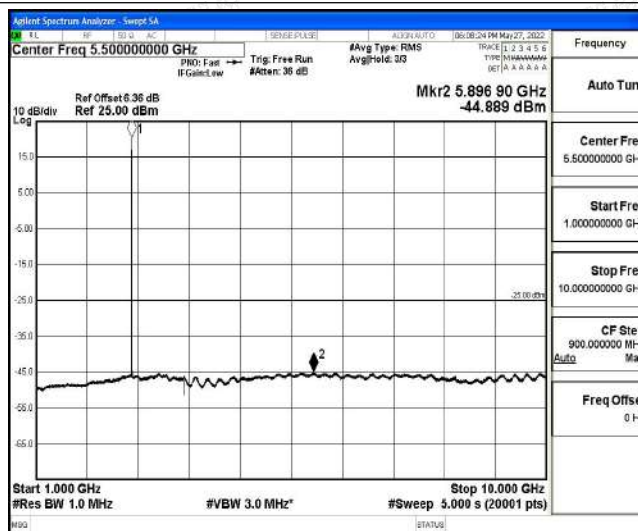

Band41-5MHz-16QAM-41565-1RB#0-Range5:10000~20000MHz

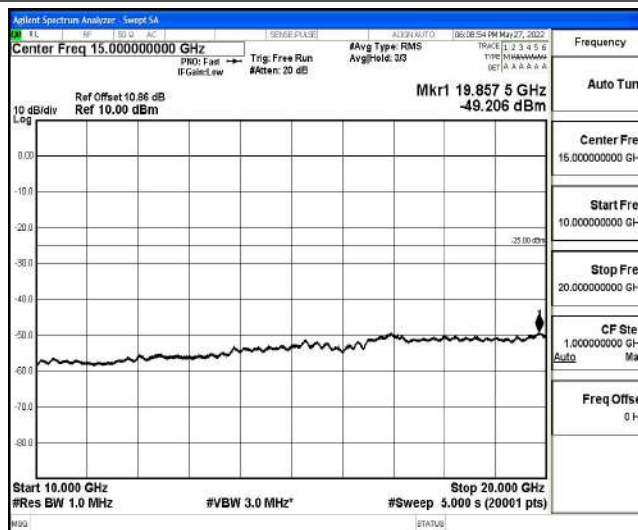


Band41-5MHz-16QAM-41565-1RB#0-Range6:20000~26500MHz

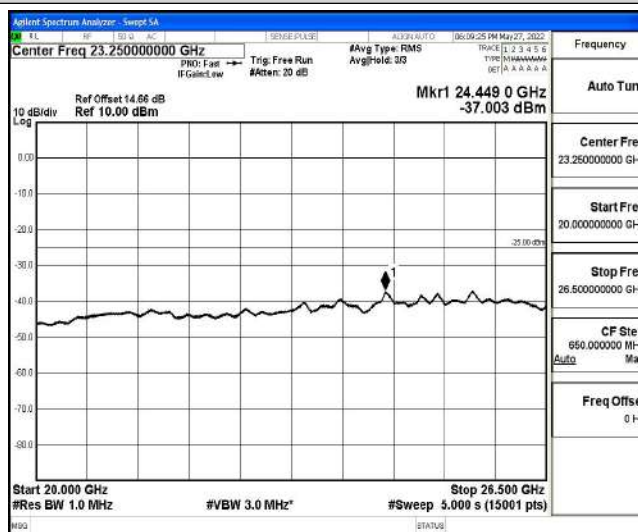


Band41-10MHz-QPSK-39700-1RB#0-Range1:0.009~0.15MHz




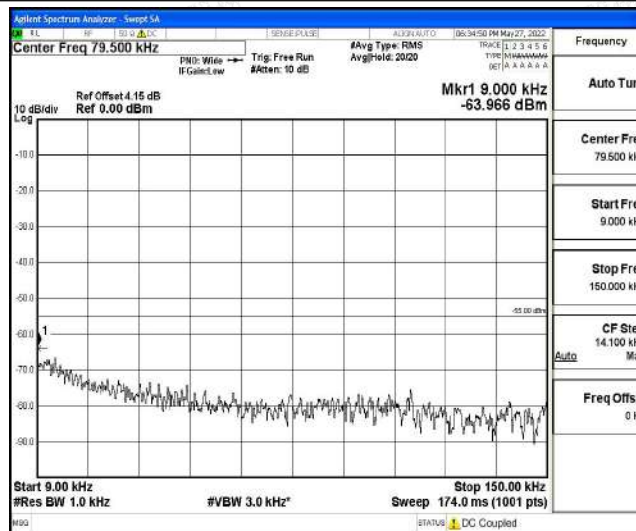

Band41-10MHz-QPSK-39700-1RB#0-Range2:0.15~30MHz

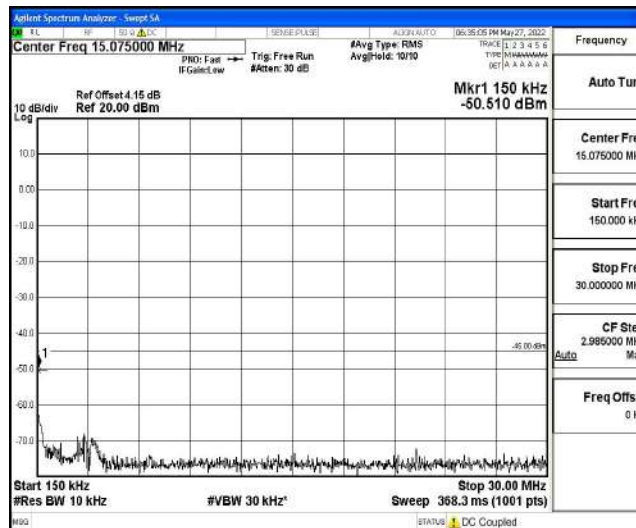


Band41-10MHz-QPSK-39700-1RB#0-Range3:30~1000MHz

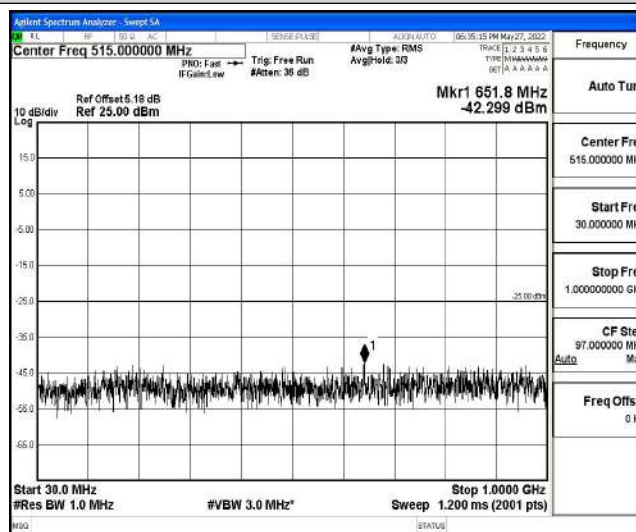


Band41-10MHz-QPSK-39700-1RB#0-Range4:1000~10000MHz




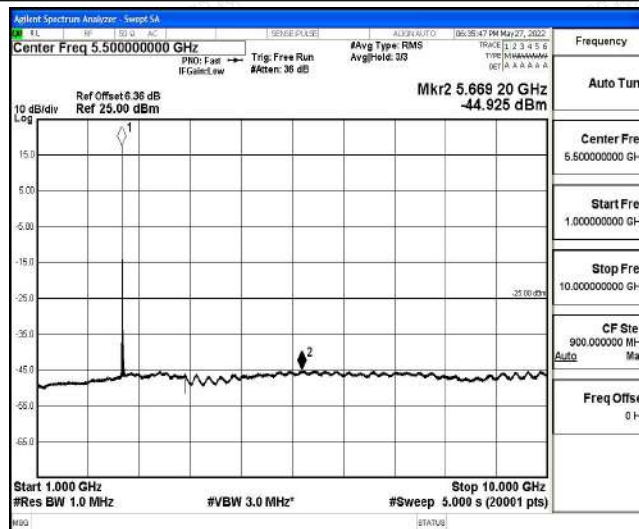

Band41-10MHz-QPSK-39700-1RB#0-Range5:10000~20000MHz

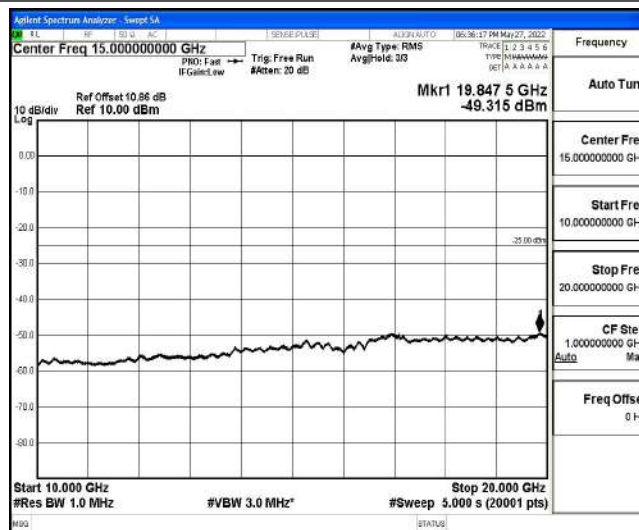


Band41-10MHz-QPSK-39700-1RB#0-Range6:20000~26500MHz

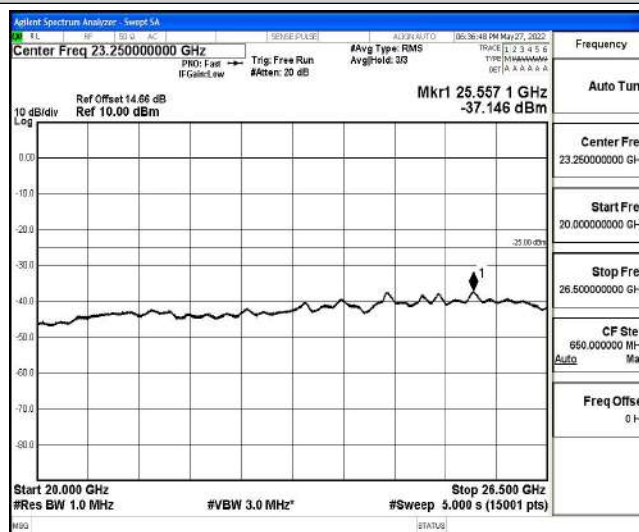


Band41-10MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz




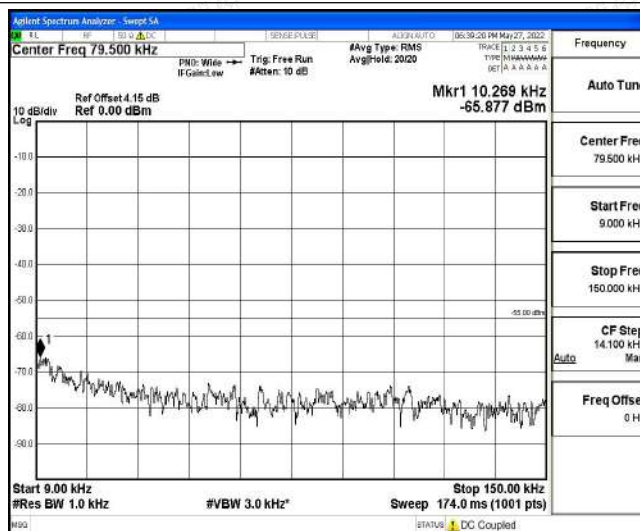

Band41-10MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

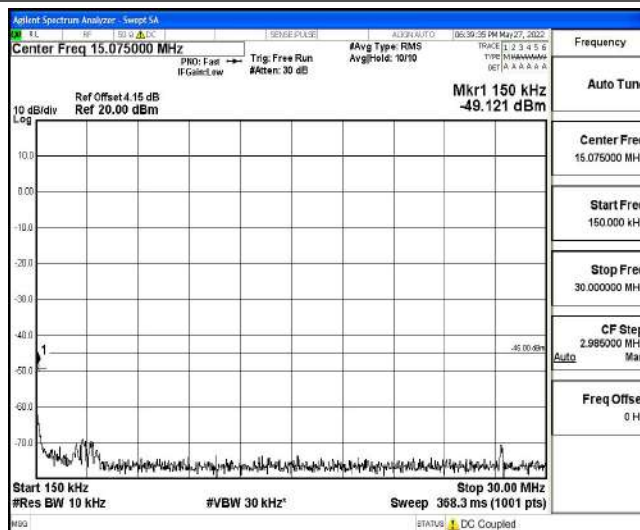

Band41-10MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

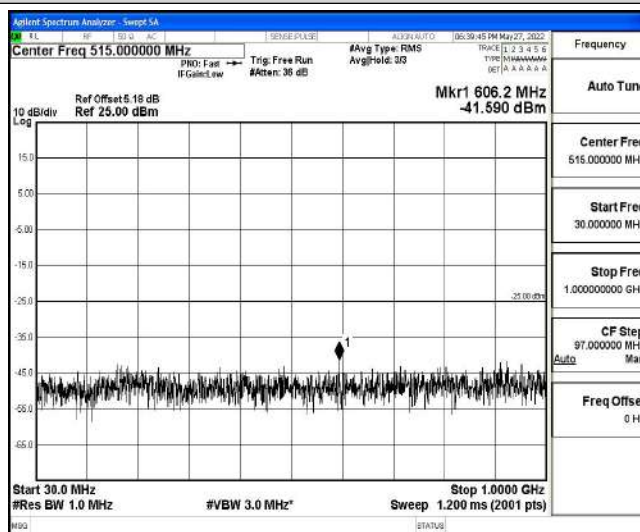

Band41-10MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

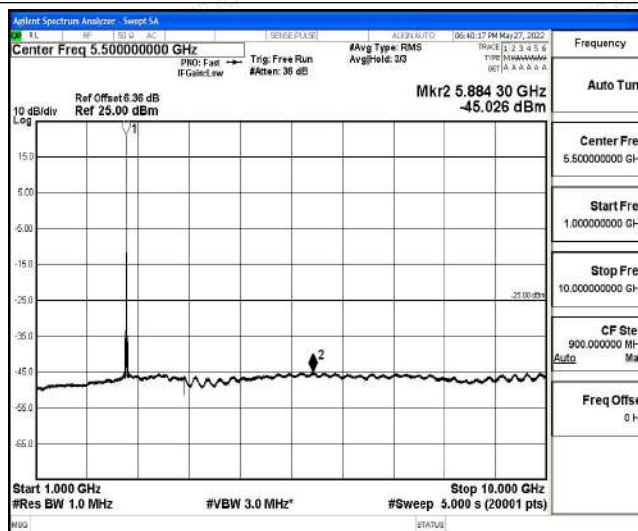

Band41-10MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

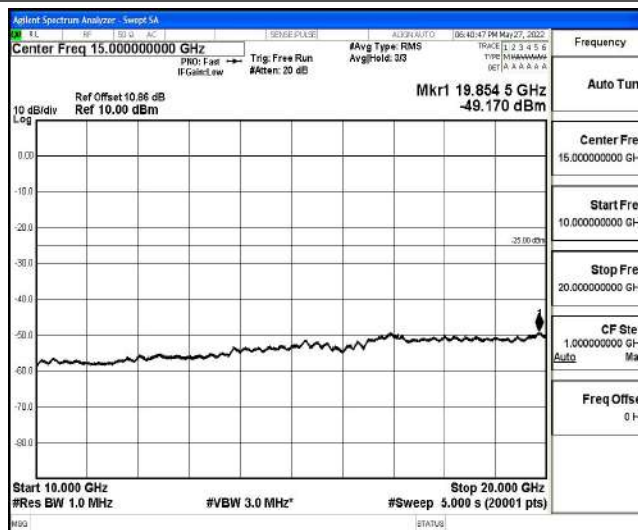


Band41-10MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

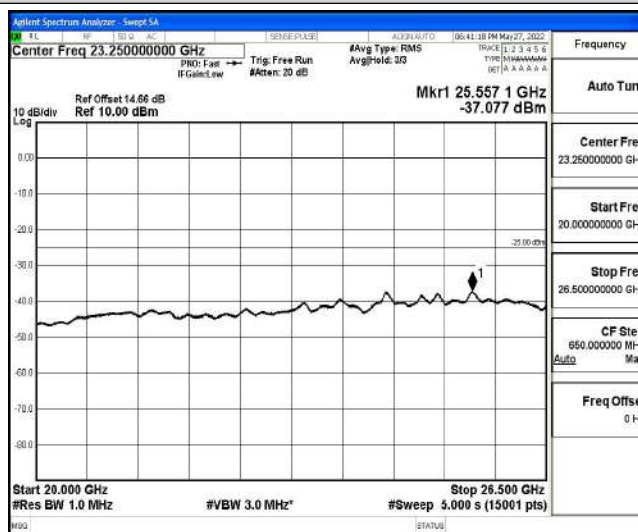


Band41-10MHz-QPSK-41540-1RB#0-Range1:0.009~0.15MHz




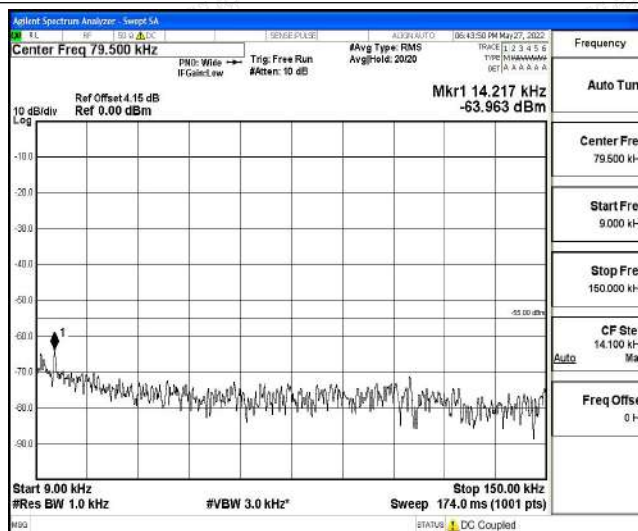

Band41-10MHz-QPSK-41540-1RB#0-Range2:0.15~30MHz

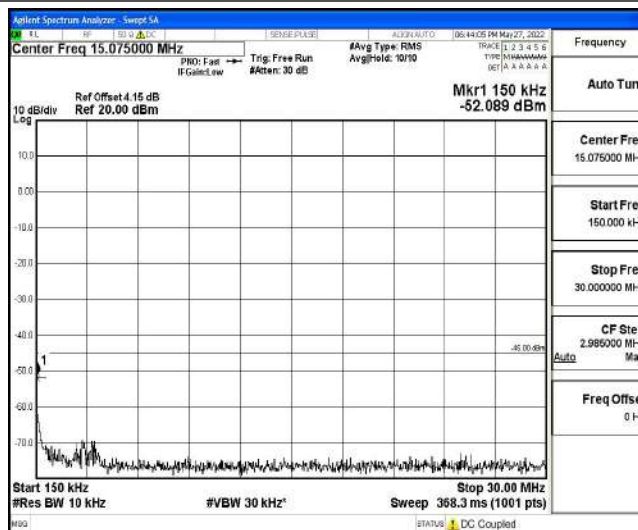

Band41-10MHz-QPSK-41540-1RB#0-Range3:30~1000MHz

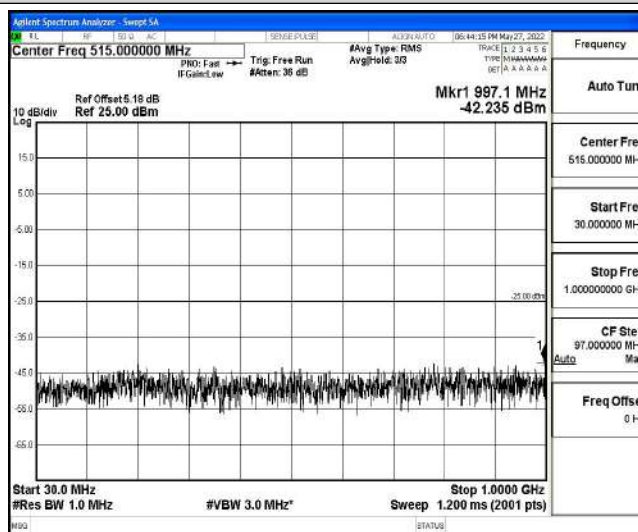

Band41-10MHz-QPSK-41540-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

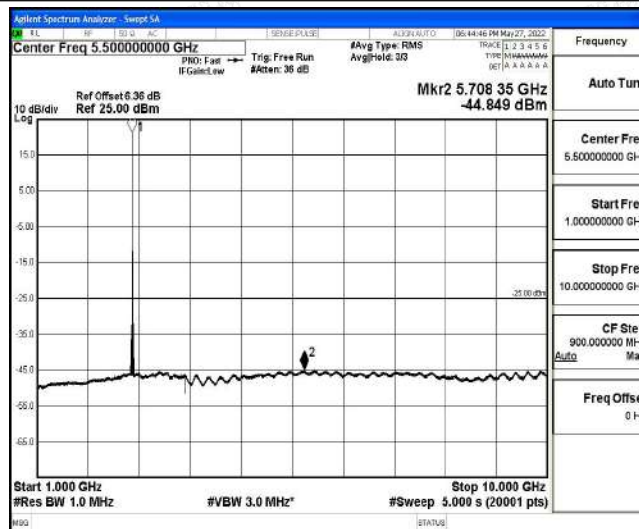

Band41-10MHz-QPSK-41540-1RB#0-Range5:10000~20000MHz

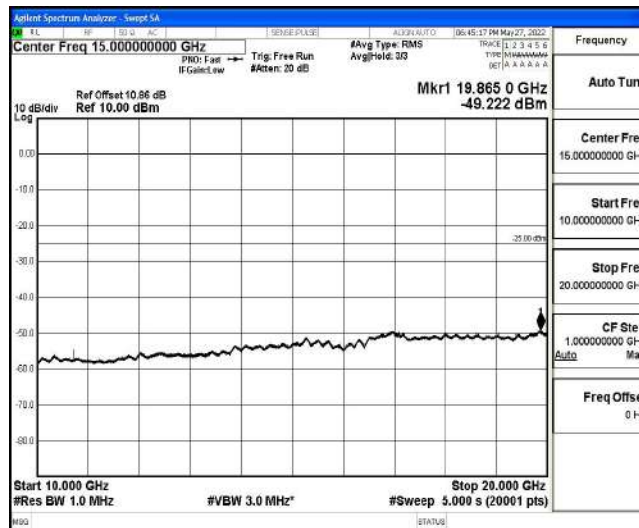


Band41-10MHz-QPSK-41540-1RB#0-Range6:20000~26500MHz

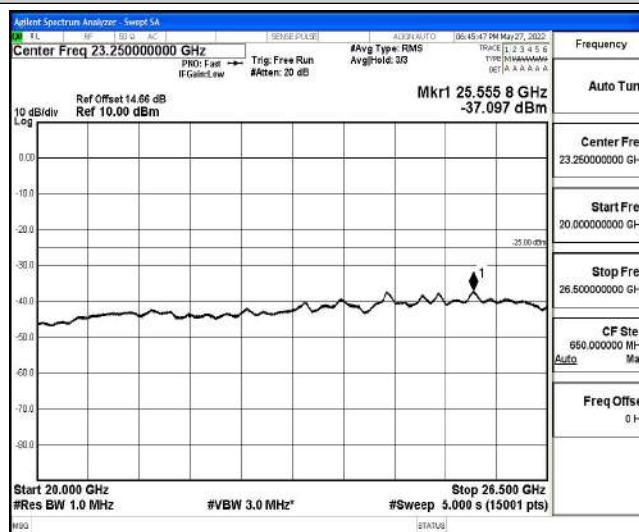


Band41-10MHz-16QAM-39700-1RB#0-Range1:0.009~0.15MHz




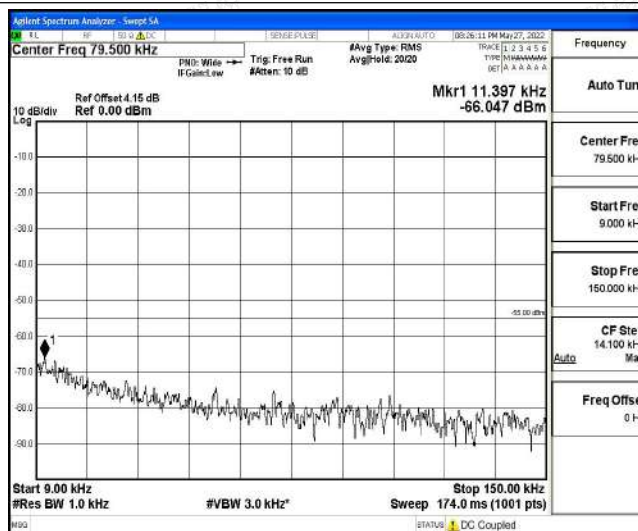

Band41-10MHz-16QAM-39700-1RB#0-Range2:0.15~30MHz

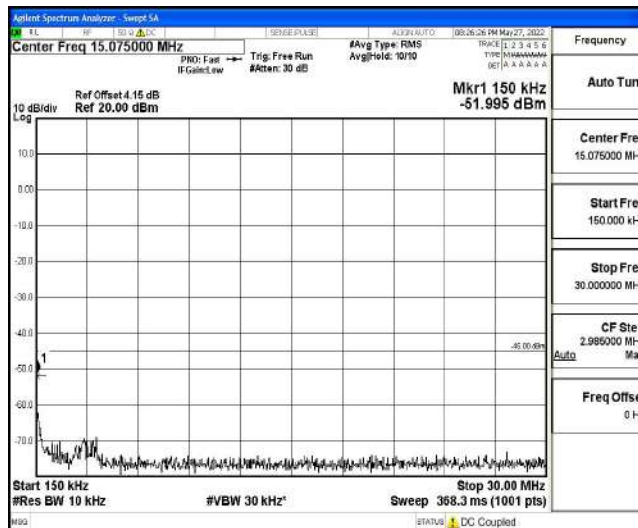


Band41-10MHz-16QAM-39700-1RB#0-Range3:30~1000MHz

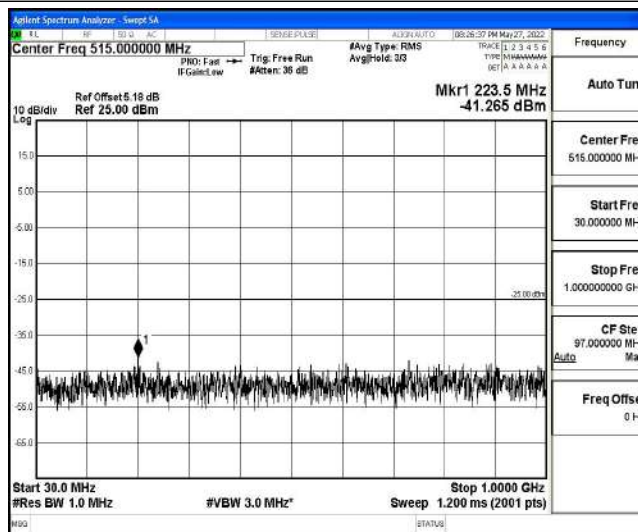


Band41-10MHz-16QAM-39700-1RB#0-Range4:1000~10000MHz




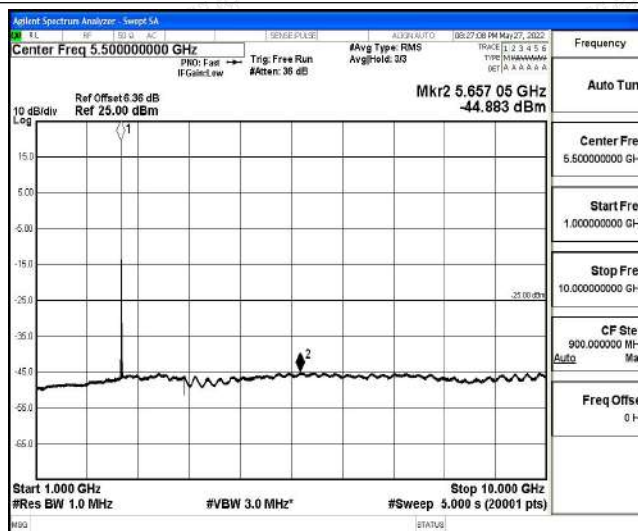

Band41-10MHz-16QAM-39700-1RB#0-Range5:10000~20000MHz

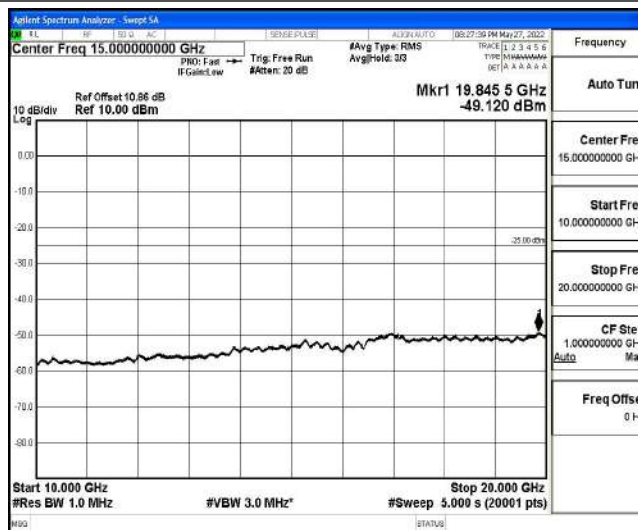

Band41-10MHz-16QAM-39700-1RB#0-Range6:20000~26500MHz

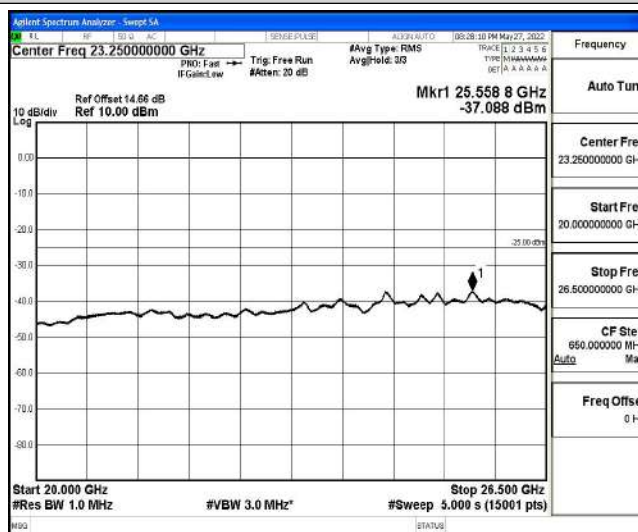

Band41-10MHz-16QAM-40620-1RB#0-Range1:0.009~0.15MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

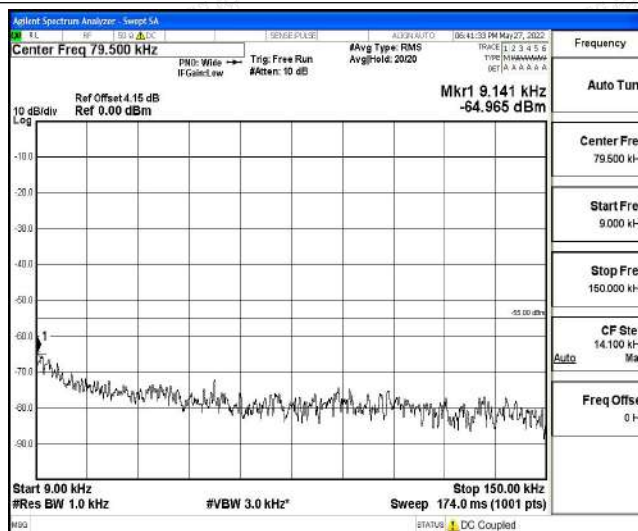

Band41-10MHz-16QAM-40620-1RB#0-Range2:0.15~30MHz

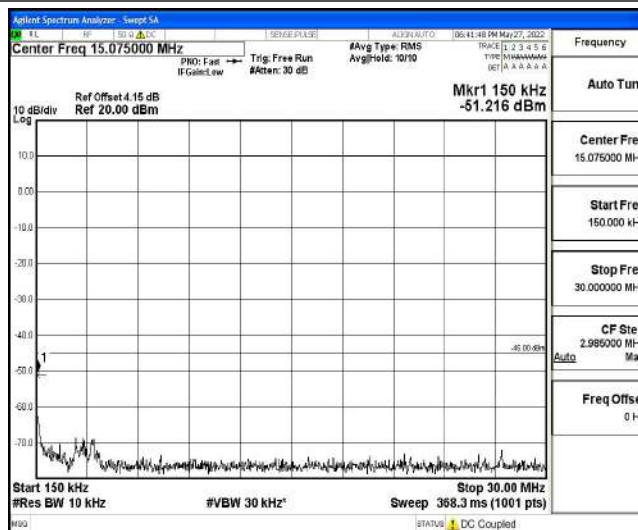


Band41-10MHz-16QAM-40620-1RB#0-Range3:30~1000MHz

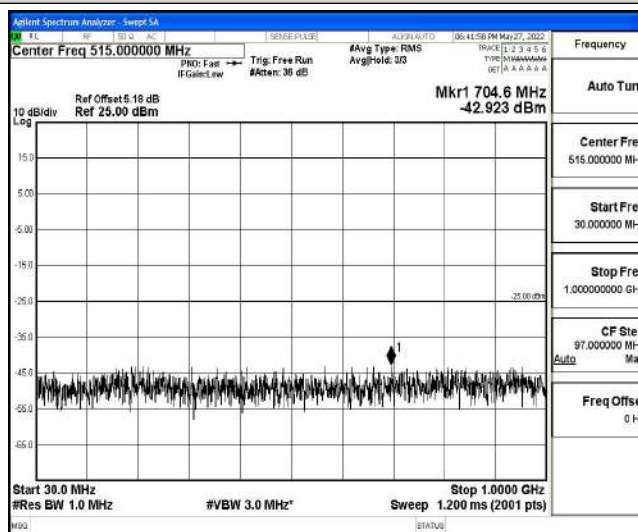


Band41-10MHz-16QAM-40620-1RB#0-Range4:1000~10000MHz




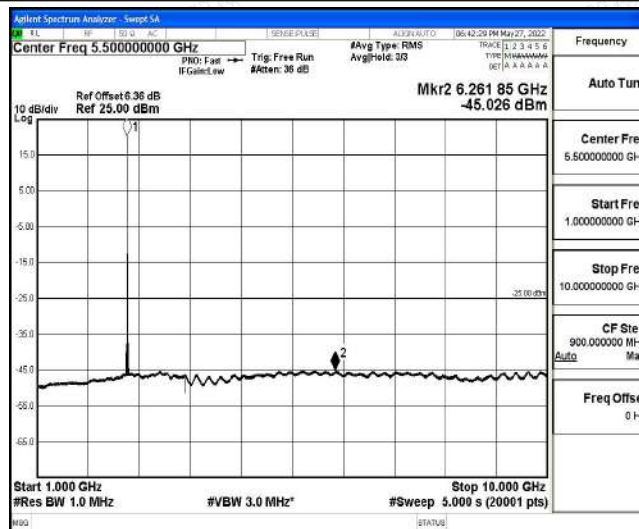

Band41-10MHz-16QAM-40620-1RB#0-Range5:10000~20000MHz

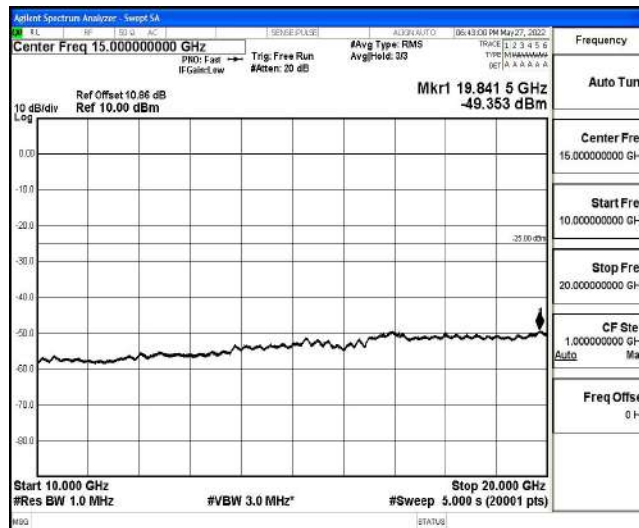

Band41-10MHz-16QAM-40620-1RB#0-Range6:20000~26500MHz

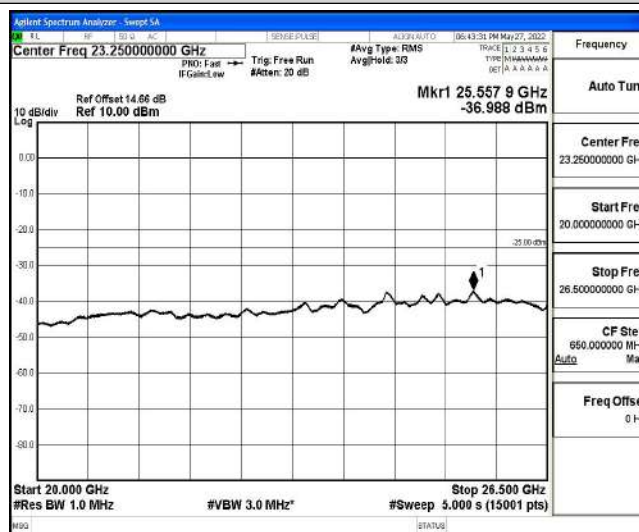

Band41-10MHz-16QAM-41540-1RB#0-Range1:0.009~0.15MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

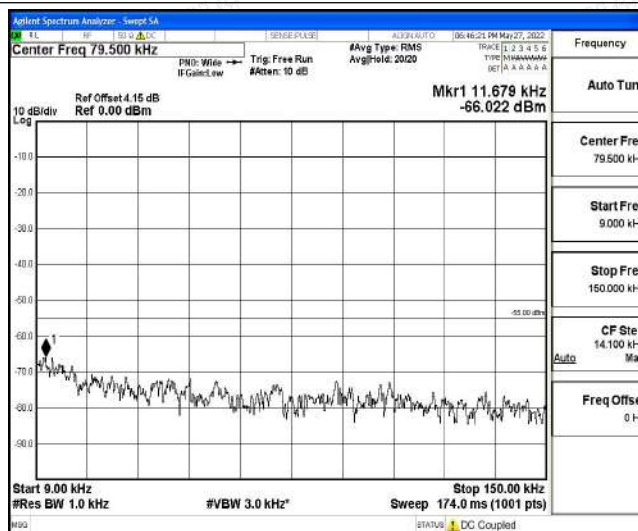

Band41-10MHz-16QAM-41540-1RB#0-Range2:0.15~30MHz

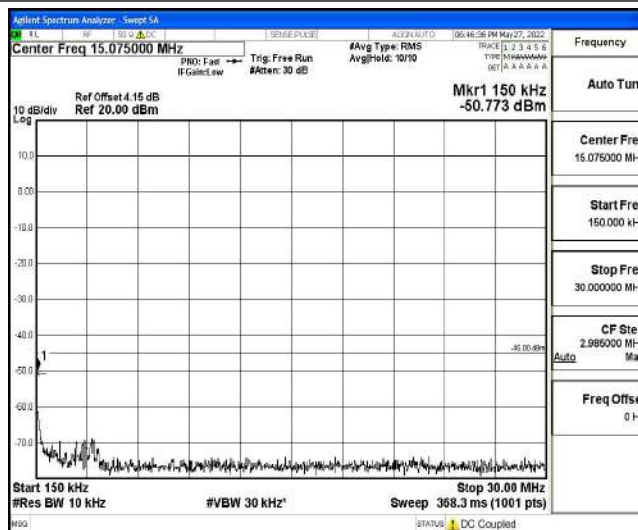


Band41-10MHz-16QAM-41540-1RB#0-Range3:30~1000MHz

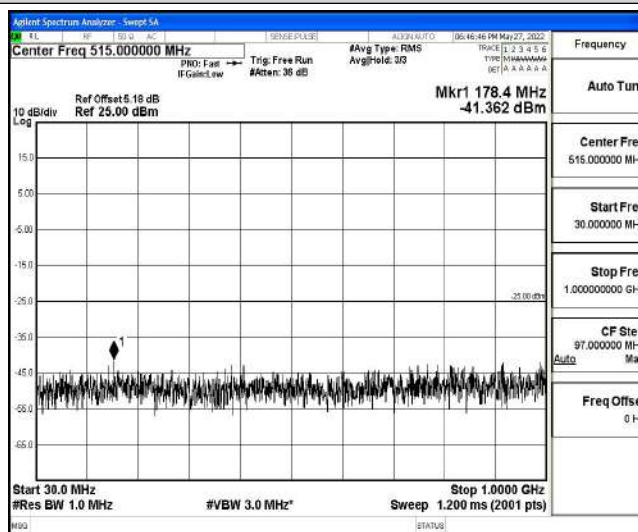


Band41-10MHz-16QAM-41540-1RB#0-Range4:1000~10000MHz




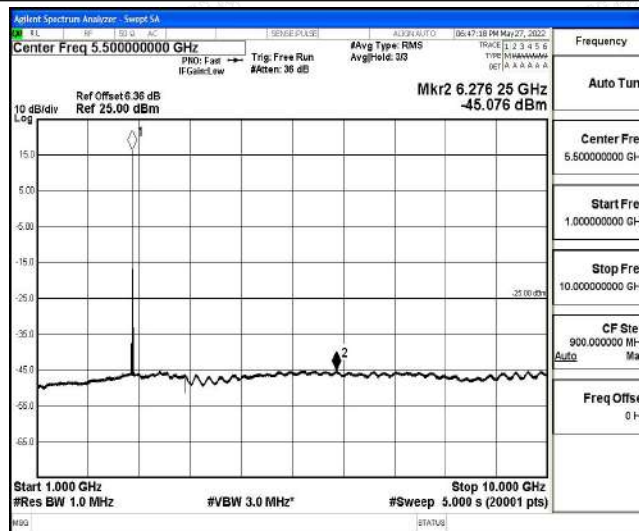

Band41-10MHz-16QAM-41540-1RB#0-Range5:10000~20000MHz

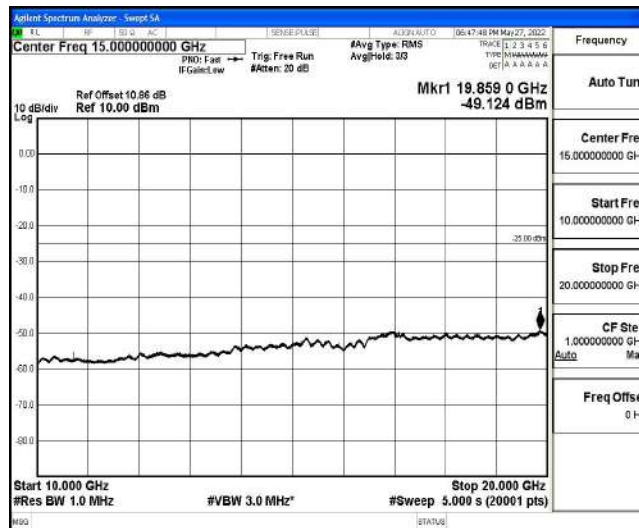


Band41-10MHz-16QAM-41540-1RB#0-Range6:20000~26500MHz

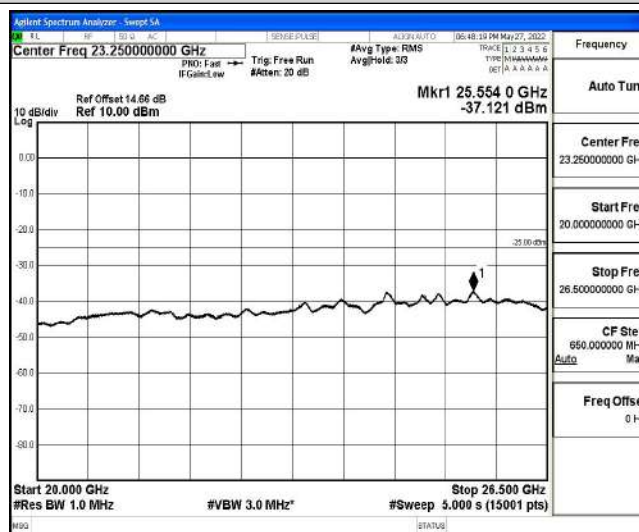


Band41-15MHz-QPSK-39725-1RB#0-Range1:0.009~0.15MHz




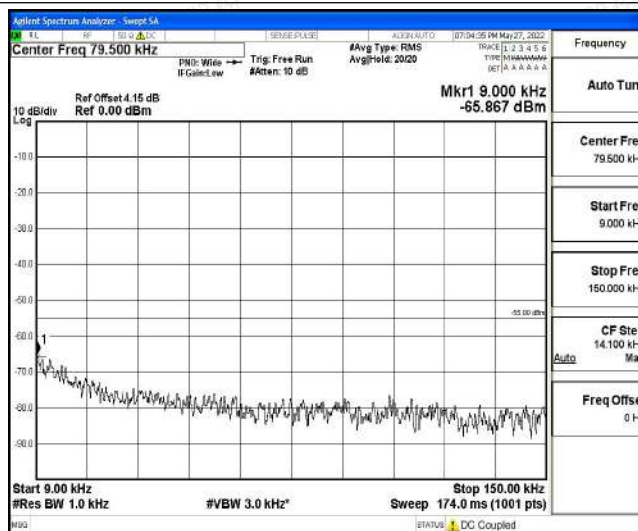

Band41-15MHz-QPSK-39725-1RB#0-Range2:0.15~30MHz

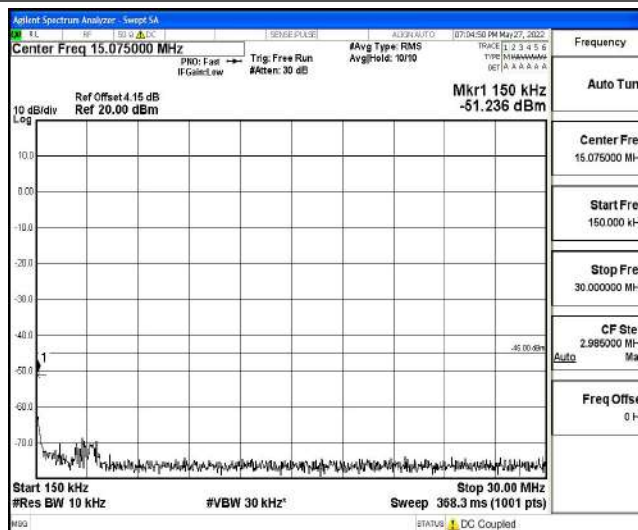

Band41-15MHz-QPSK-39725-1RB#0-Range3:30~1000MHz

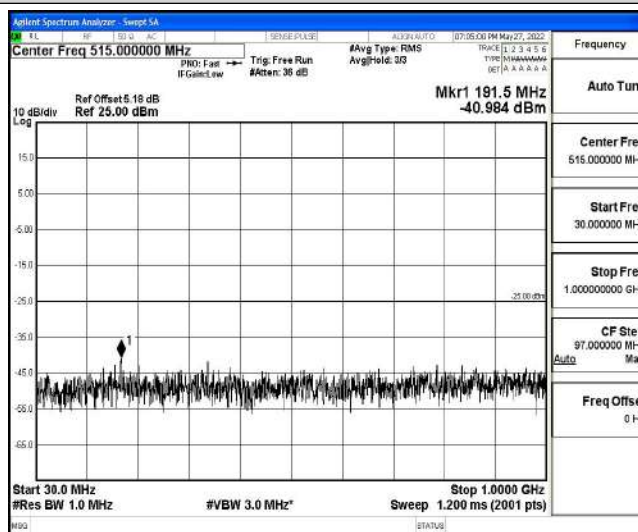

Band41-15MHz-QPSK-39725-1RB#0-Range4:1000~10000MHz




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

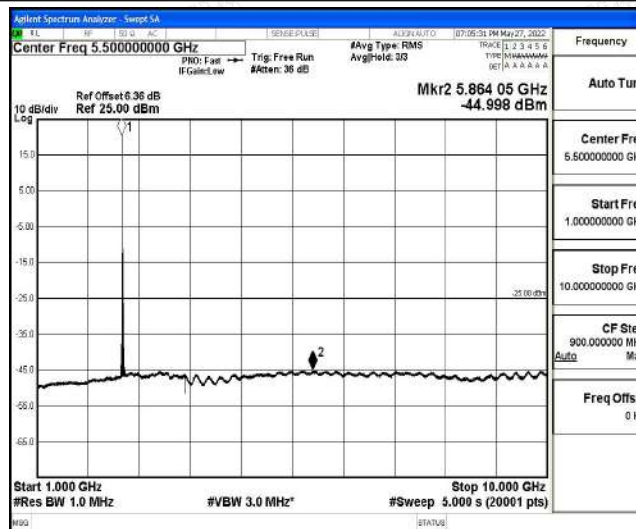

Band41-15MHz-QPSK-39725-1RB#0-Range5:10000~20000MHz

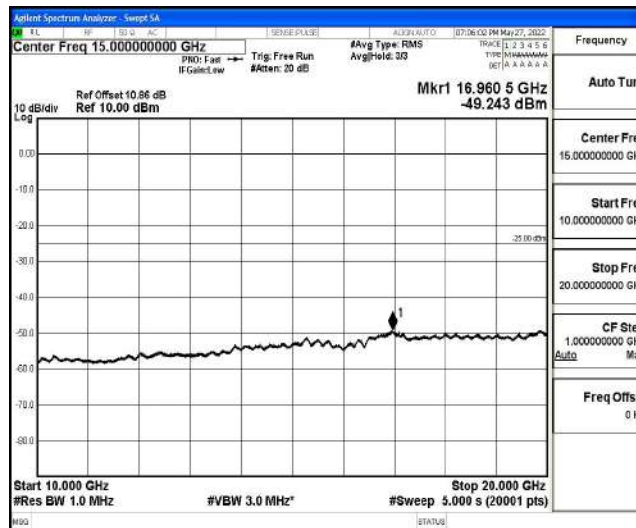


Band41-15MHz-QPSK-39725-1RB#0-Range6:20000~26500MHz

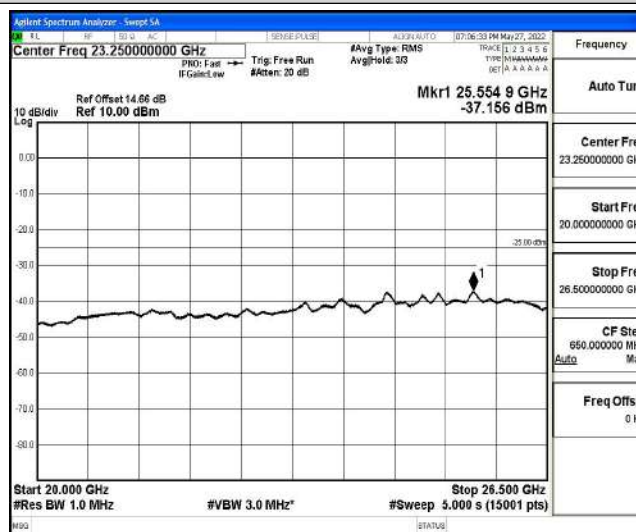


Band41-15MHz-QPSK-40620-1RB#0-Range1:0.009~0.15MHz




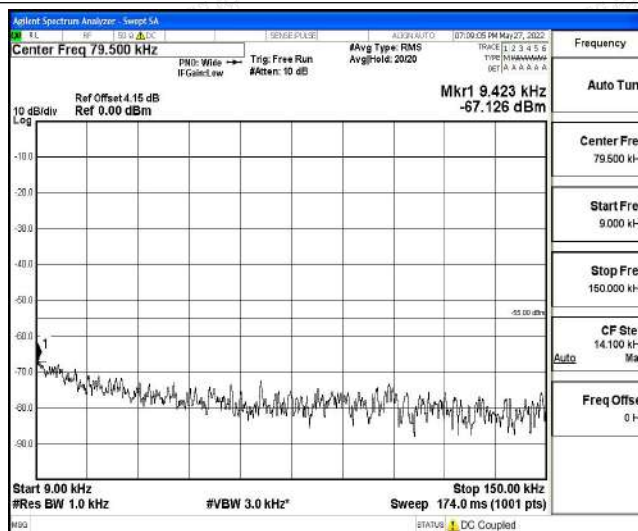

Band41-15MHz-QPSK-40620-1RB#0-Range2:0.15~30MHz

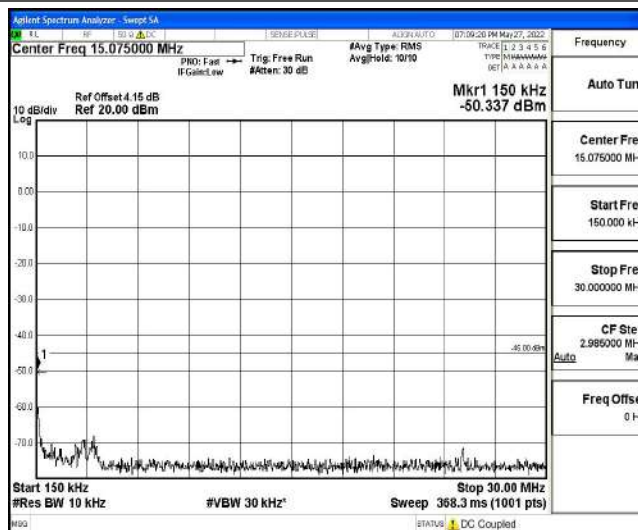


Band41-15MHz-QPSK-40620-1RB#0-Range3:30~1000MHz

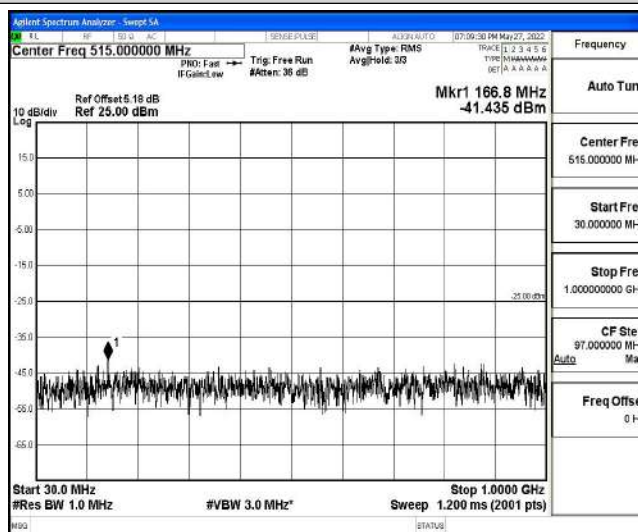


Band41-15MHz-QPSK-40620-1RB#0-Range4:1000~10000MHz




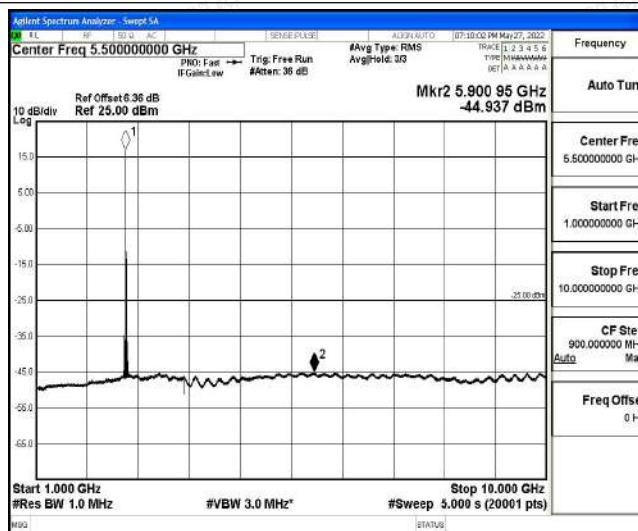

Band41-15MHz-QPSK-40620-1RB#0-Range5:10000~20000MHz

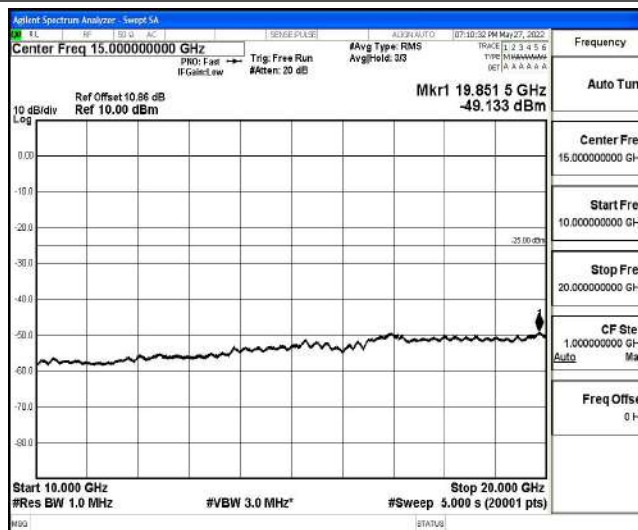


Band41-15MHz-QPSK-40620-1RB#0-Range6:20000~26500MHz

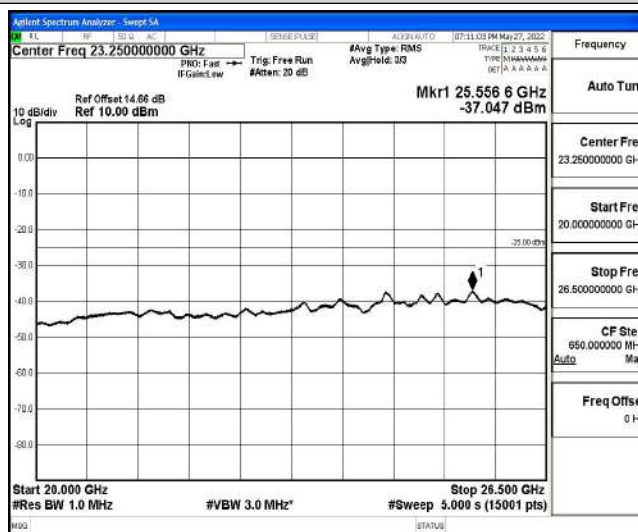


Band41-15MHz-QPSK-41515-1RB#0-Range1:0.009~0.15MHz




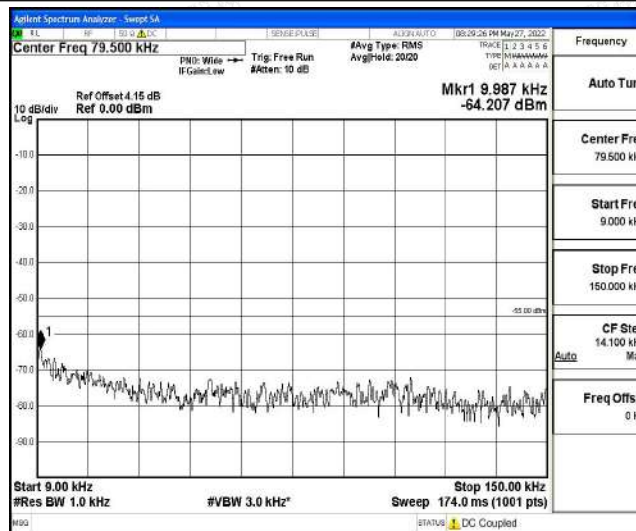

Band41-15MHz-QPSK-41515-1RB#0-Range2:0.15~30MHz

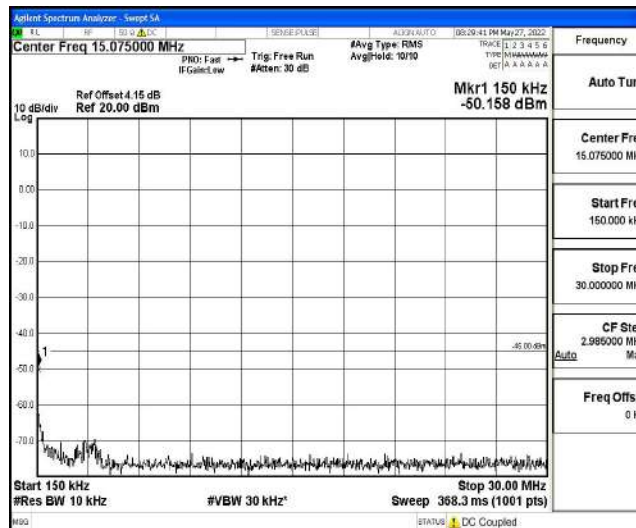


Band41-15MHz-QPSK-41515-1RB#0-Range3:30~1000MHz

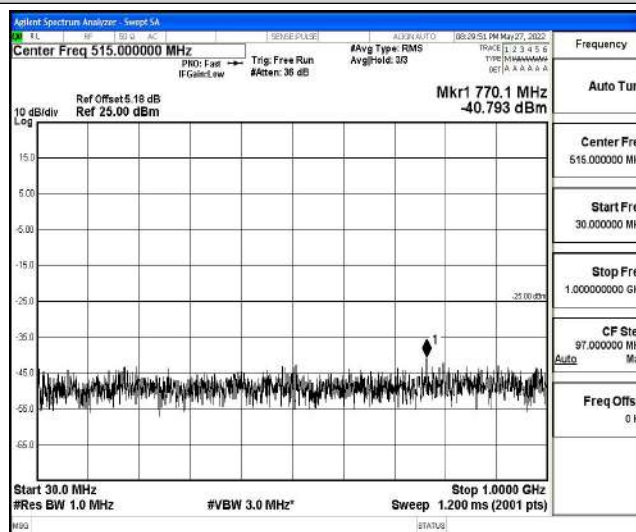


Band41-15MHz-QPSK-41515-1RB#0-Range4:1000~10000MHz




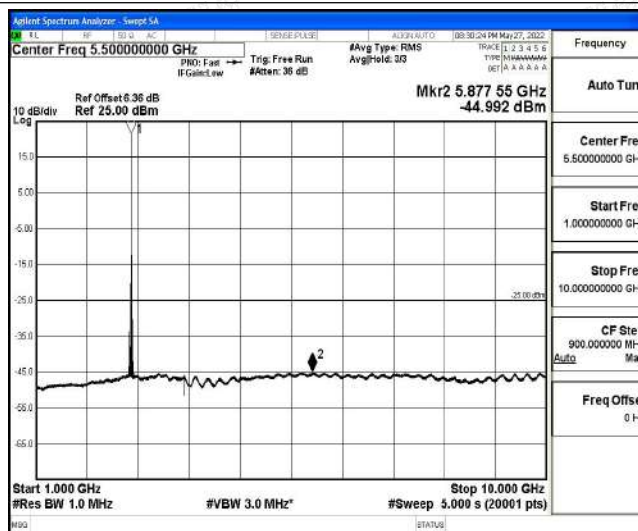

Band41-15MHz-QPSK-41515-1RB#0-Range5:10000~20000MHz

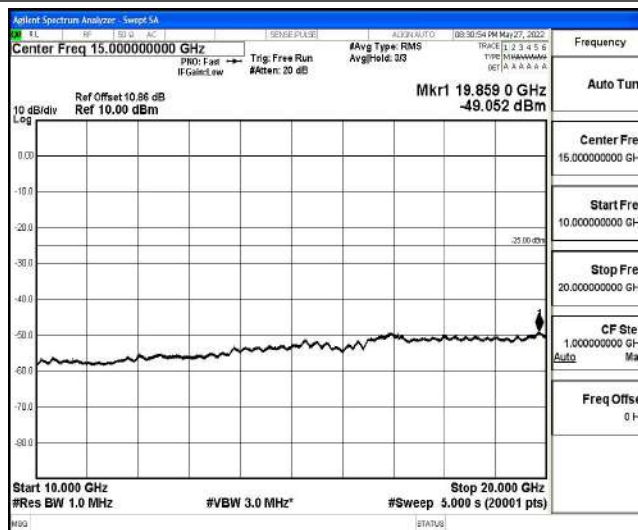

Band41-15MHz-QPSK-41515-1RB#0-Range6:20000~26500MHz

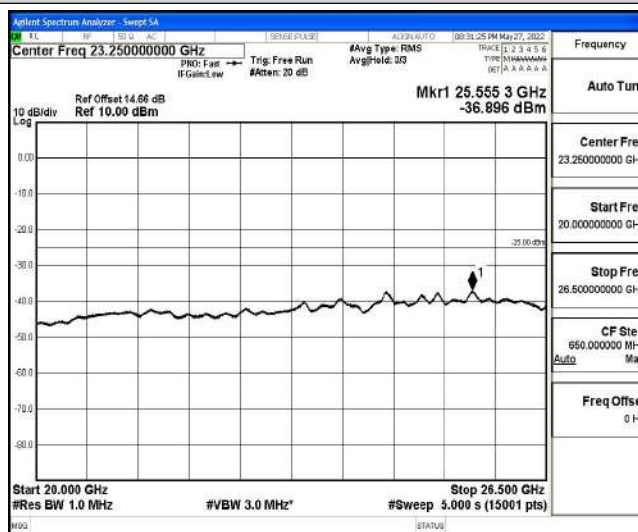

Band41-15MHz-16QAM-39725-1RB#0-Range1:0.009~0.15MHz

