# Aid Compatibility (HAC) T-Coil Test Report

**APPLICANT**: Sony Mobile Communications Inc.

**BRAND NAME**: Sony

FCC ID : PY7-24118Q

T-RATING: T4

STANDARD : FCC 47 CFR §20.19

ANSI C63.19-2011

We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Eric Huang / Manager

ENc man?

Approved by: Jones Tsai / Manager





Report No.: HA7O1941-03B

#### SPORTON INTERNATIONAL INC.

No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 1 of 19
Report Issued Date : Mar. 14, 2018



# **Table of Contents**

1.	Attestation of Test Summary	4
2.	General Information	5
3.	Administration Data	6
4.	Applied Standards	6
	••	
6.	Measurement standards for T-Coil	8
	6.1 Frequency Response	8
	6.2 T-Coil Signal Quality Categories	8
7.	T-Coil Test Procedure	g
	7.1 Test Flow Chart	10
	7.2 Test Setup Diagram	11
	7.3 Description of EUT Test Position	12
8.	Test Equipment List	13
9.	T-Coil testing for OTT VoIP Calling	14
10.	Uncertainty Assessment	on of Test Summary
11.	References	19

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q

# **Revision History**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
HA7O1941-03B	Rev. 01	Initial issue of report	Feb. 14, 2018
HA7O1941-03B	Rev. 02	Update section9 and add KDB 285076 D03v01 in the report.	Mar. 14, 2018

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 3 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

# 1. Attestation of Test Summary

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity
OTT	EDGE850	T4	Pass	Pass
OTT over EDGE	EDGE1900	T4	Pass	Pass
	Band 2	T4	Pass	Pass
OTT over UMTS	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T4	Pass	Pass
	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
OTT over LTE	Band 12	T4	Pass	Pass
OTTOVELLIE	Band 13	T4	Pass	Pass
	Band 17	T4	Pass	Pass
	Band 26	T4	Pass	Pass
	Band 66	T4	Pass	Pass
	Band 41	T4	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
OTT over WiFi	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
Date Tested		2018/2/9 ~	2018/2/10	

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 4 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

# 2. General Information

	Product Feature & Specification
Applicant Name	Sony Mobile Communications Inc.
Brand Name	Sony
FCC ID	PY7-24118Q
HW Version	A
SW Version	2.66
EUT Stage	Identical Prototype
Exposure category	General Population/Uncontrolled Exposure
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band IV: 826.4 MHz ~ 846.6 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 715.3 MHz LTE Band 17: 706.5 MHz ~ 713.5 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2472 MHz WLAN 5.2GHz Band: 5180 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5720 MHz WLAN 5.8GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA LTE: QPSK, 16QAM, 64QAM 802.11a/b/g/n/ac HT20/HT40/VHT20/VHT40/VHT80 Bluetooth v5.0 with LE

Report No.: HA7O1941-03B

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

Page Number

Report Version

: 5 of 19

: Rev. 02

Report Issued Date: Mar. 14, 2018

FAX: 886-3-328-4978 FCC ID: PY7-24118Q

## 3. Administration Data

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Testing Laboratory						
Test Site SPORTON INTERNATIONAL INC.						
Test Site Location	No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978					
Test Site No.	Sporton Site No. : SAR04-HY					
	Applicant					
Company Name	Sony Mobile Communications Inc.					
Address	4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan					
Manufacturer						
Company Name Sony Mobile Communications Inc.						
Address	4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan					

# 4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19-2011
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 6 of 19
Report Issued Date : Mar. 14, 2018

Report No. : HA7O1941-03B

## 5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
COM	EDGE850	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
GSM	EDGE1900	۷D	162	WLAN, BI	Google Duo	INO
	850			WLAN, BT		No
UMTS	1750	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	1900			WLAN, BT		No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT	Google Duo <sup>(1)</sup>	No
	Band 7			WLAN, BT		No
LTE (FDD)	Band 12	VD	Yes	WLAN, BT		No
(1 55)	Band 13			WLAN, BT		No
	Band 17			WLAN, BT		No
	Band 26			WLAN, BT		No
	Band 66			WLAN, BT		No
LTE (TDD)	Band 41	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	2450					No
	5200					No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,LTE	Google Duo <sup>(1)</sup>	No
	5500					No
	5800					No
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No

#### Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

#### Remark:

1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 7 of 19
Report Issued Date : Mar. 14, 2018


Report No.: HA7O1941-03B

## 6. Measurement standards for T-Coil

#### 6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA7O1941-03B

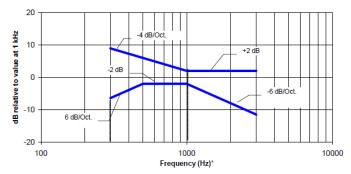

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

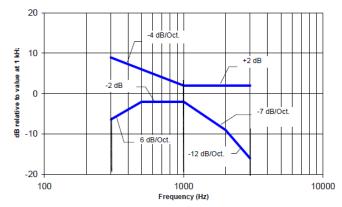

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

#### 6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

 SPORTON INTERNATIONAL INC.
 Page Number
 : 8 of 19

 TEL: 886-3-327-3456
 Report Issued Date
 : Mar. 14, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 02

FCC ID: PY7-24118Q

### 7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA7O1941-03B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 9 of 19

 TEL: 886-3-327-3456
 Report Issued Date
 : Mar. 14, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 02

FCC ID: PY7-24118Q

#### 7.1 Test Flow Chart


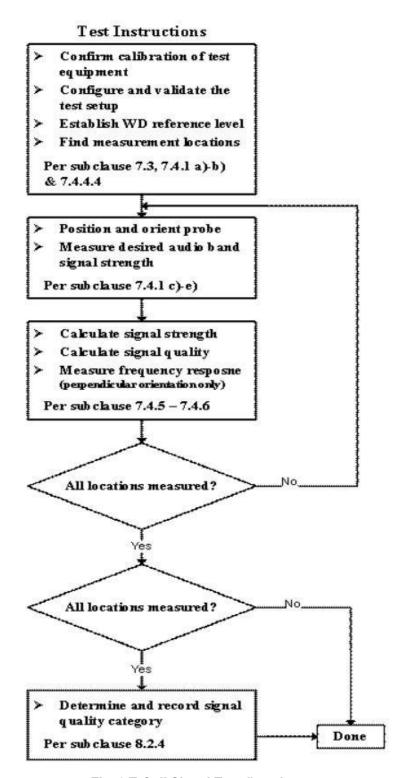


Fig. 2 T-Coil Signal Test flowchart

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 10 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

#### 7.2 Test Setup Diagram

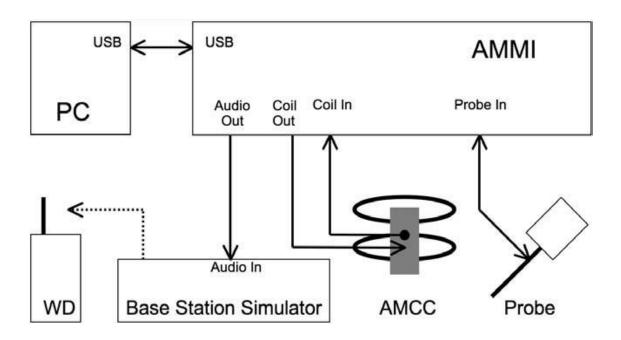

#### **General Note:**

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
  - OTT VoIP input Level: -20dBm0
- 2. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal
- 2. The below calculation formula is an example and showing how to determine the input level for the air interface for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
	3.0	0.0	1.00	
10	3.0	0.0	1.00	
10	6.0	-3.0	1.42	
10	6.0	-2.9	1.40	
10	13.8	-10.5	3.34	
10	11.1	-7.9	2.49	
1	16.2	-12.7	4.33	
2	21.6	-18.6	8.48	
	[s] 10 10 10 10 10 10 11 1	[s] RMS [dB] 3.0 10 3.0 10 6.0 10 6.0 10 13.8 10 11.1 1 16.2	[s] RMS [dB] [dB] 3.0 0.0 10 3.0 0.0 10 6.0 -3.0 10 6.0 -2.9 10 13.8 -10.5 10 11.1 -7.9 1 16.2 -12.7	[s] RMS [dB] [dB] factor *) 3.0 0.0 1.00 10 3.0 0.0 1.00 10 6.0 -3.0 1.42 10 6.0 -2.9 1.40 10 13.8 -10.5 3.34 10 11.1 -7.9 2.49 1 16.2 -12.7 4.33

(\*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 11 of 19
Report Issued Date : Mar. 14, 2018

Report No.: HA7O1941-03B

#### 7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

- ◆ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- ◆ The measurement plane is parallel to, and 10 mm in front of, the reference plane.

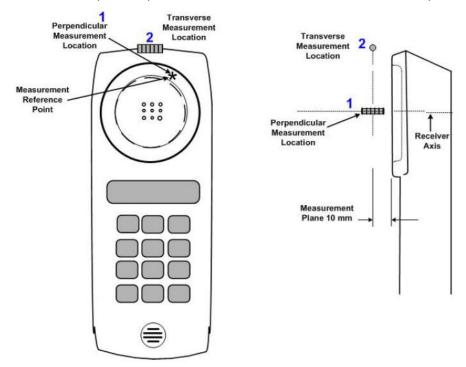


Fig.3 A typical EUT reference and plane for T-Coil measurements

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 12 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

# 8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medal	Serial Number	Calibration		
Manufacturer	Name of Equipment	Type/Model	Seriai Number	Last Cal.	Due Date	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018	
SPEAG	Data Acquisition Electronics	DAE4	854	May. 02, 2017	May. 01, 2018	
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR	
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR	
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR	
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR	
Gencom Thermometer		TE1	TM685-1	Mar. 21, 2017	Mar. 20, 2018	
R&S	Base Station	CMW500	157119	Jun. 18, 2017	Jun. 17, 2018	

Note:

1. NCR: "No-Calibration Required"

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 13 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

## 9. T-Coil testing for OTT VoIP Calling

#### **General Notes:**

1. The google Duo VoIP call software is pre-installed on this device and head-to-ear scenario should be consideration, the google Duo uses the OPUS audio codec and support 6Kbpa to 75Kbps bitrate. According to KDB 285076 D02, all air interfaces via a data connection with google Duo VoIP calling would be consideration to be tested.

Report No.: HA7O1941-03B

- 2. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0
- 3. For OTT VoIP codec investigation test reduction, due to all air interface have the same codec configuration, therefore, the codec investigation was choose 2.4GHz WLAN to determine the audio codec configuration to be used for others air interfaces testing. the following codec investigation tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 4. According to 3GPP 36.211 Table 4.2-2, the TDD LTE supports uplink-downlink configuration 0 to 6, an investigation was performed to determine the worst-case uplink-downlink configuration to be used.
- 5. For OTT VoIP codec investigation, due to all air interface have the same codec configuration, therefore, the codec investigation was choose WLAN2.4GHz to determine the audio codec configuration to be used for others air interfaces testing.

#### < Radio configure Investigation>

Air Interface	Bandwidth (MHz)	Modulation	RB size	RB offset	channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
LTE B2	20	QPSK	1	0	18900		7.04	-48.48	55.52
LTE B2	20	QPSK	50	0	18900		7.05	-49.36	56.41
LTE B2	20	QPSK	100	0	18900		7.04	-49.06	56.10
LTE B2	20	16QAM	1	0	18900		7.05	-48.55	55.60
LTE B2	20	64QAM	1	0	18900		-7.12	-63.25	56.13
LTE B2	15	QPSK	1	0	18900		7.07	-48.64	55.71
LTE B2	10	QPSK	1	0	18900		7.05	-48.59	55.64
LTE B2	5	QPSK	1	0	18900		7.05	-48.68	55.73
LTE B2	3	QPSK	1	0	18900		7.05	-48.49	55.54
LTE B2	1.4	QPSK	1	0	18900		7.06	-48.54	55.60
LTE B41	20	QPSK	1	0	40620	0	6.83	-46.80	53.63
LTE B41	20	QPSK	1	0	40620	1	6.27	-48.42	54.69
LTE B41	20	QPSK	1	0	40620	2	6.83	-47.71	54.54
LTE B41	20	QPSK	1	0	40620	3	6.23	-48.49	54.72
LTE B41	20	QPSK	1	0	40620	4	6.81	-47.42	54.23
LTE B41	20	QPSK	1	0	40620	5	7.09	-47.28	54.37
LTE B41	20	QPSK	1	0	40620	6	6.83	-47.55	54.38

 SPORTON INTERNATIONAL INC.
 Page Number
 : 14 of 19

 TEL: 886-3-327-3456
 Report Issued Date
 : Mar. 14, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 02

FCC ID: PY7-24118Q



Air Interface	Bandwidth	Data rate	channel	Antenna	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
802.11b	20	1M	6	Ant 2	7.60	-37.42	45.02
802.11b	20	11 M	6	Ant 2	7.63	-37.85	45.48
802.11g	20	6M	6	Ant 2	7.60	-38.38	45.98
802.11g	20	54M	6	Ant 2	7.68	-38.47	46.15
802.11n-HT20	20	MCS0	6	Ant 2	7.68	-38.61	46.29
802.11n-HT20	20	MCS7	6	Ant 2	7.68	-38.35	46.03
802.11a	20	6M	40	Ant 1	8.49	-35.26	43.75
802.11a	20	54M	40	Ant 1	8.59	-35.47	44.06
802.11an-HT20	20	MCS0	40	Ant 1	8.59	-35.41	44.00
802.11an-HT20	20	MCS7	40	Ant 1	8.55	-35.40	43.95
802.11an-HT40	40	MCS0	40	Ant 1	8.63	-35.36	43.99
802.11an-HT40	40	MCS7	40	Ant 1	8.59	-35.37	43.96
802.11ac-VHT20	20	MCS0	40	Ant 1	8.61	-36.08	44.69
802.11ac-VHT20	20	MCS8	40	Ant 1	8.65	-35.21	43.86
802.11ac-VHT40	40	MCS0	40	Ant 1	8.59	-35.28	43.87
802.11ac-VHT40	40	MCS9	40	Ant 1	8.61	-35.35	43.96
802.11ac-VHT80	80	MCS0	40	Ant 1	8.62	-35.44	44.06
802.11ac-VHT80	80	MCS9	40	Ant 1	8.60	-35.42	44.02

#### <Codec Investigation>

Codec State	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	Orientation	Band/channe	
ABM1 (dBA/m)	6.65	6.23	7.79			
ABM2 (dBA/m)	-38.74	-38.70	-37.77	A : 1 (7)	WLAN2.4GHz /CH 6	
Signal Quality (dB)	45.39	44.93	45.56	Axial (Z)		
Freq. Response	PASS	PASS	PASS			

Remark: The worst SNR is bitrate 40Kbps

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 15 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02



## <Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T-Rating	Frequency Response
1	GSM850	EDGE 2 Tx slots	189	Axial (Z)	6.31	-34.74	41.05	T4	PASS
'				Transversal (Y)	0.15	-48.82	48.97	T4	1 700
2	GSM1900	EDGE 2 Tx slots	661	Axial (Z)	7.04	-36.02	43.06	T4	PASS
	GSW1900	LDGL 2 1X SIOIS	001	Transversal (Y)	0.27	-49.66	49.93	T4	
3	WCDMA II	HSPA	9400	Axial (Z)	5.91	-50.66	56.57	T4	PASS
3				Transversal (Y)	0.50	-50.51	51.01	T4	
4	WCDMA IV	HSPA	1413	Axial (Z)	5.90	-50.87	56.77	T4	PASS
4				Transversal (Y)	0.52	-50.22	50.74	T4	
5	WCDMA V	HSPA	4182	Axial (Z)	6.31	-49.84	56.15	T4	PASS
5				Transversal (Y)	0.56	-49.86	50.42	T4	
6	LTE Band 2	20M_QPSK_1RB_0offset	18900	Axial (Z)	6.90	-49.09	55.99	T4	PASS
O	LIL Ballu Z			Transversal (Y)	0.71	-48.43	49.14	T4	
7	LTE Band 4	20M_QPSK_1RB_0offset	20175	Axial (Z)	6.96	-49.39	56.35	T4	PASS
1				Transversal (Y)	0.73	-48.66	49.39	T4	
8	LTE Band 5	10M_QPSK_1RB_0offset	20525	Axial (Z)	6.45	-48.84	55.29	T4	PASS
0				Transversal (Y)	0.70	-48.41	49.11	T4	
9	LTE Band 7	20M_QPSK_1RB_0offset	21100	Axial (Z)	6.37	-47.79	54.16	T4	PASS
9	LIL Ballu 7			Transversal (Y)	0.40	-48.32	48.72	T4	
10	LTE Band 12	10M_QPSK_1RB_0offset	23095	Axial (Z)	6.47	-48.88	55.35	T4	PASS
10				Transversal (Y)	0.71	-48.50	49.21	T4	
11	LTE Band 13	10M_QPSK_1RB_0offset	23230	Axial (Z)	6.76	-48.78	55.54	T4	PASS
11				Transversal (Y)	0.72	-48.54	49.26	T4	
12	LTE Band 17	10M_QPSK_1RB_0offset	23790	Axial (Z)	6.43	-49.07	55.50	T4	PASS
12				Transversal (Y)	0.64	-49.22	49.86	T4	
13	LTE Band 26	15M_QPSK_1RB_0offset	26865	Axial (Z)	6.45	-48.53	54.98	T4	PASS
				Transversal (Y)	0.64	-49.11	49.75	T4	
14	LTE Band 66	20M_QPSK_1RB_0offset	132322	Axial (Z)	6.52	-48.45	54.97	T4	PASS
				Transversal (Y)	-0.64	-48.81	48.17	T4	
15	LTE Band 41	20M_QPSK_1RB_0offset	40620	Axial (Z)	6.37	-48.09	54.46	T4	PASS
				Transversal (Y)	0.52	-49.16	49.68	T4	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 16 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02



Plot No.	Air Interface	Mode	Channel	Antenna	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T-Rating	Frequency Response
16	WLAN2.4GHz	802.11b 1Mbps	6	Ant 1	Axial (Z)	6.23	-38.70	44.93	T4	PASS
10					Transversal (Y)	-1.17	-45.58	44.41	T4	
17	WLAN2.4GHz	802.11b 1Mbps	6	Ant 2	Axial (Z)	6.88	-38.83	45.71	T4	PASS
17					Transversal (Y)	-1.13	-45.25	44.12	T4	
18	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Axial (Z)	8.69	-35.32	44.01	T4	PASS
10					Transversal (Y)	-0.63	-46.07	45.44	T4	
19	WLAN5GHz	802.11a 6Mbps	60	Ant 1	Axial (Z)	8.42	-35.48	43.90	T4	PASS
19					Transversal (Y)	-0.58	-45.99	45.41	T4	
20	WLAN5GHz	802.11a 6Mbps	124	Ant 1	Axial (Z)	8.52	-35.46	43.98	T4	PASS
20					Transversal (Y)	-0.48	-46.11	45.63	T4	
21	WLAN5GHz	802.11a 6Mbps	157	Ant 1	Axial (Z)	8.51	-35.46	43.97	T4	PASS
21					Transversal (Y)	-0.45	-46.02	45.57	T4	
22	WLAN5GHz	802.11a 6Mbps	40	Ant 2	Axial (Z)	4.80	-39.86	44.66	T4	PASS
22					Transversal (Y)	-0.54	-46.46	45.92	T4	
00	WLAN5GHz	802.11a 6Mbps	60	Ant 2	Axial (Z)	4.90	-39.43	44.33	T4	PASS
23					Transversal (Y)	-0.65	-46.60	45.95	T4	
24	WLAN5GHz	802.11a 6Mbps	124	Ant 2	Axial (Z)	8.41	-35.48	43.89	T4	PASS
24					Transversal (Y)	-0.90	-46.22	45.32	T4	
25	WLAN5GHz	802.11a 6Mbps	157	Ant 2	Axial (Z)	8.46	-35.26	43.72	T4	- PASS
					Transversal (Y)	-0.72	-46.22	45.50	T4	

#### Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Galan Chang and Steven Chang

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 17 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02

### 10. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)			
Probe Sensitivity										
Reference Level	3.0	0 Normal		1	1	± 3.0 %	± 3.0 %			
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %			
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %			
Noise Contribution	0.7 Rectangular √3 0.0143 1		1	± 0.0 %	± 0.4 %					
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %			
Probe System										
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %			
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %			
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %			
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %			
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %			
		Test Siç	gnal							
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %			
Positioning										
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %			
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %			
External Contributions										
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %			
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %			
	± 4.1 %	± 6.1 %								
	K = 2									
	± 8.1 %	± 12.3 %								

Table 8.2 Uncertainty Budget of audio band magnetic measurement

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 18 of 19
Report Issued Date : Mar. 14, 2018

Report No.: HA7O1941-03B



#### 11. References

- [1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.
- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "HEARING AID COMPATIBILITY Frequently Asked Questions", Sep 2017
- [5] SPEAG DASY System Handbook

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-24118Q Page Number : 19 of 19
Report Issued Date : Mar. 14, 2018
Report Version : Rev. 02