



### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

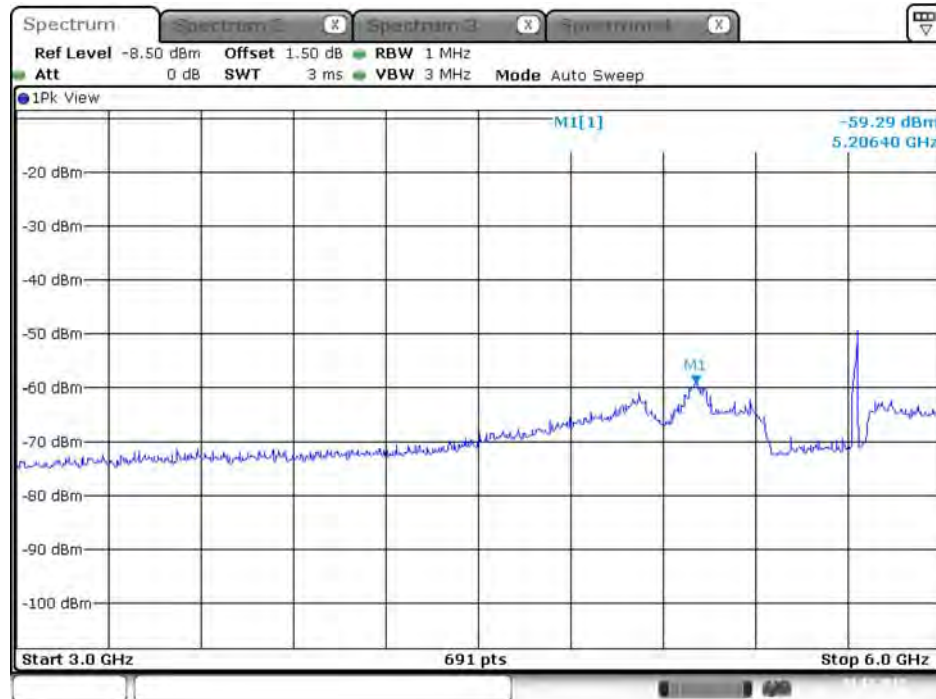


Date: 1 DEC 2017 21:50:31

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 3GHz~6GHz\_Emission in Non-restriction band

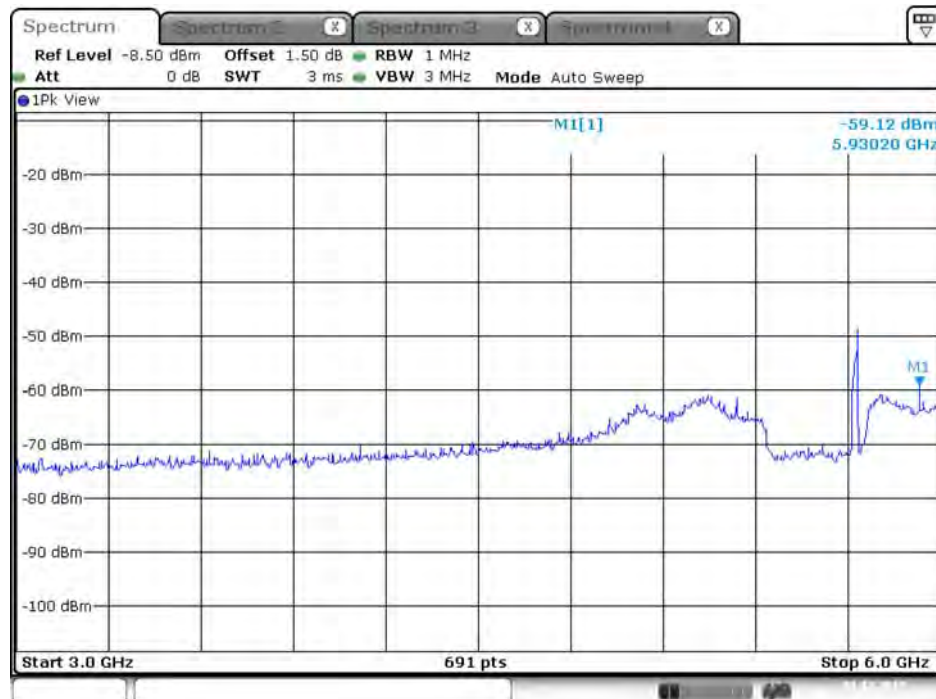

Date: 1 DEC 2017 21:39:32

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 1 / 3GHz~6GHz

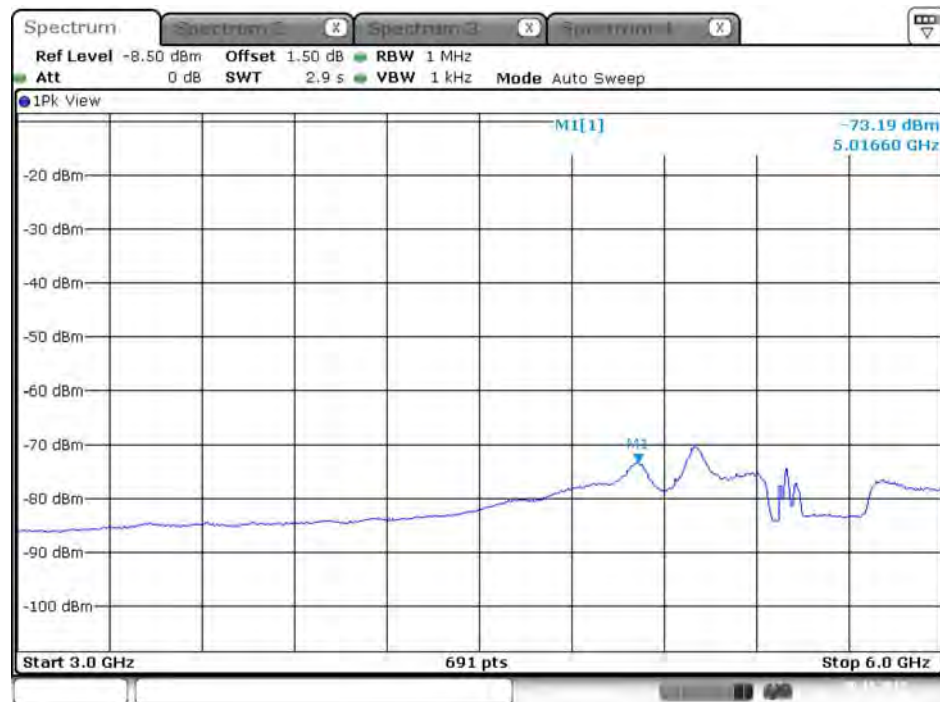


Date: 29.NOV.2017 17:56:09

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 2 / 3GHz~6GHz




Date: 29.NOV.2017 17:58:19

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 1 / 3GHz~6GHz

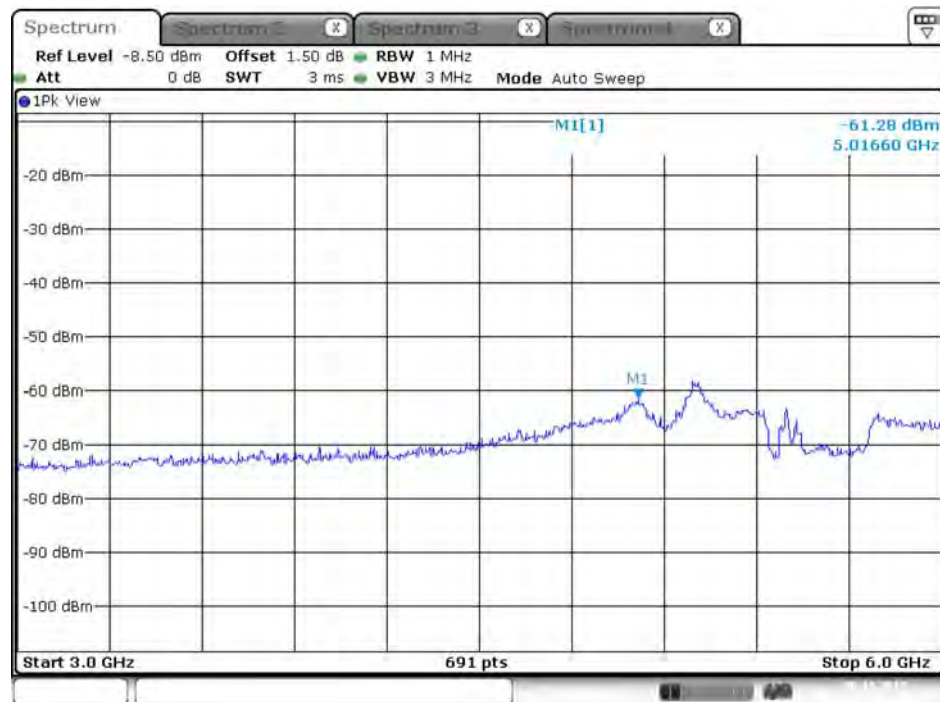

Date: 29.NOV.2017 17:56:44

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 2 / 3GHz~6GHz

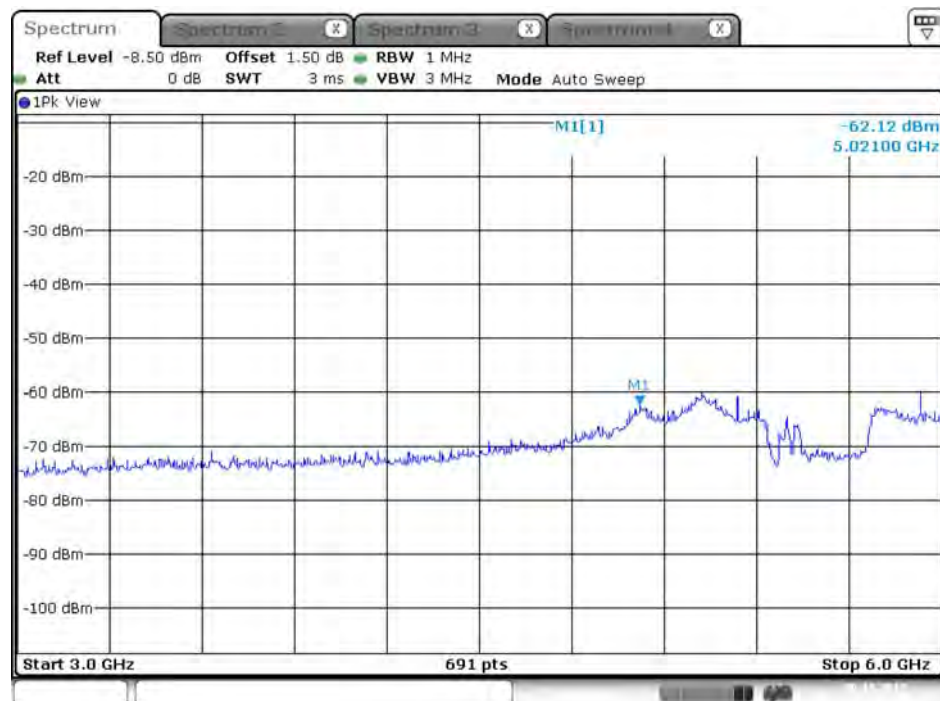

Date: 29.NOV.2017 17:58:49

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 1 / 3GHz~6GHz




Date: 29.NOV.2017 18:04:13

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 2 / 3GHz~6GHz




Date: 29.NOV.2017 18:01:06

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 1 / 3GHz~6GHz

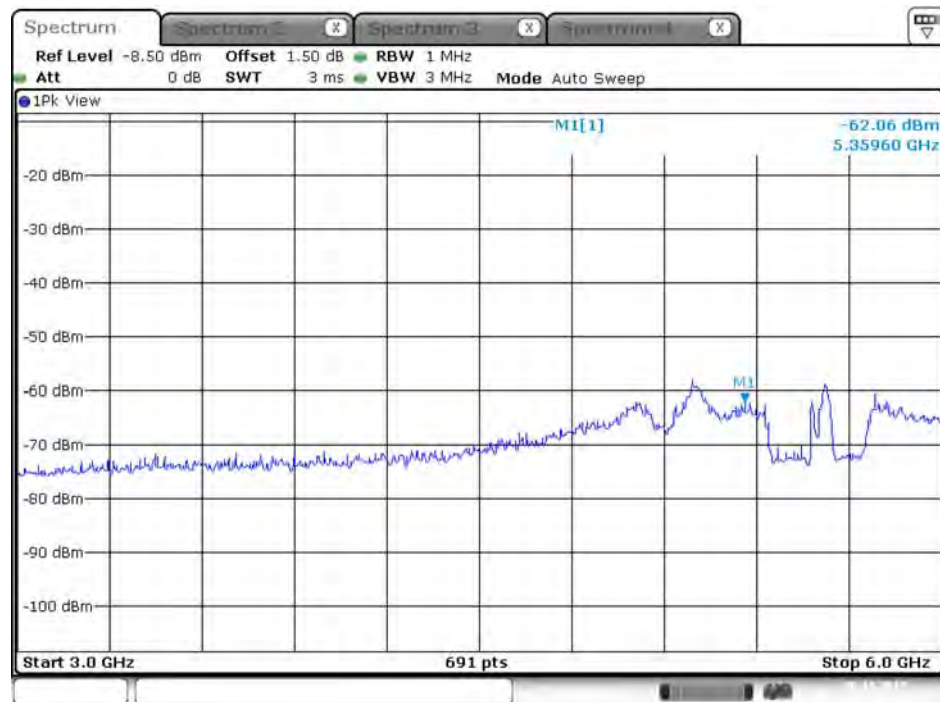

Date: 29.NOV.2017 18:04:48

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 2 / 3GHz~6GHz

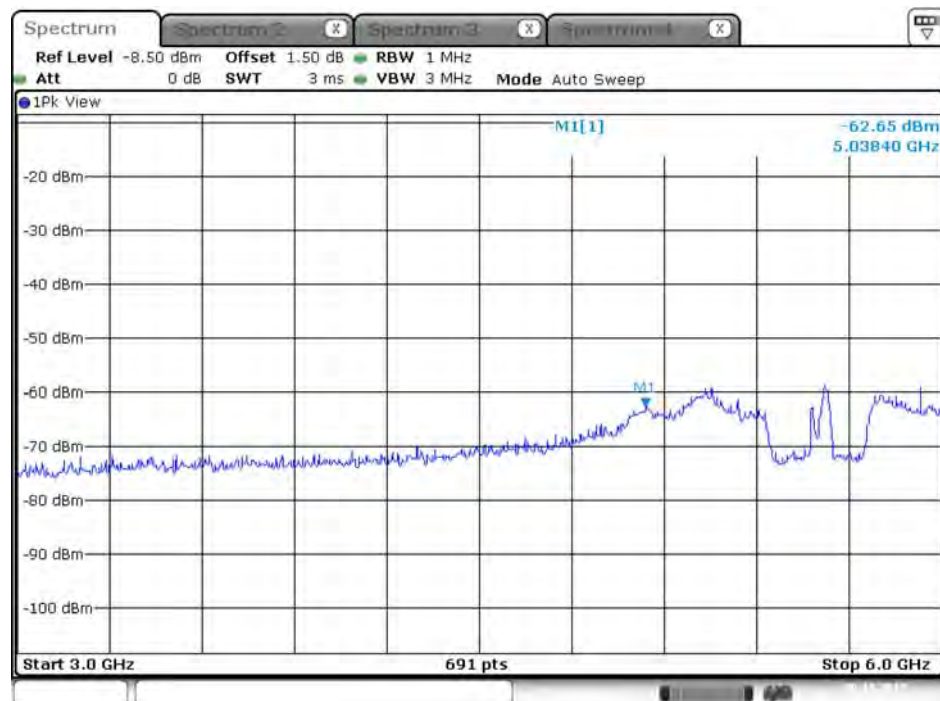

Date: 29.NOV.2017 18:02:00

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 1 / 3GHz~6GHz




Date: 29.NOV.2017 18:06:05

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 2 / 3GHz~6GHz




Date: 29.NOV.2017 18:07:38

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 1 / 3GHz~6GHz

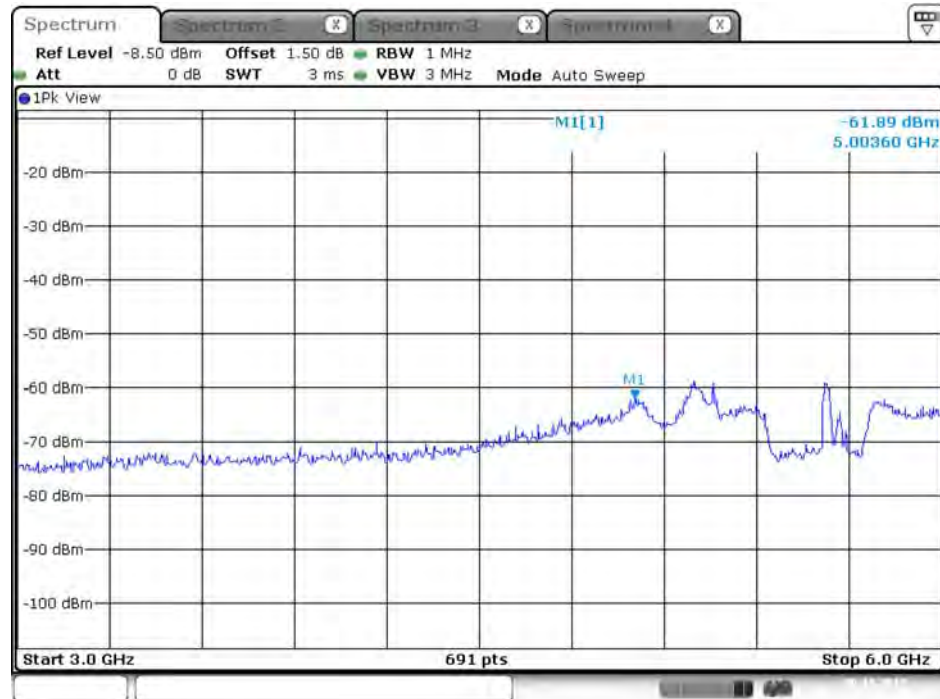

Date: 29.NOV.2017 18:06:25

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 2 / 3GHz~6GHz

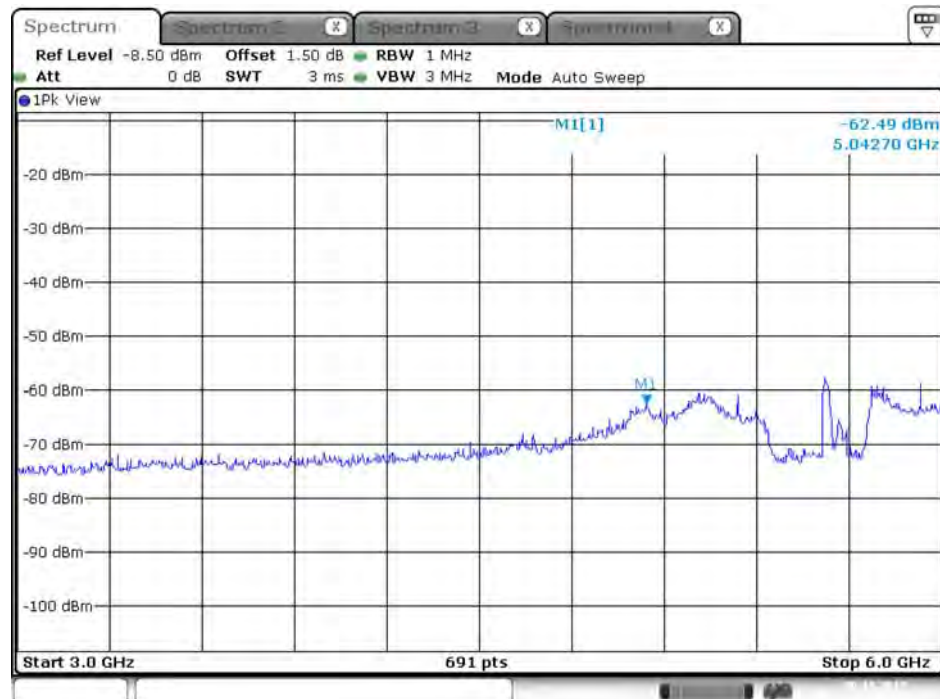

Date: 29.NOV.2017 18:07:57

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 1 / 3GHz~6GHz




Date: 2.DEC.2017 00:44:59

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 2 / 3GHz~6GHz




Date: 2.DEC.2017 00:49:50

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 1 / 3GHz~6GHz

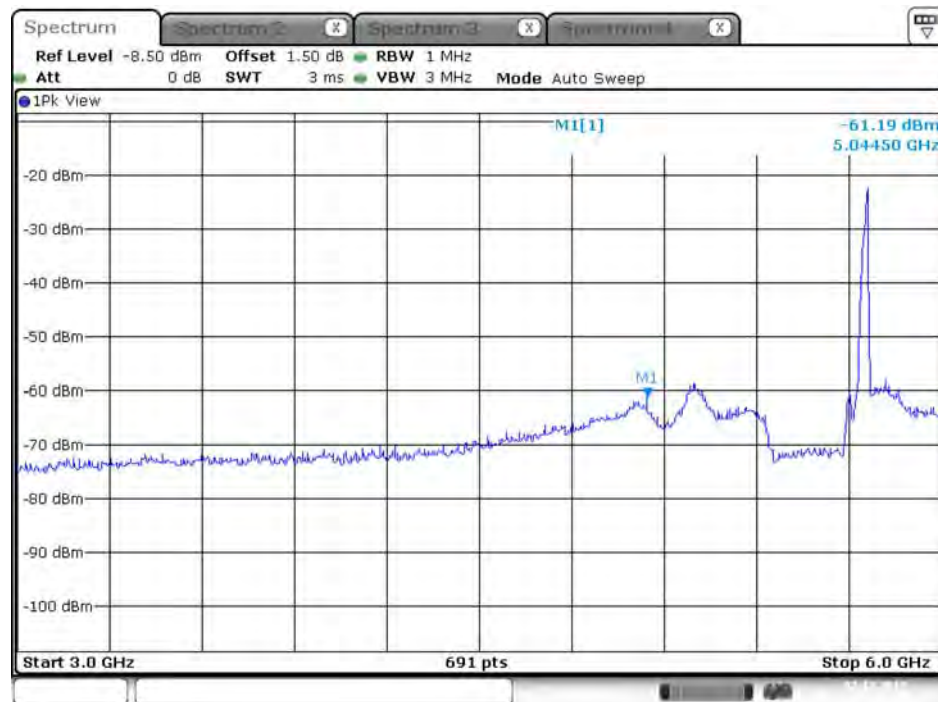


Date: 2.DEC.2017 00:45:47

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 2 / 3GHz~6GHz

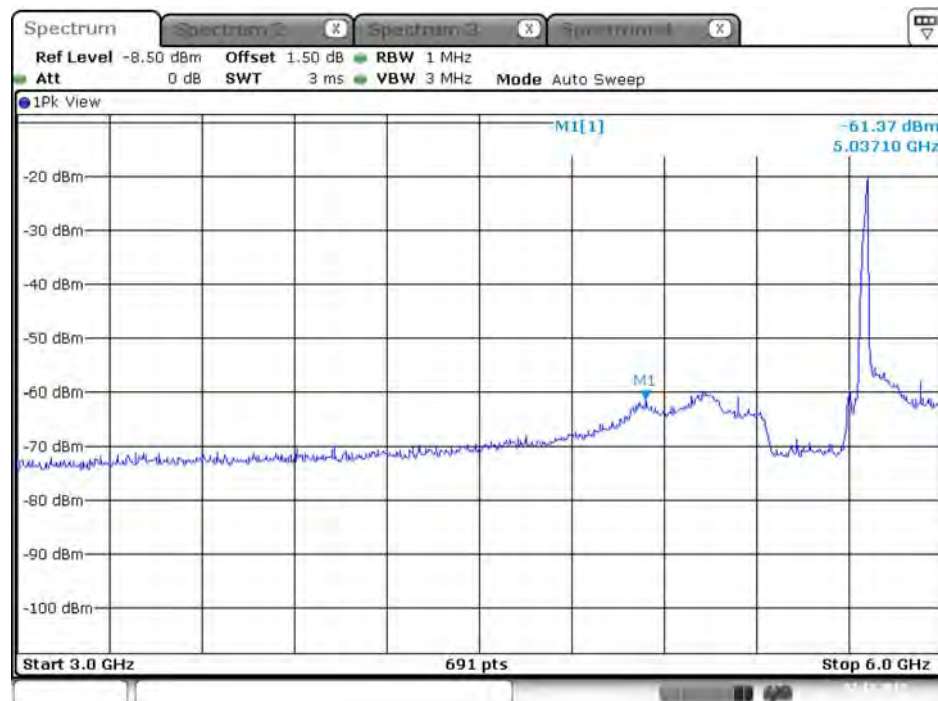


Date: 2.DEC.2017 00:51:19

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

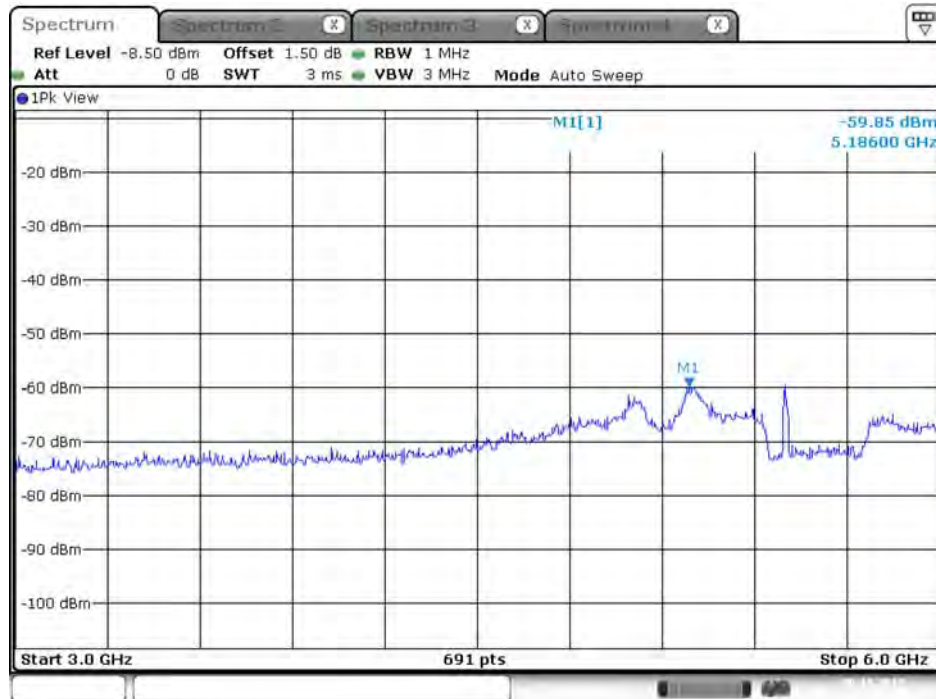


Date: 29.NOV.2017 17:44:46

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 2 / 3GHz~6GHz

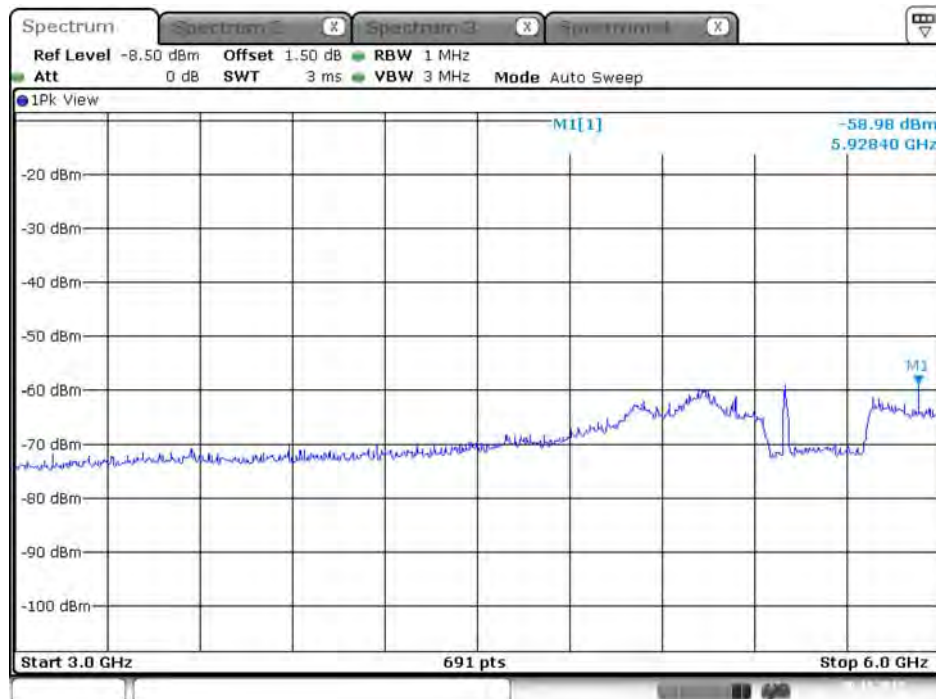


Date: 29.NOV.2017 17:26:14

### Plot on Configuration QPSK, 20M / 5510 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

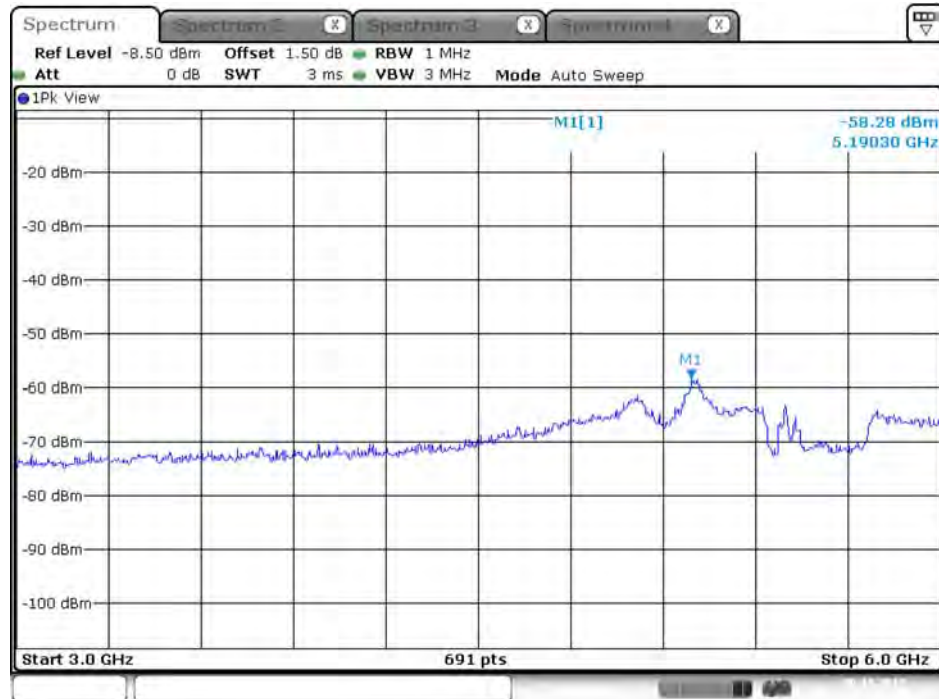


Date: 29.NOV.2017 17:57:13

### Plot on Configuration QPSK, 20M / 5510 MHz / Peak / Port 2 / 3GHz~6GHz\_Emission in Non-restriction band

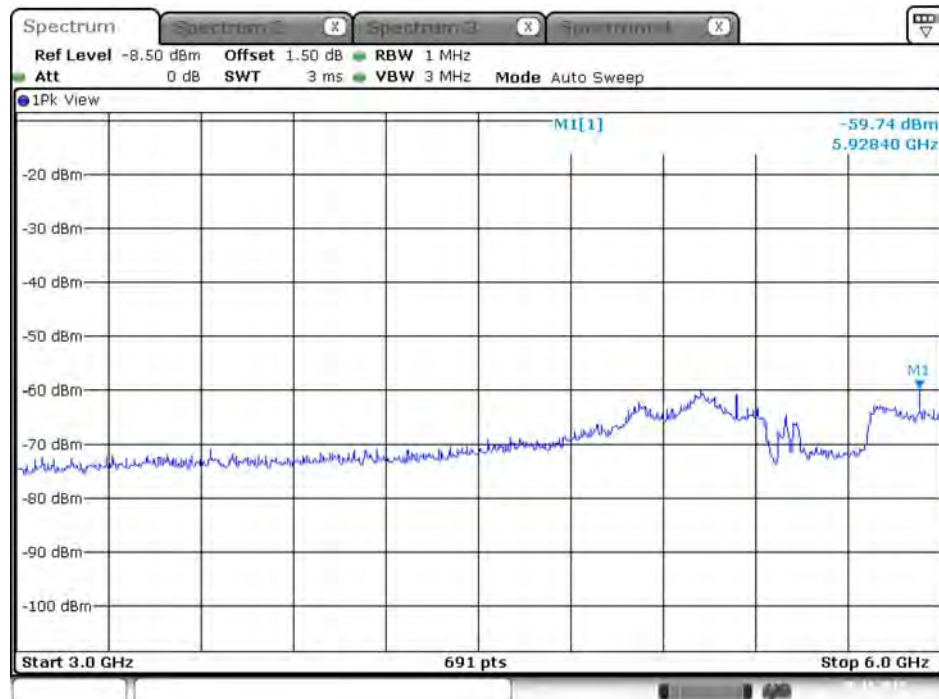


Date: 29.NOV.2017 17:59:02

### Plot on Configuration QPSK, 20M / 5610 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

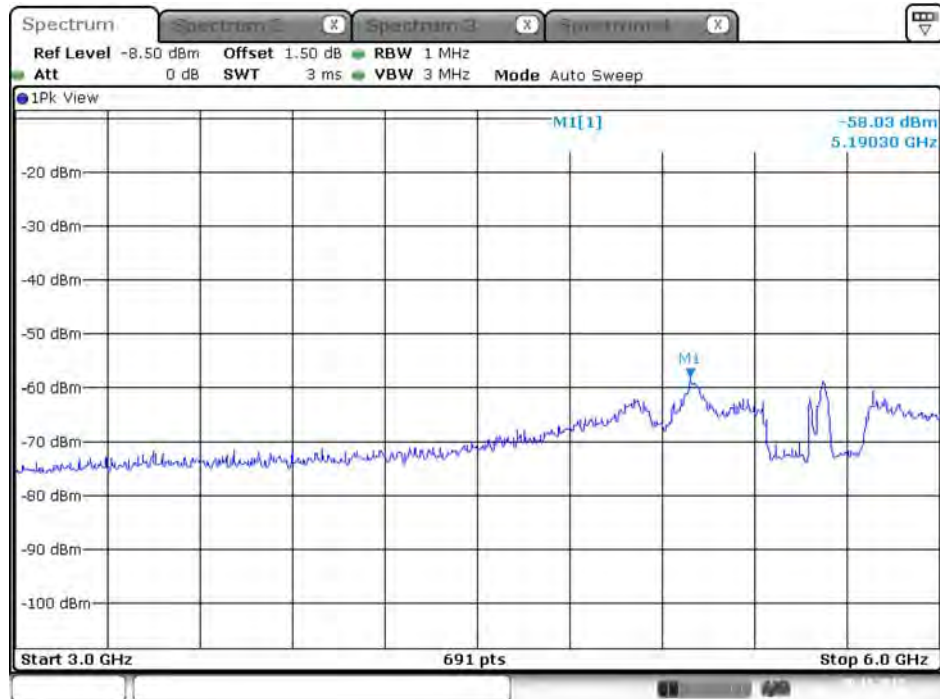


Date: 29.NOV.2017 18:05:06

### Plot on Configuration QPSK, 20M / 5610 MHz / Peak / Port 2 / 3GHz~6GHz\_Emission in Non-restriction band

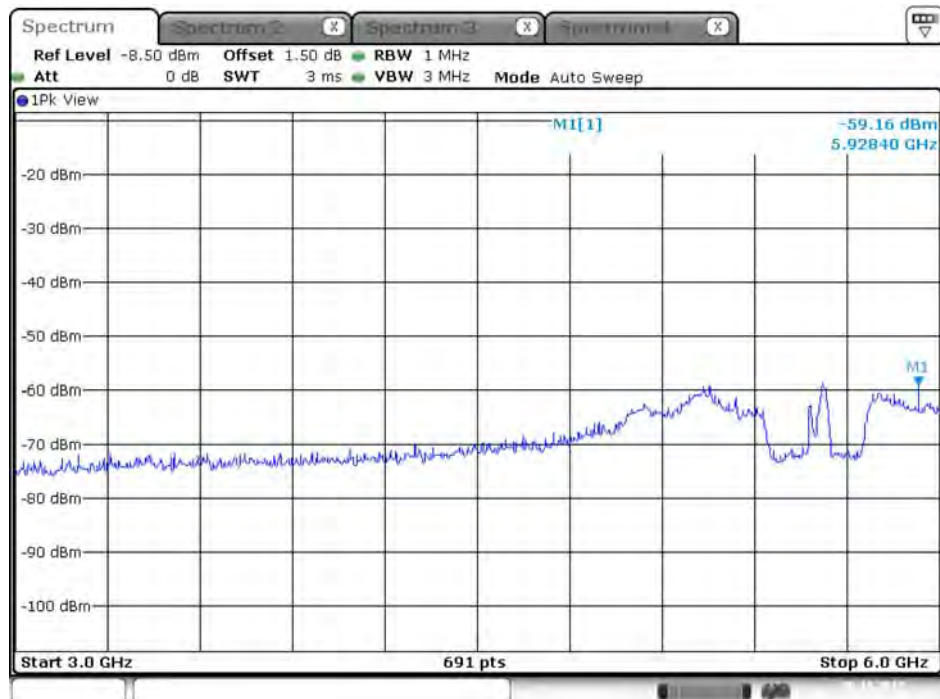


Date: 29.NOV.2017 18:02:37

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

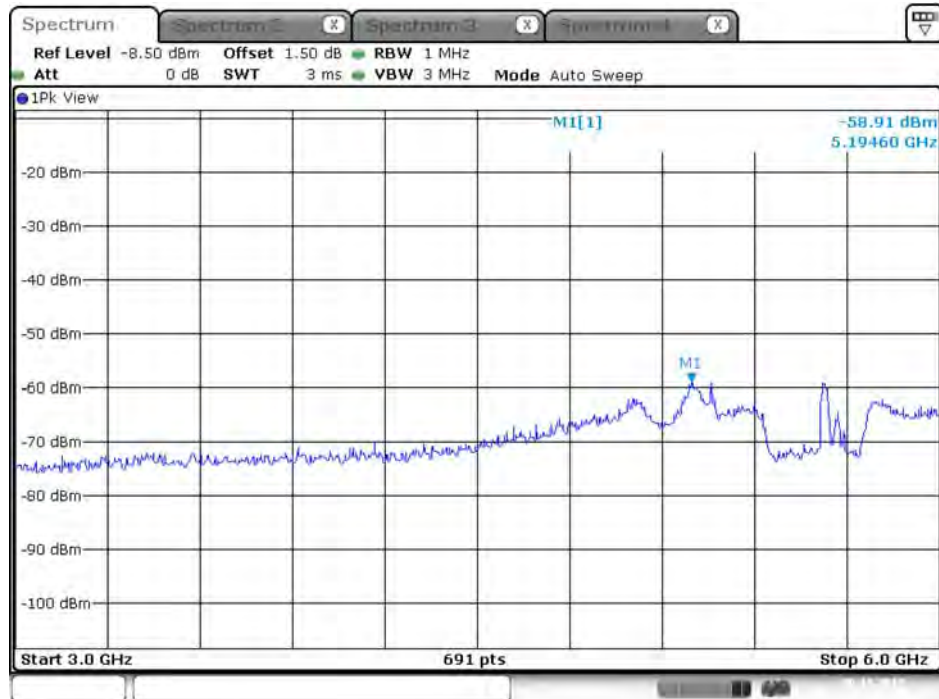


Date: 29.NOV.2017 18:06:38

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 2 / 3GHz~6GHz\_Emission in Non-restriction band

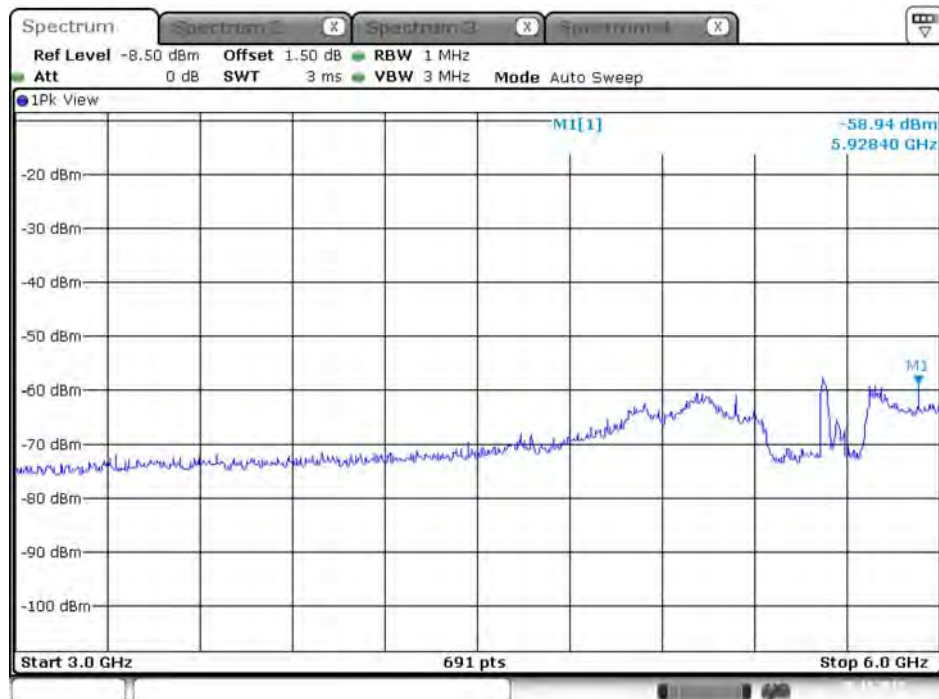


Date: 29.NOV.2017 18:08:11

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 3GHz~6GHz\_Emission in Non-restriction band

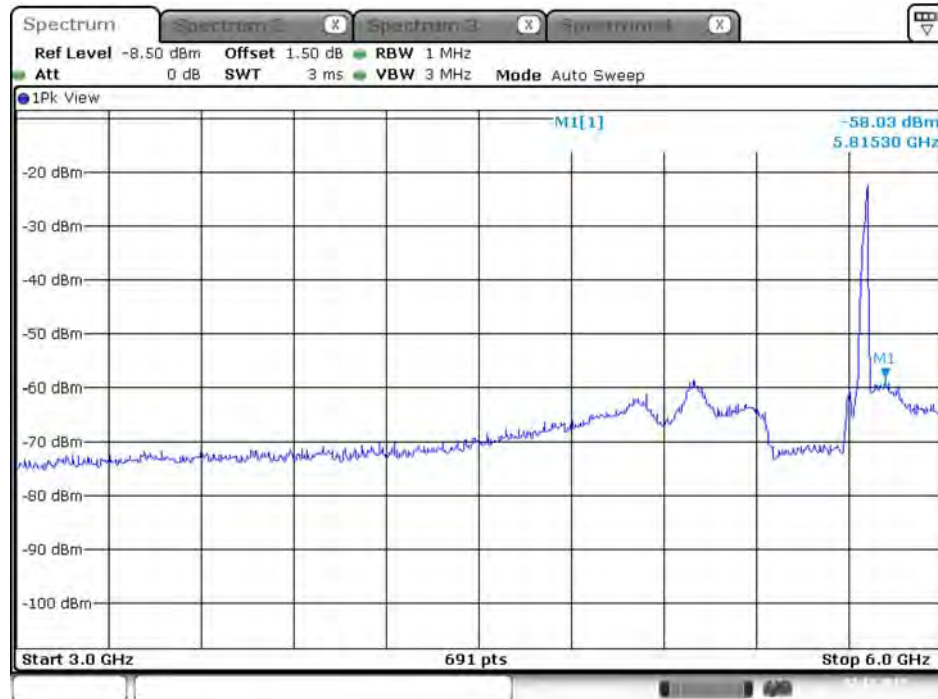


Date: 2 DEC. 2017 00:46:17

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 3GHz~6GHz\_Emission in Non-restriction band

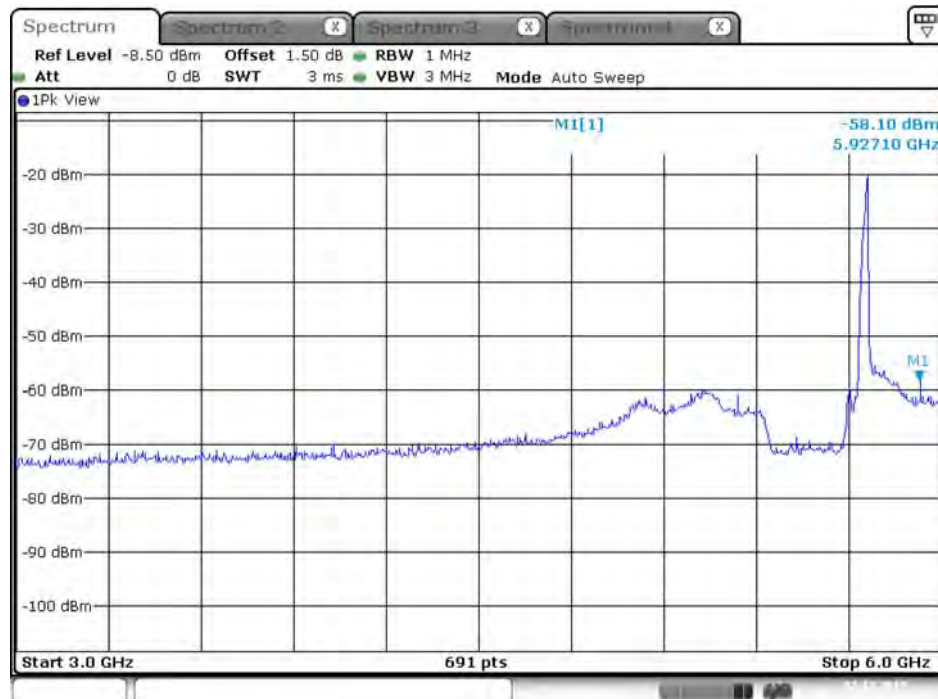

Date: 2 DEC. 2017 00:51:42

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 1 / 6GHz~9GHz

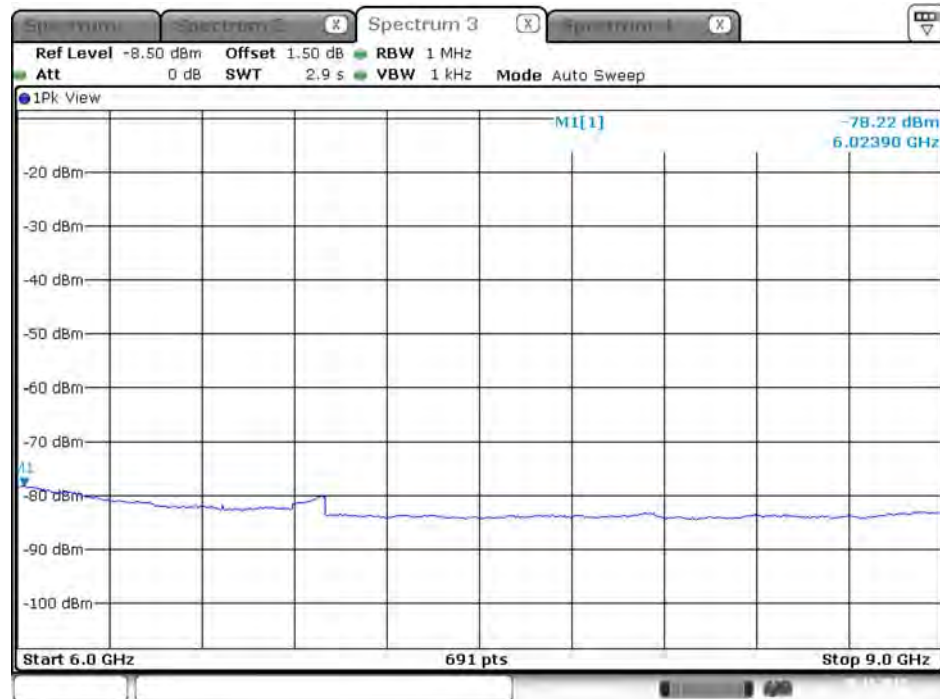


Date: 28.NOV.2017 00:29:36

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28.NOV.2017 00:47:33

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 1 / 6GHz~9GHz

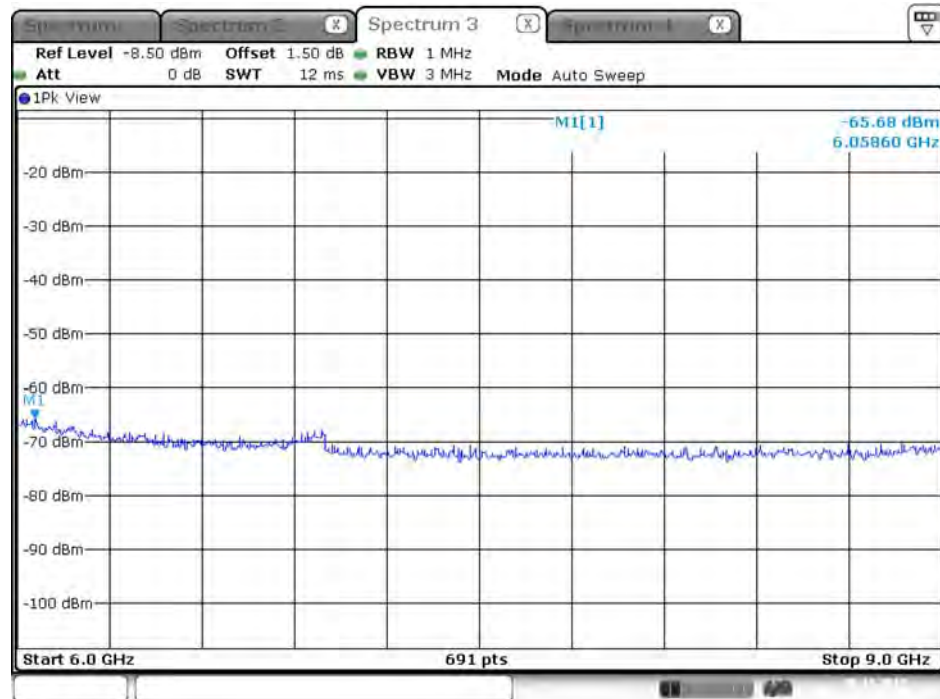


Date: 28.NOV.2017 00:30:23

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 2 / 6GHz~9GHz

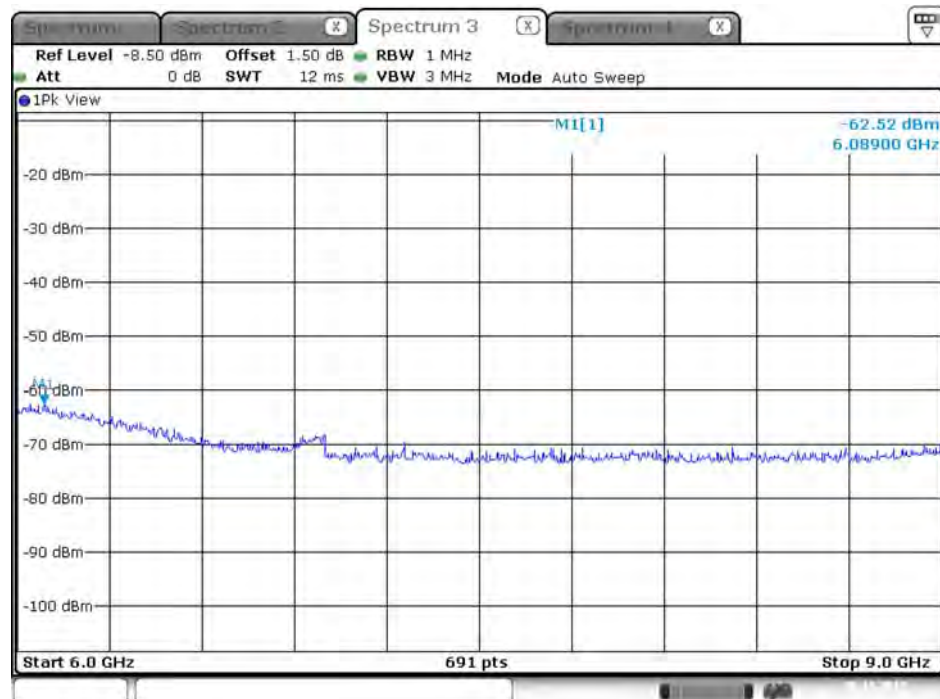

Date: 28.NOV.2017 00:48:31

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 1 / 6GHz~9GHz

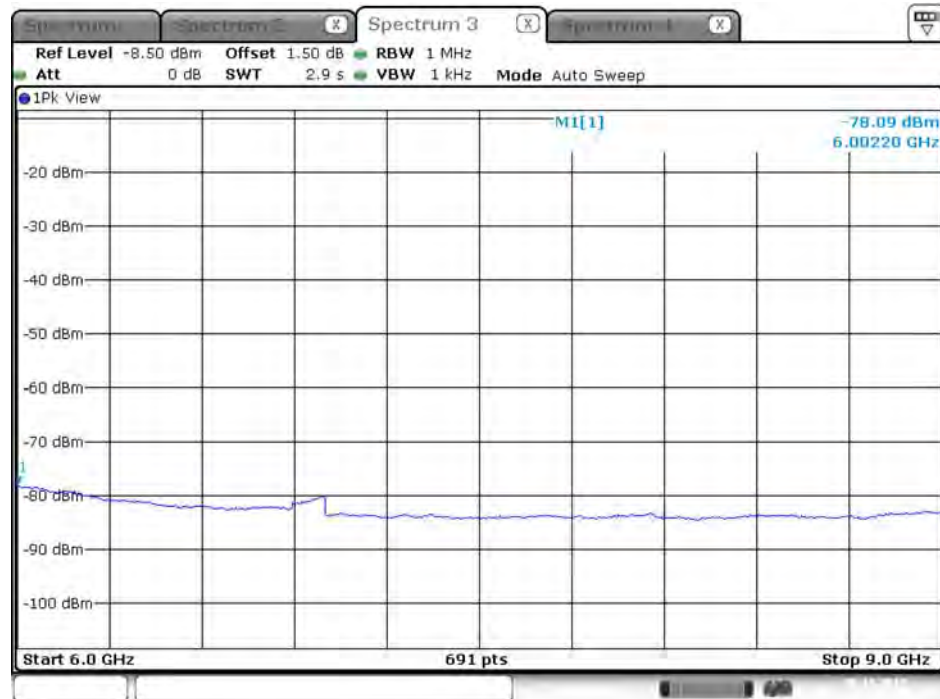


Date: 28.NOV.2017 01:03:29

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28.NOV.2017 01:14:00

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 1 / 6GHz~9GHz

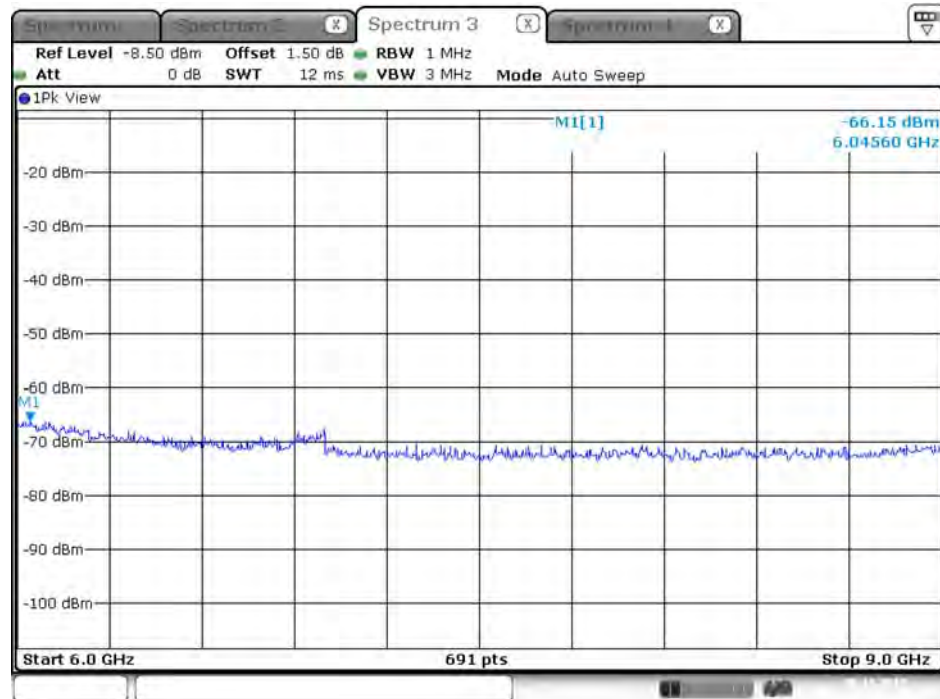


Date: 28 NOV. 2017 01:04:02

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 2 / 6GHz~9GHz

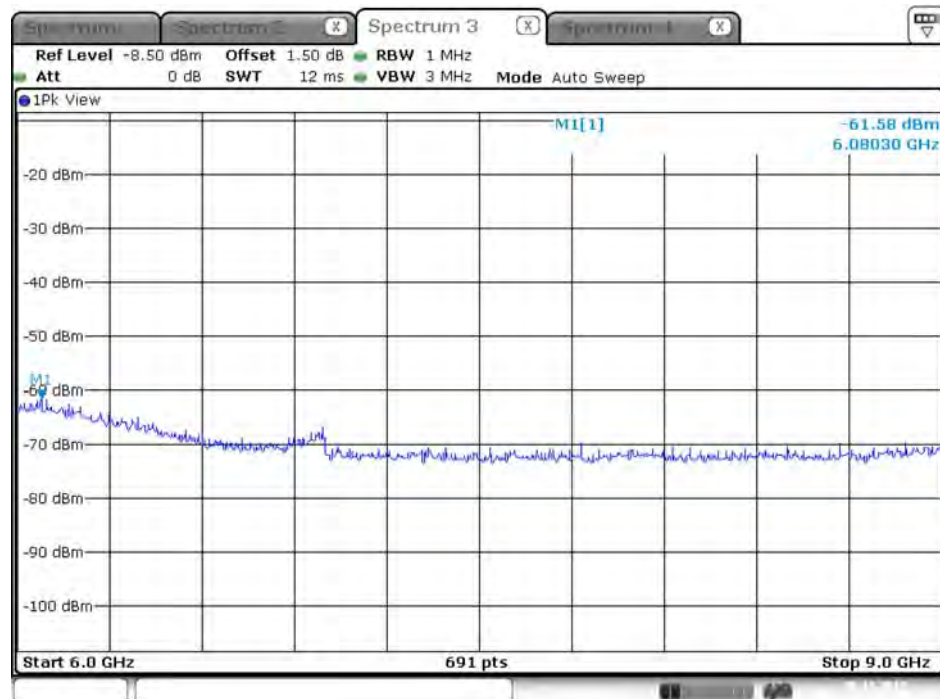

Date: 28 NOV. 2017 01:14:25

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 1 / 6GHz~9GHz

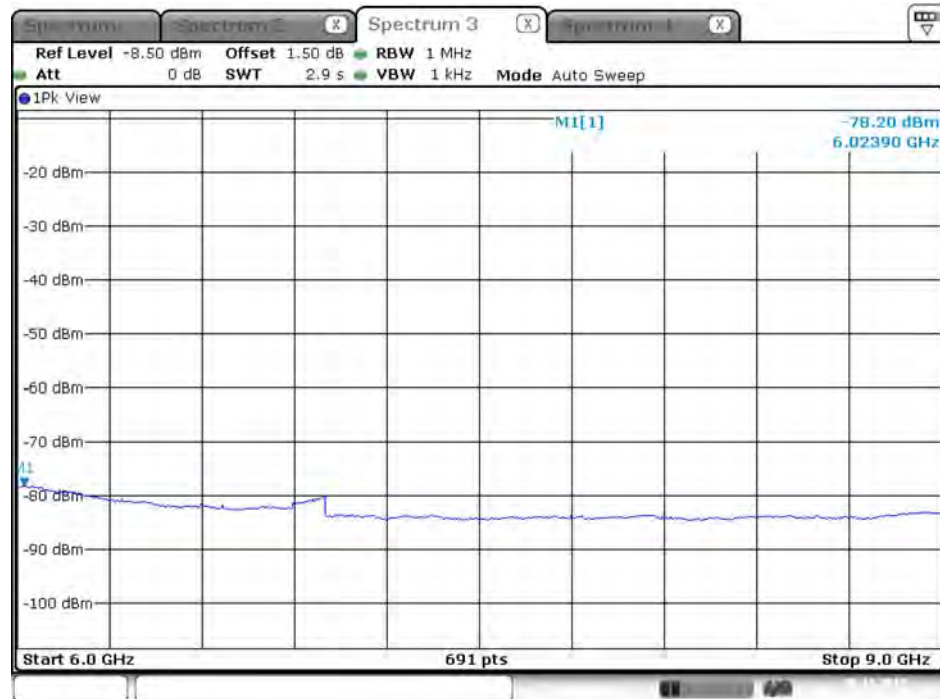


Date: 28.NOV.2017 01:25:04

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28.NOV.2017 01:36:02

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 1 / 6GHz~9GHz

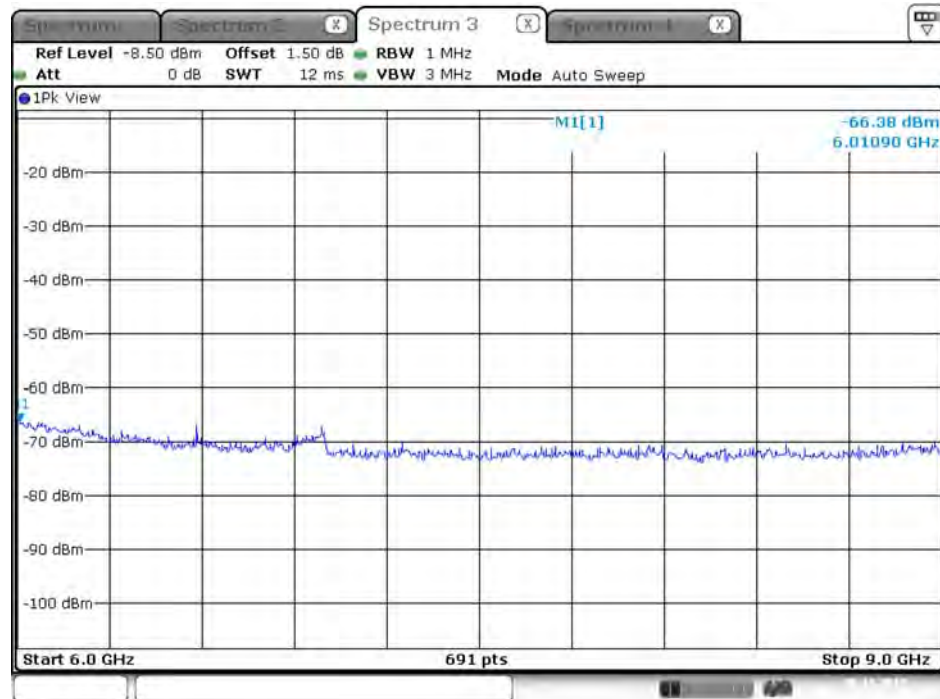


Date: 28.NOV.2017 01:25:44

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 2 / 6GHz~9GHz

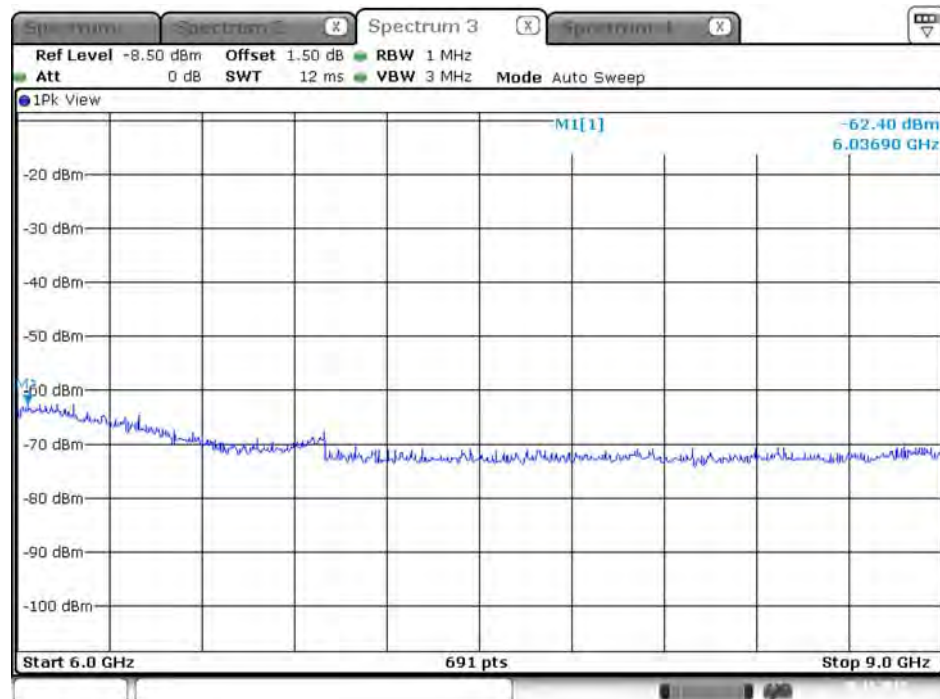

Date: 28.NOV.2017 01:36:48

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 1 / 6GHz~9GHz

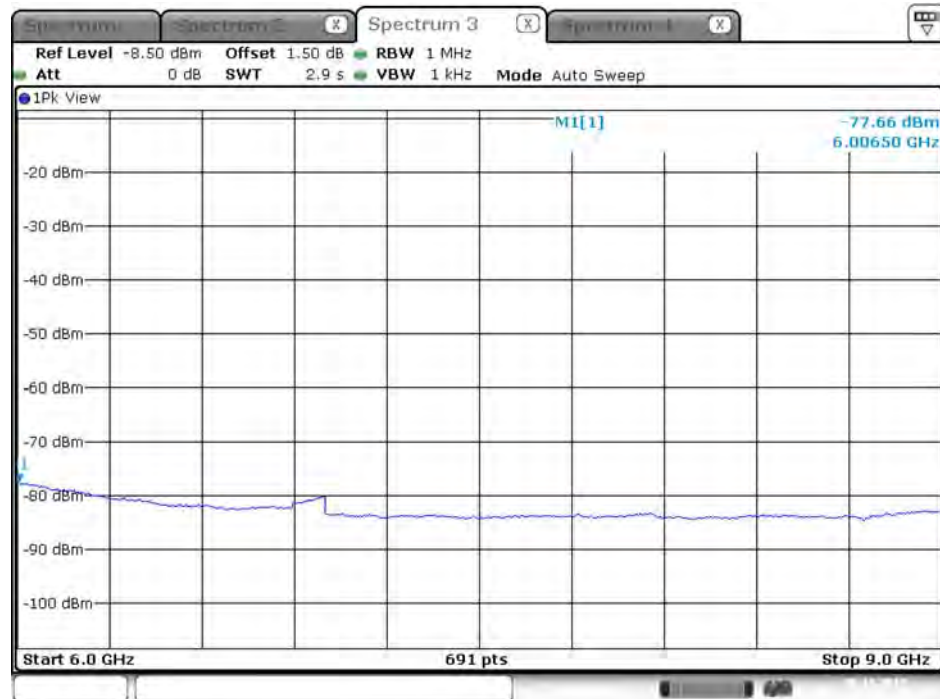


Date: 28 NOV. 2017 02:33:01

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28 NOV. 2017 02:44:17

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 1 / 6GHz~9GHz

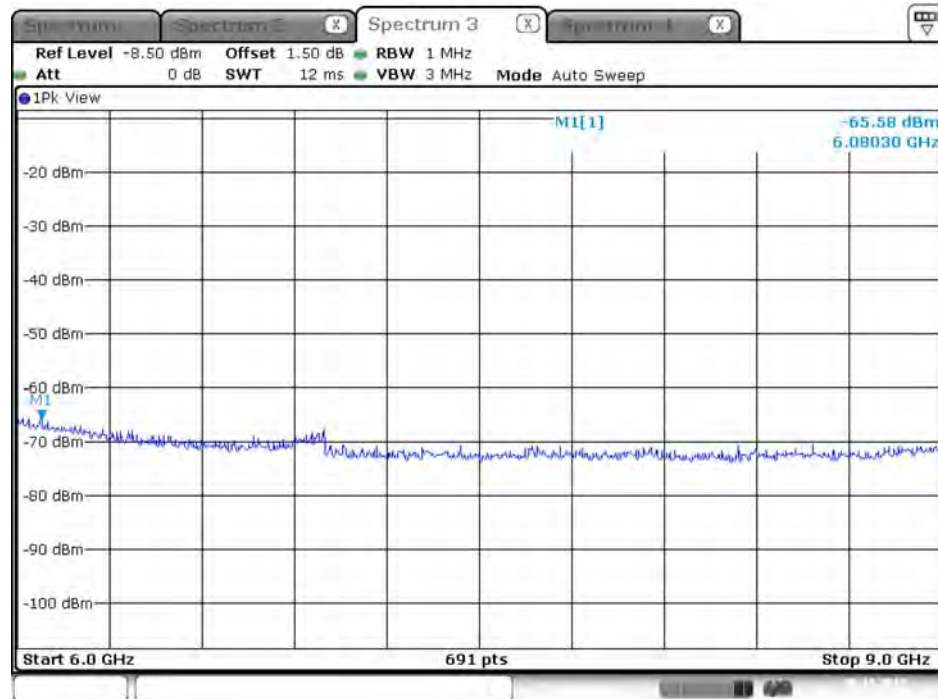


Date: 28.NOV.2017 02:33:54

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 2 / 6GHz~9GHz

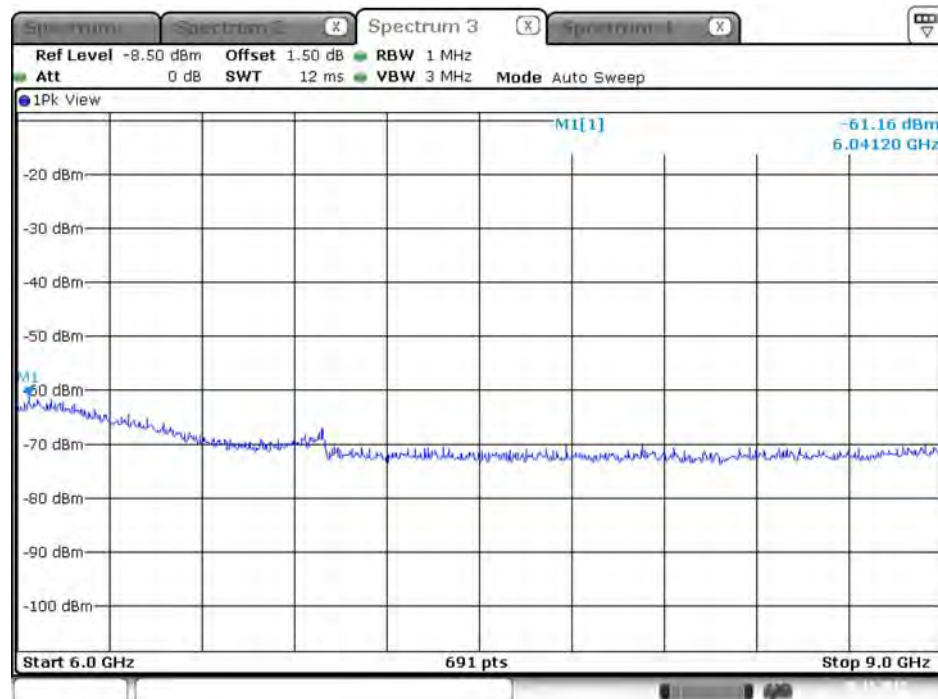

Date: 28.NOV.2017 02:44:39

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 1 / 6GHz~9GHz

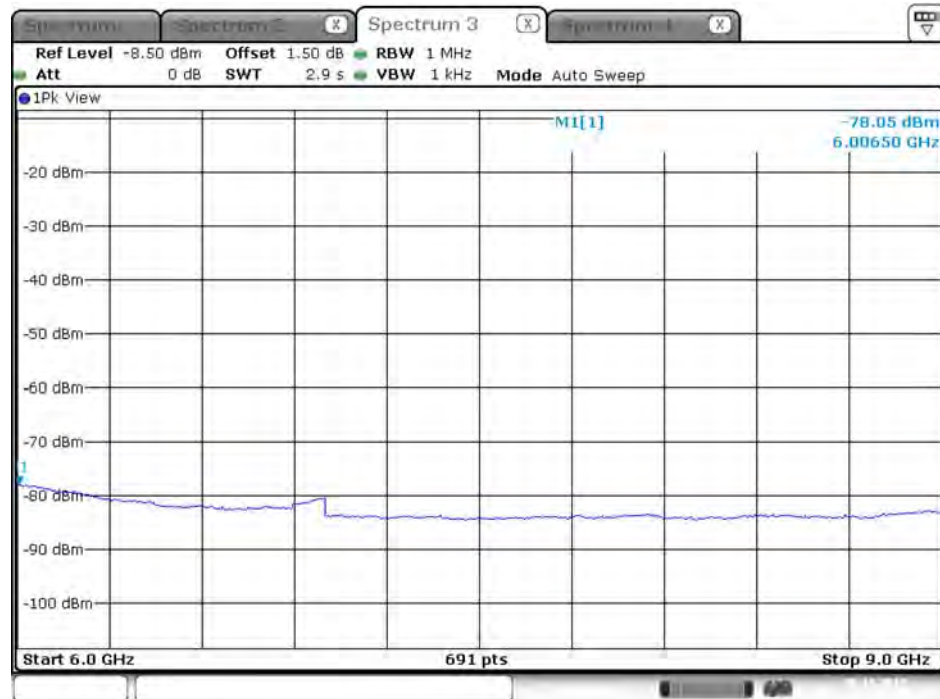


Date: 28.NOV.2017 01:48:30

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28.NOV.2017 02:01:27

### Plot on Configuration QPSK, 80M / 5290 MHz / Peak / Port 1 / 6GHz~9GHz

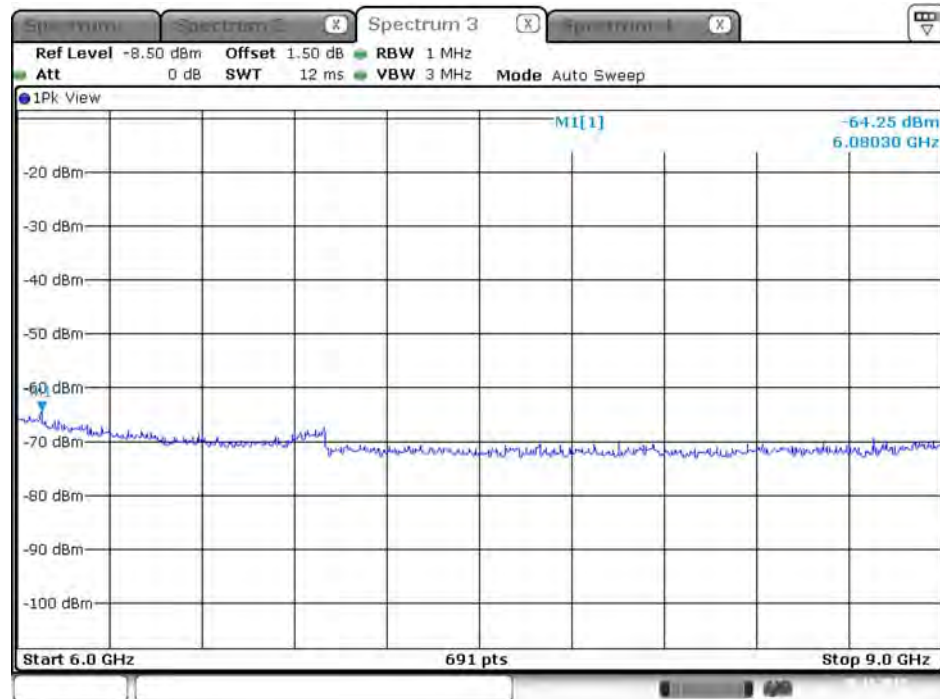


Date: 28.NOV.2017 01:49:04

### Plot on Configuration QPSK, 80M / 5290 MHz / Peak / Port 2 / 6GHz~9GHz

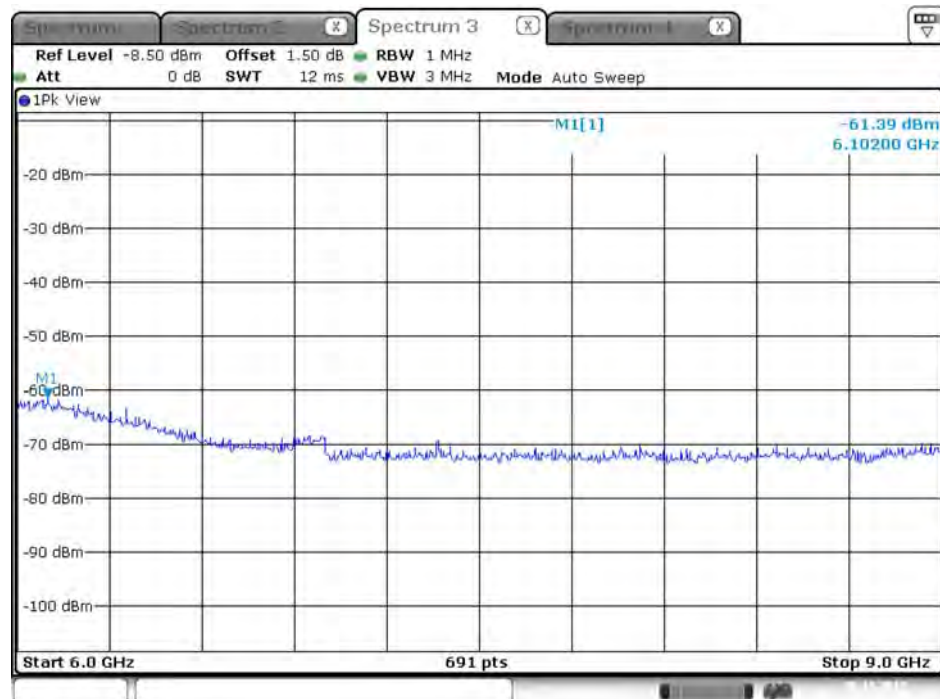

Date: 28.NOV.2017 02:02:08

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 1 / 6GHz~9GHz

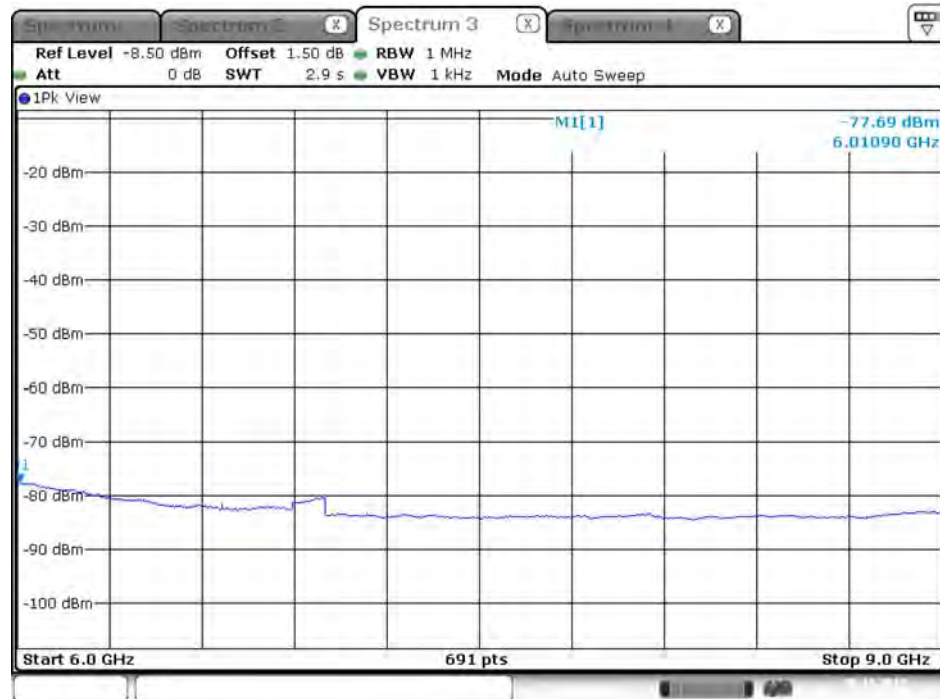


Date: 28 NOV. 2017 02:12:30

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28 NOV. 2017 02:21:52

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 1 / 6GHz~9GHz

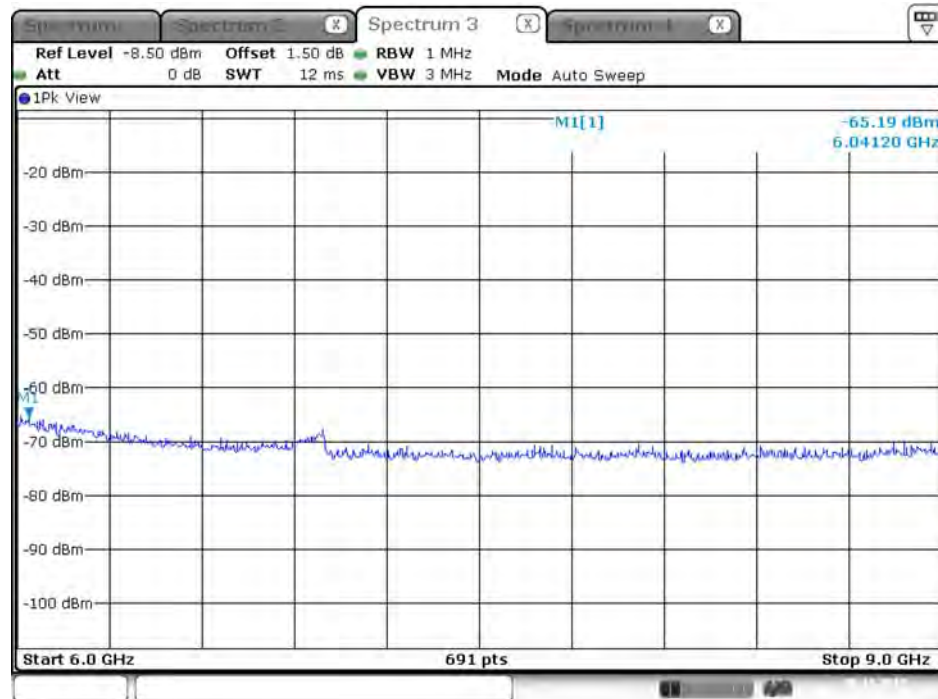


Date: 28.NOV.2017 02:13:11

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 2 / 6GHz~9GHz

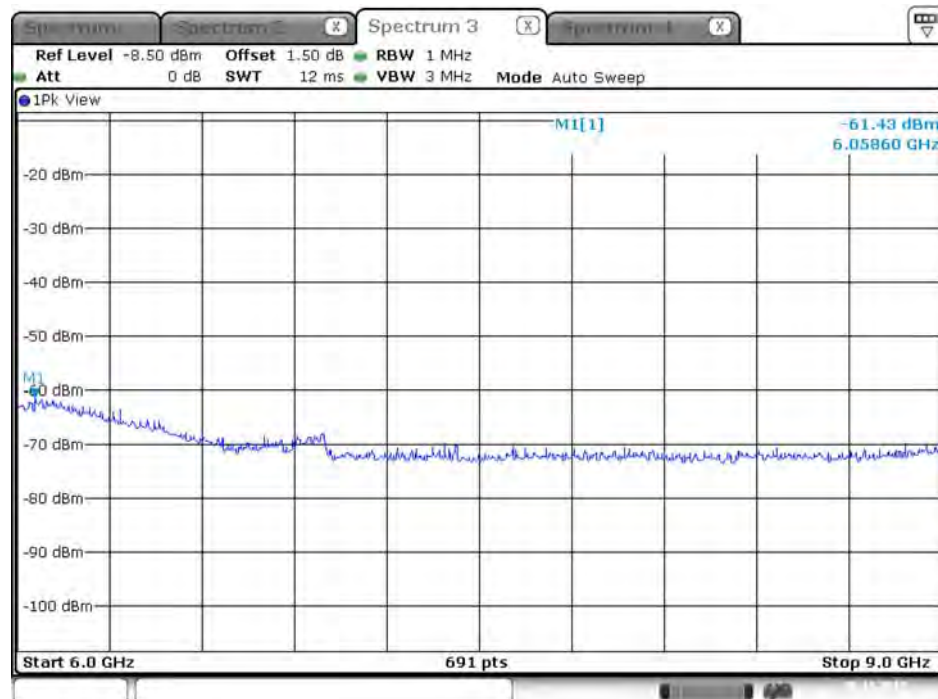

Date: 28.NOV.2017 02:22:19

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 1 / 6GHz~9GHz

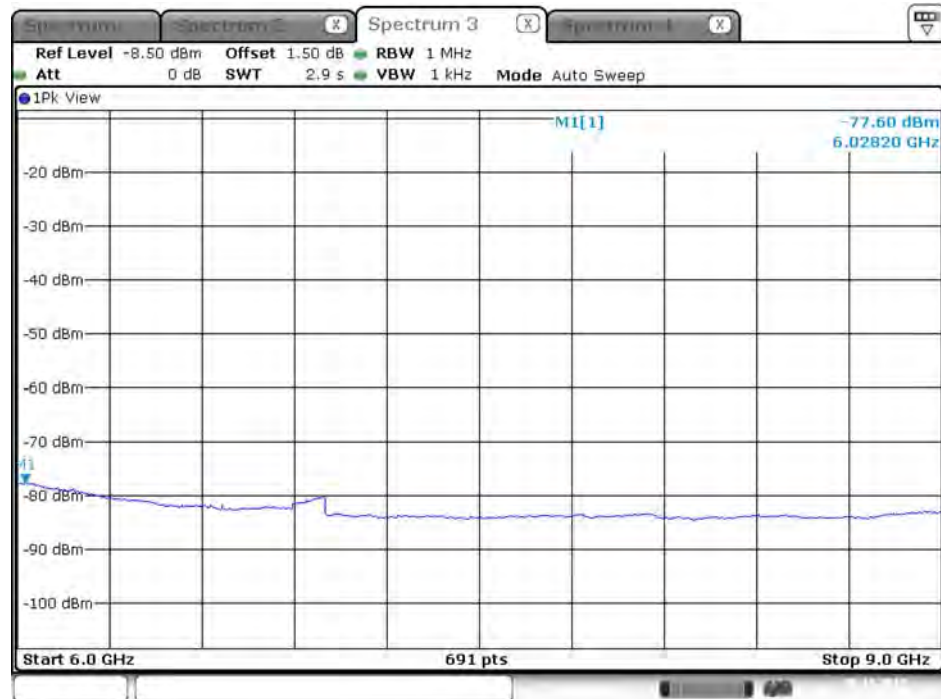


Date: 28.NOV.2017 02:54:29

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 2 / 6GHz~9GHz




Date: 28.NOV.2017 03:04:47

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 1 / 6GHz~9GHz

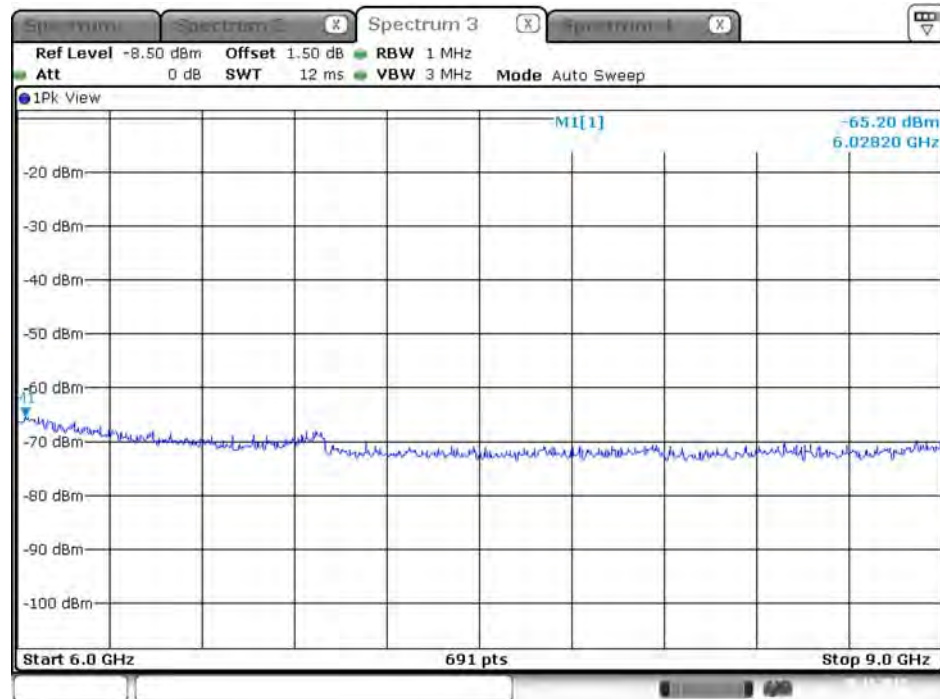


Date: 28.NOV.2017 02:55:29

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 2 / 6GHz~9GHz

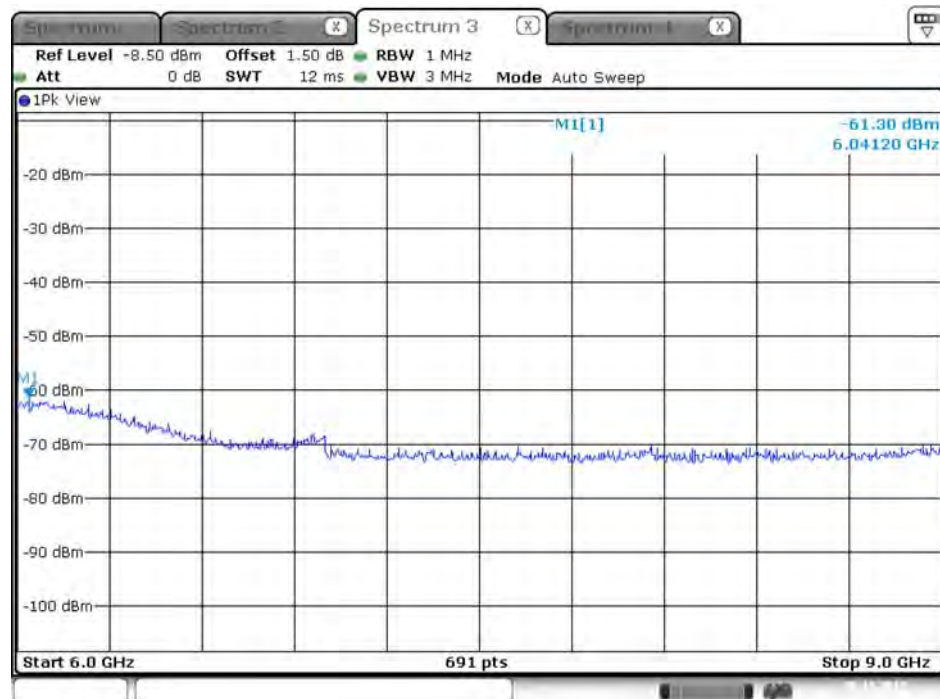


Date: 28.NOV.2017 03:05:30

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 1 / 6GHz~9GHz

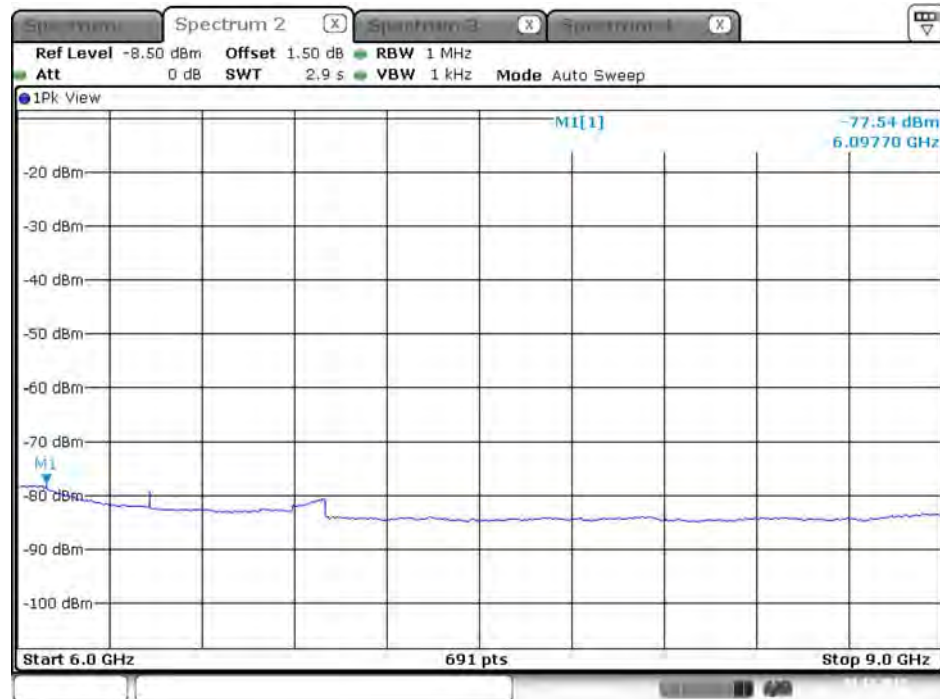


Date: 1.DEC.2017 19:38:30

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 2 / 6GHz~9GHz

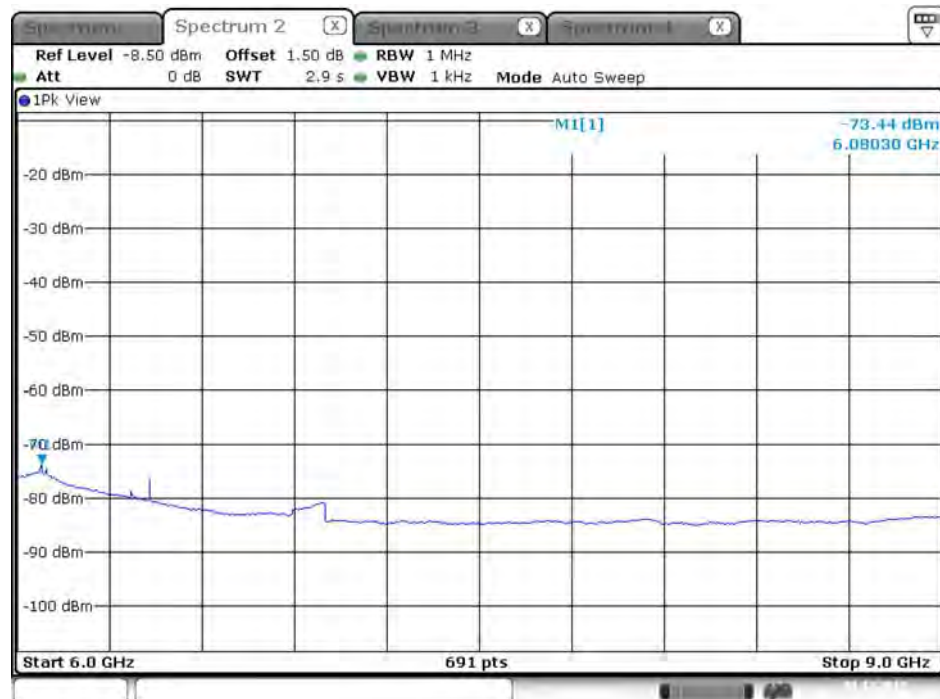


Date: 1.DEC.2017 19:53:58

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 1 / 6GHz~9GHz

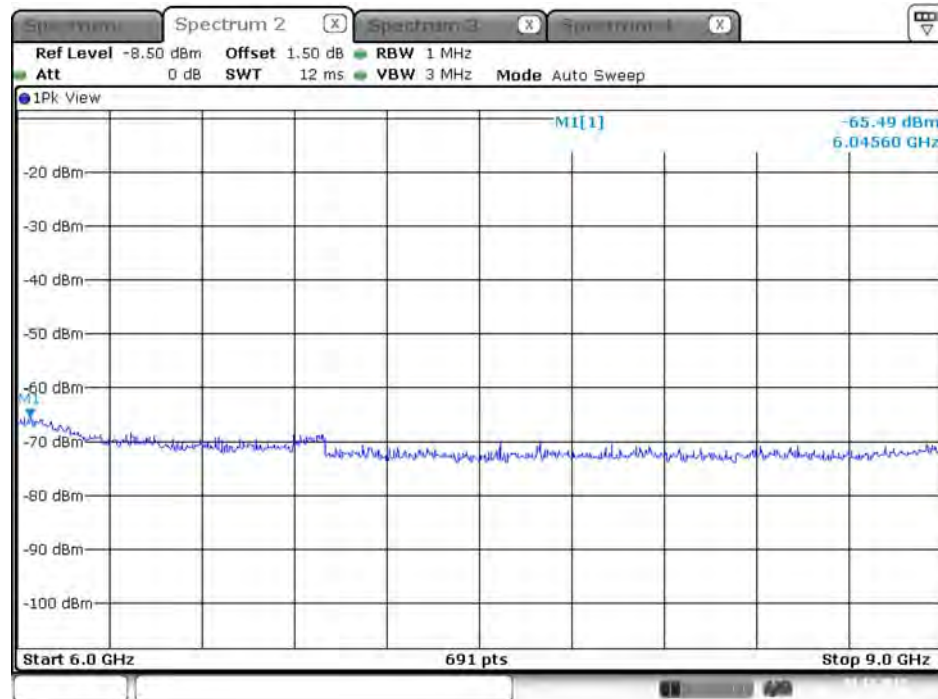


Date: 1.DEC.2017 19:39:03

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 2 / 6GHz~9GHz

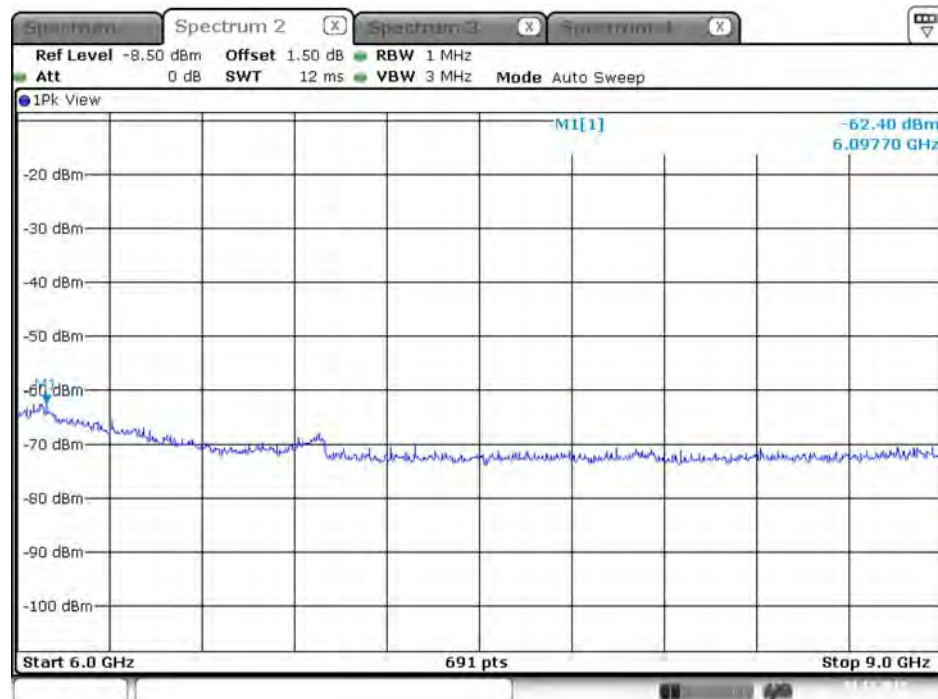


Date: 1.DEC.2017 19:54:31

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 1 / 6GHz~9GHz

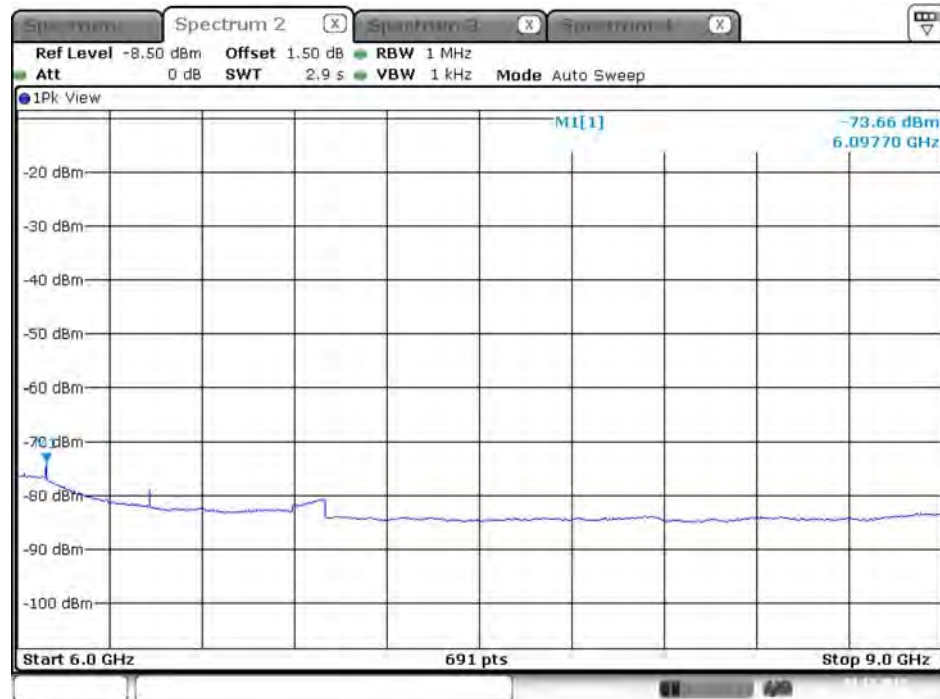


Date: 1 DEC. 2017 20:06:49

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 2 / 6GHz~9GHz

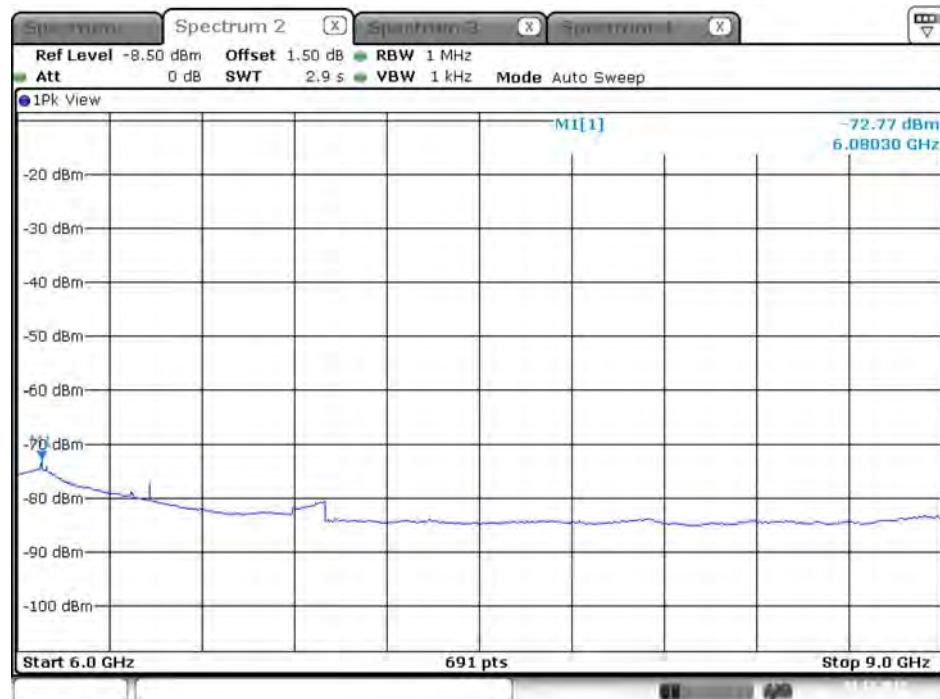


Date: 1 DEC. 2017 20:21:52

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 1 / 6GHz~9GHz

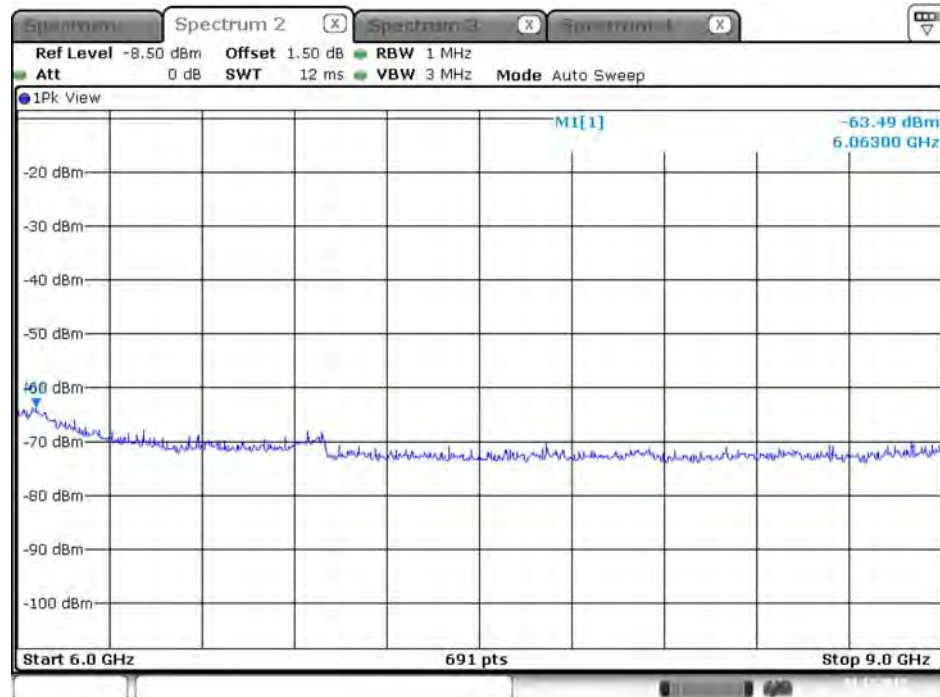


Date: 1.DEC.2017 20:07:56

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 2 / 6GHz~9GHz

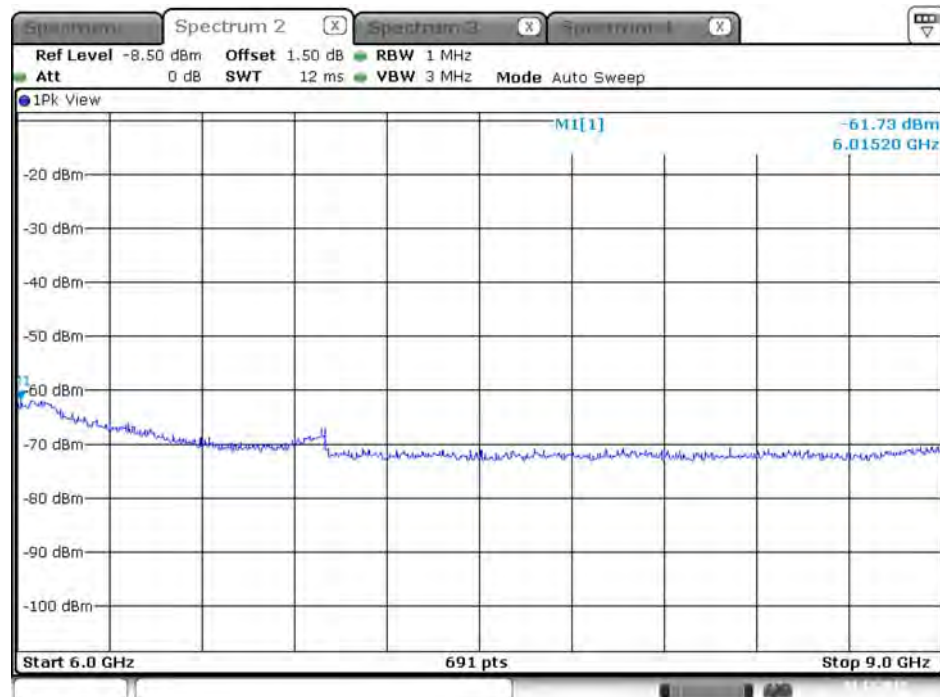


Date: 1.DEC.2017 20:22:53

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 1 / 6GHz~9GHz

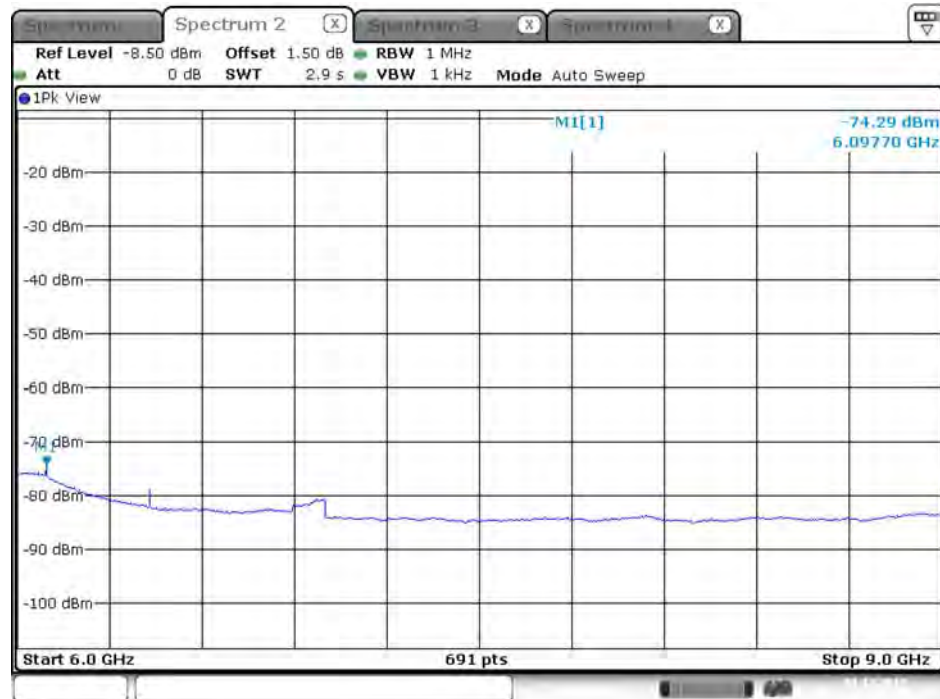


Date: 1.DEC.2017 20:36:31

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 2 / 6GHz~9GHz

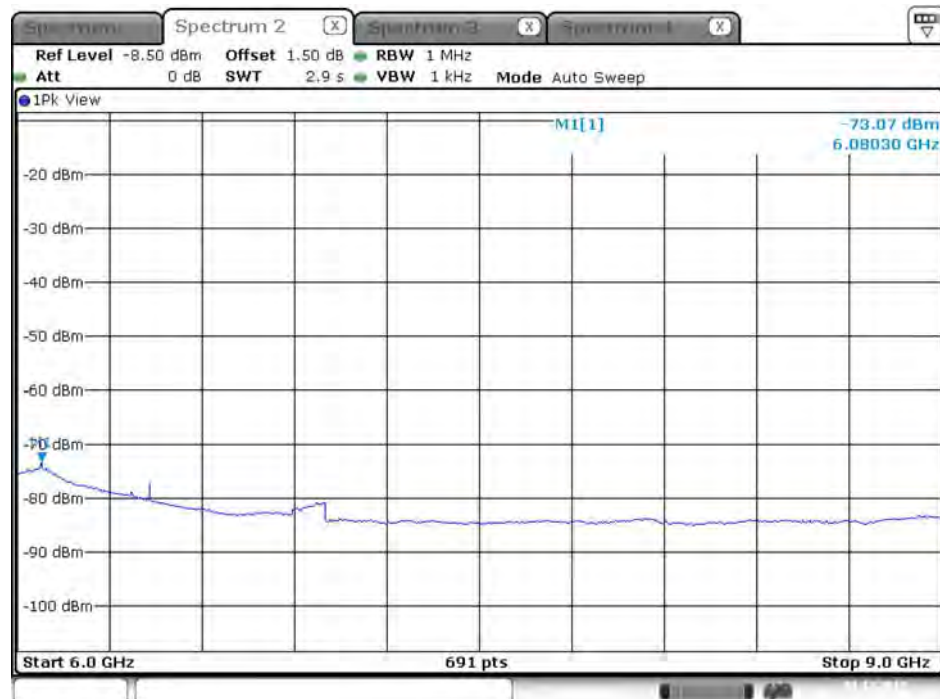


Date: 1.DEC.2017 20:55:23

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 1 / 6GHz~9GHz

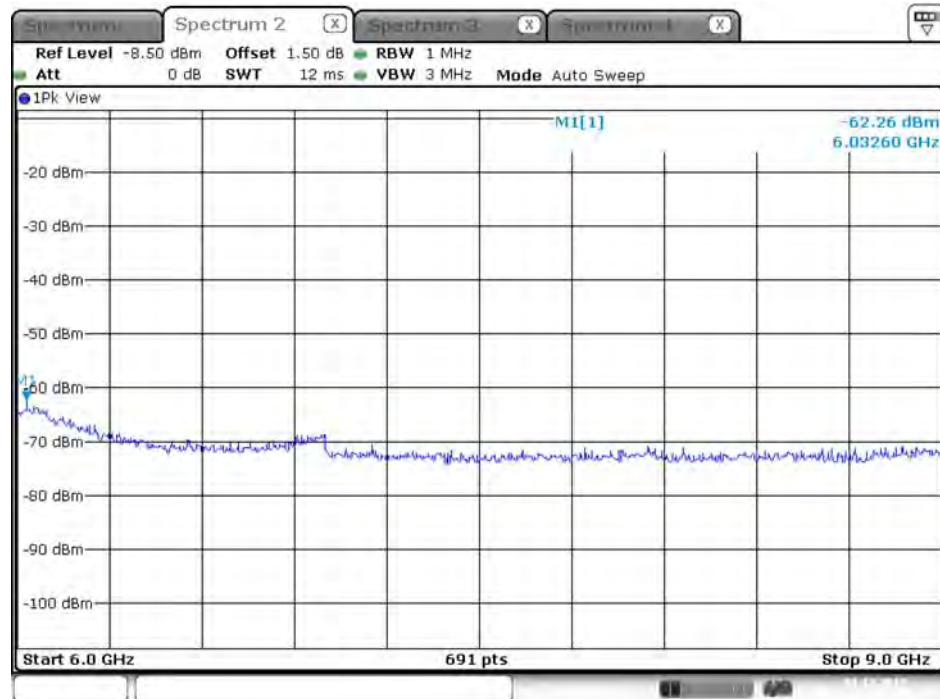


Date: 1.DEC.2017 20:36:57

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 2 / 6GHz~9GHz

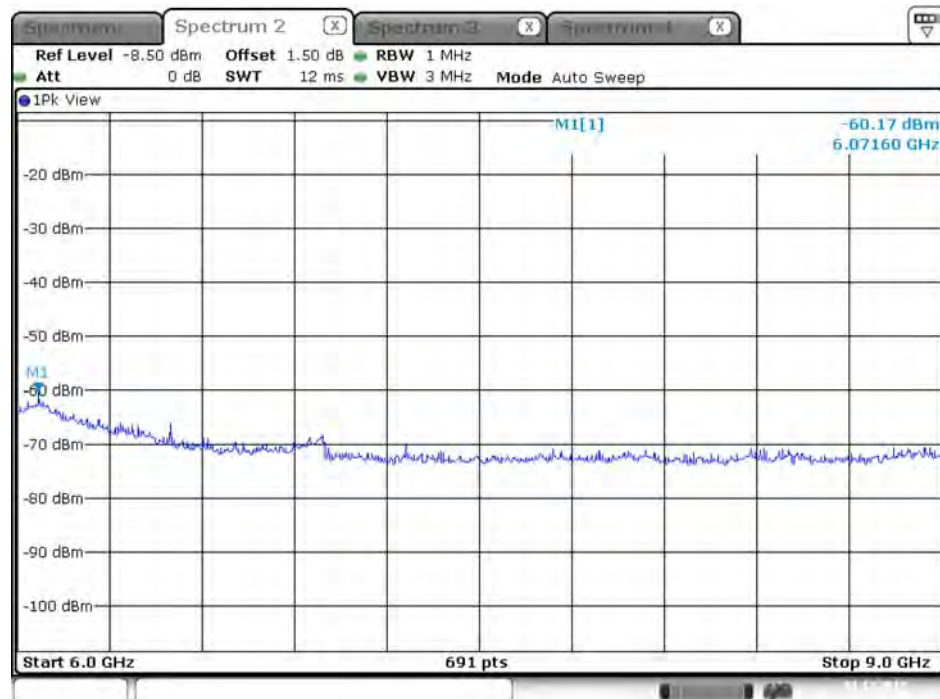


Date: 1.DEC.2017 20:56:03

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 1 / 6GHz~9GHz

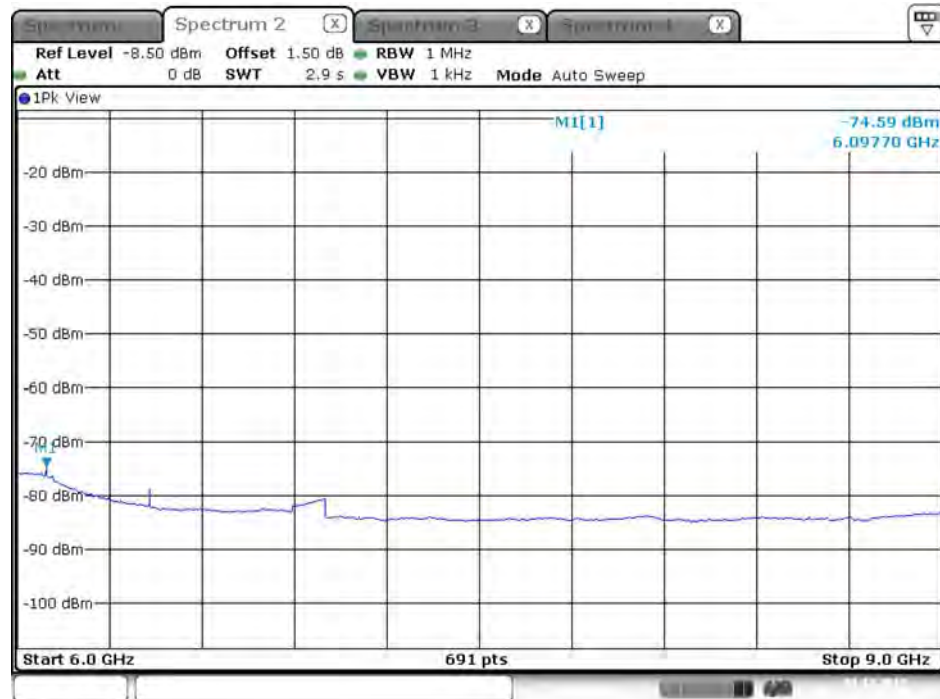


Date: 1.DEC.2017 21:09:20

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 2 / 6GHz~9GHz

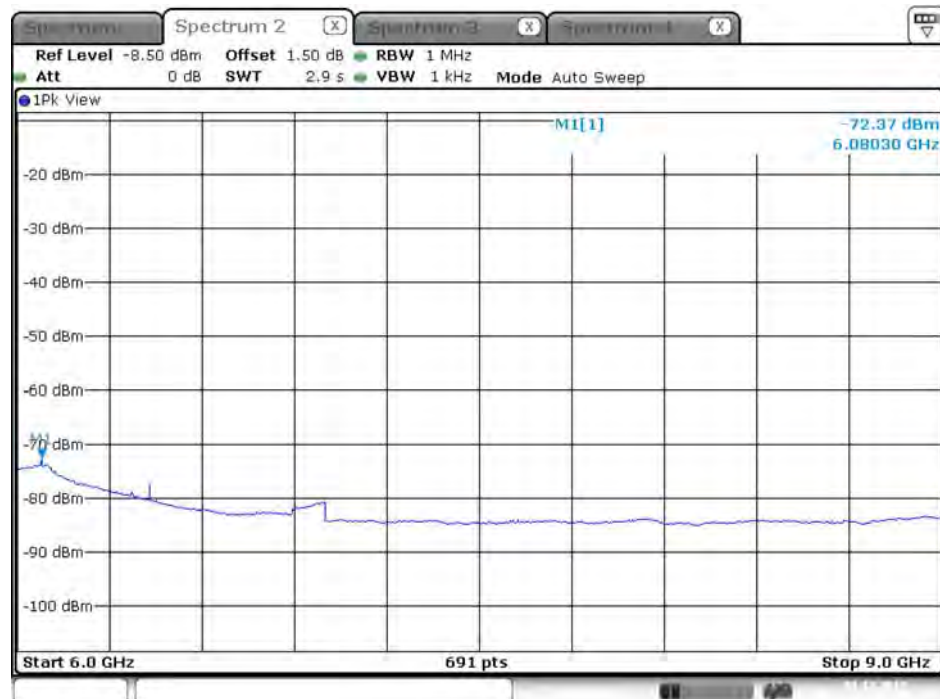


Date: 1.DEC.2017 21:27:27

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 6GHz~9GHz

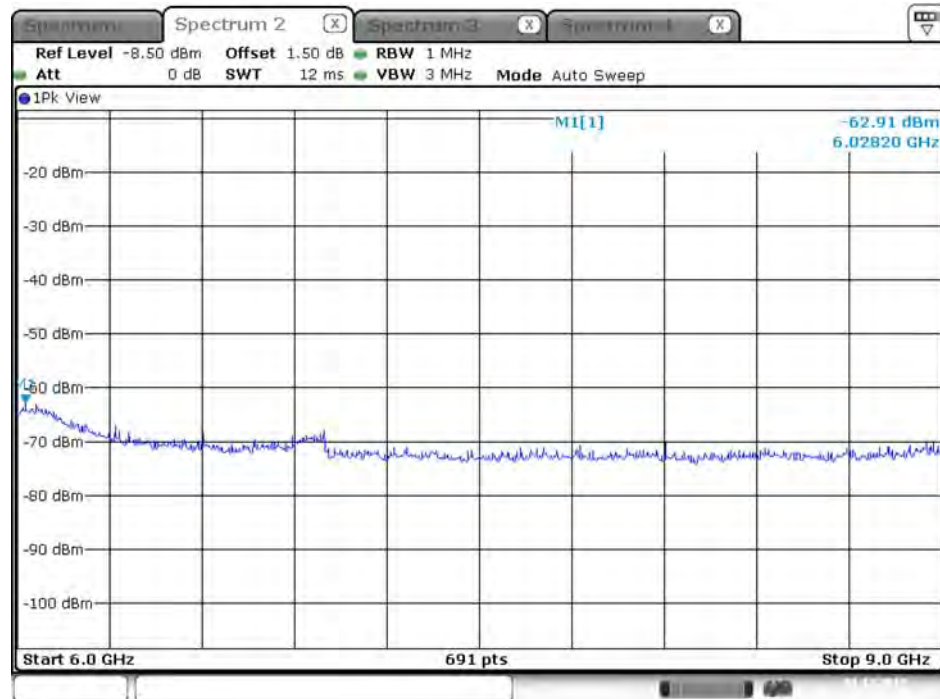


Date: 1.DEC.2017 21:10:04

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 6GHz~9GHz

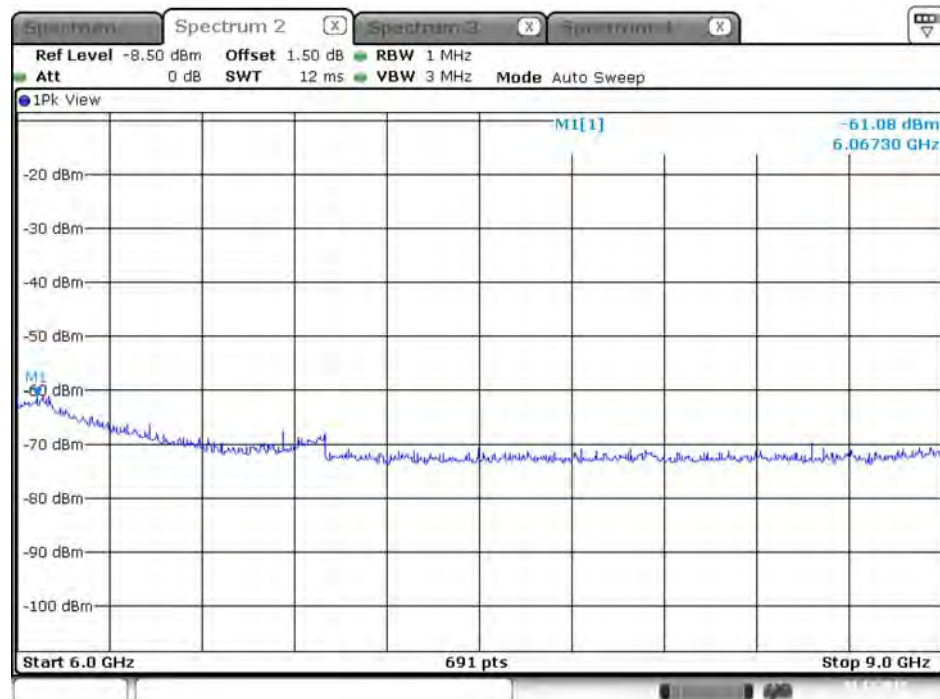


Date: 1.DEC.2017 21:31:34

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 1 / 6GHz~9GHz

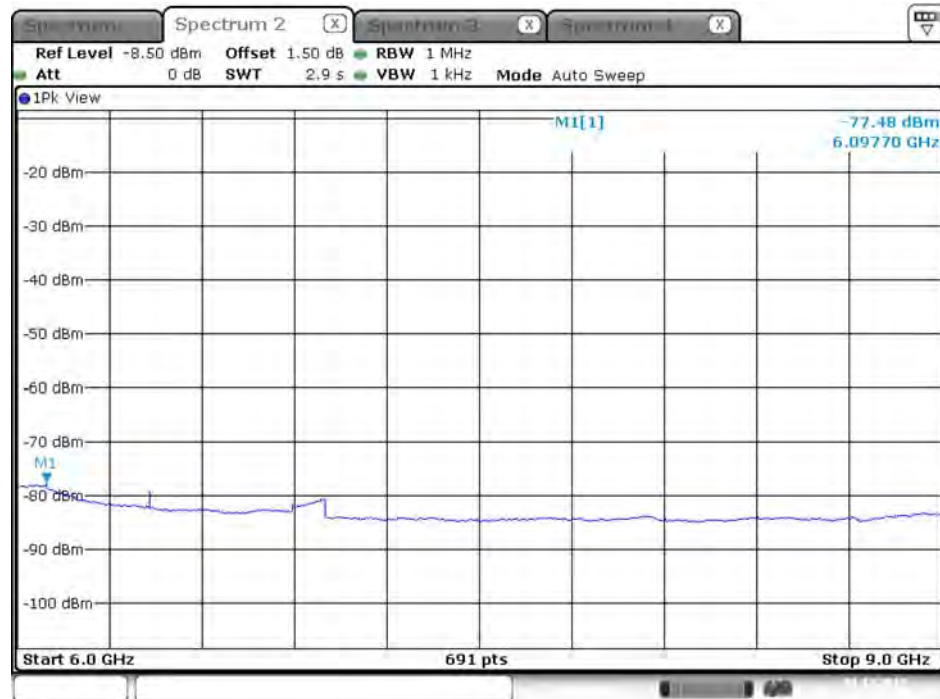


Date: 1.DEC.2017 21:58:48

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 2 / 6GHz~9GHz

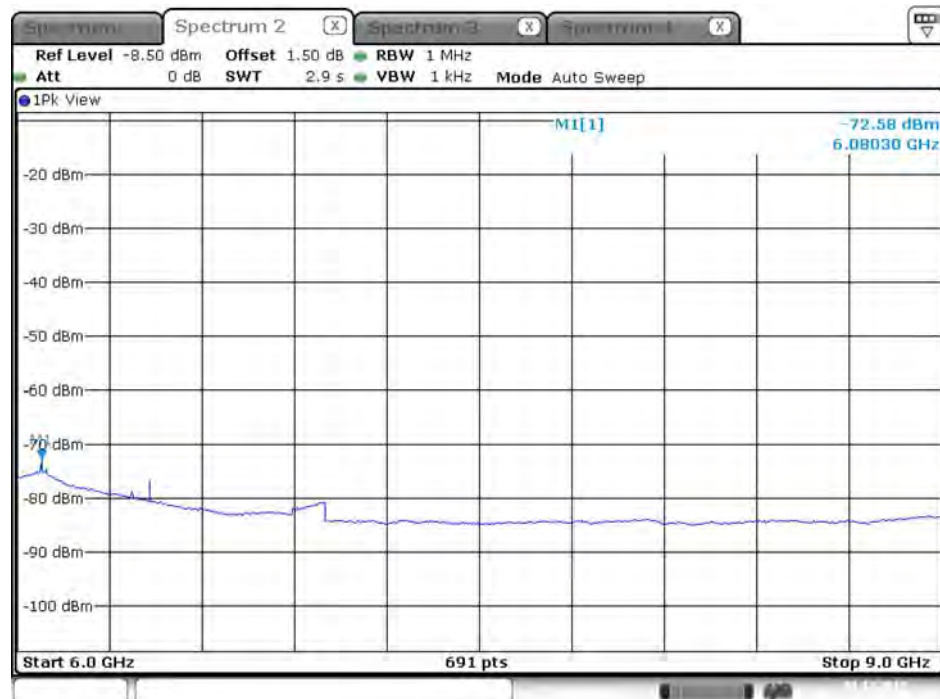


Date: 1.DEC.2017 22:14:38

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 1 / 6GHz~9GHz

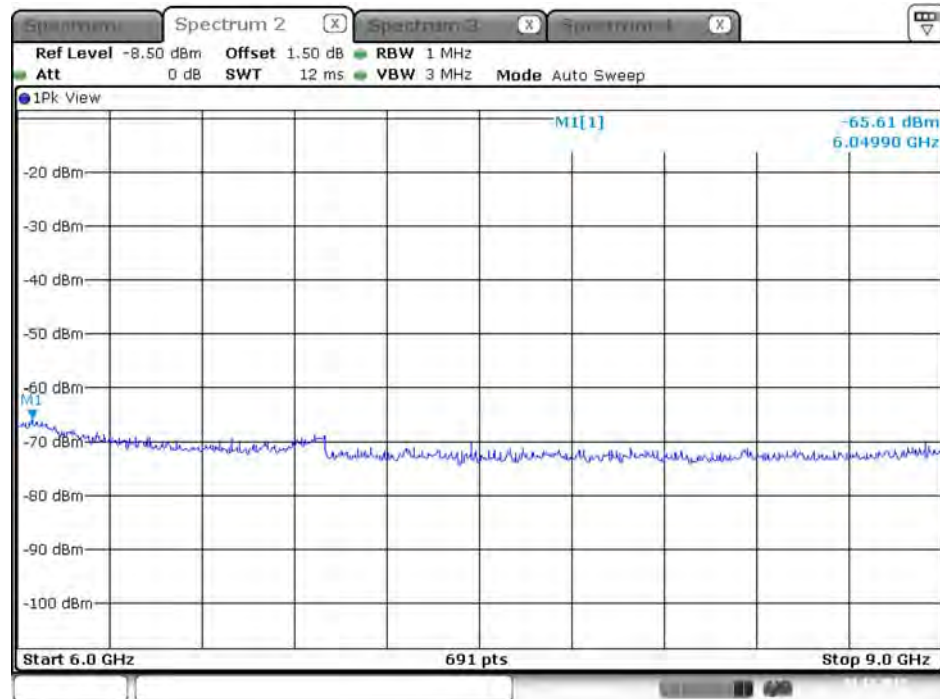


Date: 1.DEC.2017 21:59:13

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 2 / 6GHz~9GHz

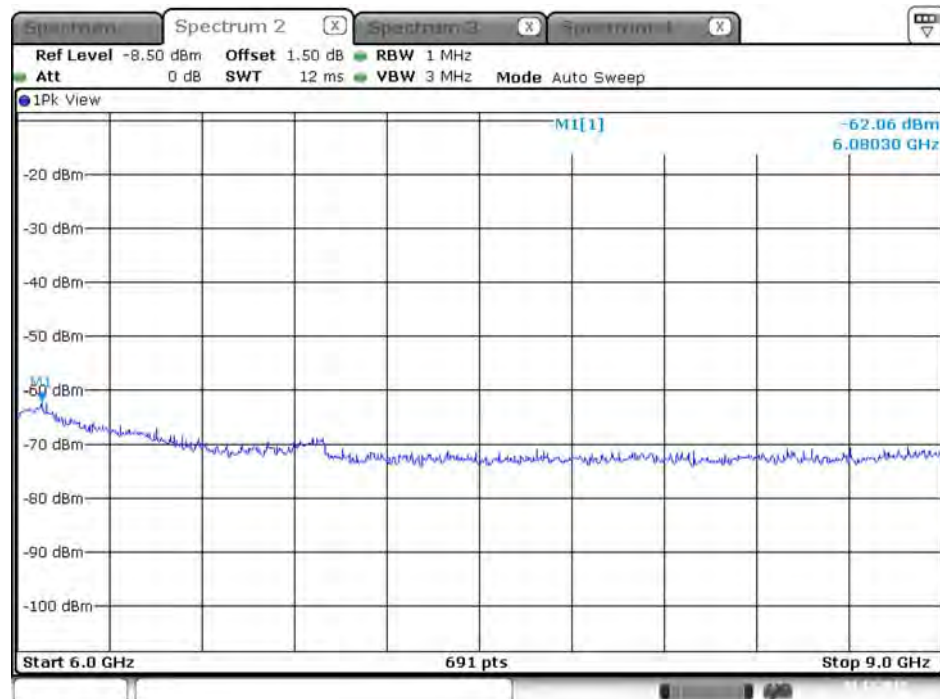


Date: 1.DEC.2017 22:15:02

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 1 / 6GHz~9GHz

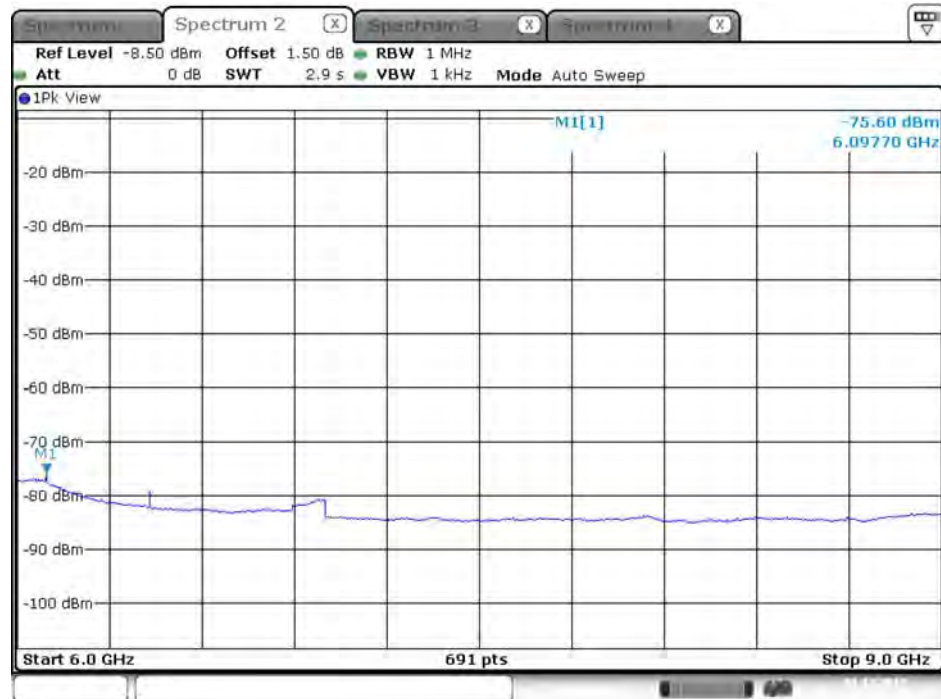


Date: 1 DEC. 2017 22:33:47

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 2 / 6GHz~9GHz

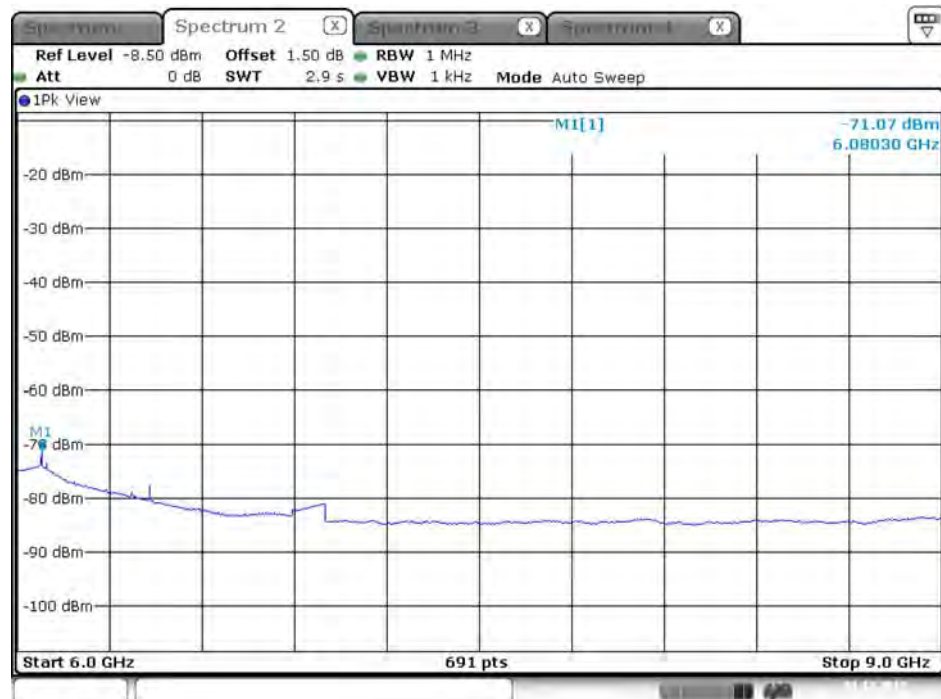


Date: 1 DEC. 2017 22:58:42

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 1 / 6GHz~9GHz

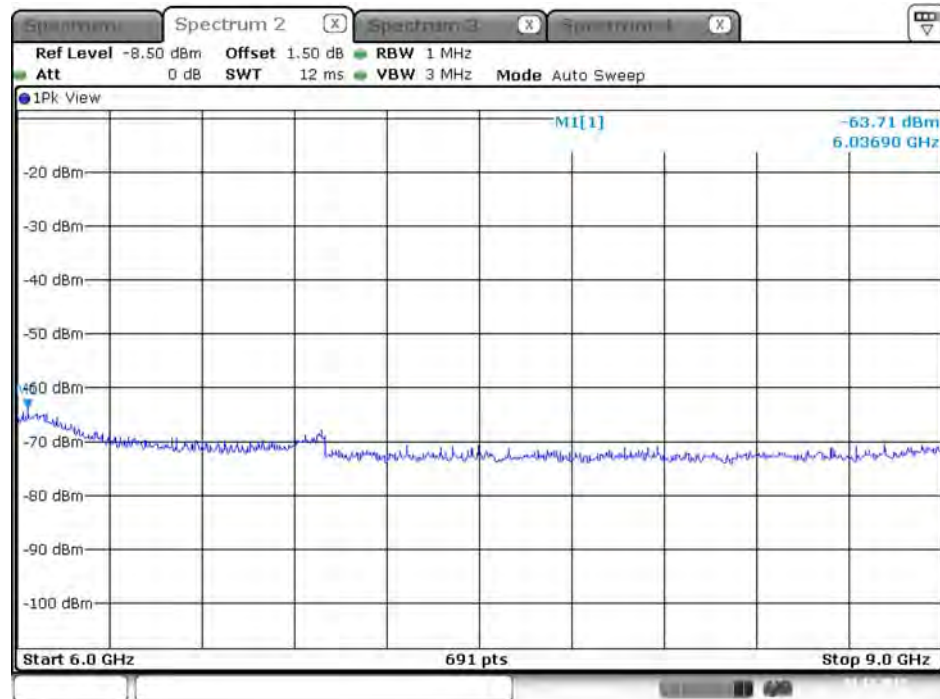


Date: 1.DEC.2017 22:34:18

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 2 / 6GHz~9GHz

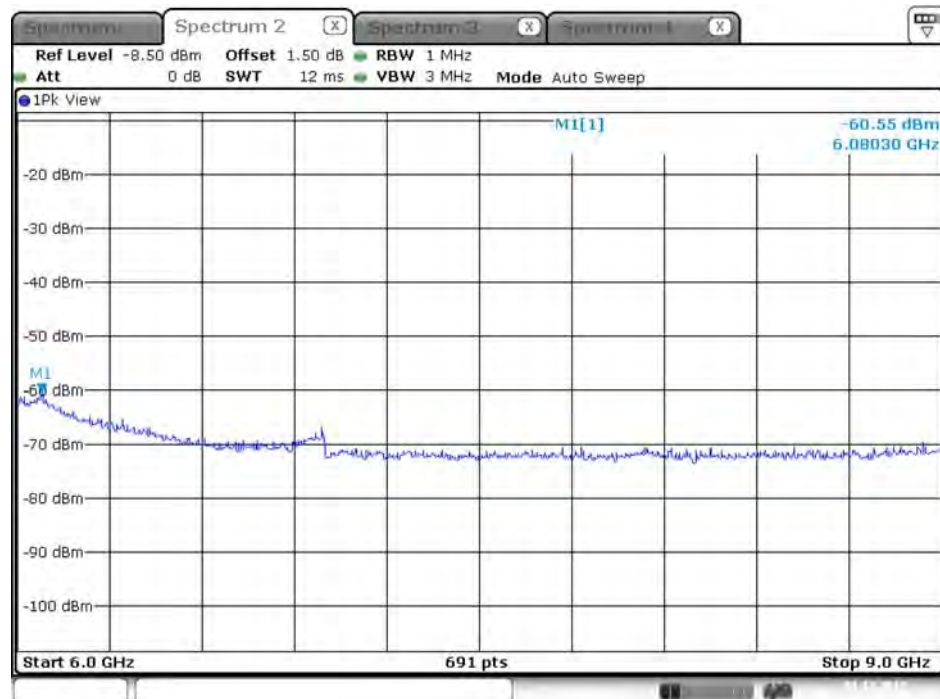


Date: 1.DEC.2017 22:57:41

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 1 / 6GHz~9GHz

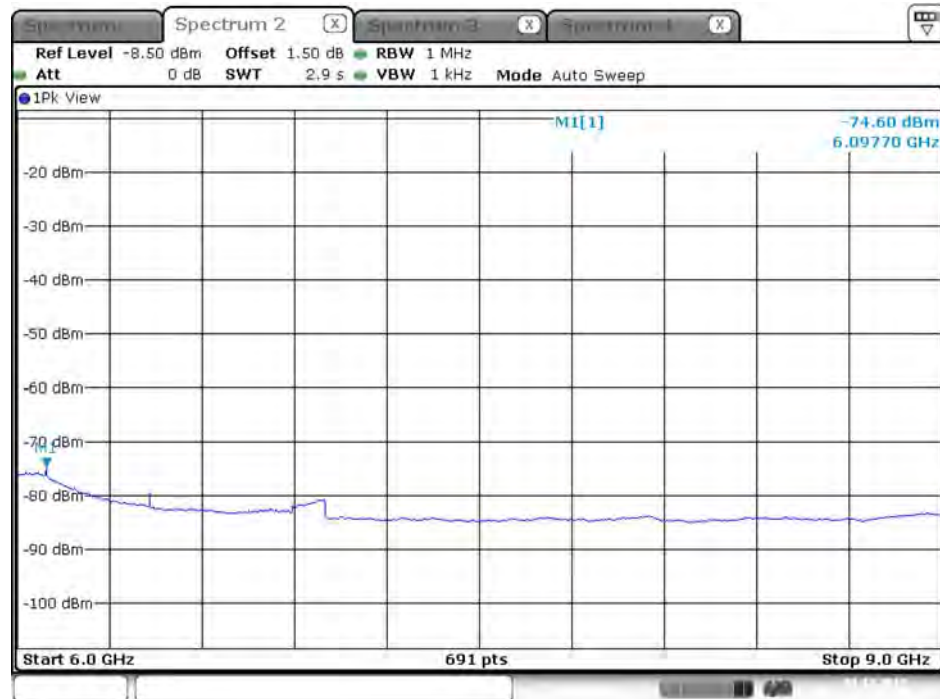


Date: 1.DEC.2017 23:07:20

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 2 / 6GHz~9GHz

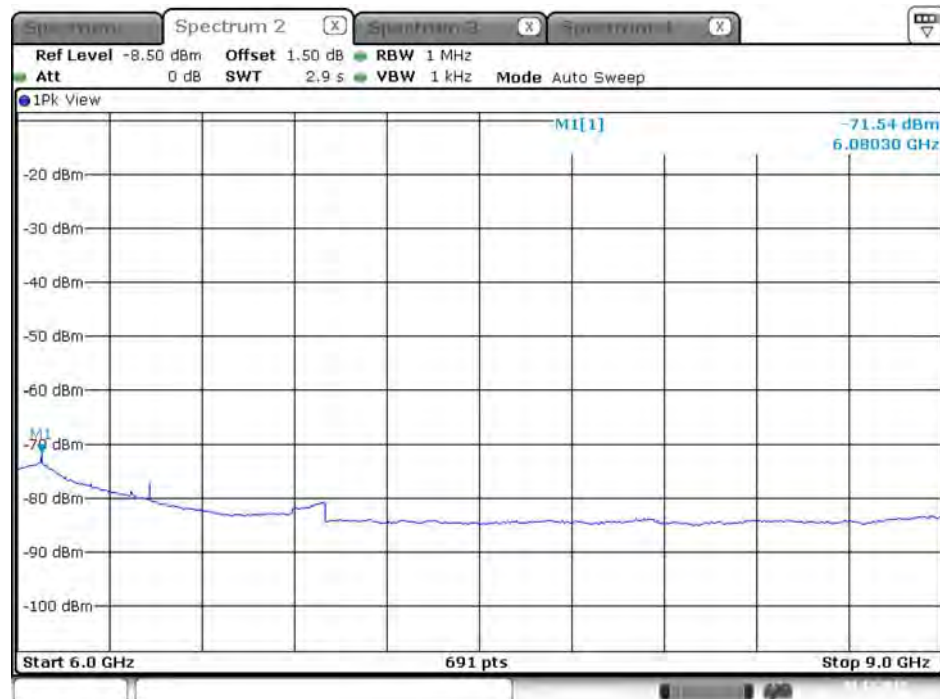


Date: 1.DEC.2017 23:22:52

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 1 / 6GHz~9GHz

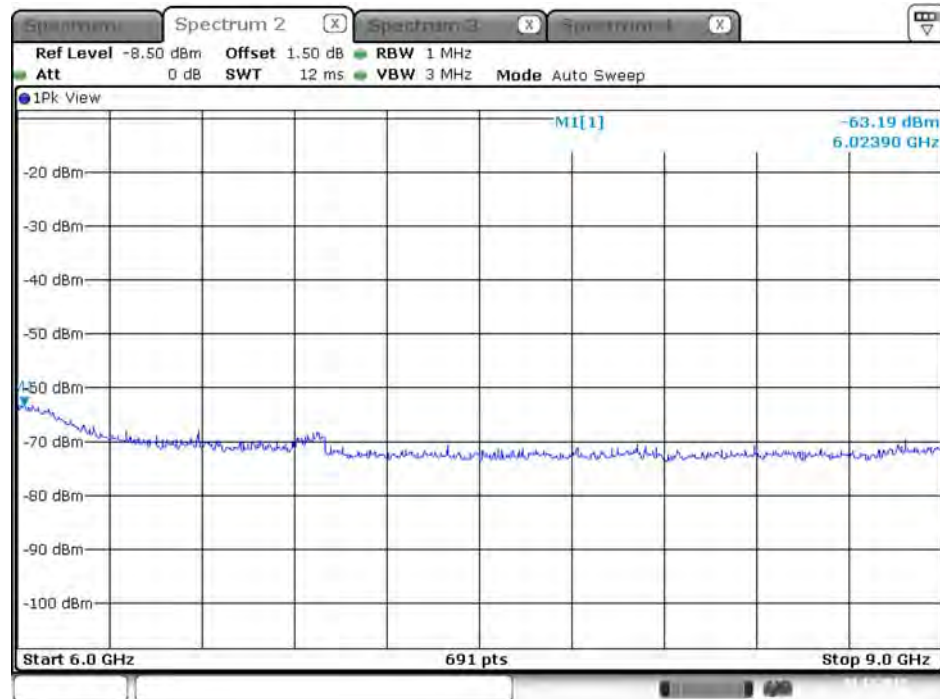


Date: 1.DEC.2017 23:07:59

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 2 / 6GHz~9GHz

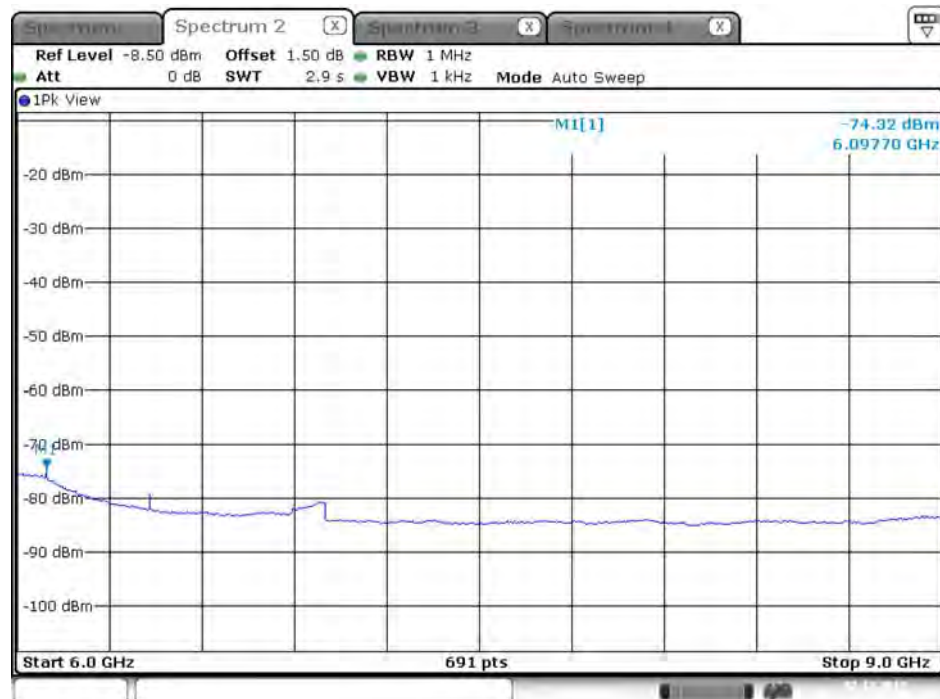

Date: 2.DEC.2017 00:38:39

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 1 / 6GHz~9GHz

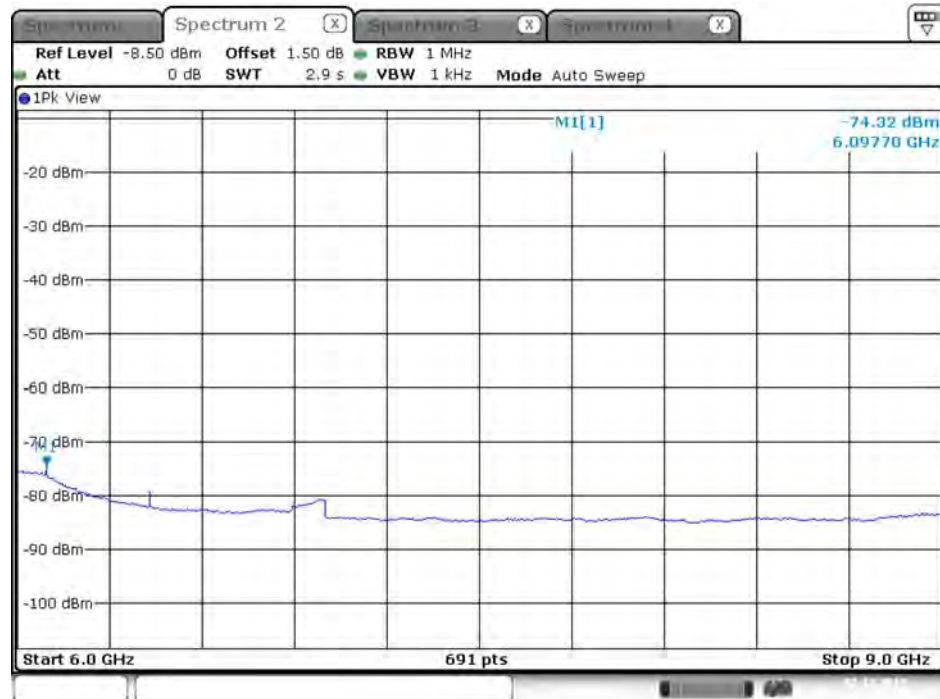


Date: 2.DEC.2017 00:38:39

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 2 / 6GHz~9GHz




Date: 2.DEC.2017 00:58:52

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 1 / 6GHz~9GHz

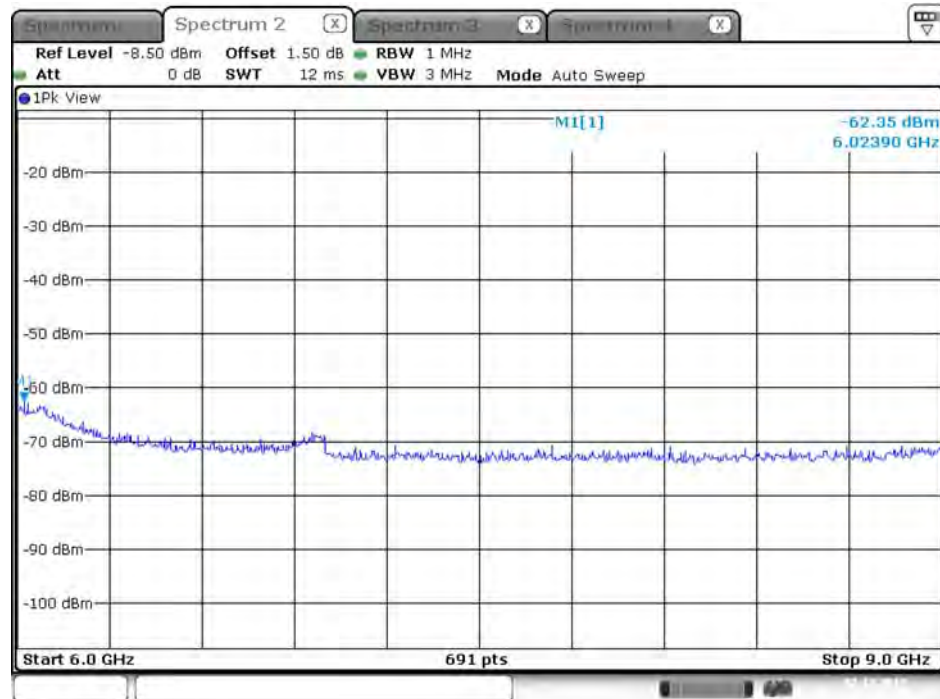


Date: 2.DEC.2017 00:37:11

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 2 / 6GHz~9GHz

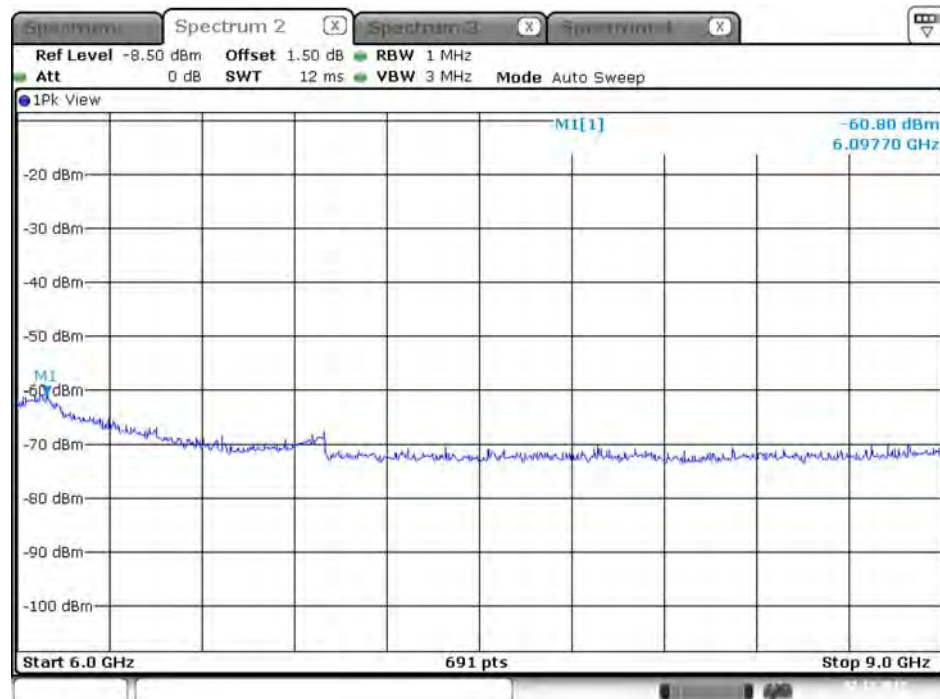


Date: 2.DEC.2017 00:57:34

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 1 / 9GHz~18GHz

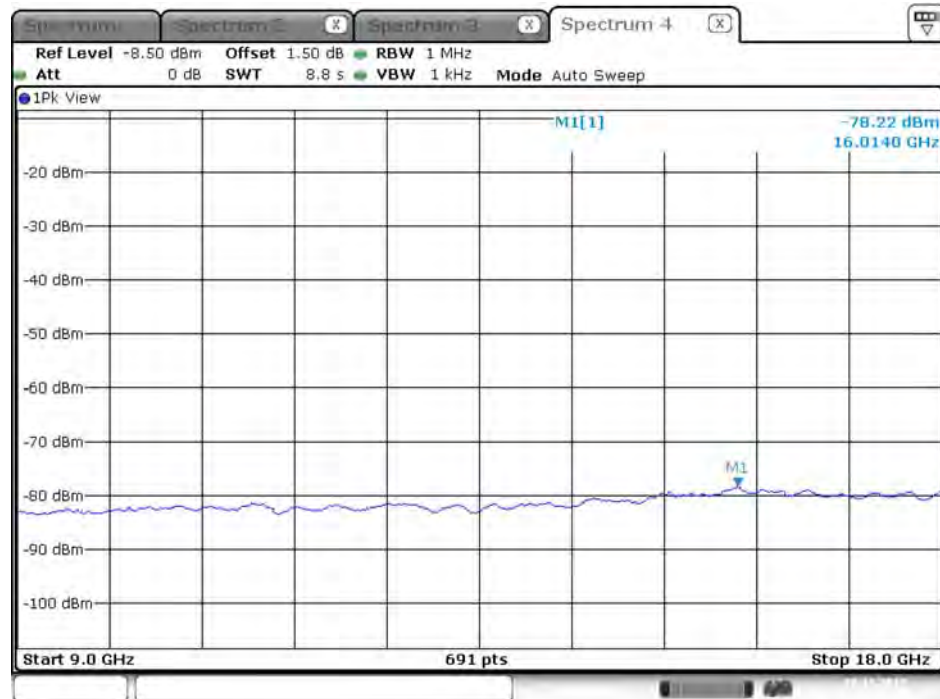


Date: 28.NOV.2017 00:31:57

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 2 / 9GHz~18GHz

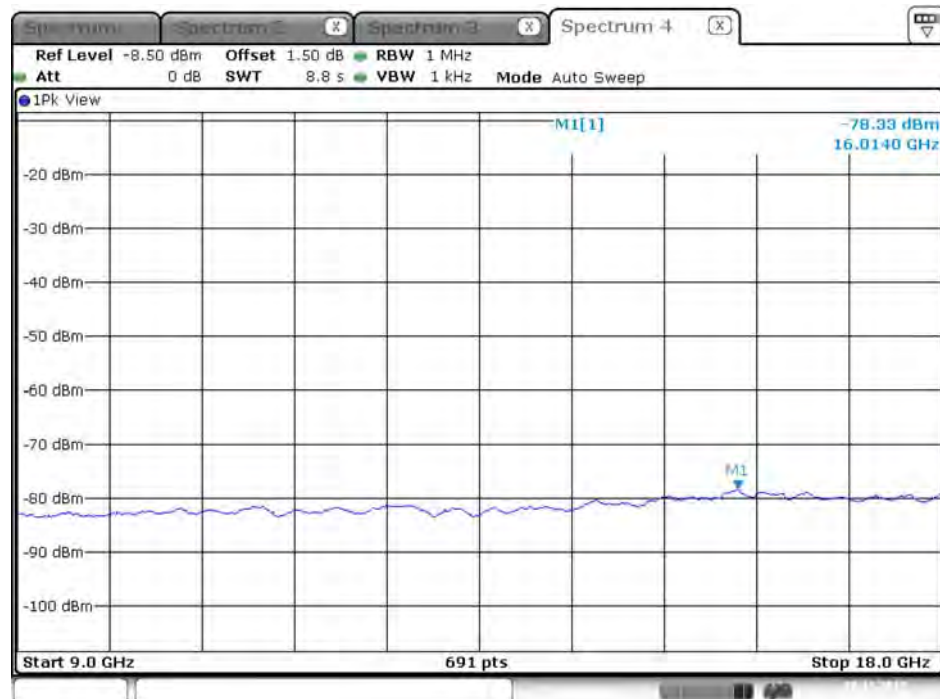


Date: 28.NOV.2017 00:45:16

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 1 / 9GHz~18GHz

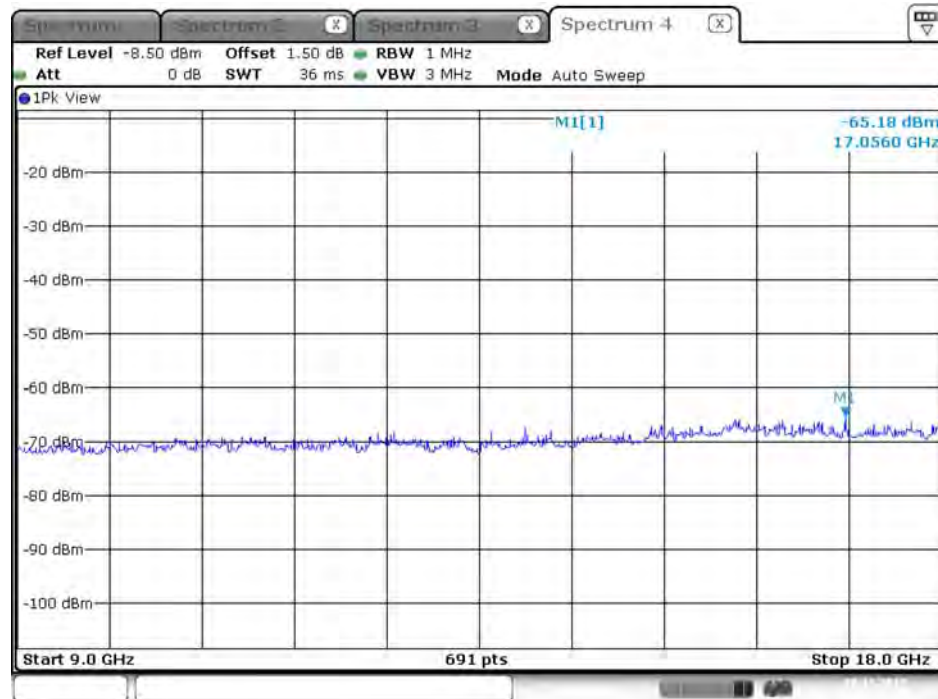


Date: 28.NOV.2017 00:33:00

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 2 / 9GHz~18GHz

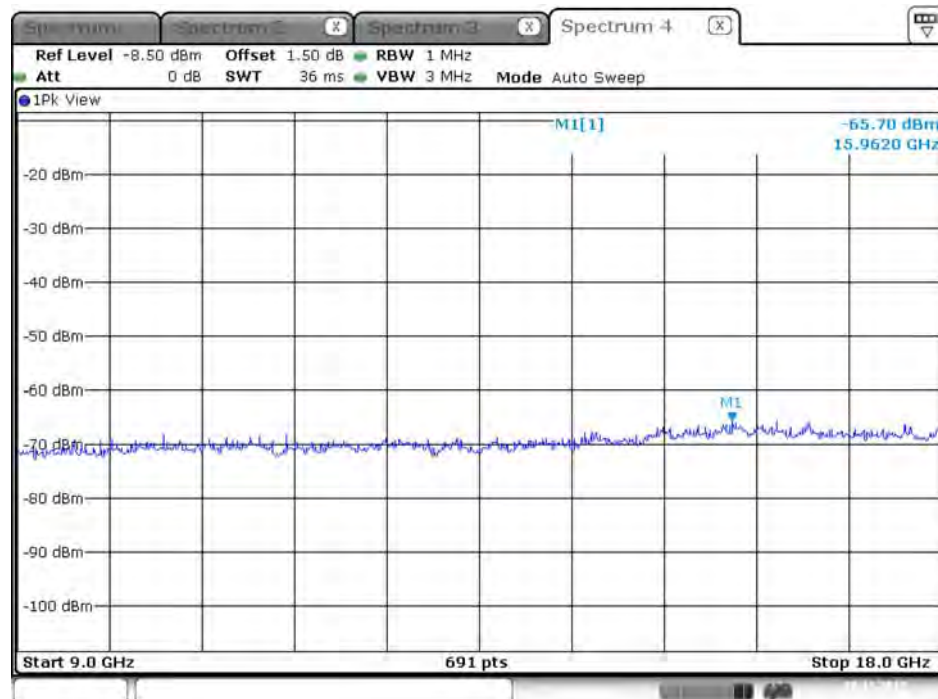


Date: 28.NOV.2017 00:45:41

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 1 / 9GHz~18GHz

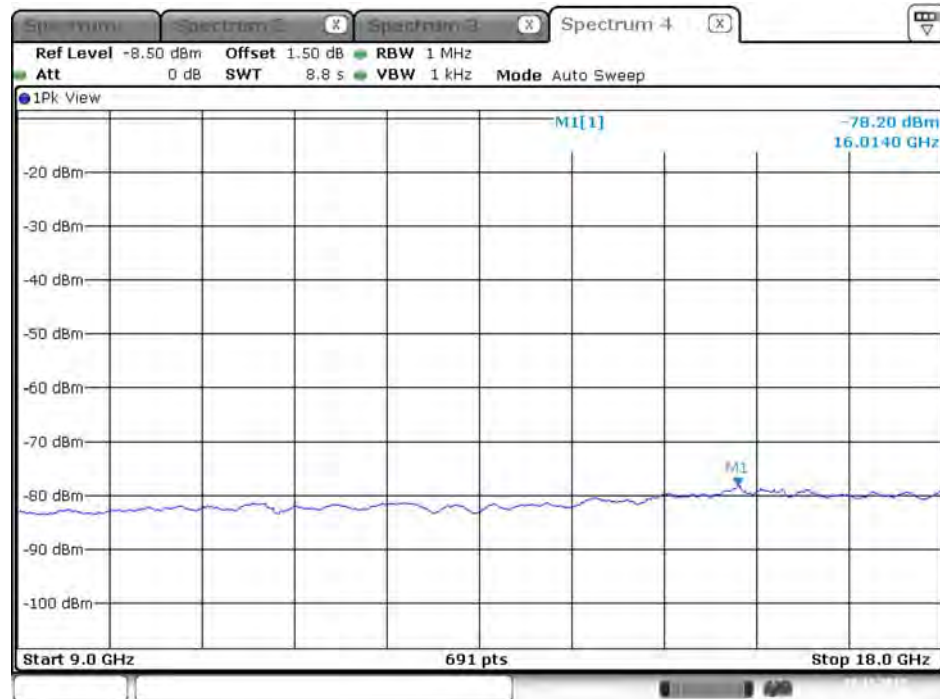


Date: 28.NOV.2017 01:05:34

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 2 / 9GHz~18GHz

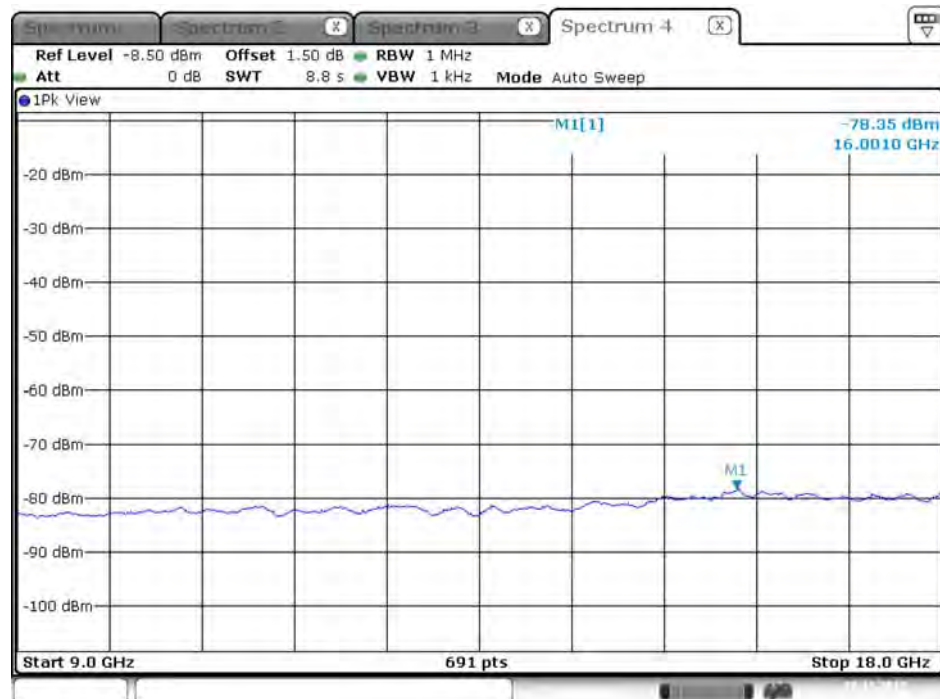


Date: 28.NOV.2017 01:12:25

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 1 / 9GHz~18GHz

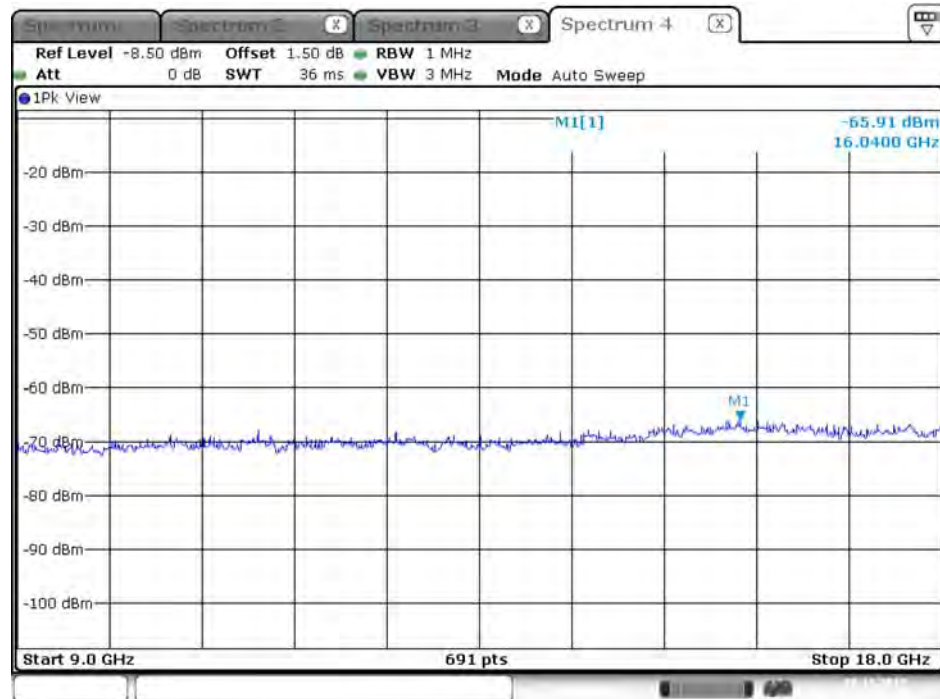


Date: 28.NOV.2017 01:06:12

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 2 / 9GHz~18GHz

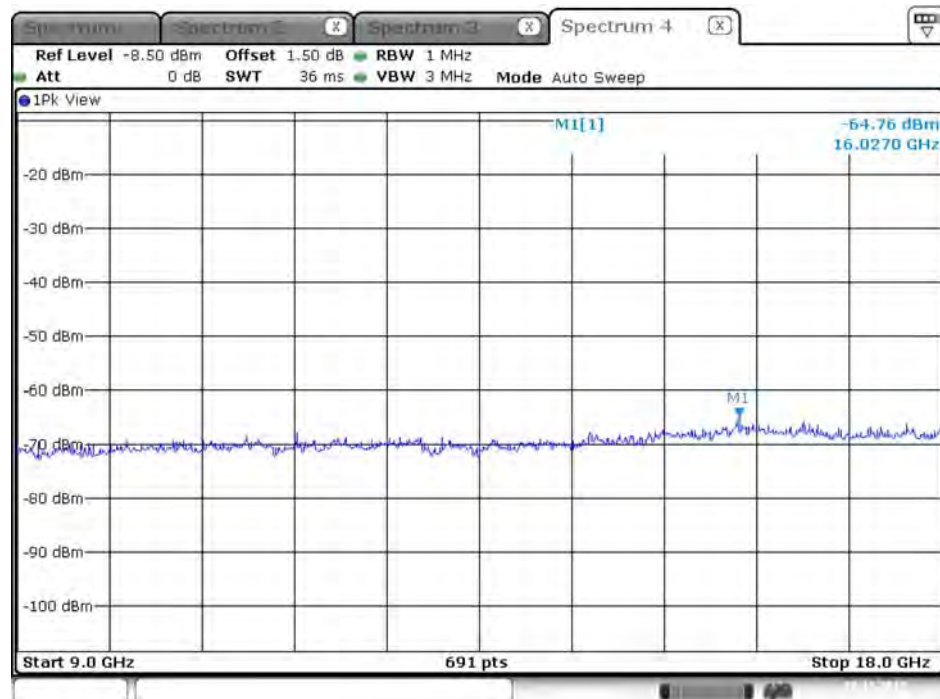


Date: 28.NOV.2017 01:12:46

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 1 / 9GHz~18GHz

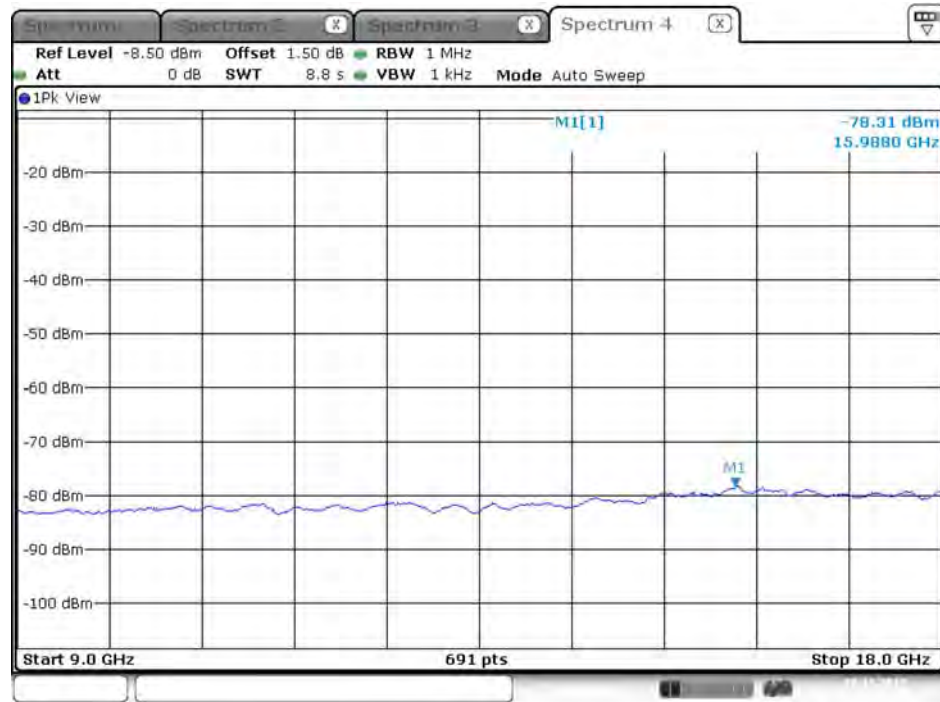


Date: 28.NOV.2017 01:26:51

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 2 / 9GHz~18GHz

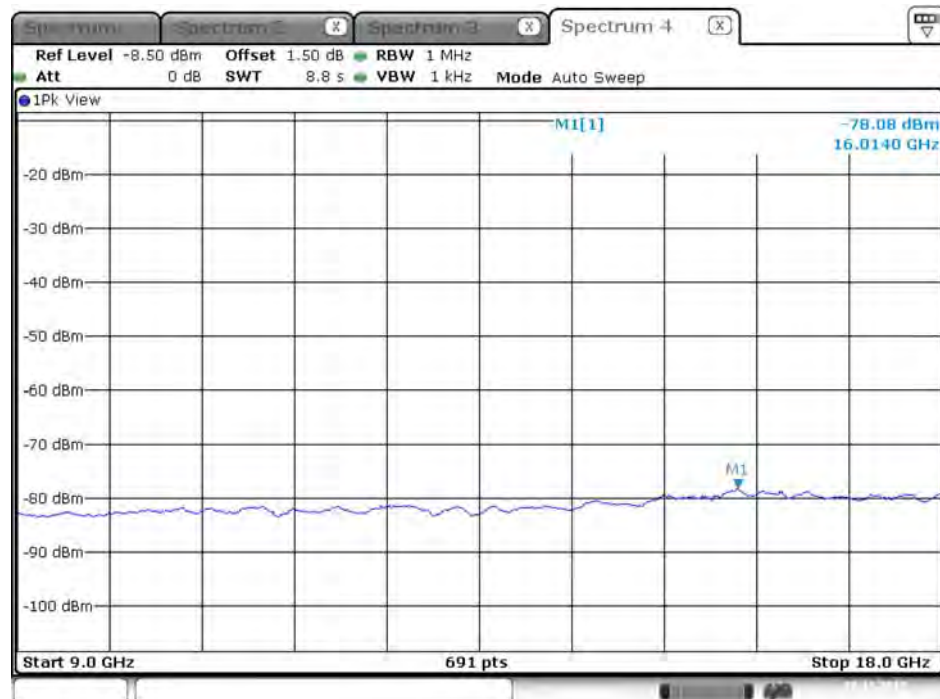


Date: 28.NOV.2017 01:34:25

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 1 / 9GHz~18GHz

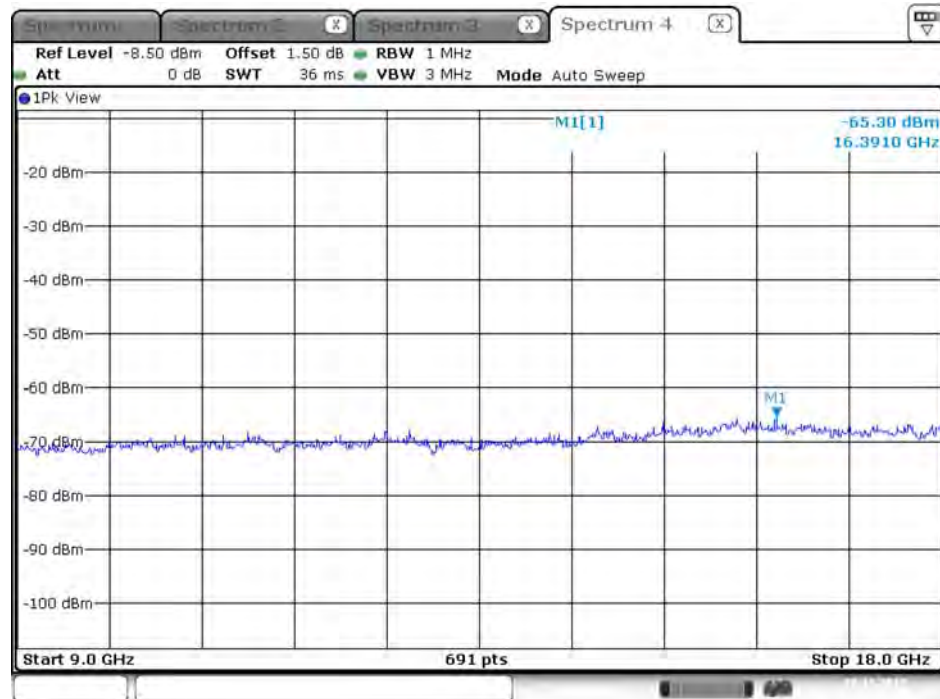


Date: 28.NOV.2017 01:27:29

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 2 / 9GHz~18GHz

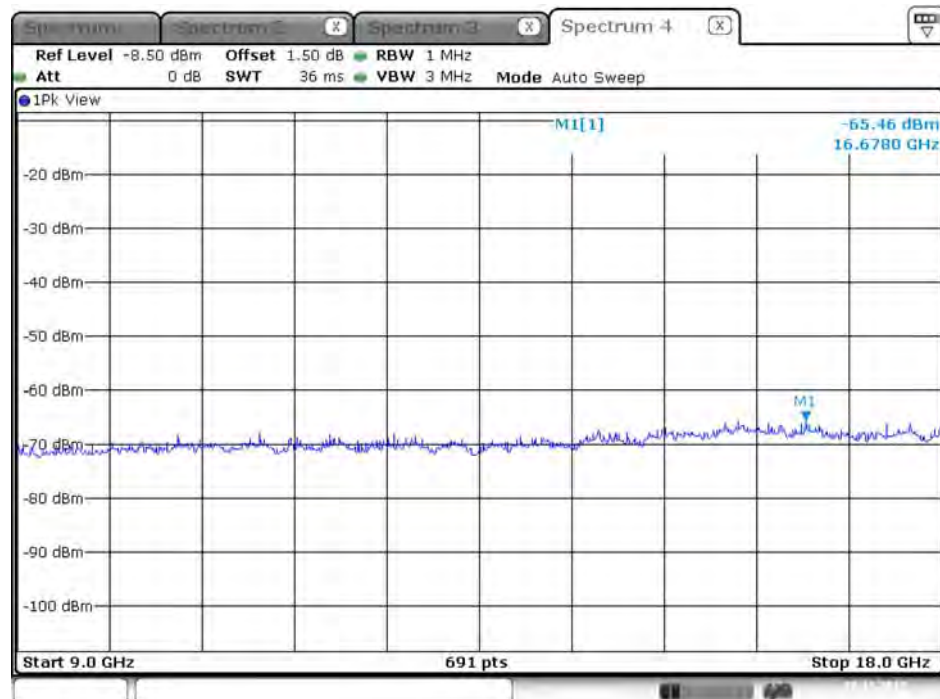


Date: 28.NOV.2017 01:34:53

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 1 / 9GHz~18GHz

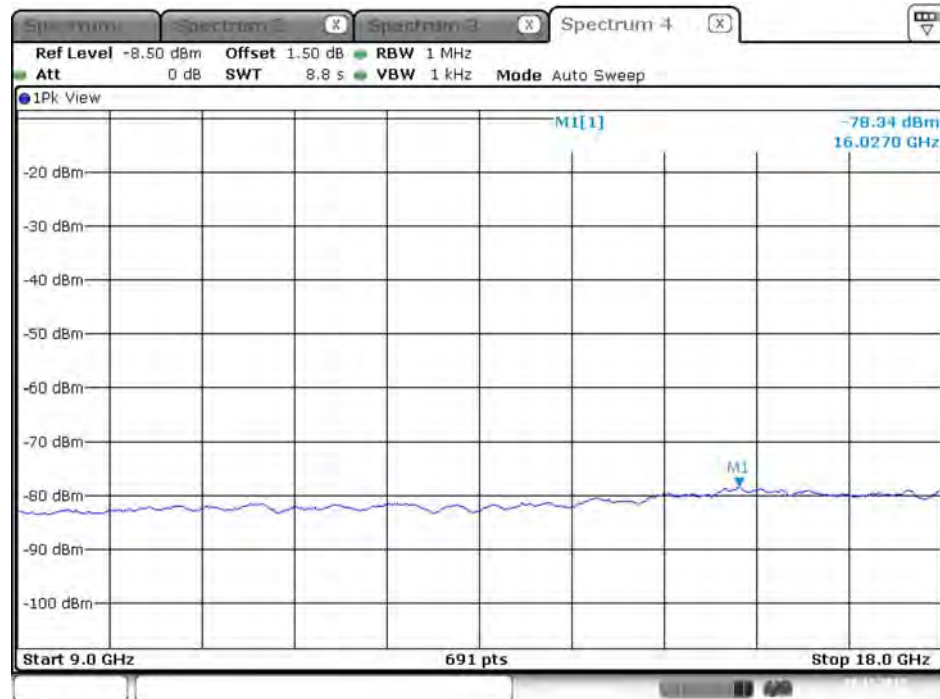


Date: 28.NOV.2017 02:34:50

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 2 / 9GHz~18GHz

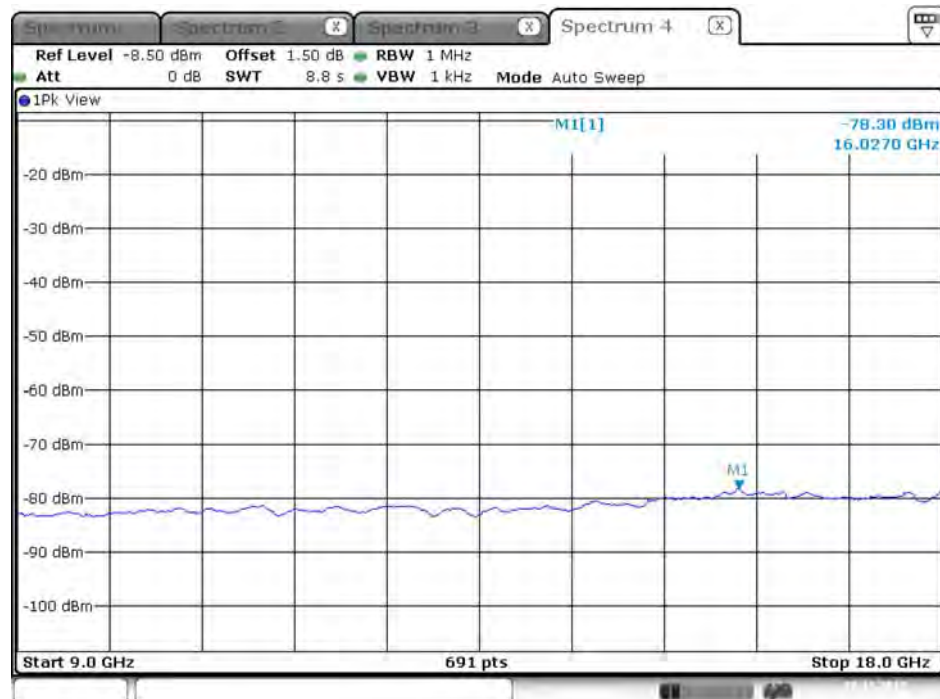


Date: 28.NOV.2017 02:42:33

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 1 / 9GHz~18GHz

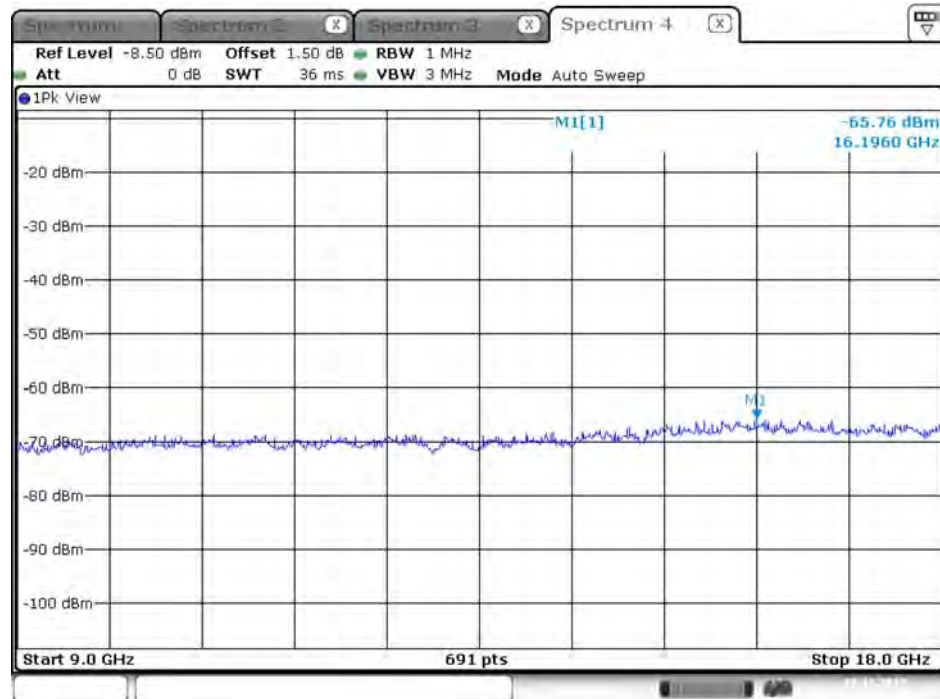


Date: 28 NOV. 2017 02:35:34

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 2 / 9GHz~18GHz

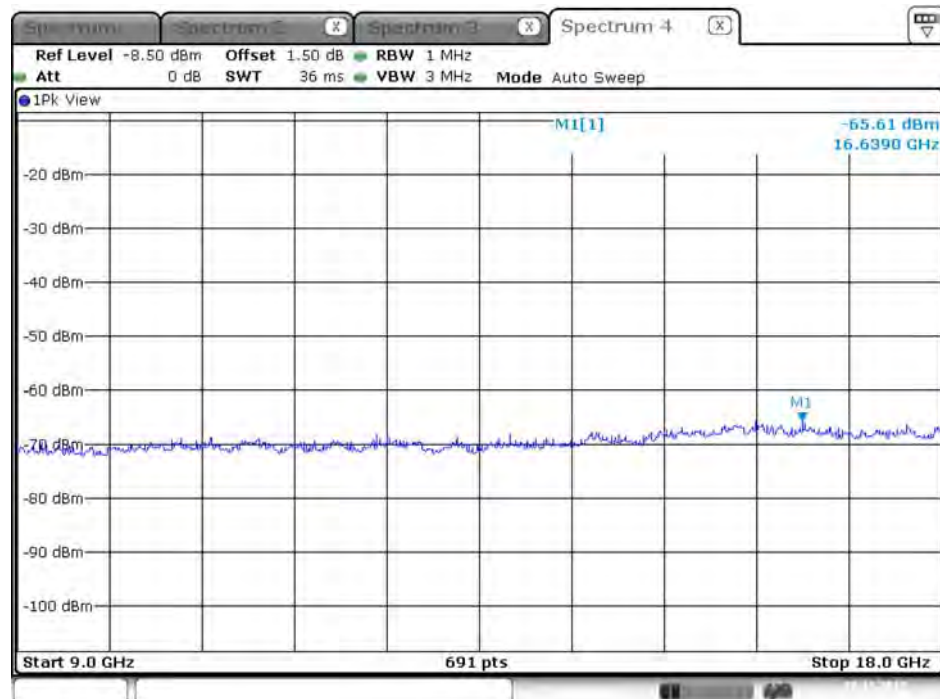


Date: 28 NOV. 2017 02:42:58

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 1 / 9GHz~18GHz

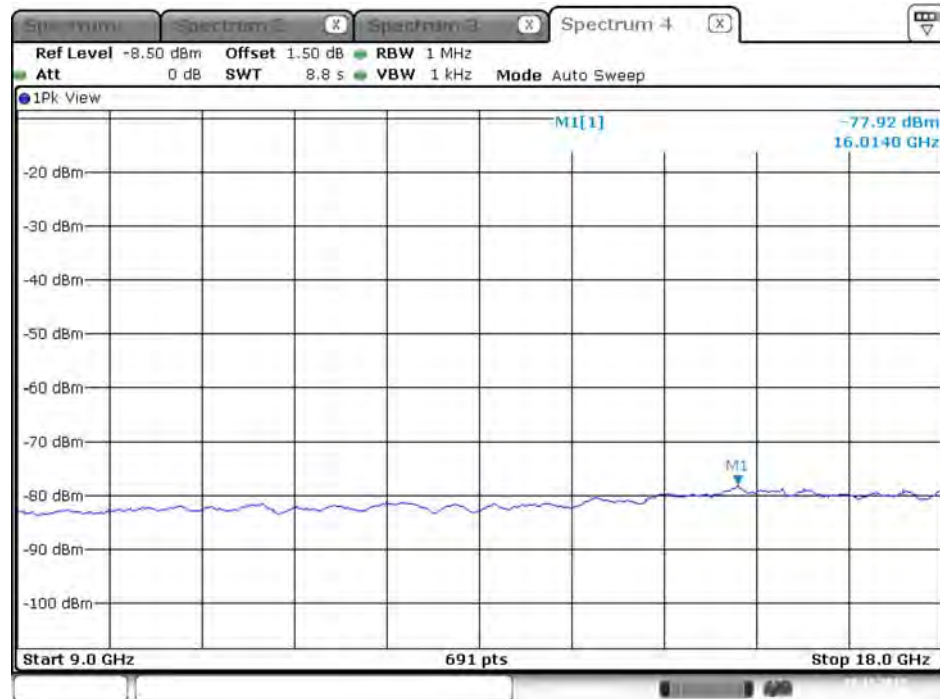


Date: 28.NOV.2017 01:49:54

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 2 / 9GHz~18GHz

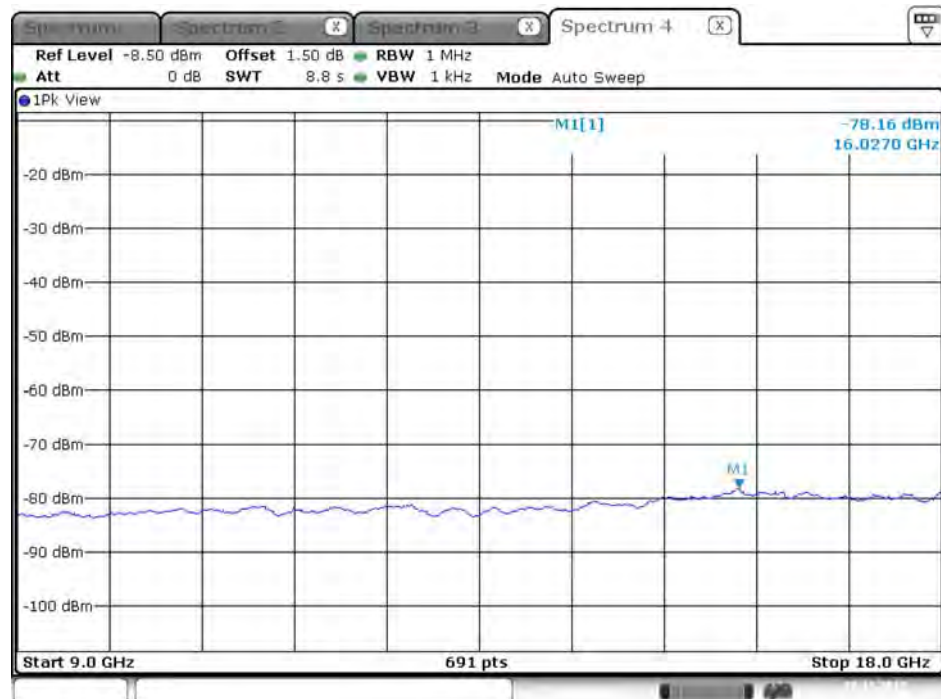


Date: 28.NOV.2017 01:57:03

### Plot on Configuration QPSK, 80M / 5290MHz / Peak / Port 1 / 9GHz~18GHz

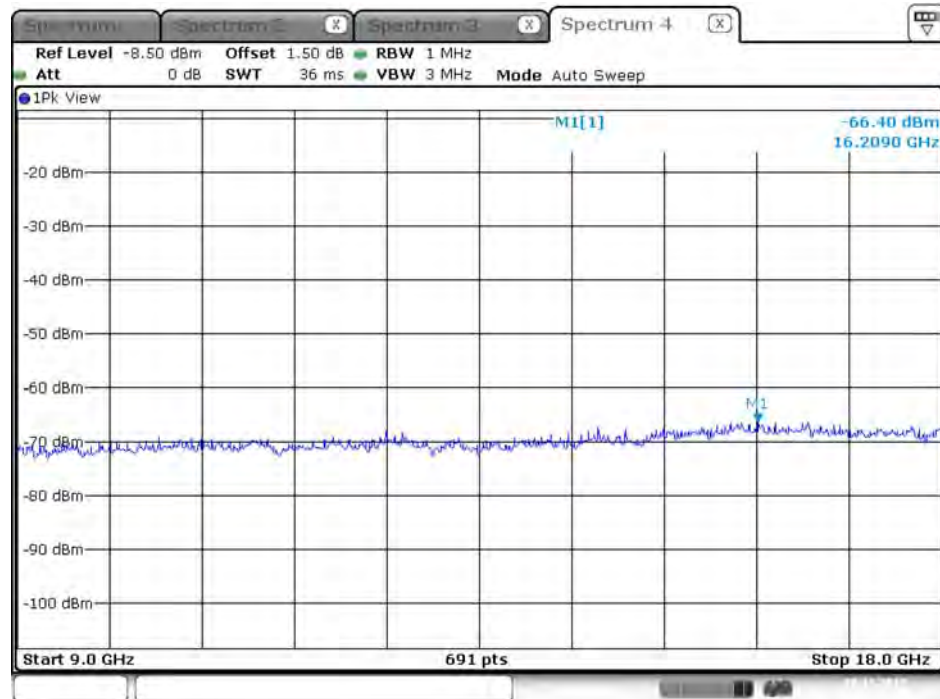


Date: 28.NOV.2017 01:50:12

### Plot on Configuration QPSK, 80M / 5290 MHz / Peak / Port 2 / 9GHz~18GHz

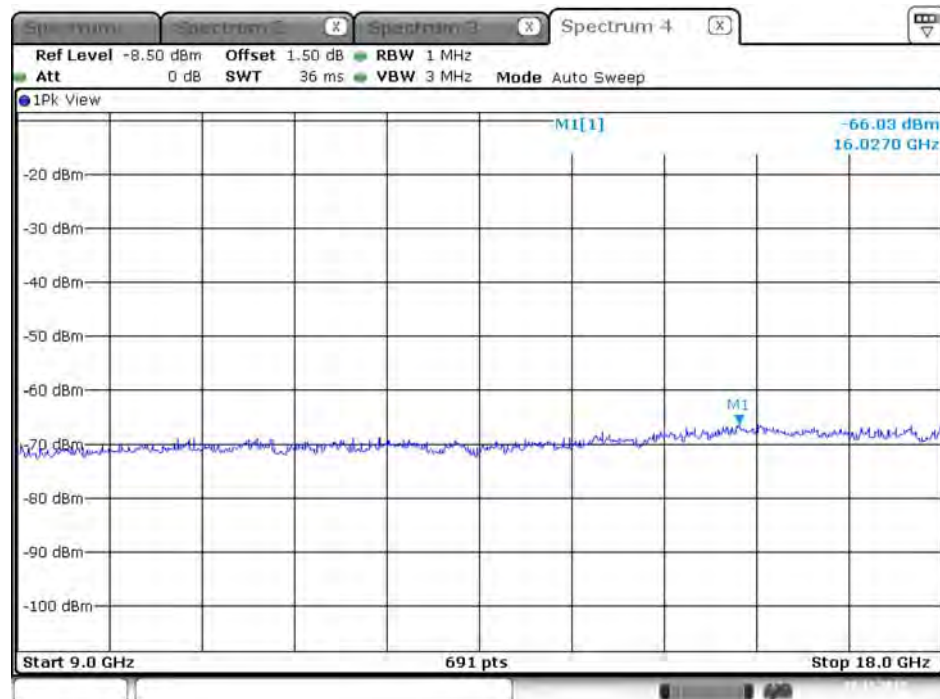


Date: 28.NOV.2017 01:57:44

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 1 / 9GHz~18GHz

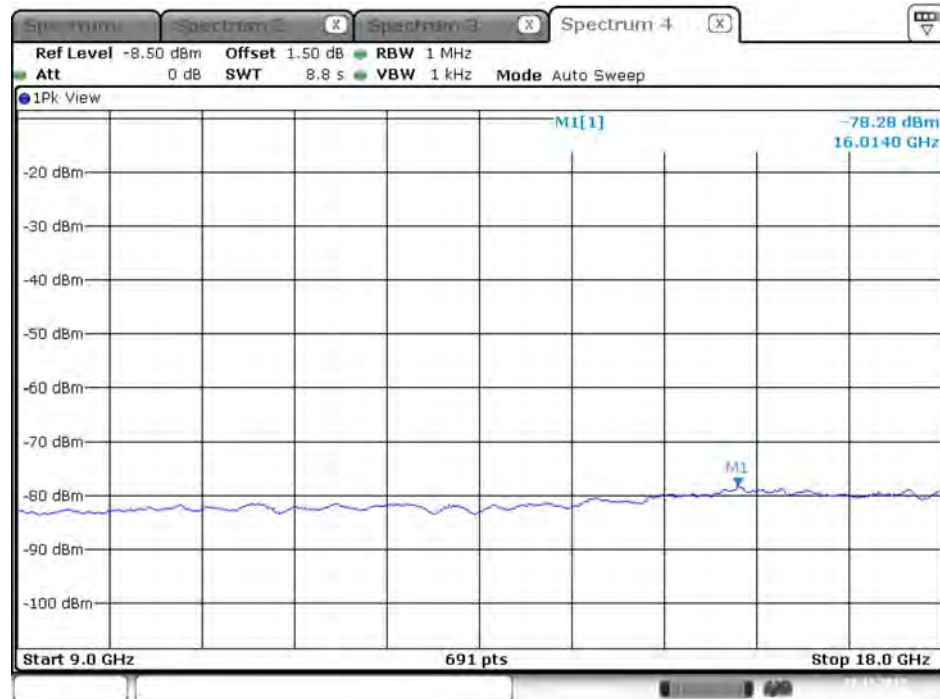


Date: 28.NOV.2017 02:14:04

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 2 / 9GHz~18GHz

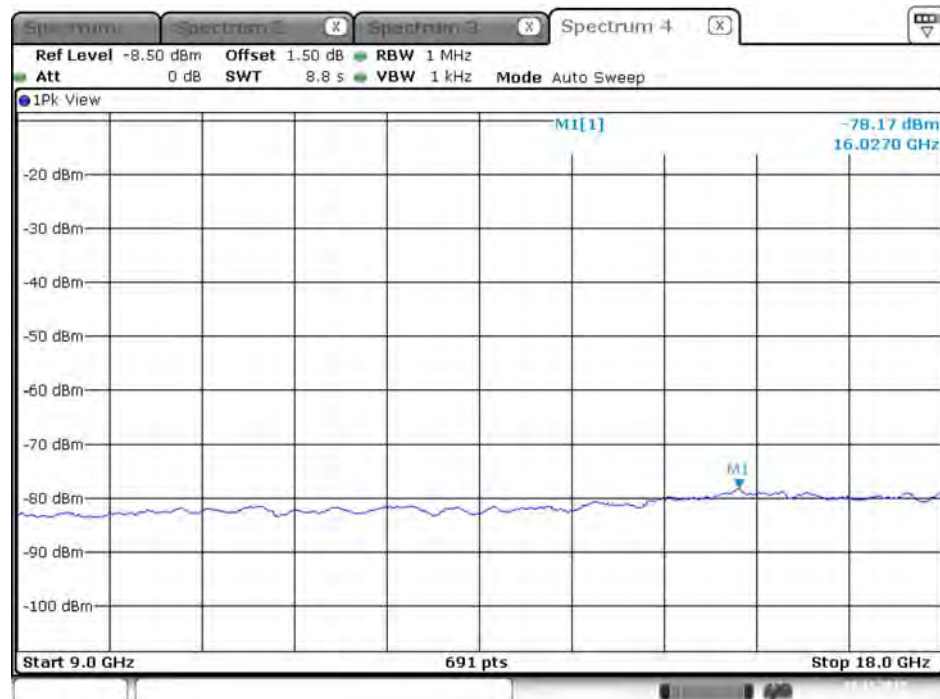


Date: 28.NOV.2017 02:20:12

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 1 / 9GHz~18GHz

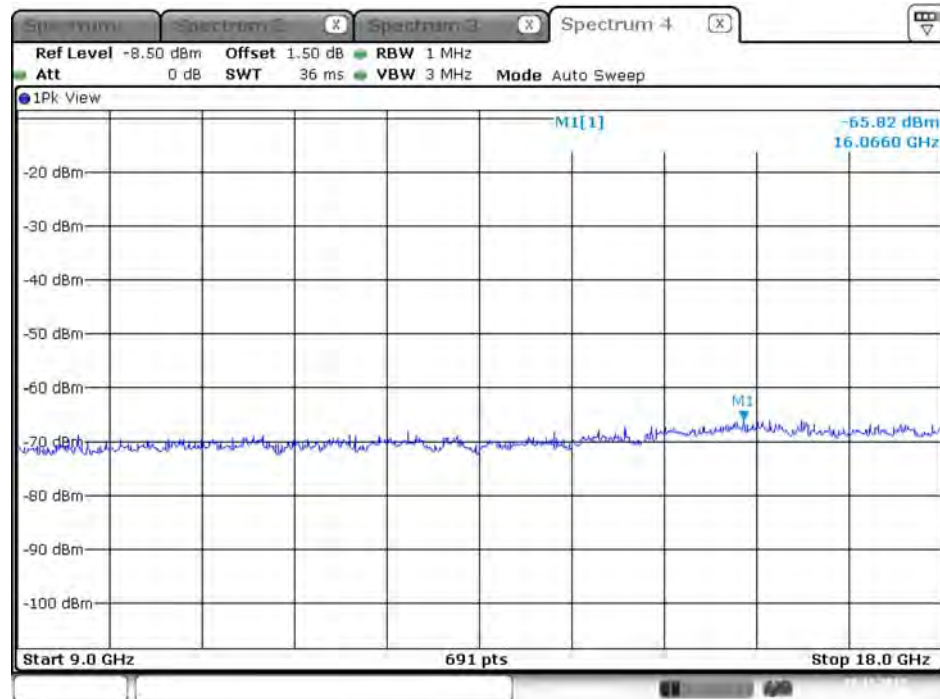


Date: 28.NOV.2017 02:14:39

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 2 / 9GHz~18GHz

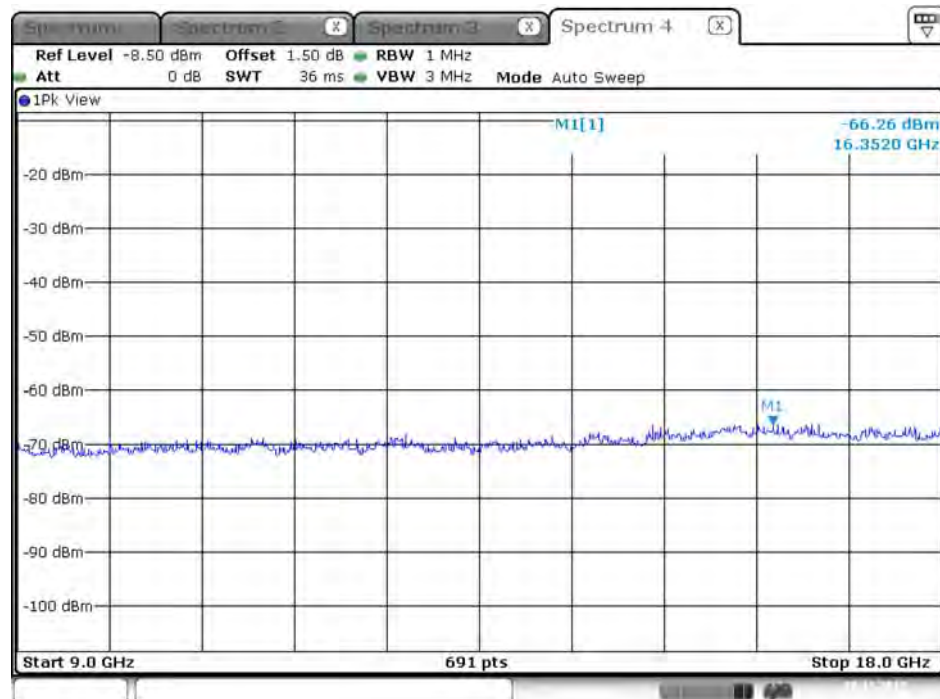


Date: 28.NOV.2017 02:20:38

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 1 / 9GHz~18GHz

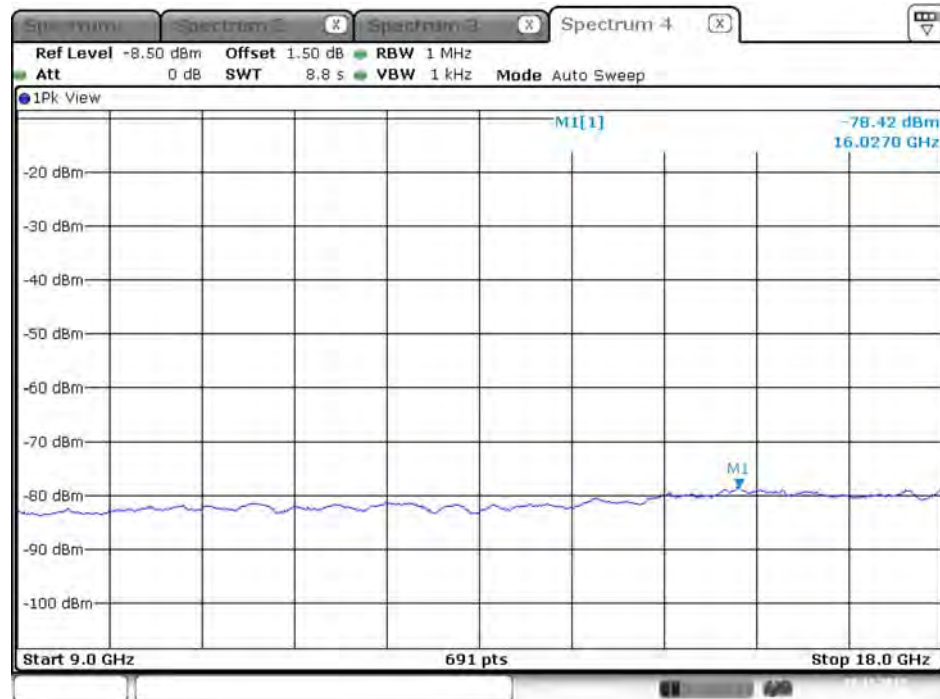


Date: 28 NOV. 2017 02:56:40

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 2 / 9GHz~18GHz

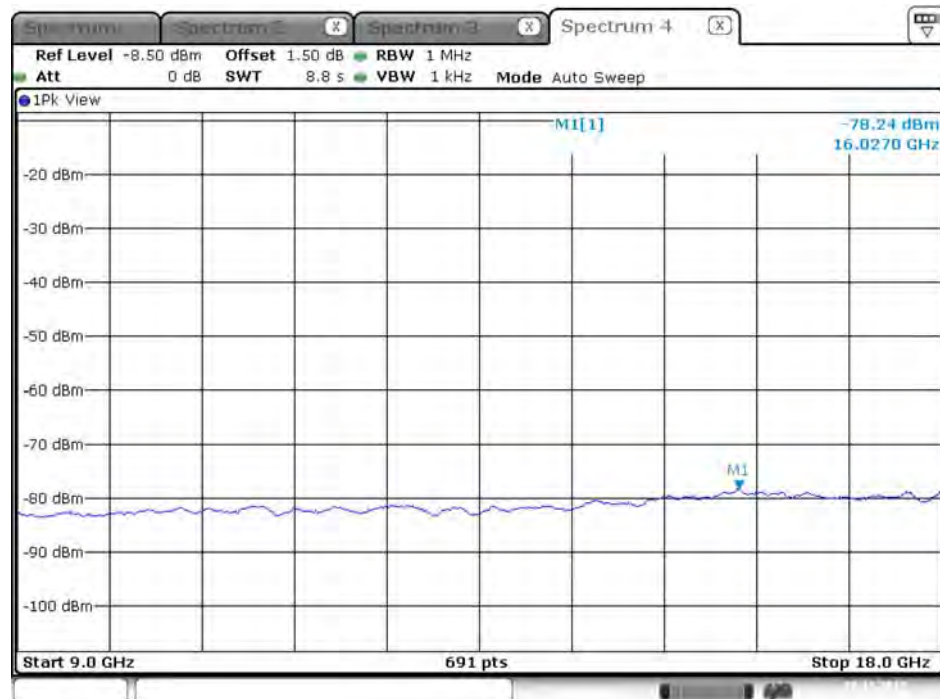


Date: 28 NOV. 2017 03:03:21

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 1 / 9GHz~18GHz

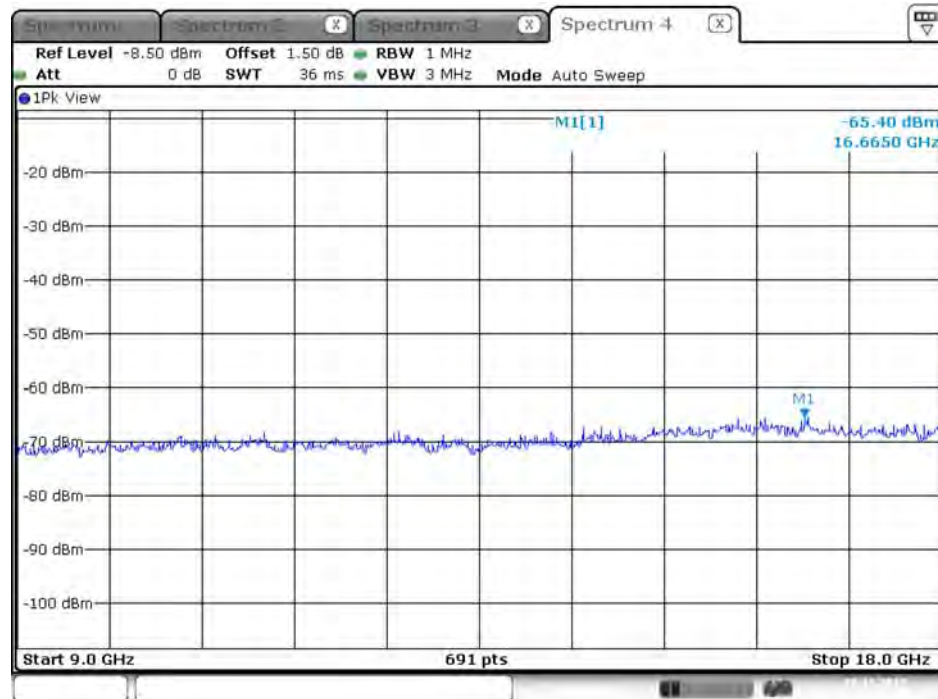


Date: 28.NOV.2017 02:57:13

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 2 / 9GHz~18GHz

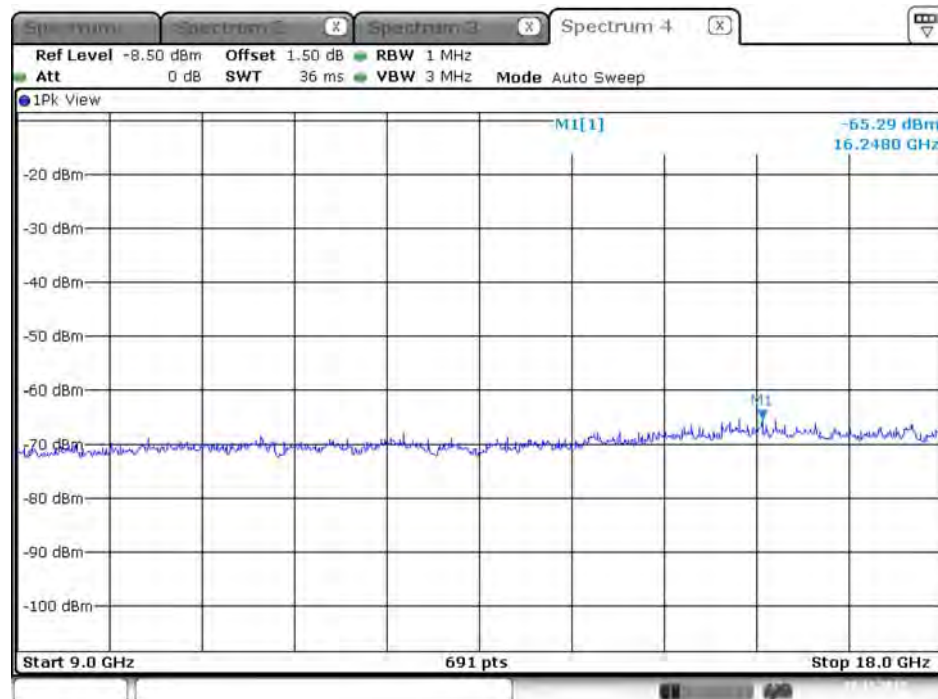


Date: 28.NOV.2017 03:03:56

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 1 / 9GHz~18GHz

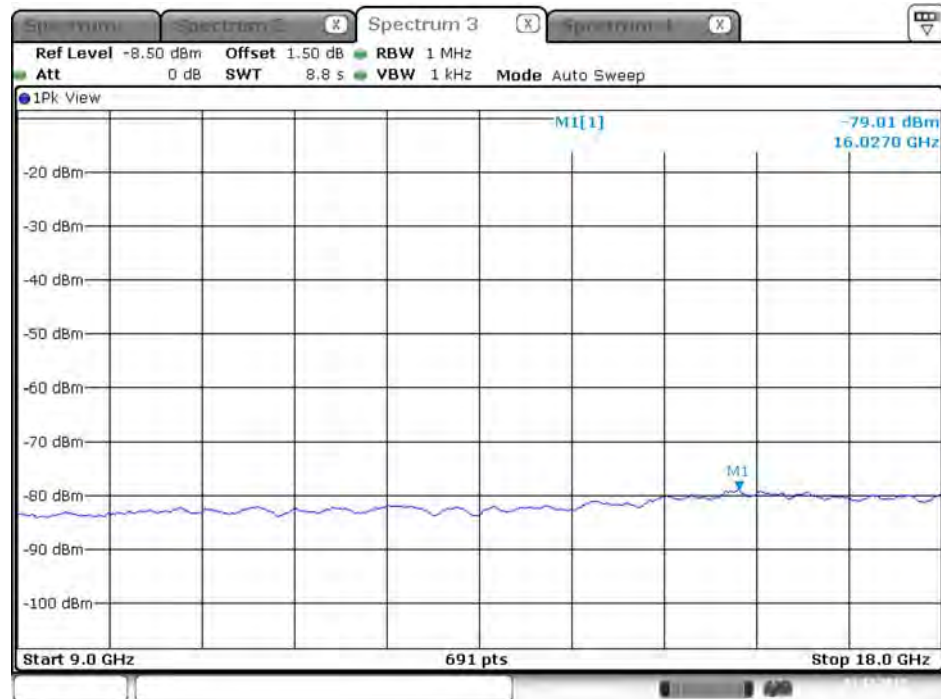


Date: 1.DEC.2017 19:41:06

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 2 / 9GHz~18GHz

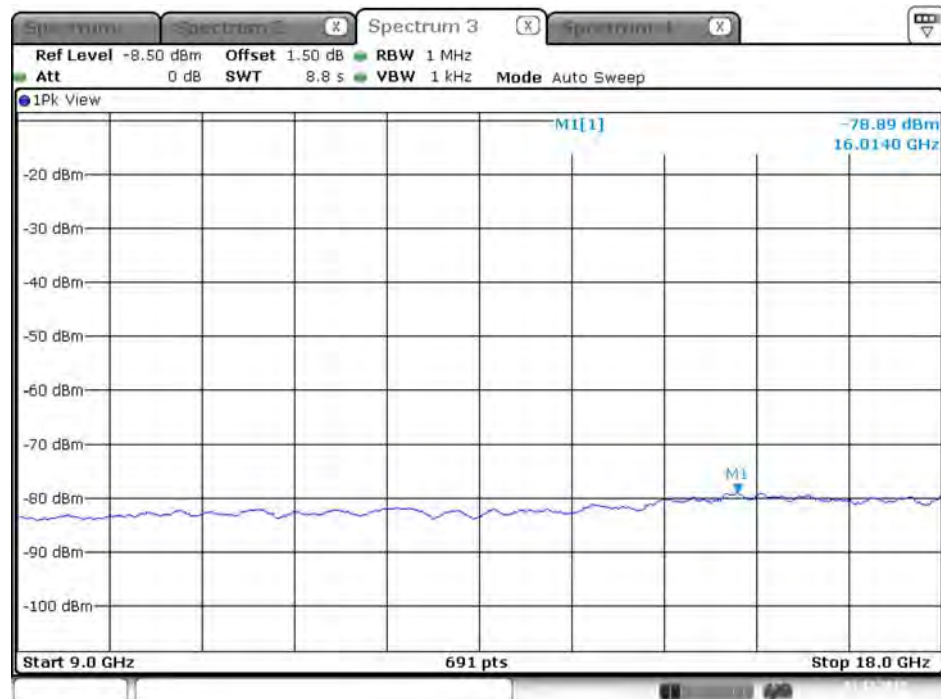


Date: 1.DEC.2017 19:51:35

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 1 / 9GHz~18GHz

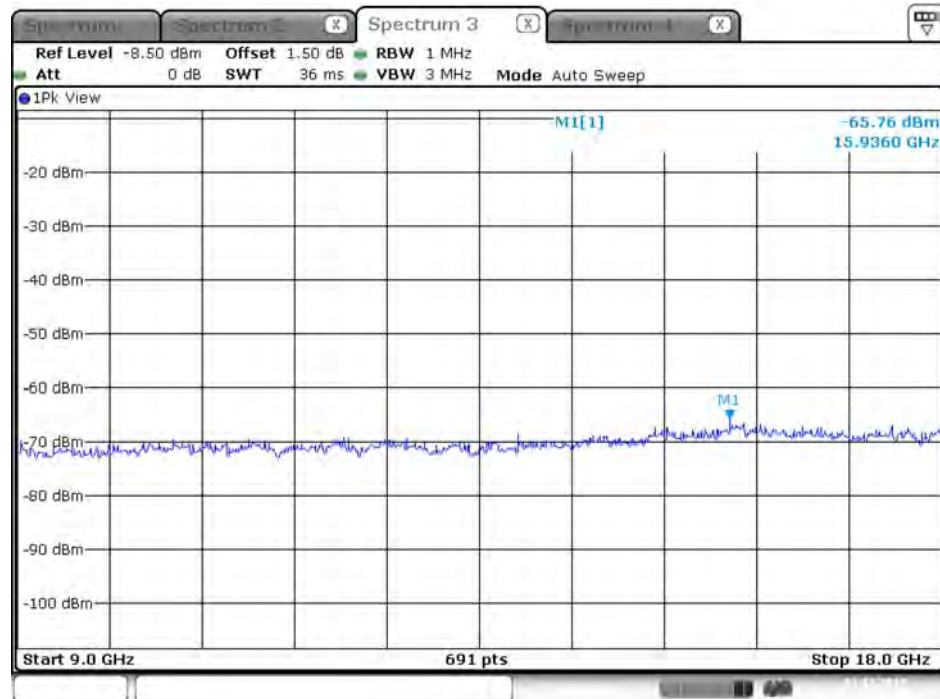


Date: 1.DEC.2017 19:42:54

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 2 / 9GHz~18GHz

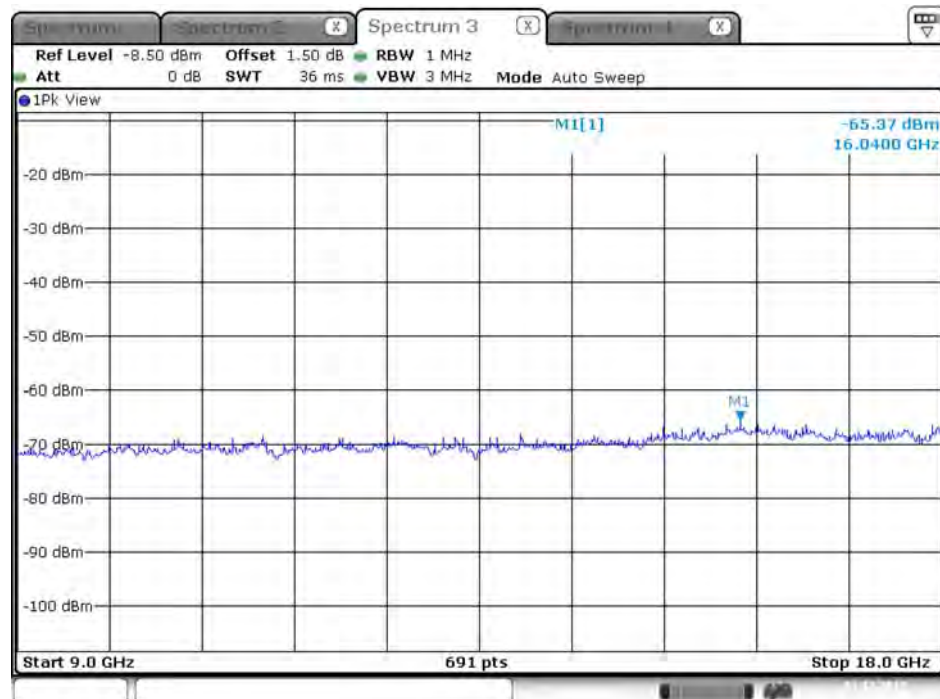


Date: 1.DEC.2017 19:52:08

### Plot on Configuration QPSK, 20M / 5580MHz / Average / Port 1 / 9GHz~18GHz

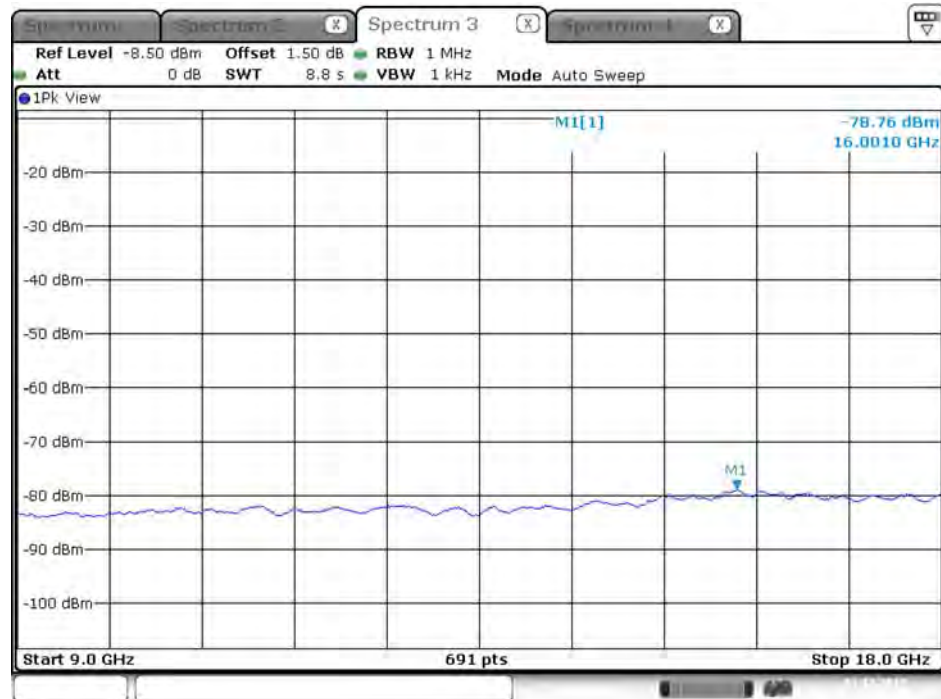


Date: 1 DEC. 2017 20:02:08

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 2 / 9GHz~18GHz

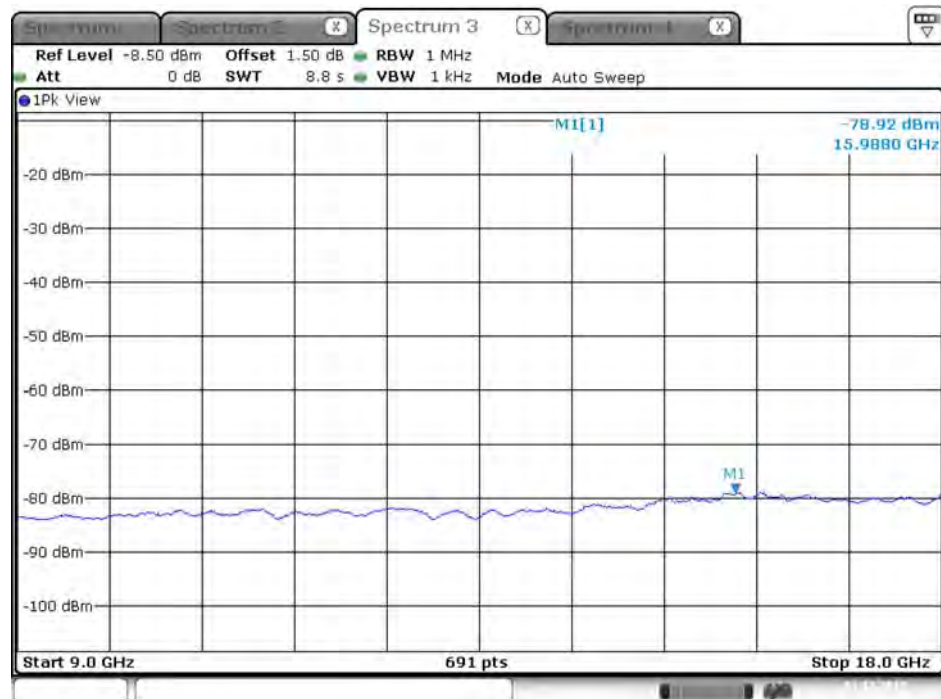


Date: 1 DEC. 2017 20:20:18

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 1 / 9GHz~18GHz

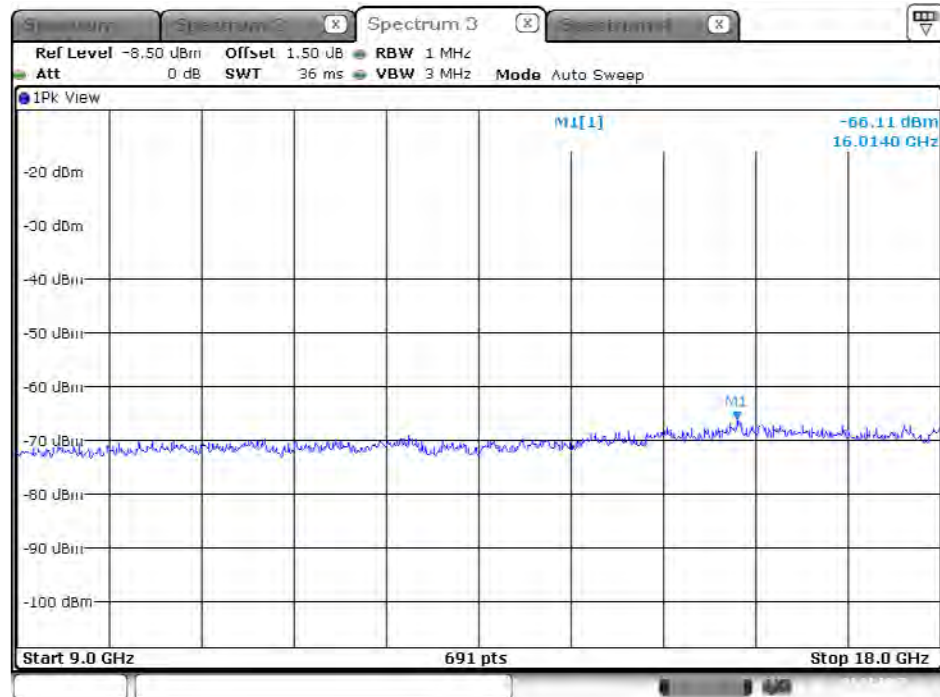


Date: 1.DEC.2017 20:02:51

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 2 / 9GHz~18GHz

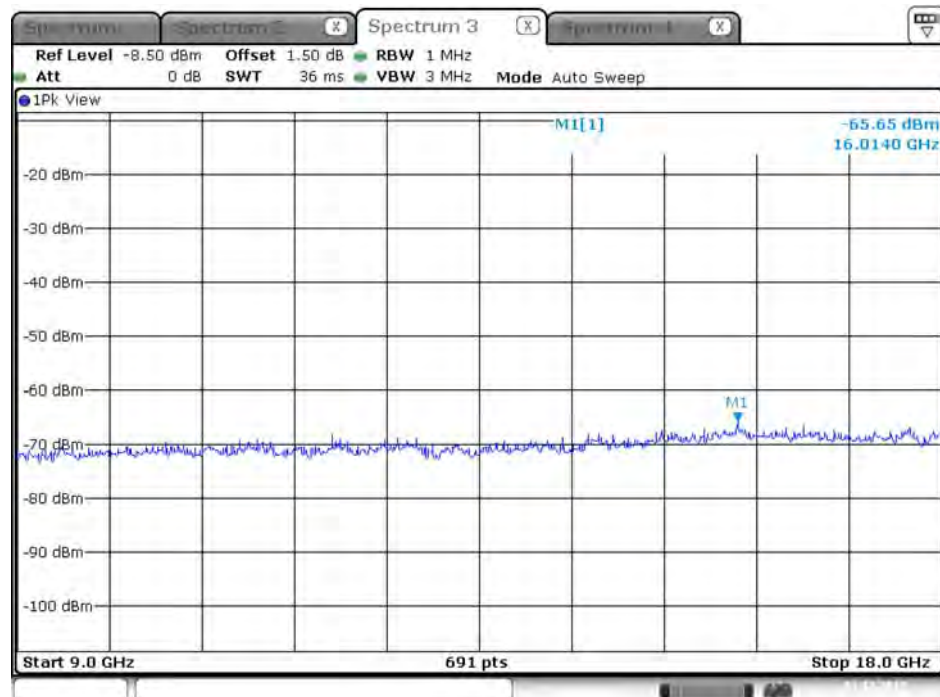


Date: 1.DEC.2017 20:18:56

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 1 / 9GHz~18GHz

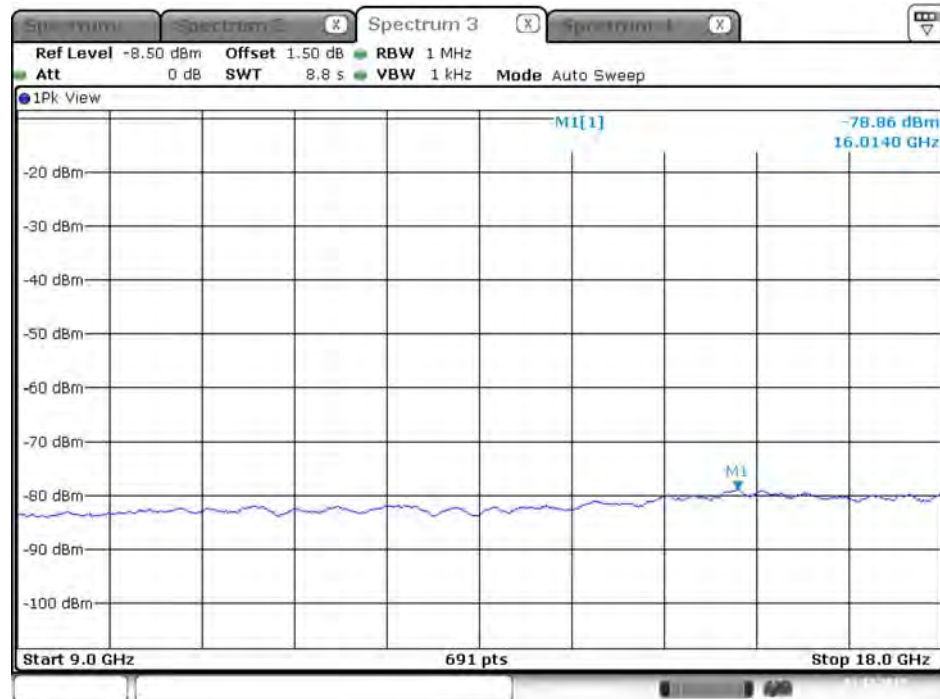


Date: 1 DEC. 2017 20:39:32

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 2 / 9GHz~18GHz

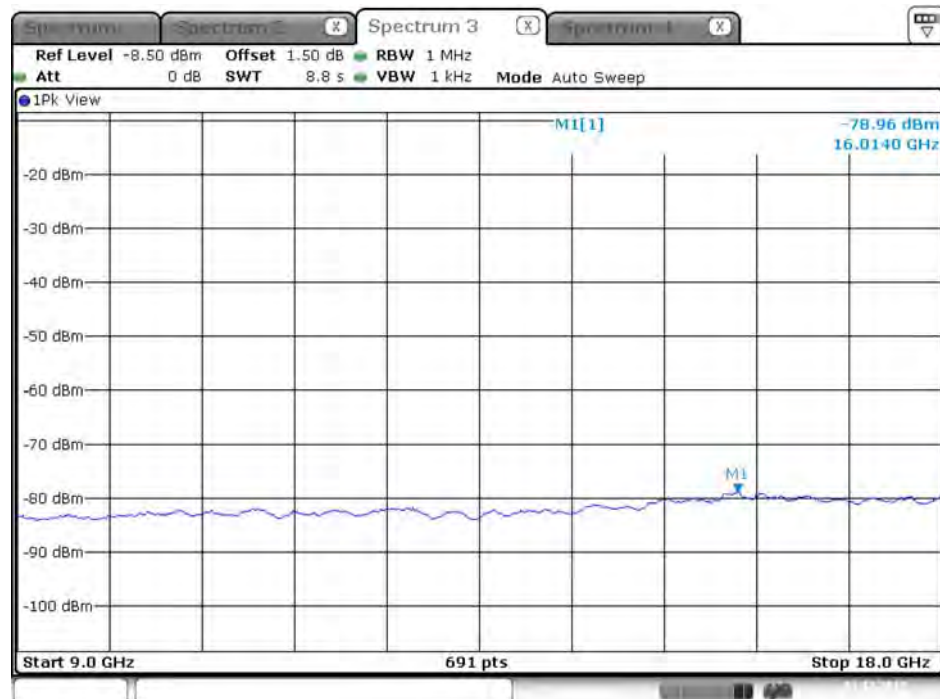


Date: 1 DEC. 2017 20:52:55

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 1 / 9GHz~18GHz

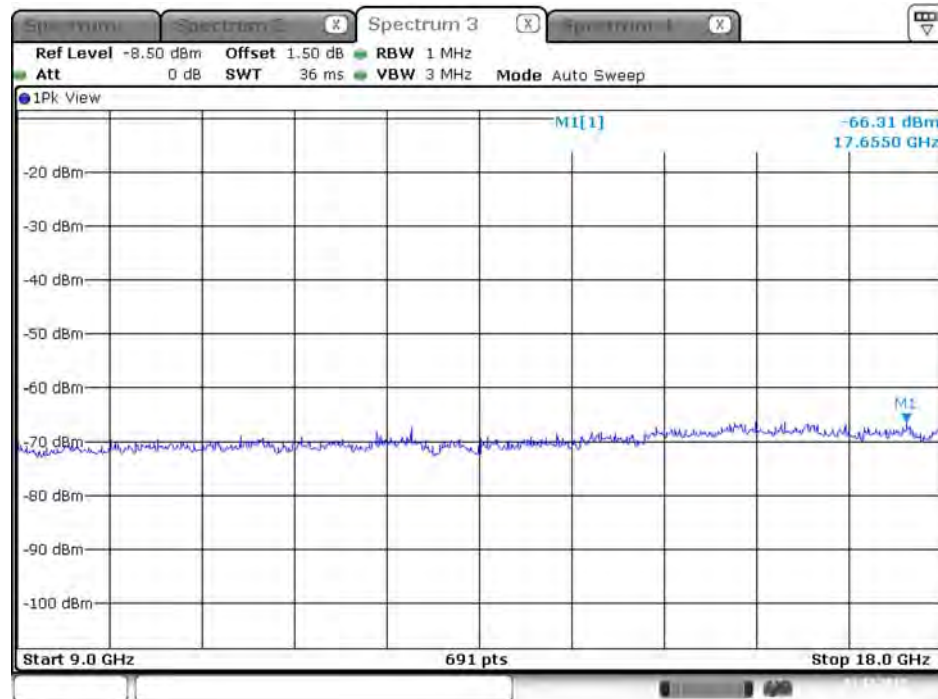


Date: 1.DEC.2017 20:40:04

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 2 / 9GHz~18GHz

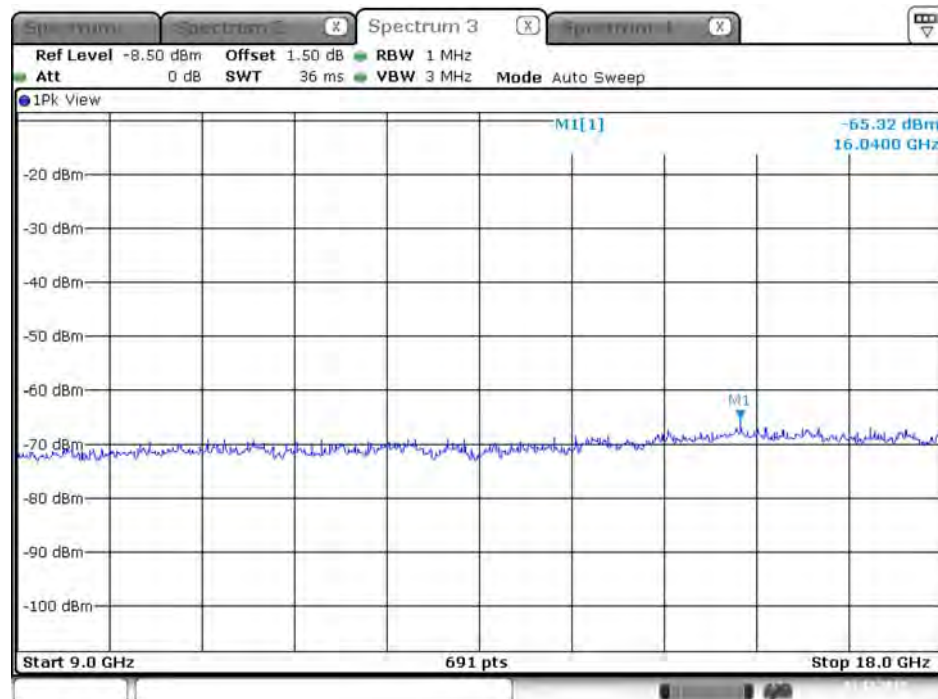


Date: 1.DEC.2017 20:52:12

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 1 / 9GHz~18GHz

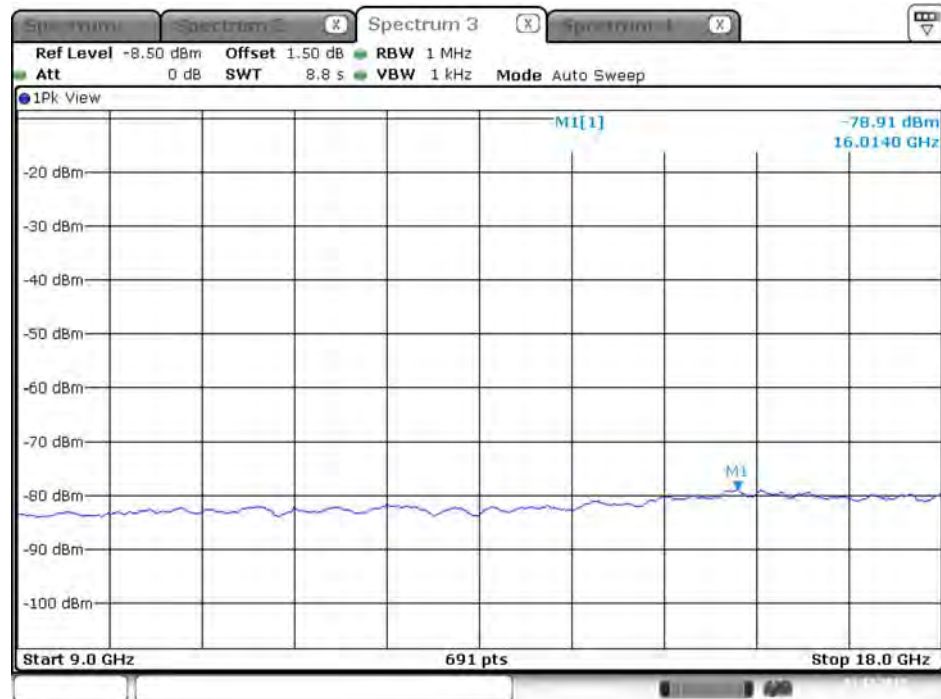


Date: 1.DEC.2017 21:12:17

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 2 / 9GHz~18GHz

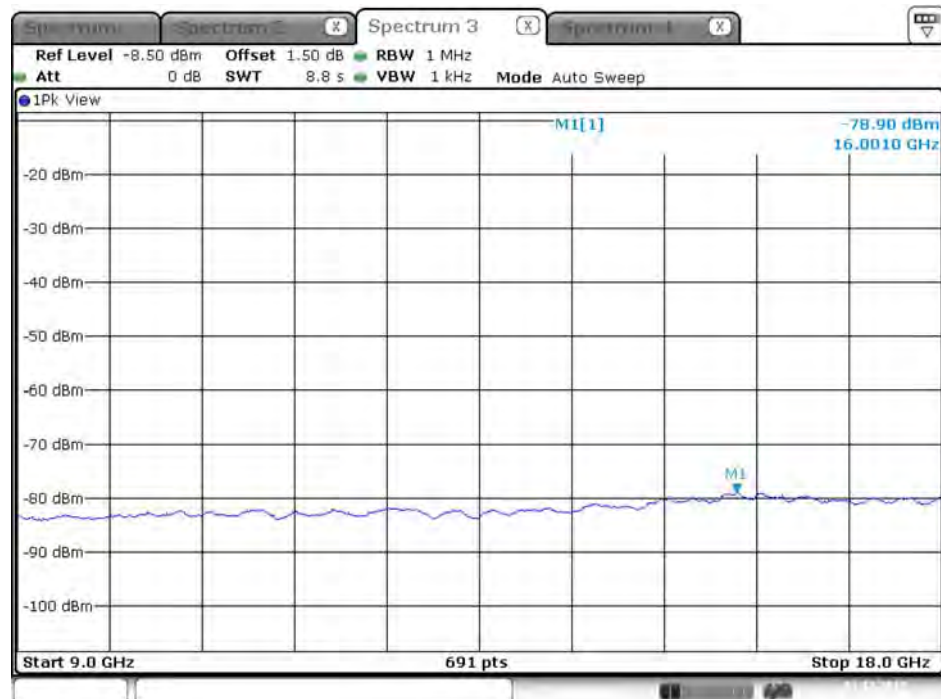


Date: 1.DEC.2017 21:25:04

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 9GHz~18GHz

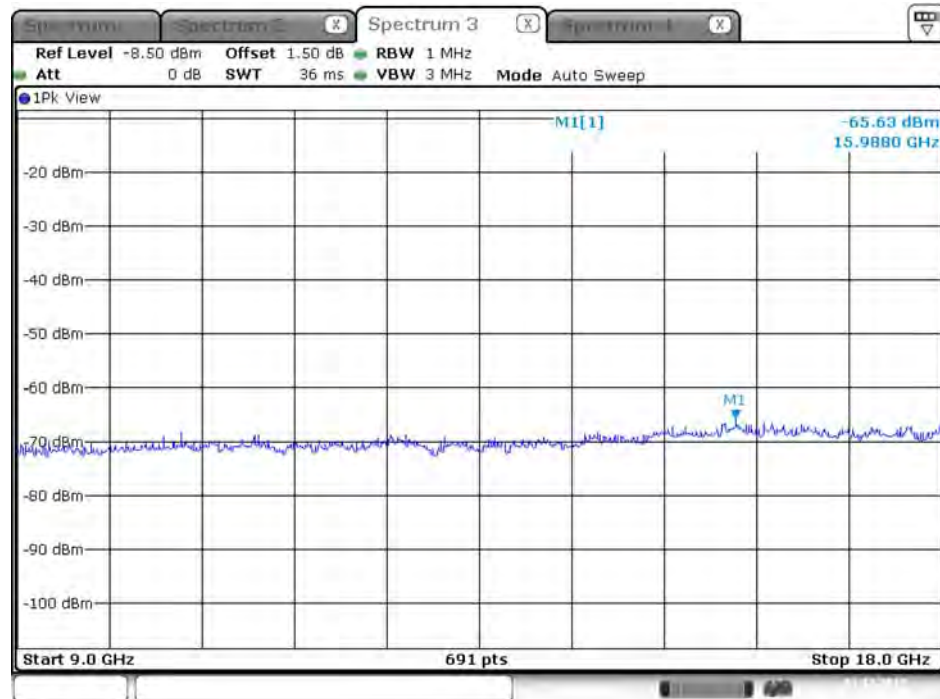


Date: 1.DEC.2017 21:12:58

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 9GHz~18GHz

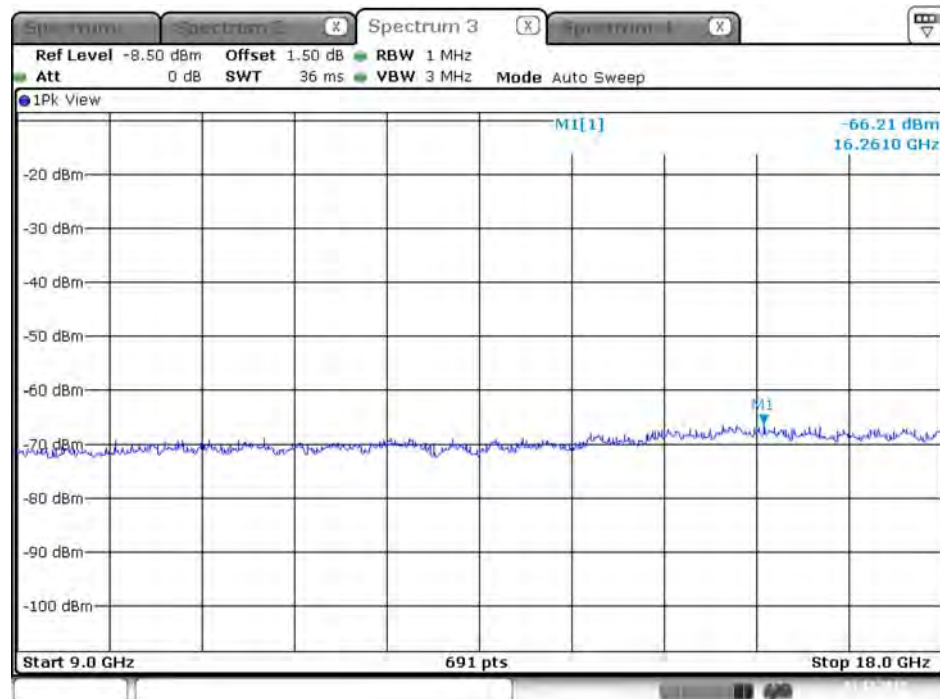


Date: 1.DEC.2017 21:25:43

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 1 / 9GHz~18GHz

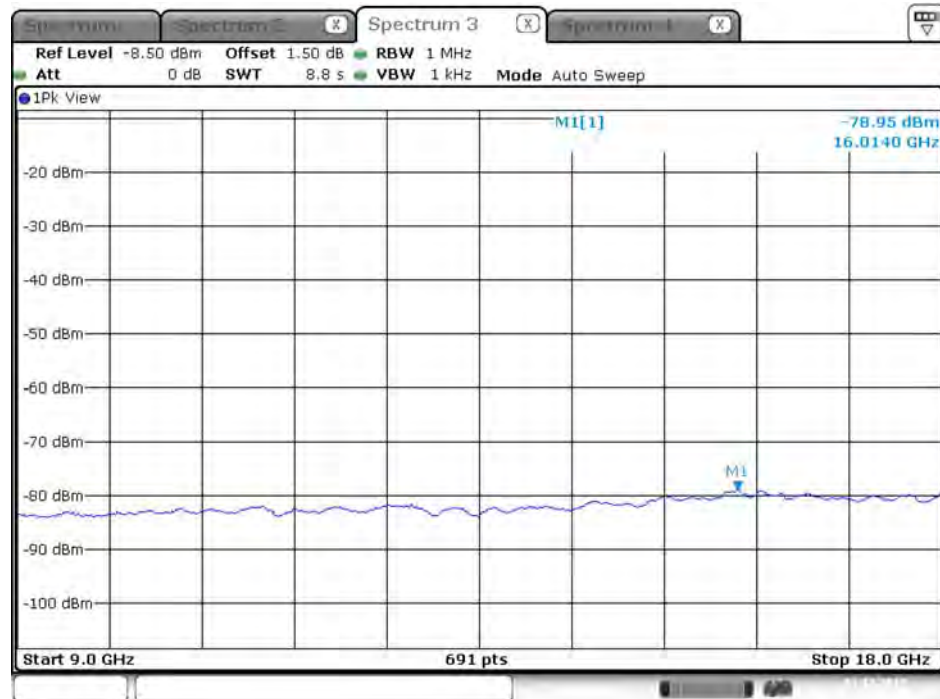


Date: 1.DEC.2017 22:01:41

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 2 / 9GHz~18GHz

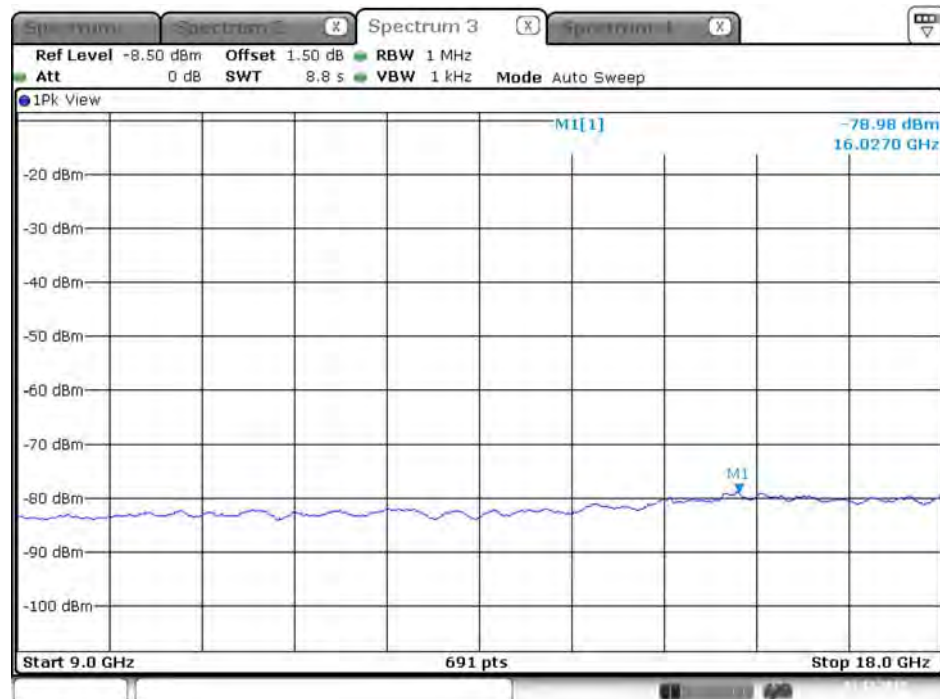


Date: 1.DEC.2017 22:12:14

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 1 / 9GHz~18GHz

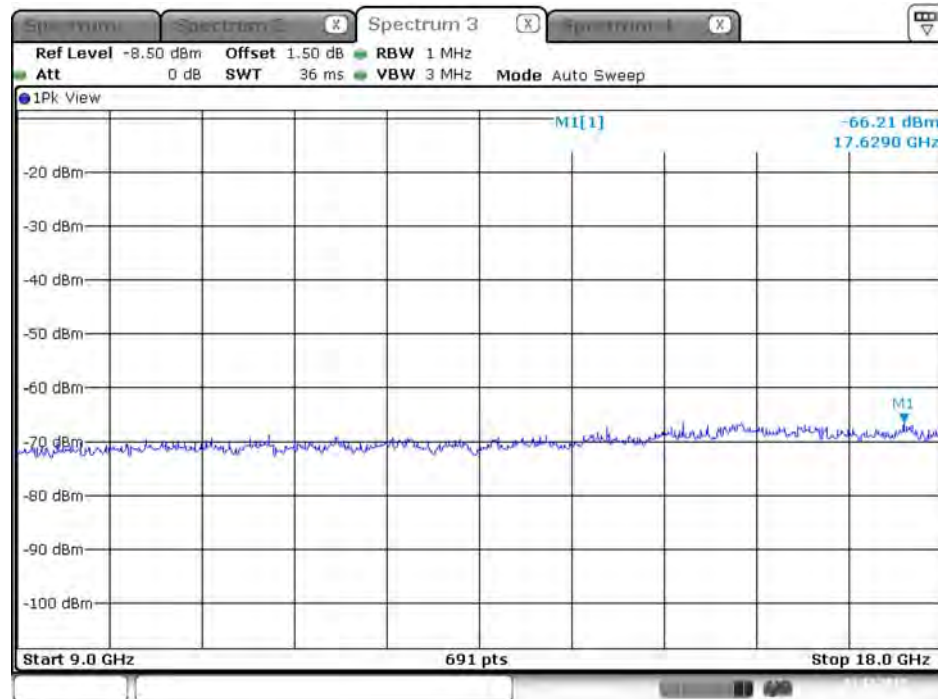


Date: 1 DEC. 2017 22:02:11

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 2 / 9GHz~18GHz

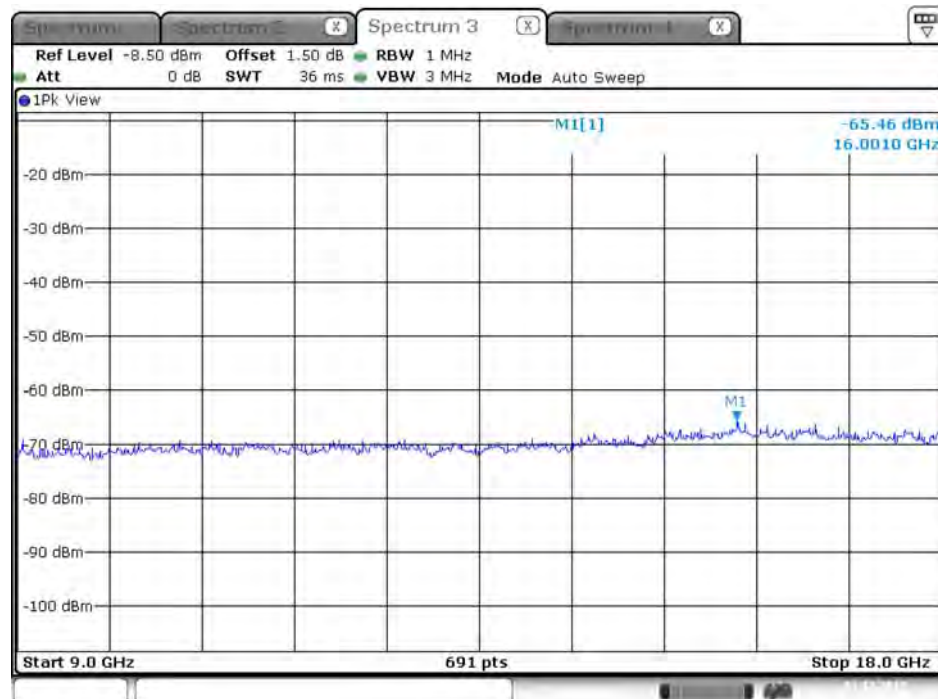


Date: 1 DEC. 2017 22:12:43

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 1 / 9GHz~18GHz

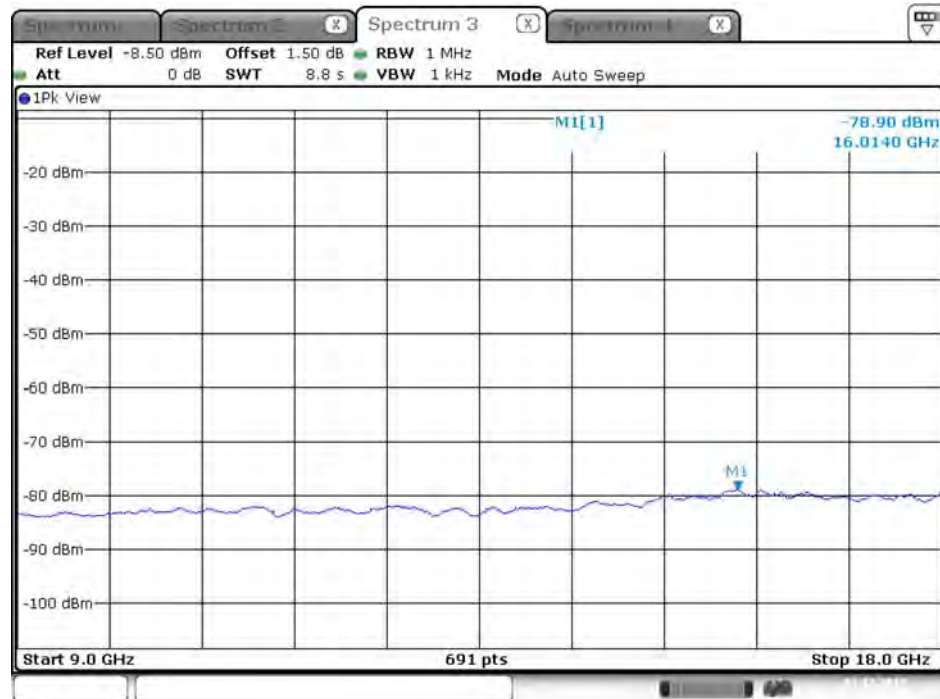


Date: 1.DEC.2017 22:35:44

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 2 / 9GHz~18GHz

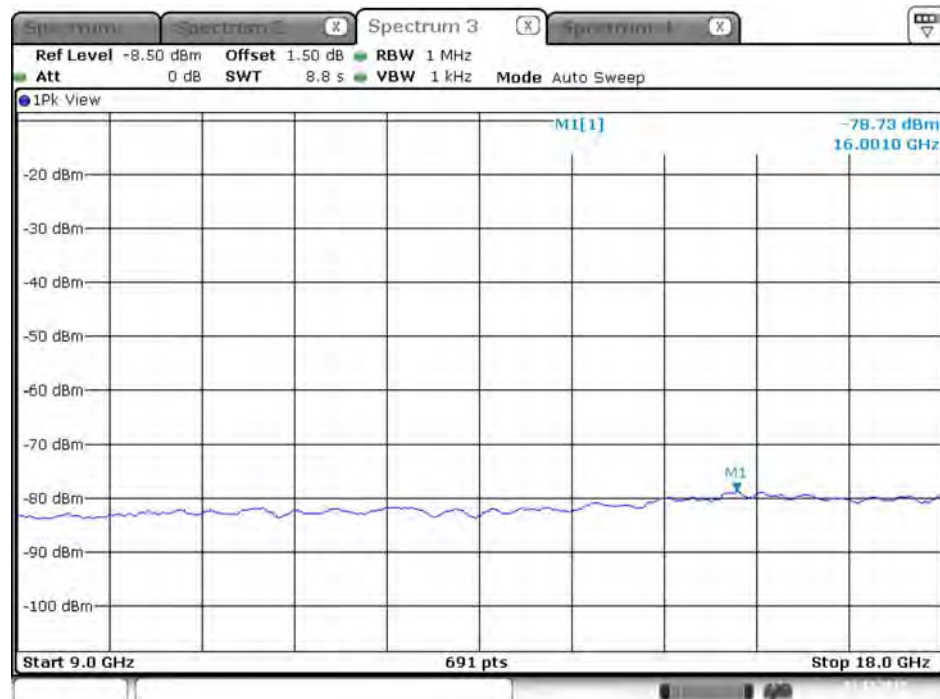


Date: 1.DEC.2017 22:53:32

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 1 / 9GHz~18GHz

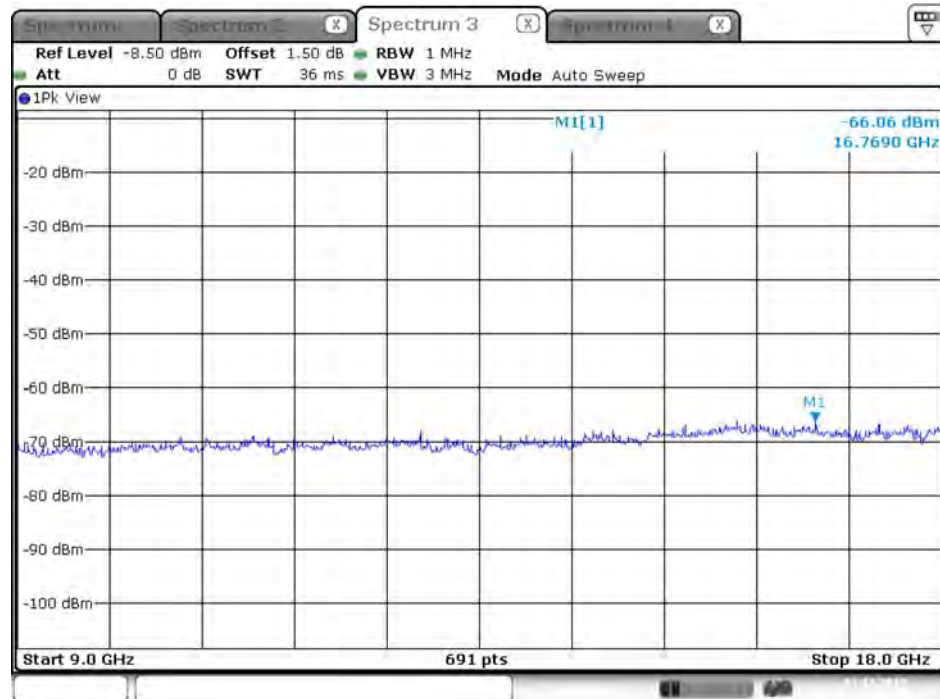


Date: 1.DEC.2017 22:38:15

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 2 / 9GHz~18GHz

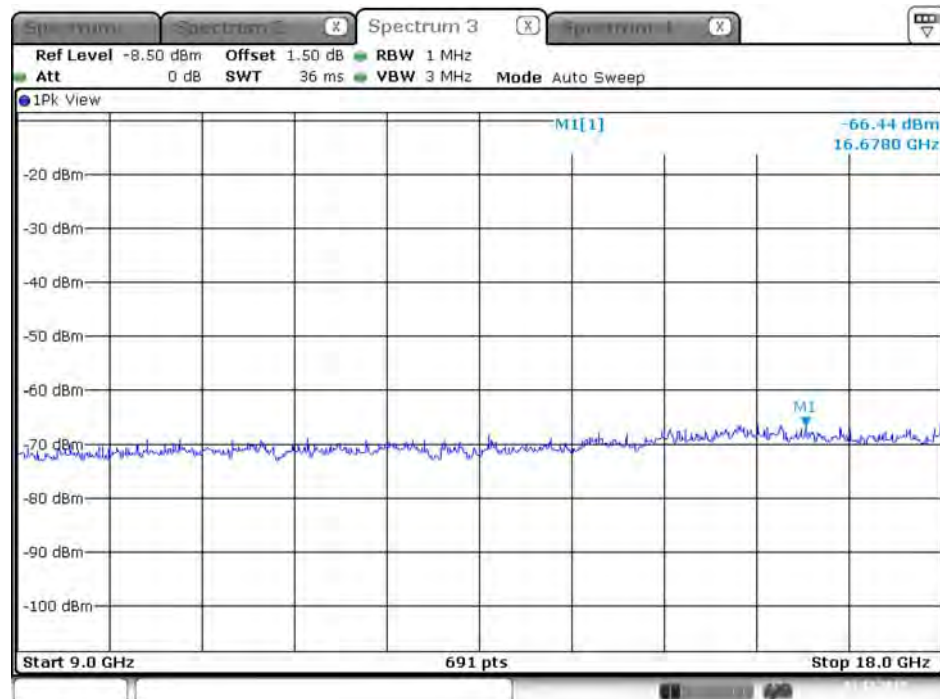


Date: 1.DEC.2017 22:54:03

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 1 / 9GHz~18GHz

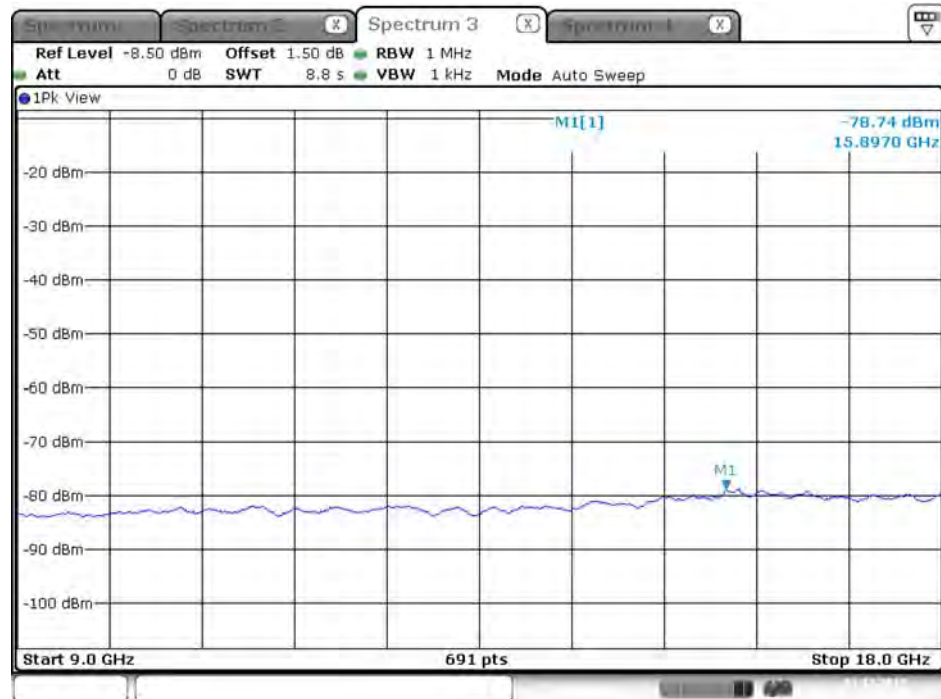


Date: 1.DEC.2017 23:11:16

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 2 / 9GHz~18GHz

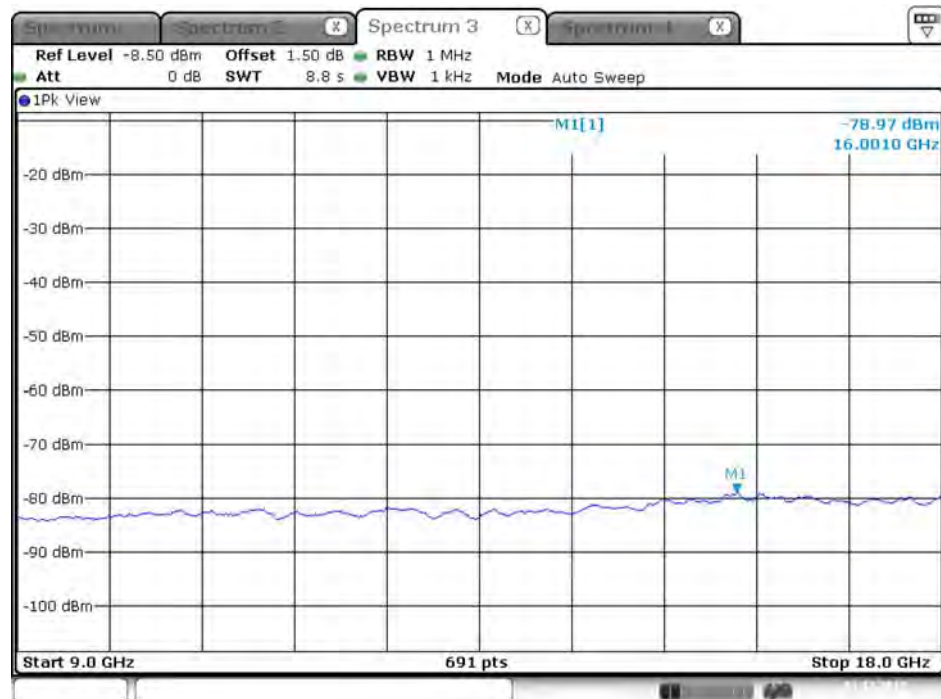


Date: 1.DEC.2017 23:19:59

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 1 / 9GHz~18GHz

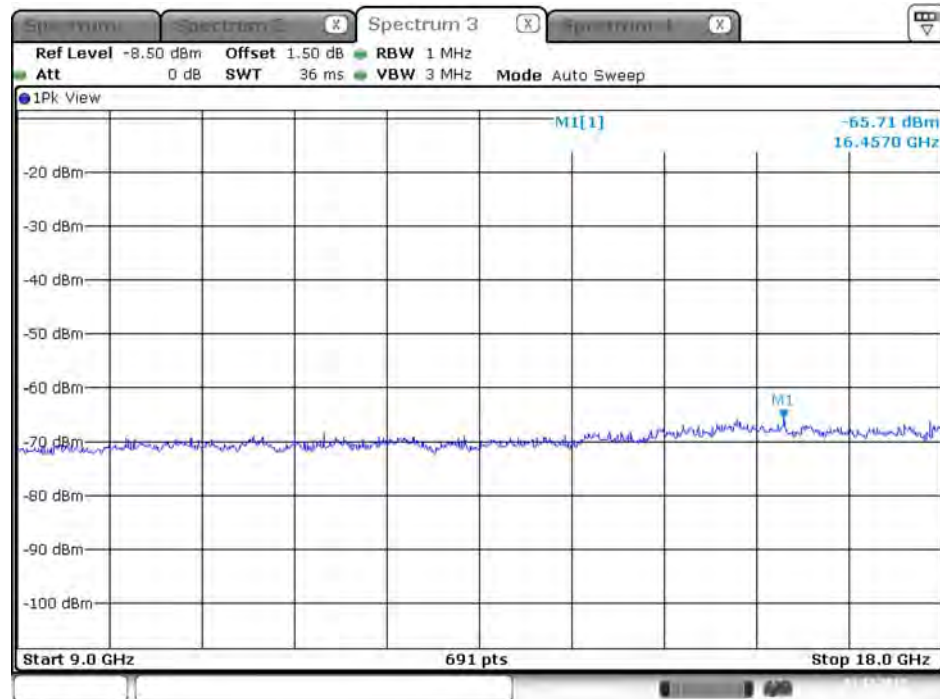


Date: 1.DEC.2017 23:11:56

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 2 / 9GHz~18GHz

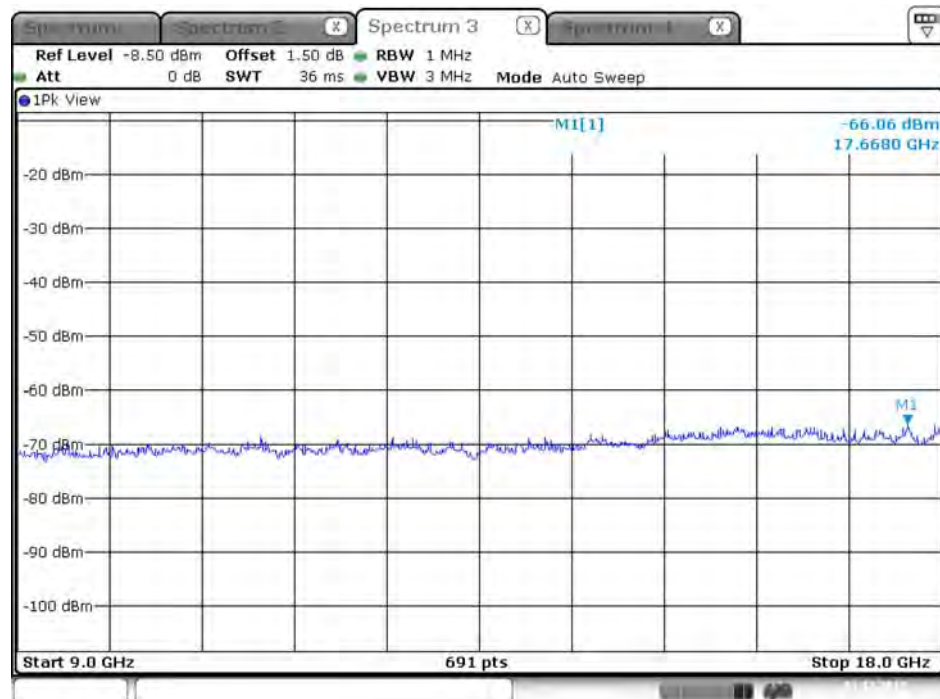


Date: 1.DEC.2017 23:20:38

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 1 / 9GHz~18GHz

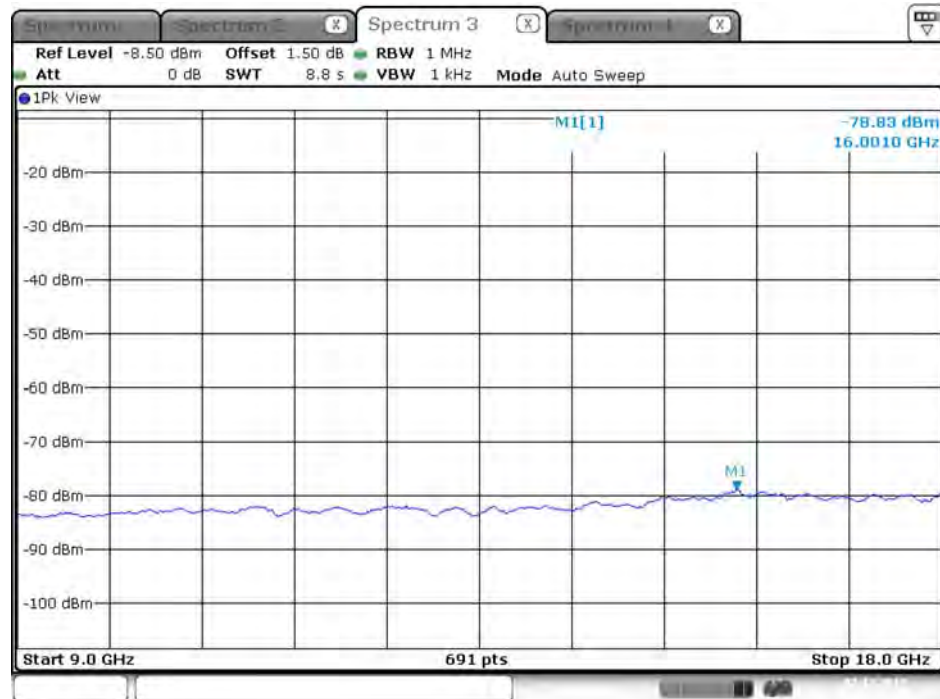


Date: 2.DEC.2017 00:38:46

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 2 / 9GHz~18GHz

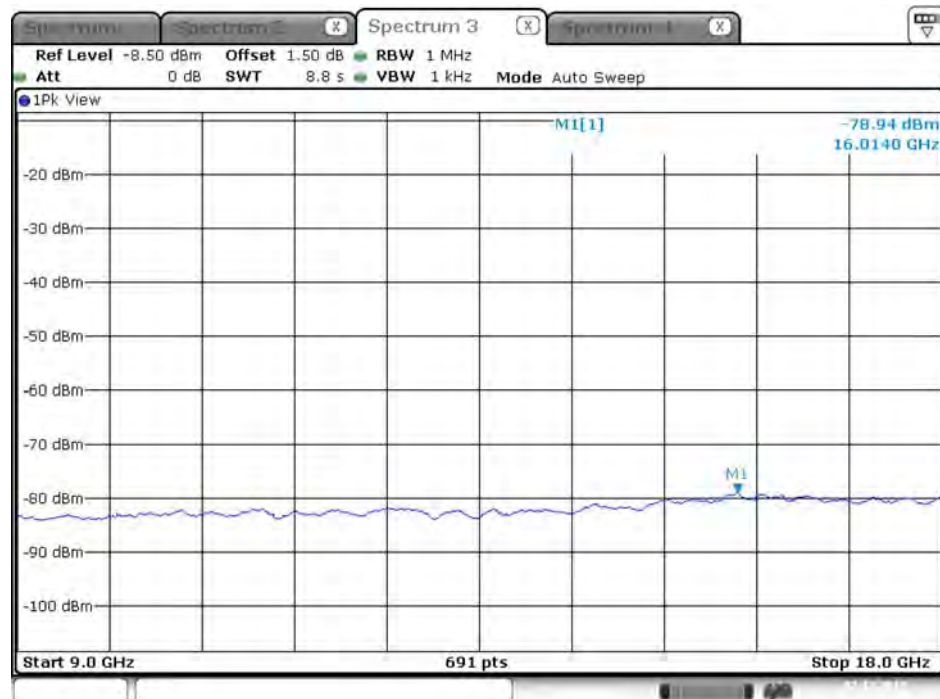


Date: 2.DEC.2017 00:58:44

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 1 / 9GHz~18GHz

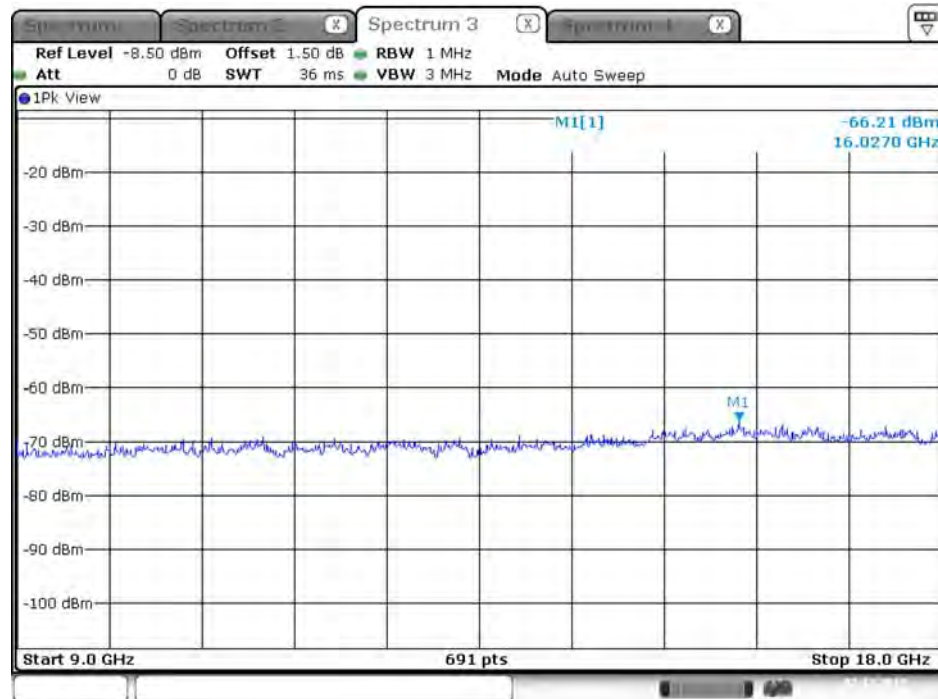


Date: 2 DEC. 2017 00:39:17

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 2 / 9GHz~18GHz

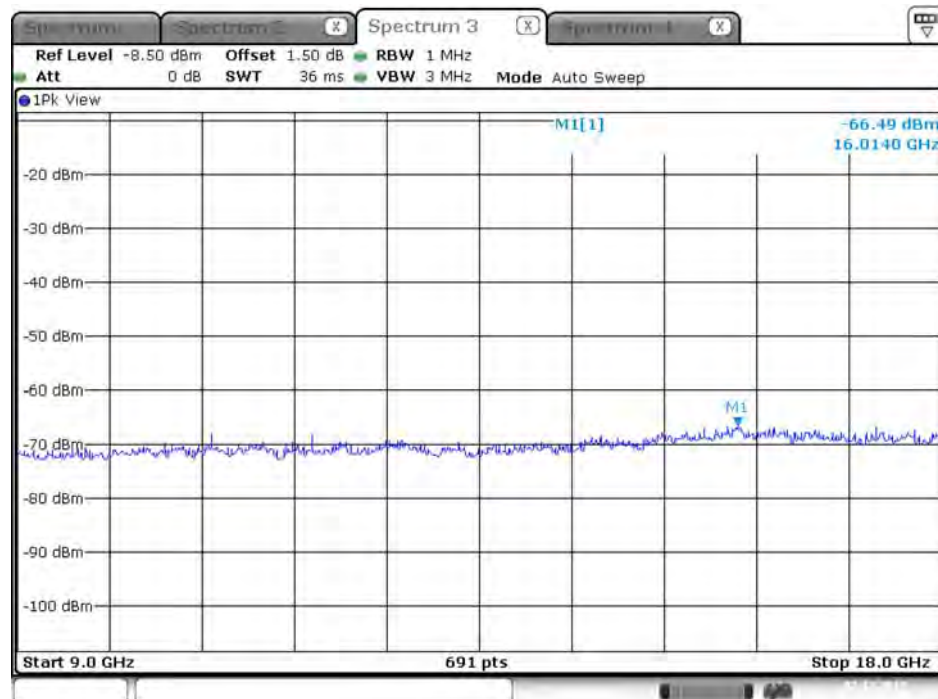


Date: 2 DEC. 2017 00:59:32

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 1 / 18GHz~40GHz

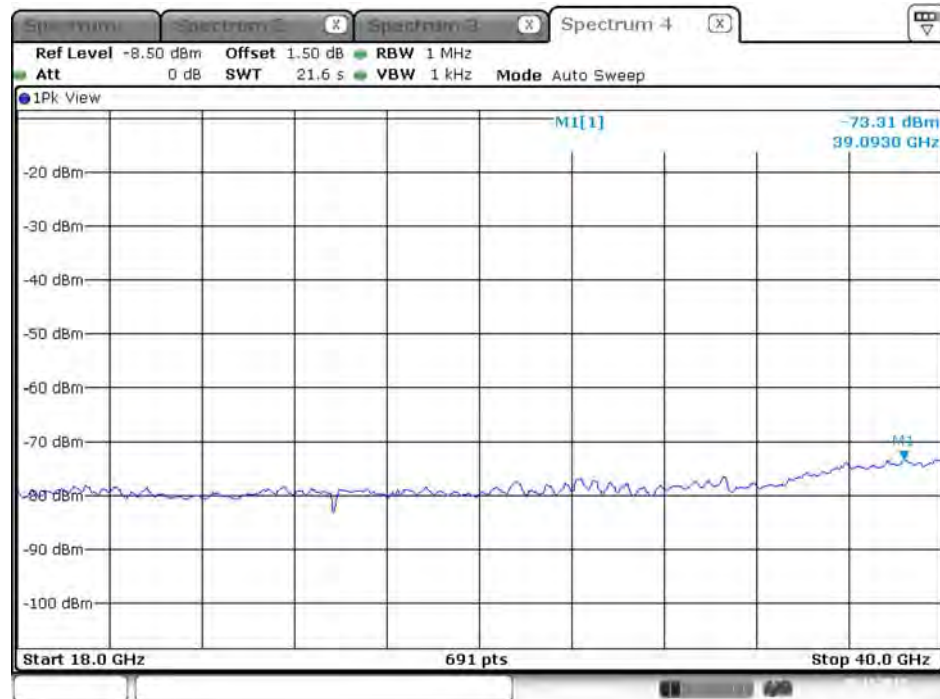


Date: 28.NOV.2017 00:34:47

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 2 / 18GHz~40GHz

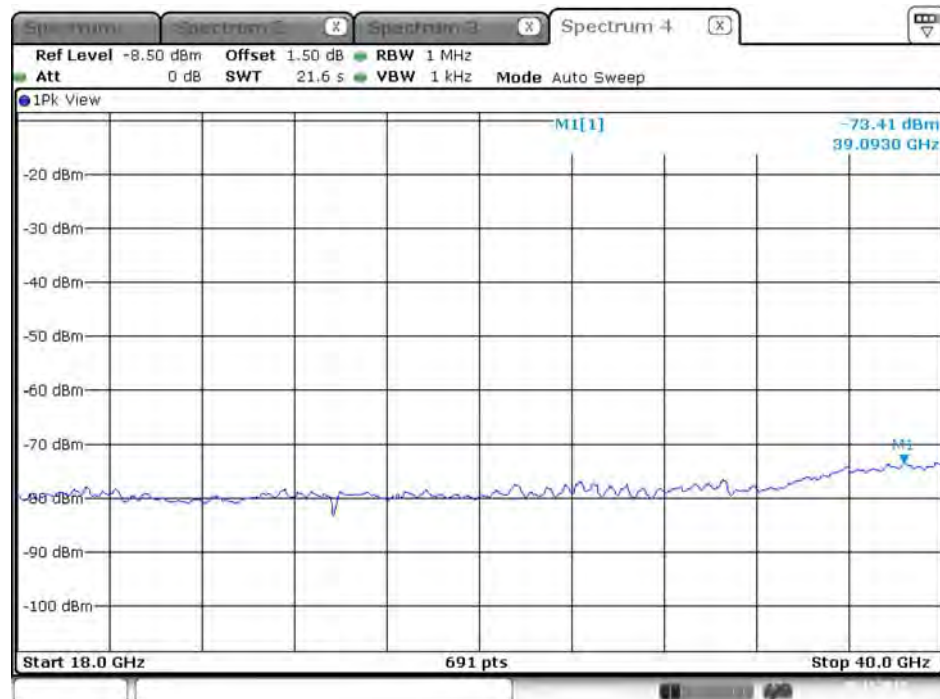


Date: 28.NOV.2017 00:43:06

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 1 / 18GHz~40GHz

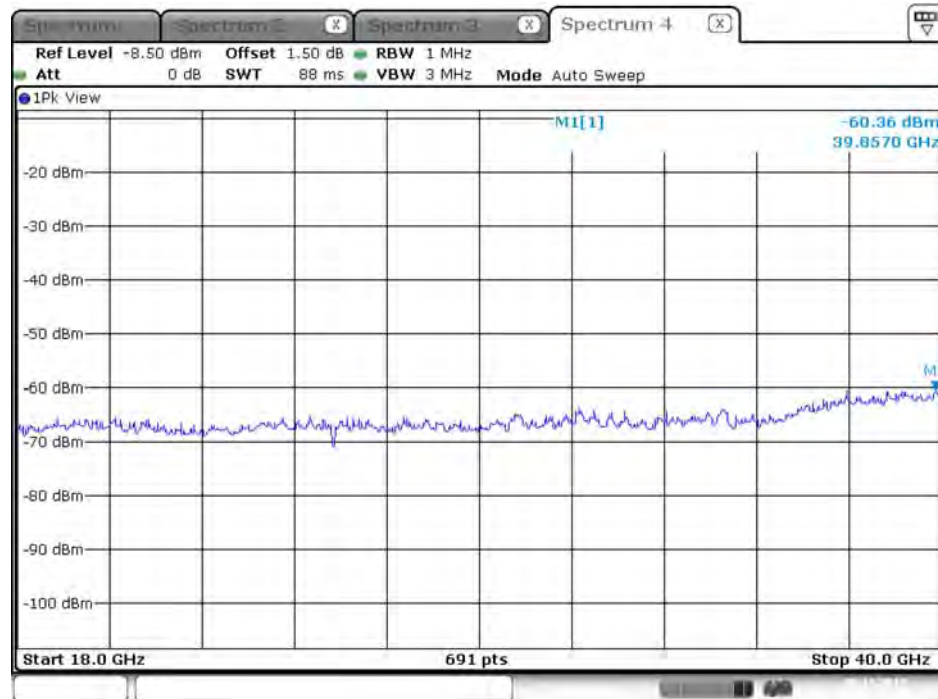


Date: 28.NOV.2017 00:35:22

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 2 / 18GHz~40GHz

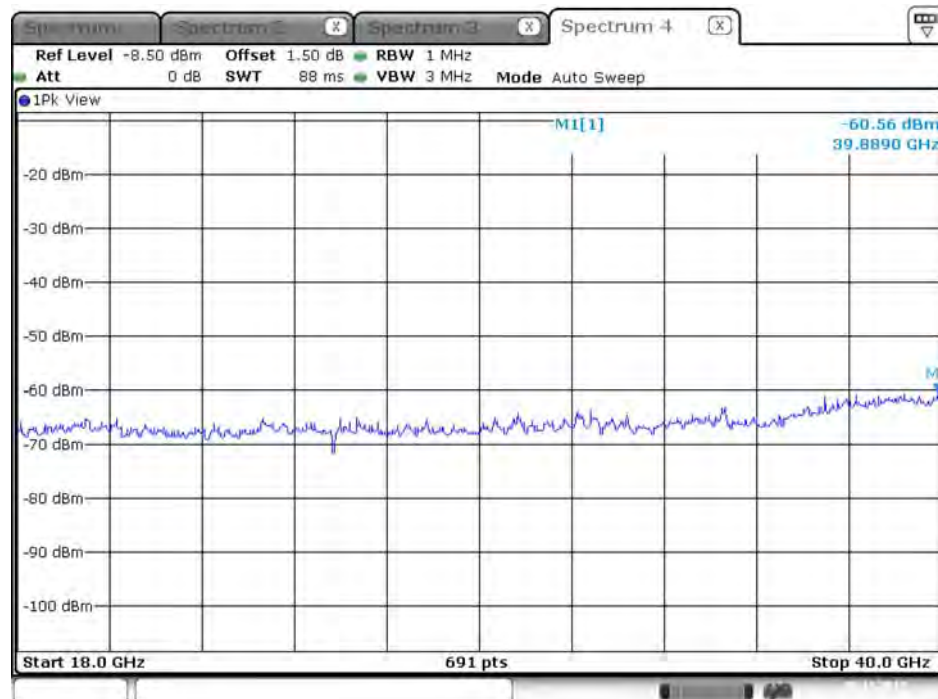


Date: 28.NOV.2017 00:44:14

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 1 / 18GHz~40GHz

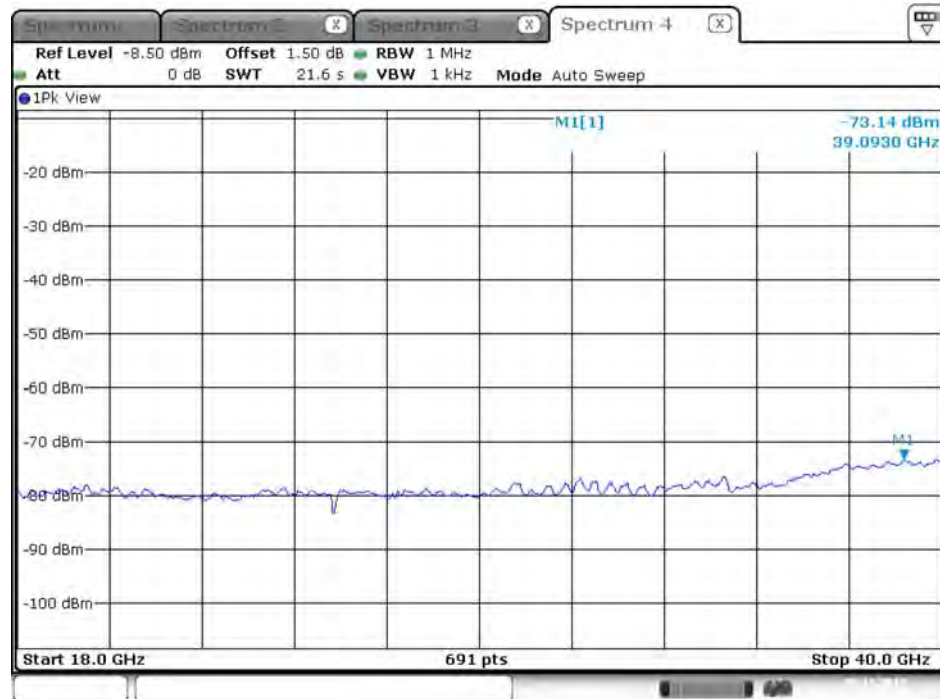


Date: 28.NOV.2017 01:07:30

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 2 / 18GHz~40GHz

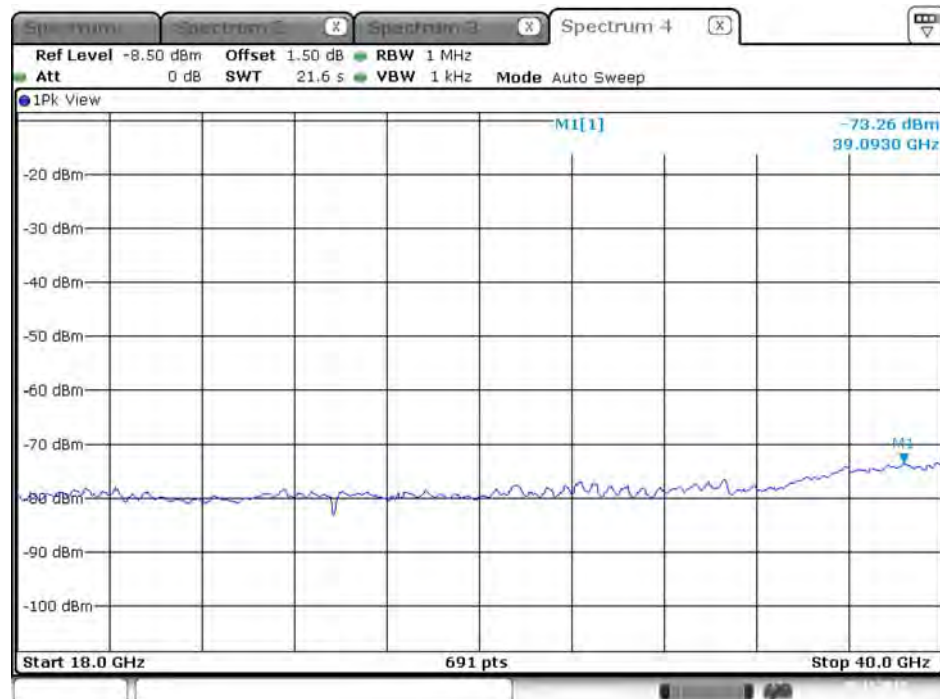


Date: 28.NOV.2017 01:10:35

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 1 / 18GHz~40GHz

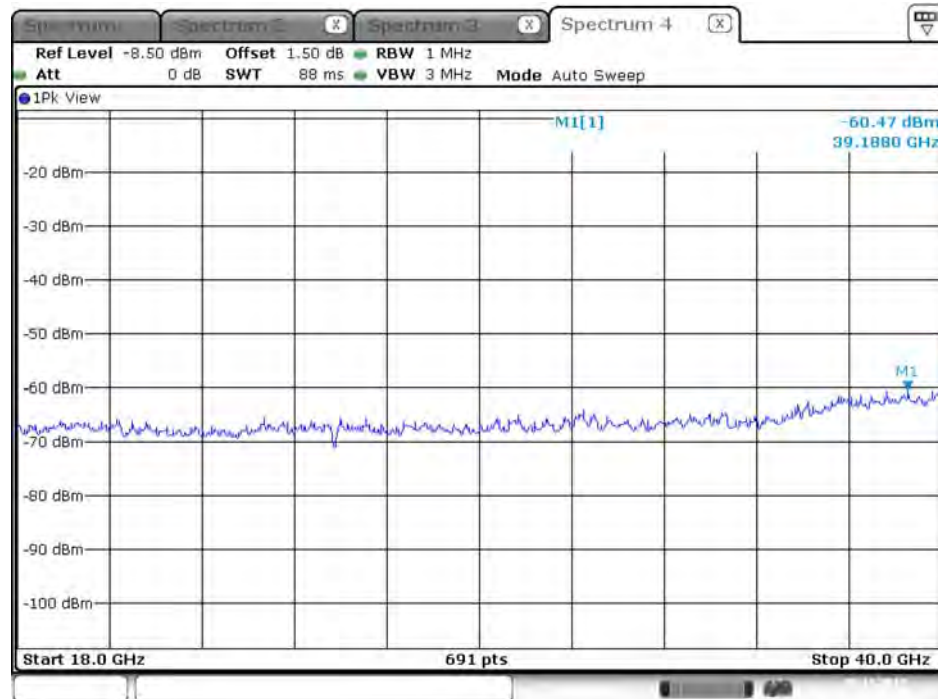


Date: 28.NOV.2017 01:08:13

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 2 / 18GHz~40GHz

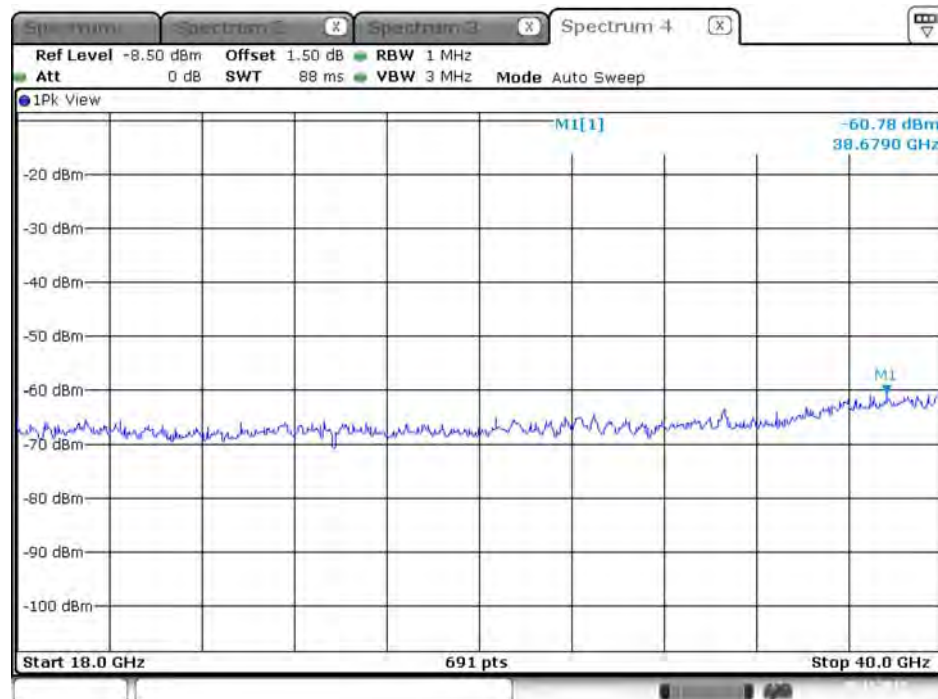


Date: 28.NOV.2017 01:11:19

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 1 / 18GHz~40GHz

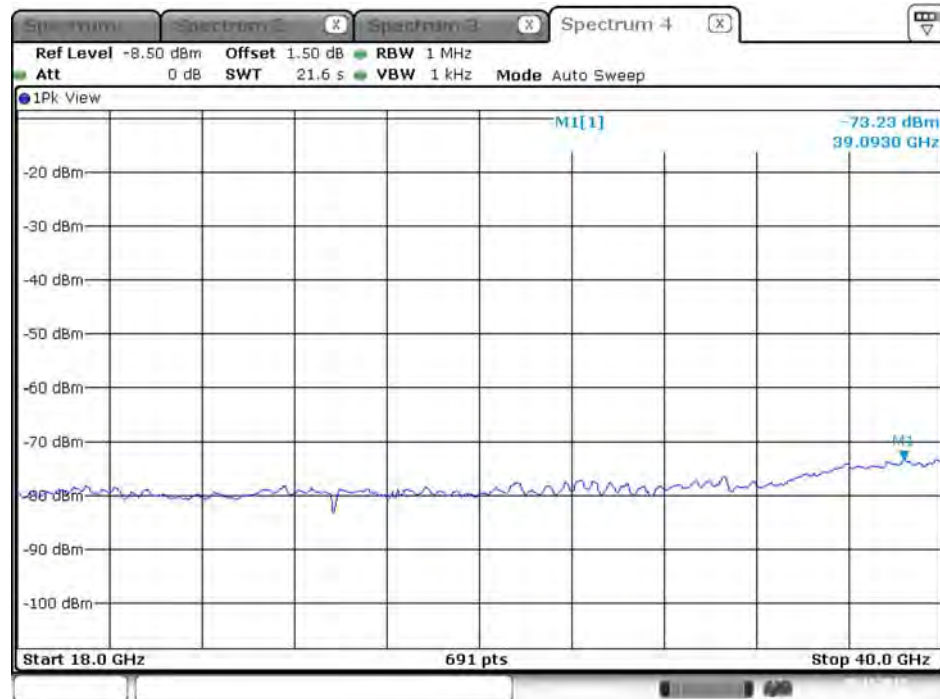


Date: 28 NOV. 2017 01:29:09

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 2 / 18GHz~40GHz

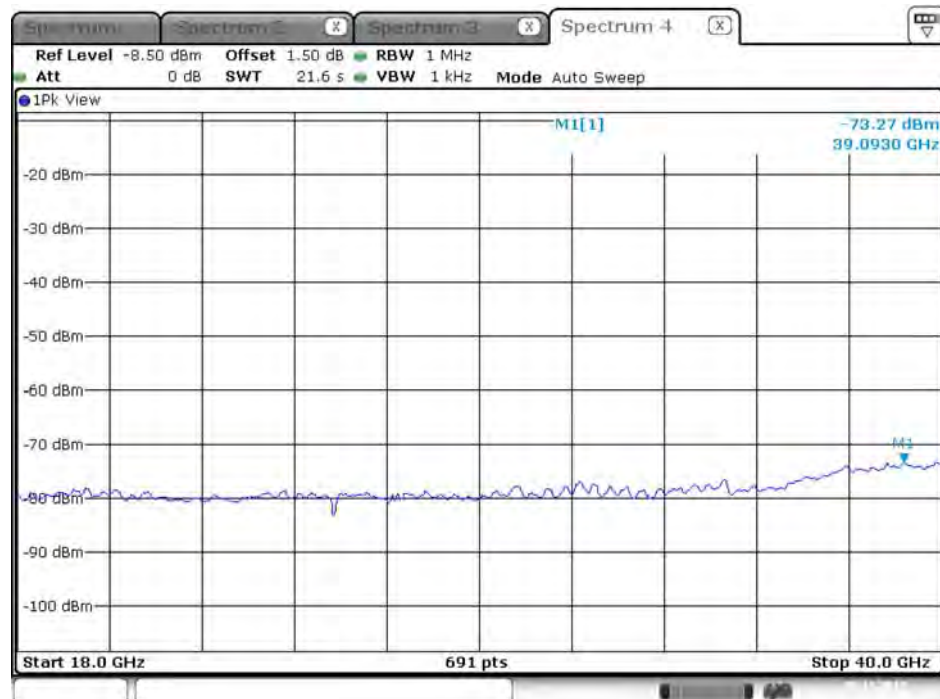


Date: 28 NOV. 2017 01:32:33

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 1 / 18GHz~40GHz

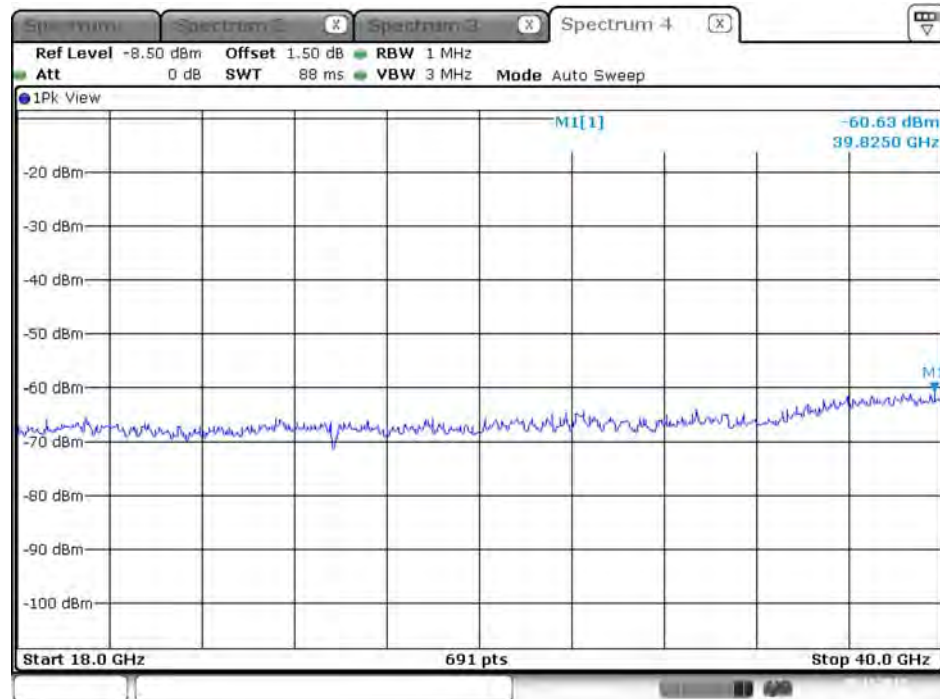


Date: 28.NOV.2017 01:30:08

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 2 / 18GHz~40GHz

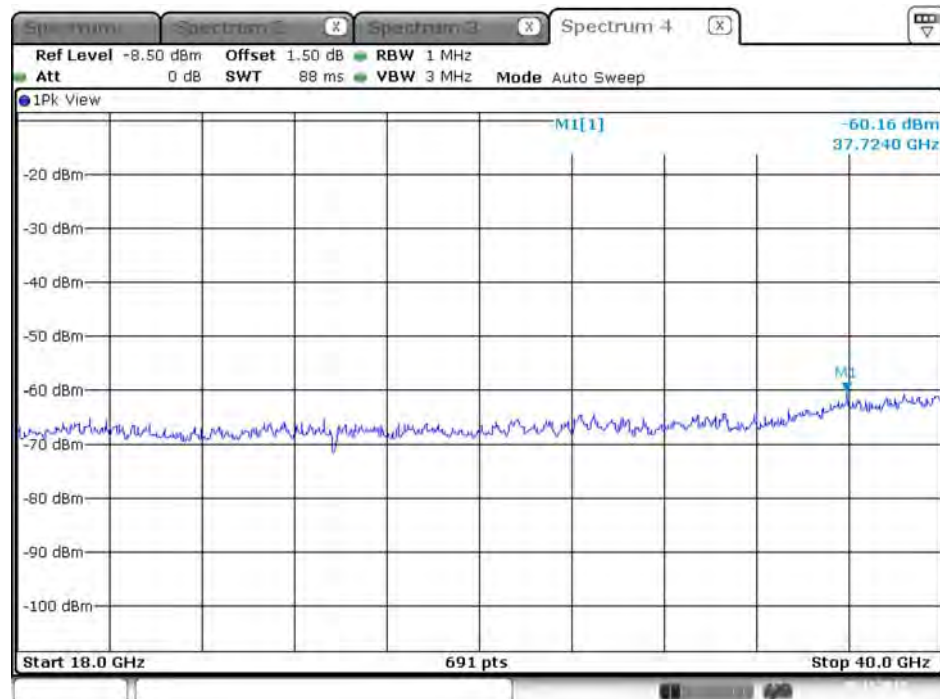


Date: 28.NOV.2017 01:33:01

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 1 / 18GHz~40GHz

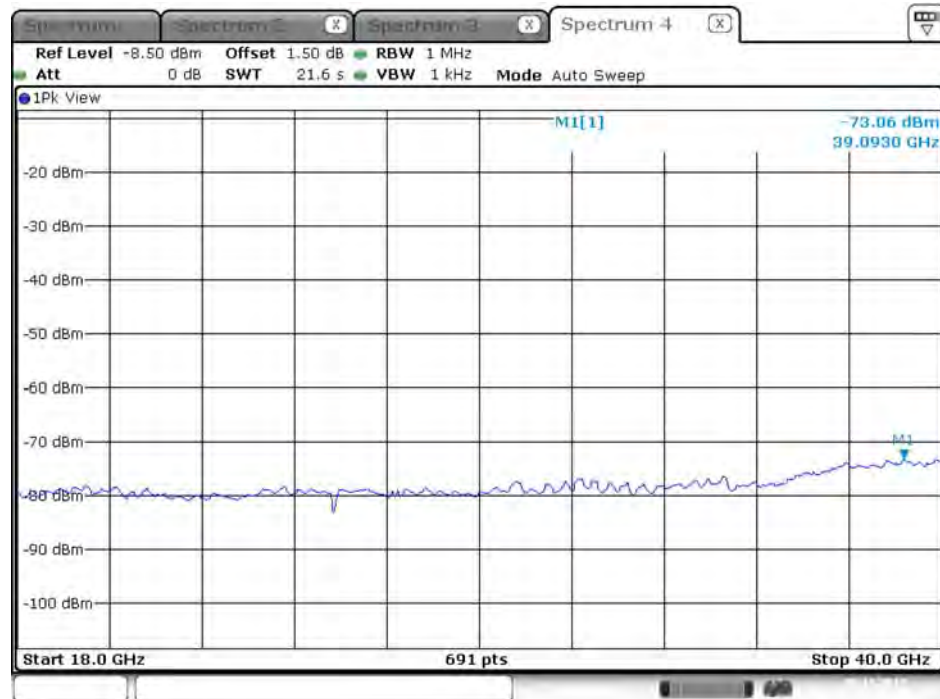


Date: 28.NOV.2017 02:36:50

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 2 / 18GHz~40GHz

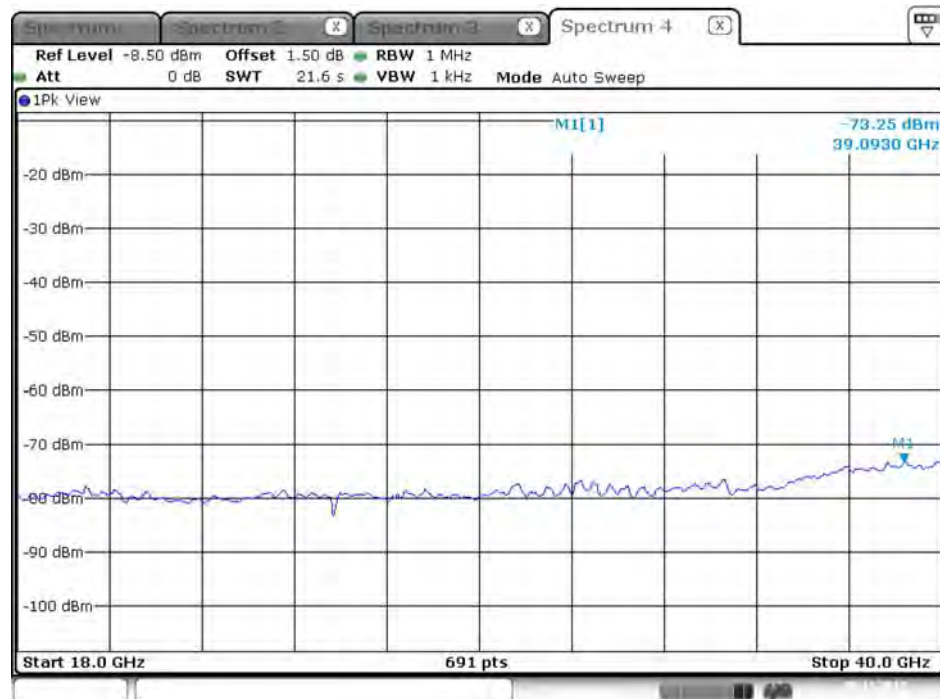


Date: 28.NOV.2017 02:39:28

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 1 / 18GHz~40GHz

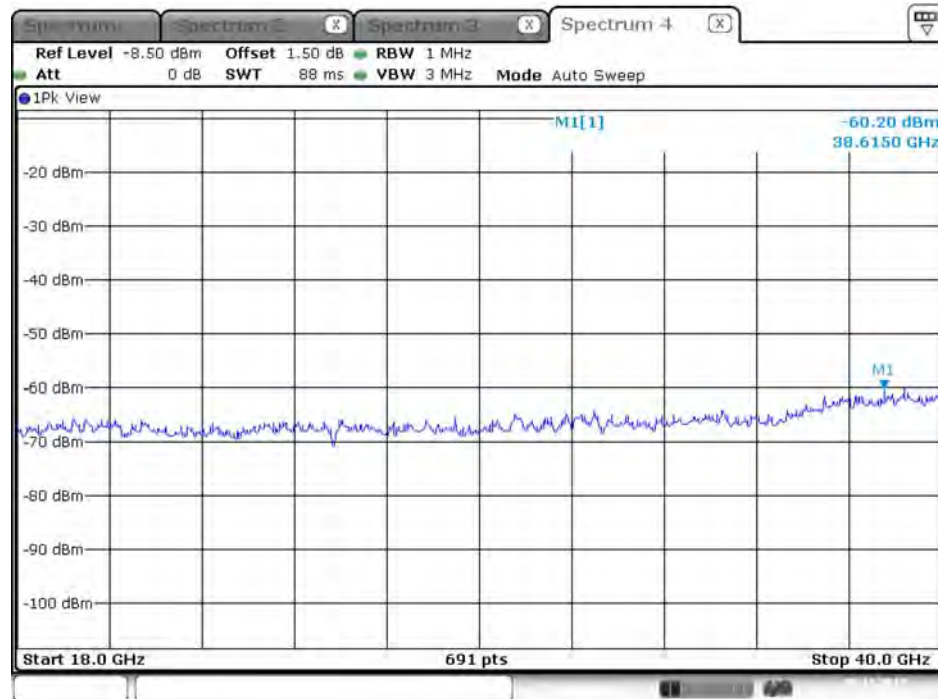


Date: 28.NOV.2017 02:37:12

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 2 / 18GHz~40GHz

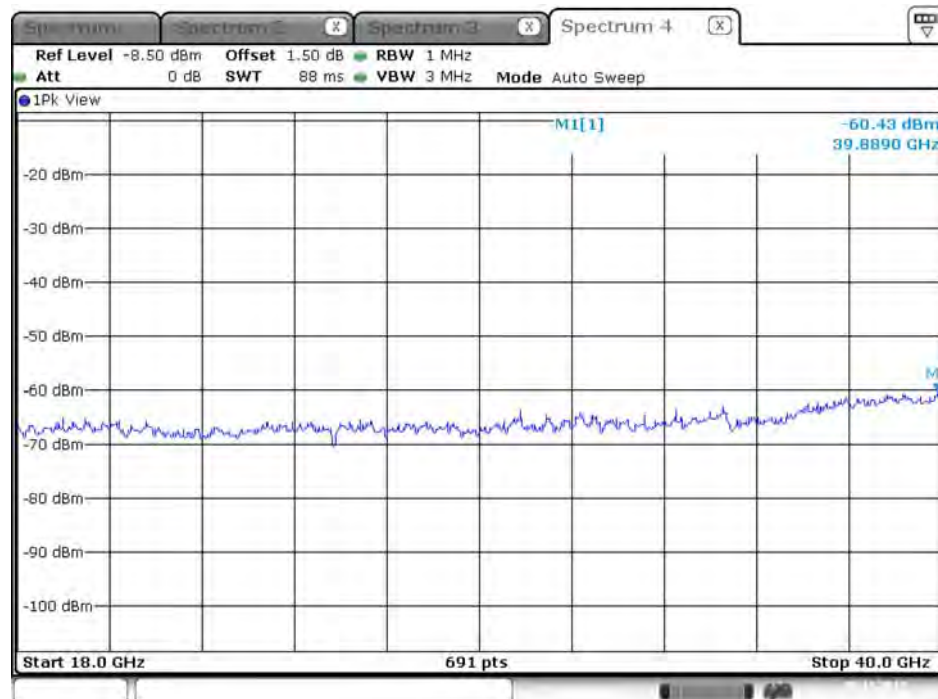


Date: 28.NOV.2017 02:40:06

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 1 / 18GHz~40GHz

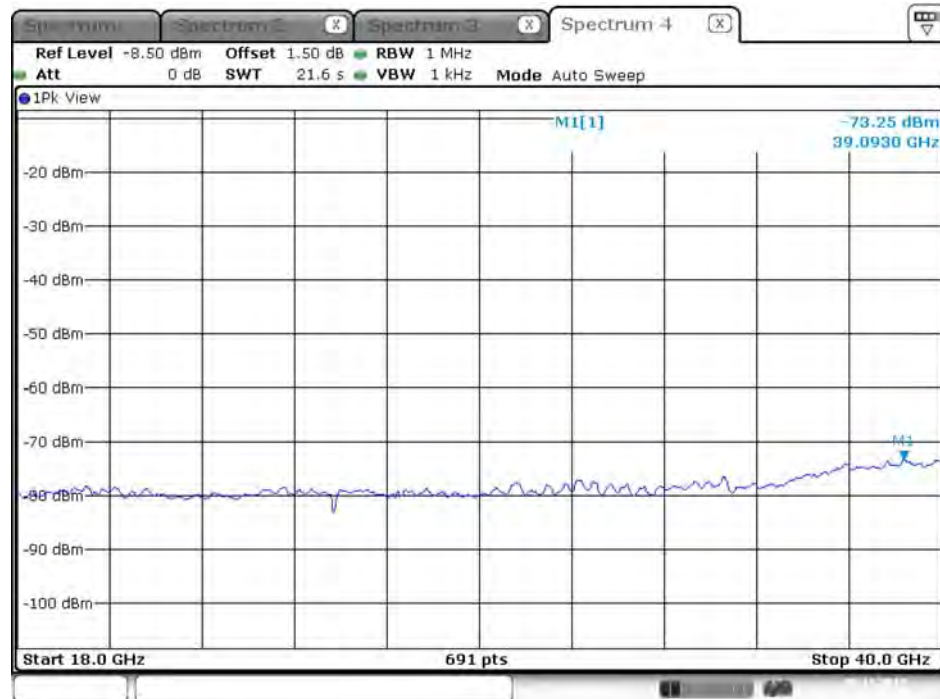


Date: 28.NOV.2017 01:51:39

### Plot on Configuration QPSK, 80M / 5290 MHz / Average / Port 2 / 18GHz~40GHz

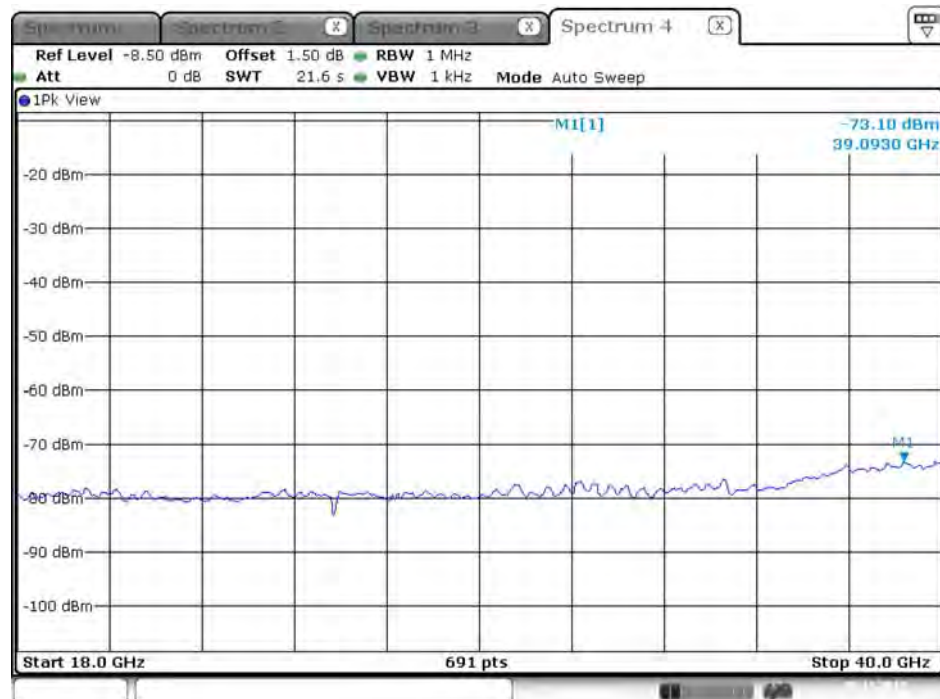


Date: 28.NOV.2017 01:55:13

### Plot on Configuration QPSK, 80M / 5290 MHz / Peak / Port 1 / 18GHz~40GHz

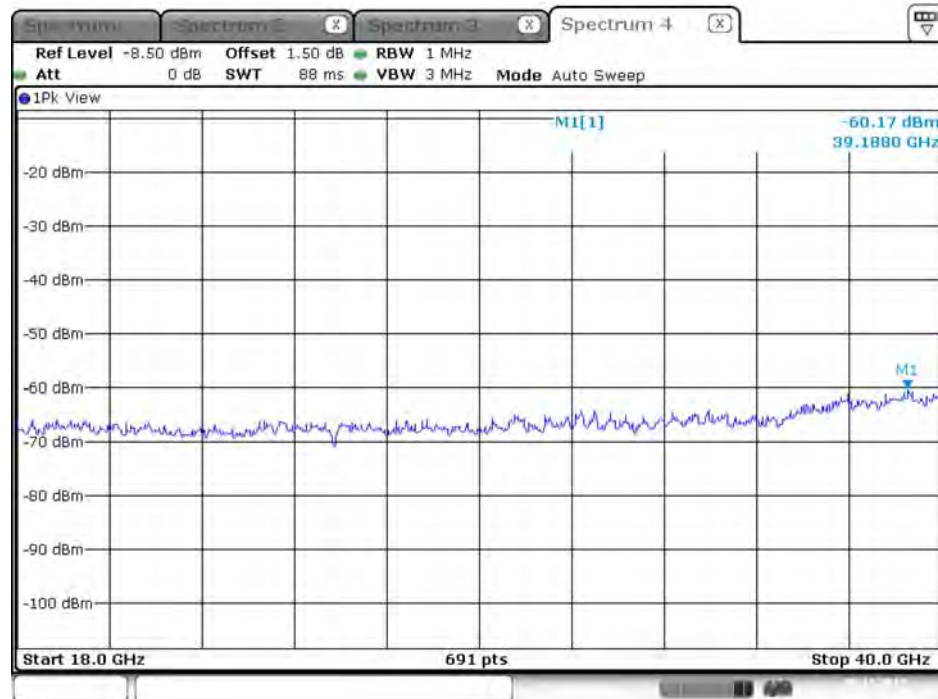


Date: 28 NOV 2017 01:52:24

### Plot on Configuration QPSK, 80M / 5290 MHz / Peak / Port 2 / 18GHz~40GHz

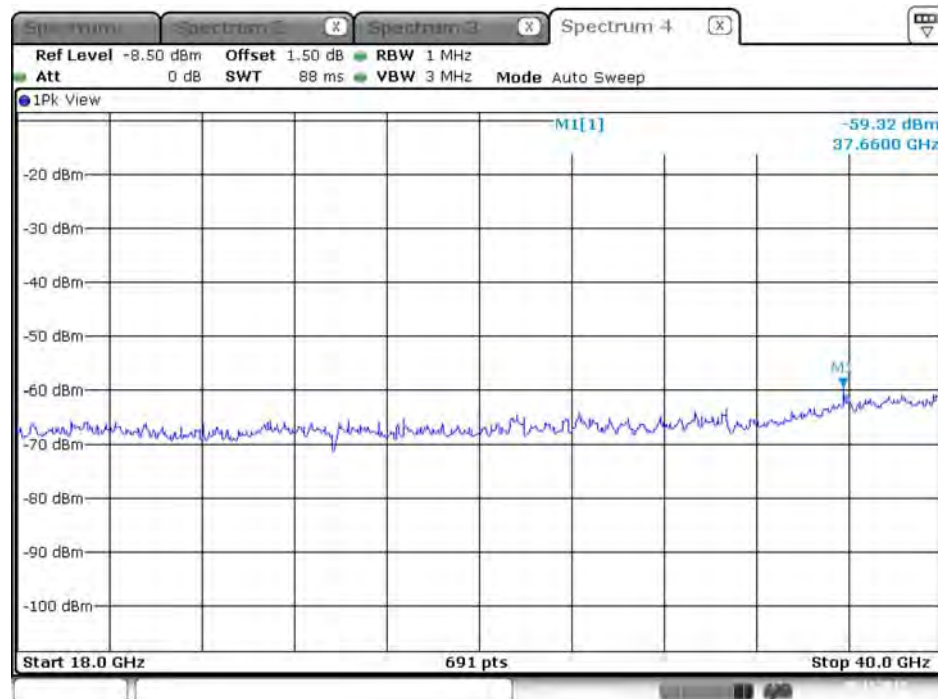


Date: 28 NOV 2017 01:55:58

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 1 / 18GHz~40GHz

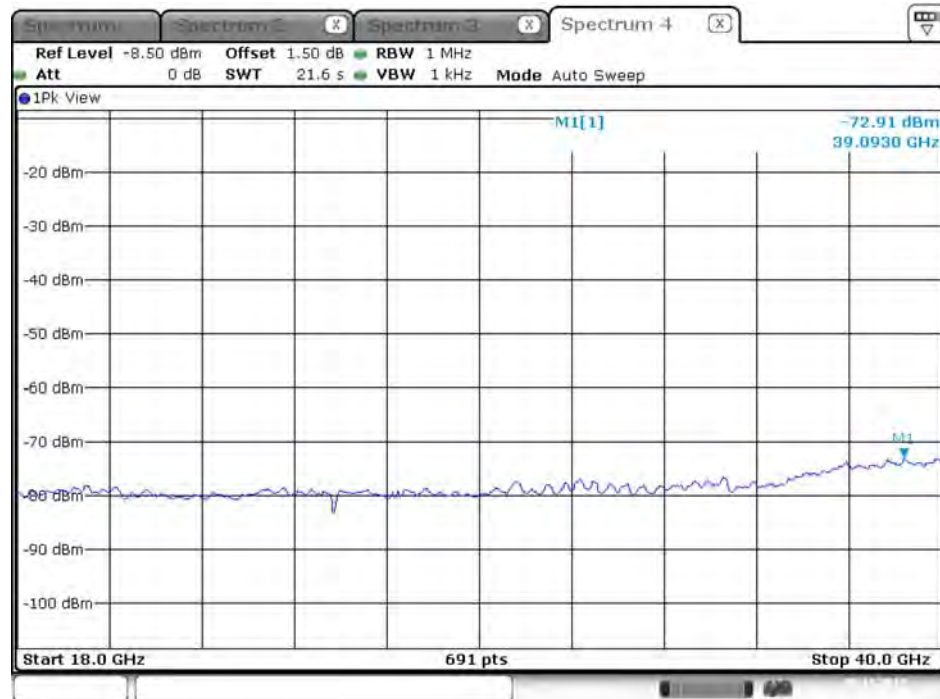


Date: 28 NOV 2017 02:15:48

### Plot on Configuration QPSK, 80M / 5300 MHz / Average / Port 2 / 18GHz~40GHz

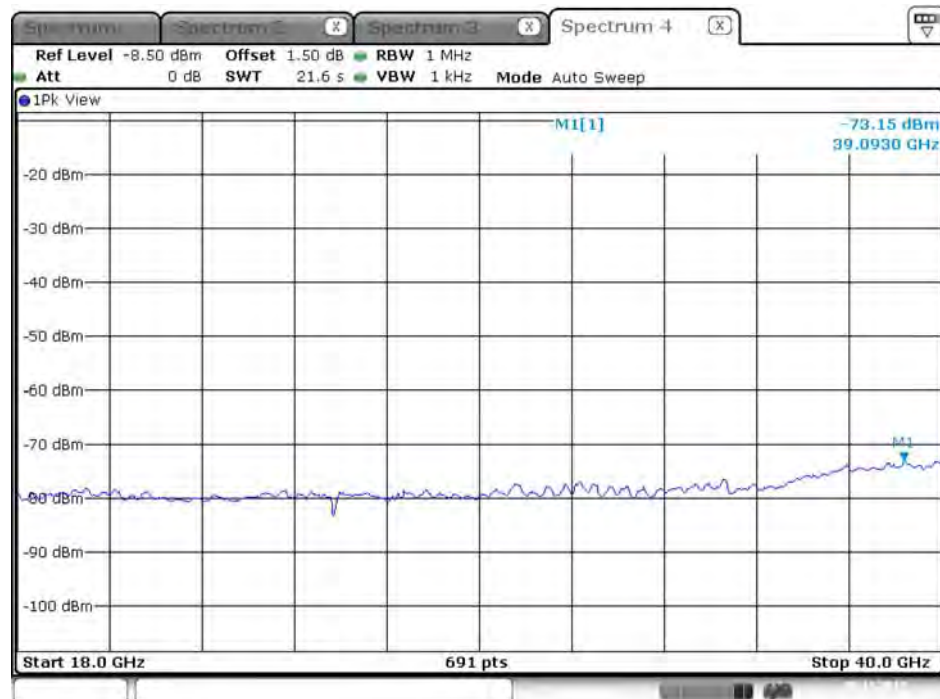


Date: 28 NOV 2017 02:18:24

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 1 / 18GHz~40GHz

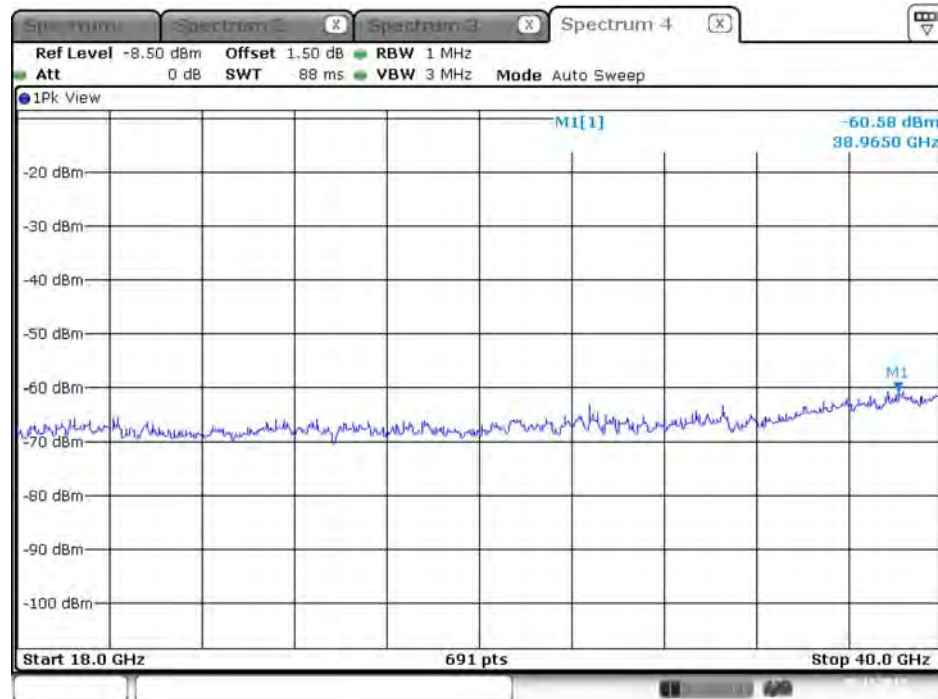


Date: 28 NOV 2017 02:16:09

### Plot on Configuration QPSK, 80M / 5300 MHz / Peak / Port 2 / 18GHz~40GHz

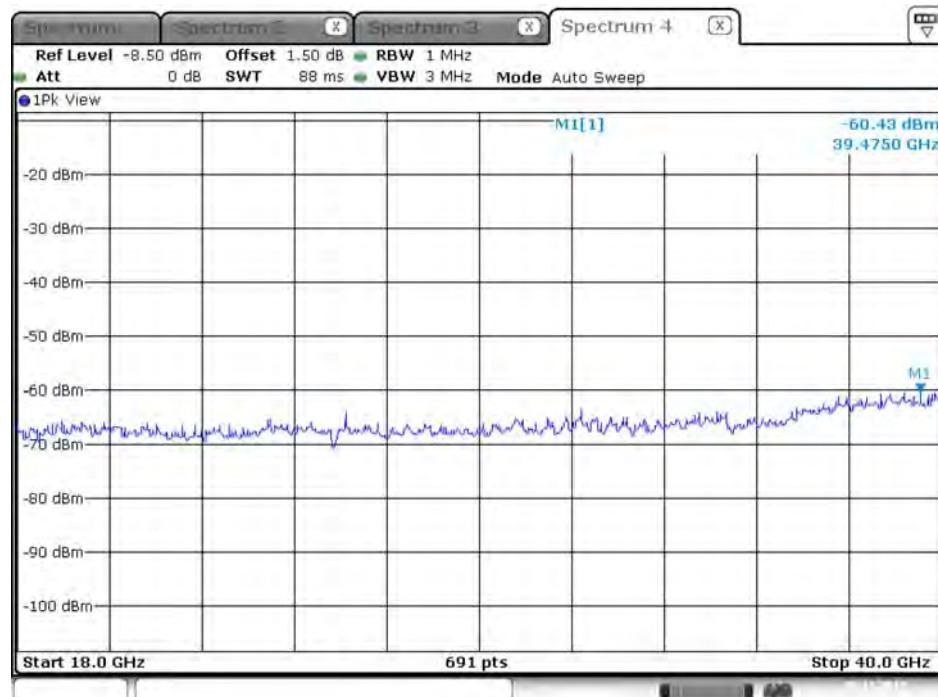


Date: 28 NOV 2017 02:19:14

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 1 / 18GHz~40GHz

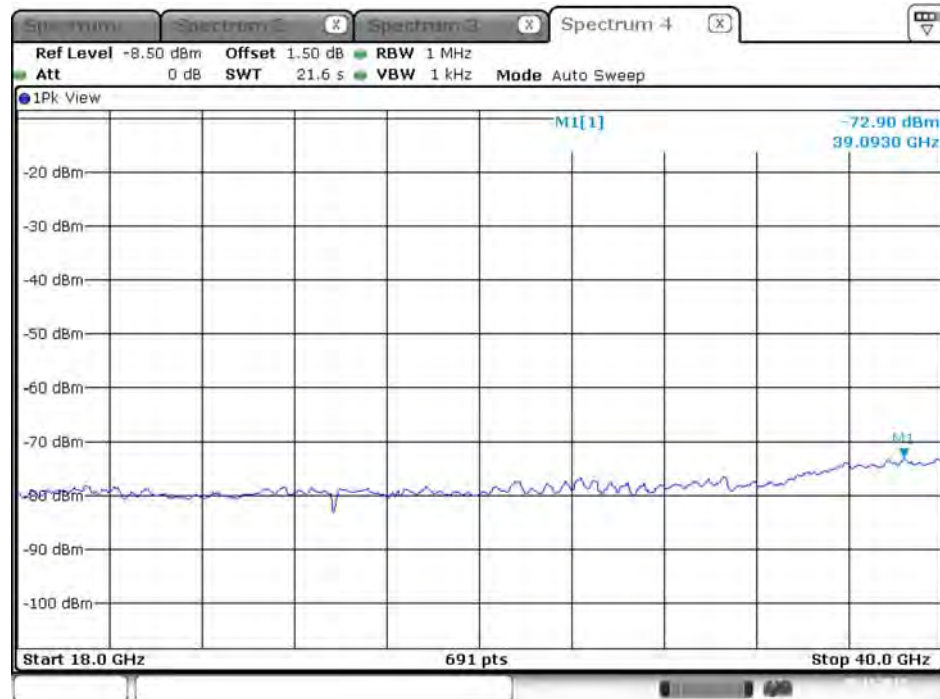


Date: 28 NOV 2017 02:59:04

### Plot on Configuration QPSK, 80M / 5250 MHz / Average / Port 2 / 18GHz~40GHz

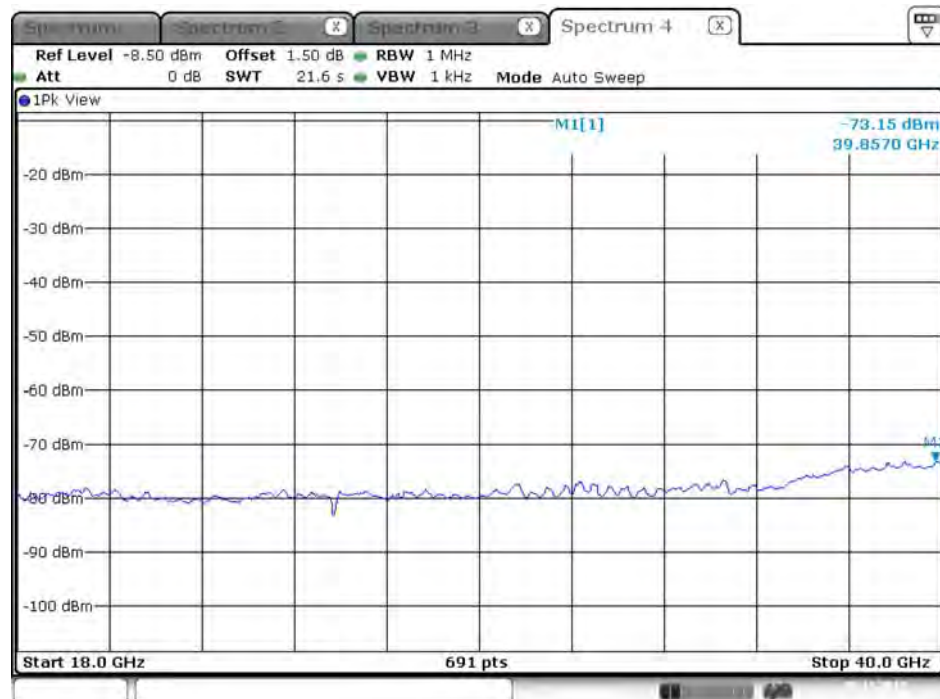


Date: 28 NOV 2017 03:01:33

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 1 / 18GHz~40GHz

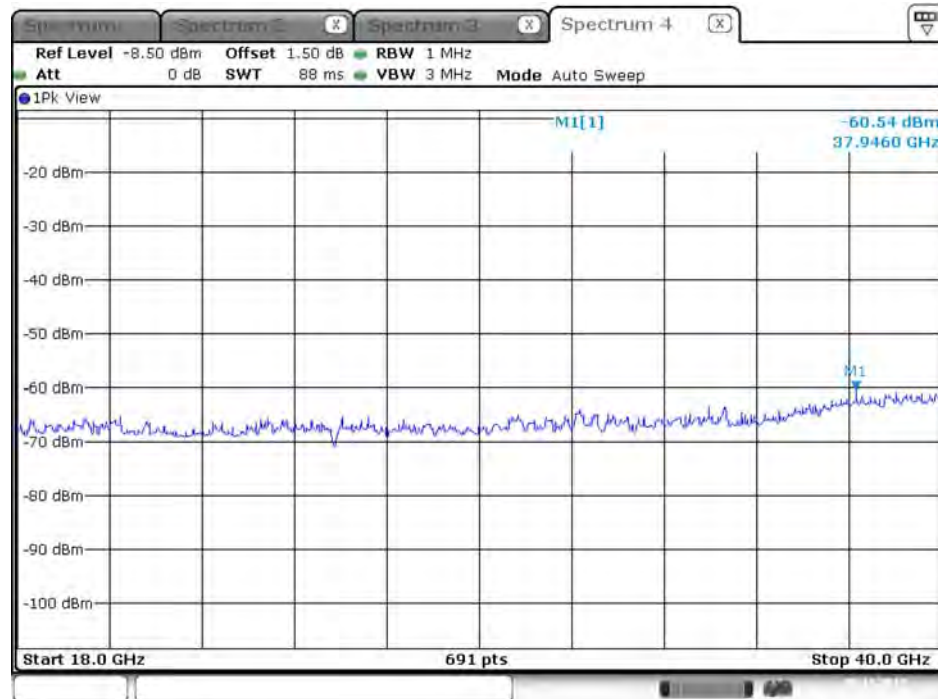


Date: 28 NOV 2017 02:59:42

### Plot on Configuration QPSK, 80M / 5250 MHz / Peak / Port 2 / 18GHz~40GHz

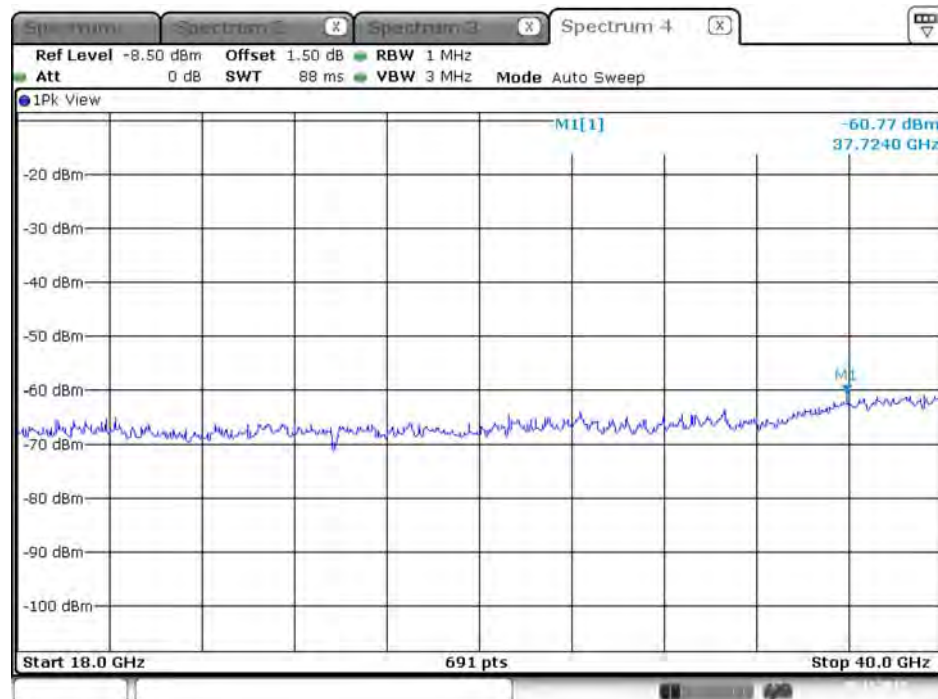


Date: 28 NOV 2017 03:02:22

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 1 / 18GHz~40GHz

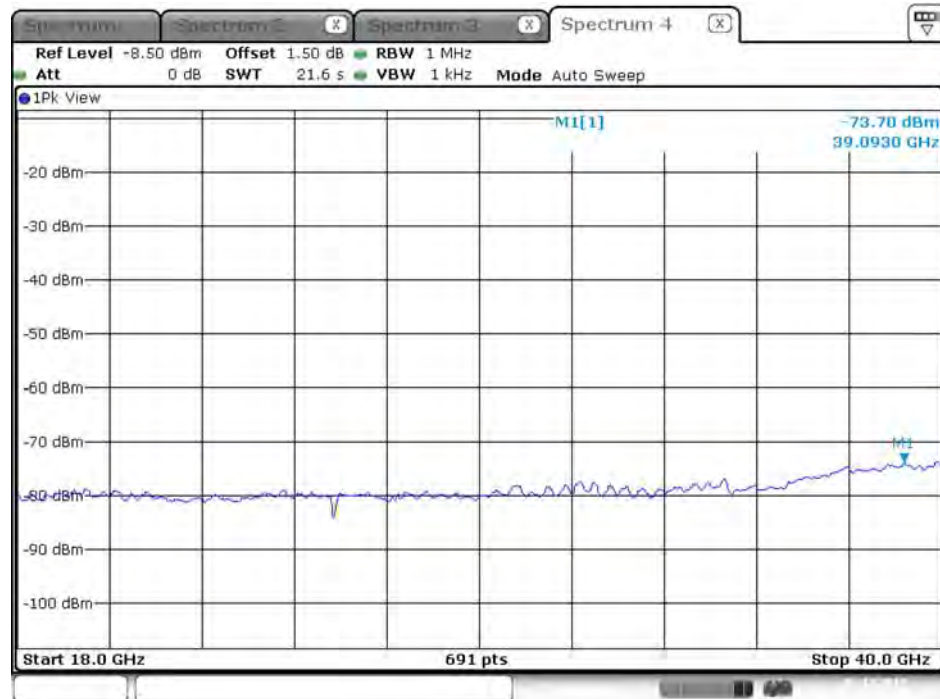


Date: 1.DEC.2017 19:45:28

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 2 / 18GHz~40GHz

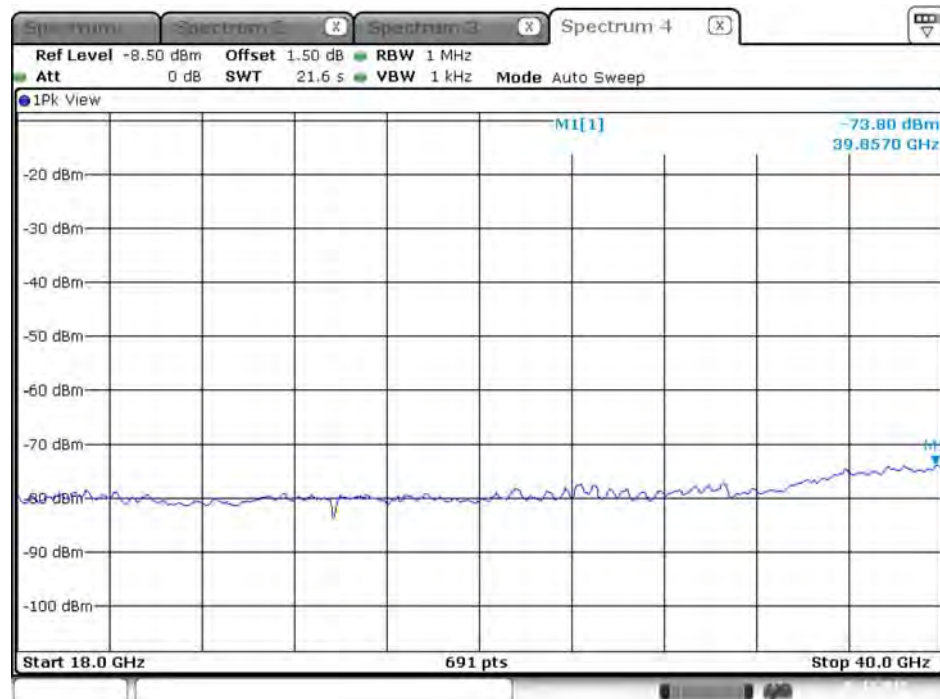


Date: 1.DEC.2017 19:49:23

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 1 / 18GHz~40GHz

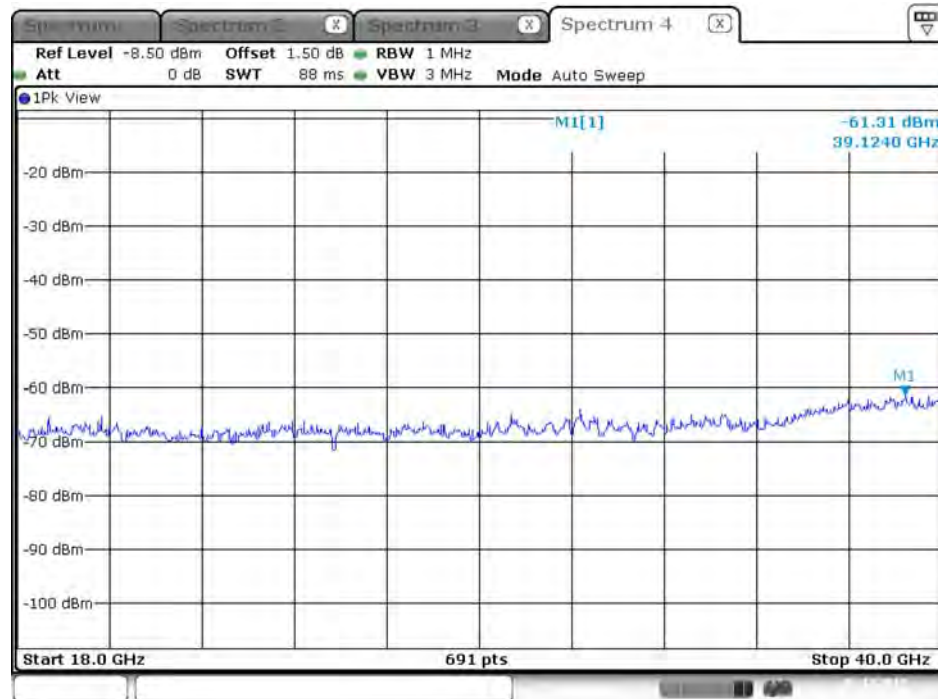


Date: 1.DEC.2017 19:46:02

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 2 / 18GHz~40GHz

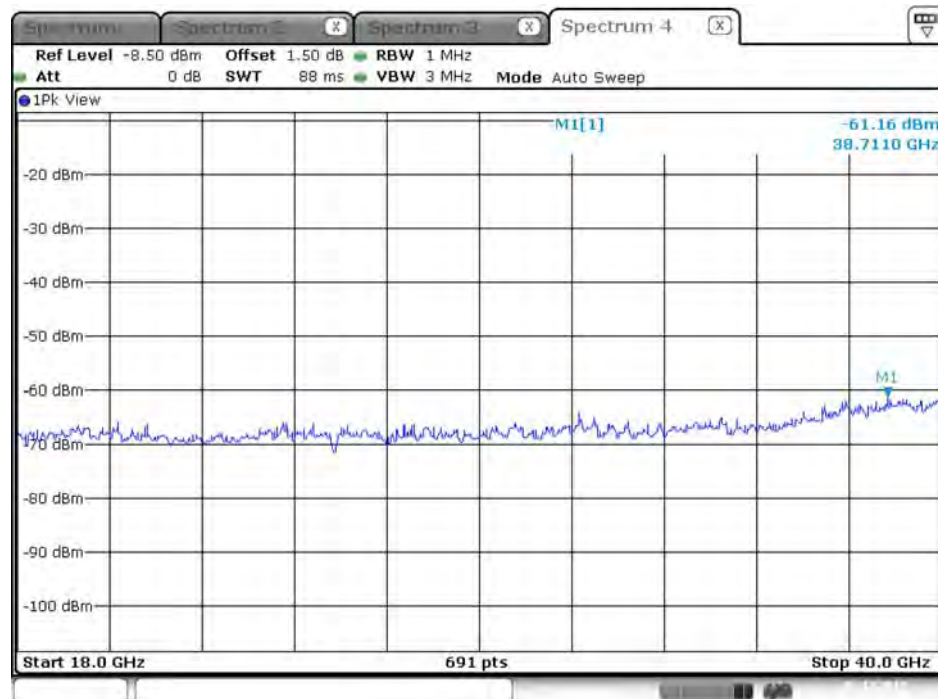


Date: 1.DEC.2017 19:50:27

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 1 / 18GHz~40GHz

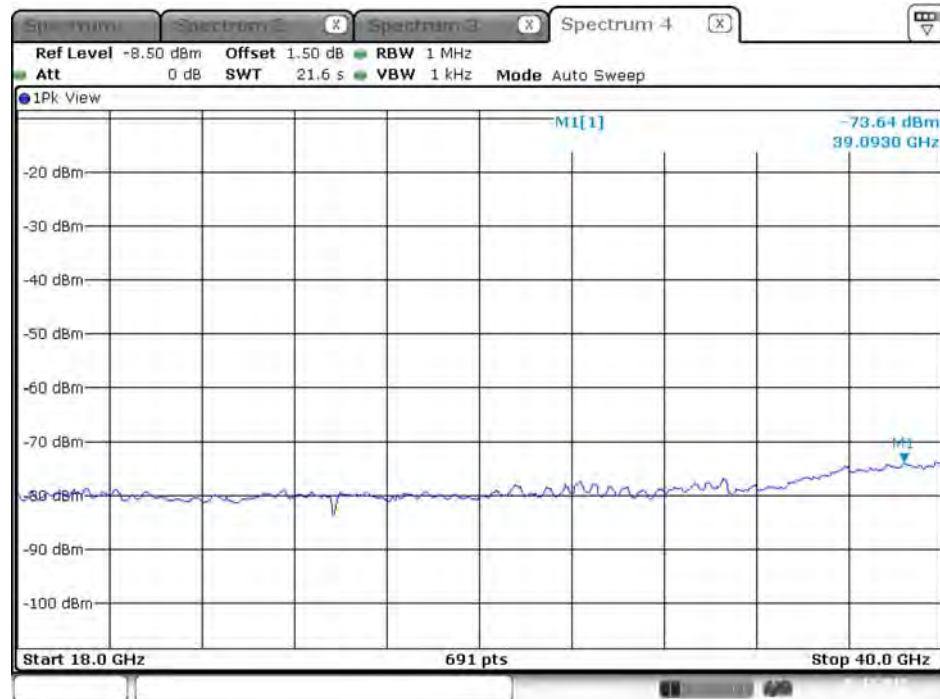


Date: 1.DEC.2017 20:11:57

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 2 / 18GHz~40GHz

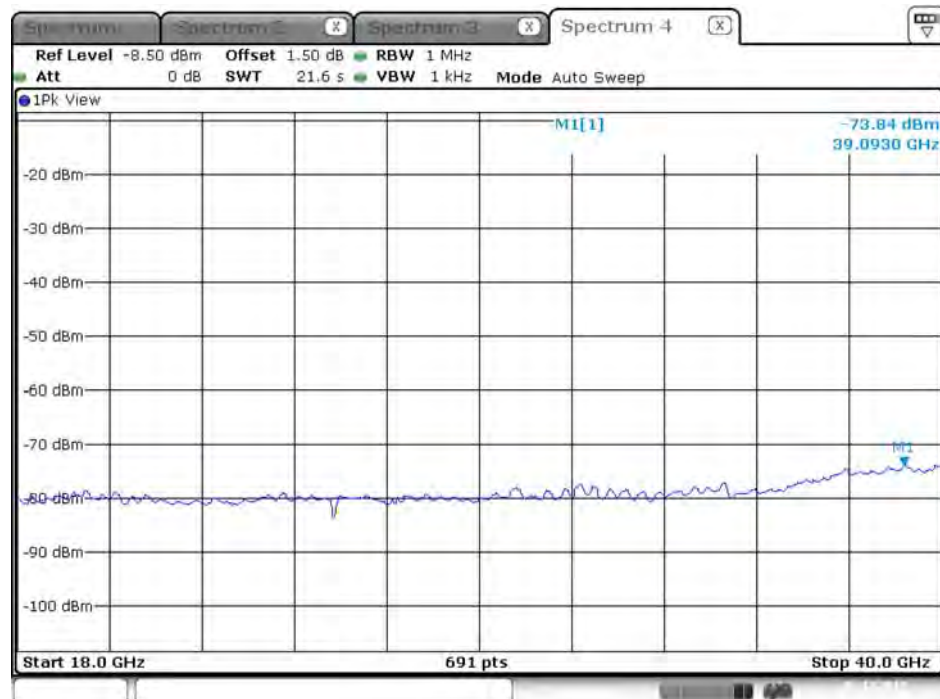


Date: 1.DEC.2017 20:16:05

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 1 / 18GHz~40GHz

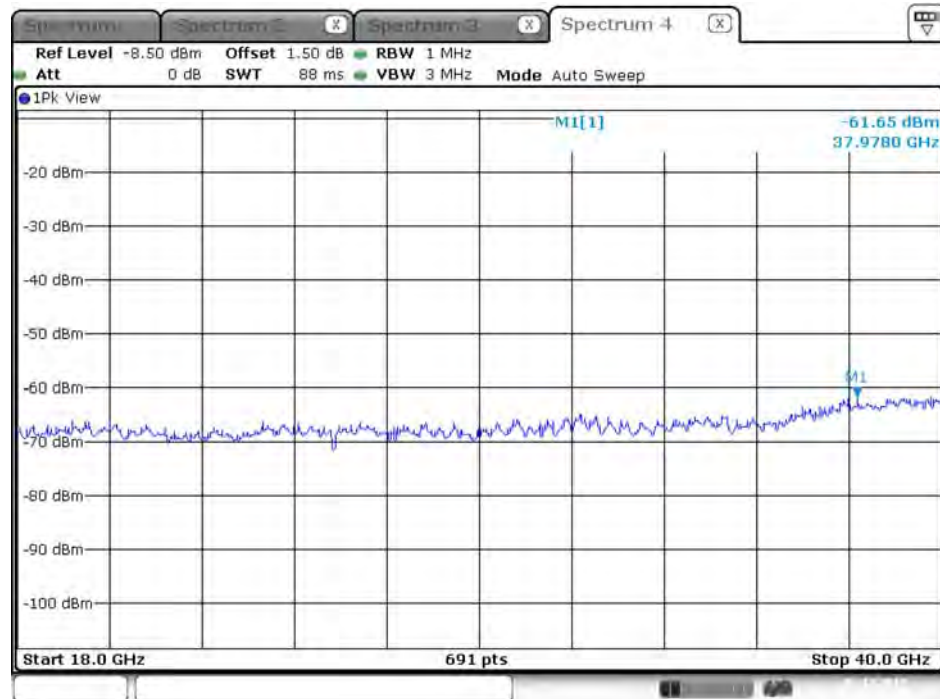


Date: 1.DEC.2017 20:12:31

### Plot on Configuration QPSK, 20M / 5580MHz / Peak / Port 2 / 18GHz~40GHz

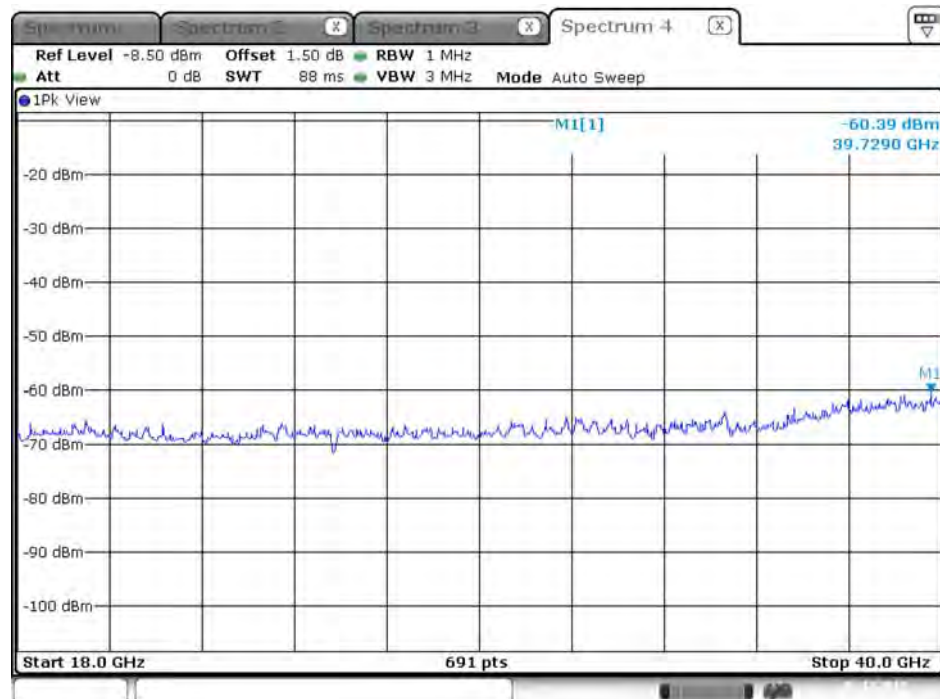


Date: 1.DEC.2017 20:16:44

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 1 / 18GHz~40GHz

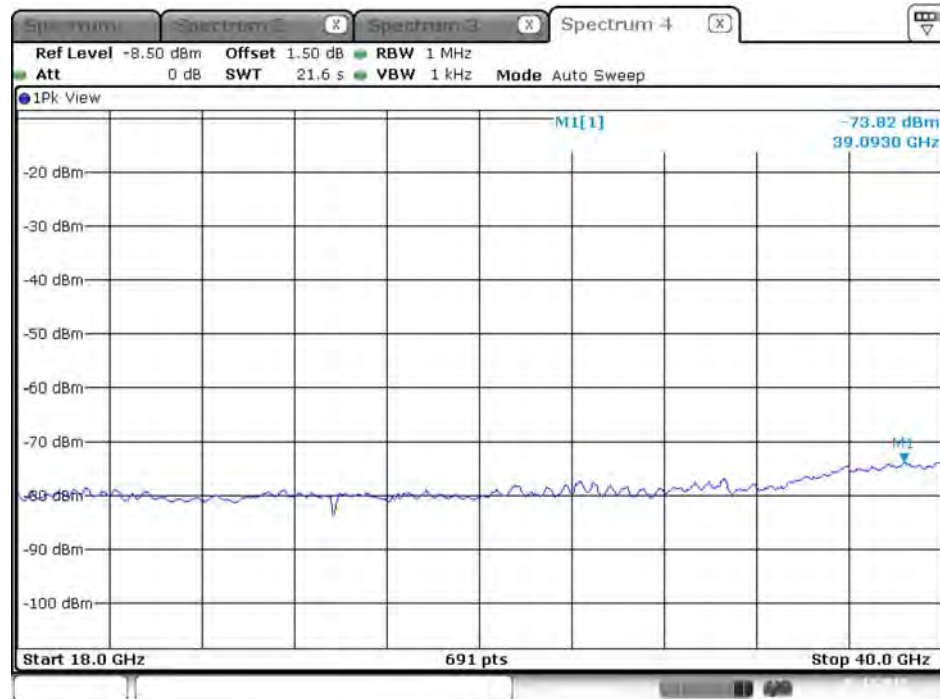


Date: 1.DEC.2017 20:42:08

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 2 / 18GHz~40GHz

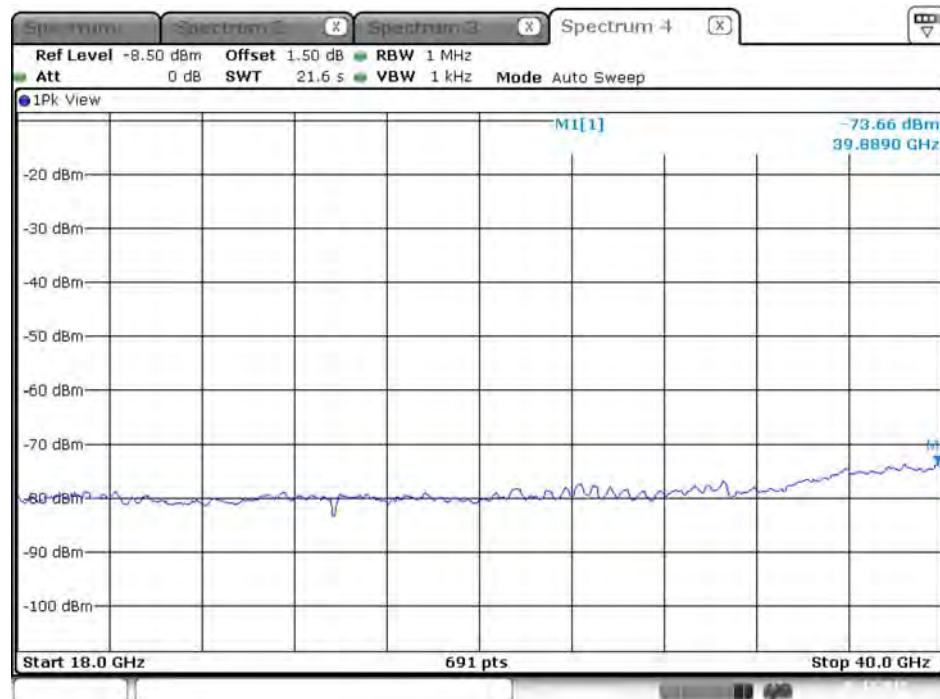


Date: 1.DEC.2017 20:48:53

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 1 / 18GHz~40GHz

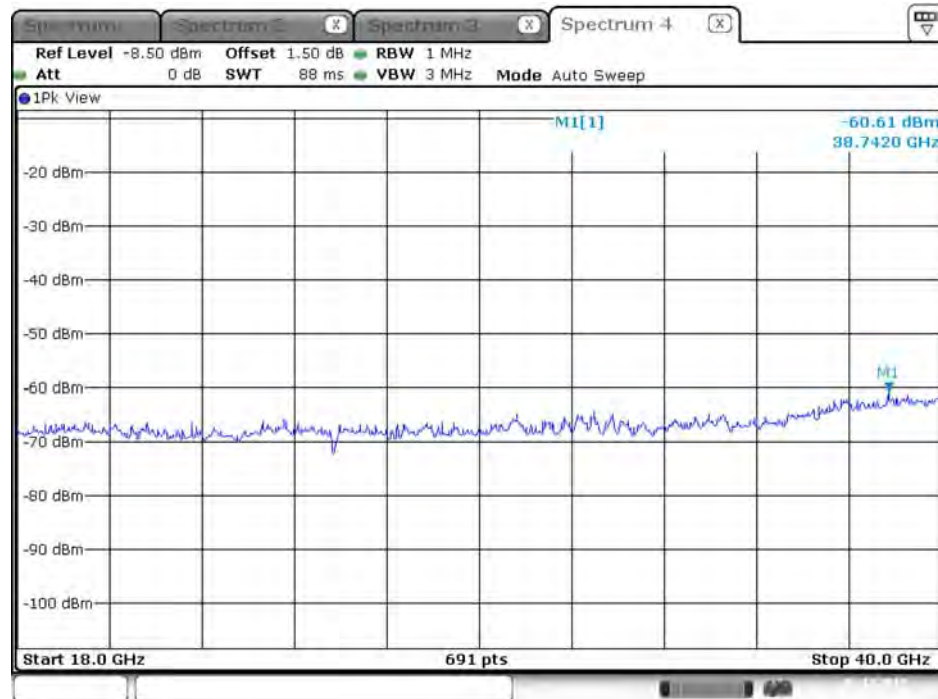


Date: 1.DEC.2017 20:42:41

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 2 / 18GHz~40GHz

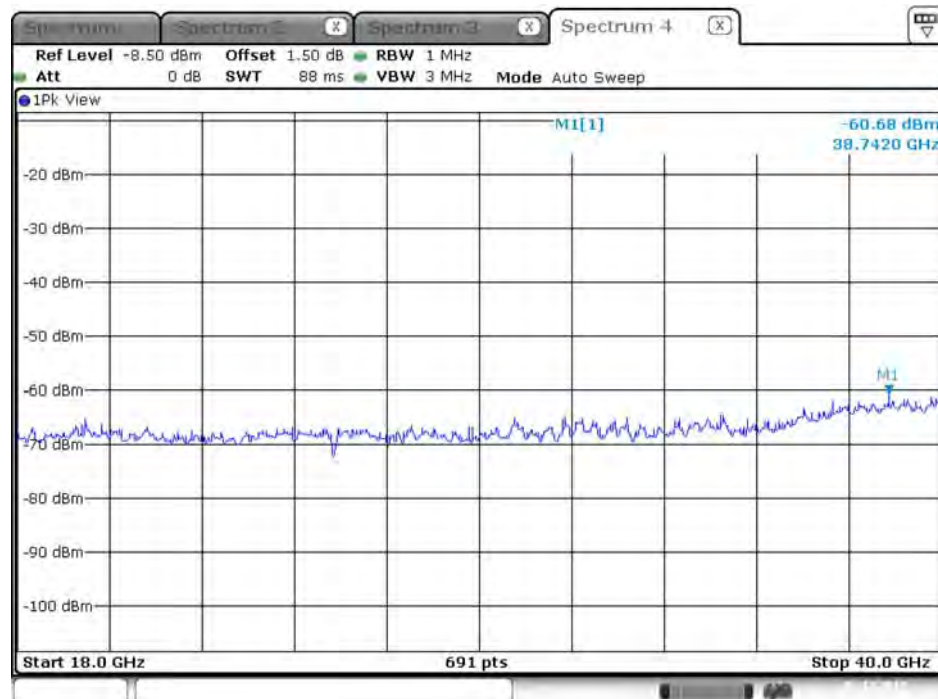


Date: 1.DEC.2017 20:49:34

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 1 / 18GHz~40GHz

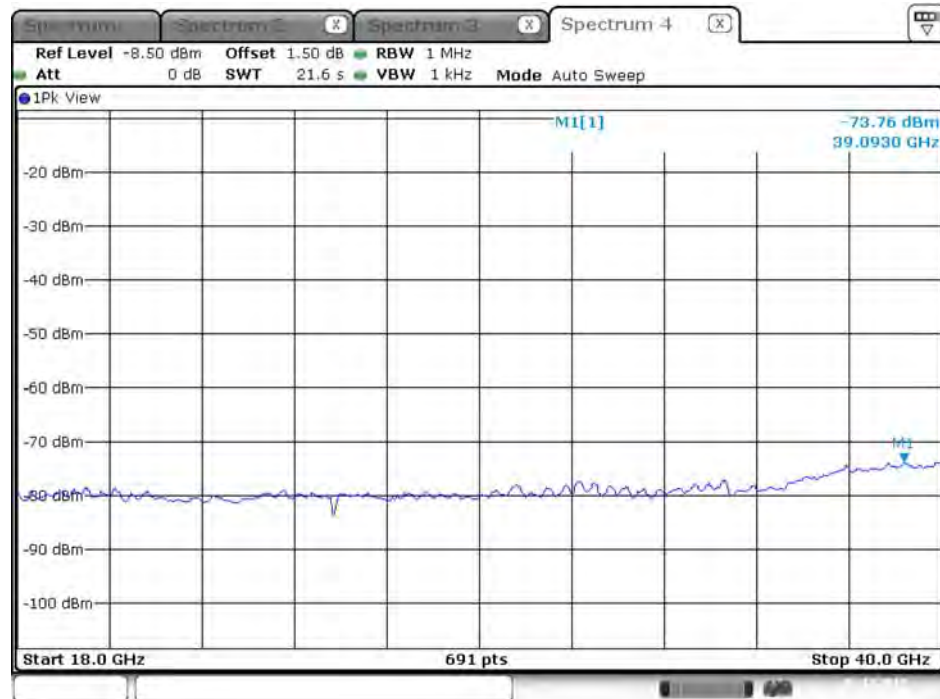


Date: 1.DEC.2017 21:15:00

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 2 / 18GHz~40GHz

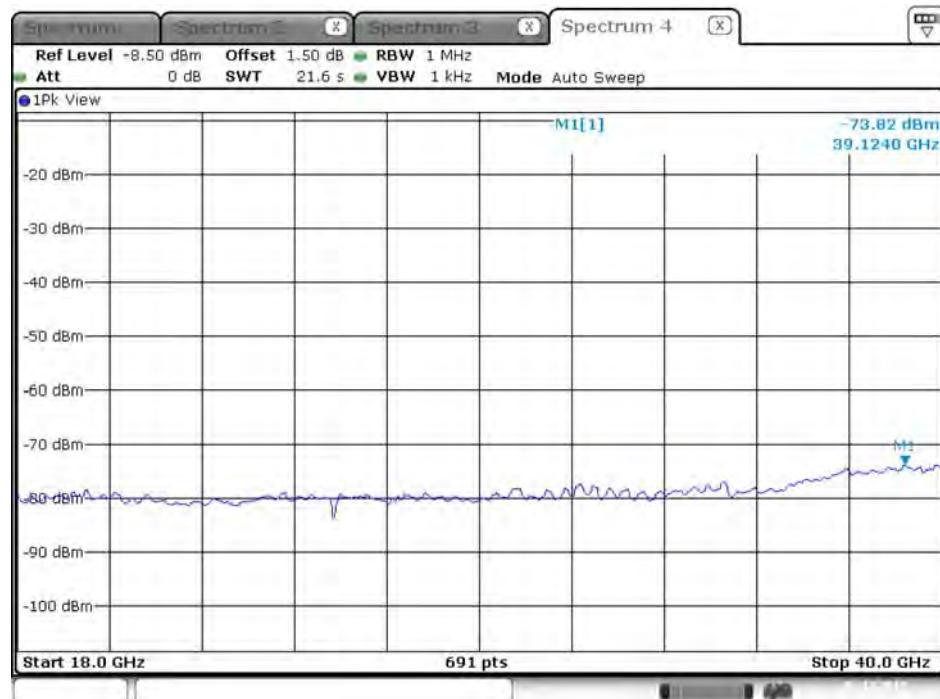


Date: 1.DEC.2017 21:21:17

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 18GHz~40GHz

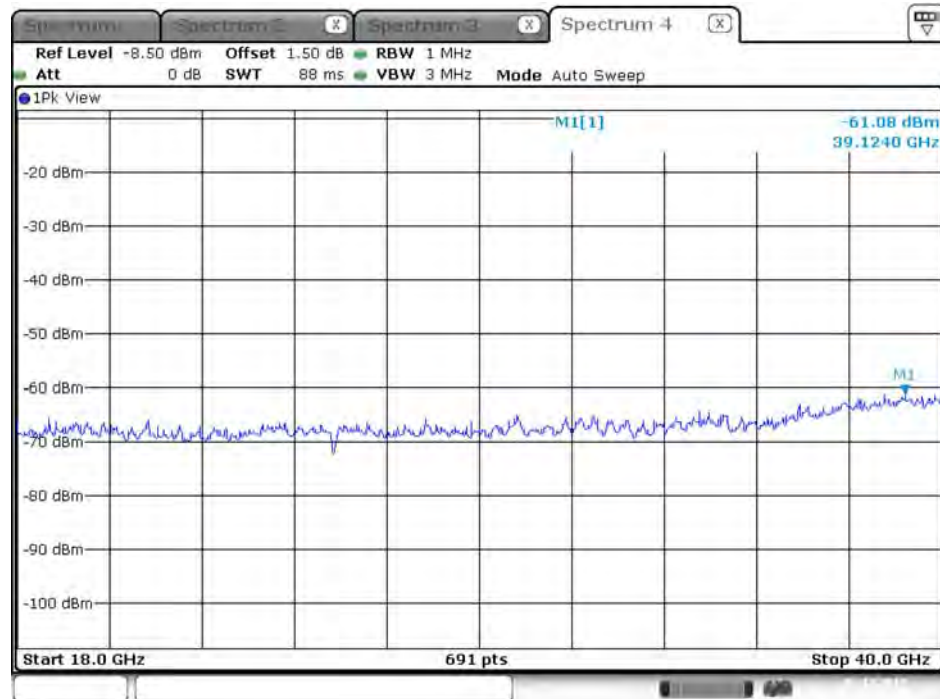


Date: 1.DEC.2017 21:15:35

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 18GHz~40GHz

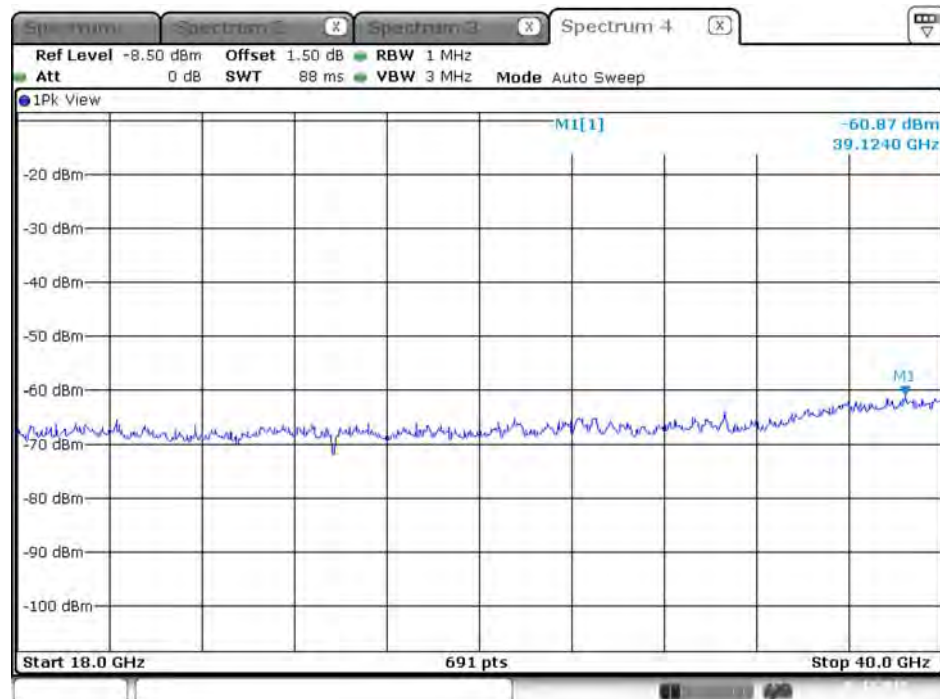


Date: 1.DEC.2017 21:22:14

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 1 / 18GHz~40GHz

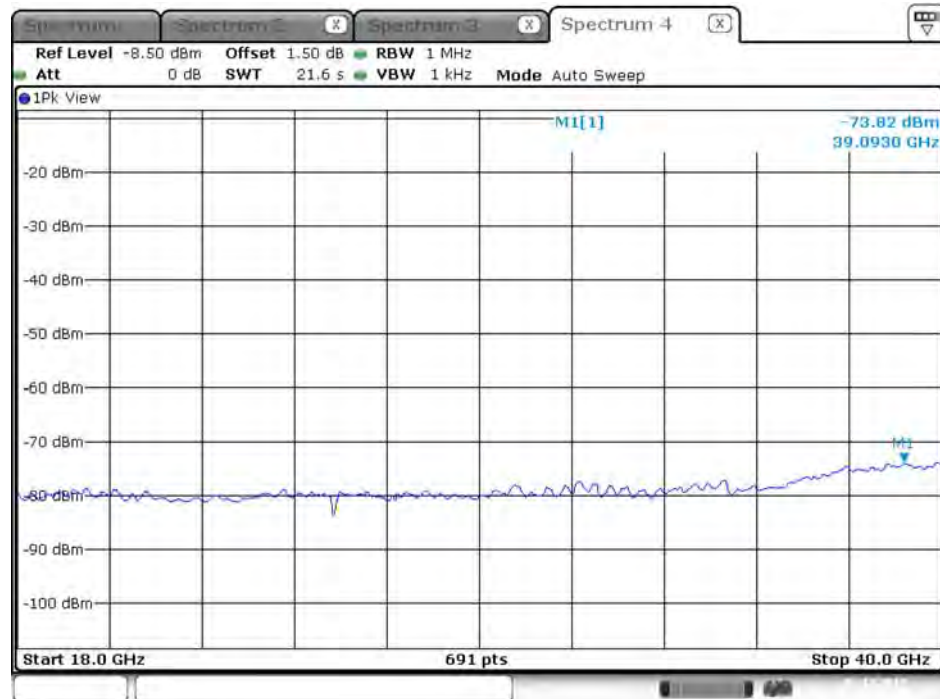


Date: 1 DEC. 2017 22:06:28

### Plot on Configuration QPSK, 80M / 5520 MHz / Average / Port 2 / 18GHz~40GHz

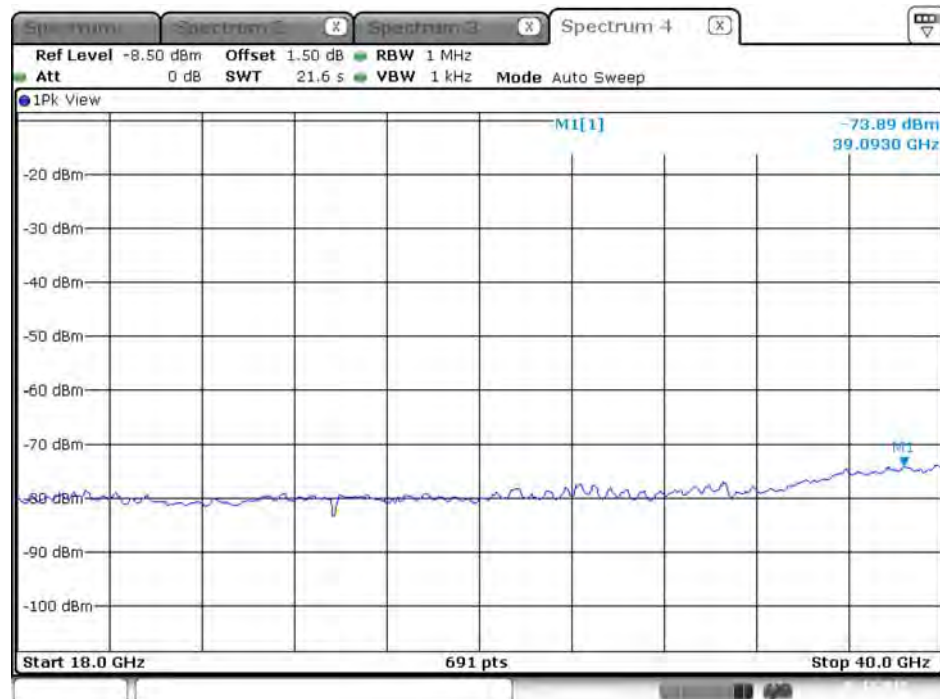


Date: 1 DEC. 2017 22:09:40

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 1 / 18GHz~40GHz

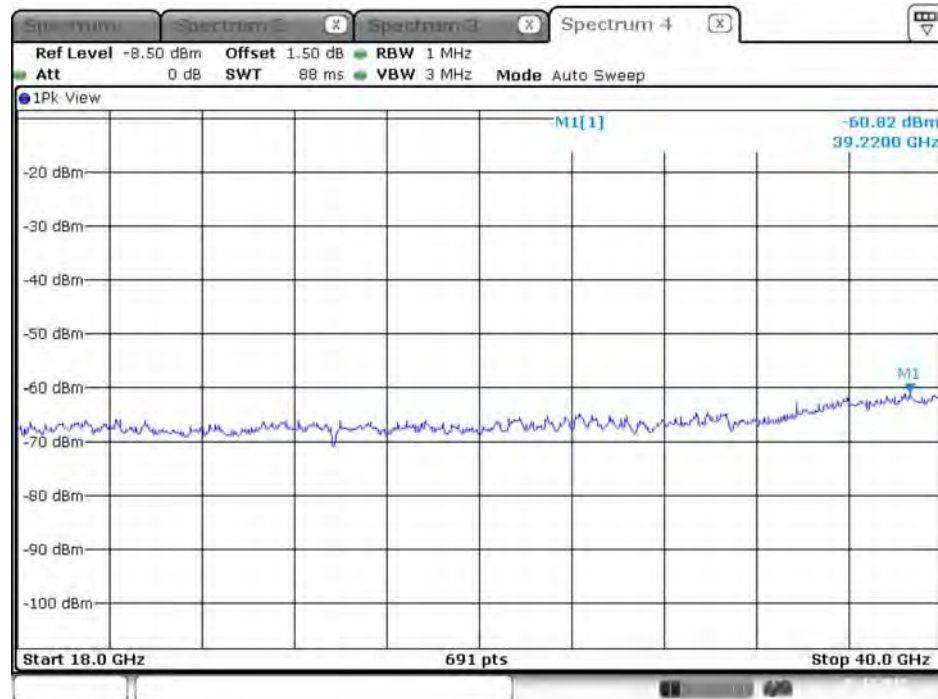


Date: 1.DEC.2017 22:04:54

### Plot on Configuration QPSK, 80M / 5520 MHz / Peak / Port 2 / 18GHz~40GHz

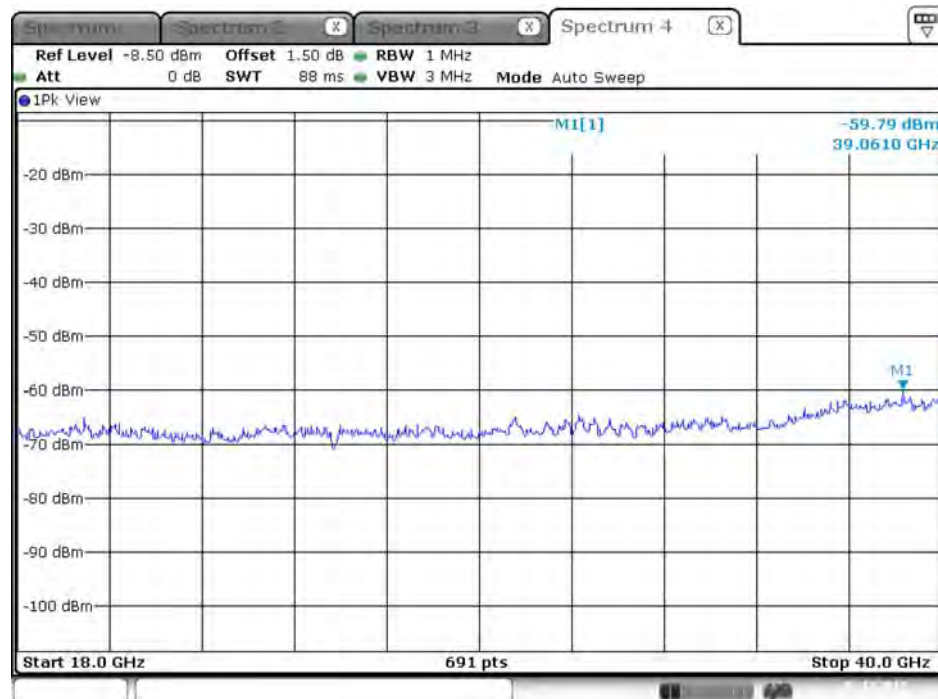


Date: 1.DEC.2017 22:10:12

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 1 /18GHz~40GHz

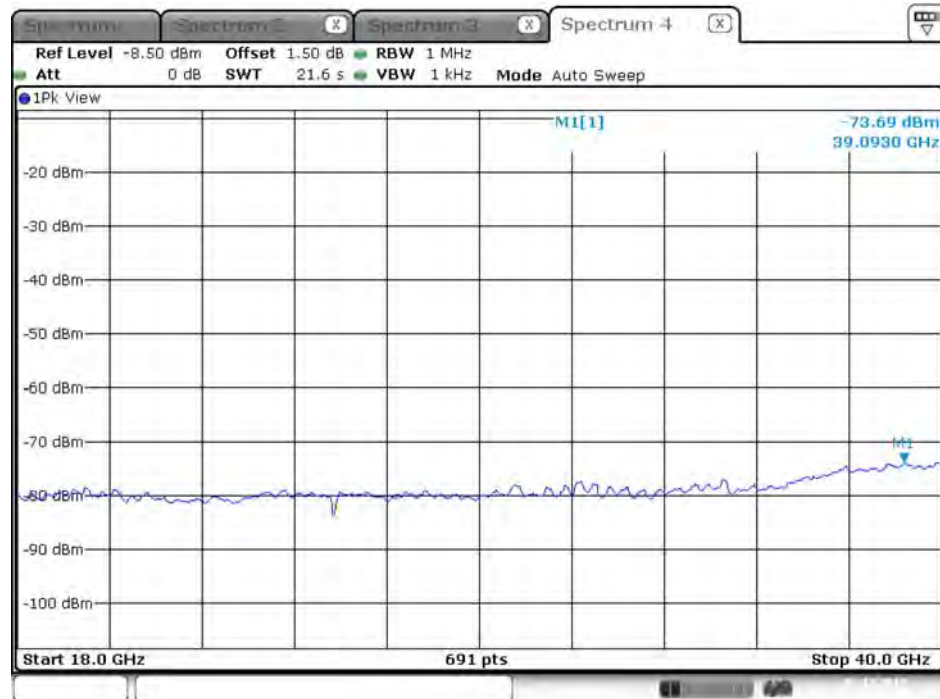


Date: 1.DEC.2017 22:38:59

### Plot on Configuration QPSK, 80M / 5610 MHz / Average / Port 2 / 18GHz~40GHz

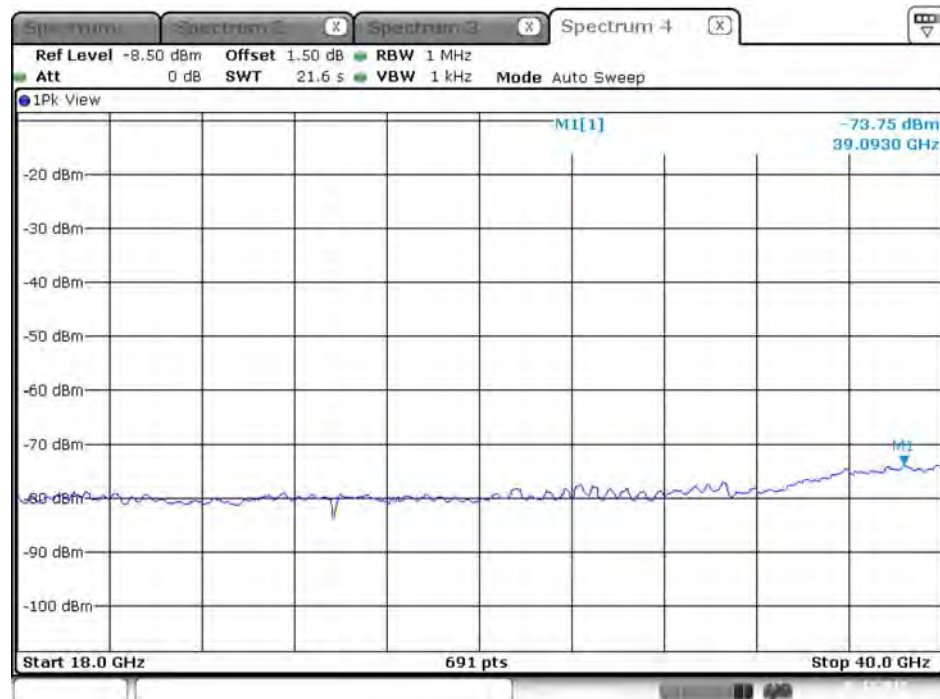


Date: 1.DEC.2017 22:43:03

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 1 / 18GHz~40GHz

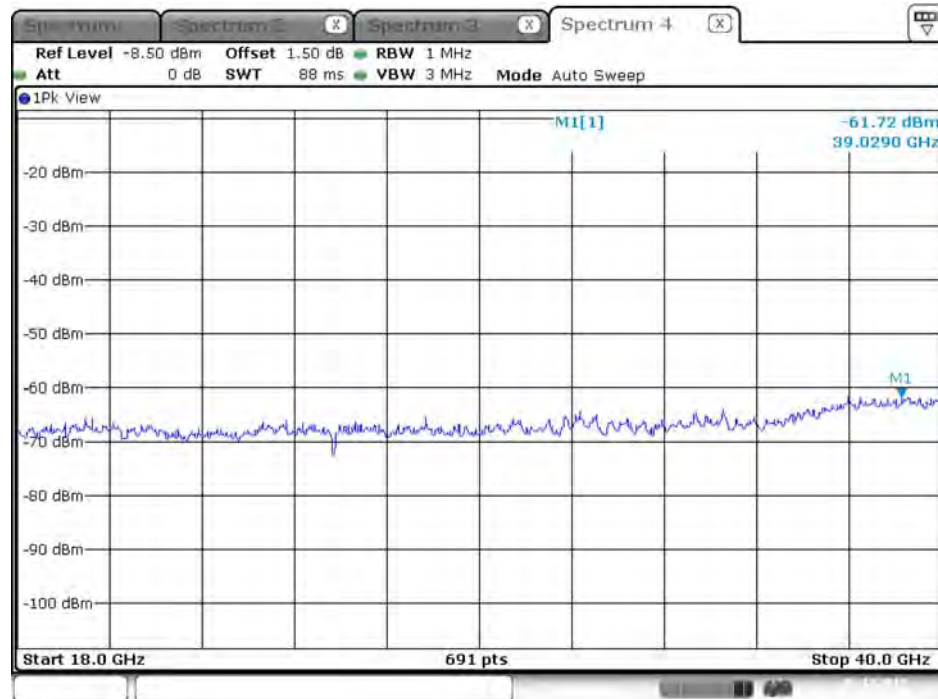


Date: 1 DEC. 2017 22:39:34

### Plot on Configuration QPSK, 80M / 5610 MHz / Peak / Port 2 / 18GHz~40GHz

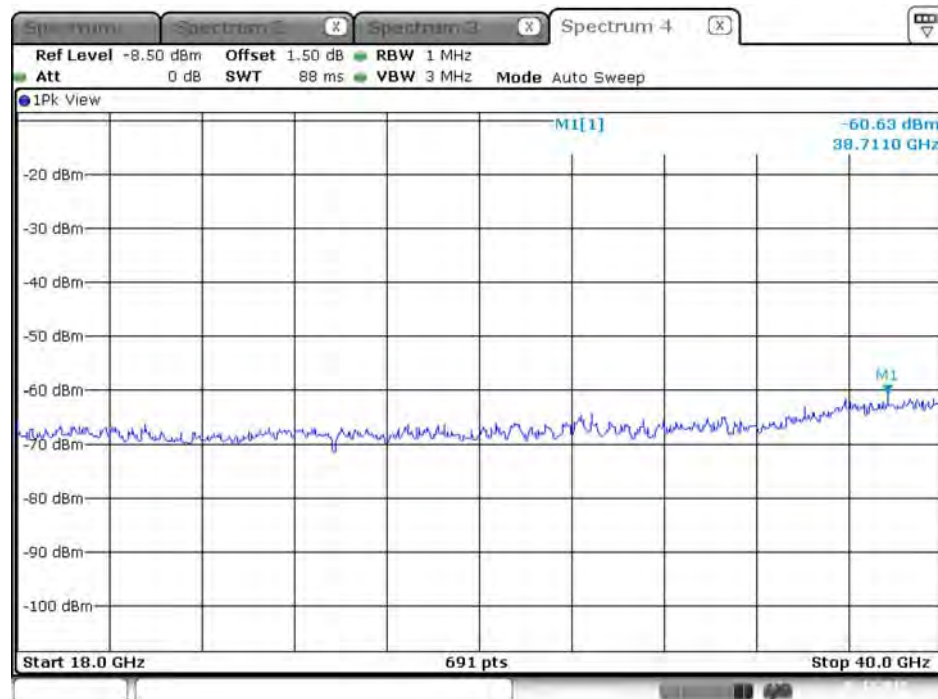


Date: 1 DEC. 2017 22:43:30

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 1 / 18GHz~40GHz

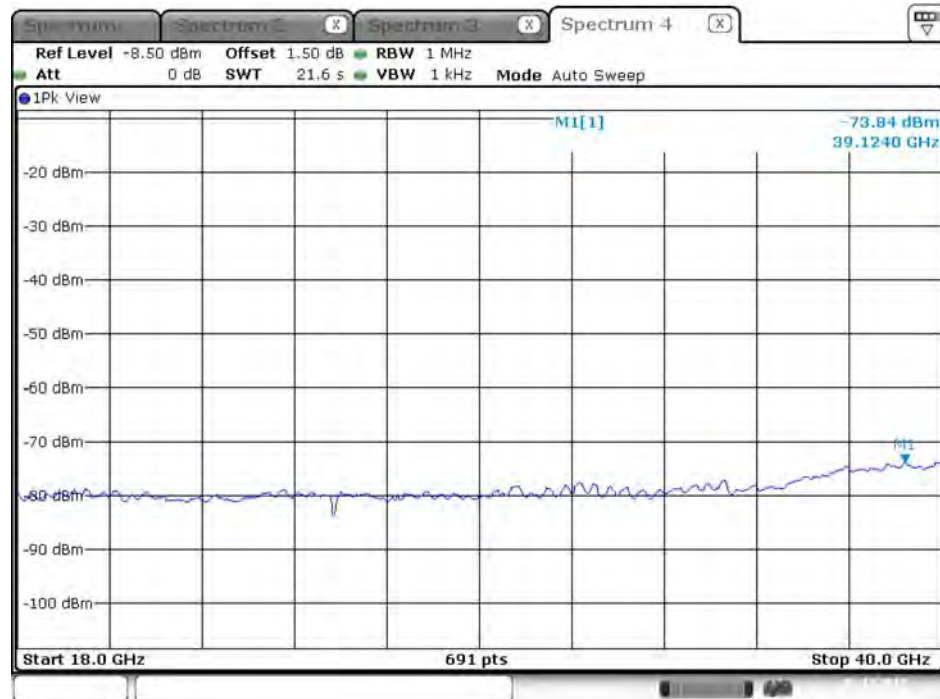


Date: 1.DEC.2017 23:13:54

### Plot on Configuration QPSK, 80M / 5650 MHz / Average / Port 2 / 18GHz~40GHz

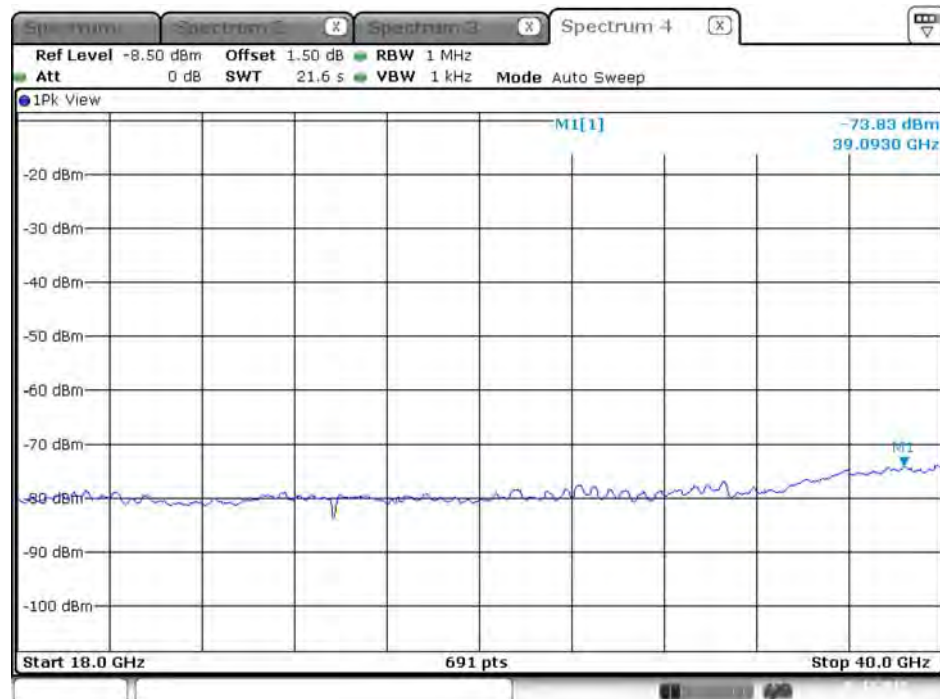


Date: 1.DEC.2017 23:17:24

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 1 / 18GHz~40GHz

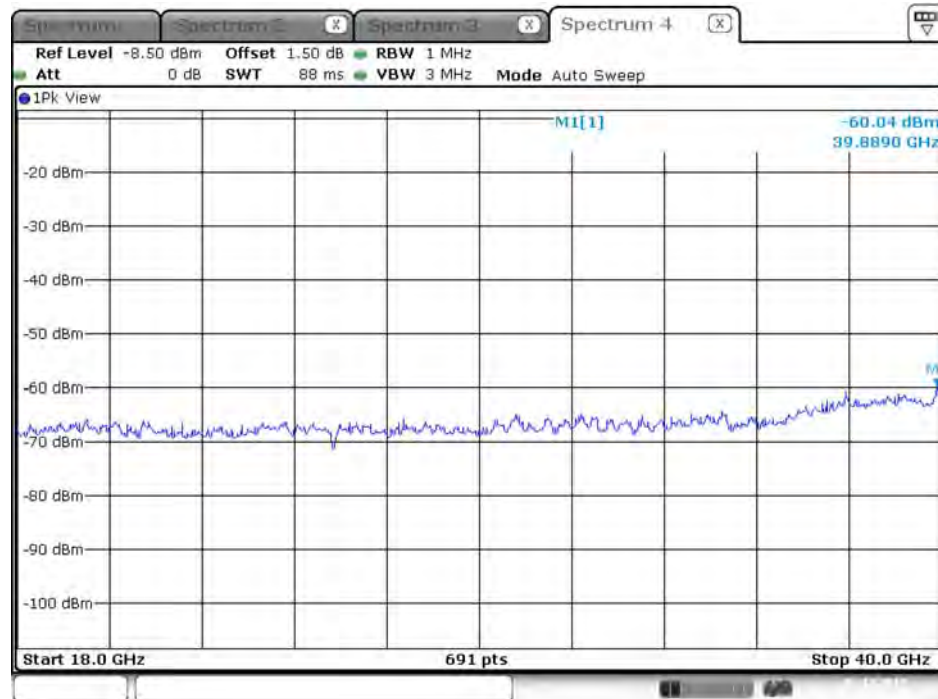


Date: 1.DEC.2017 23:14:37

### Plot on Configuration QPSK, 80M / 5650 MHz / Peak / Port 2 / 18GHz~40GHz

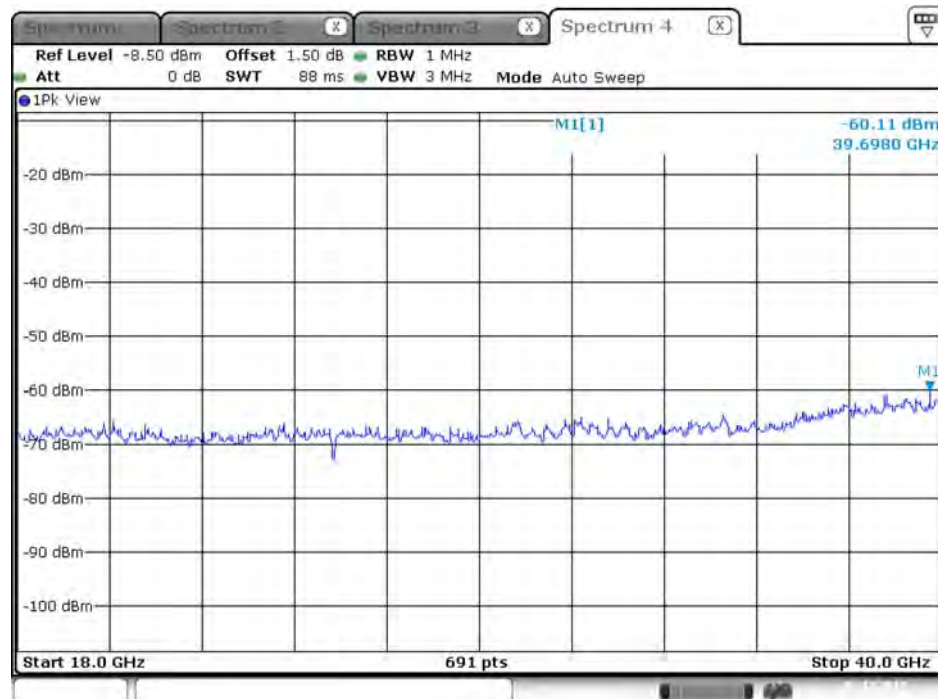


Date: 1.DEC.2017 23:18:00

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 1 / 18GHz~40GHz

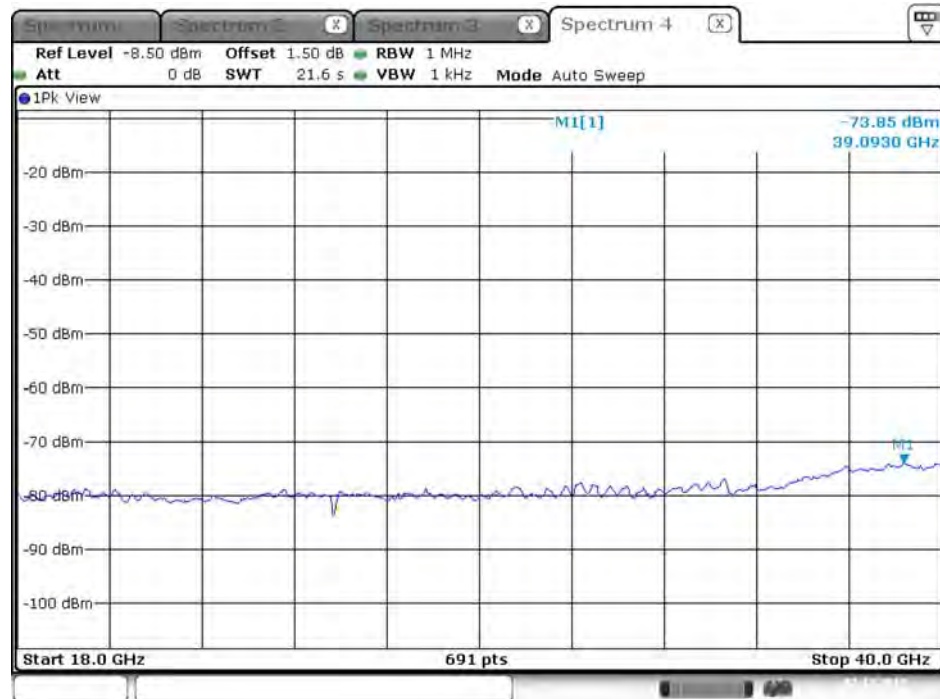


Date: 2.DEC.2017 00:41:58

### Plot on Configuration QPSK, 80M / 5720 MHz / Average / Port 2 / 18GHz~40GHz

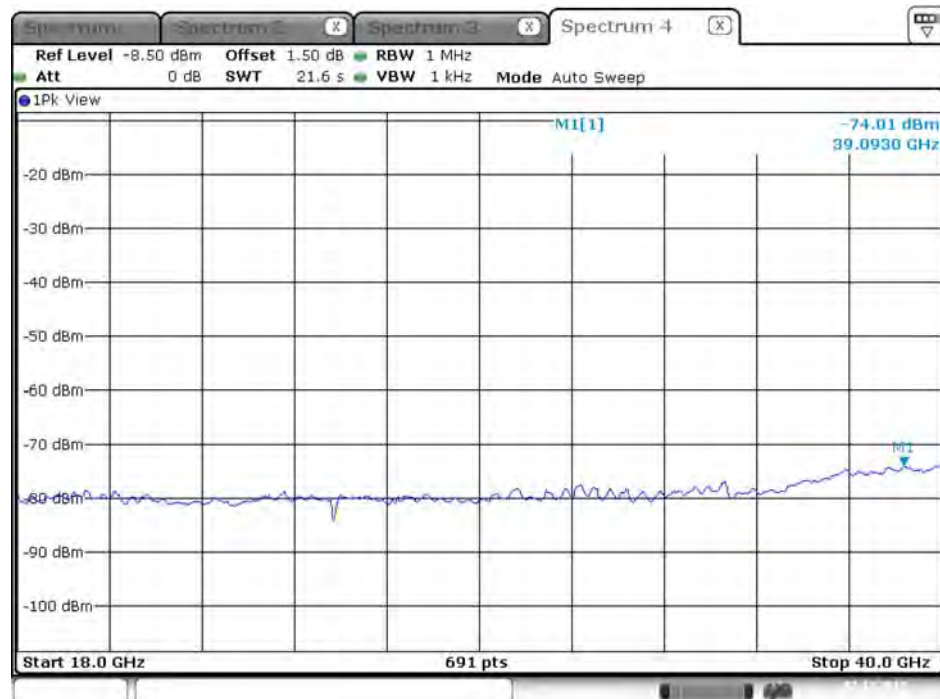


Date: 2.DEC.2017 01:01:45

### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 1 / 18GHz~40GHz

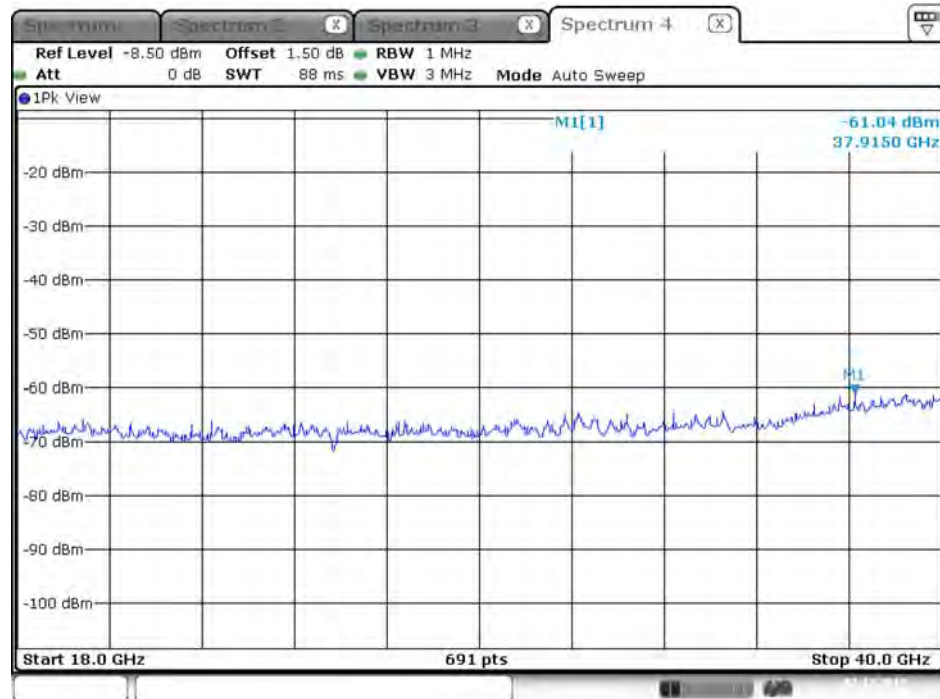

Date: 2 DEC. 2017 00:42:52


### Plot on Configuration QPSK, 80M / 5720 MHz / Peak / Port 2 / 18GHz~40GHz

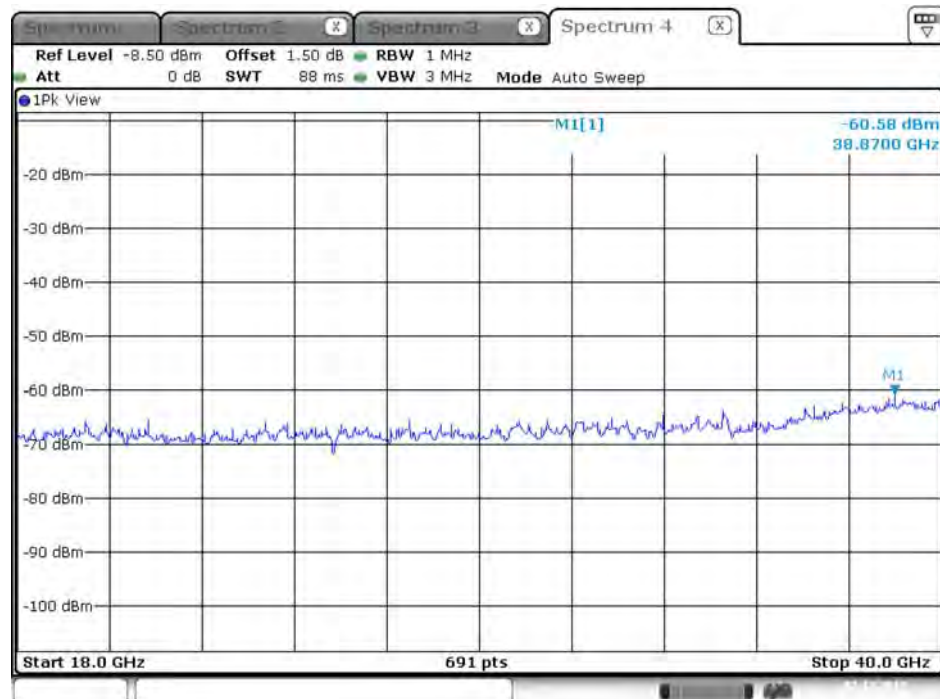

Date: 2 DEC. 2017 01:02:15


For Antenna 3:

Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 1 / 1GHz~3GHz

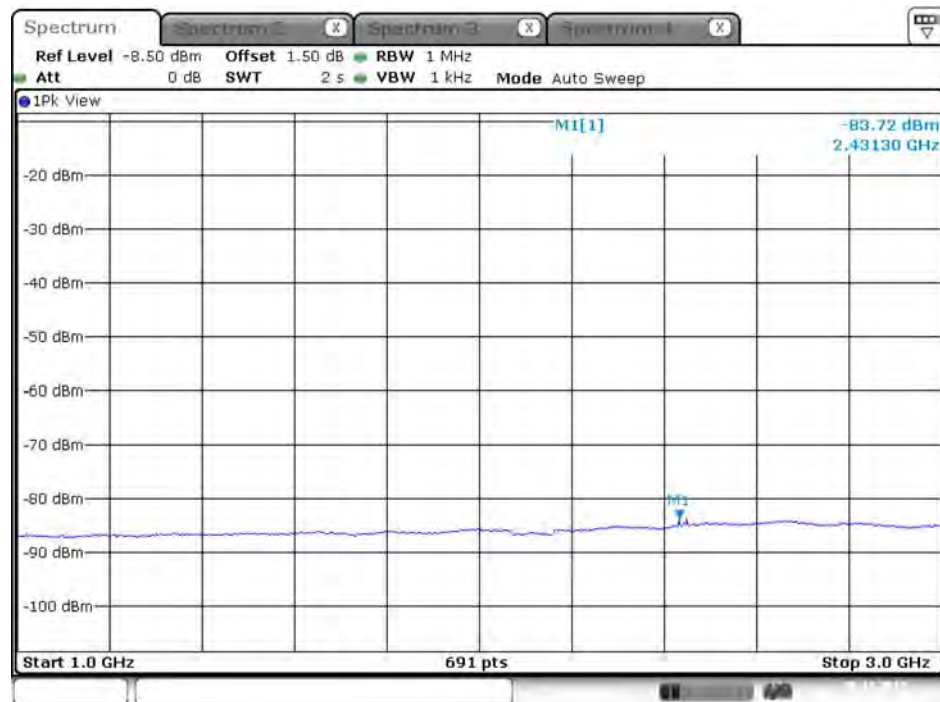


Date: 30.NOV.2017 20:53:34

Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 2 / 1GHz~3GHz

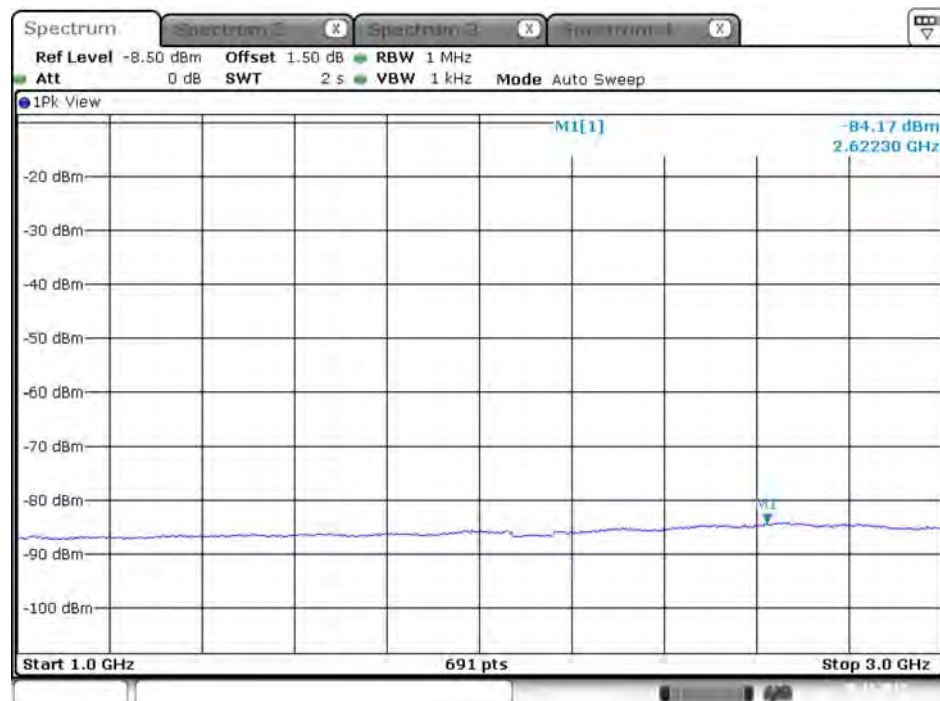


Date: 30.NOV.2017 21:16:23

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 1 / 1GHz~3GHz

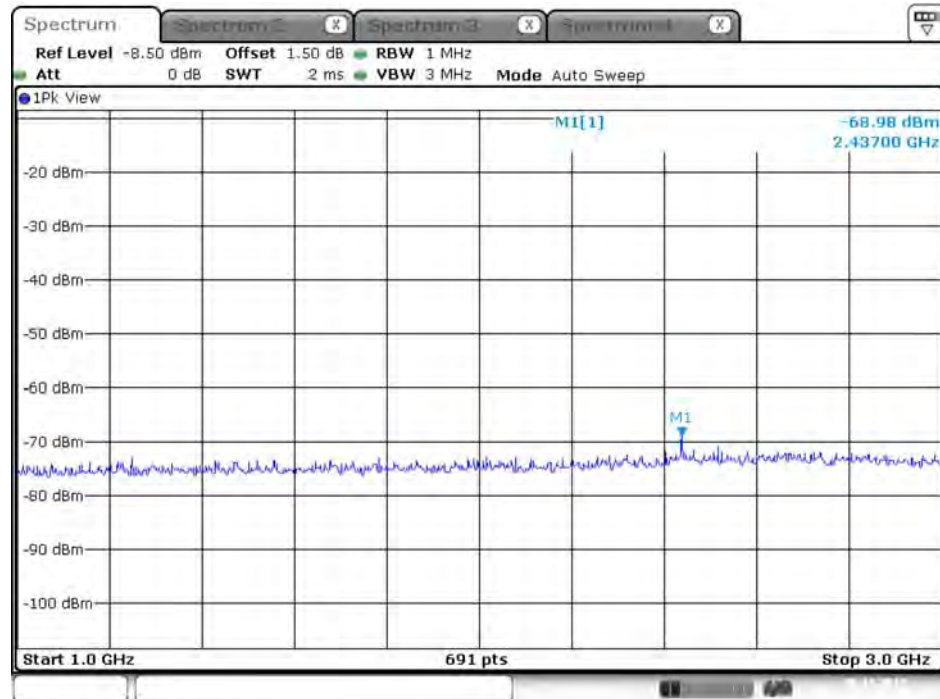


Date: 30.NOV.2017 20:54:20

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 2 / 1GHz~3GHz

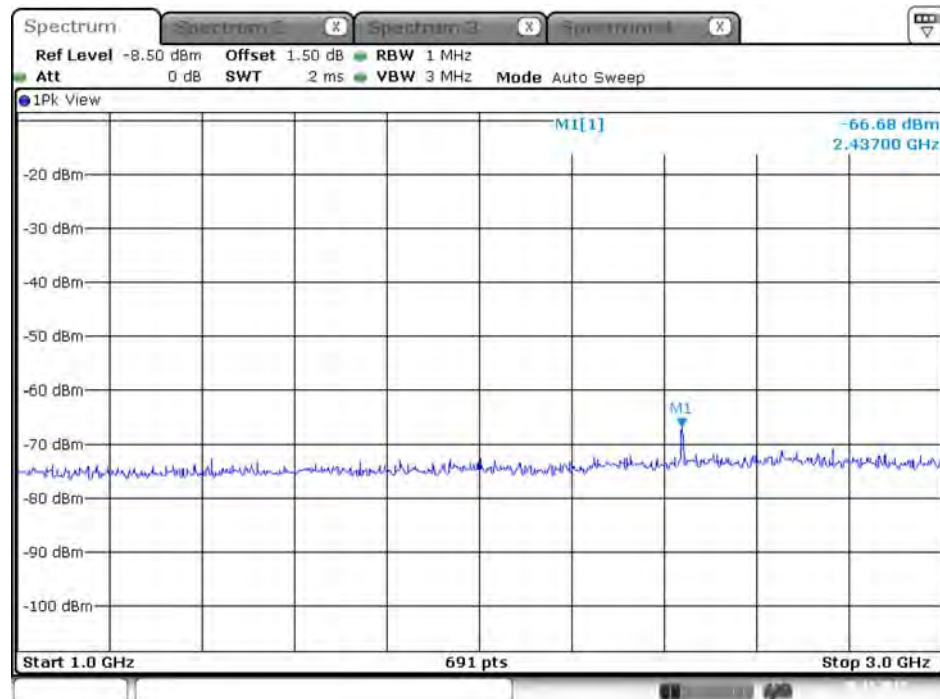

Date: 30.NOV.2017 21:17:04

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 1 / 1GHz~3GHz

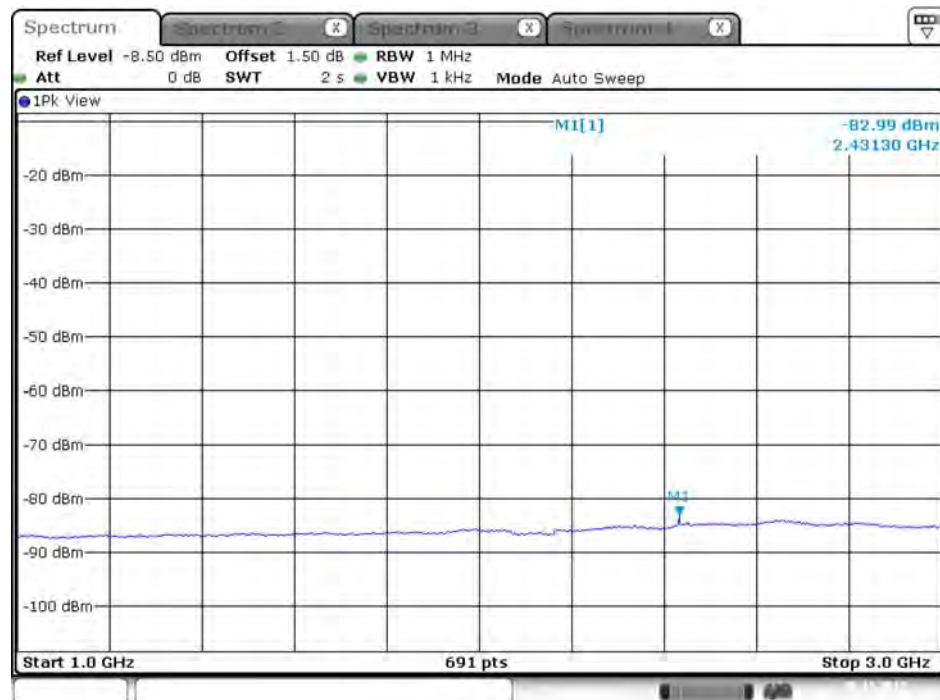


Date: 30.NOV.2017 21:19:40

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 2 / 1GHz~3GHz




Date: 30.NOV.2017 22:11:41

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 1 / 1GHz~3GHz

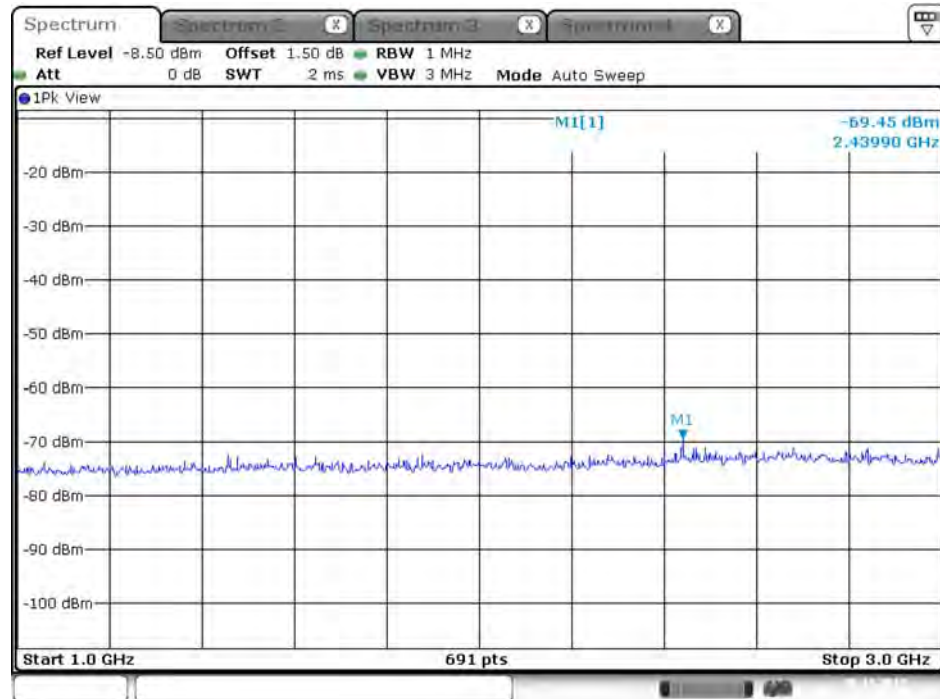


Date: 30.NOV.2017 21:20:28

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 2 / 1GHz~3GHz

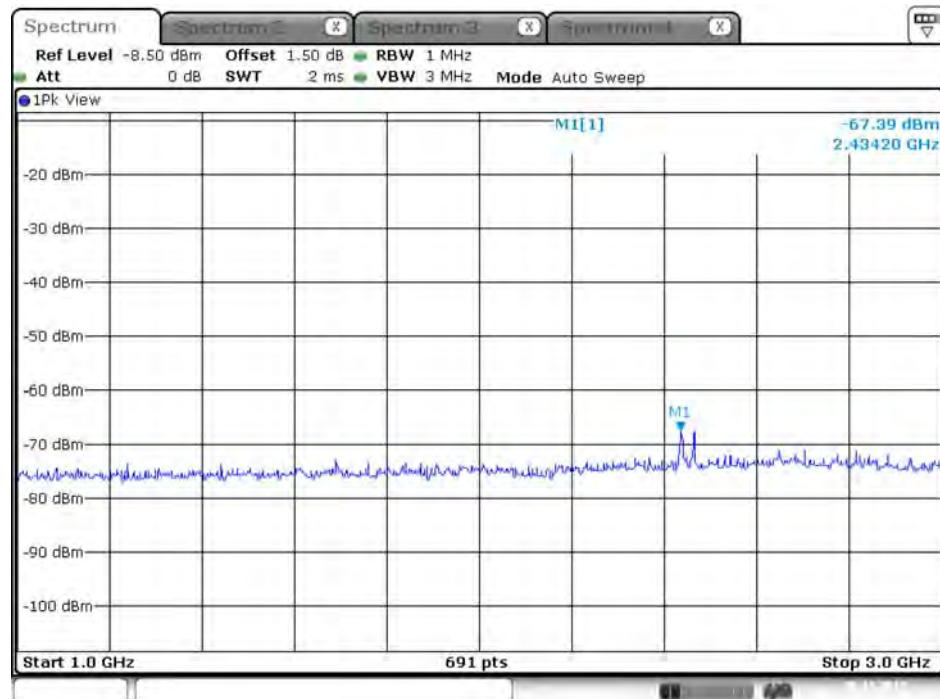

Date: 30.NOV.2017 22:12:30

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 1 / 1GHz~3GHz

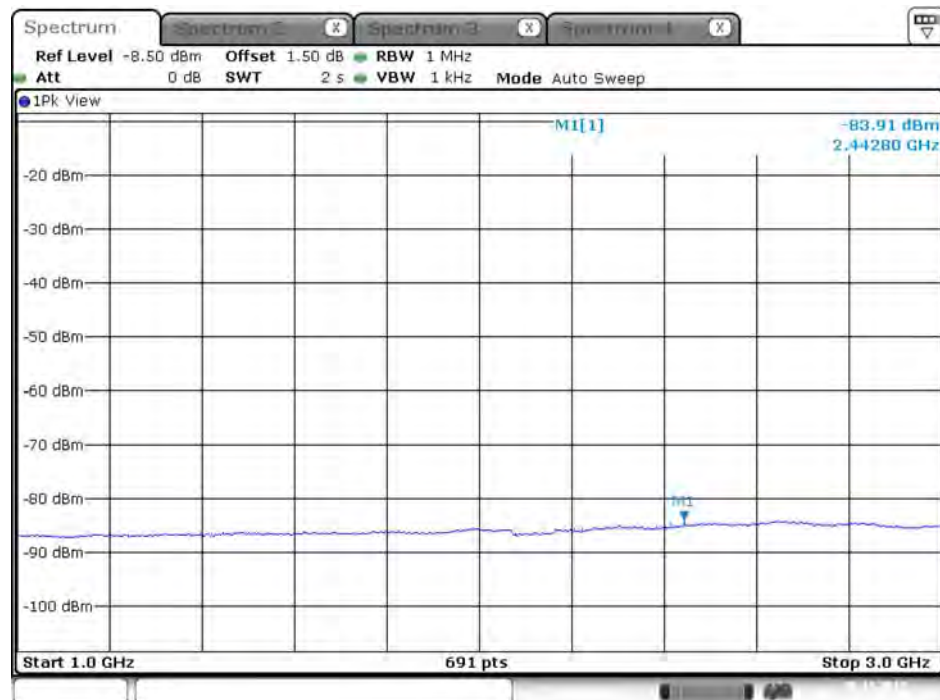


Date: 30.NOV.2017 22:15:20

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 2 / 1GHz~3GHz




Date: 30.NOV.2017 22:35:45

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 1 / 1GHz~3GHz

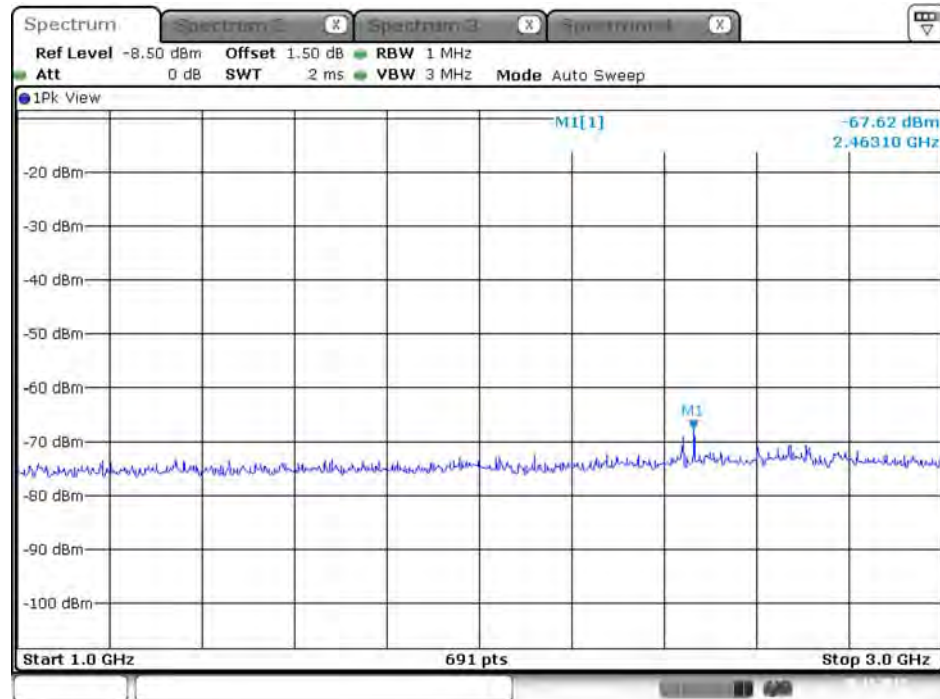


Date: 30.NOV.2017 22:15:53

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 2 / 1GHz~3GHz

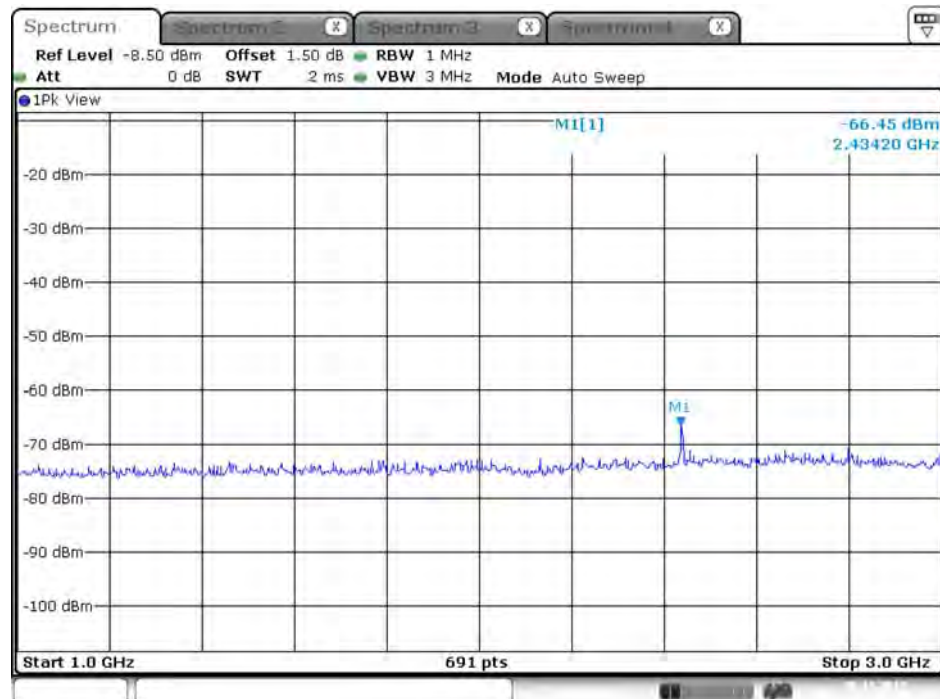


Date: 30.NOV.2017 22:36:22

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 1 / 1GHz~3GHz

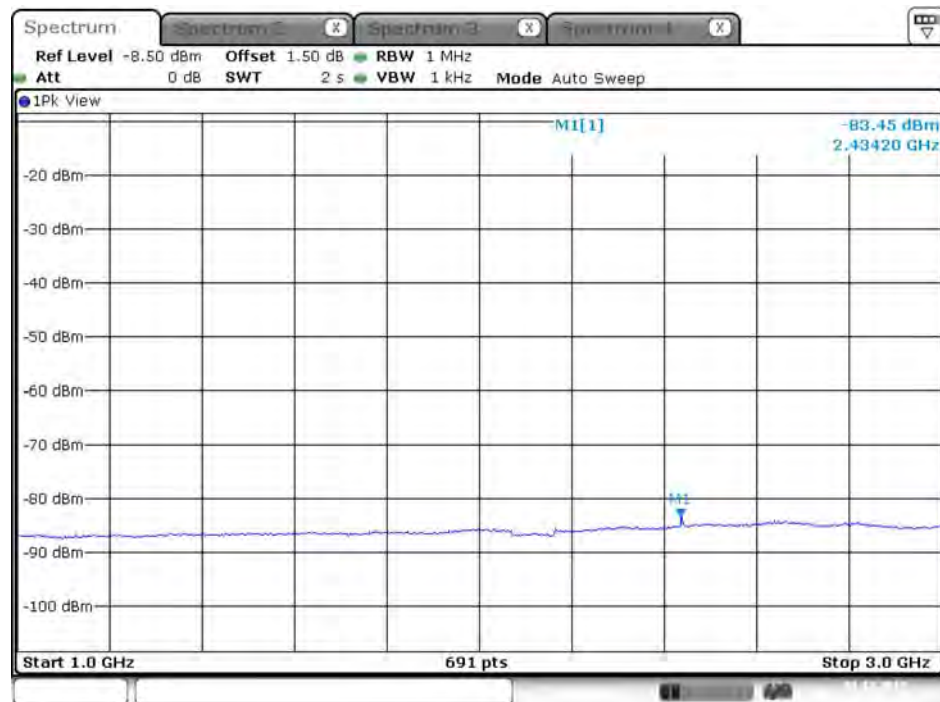


Date: 1.DEC.2017 00:11:32

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 2 / 1GHz~3GHz

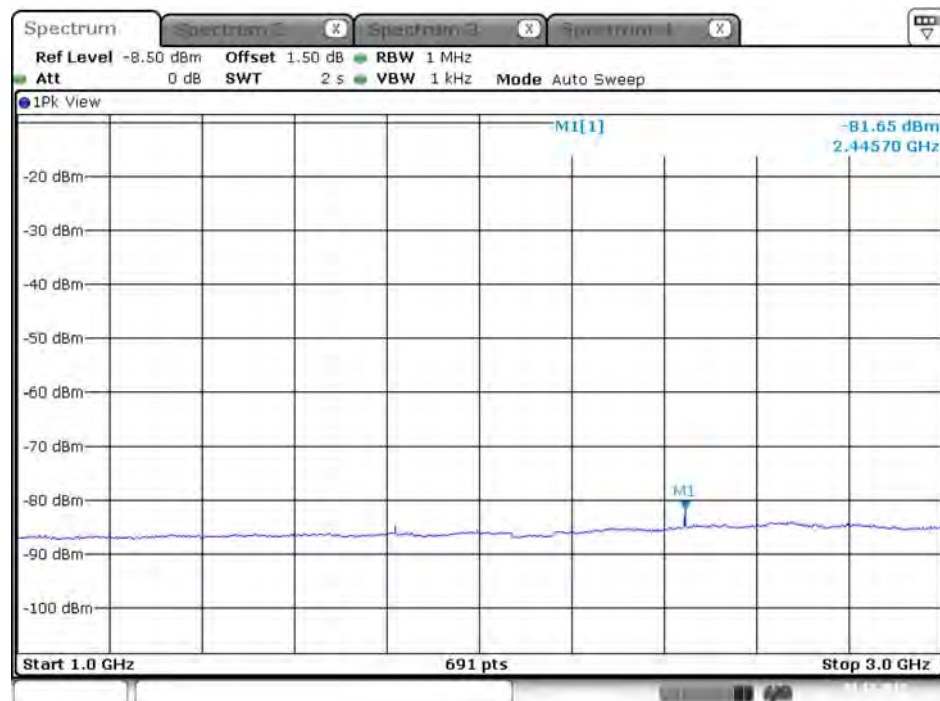


Date: 1.DEC.2017 00:40:38

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 1 / 1GHz~3GHz

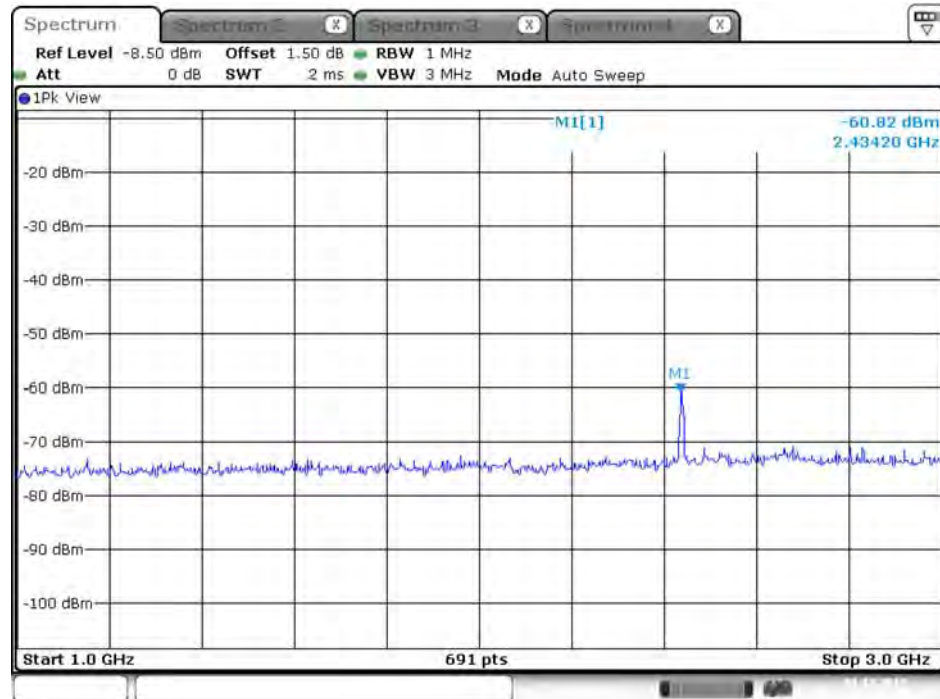


Date: 1.DEC.2017 00:13:35

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 2 / 1GHz~3GHz

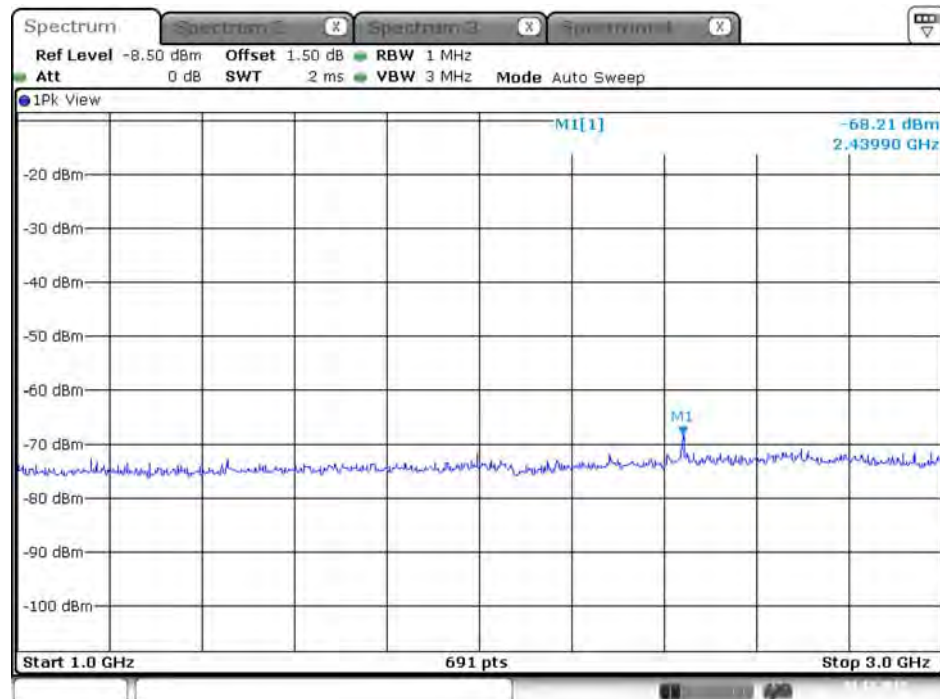


Date: 1.DEC.2017 00:41:17

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 1 / 1GHz~3GHz

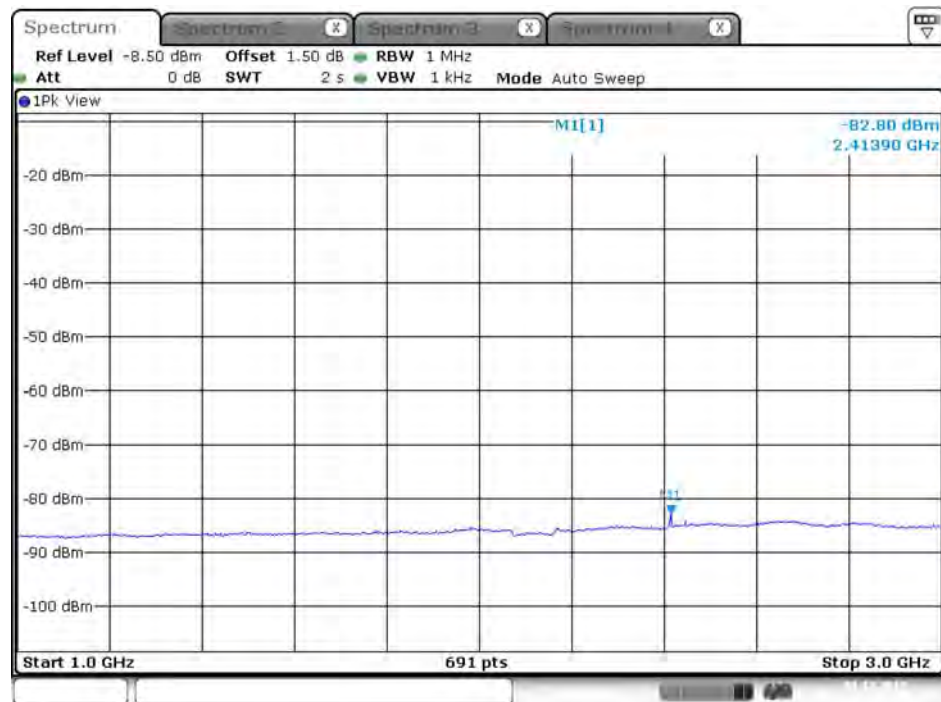


Date: 1.DEC.2017 01:47:59

### Plot on Configuration QPSK, 20M / 5500 MHz / Average / Port 2 / 1GHz~3GHz

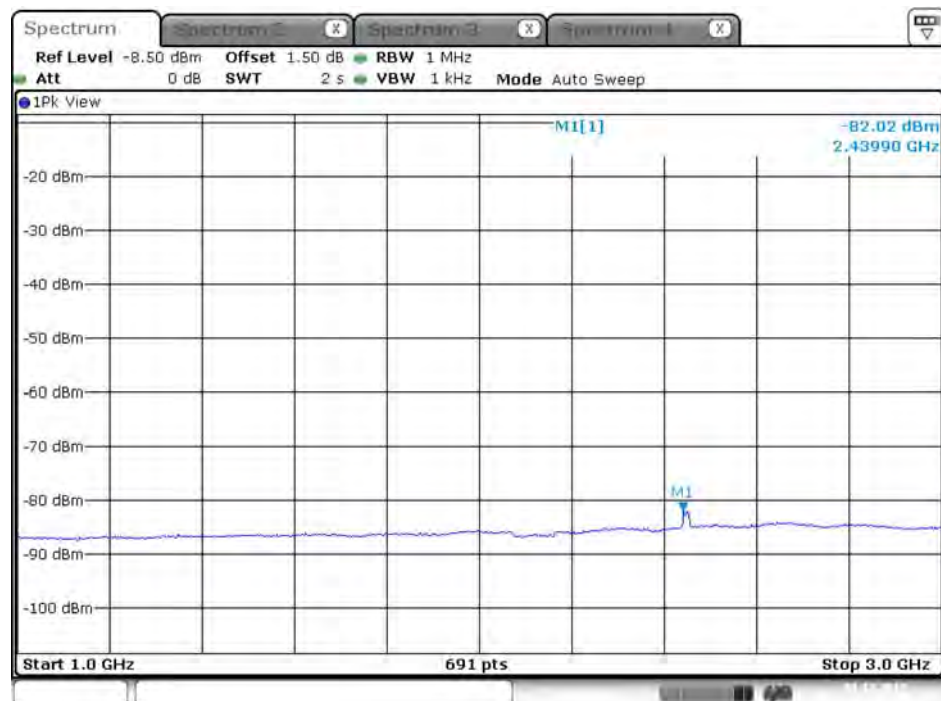


Date: 1.DEC.2017 02:12:08

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 1 / 1GHz~3GHz

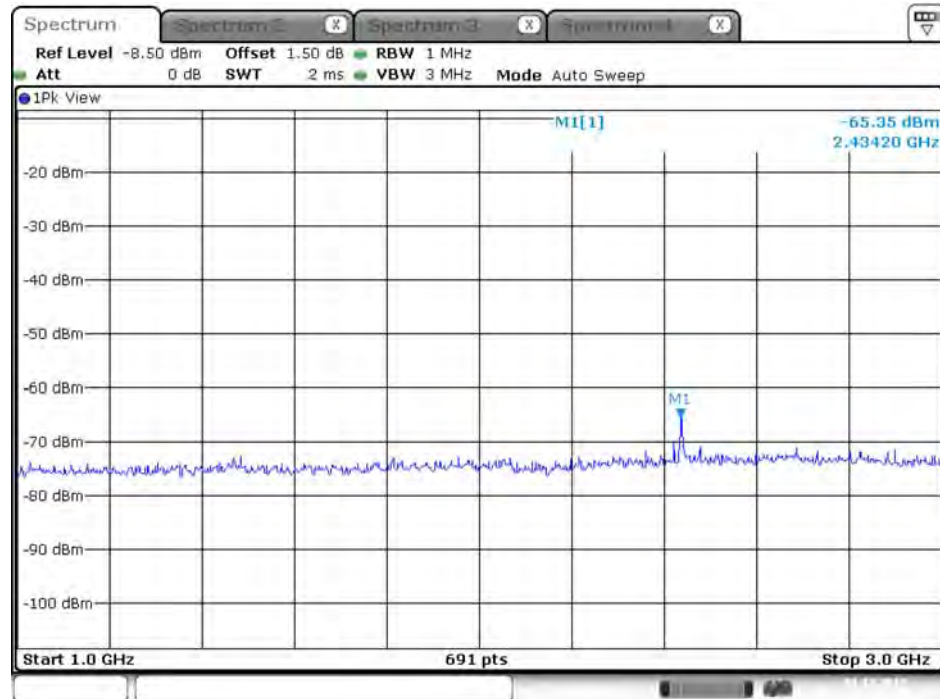


Date: 1.DEC.2017 01:48:25

### Plot on Configuration QPSK, 20M / 5500 MHz / Peak / Port 2 / 1GHz~3GHz

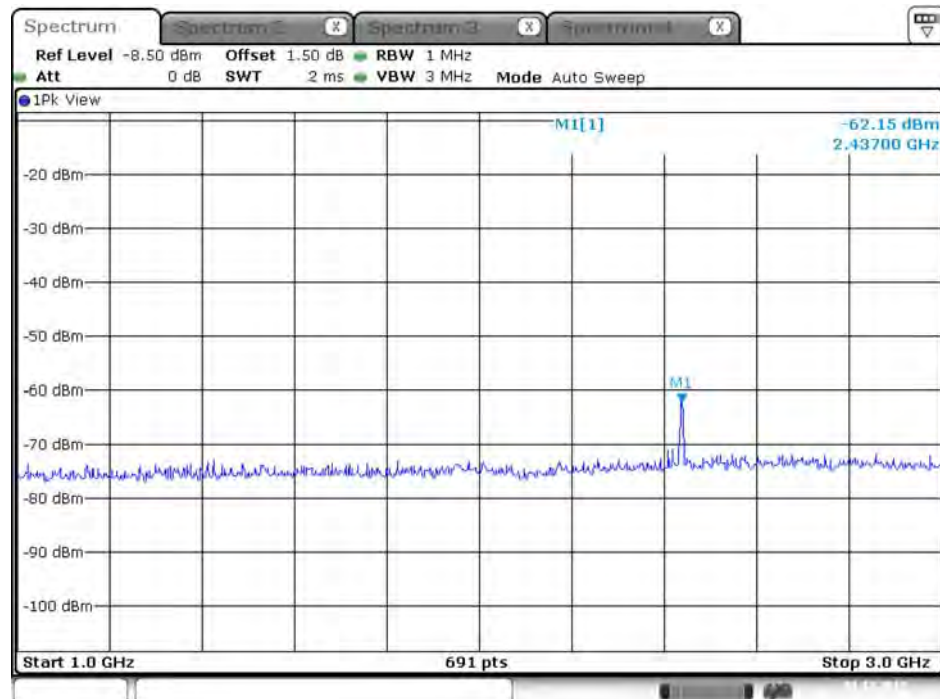

Date: 1.DEC.2017 02:12:33

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 1 / 1GHz~3GHz

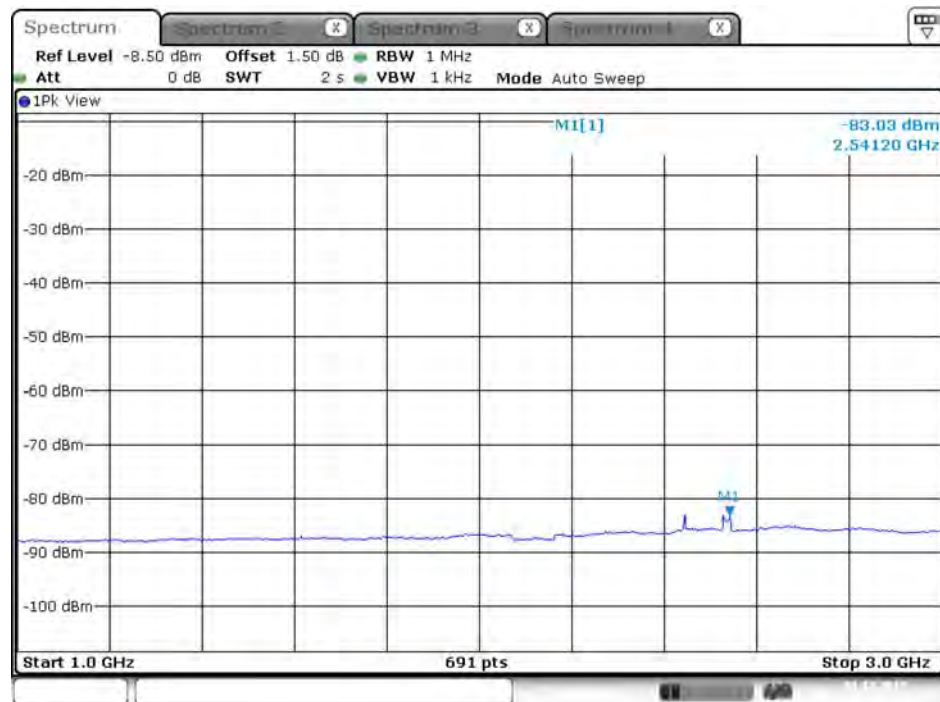


Date: 1.DEC.2017 10:46:47

### Plot on Configuration QPSK, 20M / 5580 MHz / Average / Port 2 / 1GHz~3GHz




Date: 1.DEC.2017 10:49:17

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 1 / 1GHz~3GHz

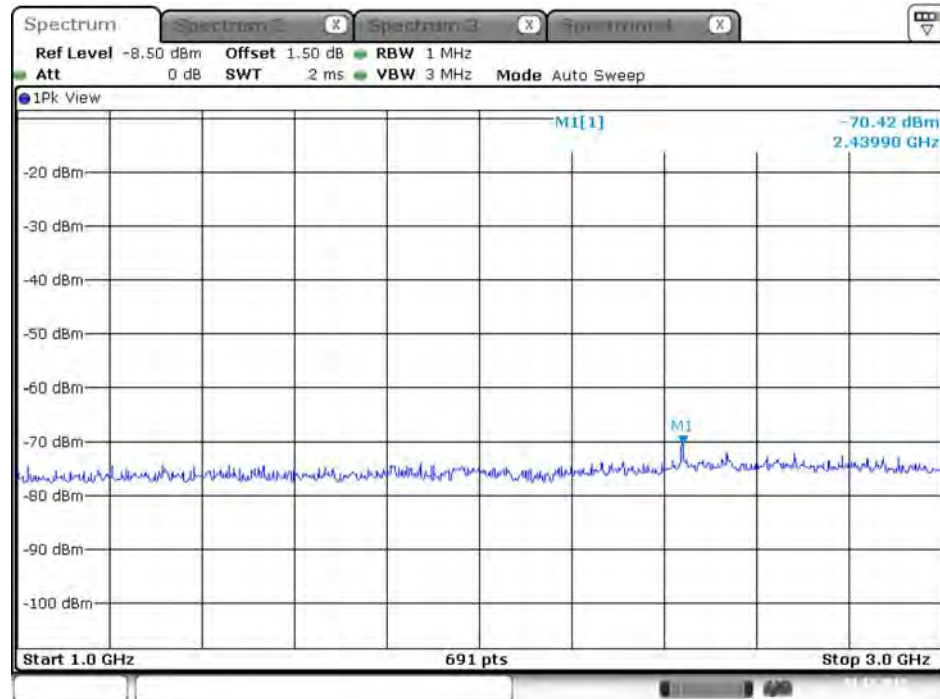


Date: 1.DEC.2017 10:47:09

### Plot on Configuration QPSK, 20M / 5580 MHz / Peak / Port 2 / 1GHz~3GHz

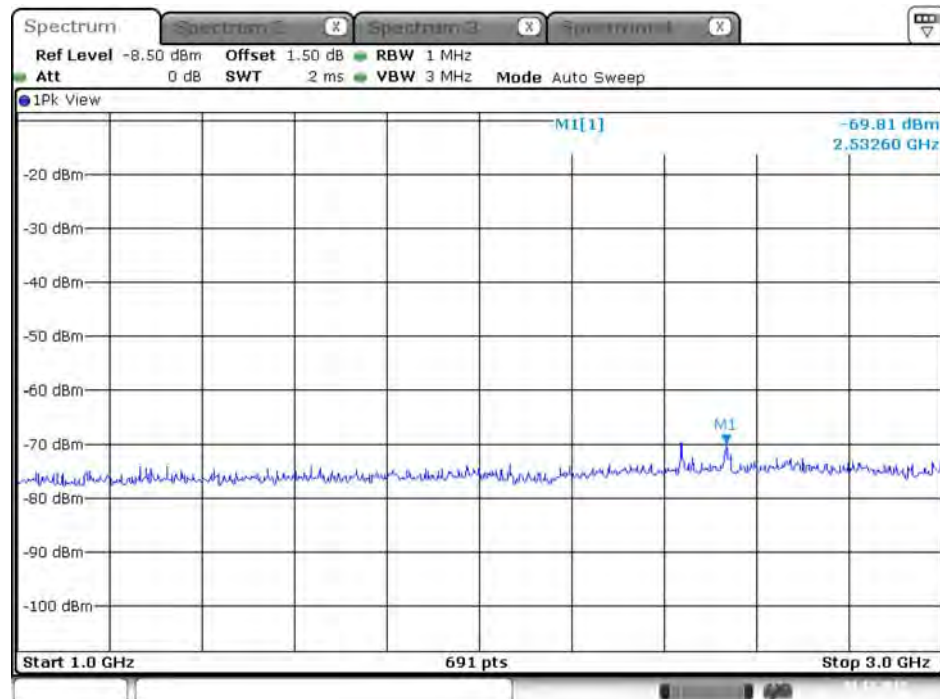


Date: 1.DEC.2017 10:49:31

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 1 / 1GHz~3GHz

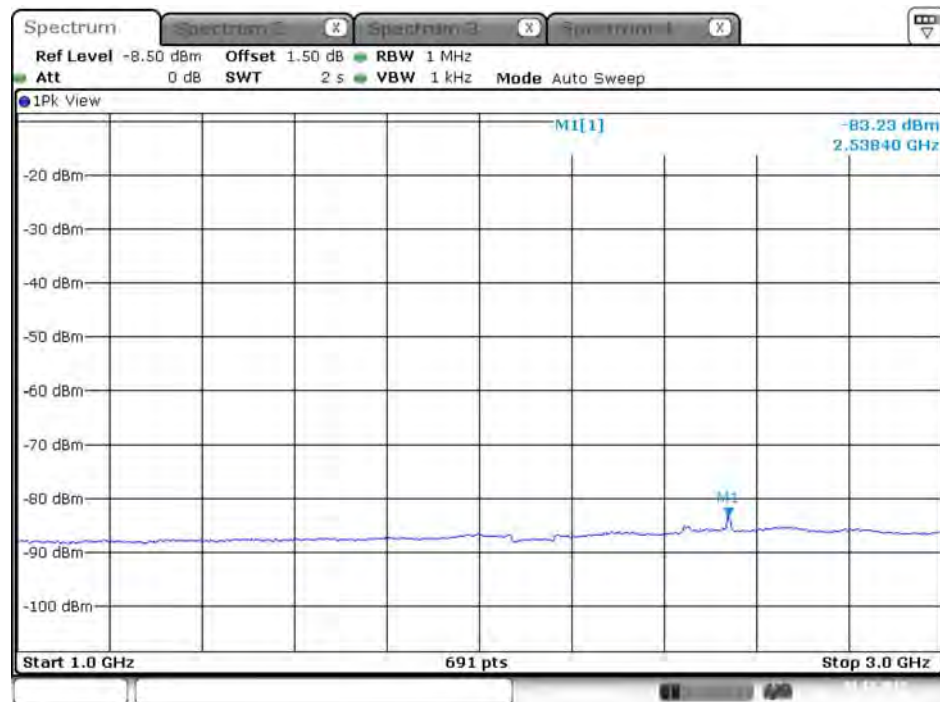


Date: 1.DEC.2017 10:48:06

### Plot on Configuration QPSK, 20M / 5650 MHz / Average / Port 2 / 1GHz~3GHz

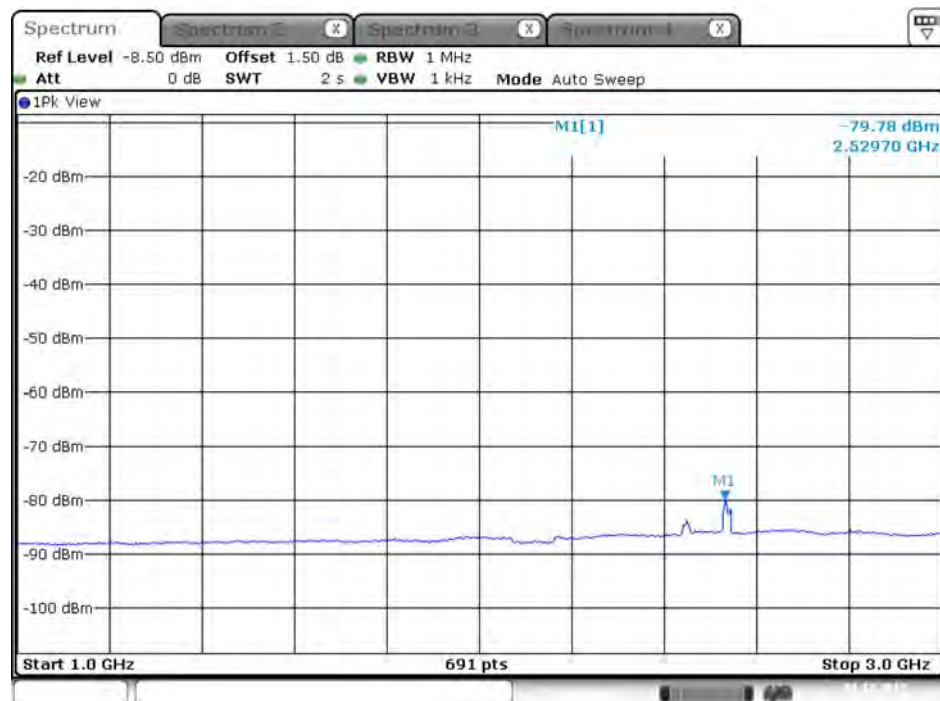


Date: 1.DEC.2017 10:50:43

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 1 / 1GHz~3GHz

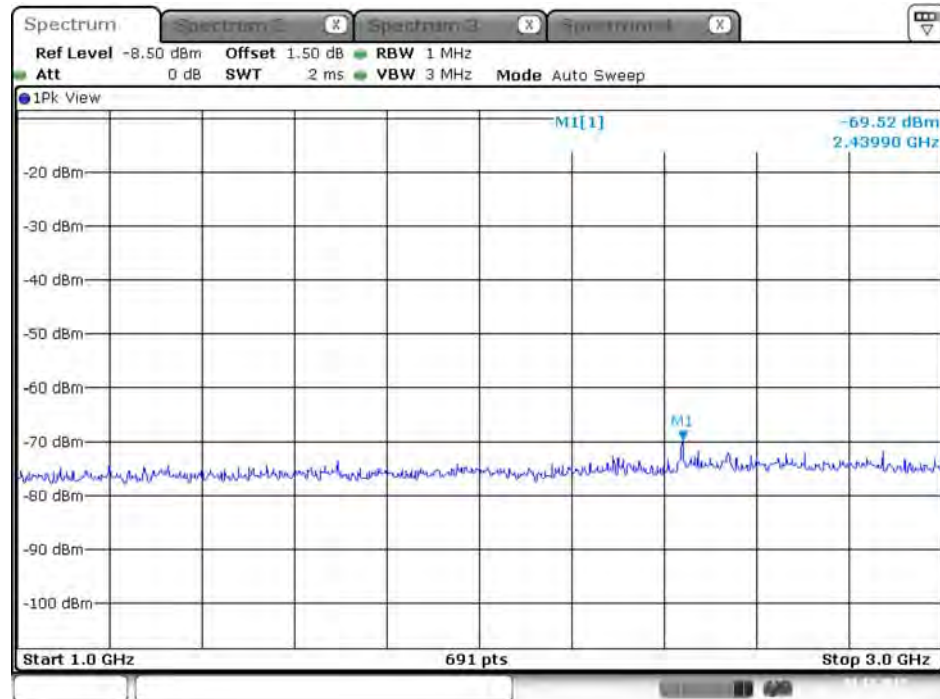


Date: 1.DEC.2017 10:47:47

### Plot on Configuration QPSK, 20M / 5650 MHz / Peak / Port 2 / 1GHz~3GHz

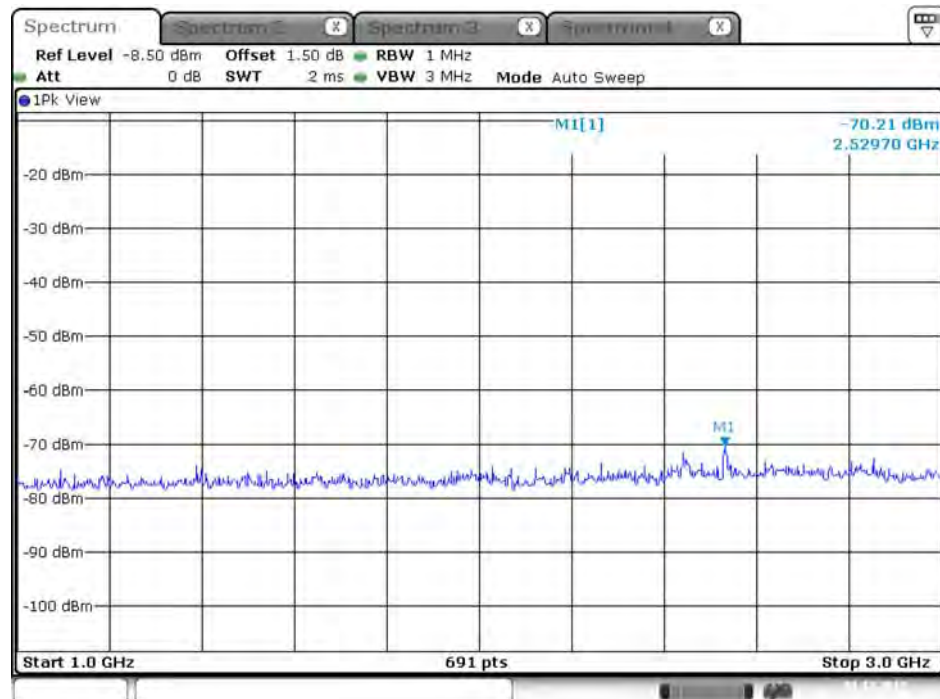


Date: 1.DEC.2017 10:50:28

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 1 / 1GHz~3GHz

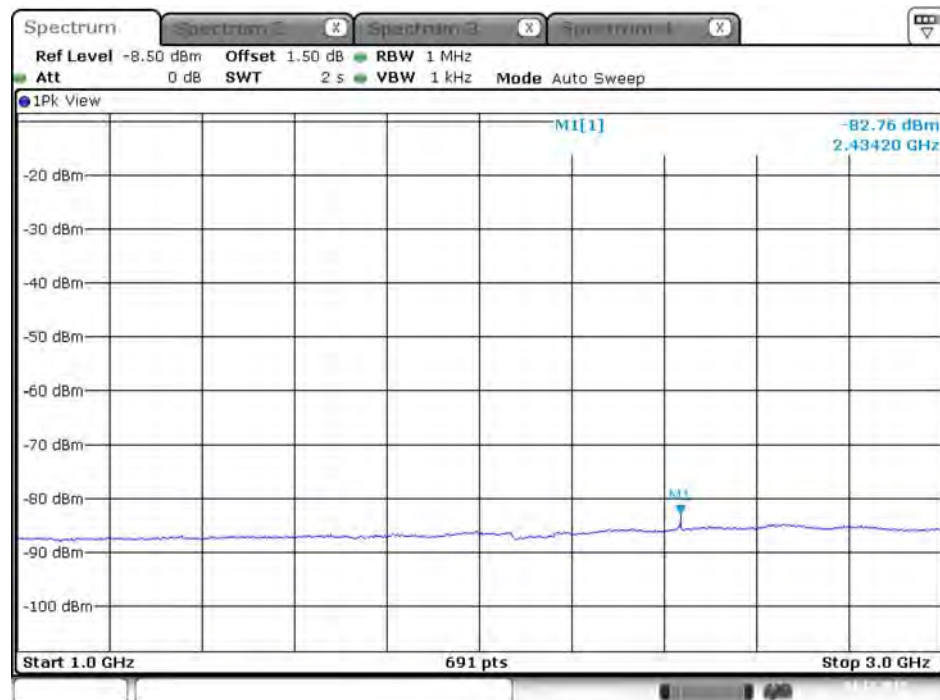


Date: 4 DEC. 2017 15:05:18

### Plot on Configuration QPSK, 20M / 5720 MHz / Average / Port 2 / 1GHz~3GHz

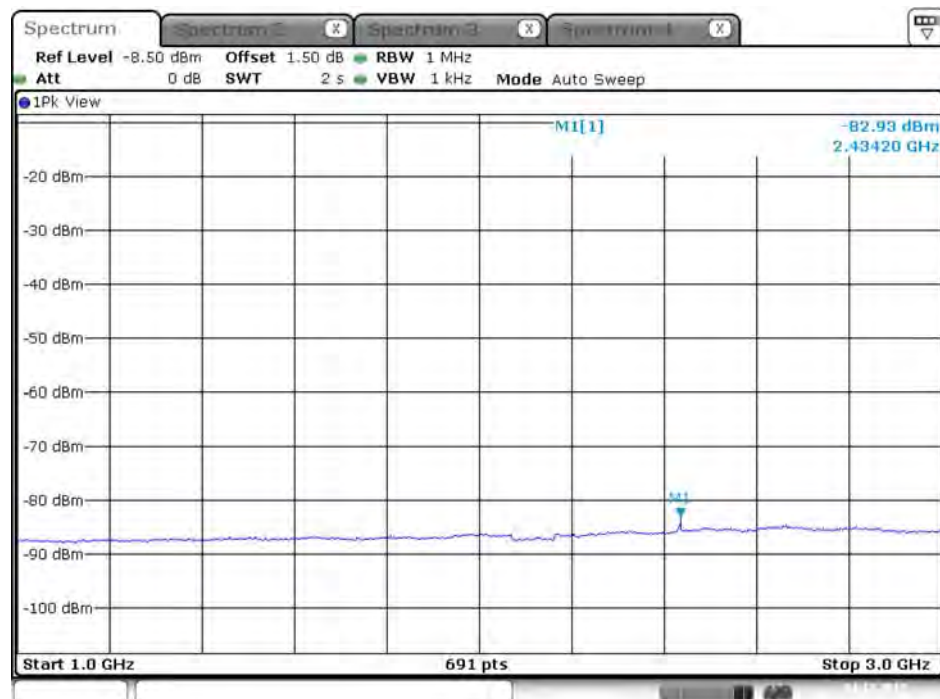


Date: 4 DEC. 2017 15:23:14

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 1 / 1GHz~3GHz

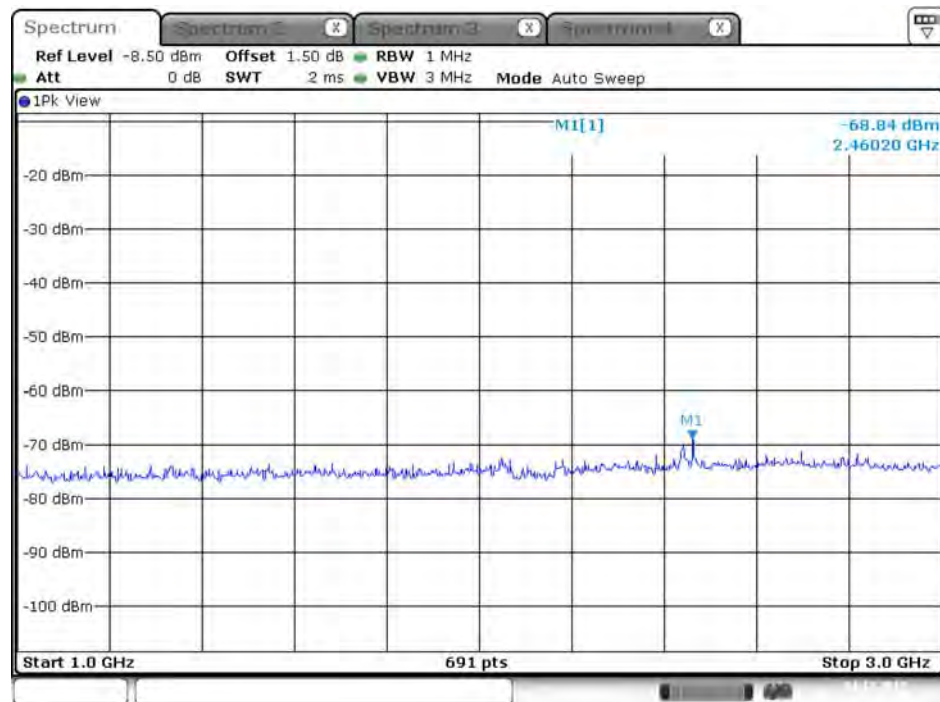

Date: 4 DEC. 2017 15:05:49

### Plot on Configuration QPSK, 20M / 5720 MHz / Peak / Port 2 / 1GHz~3GHz

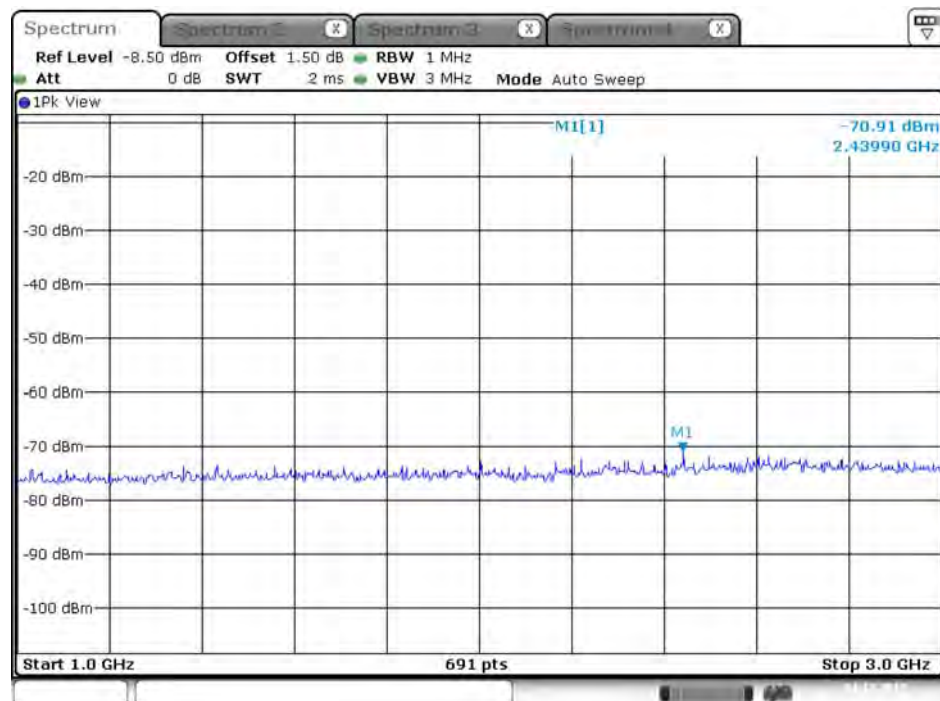

Date: 4 DEC. 2017 15:23:44

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 1 / 3GHz~6GHz




Date: 30.NOV.2017 20:56:22

### Plot on Configuration QPSK, 20M / 5260 MHz / Average / Port 2 / 3GHz~6GHz




Date: 30.NOV.2017 21:14:53

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 1 / 3GHz~6GHz

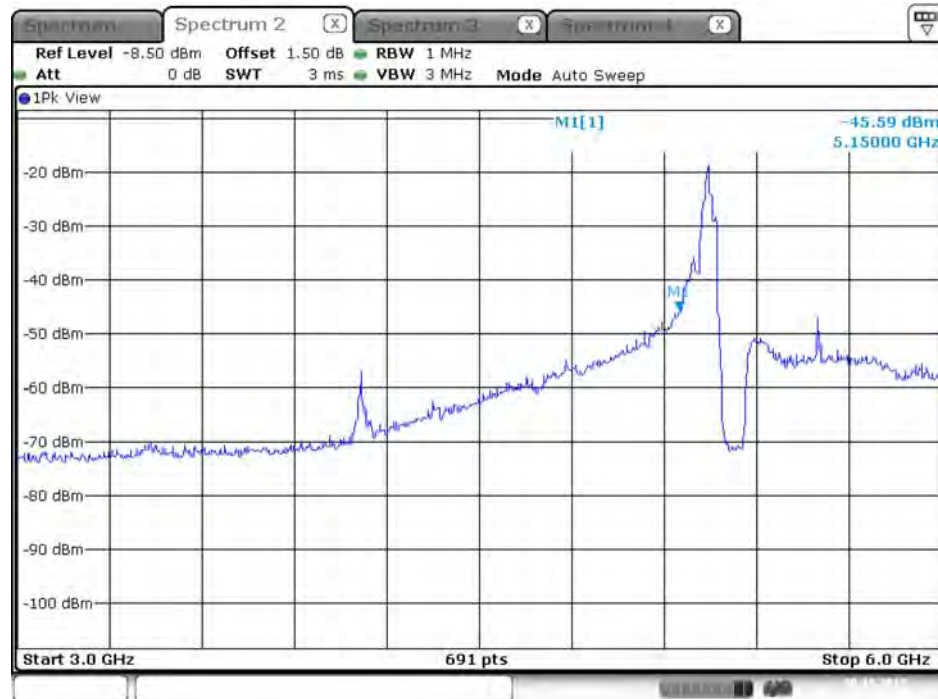

Date: 30.NOV.2017 20:58:08

### Plot on Configuration QPSK, 20M / 5260 MHz / Peak / Port 2 / 3GHz~6GHz

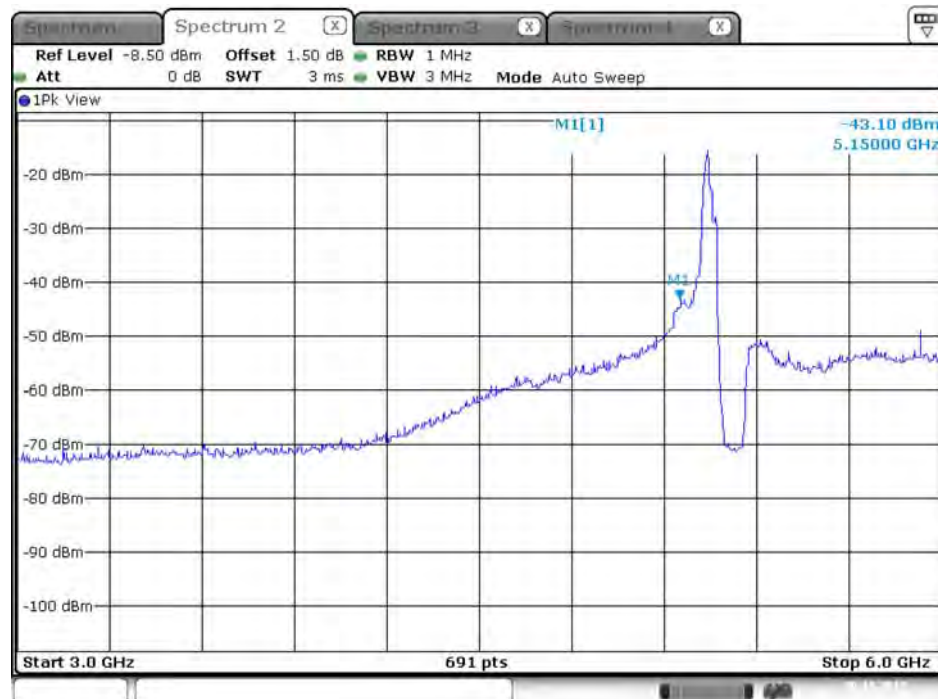

Date: 30.NOV.2017 21:15:31

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 1 / 3GHz~6GHz



Date: 30.NOV.2017 21:21:34

### Plot on Configuration QPSK, 20M / 5300 MHz / Average / Port 2 / 3GHz~6GHz




Date: 30.NOV.2017 22:09:53

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 1 / 3GHz~6GHz



Date: 30.NOV.2017 21:22:29

### Plot on Configuration QPSK, 20M / 5300 MHz / Peak / Port 2 / 3GHz~6GHz

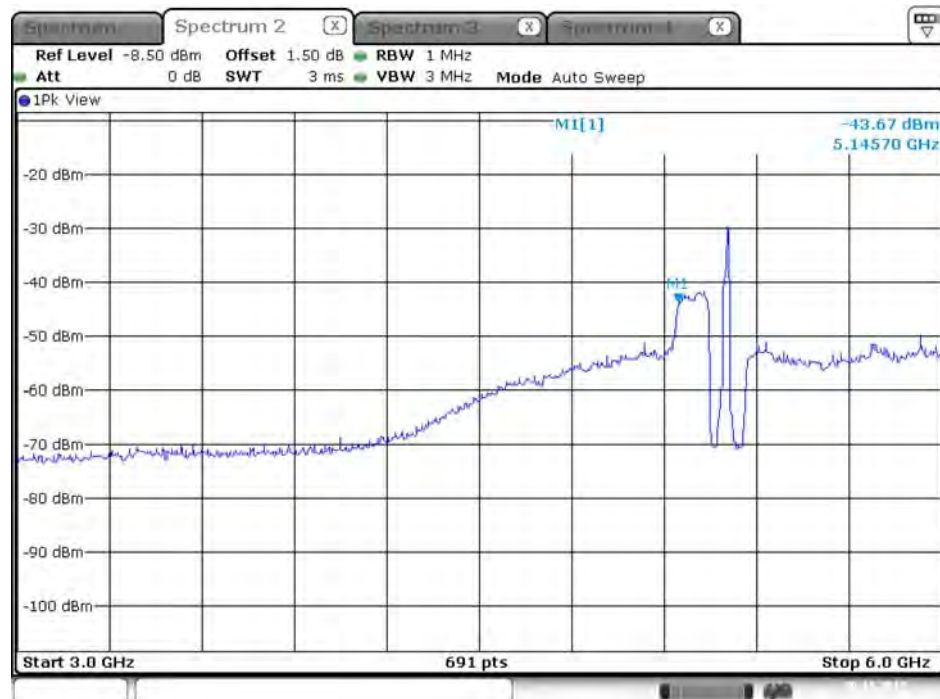

Date: 30.NOV.2017 22:10:43

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 1 / 3GHz~6GHz




Date: 30.NOV.2017 22:17:12

### Plot on Configuration QPSK, 20M / 5320 MHz / Average / Port 2 / 3GHz~6GHz




Date: 30.NOV.2017 22:33:01

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 1 / 3GHz~6GHz

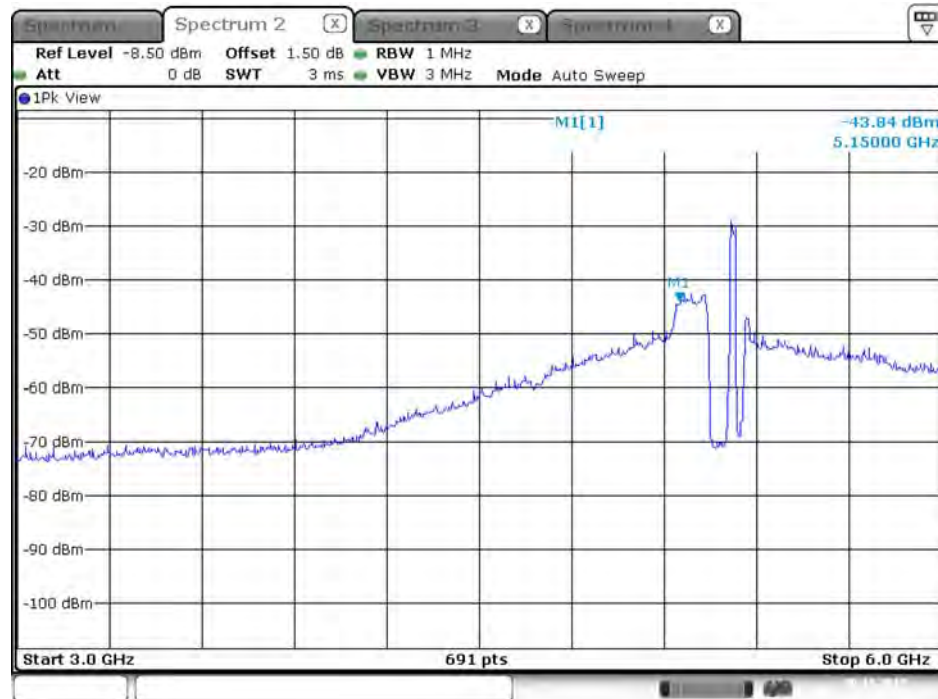

Date: 30.NOV.2017 22:17:58

### Plot on Configuration QPSK, 20M / 5320 MHz / Peak / Port 2 / 3GHz~6GHz

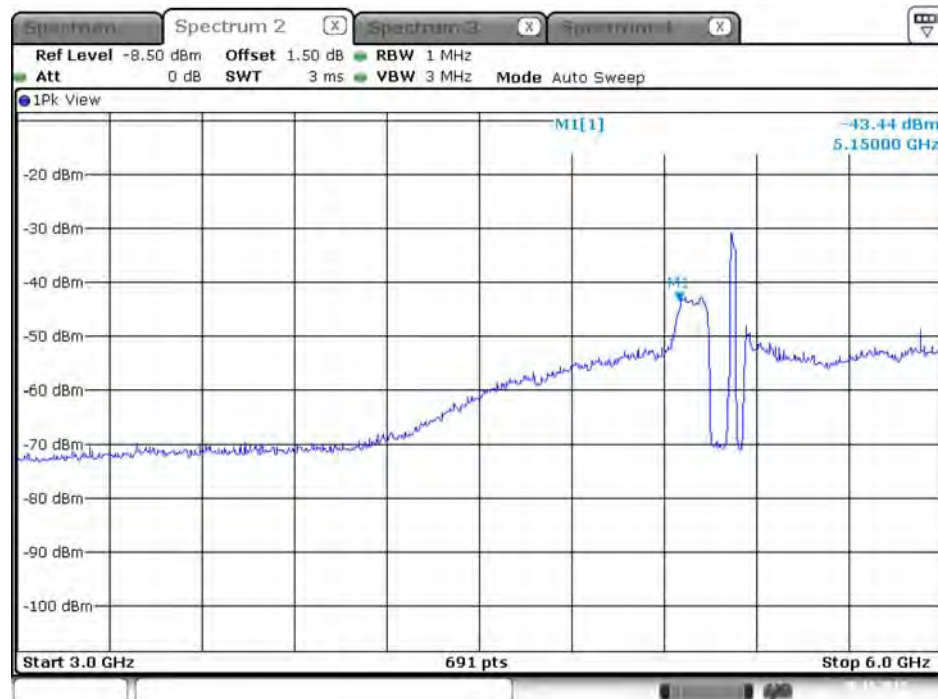

Date: 30.NOV.2017 22:33:59

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 1 / 3GHz~6GHz




Date: 1.DEC.2017 00:14:48

### Plot on Configuration QPSK, 20M / 5250 MHz / Average / Port 2 / 3GHz~6GHz




Date: 1.DEC.2017 00:35:33

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 1 / 3GHz~6GHz

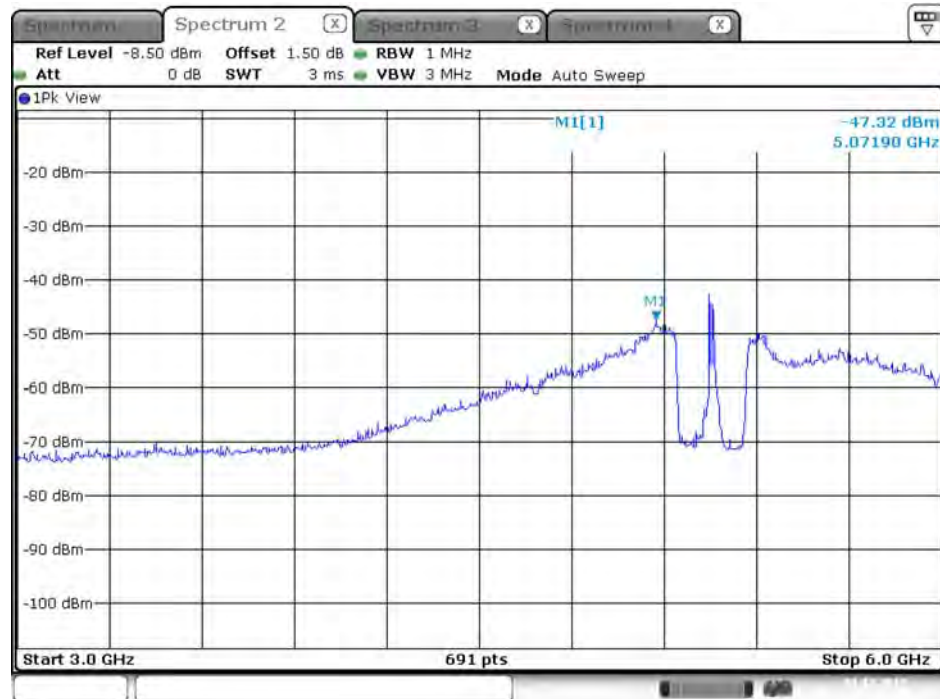

Date: 1.DEC.2017 00:15:23

### Plot on Configuration QPSK, 20M / 5250 MHz / Peak / Port 2 / 3GHz~6GHz

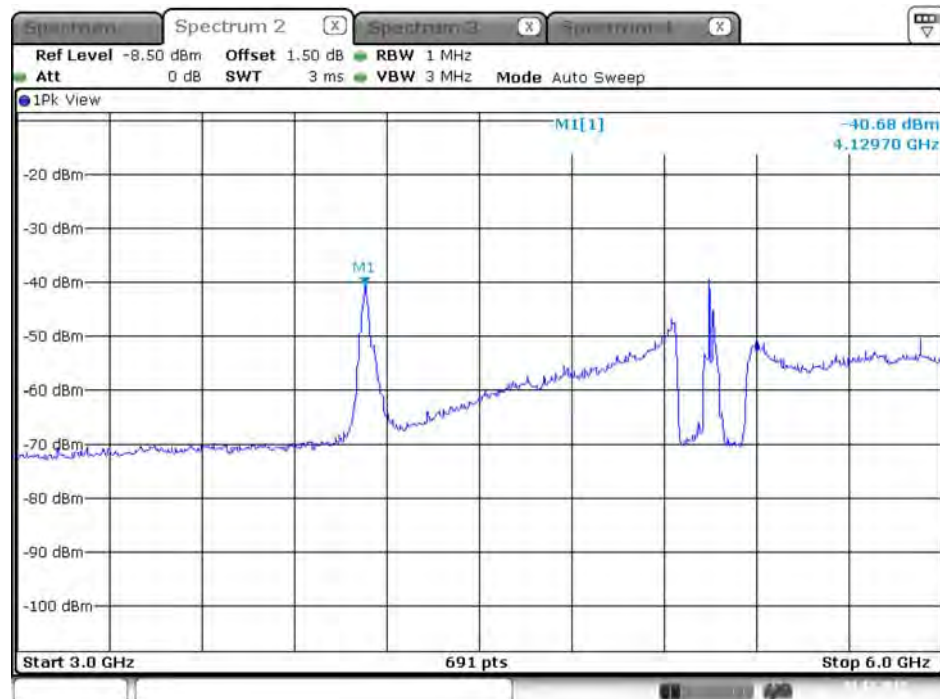

Date: 1.DEC.2017 00:38:51