






11G_Ant0_High_2462

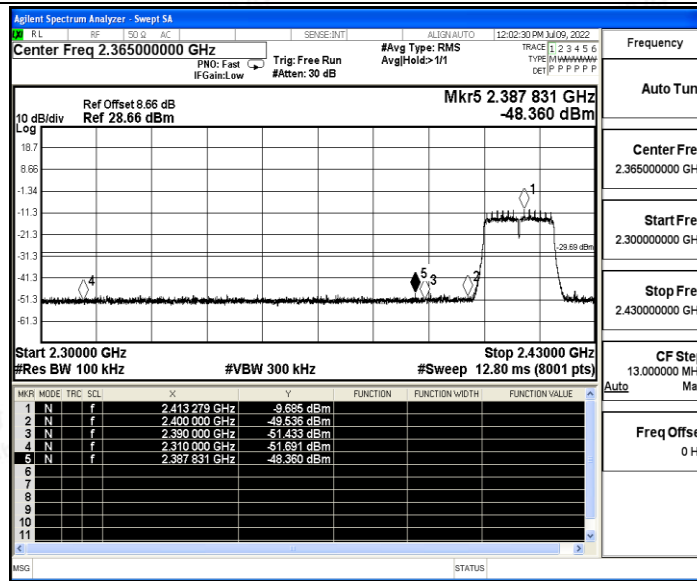


11N20SISO_Ant0_Low_2412

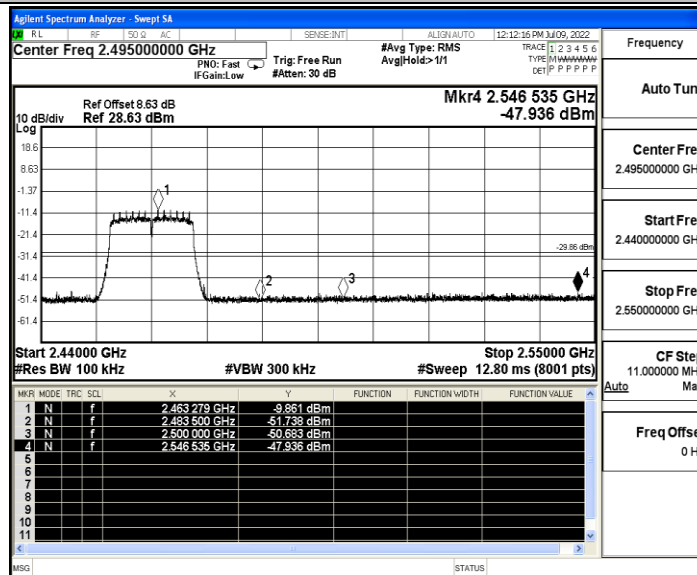

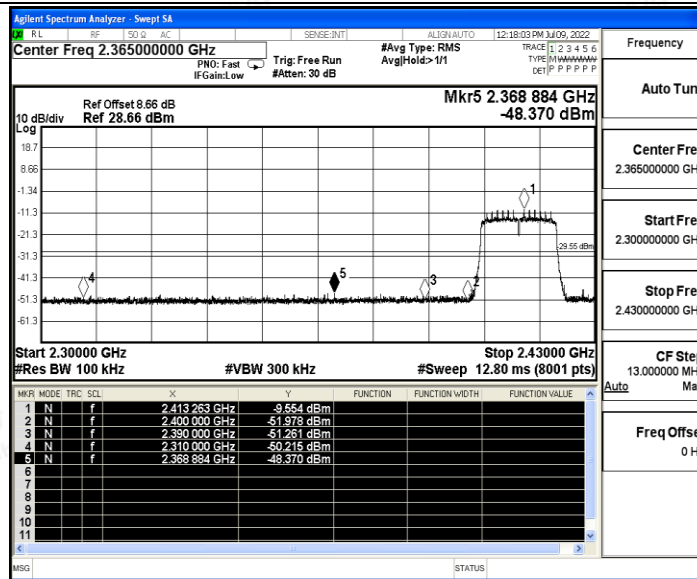

11N20SISO_Ant0_High_2462

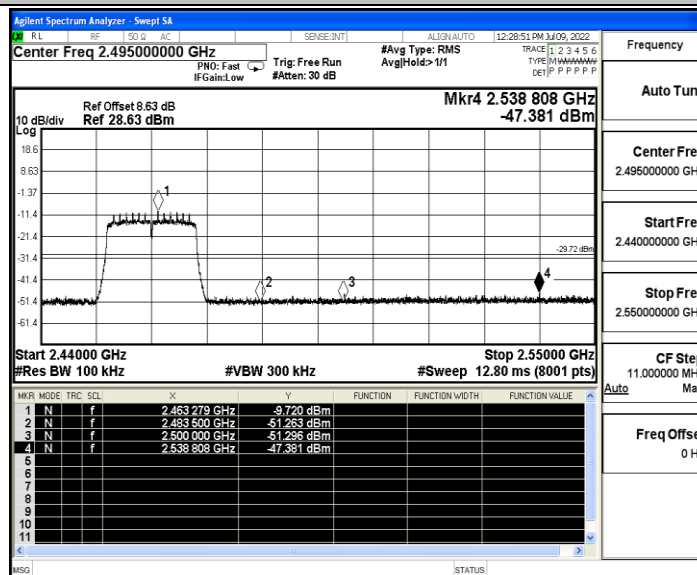

11N40SISO_Ant0_Low_2422




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

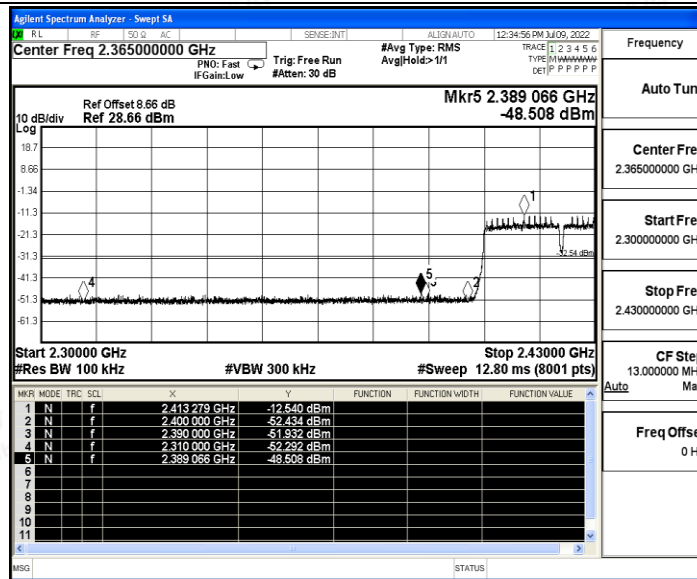


11N40SISO_Ant0_High_2452

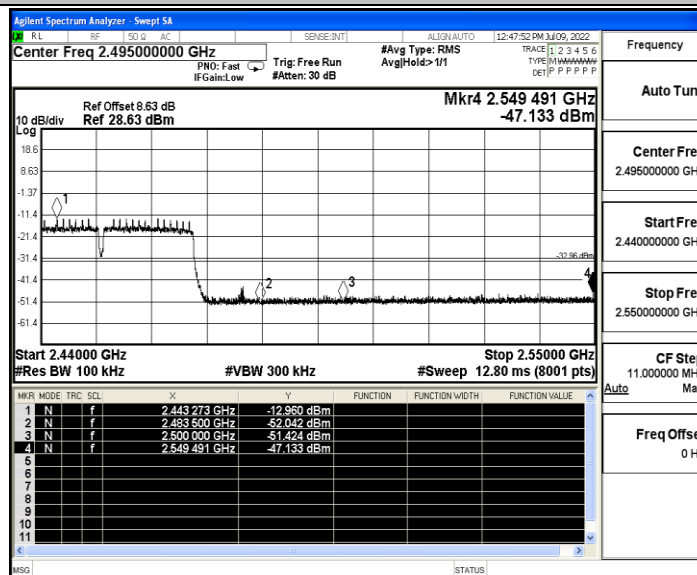


11AX20SISO_Ant0_Low_2412



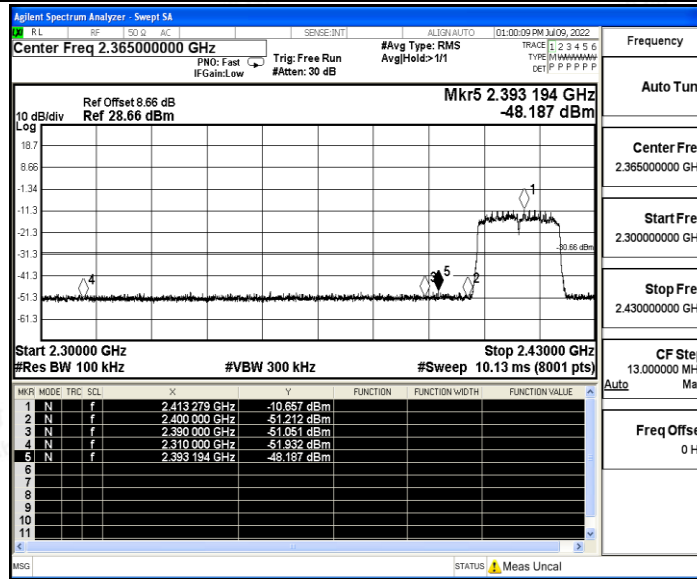


11AX20SISO_Ant0_High_2462

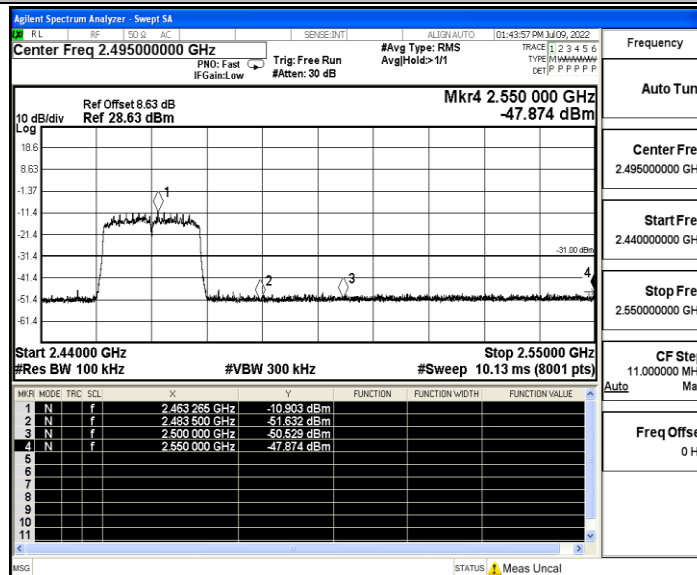


11AX40SISO_Ant0_Low_2422



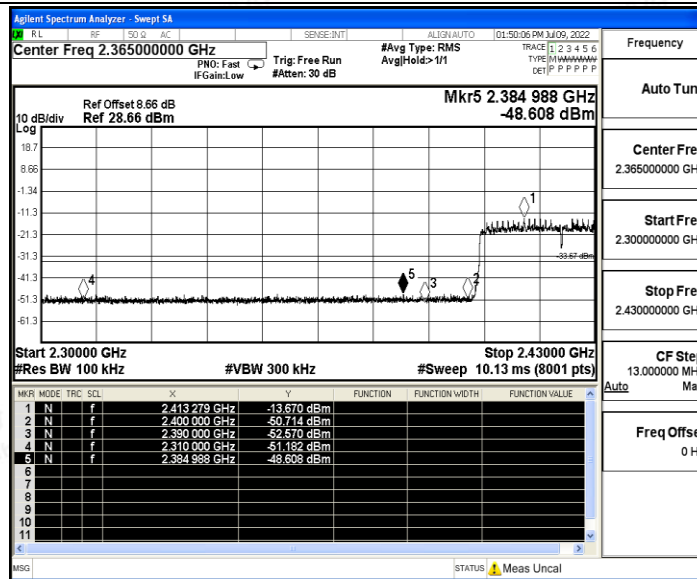

11AX40SISO_Ant0_High_2452

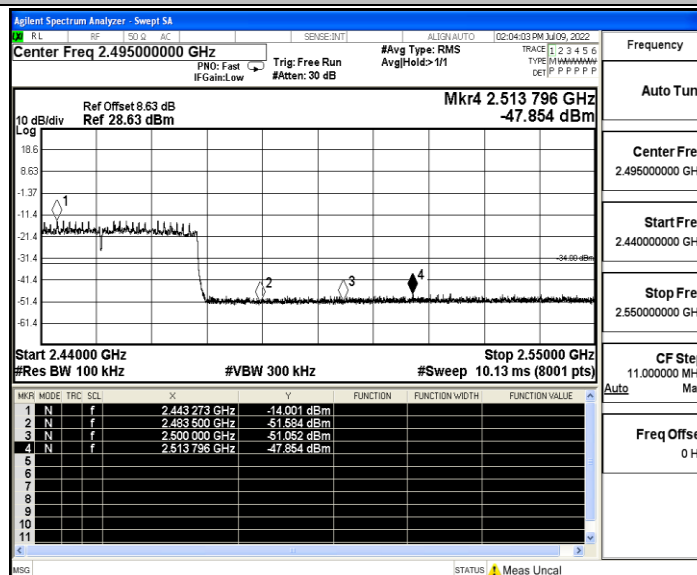

**Test Result**


TestMode	Antenna	ChName	Channel	RefLevel[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	Low	2412	-8.00	-48.65	≤ -28	PASS
		High	2462	-4.98	-47.67	≤ -24.98	PASS
11G	Ant1	Low	2412	-9.41	-47.77	≤ -29.41	PASS
		High	2462	-10.23	-48.14	≤ -30.23	PASS
11N20SISO	Ant1	Low	2412	-9.47	-48.87	≤ -29.47	PASS
		High	2462	-10.39	-47.45	≤ -30.39	PASS
11N40SISO	Ant1	Low	2422	-12.31	-48.42	≤ -32.31	PASS
		High	2452	-12.94	-47.79	≤ -32.94	PASS
11AX20SISO	Ant1	Low	2412	-10.44	-48.74	≤ -30.44	PASS
		High	2462	-11.21	-47.9	≤ -31.21	PASS
11AX40SISO	Ant1	Low	2422	-13.40	-47.81	≤ -33.4	PASS
		High	2452	-14.29	-47.67	≤ -34.29	PASS






Test Graphs

11B_Ant1_Low_2412

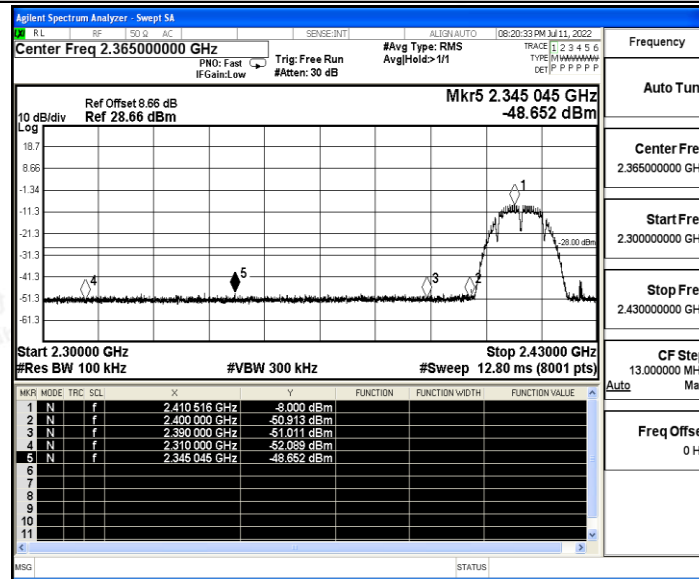


11B_Ant1_High_2462

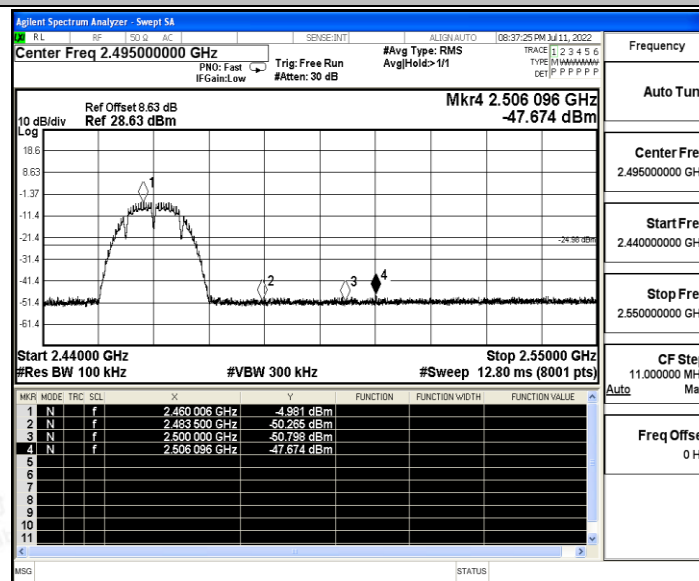


11G_Ant1_Low_2412



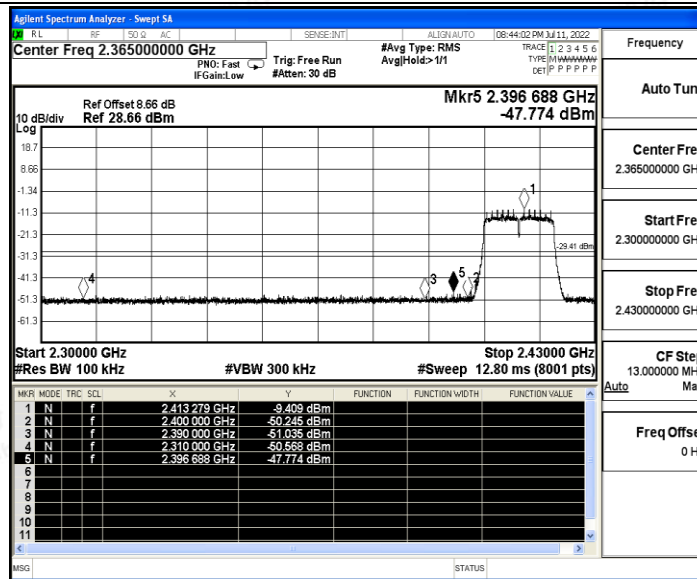


11G_Ant1_High_2462

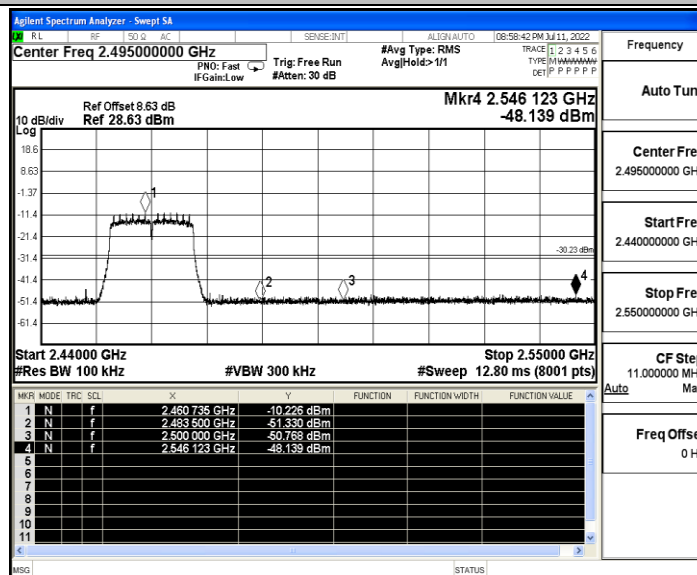


11N20SISO_Ant1_Low_2412



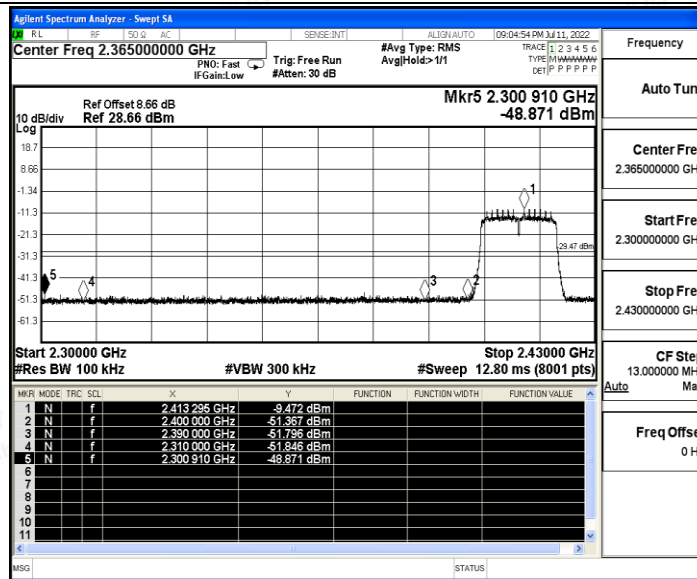


11N20SISO_Ant1_High_2462

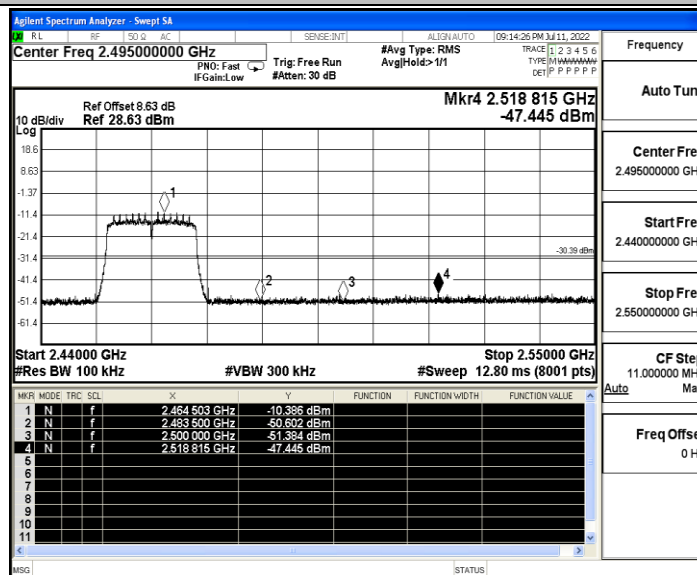


11N40SISO_Ant1_Low_2422



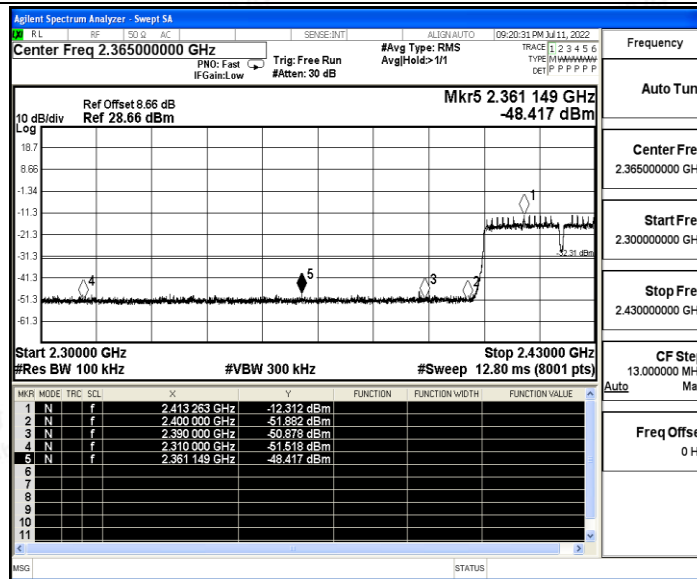


11N40SISO_Ant1_High_2452

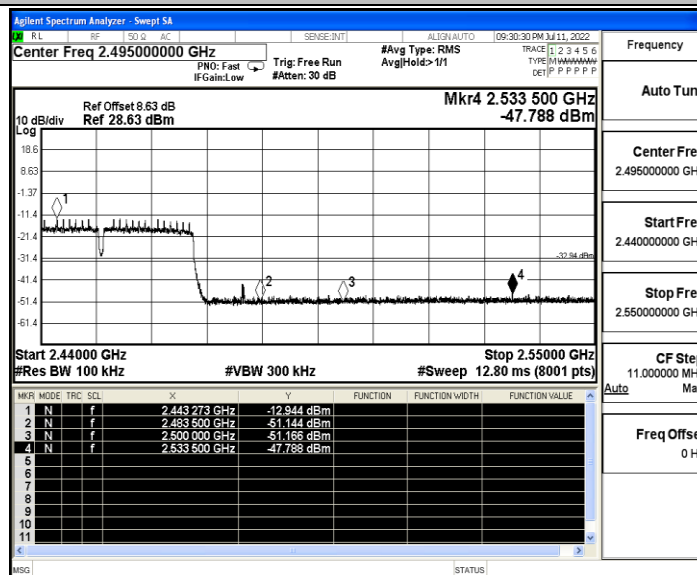


11AX20SISO_Ant1_Low_2412



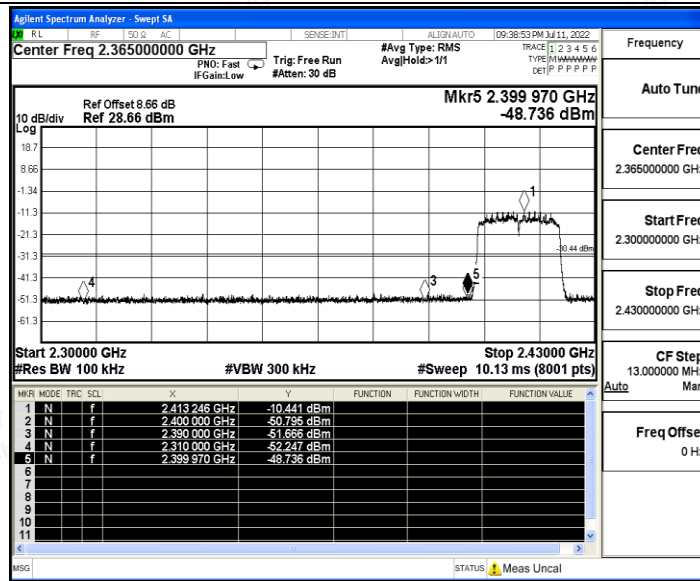


11AX20SISO_Ant1_High_2462

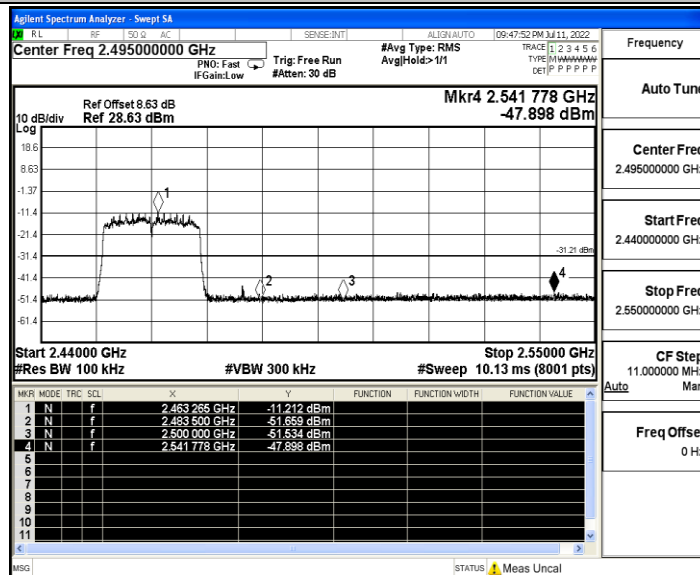


11AX40SISO_Ant1_Low_2422



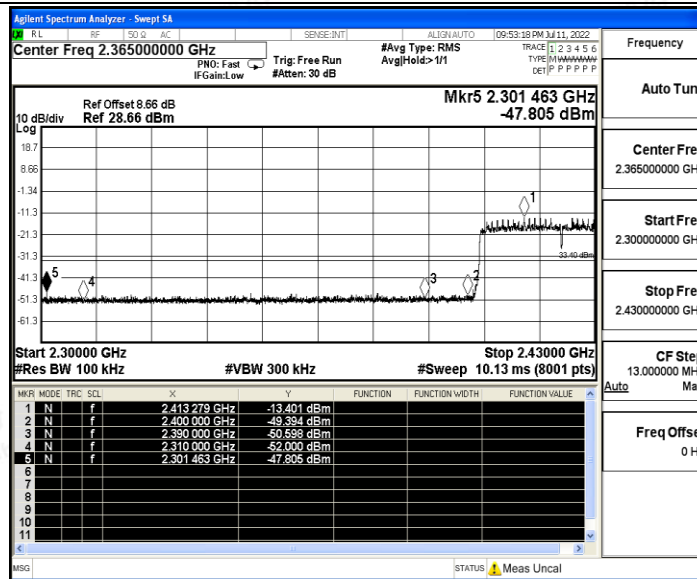

11AX40SISO_Ant1_High_2452

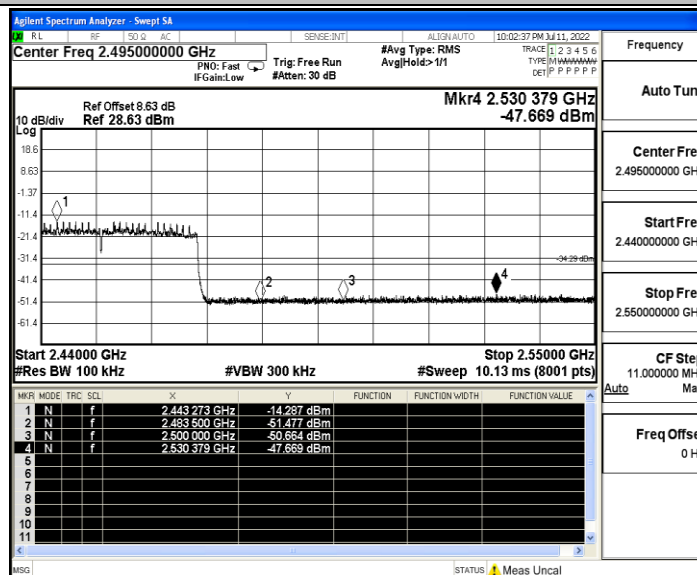



C.5 Conducted Spurious Emission

Test Result

TestMode	Antenna	Channel	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant0	2412	Reference	-4.42	-4.42	---	PASS
			30~1000	-4.42	-60.26	≤-24.42	PASS
			1000~26500	-4.42	-46.03	≤-24.42	PASS
		2437	Reference	-4.61	-4.61	---	PASS
			30~1000	-4.61	-60.2	≤-24.61	PASS
			1000~26500	-4.61	-46.53	≤-24.61	PASS
		2462	Reference	-7.83	-7.83	---	PASS
			30~1000	-7.83	-60.05	≤-27.83	PASS
			1000~26500	-7.83	-45.95	≤-27.83	PASS
11G	Ant0	2412	Reference	-9.62	-9.62	---	PASS
			30~1000	-9.62	-59.89	≤-29.62	PASS
			1000~26500	-9.62	-45.8	≤-29.62	PASS
		2437	Reference	-10.14	-10.14	---	PASS
			30~1000	-10.14	-60.34	≤-30.14	PASS
			1000~26500	-10.14	-45.31	≤-30.14	PASS
		2462	Reference	-9.94	-9.94	---	PASS
			30~1000	-9.94	-46.93	≤-29.94	PASS
			1000~26500	-9.94	-44.9	≤-29.94	PASS
11N20SISO	Ant0	2412	Reference	-9.57	-9.57	---	PASS
			30~1000	-9.57	-39.81	≤-29.57	PASS
			1000~26500	-9.57	-46.18	≤-29.57	PASS
		2437	Reference	-10.16	-10.16	---	PASS
			30~1000	-10.16	-60.8	≤-30.16	PASS
			1000~26500	-10.16	-46.14	≤-30.16	PASS
		2462	Reference	-9.60	-9.60	---	PASS
			30~1000	-9.60	-35.1	≤-29.6	PASS
			1000~26500	-9.60	-46.2	≤-29.6	PASS
11N40SISO	Ant0	2422	Reference	-12.59	-12.59	---	PASS
			30~1000	-12.59	-60.03	≤-32.59	PASS
			1000~26500	-12.59	-45.73	≤-32.59	PASS
		2437	Reference	-12.60	-12.60	---	PASS
			30~1000	-12.60	-38.67	≤-32.6	PASS
			1000~26500	-12.60	-46.06	≤-32.6	PASS
		2452	Reference	-12.85	-12.85	---	PASS
			30~1000	-12.85	-60.99	≤-32.85	PASS






			1000~26500	-12.85	-46.14	≤ -32.85	PASS
11AX20SISO	Ant0	2412	Reference	-10.83	-10.83	---	PASS
			30~1000	-10.83	-60.7	≤ -30.83	PASS
			1000~26500	-10.83	-45.27	≤ -30.83	PASS
		2437	Reference	-10.90	-10.90	---	PASS
			30~1000	-10.90	-59.94	≤ -30.9	PASS
			1000~26500	-10.90	-46.22	≤ -30.9	PASS
		2462	Reference	-11.11	-11.11	---	PASS
			30~1000	-11.11	-60.91	≤ -31.11	PASS
			1000~26500	-11.11	-46.24	≤ -31.11	PASS
11AX40SISO	Ant0	2422	Reference	-13.91	-13.91	---	PASS
			30~1000	-13.91	-60.14	≤ -33.91	PASS
			1000~26500	-13.91	-46.64	≤ -33.91	PASS
		2437	Reference	-14.05	-14.05	---	PASS
			30~1000	-14.05	-60.22	≤ -34.05	PASS
			1000~26500	-14.05	-46.53	≤ -34.05	PASS
		2452	Reference	-14.10	-14.10	---	PASS
			30~1000	-14.10	-60.28	≤ -34.1	PASS
			1000~26500	-14.10	-46.73	≤ -34.1	PASS






Test Graphs

11B_Ant0_2412_0~Reference

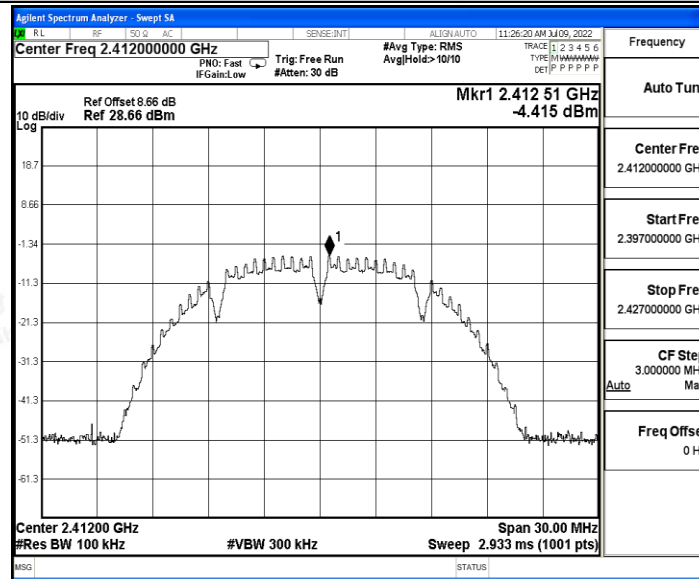


11B_Ant0_2412_30~1000

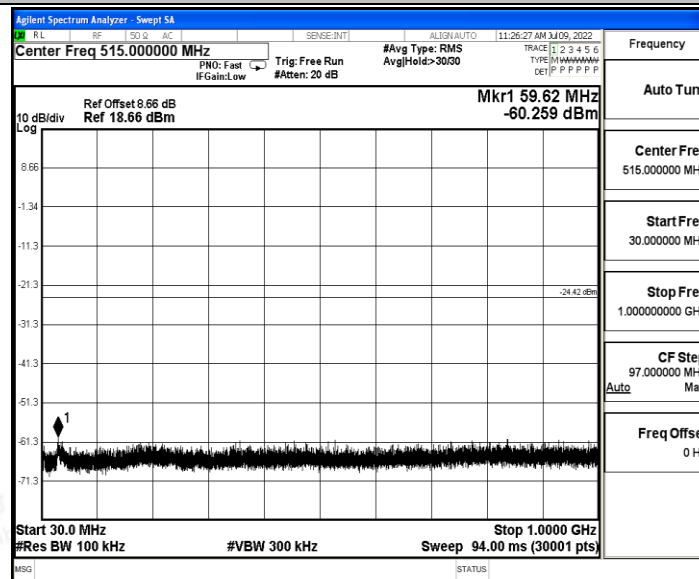


11B_Ant0_2412_1000~26500



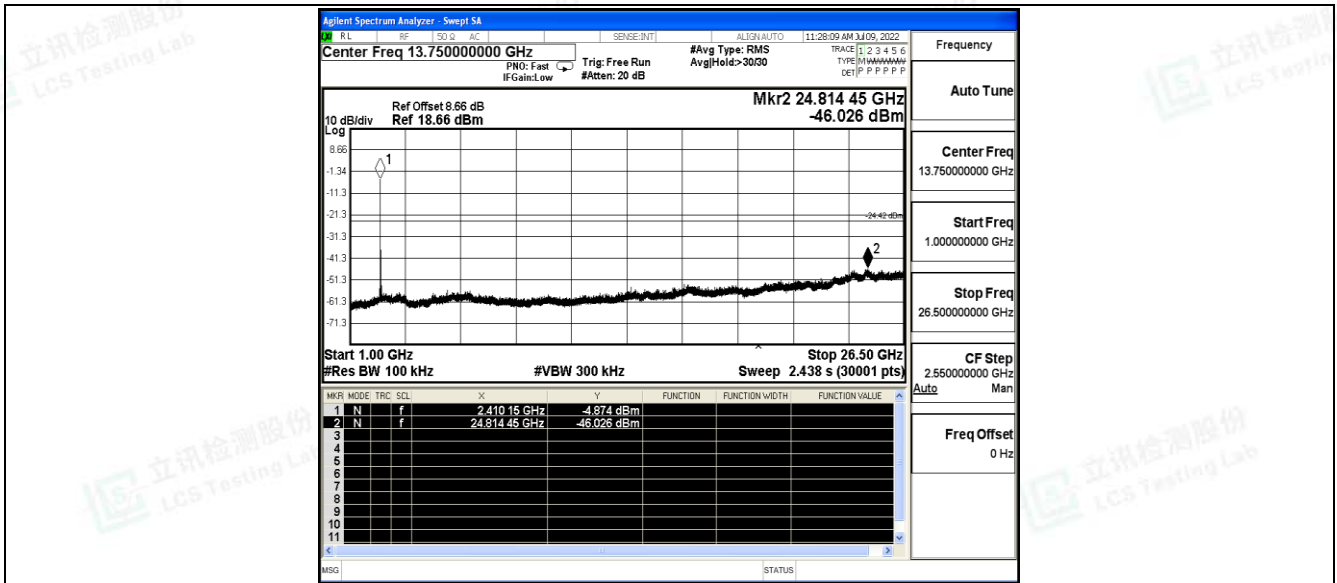

11B_Ant0_2437_0~Reference

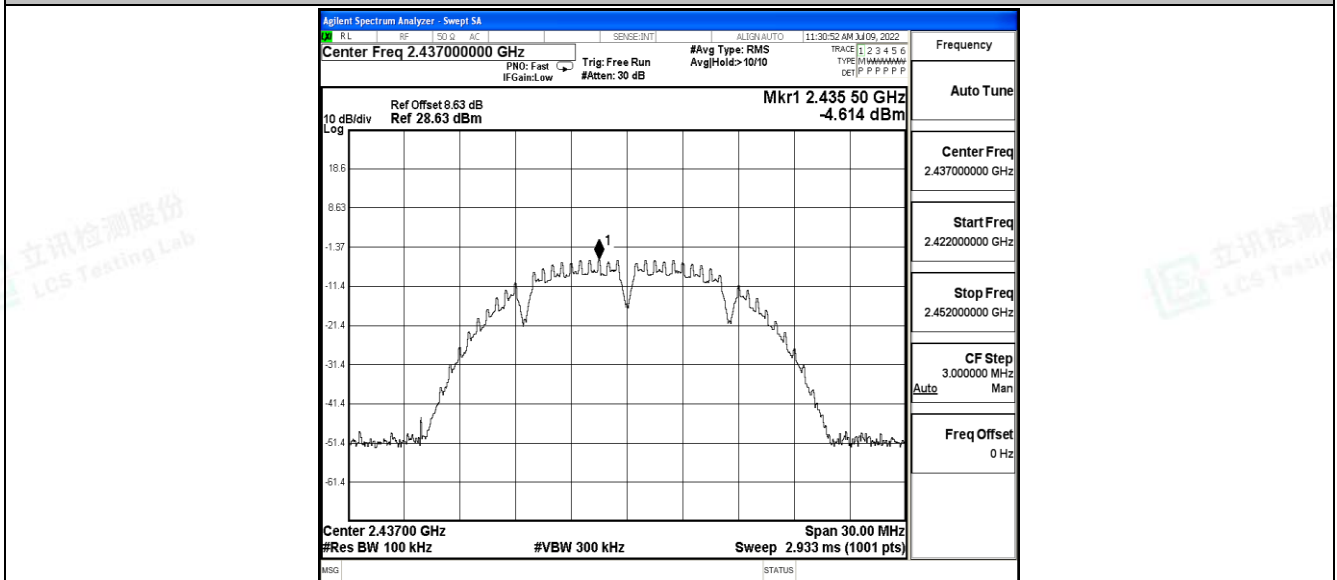

11B_Ant0_2437_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

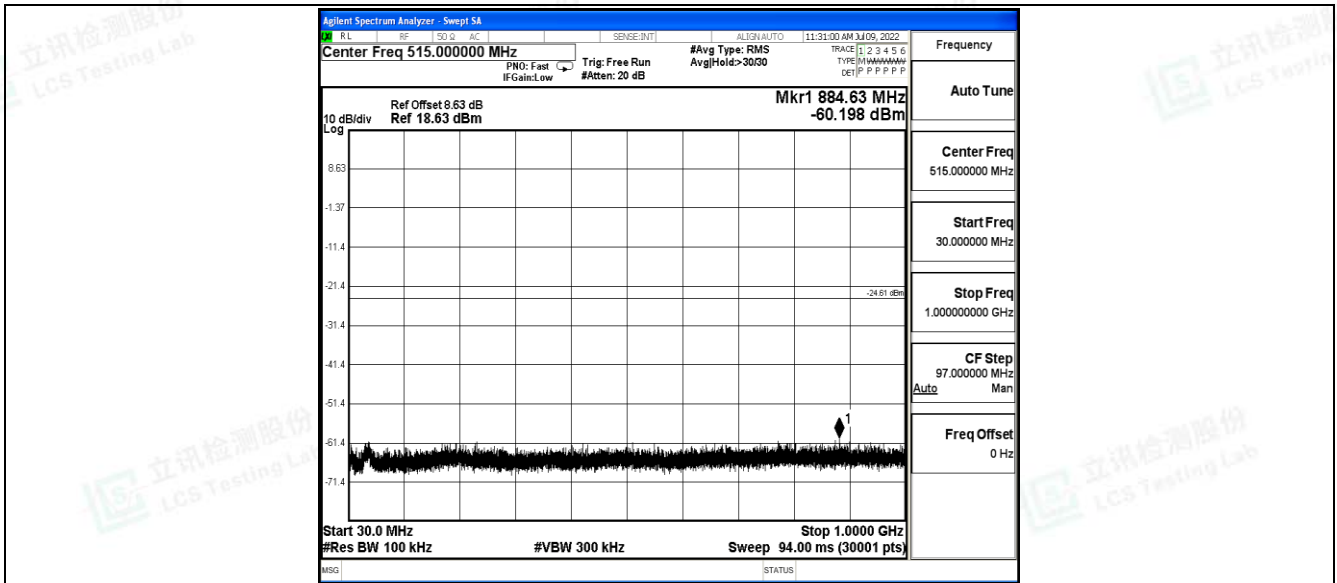


11B_Ant0_2437_1000~26500

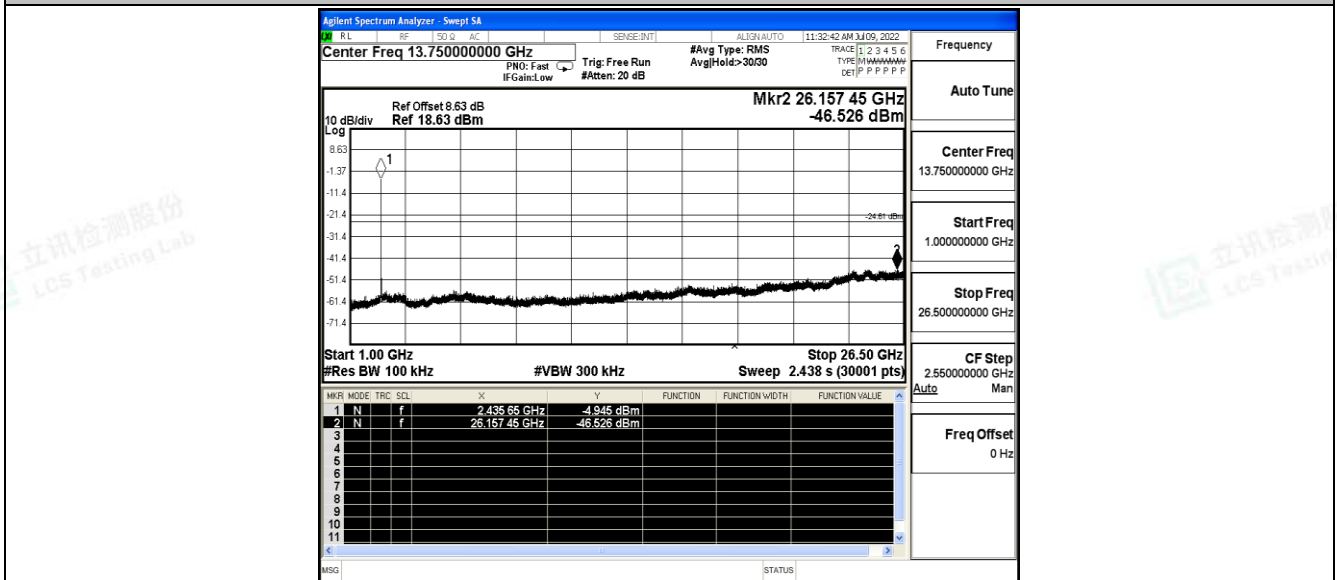


11B_Ant0_2462_30~1000



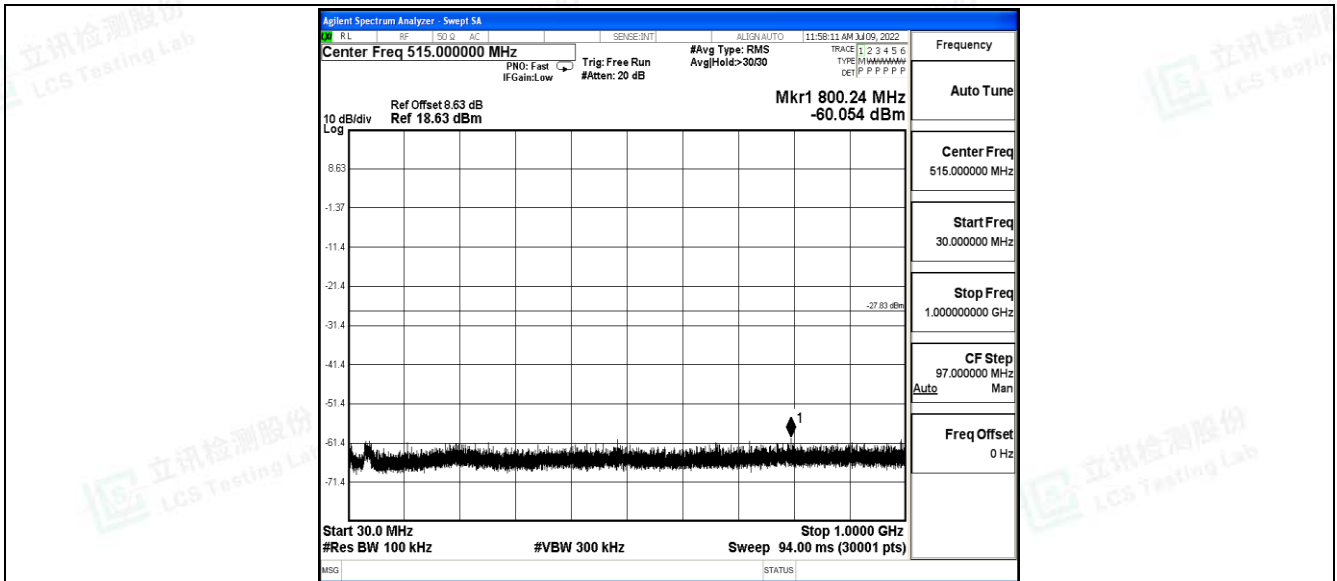


11B_Ant0_2462_1000~26500

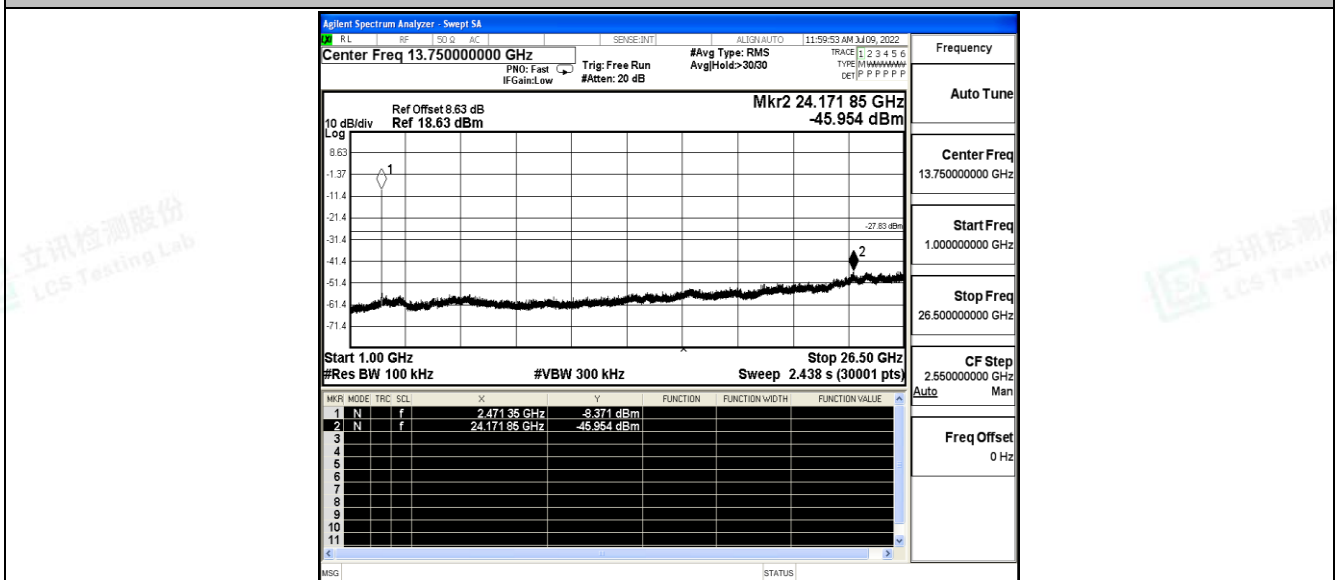


11G_Ant0_2412_0-Reference



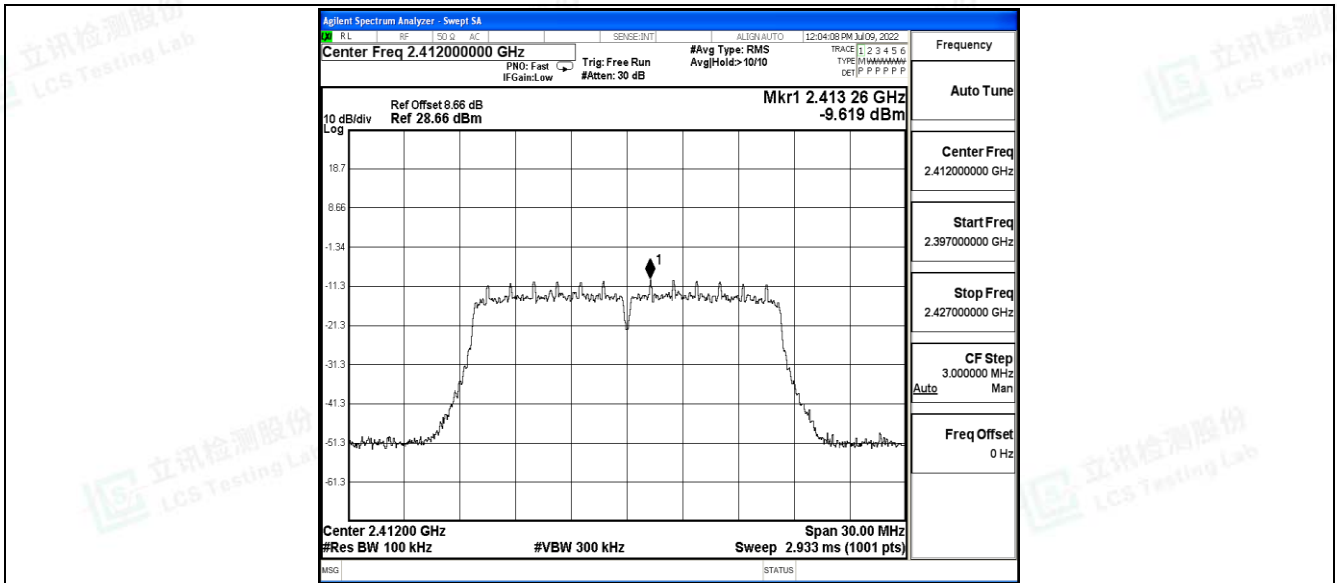


11G_Ant0_2412_30~1000

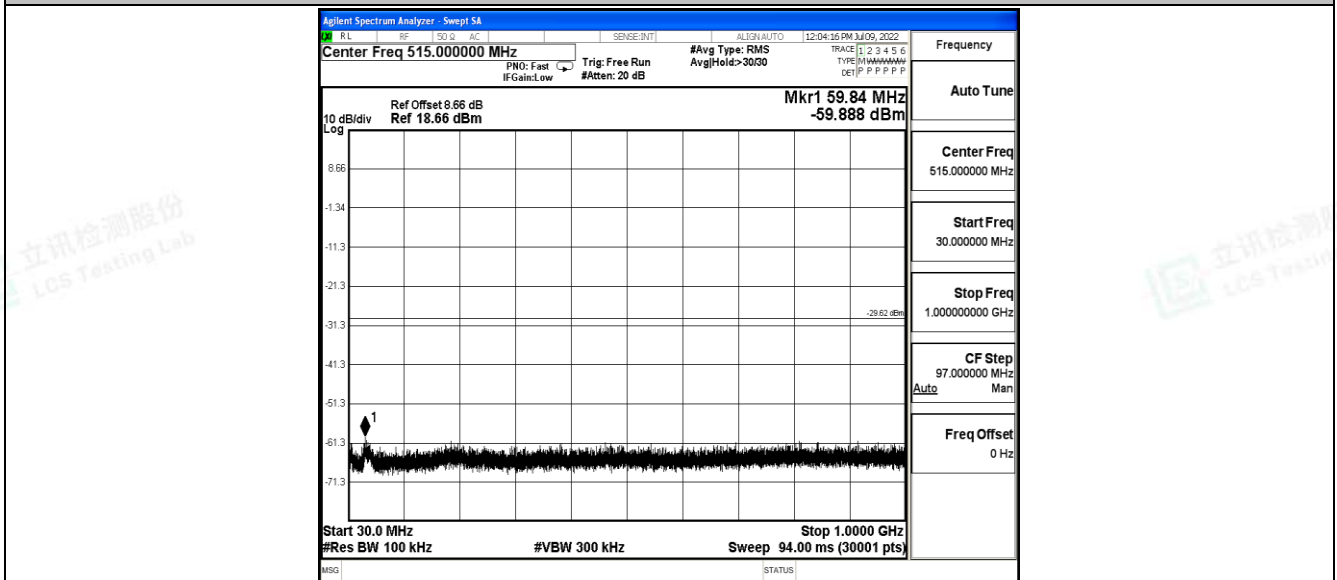


11G_Ant0_2412_1000~26500



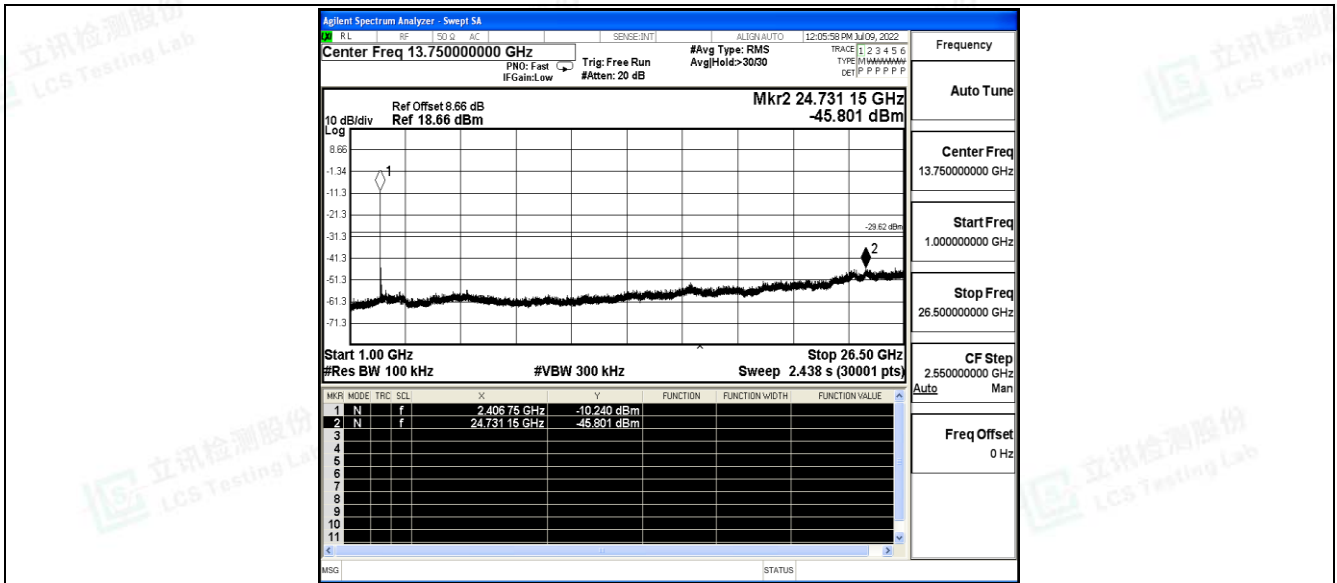


11G_Ant0_2437_0~Reference

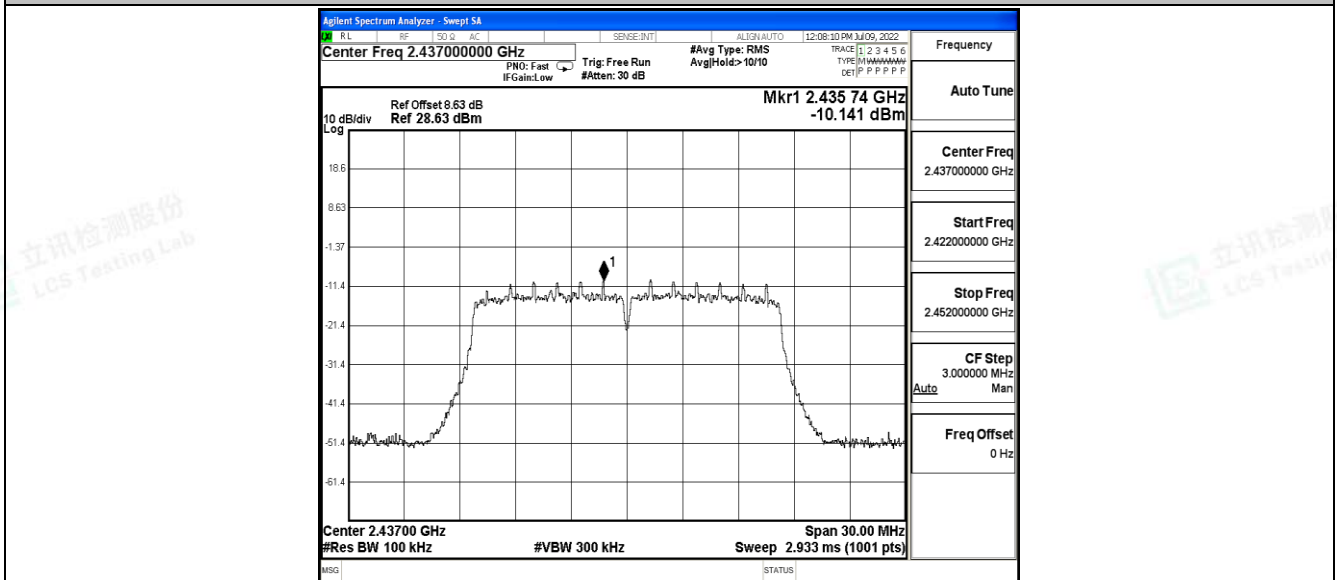


11G_Ant0_2437_30~1000



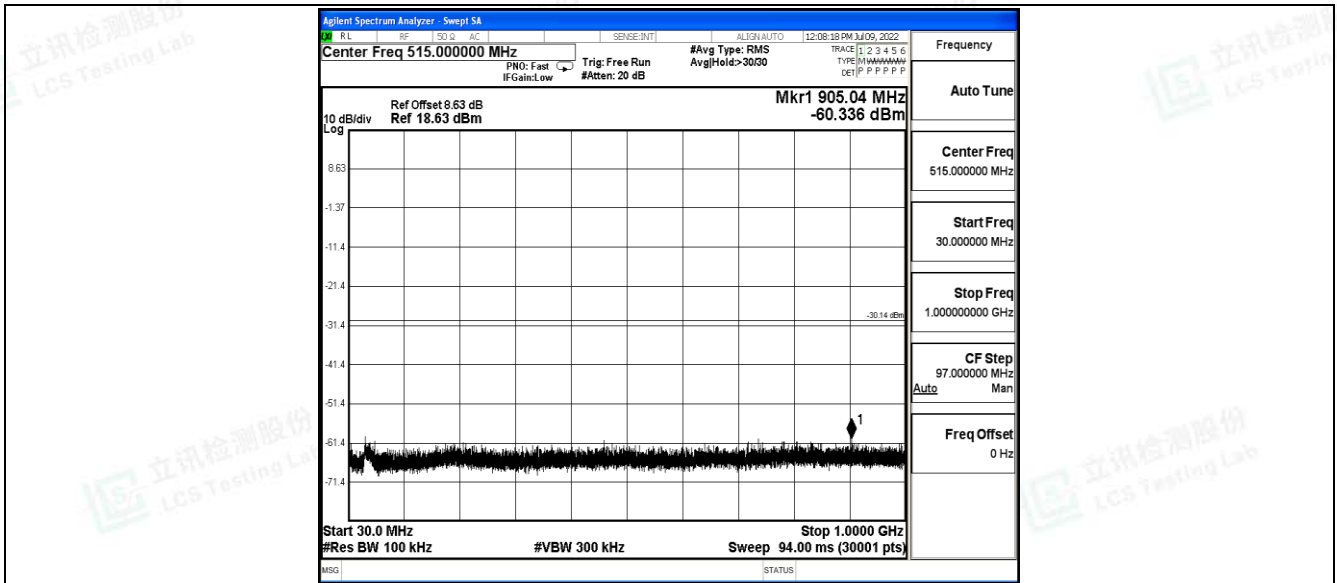


11G_Ant0_2437_1000~26500

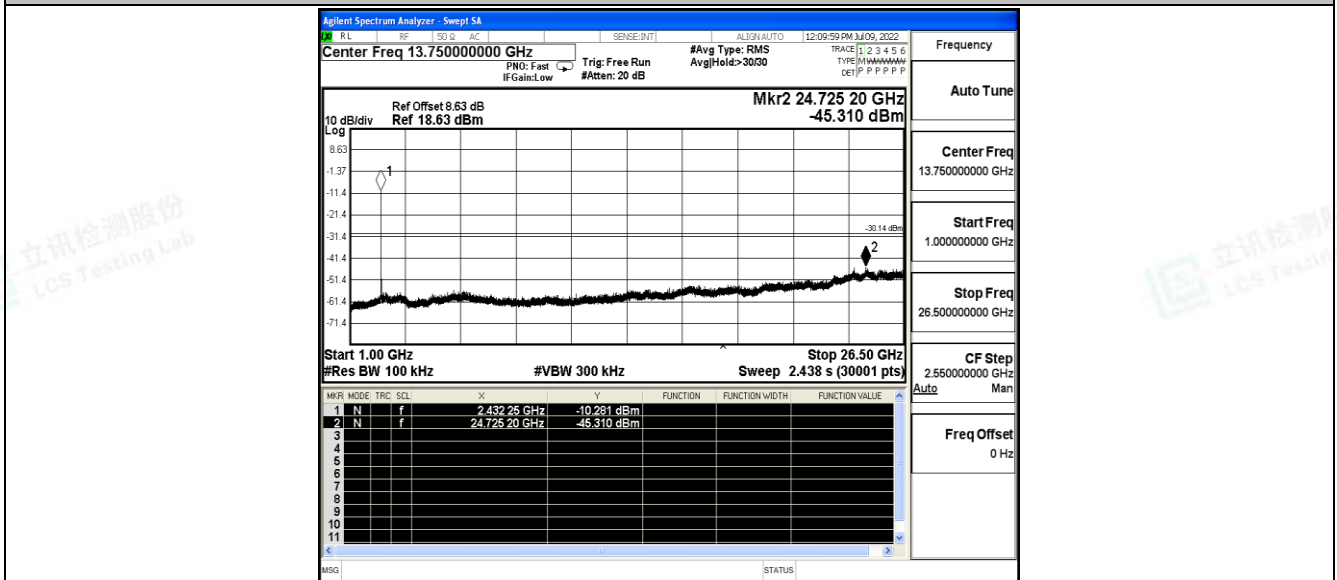


11G_Ant0_2462_0-Reference



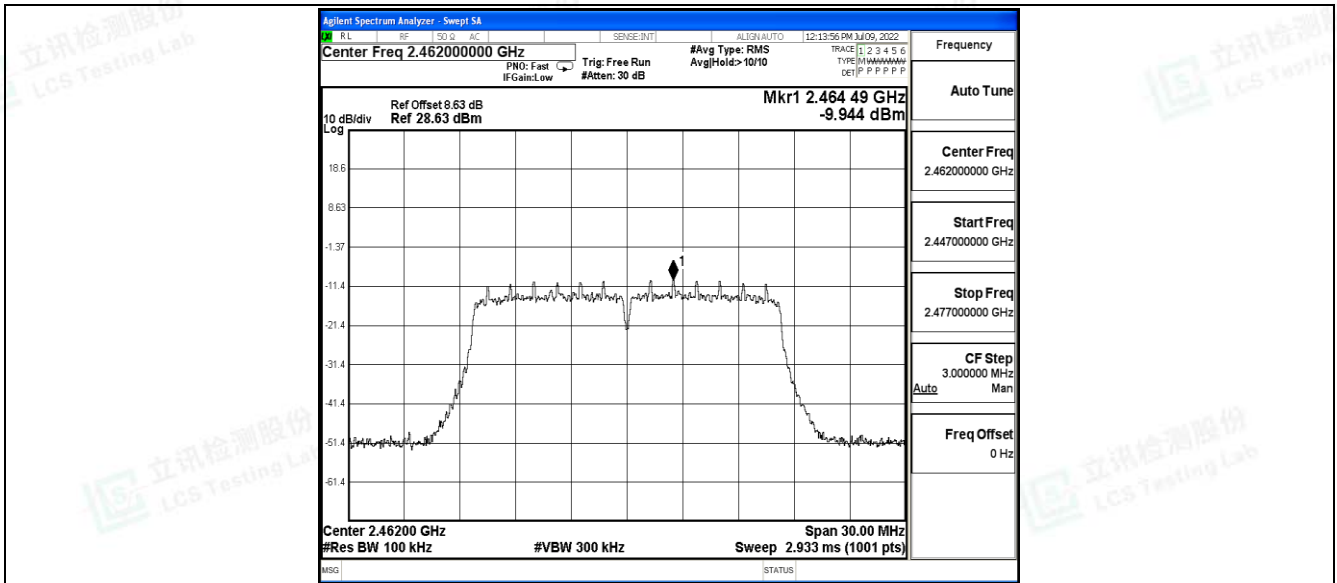


11G_Ant0_2462_30~1000

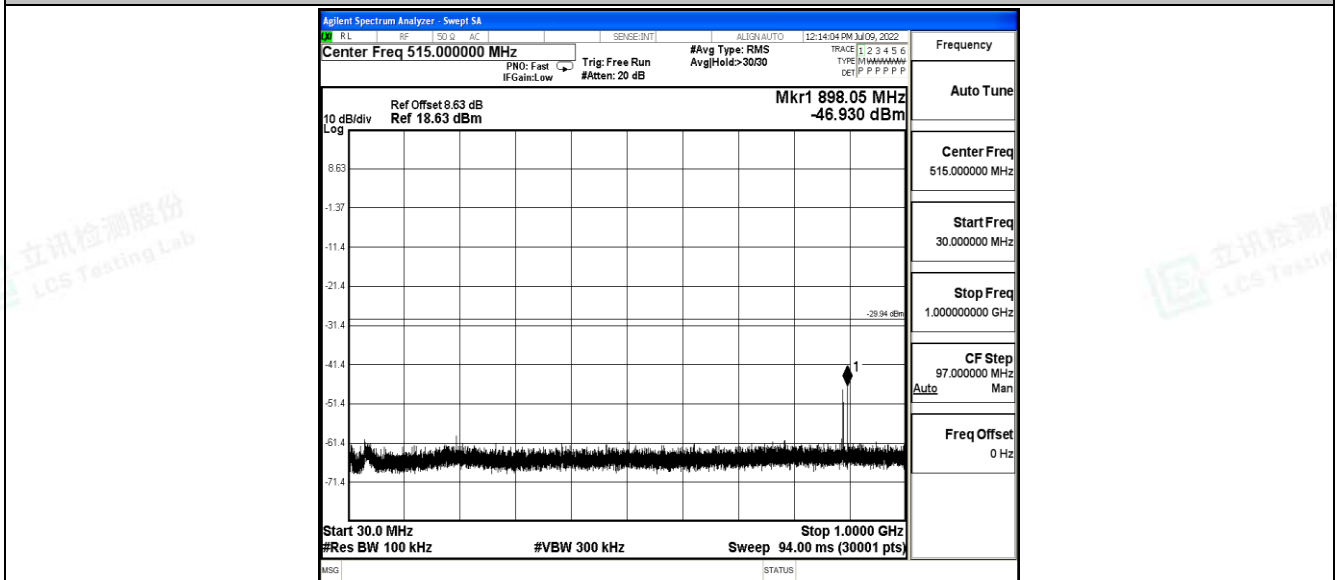


11G_Ant0_2462_1000~26500



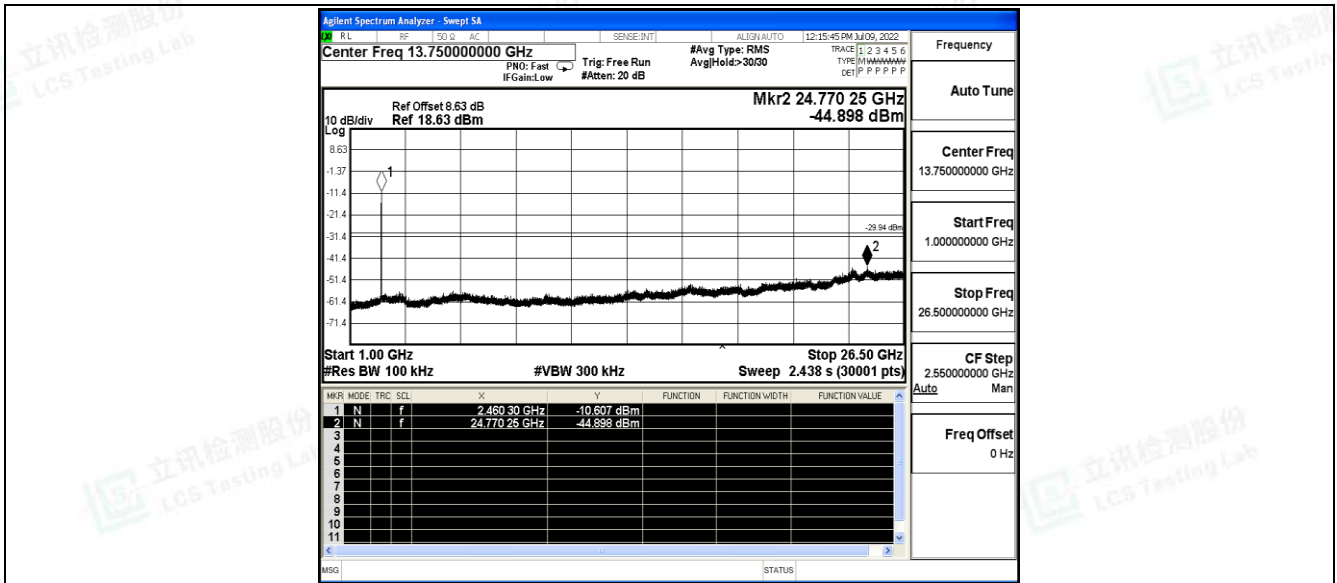


11N20SISO_Ant0_2412_0~Reference

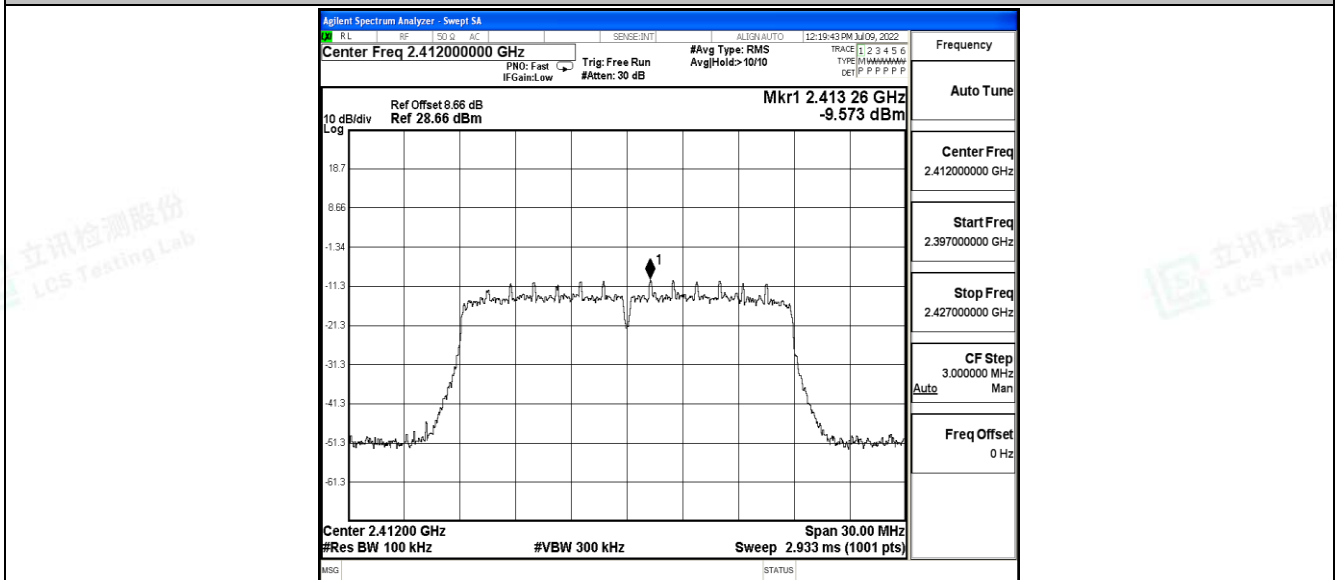


11N20SISO_Ant0_2412_30~1000



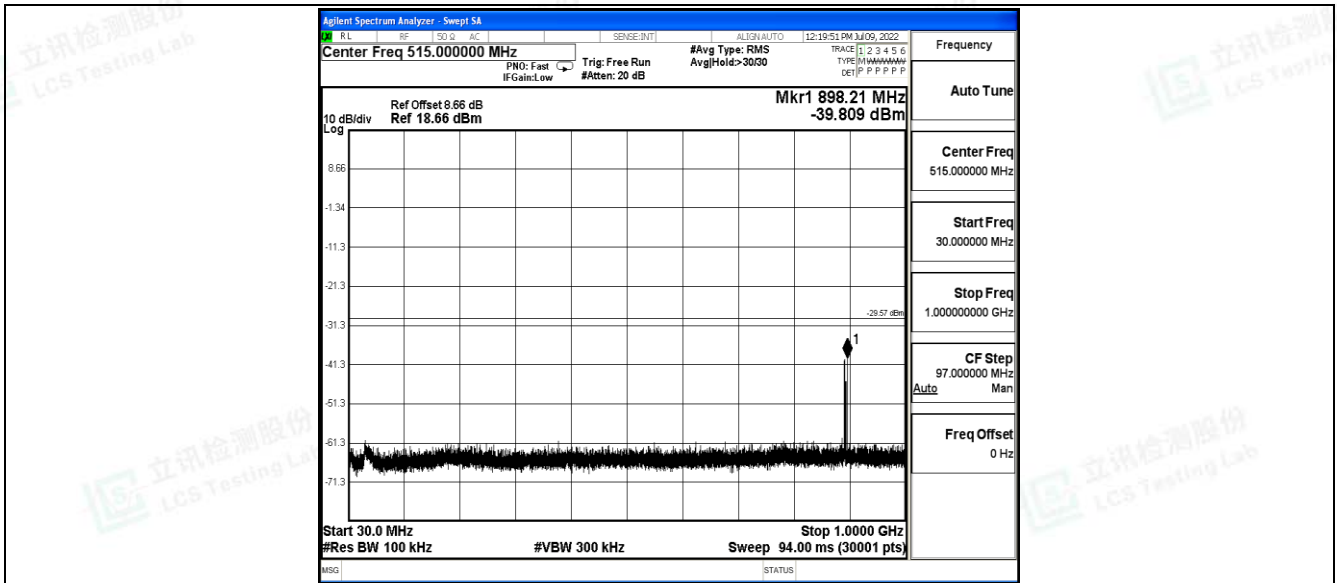


11N20SISO_Ant0_2412_1000~26500

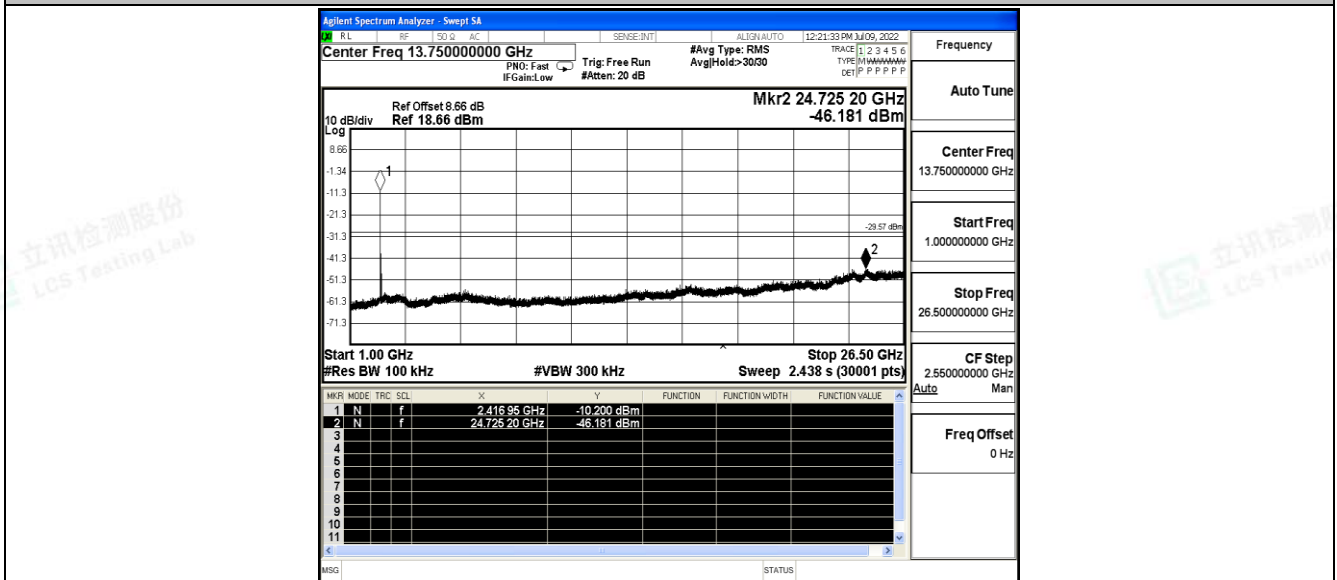


11N20SISO_Ant0_2437_0~Reference



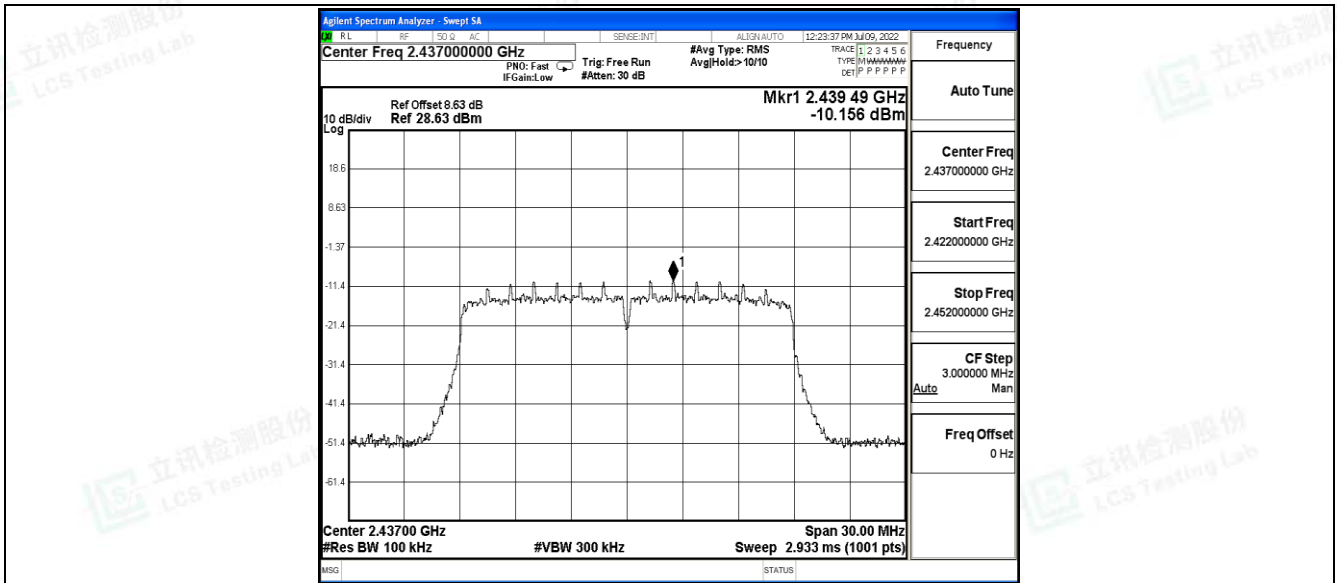


11N20SISO_Ant0_2437_30~1000

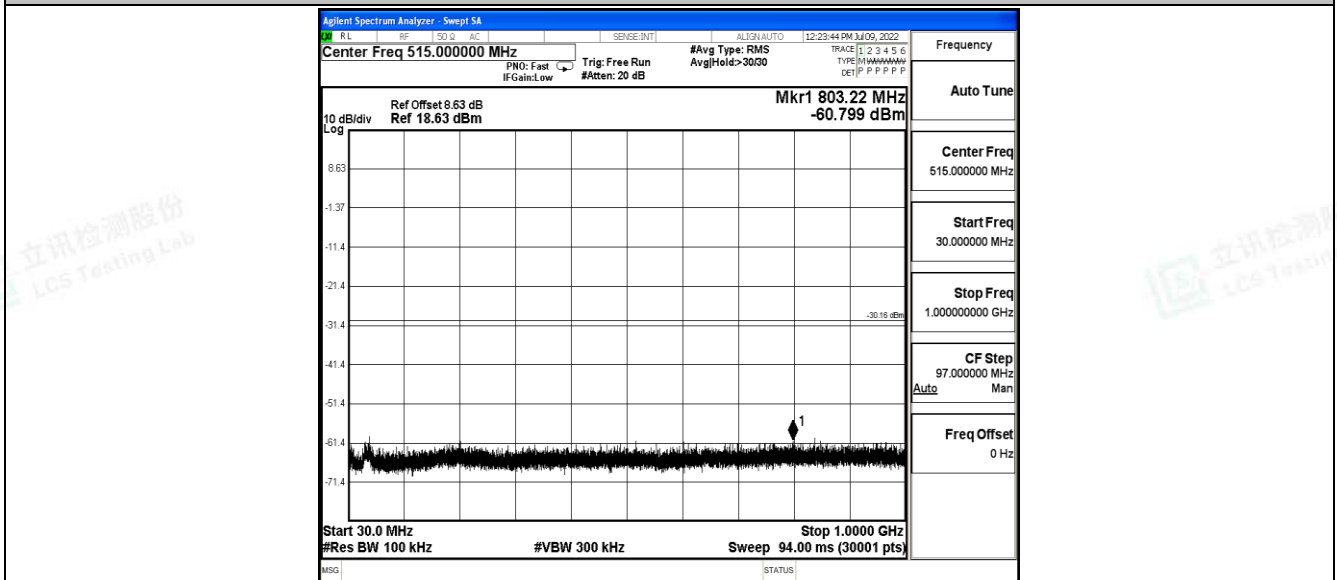


11N20SISO_Ant0_2437_1000~26500



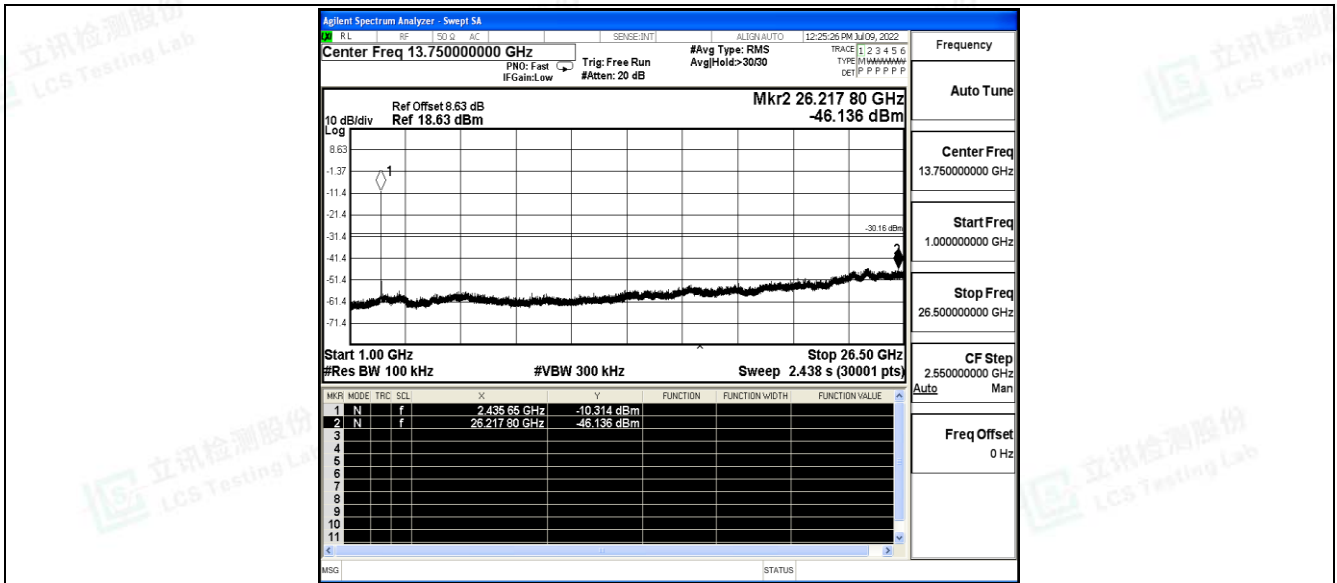


11N20SISO_Ant0_2462_0~Reference

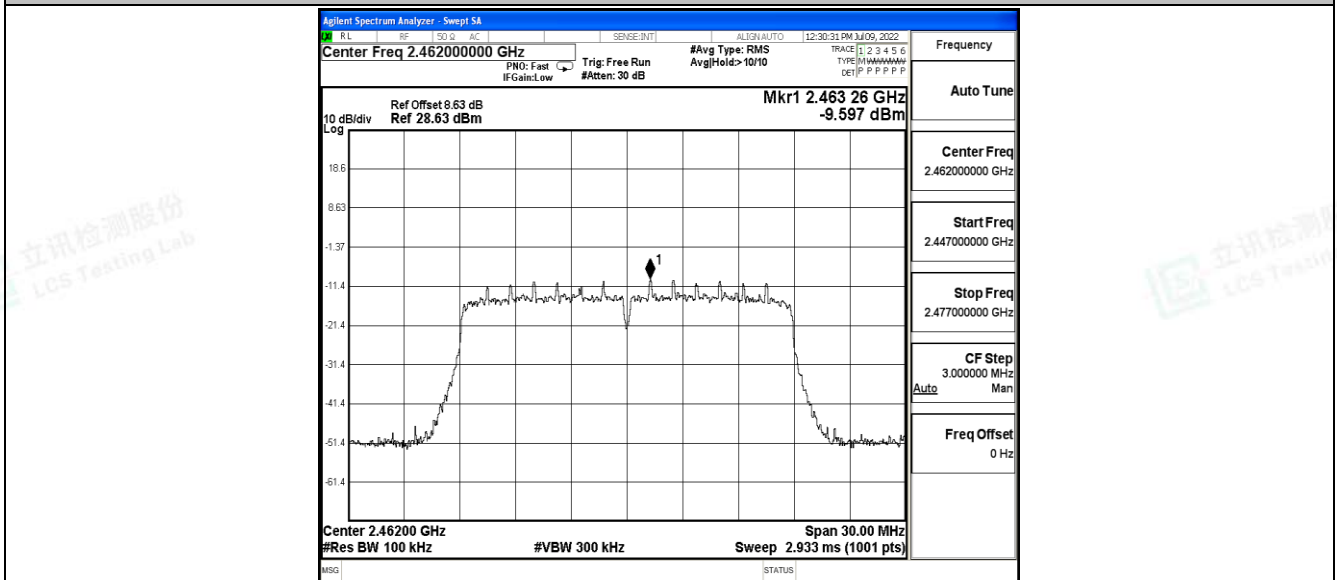


11N20SISO_Ant0_2462_30~1000




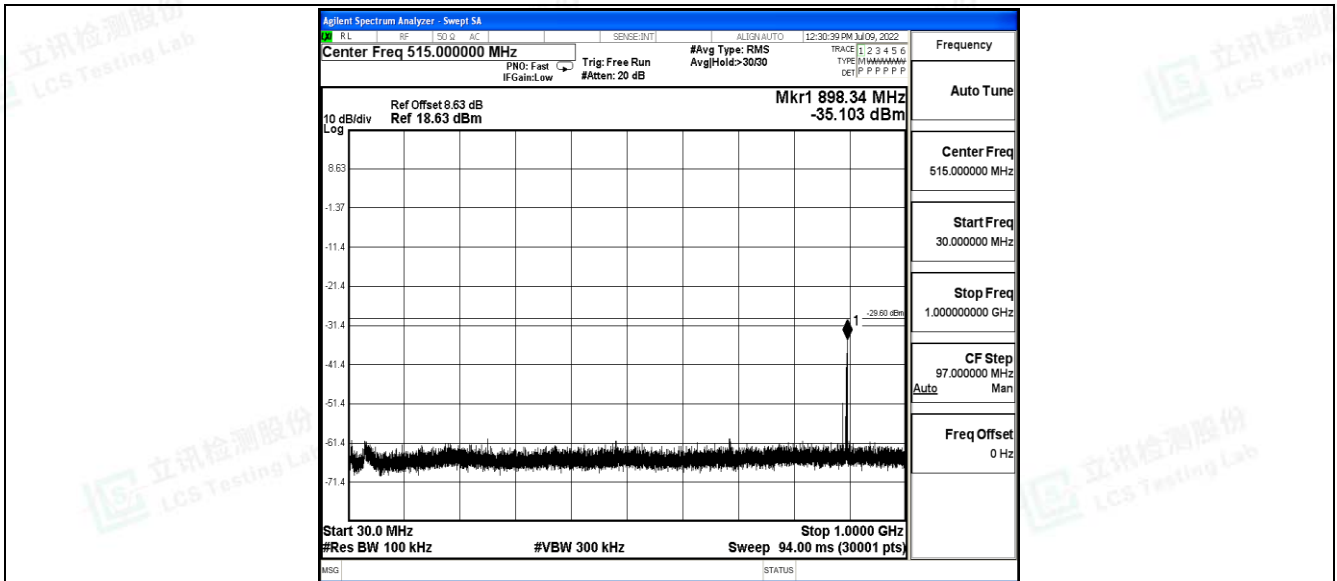



11N20SISO_Ant0_2462_1000~26500

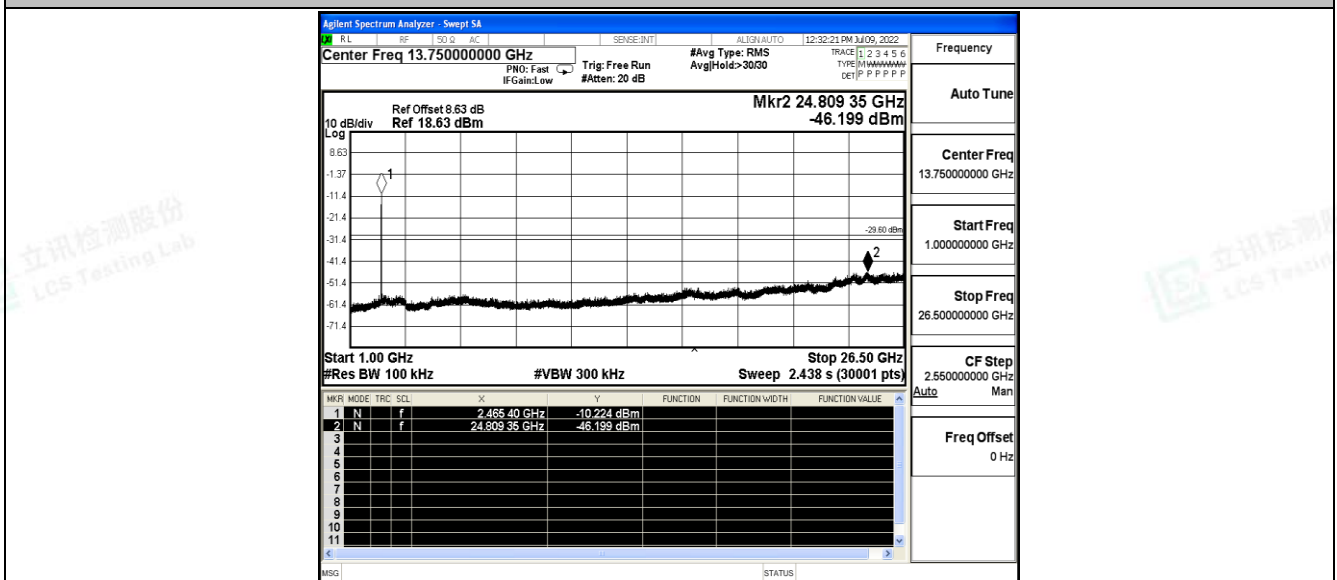


11N40SISO_Ant0_2422_0~Reference



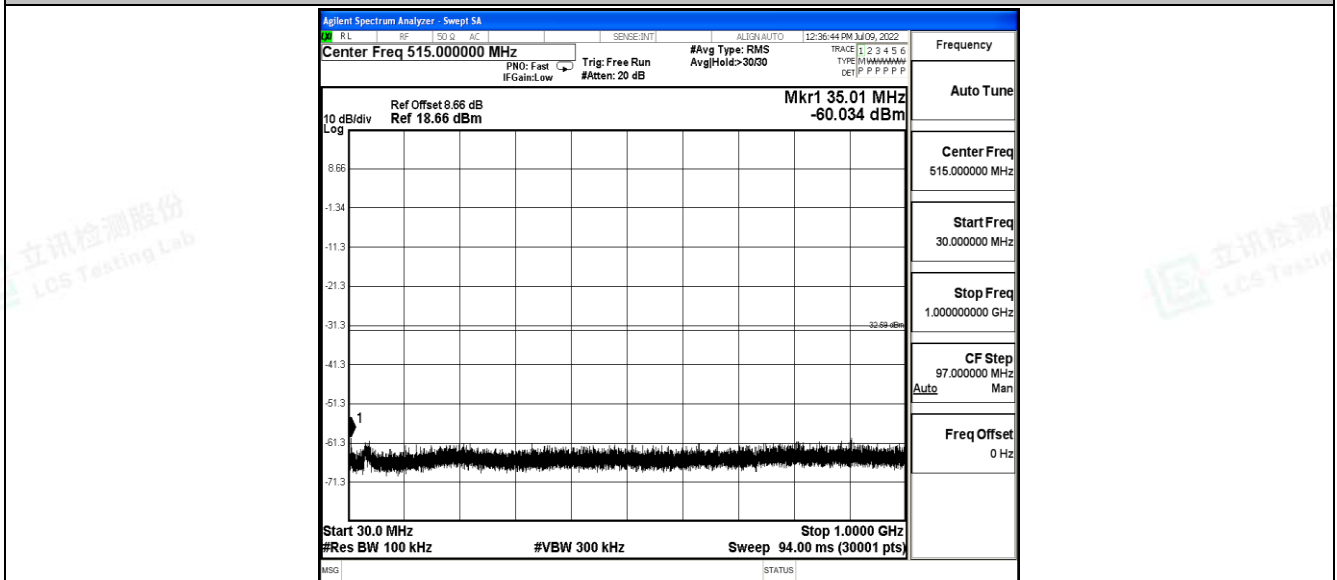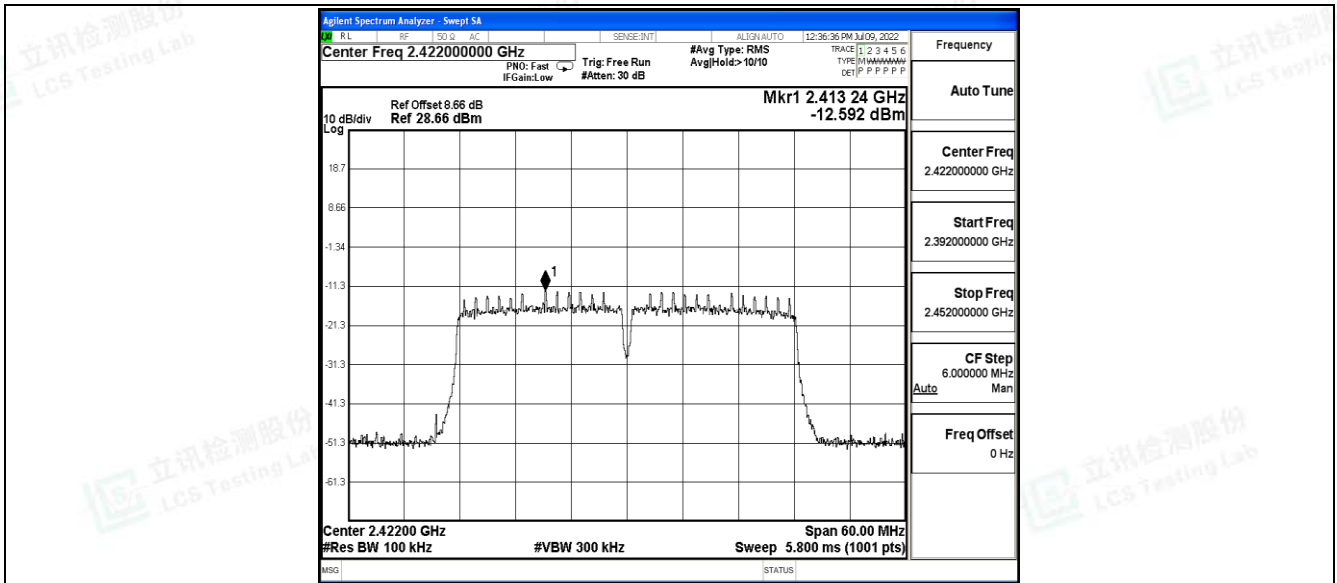

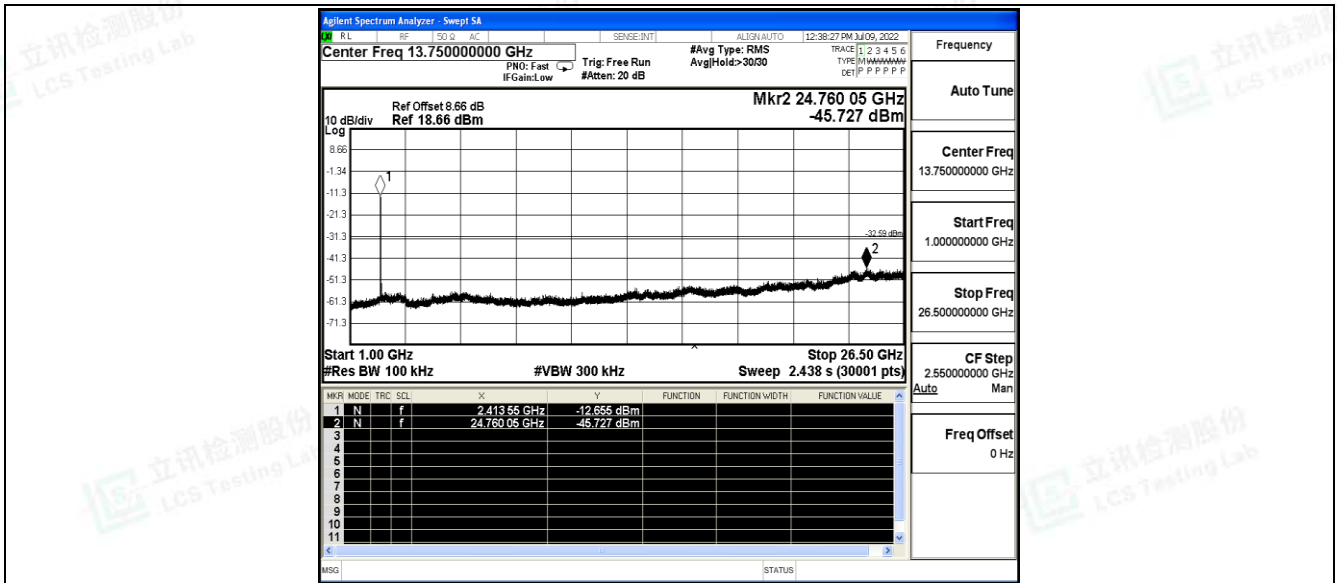

11N40SISO_Ant0_2437_0~Reference

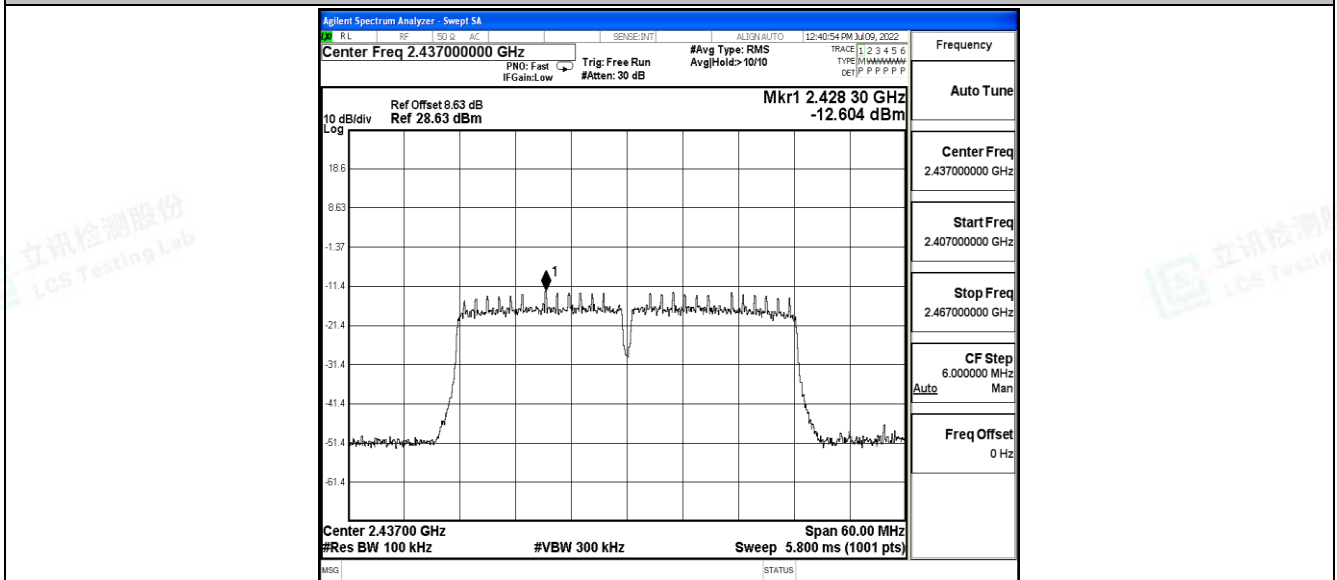

11N40SISO_Ant0_2437_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

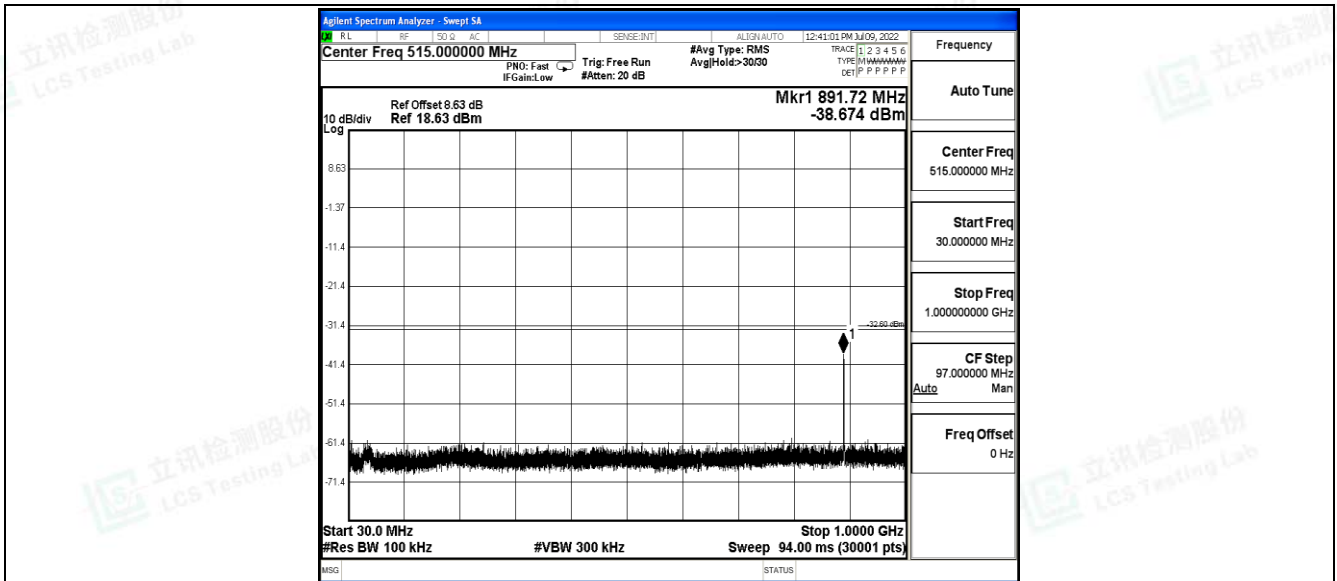


11N40SISO_Ant0_2437_1000~26500

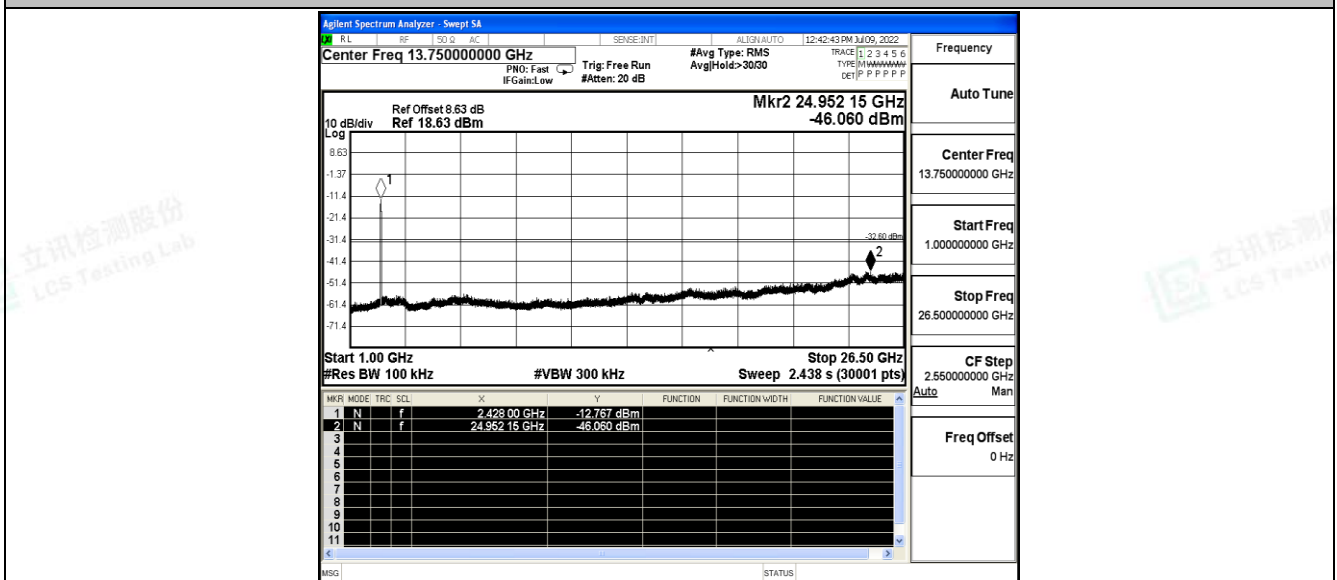


11N40SISO_Ant0_2452_0~Reference



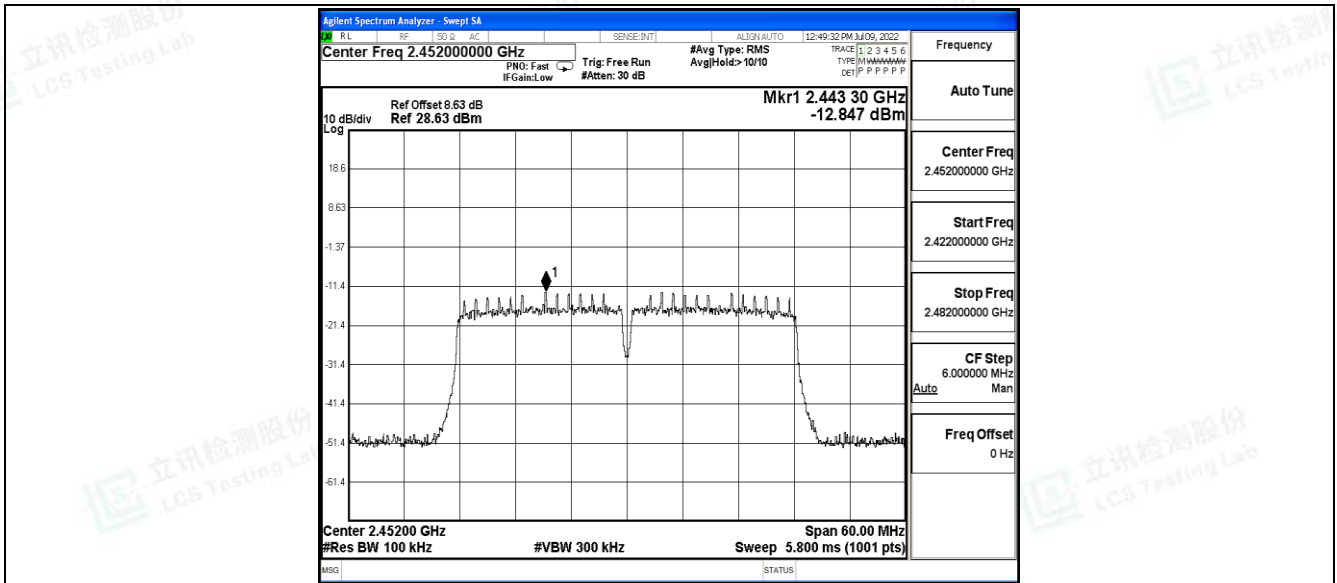


11N40SISO_Ant0_2452_30~1000

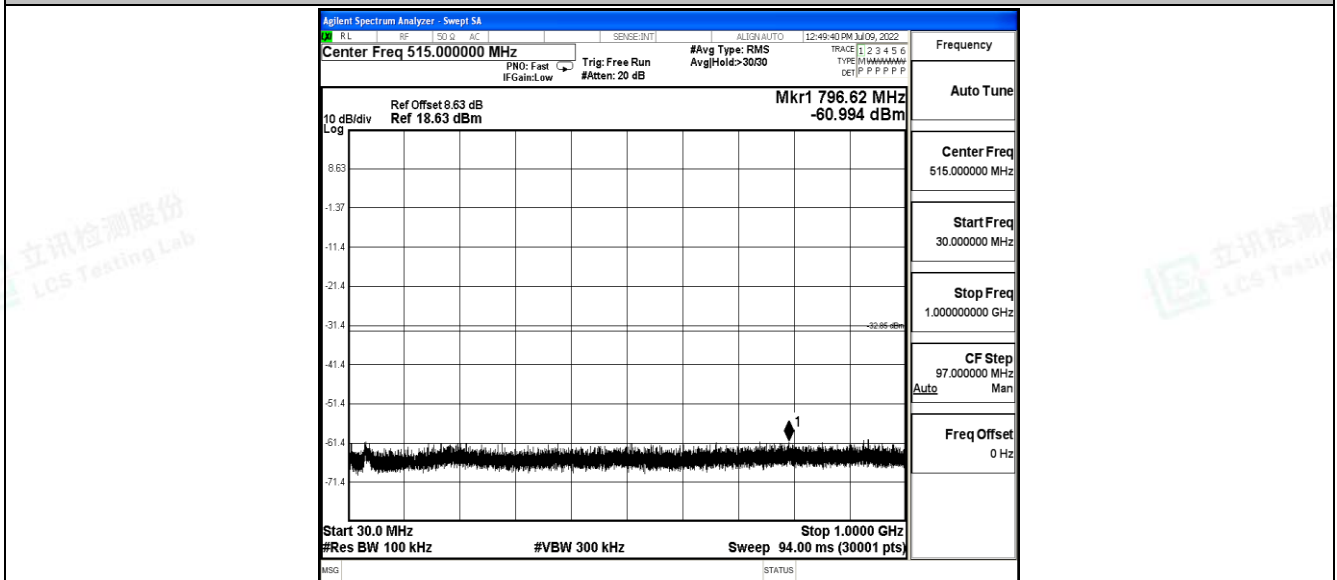


11N40SISO_Ant0_2452_1000~26500



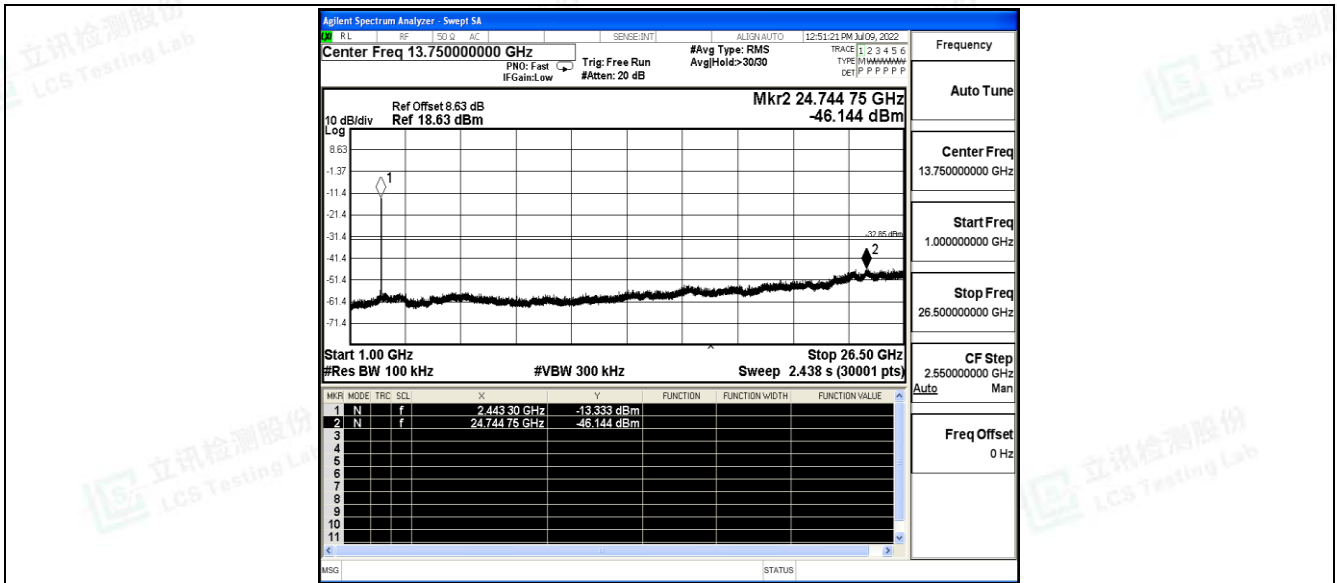


11AX20SISO_Ant0_2412_0-Reference

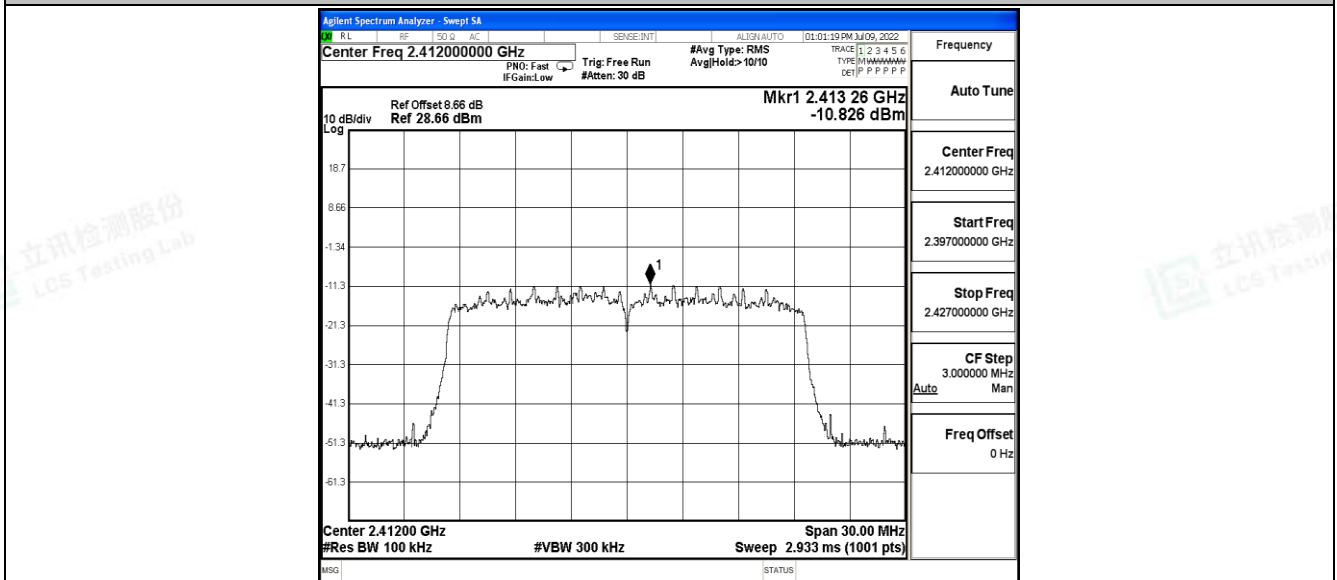


11AX20SISO_Ant0_2412_30~1000



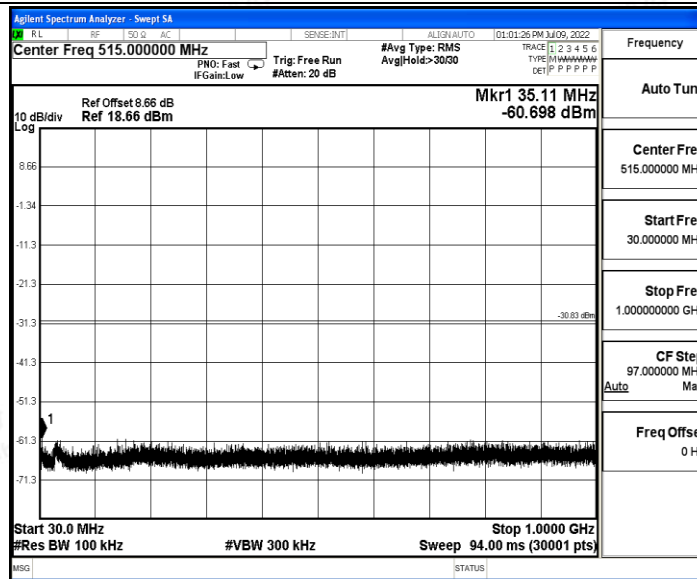


11AX20SISO_Ant0_2412_1000~26500

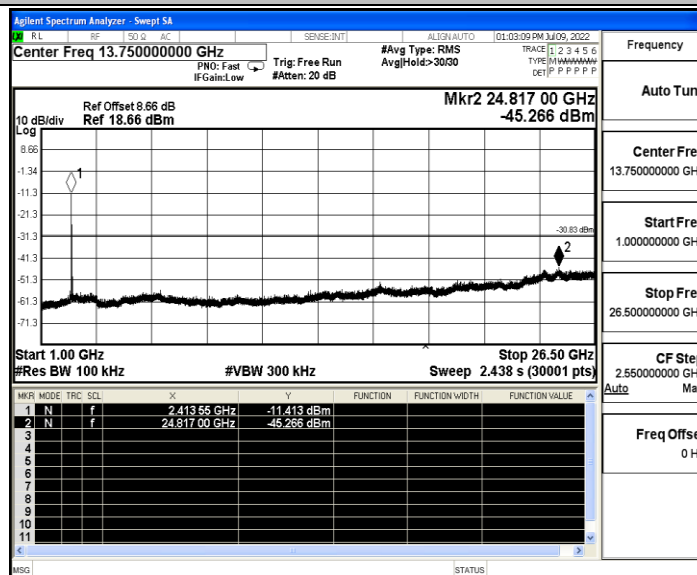


11AX20SISO_Ant0_2437_0-Reference



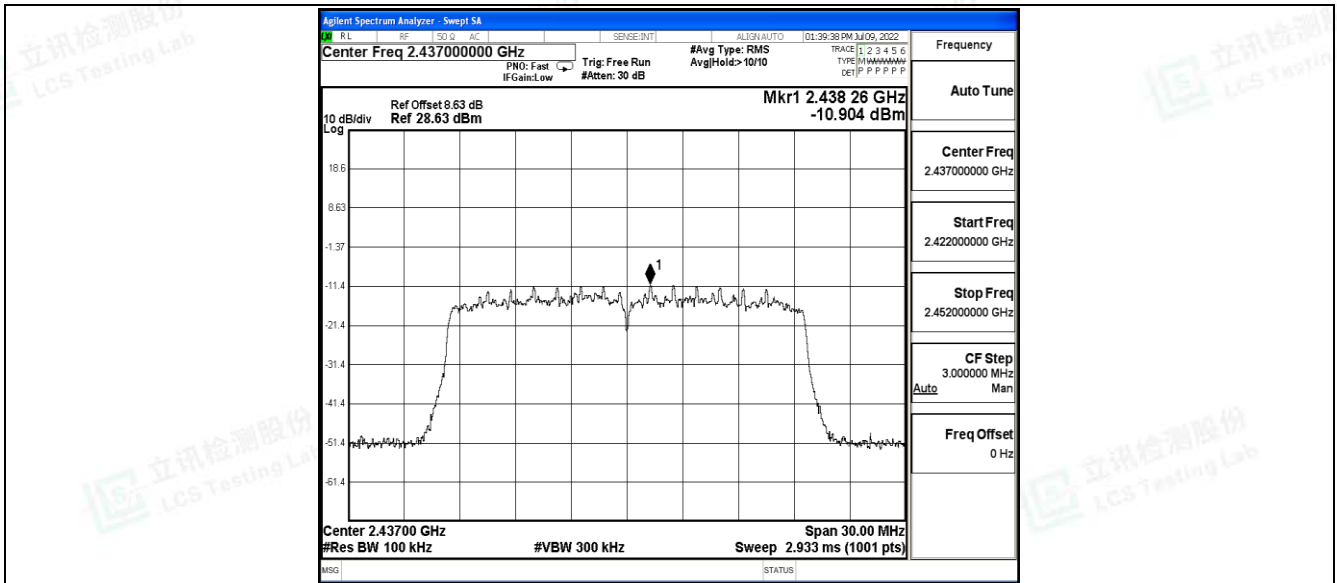


11AX20SISO_Ant0_2437_30~1000

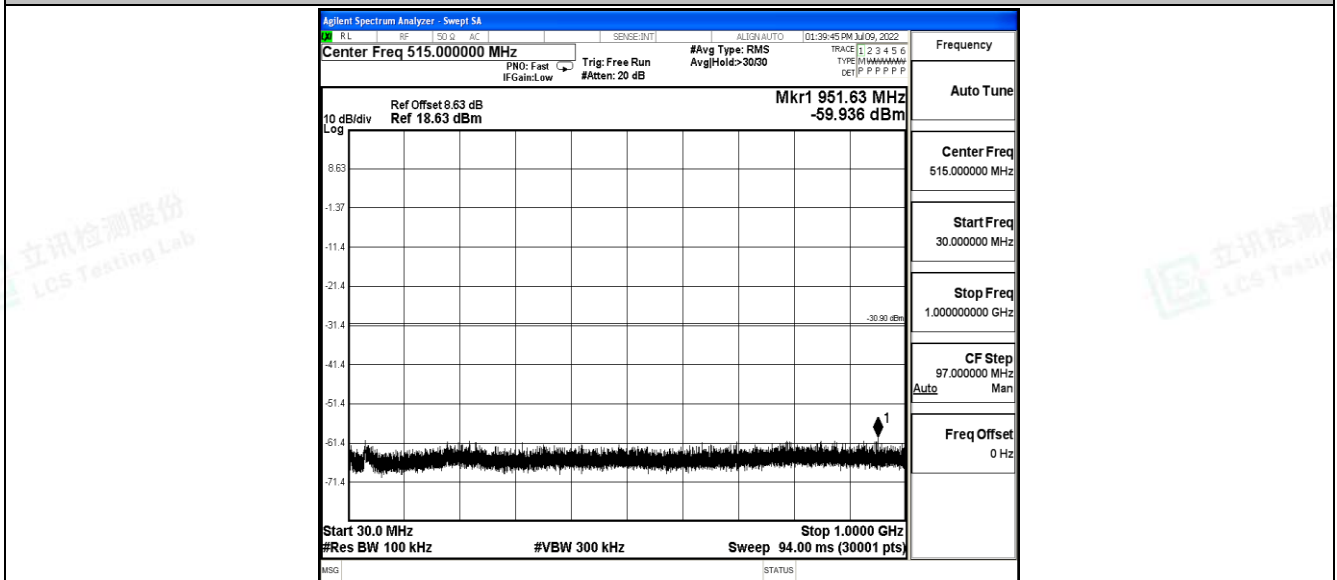


11AX20SISO_Ant0_2437_1000~26500



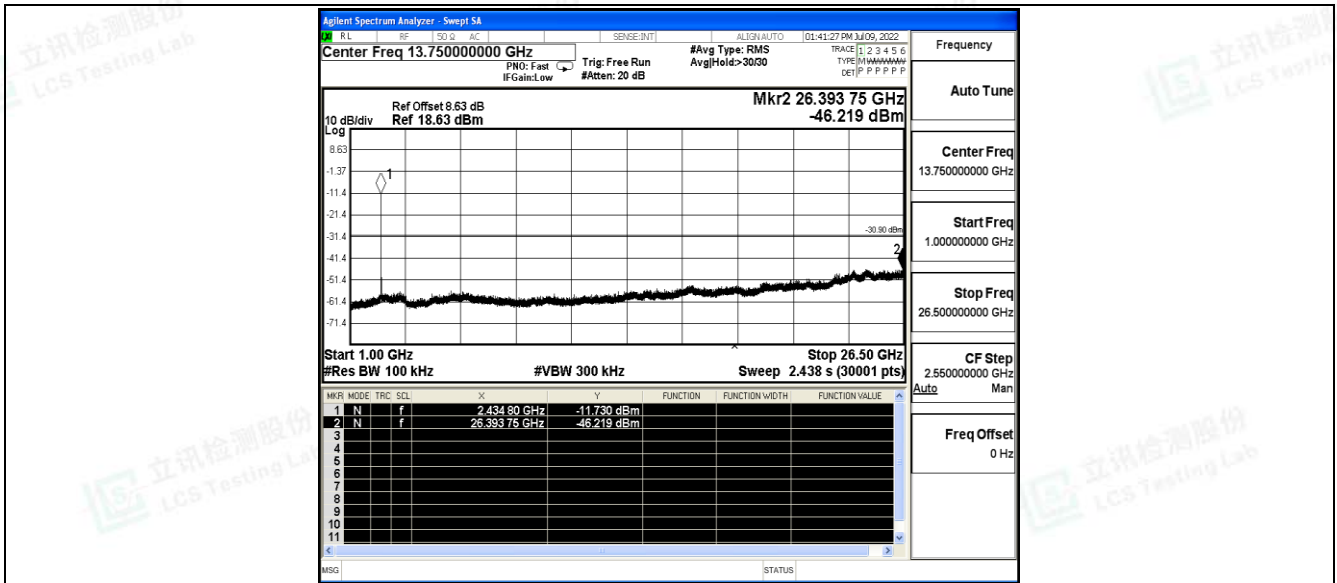


11AX20SISO_Ant0_2462_0-Reference

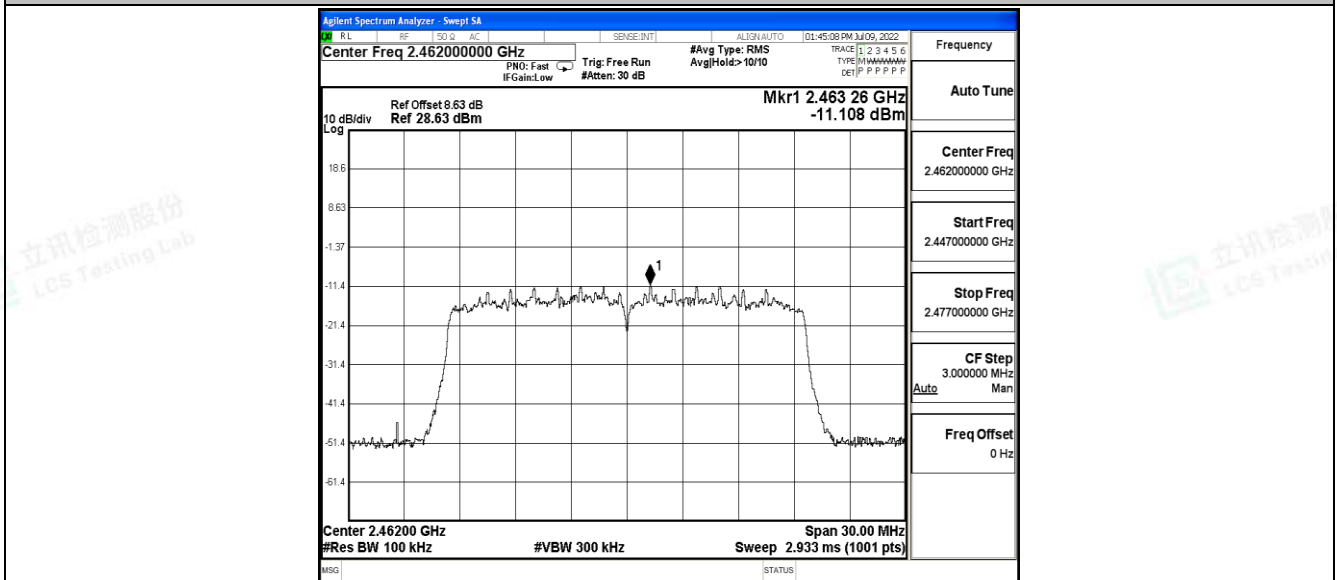


11AX20SISO_Ant0_2462_30~1000




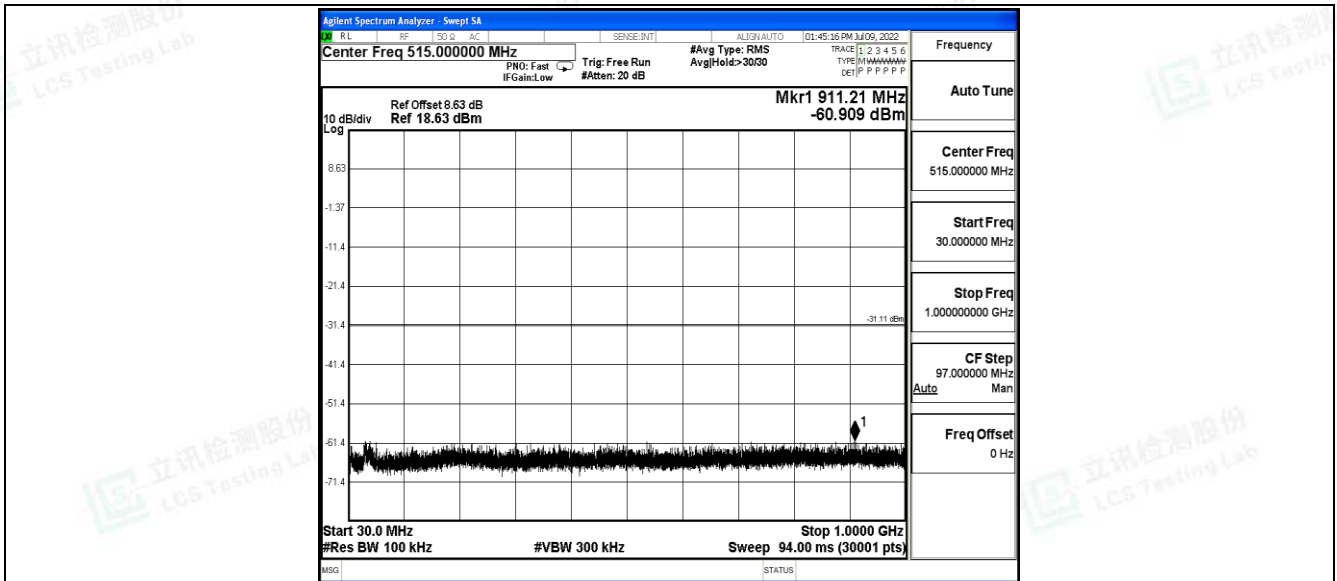



11AX20SISO_Ant0_2462_1000~26500

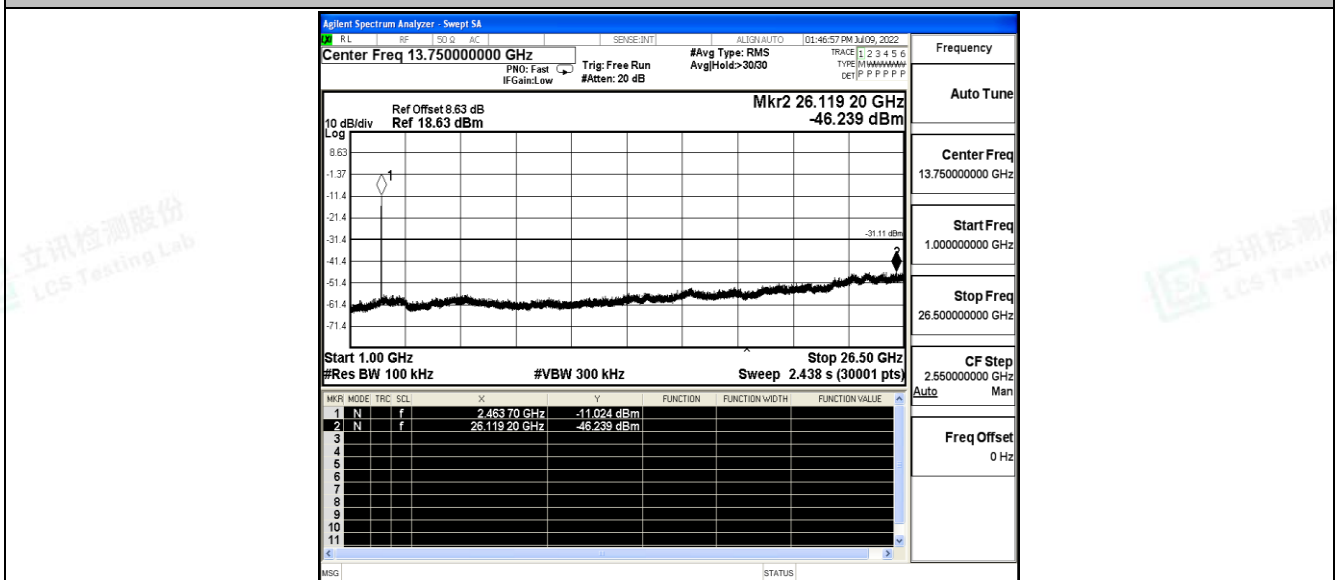


11AX40SISO_Ant0_2422_0-Reference



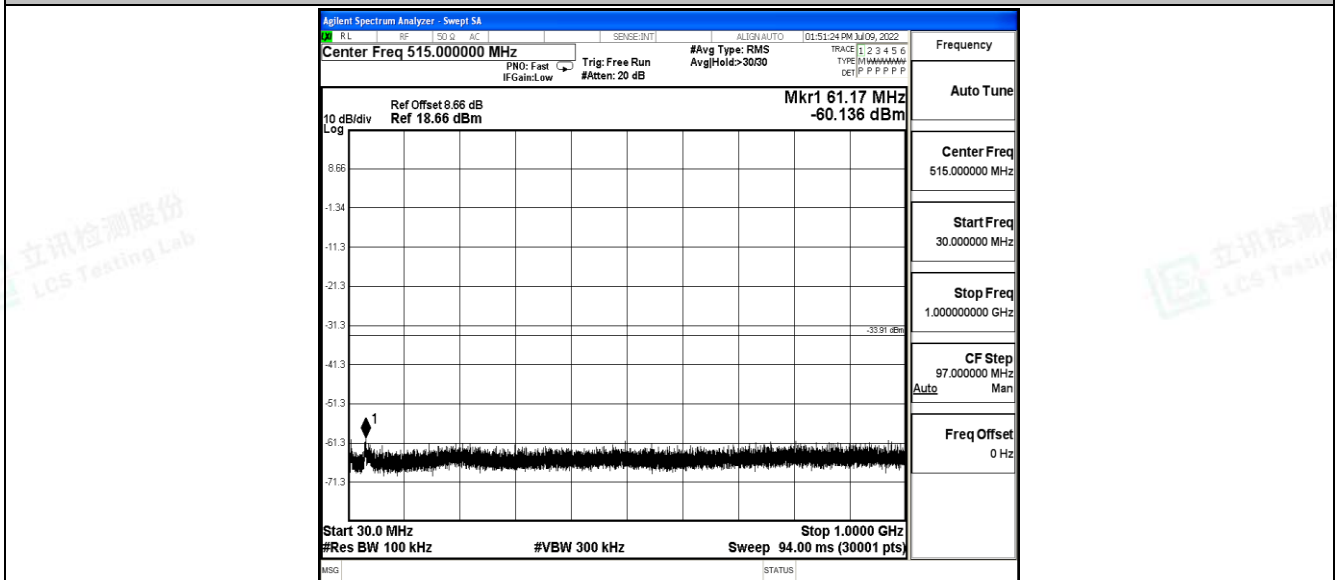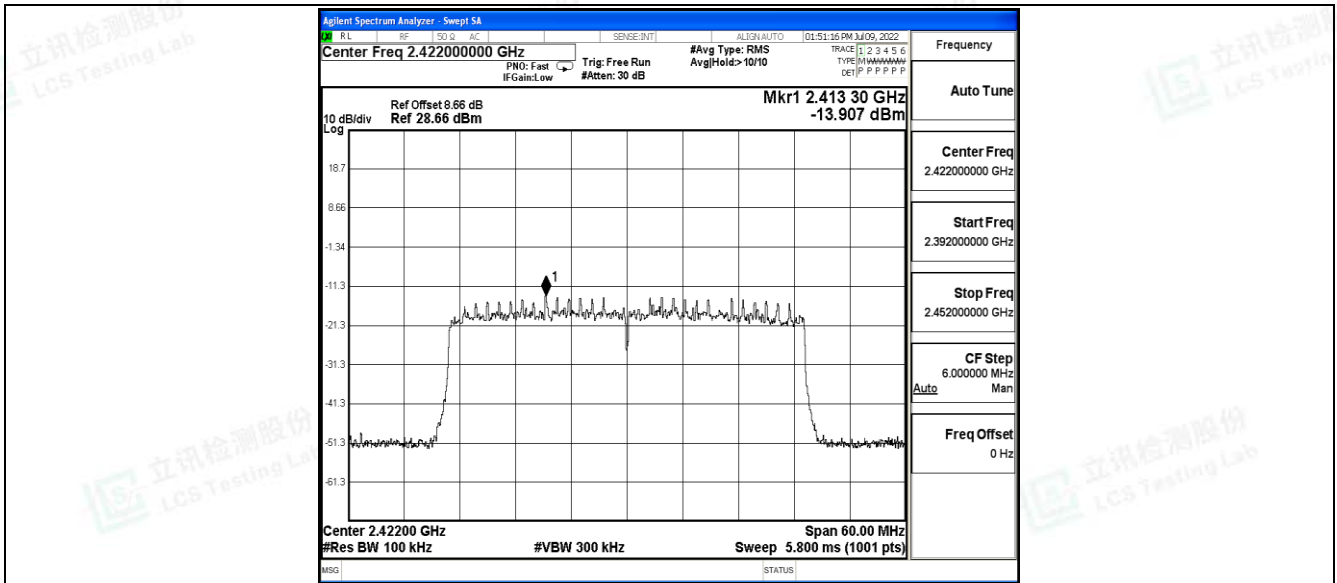

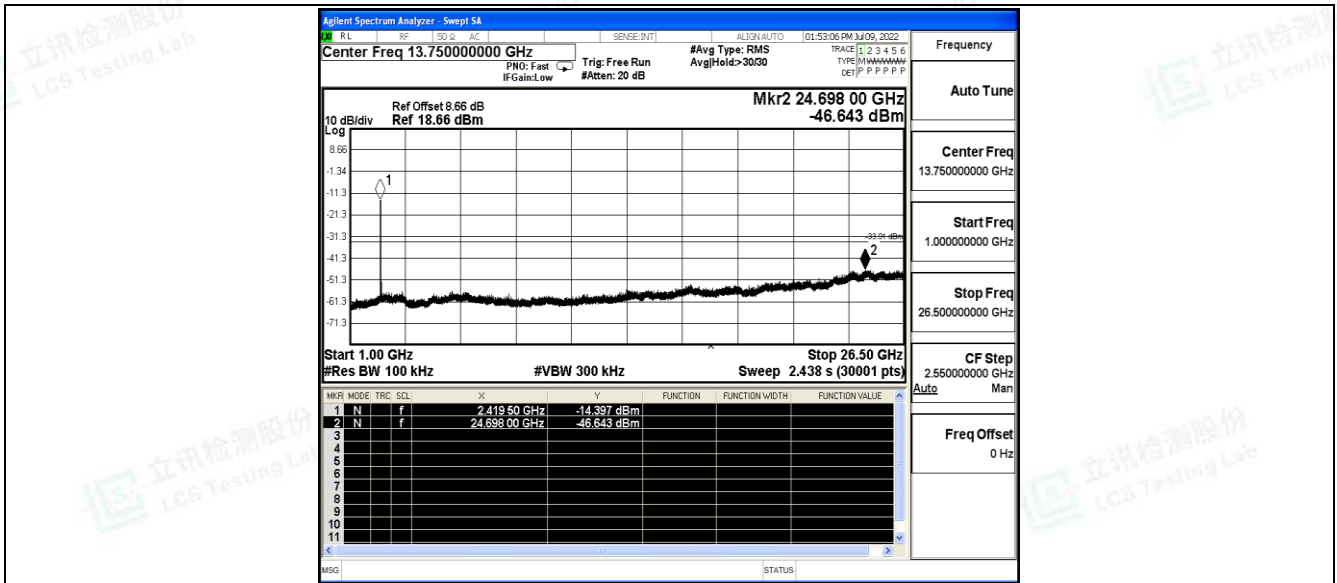


11AX40SISO_Ant0_2437_0-Reference

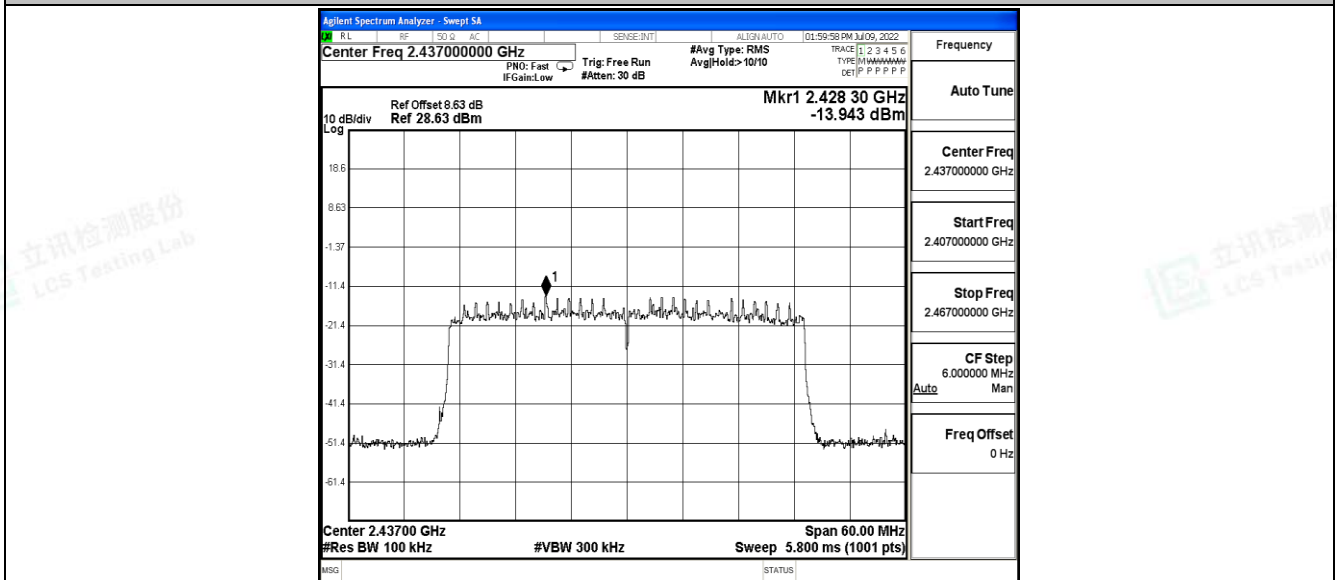


11AX40SISO_Ant0_2437_30~1000



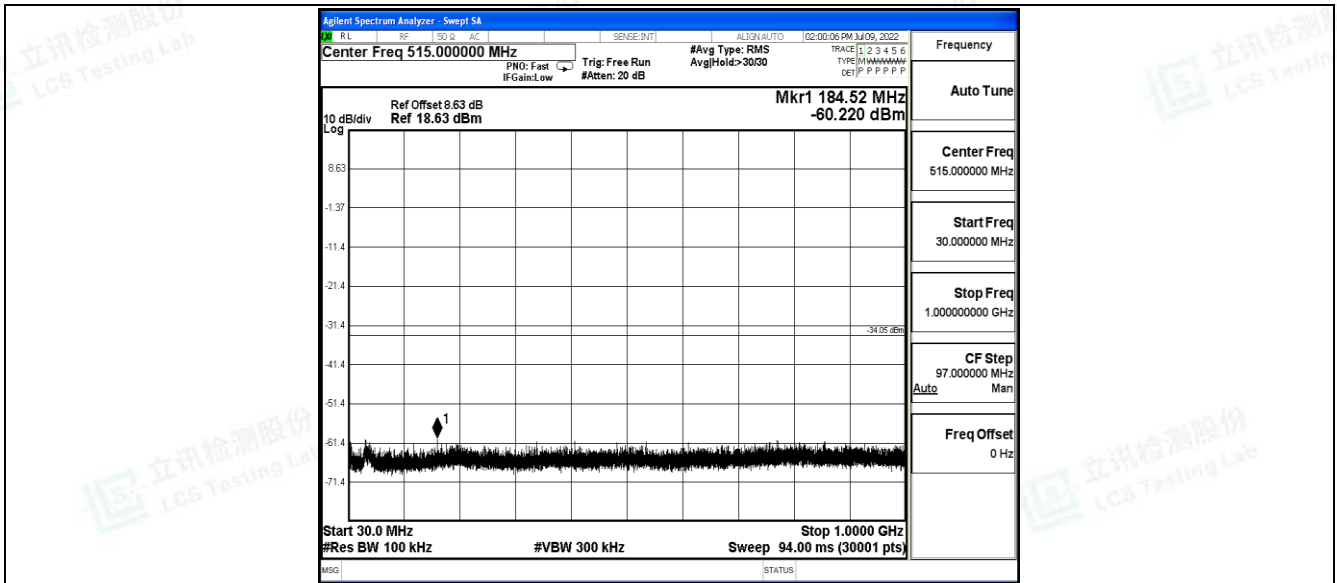


11AX40SISO_Ant0_2437_1000~26500

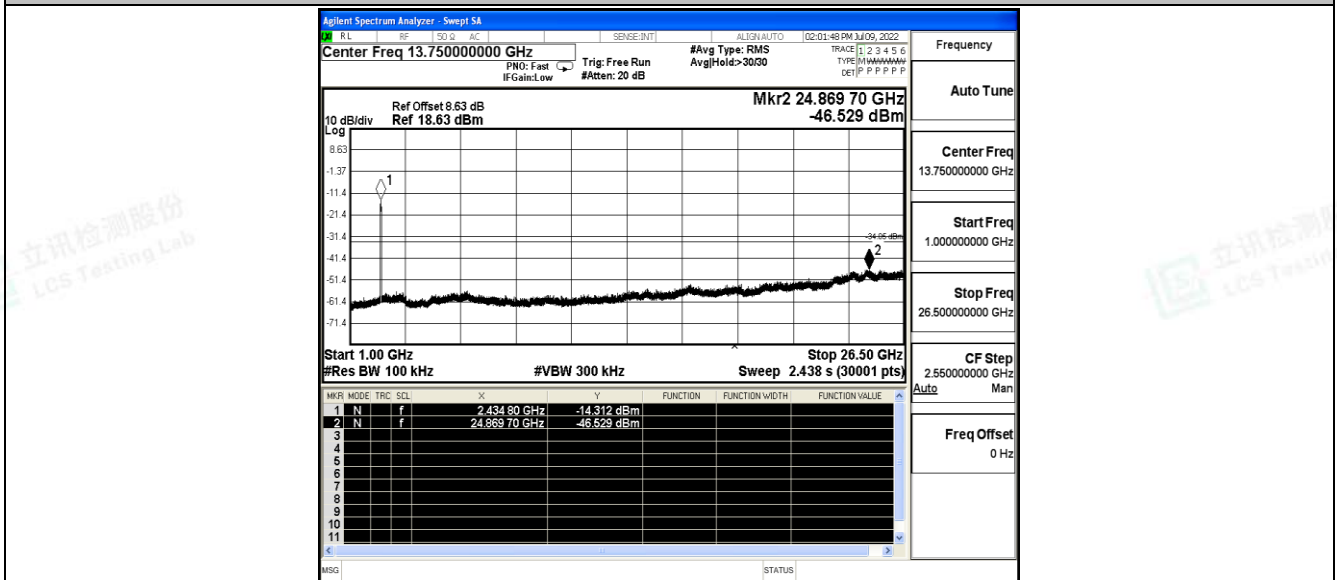


11AX40SISO_Ant0_2452_0-Reference



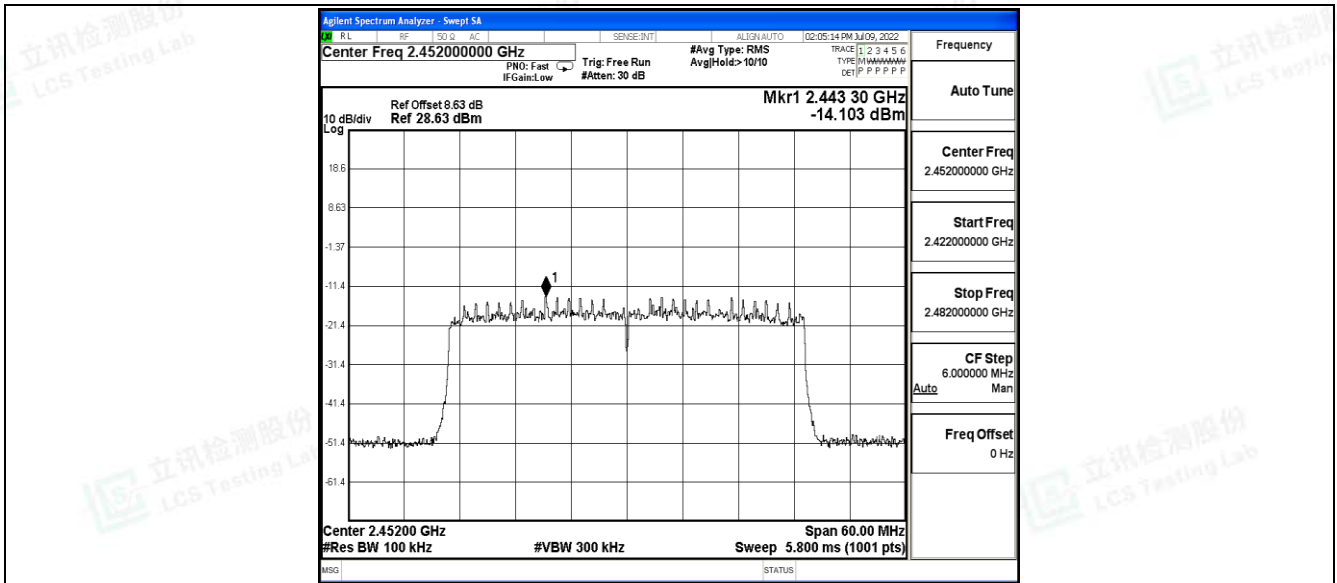

11AX40SISO_Ant0_2452_30~1000

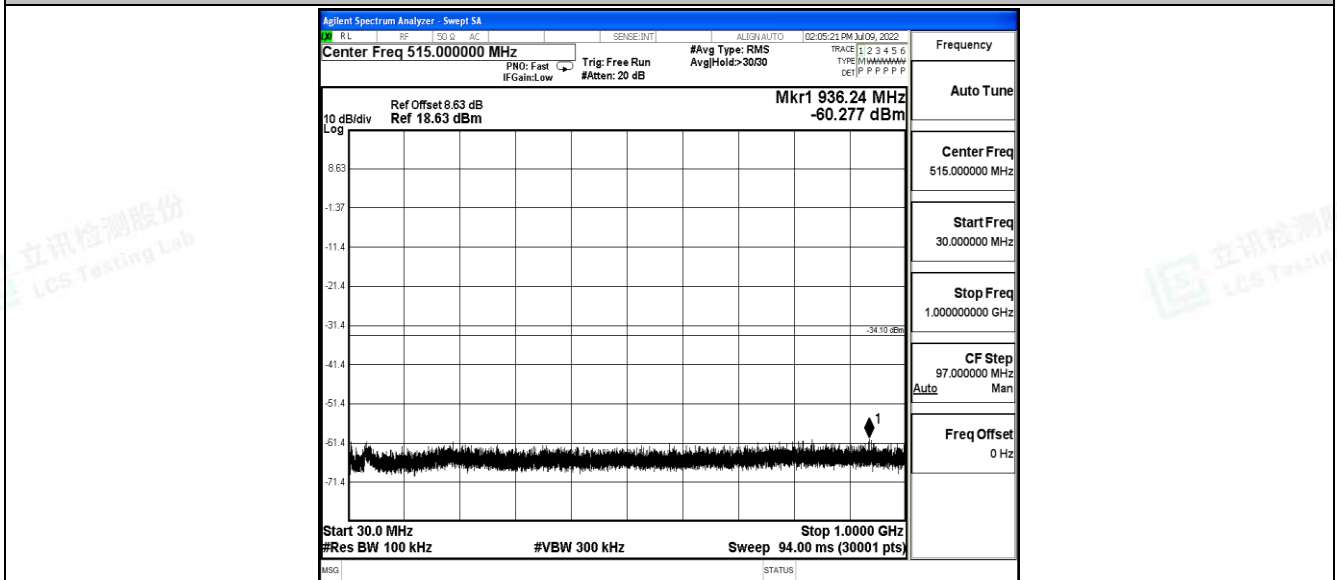

11AX40SISO_Ant0_2452_1000~26500



