




Test report No. : 4790371368-US-R2-V0
Page : 193 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

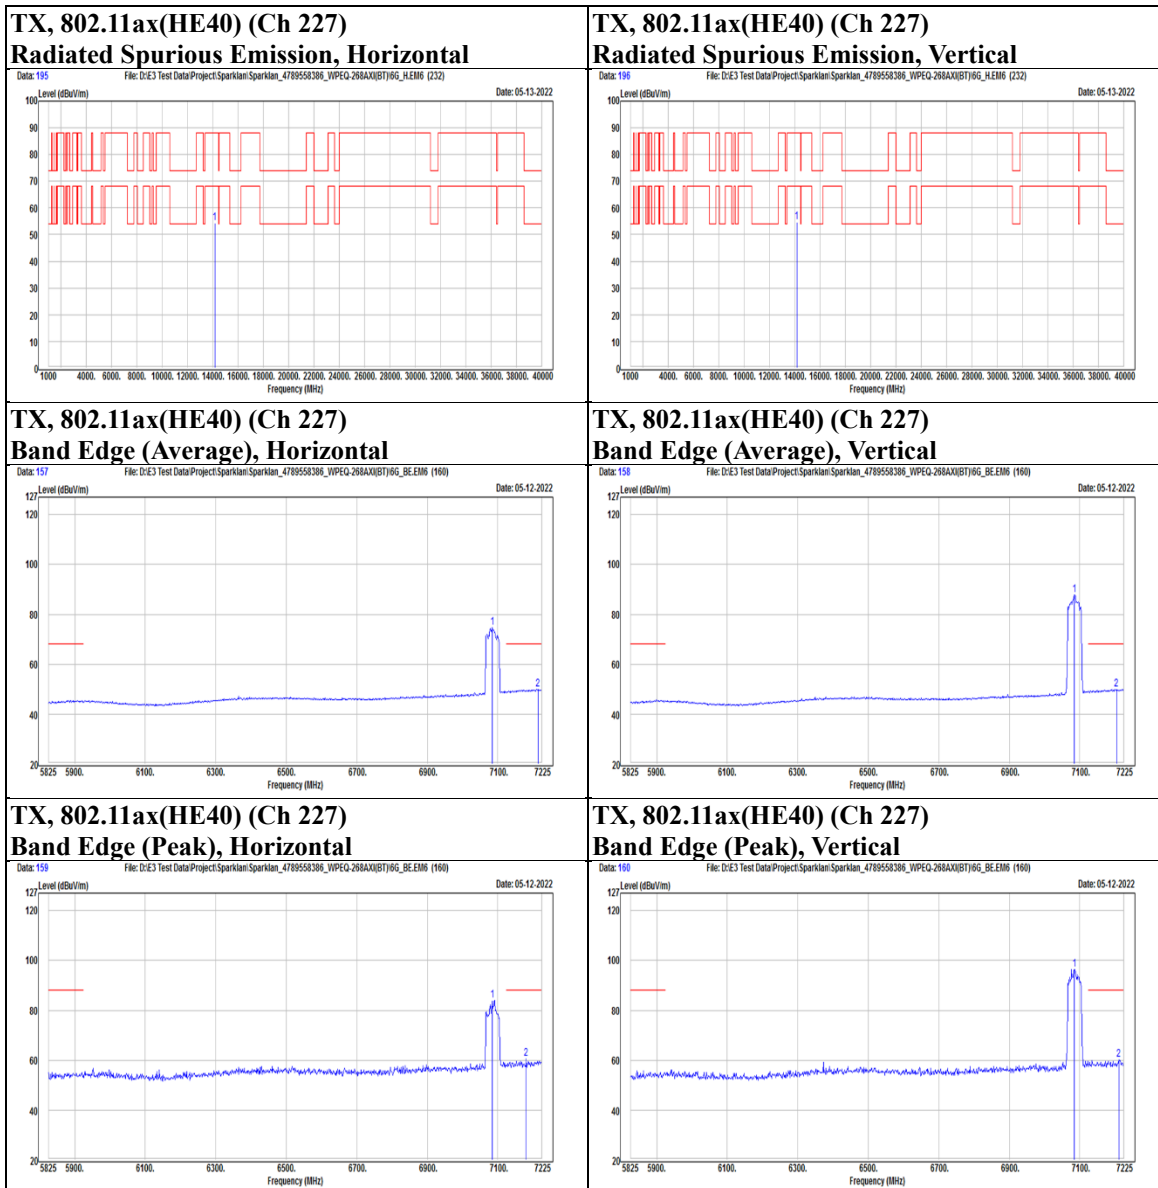

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 194 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	7
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5878.2	41.14	14.83	55.97	88.2	-32.23	PK
		5889.4	30.72	14.91	45.63	68.2	-22.57	AVG
	@	5985	73.11	14.98	88.09	N/A	N/A	PK
	@	5985	62.57	14.98	77.55	N/A	N/A	AVG
	*	11970	29.96	18.81	48.77	74	-25.23	PK
Vertical		5910.4	30.51	14.97	45.48	68.2	-22.72	AVG
		5914.6	40.39	14.96	55.35	88.2	-32.85	PK
	@	5985	79.94	14.98	94.92	N/A	N/A	PK
	@	5985	71.43	14.98	86.41	N/A	N/A	AVG
	*	11970	30.92	18.81	49.73	74	-24.27	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

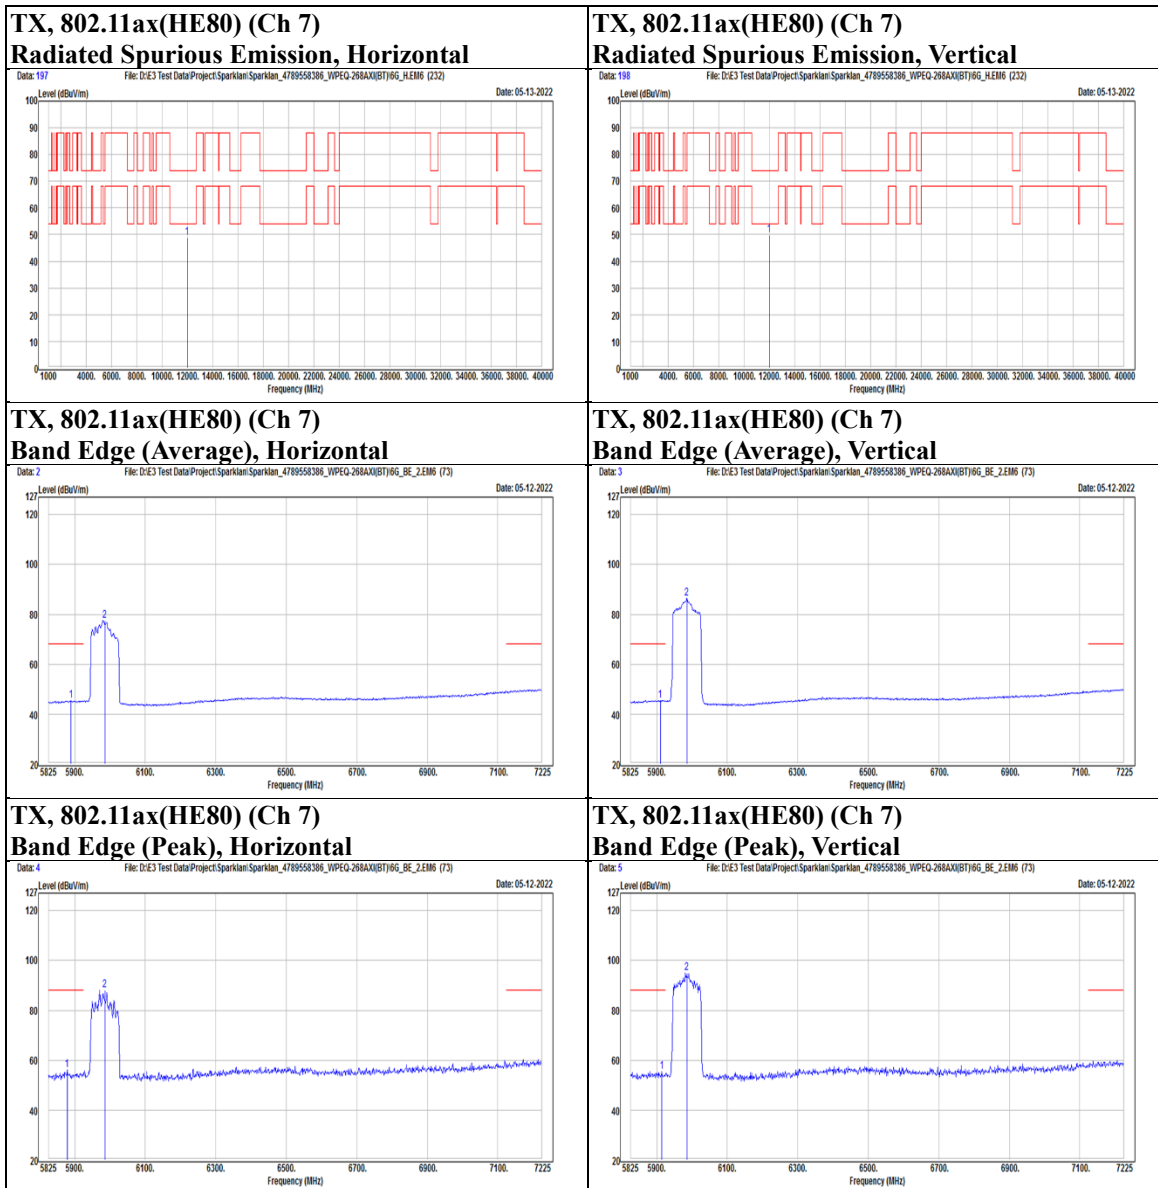



Test report No. : 4790371368-US-R2-V0
Page : 196 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	39
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5868.4	41.49	14.75	56.24	88.2	-31.96	PK
		5893.6	30.67	14.93	45.6	68.2	-22.6	AVG
	@	6145	66.25	15.37	81.62	N/A	N/A	PK
	@	6145	55.62	15.37	70.99	N/A	N/A	AVG
	*	12290	29.63	19.38	49.01	74	-24.99	PK
Vertical		5907.6	30.36	14.97	45.33	68.2	-22.87	AVG
		5924.4	41.63	14.96	56.59	88.2	-31.61	PK
	@	6145	80.18	15.37	95.55	N/A	N/A	PK
	@	6145	70.52	15.37	85.89	N/A	N/A	AVG
	*	12290	29.62	19.38	49	74	-25	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

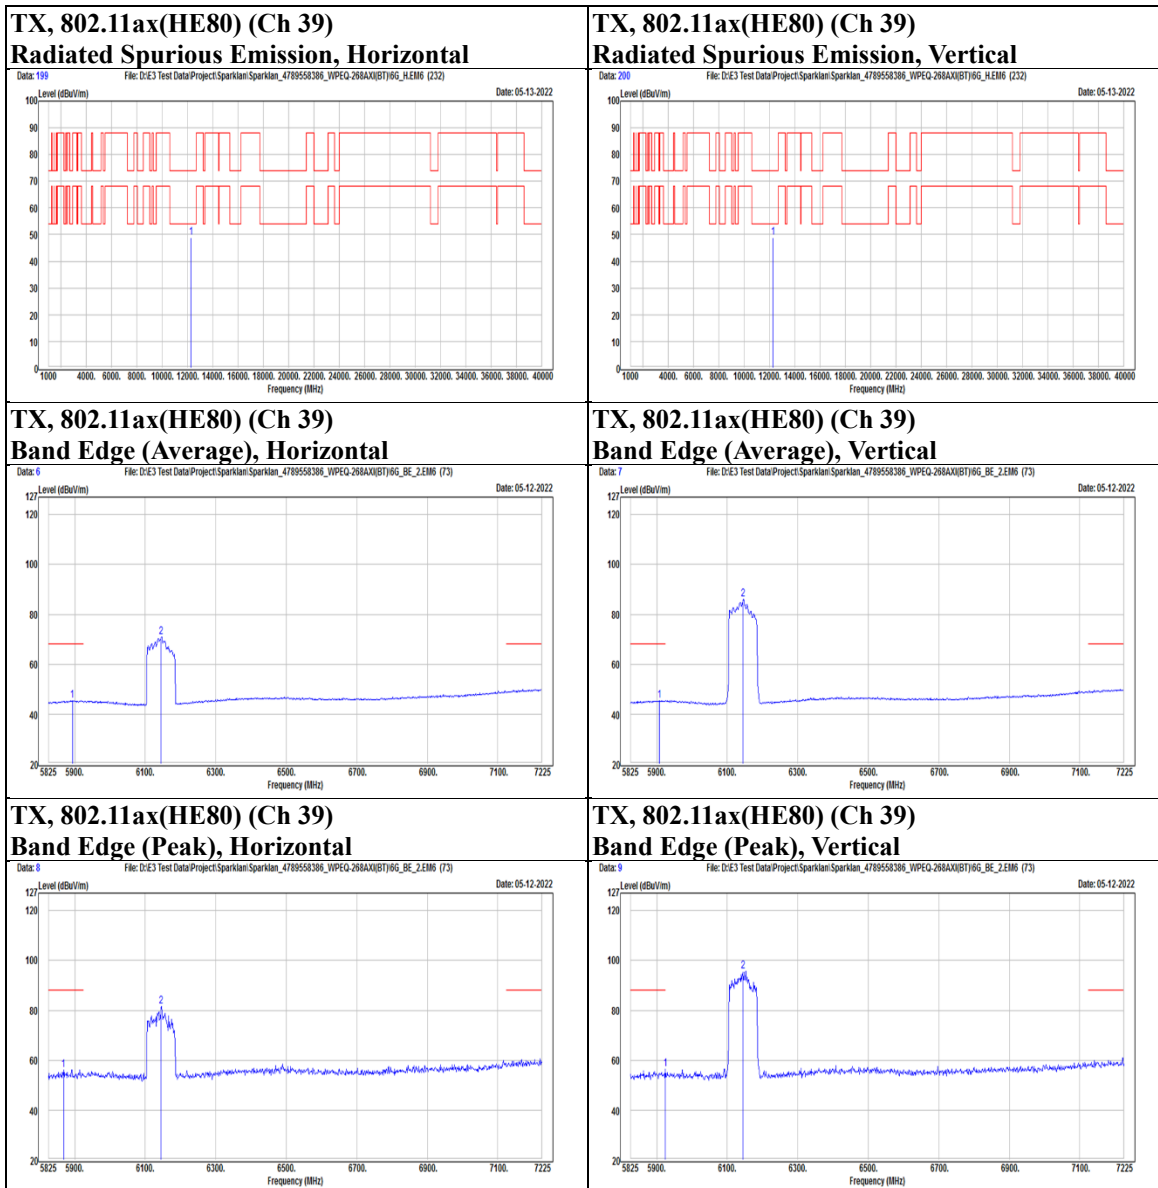



Test report No. : 4790371368-US-R2-V0
Page : 198 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	87
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5836.2	41.19	14.6	55.79	88.2	-32.41	PK
		5921.6	30.63	14.96	45.59	68.2	-22.61	AVG
	@	6385	68.68	16.6	85.28	N/A	N/A	PK
	@	6385	59.8	16.6	76.4	N/A	N/A	AVG
		7135.4	41.18	19.77	60.95	88.2	-27.25	PK
		7220.8	29.71	20.23	49.94	68.2	-18.26	AVG
	*	12770	29.25	20.39	49.64	88.2	-38.56	PK
Vertical		5858.6	40.91	14.68	55.59	88.2	-32.61	PK
		5888	30.84	14.9	45.74	68.2	-22.46	AVG
	@	6385	80.44	16.6	97.04	N/A	N/A	PK
	@	6385	71.12	16.6	87.72	N/A	N/A	AVG
		7212.4	40.57	20.19	60.76	88.2	-27.44	PK
		7215.2	29.66	20.21	49.87	68.2	-18.33	AVG
	*	12770	30.02	20.39	50.41	88.2	-37.79	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

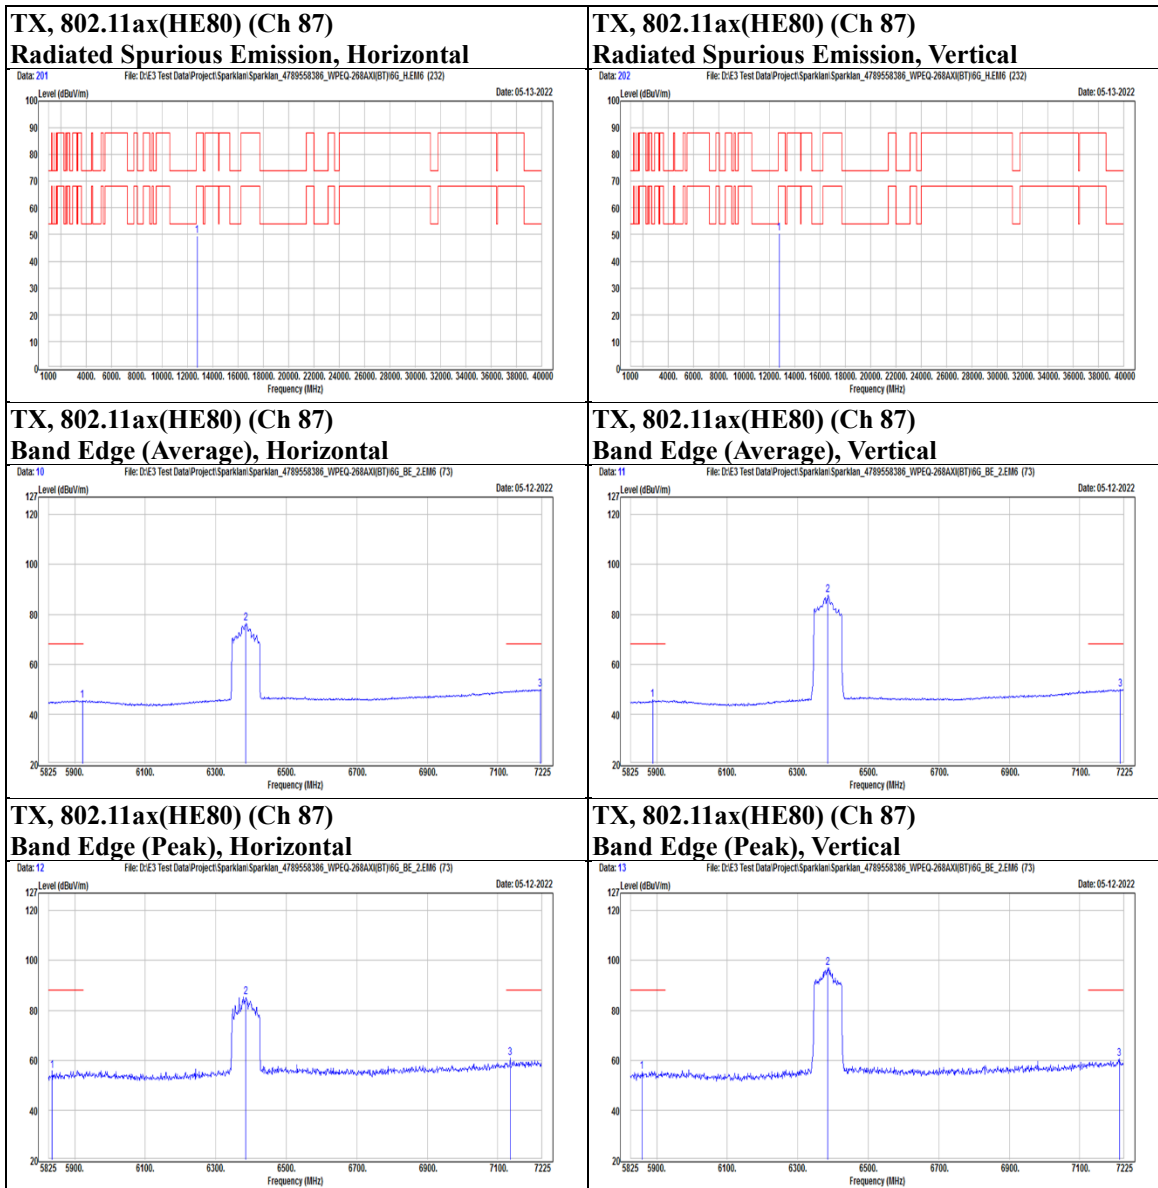



Test report No. : 4790371368-US-R2-V0
Page : 200 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	103
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5878.2	41.87	14.83	56.7	88.2	-31.5	PK
		5911.8	30.31	14.97	45.28	68.2	-22.92	AVG
	@	6465	68.07	16.97	85.04	N/A	N/A	PK
	@	6465	58.24	16.97	75.21	N/A	N/A	AVG
		7198.4	29.96	20.11	50.07	68.2	-18.13	AVG
		7208.2	40.25	20.17	60.42	88.2	-27.78	PK
	*	12930	28.53	20.84	49.37	88.2	-38.83	PK
Vertical		5867	40.68	14.74	55.42	88.2	-32.78	PK
		5897.8	30.5	14.96	45.46	68.2	-22.74	AVG
	@	6465	80.04	16.97	97.01	N/A	N/A	PK
	@	6465	69.73	16.97	86.7	N/A	N/A	AVG
		7215.2	39.38	20.21	59.59	88.2	-28.61	PK
		7216.6	29.7	20.22	49.92	68.2	-18.28	AVG
	*	12930	30.21	20.84	51.05	88.2	-37.15	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

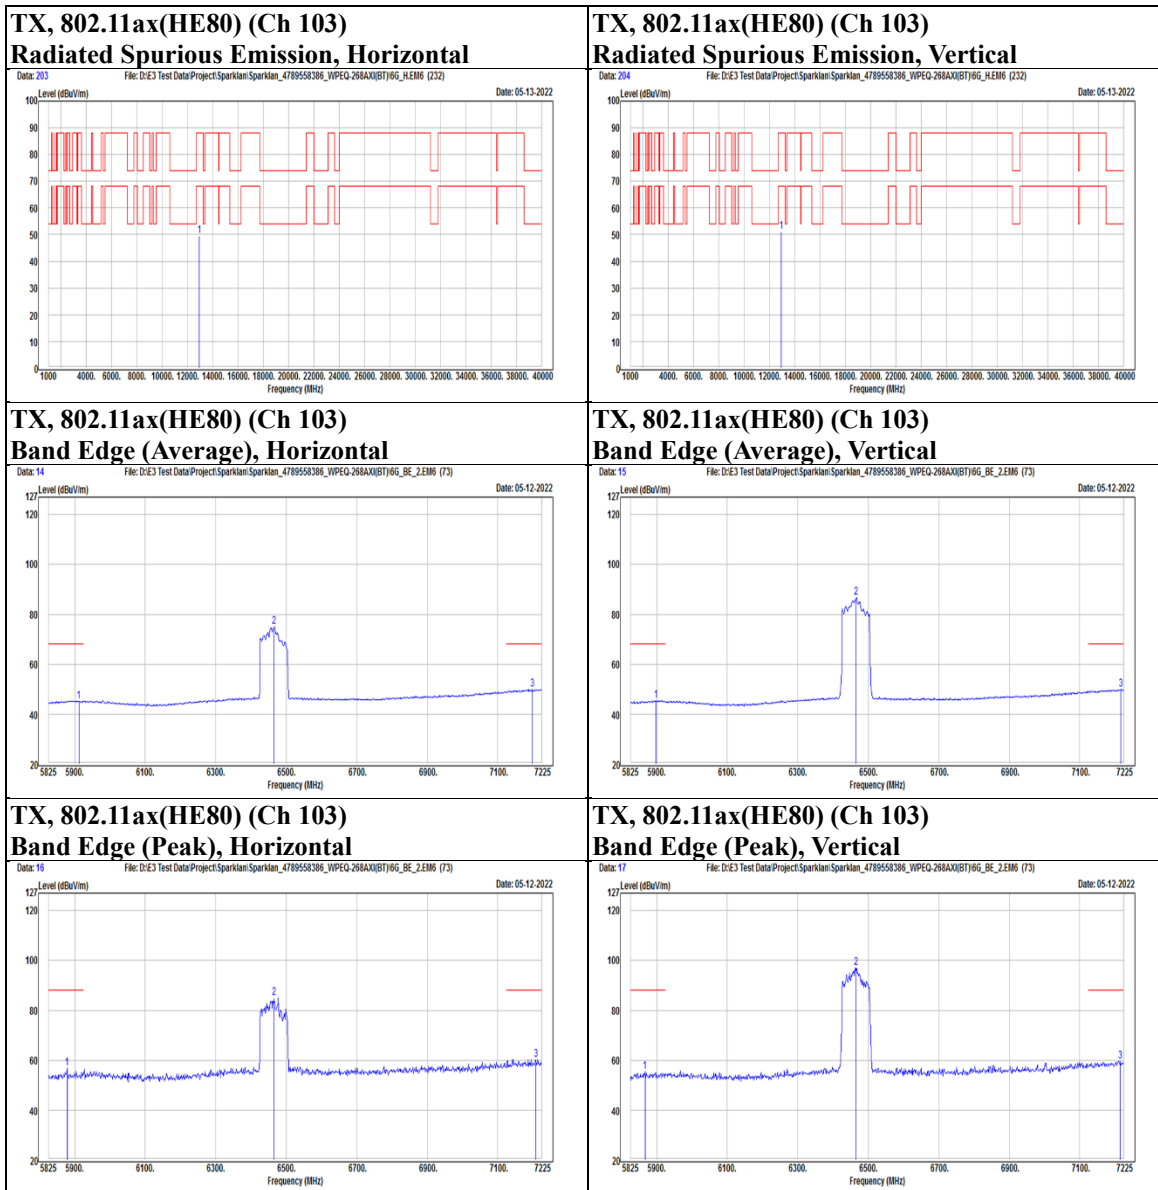



Test report No. : 4790371368-US-R2-V0
Page : 202 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	119
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5882.4	30.65	14.85	45.5	68.2	-22.7	AVG
		5895	42.31	14.94	57.25	88.2	-30.95	PK
	@	6545	66.03	17.34	83.37	N/A	N/A	PK
	@	6545	55.46	17.34	72.8	N/A	N/A	AVG
		7190	39.46	20.07	59.53	88.2	-28.67	PK
		7219.4	29.56	20.23	49.79	68.2	-18.41	AVG
	*	13090	28.52	21.03	49.55	88.2	-38.65	PK
Vertical		5883.8	40.75	14.86	55.61	88.2	-32.59	PK
		5899.2	30.46	14.97	45.43	68.2	-22.77	AVG
	@	6545	78.66	17.34	96	N/A	N/A	PK
	@	6545	69.45	17.34	86.79	N/A	N/A	AVG
		7208.2	29.9	20.17	50.07	68.2	-18.13	AVG
		7218	39.19	20.22	59.41	88.2	-28.79	PK
	*	13090	28.78	21.03	49.81	88.2	-38.39	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0988 / 1.0




TX, 802.11ax(HE80) (Ch 119)
Radiated Spurious Emission, Horizontal

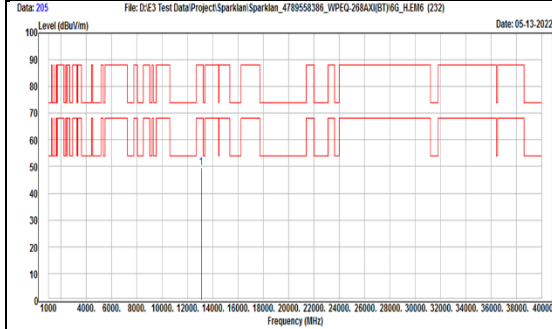


TX, 802.11ax(HE80) (Ch 119)
Radiated Spurious Emission, Vertical

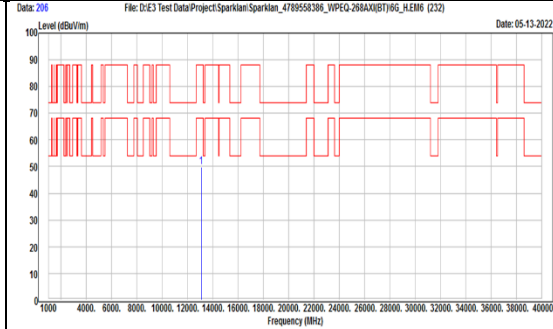


TX, 802.11ax(HE80) (Ch 119)
Band Edge (Average), Horizontal

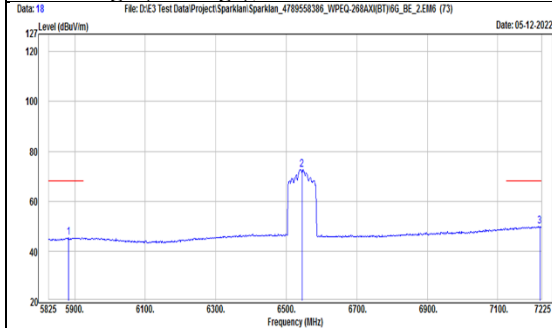


TX, 802.11ax(HE80) (Ch 119)
Band Edge (Average), Vertical

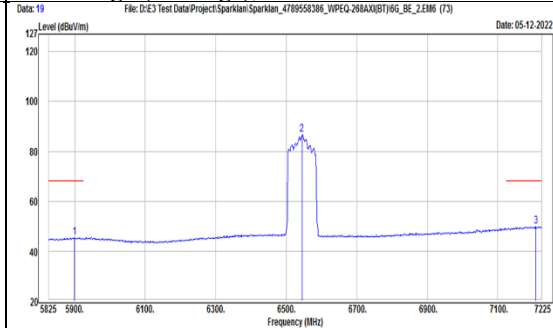

TX, 802.11ax(HE80) (Ch 119)
Band Edge (Peak), Horizontal

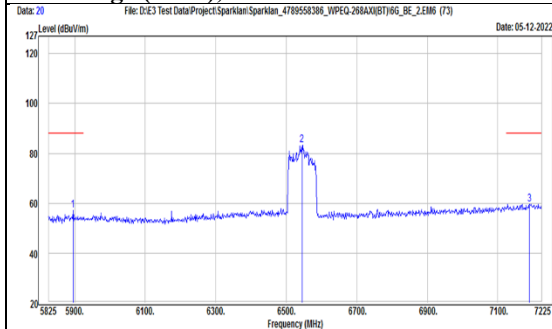

TX, 802.11ax(HE80) (Ch 119)
Band Edge (Peak), Vertical

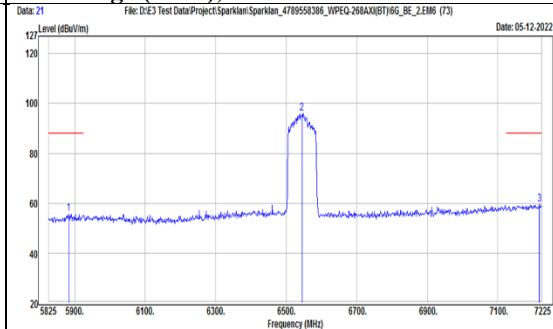



Test report No. : 4790371368-US-R2-V0
Page : 204 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	135
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5892.2	40.66	14.92	55.58	88.2	-32.62	PK
		5917.4	30.57	14.97	45.54	68.2	-22.66	AVG
	@	6625	66.69	17.42	84.11	N/A	N/A	PK
	@	6625	57.53	17.42	74.95	N/A	N/A	AVG
		7176	29.9	19.99	49.89	68.2	-18.31	AVG
		7222.2	40.3	20.25	60.55	88.2	-27.65	PK
	*	13250	29.44	21.49	50.93	74	-23.07	PK
Vertical		5855.8	40.84	14.65	55.49	88.2	-32.71	PK
		5889.4	30.52	14.91	45.43	68.2	-22.77	AVG
	@	6625	79.56	17.42	96.98	N/A	N/A	PK
	@	6625	69.59	17.42	87.01	N/A	N/A	AVG
		7191.4	40.21	20.08	60.29	88.2	-27.91	PK
		7215.2	29.53	20.21	49.74	68.2	-18.46	AVG
	*	13250	28.65	21.49	50.14	74	-23.86	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

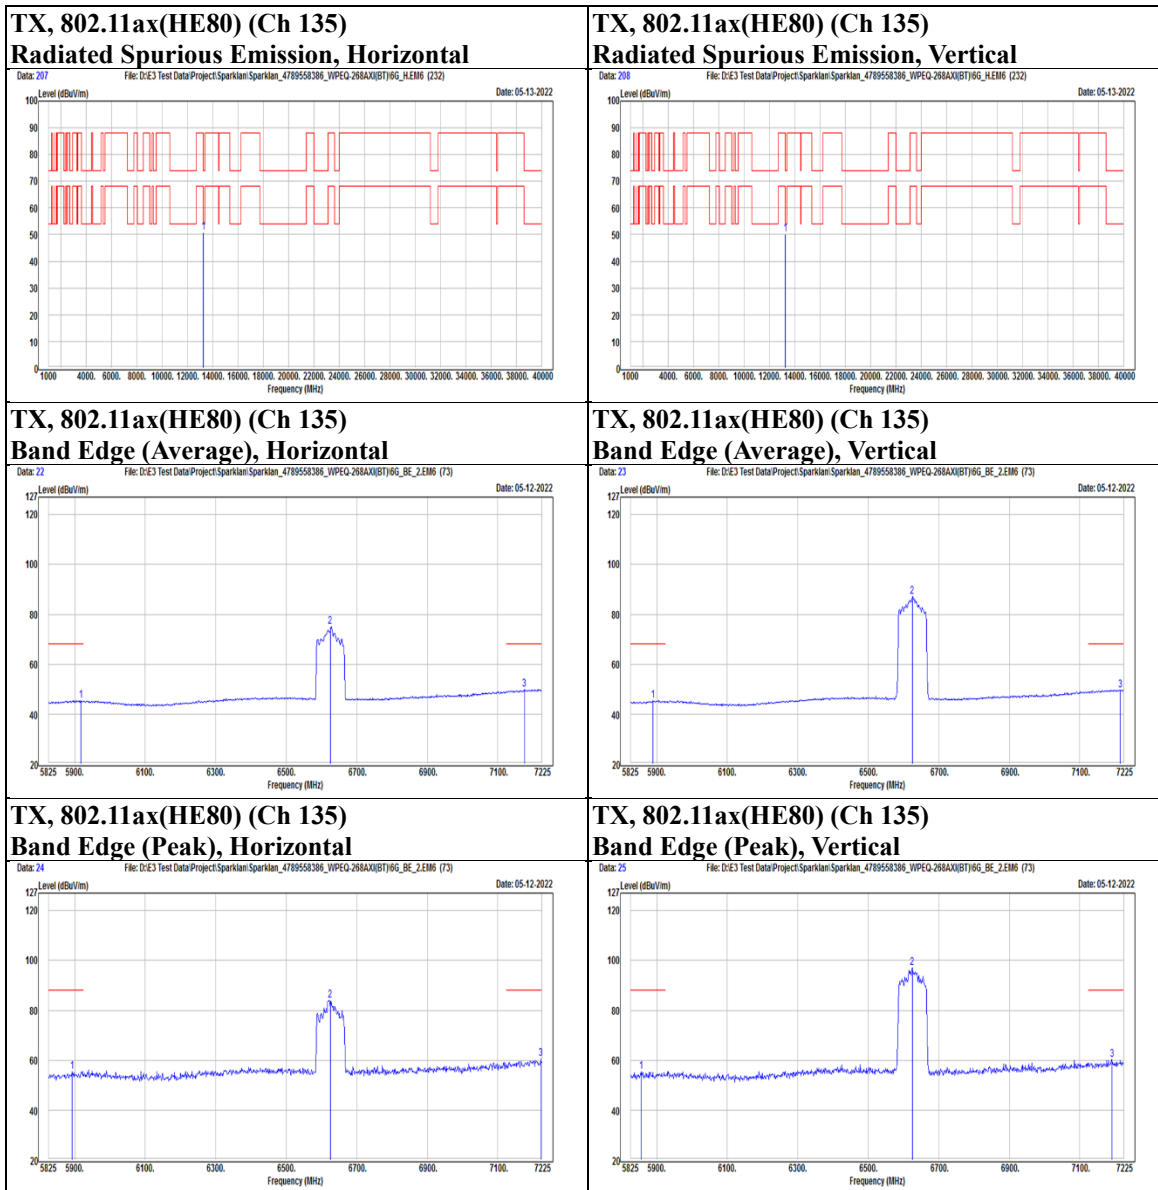



Test report No. : 4790371368-US-R2-V0
Page : 206 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	151
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5833.4	30.96	14.59	45.55	68.2	-22.65	AVG
		5892.2	40.46	14.92	55.38	88.2	-32.82	PK
	@	6705	67.37	17.51	84.88	N/A	N/A	PK
	@	6705	57.52	17.51	75.03	N/A	N/A	AVG
		7183	40.24	20.03	60.27	88.2	-27.93	PK
		7205.4	29.58	20.15	49.73	68.2	-18.47	AVG
	*	13410	28.91	22.17	51.08	88.2	-37.12	PK
Vertical		5897.8	30.72	14.96	45.68	68.2	-22.52	AVG
		5899.2	41.39	14.97	56.36	88.2	-31.84	PK
	@	6705	80.17	17.51	97.68	N/A	N/A	PK
	@	6705	69.89	17.51	87.4	N/A	N/A	AVG
		7187.2	40.03	20.06	60.09	88.2	-28.11	PK
		7225	29.78	20.26	50.04	68.2	-18.16	AVG
	*	13410	29.68	22.17	51.85	88.2	-36.35	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

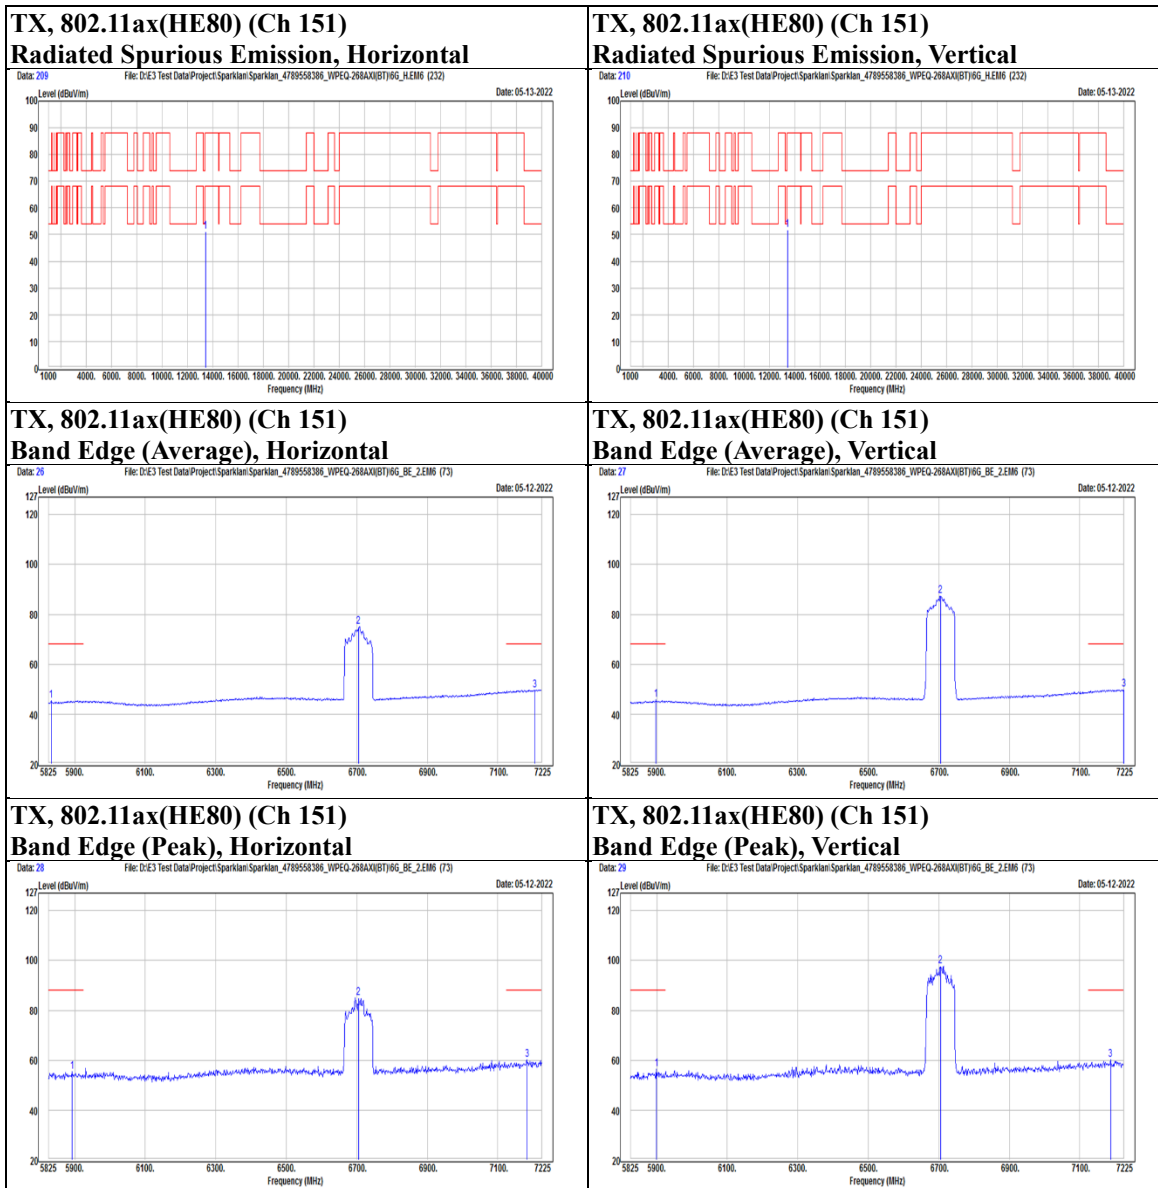



Test report No. : 4790371368-US-R2-V0
Page : 208 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	167
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5886.6	30.46	14.89	45.35	68.2	-22.85	AVG
		5889.4	40.53	14.91	55.44	88.2	-32.76	PK
	@	6785	65.98	17.81	83.79	N/A	N/A	PK
	@	6785	57.16	17.81	74.97	N/A	N/A	AVG
		7220.8	39.8	20.23	60.03	88.2	-28.17	PK
		7223.6	29.52	20.25	49.77	68.2	-18.43	AVG
	*	13570	30.05	22.84	52.89	88.2	-35.31	PK
Vertical		5883.8	40.73	14.86	55.59	88.2	-32.61	PK
		5920.2	30.52	14.96	45.48	68.2	-22.72	AVG
	@	6785	80.37	17.81	98.18	N/A	N/A	PK
	@	6785	71.04	17.81	88.85	N/A	N/A	AVG
		7216.6	29.57	20.22	49.79	68.2	-18.41	AVG
		7222.2	40.26	20.25	60.51	88.2	-27.69	PK
	*	13570	30.79	22.84	53.63	88.2	-34.57	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

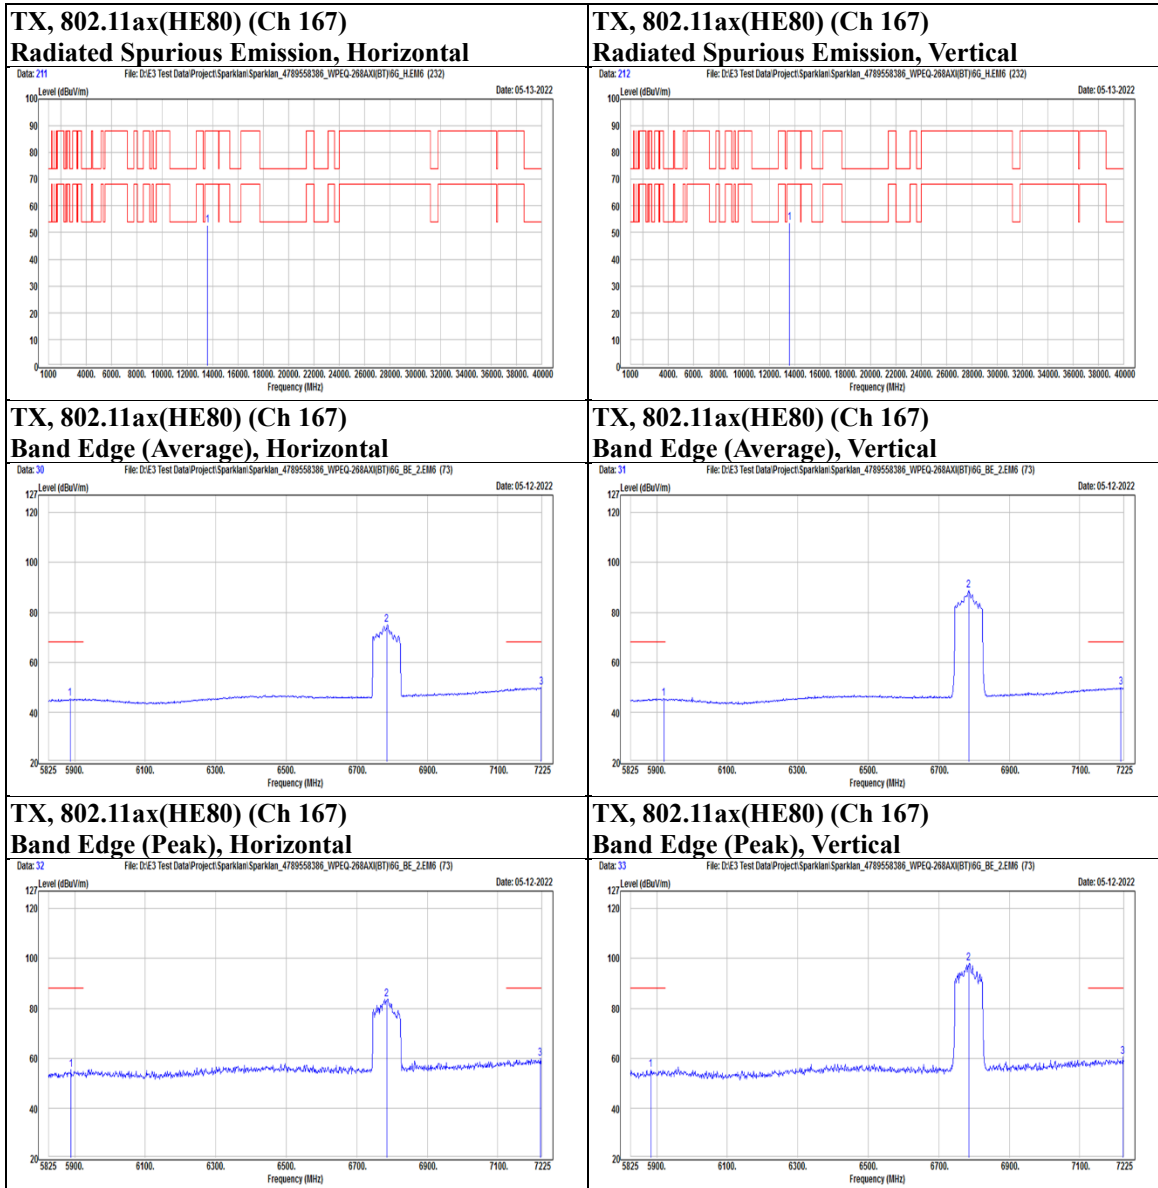



Test report No. : 4790371368-US-R2-V0
Page : 210 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	183
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5878.2	40.96	14.83	55.79	88.2	-32.41	PK
		5893.6	30.29	14.93	45.22	68.2	-22.98	AVG
	@	6865	65.69	18.29	83.98	N/A	N/A	PK
	@	6865	55.58	18.29	73.87	N/A	N/A	AVG
		7202.6	40.13	20.14	60.27	88.2	-27.93	PK
		7222.2	29.72	20.25	49.97	68.2	-18.23	AVG
	*	13730	30.77	22.86	53.63	88.2	-34.57	PK
Vertical		5871.2	41.09	14.78	55.87	88.2	-32.33	PK
		5900.6	30.55	14.98	45.53	68.2	-22.67	AVG
	@	6865	80.6	18.29	98.89	N/A	N/A	PK
	@	6865	69.05	18.29	87.34	N/A	N/A	AVG
		7212.4	29.52	20.19	49.71	68.2	-18.49	AVG
		7225	40.23	20.26	60.49	88.2	-27.71	PK
	*	13730	29.64	22.86	52.5	88.2	-35.7	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

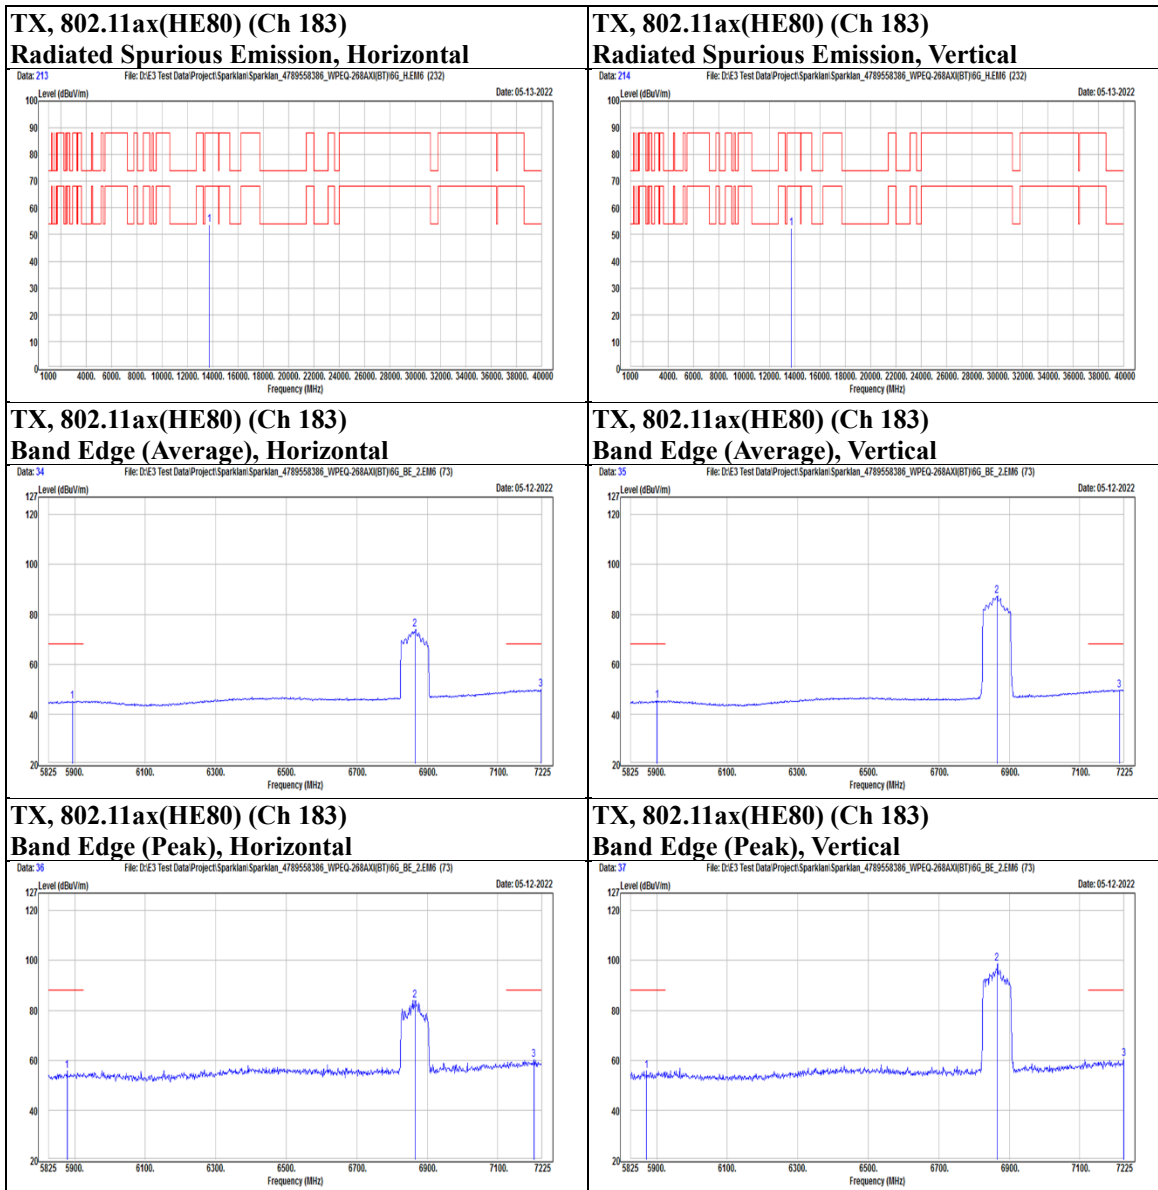



Test report No. : 4790371368-US-R2-V0
Page : 212 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	199
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	6945	64.37	18.55	82.92	N/A	N/A	PK
	@	6945	55.4	18.55	73.95	N/A	N/A	AVG
		7213.8	40.76	20.2	60.96	88.2	-27.24	PK
		7220.8	29.43	20.23	49.66	68.2	-18.54	AVG
	*	13890	29.96	23.56	53.52	88.2	-34.68	PK
Vertical	@	6945	78.56	18.55	97.11	N/A	N/A	PK
	@	6945	68.4	18.55	86.95	N/A	N/A	AVG
		7222.2	29.74	20.25	49.99	68.2	-18.21	AVG
		7223.6	40.09	20.25	60.34	88.2	-27.86	PK
	*	13890	30.6	23.56	54.16	88.2	-34.04	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 213 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

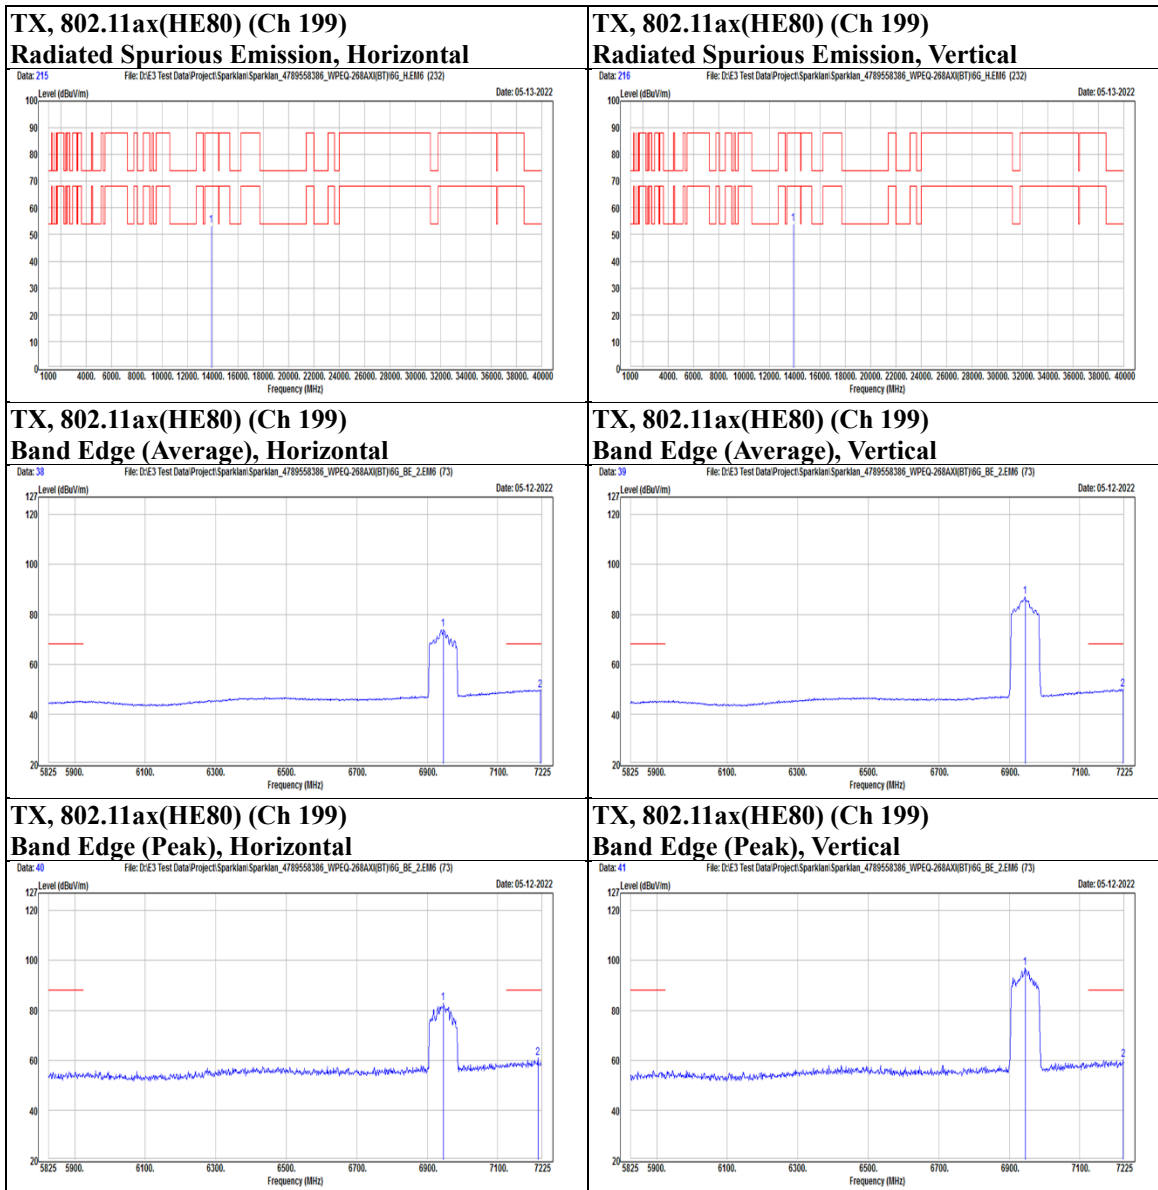

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 214 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE80)	Channel	215
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7025	61.34	18.97	80.31	N/A	N/A	PK
	@	7025	54.06	18.97	73.03	N/A	N/A	AVG
		7208.2	29.72	20.17	49.89	68.2	-18.31	AVG
		7209.6	40.5	20.18	60.68	88.2	-27.52	PK
	*	14050	30.1	24.2	54.3	88.2	-33.9	PK
Vertical	@	7025	75.91	18.97	94.88	N/A	N/A	PK
	@	7025	66.55	18.97	85.52	N/A	N/A	AVG
		7185.8	41.91	20.04	61.95	88.2	-26.25	PK
		7208.2	29.7	20.17	49.87	68.2	-18.33	AVG
	*	14050	29.72	24.2	53.92	88.2	-34.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 215 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

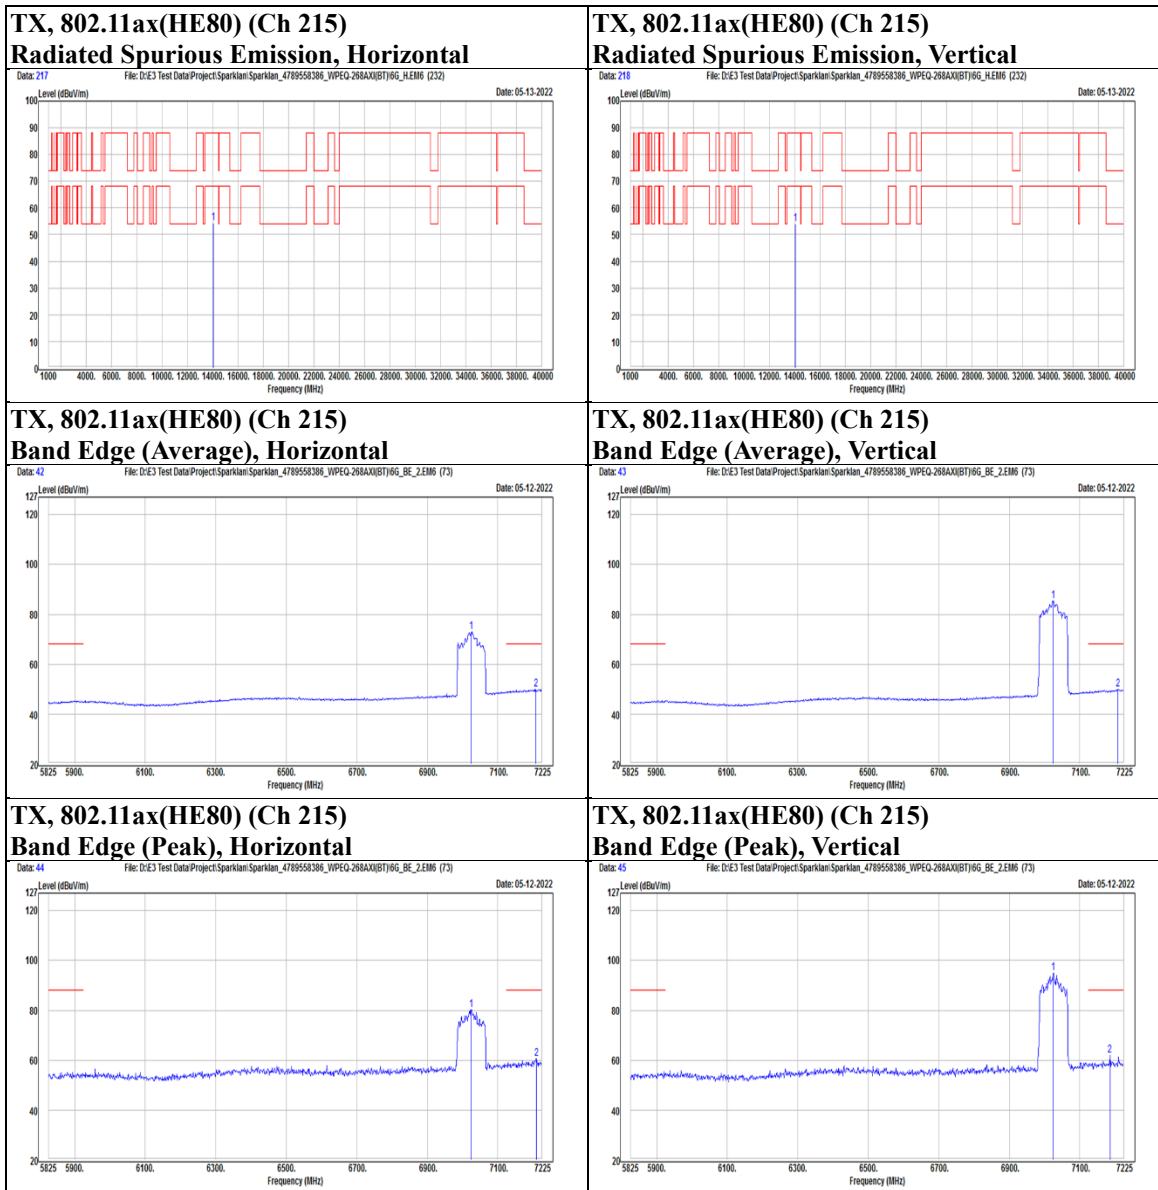

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0988 / 1.0



Test report No. : 4790371368-US-R2-V0
Page : 216 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE160)	Channel	15
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5897.8	40.62	14.96	55.58	88.2	-32.62	PK
		5923	30.66	14.96	45.62	68.2	-22.58	AVG
	@	6025	73.3	14.98	88.28	N/A	N/A	PK
	@	6025	61.44	14.98	76.42	N/A	N/A	AVG
	*	12050	29.53	18.97	48.5	74	-25.5	PK
Vertical		5896.4	33.28	14.95	48.23	68.2	-19.97	AVG
		5909	41.35	14.97	56.32	88.2	-31.88	PK
	@	6025	83.55	14.98	98.53	N/A	N/A	PK
	@	6025	72.16	14.98	87.14	N/A	N/A	AVG
	*	12050	31.11	18.97	50.08	74	-23.92	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

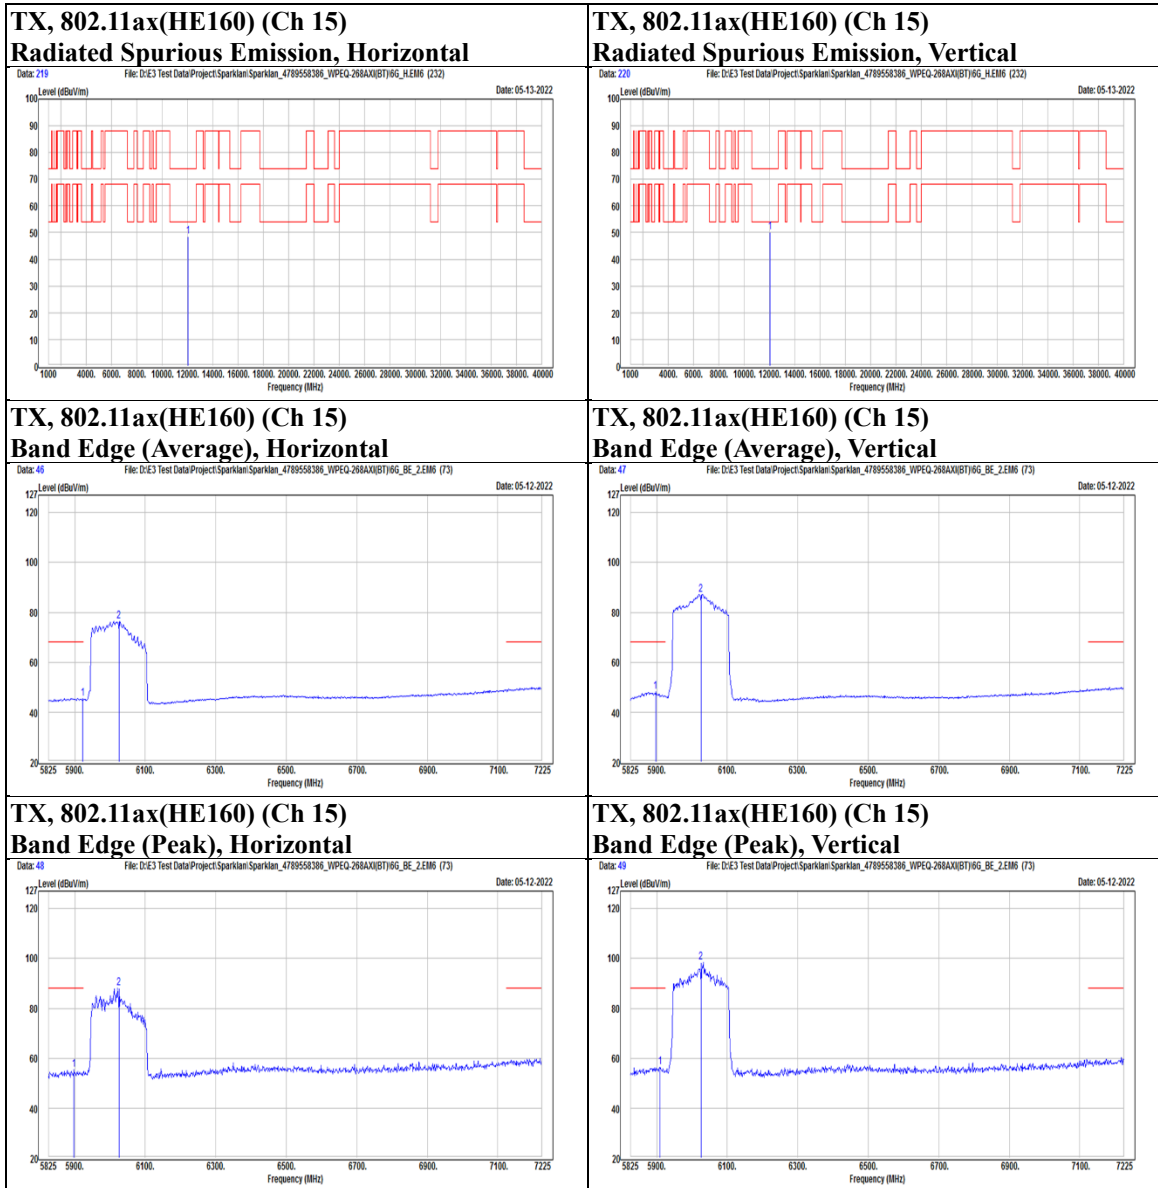



Test report No. : 4790371368-US-R2-V0
Page : 218 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE160)	Channel	47
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5871.2	41.05	14.78	55.83	88.2	-32.37	PK
		5899.2	30.24	14.97	45.21	68.2	-22.99	AVG
	@	6185	66.48	15.57	82.05	N/A	N/A	PK
	@	6185	56.45	15.57	72.02	N/A	N/A	AVG
	*	12370	29.27	19.2	48.47	74	-25.53	PK
Vertical		5848.8	40.98	14.61	55.59	88.2	-32.61	PK
		5918.8	30.6	14.96	45.56	68.2	-22.64	AVG
	@	6185	80.47	15.57	96.04	N/A	N/A	PK
	@	6185	71.03	15.57	86.6	N/A	N/A	AVG
	*	12370	31.07	19.2	50.27	74	-23.73	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

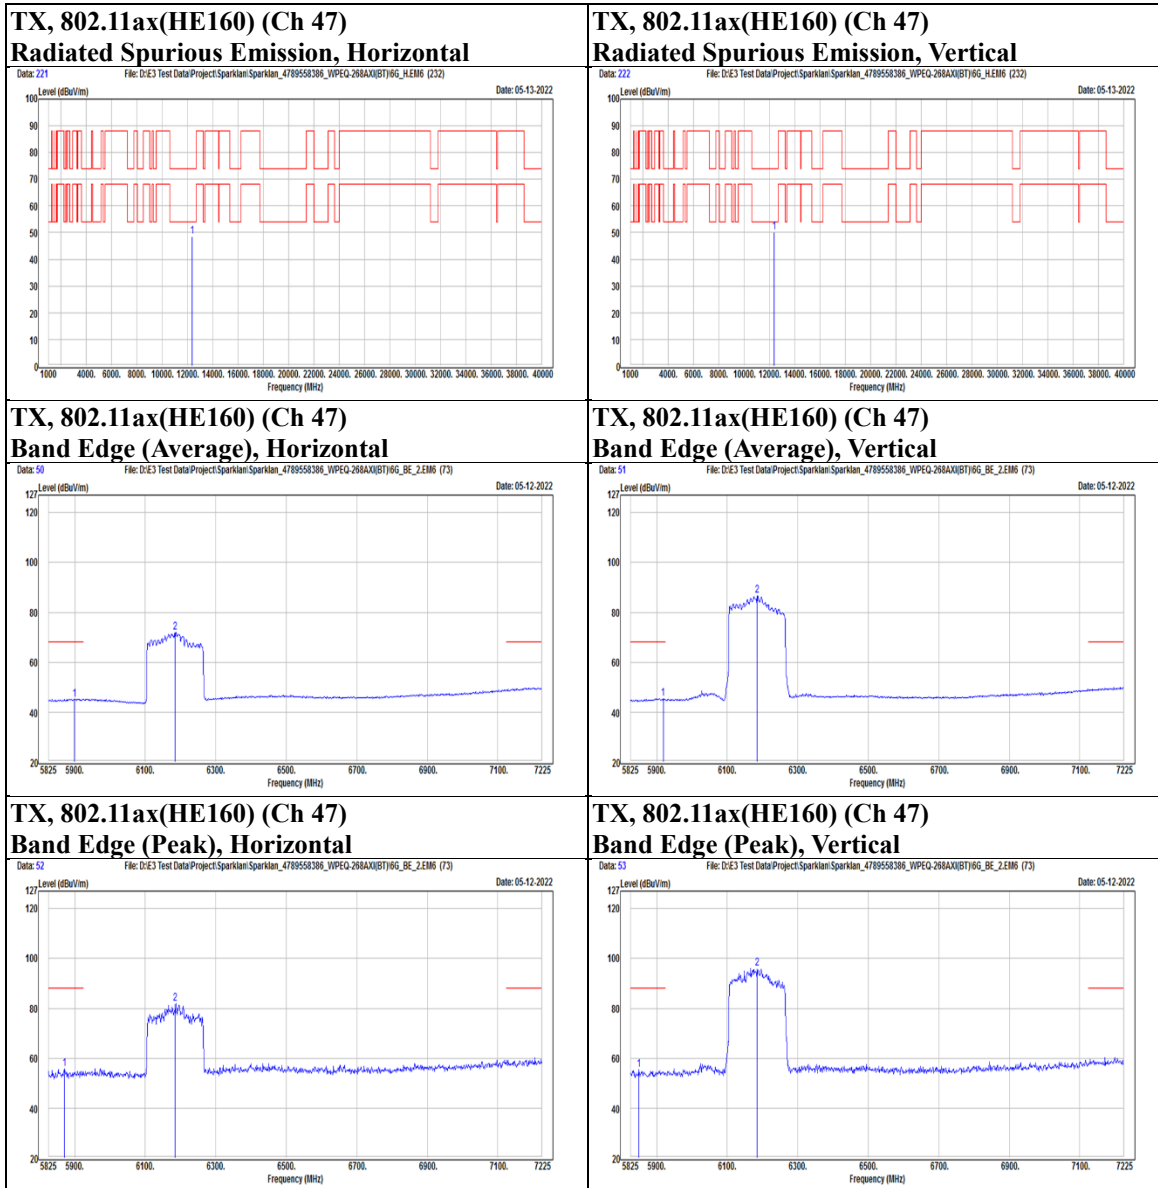



Test report No. : 4790371368-US-R2-V0
Page : 220 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE160)	Channel	79
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5896.4	41.17	14.95	56.12	88.2	-32.08	PK
		5923	30.41	14.96	45.37	68.2	-22.83	AVG
	@	6345	70.18	16.38	86.56	N/A	N/A	PK
	@	6345	59.82	16.38	76.2	N/A	N/A	AVG
		7192.8	40.43	20.08	60.51	88.2	-27.69	PK
		7219.4	29.56	20.23	49.79	68.2	-18.41	AVG
	*	12690	30.59	20	50.59	74	-23.41	PK
Vertical		5878.2	40.76	14.83	55.59	88.2	-32.61	PK
		5900.6	30.35	14.98	45.33	68.2	-22.87	AVG
	@	6345	82.42	16.38	98.8	N/A	N/A	PK
	@	6345	71.62	16.38	88	N/A	N/A	AVG
		7209.6	39.44	20.18	59.62	88.2	-28.58	PK
		7218	29.68	20.22	49.9	68.2	-18.3	AVG
	*	12690	29.76	20	49.76	74	-24.24	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

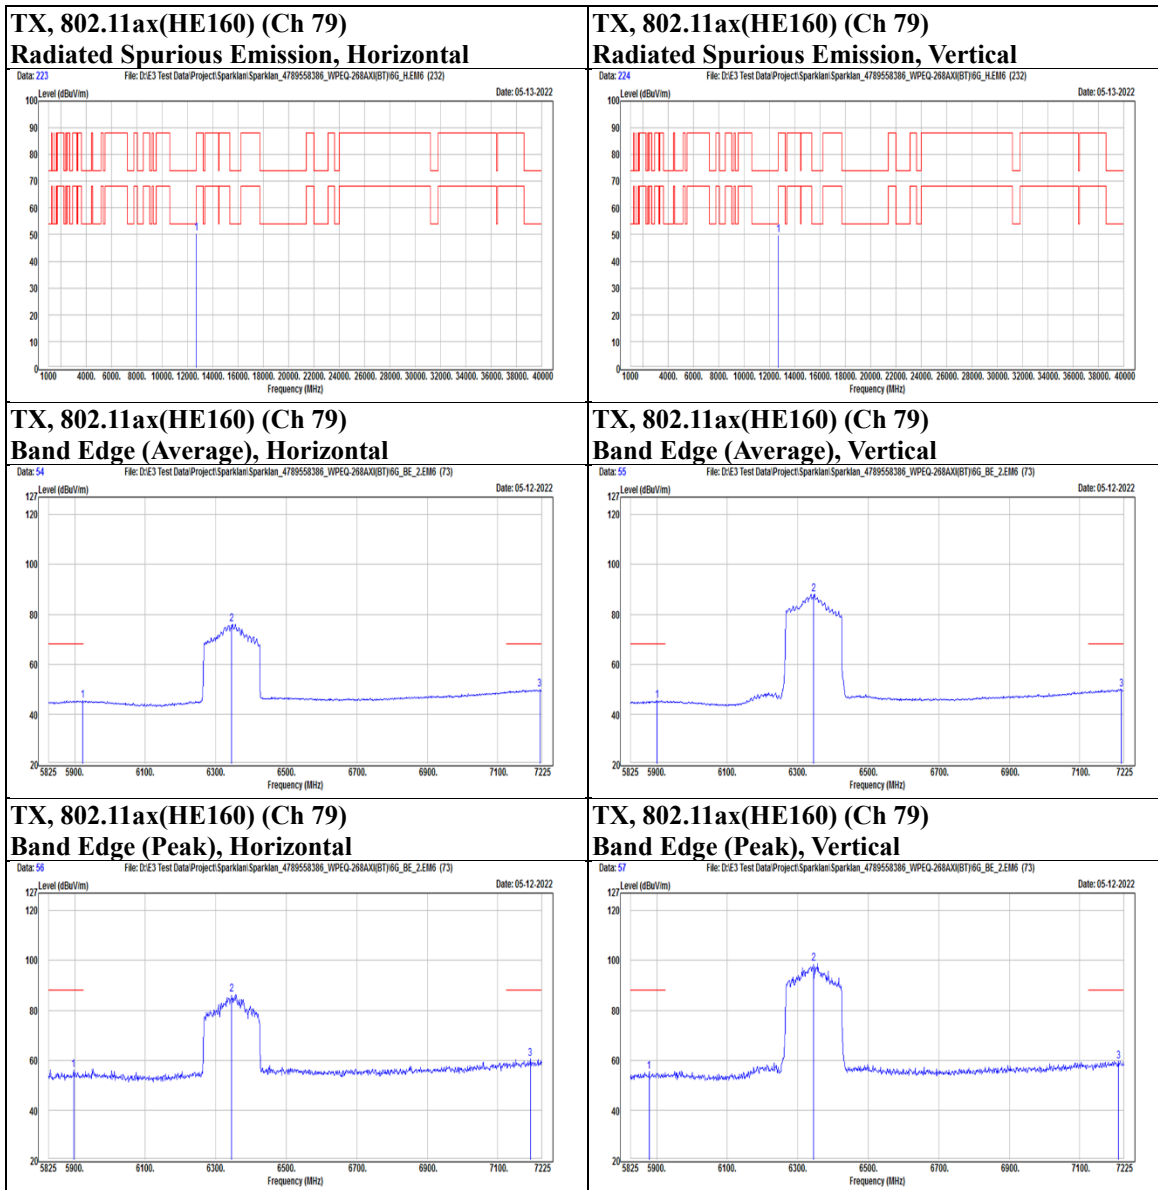



Test report No. : 4790371368-US-R2-V0
Page : 222 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE160)	Channel	111
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5860	41.48	14.69	56.17	88.2	-32.03	PK
		5896.4	30.17	14.95	45.12	68.2	-23.08	AVG
	@	6505	66.36	17.3	83.66	N/A	N/A	PK
	@	6505	56.18	17.3	73.48	N/A	N/A	AVG
		7157.8	40.1	19.89	59.99	88.2	-28.21	PK
		7218	29.64	20.22	49.86	68.2	-18.34	AVG
	*	13010	29.07	20.92	49.99	88.2	-38.21	PK
Vertical		5903.4	30.19	14.97	45.16	68.2	-23.04	AVG
		5916	41.26	14.97	56.23	88.2	-31.97	PK
	@	6505	80.09	17.3	97.39	N/A	N/A	PK
	@	6505	69.28	17.3	86.58	N/A	N/A	AVG
		7219.4	29.61	20.23	49.84	68.2	-18.36	AVG
		7225	40.36	20.26	60.62	88.2	-27.58	PK
	*	13010	28.66	20.92	49.58	88.2	-38.62	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

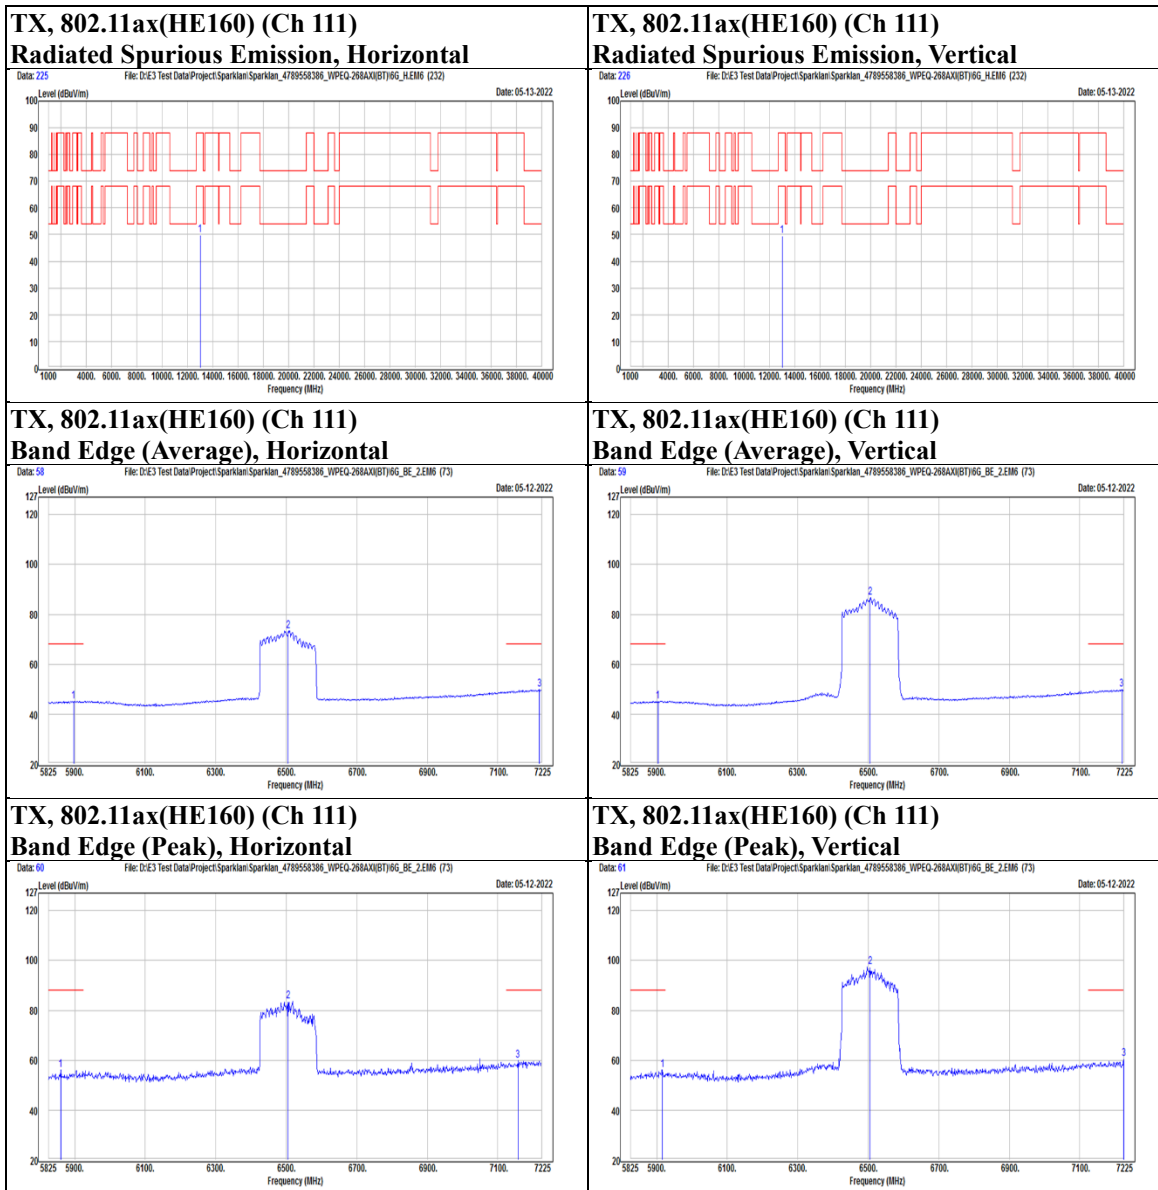



Test report No. : 4790371368-US-R2-V0
Page : 224 of 269
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE160)	Channel	143
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5897.8	30.54	14.96	45.5	68.2	-22.7	AVG
		5918.8	40.5	14.96	55.46	88.2	-32.74	PK
	@	6665	66.66	17.47	84.13	N/A	N/A	PK
	@	6665	56.72	17.47	74.19	N/A	N/A	AVG
		7192.8	29.74	20.08	49.82	68.2	-18.38	AVG
		7209.6	39.94	20.18	60.12	88.2	-28.08	PK
	*	13330	29.27	21.8	51.07	74	-22.93	PK
Vertical		5909	30.37	14.97	45.34	68.2	-22.86	AVG
		5913.2	41.17	14.96	56.13	88.2	-32.07	PK
	@	6665	78.82	17.47	96.29	N/A	N/A	PK
	@	6665	68.91	17.47	86.38	N/A	N/A	AVG
		7176	40.25	19.99	60.24	88.2	-27.96	PK
		7211	29.56	20.18	49.74	68.2	-18.46	AVG
	*	13330	28.33	21.8	50.13	74	-23.87	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0