





Restrict Band NVNT n40 5230MHz Ant2 Peak

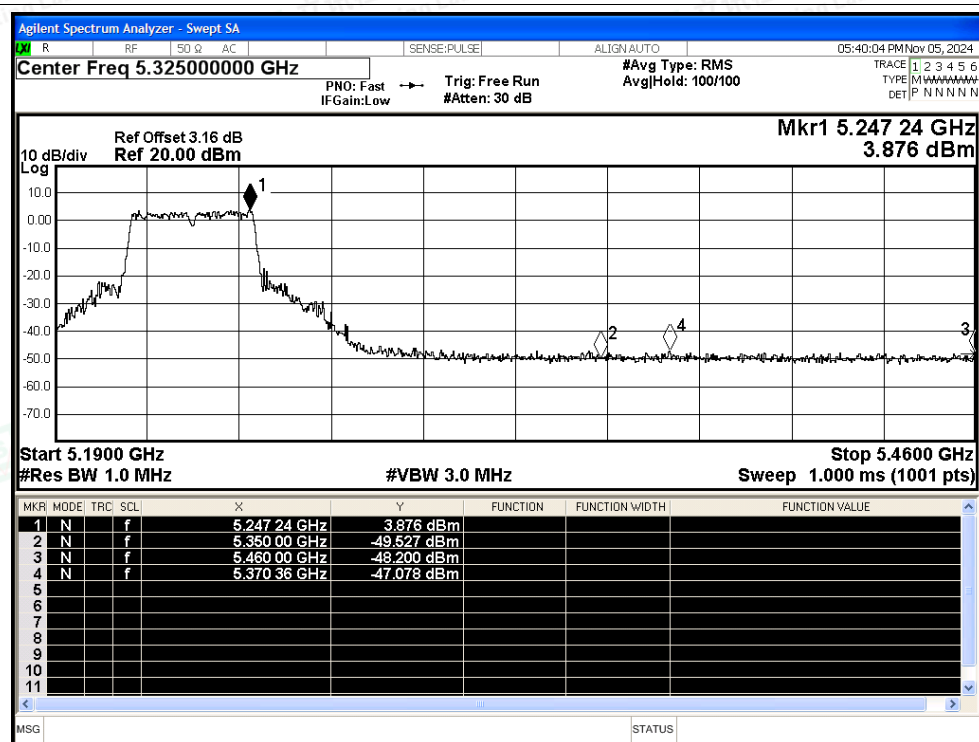

Restrict Band NVNT n40 5230MHz Ant2 Average

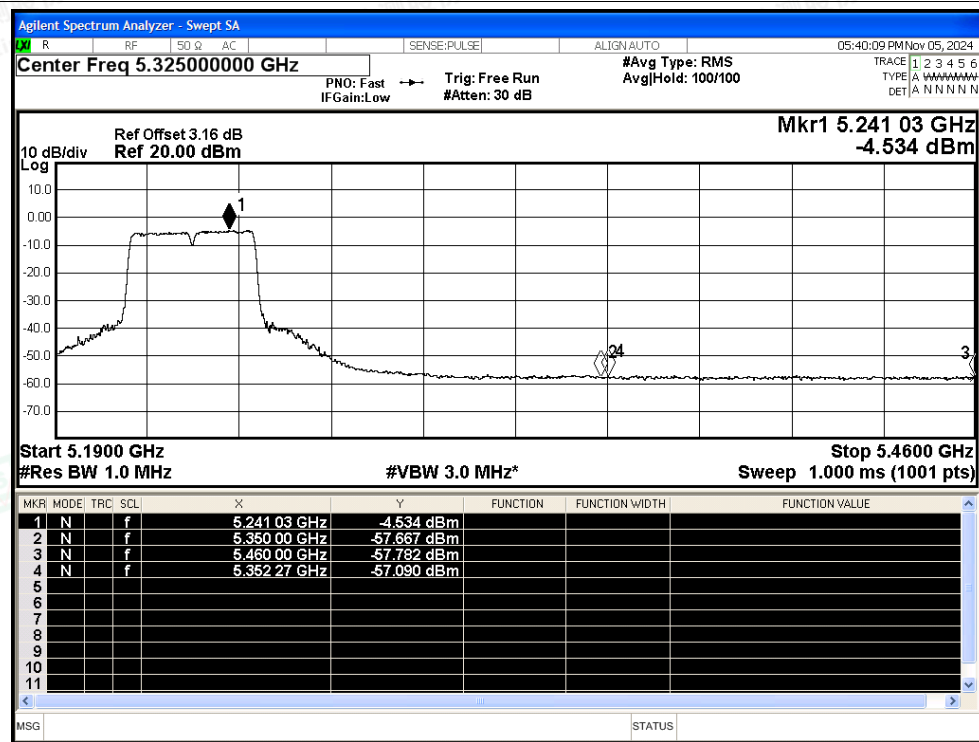

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

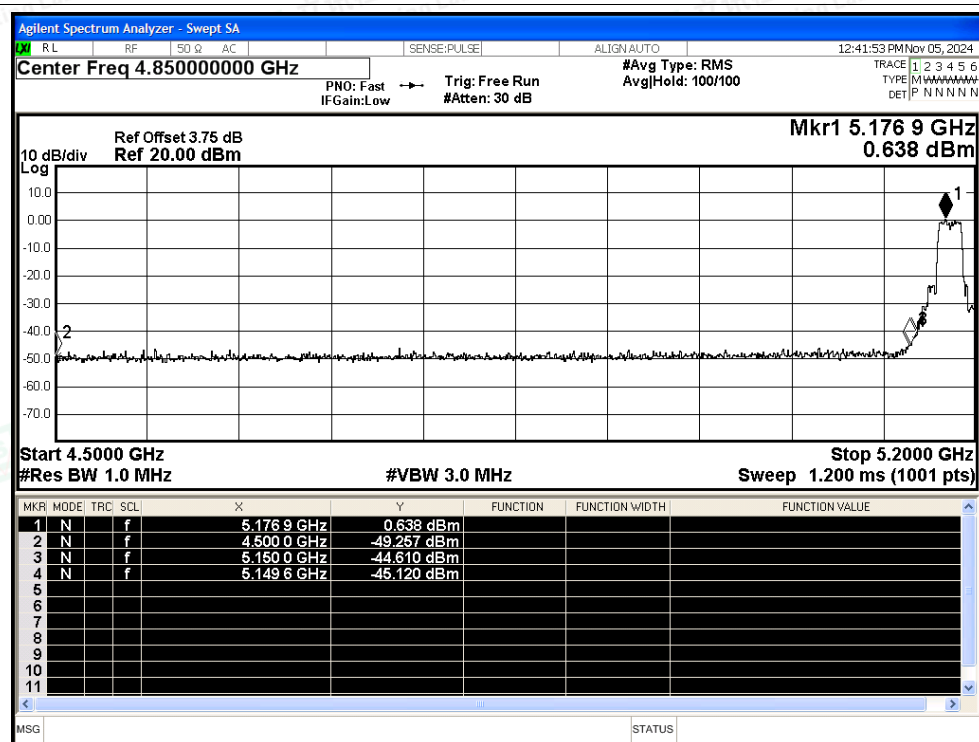


Restrict Band NVNT ac20 5180MHz Ant2 Average

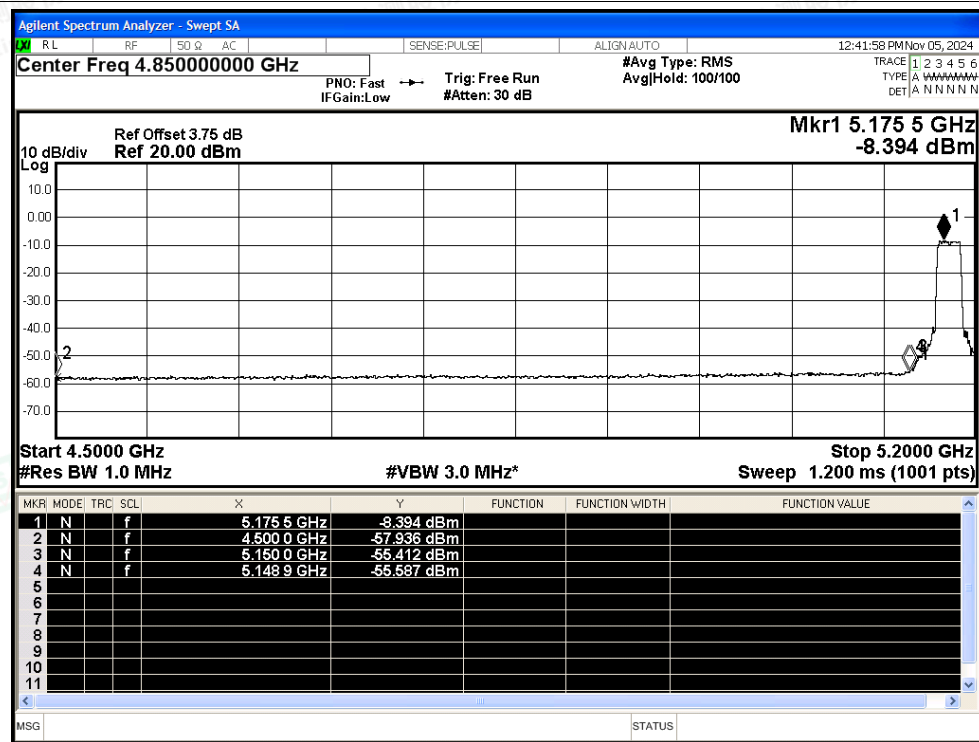




Restrict Band NVNT ac20 5240MHz Ant2 Peak

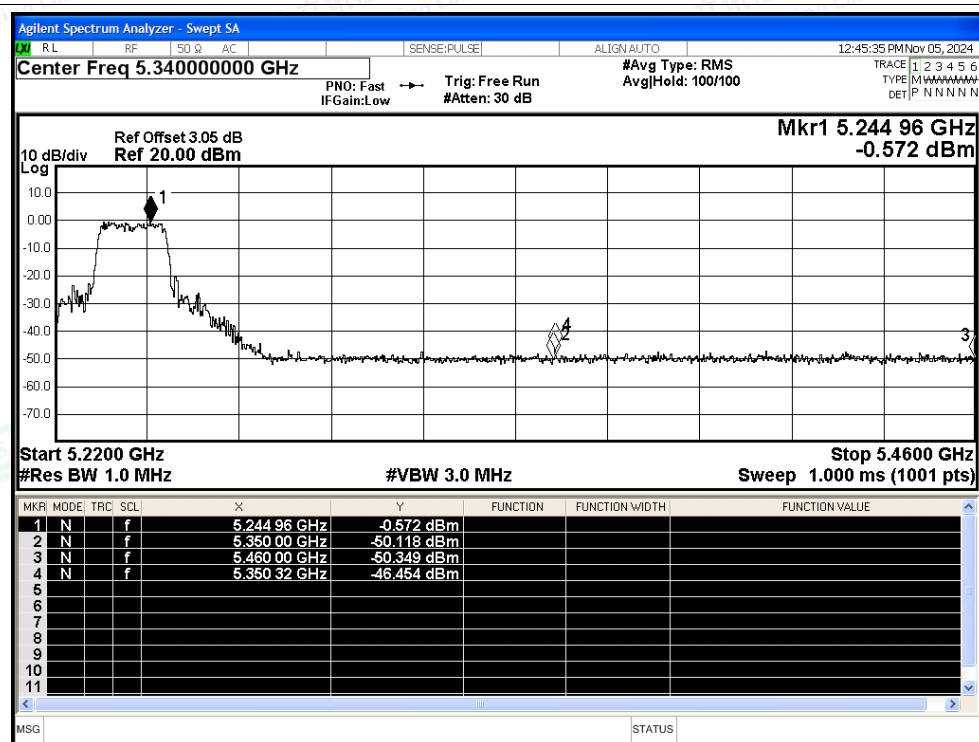


Restrict Band NVNT ac20 5240MHz Ant2 Average

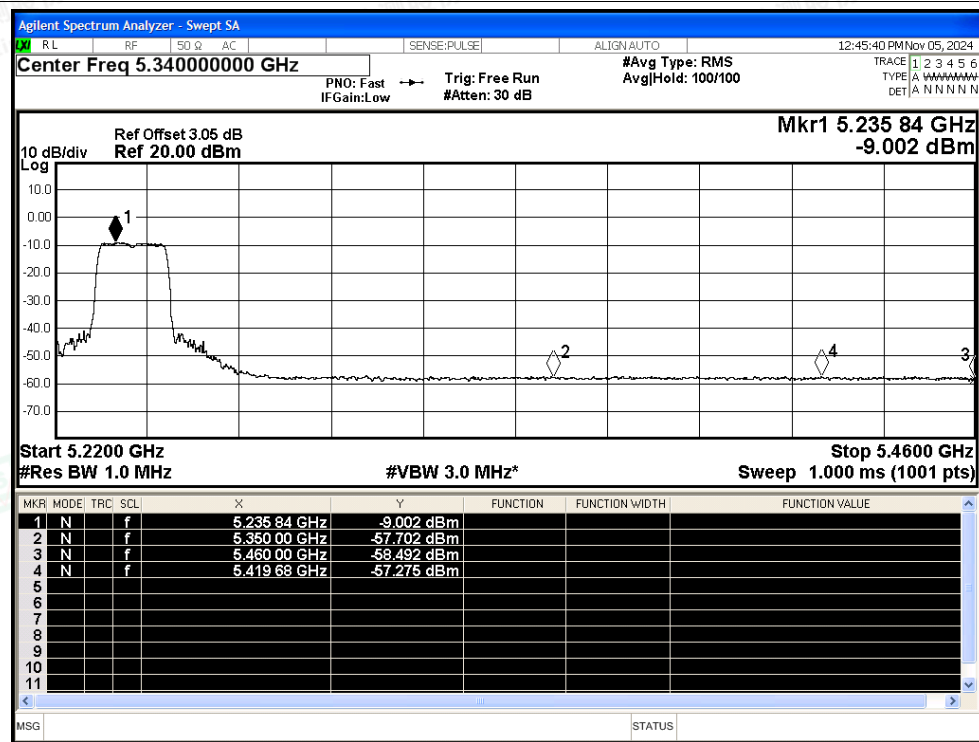




Restrict Band NVNT ac40 5190MHz Ant2 Peak

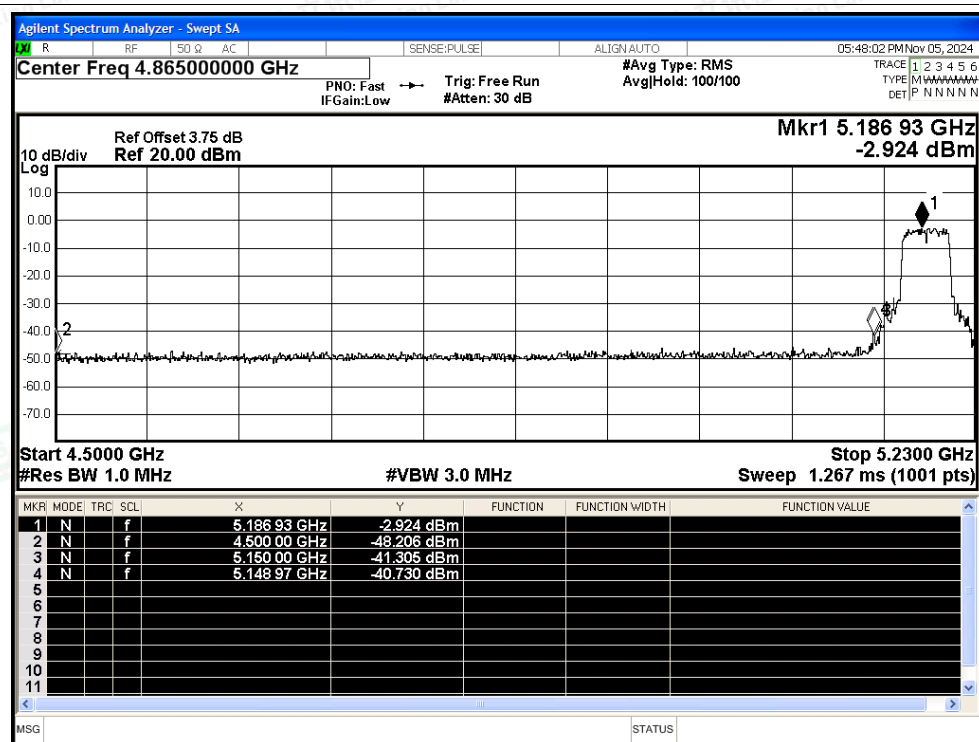


Restrict Band NVNT ac40 5190MHz Ant2 Average

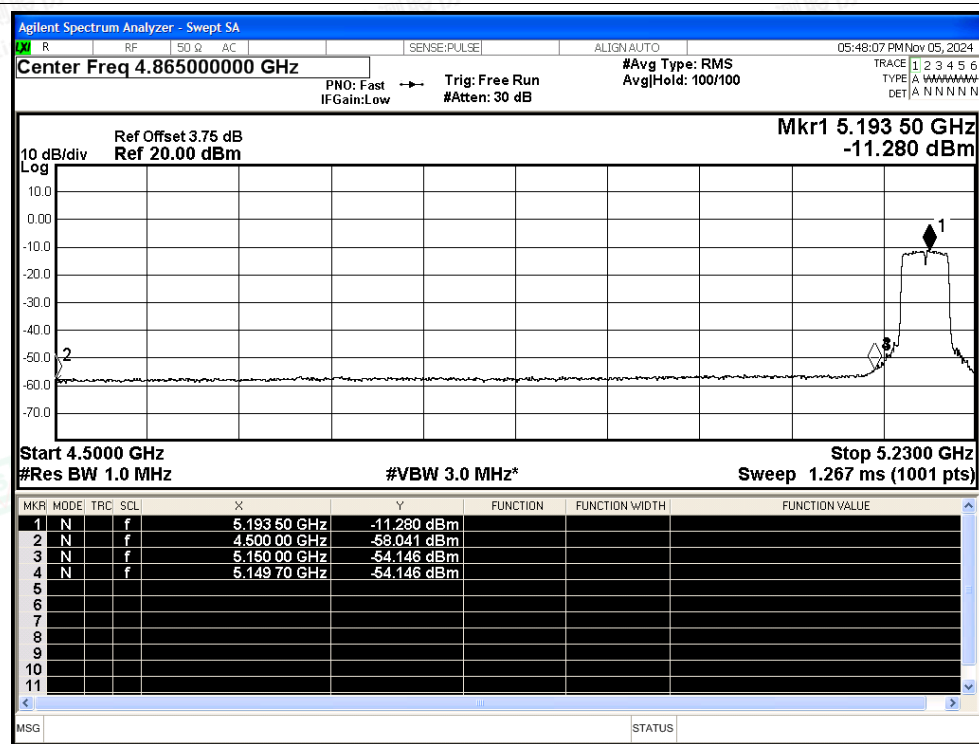




Restrict Band NVNT ac40 5230MHz Ant2 Peak

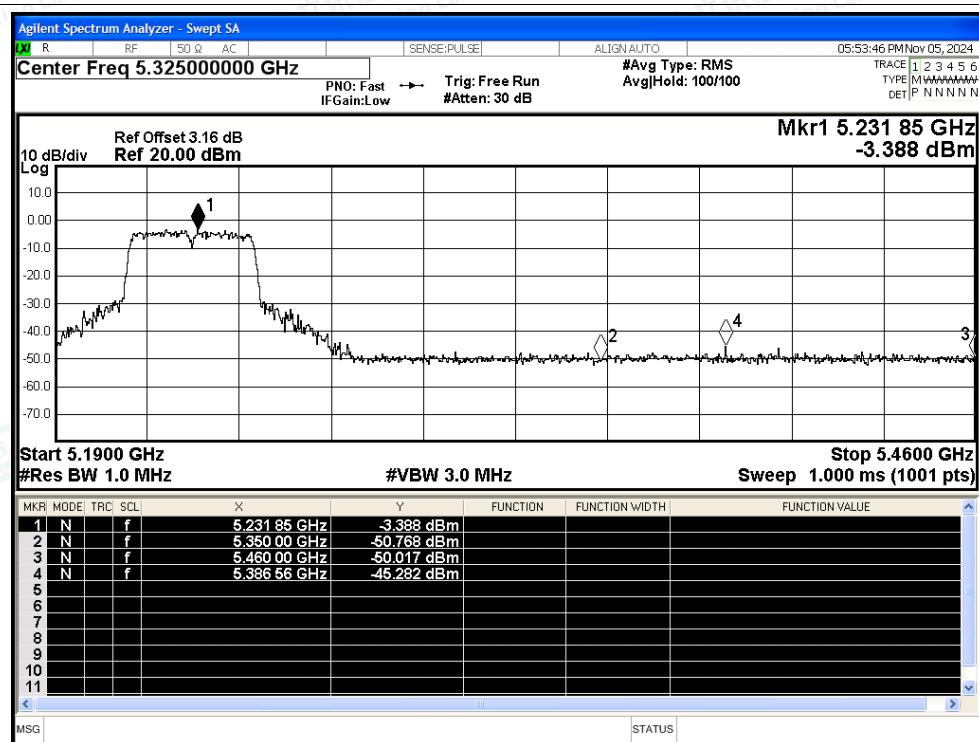

Restrict Band NVNT ac40 5230MHz Ant2 Average

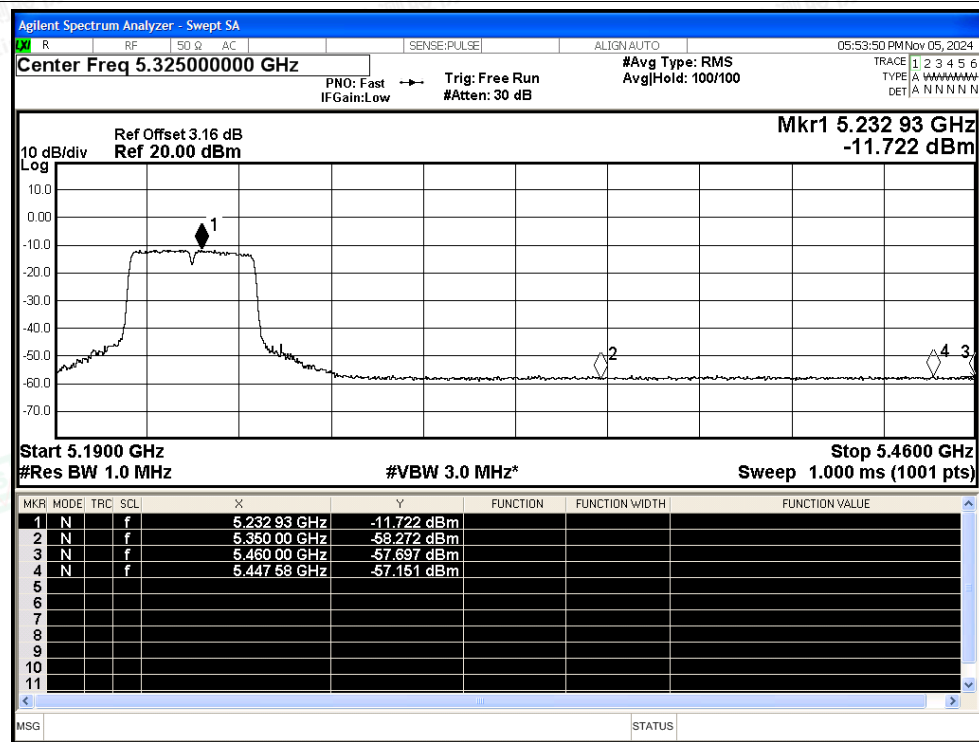

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

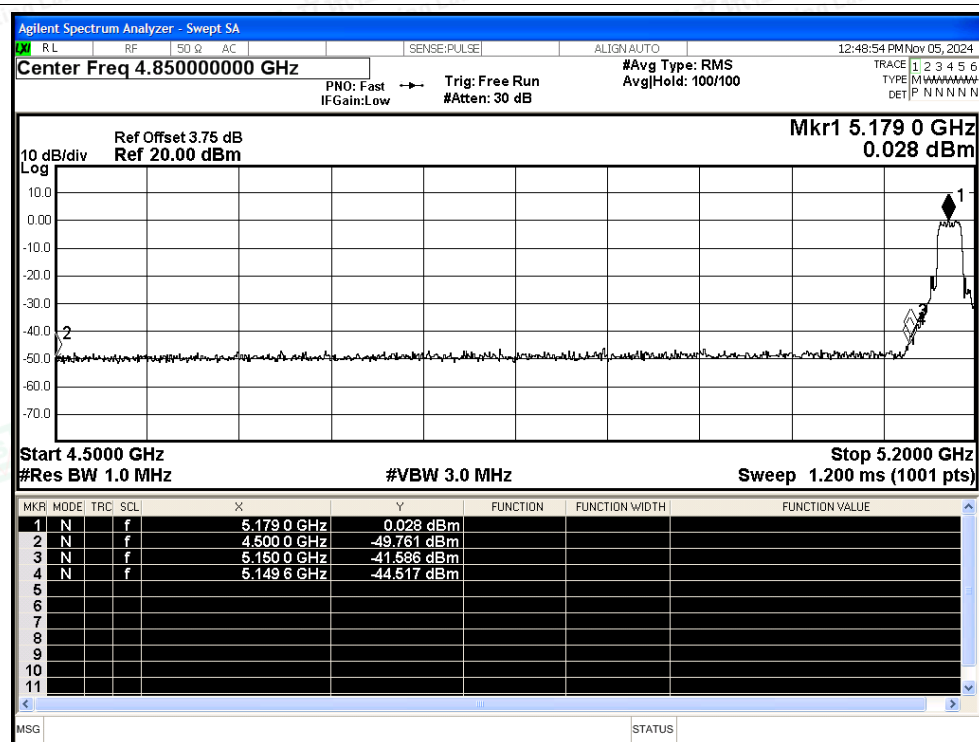


Restrict Band NVNT ax20 5180MHz Ant2 Average

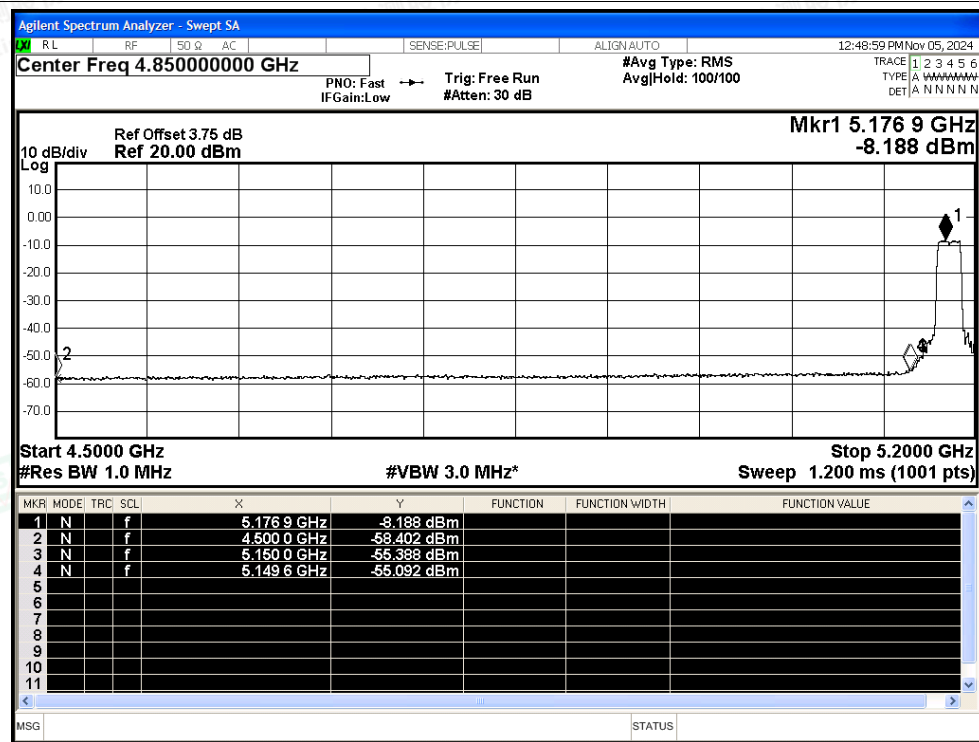




Restrict Band NVNT ax20 5240MHz Ant2 Peak

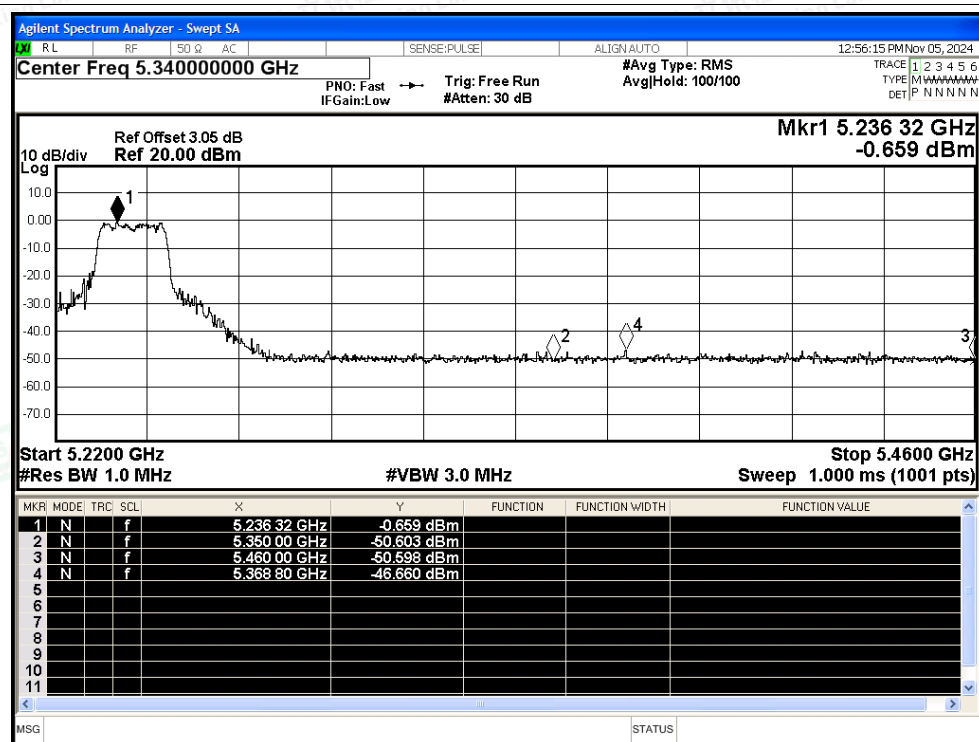

Restrict Band NVNT ax20 5240MHz Ant2 Average

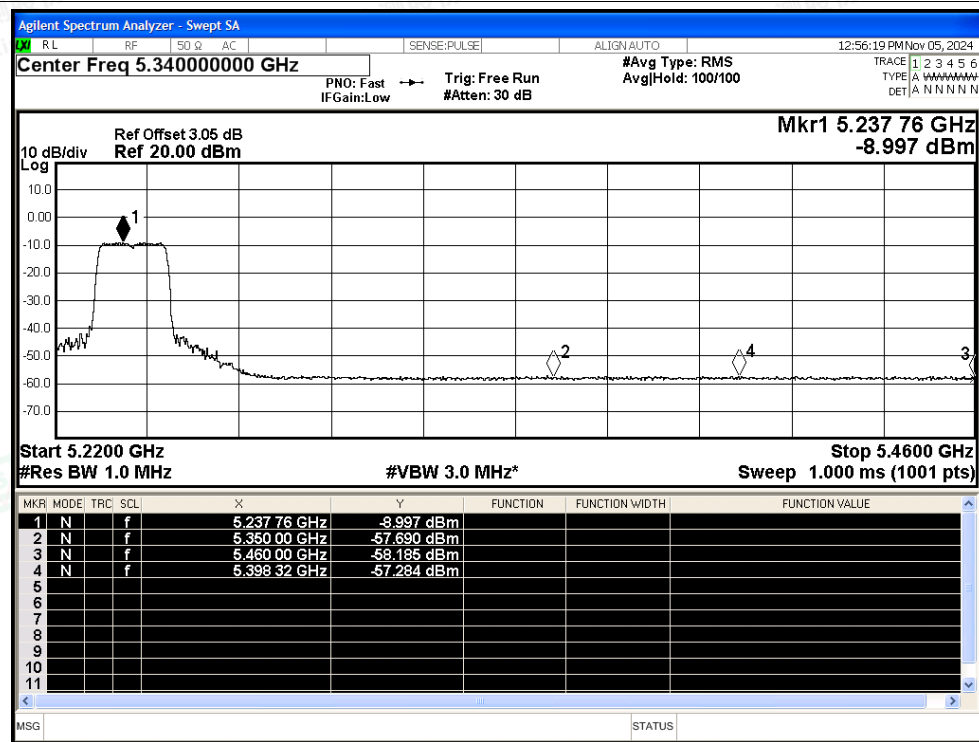

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

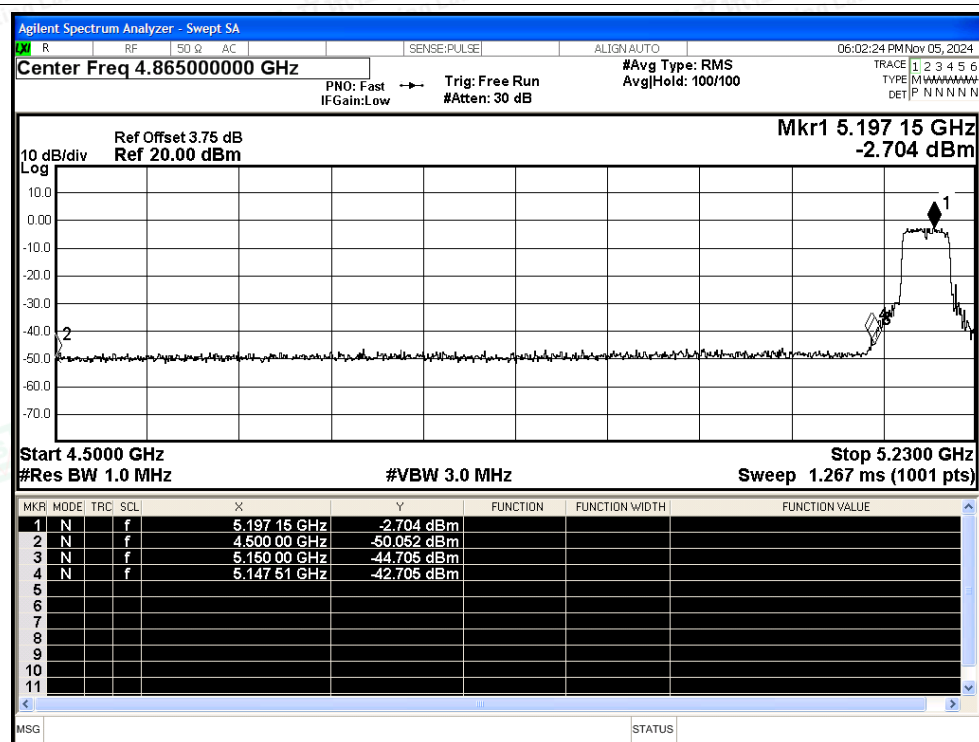

Restrict Band NVNT ax40 5190MHz Ant2 Average

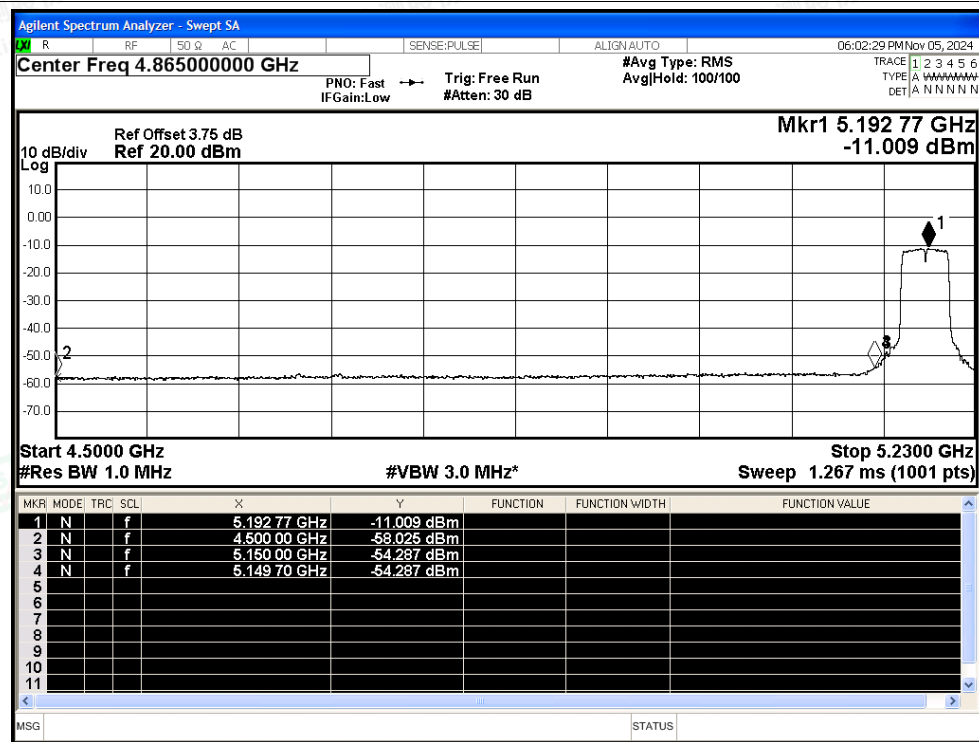

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

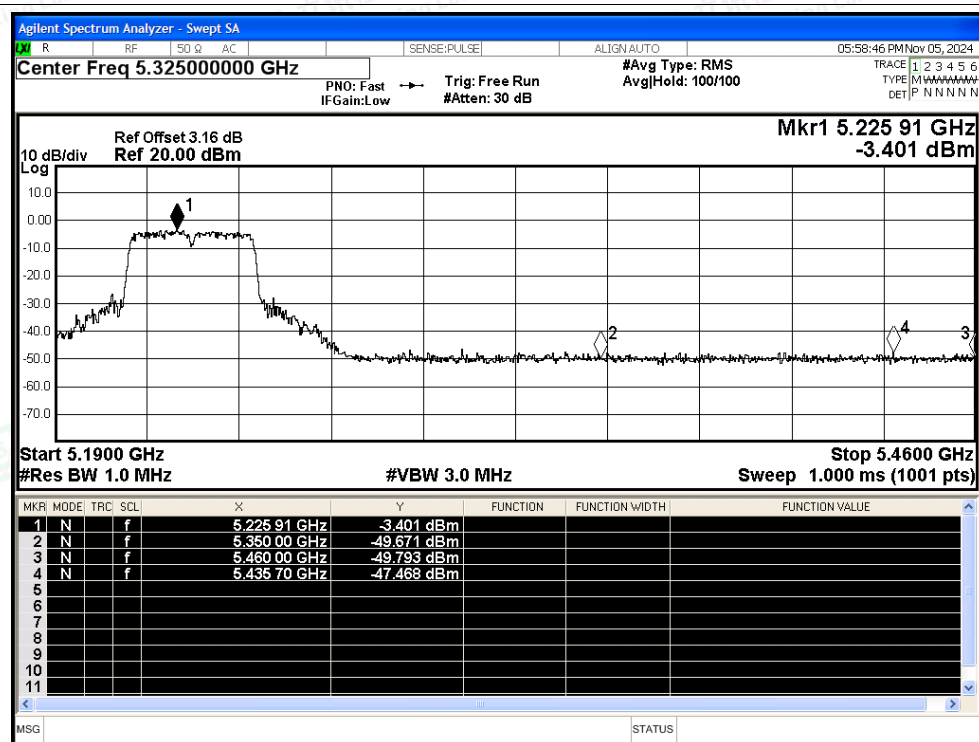

Restrict Band NVNT ax40 5230MHz Ant2 Average

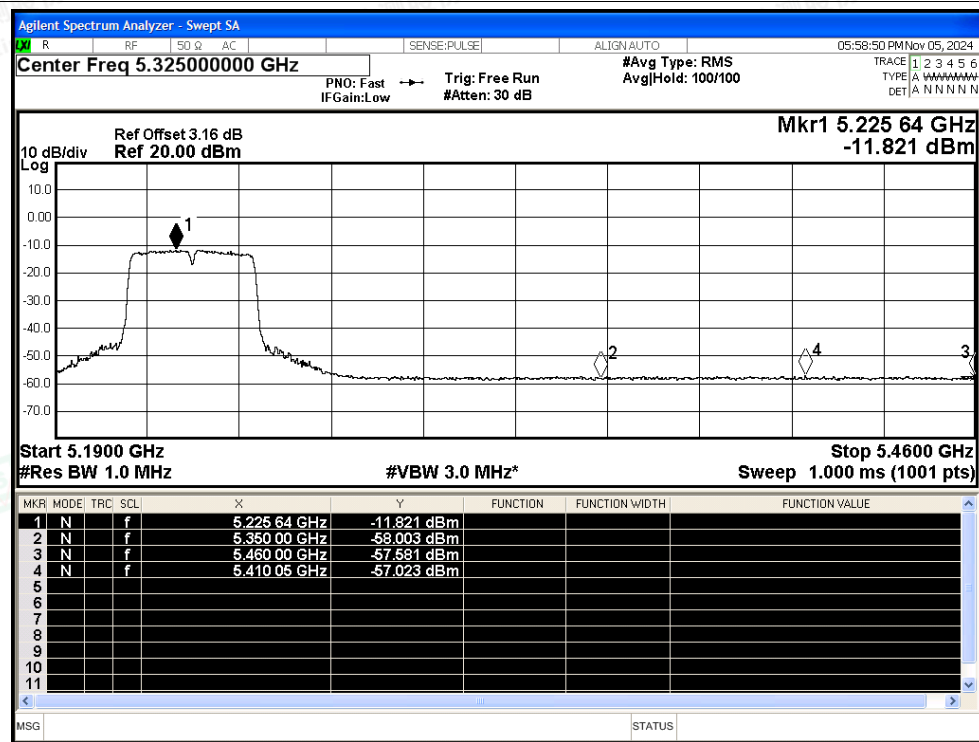



Ant 1 + Ant 2

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant1	Ant2	Ant1+ Ant2			
NVNT	a	5180	48.57	49.54	55.09	Peak	68.2	Pass
NVNT	a	5180	41.25	40.46	46.88	Average	54	Pass
NVNT	a	5180	53.89	53.55	59.74	Peak	68.2	Pass
NVNT	a	5180	43.51	43.34	49.45	Average	54	Pass
NVNT	a	5180	53.76	54.2	60.00	Peak	68.2	Pass
NVNT	a	5180	43.75	42.78	49.30	Average	54	Pass
NVNT	a	5240	49.62	48.23	54.97	Peak	68.2	Pass
NVNT	a	5240	40.7	40.81	46.78	Average	54	Pass
NVNT	a	5240	51.8	51.91	57.88	Peak	68.2	Pass
NVNT	a	5240	42	41.71	47.88	Average	54	Pass
NVNT	a	5240	49.64	47.05	54.46	Peak	68.2	Pass
NVNT	a	5240	41.79	41.13	47.49	Average	54	Pass
NVNT	n20	5180	50	49.58	55.81	Peak	68.2	Pass
NVNT	n20	5180	41.54	40.96	47.28	Average	54	Pass
NVNT	n20	5180	55.75	53.55	60.74	Peak	68.2	Pass
NVNT	n20	5180	44.31	43.42	49.90	Average	54	Pass
NVNT	n20	5180	56.61	53.02	61.02	Peak	68.2	Pass
NVNT	n20	5180	43.92	44.4	50.18	Average	54	Pass
NVNT	n20	5240	48.6	48.97	54.81	Peak	68.2	Pass
NVNT	n20	5240	42.82	41.53	48.22	Average	54	Pass
NVNT	n20	5240	53.17	51.03	58.19	Peak	68.2	Pass
NVNT	n20	5240	42.82	42.07	48.47	Average	54	Pass
NVNT	n20	5240	49.27	49.09	55.20	Peak	68.2	Pass
NVNT	n20	5240	41.14	41.26	47.22	Average	54	Pass
NVNT	n40	5190	49.77	50.9	56.37	Peak	68.2	Pass
NVNT	n40	5190	41.14	41.12	47.15	Average	54	Pass
NVNT	n40	5190	56.01	55.72	61.89	Peak	68.2	Pass
NVNT	n40	5190	44.96	44.18	50.60	Average	54	Pass
NVNT	n40	5190	53.45	55.72	60.68	Peak	68.2	Pass
NVNT	n40	5190	44.96	44.04	50.53	Average	54	Pass
NVNT	n40	5230	49.21	49.2	55.23	Peak	68.2	Pass
NVNT	n40	5230	41.3	41.3	47.32	Average	54	Pass
NVNT	n40	5230	52.76	51.65	58.24	Peak	68.2	Pass
NVNT	n40	5230	42.11	41.88	48.02	Average	54	Pass
NVNT	n40	5230	49.04	50.53	55.84	Peak	68.2	Pass
NVNT	n40	5230	41.31	41.19	47.27	Average	54	Pass
NVNT	ac20	5180	48.94	49.47	55.23	Peak	68.2	Pass
NVNT	ac20	5180	40.69	41.07	46.90	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	54.73	53.61	60.21	Peak	68.2	Pass
NVNT	ac20	5180	44.23	43.42	49.86	Average	54	Pass
NVNT	ac20	5180	54.29	54.12	60.23	Peak	68.2	Pass
NVNT	ac20	5180	44.6	43.6	50.13	Average	54	Pass
NVNT	ac20	5240	48.97	48.61	54.81	Peak	68.2	Pass
NVNT	ac20	5240	40.88	41.31	47.12	Average	54	Pass
NVNT	ac20	5240	51.73	52.28	58.03	Peak	68.2	Pass
NVNT	ac20	5240	42.06	41.73	47.92	Average	54	Pass
NVNT	ac20	5240	47.9	48.38	54.16	Peak	68.2	Pass
NVNT	ac20	5240	41.82	40.52	47.21	Average	54	Pass
NVNT	ac40	5190	49.04	50.52	55.83	Peak	68.2	Pass
NVNT	ac40	5190	41.25	40.93	47.11	Average	54	Pass
NVNT	ac40	5190	56.11	58	63.13	Peak	68.2	Pass
NVNT	ac40	5190	45.02	44.82	50.94	Average	54	Pass
NVNT	ac40	5190	53.58	57.42	61.73	Peak	68.2	Pass
NVNT	ac40	5190	44.5	44.82	50.68	Average	54	Pass
NVNT	ac40	5230	48.99	47.96	54.51	Peak	68.2	Pass
NVNT	ac40	5230	40.93	40.7	46.84	Average	54	Pass
NVNT	ac40	5230	52.36	53.45	58.94	Peak	68.2	Pass
NVNT	ac40	5230	42.26	41.82	48.06	Average	54	Pass
NVNT	ac40	5230	49.76	48.71	55.27	Peak	68.2	Pass
NVNT	ac40	5230	41.2	41.27	47.26	Average	54	Pass
NVNT	ax20	5180	48.02	48.97	54.53	Peak	68.2	Pass
NVNT	ax20	5180	40.54	40.61	46.60	Average	54	Pass
NVNT	ax20	5180	54.6	54.21	60.43	Peak	68.2	Pass
NVNT	ax20	5180	43.95	43.92	49.96	Average	54	Pass
NVNT	ax20	5180	53.45	57.14	61.51	Peak	68.2	Pass
NVNT	ax20	5180	44.01	43.62	49.84	Average	54	Pass
NVNT	ax20	5240	49.53	48.13	54.88	Peak	68.2	Pass
NVNT	ax20	5240	41.95	41.32	47.66	Average	54	Pass
NVNT	ax20	5240	51.8	52.07	57.96	Peak	68.2	Pass
NVNT	ax20	5240	42.05	41.73	47.91	Average	54	Pass
NVNT	ax20	5240	48.86	48.13	54.52	Peak	68.2	Pass
NVNT	ax20	5240	41.09	40.82	46.98	Average	54	Pass
NVNT	ax40	5190	48.65	48.68	54.69	Peak	68.2	Pass
NVNT	ax40	5190	41.56	40.93	47.27	Average	54	Pass
NVNT	ax40	5190	56.49	56.02	62.28	Peak	68.2	Pass
NVNT	ax40	5190	44.57	44.67	50.64	Average	54	Pass
NVNT	ax40	5190	56.49	54.02	61.36	Peak	68.2	Pass
NVNT	ax40	5190	44.57	44.67	50.64	Average	54	Pass
NVNT	ax40	5230	49.86	49.06	55.49	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	41.95	40.97	47.49	Average	54	Pass
NVNT	ax40	5230	52.15	51.26	57.74	Peak	68.2	Pass
NVNT	ax40	5230	42.28	41.95	48.14	Average	54	Pass
NVNT	ax40	5230	49.26	48.94	55.12	Peak	68.2	Pass
NVNT	ax40	5230	41.25	41.39	47.34	Average	54	Pass





B.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5200	0	0	25	Pass
NVNT	n20	5240	Ant1	5240	0	0	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant1	5200	0	0	25	Pass
NVNT	ax20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

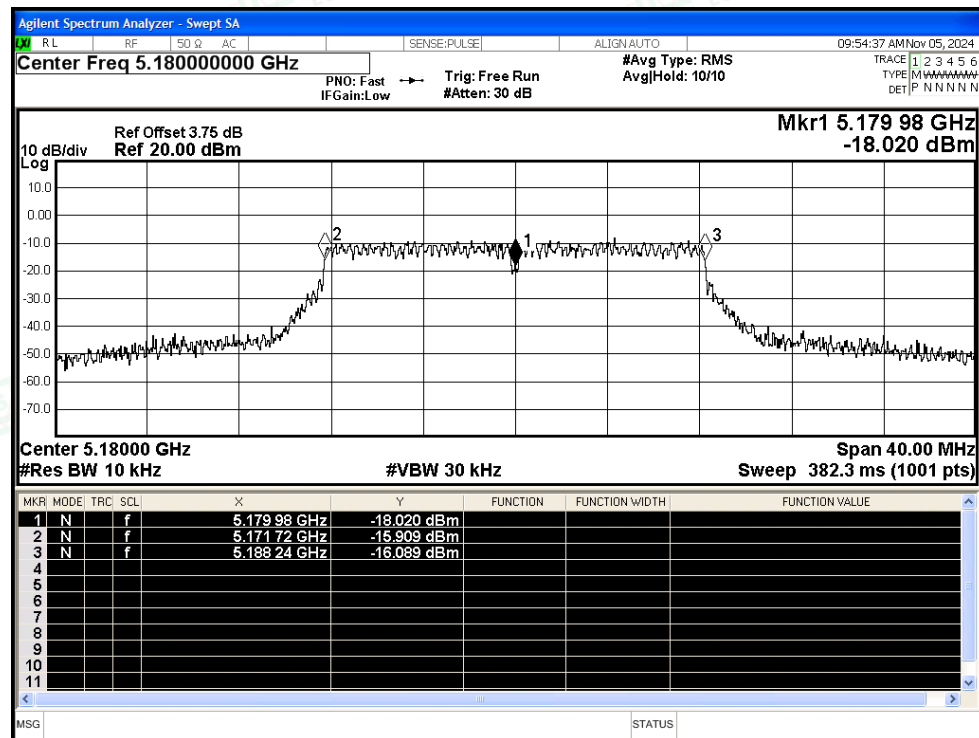


Freq. Stability NVNT a 5200MHz Ant1

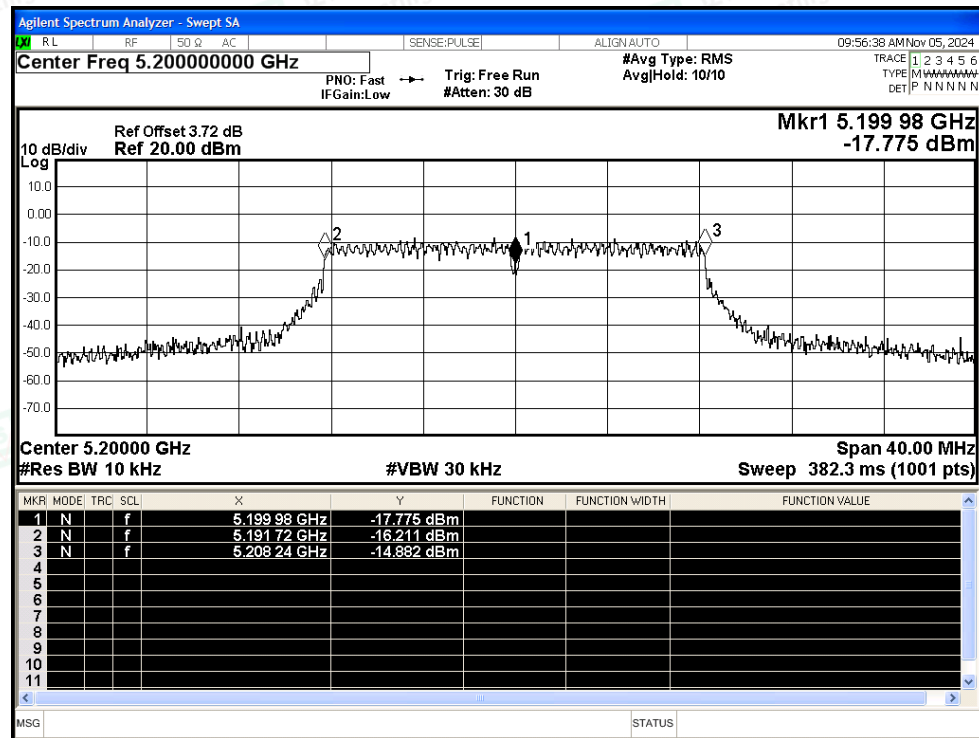




Freq. Stability NVNT a 5240MHz Ant1

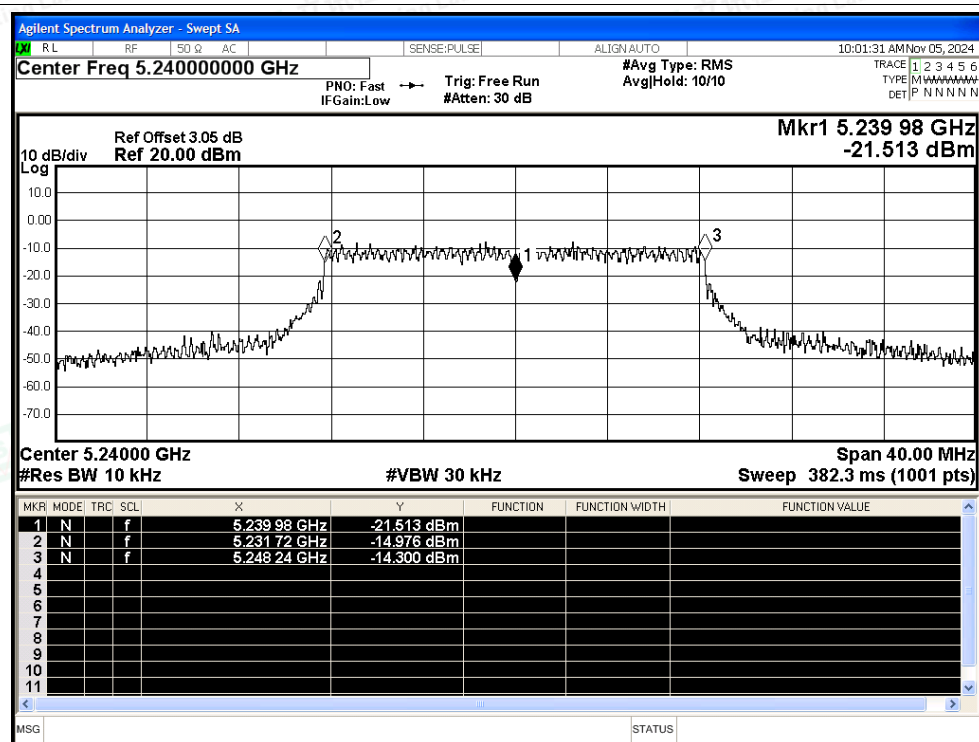

Freq. Stability NVNT n20 5180MHz Ant1

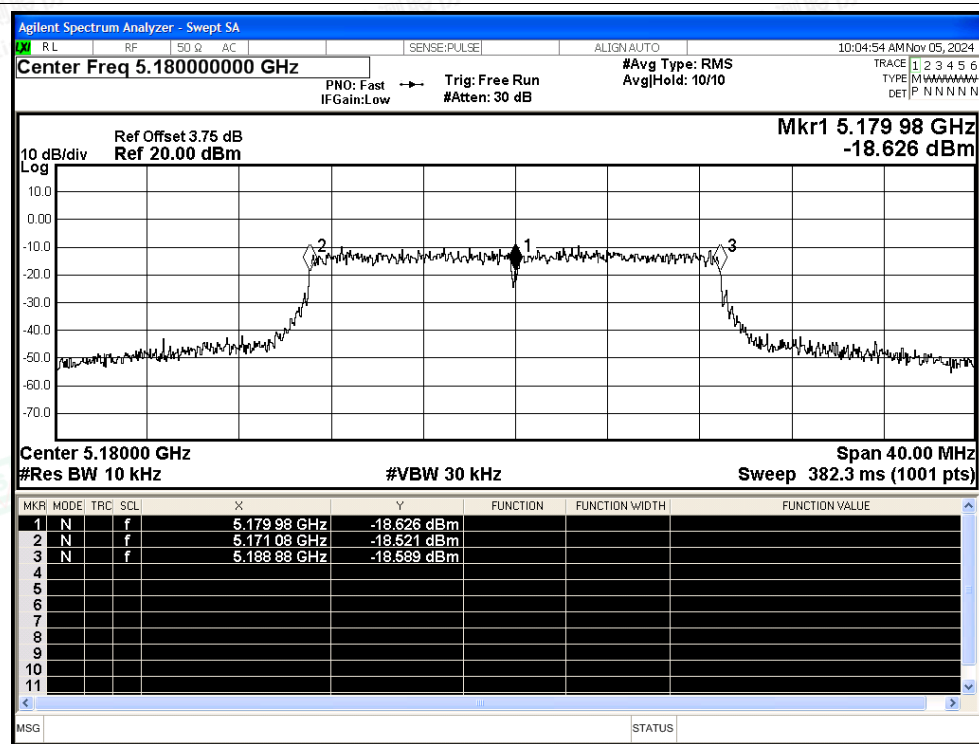

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

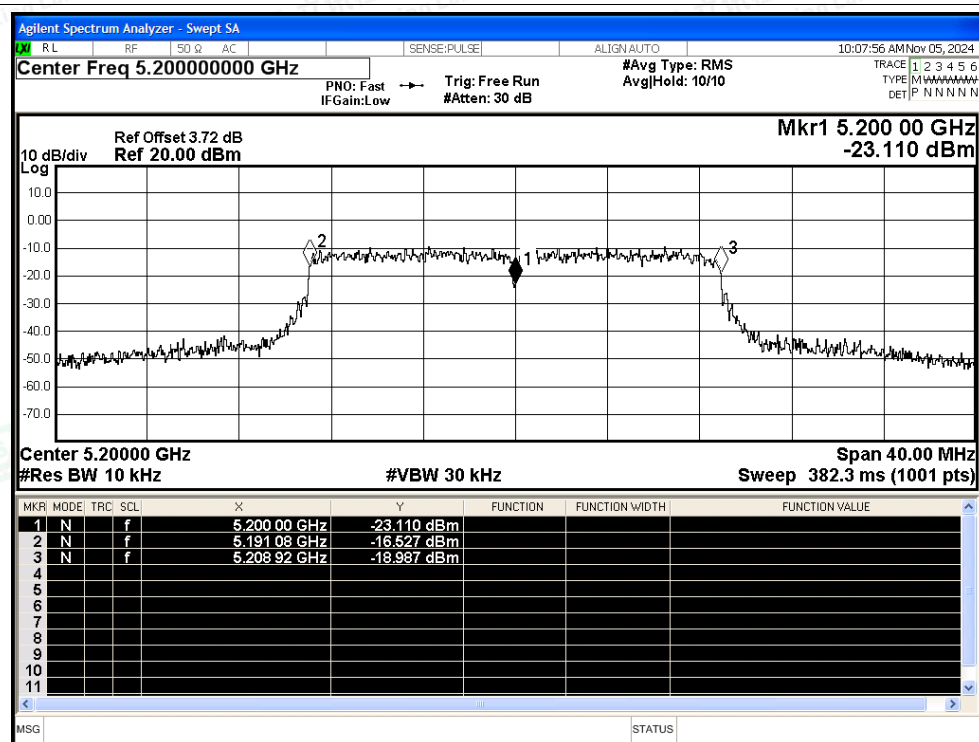

Freq. Stability NVNT n20 5240MHz Ant1

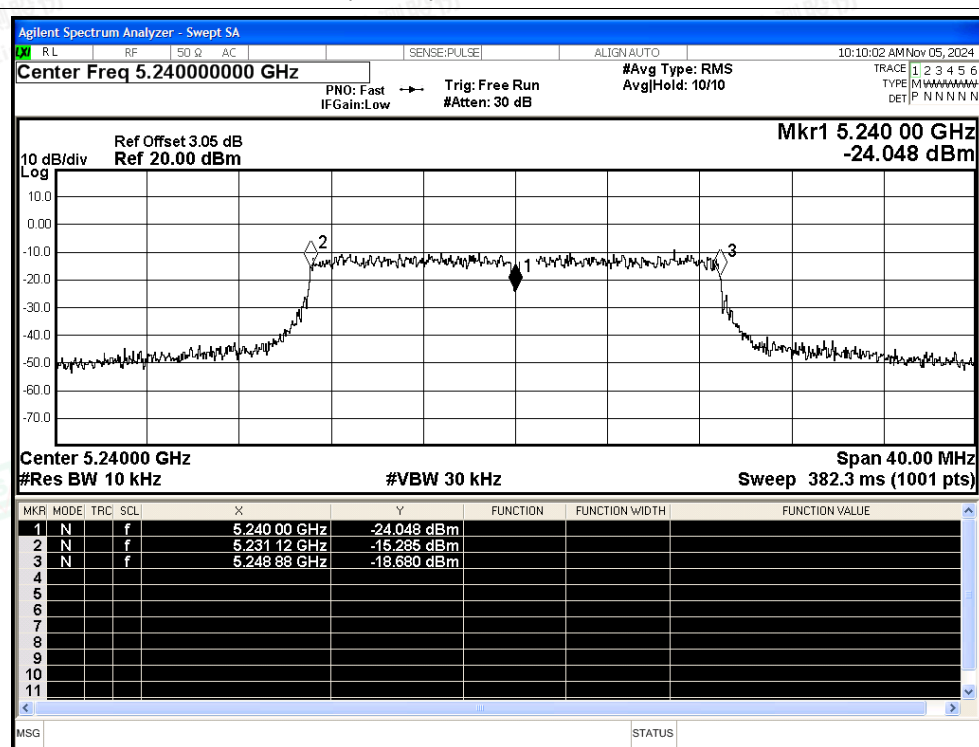

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

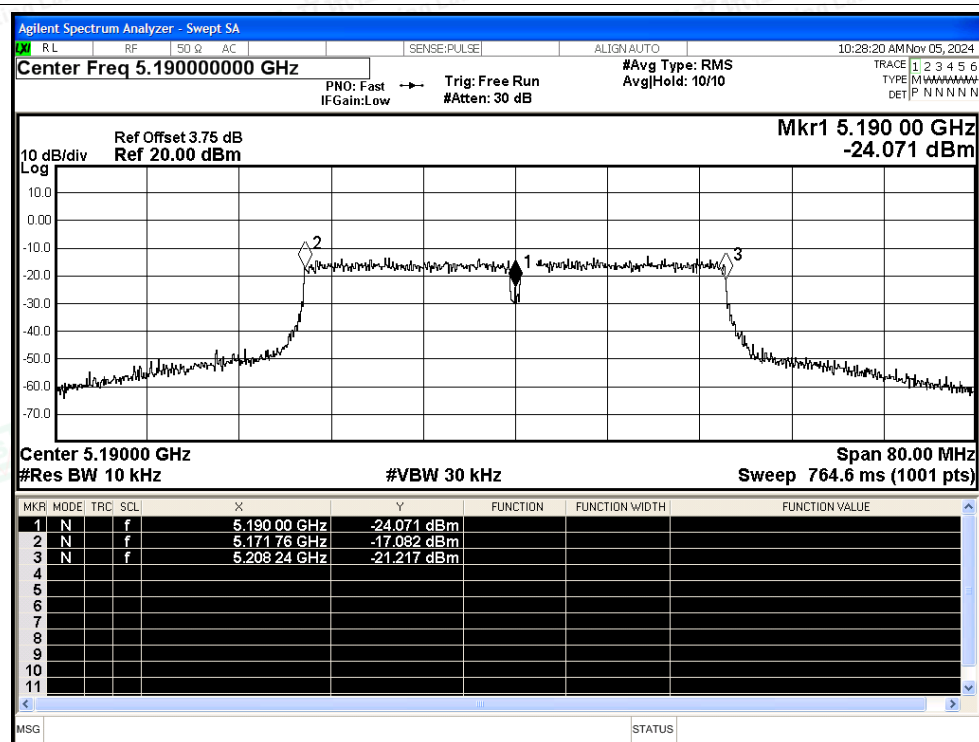

Freq. Stability NVNT n40 5230MHz Ant1

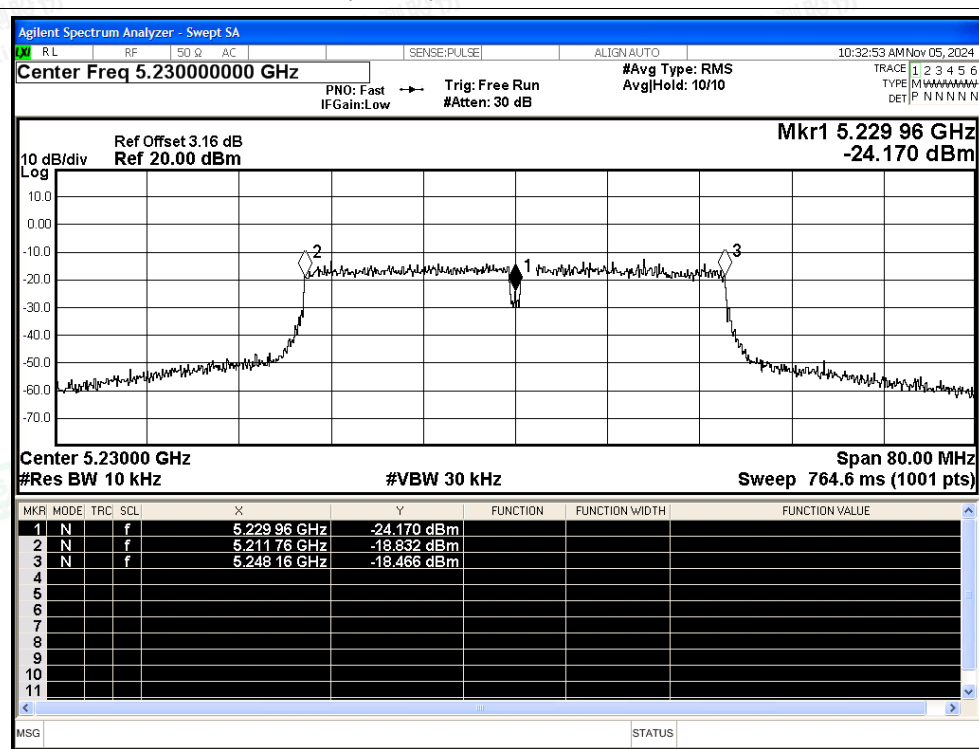

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

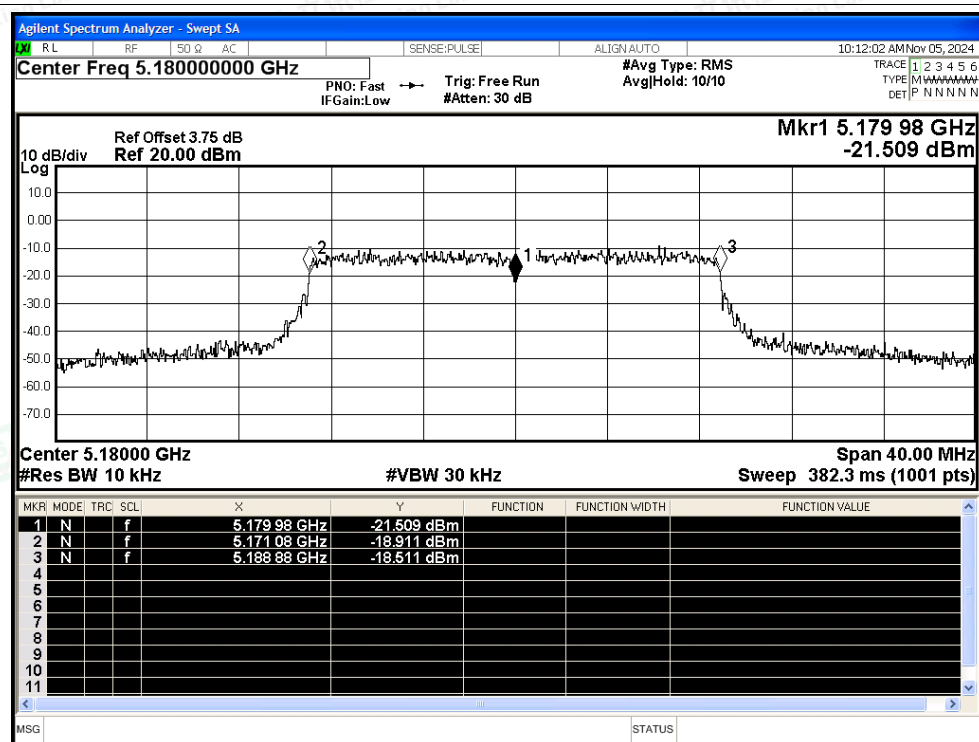

Freq. Stability NVNT ac20 5200MHz Ant1

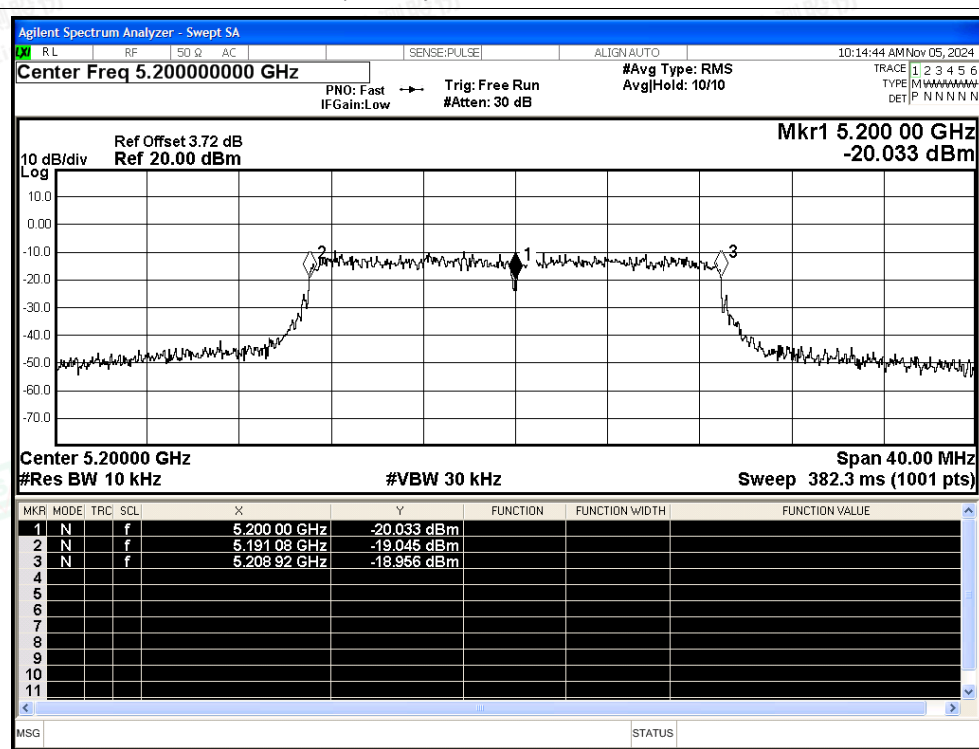

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

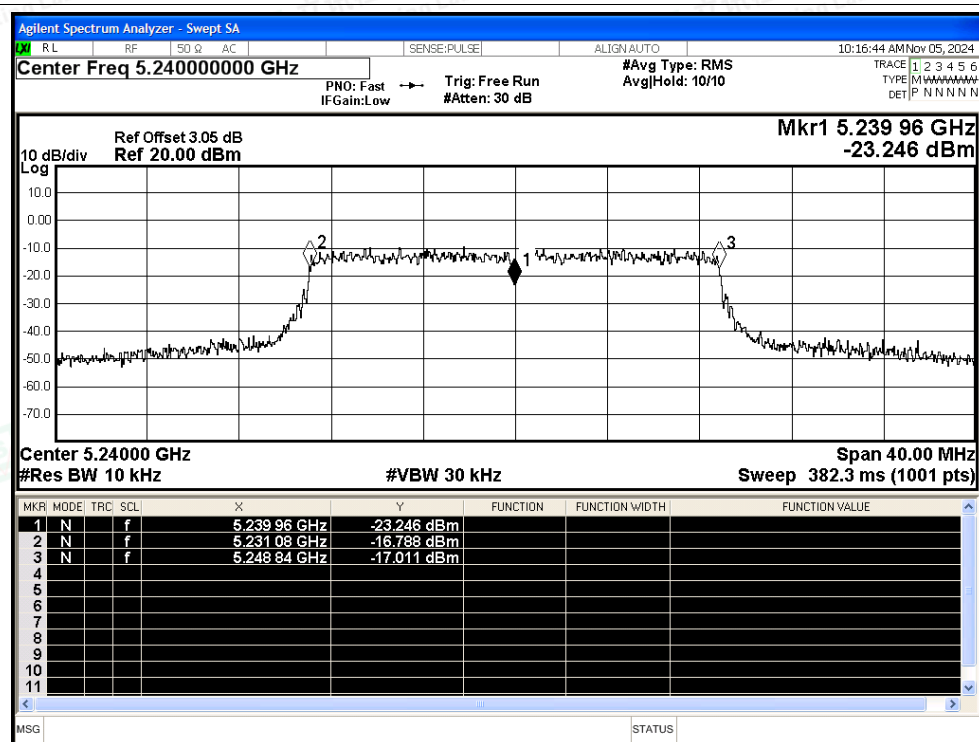

Freq. Stability NVNT ac40 5190MHz Ant1

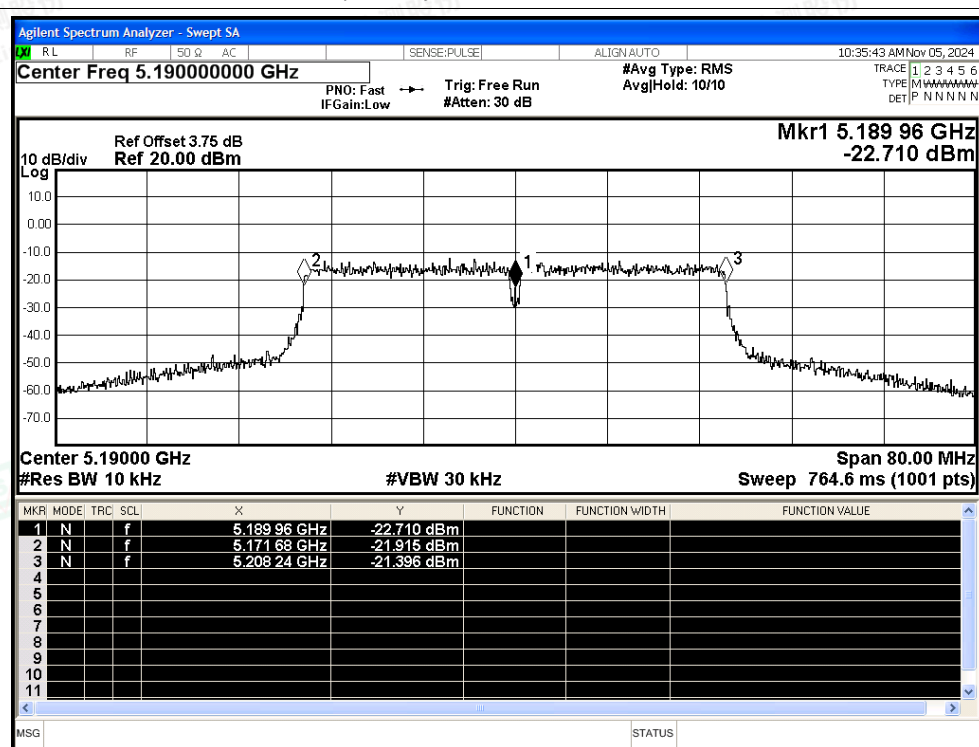

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

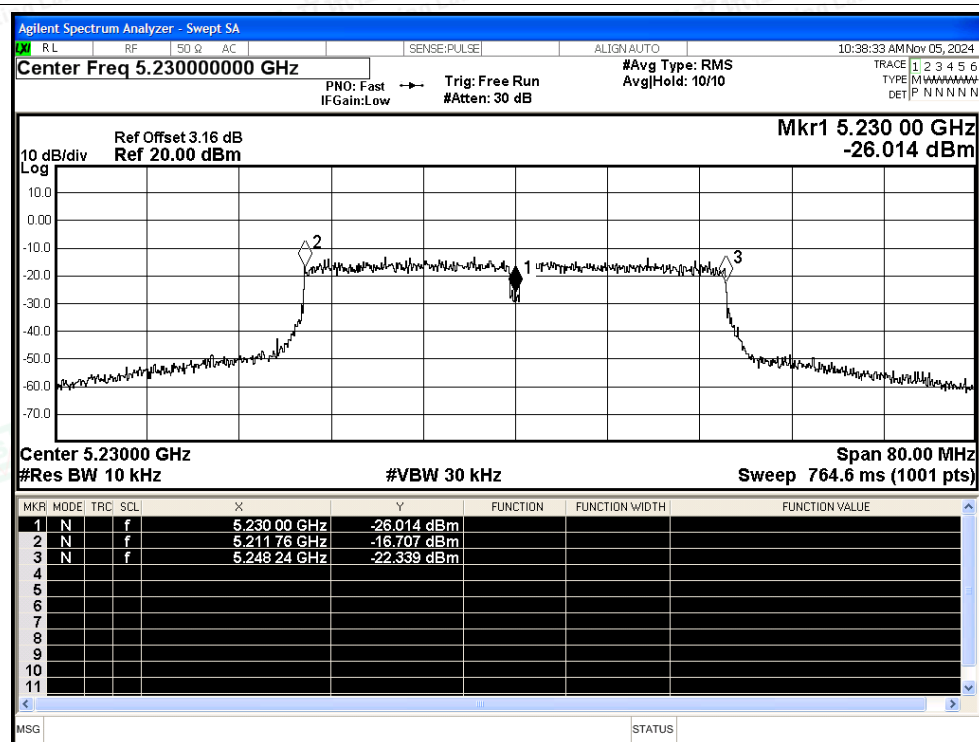


Freq. Stability NVNT ax20 5180MHz Ant1

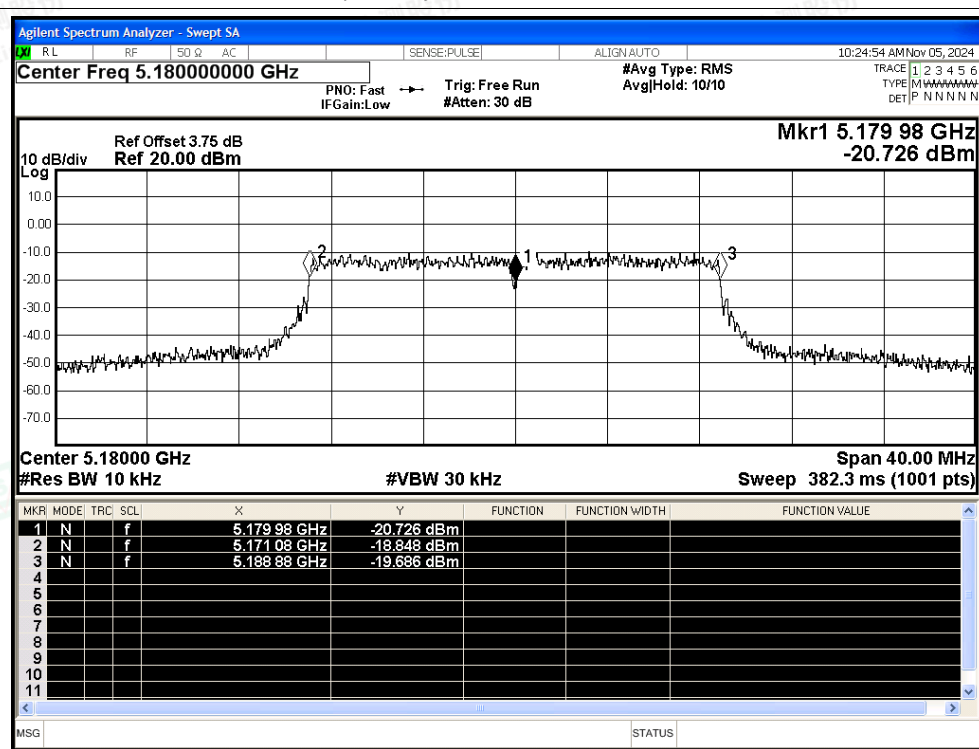




Freq. Stability NVNT ax20 5200MHz Ant1

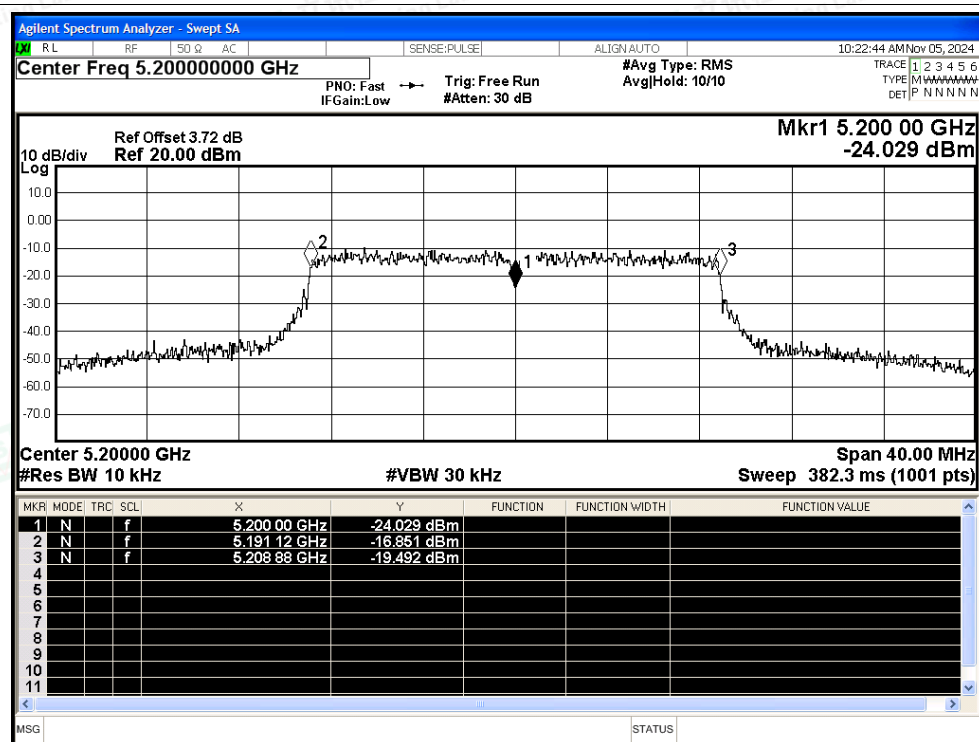

Freq. Stability NVNT ax20 5240MHz Ant1

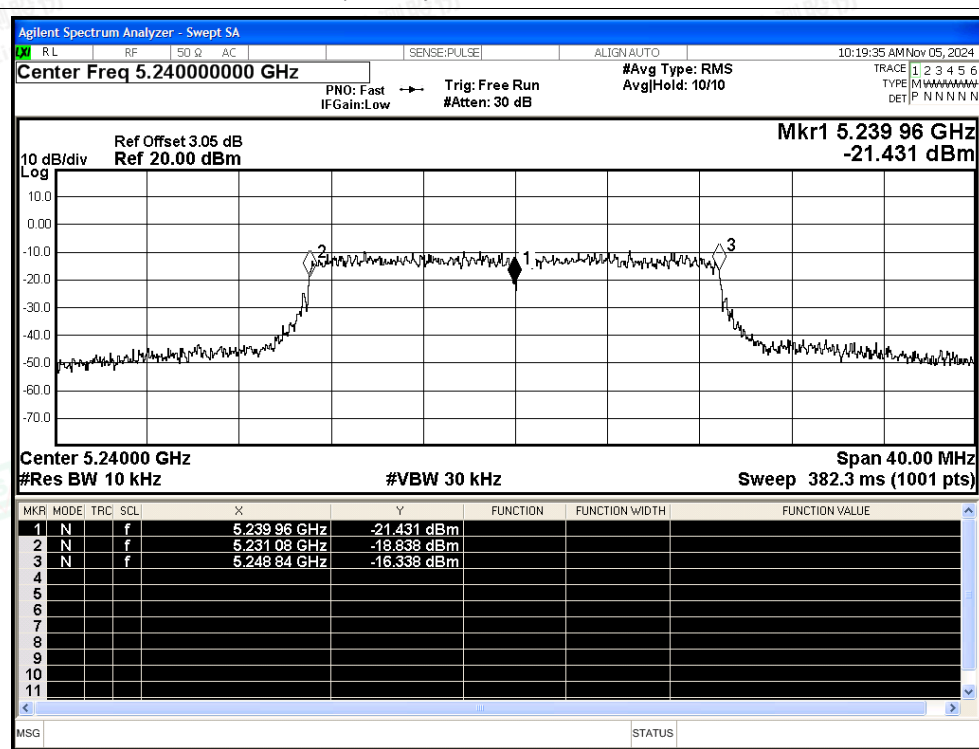

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5190MHz Ant1

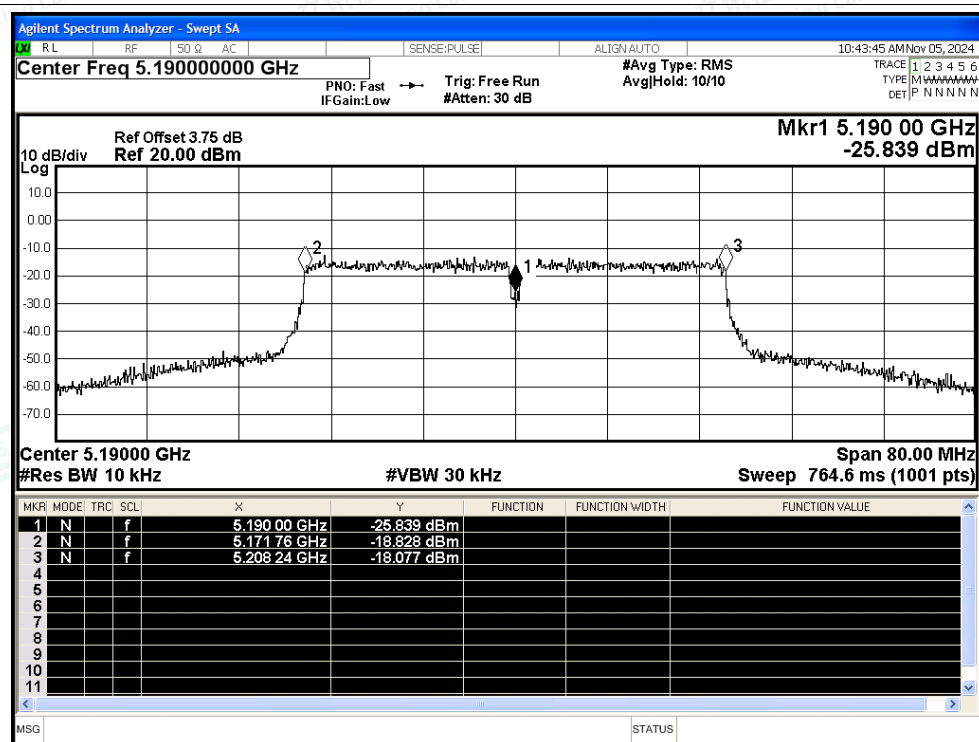

Freq. Stability NVNT ax40 5230MHz Ant1

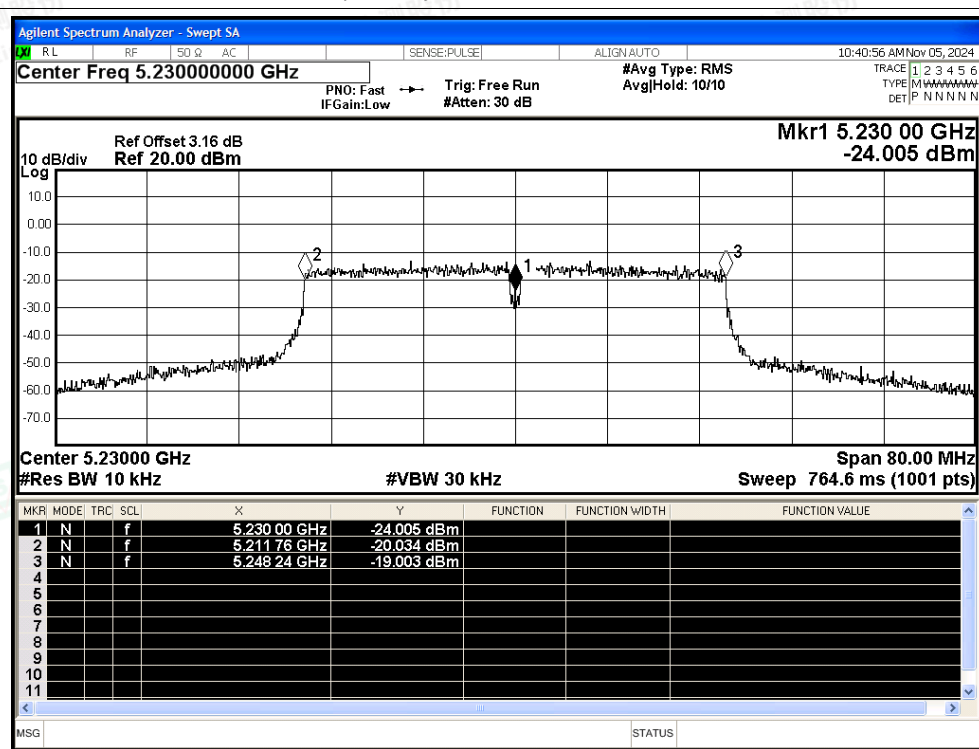

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5180	0	0	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5180	0	0	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax20	5180	Ant2	5180	0	0	25	Pass
NVNT	ax20	5200	Ant2	5199.96	-40000	-7.69	25	Pass
NVNT	ax20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
NVNT	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

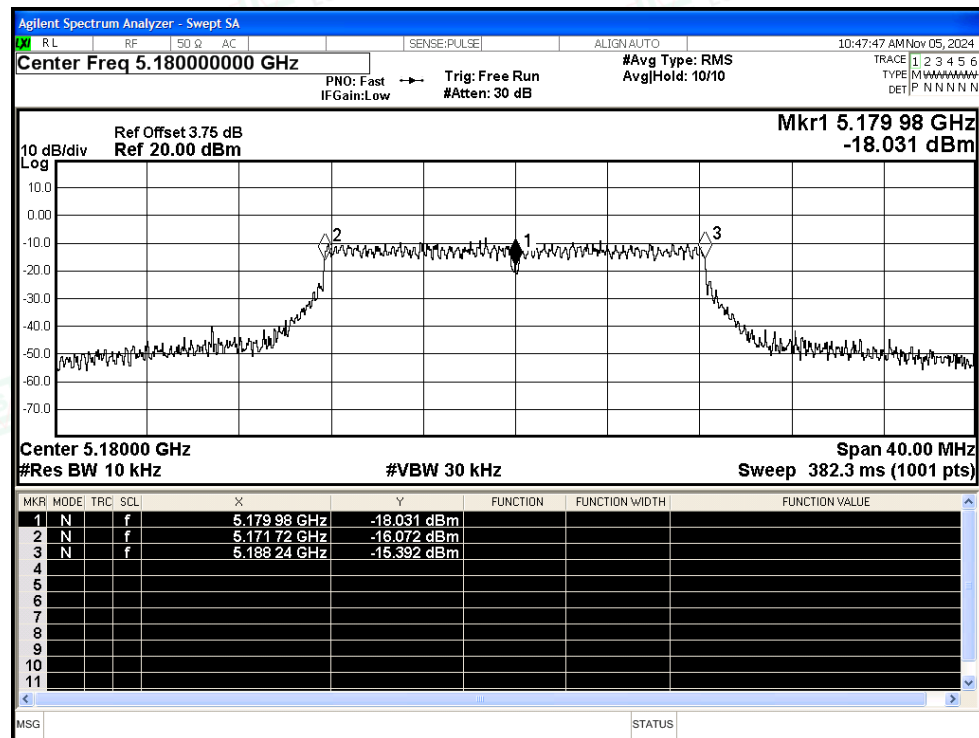

Freq. Stability NVNT a 5200MHz Ant2

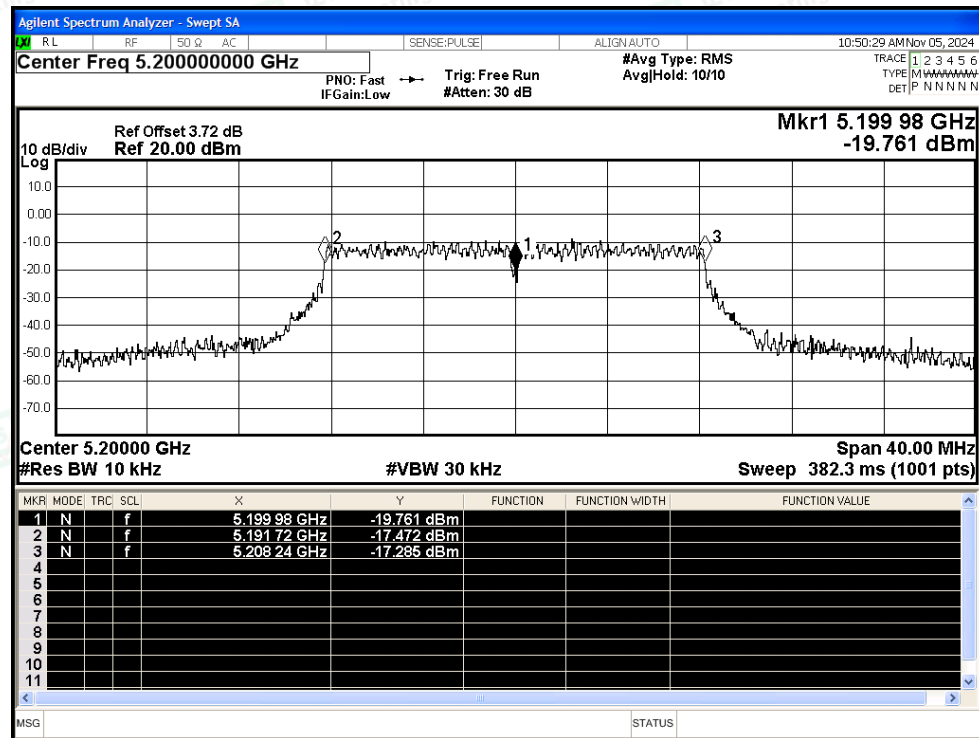

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

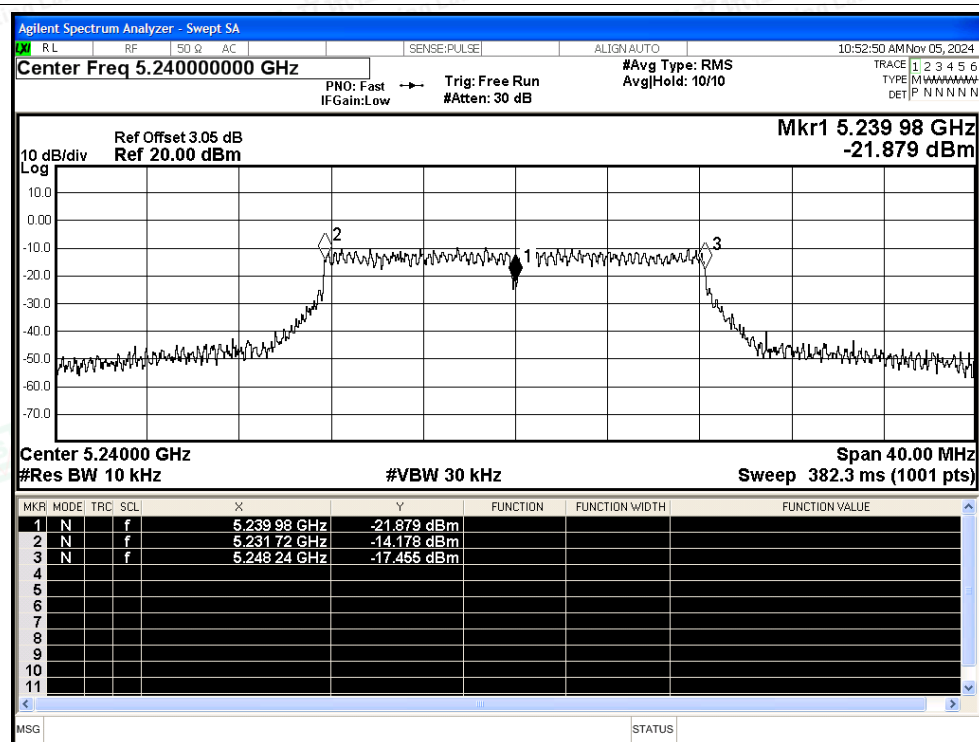

Freq. Stability NVNT n20 5180MHz Ant2

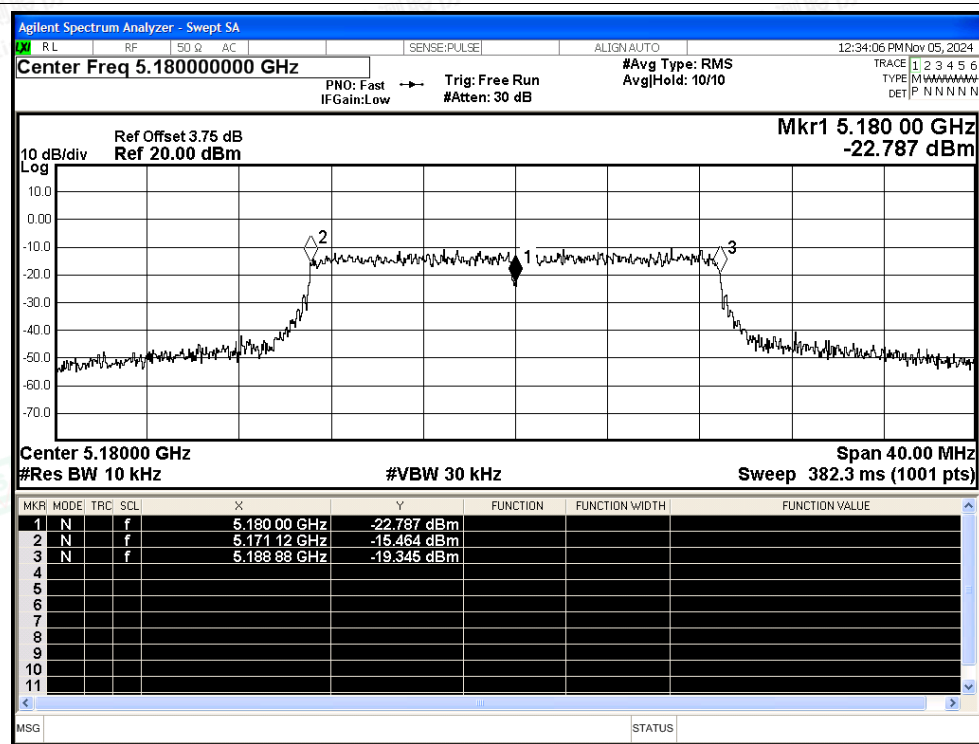

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

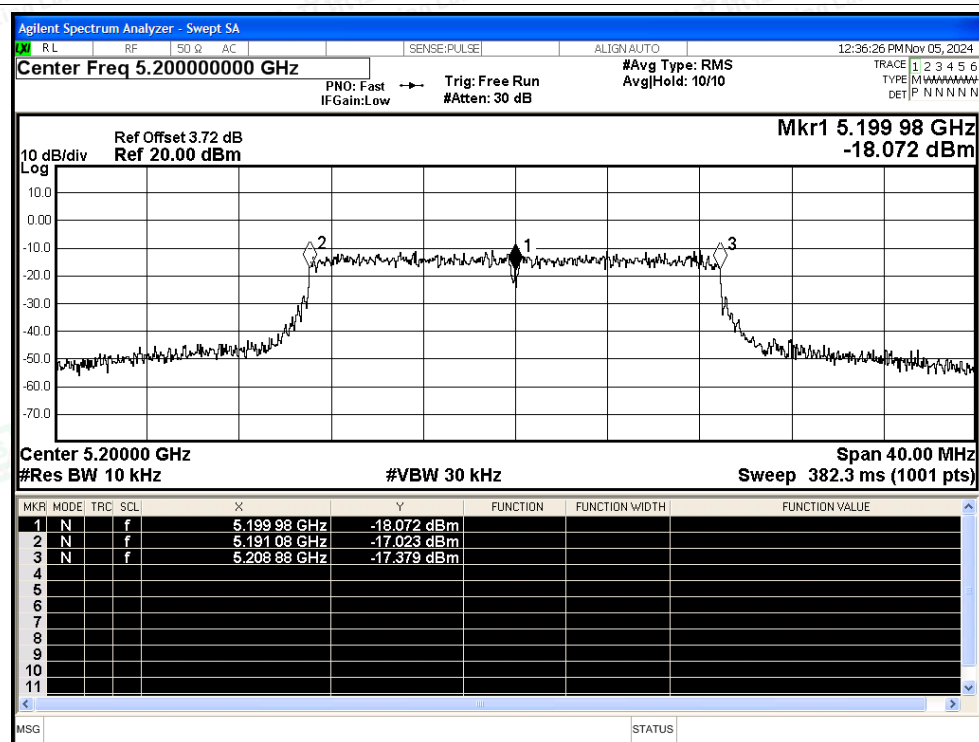


Freq. Stability NVNT n20 5240MHz Ant2

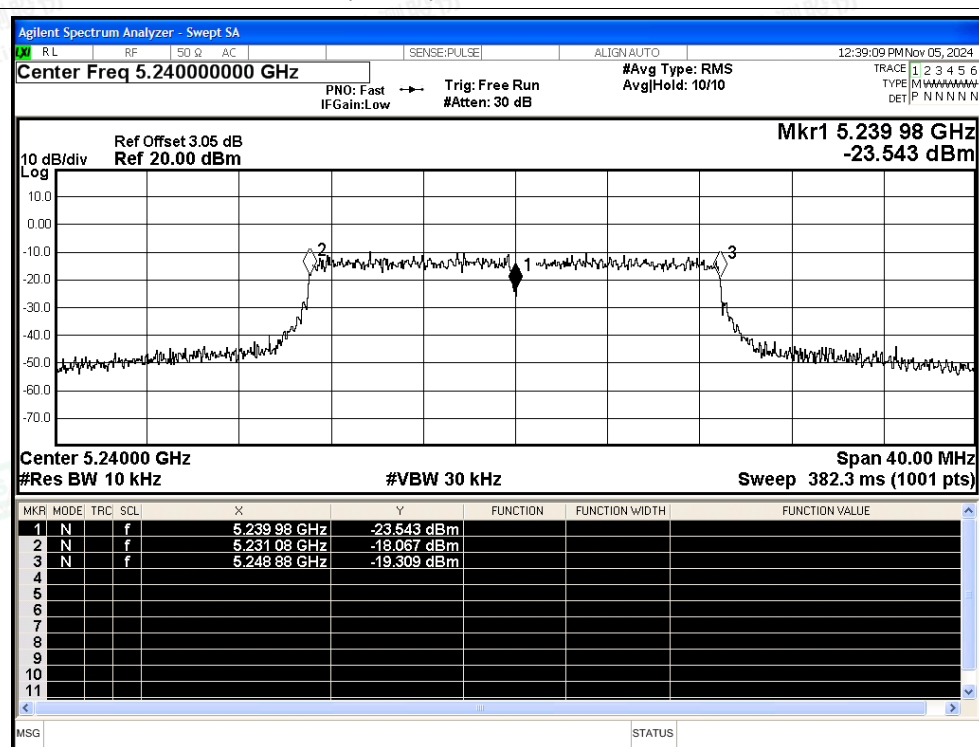




Freq. Stability NVNT n40 5190MHz Ant2

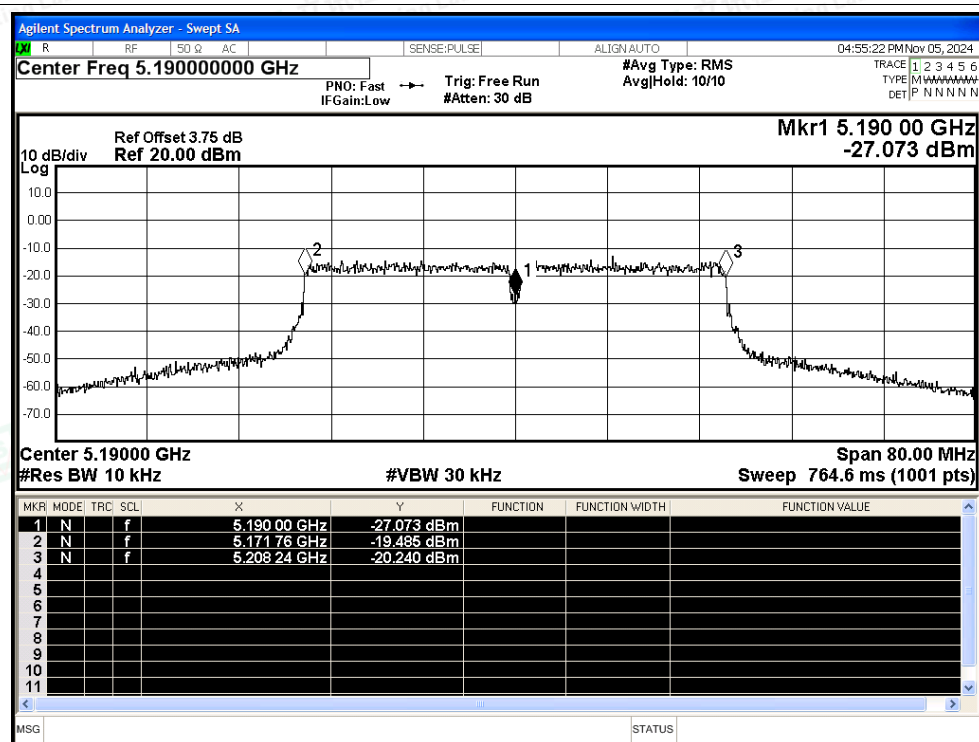


Freq. Stability NVNT n40 5230MHz Ant2

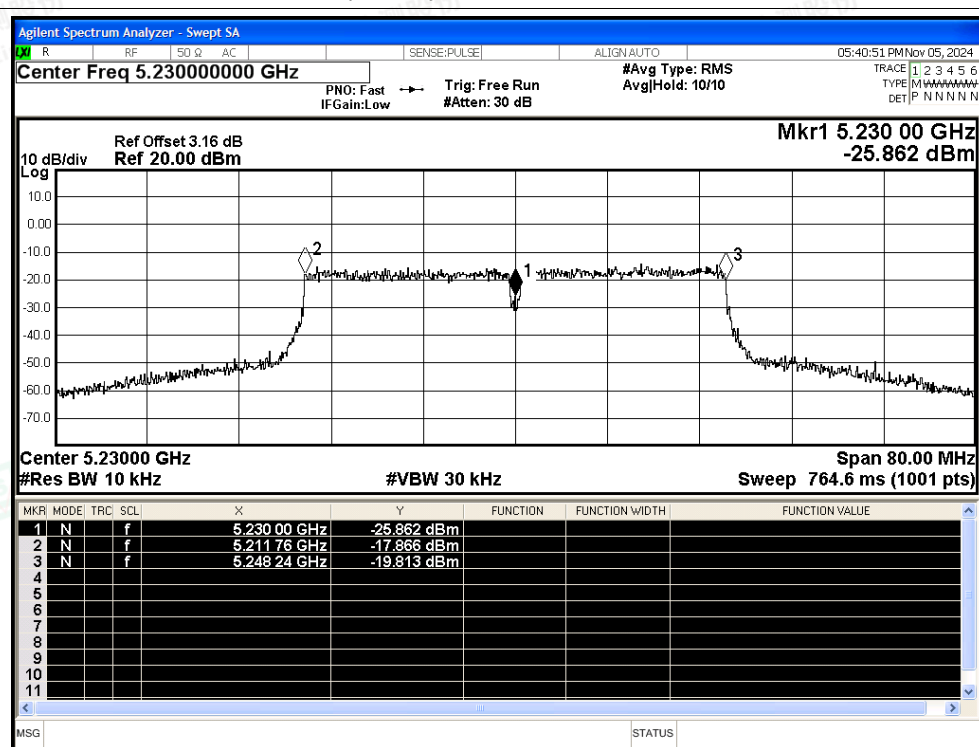




Freq. Stability NVNT ac20 5180MHz Ant2

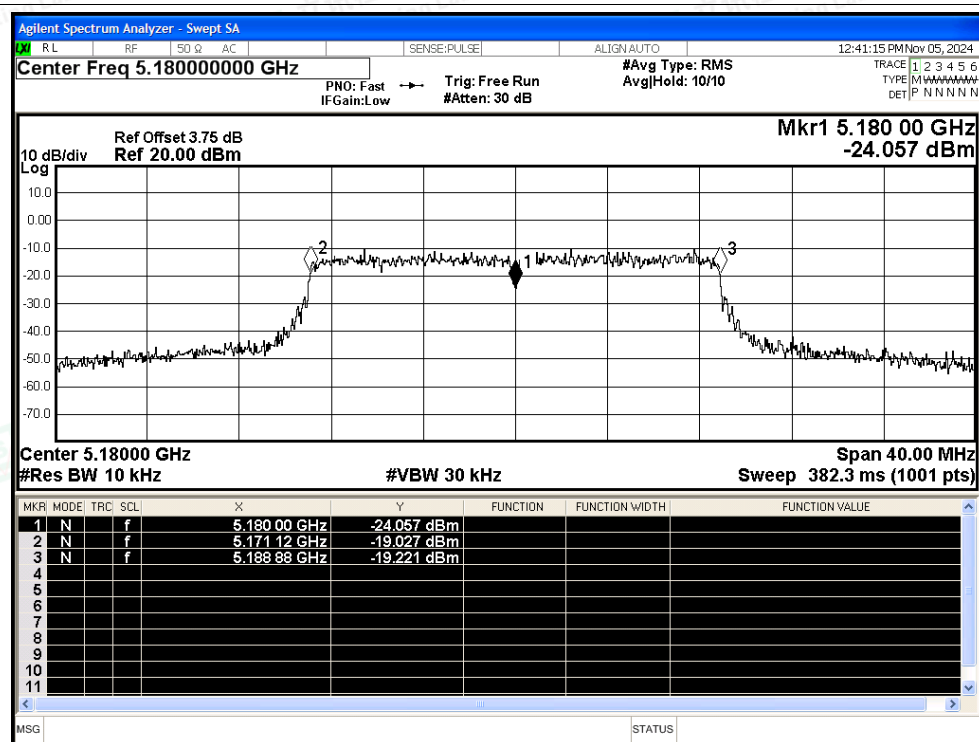


Freq. Stability NVNT ac20 5200MHz Ant2

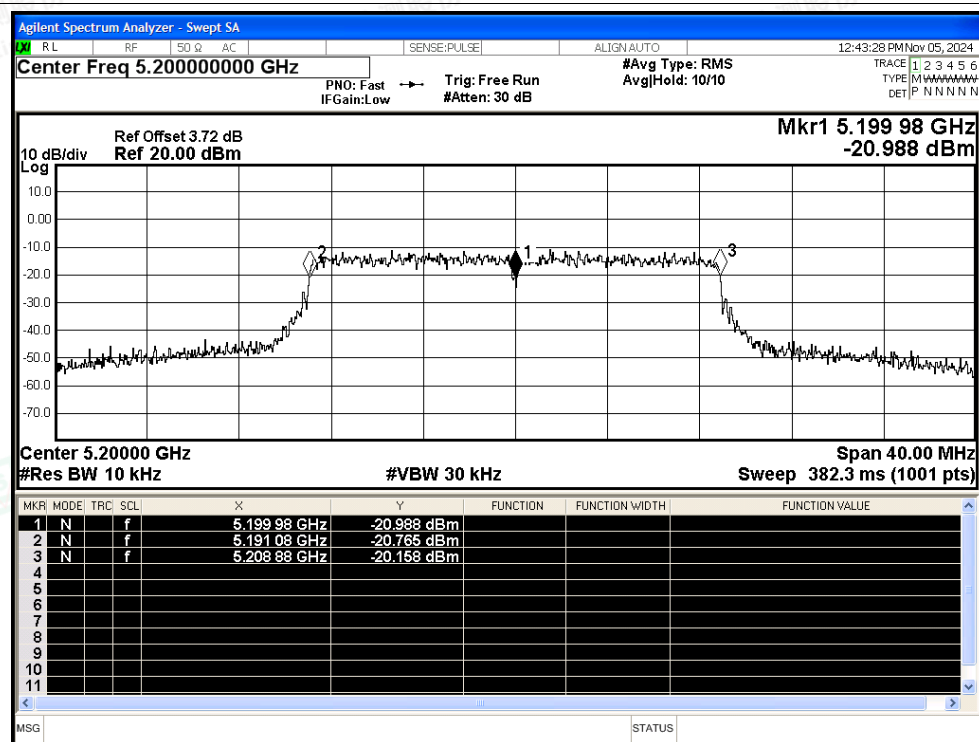




Freq. Stability NVNT ac20 5240MHz Ant2

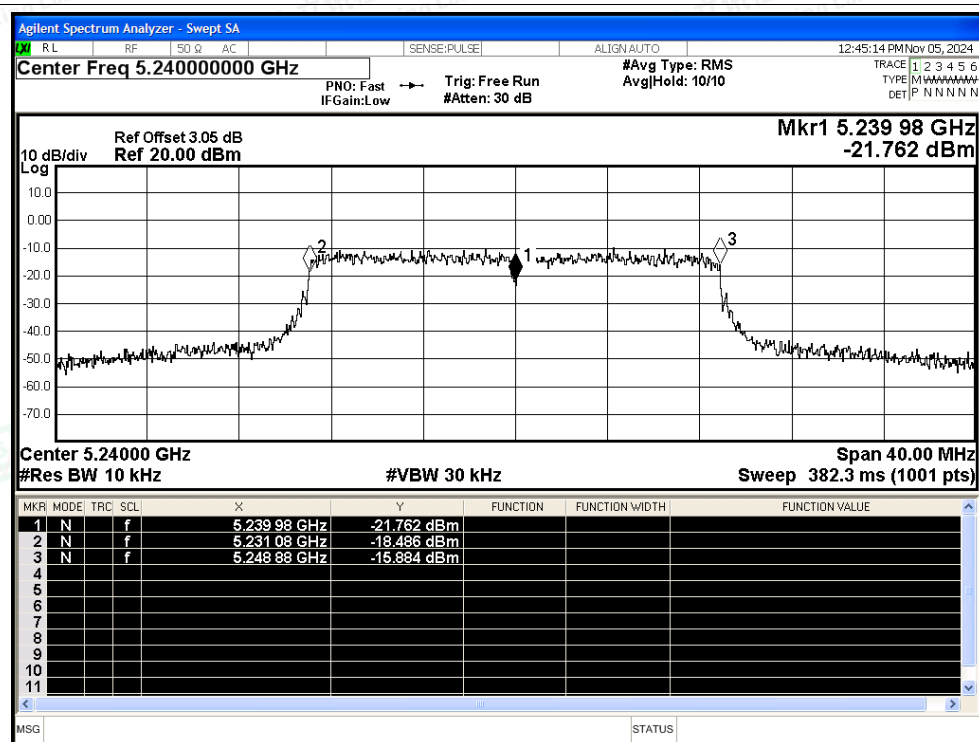

Freq. Stability NVNT ac40 5190MHz Ant2

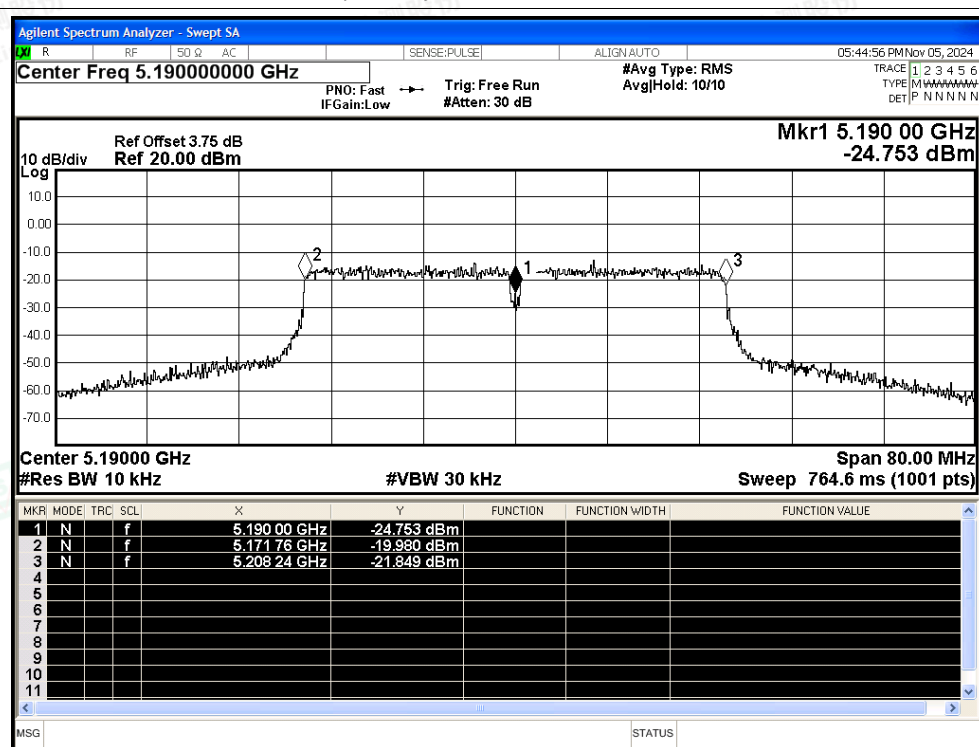

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant2

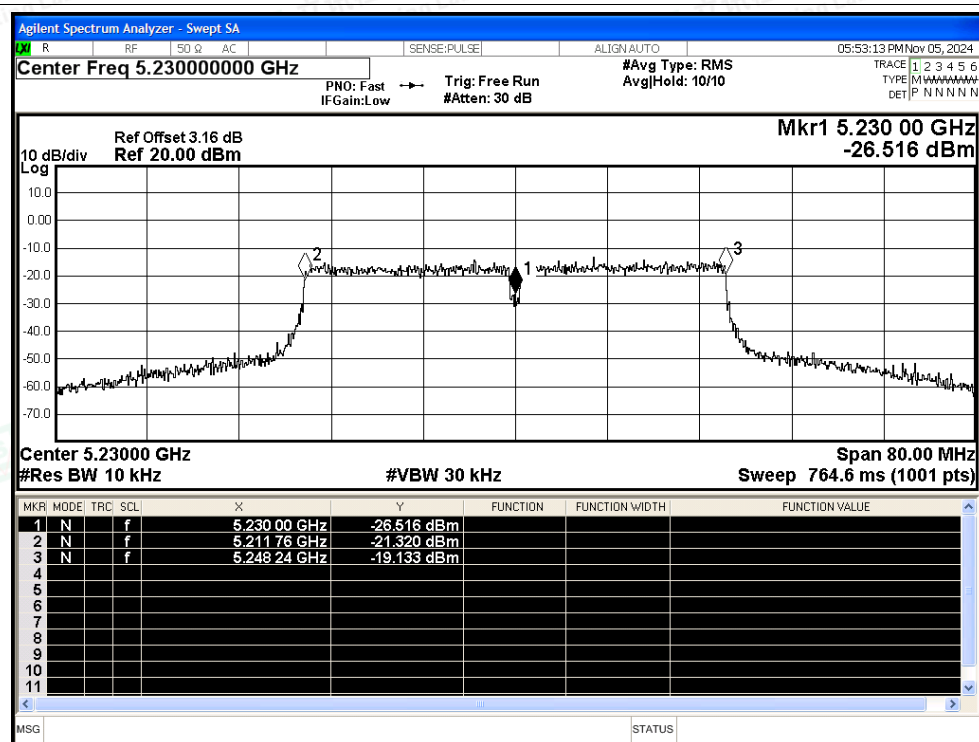


Freq. Stability NVNT ax20 5180MHz Ant2

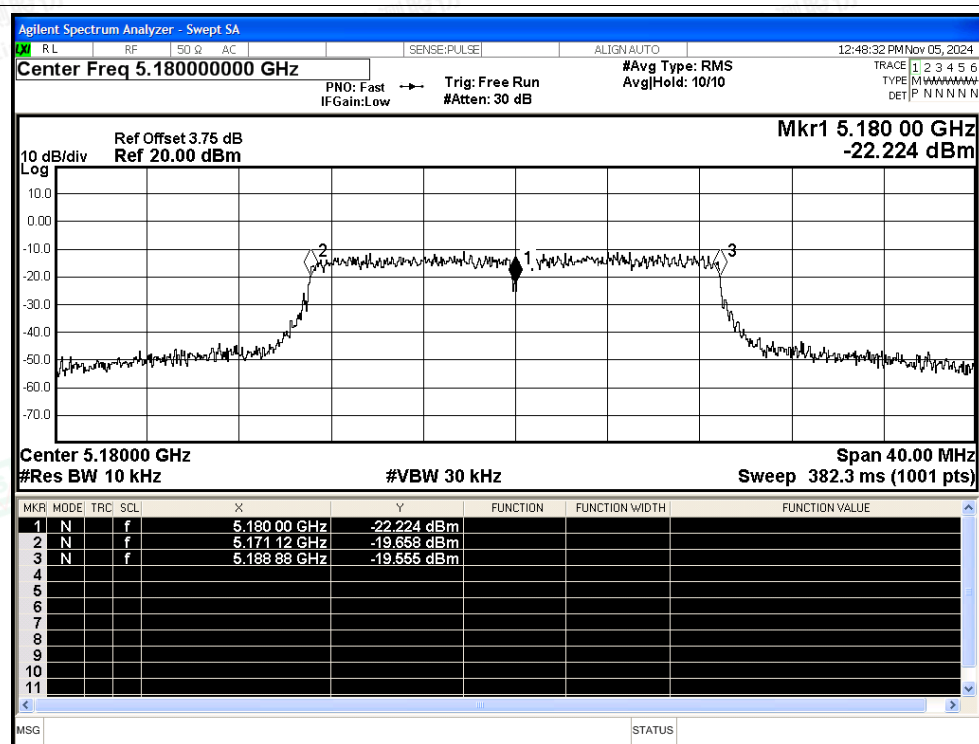




Freq. Stability NVNT ax20 5200MHz Ant2

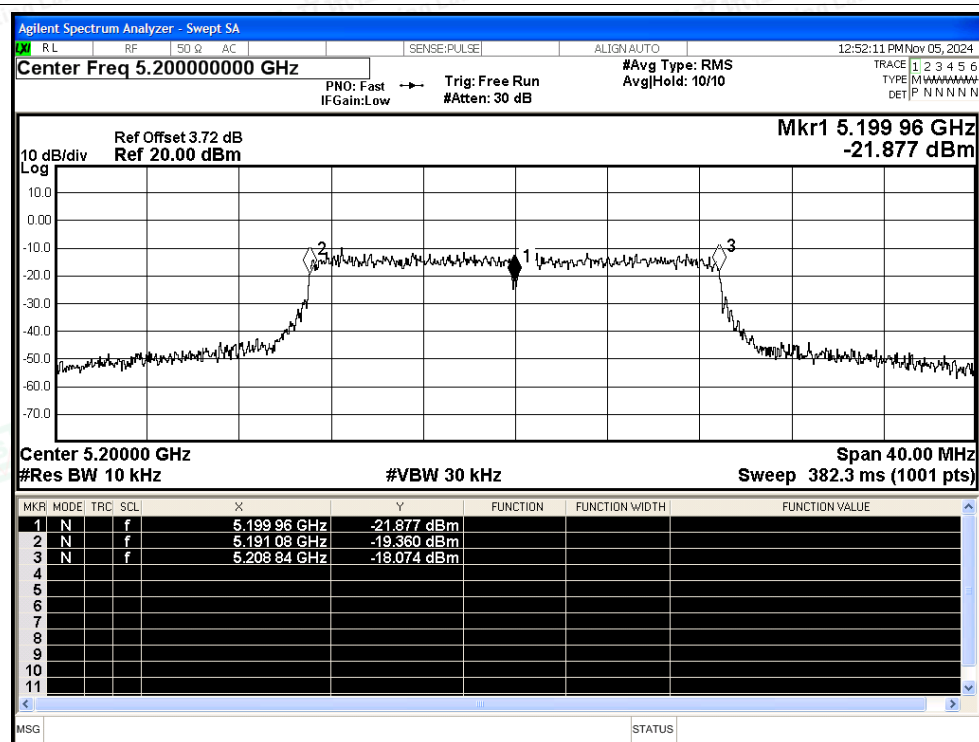

Freq. Stability NVNT ax20 5240MHz Ant2

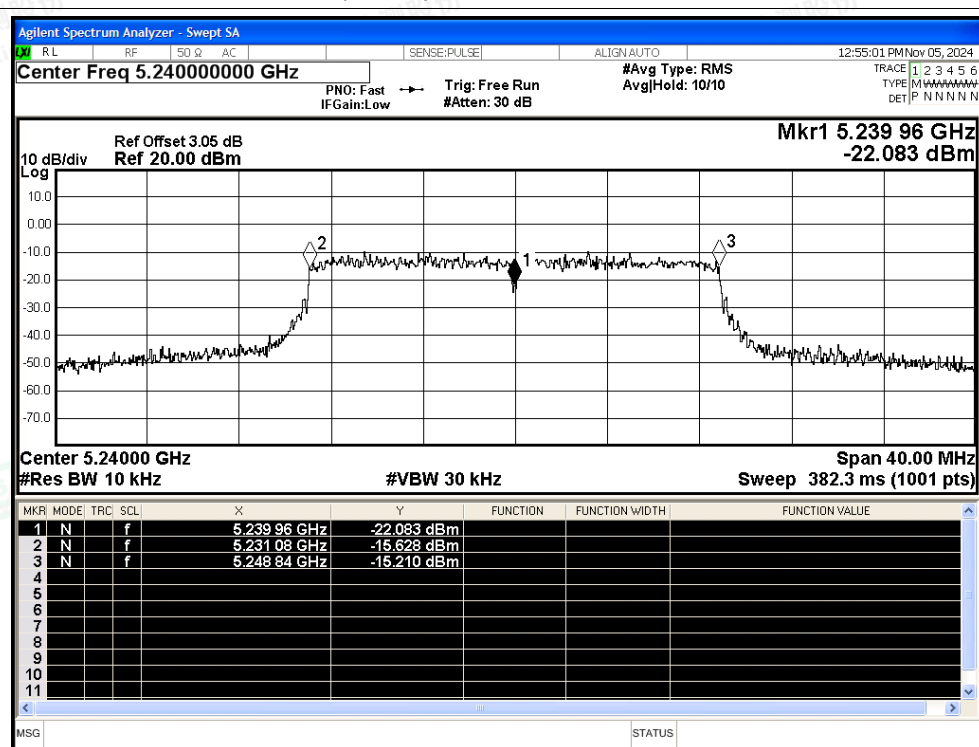

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5190MHz Ant2

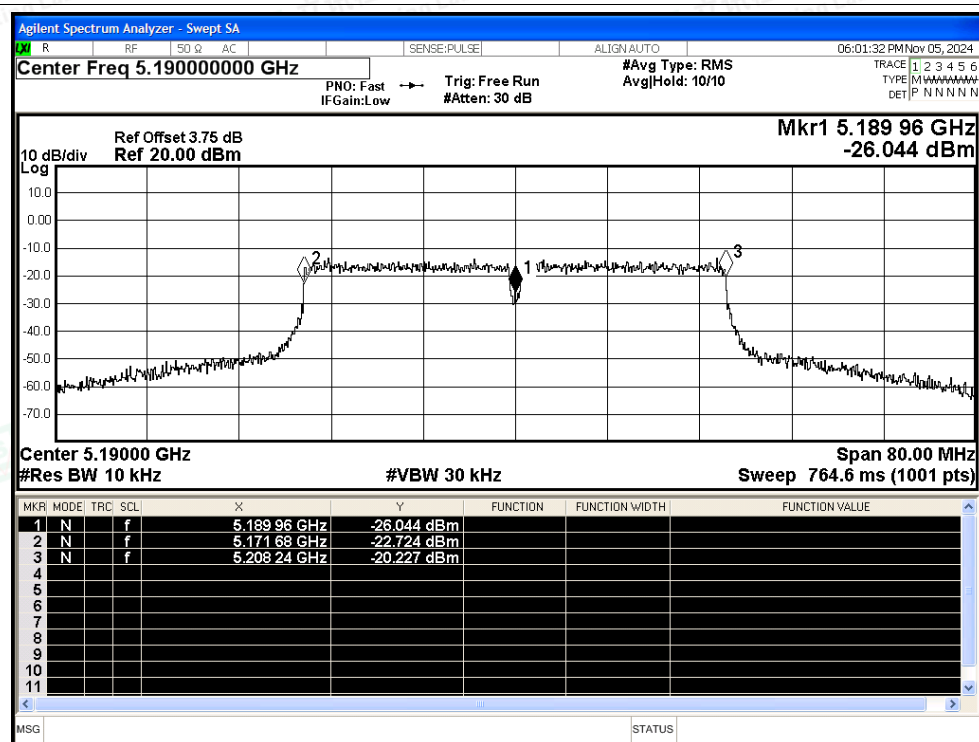

Freq. Stability NVNT ax40 5230MHz Ant2

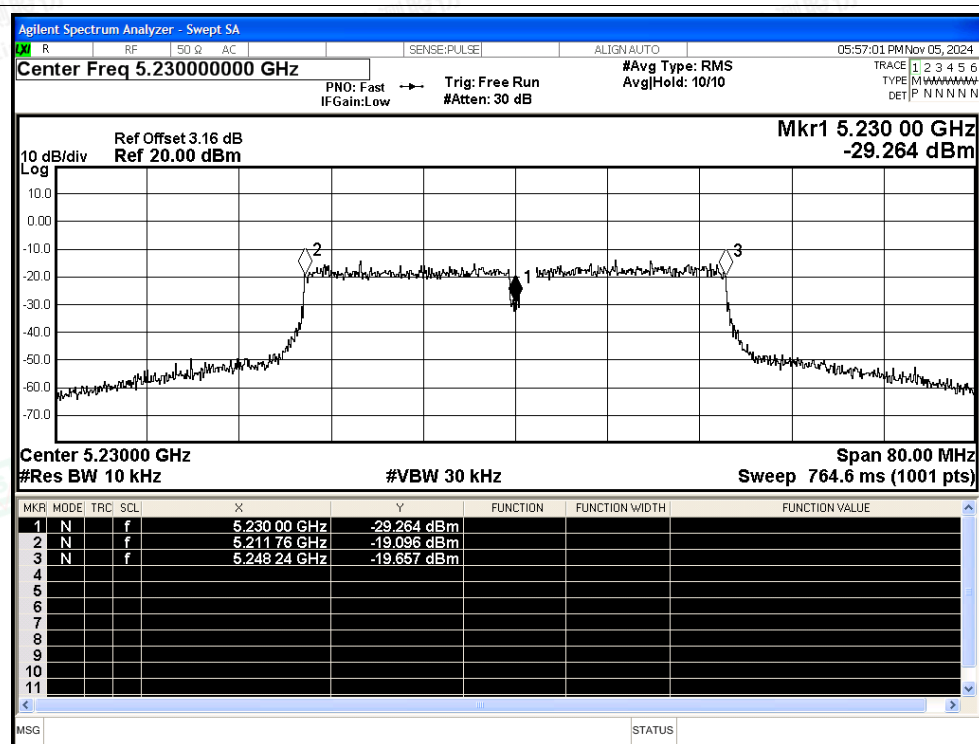

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.65	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.65	0.24	0.91
NVNT	n20	5180	Ant1	93.77	0.28	1.07
NVNT	n20	5200	Ant1	93.77	0.28	1.07
NVNT	n20	5240	Ant1	93.76	0.28	1.07
NVNT	n40	5190	Ant1	94.71	0.24	0.9
NVNT	n40	5230	Ant1	94.71	0.24	0.9
NVNT	ac20	5180	Ant1	93.72	0.28	1.06
NVNT	ac20	5200	Ant1	93.82	0.28	1.06
NVNT	ac20	5240	Ant1	93.72	0.28	1.06
NVNT	ac40	5190	Ant1	94.72	0.24	0.9
NVNT	ac40	5230	Ant1	94.72	0.24	0.9
NVNT	ax20	5180	Ant1	93.82	0.28	1.06
NVNT	ax20	5200	Ant1	93.72	0.28	1.06
NVNT	ax20	5240	Ant1	93.82	0.28	1.06
NVNT	ax40	5190	Ant1	94.81	0.23	0.9
NVNT	ax40	5230	Ant1	94.72	0.24	0.9






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

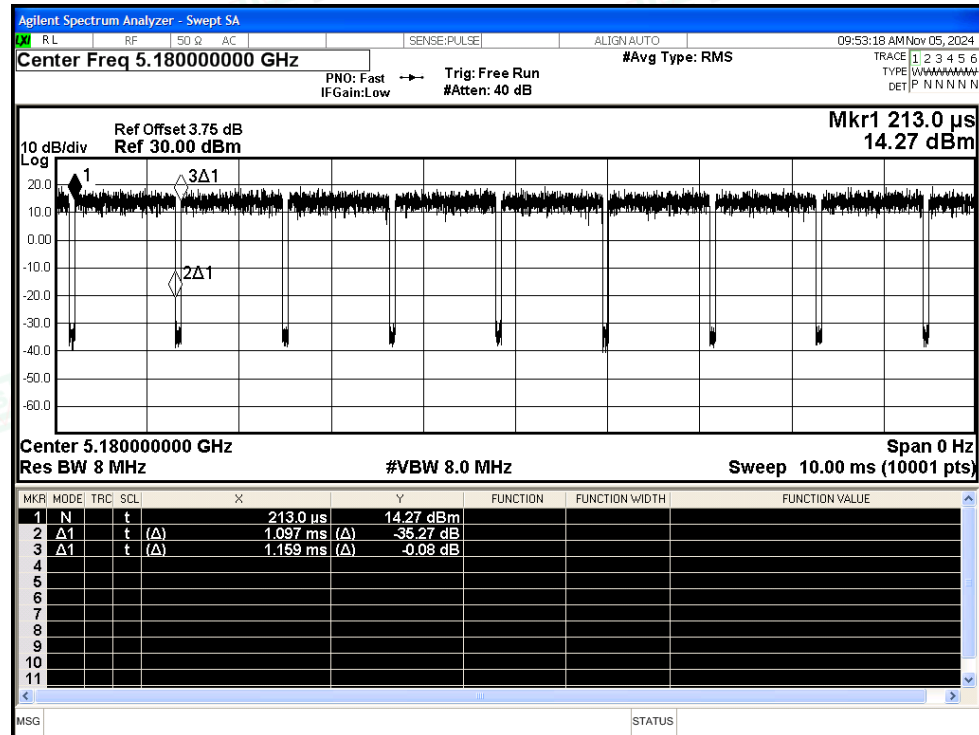

Duty Cycle NVNT a 5200MHz Ant1

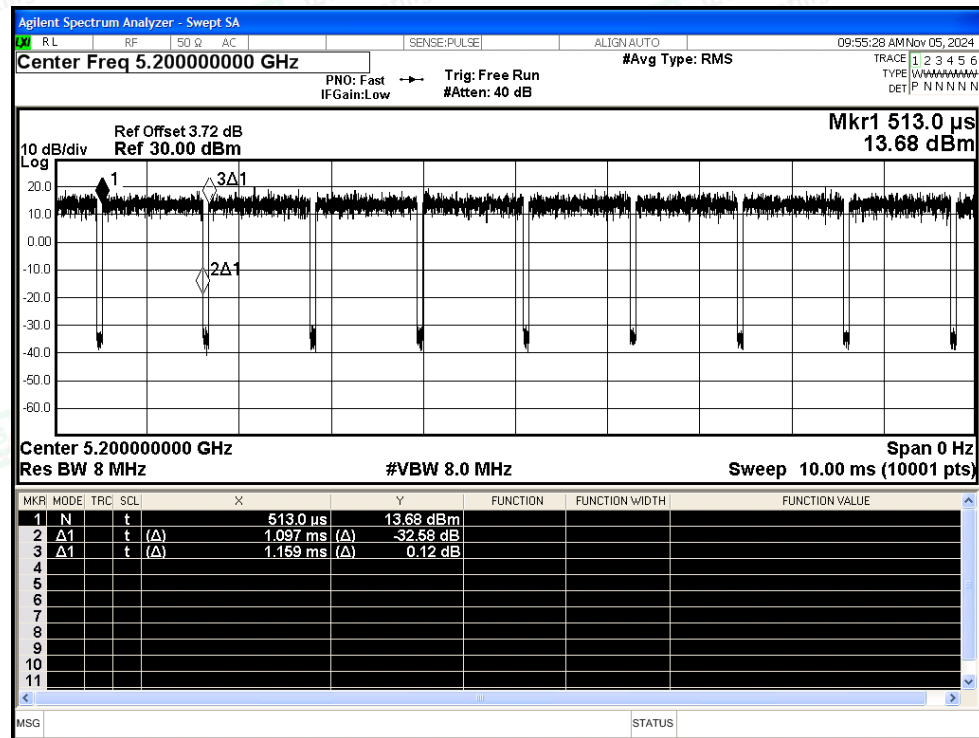

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

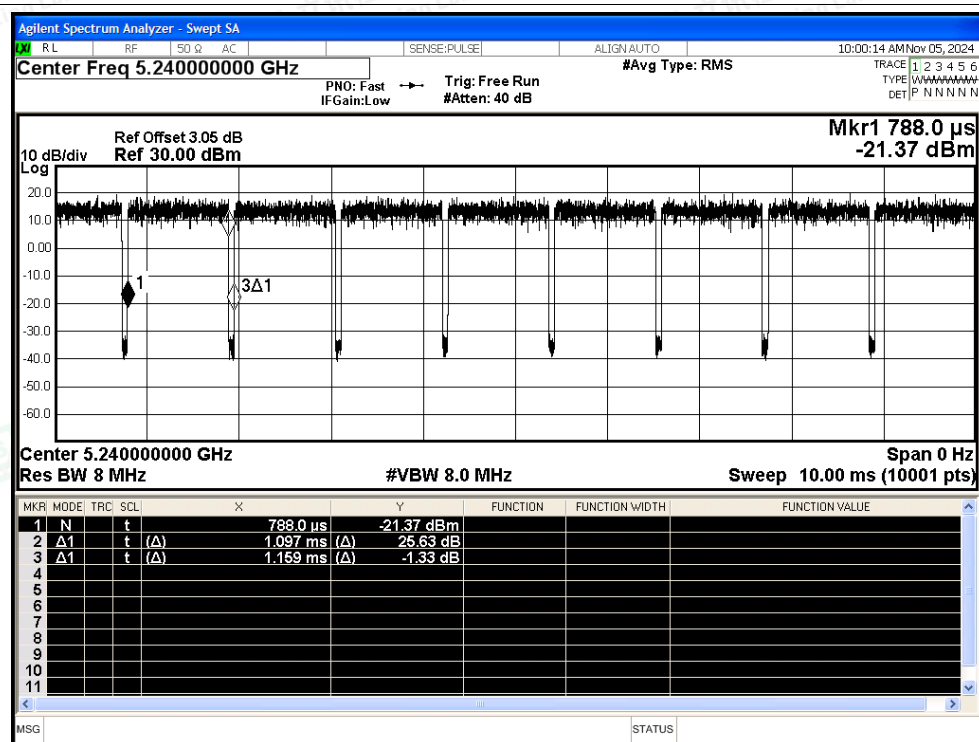

Duty Cycle NVNT n20 5180MHz Ant1

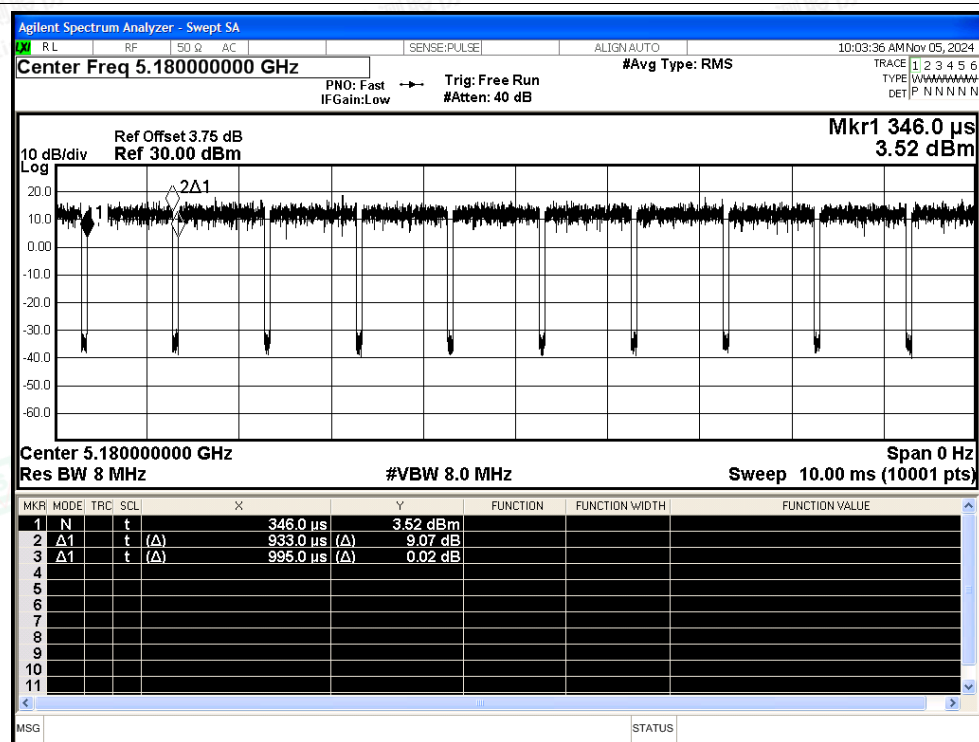

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant1

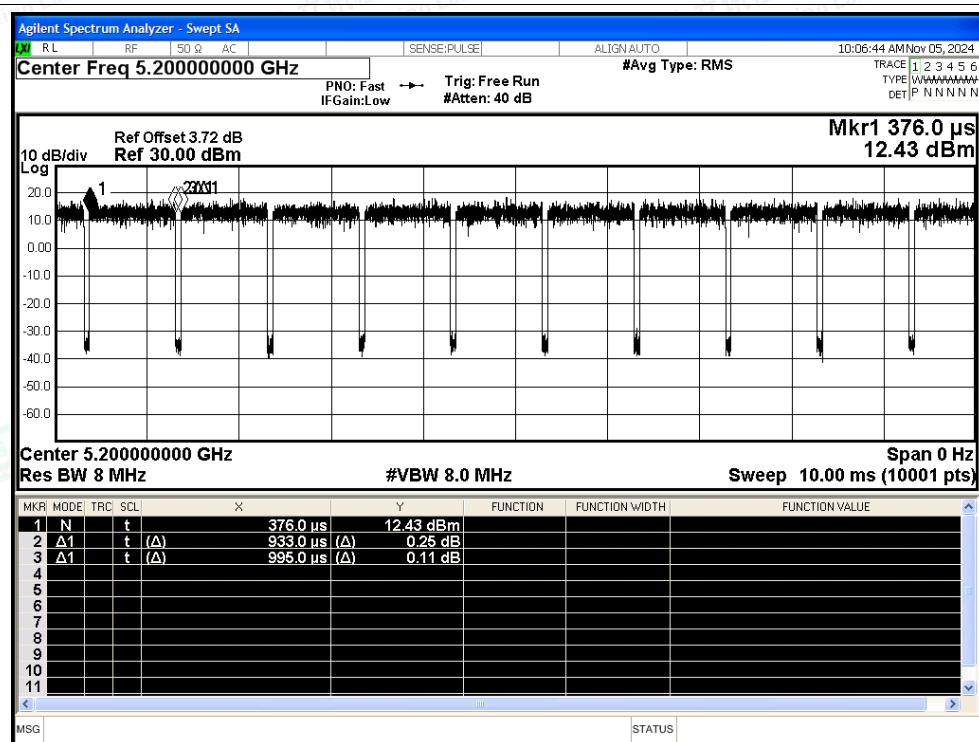

Duty Cycle NVNT n20 5240MHz Ant1

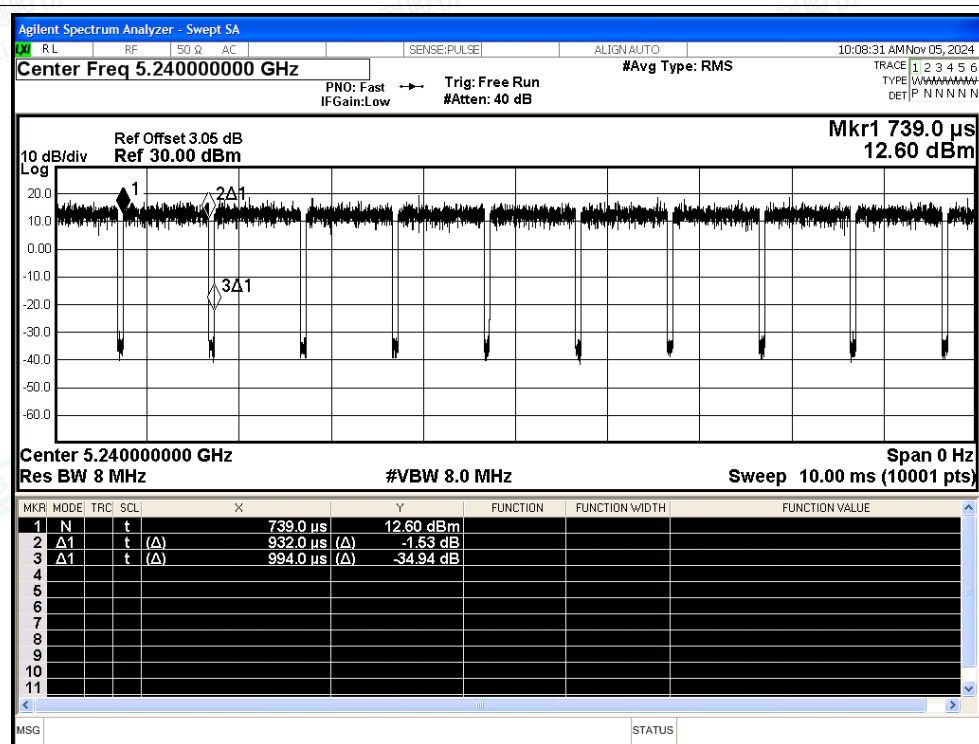

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

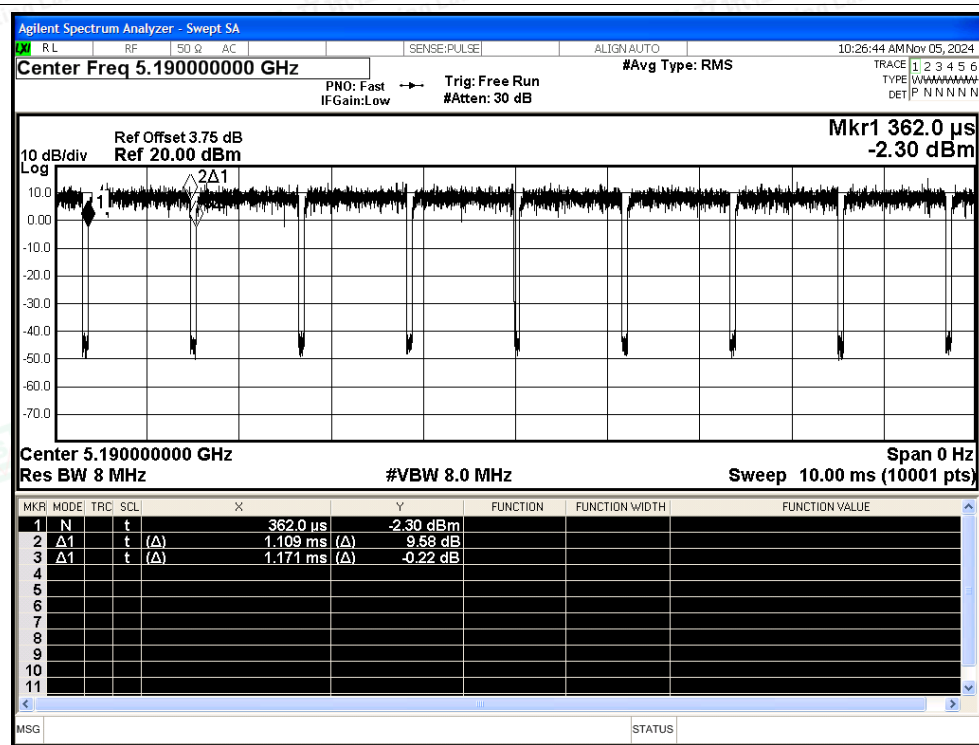

Duty Cycle NVNT n40 5230MHz Ant1

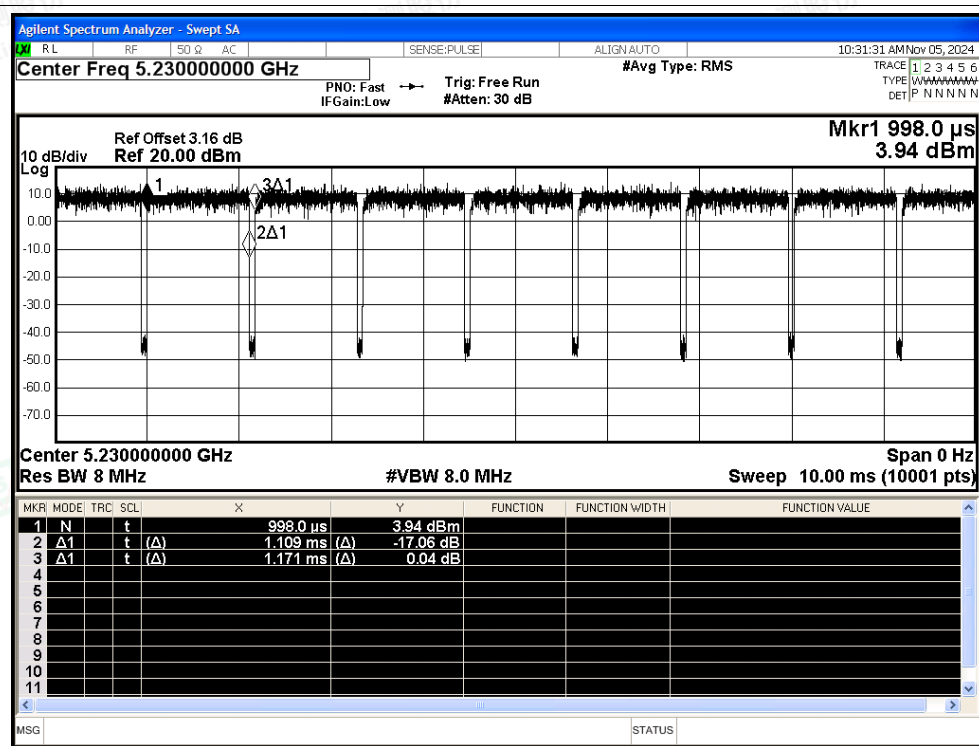

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant1

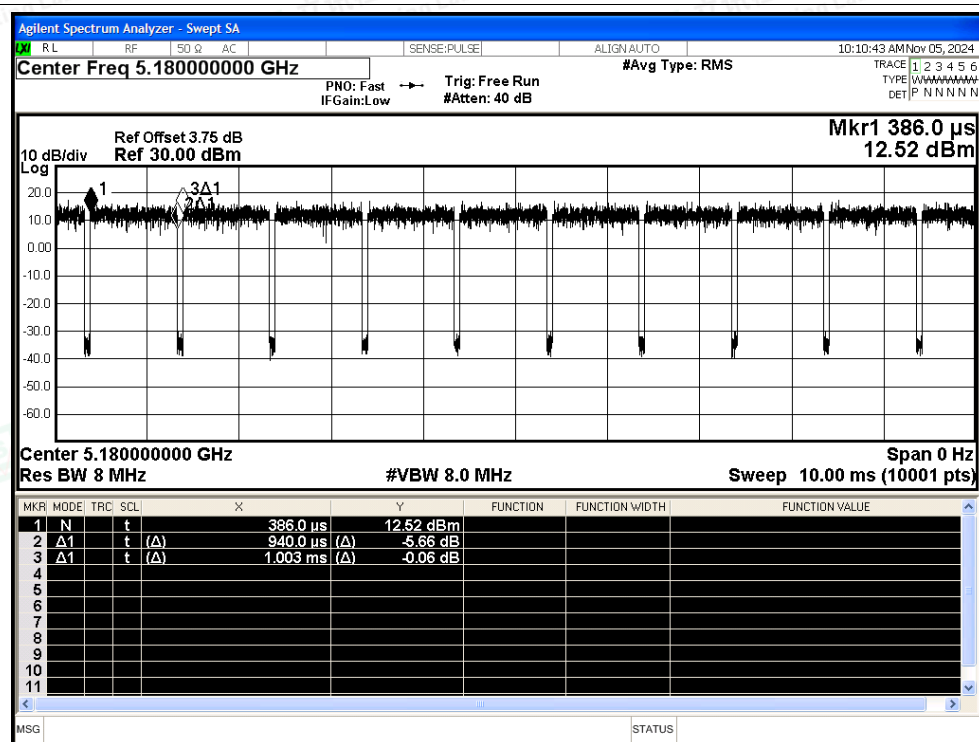

Duty Cycle NVNT ac20 5200MHz Ant1

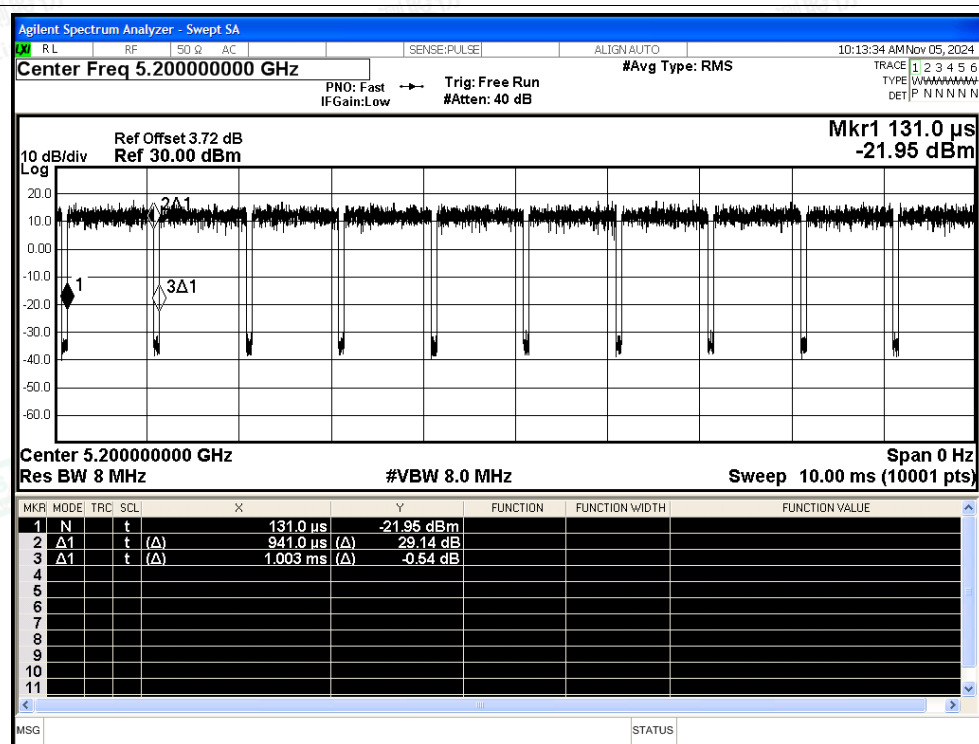

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

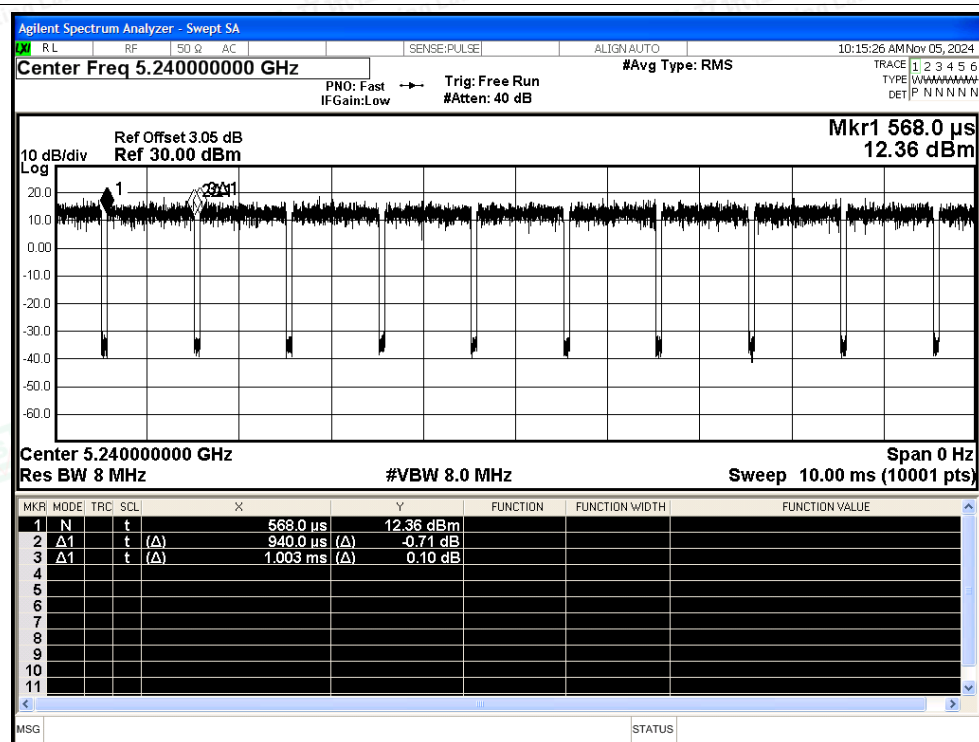

Duty Cycle NVNT ac40 5190MHz Ant1

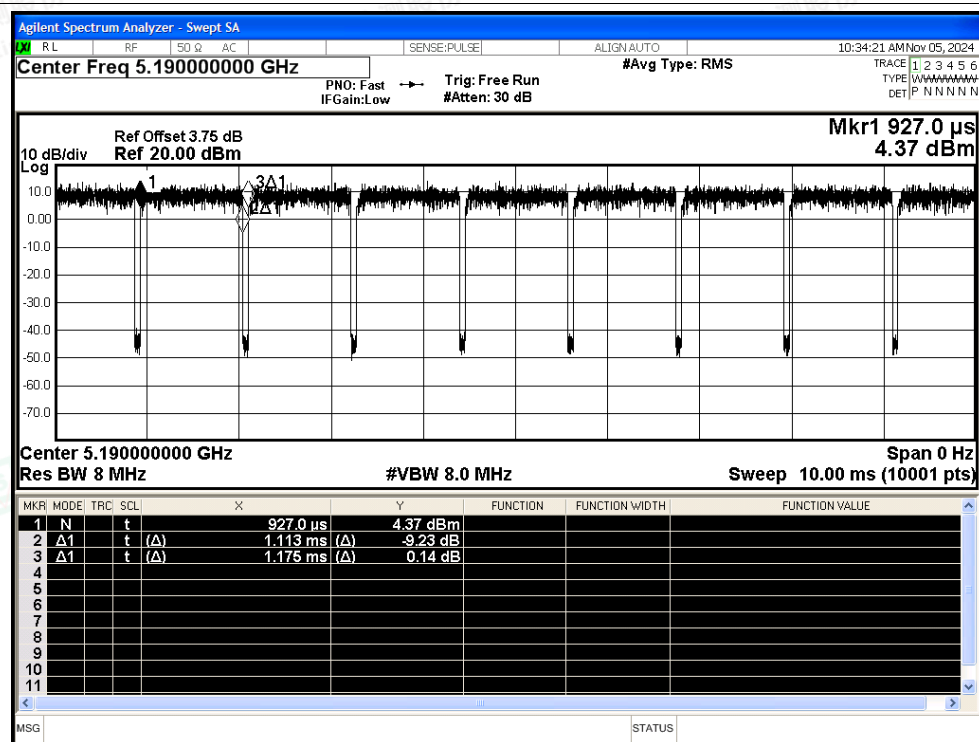

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

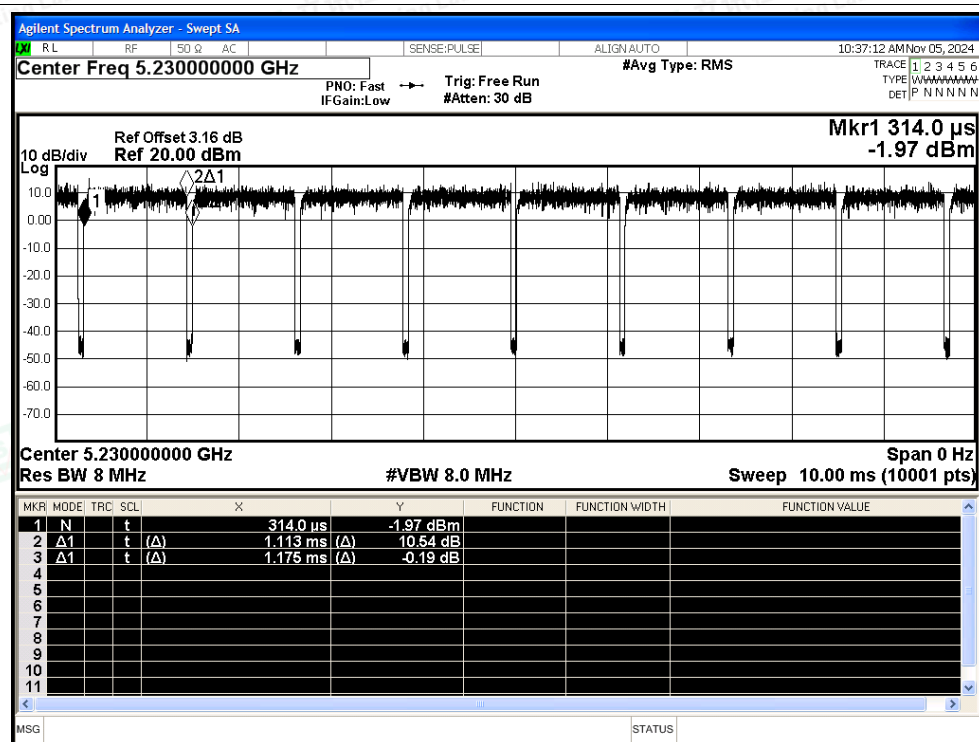

Duty Cycle NVNT ax20 5180MHz Ant1

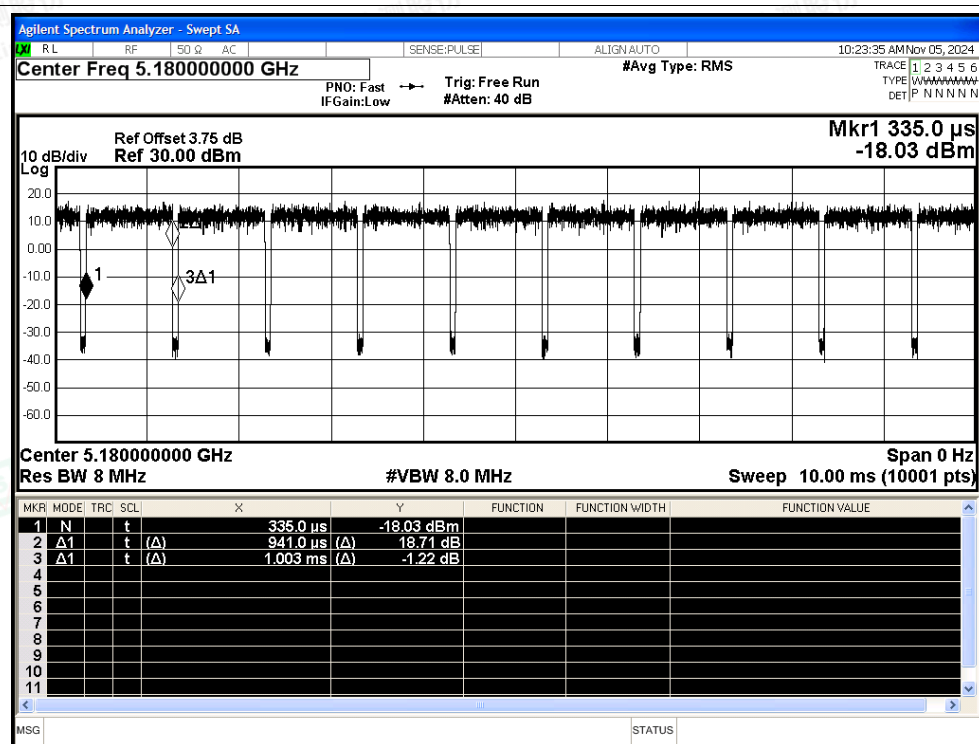

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5200MHz Ant1

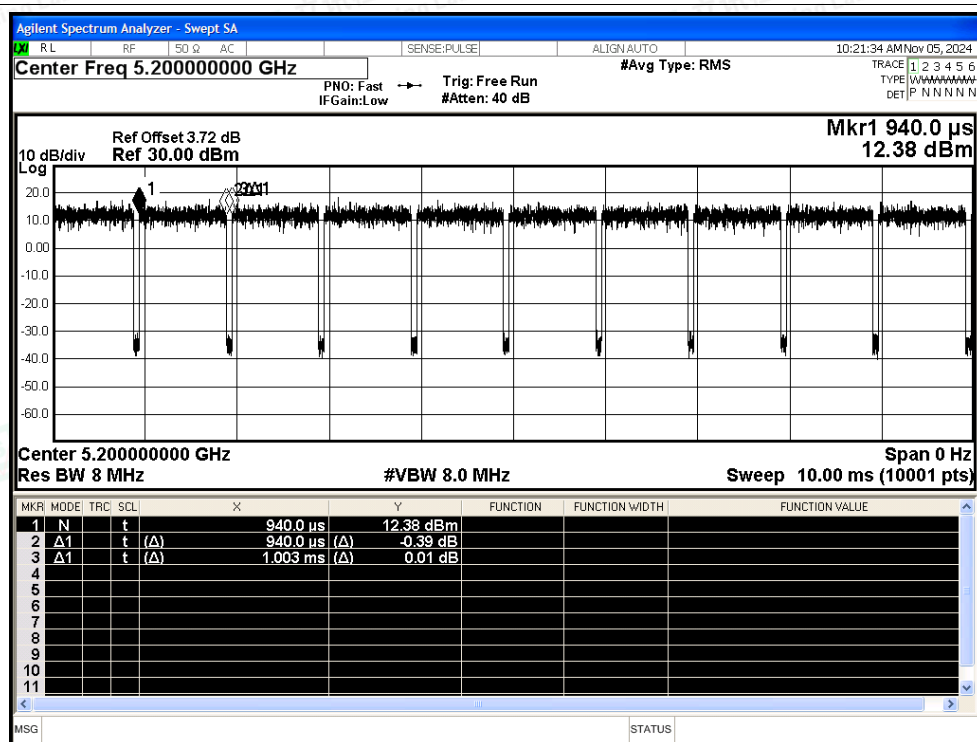

Duty Cycle NVNT ax20 5240MHz Ant1

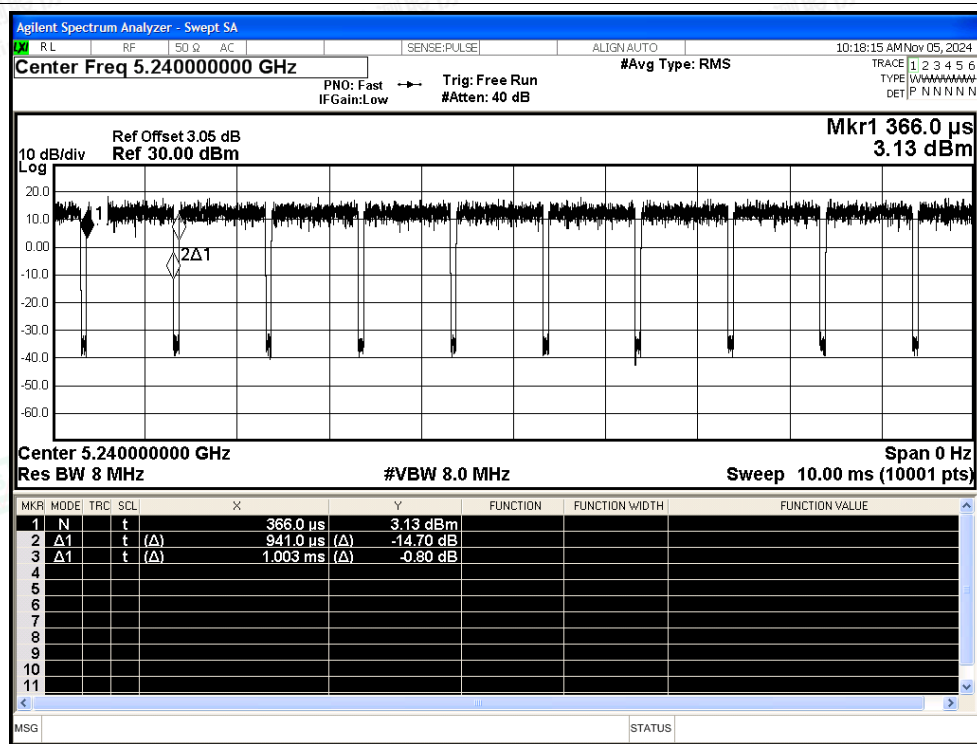

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5190MHz Ant1

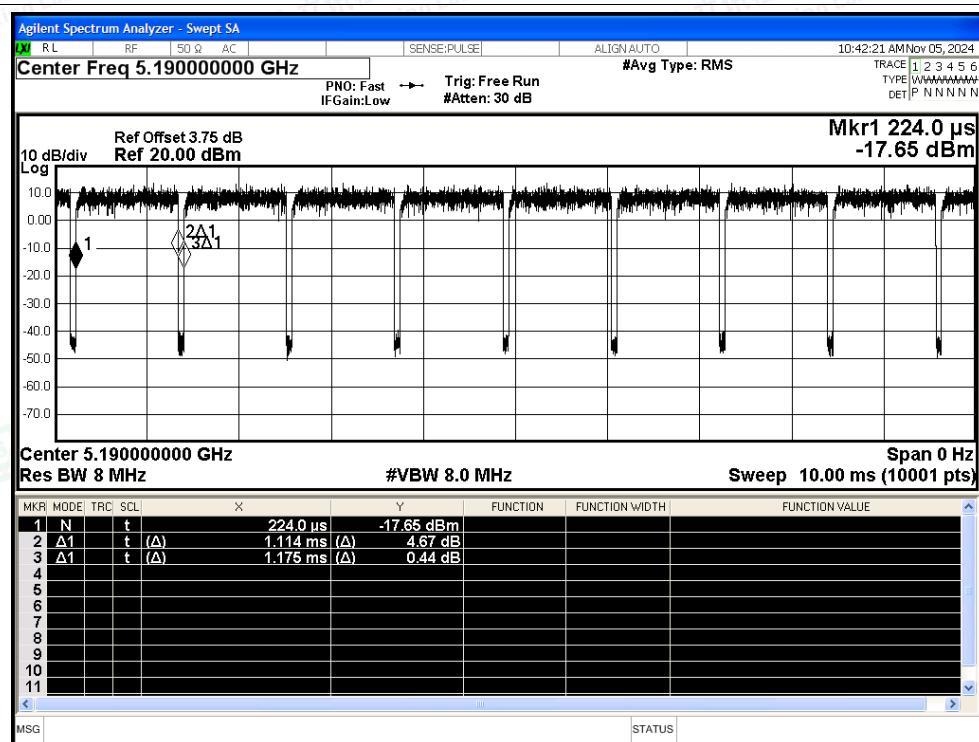

Duty Cycle NVNT ax40 5230MHz Ant1

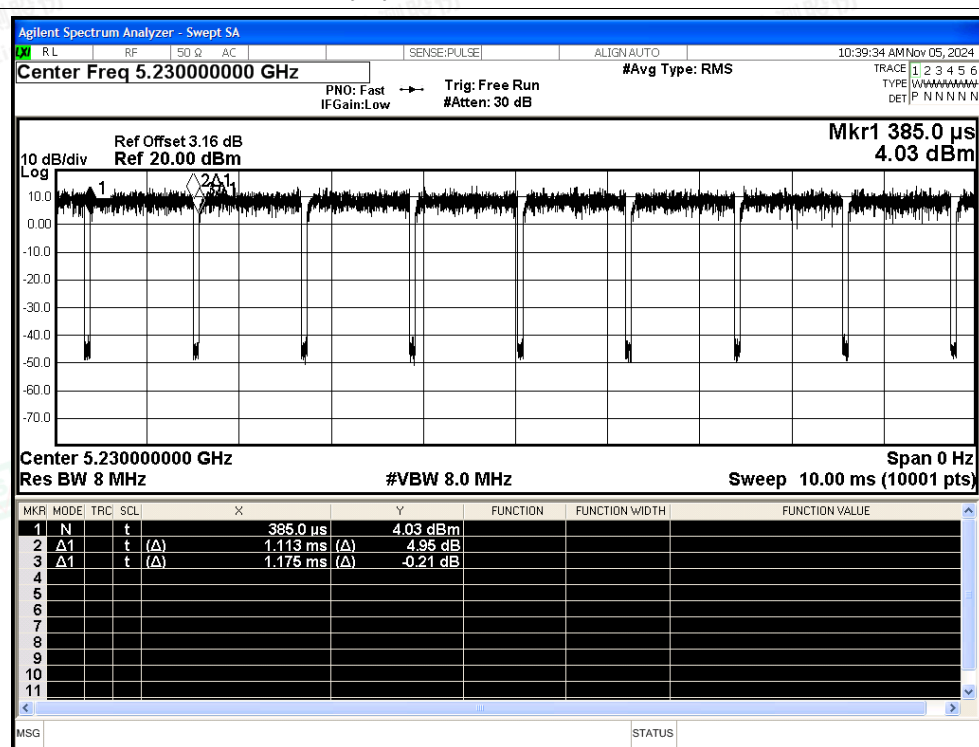

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	94.56	0.24	0.91
NVNT	a	5200	Ant2	94.65	0.24	0.91
NVNT	a	5240	Ant2	94.56	0.24	0.91
NVNT	n20	5180	Ant2	93.77	0.28	1.07
NVNT	n20	5200	Ant2	93.77	0.28	1.07
NVNT	n20	5240	Ant2	93.77	0.28	1.07
NVNT	n40	5190	Ant2	94.71	0.24	0.9
NVNT	n40	5230	Ant2	94.71	0.24	0.9
NVNT	ac20	5180	Ant2	93.72	0.28	1.06
NVNT	ac20	5200	Ant2	93.72	0.28	1.06
NVNT	ac20	5240	Ant2	93.72	0.28	1.06
NVNT	ac40	5190	Ant2	94.72	0.24	0.9
NVNT	ac40	5230	Ant2	94.72	0.24	0.9
NVNT	ax20	5180	Ant2	93.82	0.28	1.06
NVNT	ax20	5200	Ant2	93.82	0.28	1.06
NVNT	ax20	5240	Ant2	93.72	0.28	1.06
NVNT	ax40	5190	Ant2	94.81	0.23	0.9
NVNT	ax40	5230	Ant2	94.72	0.24	0.9






Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

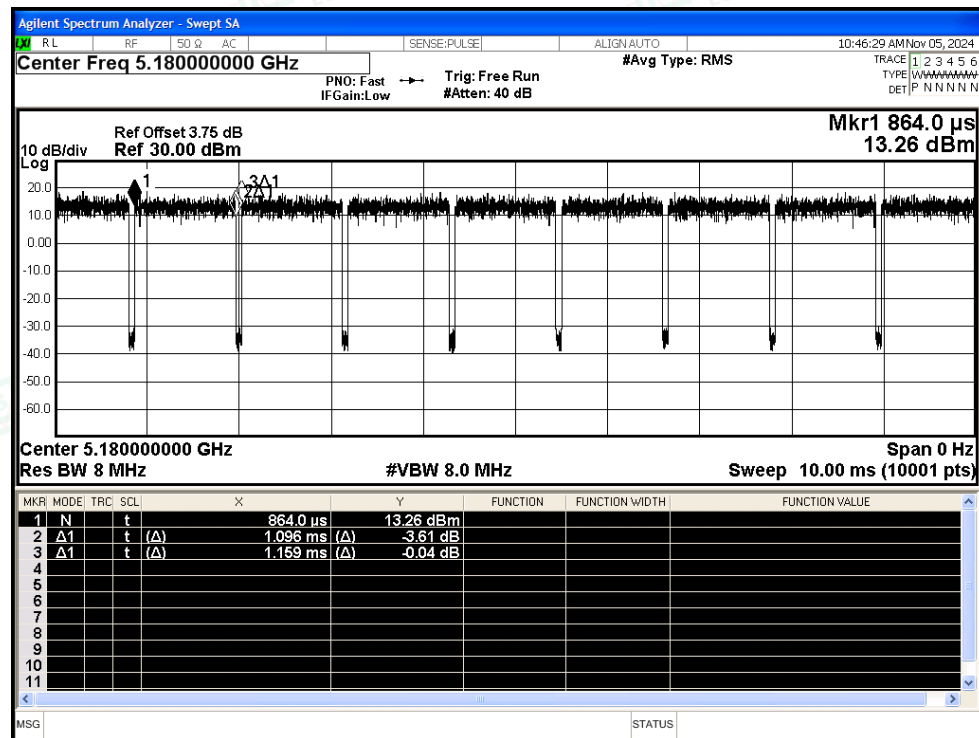

Duty Cycle NVNT a 5200MHz Ant2

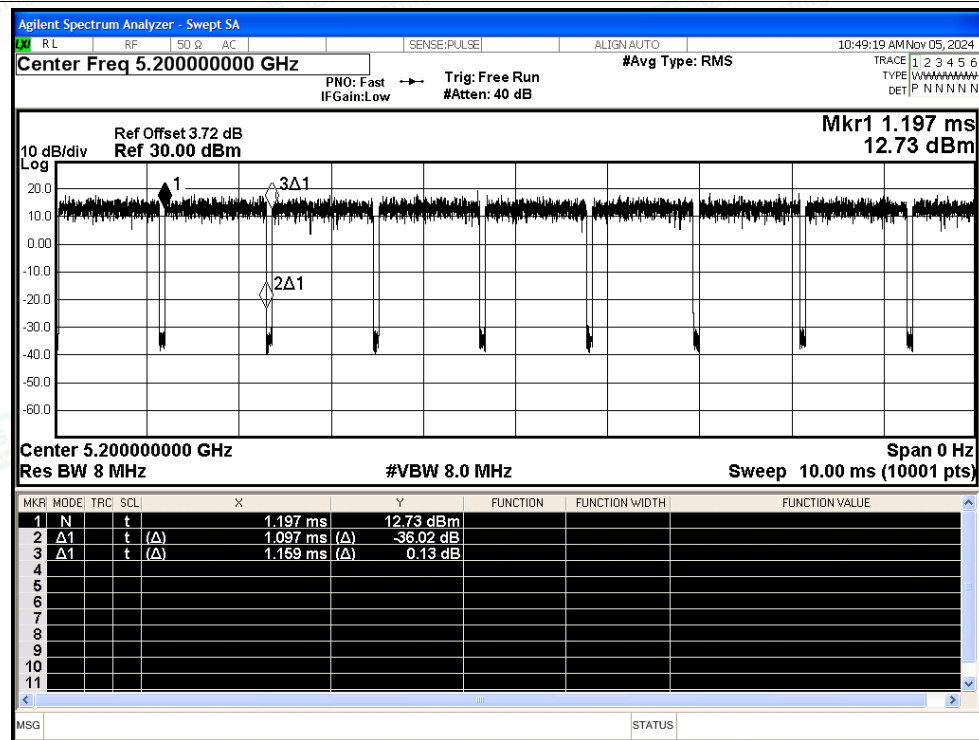

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant2

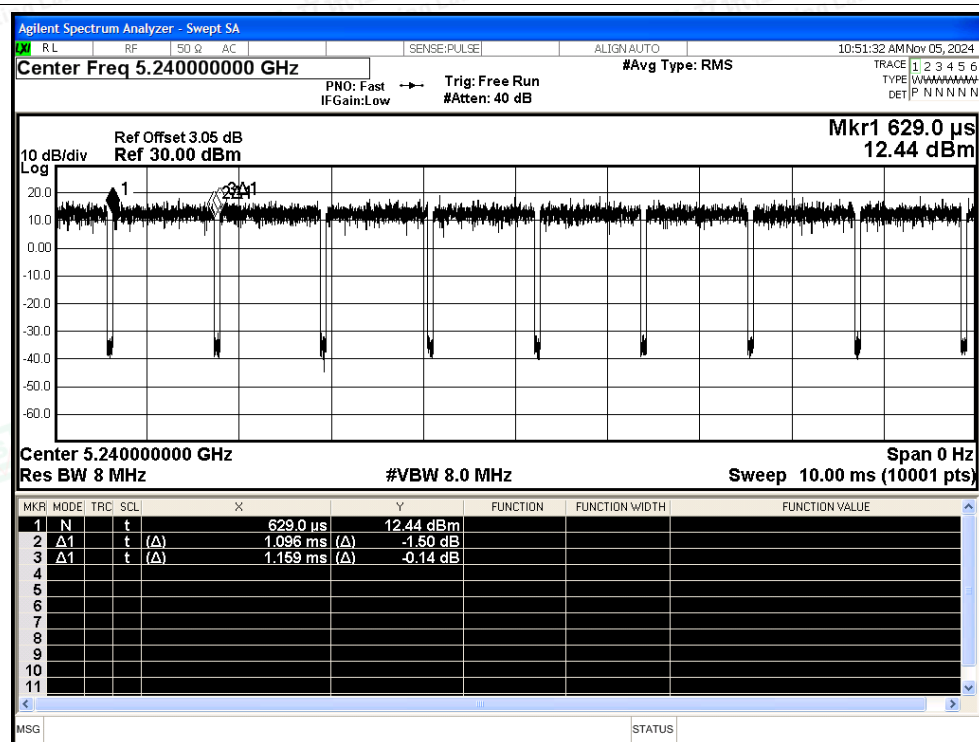

Duty Cycle NVNT n20 5180MHz Ant2


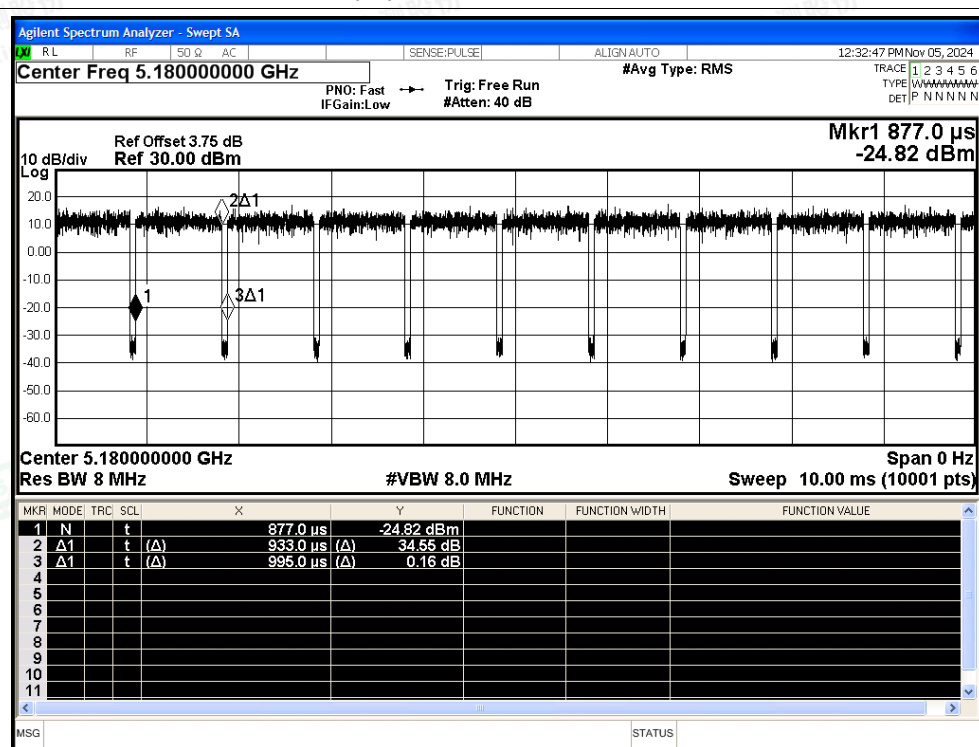


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

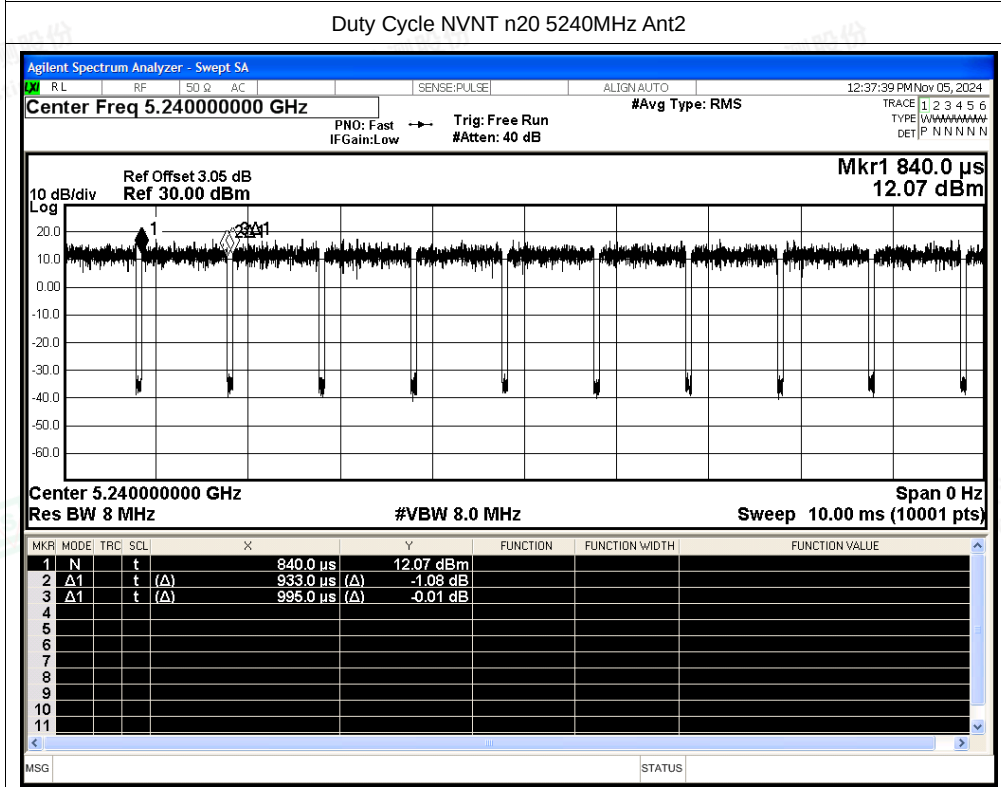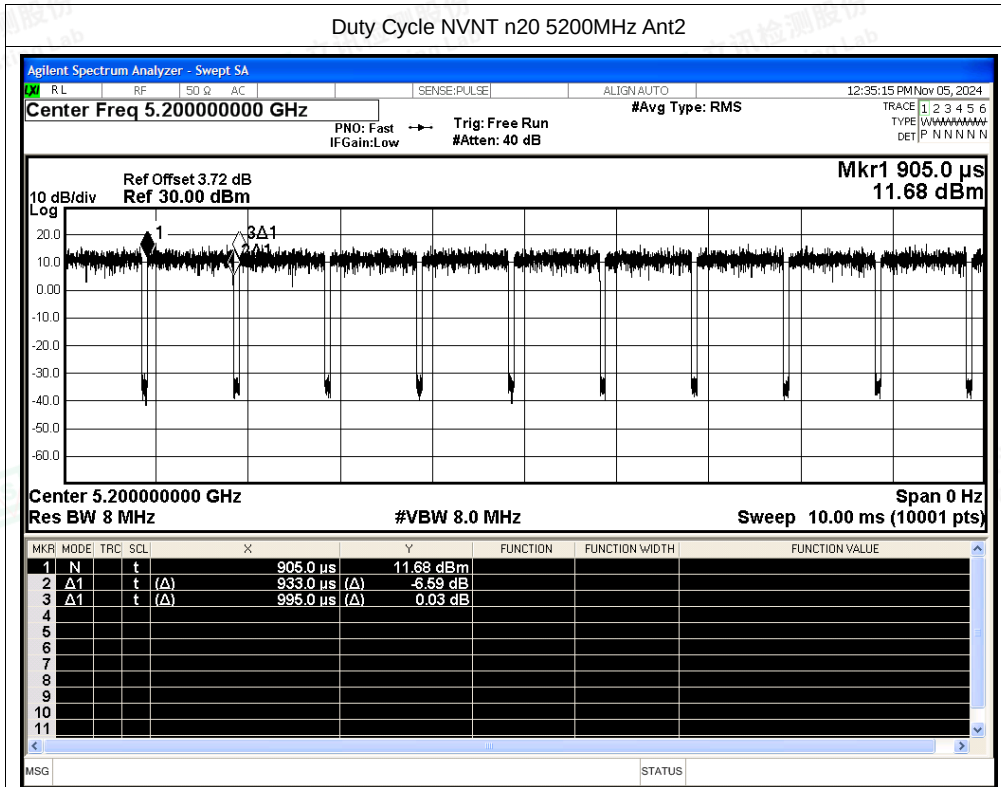




Duty Cycle NVNT n40 5190MHz Ant2

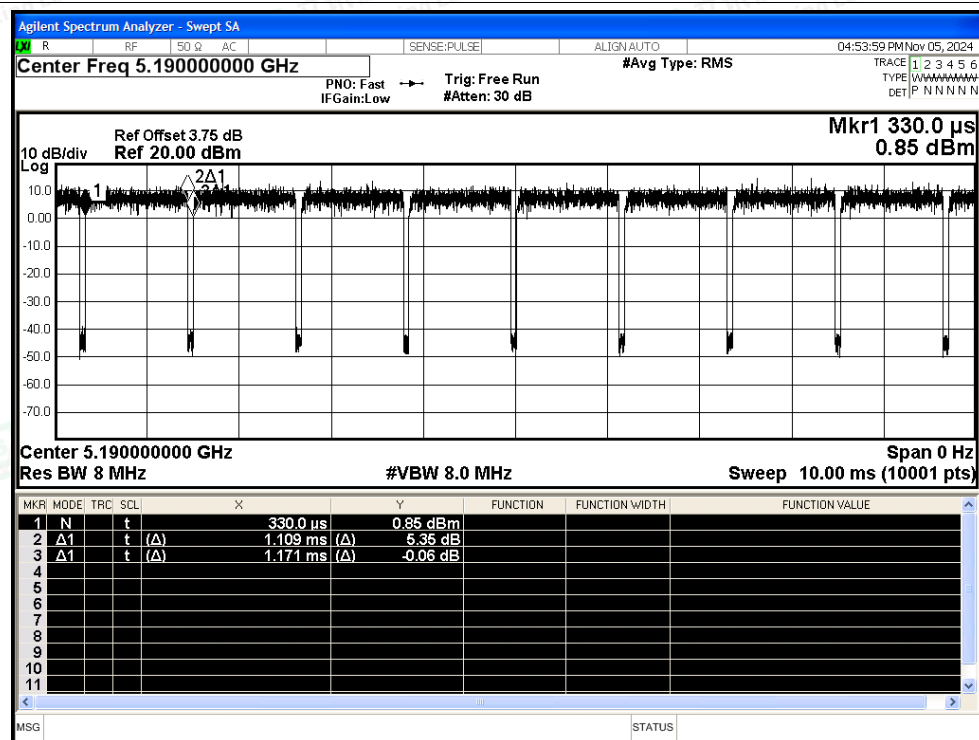

Duty Cycle NVNT n40 5230MHz Ant2

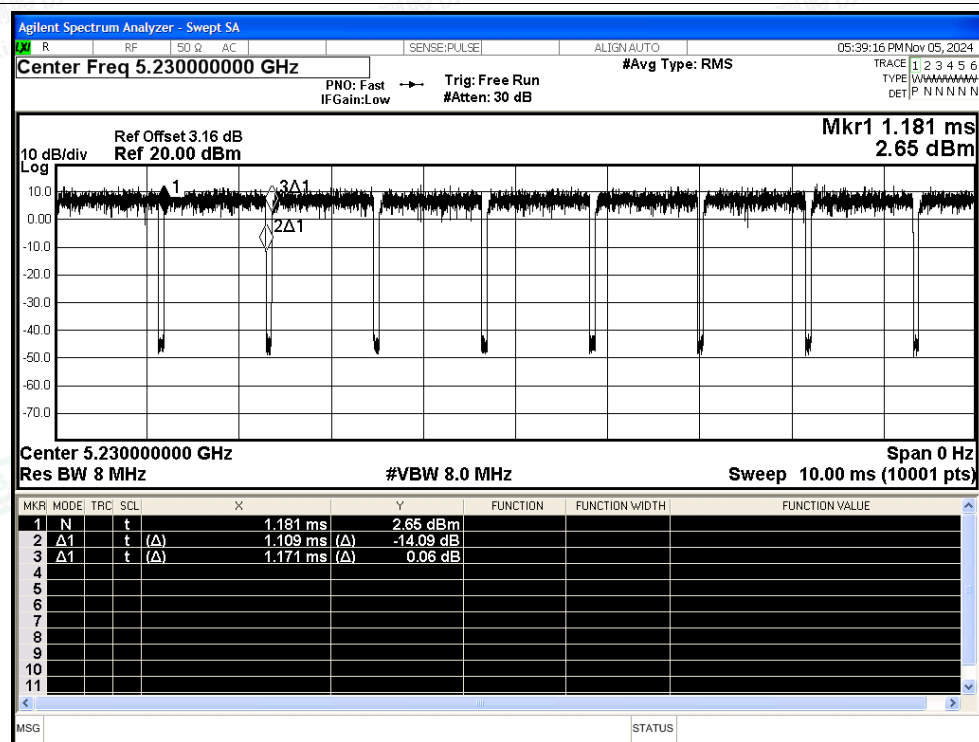

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant2

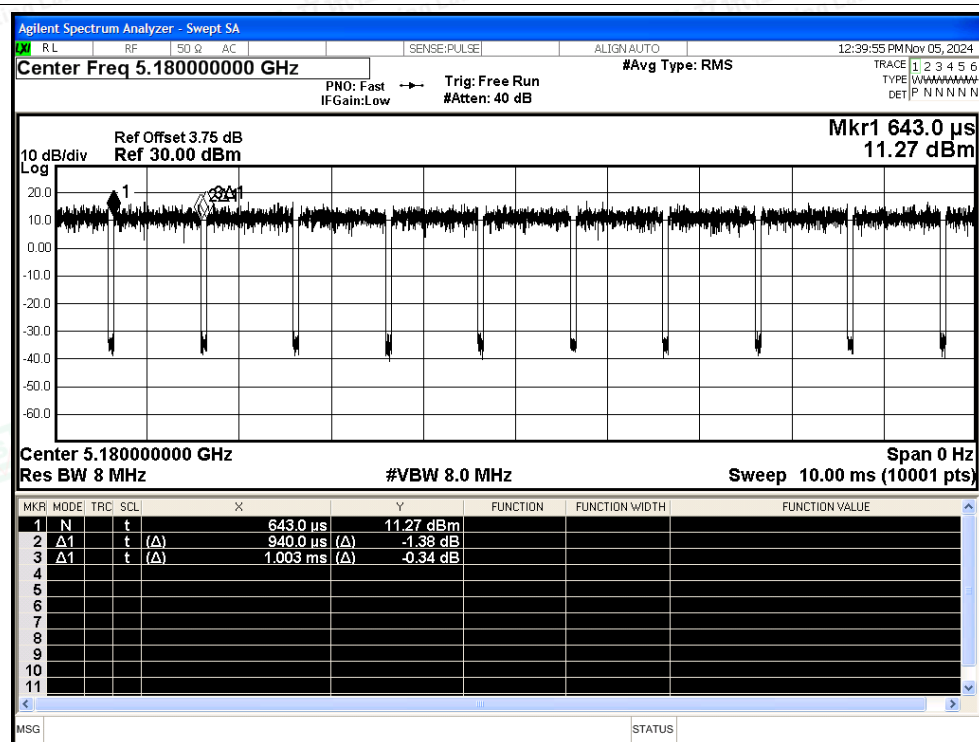

Duty Cycle NVNT ac20 5200MHz Ant2

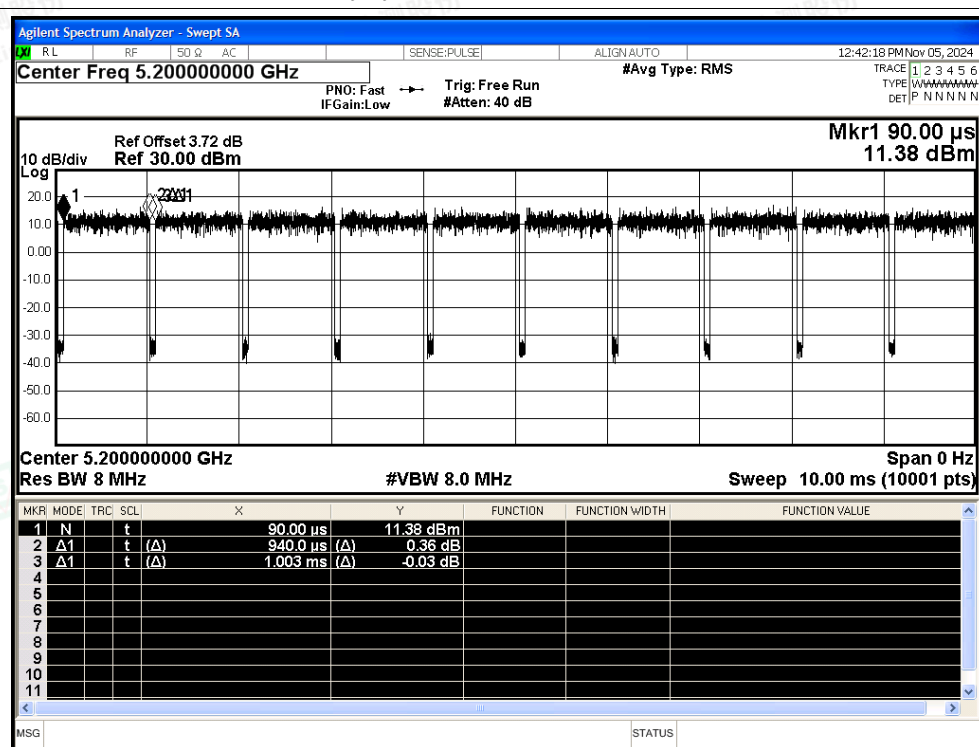

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant2

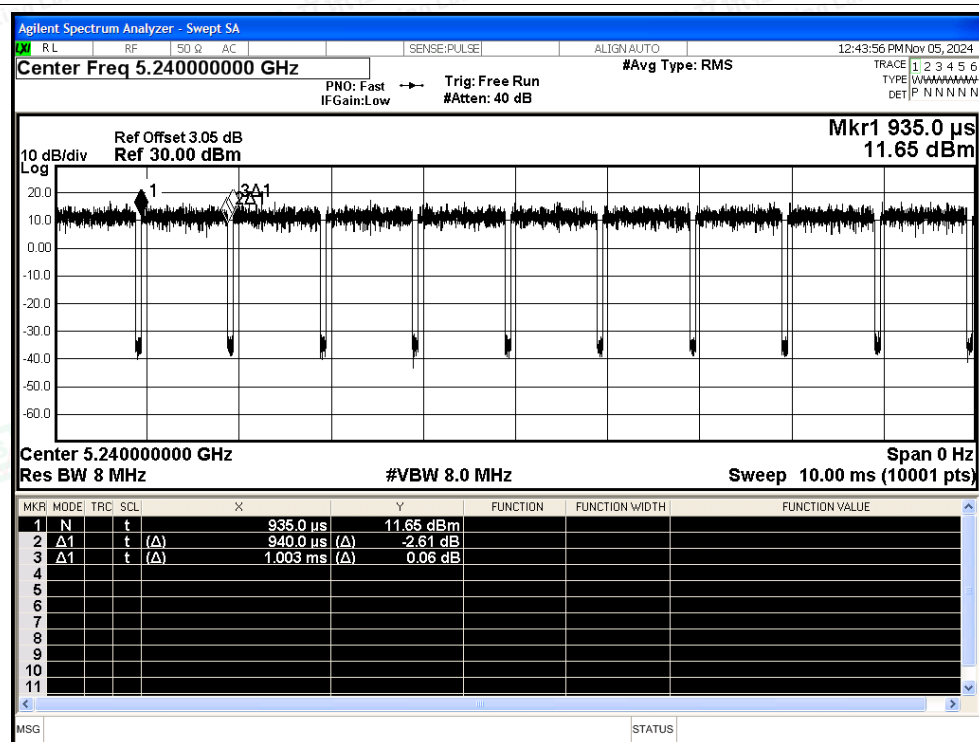


Duty Cycle NVNT ac40 5190MHz Ant2

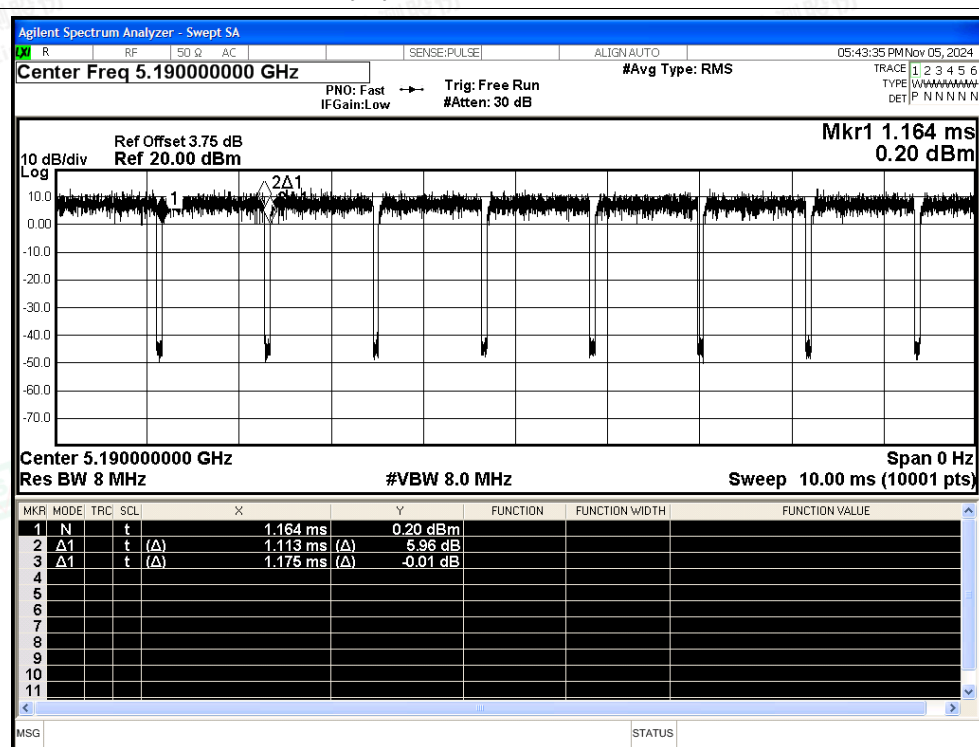




Duty Cycle NVNT ac40 5230MHz Ant2

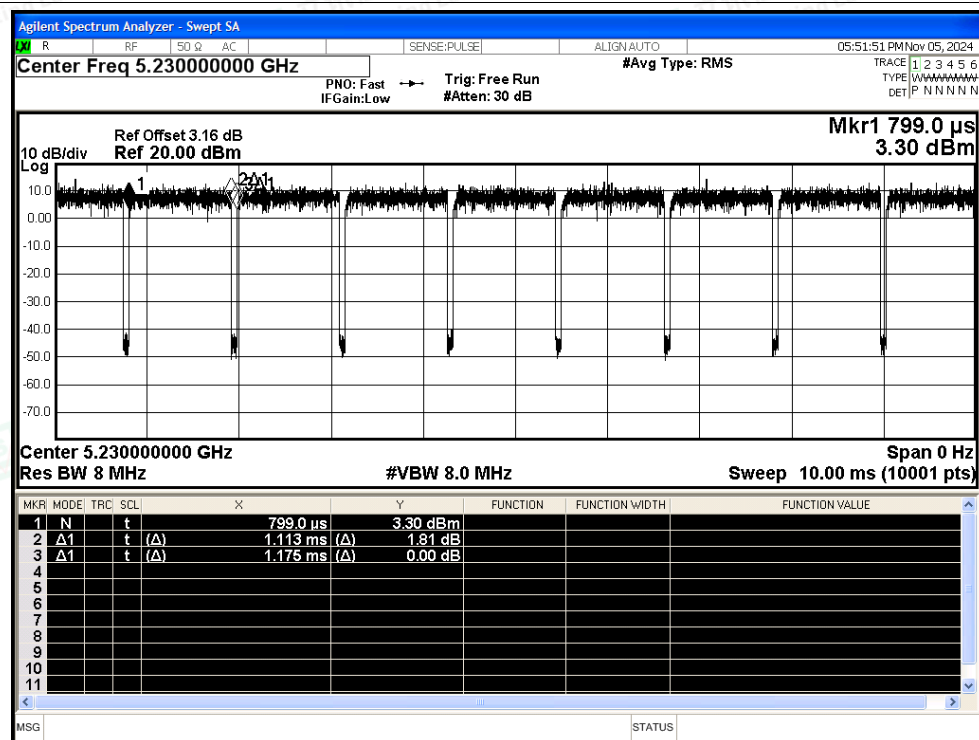

Duty Cycle NVNT ax20 5180MHz Ant2

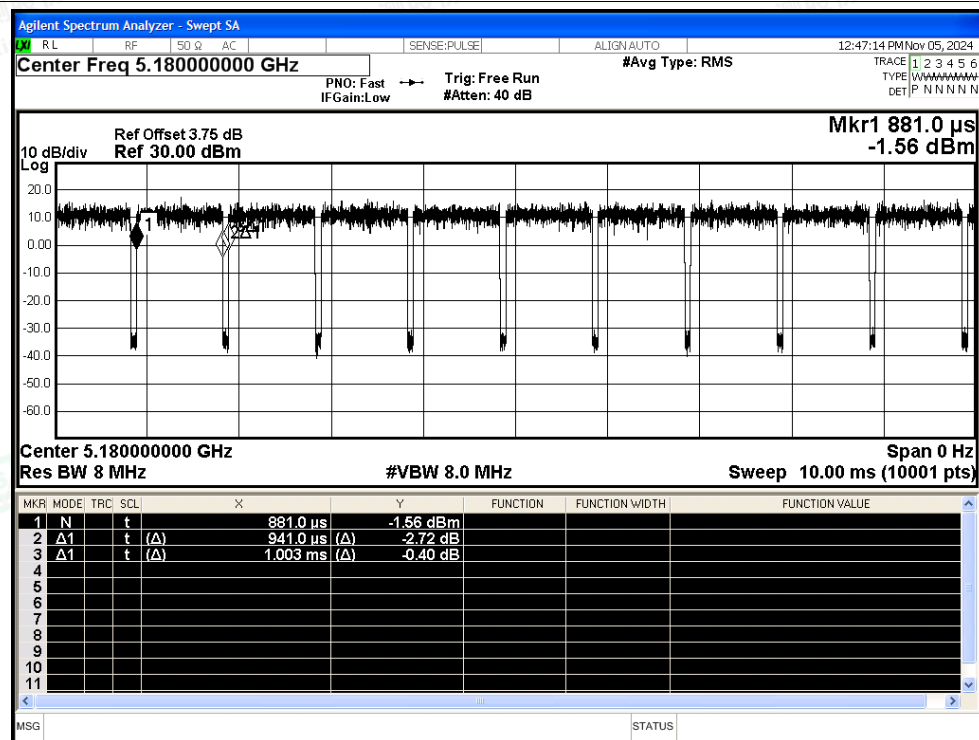

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5200MHz Ant2

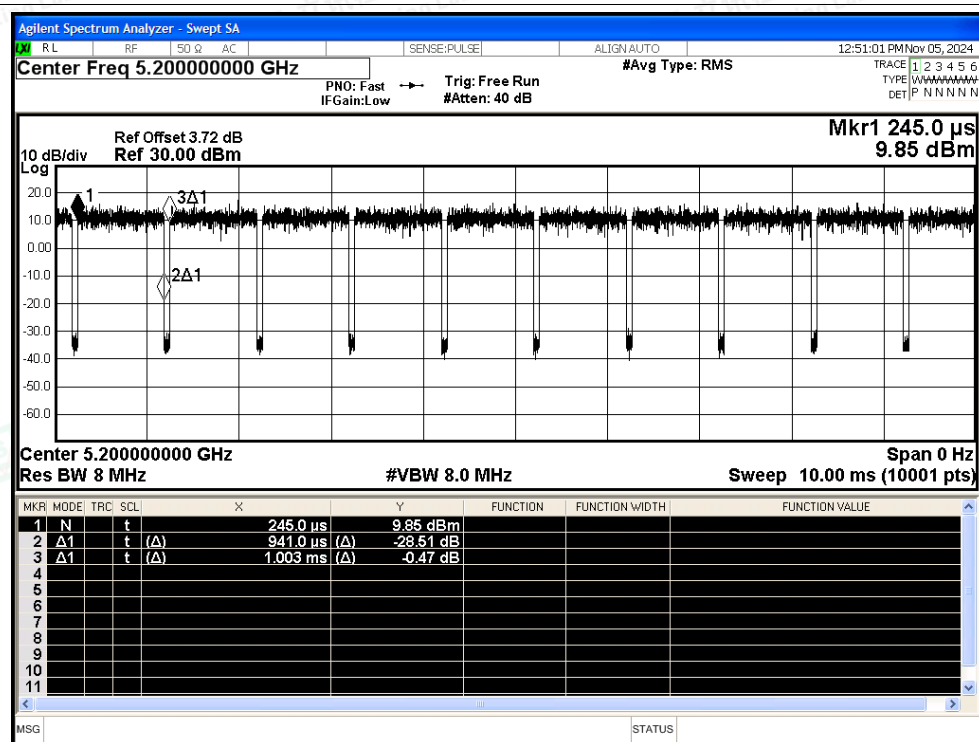

Duty Cycle NVNT ax20 5240MHz Ant2

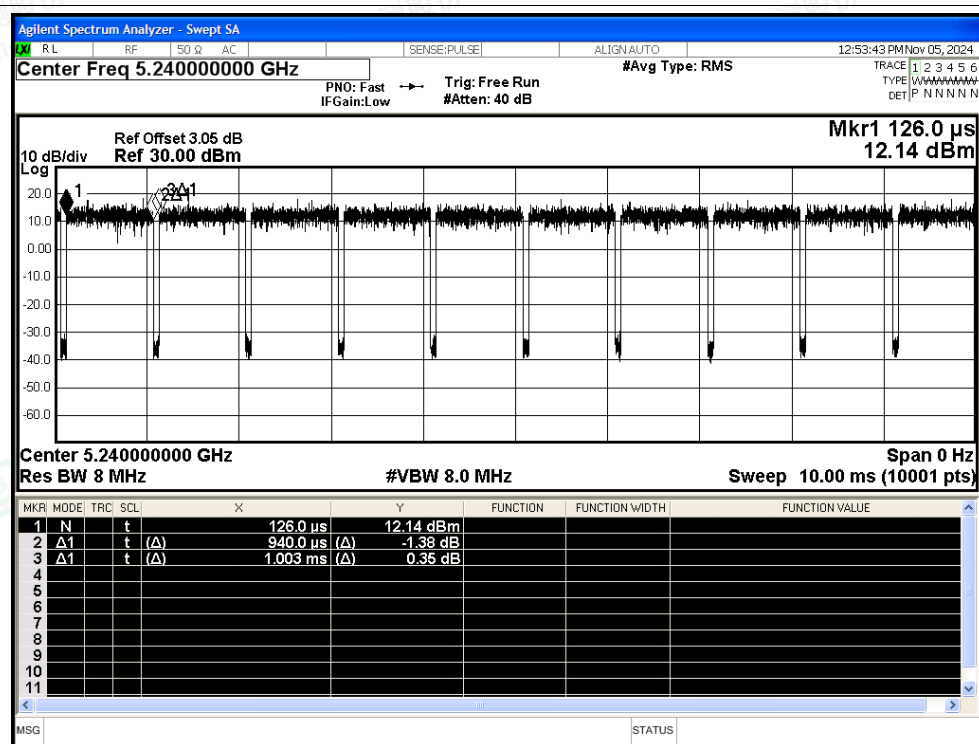

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5190MHz Ant2

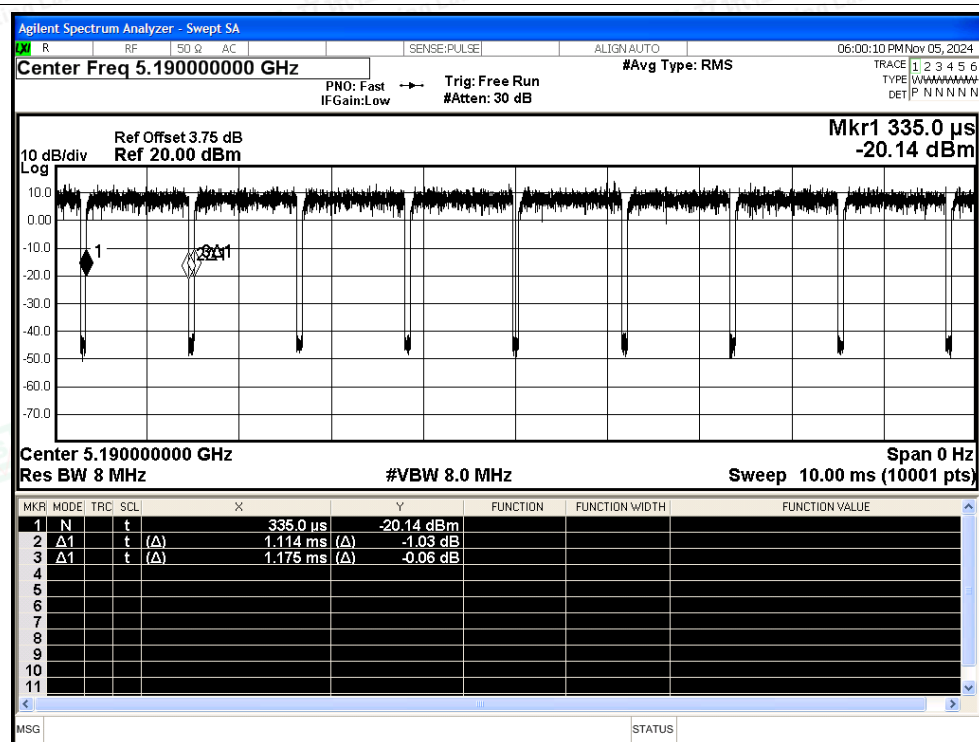

Duty Cycle NVNT ax40 5230MHz Ant2

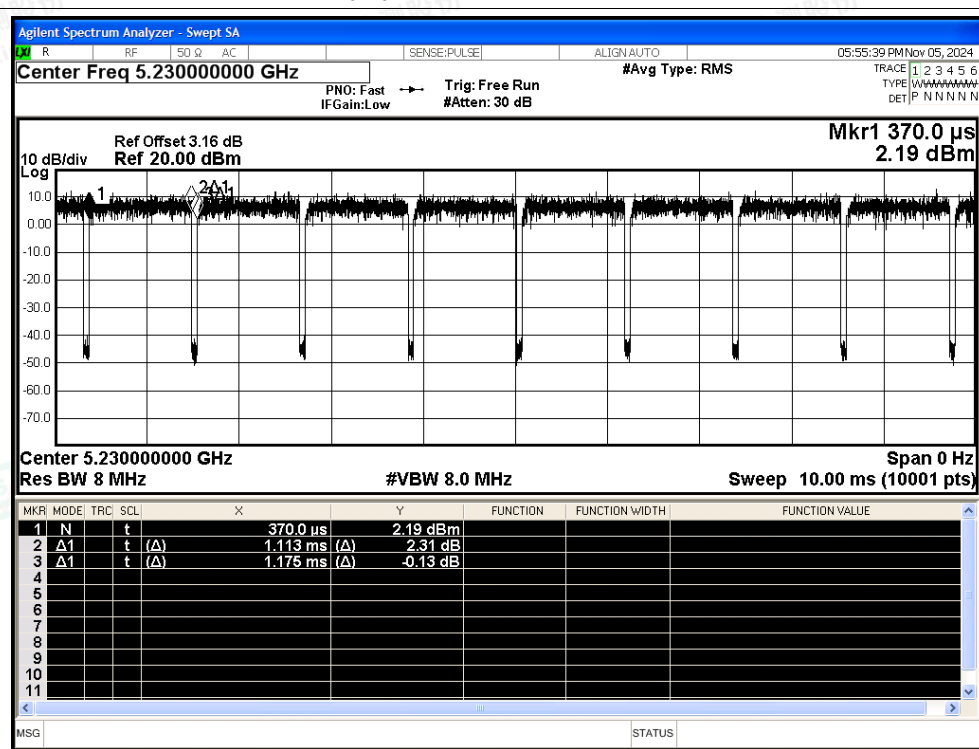

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity