





Restrict Band NVNT ac20 5260MHz Ant2 Peak

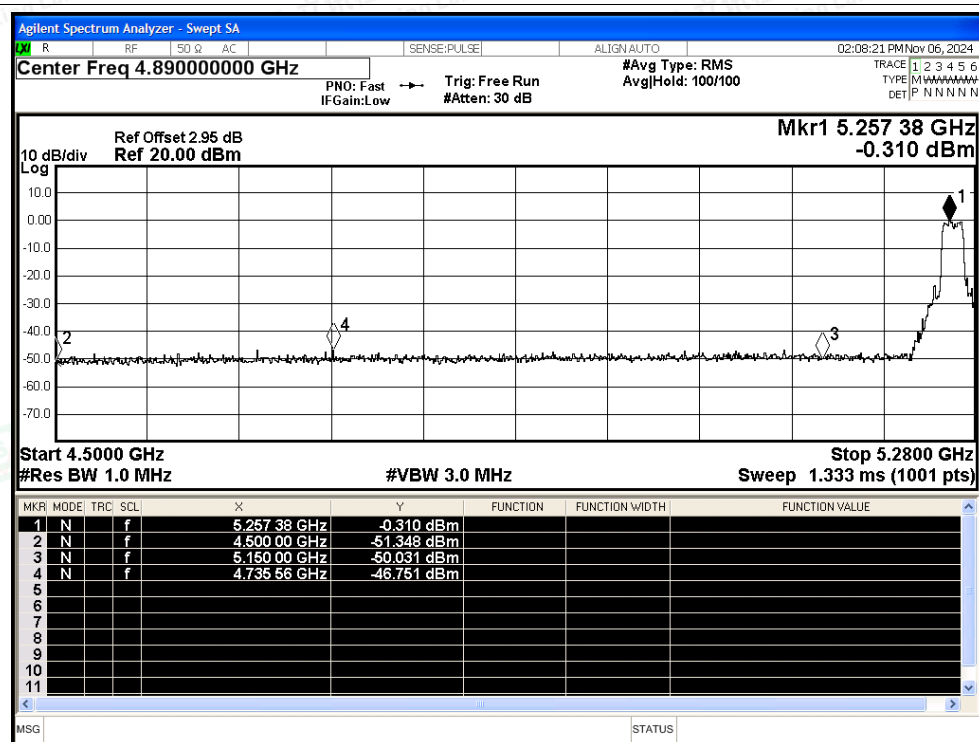

Restrict Band NVNT ac20 5260MHz Ant2 Average

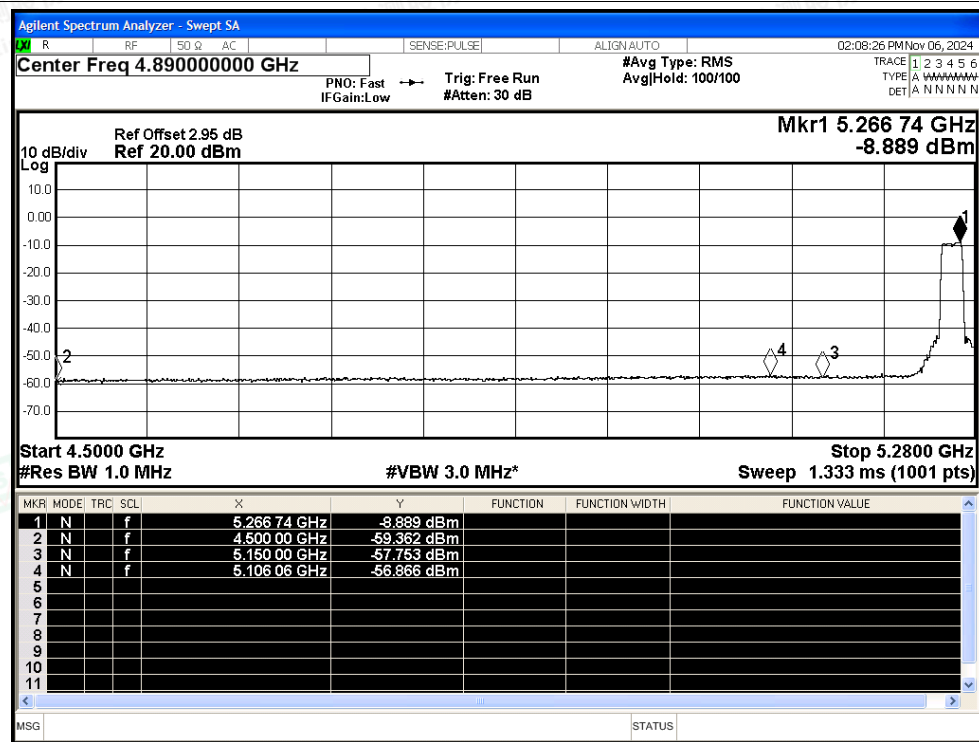

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

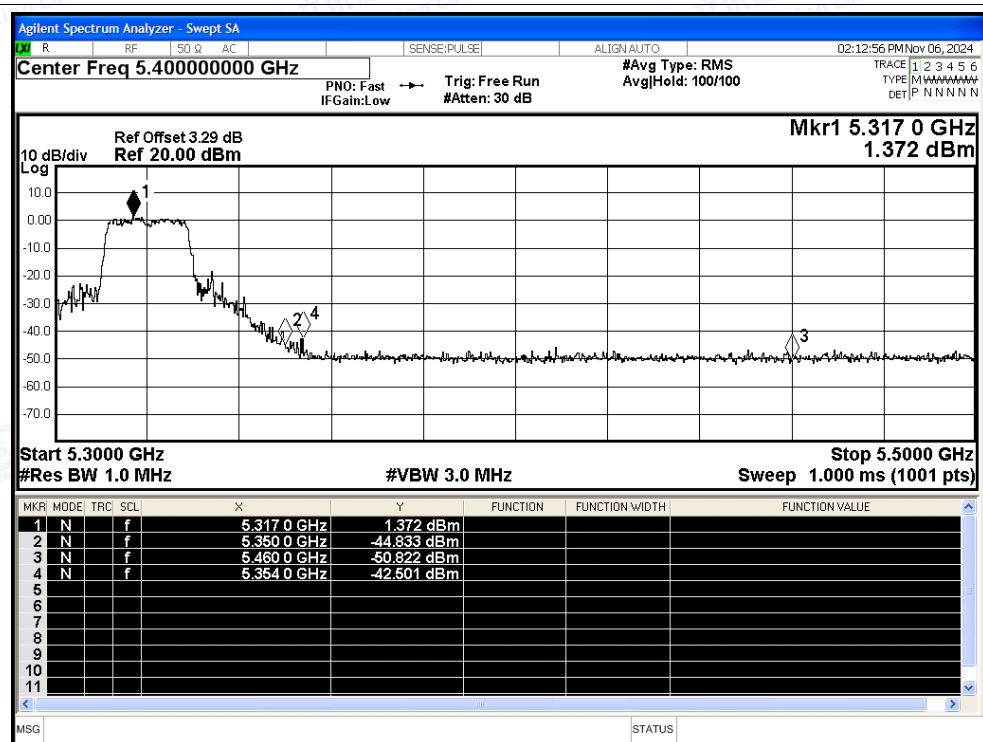

Restrict Band NVNT ac20 5320MHz Ant2 Average

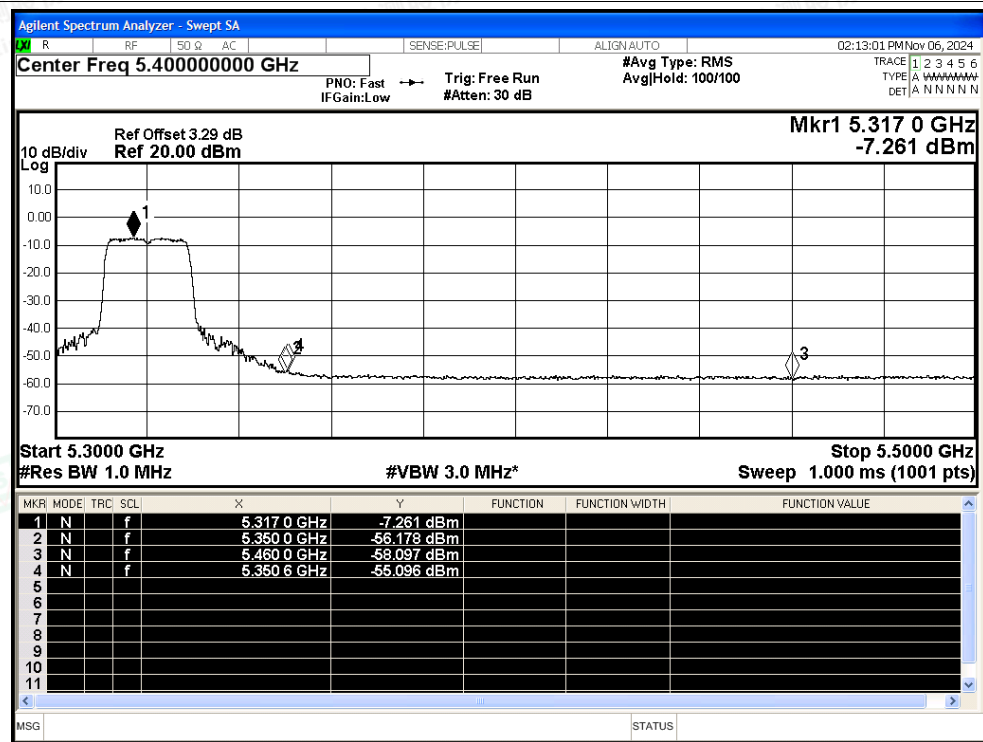

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

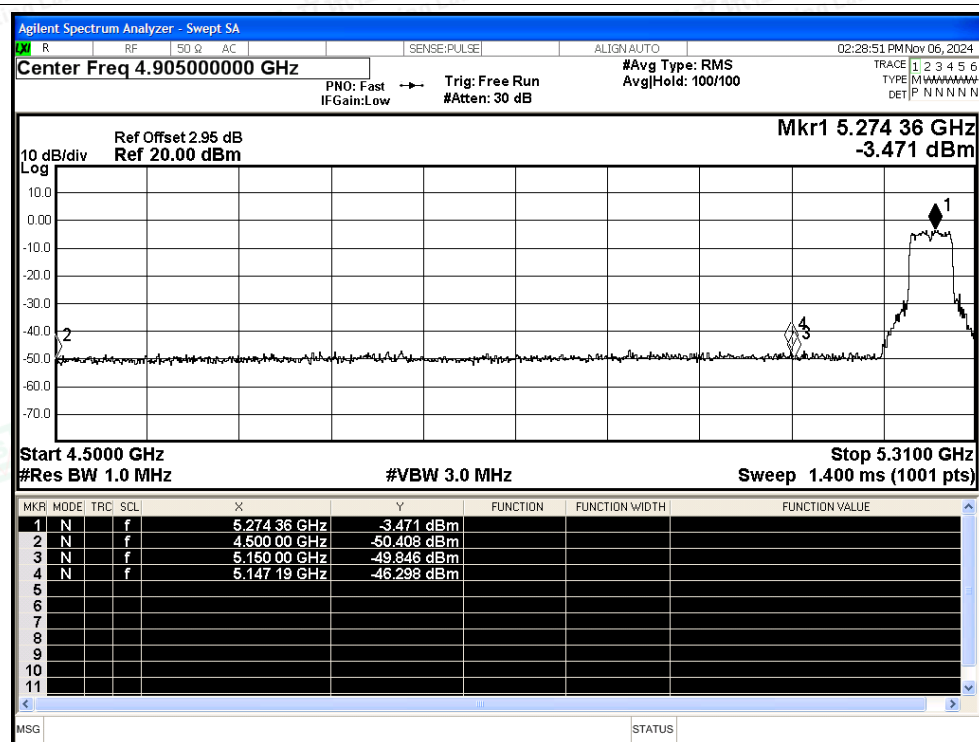

Restrict Band NVNT ac40 5270MHz Ant2 Average

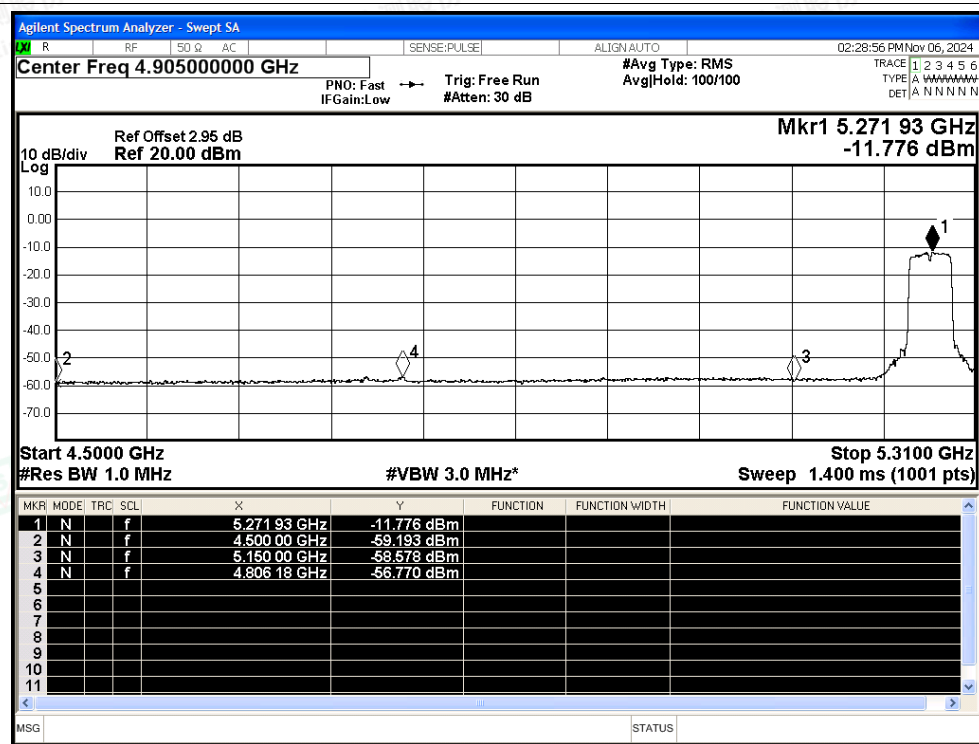

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

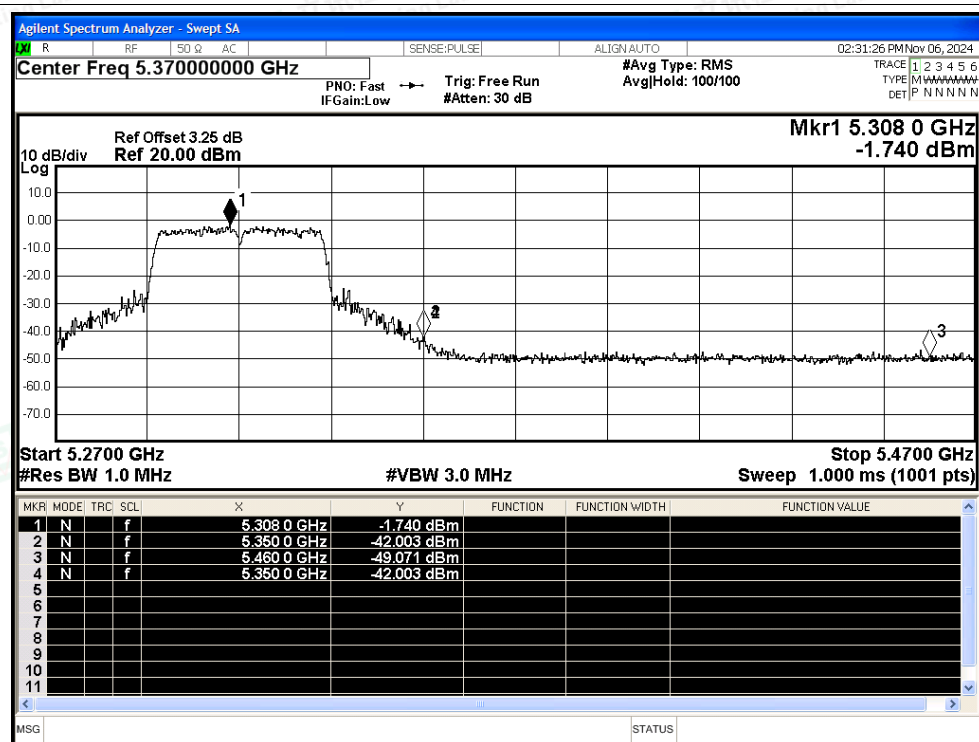

Restrict Band NVNT ac40 5310MHz Ant2 Average

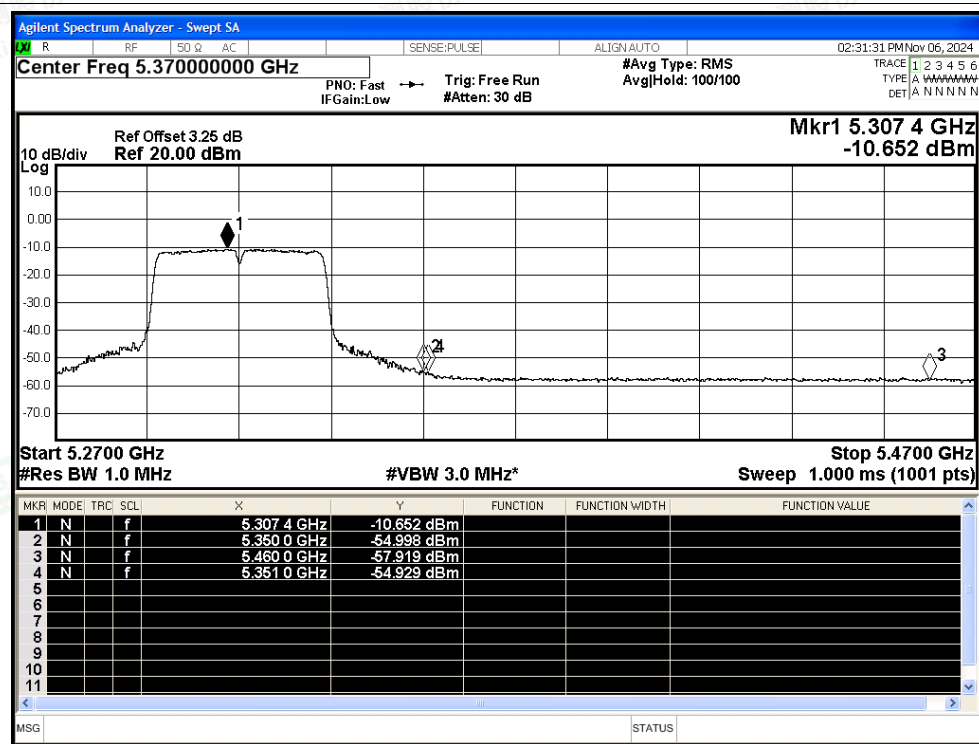

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant2 Peak

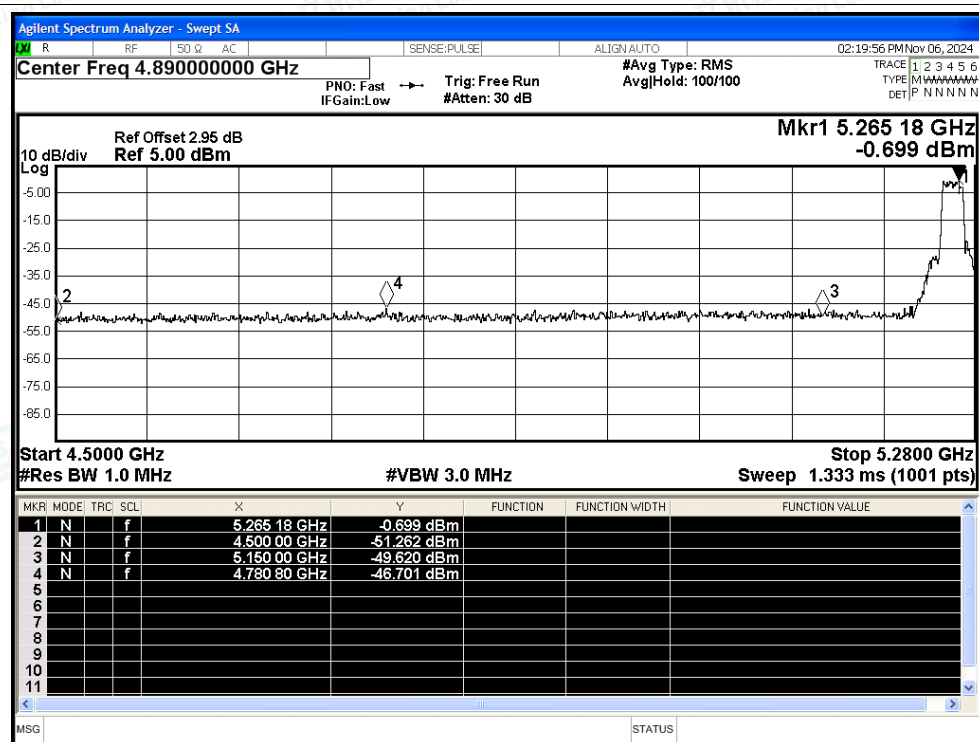

Restrict Band NVNT ax20 5260MHz Ant2 Average

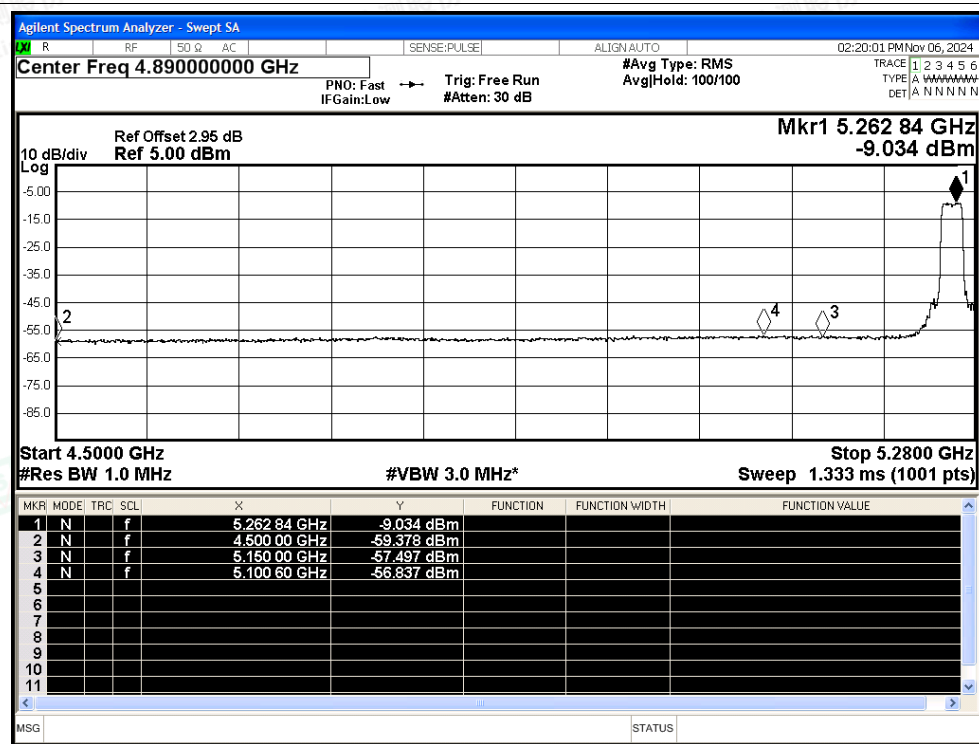

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant2 Peak

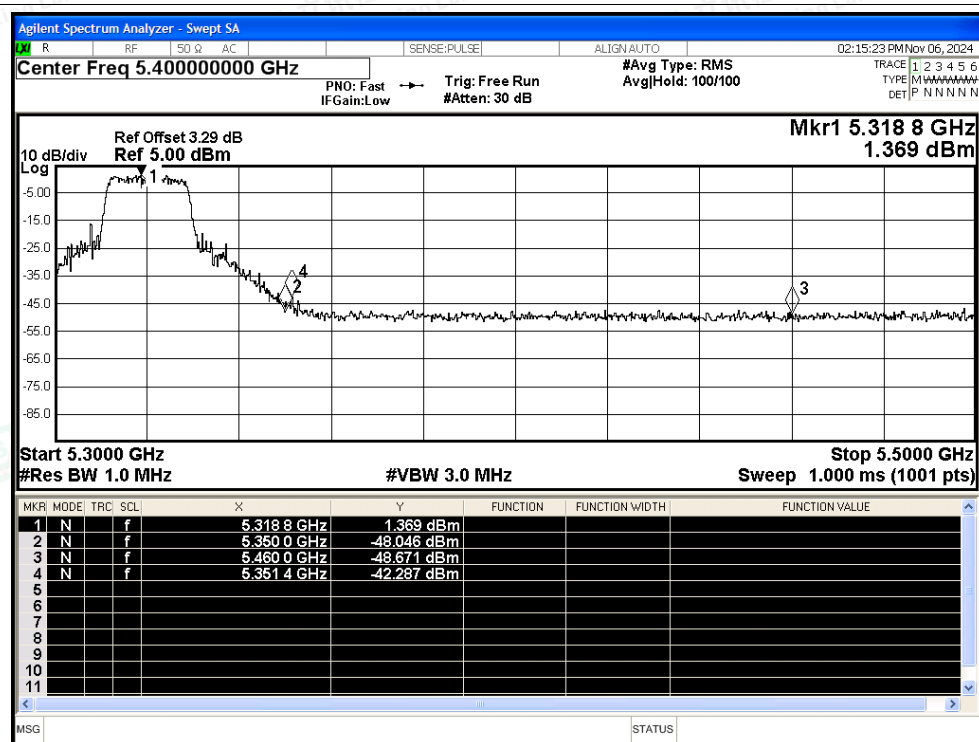

Restrict Band NVNT ax20 5320MHz Ant2 Average

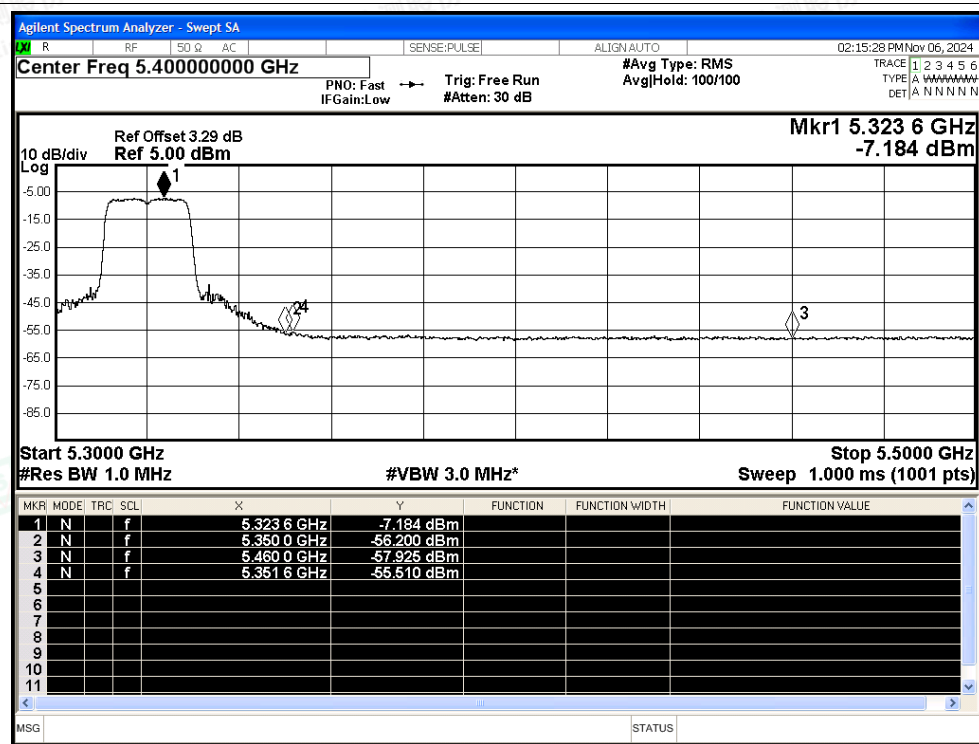

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant2 Peak

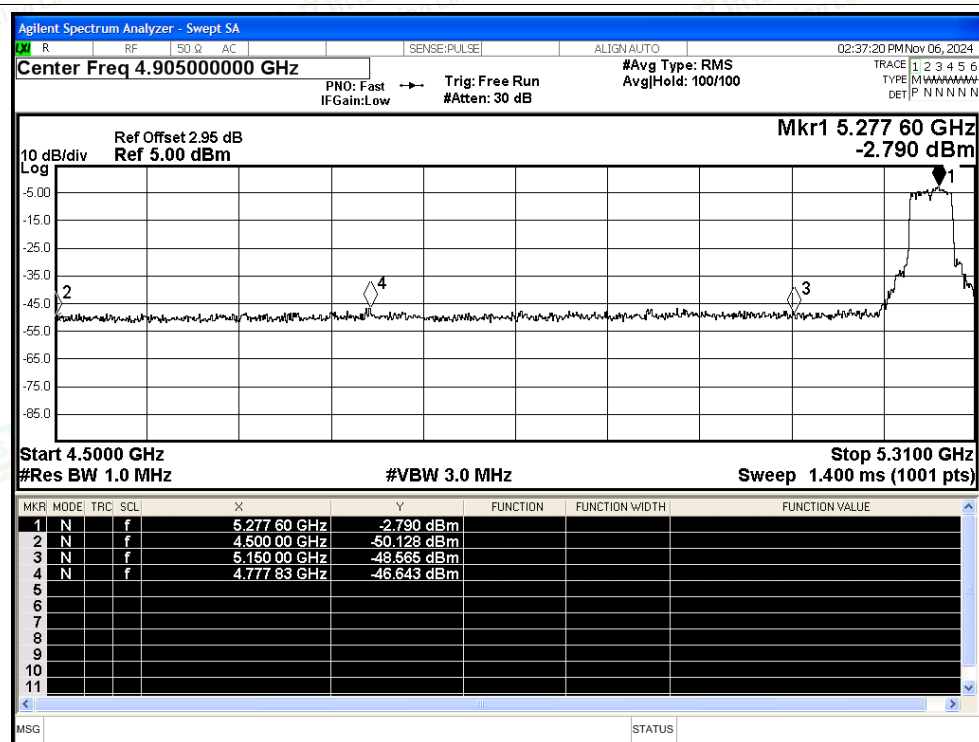

Restrict Band NVNT ax40 5270MHz Ant2 Average

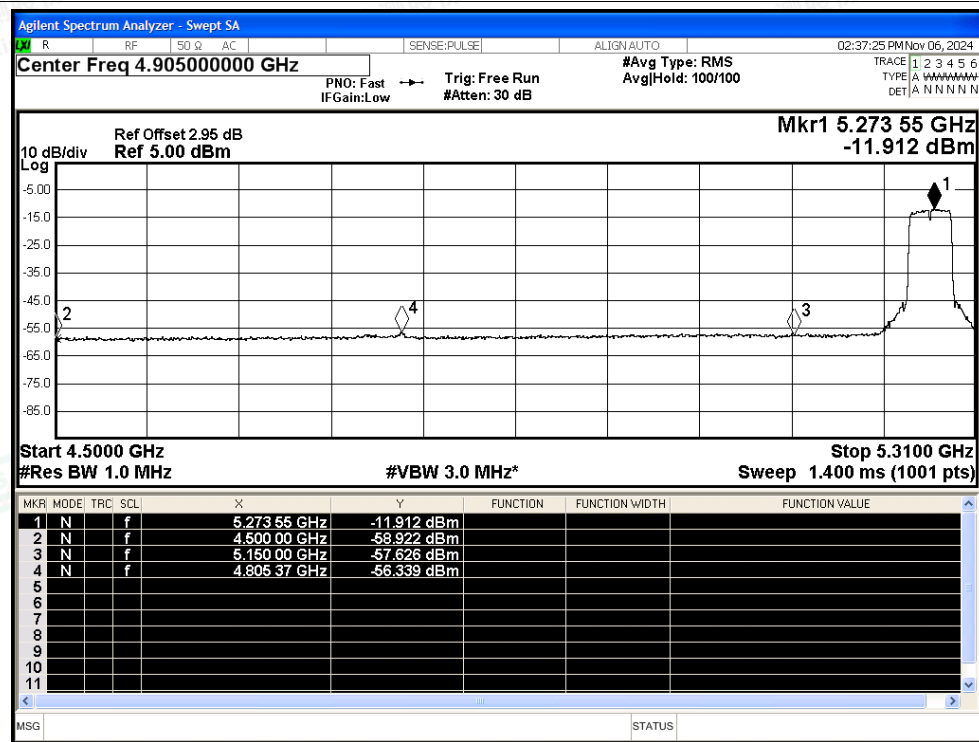

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant2 Peak

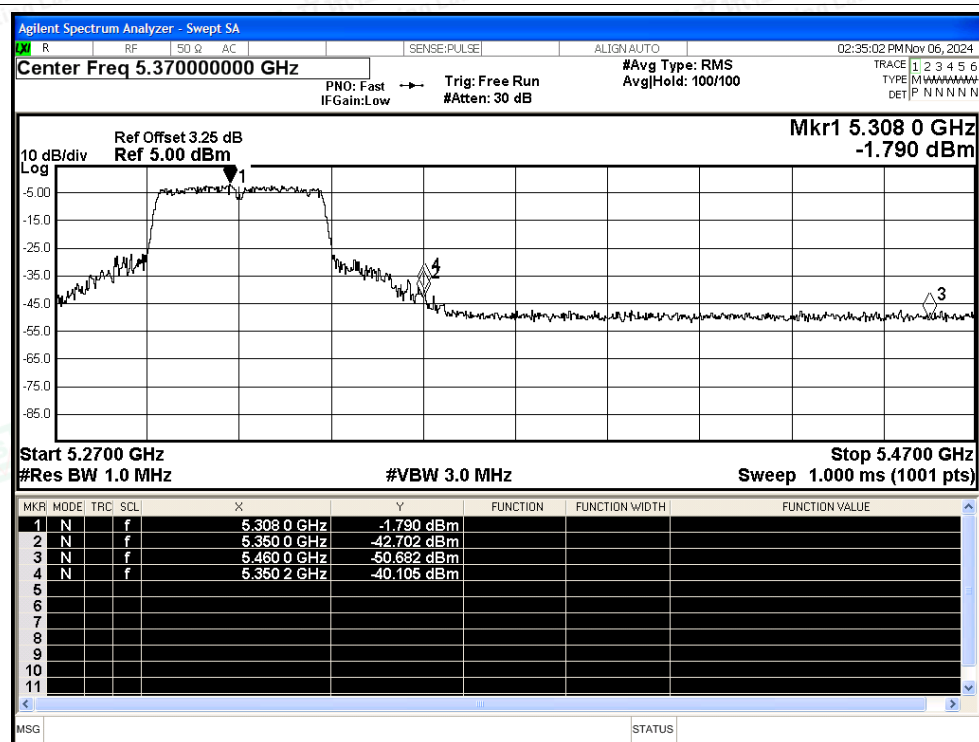

Restrict Band NVNT ax40 5310MHz Ant2 Average

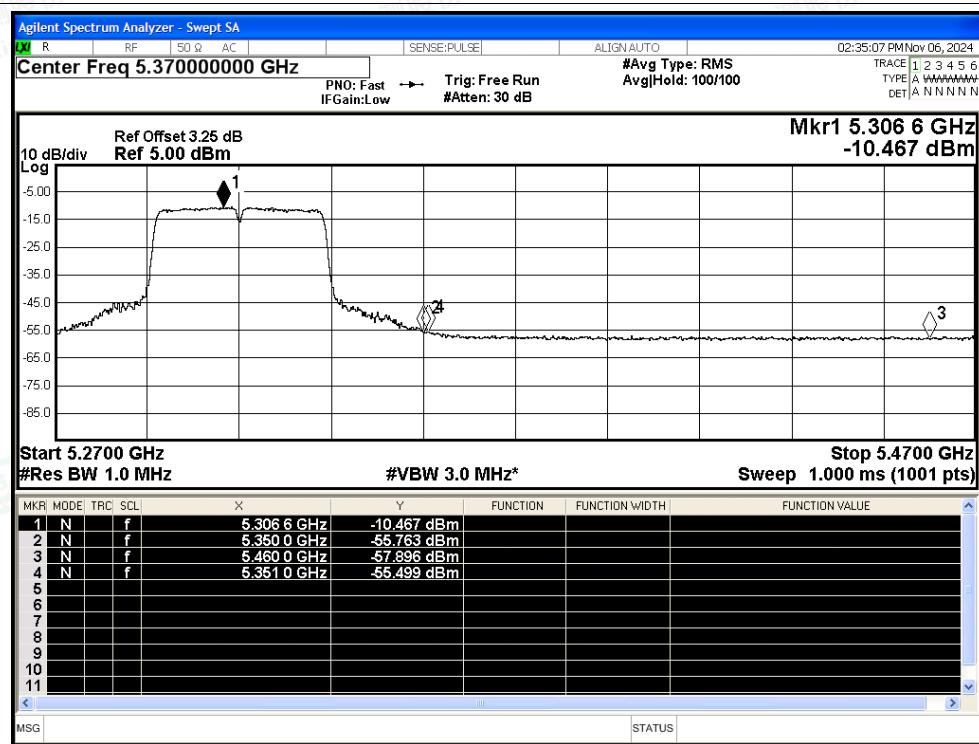

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Ant 1 + Ant 2

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant1	Ant2	Ant1+ Ant2			
NVNT	a	5260	47.45	47.28	53.39	Peak	68.2	Pass
NVNT	a	5260	39.76	40.17	45.99	Average	54	Pass
NVNT	a	5260	52.55	52.76	58.68	Peak	68.2	Pass
NVNT	a	5260	44.07	42.34	49.27	Average	54	Pass
NVNT	a	5260	51.82	49.42	56.72	Peak	68.2	Pass
NVNT	a	5260	42.67	41.42	48.09	Average	54	Pass
NVNT	a	5320	51.33	51.48	57.43	Peak	68.2	Pass
NVNT	a	5320	42.73	42.3	48.54	Average	54	Pass
NVNT	a	5320	54.43	55.05	60.77	Peak	68.2	Pass
NVNT	a	5320	42.77	42.67	48.74	Average	54	Pass
NVNT	a	5320	49.72	48.84	55.31	Peak	68.2	Pass
NVNT	a	5320	41.22	40.82	47.04	Average	54	Pass
NVNT	n20	5260	48.24	48.29	54.29	Peak	68.2	Pass
NVNT	n20	5260	40.51	40.1	46.33	Average	54	Pass
NVNT	n20	5260	52.56	51.95	58.28	Peak	68.2	Pass
NVNT	n20	5260	42.6	42.15	48.40	Average	54	Pass
NVNT	n20	5260	49.31	49.84	55.60	Peak	68.2	Pass
NVNT	n20	5260	42.44	41.76	48.13	Average	54	Pass
NVNT	n20	5320	57.43	55.67	62.62	Peak	68.2	Pass
NVNT	n20	5320	43.45	43.57	49.53	Average	54	Pass
NVNT	n20	5320	50.03	50.53	56.30	Peak	68.2	Pass
NVNT	n20	5320	41.57	41.46	47.54	Average	54	Pass
NVNT	n40	5270	48.4	48.04	54.24	Peak	68.2	Pass
NVNT	n40	5270	40.14	39.98	46.08	Average	54	Pass
NVNT	n40	5270	52.28	51.52	57.93	Peak	68.2	Pass
NVNT	n40	5270	42.67	42.14	48.43	Average	54	Pass
NVNT	n40	5270	48.58	49.63	55.14	Peak	68.2	Pass
NVNT	n40	5270	41.59	41.57	47.60	Average	54	Pass
NVNT	n40	5310	56.03	55.05	61.57	Peak	68.2	Pass
NVNT	n40	5310	44.33	43.59	49.99	Average	54	Pass
NVNT	n40	5310	49.63	48.71	55.20	Peak	68.2	Pass
NVNT	n40	5310	41.15	41.38	47.29	Average	54	Pass
NVNT	ac20	5260	47.48	47.38	53.45	Peak	68.2	Pass
NVNT	ac20	5260	40.52	39.65	46.12	Average	54	Pass
NVNT	ac20	5260	52.66	51.98	58.35	Peak	68.2	Pass
NVNT	ac20	5260	42.59	42.14	48.39	Average	54	Pass
NVNT	ac20	5260	50.39	48.7	55.61	Peak	68.2	Pass
NVNT	ac20	5260	41.68	41.26	47.49	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5320	58.18	53.9	62.32	Peak	68.2	Pass
NVNT	ac20	5320	43.88	42.83	49.39	Average	54	Pass
NVNT	ac20	5320	59.08	56.23	63.79	Peak	68.2	Pass
NVNT	ac20	5320	44	43.91	49.98	Average	54	Pass
NVNT	ac20	5320	50.89	47.91	55.55	Peak	68.2	Pass
NVNT	ac20	5320	41.07	40.91	47.01	Average	54	Pass
NVNT	ac40	5270	48.49	48.32	54.43	Peak	68.2	Pass
NVNT	ac40	5270	40.08	39.78	45.95	Average	54	Pass
NVNT	ac40	5270	52.56	52.43	58.52	Peak	68.2	Pass
NVNT	ac40	5270	42.88	42.2	48.57	Average	54	Pass
NVNT	ac40	5270	48.65	48.88	54.79	Peak	68.2	Pass
NVNT	ac40	5270	41.45	40.39	46.96	Average	54	Pass
NVNT	ac40	5310	55.92	56.73	62.36	Peak	68.2	Pass
NVNT	ac40	5310	43.76	44.04	49.92	Average	54	Pass
NVNT	ac40	5310	50.36	49.66	56.04	Peak	68.2	Pass
NVNT	ac40	5310	41.74	41.05	47.42	Average	54	Pass
NVNT	ax20	5260	46.92	47.47	53.22	Peak	68.2	Pass
NVNT	ax20	5260	40.16	39.63	45.92	Average	54	Pass
NVNT	ax20	5260	52.75	52.03	58.42	Peak	68.2	Pass
NVNT	ax20	5260	42.64	42.17	48.43	Average	54	Pass
NVNT	ax20	5260	49.7	49.11	55.43	Peak	68.2	Pass
NVNT	ax20	5260	41.82	41.51	47.69	Average	54	Pass
NVNT	ax20	5320	55.72	50.68	59.58	Peak	68.2	Pass
NVNT	ax20	5320	43.46	42.81	49.16	Average	54	Pass
NVNT	ax20	5320	60.1	56.44	64.48	Peak	68.2	Pass
NVNT	ax20	5320	43.64	43.5	49.59	Average	54	Pass
NVNT	ax20	5320	49.68	50.06	55.89	Peak	68.2	Pass
NVNT	ax20	5320	41.21	41.08	47.17	Average	54	Pass
NVNT	ax40	5270	48.03	48.6	54.34	Peak	68.2	Pass
NVNT	ax40	5270	40.14	40.05	46.12	Average	54	Pass
NVNT	ax40	5270	52.2	52.09	58.17	Peak	68.2	Pass
NVNT	ax40	5270	42.82	42.63	48.75	Average	54	Pass
NVNT	ax40	5270	48.77	50.16	55.51	Peak	68.2	Pass
NVNT	ax40	5270	41.48	41.34	47.43	Average	54	Pass
NVNT	ax40	5310	55.96	56.03	62.02	Peak	68.2	Pass
NVNT	ax40	5310	43.94	43.21	49.60	Average	54	Pass
NVNT	ax40	5310	57.74	58.63	64.22	Peak	68.2	Pass
NVNT	ax40	5310	44.46	43.47	50.00	Average	54	Pass
NVNT	ax40	5310	48.62	48.05	54.36	Peak	68.2	Pass
NVNT	ax40	5310	41.39	41.07	47.25	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5260	0	0	25	Pass
NVNT	a	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant1	5320	0	0	25	Pass
NVNT	n20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant1	5320	0	0	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant1	5300	0	0	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ax20	5260	Ant1	5260	0	0	25	Pass
NVNT	ax20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant1	5320	0	0	25	Pass
NVNT	ax40	5270	Ant1	5270	0	0	25	Pass
NVNT	ax40	5310	Ant1	5309.96	-40000	-7.53	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

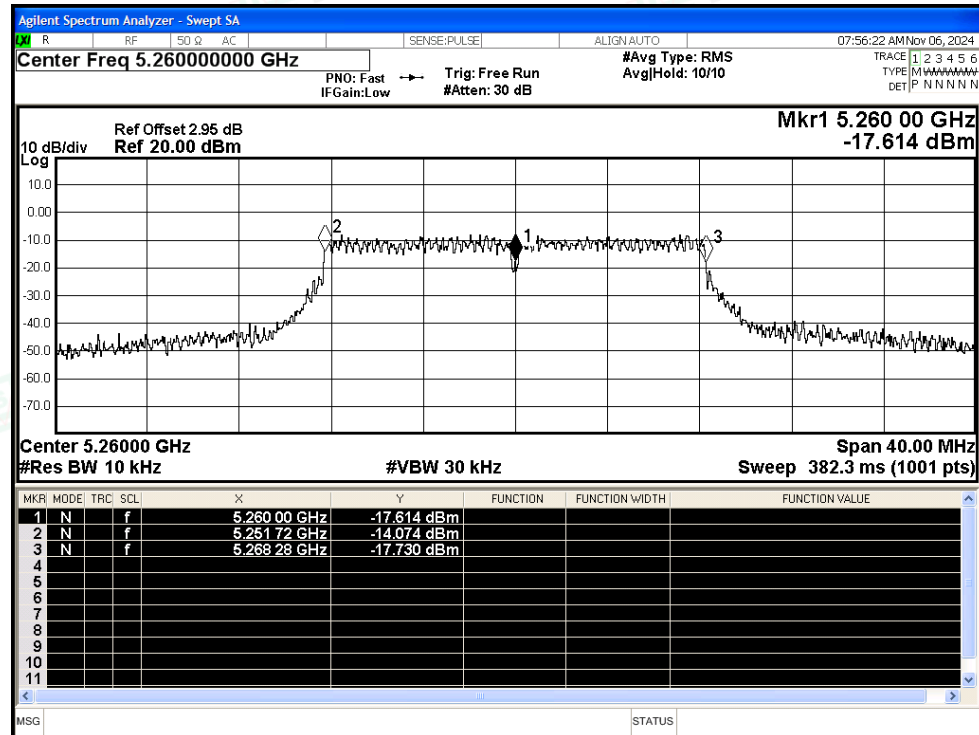


Freq. Stability NVNT a 5300MHz Ant1

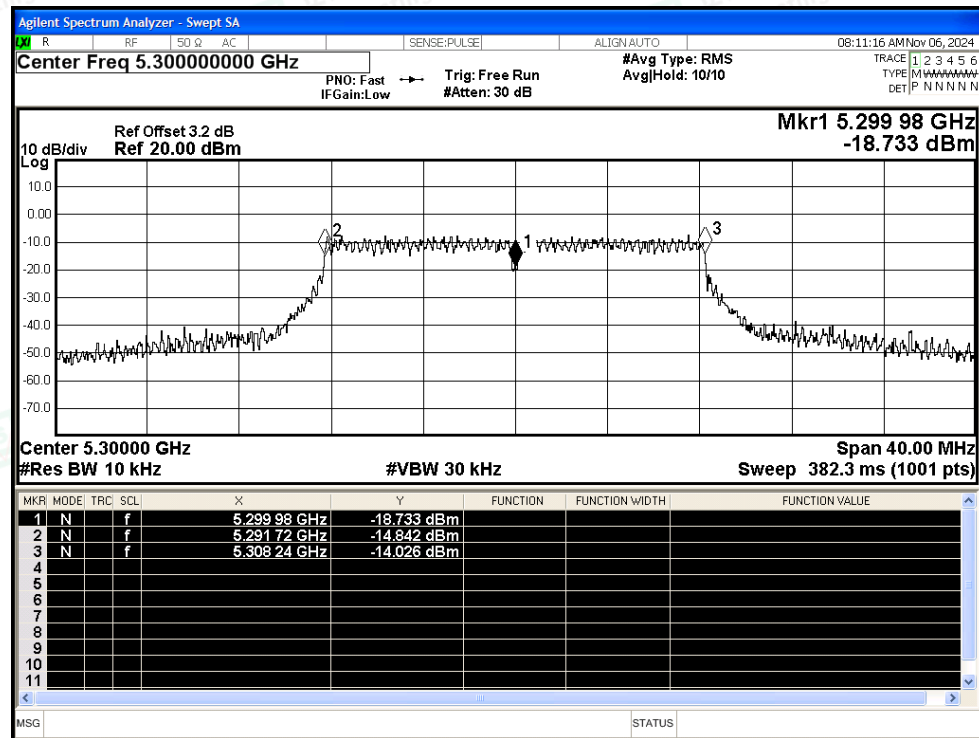




Freq. Stability NVNT a 5320MHz Ant1

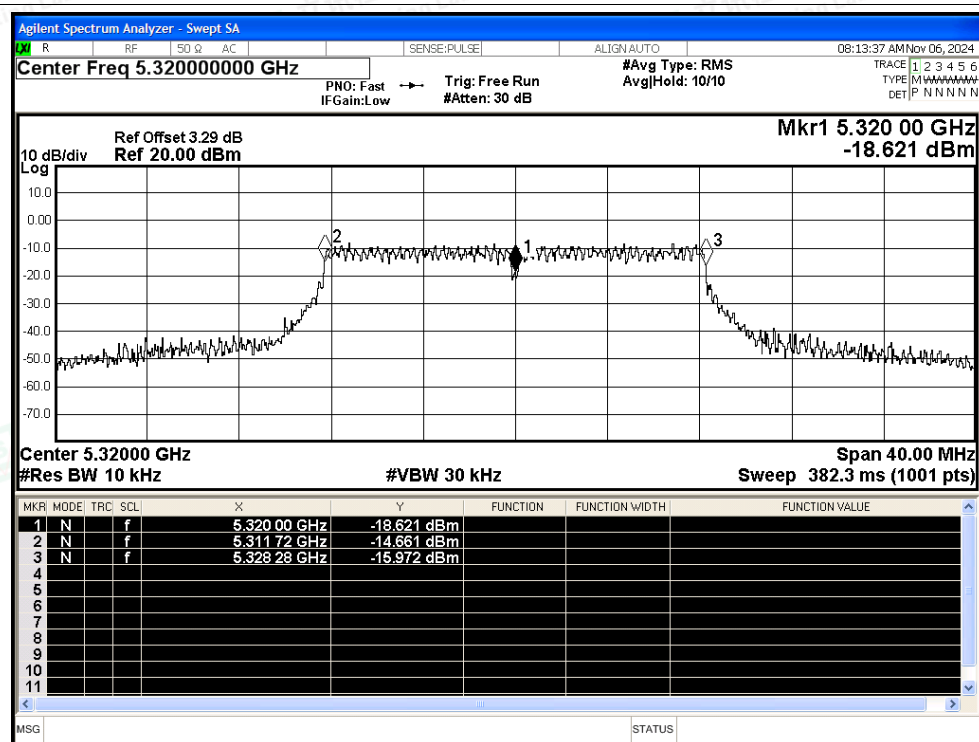

Freq. Stability NVNT n20 5260MHz Ant1

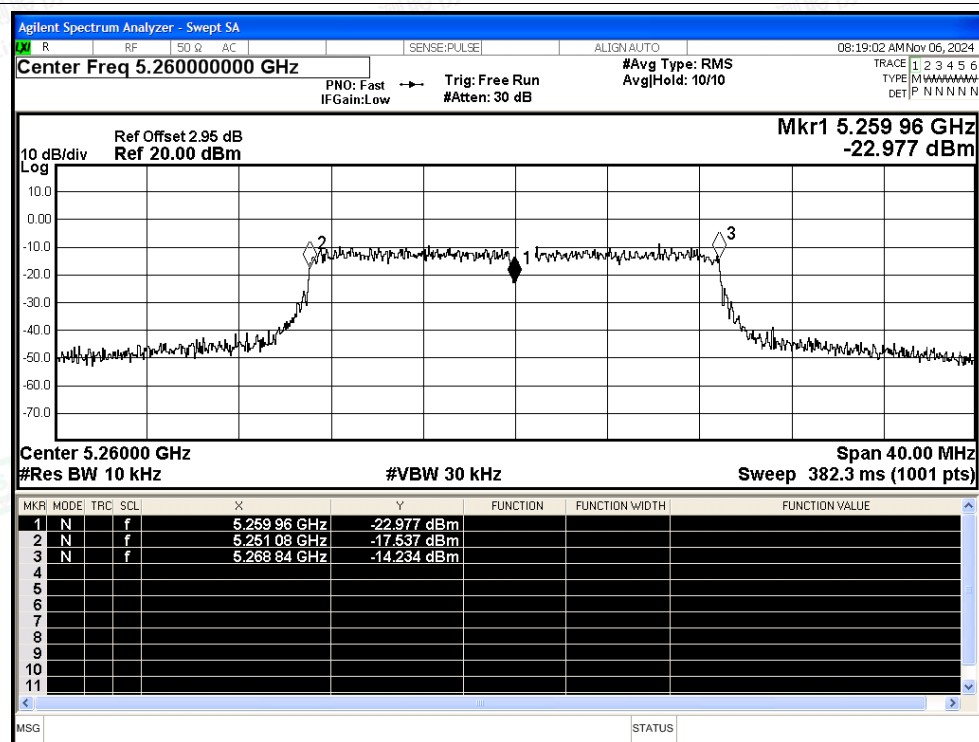

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

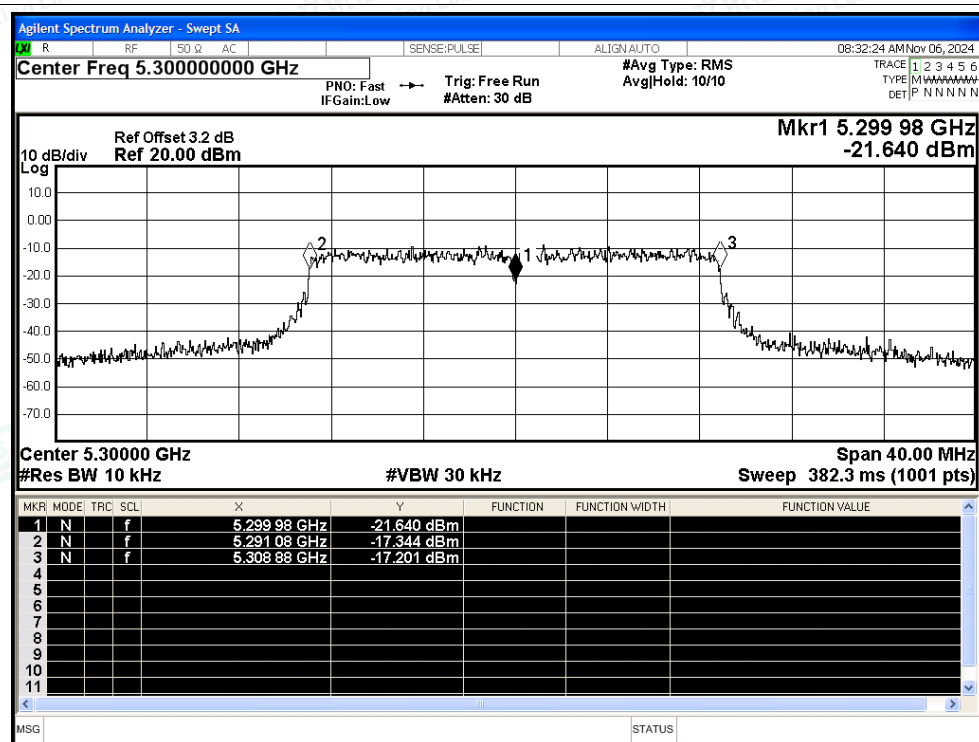

Freq. Stability NVNT n20 5320MHz Ant1

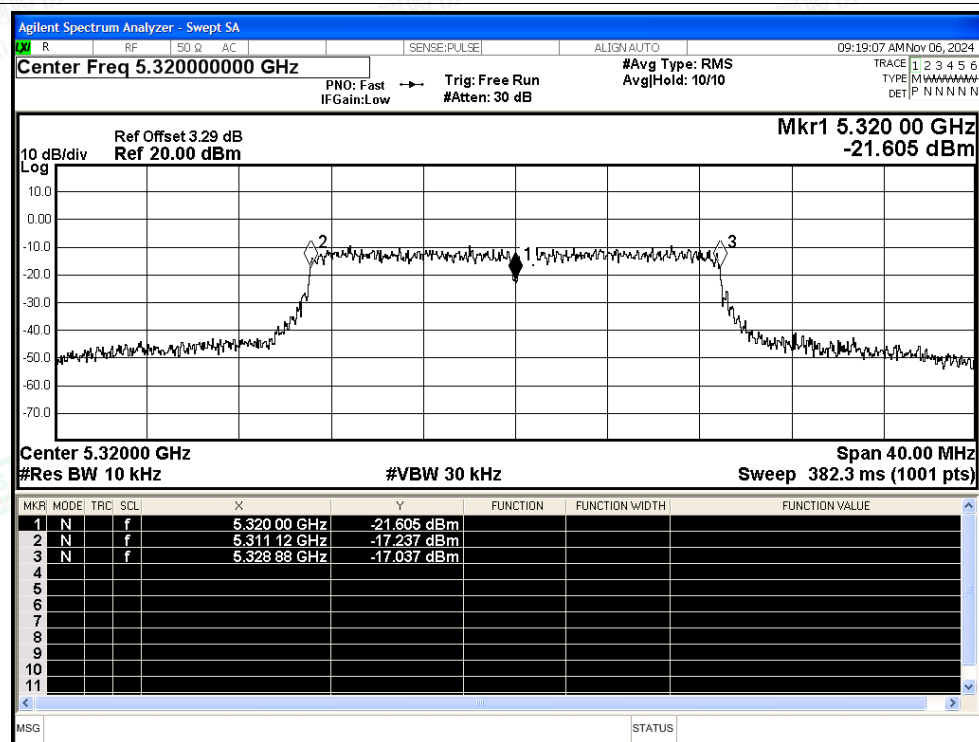

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

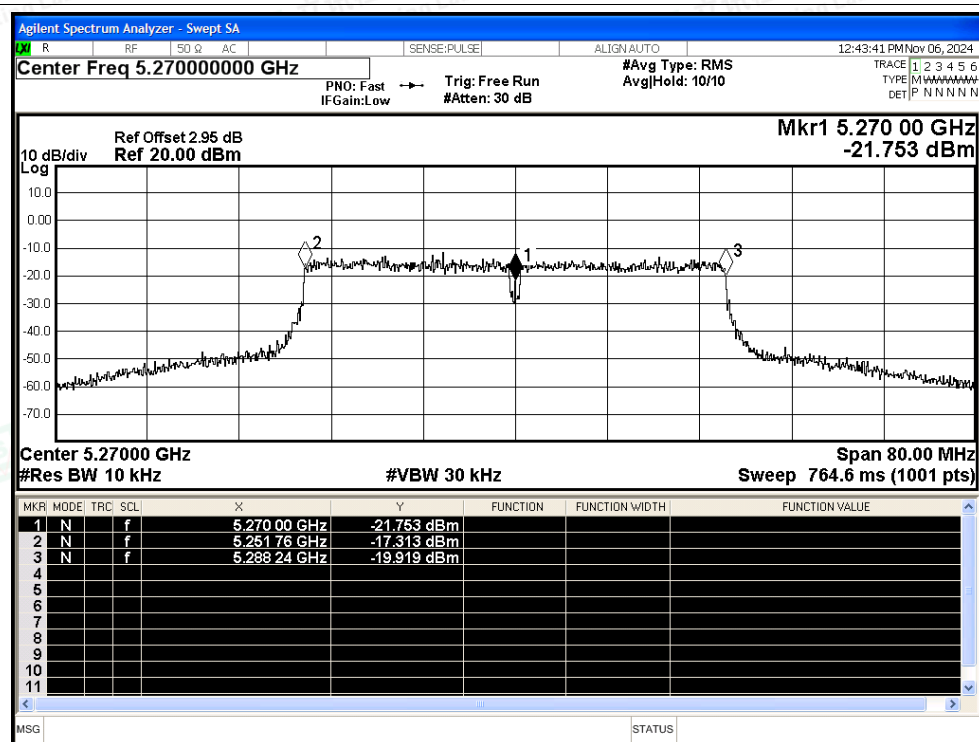

Freq. Stability NVNT n40 5310MHz Ant1

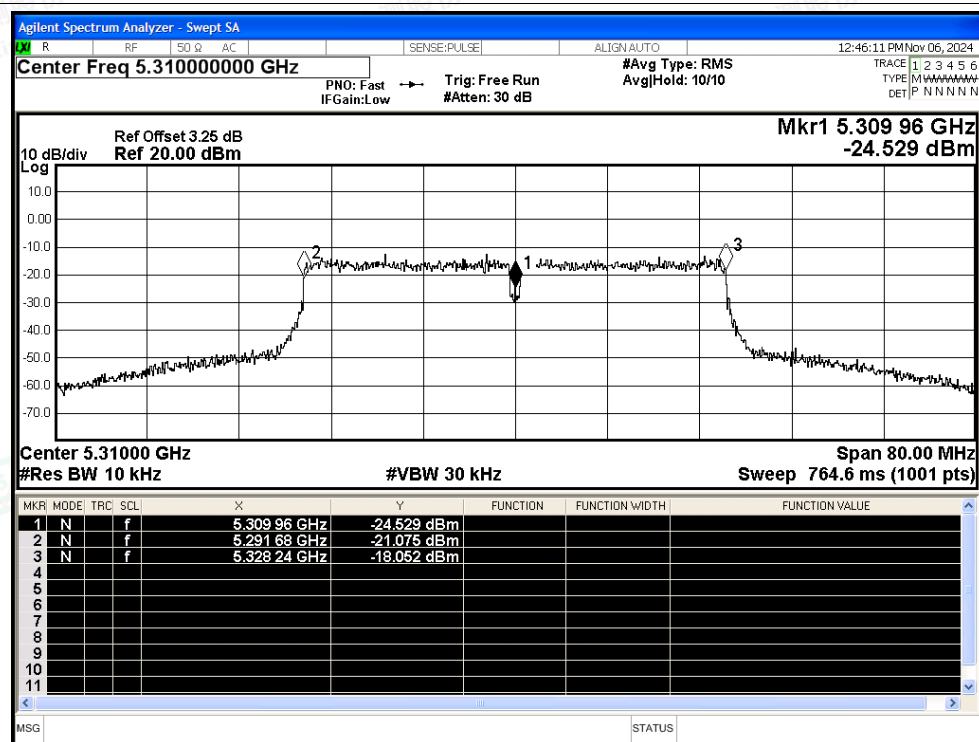

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

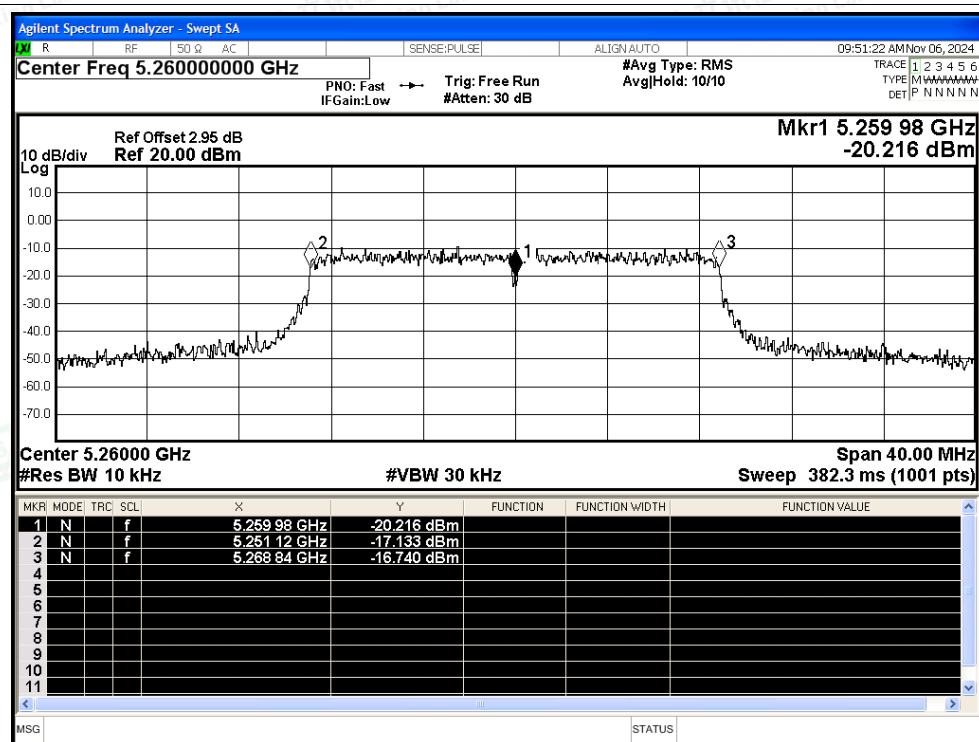

Freq. Stability NVNT ac20 5300MHz Ant1

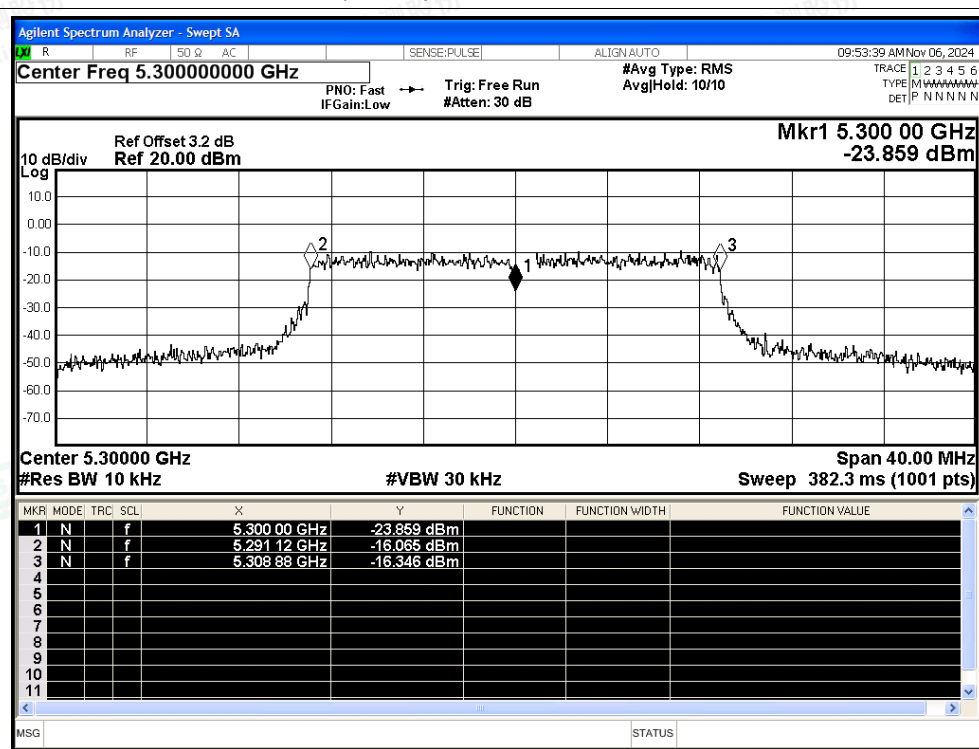

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

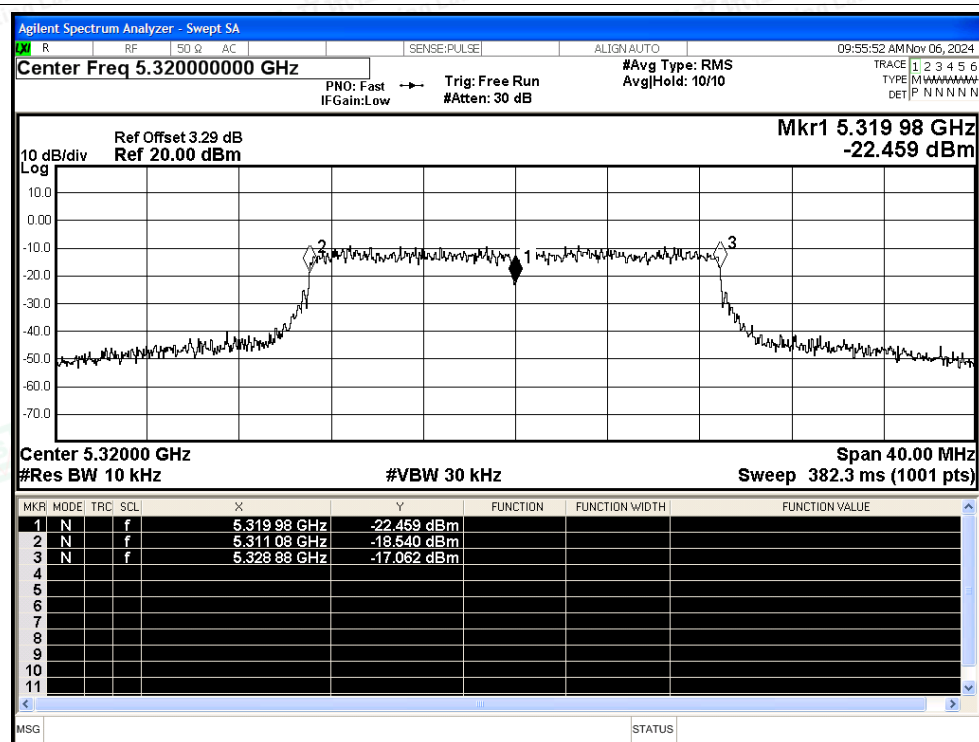

Freq. Stability NVNT ac40 5270MHz Ant1

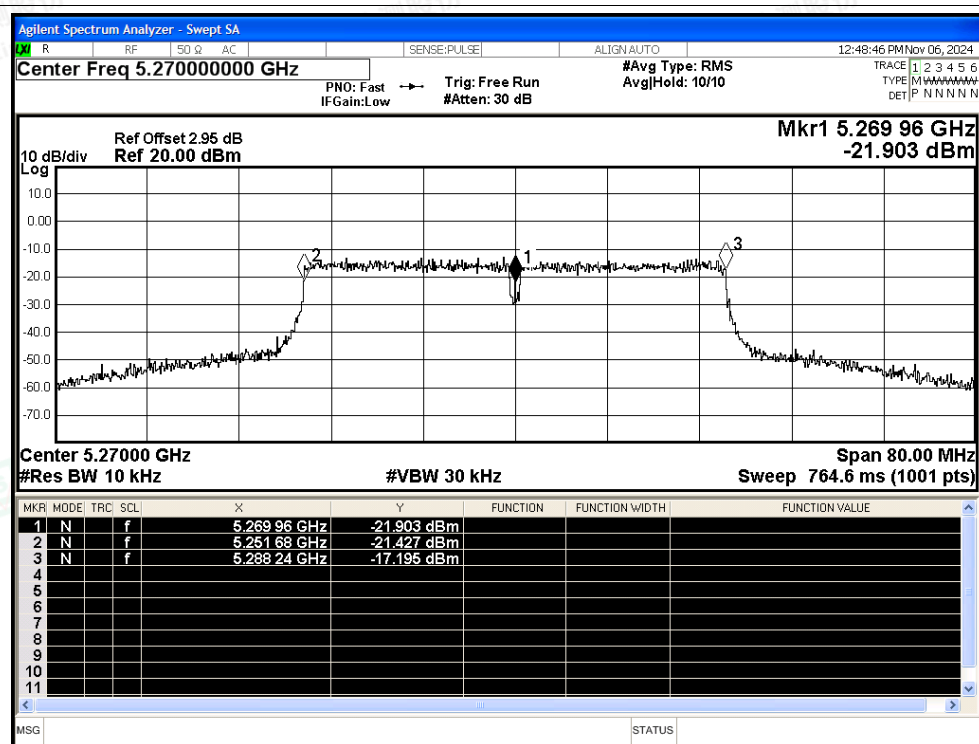

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

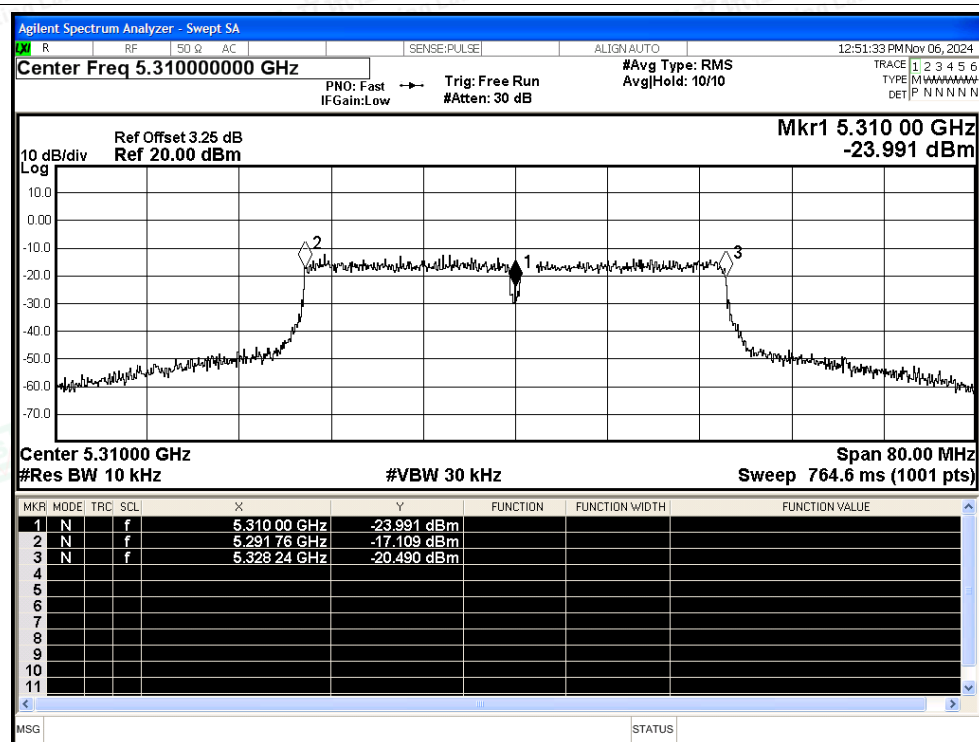


Freq. Stability NVNT ax20 5260MHz Ant1

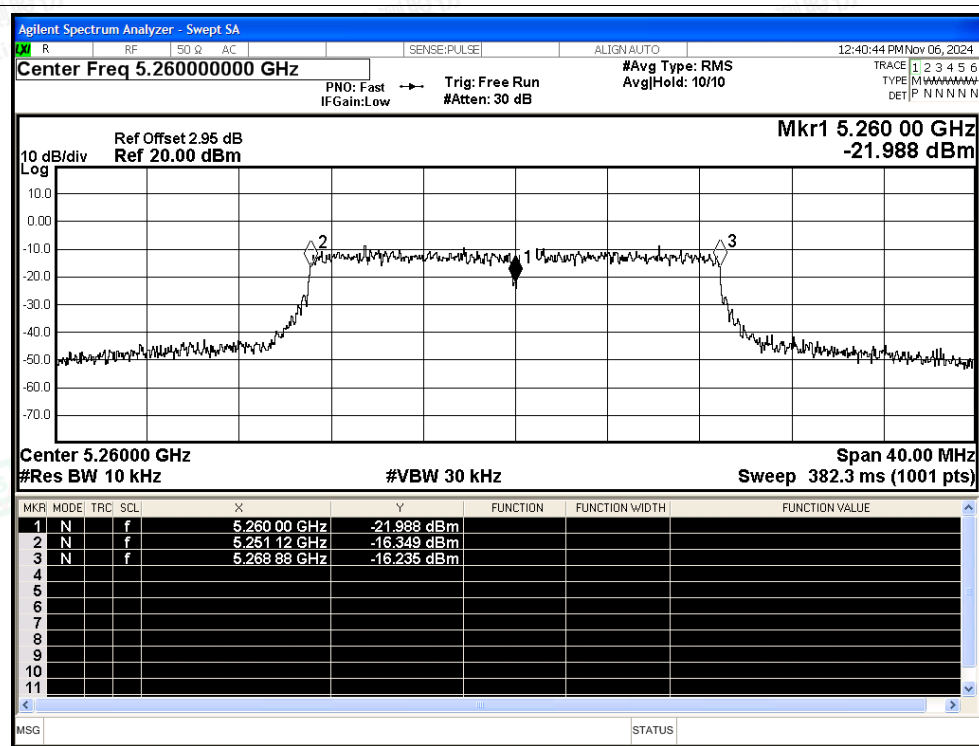




Freq. Stability NVNT ax20 5300MHz Ant1

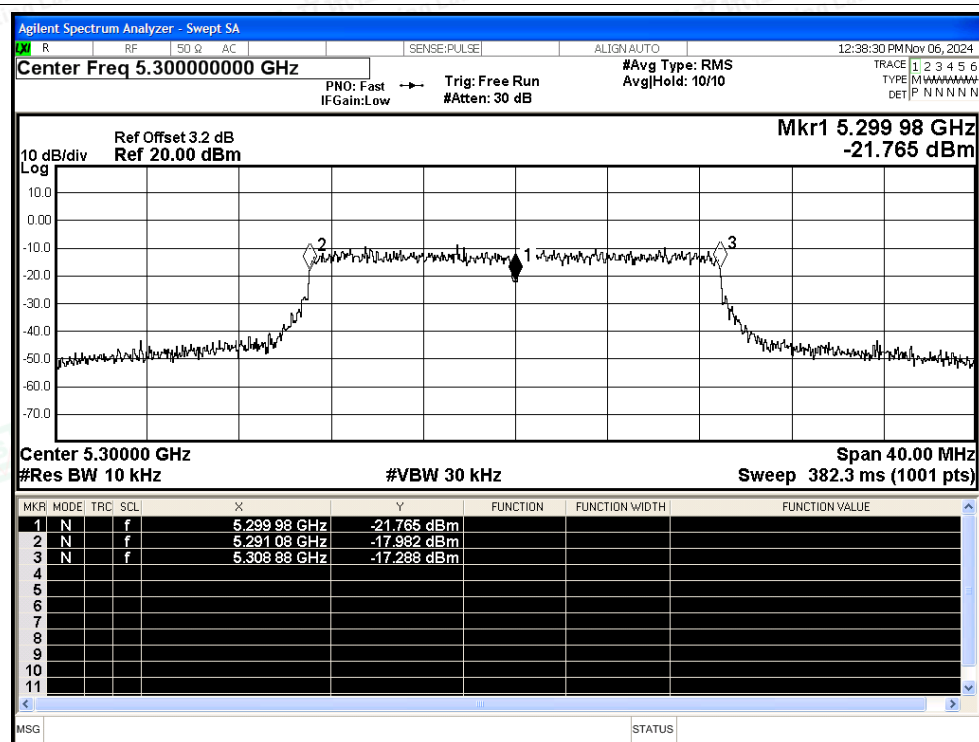

Freq. Stability NVNT ax20 5320MHz Ant1

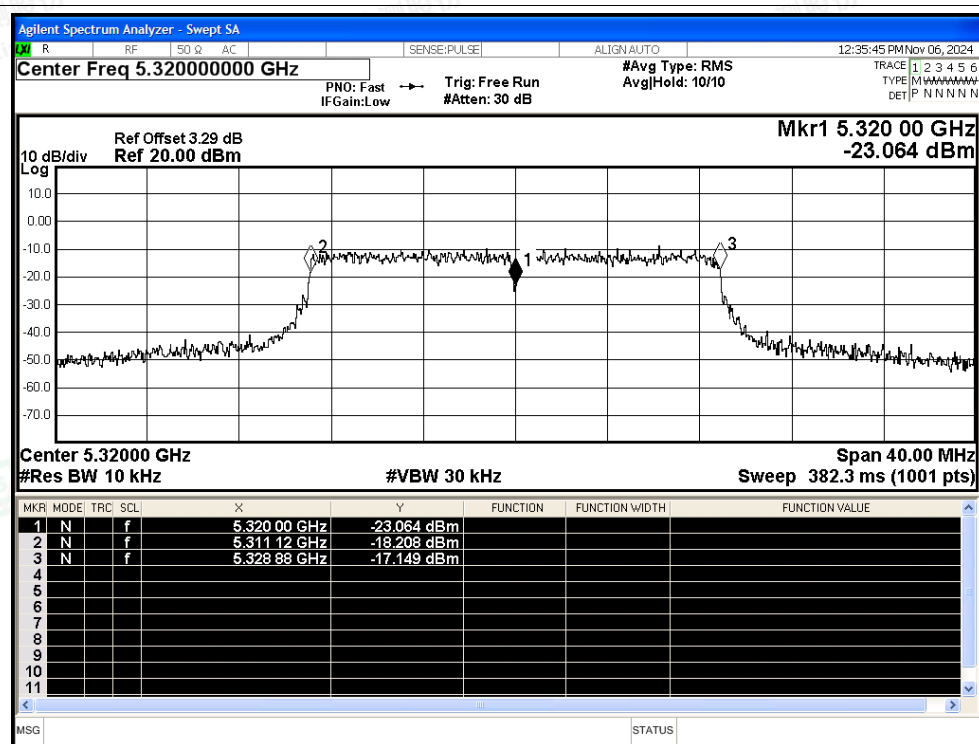

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5270MHz Ant1

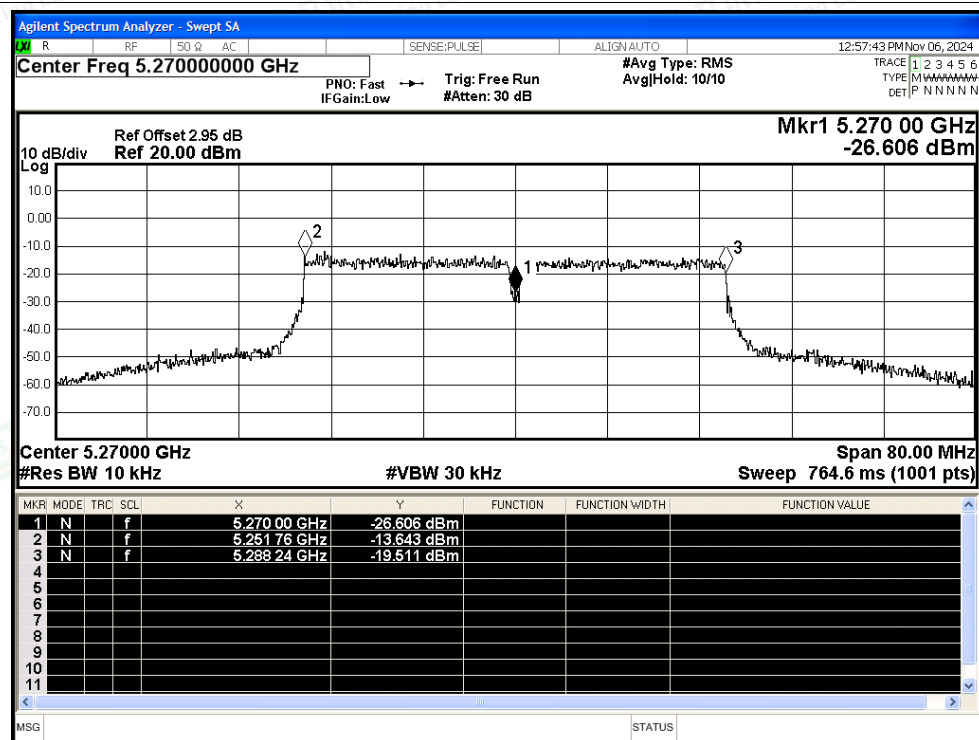

Freq. Stability NVNT ax40 5310MHz Ant1

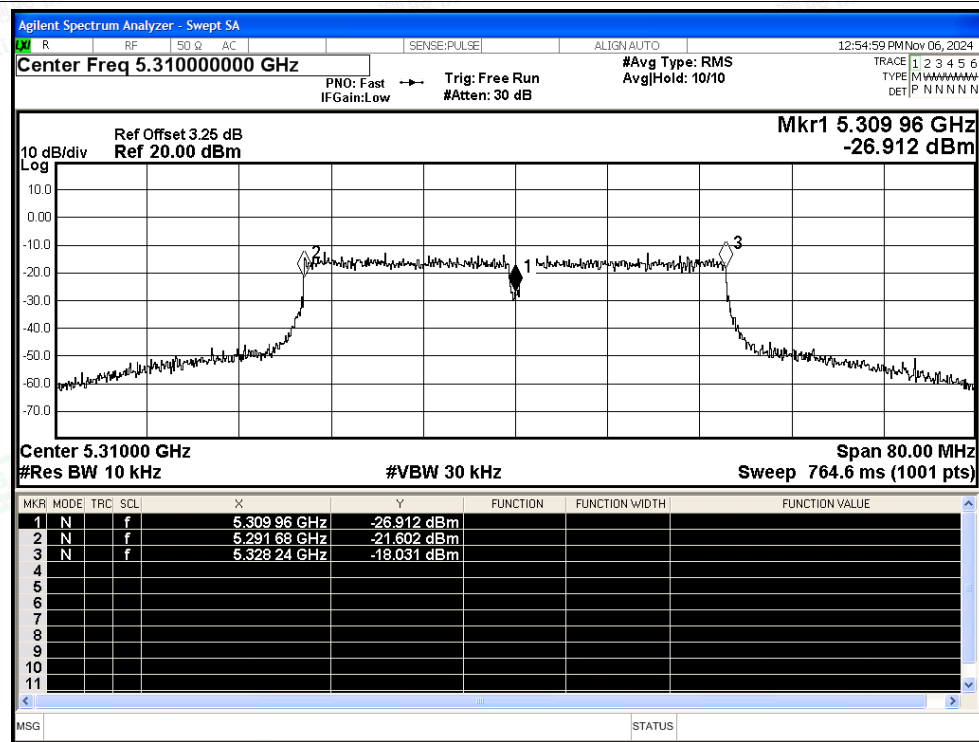




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5300	Ant2	5300	0	0	25	Pass
NVNT	a	5320	Ant2	5320	0	0	25	Pass
NVNT	n20	5260	Ant2	5260	0	0	25	Pass
NVNT	n20	5300	Ant2	5300	0	0	25	Pass
NVNT	n20	5320	Ant2	5320	0	0	25	Pass
NVNT	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5260	0	0	25	Pass
NVNT	ac20	5300	Ant2	5300	0	0	25	Pass
NVNT	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ax20	5260	Ant2	5260	0	0	25	Pass
NVNT	ax20	5300	Ant2	5300.02	20000	3.77	25	Pass
NVNT	ax20	5320	Ant2	5320	0	0	25	Pass
NVNT	ax40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant2	5310	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

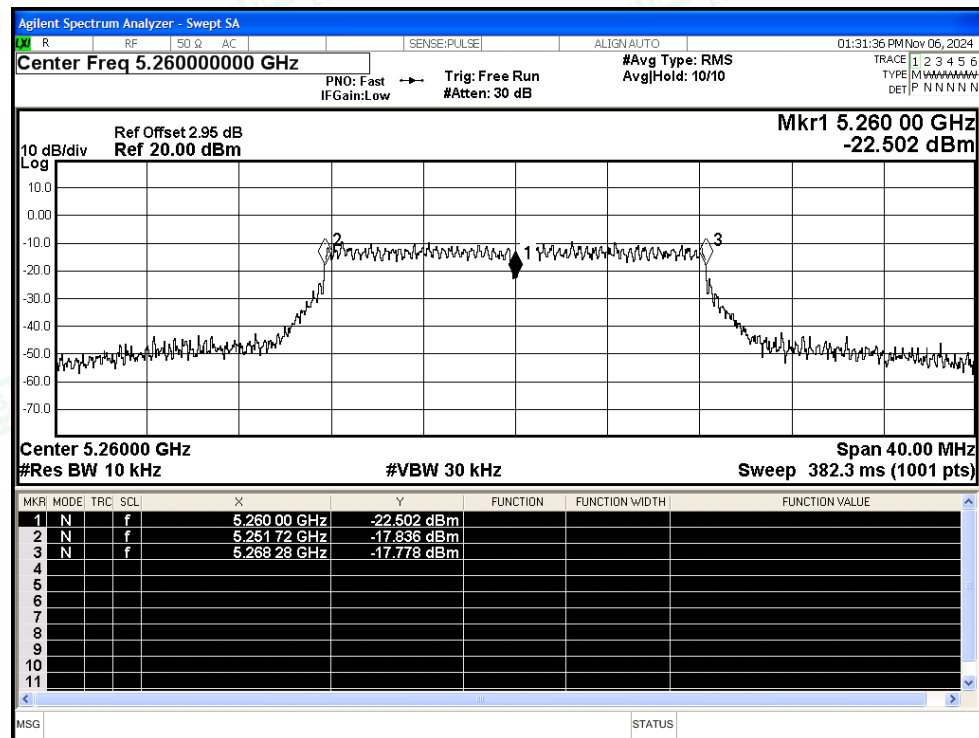

Freq. Stability NVNT a 5300MHz Ant2

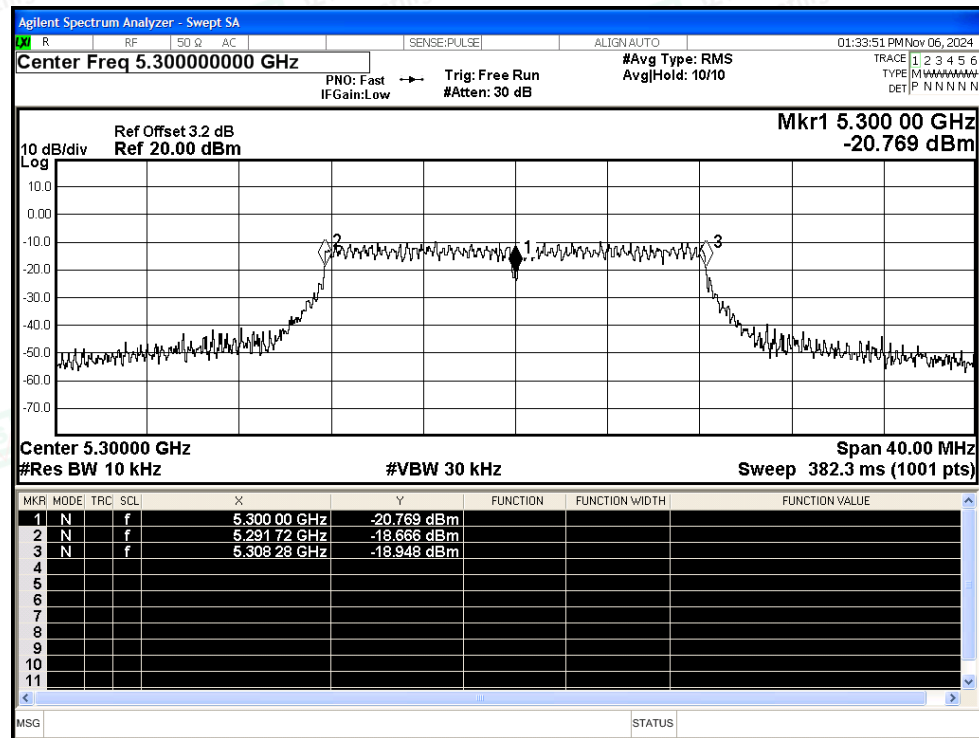

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

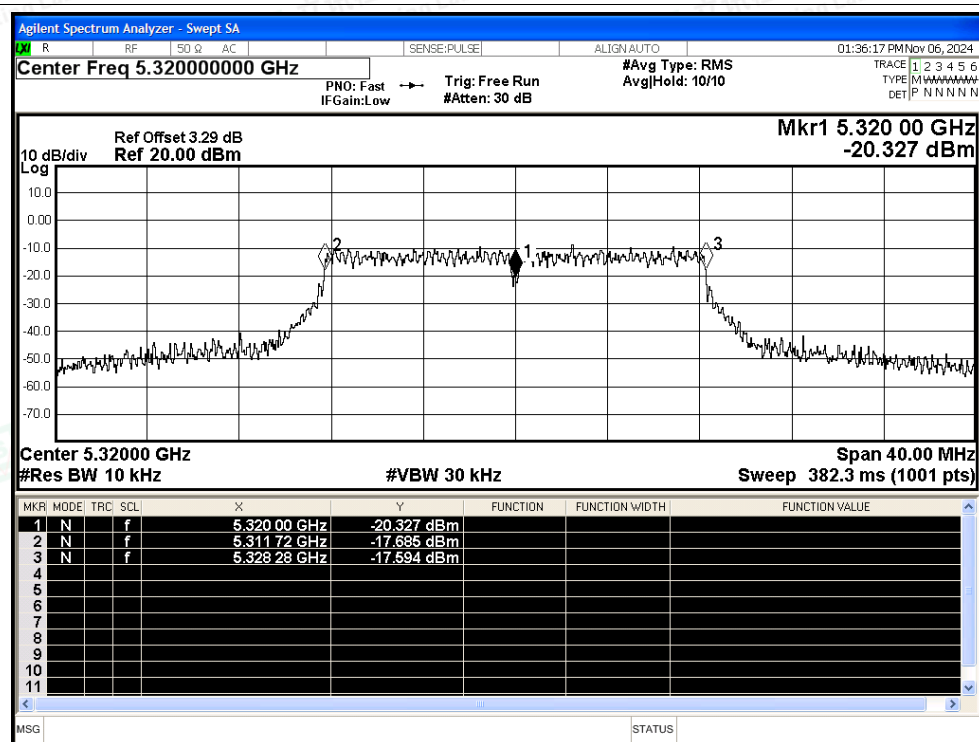


Freq. Stability NVNT n20 5260MHz Ant2

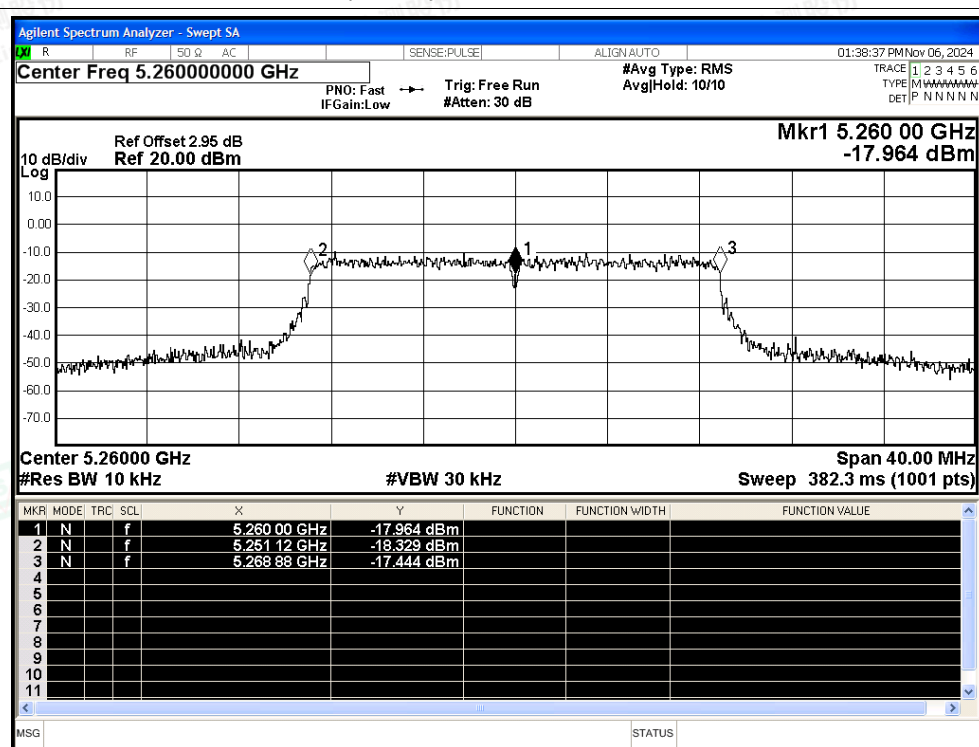




Freq. Stability NVNT n20 5300MHz Ant2

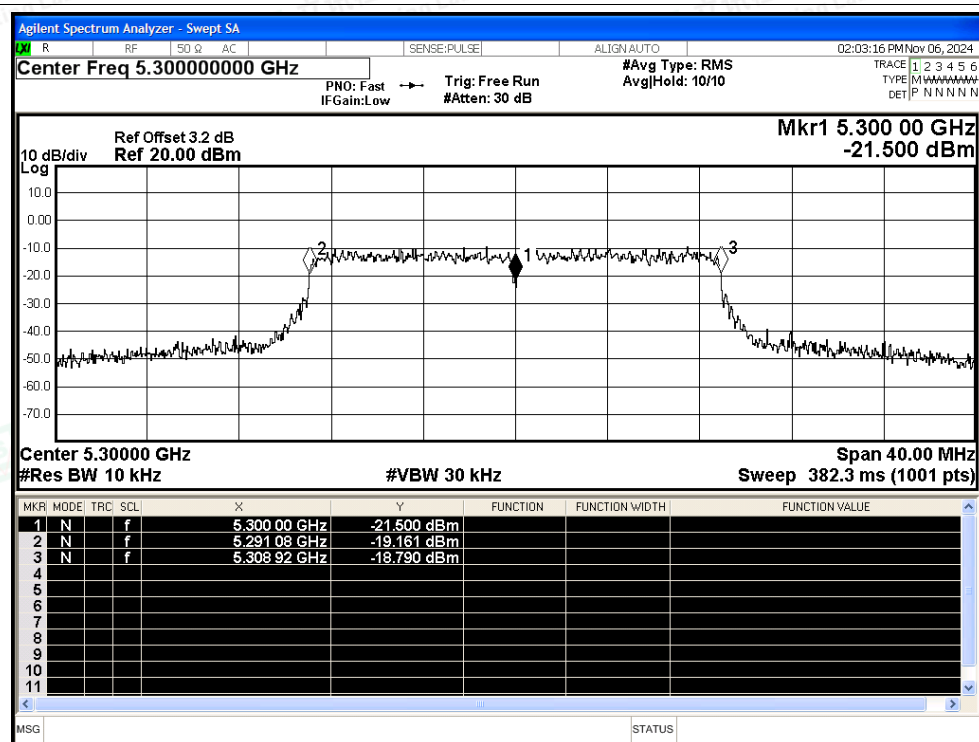

Freq. Stability NVNT n20 5320MHz Ant2

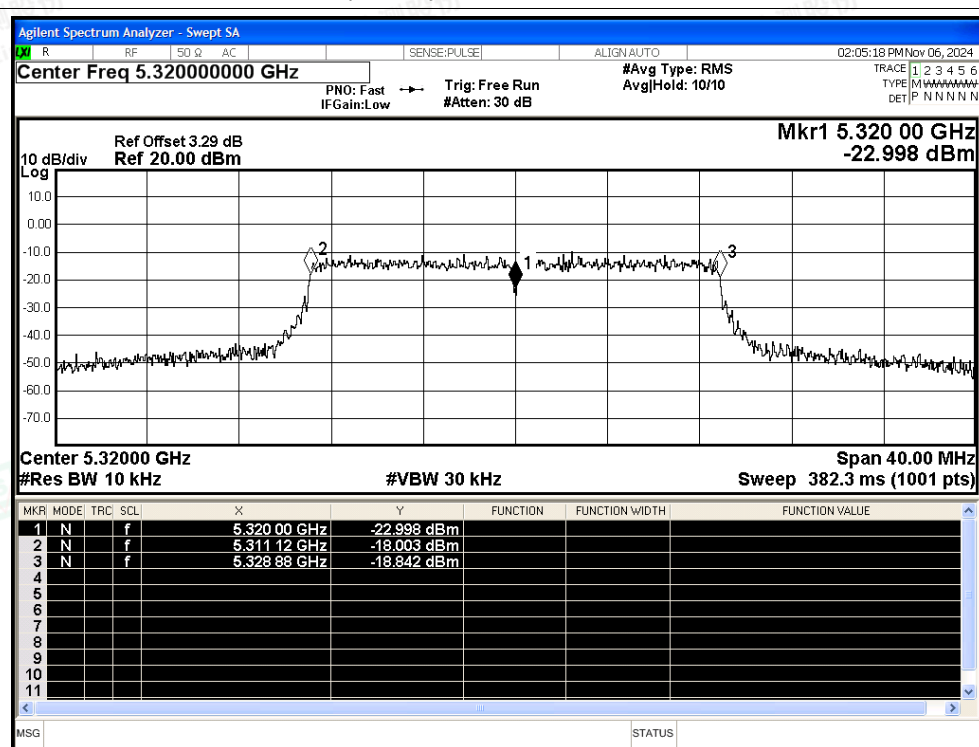

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

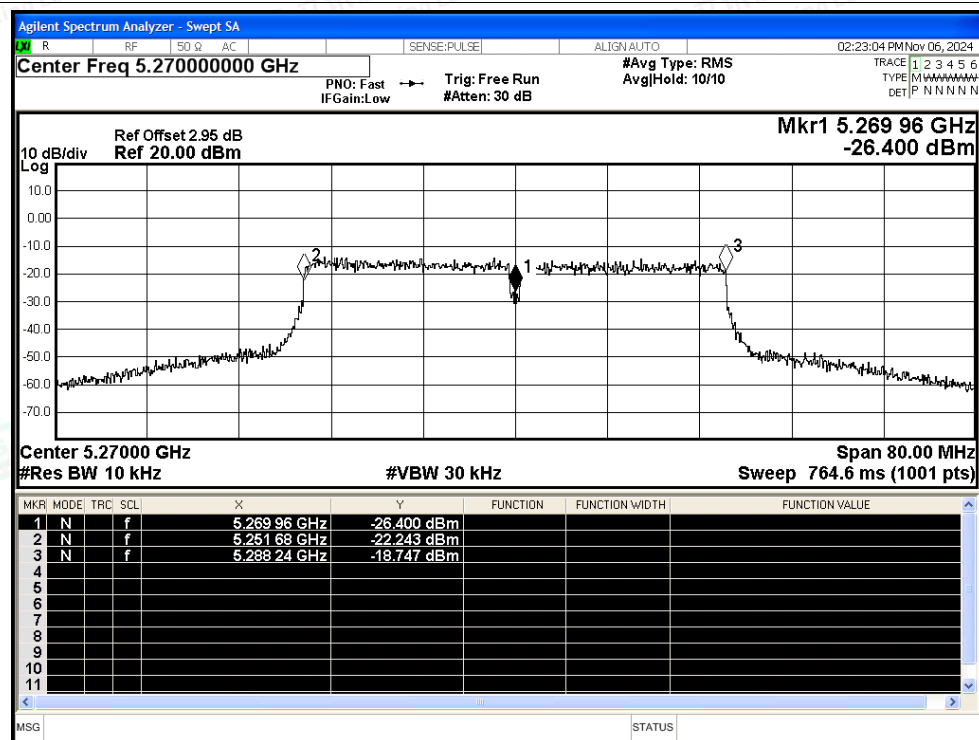

Freq. Stability NVNT n40 5310MHz Ant2

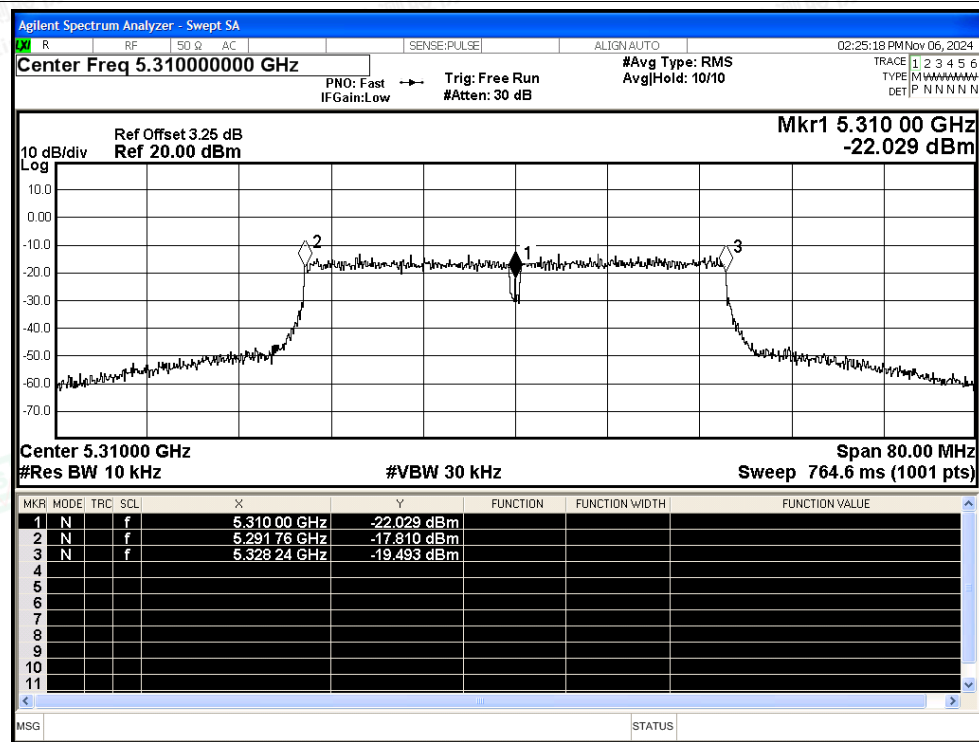

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

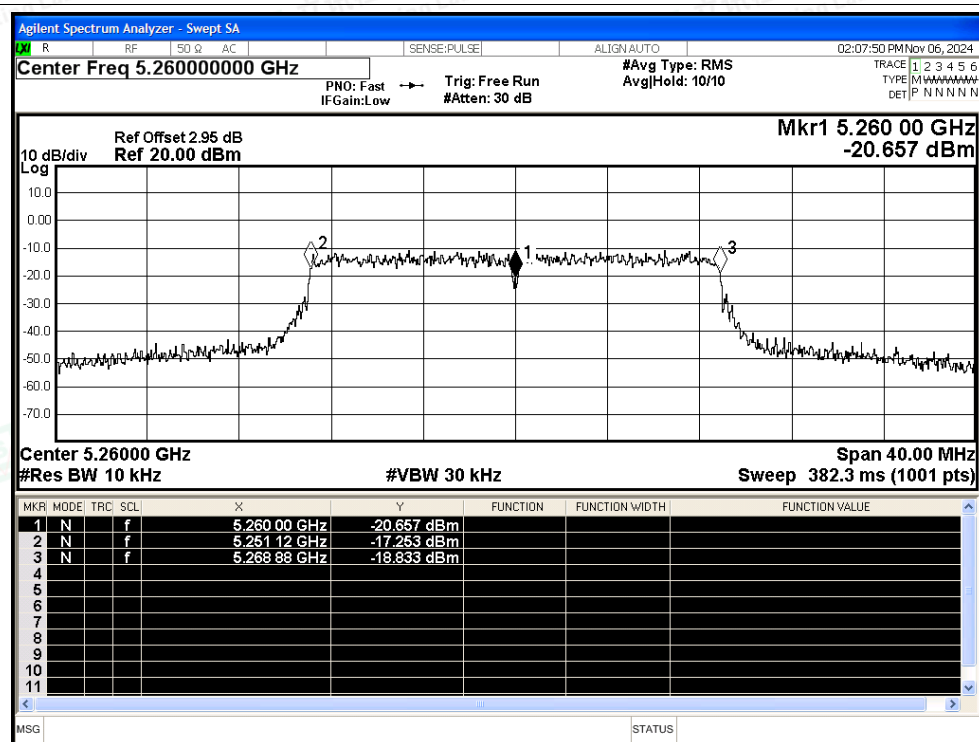

Freq. Stability NVNT ac20 5300MHz Ant2

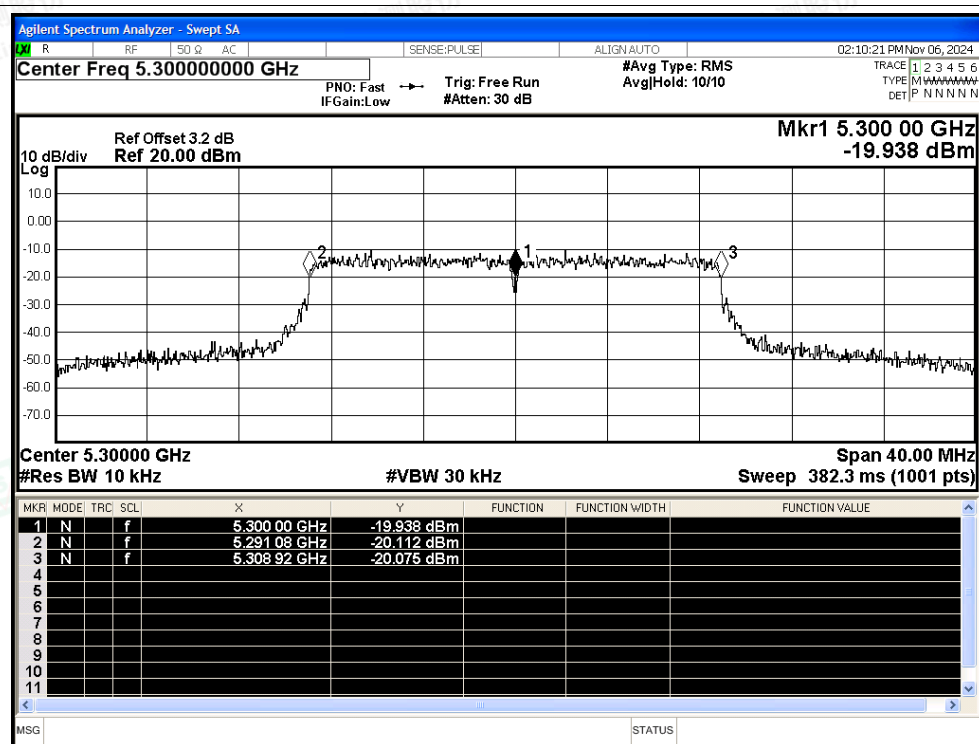

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

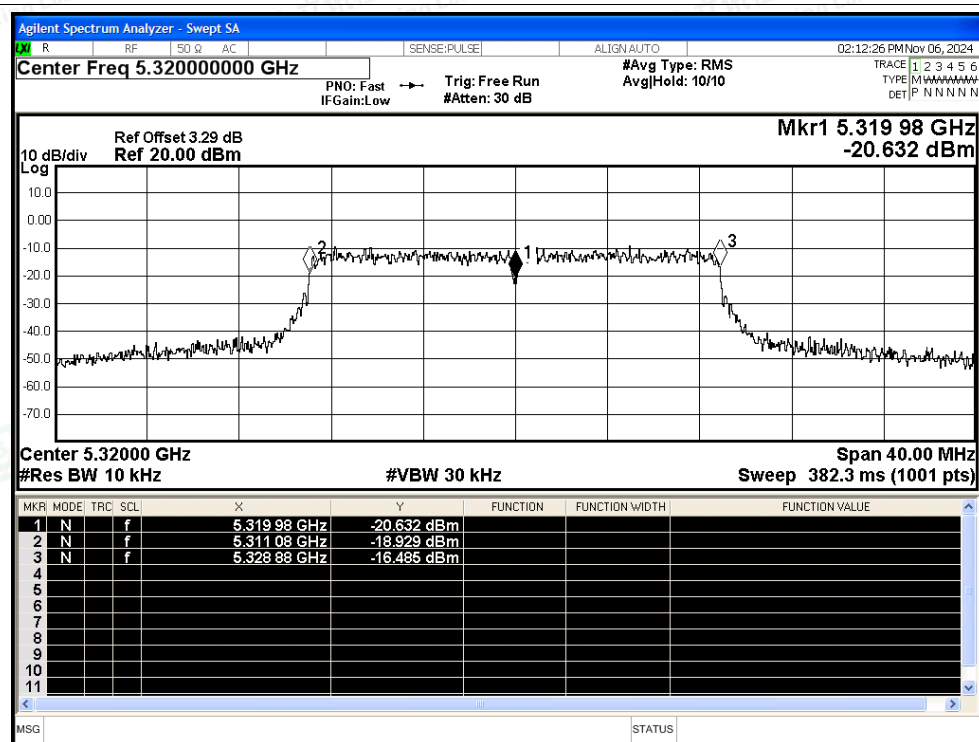


Freq. Stability NVNT ac40 5270MHz Ant2

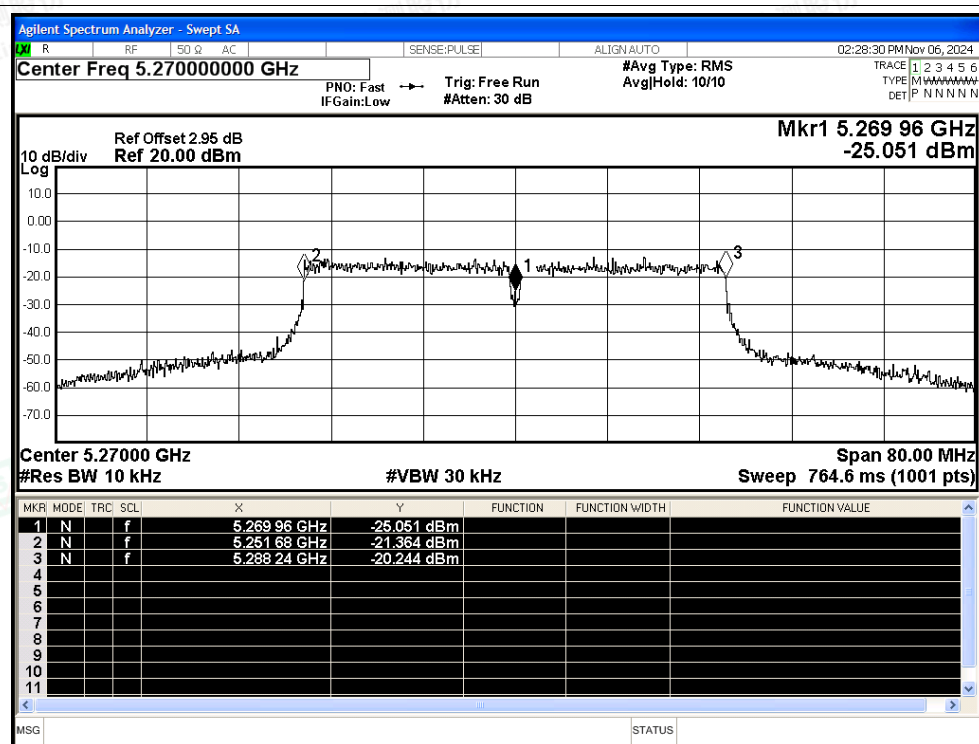




Freq. Stability NVNT ac40 5310MHz Ant2

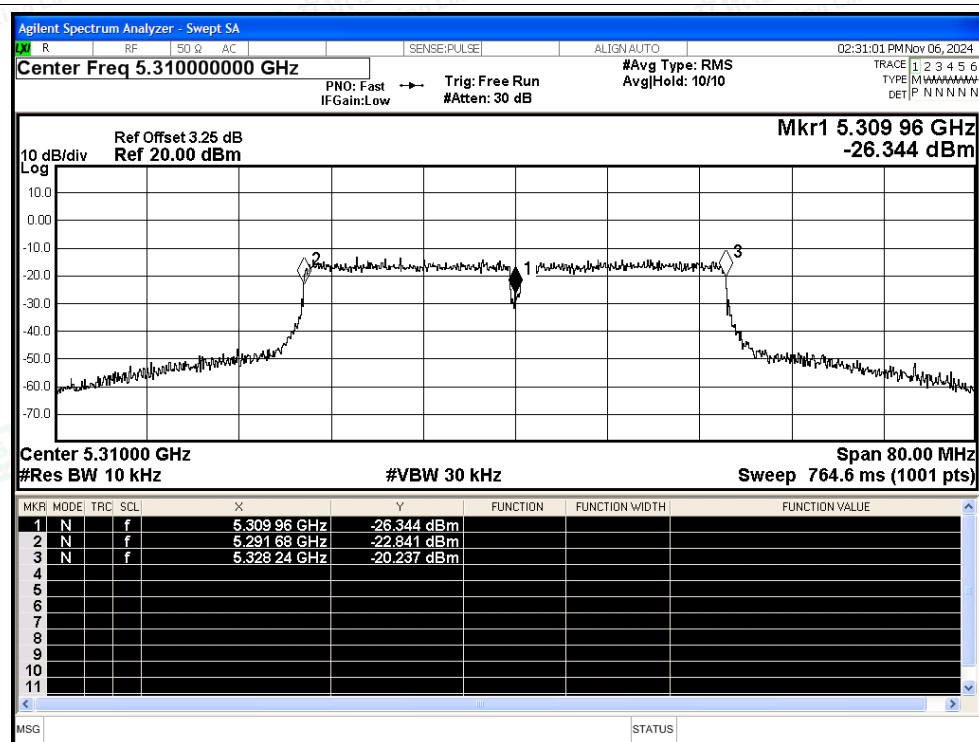


Freq. Stability NVNT ax20 5260MHz Ant2

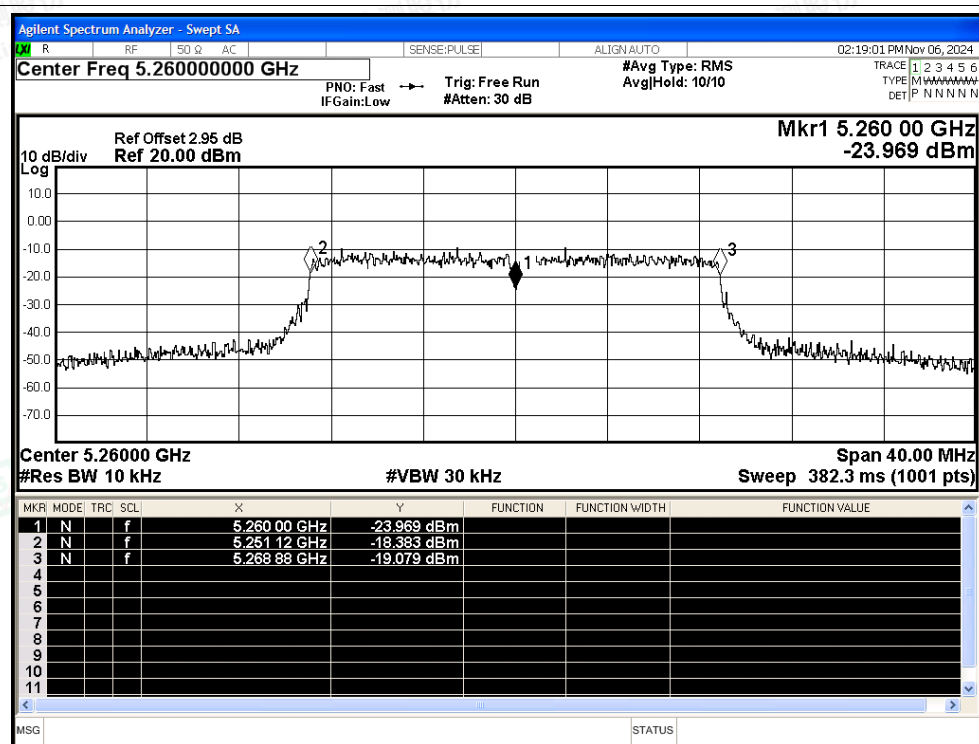




Freq. Stability NVNT ax20 5300MHz Ant2

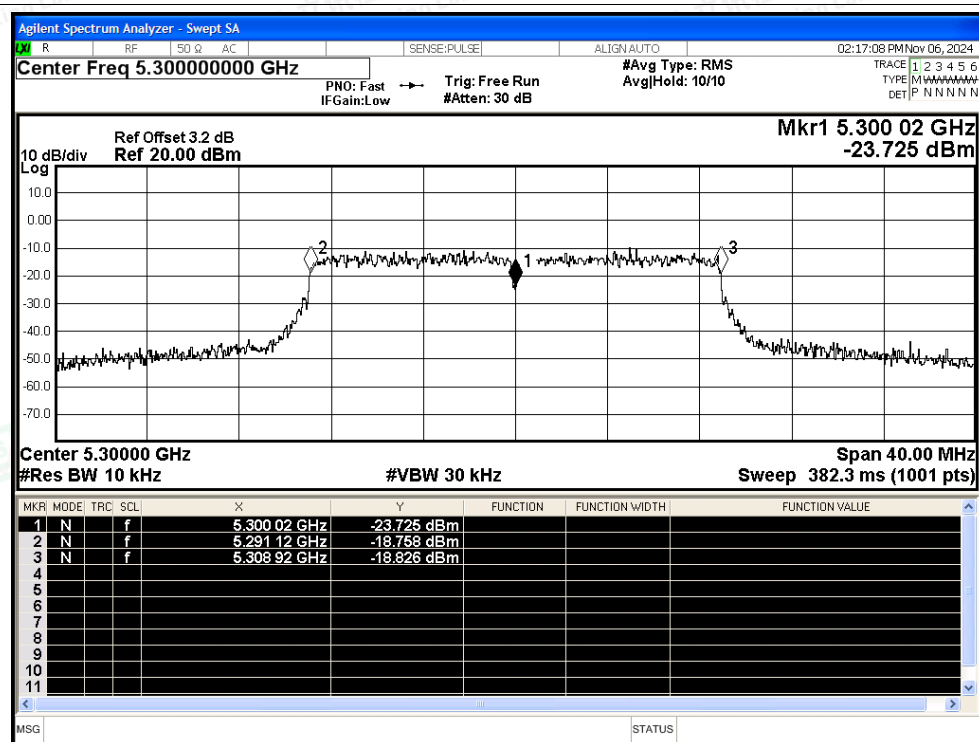

Freq. Stability NVNT ax20 5320MHz Ant2

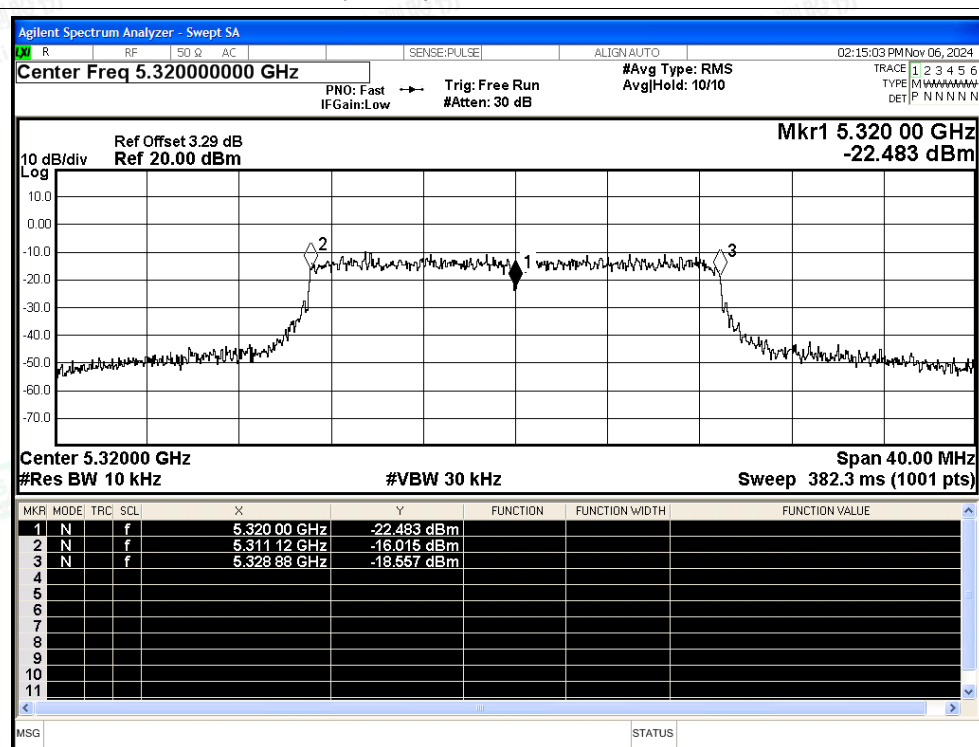

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5270MHz Ant2

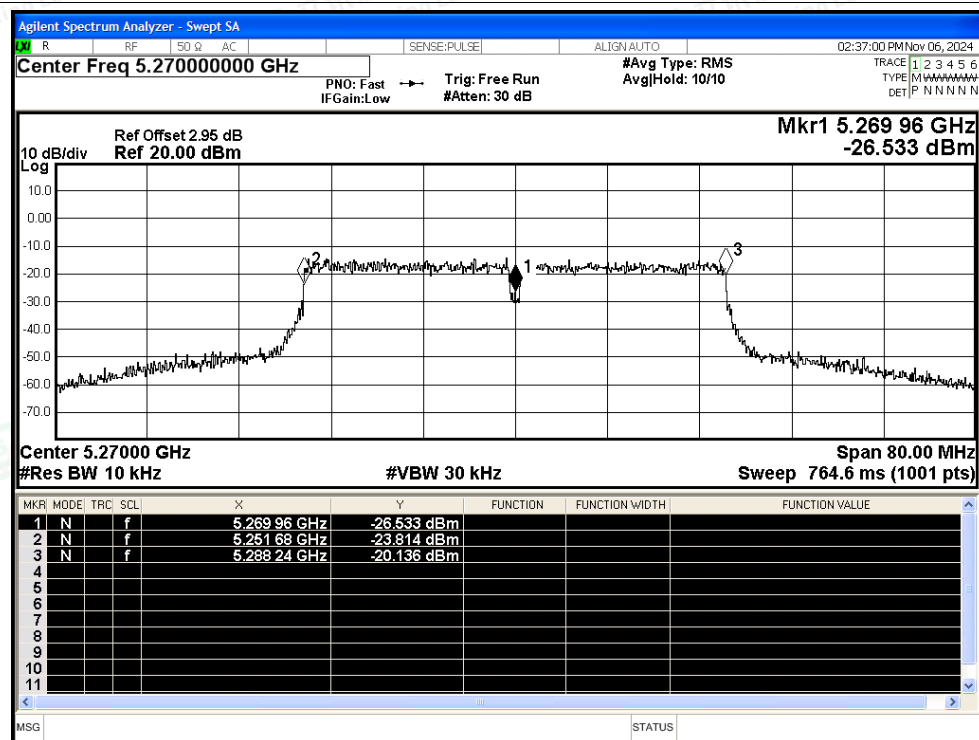

Freq. Stability NVNT ax40 5310MHz Ant2

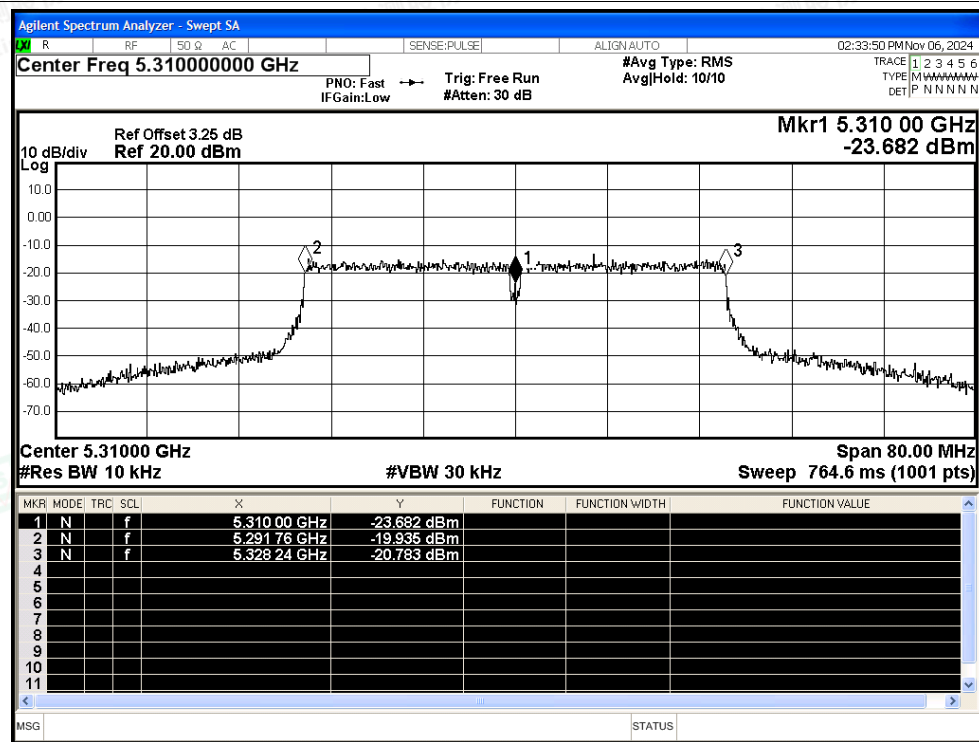

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.65	0.24	0.91
NVNT	a	5300	Ant1	94.56	0.24	0.91
NVNT	a	5320	Ant1	94.56	0.24	0.91
NVNT	n20	5260	Ant1	93.77	0.28	1.07
NVNT	n20	5300	Ant1	93.67	0.28	1.07
NVNT	n20	5320	Ant1	93.77	0.28	1.07
NVNT	n40	5270	Ant1	94.71	0.24	0.9
NVNT	n40	5310	Ant1	94.71	0.24	0.9
NVNT	ac20	5260	Ant1	93.72	0.28	1.06
NVNT	ac20	5300	Ant1	93.72	0.28	1.06
NVNT	ac20	5320	Ant1	93.82	0.28	1.06
NVNT	ac40	5270	Ant1	94.72	0.24	0.9
NVNT	ac40	5310	Ant1	94.72	0.24	0.9
NVNT	ax20	5260	Ant1	93.73	0.28	1.06
NVNT	ax20	5300	Ant1	93.72	0.28	1.06
NVNT	ax20	5320	Ant1	93.82	0.28	1.06
NVNT	ax40	5270	Ant1	94.81	0.23	0.9
NVNT	ax40	5310	Ant1	94.72	0.24	0.9






Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

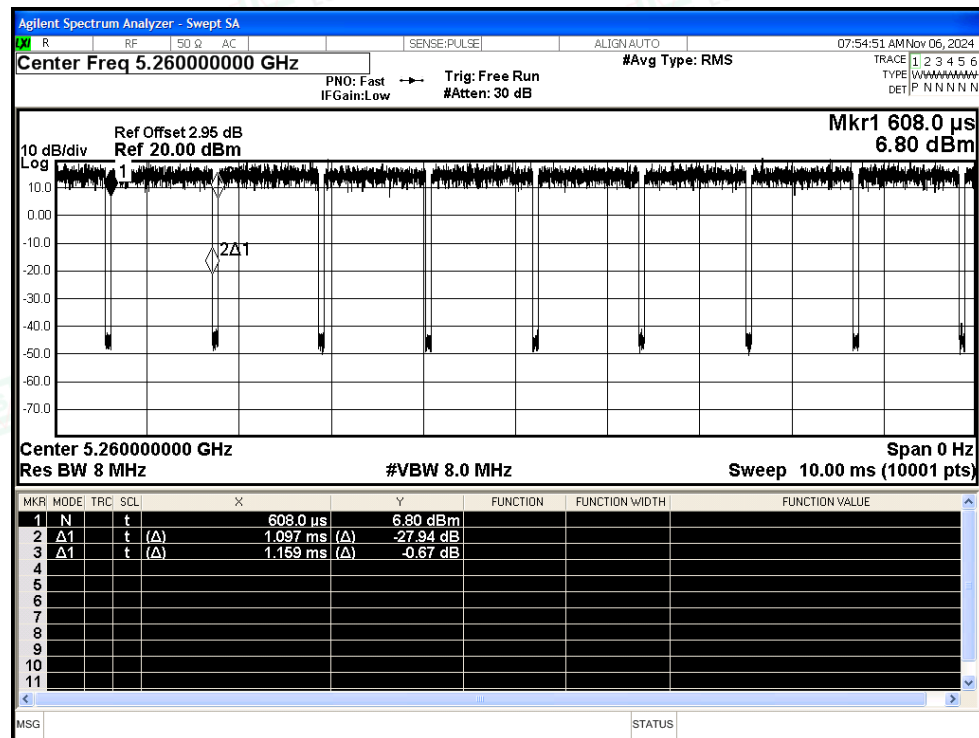

Duty Cycle NVNT a 5300MHz Ant1

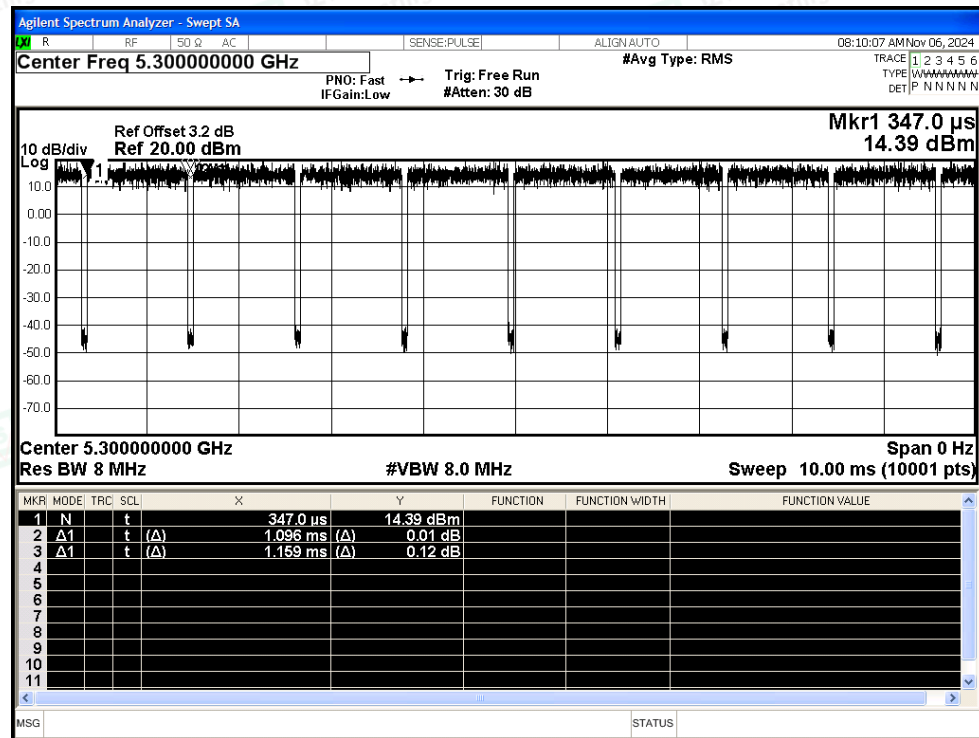

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

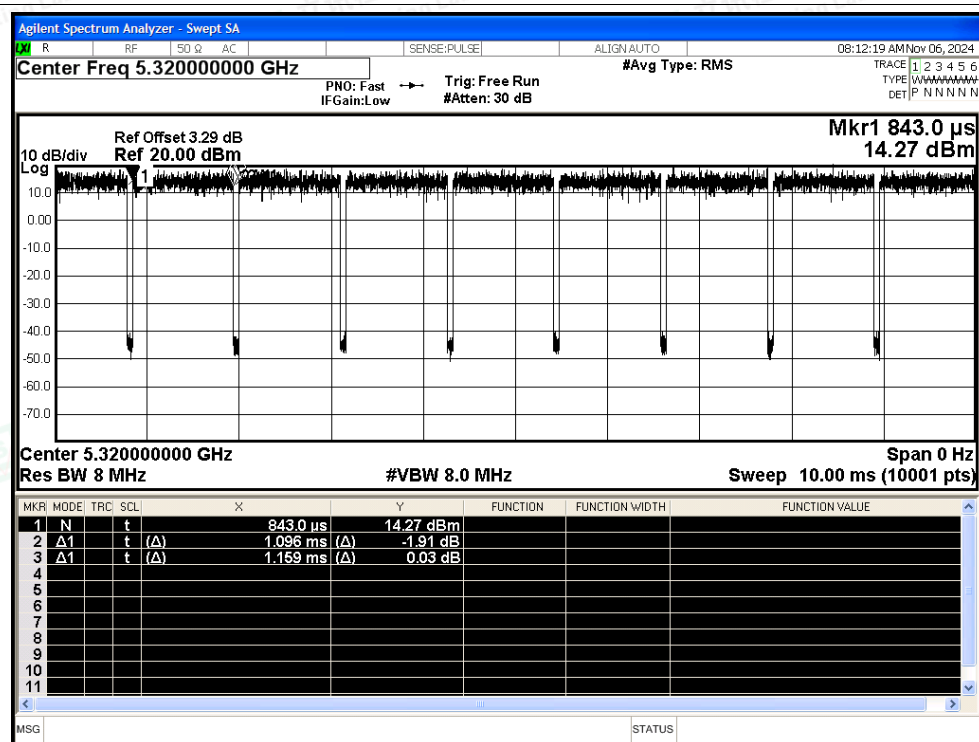

Duty Cycle NVNT n20 5260MHz Ant1

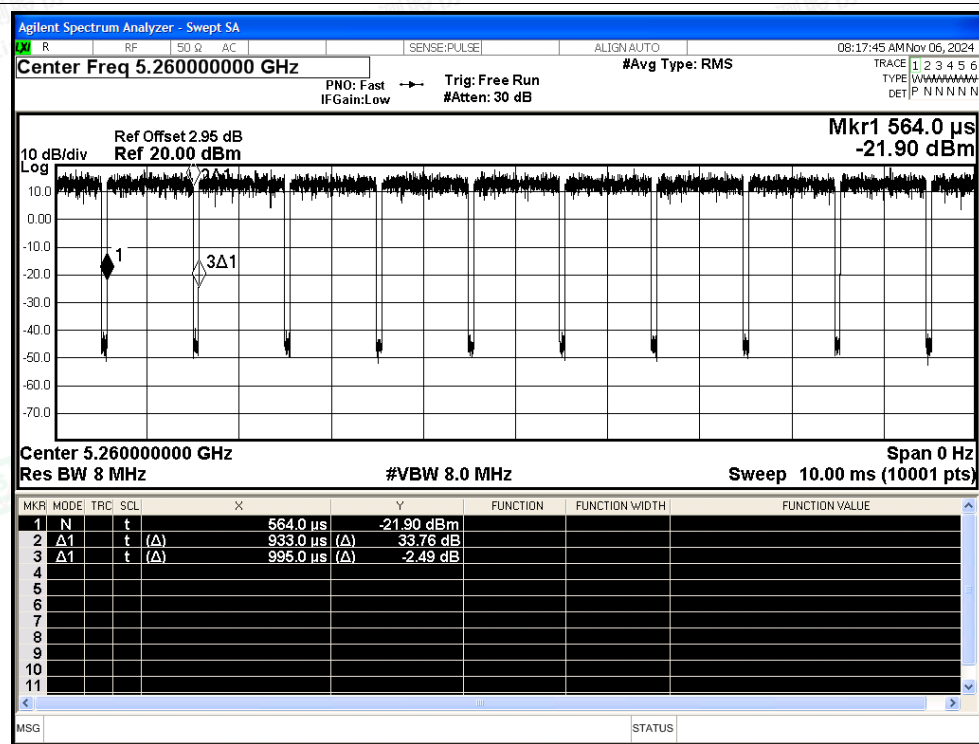

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant1

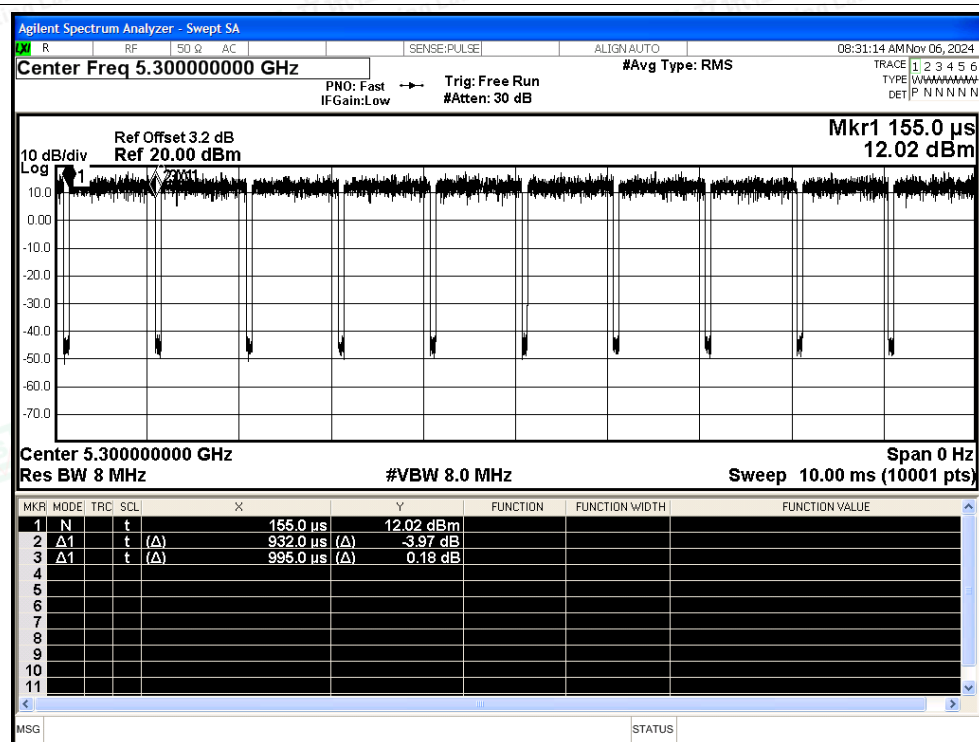


Duty Cycle NVNT n20 5320MHz Ant1

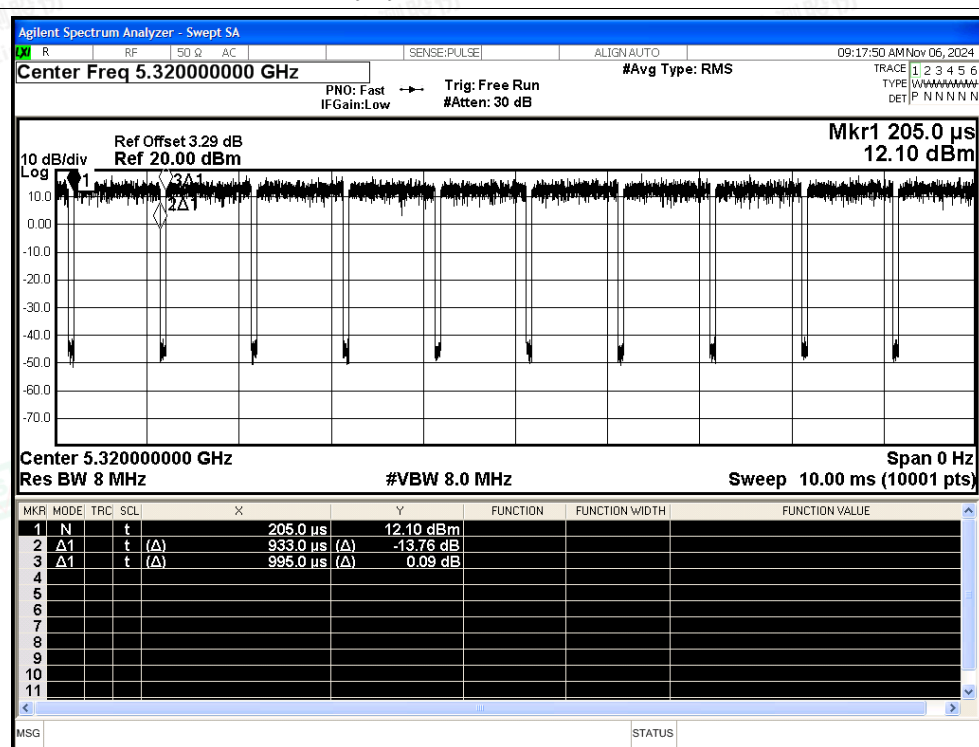




Duty Cycle NVNT n40 5270MHz Ant1

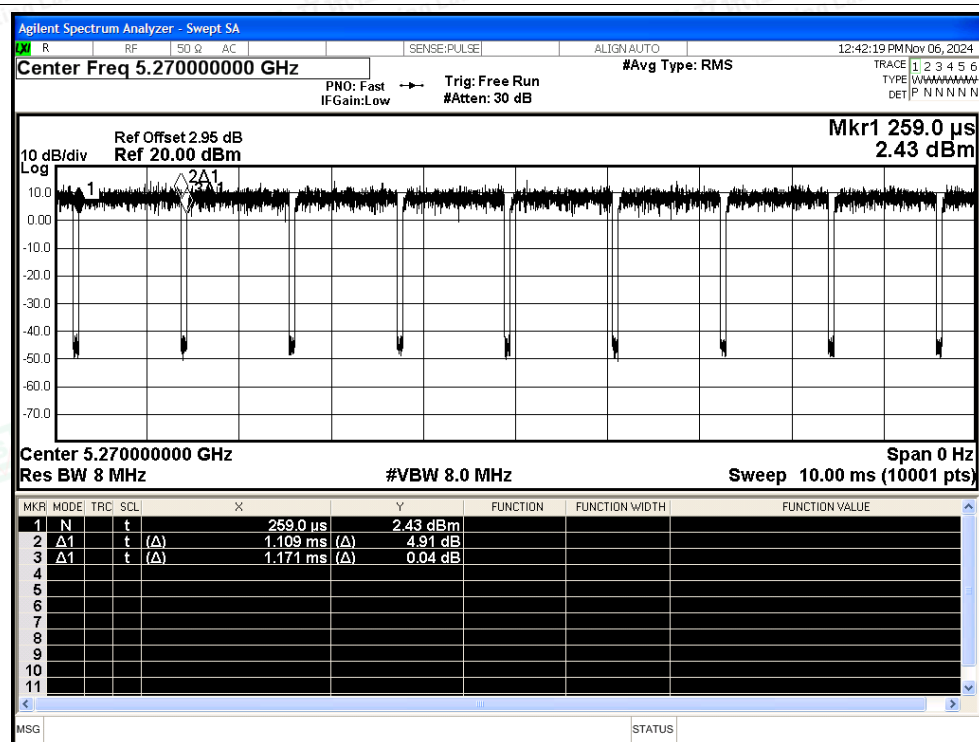


Duty Cycle NVNT n40 5310MHz Ant1

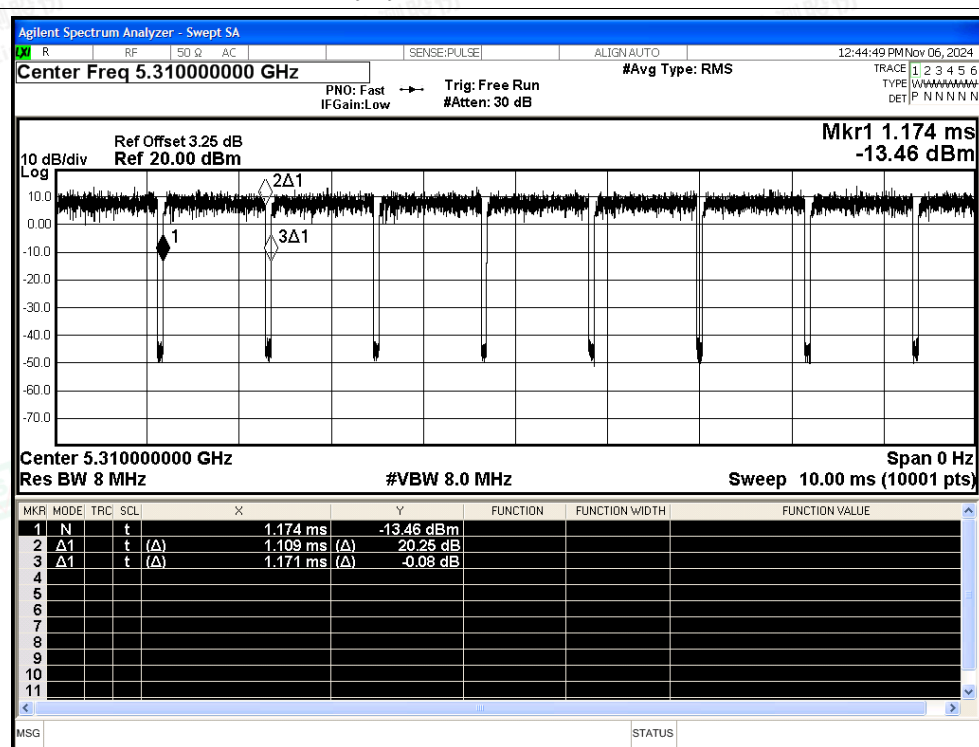




Duty Cycle NVNT ac20 5260MHz Ant1

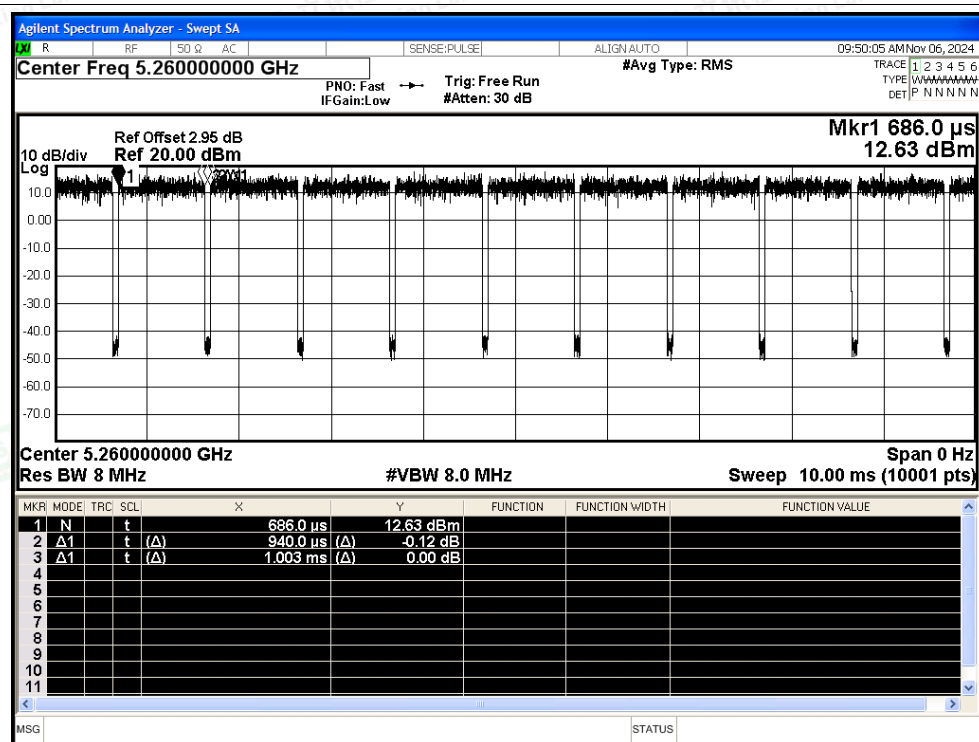


Duty Cycle NVNT ac20 5300MHz Ant1

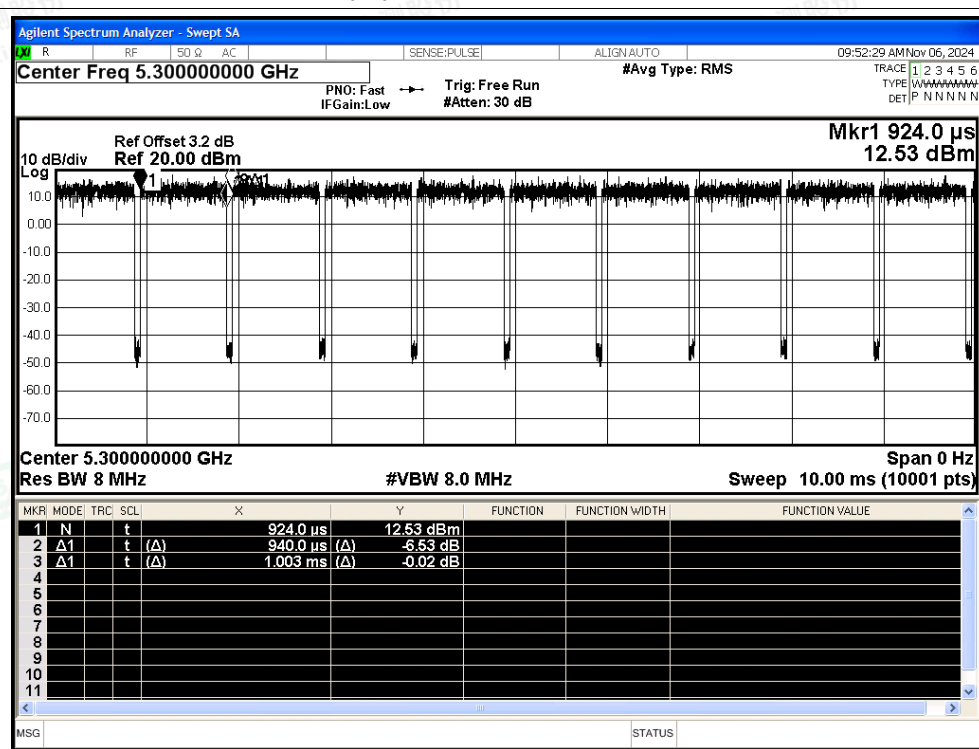




Duty Cycle NVNT ac20 5320MHz Ant1

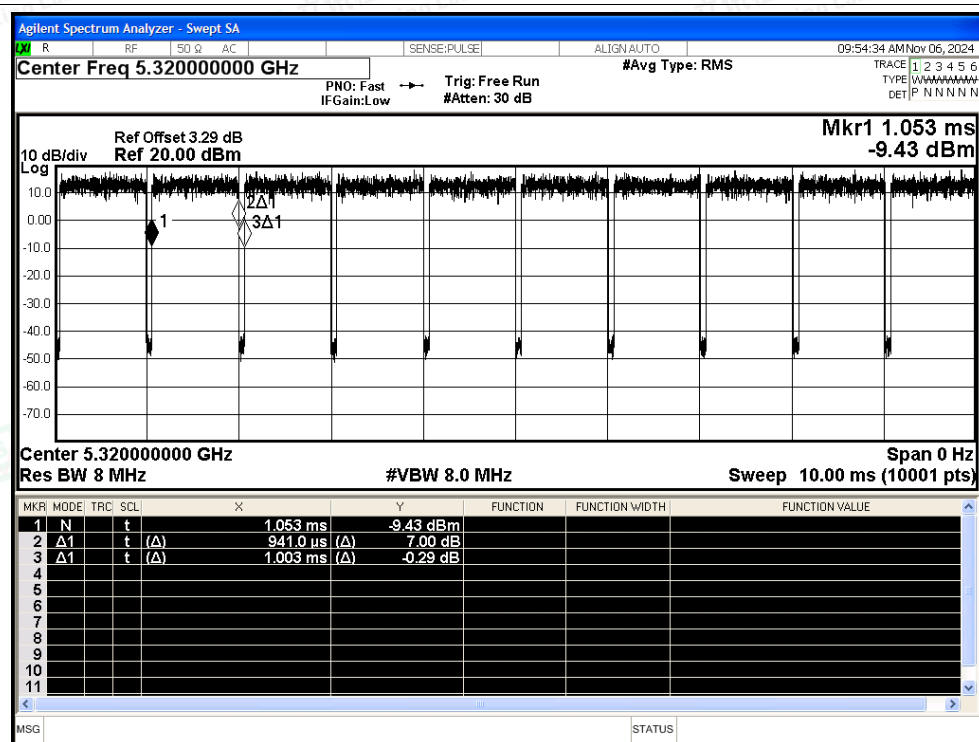


Duty Cycle NVNT ac40 5270MHz Ant1

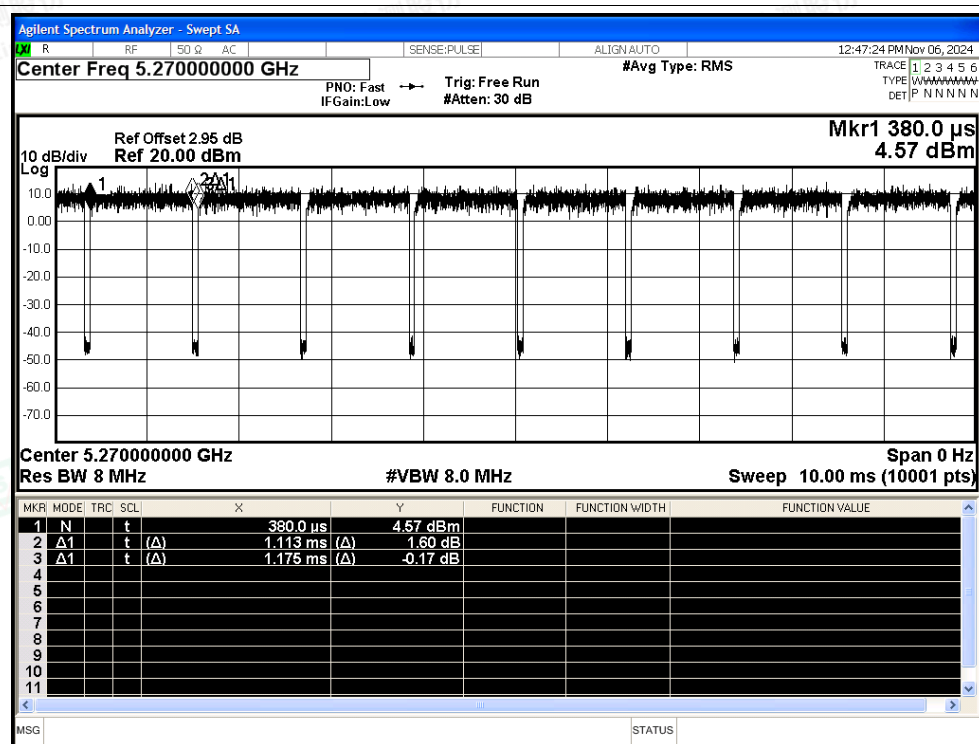




Duty Cycle NVNT ac40 5310MHz Ant1

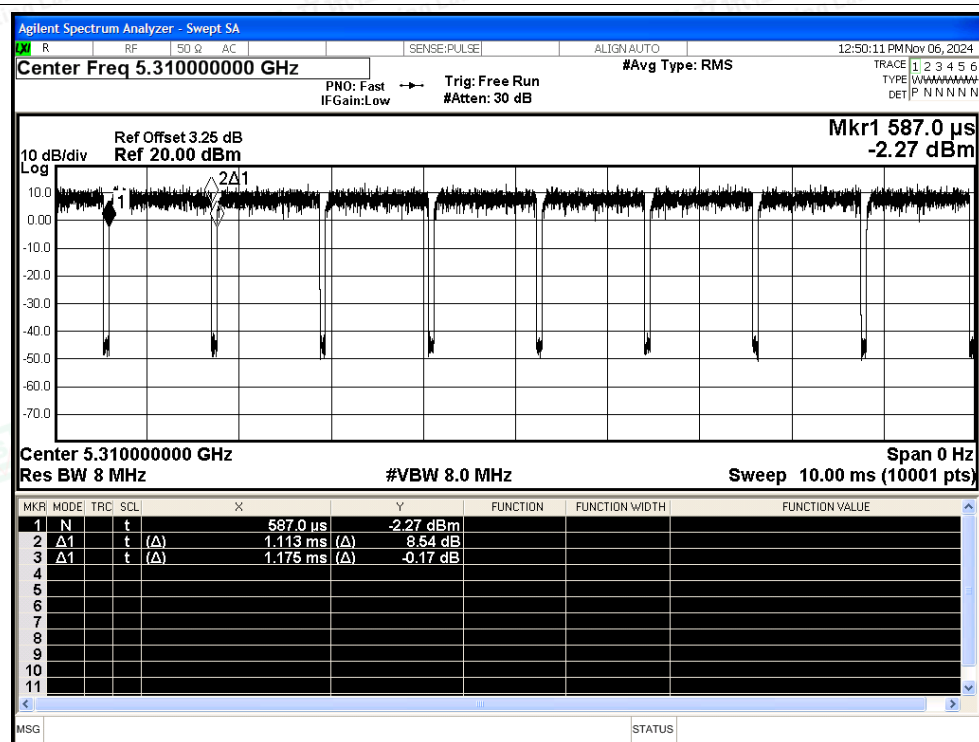


Duty Cycle NVNT ax20 5260MHz Ant1

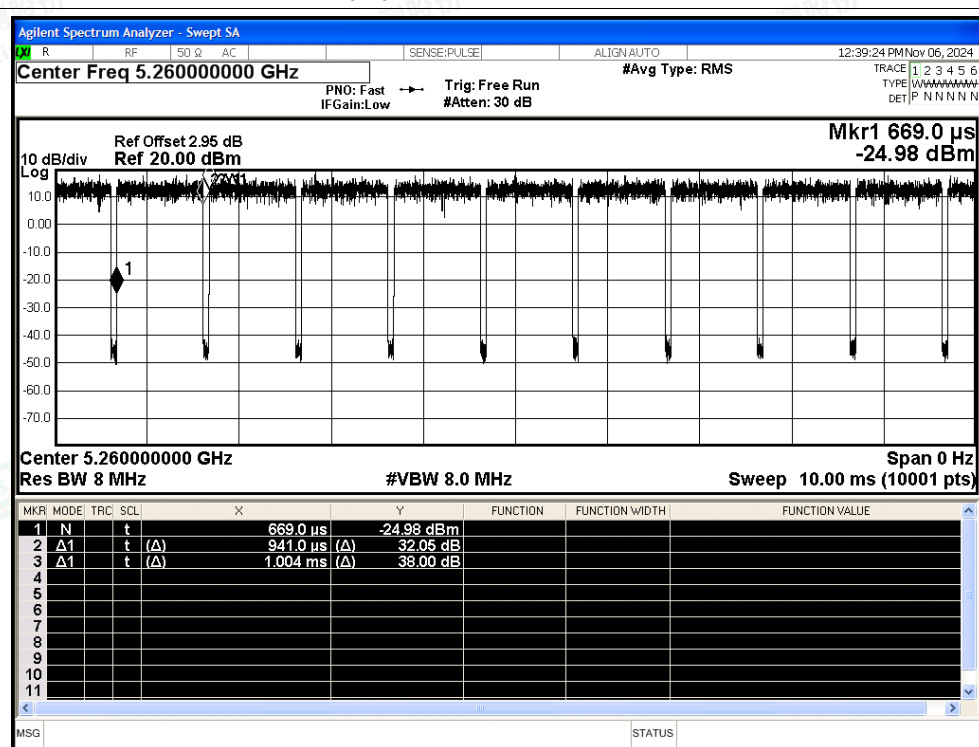




Duty Cycle NVNT ax20 5300MHz Ant1

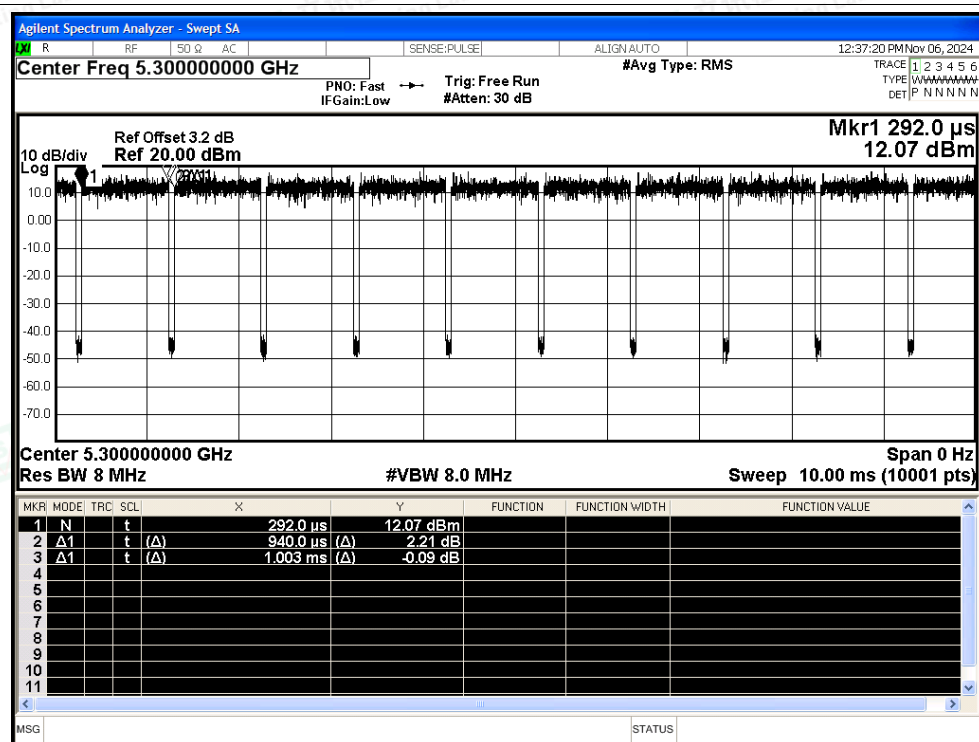

Duty Cycle NVNT ax20 5320MHz Ant1

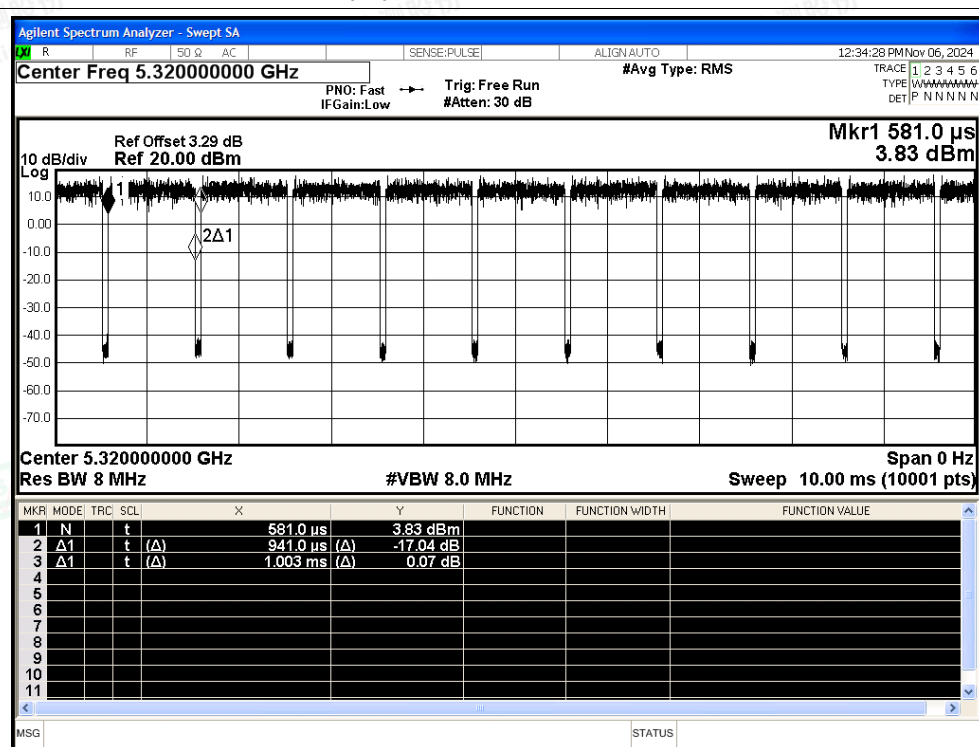

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5270MHz Ant1

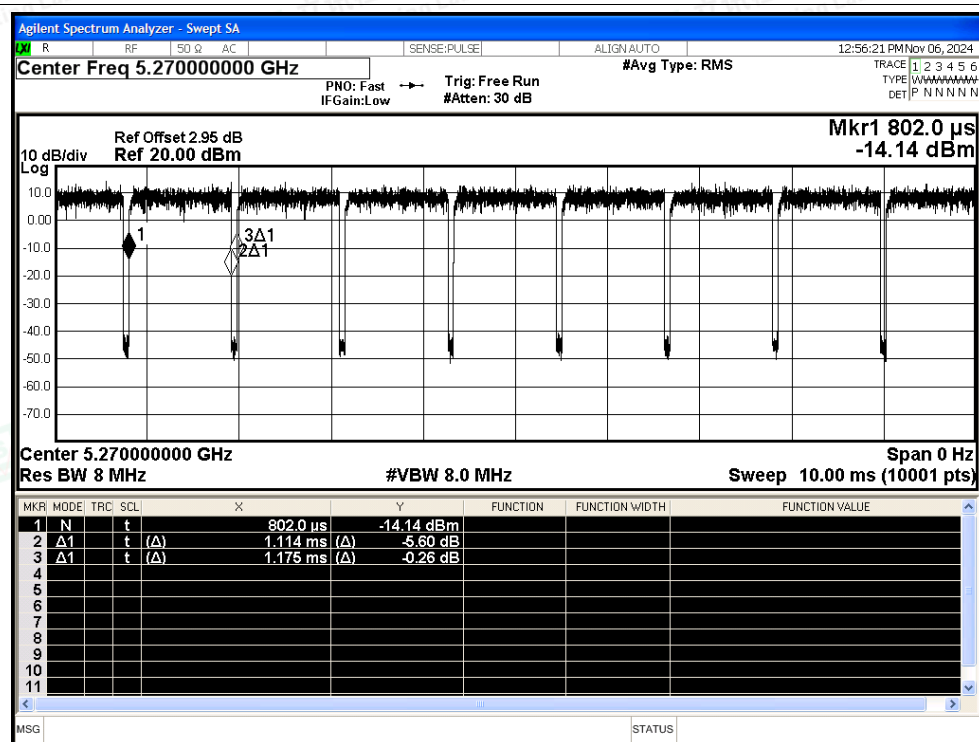

Duty Cycle NVNT ax40 5310MHz Ant1

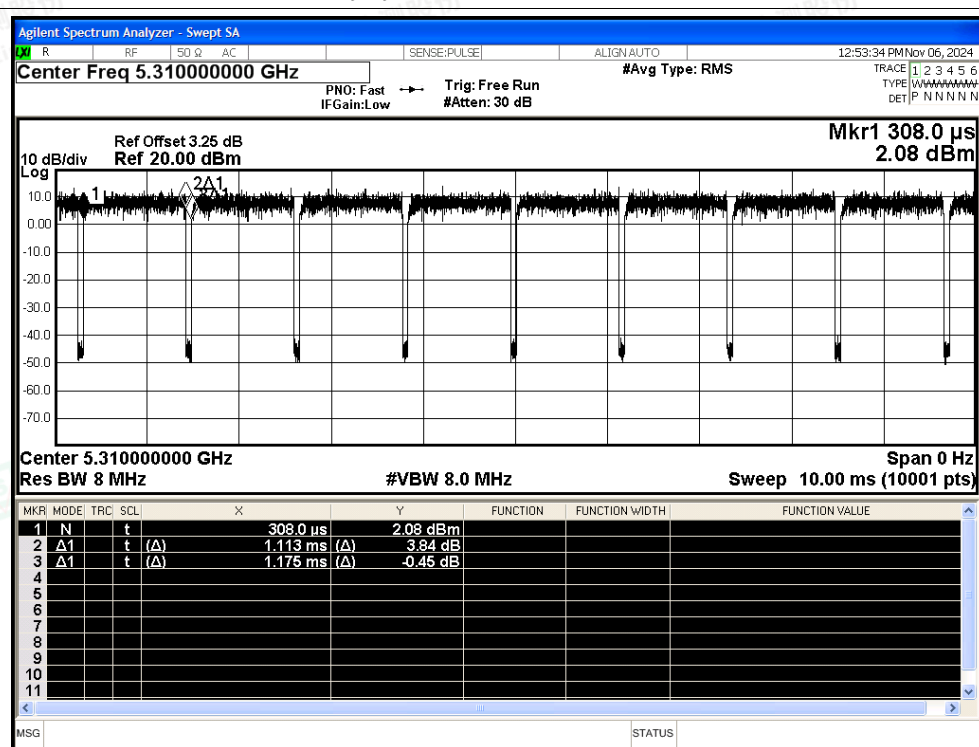




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	94.56	0.24	0.91
NVNT	a	5300	Ant2	94.56	0.24	0.91
NVNT	a	5320	Ant2	94.65	0.24	0.91
NVNT	n20	5260	Ant2	93.67	0.28	1.07
NVNT	n20	5300	Ant2	93.77	0.28	1.07
NVNT	n20	5320	Ant2	93.77	0.28	1.07
NVNT	n40	5270	Ant2	94.71	0.24	0.9
NVNT	n40	5310	Ant2	94.71	0.24	0.9
NVNT	ac20	5260	Ant2	93.82	0.28	1.06
NVNT	ac20	5300	Ant2	93.72	0.28	1.06
NVNT	ac20	5320	Ant2	93.72	0.28	1.06
NVNT	ac40	5270	Ant2	94.72	0.24	0.9
NVNT	ac40	5310	Ant2	94.72	0.24	0.9
NVNT	ax20	5260	Ant2	93.72	0.28	1.06
NVNT	ax20	5300	Ant2	93.82	0.28	1.06
NVNT	ax20	5320	Ant2	93.82	0.28	1.06
NVNT	ax40	5270	Ant2	94.72	0.24	0.9
NVNT	ax40	5310	Ant2	94.72	0.24	0.9






Test Graphs

Duty Cycle NVNT a 5260MHz Ant2

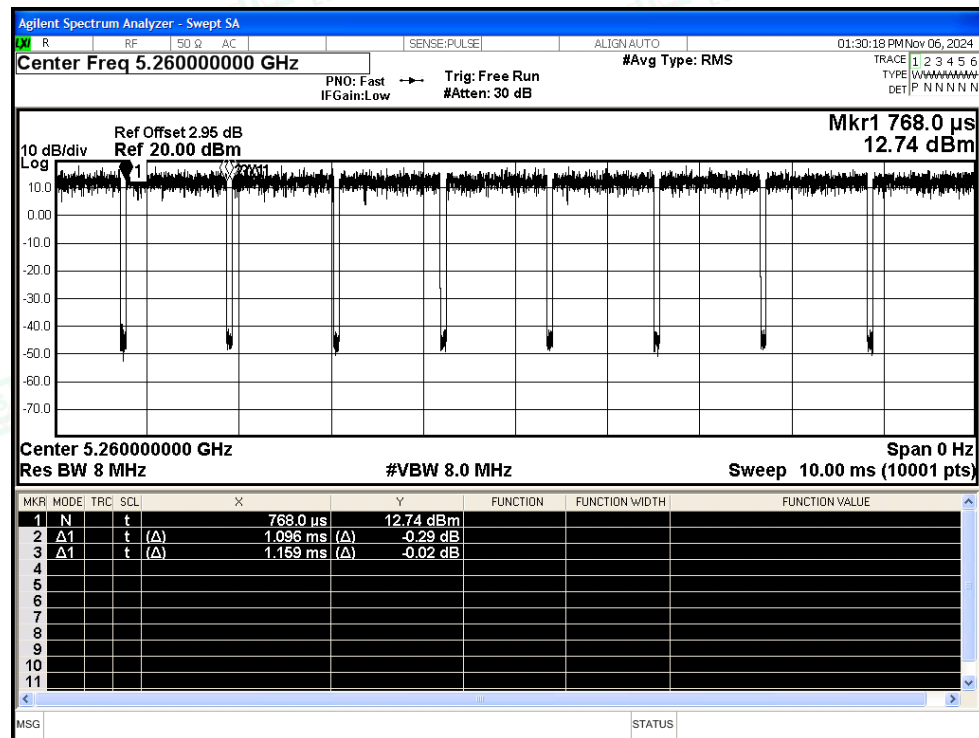

Duty Cycle NVNT a 5300MHz Ant2

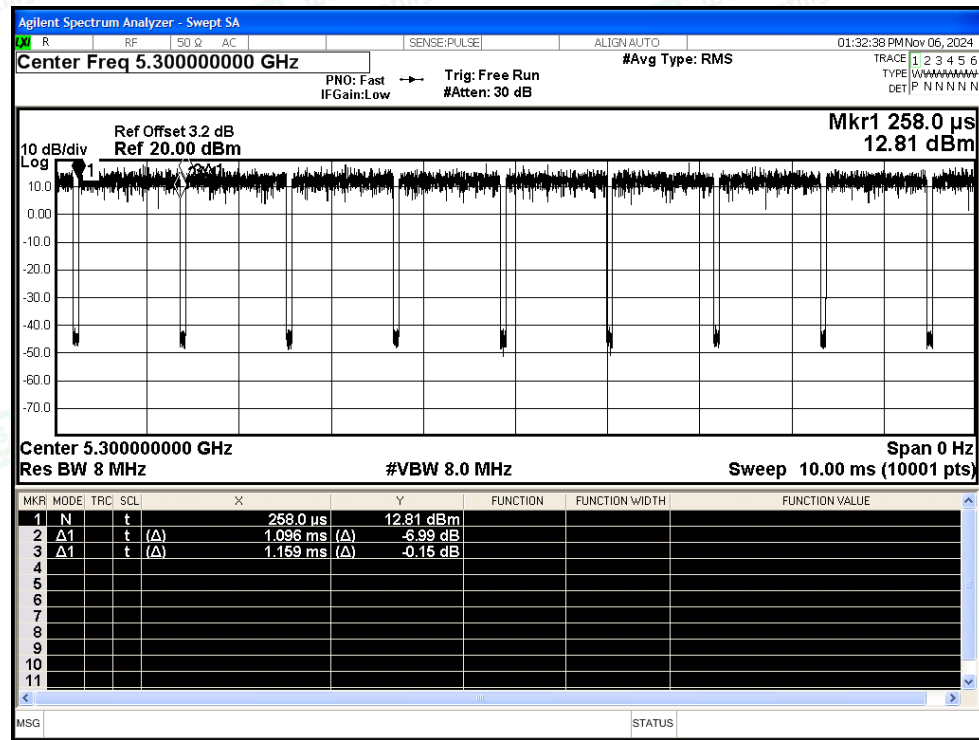

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant2

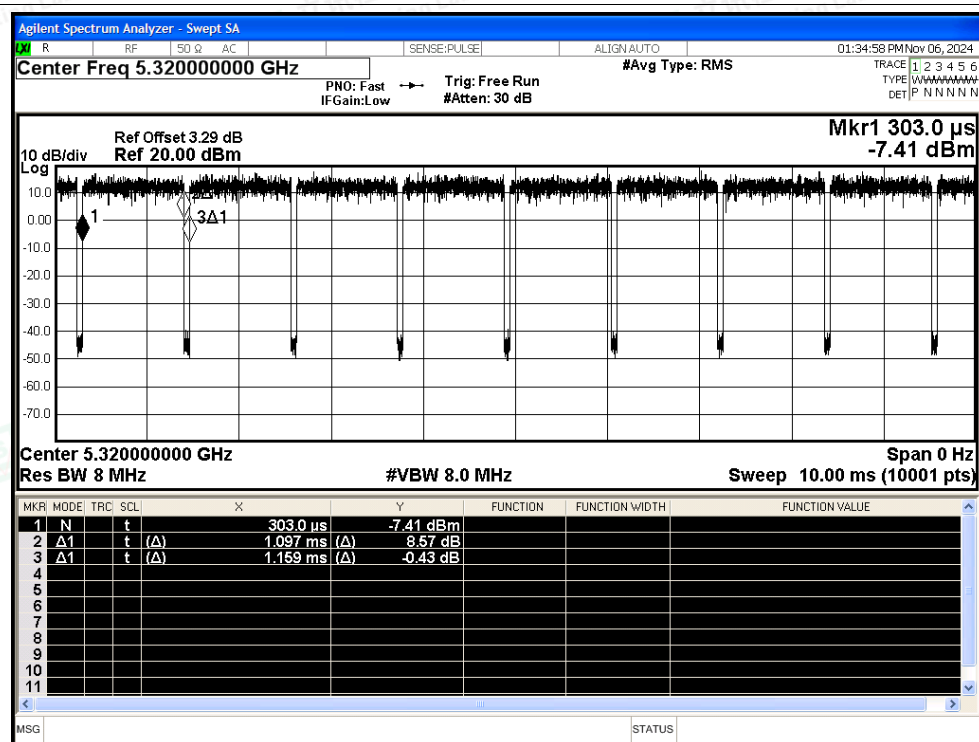


Duty Cycle NVNT n20 5260MHz Ant2

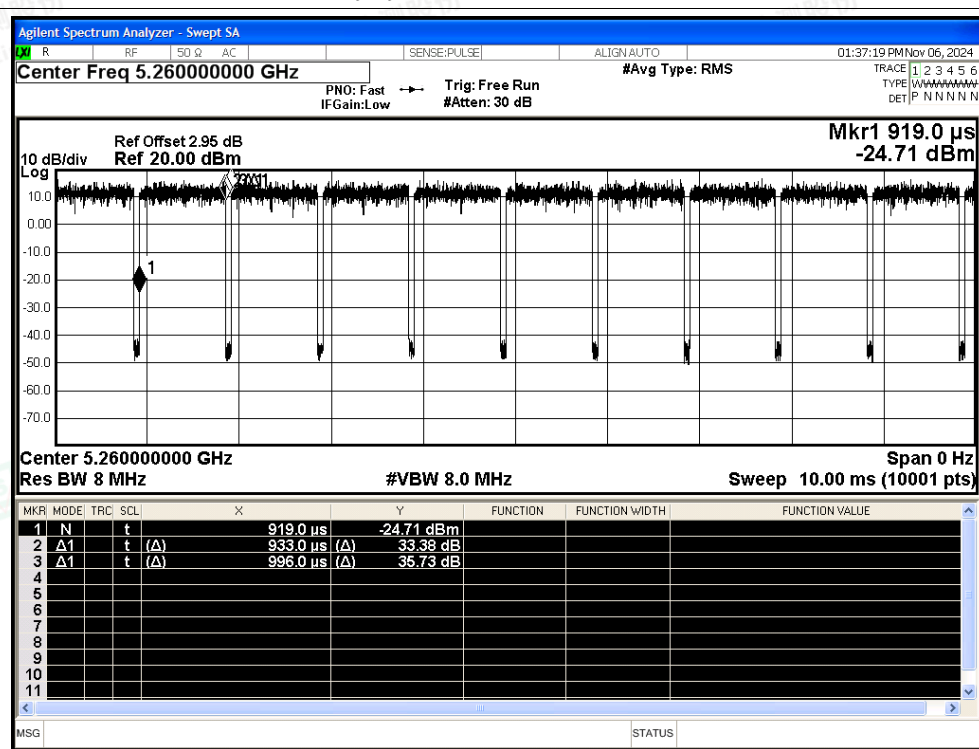




Duty Cycle NVNT n20 5300MHz Ant2

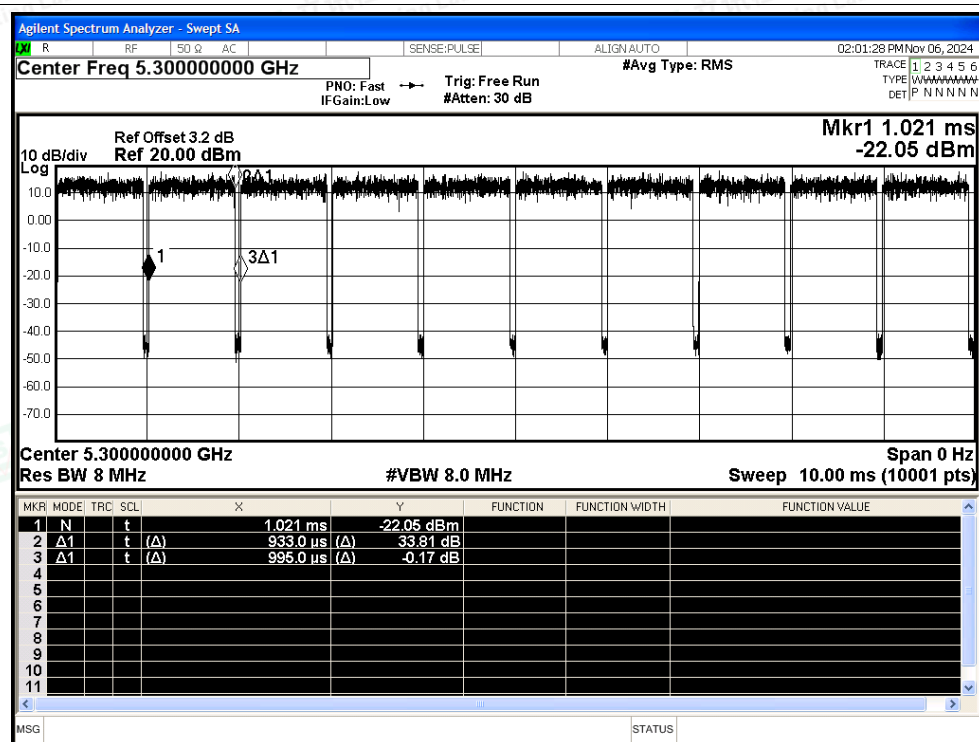

Duty Cycle NVNT n20 5320MHz Ant2

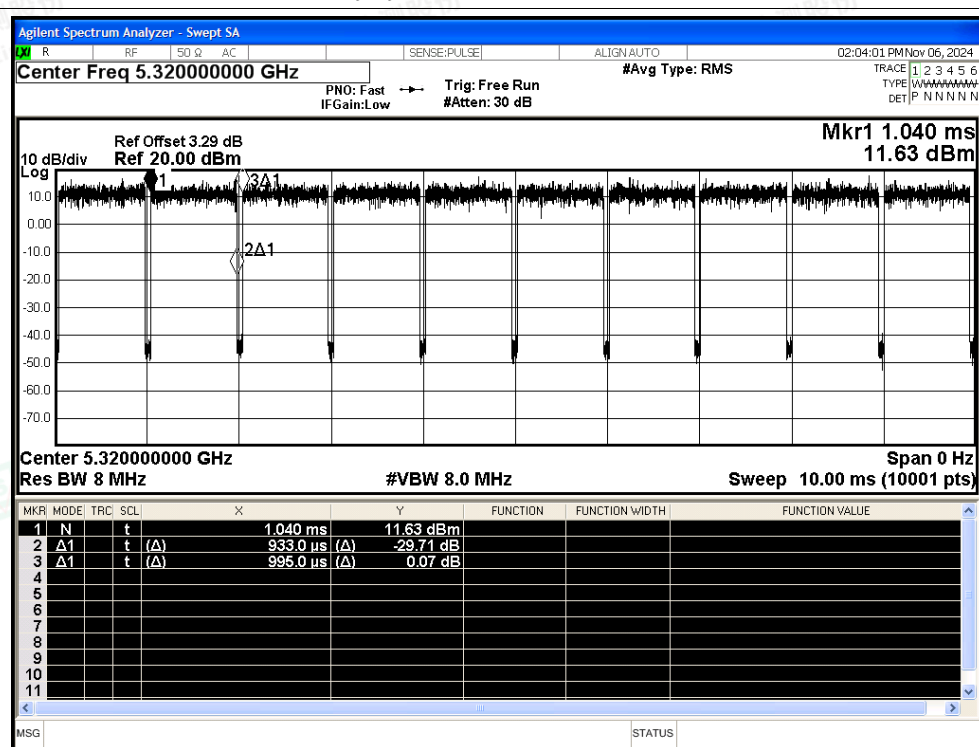

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant2

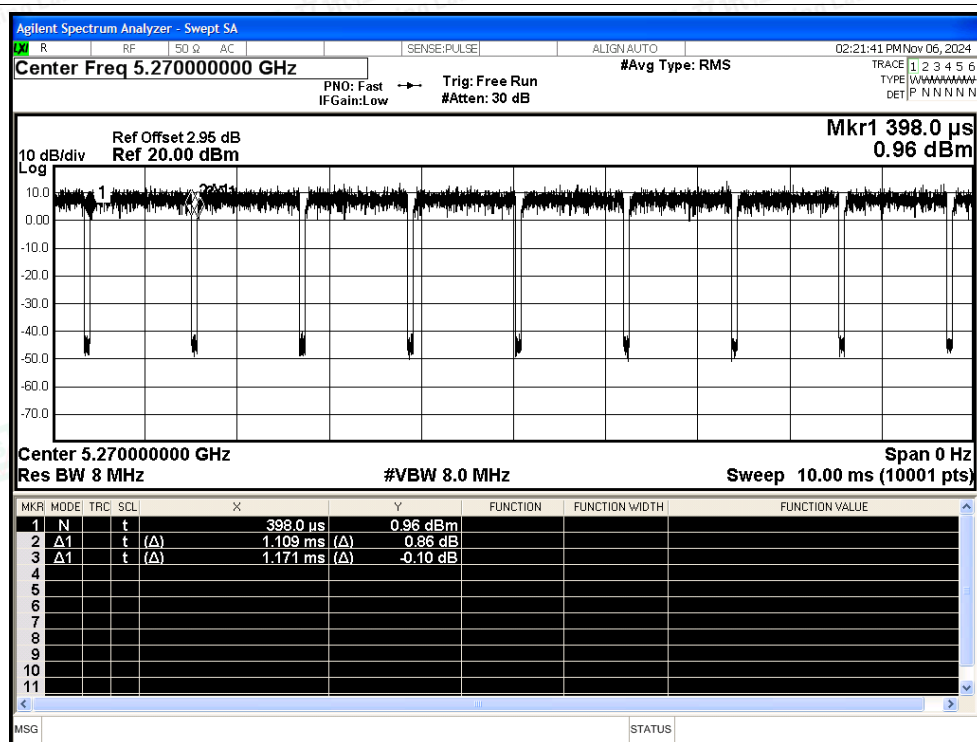

Duty Cycle NVNT n40 5310MHz Ant2

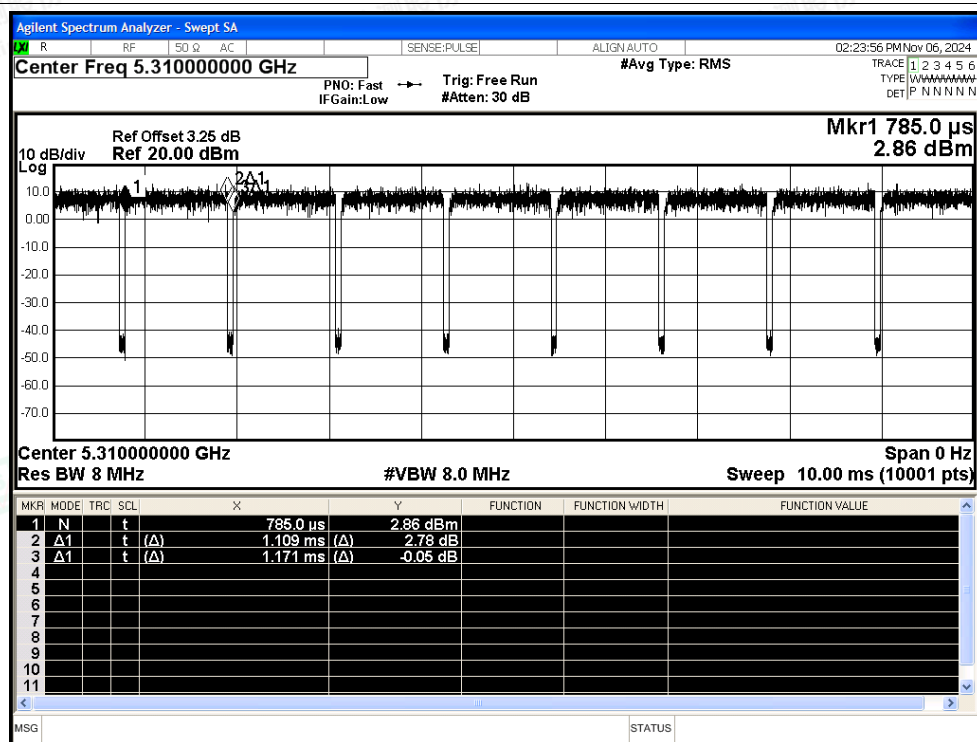

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant2

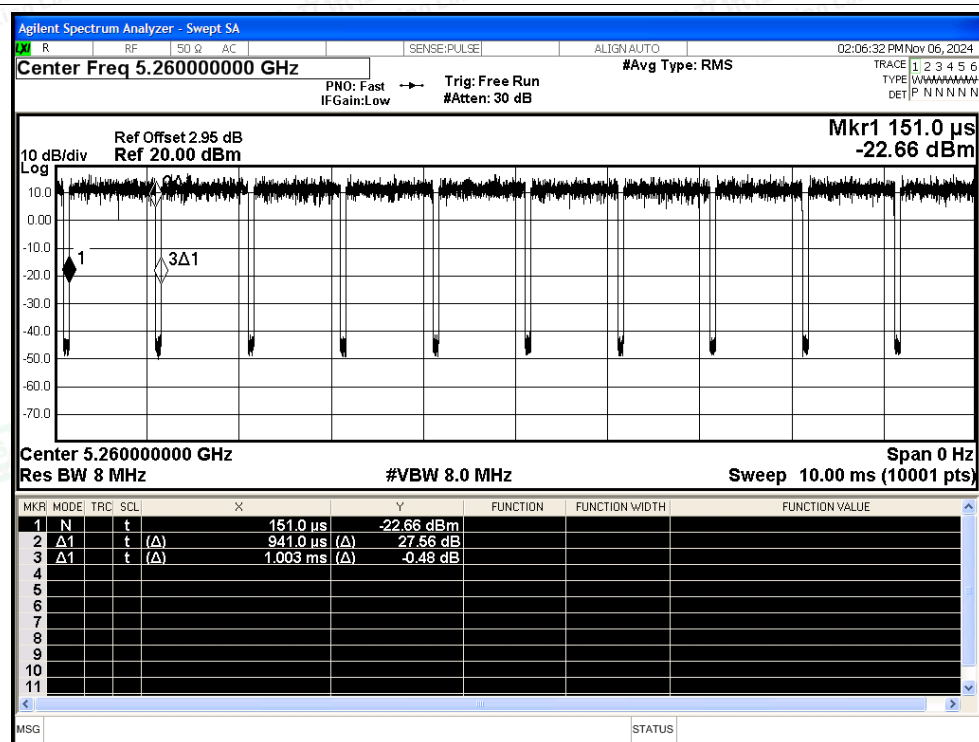

Duty Cycle NVNT ac20 5300MHz Ant2

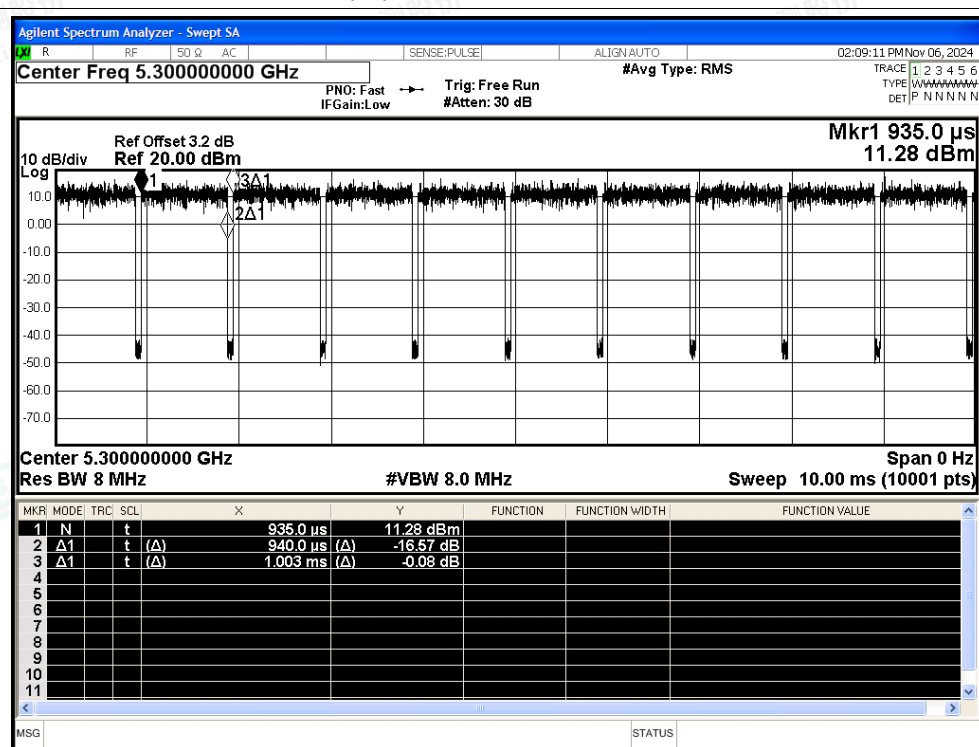

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant2

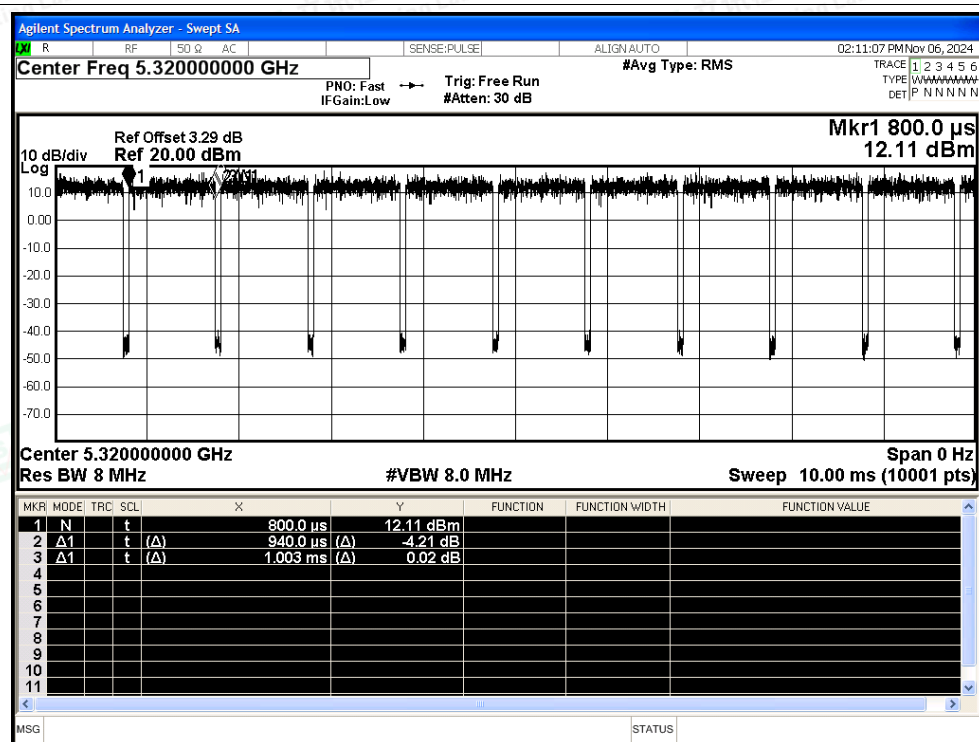


Duty Cycle NVNT ac40 5270MHz Ant2

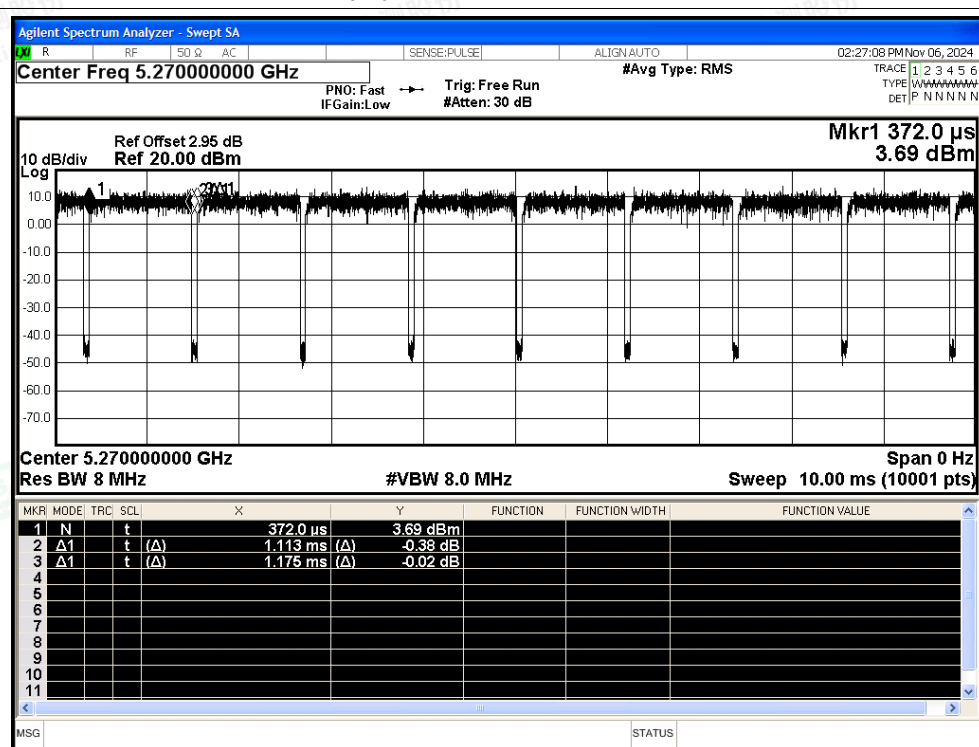




Duty Cycle NVNT ac40 5310MHz Ant2

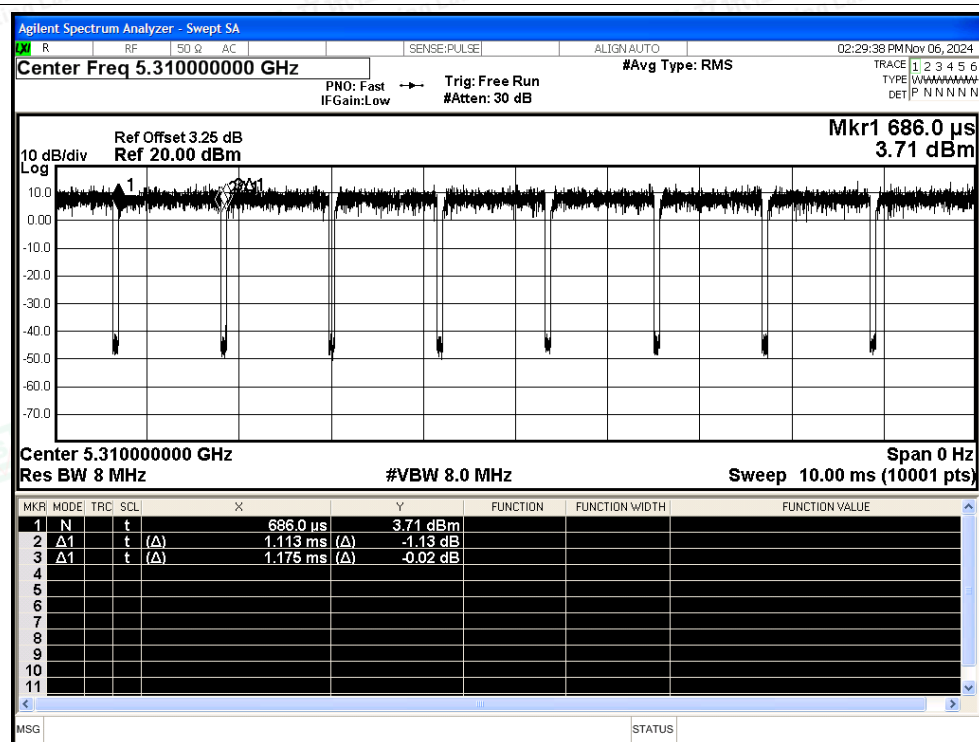

Duty Cycle NVNT ax20 5260MHz Ant2

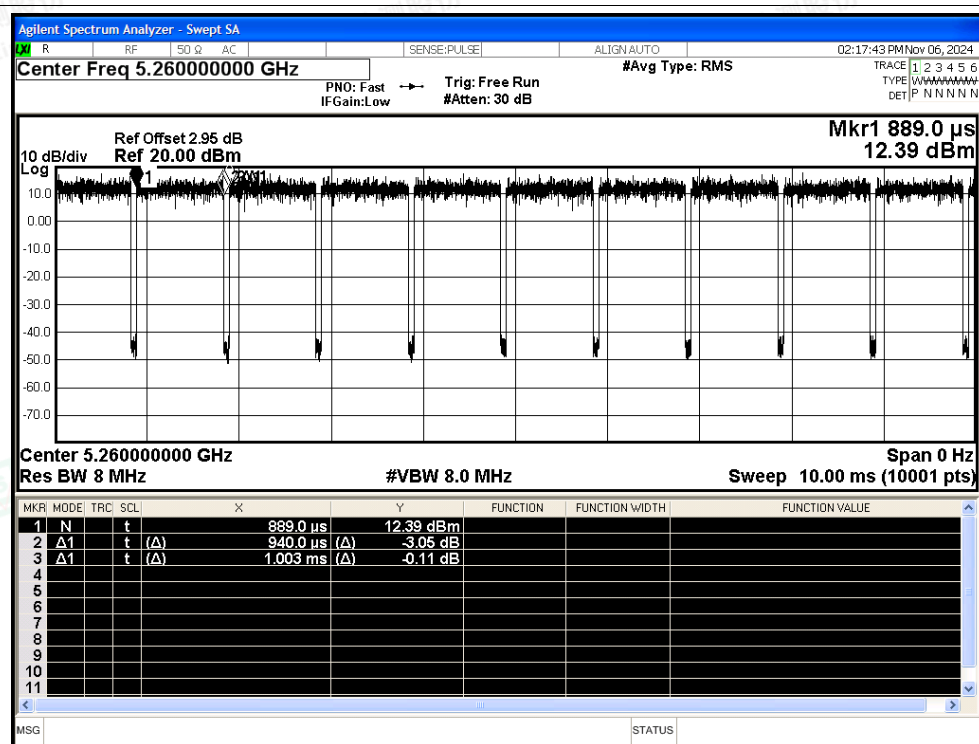

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5300MHz Ant2

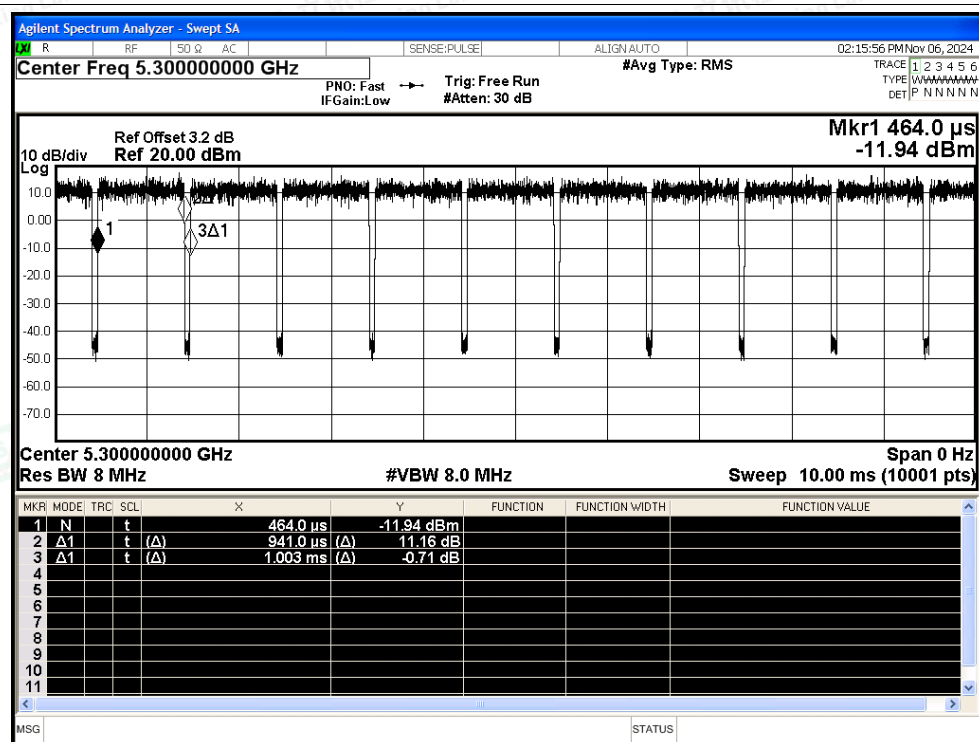

Duty Cycle NVNT ax20 5320MHz Ant2

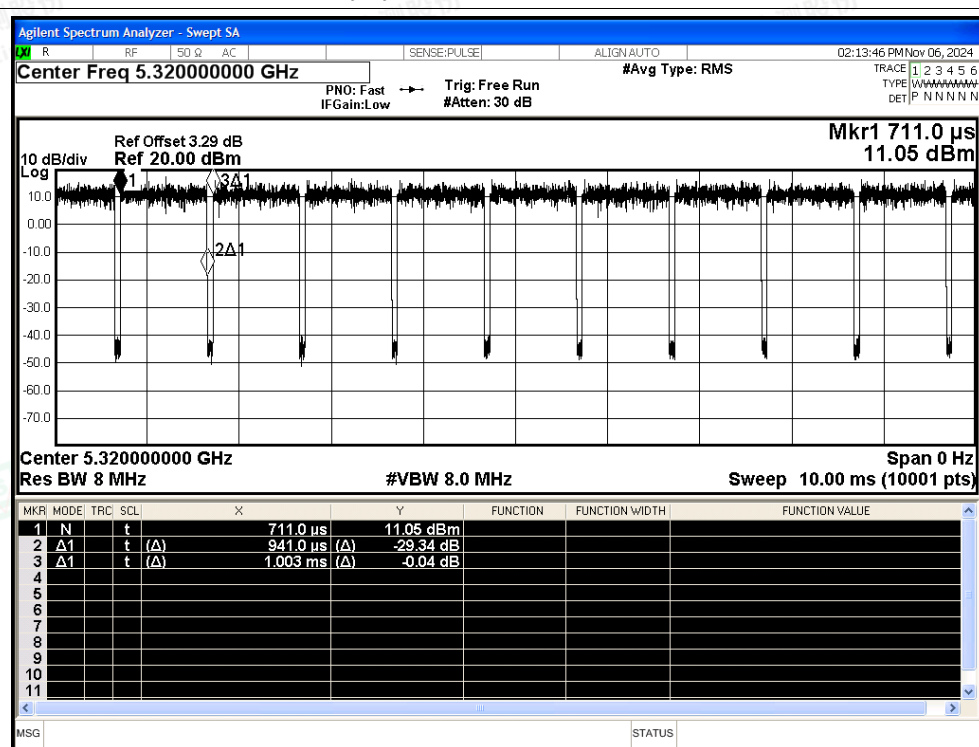

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5270MHz Ant2

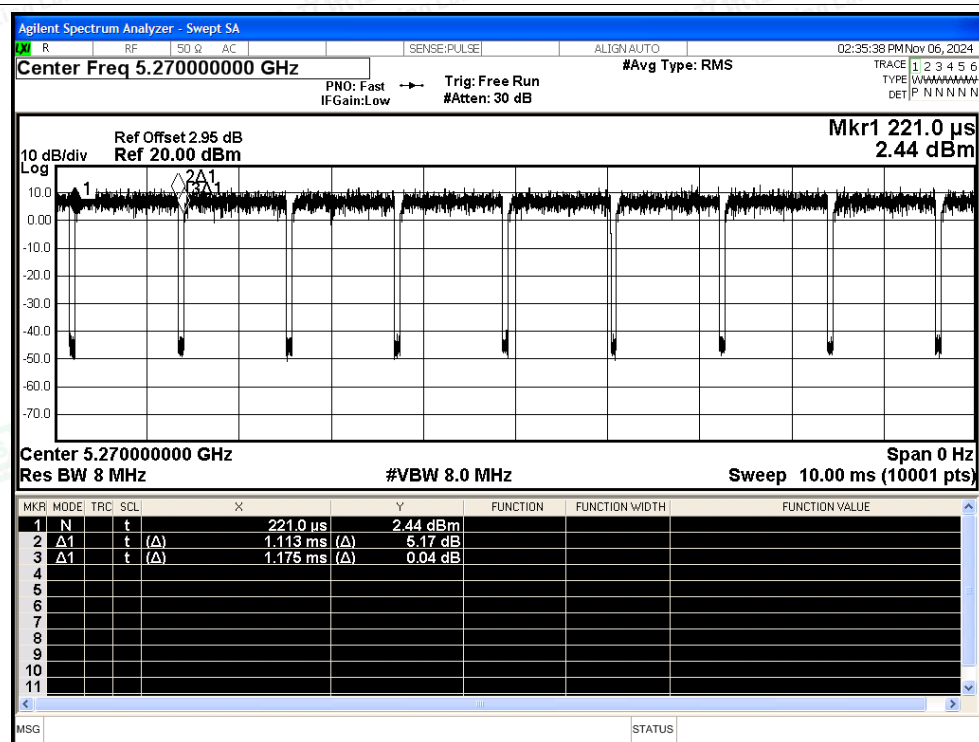

Duty Cycle NVNT ax40 5310MHz Ant2

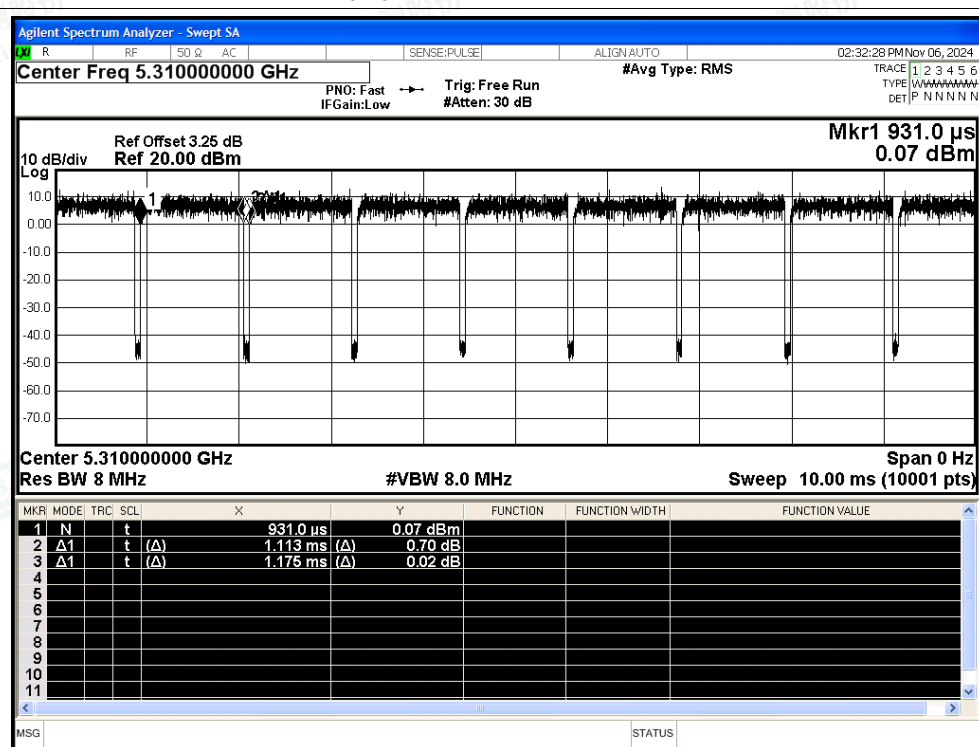

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity