
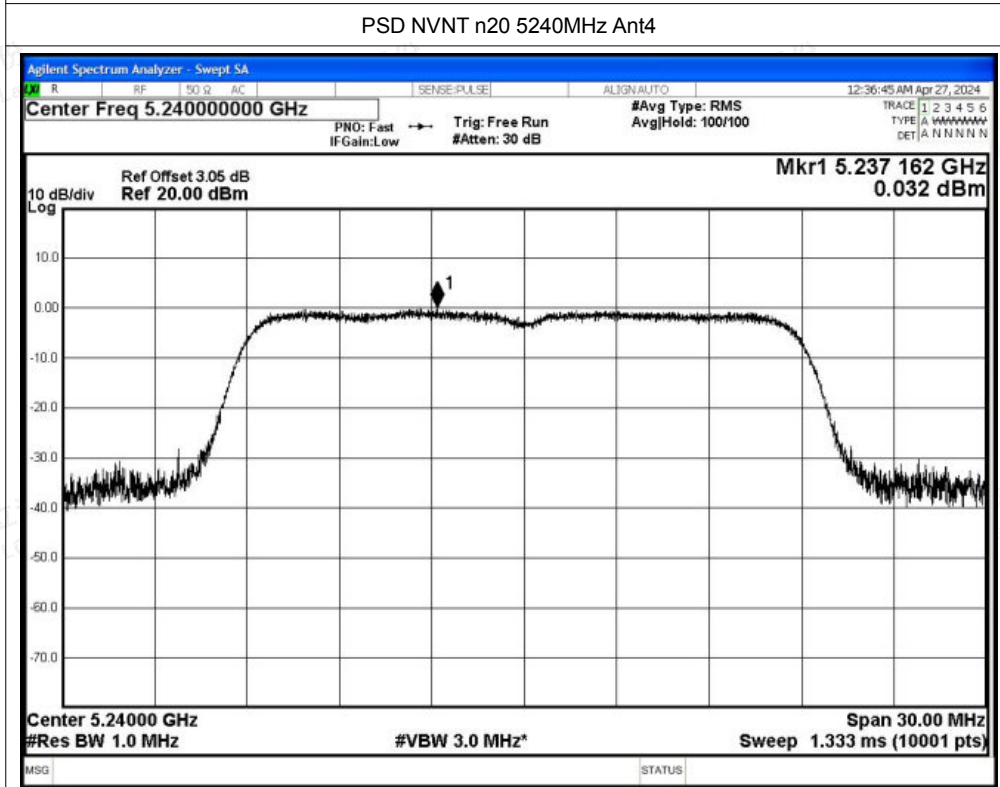



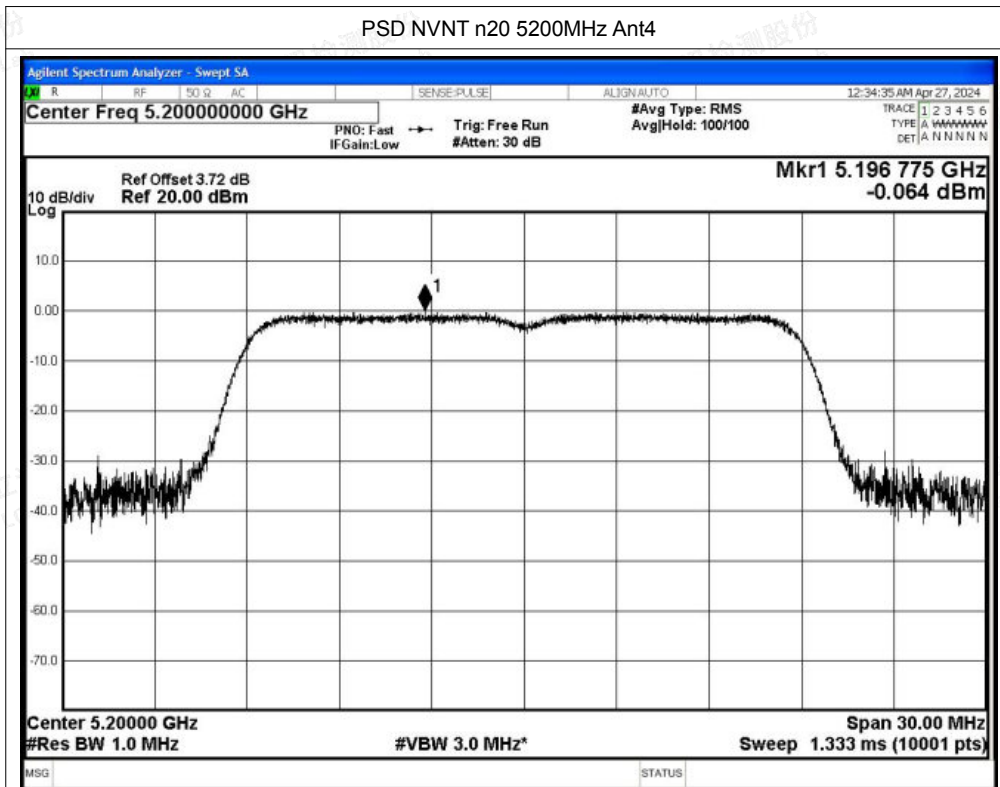


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

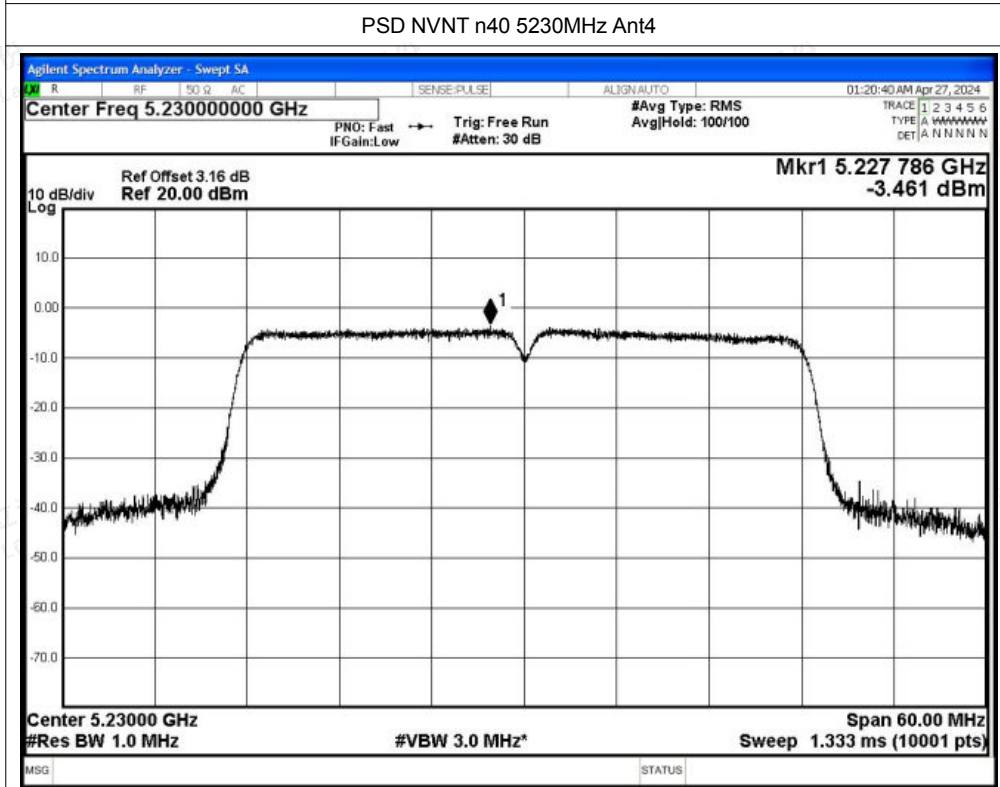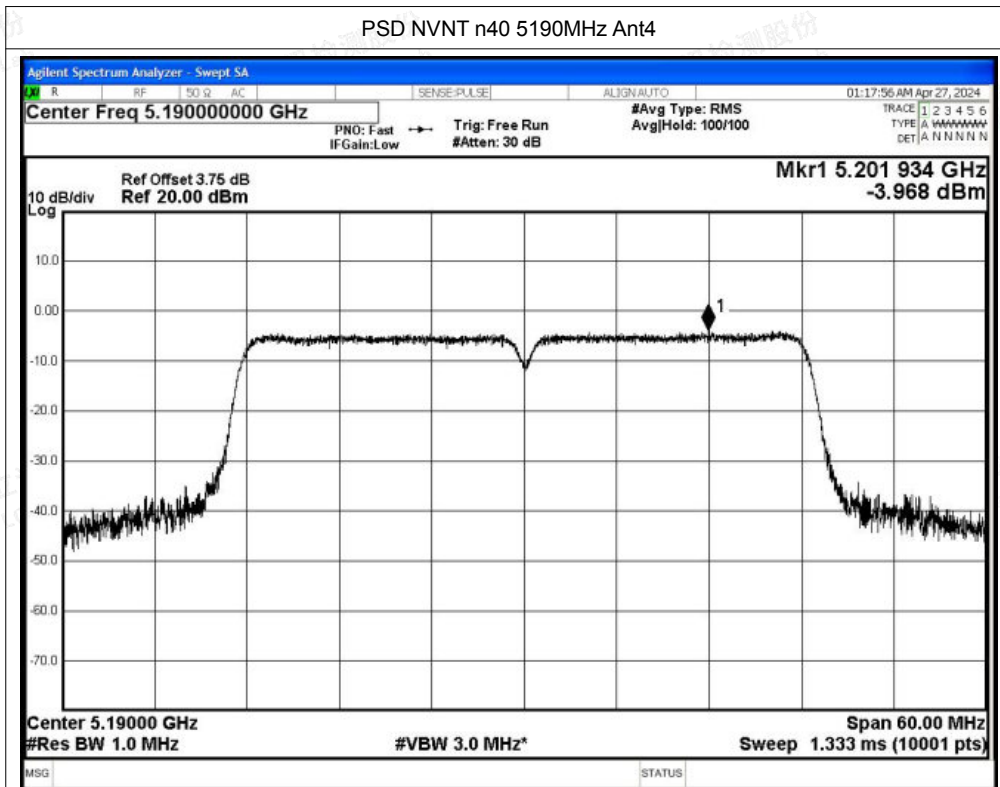

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant4

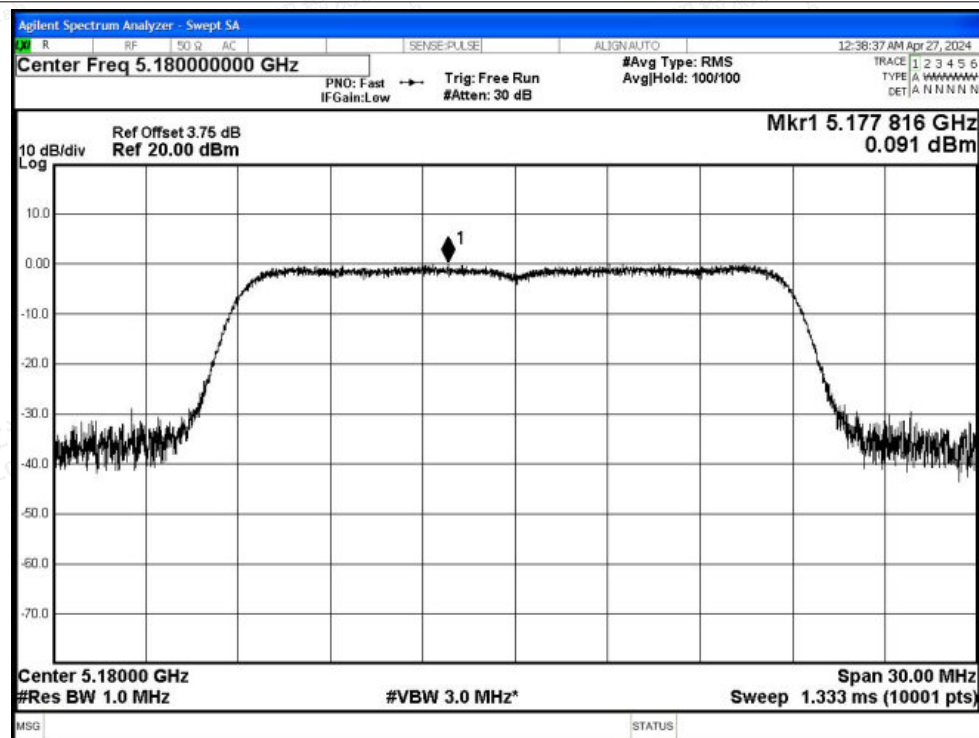

PSD NVNT ac20 5200MHz Ant4

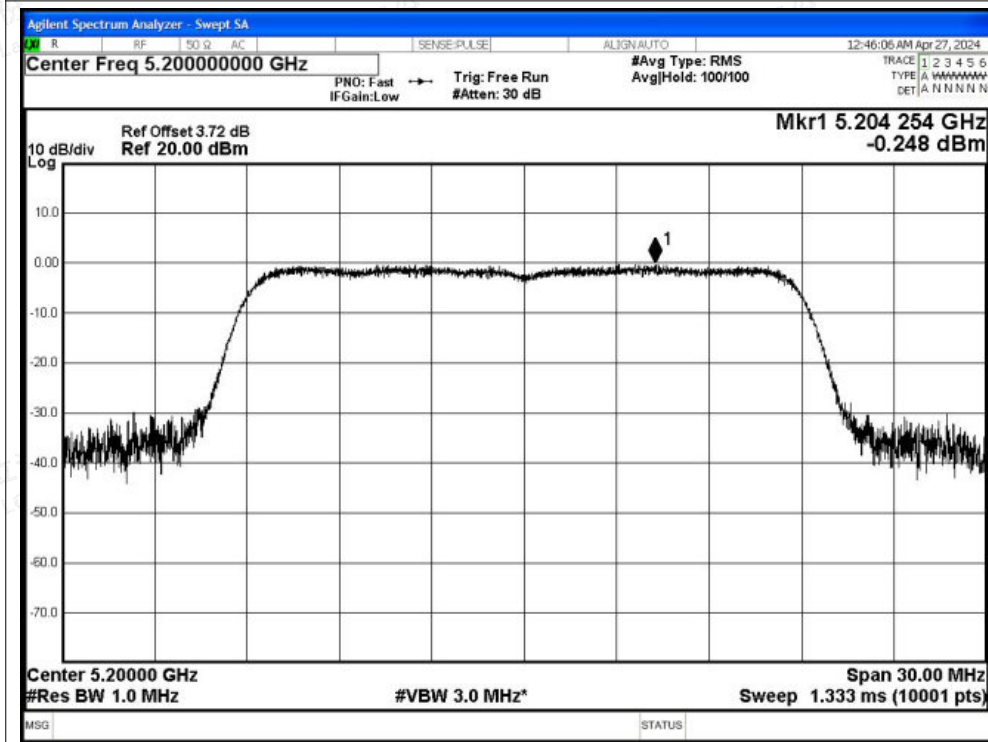

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant4

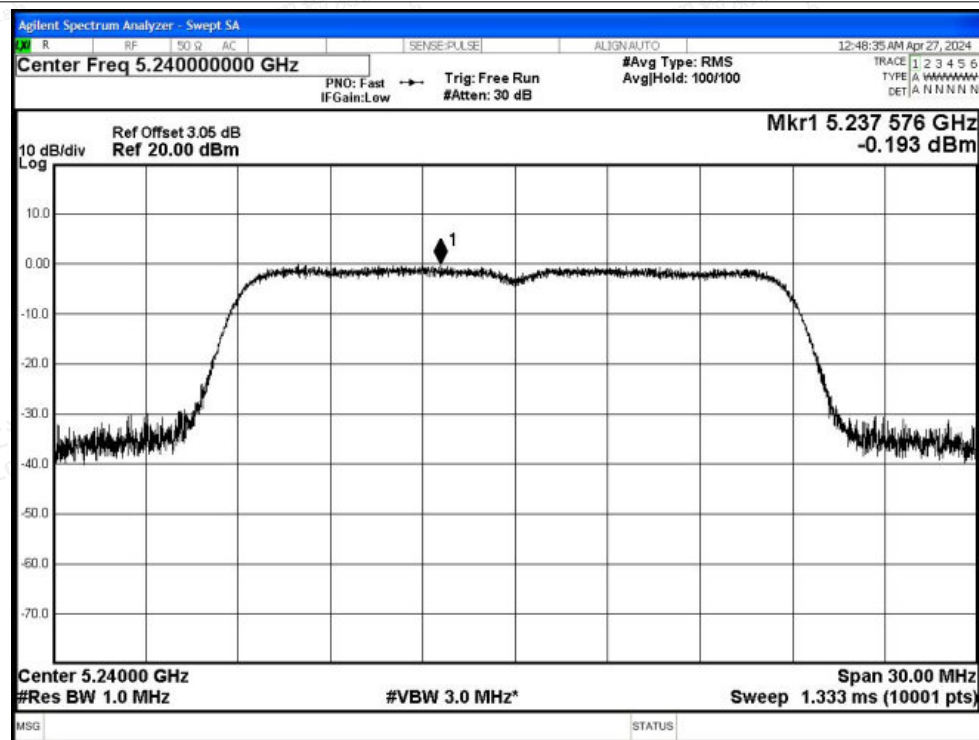

PSD NVNT ac40 5190MHz Ant4

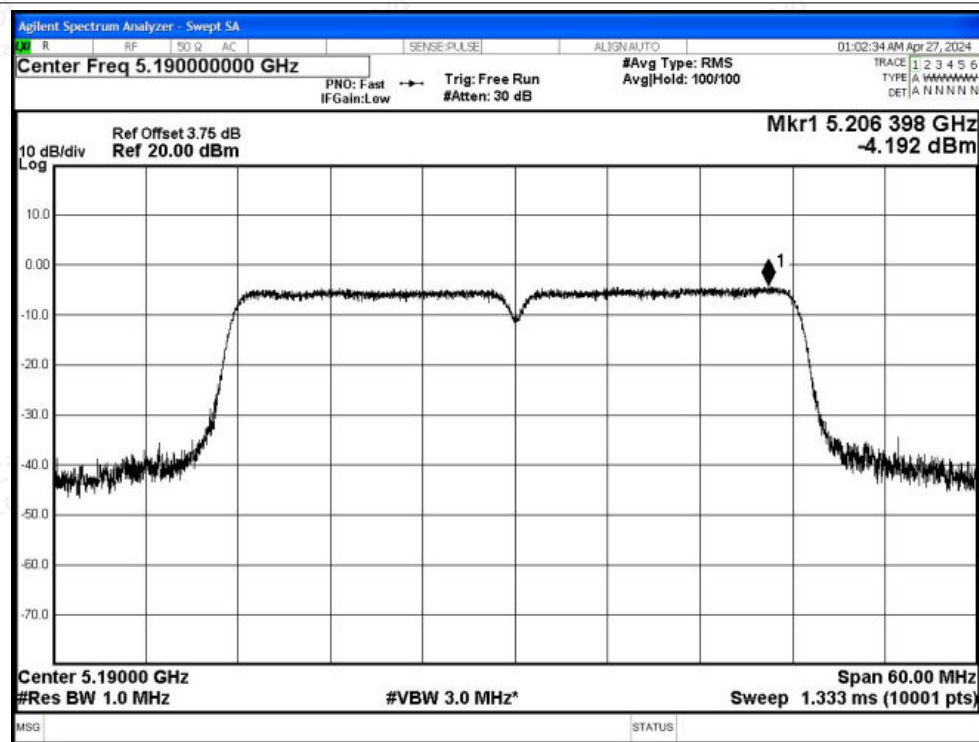

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant4

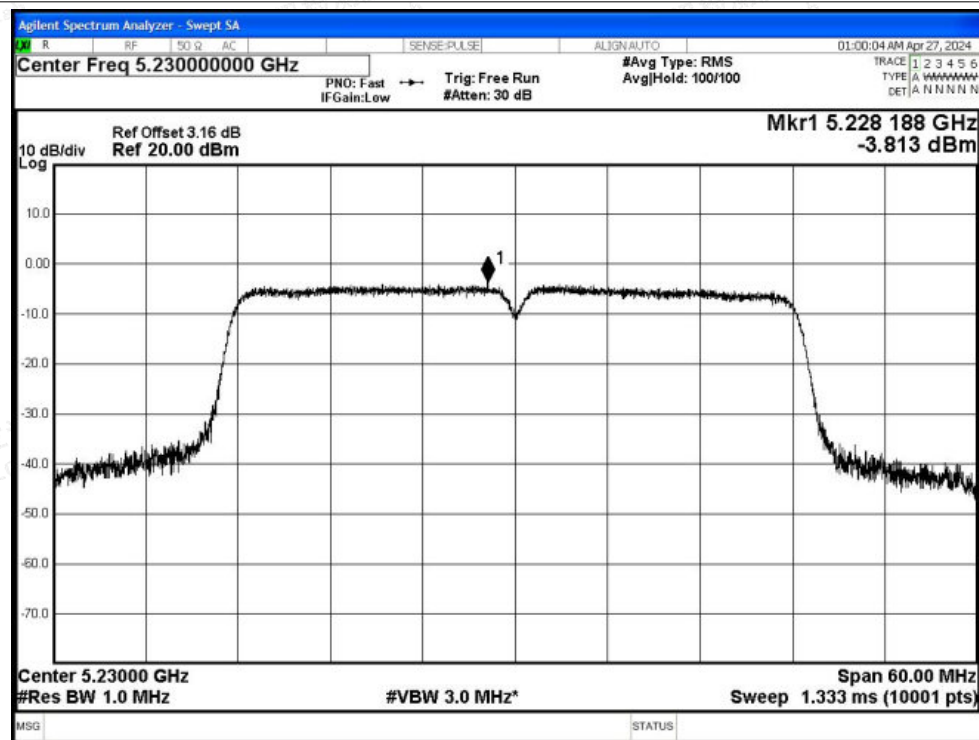

PSD NVNT ac80 5210MHz Ant4

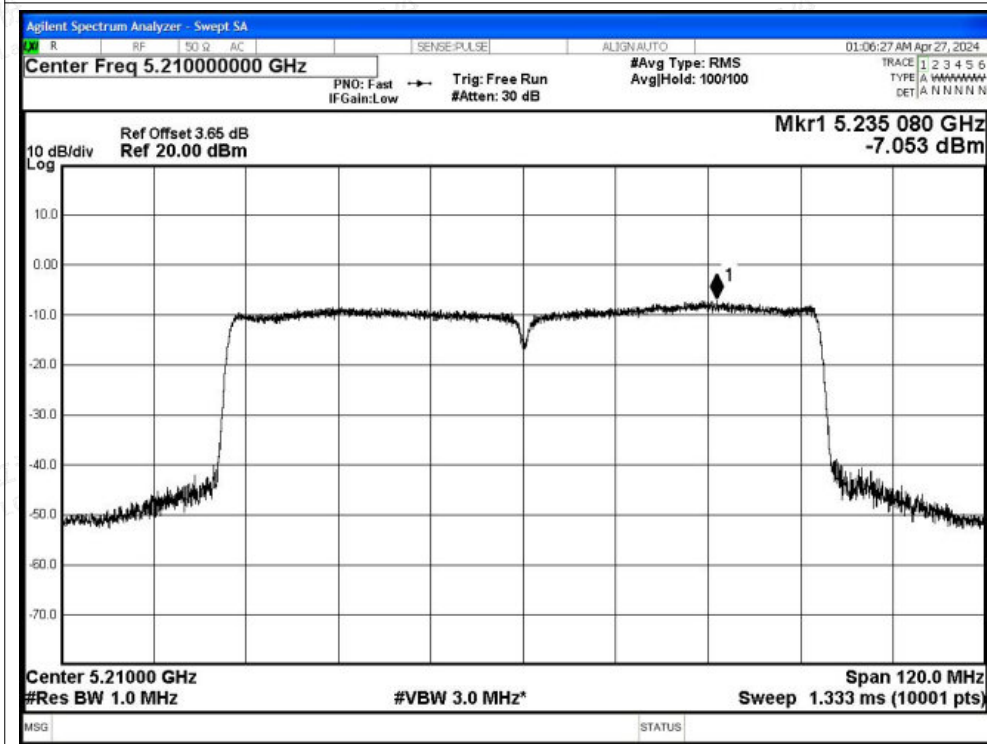

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-49.67	5.04	-	50.63	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-59.19	5.04	0.24	41.35	Average	54	Pass
NVNT	a	5180	Ant3	5068.4	-45.85	5.04	-	54.45	Peak	68.2	Pass
NVNT	a	5180	Ant3	5147.5	-55.45	5.04	0.24	45.09	Average	54	Pass
NVNT	a	5180	Ant3	5150	-46.42	5.04	-	53.88	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-56.11	5.04	0.24	44.43	Average	54	Pass
NVNT	a	5240	Ant3	5350	-47.46	5.04	-	52.84	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-56.62	5.04	0.24	43.92	Average	54	Pass
NVNT	a	5240	Ant3	5425.2	-47.25	5.04	-	53.05	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350.32	-56.57	5.04	0.24	43.97	Average	54	Pass
NVNT	a	5240	Ant3	5460	-50.31	5.04	-	49.99	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-58.4	5.04	0.24	42.14	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-51.48	5.04	-	48.82	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-58.73	5.04	0.28	41.85	Average	54	Pass
NVNT	n20	5180	Ant3	5148.9	-44.67	5.04	-	55.63	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5148.9	-55.97	5.04	0.28	44.61	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-45.42	5.04	-	54.88	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-56.4	5.04	0.28	44.18	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-48.6	5.04	-	51.7	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-57.38	5.04	0.28	43.2	Average	54	Pass
NVNT	n20	5240	Ant3	5423.76	-47.38	5.04	-	52.92	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5351.76	-56.48	5.04	0.28	44.1	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-49.94	5.04	-	50.36	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-58.13	5.04	0.28	42.45	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-50.86	5.04	-	49.44	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-58.48	5.04	0.24	42.06	Average	54	Pass
NVNT	n40	5190	Ant3	5148.97	-45.13	5.04	-	55.17	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5149.7	-54.92	5.04	0.24	45.62	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-45.78	5.04	-	54.52	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-54.92	5.04	0.24	45.62	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-49.81	5.04	-	50.49	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-57.16	5.04	0.24	43.38	Average	54	Pass
NVNT	n40	5230	Ant3	5383.05	-47.72	5.04	-	52.58	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5390.07	-56.9	5.04	0.24	43.64	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-50.91	5.04	-	49.39	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-58.25	5.04	0.24	42.29	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-49.75	5.04	-	50.55	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	4500	-58.24	5.04	0.28	42.34	Average	54	Pass
NVNT	ac20	5180	Ant3	5148.9	-43.66	5.04	-	56.64	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5149.6	-55.19	5.04	0.28	45.39	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-46.52	5.04	-	53.78	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-54.96	5.04	0.28	45.62	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-47.73	5.04	-	52.57	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-57.06	5.04	0.28	43.52	Average	54	Pass
NVNT	ac20	5240	Ant3	5455.92	-46.77	5.04	-	53.53	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350.56	-56.72	5.04	0.28	43.86	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-51.03	5.04	-	49.27	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-57.71	5.04	0.28	42.87	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-49.88	5.04	-	50.42	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-58.32	5.04	0.23	42.21	Average	54	Pass
NVNT	ac40	5190	Ant3	5145.32	-40.63	5.04	-	59.67	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5149.7	-52.93	5.04	0.23	47.6	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-41.22	5.04	-	59.08	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-52.93	5.04	0.23	47.6	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-49.84	5.04	-	50.46	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-57.62	5.04	0.24	42.92	Average	54	Pass
NVNT	ac40	5230	Ant3	5377.65	-47.54	5.04	-	52.76	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5369.28	-57.12	5.04	0.24	43.42	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-49.58	5.04	-	50.72	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-57.79	5.04	0.24	42.75	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-47.84	5.04	-	52.46	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-56.48	5.04	0.25	44.07	Average	54	Pass
NVNT	ac80	5210	Ant3	5353.74	-45.46	5.04	-	54.84	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5351.43	-55.75	5.04	0.25	44.8	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-49.1	5.04	-	51.2	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-57.6	5.04	0.25	42.95	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-51.1	5.04	-	49.2	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-58.7	5.04	0.25	41.85	Average	54	Pass
NVNT	ac80	5210	Ant3	5147.8	-44.04	5.04	-	56.26	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5147.8	-54.53	5.04	0.25	46.02	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-43.71	5.04	-	56.59	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-54.58	5.04	0.25	45.97	Average	54	Pass


Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT a 5180MHz Ant3 Peak

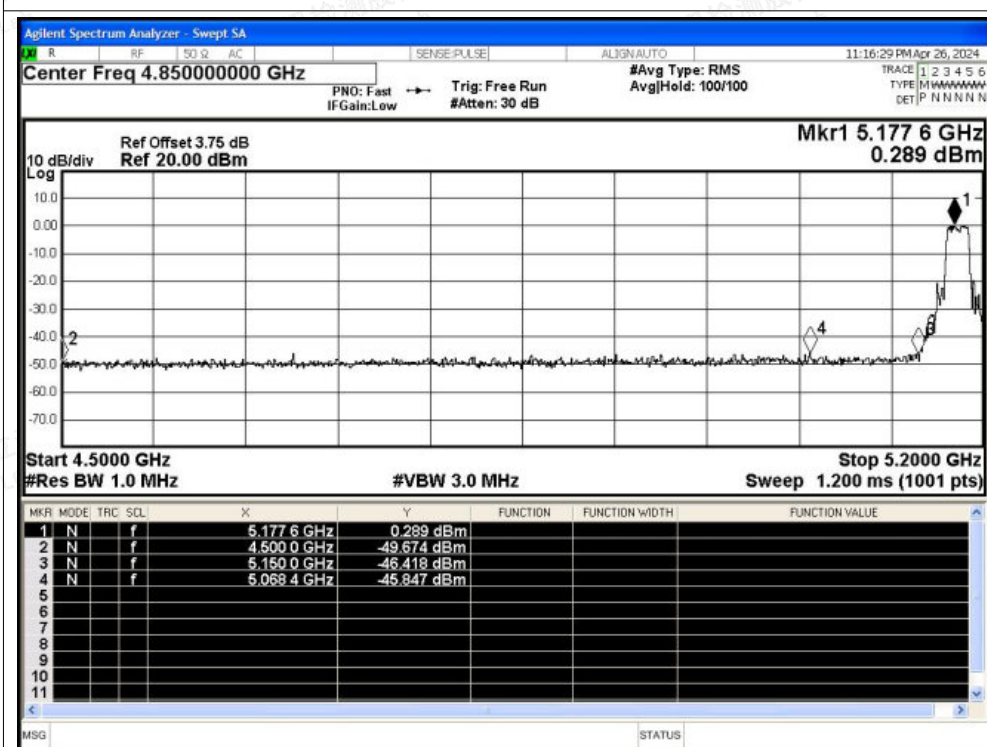

Restrict Band NVNT a 5180MHz Ant3 Average

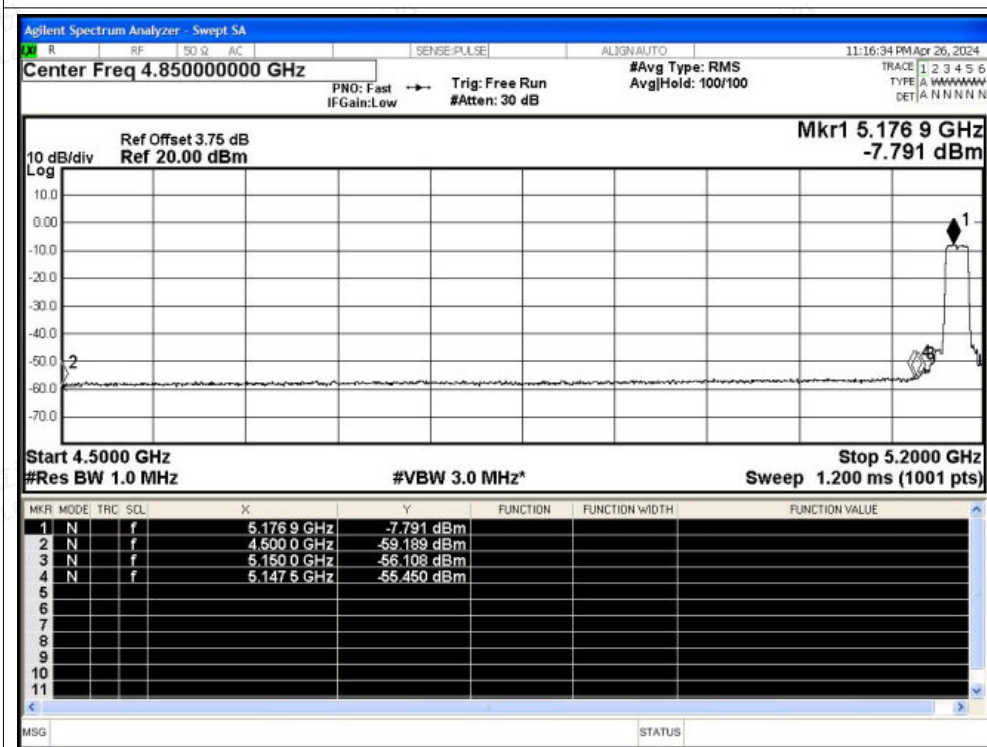

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

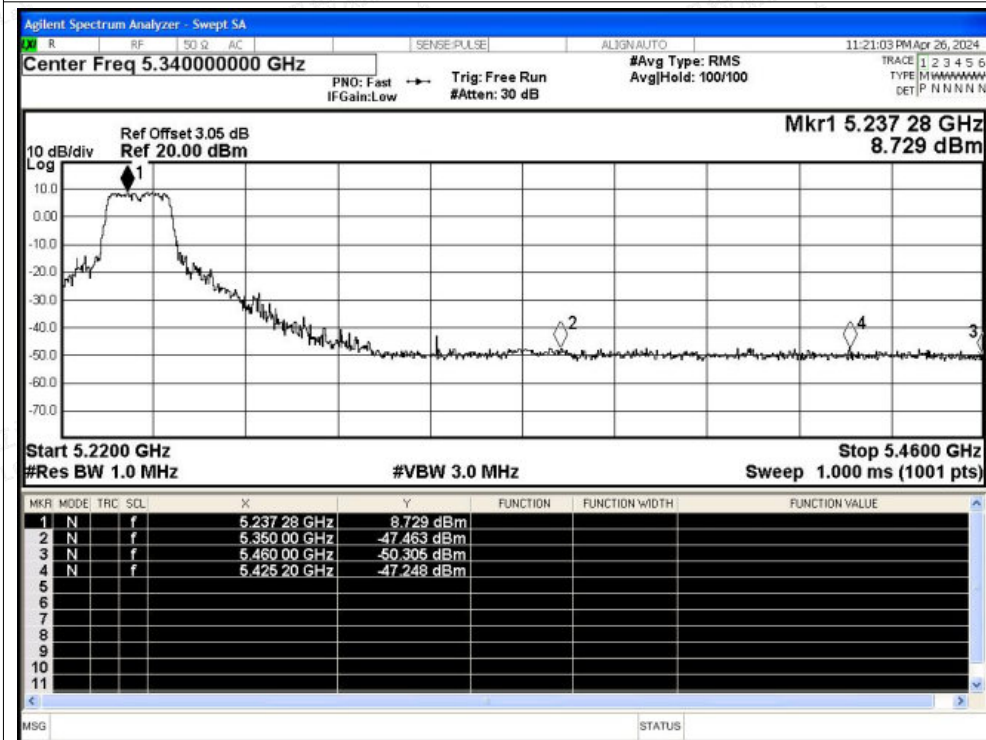

Restrict Band NVNT a 5240MHz Ant3 Average

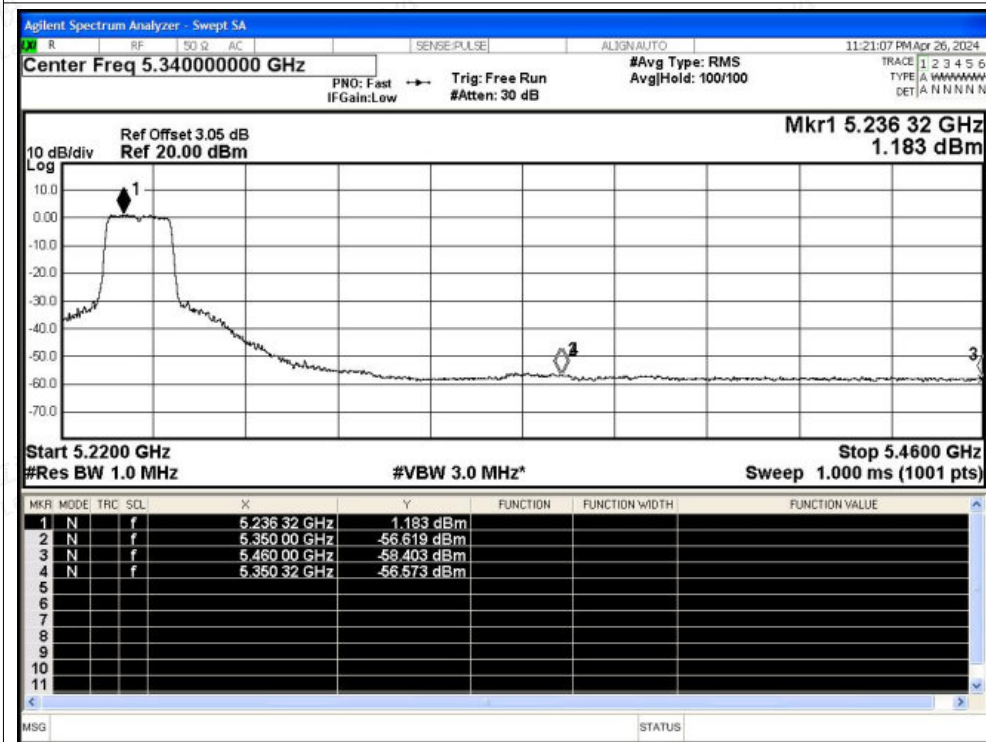

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant3 Peak

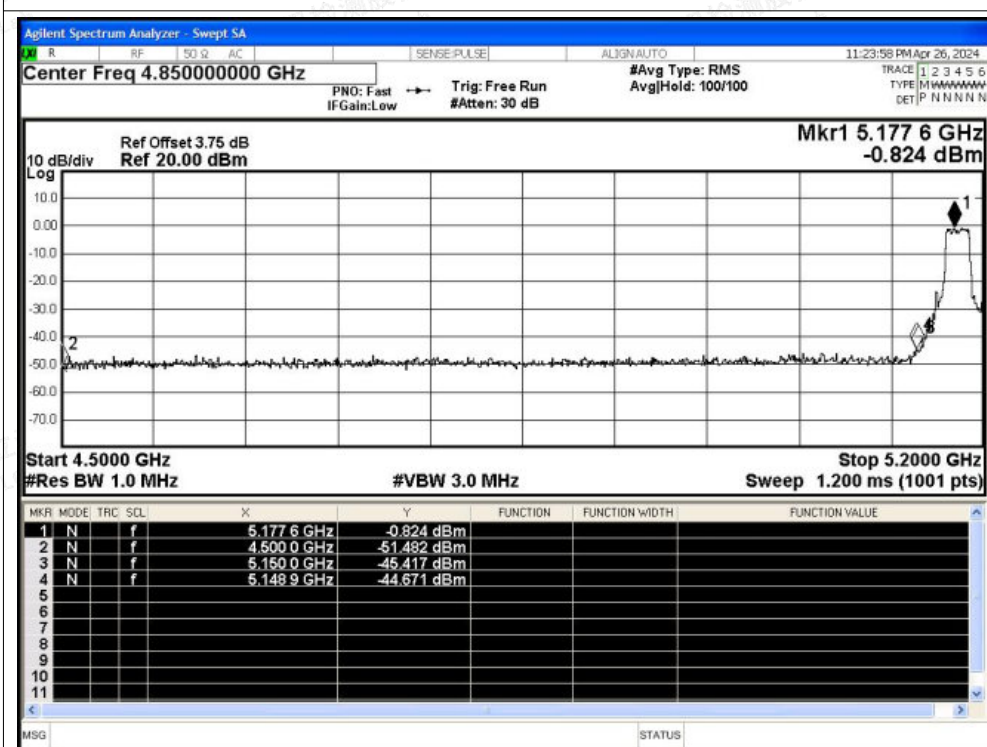

Restrict Band NVNT n20 5180MHz Ant3 Average

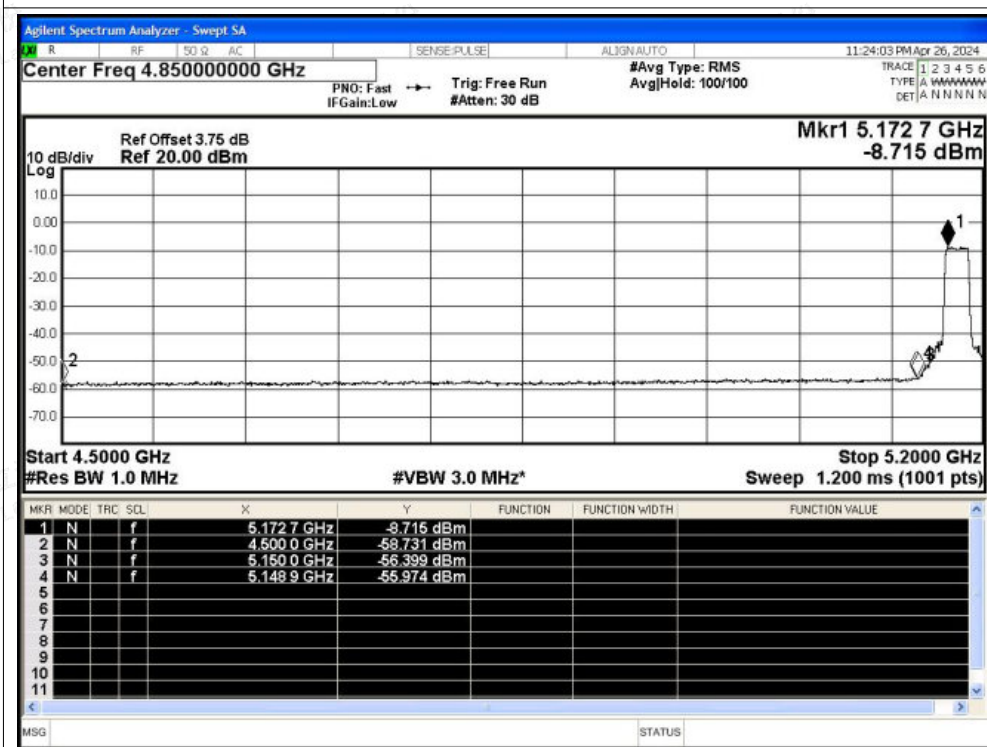

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant3 Peak

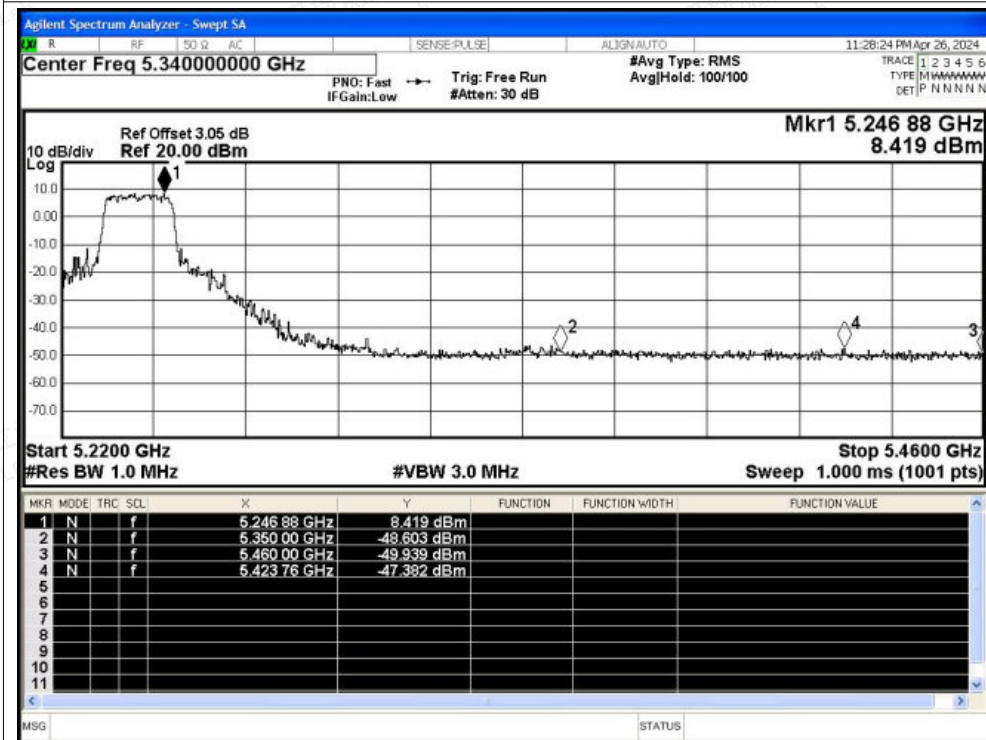

Restrict Band NVNT n20 5240MHz Ant3 Average

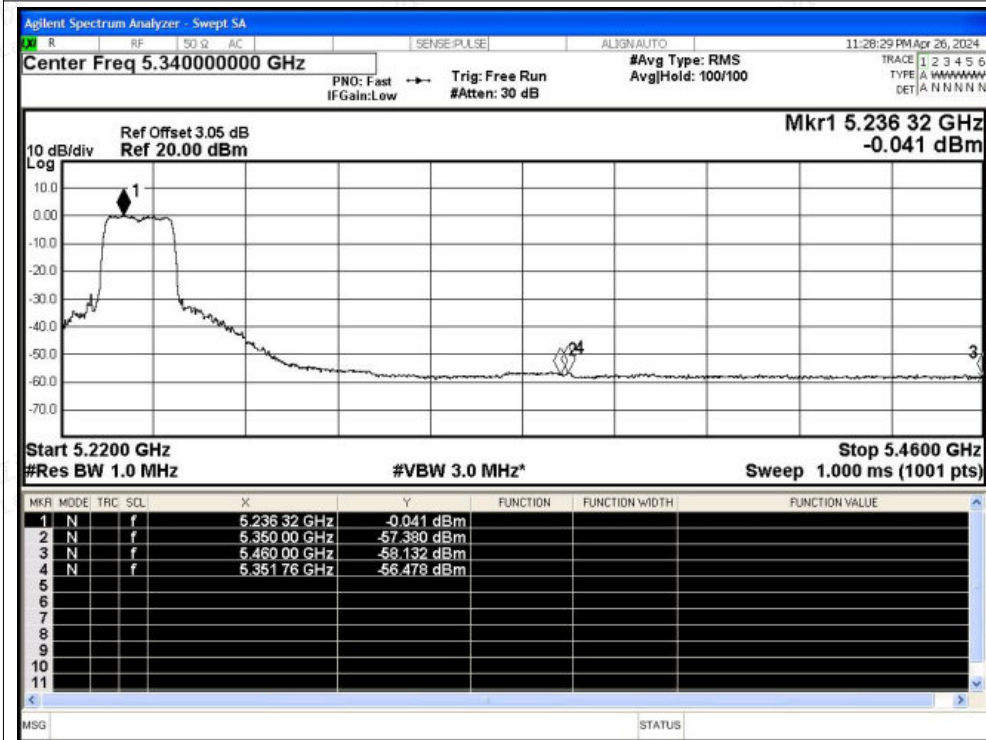

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

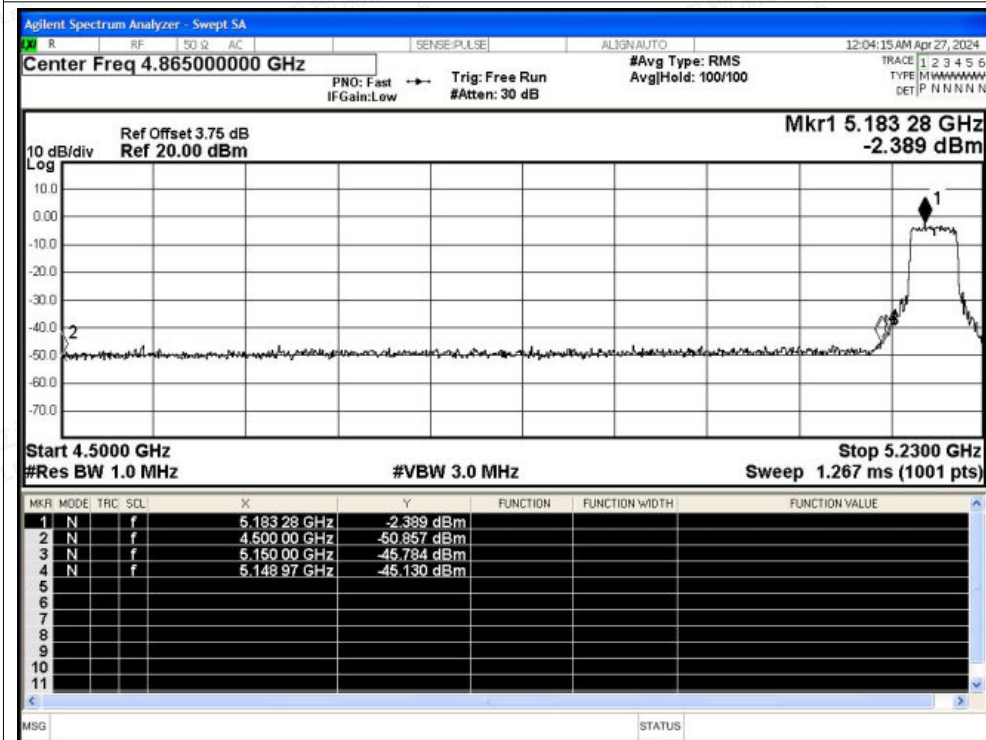

Restrict Band NVNT n40 5190MHz Ant3 Average

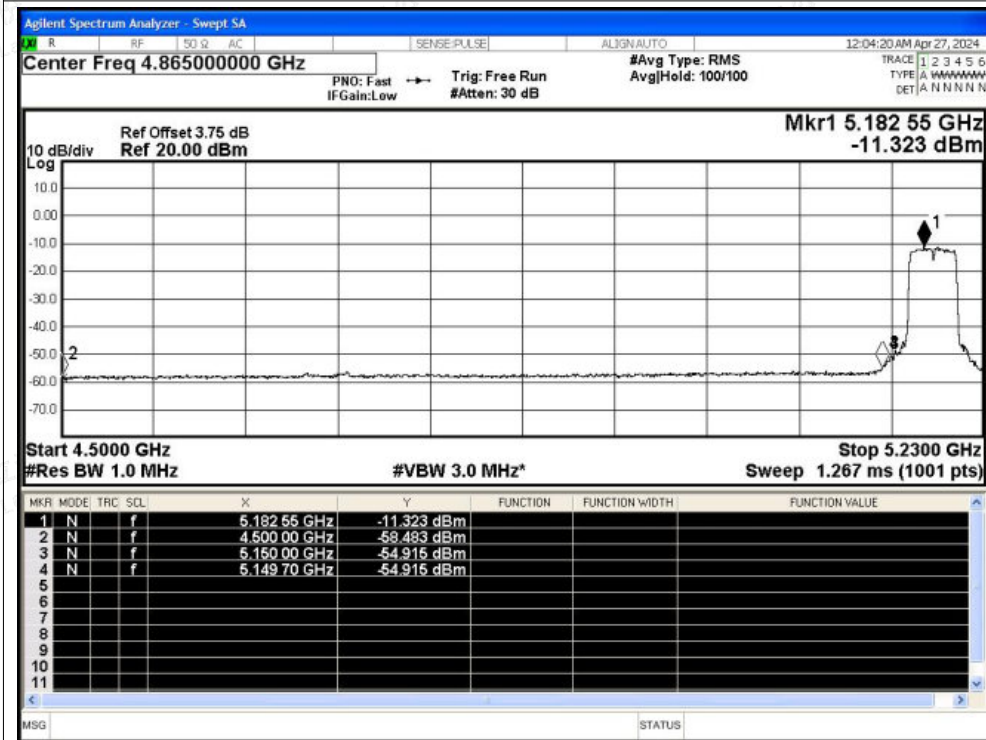

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

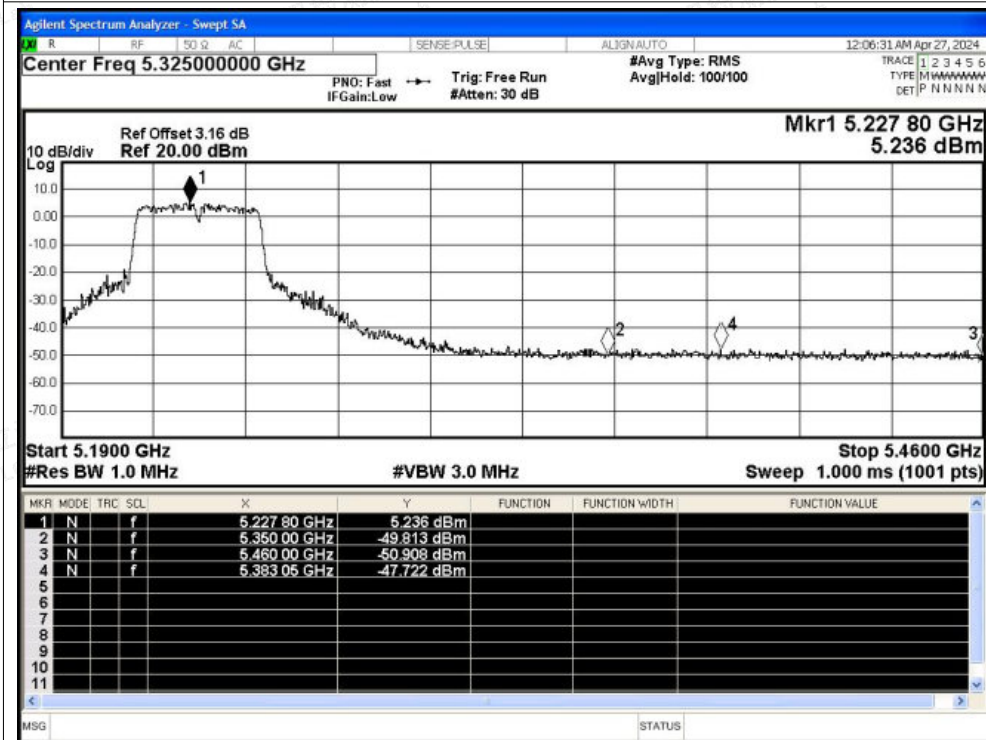

Restrict Band NVNT n40 5230MHz Ant3 Average

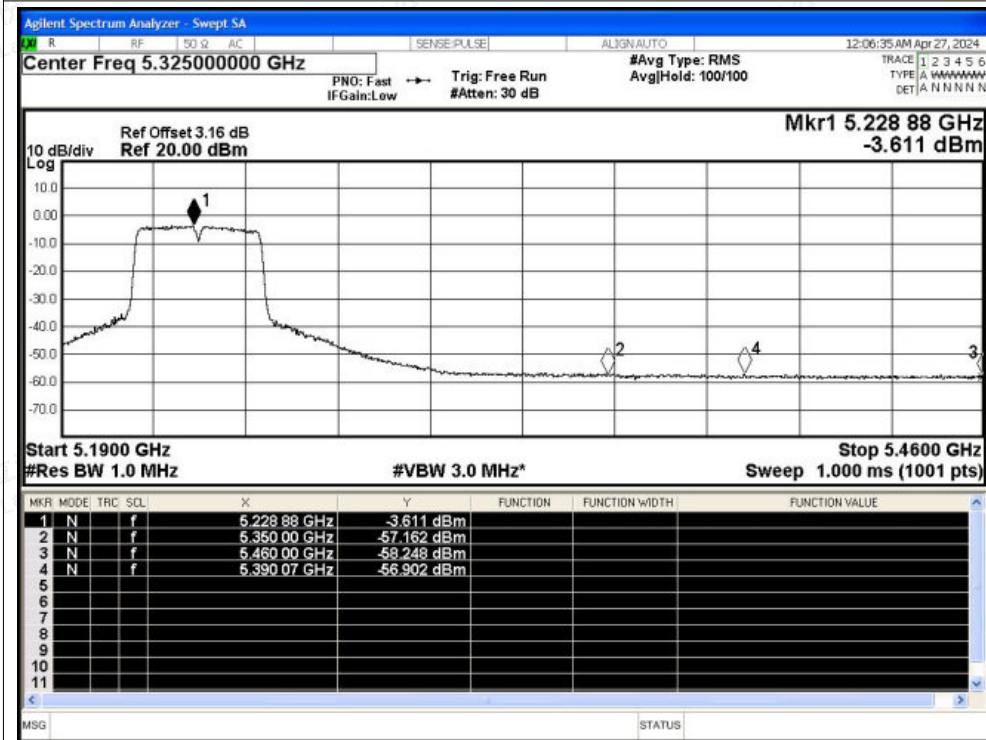

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

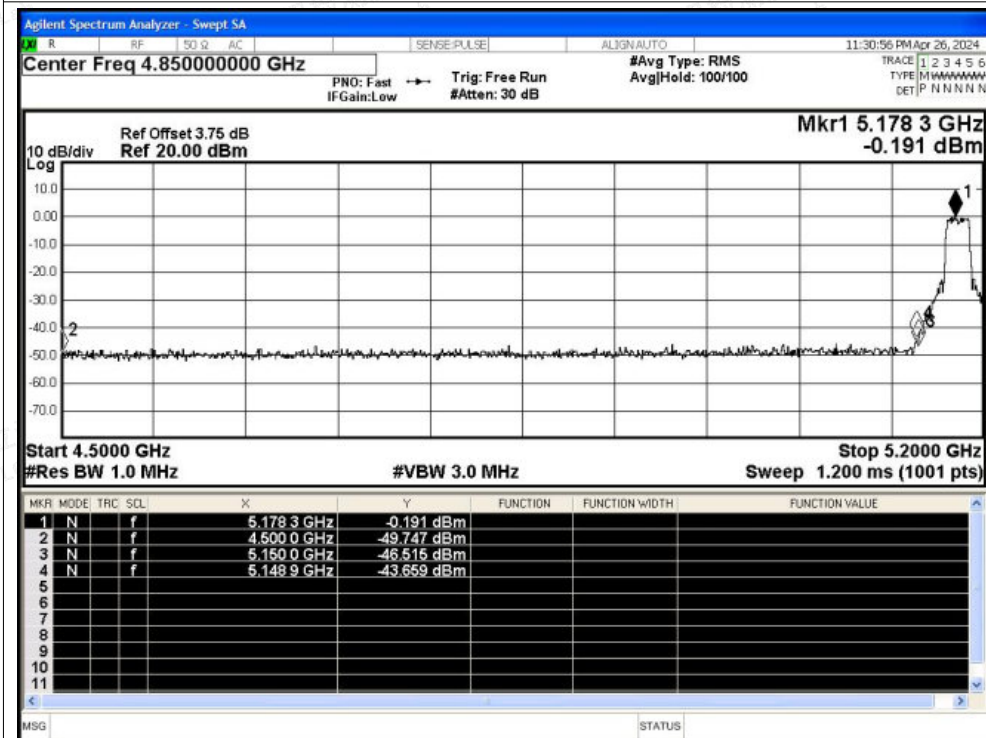

Restrict Band NVNT ac20 5180MHz Ant3 Average

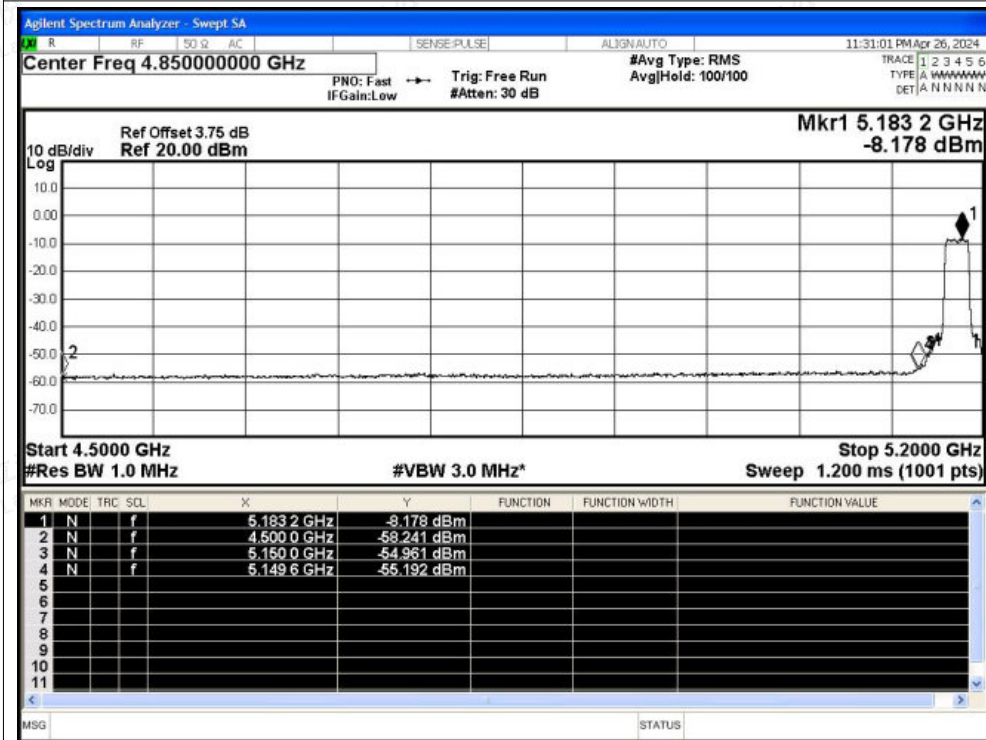

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

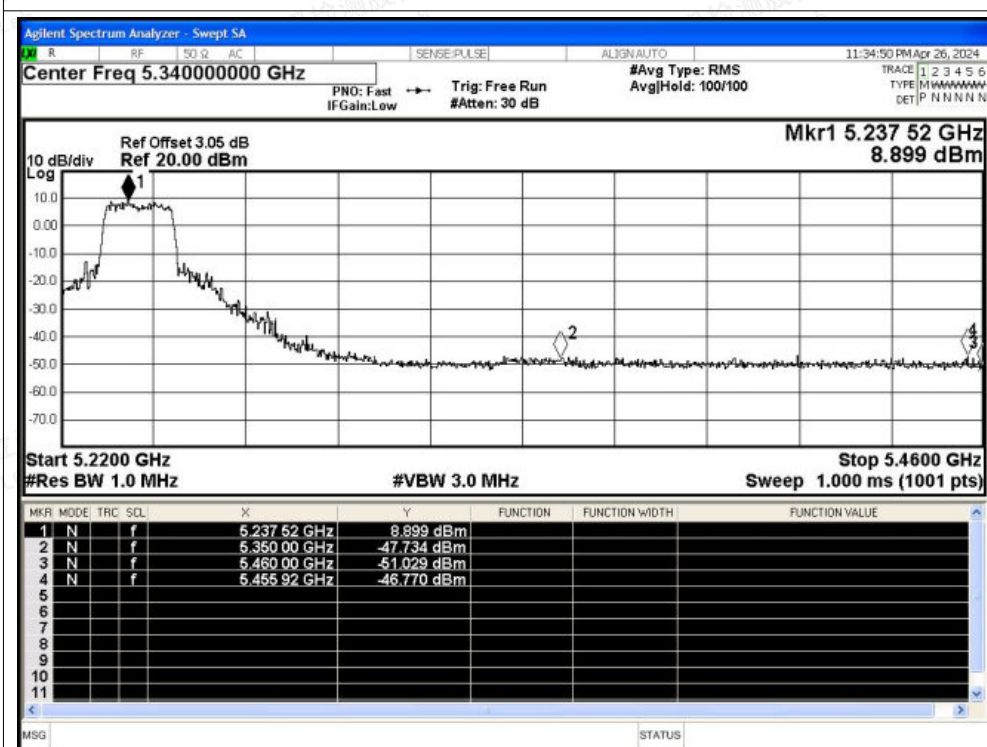

Restrict Band NVNT ac20 5240MHz Ant3 Average

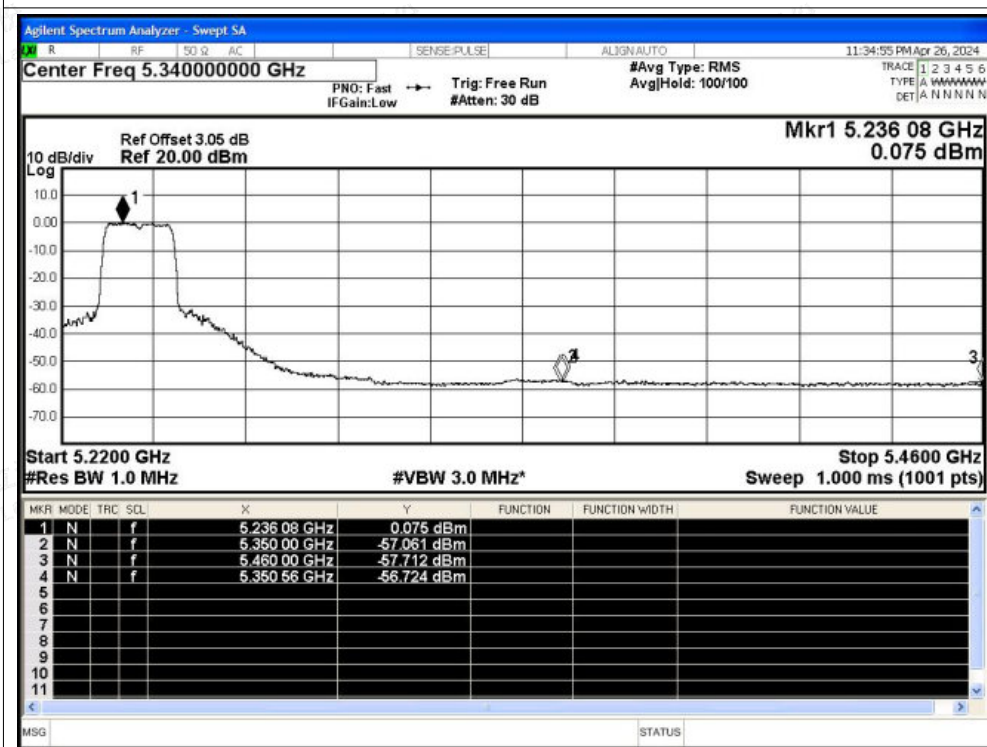

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

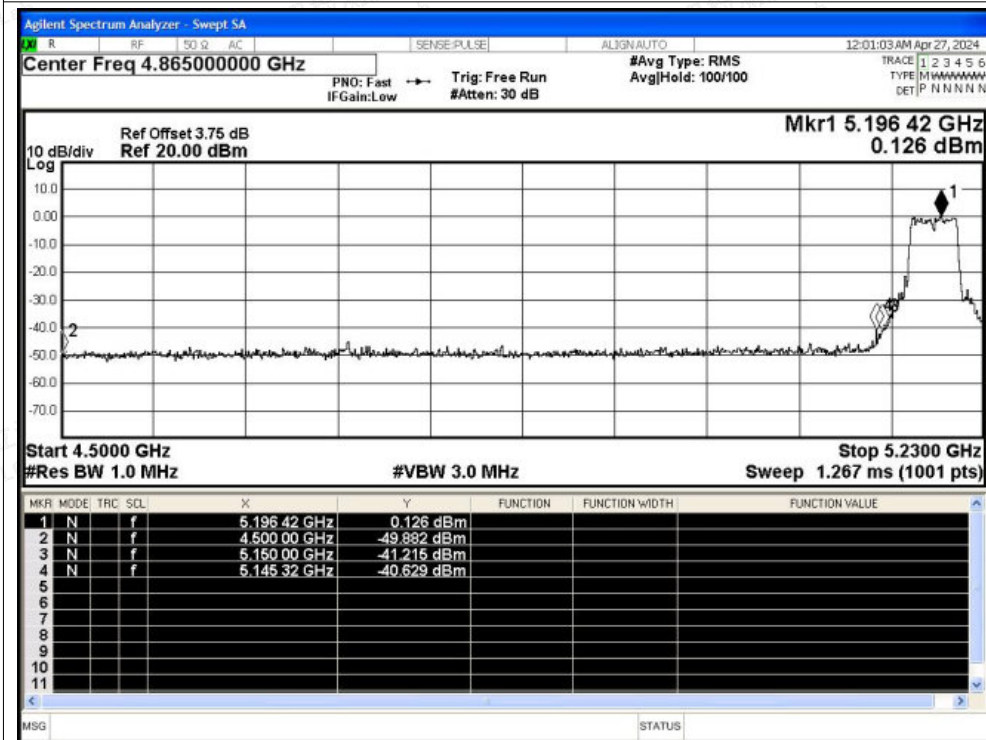

Restrict Band NVNT ac40 5190MHz Ant3 Average

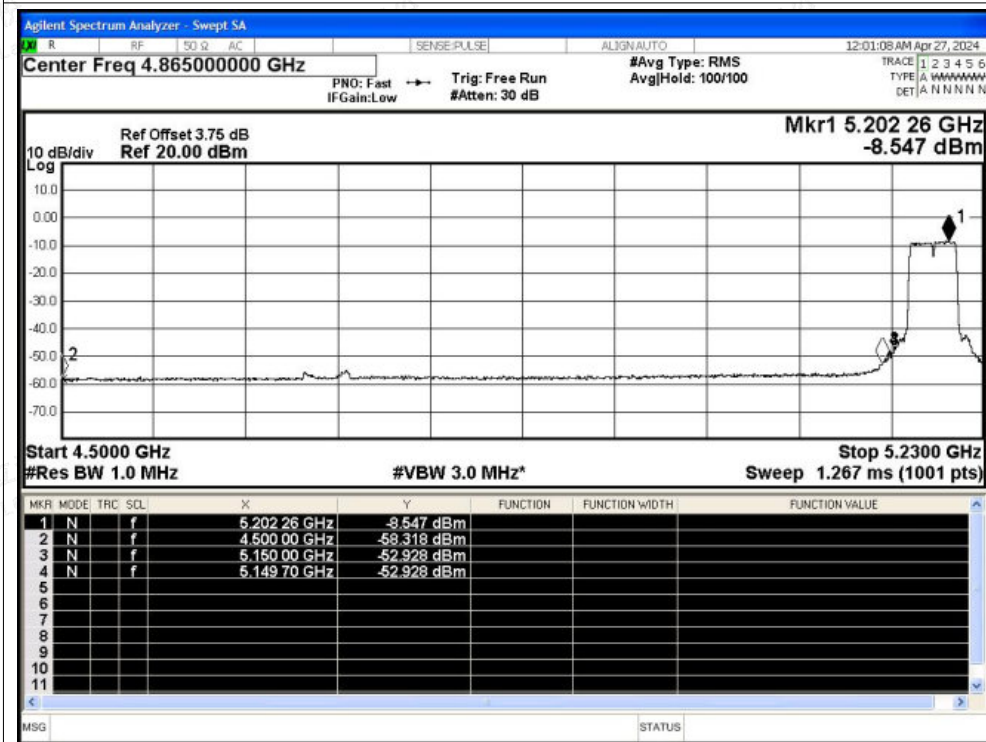

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

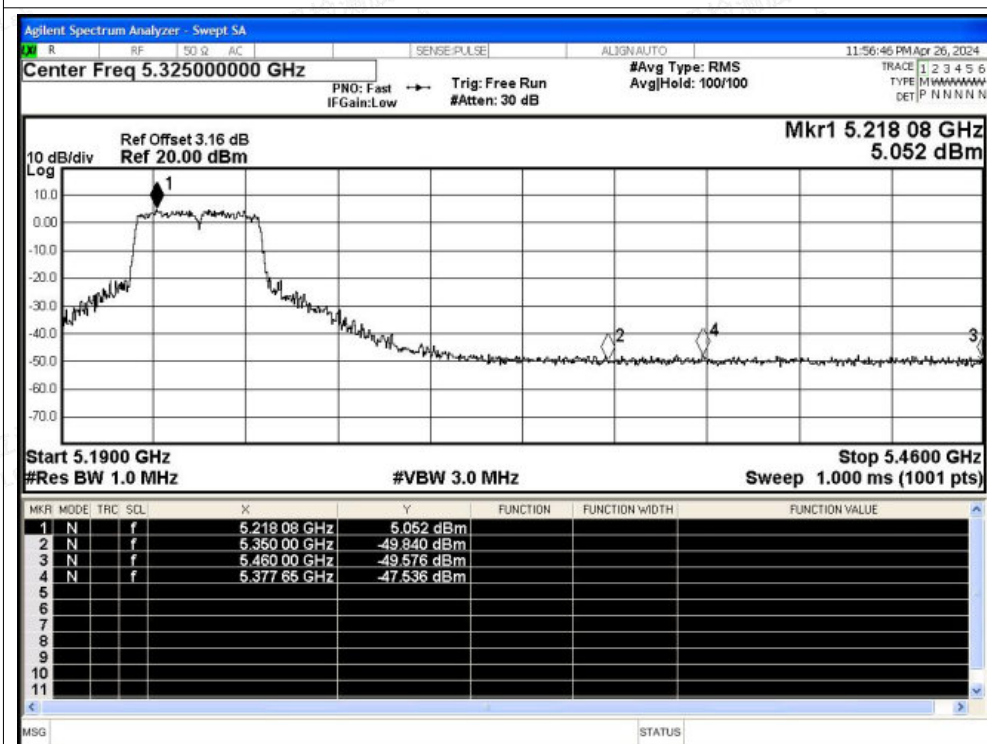

Restrict Band NVNT ac40 5230MHz Ant3 Average

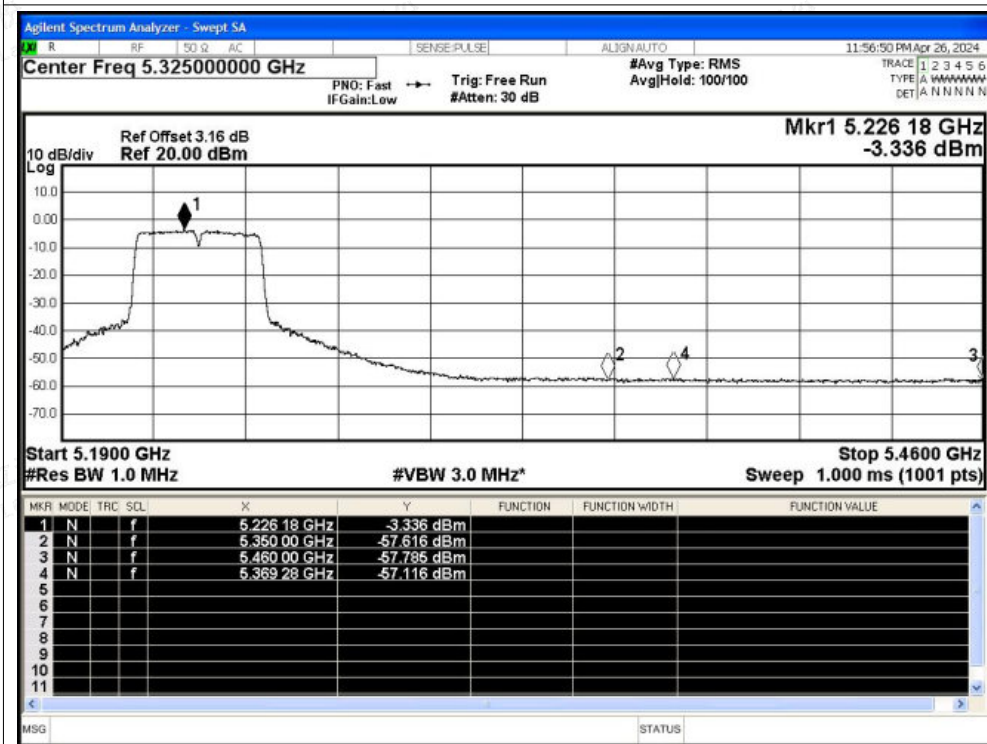

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

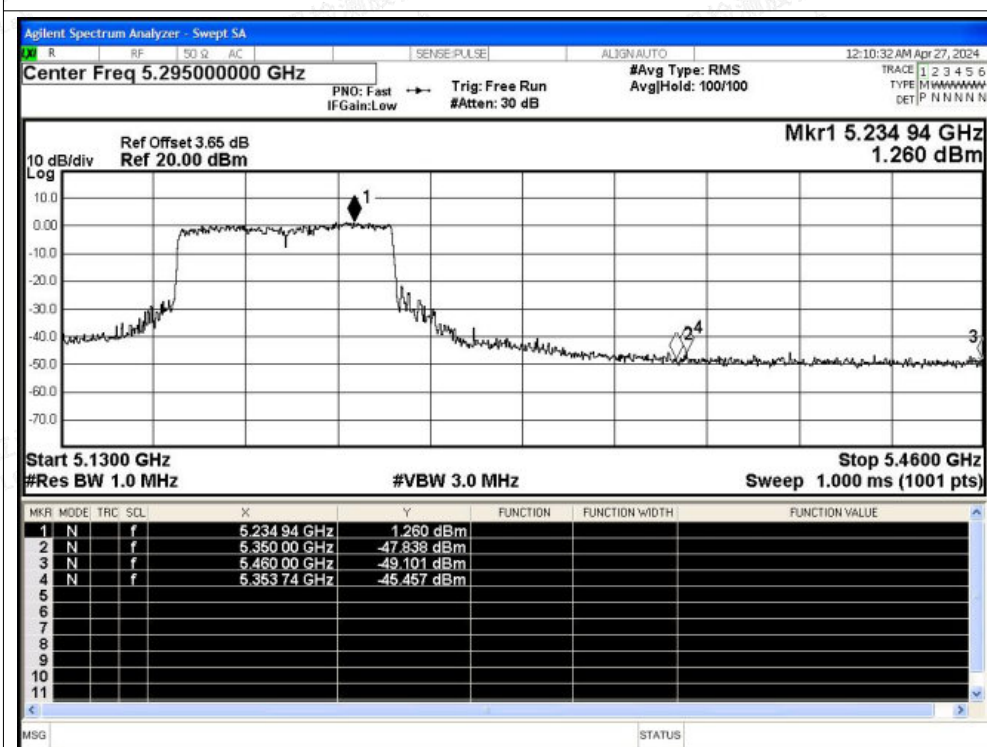

Restrict Band NVNT ac80 5210MHz Ant3 Average

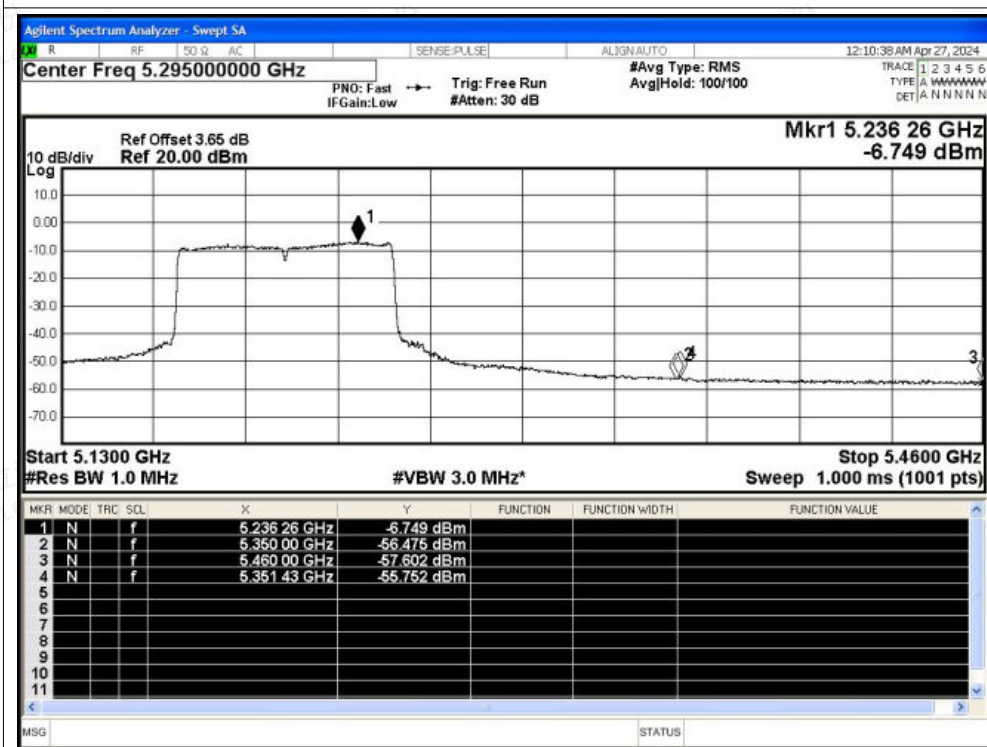

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

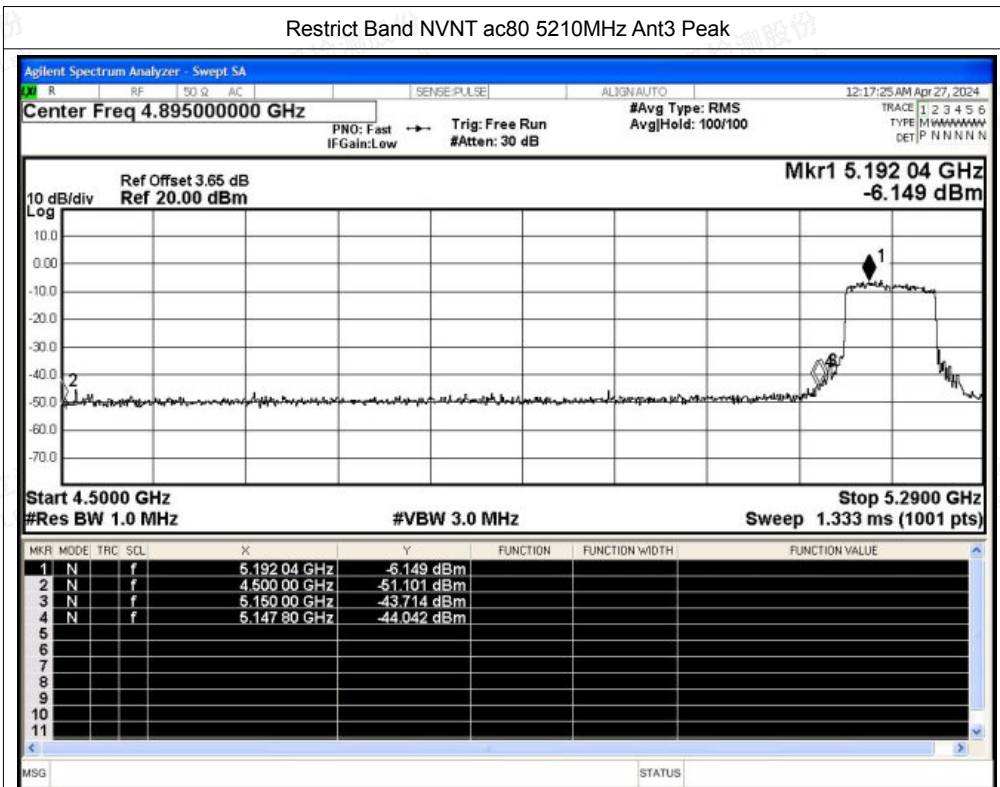

Restrict Band NVNT ac80 5210MHz Ant3 Average

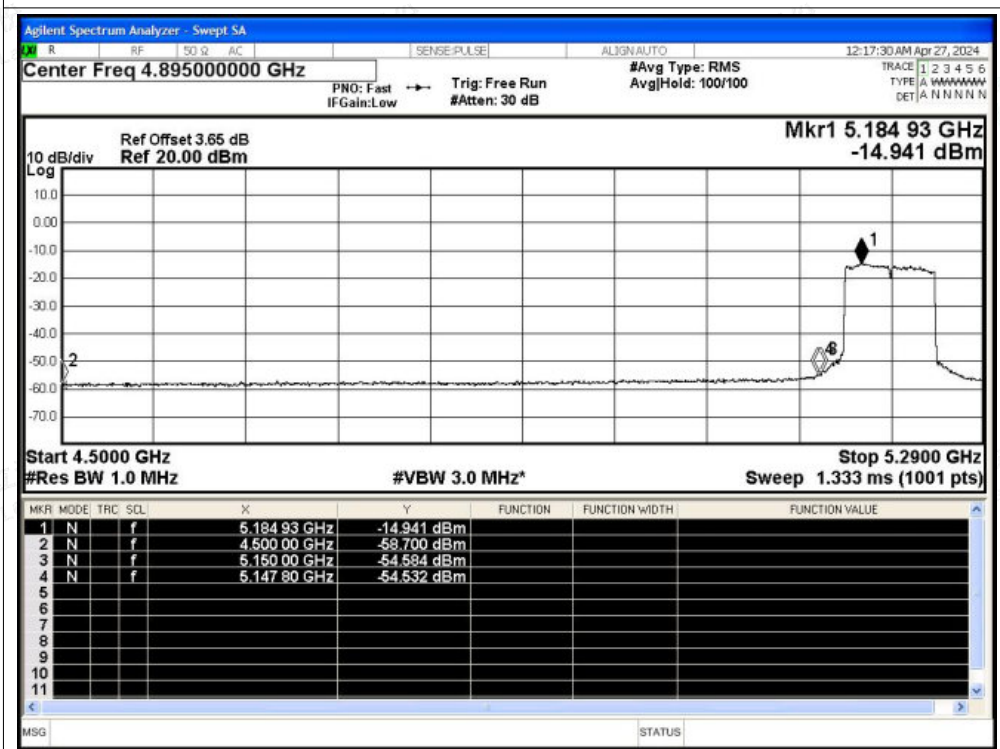

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant4	4500	-49.67	5.04	-	50.63	Peak	68.2	Pass
NVNT	a	5180	Ant4	4500	-58.62	5.04	0.24	41.92	Average	54	Pass
NVNT	a	5180	Ant4	5148.2	-44.05	5.04	-	56.25	Peak	68.2	Pass
NVNT	a	5180	Ant4	5148.2	-56.04	5.04	0.24	44.5	Average	54	Pass
NVNT	a	5180	Ant4	5150	-47.45	5.04	-	52.85	Peak	68.2	Pass
NVNT	a	5180	Ant4	5150	-56.47	5.04	0.24	44.07	Average	54	Pass
NVNT	a	5240	Ant4	5350	-47.9	5.04	-	52.4	Peak	68.2	Pass
NVNT	a	5240	Ant4	5350	-57.41	5.04	0.24	43.13	Average	54	Pass
NVNT	a	5240	Ant4	5424.96	-47.38	5.04	-	52.92	Peak	68.2	Pass
NVNT	a	5240	Ant4	5351.76	-56.65	5.04	0.24	43.89	Average	54	Pass
NVNT	a	5240	Ant4	5460	-49.46	5.04	-	50.84	Peak	68.2	Pass
NVNT	a	5240	Ant4	5460	-58.44	5.04	0.24	42.1	Average	54	Pass
NVNT	n20	5180	Ant4	4500	-51.06	5.04	-	49.24	Peak	68.2	Pass
NVNT	n20	5180	Ant4	4500	-58.56	5.04	0.28	42.02	Average	54	Pass
NVNT	n20	5180	Ant4	5146.8	-45.36	5.04	-	54.94	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5148.2	-55.64	5.04	0.28	44.94	Average	54	Pass
NVNT	n20	5180	Ant4	5150	-45.08	5.04	-	55.22	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5150	-55.41	5.04	0.28	45.17	Average	54	Pass
NVNT	n20	5240	Ant4	5350	-49.56	5.04	-	50.74	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5350	-57.67	5.04	0.28	42.91	Average	54	Pass
NVNT	n20	5240	Ant4	5416.56	-47.08	5.04	-	53.22	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5352	-57.06	5.04	0.28	43.52	Average	54	Pass
NVNT	n20	5240	Ant4	5460	-50.18	5.04	-	50.12	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5460	-58.51	5.04	0.28	42.07	Average	54	Pass
NVNT	n40	5190	Ant4	4500	-50.2	5.04	-	50.1	Peak	68.2	Pass
NVNT	n40	5190	Ant4	4500	-58.86	5.04	0.12	41.56	Average	54	Pass
NVNT	n40	5190	Ant4	5146.78	-39.42	5.04	-	60.88	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5146.78	-55.04	5.04	0.12	45.38	Average	54	Pass
NVNT	n40	5190	Ant4	5150	-42.66	5.04	-	57.64	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5150	-55.49	5.04	0.12	44.93	Average	54	Pass
NVNT	n40	5230	Ant4	5350	-50.51	5.04	-	49.79	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350	-57.7	5.04	0.12	42.72	Average	54	Pass
NVNT	n40	5230	Ant4	5413.02	-47.41	5.04	-	52.89	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5399.25	-57.11	5.04	0.12	43.31	Average	54	Pass
NVNT	n40	5230	Ant4	5460	-49.57	5.04	-	50.73	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5460	-58.09	5.04	0.12	42.33	Average	54	Pass
NVNT	ac20	5180	Ant4	4500	-50.2	5.04	-	50.1	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	4500	-58.69	5.04	0.28	41.89	Average	54	Pass
NVNT	ac20	5180	Ant4	5144.7	-42.67	5.04	-	57.63	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ac20	5180	Ant4	5149.6	-55.65	5.04	0.28	44.93	Average	54	Pass
NVNT	ac20	5180	Ant4	5150	-46.63	5.04	-	53.67	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5150	-55.16	5.04	0.28	45.42	Average	54	Pass
NVNT	ac20	5240	Ant4	5350	-49.83	5.04	-	50.47	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350	-57.07	5.04	0.28	43.51	Average	54	Pass
NVNT	ac20	5240	Ant4	5390.4	-47.34	5.04	-	52.96	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350.8	-56.84	5.04	0.28	43.74	Average	54	Pass
NVNT	ac20	5240	Ant4	5460	-49.2	5.04	-	51.1	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5460	-58.03	5.04	0.28	42.55	Average	54	Pass
NVNT	ac40	5190	Ant4	4500	-49.98	5.04	-	50.32	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	4500	-58.59	5.04	0.23	41.94	Average	54	Pass
NVNT	ac40	5190	Ant4	5148.97	-45.18	5.04	-	55.12	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5149.7	-54.59	5.04	0.23	45.94	Average	54	Pass
NVNT	ac40	5190	Ant4	5150	-46.45	5.04	-	53.85	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5150	-54.59	5.04	0.23	45.94	Average	54	Pass
NVNT	ac40	5230	Ant4	5350	-49.85	5.04	-	50.45	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5350	-57.54	5.04	0.23	42.99	Average	54	Pass
NVNT	ac40	5230	Ant4	5451.63	-47.88	5.04	-	52.42	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5351.19	-57.28	5.04	0.23	43.25	Average	54	Pass
NVNT	ac40	5230	Ant4	5460	-50.17	5.04	-	50.13	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5460	-57.88	5.04	0.23	42.65	Average	54	Pass
NVNT	ac80	5210	Ant4	5350	-48.83	5.04	-	51.47	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5350	-56.49	5.04	0.47	44.28	Average	54	Pass
NVNT	ac80	5210	Ant4	5377.17	-45.87	5.04	-	54.43	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5362.98	-56.28	5.04	0.47	44.49	Average	54	Pass
NVNT	ac80	5210	Ant4	5460	-50.77	5.04	-	49.53	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5460	-57.68	5.04	0.47	43.09	Average	54	Pass
NVNT	ac80	5210	Ant4	4500	-49.49	5.04	-	50.81	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	4500	-58.61	5.04	0.47	42.16	Average	54	Pass
NVNT	ac80	5210	Ant4	5149.38	-42.8	5.04	-	57.5	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5149.38	-55.14	5.04	0.47	45.63	Average	54	Pass
NVNT	ac80	5210	Ant4	5150	-44.04	5.04	-	56.26	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5150	-54.97	5.04	0.47	45.8	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant4 Peak

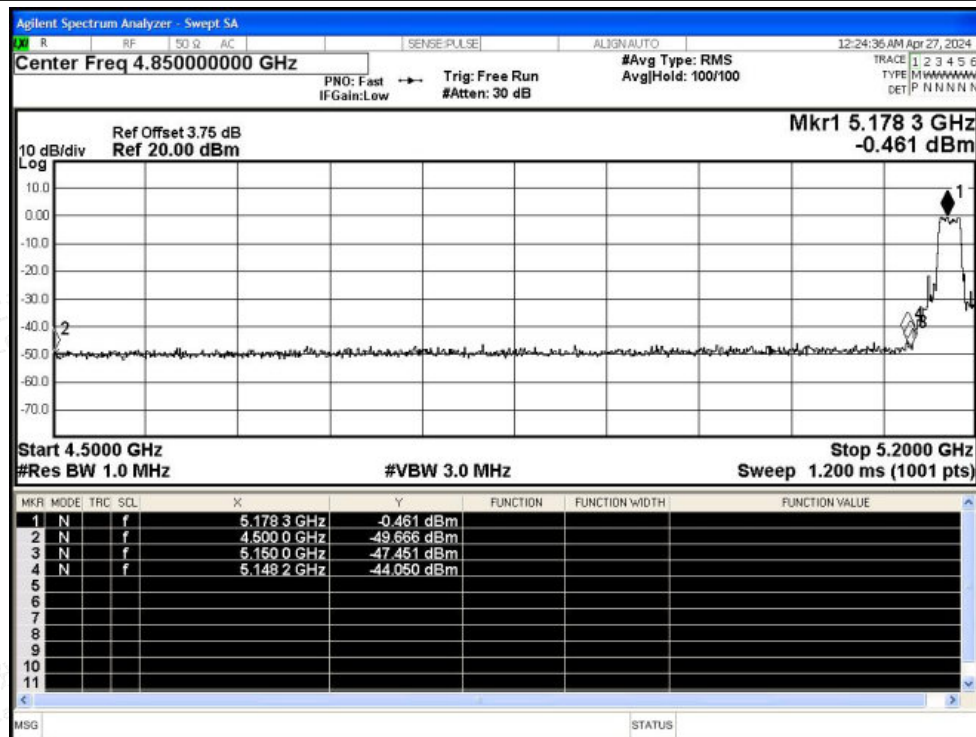

Restrict Band NVNT a 5180MHz Ant4 Average

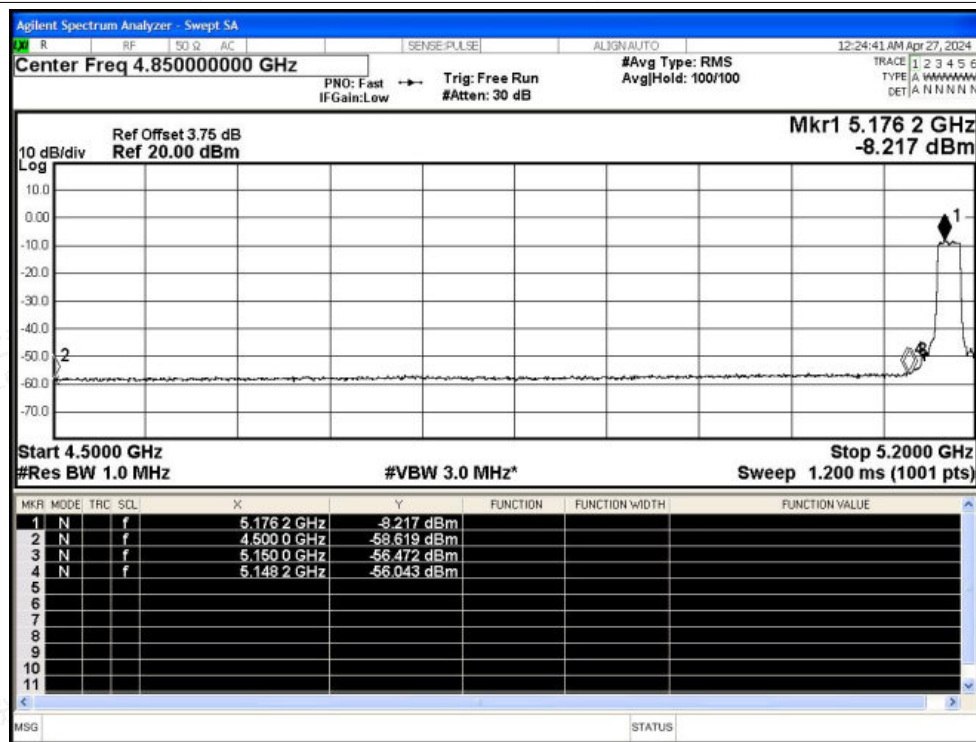

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant4 Peak

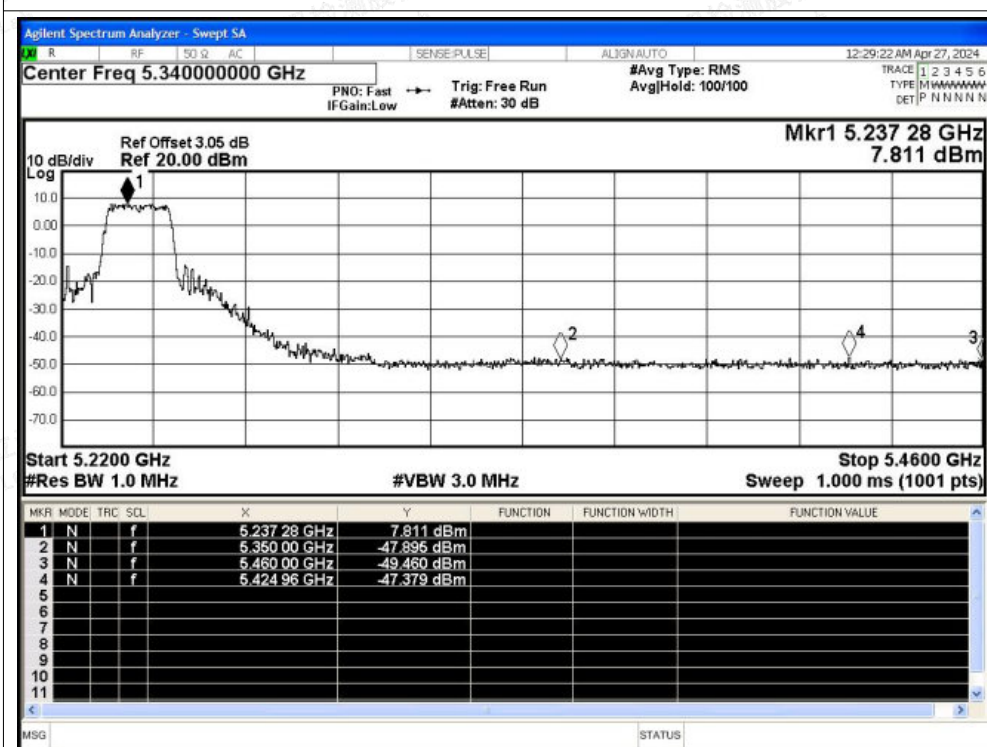

Restrict Band NVNT a 5240MHz Ant4 Average

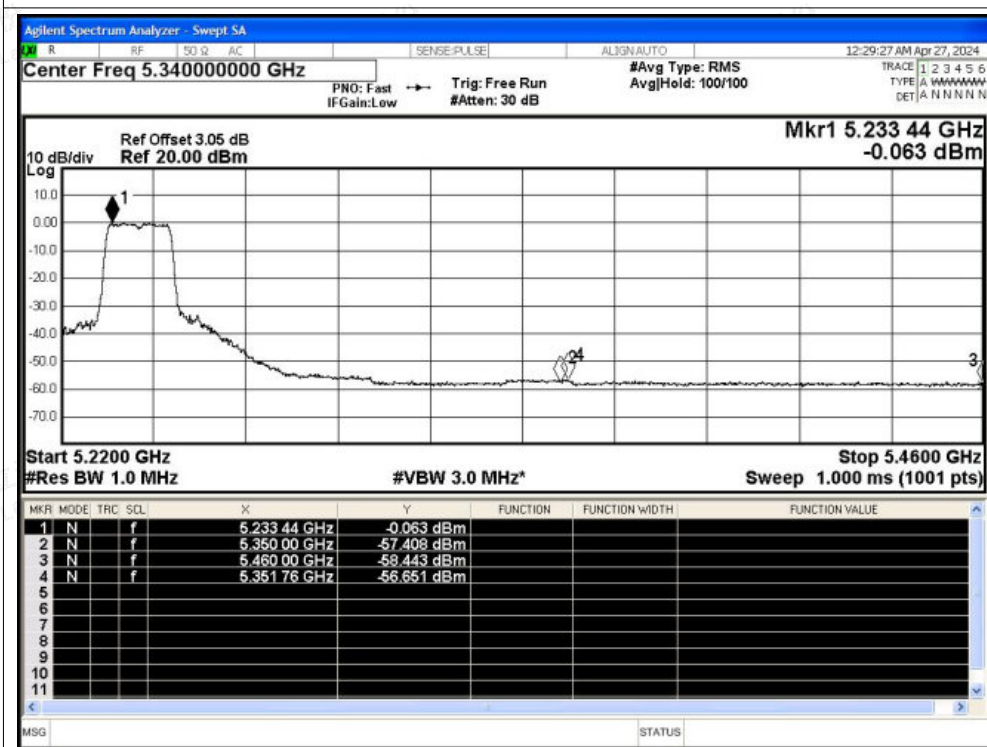

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant4 Peak

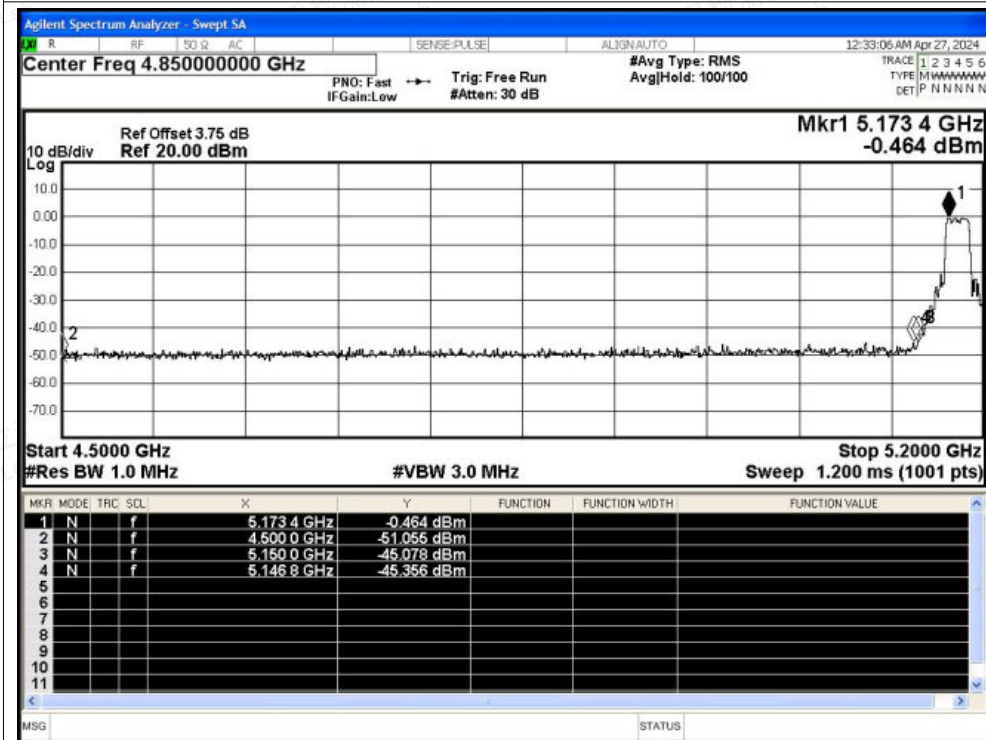

Restrict Band NVNT n20 5180MHz Ant4 Average

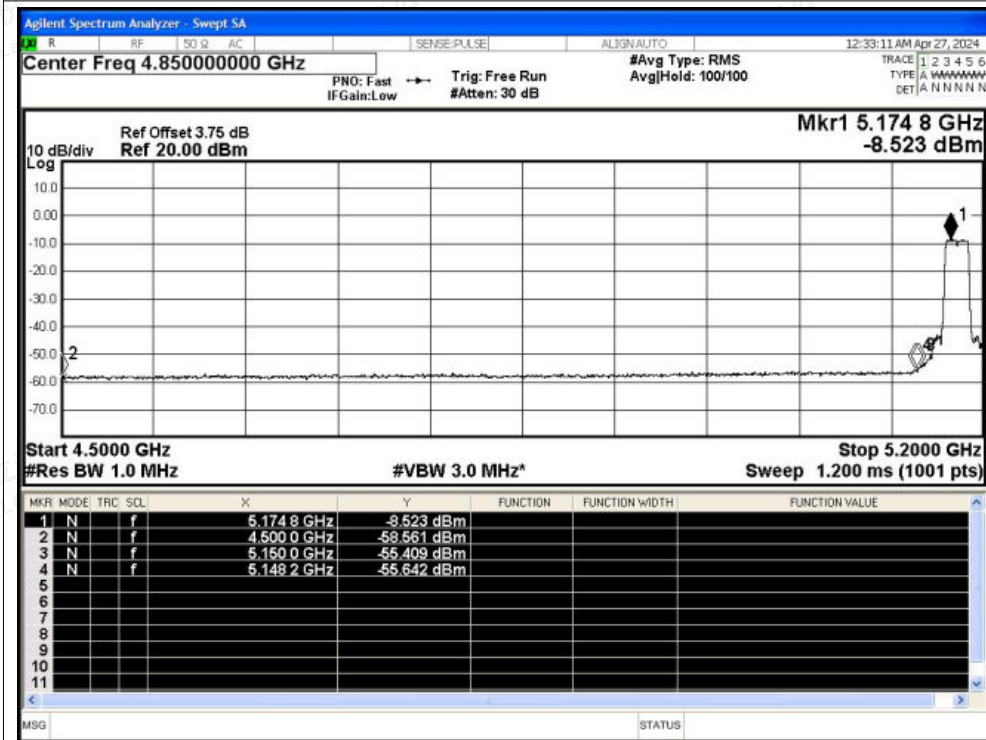

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant4 Peak

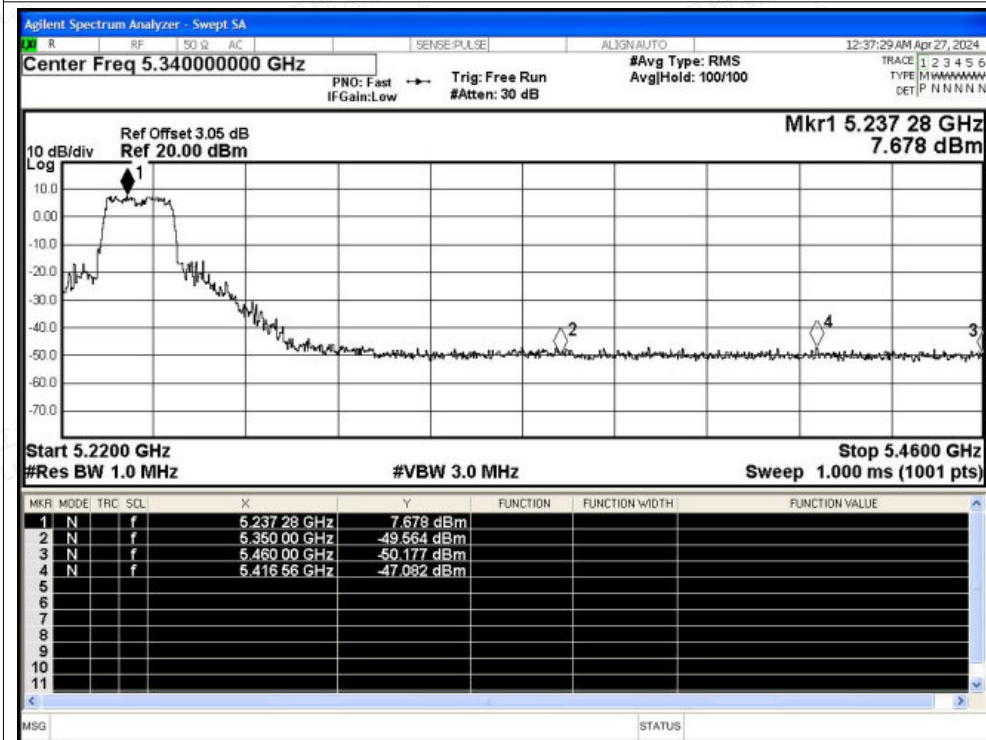

Restrict Band NVNT n20 5240MHz Ant4 Average

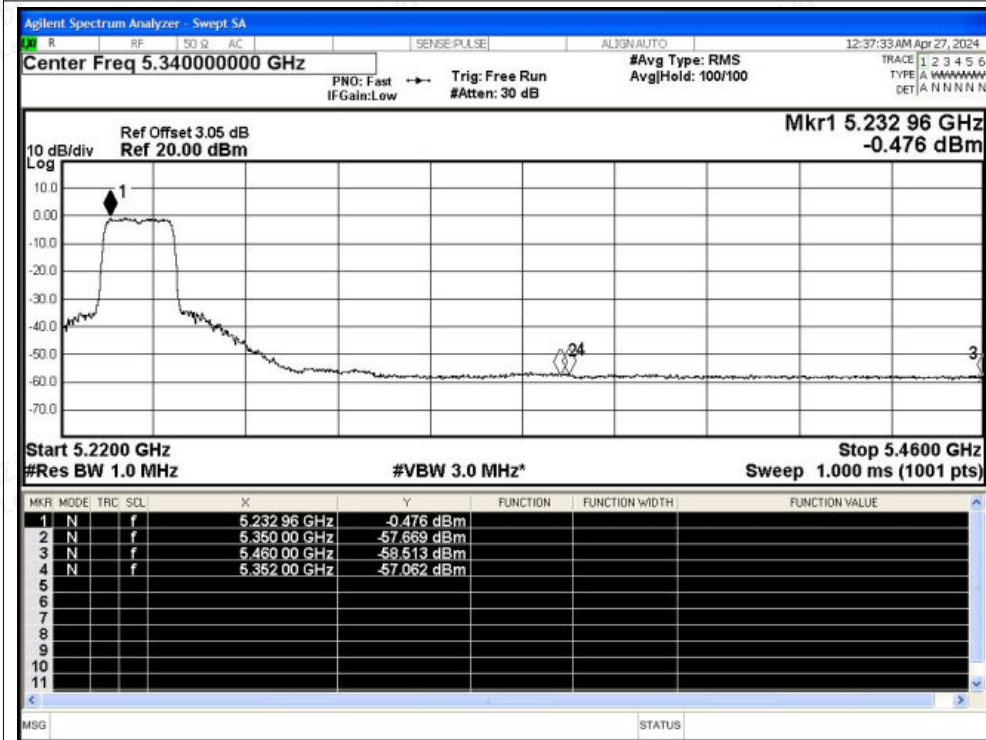

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant4 Peak

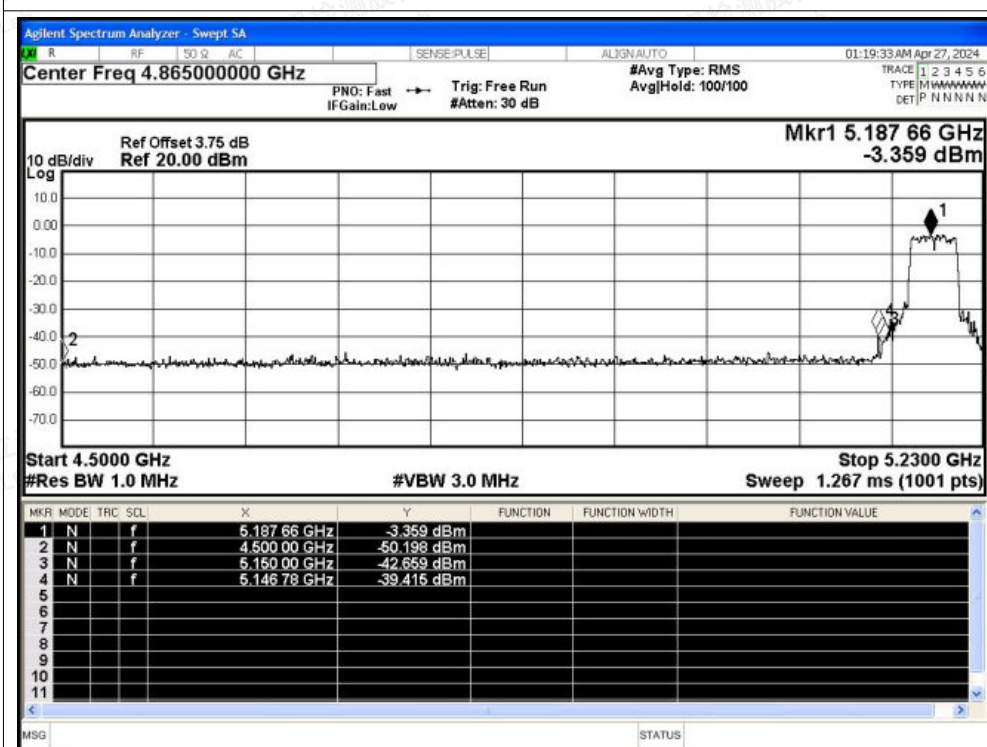

Restrict Band NVNT n40 5190MHz Ant4 Average

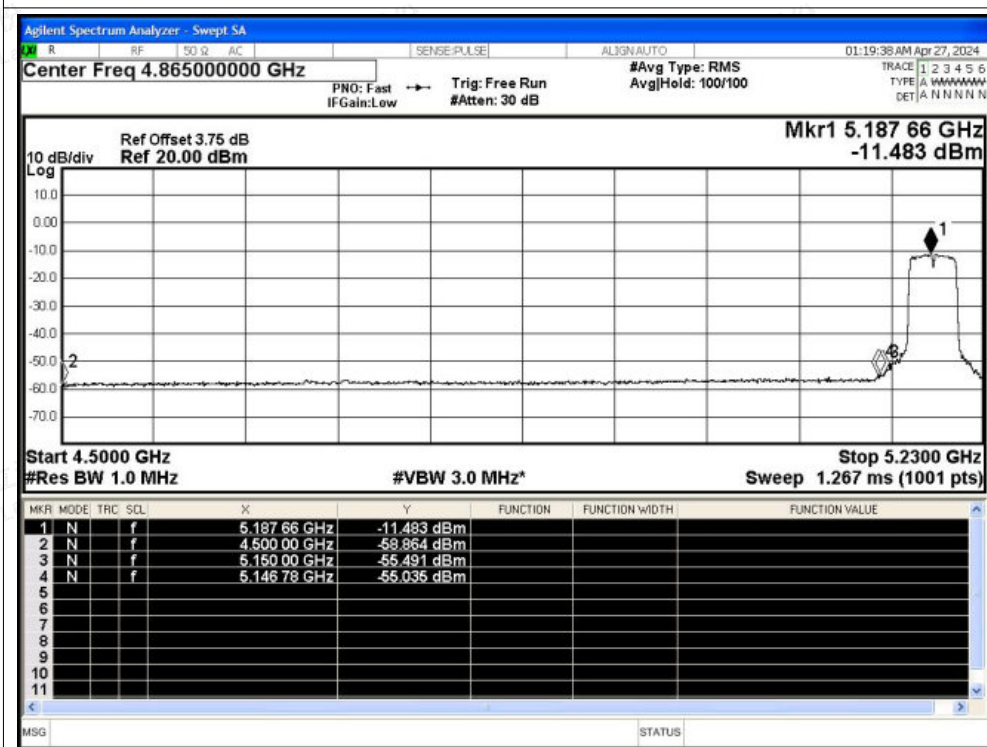

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant4 Peak

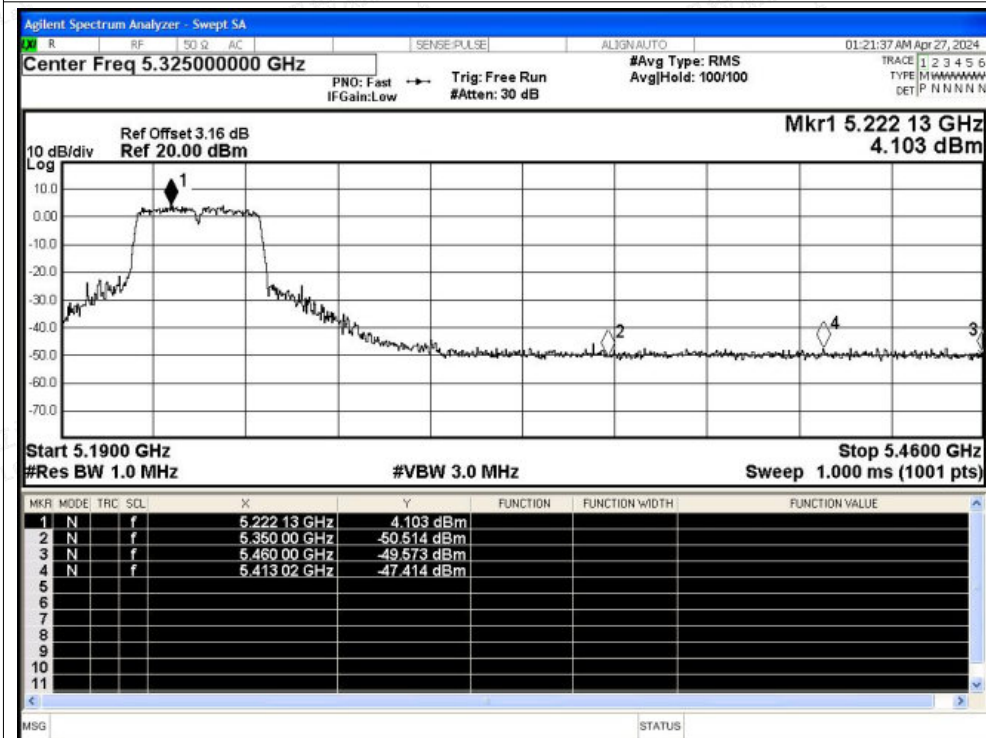

Restrict Band NVNT n40 5230MHz Ant4 Average

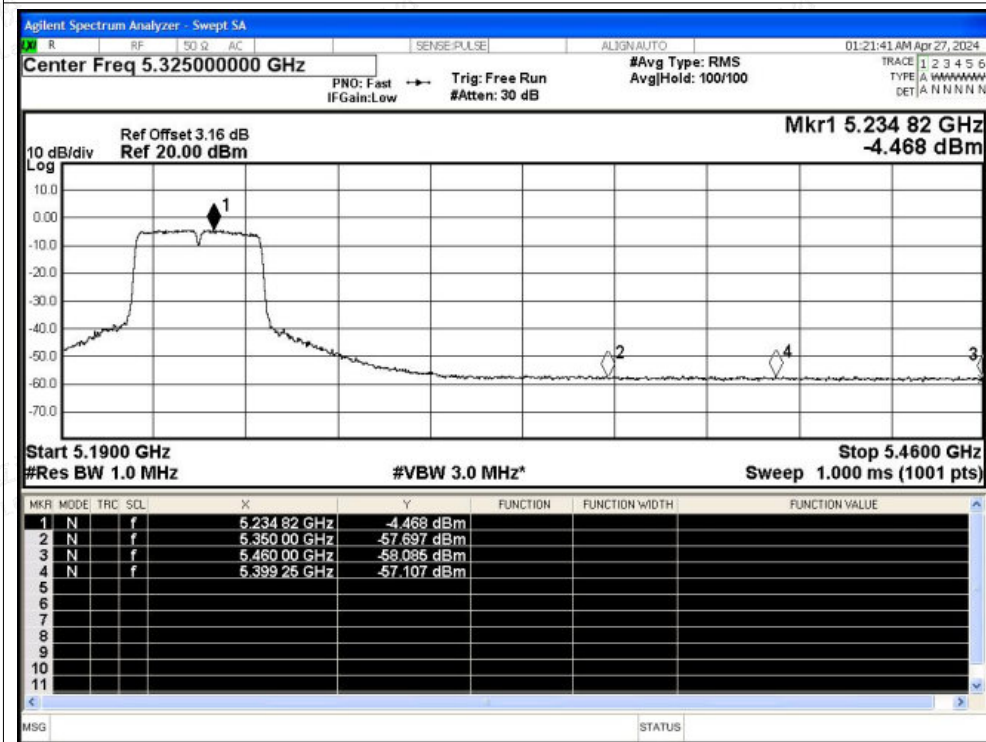

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant4 Peak

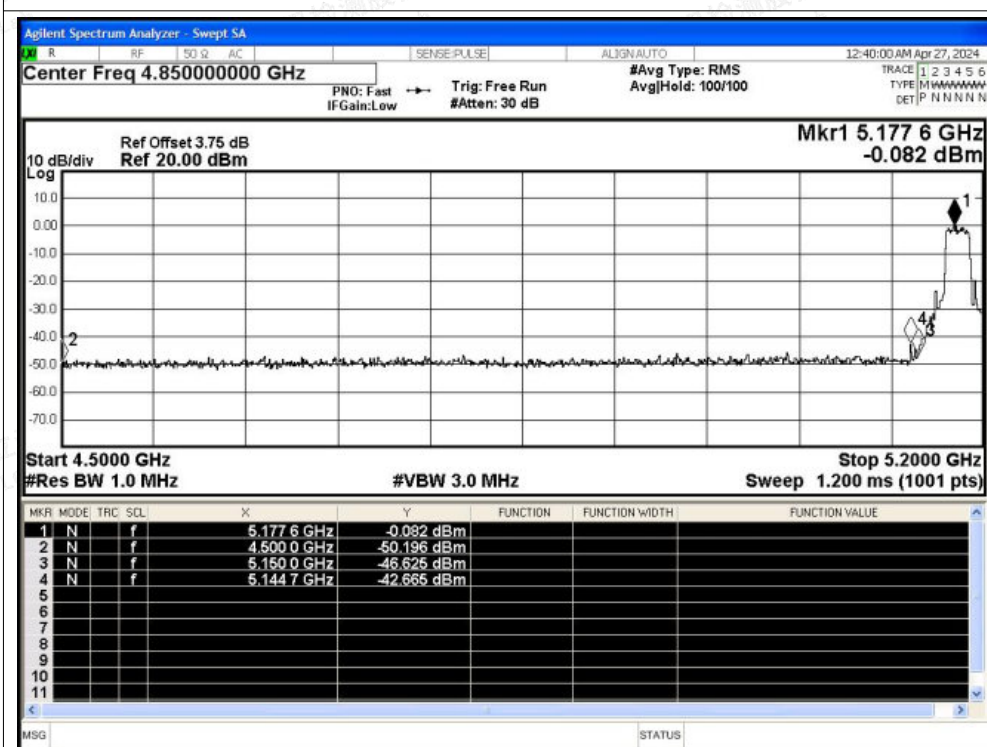

Restrict Band NVNT ac20 5180MHz Ant4 Average

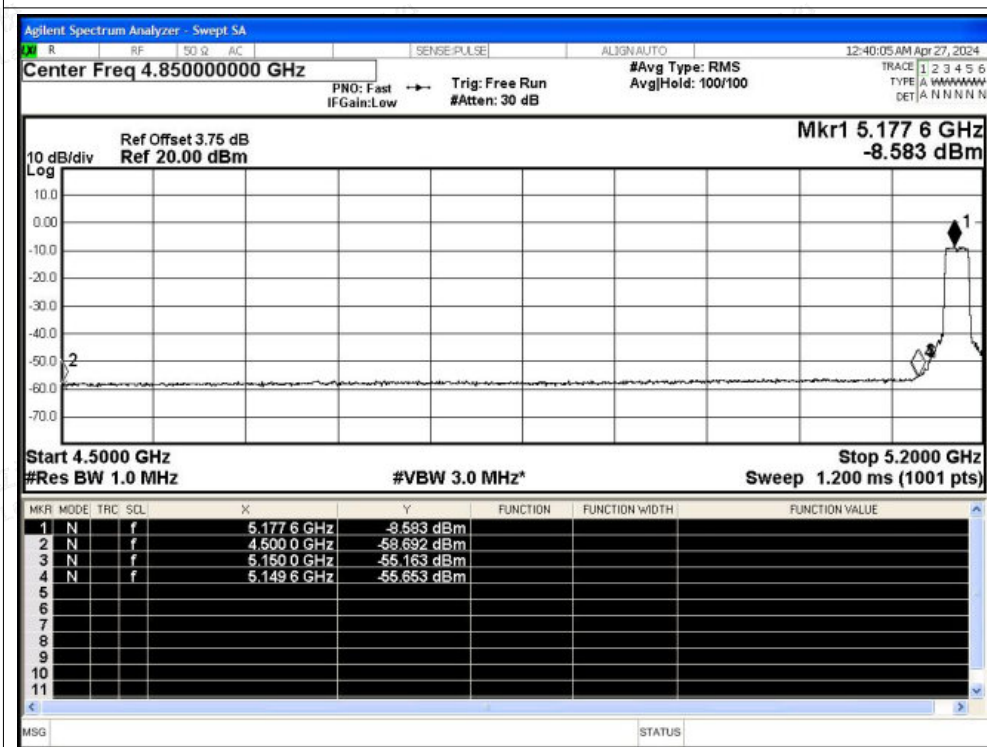

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant4 Peak

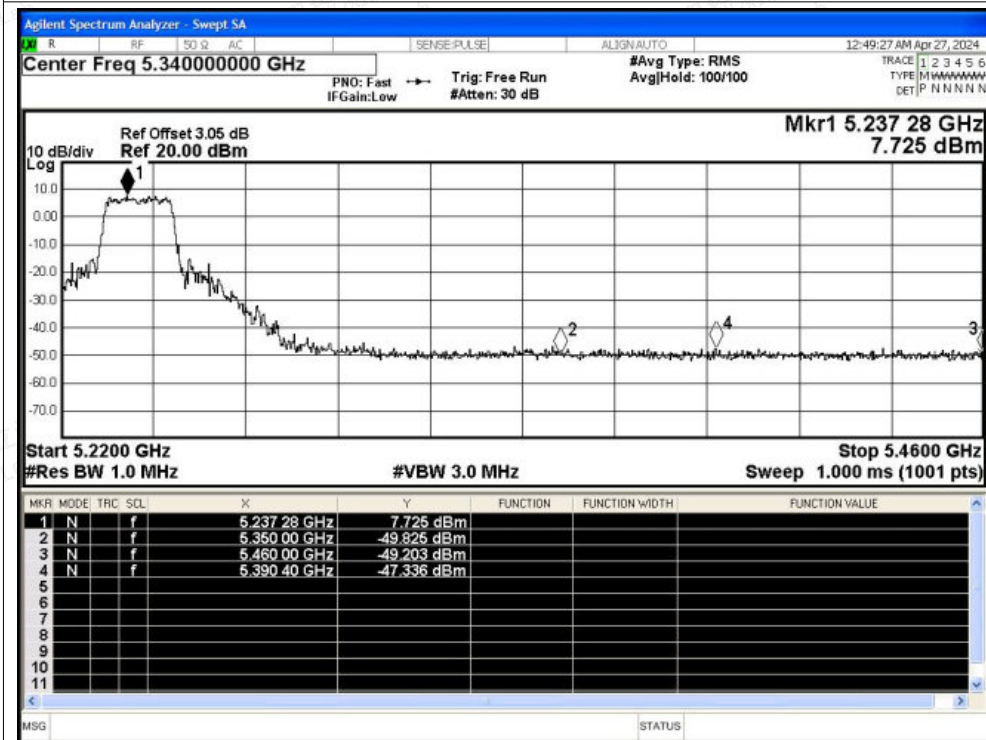

Restrict Band NVNT ac20 5240MHz Ant4 Average

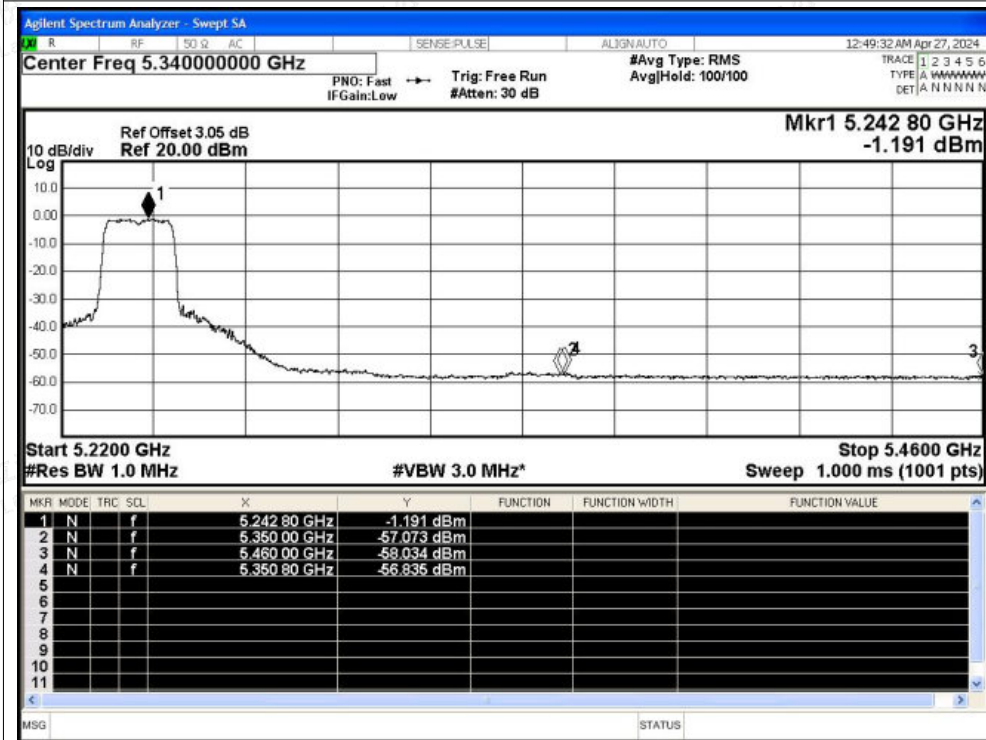

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant4 Peak

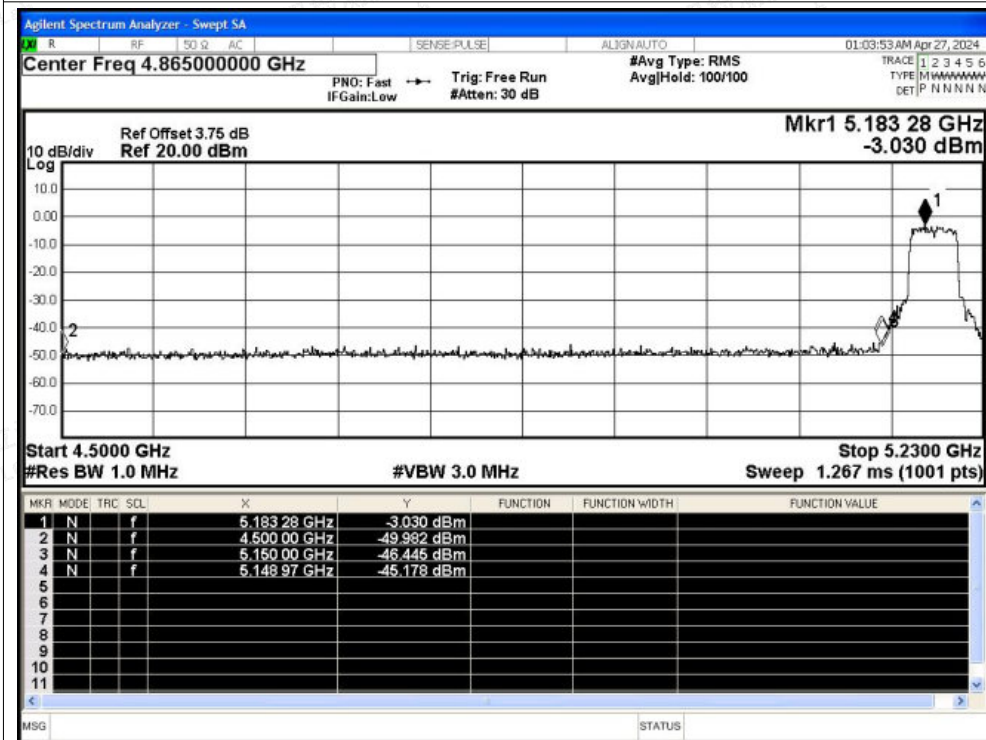

Restrict Band NVNT ac40 5190MHz Ant4 Average

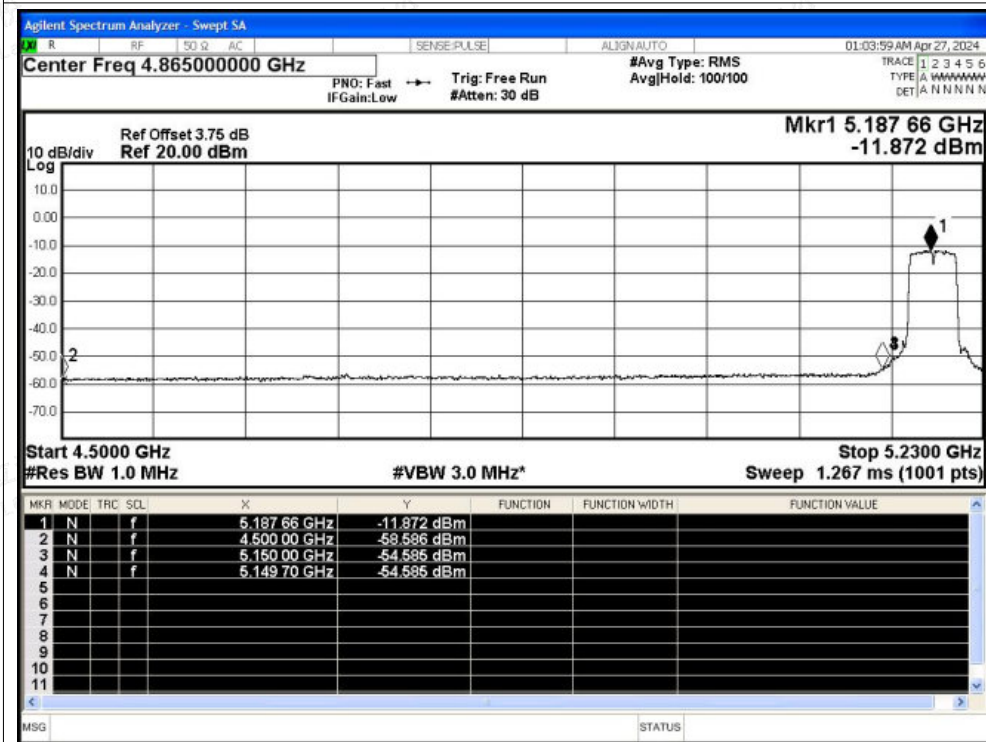

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity