

Test Information:

|             |                    |              |                       |
|-------------|--------------------|--------------|-----------------------|
| Sample No.: | 2UGH-1             | Test Date:   | 2024/12/07~2024/12/16 |
| Test Site:  | RF                 | Test Mode:   | Transmitting          |
| Tester:     | Kungfumaster Liang | Test Result: | Pass                  |

Environmental Conditions:

|                       |           |                           |       |                        |           |
|-----------------------|-----------|---------------------------|-------|------------------------|-----------|
| Temperature:<br>(°C): | 22.1-25.7 | Relative Humidity:<br>(%) | 46-53 | ATM Pressure:<br>(kPa) | 100.9-101 |
|-----------------------|-----------|---------------------------|-------|------------------------|-----------|

## Out of band emission, Band Edge

### FCC Part 96

n77\_2

| Mode                                               | Result (MHz) | Limit      | Verdict |
|----------------------------------------------------|--------------|------------|---------|
| n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0    | -41.271      | See Graphs | Pass    |
| n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0   | -41.080      | See Graphs | Pass    |
| n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23   | -40.581      | See Graphs | Pass    |
| n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0   | -40.655      | See Graphs | Pass    |
| n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0  | -34.546      | See Graphs | Pass    |
| n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0 | -41.289      | See Graphs | Pass    |
| n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37 | -39.441      | See Graphs | Pass    |
| n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0 | -39.937      | See Graphs | Pass    |
| n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0    | -41.009      | See Graphs | Pass    |
| n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0   | -41.014      | See Graphs | Pass    |
| n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50   | -40.547      | See Graphs | Pass    |
| n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0   | -40.014      | See Graphs | Pass    |
| n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0    | -33.603      | See Graphs | Pass    |
| n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0   | -40.975      | See Graphs | Pass    |
| n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77   | -32.994      | See Graphs | Pass    |
| n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0   | -39.930      | See Graphs | Pass    |
| n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0  | -41.063      | See Graphs | Pass    |
| n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0    | -27.050      | See Graphs | Pass    |
| n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0  | -39.994      | See Graphs | Pass    |

| Mode                                                 | Result (MHz) | Limit      | Verdict |
|------------------------------------------------------|--------------|------------|---------|
| n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM<br>QPSK_RB1@105 | -25.821      | See Graphs | Pass    |
| n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM<br>QPSK_RB128@0 | -40.885      | See Graphs | Pass    |
| n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM<br>QPSK_RB1@0   | -31.188      | See Graphs | Pass    |
| n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM<br>QPSK_RB128@0 | -39.952      | See Graphs | Pass    |
| n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM<br>QPSK_RB1@132 | -30.708      | See Graphs | Pass    |
| n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM<br>QPSK_RB162@0 | -41.027      | See Graphs | Pass    |
| n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM<br>QPSK_RB1@0   | -28.275      | See Graphs | Pass    |
| n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM<br>QPSK_RB162@0 | -40.418      | See Graphs | Pass    |
| n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM<br>QPSK_RB1@161 | -28.663      | See Graphs | Pass    |
| n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM<br>QPSK_RB180@0 | -41.083      | See Graphs | Pass    |
| n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM<br>QPSK_RB1@0   | -32.990      | See Graphs | Pass    |
| n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM<br>QPSK_RB180@0 | -40.198      | See Graphs | Pass    |
| n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM<br>QPSK_RB1@188 | -32.537      | See Graphs | Pass    |
| n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM<br>QPSK_RB1@0   | -27.187      | See Graphs | Pass    |
| n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM<br>QPSK_RB216@0 | -27.233      | See Graphs | Pass    |
| n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM<br>QPSK_RB1@216 | -22.707      | See Graphs | Pass    |
| n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM<br>QPSK_RB216@0 | -37.700      | See Graphs | Pass    |
| n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM<br>QPSK_RB1@0   | -27.821      | See Graphs | Pass    |
| n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM<br>QPSK_RB243@0 | -24.899      | See Graphs | Pass    |
| n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM<br>QPSK_RB1@244 | -24.689      | See Graphs | Pass    |
| n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM<br>QPSK_RB243@0 | -40.127      | See Graphs | Pass    |

| Mode                                               | Result (MHz)   | Limit      | Verdict |
|----------------------------------------------------|----------------|------------|---------|
| n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0   | -20.831        | See Graphs | Pass    |
| n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0 | -27.039        | See Graphs | Pass    |
| n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272 | <b>-18.525</b> | See Graphs | Pass    |
| n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0 | -40.083        | See Graphs | Pass    |

## n78\_2


| Mode                                               | Result (MHz)   | Limit      | Verdict |
|----------------------------------------------------|----------------|------------|---------|
| n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0    | -41.049        | See Graphs | Pass    |
| n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0   | -41.173        | See Graphs | Pass    |
| n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23   | -40.566        | See Graphs | Pass    |
| n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0   | -40.551        | See Graphs | Pass    |
| n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0  | -35.536        | See Graphs | Pass    |
| n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0 | -41.108        | See Graphs | Pass    |
| n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37 | -37.328        | See Graphs | Pass    |
| n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0 | -40.104        | See Graphs | Pass    |
| n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0    | -40.948        | See Graphs | Pass    |
| n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0   | -40.921        | See Graphs | Pass    |
| n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50   | -40.530        | See Graphs | Pass    |
| n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0   | -40.095        | See Graphs | Pass    |
| n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0    | <b>-32.314</b> | See Graphs | Pass    |
| n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0   | -40.767        | See Graphs | Pass    |
| n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77   | -34.608        | See Graphs | Pass    |

| Mode                                              | Result (MHz) | Limit      | Verdict |
|---------------------------------------------------|--------------|------------|---------|
| n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0  | -40.144      | See Graphs | Pass    |
| n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0 | -40.918      | See Graphs | Pass    |
| n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0   | -28.922      | See Graphs | Pass    |
| n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0 | -40.091      | See Graphs | Pass    |
| n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105 | -27.932      | See Graphs | Pass    |
| n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0 | -40.287      | See Graphs | Pass    |
| n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0   | -31.225      | See Graphs | Pass    |
| n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0 | -39.815      | See Graphs | Pass    |
| n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132 | -32.462      | See Graphs | Pass    |
| n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0 | -40.994      | See Graphs | Pass    |
| n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0   | -27.931      | See Graphs | Pass    |
| n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0 | -40.355      | See Graphs | Pass    |
| n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161 | -28.859      | See Graphs | Pass    |
| n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0 | -40.882      | See Graphs | Pass    |
| n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0   | -31.413      | See Graphs | Pass    |
| n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0 | -40.194      | See Graphs | Pass    |
| n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188 | -34.331      | See Graphs | Pass    |
| n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0   | -25.619      | See Graphs | Pass    |
| n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0 | -27.084      | See Graphs | Pass    |
| n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216 | -24.565      | See Graphs | Pass    |
| n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0 | -38.390      | See Graphs | Pass    |

| Mode                                               | Result (MHz)   | Limit      | Verdict |
|----------------------------------------------------|----------------|------------|---------|
| n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0    | -24.996        | See Graphs | Pass    |
| n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0  | -27.519        | See Graphs | Pass    |
| n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244  | -22.788        | See Graphs | Pass    |
| n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0  | -40.201        | See Graphs | Pass    |
| n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0   | <b>-18.769</b> | See Graphs | Pass    |
| n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0 | -25.099        | See Graphs | Pass    |
| n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272 | -24.673        | See Graphs | Pass    |
| n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0 | -40.135        | See Graphs | Pass    |


n77\_2

n77\_2\_10MHz\_30kHz\_3555MHz\_DFT-s-OFDM  
QPSK\_RB1@0

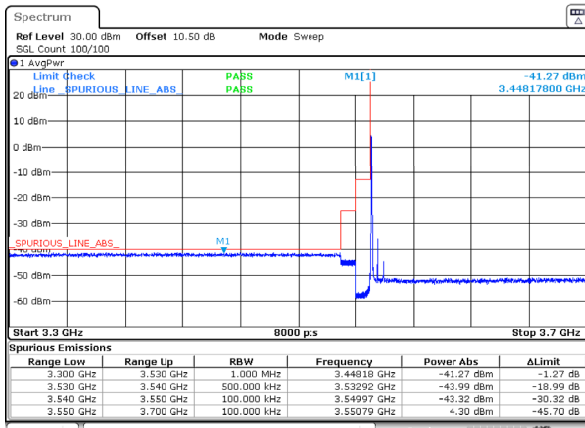


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:51:28

n77\_2\_10MHz\_30kHz\_3555MHz\_DFT-s-OFDM  
QPSK\_RB24@0

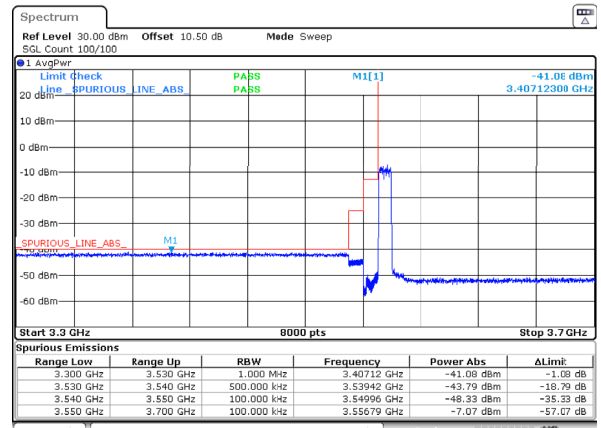


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:52:20

n77\_2\_10MHz\_30kHz\_3695MHz\_DFT-s-OFDM  
QPSK\_RB1@23

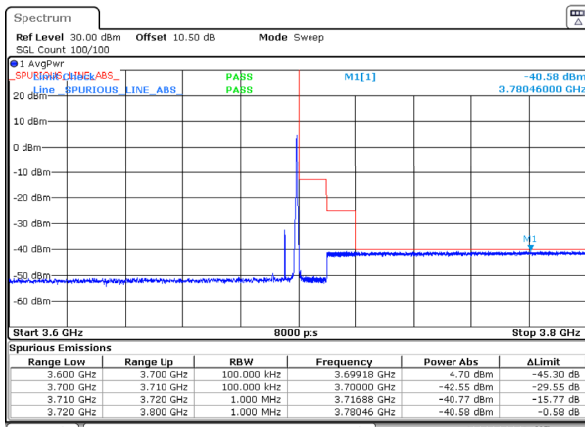


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:53:15

n77\_2\_10MHz\_30kHz\_3695MHz\_DFT-s-OFDM  
QPSK\_RB24@0

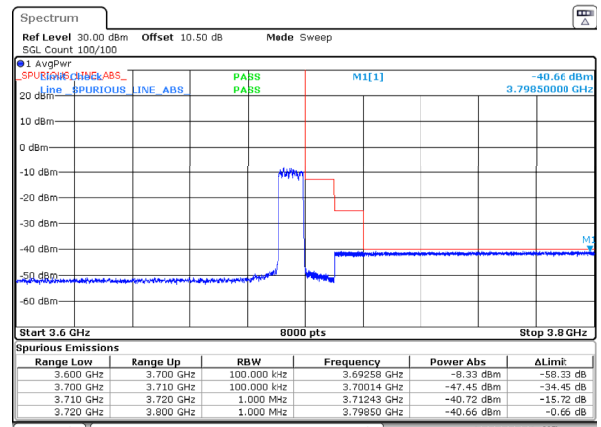


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:54:05

n77\_2\_15MHz\_30kHz\_3557.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0

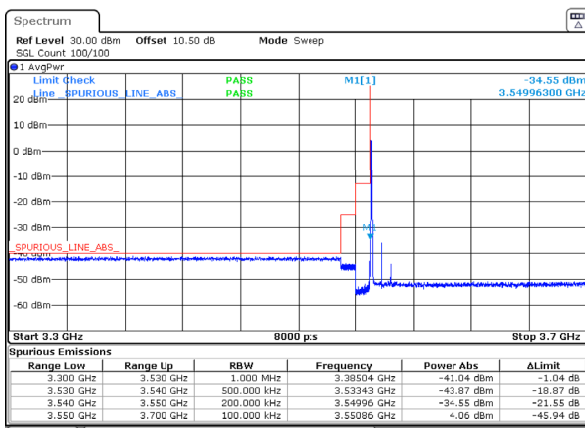


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:55:07

n77\_2\_15MHz\_30kHz\_3557.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0

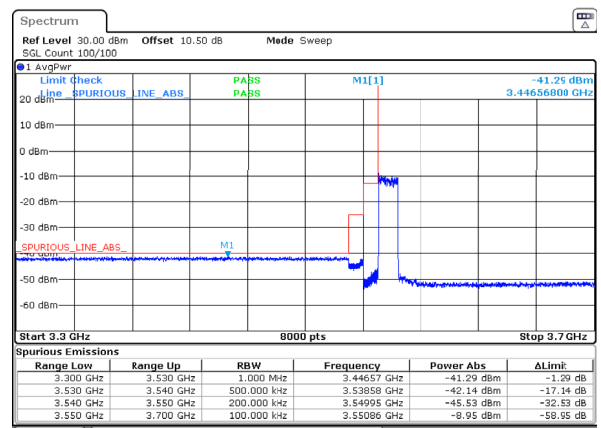


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang  
Date: 7.DEC.2024 18:55:58

n77\_2\_15MHz\_30kHz\_3692.5MHz\_DFT-s-OFDM  
QPSK\_RB1@37

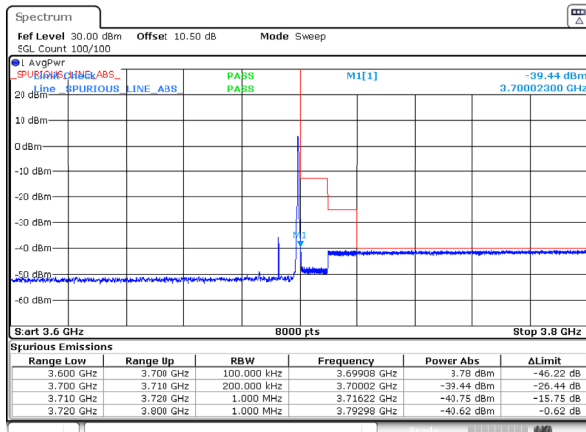


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 18:56:54

n77\_2\_15MHz\_30kHz\_3692.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0

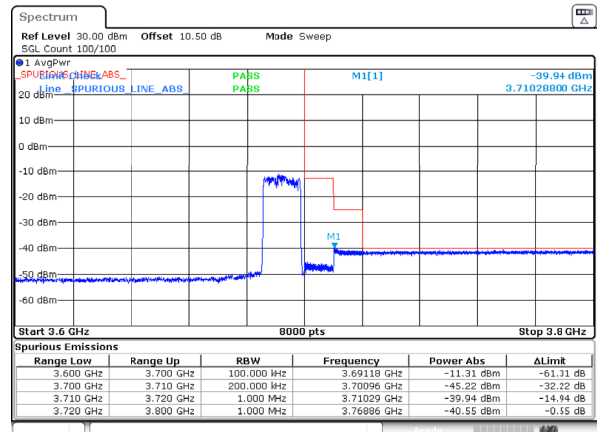


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 18:57:45

n77\_2\_20MHz\_30kHz\_3560MHz\_DFT-s-OFDM  
QPSK\_RB1@0

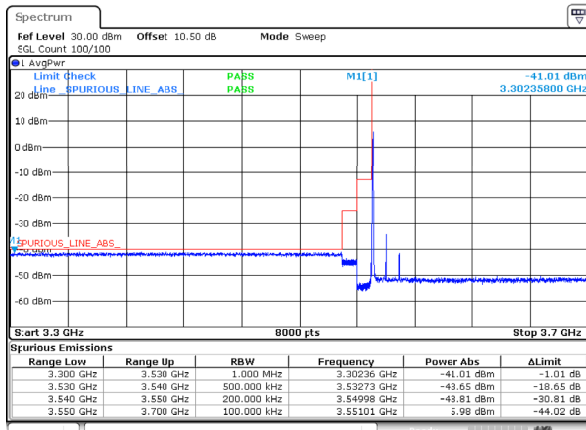


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 16.DEC.2024 14:00:48

n77\_2\_20MHz\_30kHz\_3560MHz\_DFT-s-OFDM  
QPSK\_RB50@0

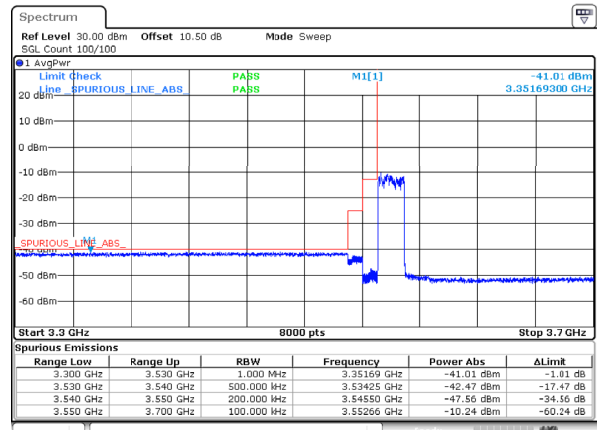


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 16.DEC.2024 14:01:26

n77\_2\_20MHz\_30kHz\_3690MHz\_DFT-s-OFDM  
QPSK\_RB1@50

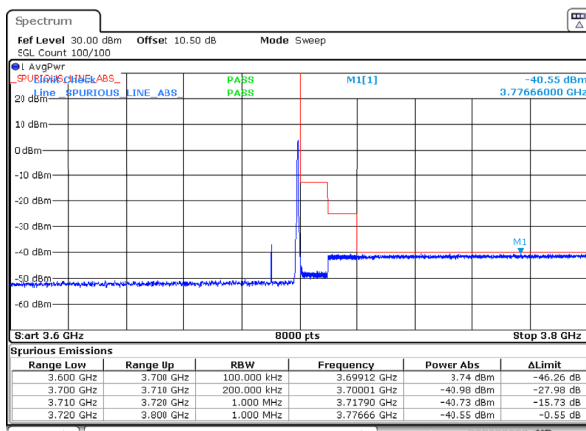

ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 19:08:42


n77\_2\_20MHz\_30kHz\_3690MHz\_DFT-s-OFDM  
QPSK\_RB50@0

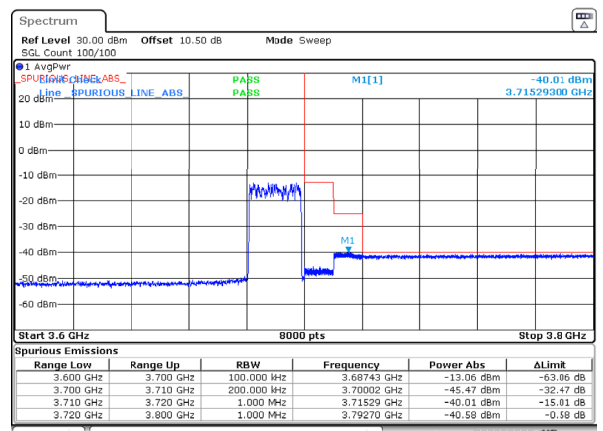

ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 19:09:33




n77\_2\_30MHz\_30kHz\_3565MHz\_DFT-s-OFDM  
QPSK\_RB1@0

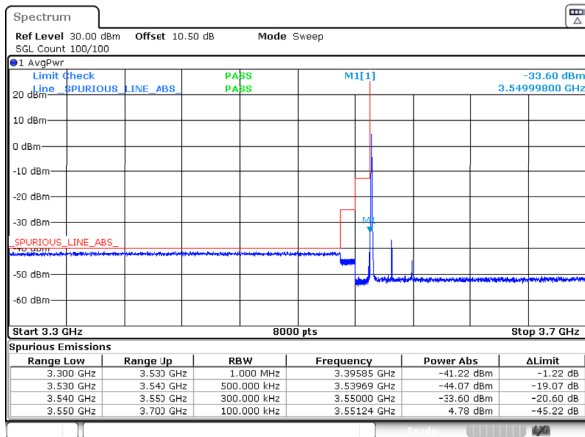


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 19:10:33

n77\_2\_30MHz\_30kHz\_3565MHz\_DFT-s-OFDM  
QPSK\_RB75@0

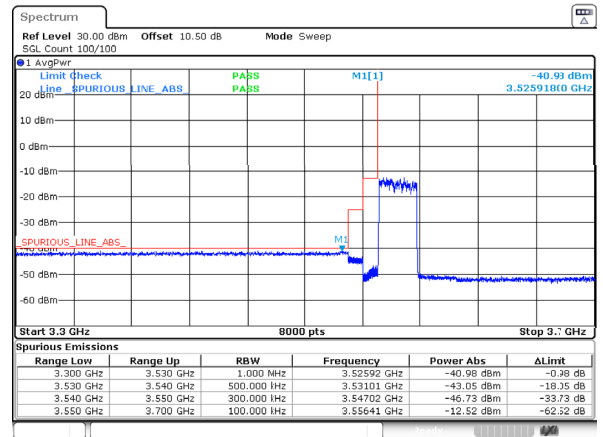


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 15:11:25

n77\_2\_30MHz\_30kHz\_3685MHz\_DFT-s-OFDM  
QPSK\_RB1@77

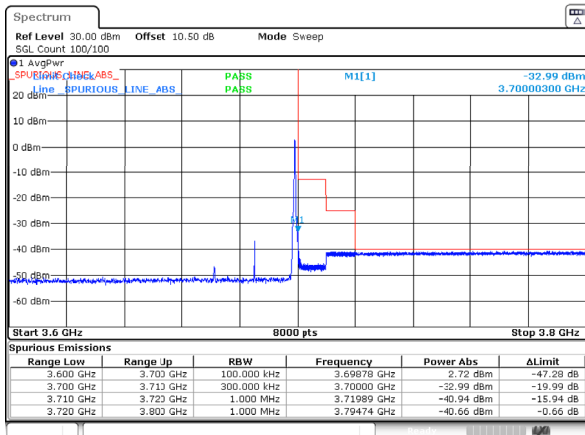


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 19:12:25

n77\_2\_30MHz\_30kHz\_3685MHz\_DFT-s-OFDM  
QPSK\_RB75@0

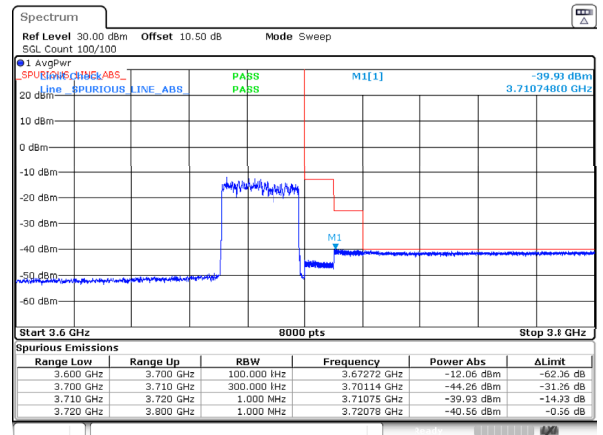


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 15:13:15

n77\_2\_40MHz\_30kHz\_3570MHz\_DFT-s-OFDM  
QPSK\_RB100@0

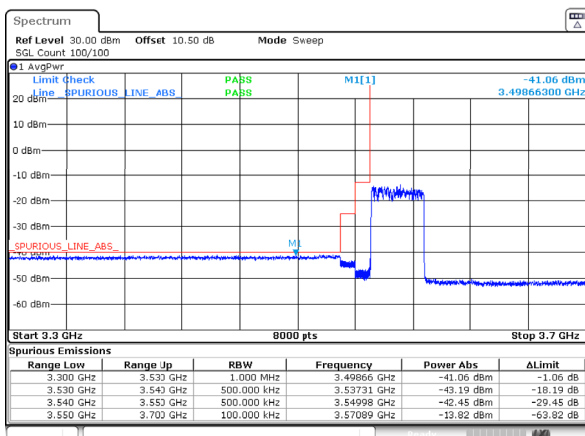


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 19:15:07

n77\_2\_40MHz\_30kHz\_3570MHz\_DFT-s-OFDM  
QPSK\_RB1@0

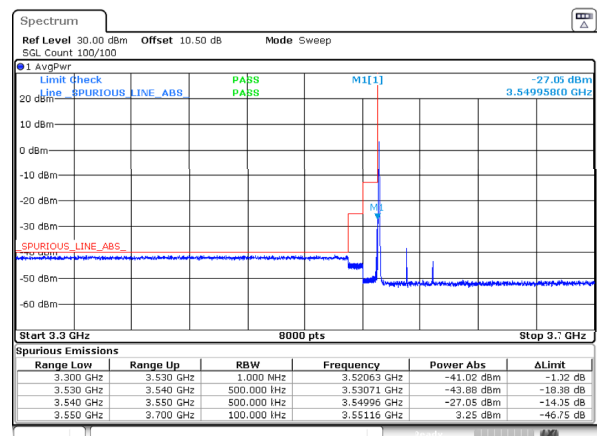


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang  
Date: 7.DEC.2024 15:14:15

n77\_2\_40MHz\_30kHz\_3680MHz\_DFT-s-OFDM  
QPSK\_RB100@0

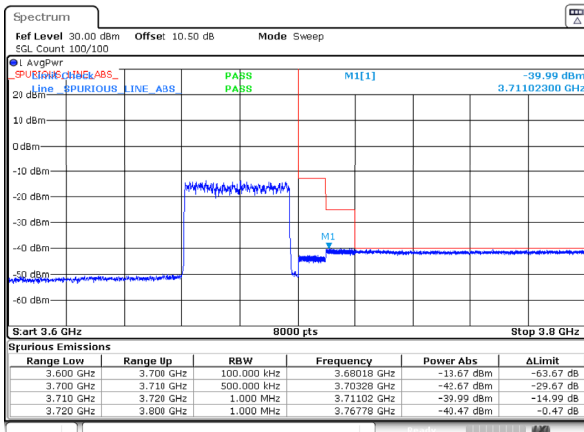


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:16:55

n77\_2\_40MHz\_30kHz\_3680MHz\_DFT-s-OFDM  
QPSK\_RB1@105

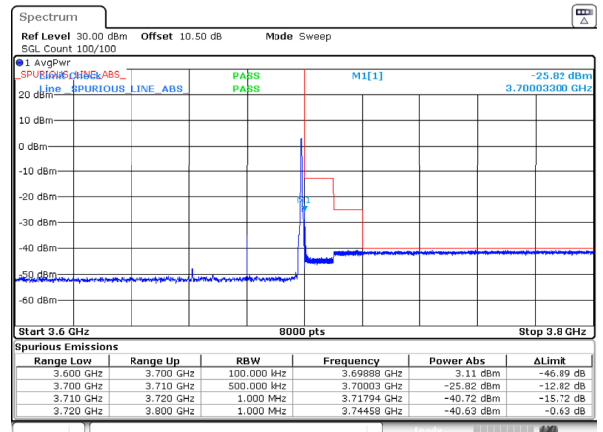


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:16:03

n77\_2\_50MHz\_30kHz\_3575MHz\_DFT-s-OFDM  
QPSK\_RB128@0

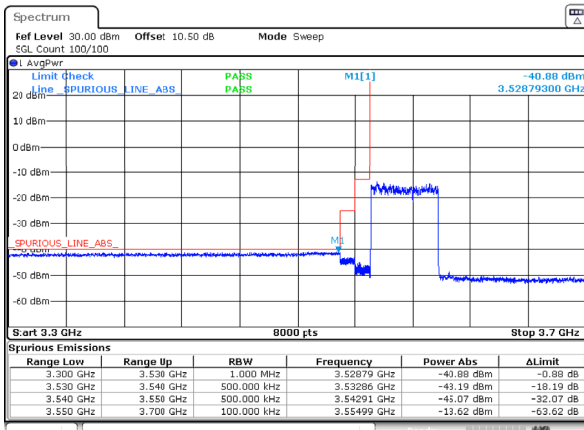


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:18:49

n77\_2\_50MHz\_30kHz\_3575MHz\_DFT-s-OFDM  
QPSK\_RB1@0

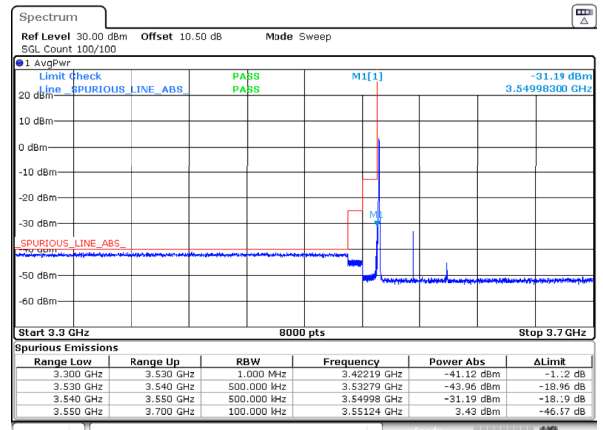


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:17:56

n77\_2\_50MHz\_30kHz\_3675MHz\_DFT-s-OFDM  
QPSK\_RB128@0

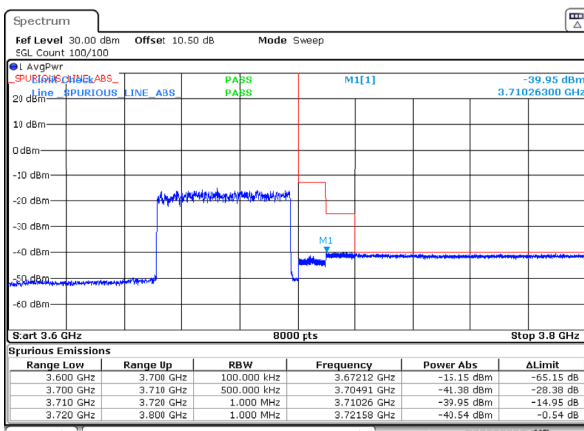


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:20:37

n77\_2\_50MHz\_30kHz\_3675MHz\_DFT-s-OFDM  
QPSK\_RB1@132

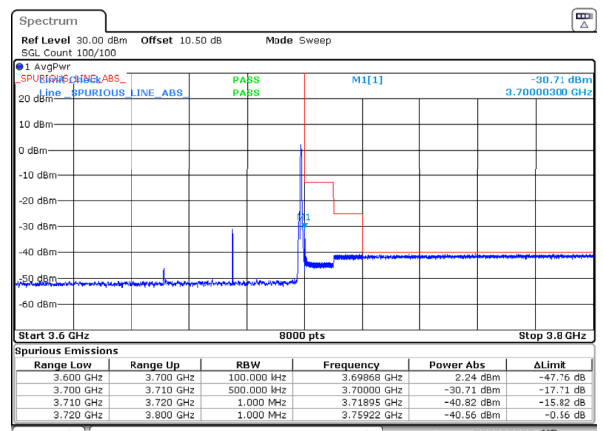


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:19:46

n77\_2\_60MHz\_30kHz\_3580MHz\_DFT-s-OFDM  
QPSK\_RB162@0

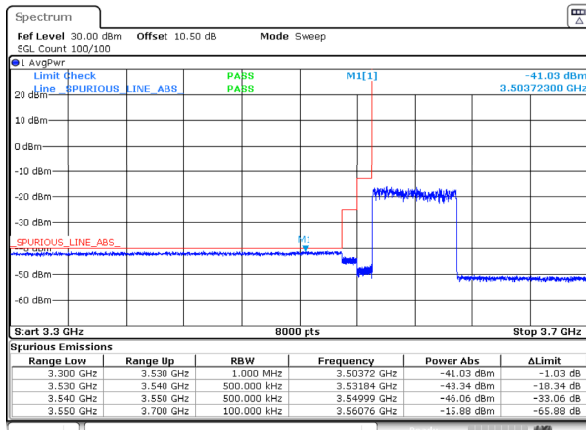


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:22:30

n77\_2\_60MHz\_30kHz\_3580MHz\_DFT-s-OFDM  
QPSK\_RB1@0

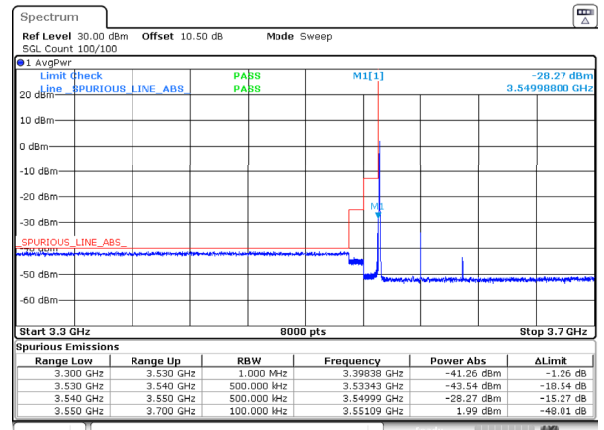


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:21:37

n77\_2\_60MHz\_30kHz\_3670MHz\_DFT-s-OFDM  
QPSK\_RB162@0

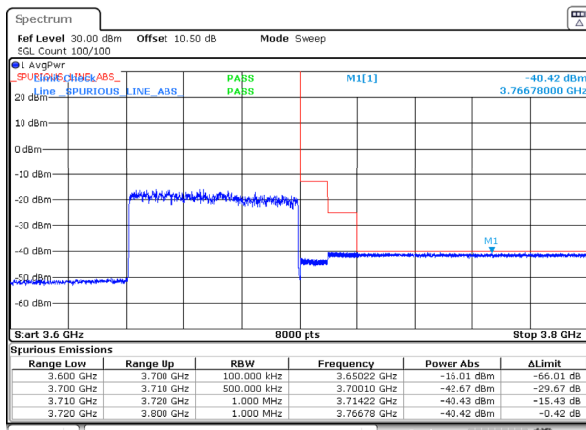


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:24:19

n77\_2\_60MHz\_30kHz\_3670MHz\_DFT-s-OFDM  
QPSK\_RB1@161

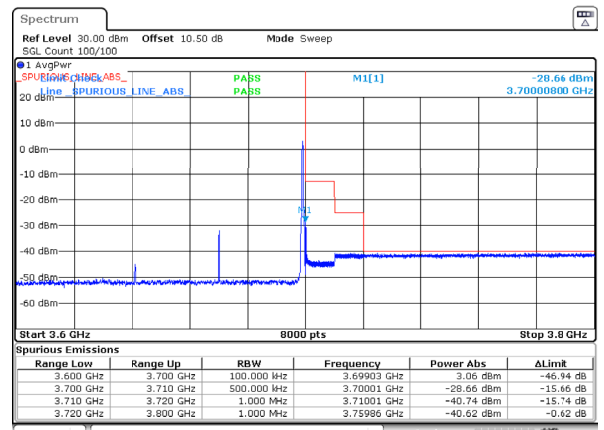


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:23:27

n77\_2\_70MHz\_30kHz\_3585MHz\_DFT-s-OFDM  
QPSK\_RB180@0

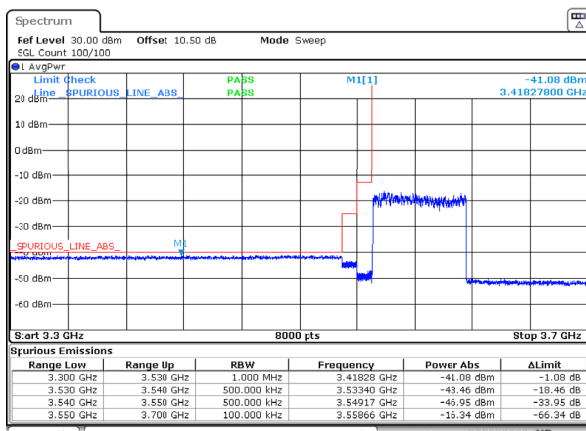


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:26:14

n77\_2\_70MHz\_30kHz\_3585MHz\_DFT-s-OFDM  
QPSK\_RB1@0

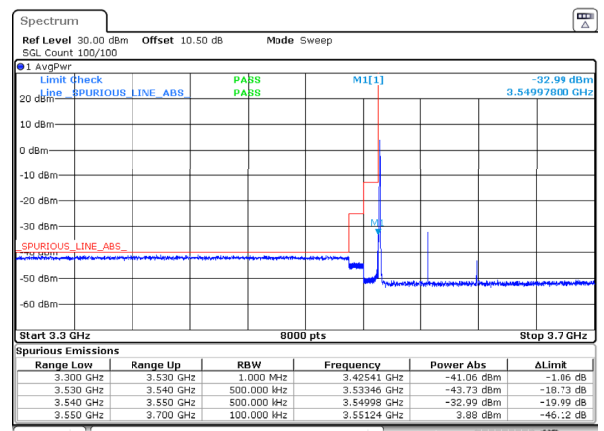


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:25:20

n77\_2\_70MHz\_30kHz\_3665MHz\_DFT-s-OFDM  
QPSK\_RB180@0

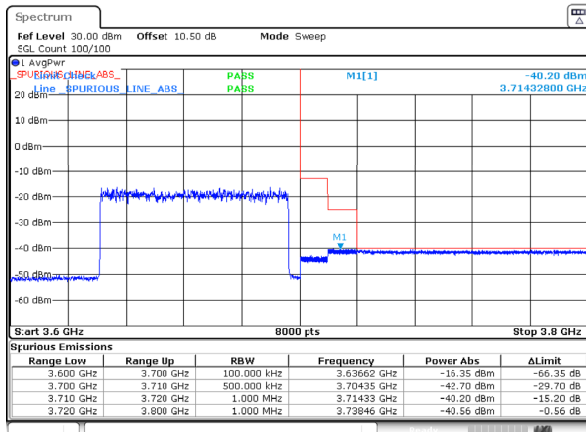


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:28:07

n77\_2\_70MHz\_30kHz\_3665MHz\_DFT-s-OFDM  
QPSK\_RB1@188

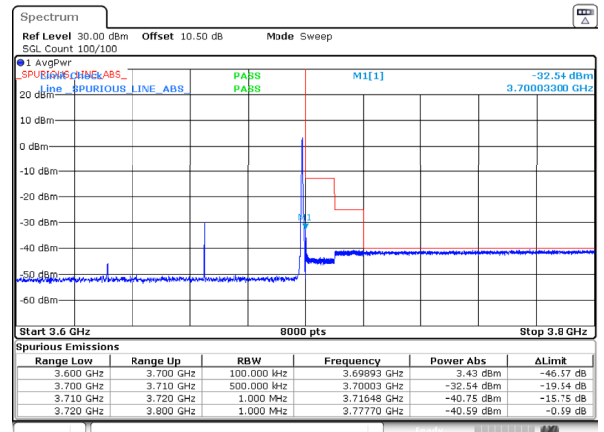


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:27:15

n77\_2\_80MHz\_30kHz\_3590MHz\_DFT-s-OFDM  
QPSK\_RB1@0

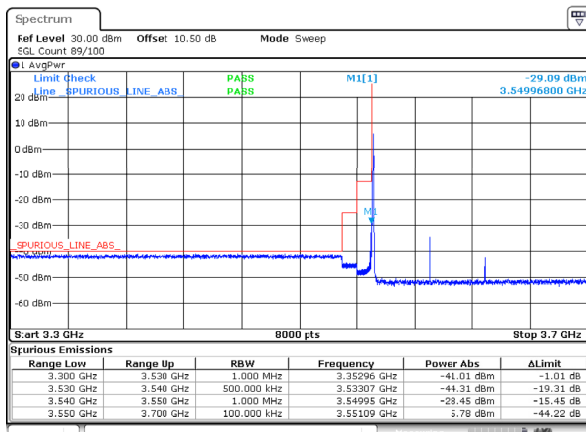


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:20:21

n77\_2\_80MHz\_30kHz\_3590MHz\_DFT-s-OFDM  
QPSK\_RB216@0

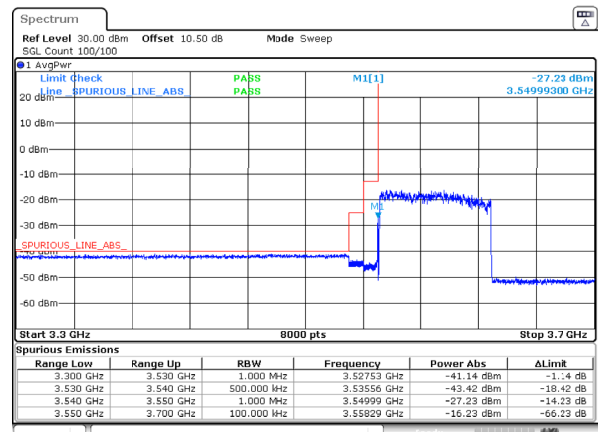


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:30:02

n77\_2\_80MHz\_30kHz\_3660MHz\_DFT-s-OFDM  
QPSK\_RB1@216

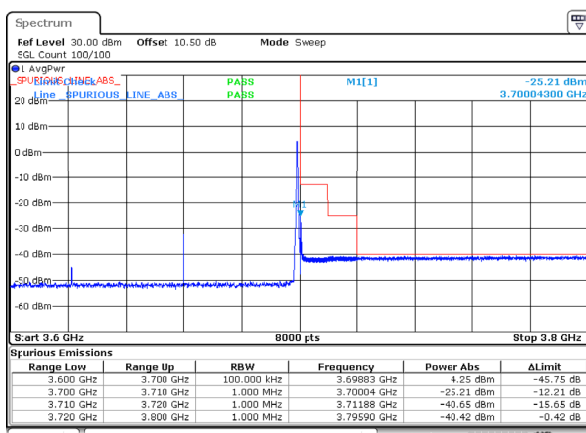


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:21:20

n77\_2\_80MHz\_30kHz\_3660MHz\_DFT-s-OFDM  
QPSK\_RB216@0

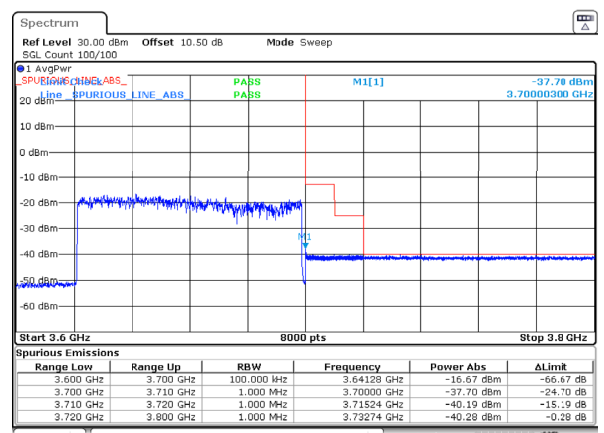


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 19:31:52

n77\_2\_90MHz\_30kHz\_3595MHz\_DFT-s-OFDM  
QPSK\_RB1@0

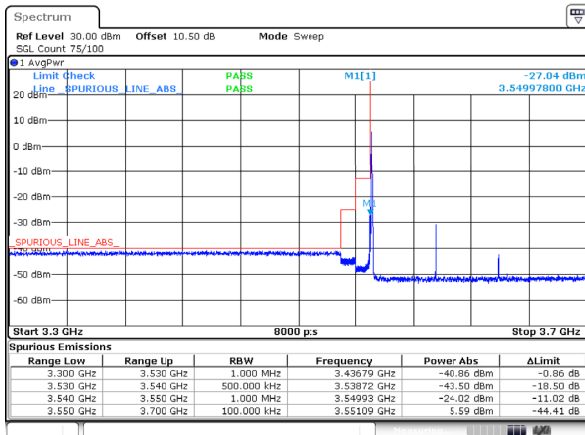


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 16.DEC.2024 14:04:23

n77\_2\_90MHz\_30kHz\_3595MHz\_DFT-s-OFDM  
QPSK\_RB243@0

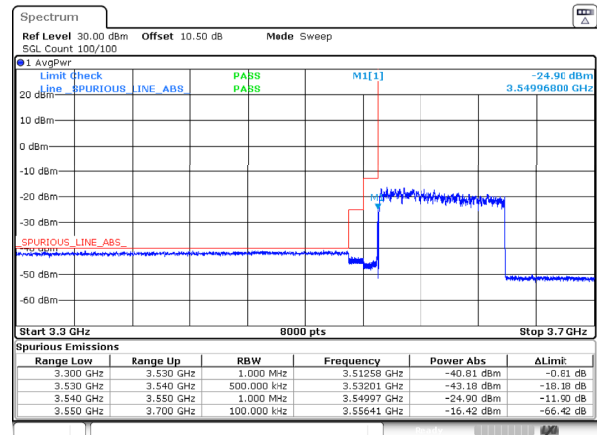


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 7.DEC.2024 19:33:49

n77\_2\_90MHz\_30kHz\_3655MHz\_DFT-s-OFDM  
QPSK\_RB1@244

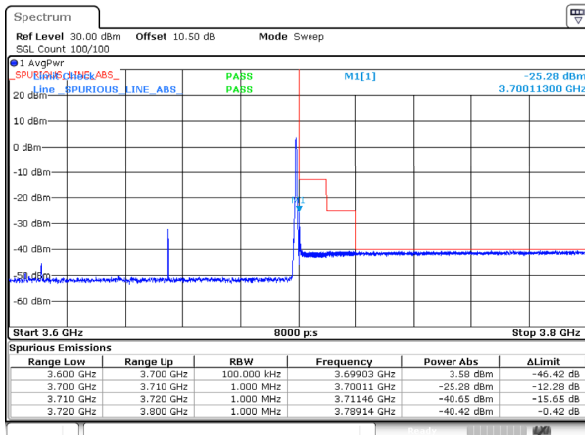


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 16.DEC.2024 14:05:23

n77\_2\_90MHz\_30kHz\_3655MHz\_DFT-s-OFDM  
QPSK\_RB243@0

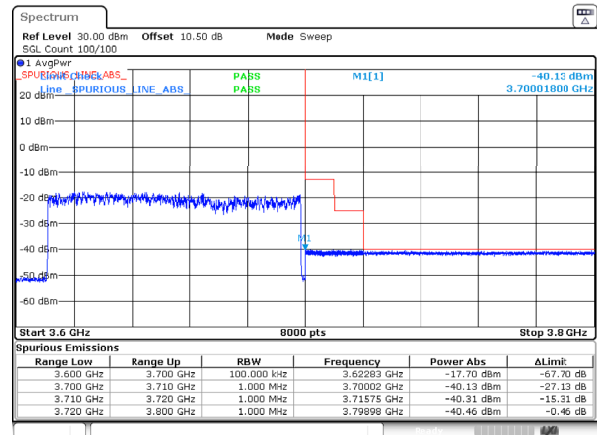


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 7.DEC.2024 19:35:39

n77\_2\_100MHz\_30kHz\_3600MHz\_DFT-s-OFDM  
QPSK\_RB1@0

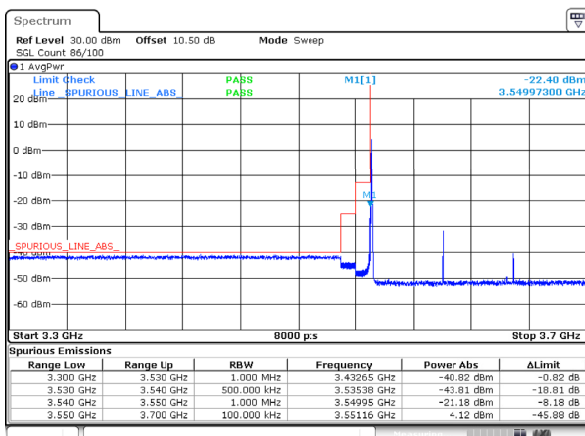


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 16.DEC.2024 14:06:30

n77\_2\_100MHz\_30kHz\_3600MHz\_DFT-s-OFDM  
QPSK\_RB270@0

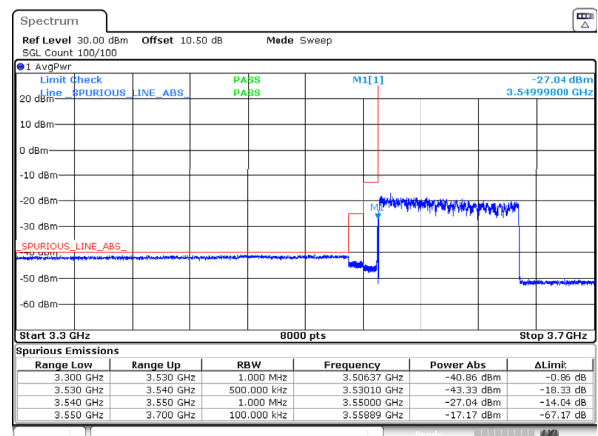


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang  
Date: 7.DEC.2024 19:37:34

n77\_2\_100MHz\_30kHz\_3650MHz\_DFT-s-OFDM  
QPSK\_RB1@272

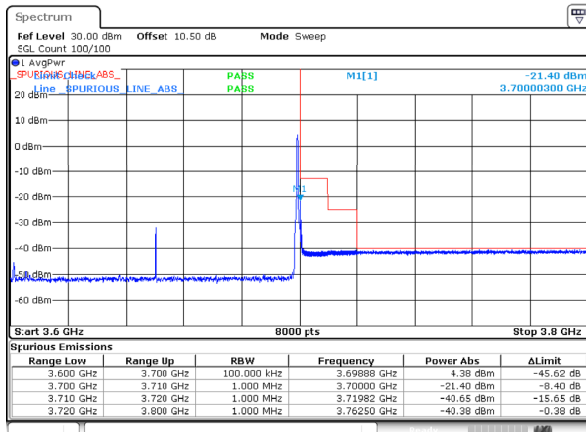

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 16.DEC.2024 14:07:34


n77\_2\_100MHz\_30kHz\_3650MHz\_DFT-s-OFDM  
QPSK\_RB270@0

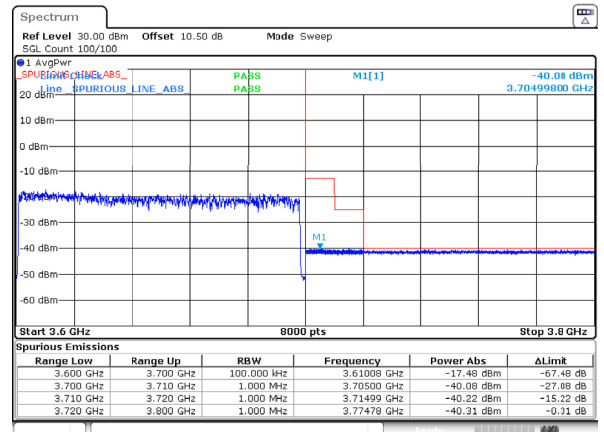

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 7.DEC.2024 19:39:29


n78\_2

n78\_2\_10MHz\_30kHz\_3555MHz\_DFT-s-OFDM  
QPSK\_RB1@0

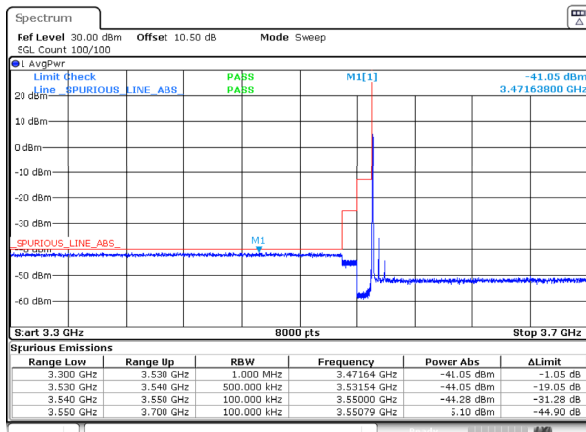


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 7.DEC.2024 21:15:24

n78\_2\_10MHz\_30kHz\_3555MHz\_DFT-s-OFDM  
QPSK\_RB24@0

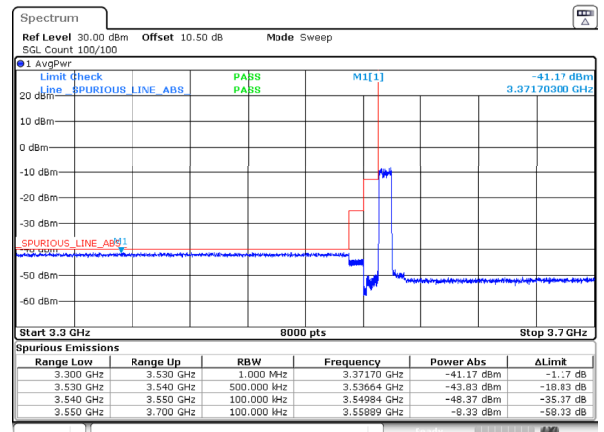


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 7.DEC.2024 21:16:33

n78\_2\_10MHz\_30kHz\_3695MHz\_DFT-s-OFDM  
QPSK\_RB1@23

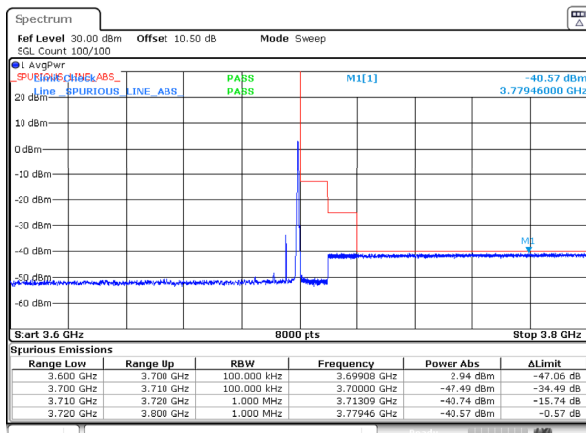

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 7.DEC.2024 21:17:47


n78\_2\_10MHz\_30kHz\_3695MHz\_DFT-s-OFDM  
QPSK\_RB24@0

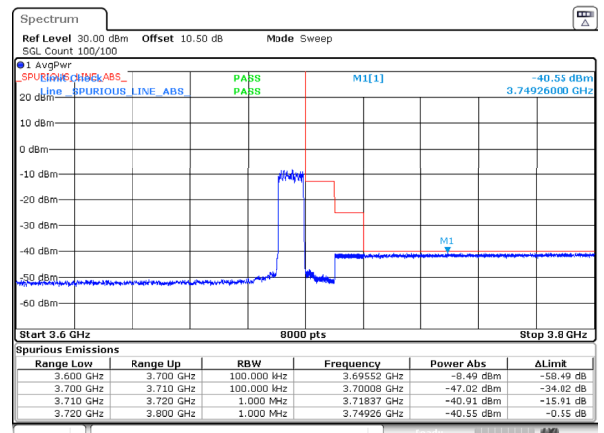

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang  
Date: 7.DEC.2024 21:18:54




n78\_2\_15MHz\_30kHz\_3557.5MHz\_DFT-s-OFDM  
QPSK\_RB1@0

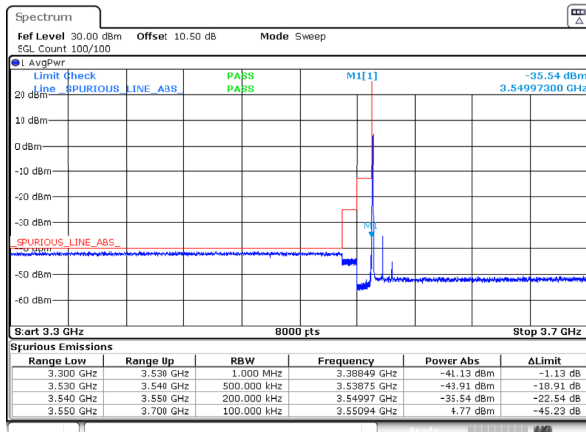


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 7.DEC.2024 21:20:13

n78\_2\_15MHz\_30kHz\_3557.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0

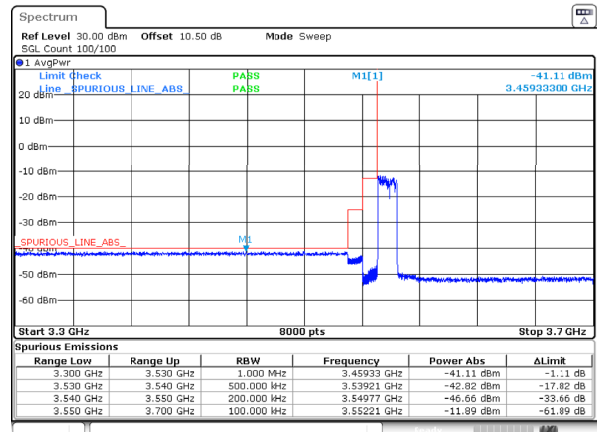


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 7.DEC.2024 21:21:21

n78\_2\_15MHz\_30kHz\_3692.5MHz\_DFT-s-OFDM  
QPSK\_RB1@37

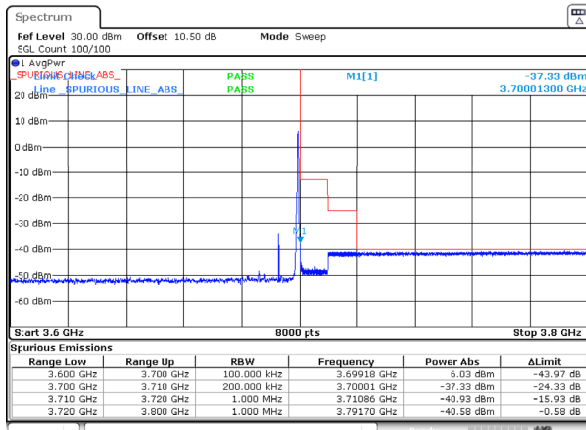


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 7.DEC.2024 21:22:35

n78\_2\_15MHz\_30kHz\_3692.5MHz\_DFT-s-OFDM  
QPSK\_RB36@0

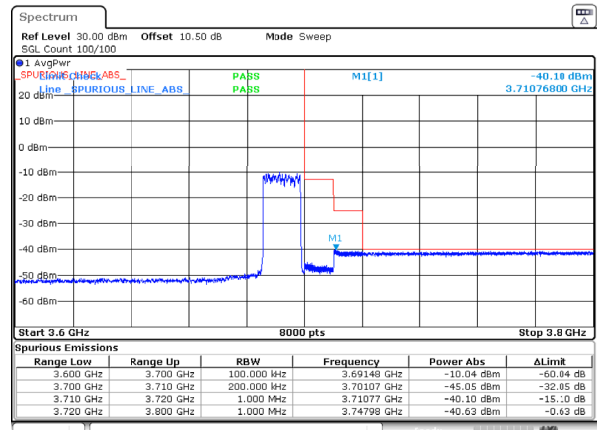


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 7.DEC.2024 21:23:42

n78\_2\_20MHz\_30kHz\_3560MHz\_DFT-s-OFDM  
QPSK\_RB1@0

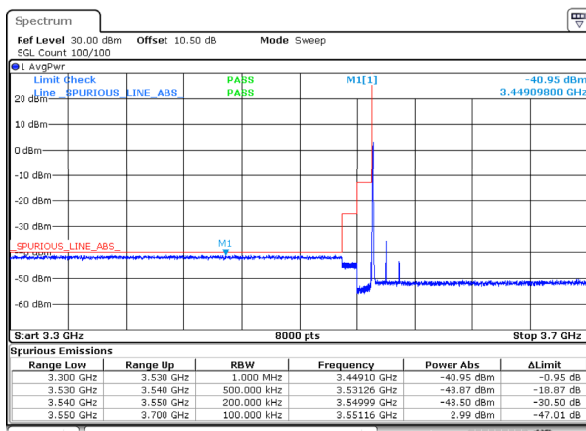


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 16.DEC.2024 14:38:50

n78\_2\_20MHz\_30kHz\_3560MHz\_DFT-s-OFDM  
QPSK\_RB50@0

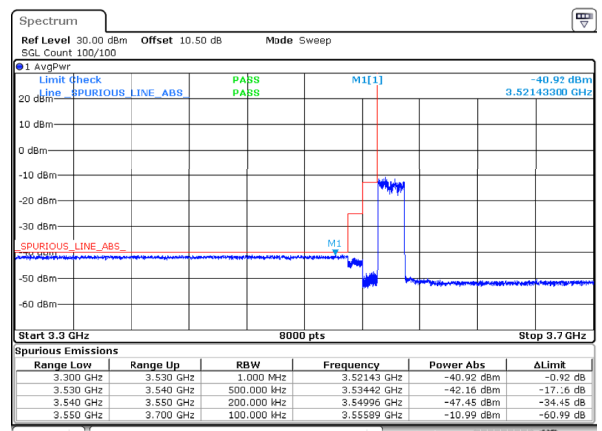


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang  
Date: 16.DEC.2024 14:39:32

n78\_2\_20MHz\_30kHz\_3690MHz\_DFT-s-OFDM  
QPSK\_RB1@50

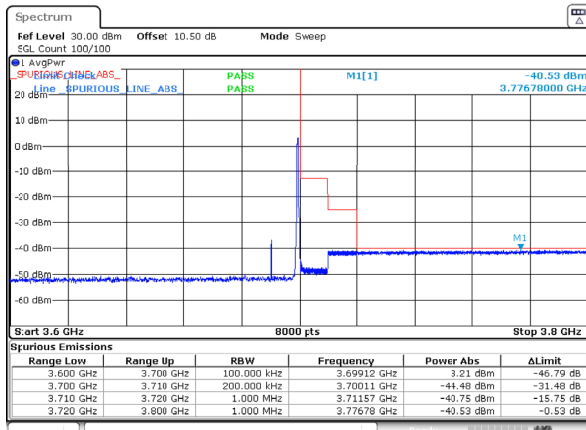


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:36:49

n78\_2\_20MHz\_30kHz\_3690MHz\_DFT-s-OFDM  
QPSK\_RB50@0

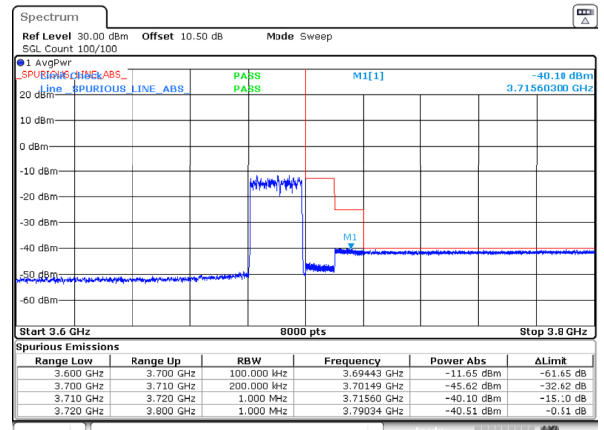


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:37:58

n78\_2\_30MHz\_30kHz\_3565MHz\_DFT-s-OFDM  
QPSK\_RB1@0

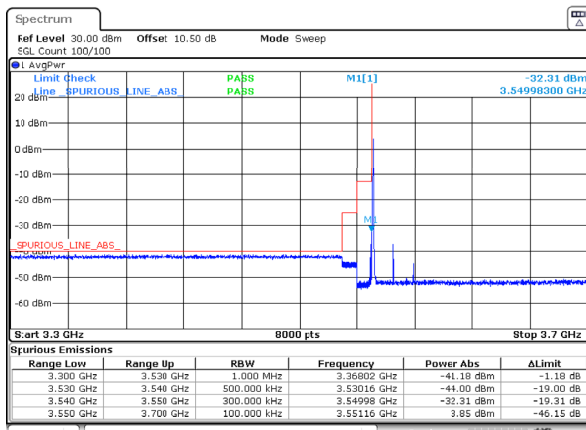


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:39:16

n78\_2\_30MHz\_30kHz\_3565MHz\_DFT-s-OFDM  
QPSK\_RB75@0

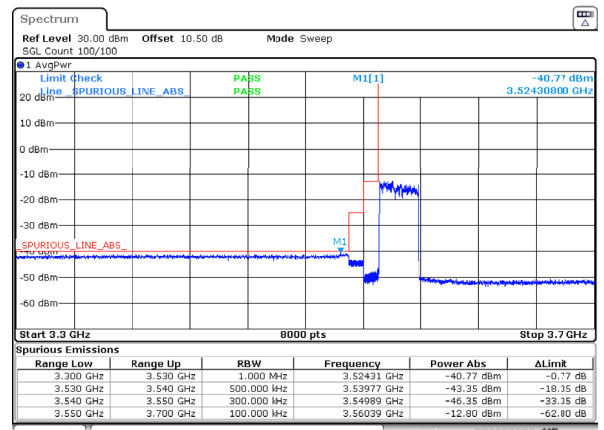


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:40:25

n78\_2\_30MHz\_30kHz\_3685MHz\_DFT-s-OFDM  
QPSK\_RB1@77

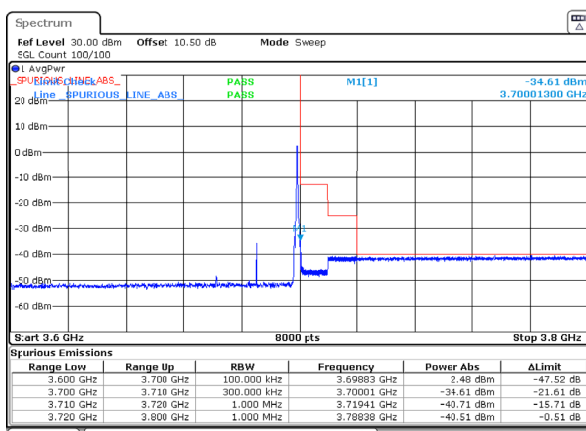

ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:41:43


n78\_2\_30MHz\_30kHz\_3685MHz\_DFT-s-OFDM  
QPSK\_RB75@0

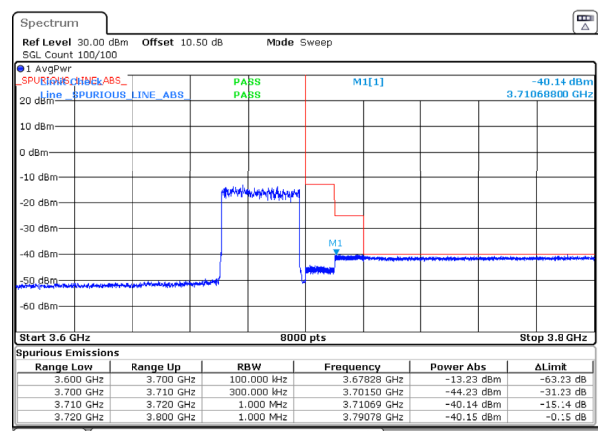

ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:42:51




n78\_2\_40MHz\_30kHz\_3570MHz\_DFT-s-OFDM  
QPSK\_RB100@0

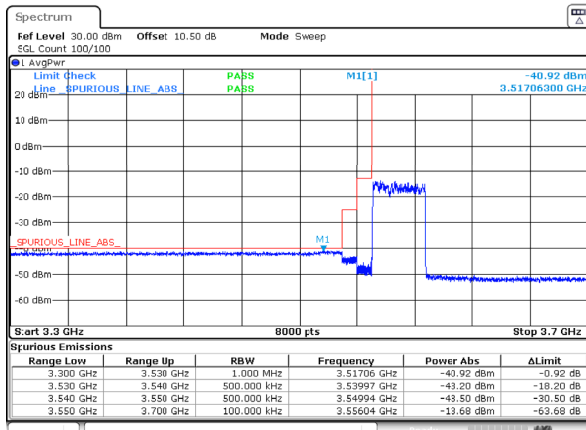


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:45:20

n78\_2\_40MHz\_30kHz\_3570MHz\_DFT-s-OFDM  
QPSK\_RB1@0

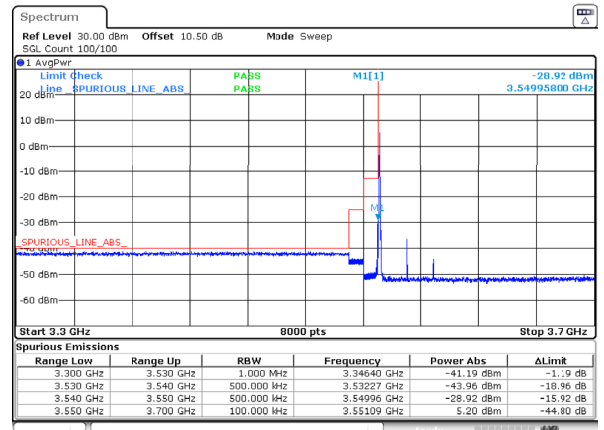


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:44:10

n78\_2\_40MHz\_30kHz\_3680MHz\_DFT-s-OFDM  
QPSK\_RB100@0

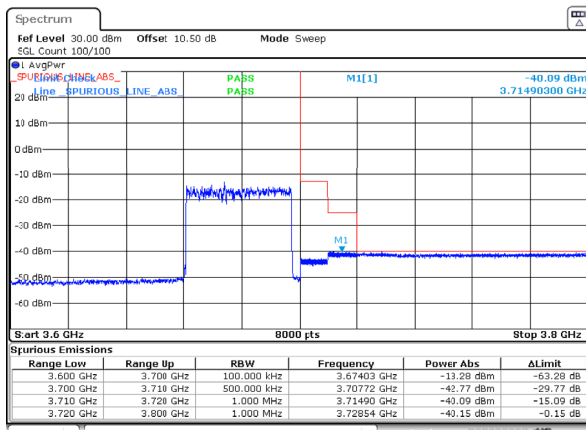


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:47:46

n78\_2\_40MHz\_30kHz\_3680MHz\_DFT-s-OFDM  
QPSK\_RB1@105

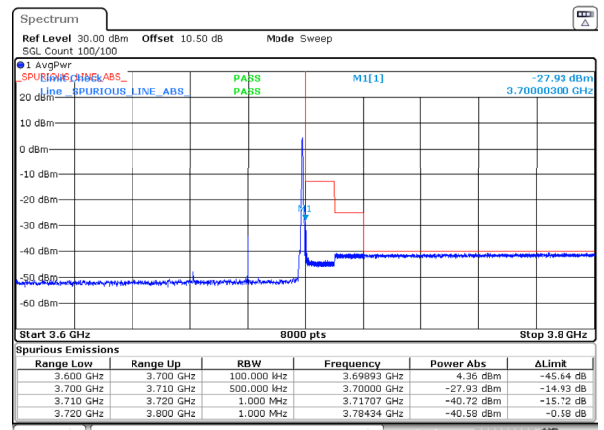


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:46:38

n78\_2\_50MHz\_30kHz\_3575MHz\_DFT-s-OFDM  
QPSK\_RB128@0

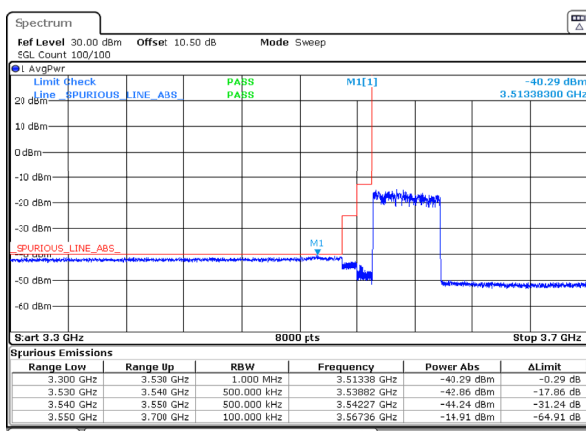


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:50:15

n78\_2\_50MHz\_30kHz\_3575MHz\_DFT-s-OFDM  
QPSK\_RB1@0

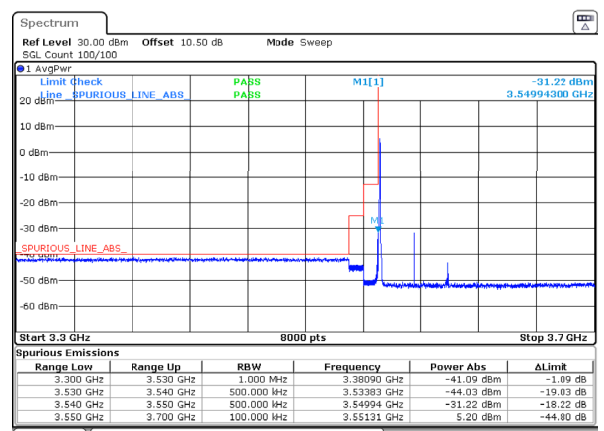


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang  
Date: 7.DEC.2024 21:49:05

n78\_2\_50MHz\_30kHz\_3675MHz\_DFT-s-OFDM  
QPSK\_RB128@0

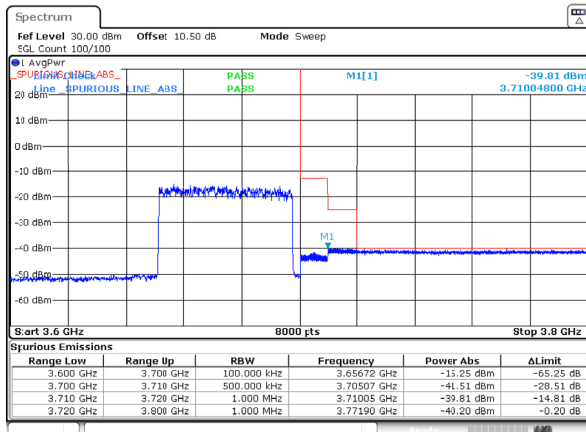


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:52:37

n78\_2\_50MHz\_30kHz\_3675MHz\_DFT-s-OFDM  
QPSK\_RB1@132

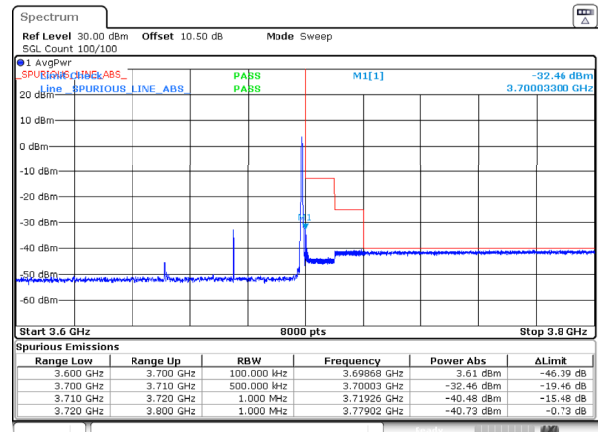


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:51:29

n78\_2\_60MHz\_30kHz\_3580MHz\_DFT-s-OFDM  
QPSK\_RB162@0

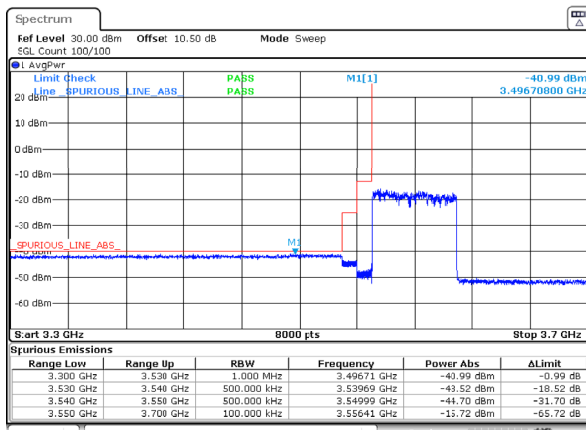


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:55:10

n78\_2\_60MHz\_30kHz\_3580MHz\_DFT-s-OFDM  
QPSK\_RB1@0

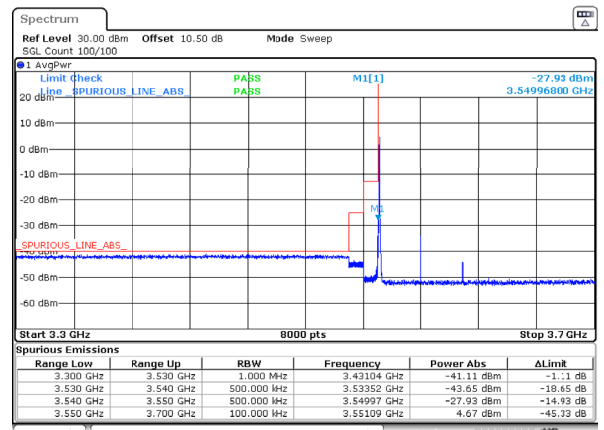


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:54:00

n78\_2\_60MHz\_30kHz\_3670MHz\_DFT-s-OFDM  
QPSK\_RB162@0

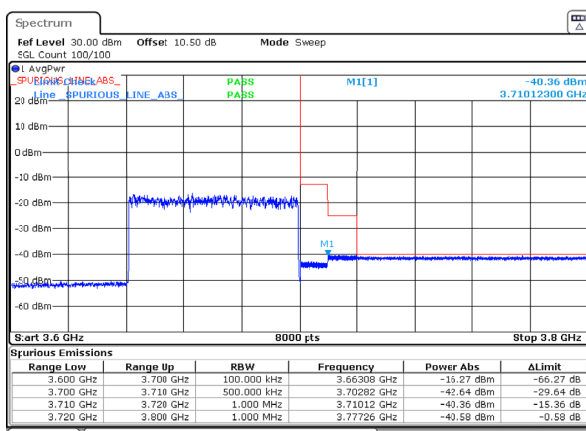


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:57:33

n78\_2\_60MHz\_30kHz\_3670MHz\_DFT-s-OFDM  
QPSK\_RB1@161

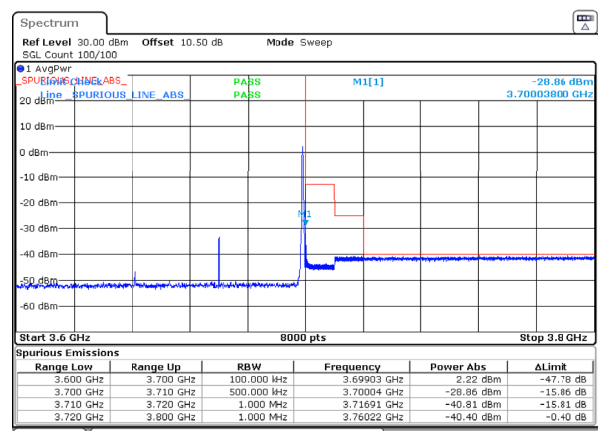


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:54:24

n78\_2\_70MHz\_30kHz\_3585MHz\_DFT-s-OFDM  
QPSK\_RB180@0

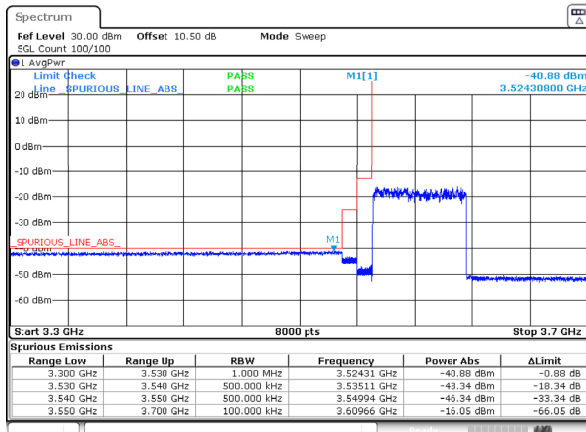


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:00:02

n78\_2\_70MHz\_30kHz\_3585MHz\_DFT-s-OFDM  
QPSK\_RB1@0

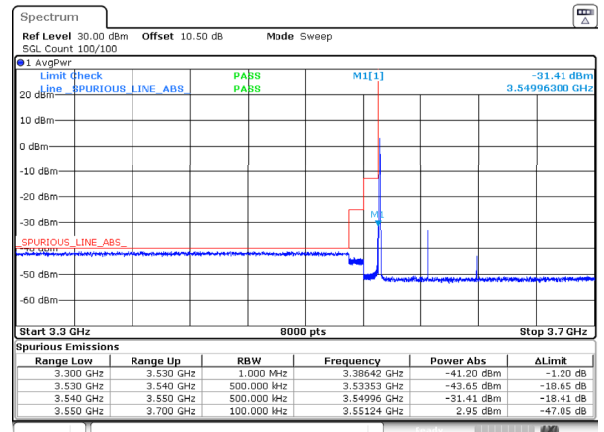


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 21:58:51

n78\_2\_70MHz\_30kHz\_3665MHz\_DFT-s-OFDM  
QPSK\_RB180@0

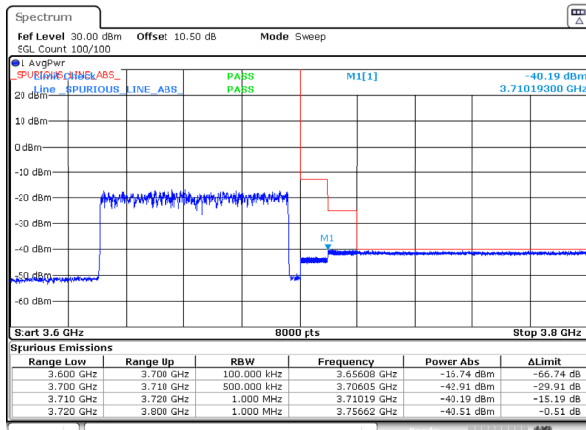


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:02:26

n78\_2\_70MHz\_30kHz\_3665MHz\_DFT-s-OFDM  
QPSK\_RB1@188

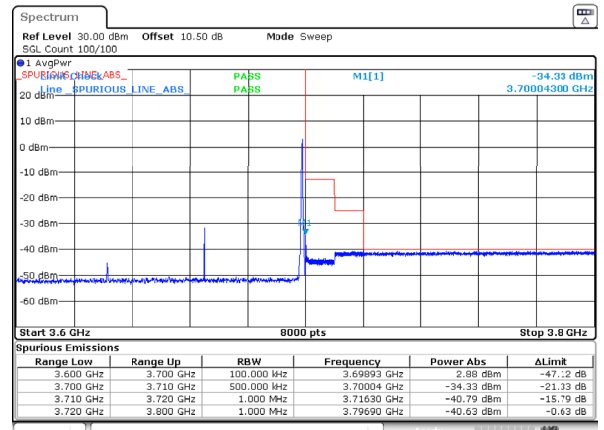


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:01:16

n78\_2\_80MHz\_30kHz\_3590MHz\_DFT-s-OFDM  
QPSK\_RB1@0

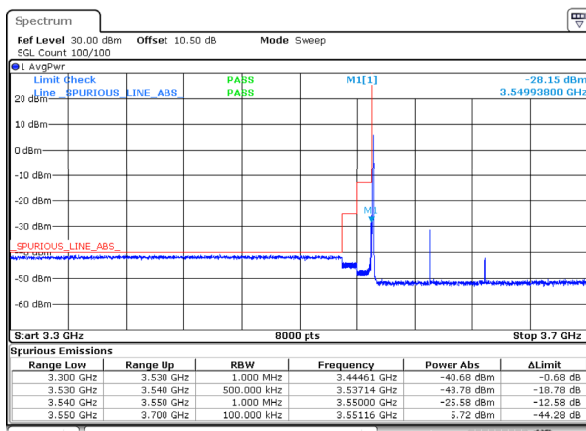


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:40:35

n78\_2\_80MHz\_30kHz\_3590MHz\_DFT-s-OFDM  
QPSK\_RB216@0

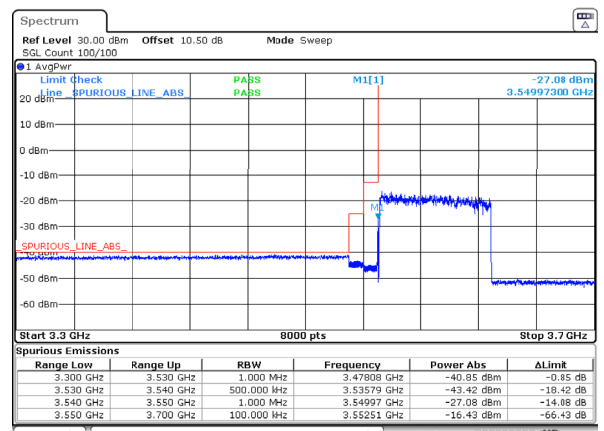


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:04:56

n78\_2\_80MHz\_30kHz\_3660MHz\_DFT-s-OFDM  
QPSK\_RB1@216

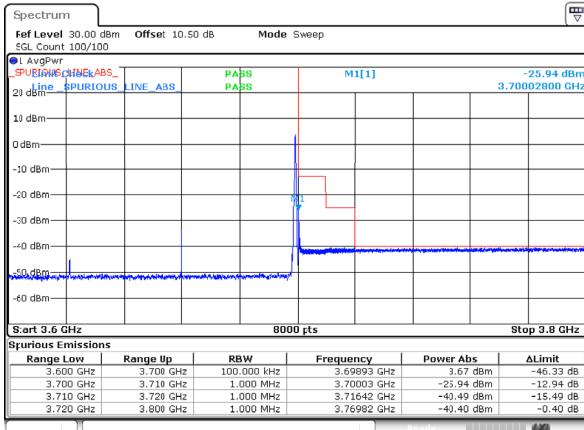


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:41:35

n78\_2\_80MHz\_30kHz\_3660MHz\_DFT-s-OFDM  
QPSK\_RB216@0

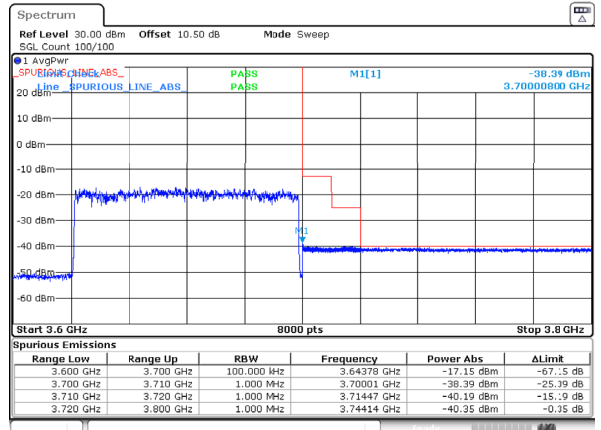


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:07:19

n78\_2\_90MHz\_30kHz\_3595MHz\_DFT-s-OFDM  
QPSK\_RB1@0

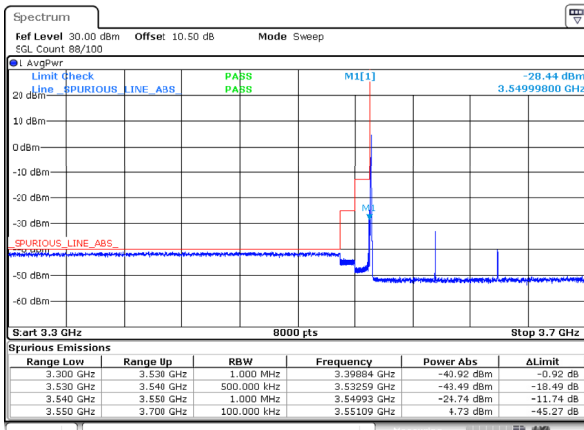


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:42:43

n78\_2\_90MHz\_30kHz\_3595MHz\_DFT-s-OFDM  
QPSK\_RB243@0

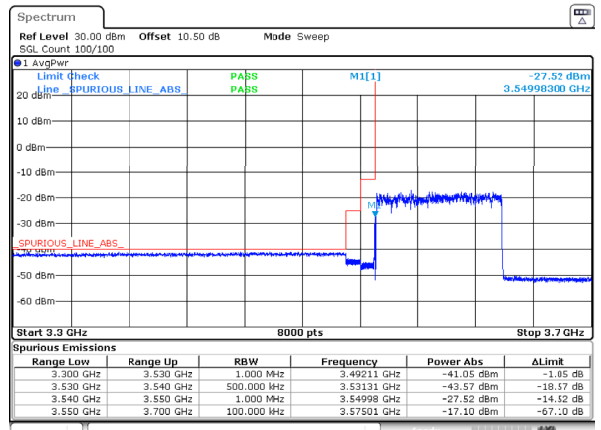


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:09:50

n78\_2\_90MHz\_30kHz\_3655MHz\_DFT-s-OFDM  
QPSK\_RB1@244

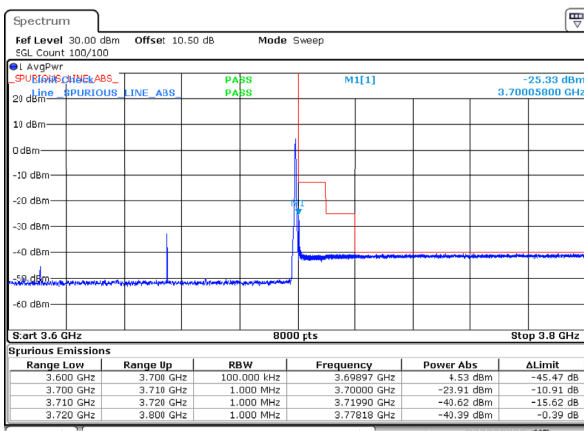


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 16.DEC.2024 14:43:42

n78\_2\_90MHz\_30kHz\_3655MHz\_DFT-s-OFDM  
QPSK\_RB243@0

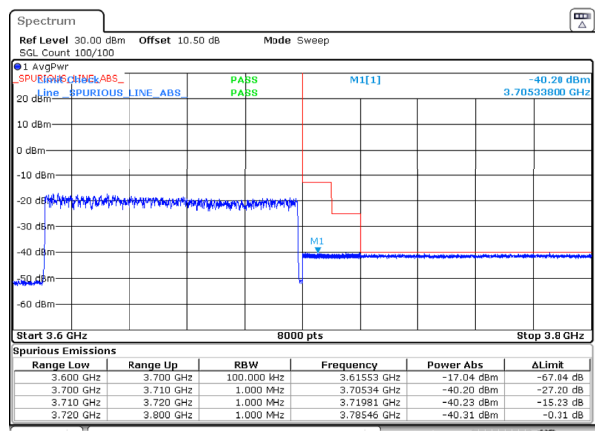


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang  
Date: 7.DEC.2024 22:12:14

n78\_2\_100MHz\_30kHz\_3600MHz\_DFT-s-OFDM  
QPSK\_RB1@0

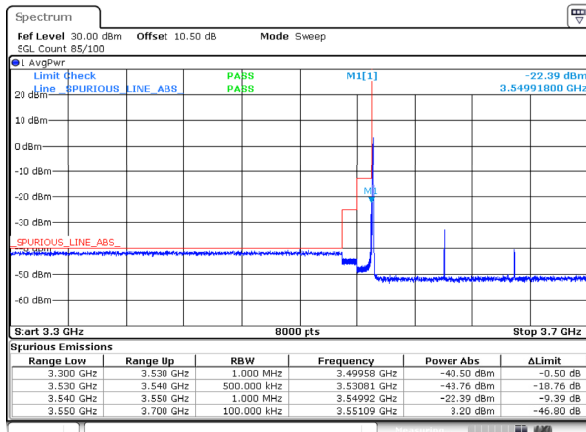


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter: L.Jiang  
Date: 16.DEC.2024 14:44:46

n78\_2\_100MHz\_30kHz\_3600MHz\_DFT-s-OFDM  
QPSK\_RB270@0

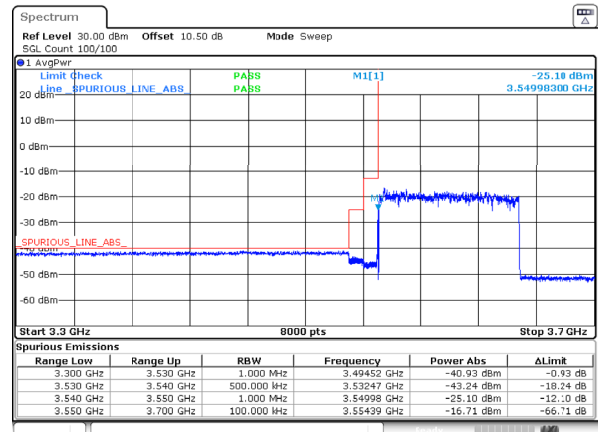


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter: L.Jiang  
Date: 7.DEC.2024 22:14:44

n78\_2\_100MHz\_30kHz\_3650MHz\_DFT-s-OFDM  
QPSK\_RB1@272

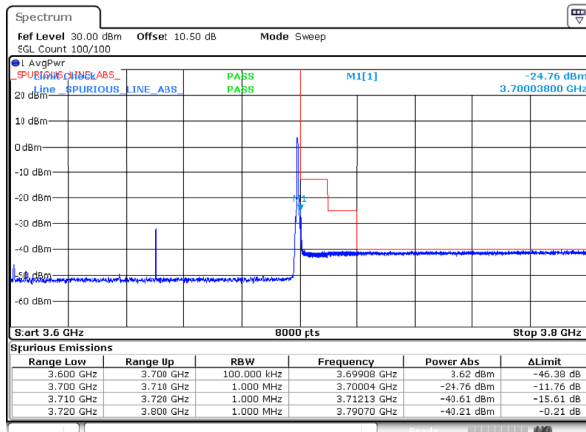

ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter: L.Jiang  
Date: 16.DEC.2024 14:45:44

n78\_2\_100MHz\_30kHz\_3650MHz\_DFT-s-OFDM  
QPSK\_RB270@0

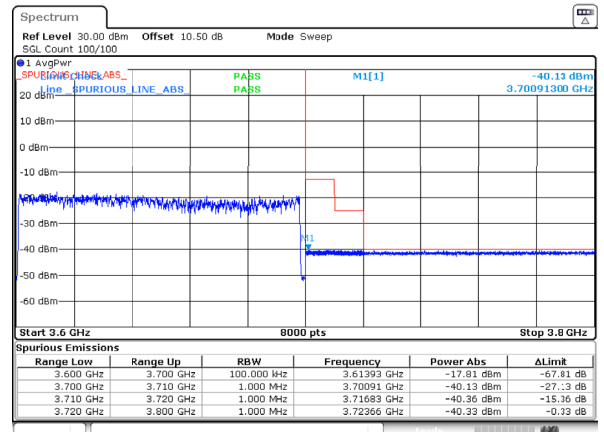

ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter: L.Jiang  
Date: 7.DEC.2024 22:17:14