



Please refer to following plots:

Band 2_1.4 MHz_Low_QPSK_RB6#0

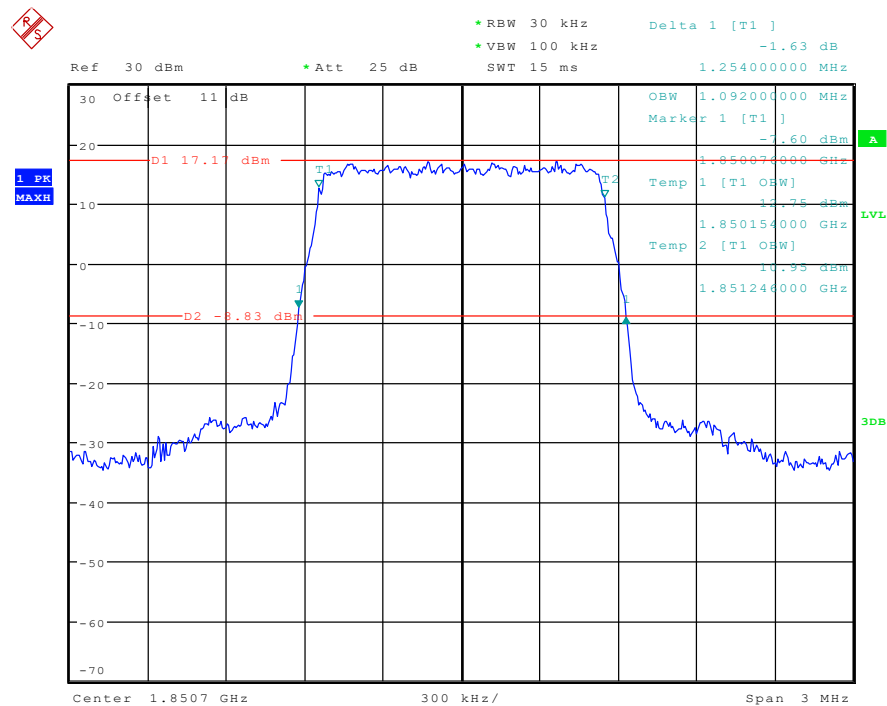


Date: 24.NOV.2022 10:42:17

Band 2_1.4 MHz_Low_16QAM_RB6#0

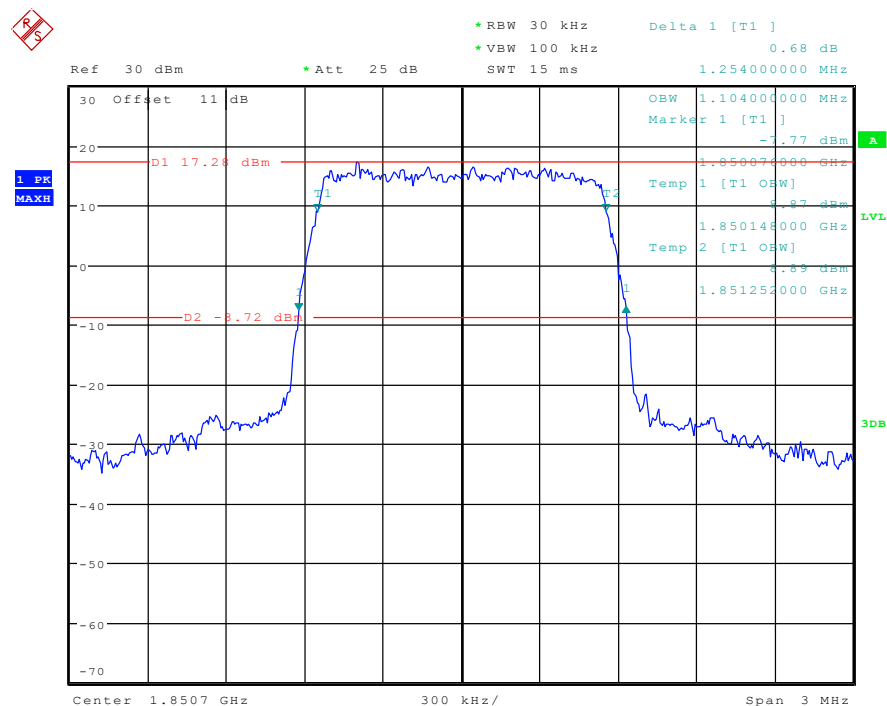


Date: 24.NOV.2022 10:42:36

Band 2_1.4 MHz_Middle_QPSK_RB6#0

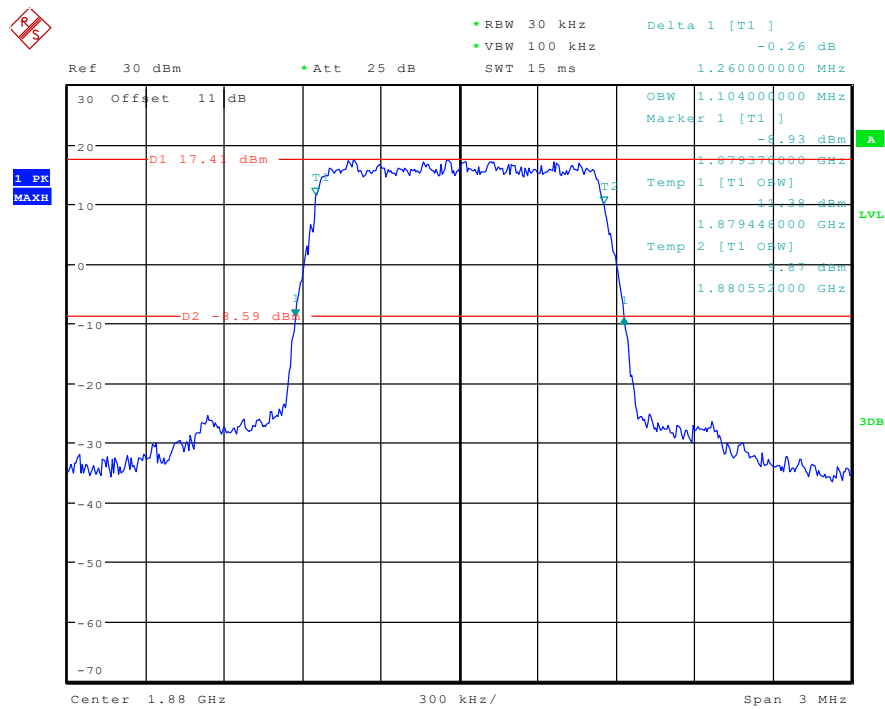

Date: 24.NOV.2022 10:44:19

Band 2_1.4 MHz_Middle_16QAM_RB6#0

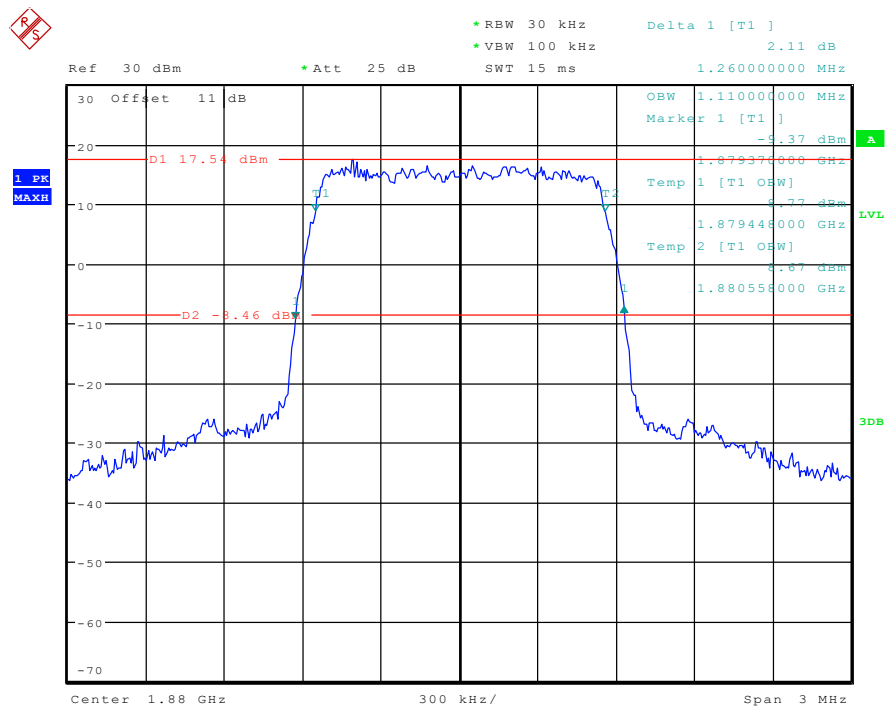


Date: 24.NOV.2022 10:44:37

Date: 24.NOV.2022 10:45:35


Date: 24.NOV.2022 10:45:50

Band 2_3 MHz_Low_QPSK_RB15#0

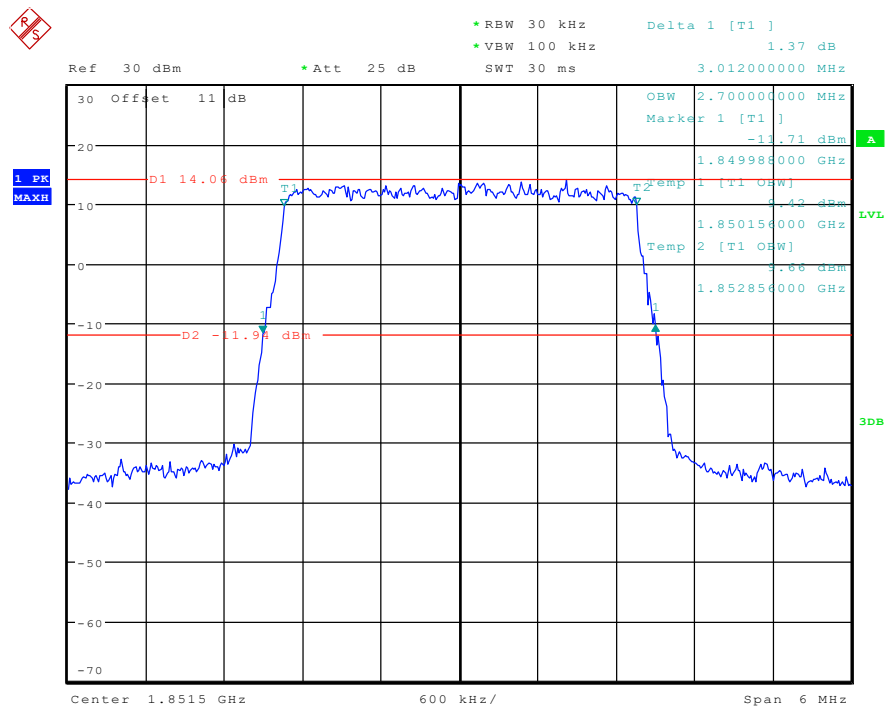


Date: 24.NOV.2022 10:46:07

Band 2_3 MHz_Low_16QAM_RB15#0

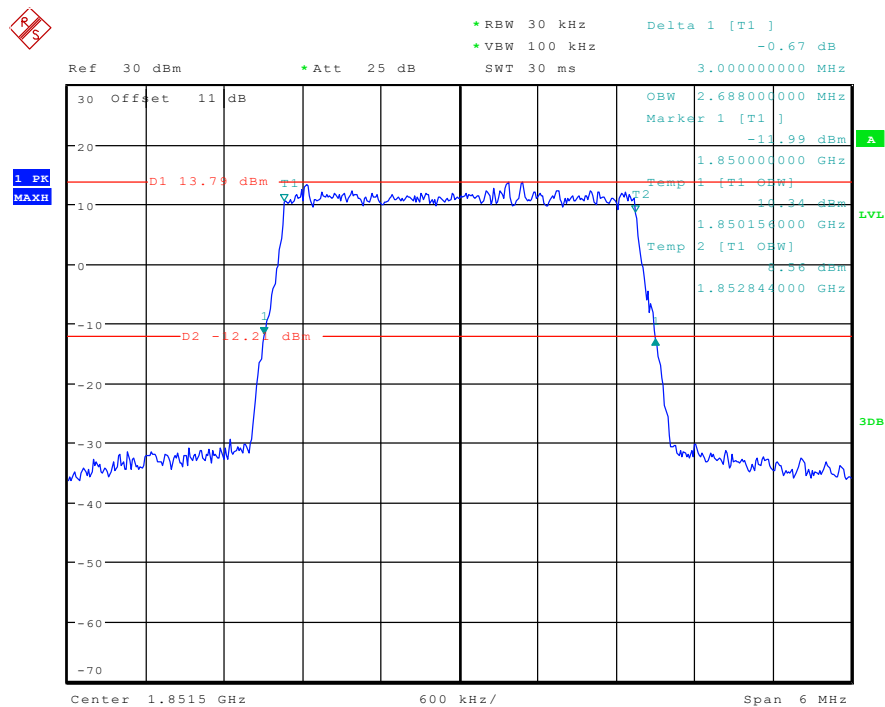


Date: 24.NOV.2022 10:46:22

Band 2_3 MHz_Middle_QPSK_RB15#0

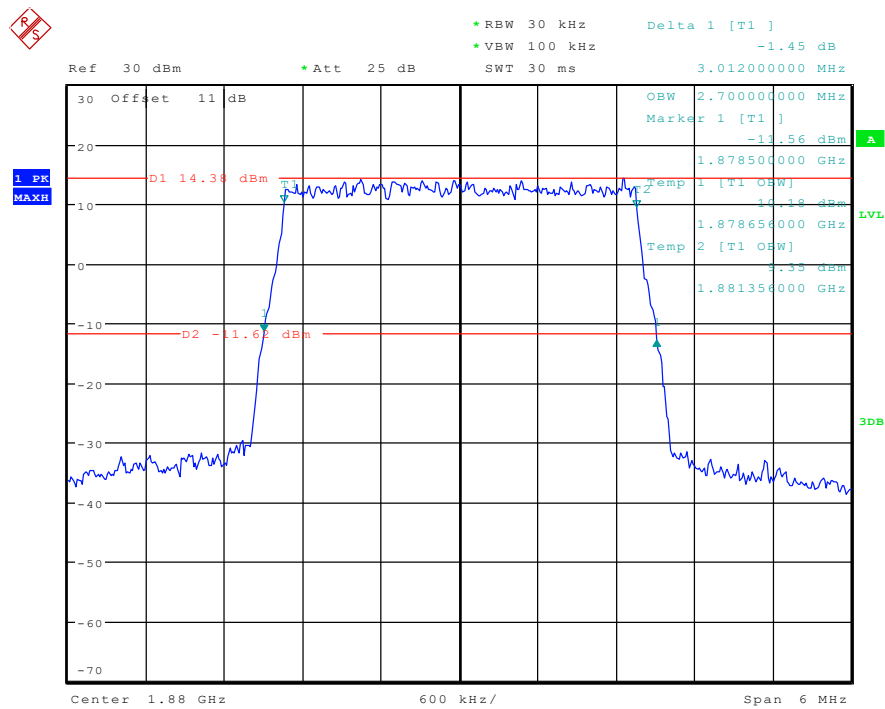


Date: 24.NOV.2022 10:46:38

Band 2_3 MHz_Middle_16QAM_RB15#0

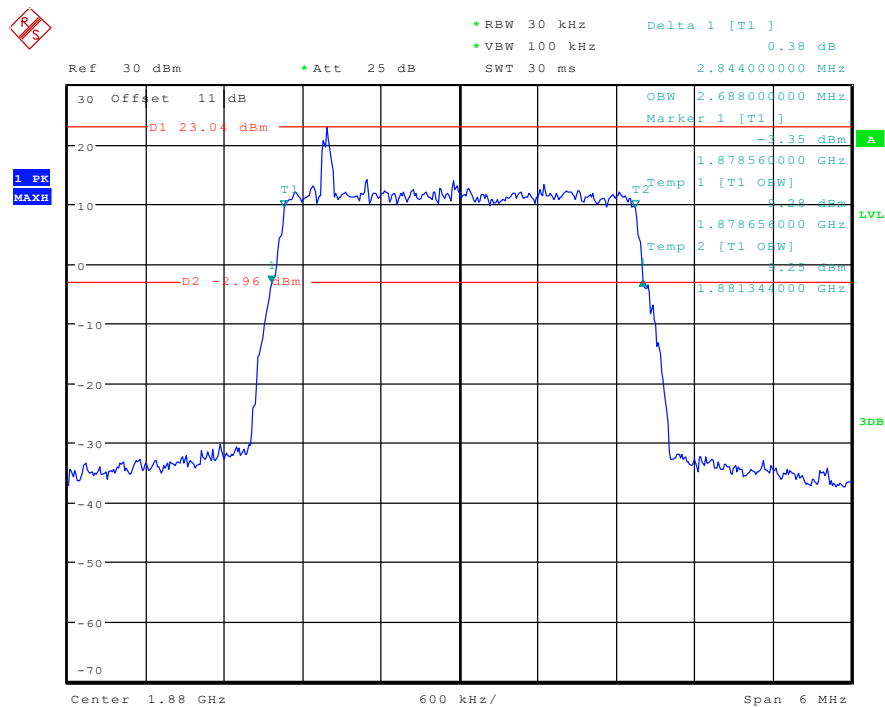


Date: 24.NOV.2022 10:46:53

Band 2_3 MHz_High_QPSK_RB15#0

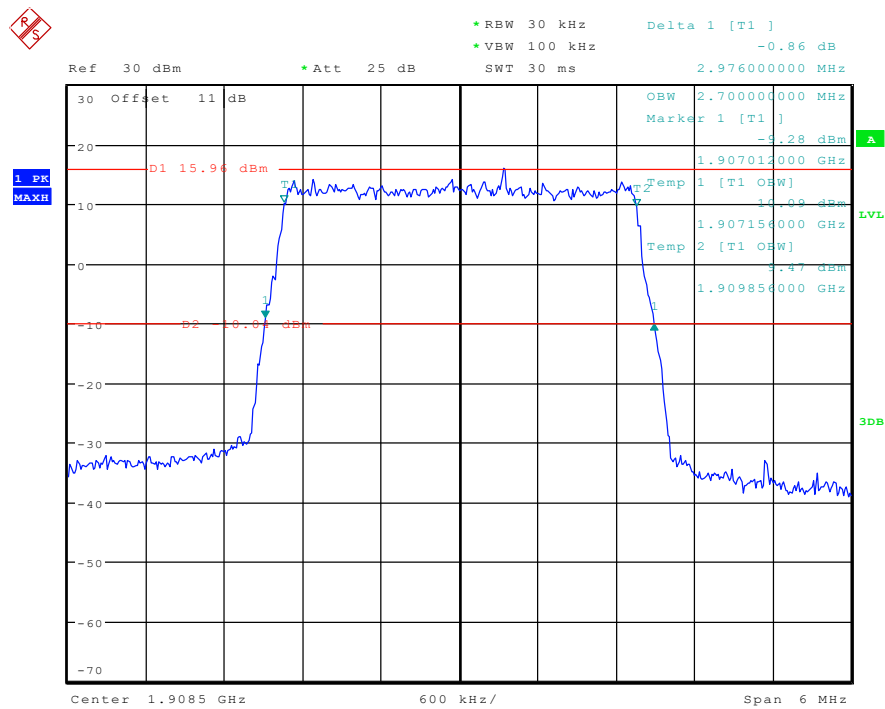


Date: 24.NOV.2022 10:47:11

Band 2_3 MHz_High_16QAM_RB15#0

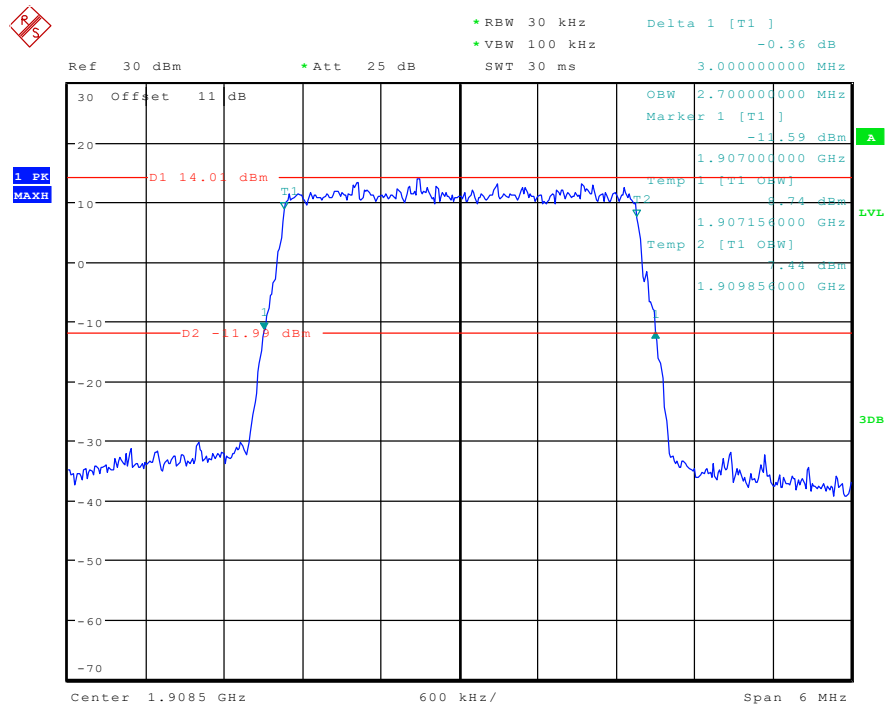


Date: 24.NOV.2022 10:47:30

Band 2_5 MHz_Low_QPSK_RB25#0

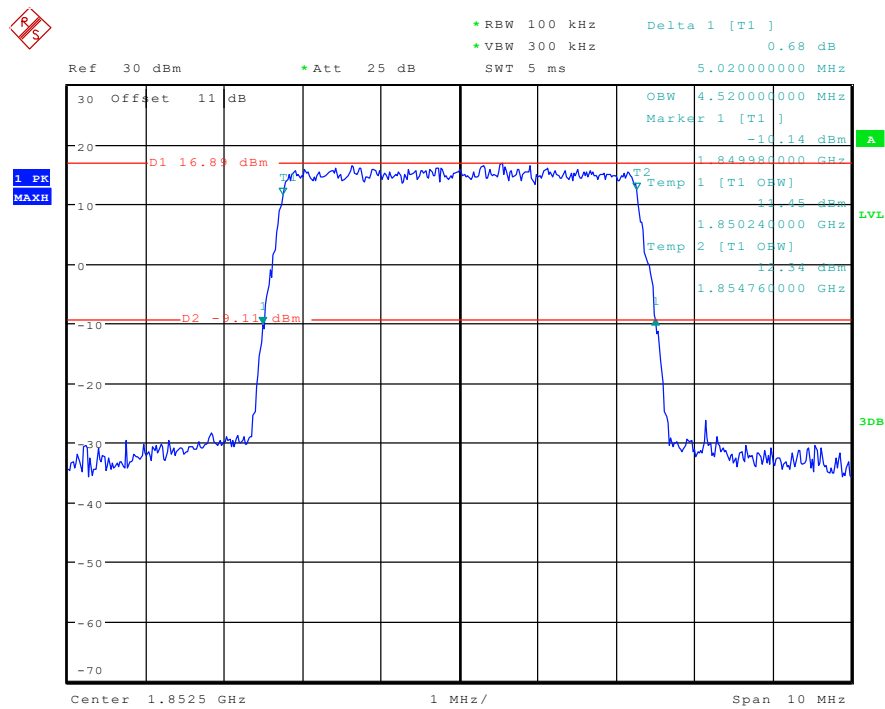


Date: 24.NOV.2022 10:47:51

Band 2_5 MHz_Low_16QAM_RB25#0

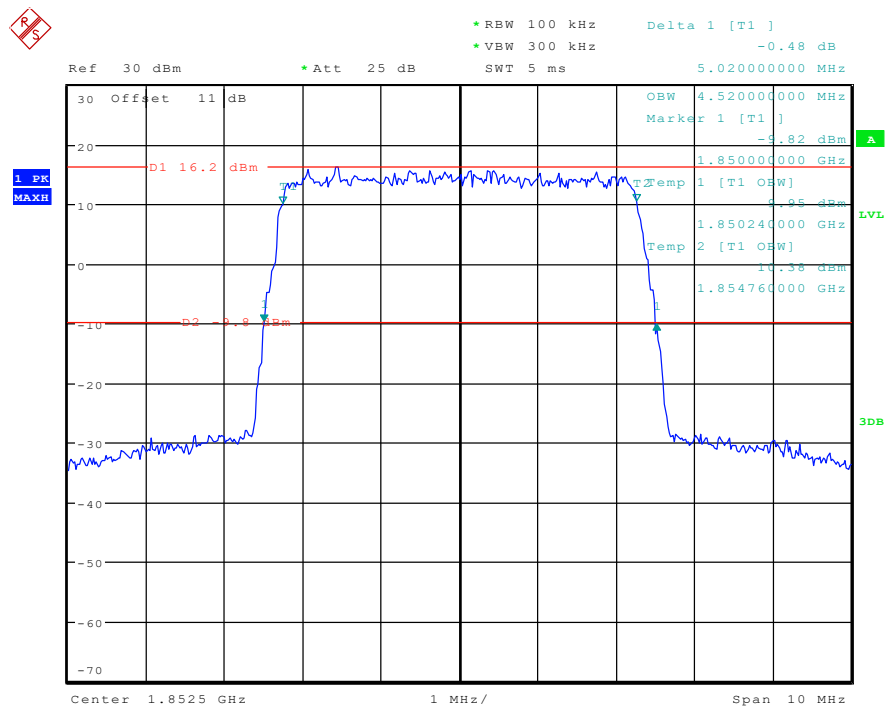


Date: 24.NOV.2022 10:48:09

Band 2_5 MHz_Middle_QPSK_RB25#0

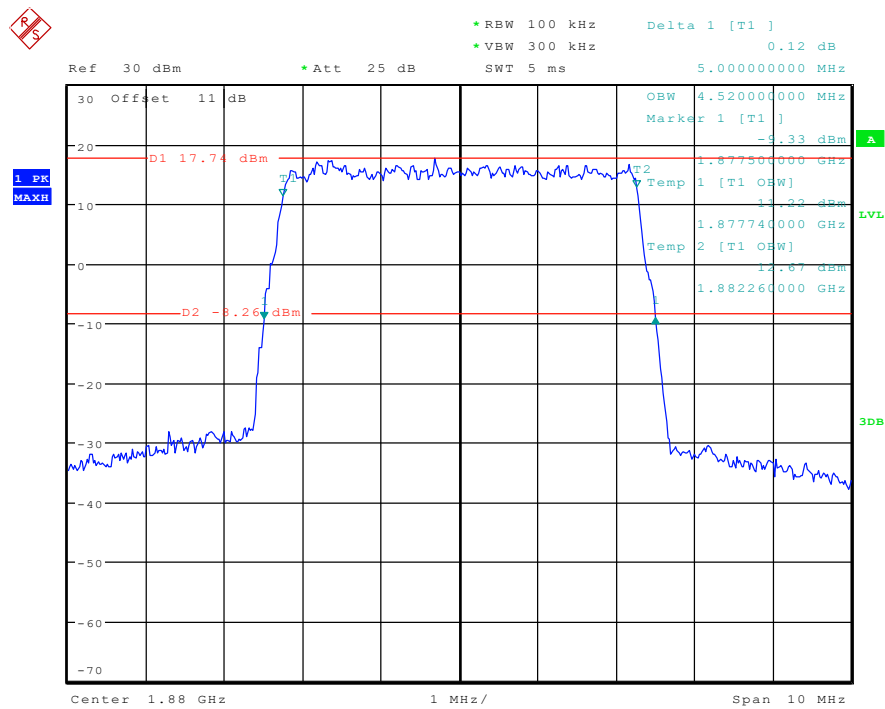


Date: 24.NOV.2022 10:48:29

Band 2_5 MHz_Middle_16QAM_RB25#0

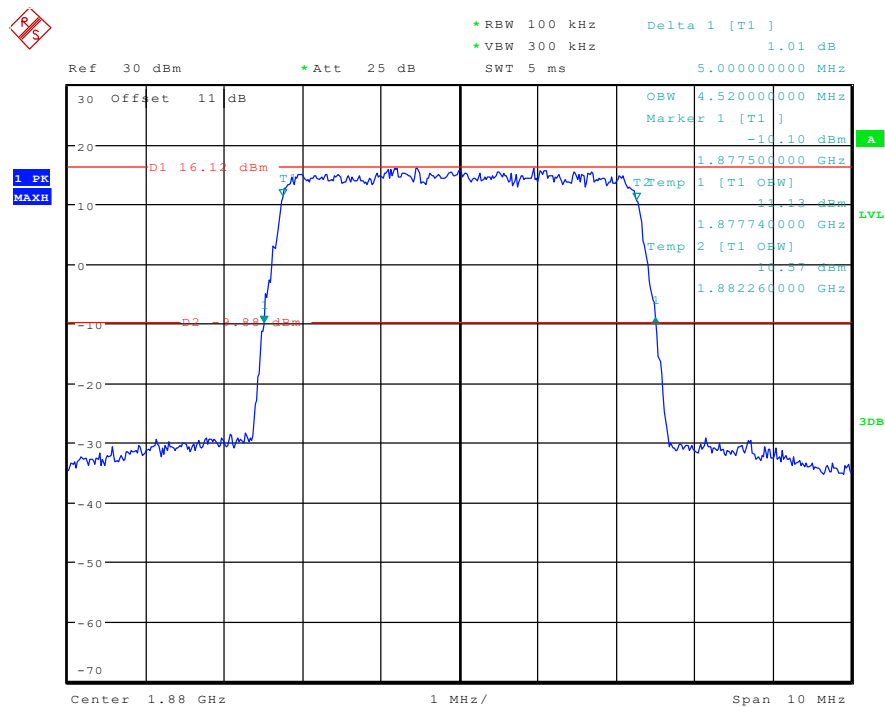


Date: 24.NOV.2022 10:48:47

Band 2_5 MHz_High_QPSK_RB25#0

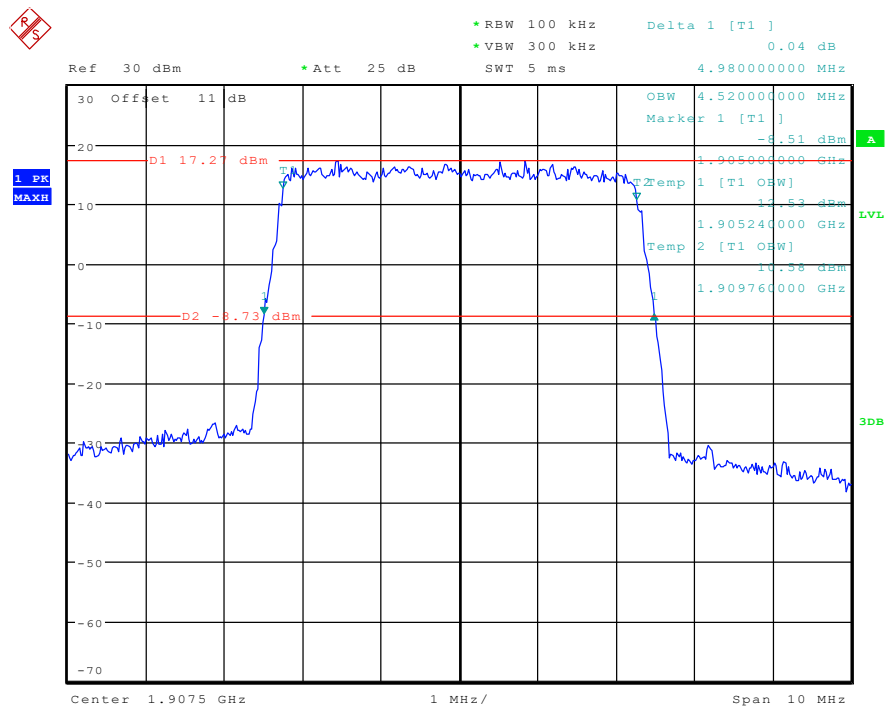

Date: 24.NOV.2022 10:49:10

Band 2_5 MHz_High_16QAM_RB25#0

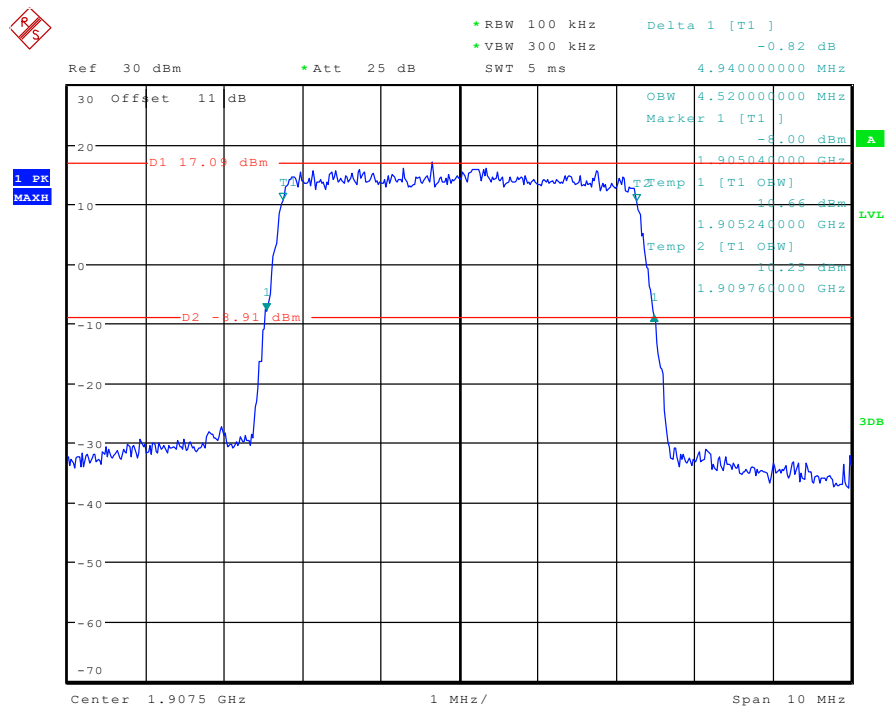

Date: 24.NOV.2022 10:49:28

RBW 100 kHz Delta 1 [T1]
 VBW 300 kHz -0.04 dB
 Ref 30 dBm * Att 25 dB SWT 10 ms 9.800000000 MHz

30 Offset 11 dB

1 PR
 MAXH

D1 14.63 dBm

D2 -11.37 dBm

OBW 9.000000000 MHz
 Marker 1 [T1]
 -11.21 dBm
 1.850120000 GHz
 1 [T1 OBW]
 10.24 dBm
 1.850520000 GHz
 2 [T1 OBW]
 10.83 dBm
 1.859520000 GHz

Temp 1 [T1 OBW]
 Temp 2 [T1 OBW]

1

1

3dB

Center 1.855 GHz 2 MHz/
 Span 20 MHz


Date: 24.NOV.2022 10:49:50

* RBW 100 kHz Delta 1 [T1] 1.20 dB
 * VBW 300 kHz
 Ref 30 dBm * Att 25 dB SWT 10 ms 9.840000000 MHz

30 Offset 11 dB
 1 PK
 MAXH
 D1 13.56 dBm
 T1
 OBW 9.000000000 MHz
 Marker 1 [T1] -13.60 dBm
 1.850080000 GHz
 Temp 1 [T1 OBW] -13.60 dBm
 1.850520000 GHz
 Temp 2 [T1 OBW] -13.60 dBm
 1.859520000 GHz
 D2 -12.44 dBm
 1
 30dB
 LVL
 30
 20
 10
 0
 -10
 -20
 -30
 -40
 -50
 -60
 -70
 Center 1.855 GHz 2 MHz/
 Span 20 MHz


Date: 24.NOV.2022 10:50:09

Band 2_10 MHz_Middle_QPSK_RB50#0

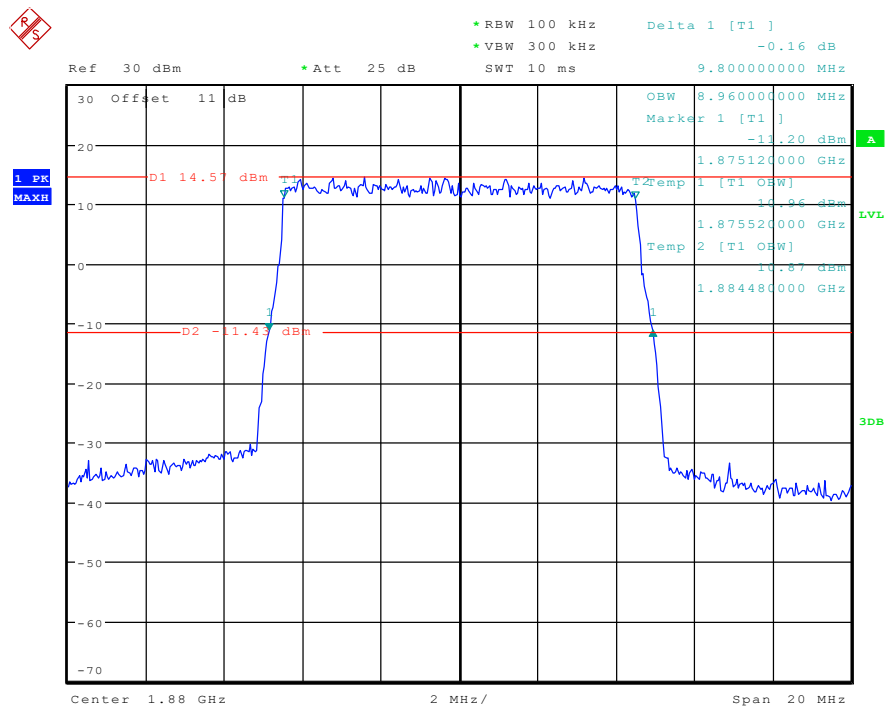


Date: 24.NOV.2022 10:50:29

Band 2_10 MHz_Middle_16QAM_RB50#0

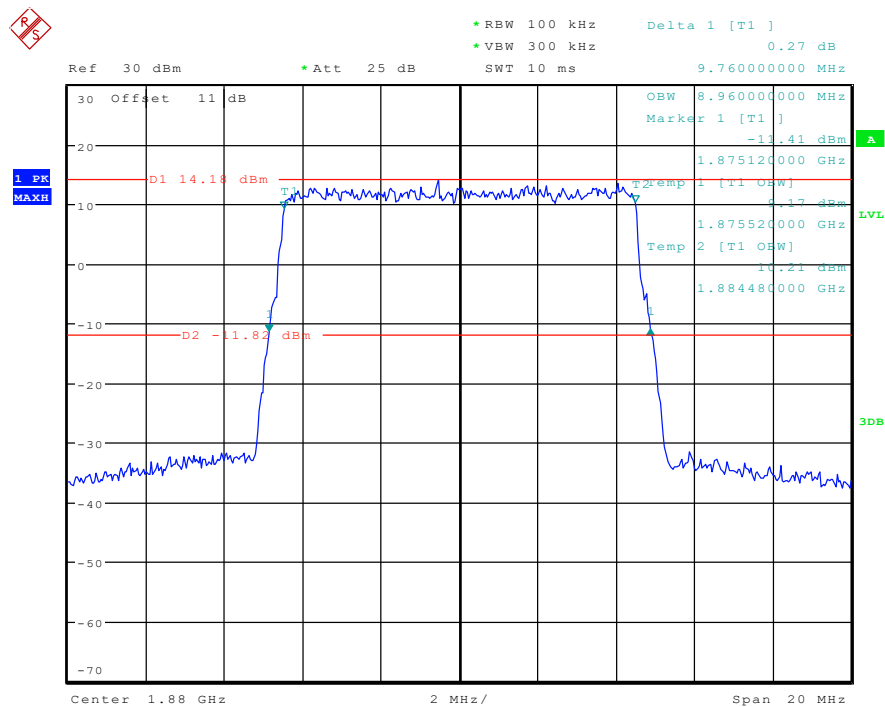


Date: 24.NOV.2022 10:50:48

Band 2_10 MHz_High_QPSK_RB50#0

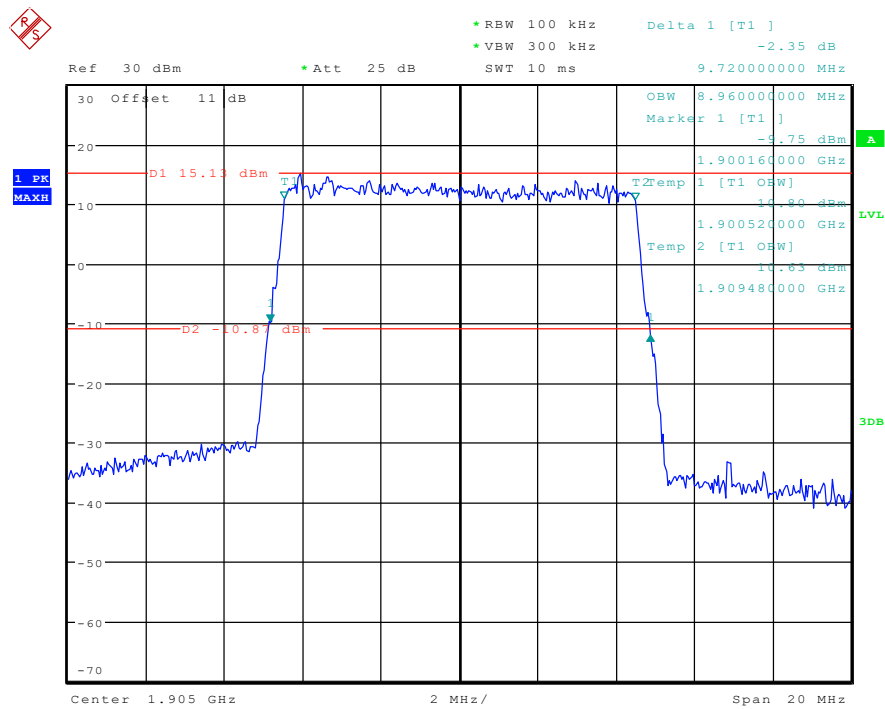


Date: 24.NOV.2022 10:51:08

Band 2_10 MHz_High_16QAM_RB50#0

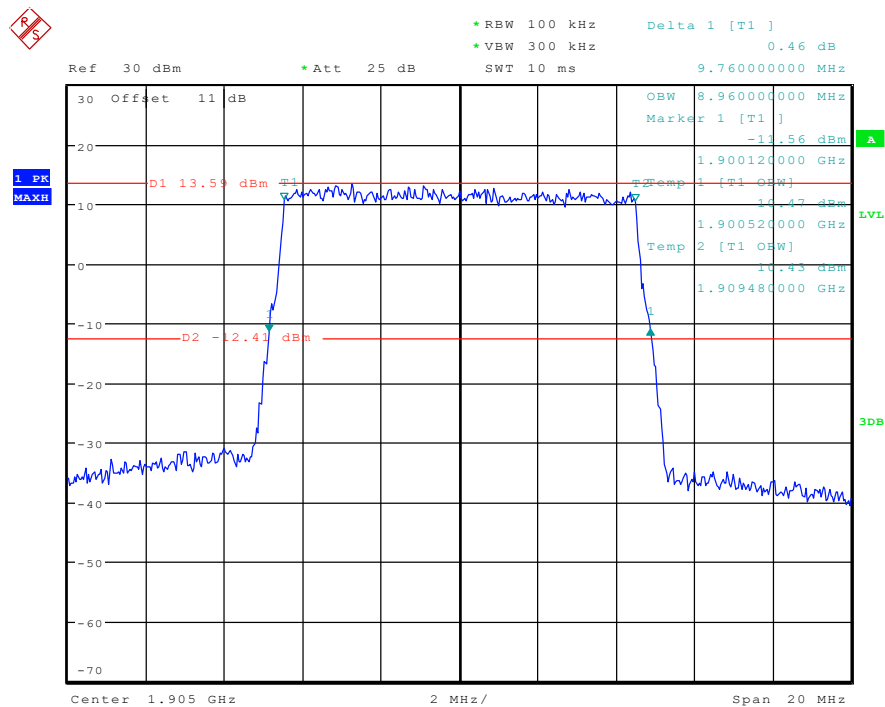


Date: 24.NOV.2022 10:51:27

Band 2_15 MHz_Low_QPSK_RB75#0

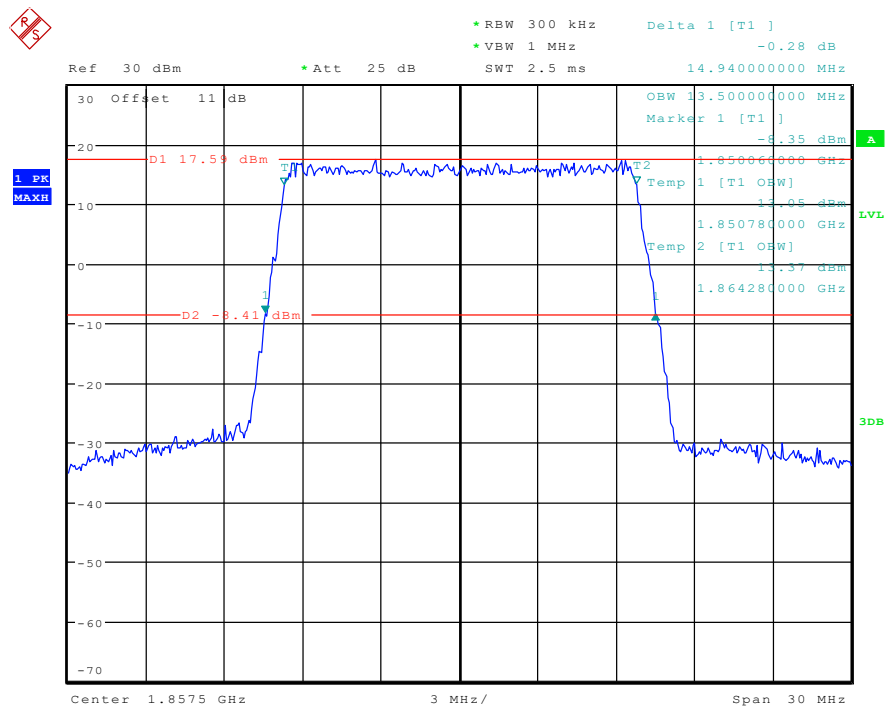


Date: 24.NOV.2022 10:51:48

Band 2_15 MHz_Low_16QAM_RB75#0

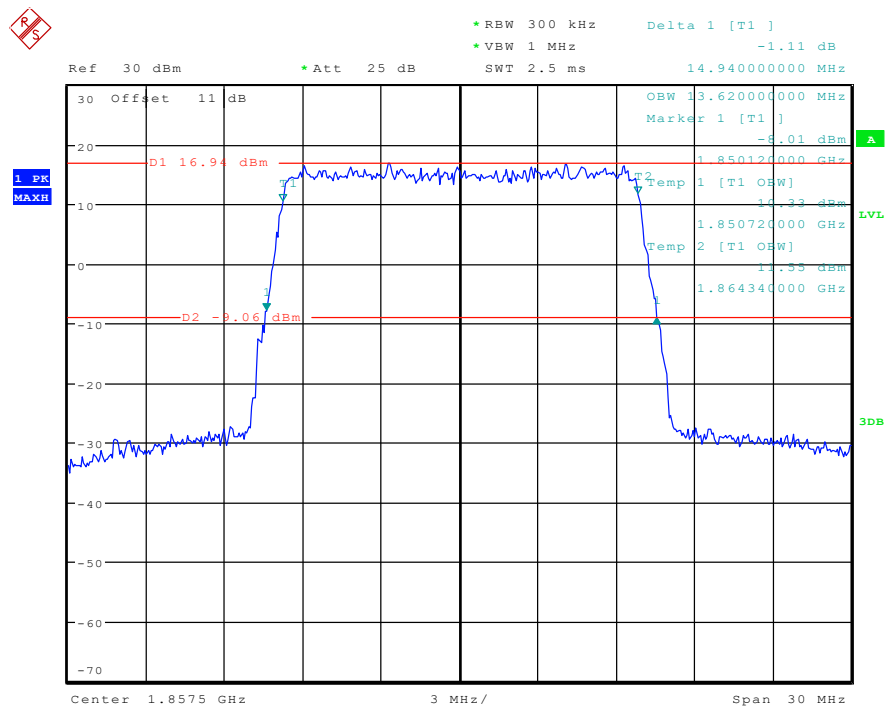


Date: 24.NOV.2022 10:52:10

Band 2_15 MHz_Middle_QPSK_RB75#0

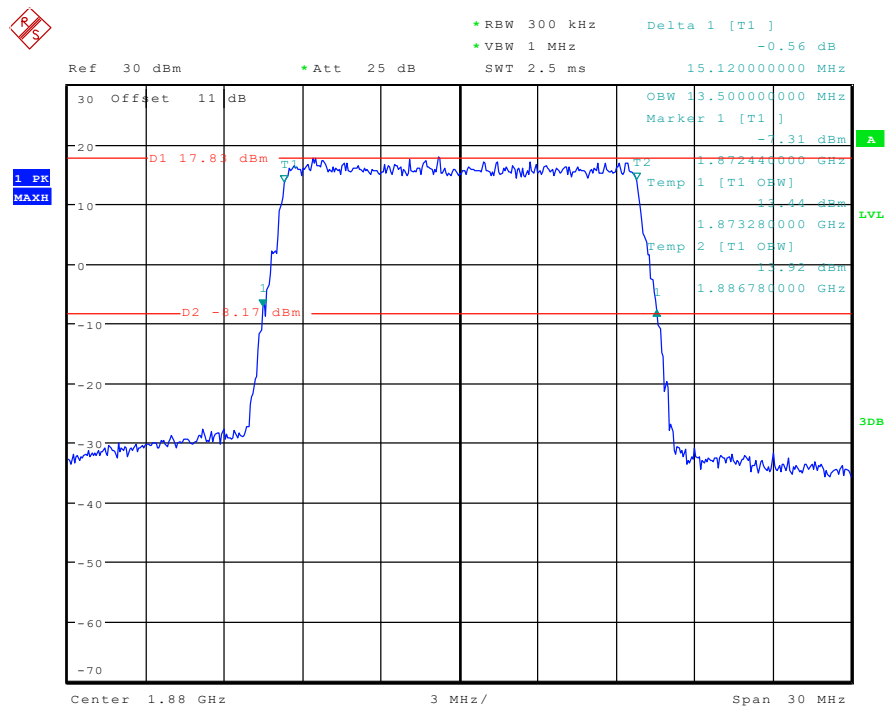


Date: 24.NOV.2022 10:52:30

Band 2_15 MHz_Middle_16QAM_RB75#0

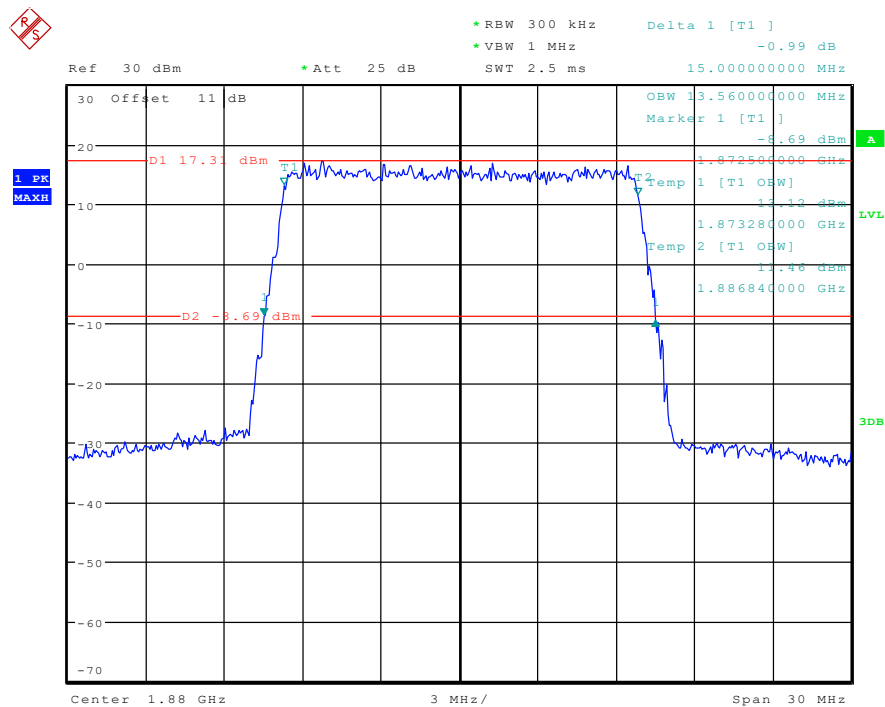


Date: 24.NOV.2022 10:52:48

Band 2_15 MHz_High_QPSK_RB75#0

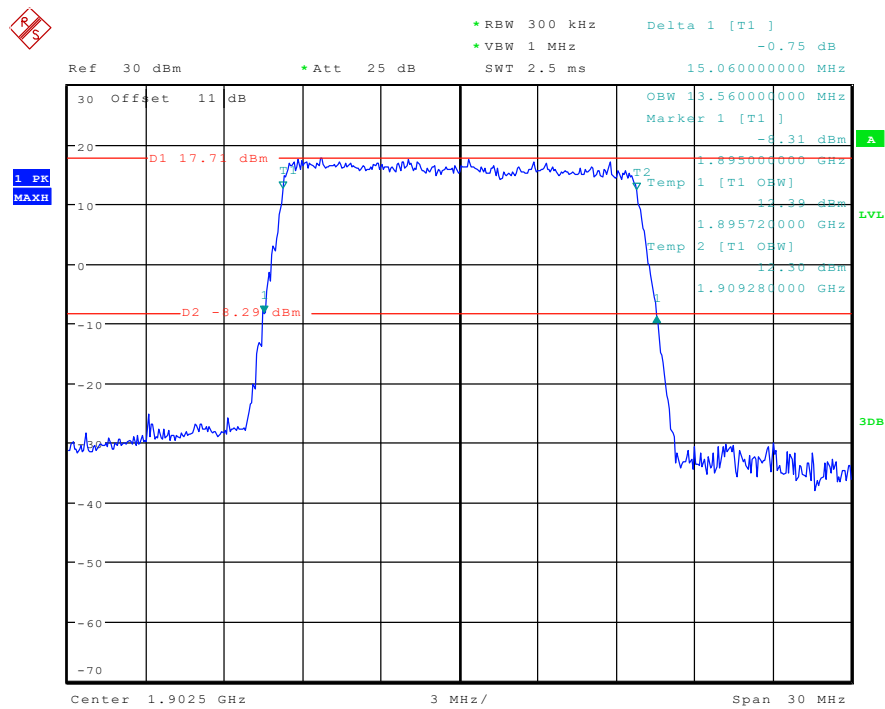


Date: 24.NOV.2022 10:53:11

Band 2_15 MHz_High_16QAM_RB75#0

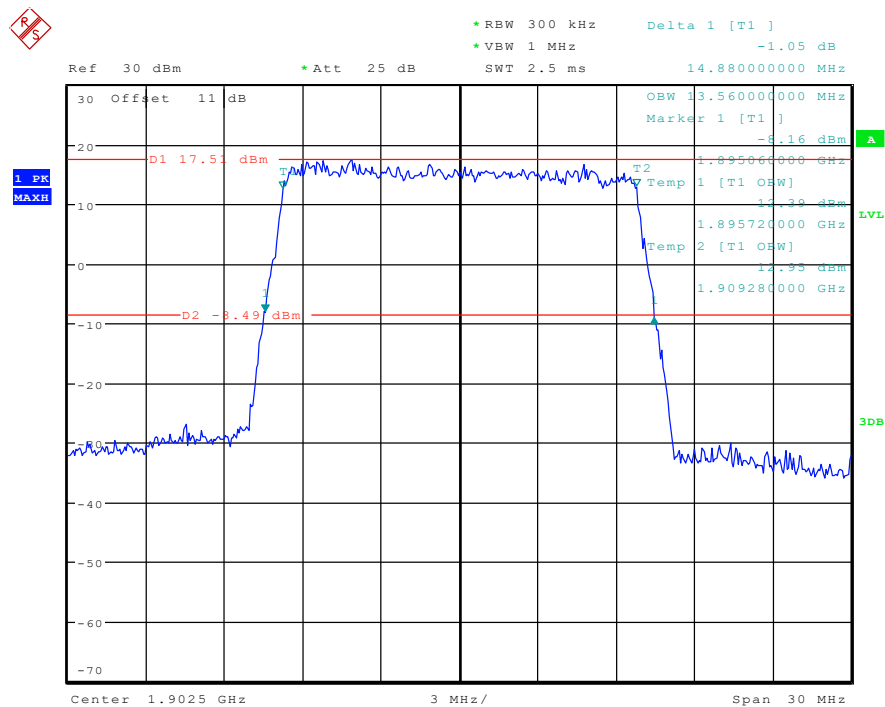


Date: 24.NOV.2022 10:53:33

Band 2_20 MHz_Low_QPSK_RB100#0

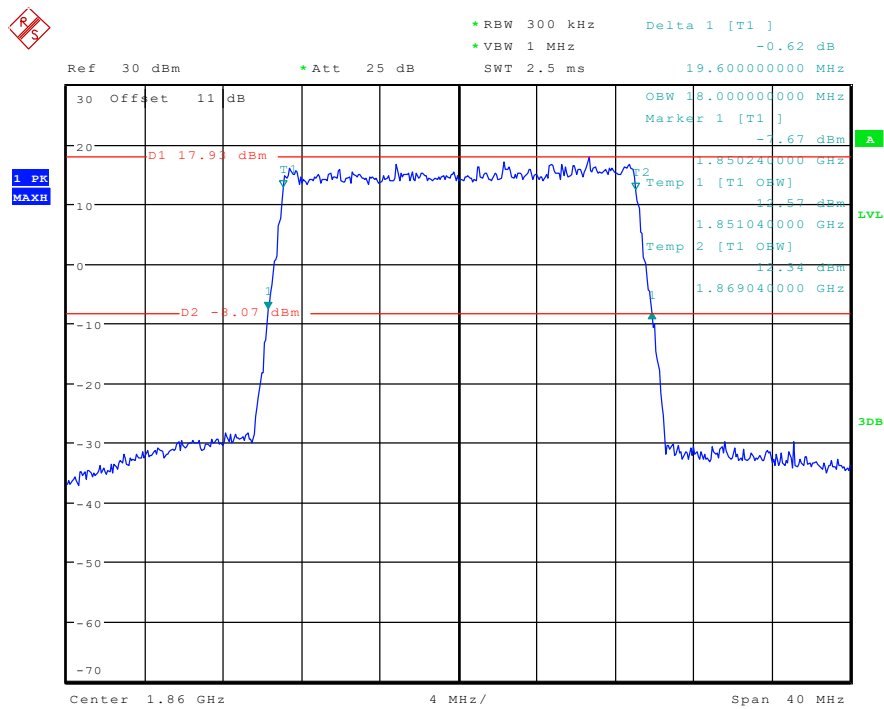


Date: 24.NOV.2022 10:53:58

Band 2_20 MHz_Low_16QAM_RB100#0

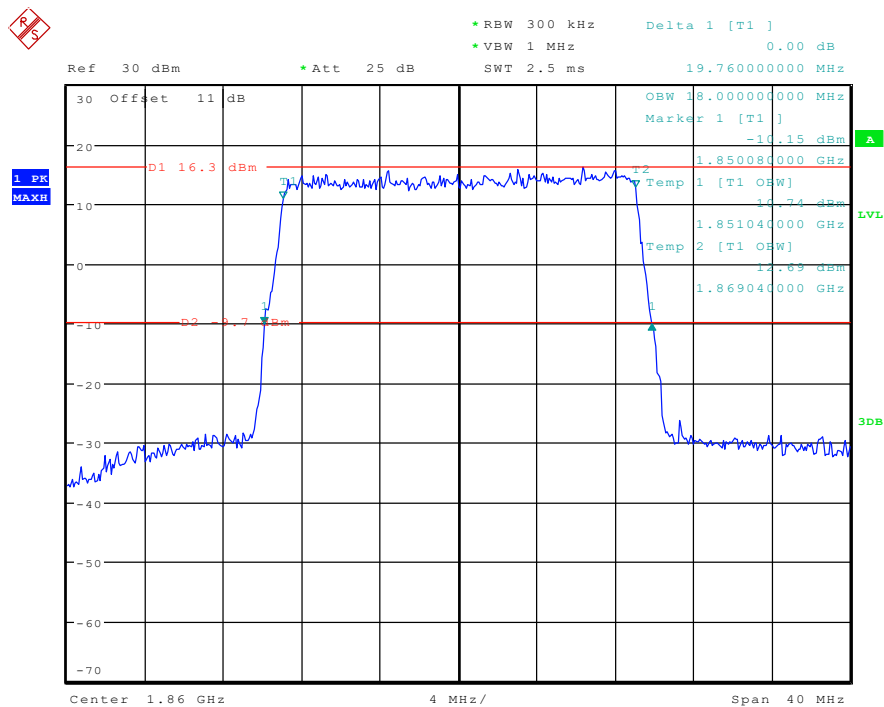


Date: 24.NOV.2022 10:54:20

Band 2_20 MHz_Middle_QPSK_RB100#0

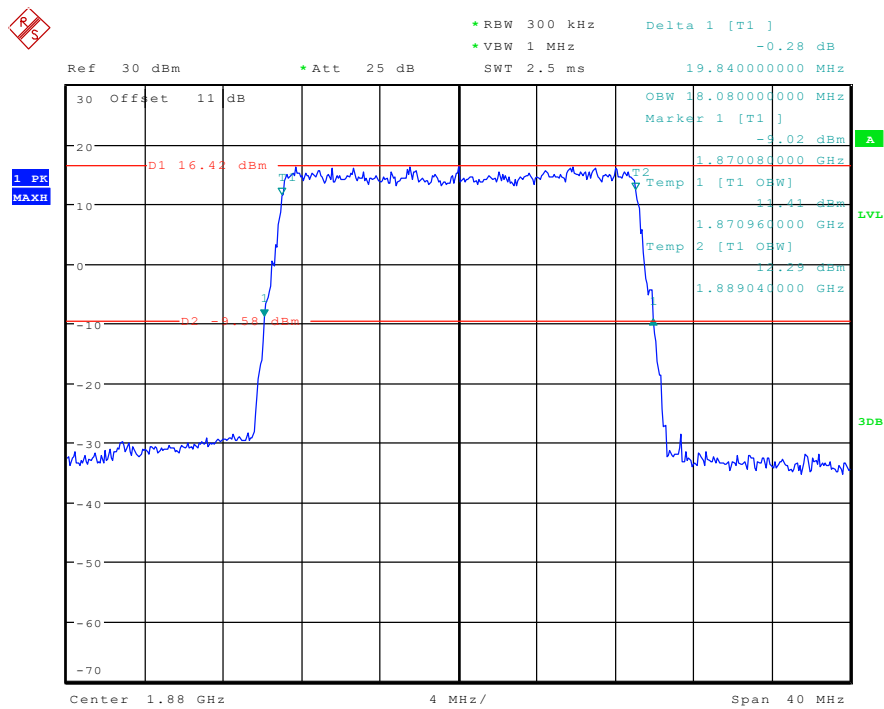


Date: 24.NOV.2022 10:54:44

Band 2_20 MHz_Middle_16QAM_RB100#0

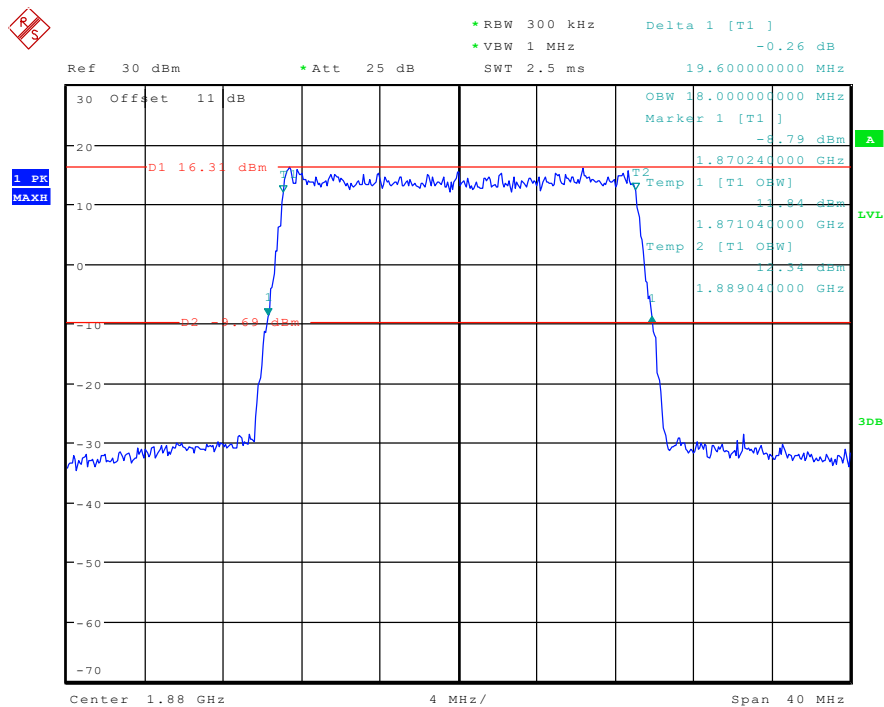


Date: 24.NOV.2022 10:55:06

Band 2_20 MHz_High_QPSK_RB100#0

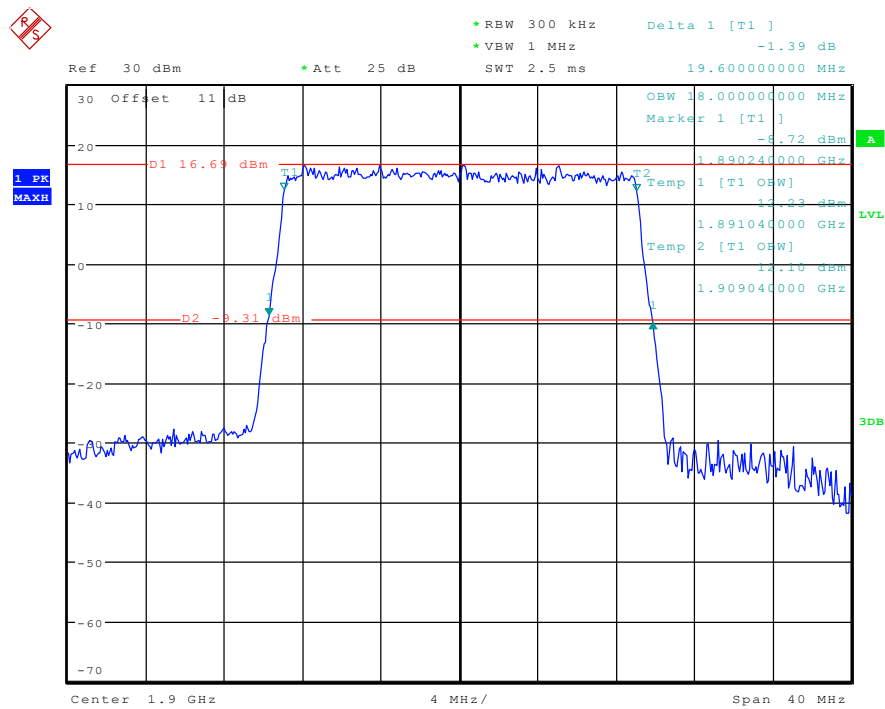


Date: 24.NOV.2022 10:55:29

Band 2_20 MHz_High_16QAM_RB100#0

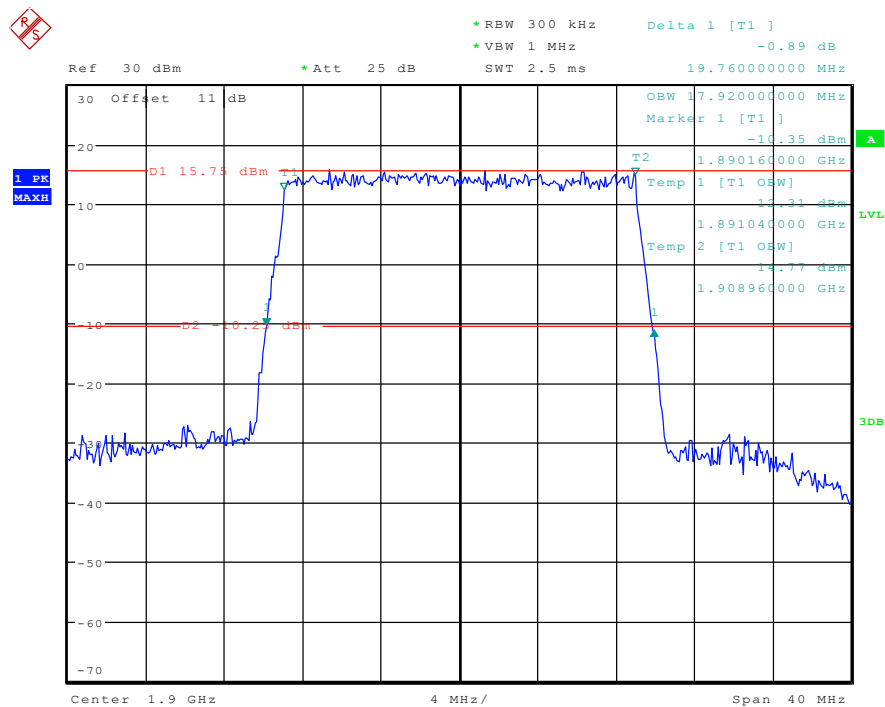


Date: 24.NOV.2022 10:55:52

Band 4_1.4 MHz_Low_QPSK_RB6#0

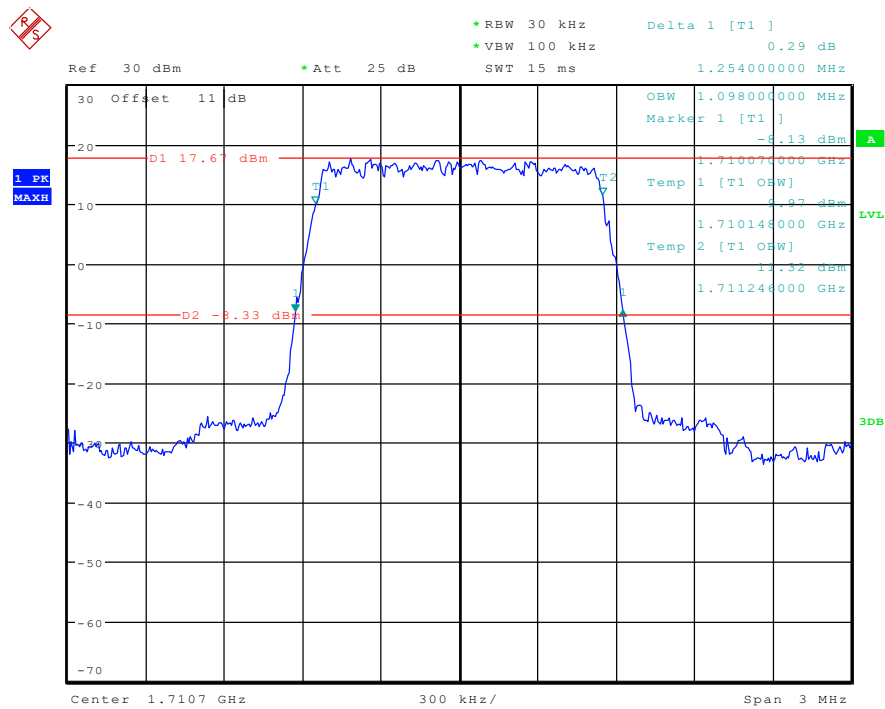


Date: 24.NOV.2022 10:56:44

Band 4_1.4 MHz_Low_16QAM_RB6#0

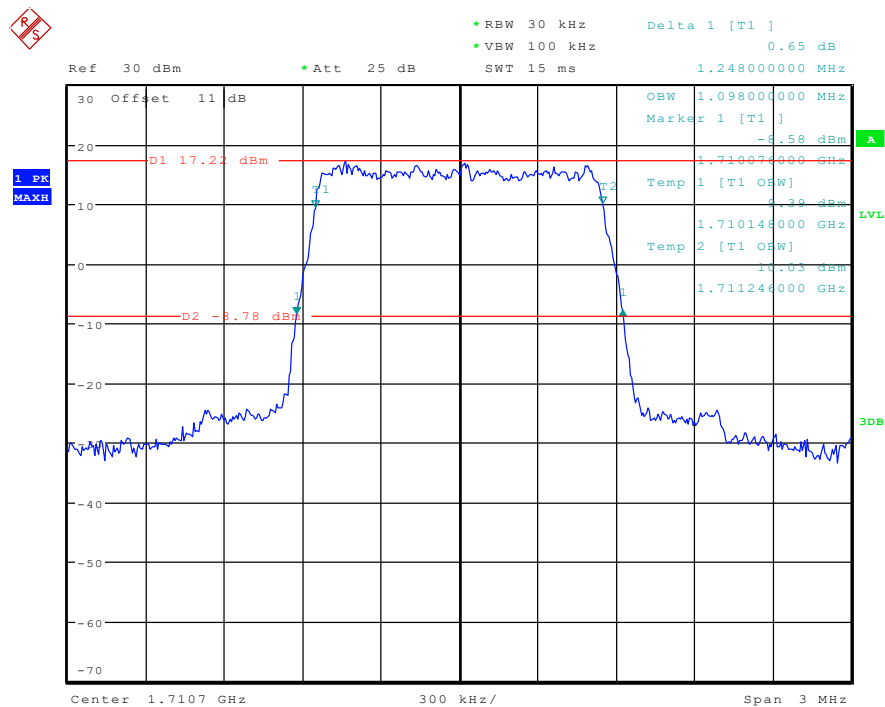


Date: 24.NOV.2022 10:57:02

Band 4_1.4 MHz_Middle_QPSK_RB6#0

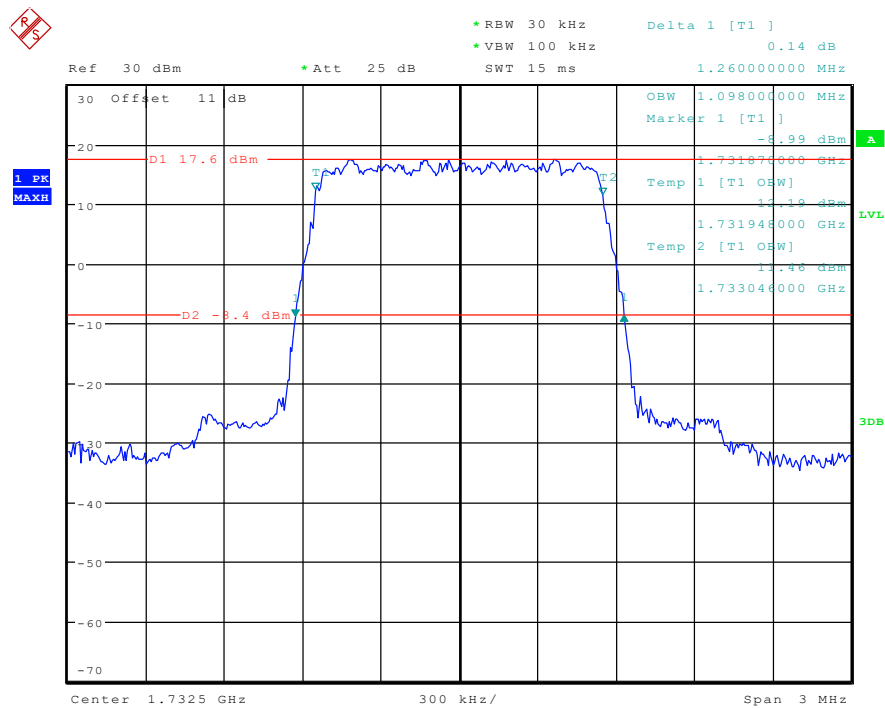


Date: 24.NOV.2022 10:59:37

Band 4_1.4 MHz_Middle_16QAM_RB6#0

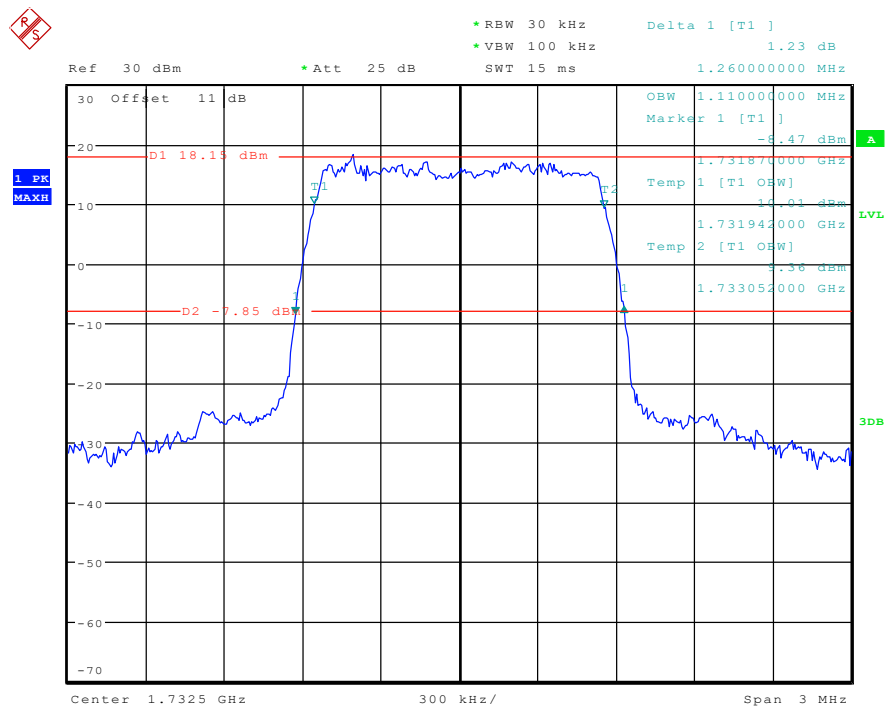


Date: 24.NOV.2022 10:59:59

Band 4_1.4 MHz_High_QPSK_RB6#0

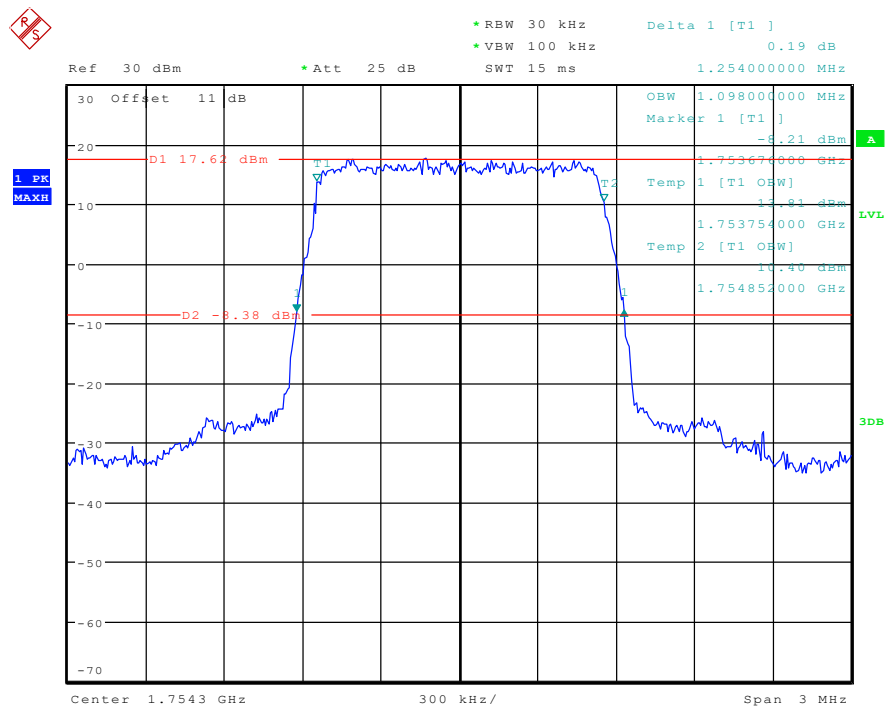


Date: 24.NOV.2022 11:00:58

Band 4_1.4 MHz_High_16QAM_RB6#0

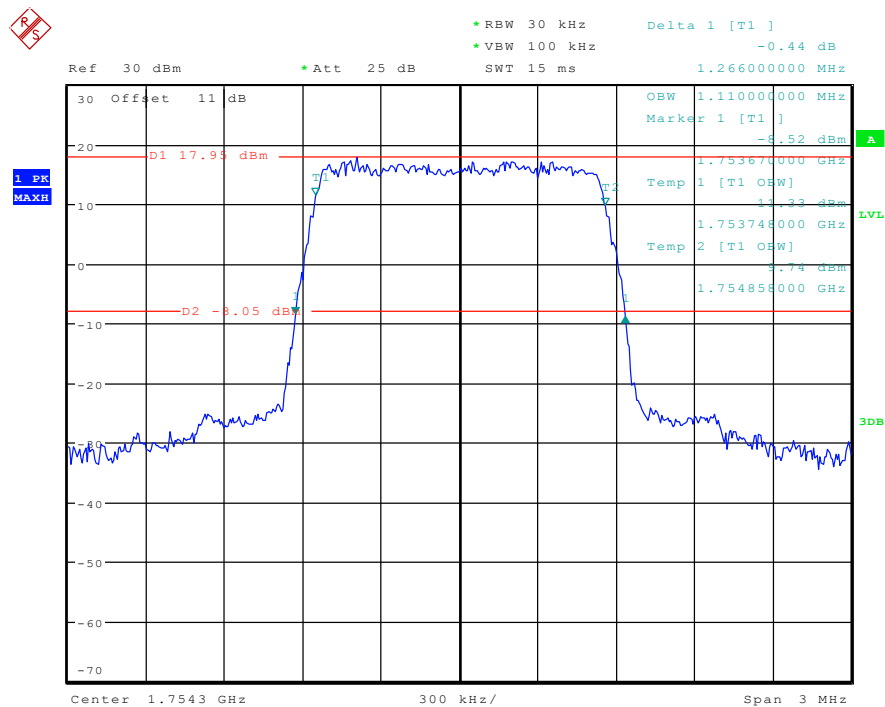


Date: 24.NOV.2022 11:01:16

Band 4_3 MHz_Low_QPSK_RB15#0

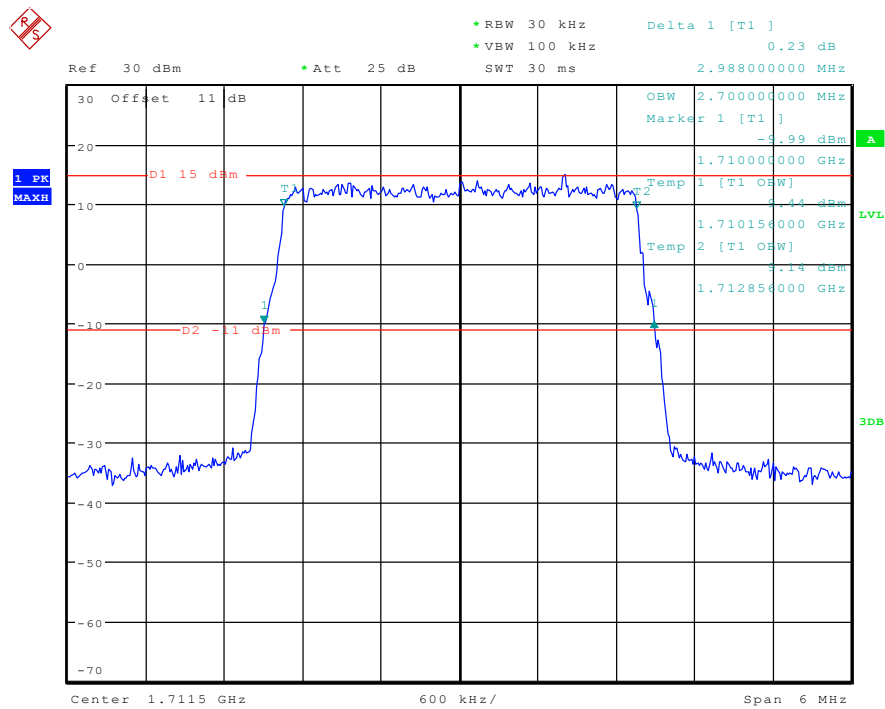


Date: 24.NOV.2022 11:01:33

Band 4_3 MHz_Low_16QAM_RB15#0

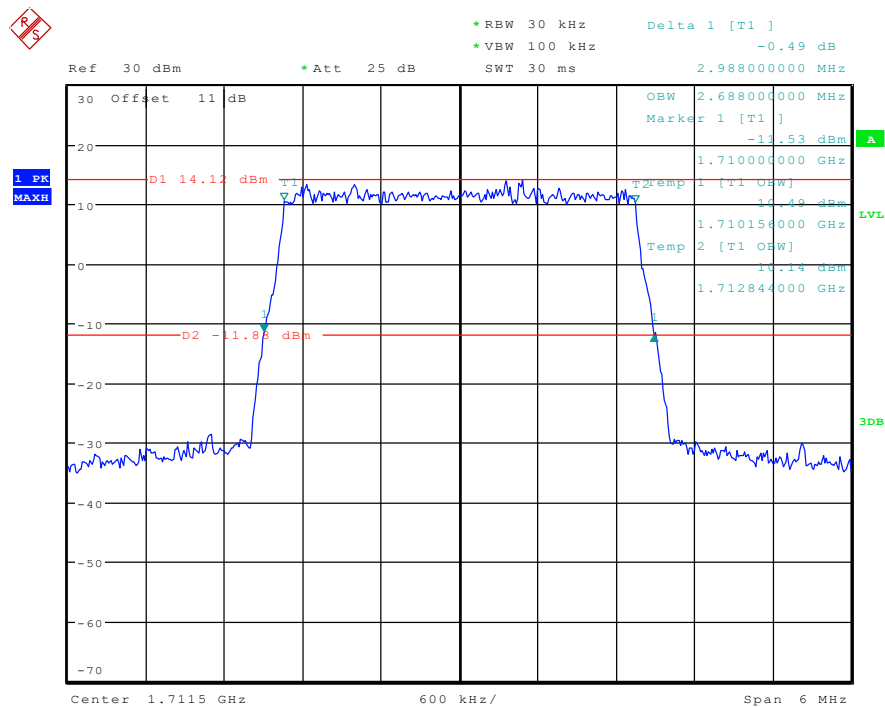


Date: 24.NOV.2022 11:01:51

Band 4_3 MHz_Middle_QPSK_RB15#0

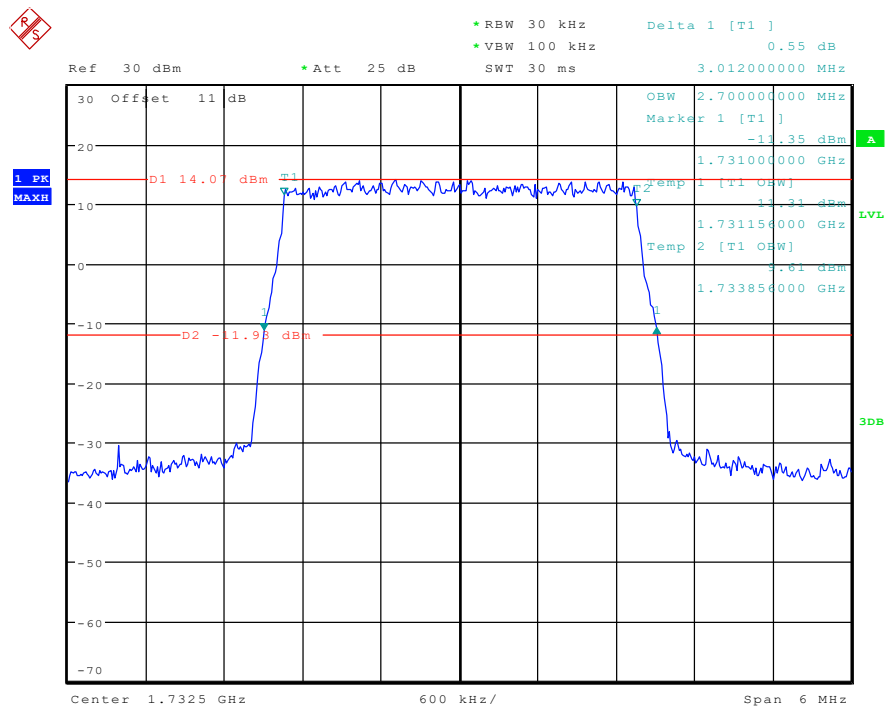


Date: 24.NOV.2022 11:02:07

Band 4_3 MHz_Middle_16QAM_RB15#0

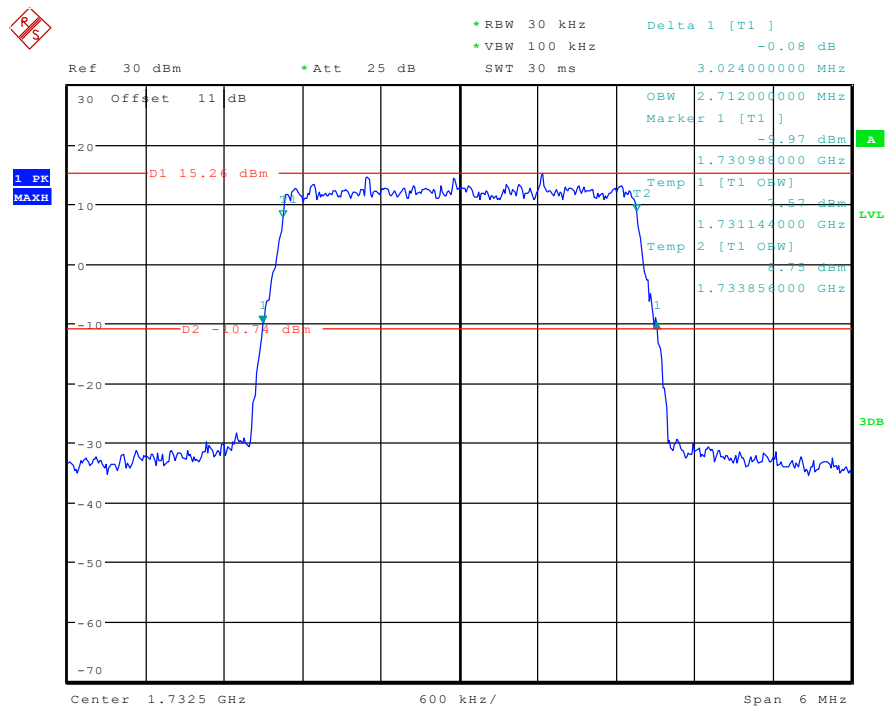


Date: 24.NOV.2022 11:02:26

Band 4_3 MHz_High_QPSK_RB15#0

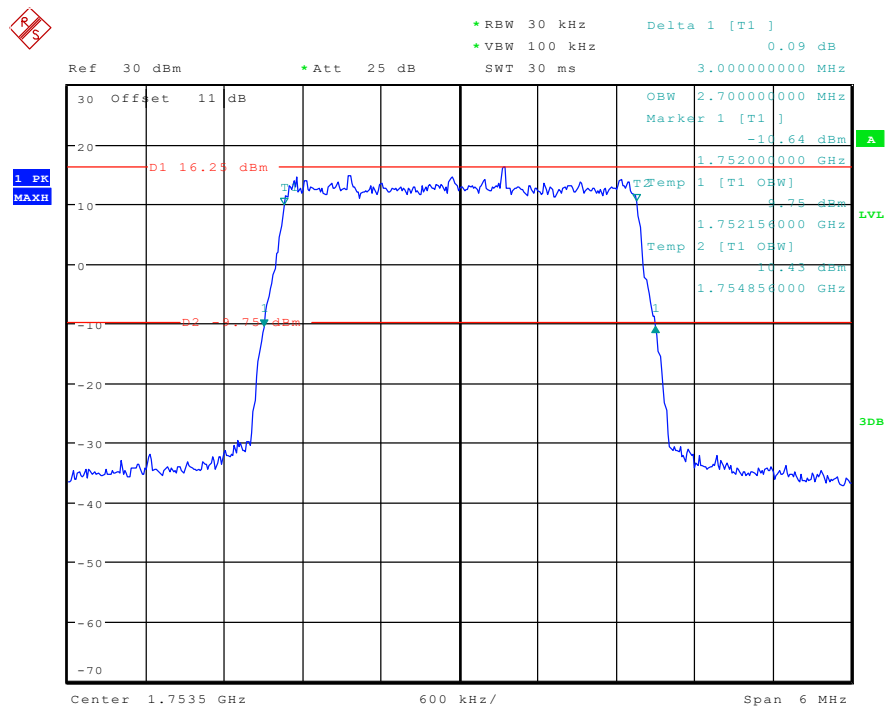


Date: 24.NOV.2022 11:02:43

Band 4_3 MHz_High_16QAM_RB15#0

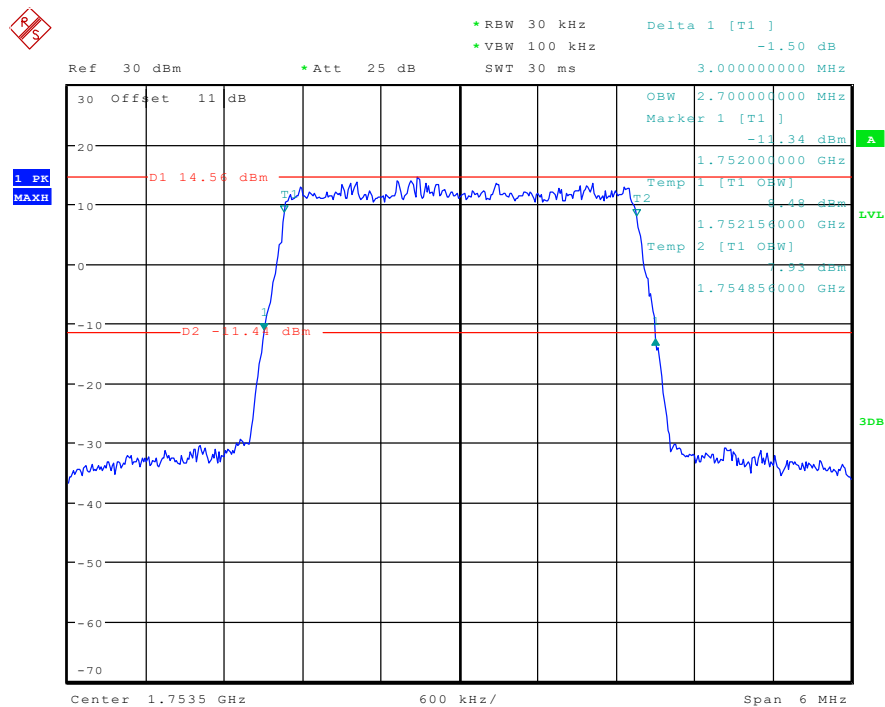


Date: 24.NOV.2022 11:02:58

Band 4_5 MHz_Low_QPSK_RB25#0

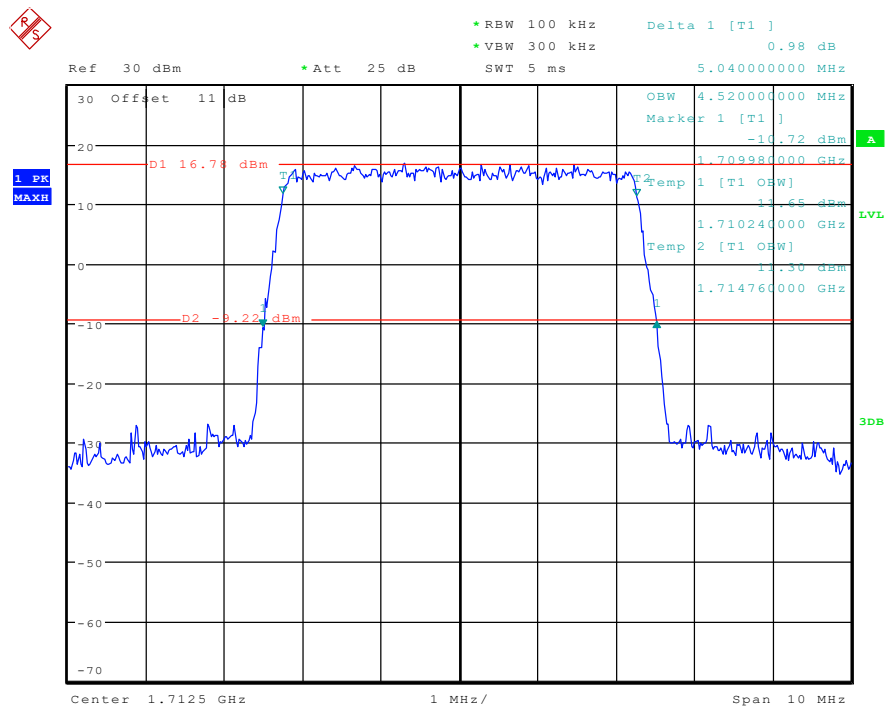


Date: 24.NOV.2022 11:03:22

Band 4_5 MHz_Low_16QAM_RB25#0

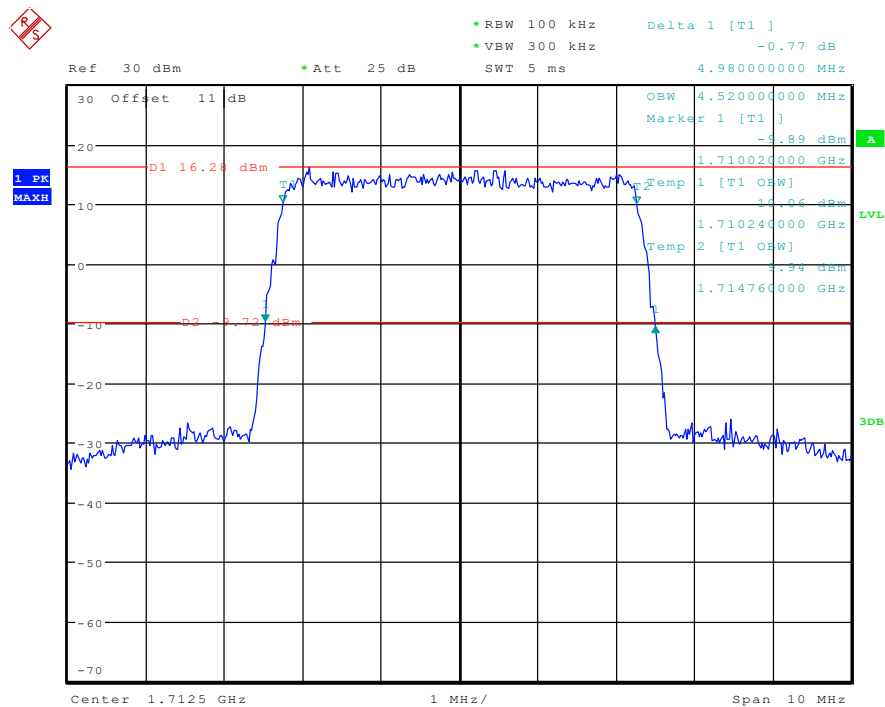


Date: 24.NOV.2022 11:03:39

Band 4_5 MHz_Middle_QPSK_RB25#0

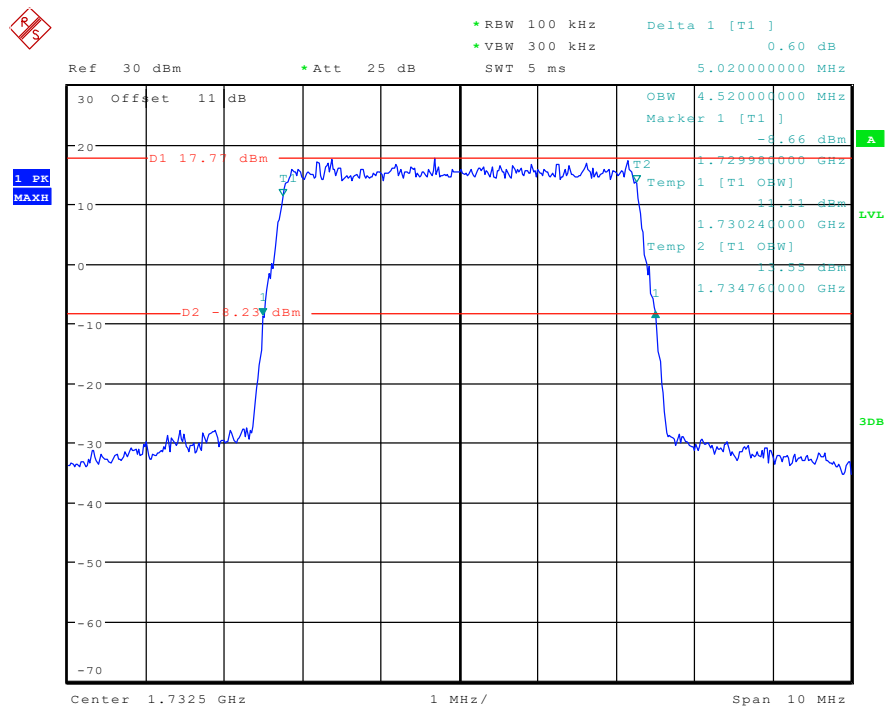


Date: 24.NOV.2022 11:03:55

Band 4_5 MHz_Middle_16QAM_RB25#0

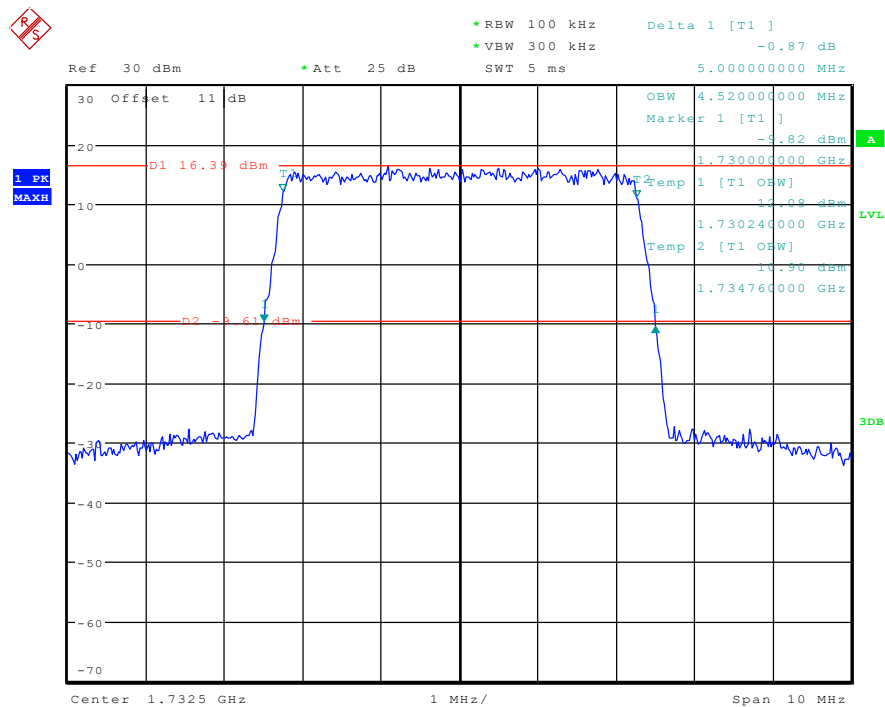


Date: 24.NOV.2022 11:04:11

Band 4_5 MHz_High_QPSK_RB25#0

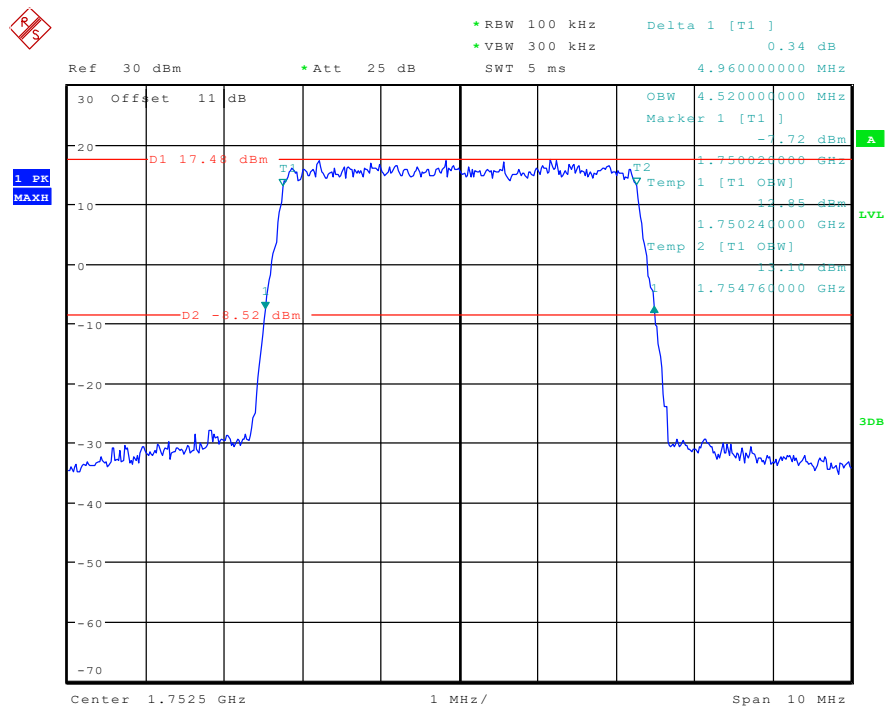


Date: 24.NOV.2022 11:04:30

Band 4_5 MHz_High_16QAM_RB25#0

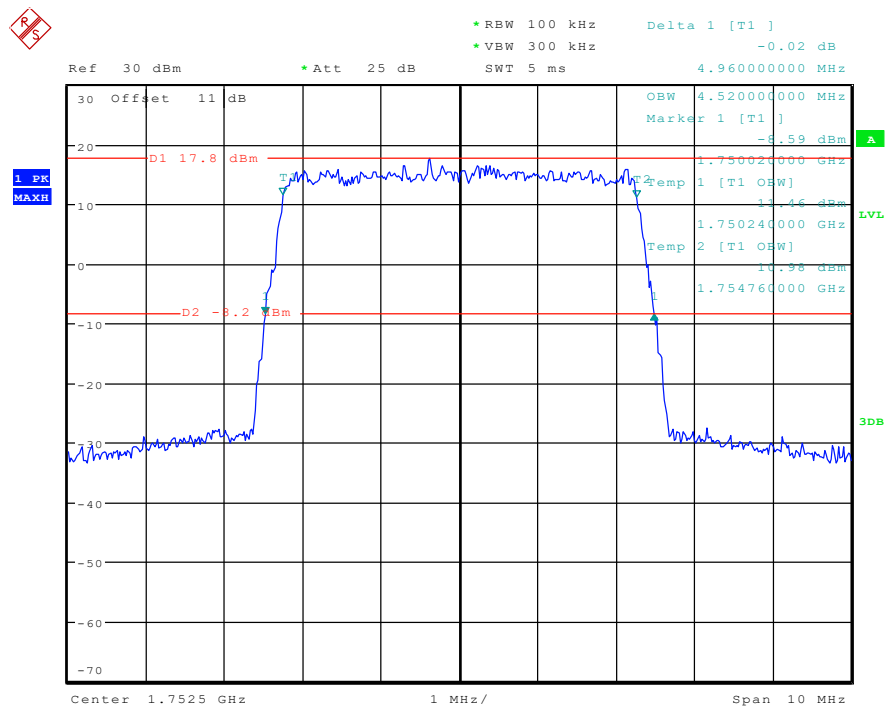


Date: 24.NOV.2022 11:04:49

Band 4_10 MHz_Low_QPSK_RB50#0

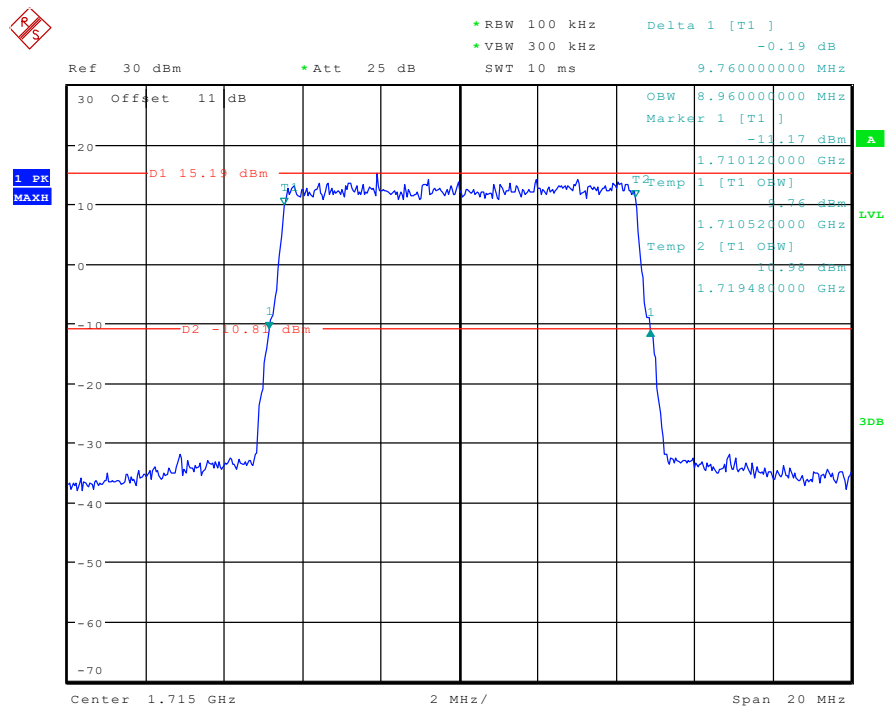


Date: 24.NOV.2022 11:05:10

Band 4_10 MHz_Low_16QAM_RB50#0

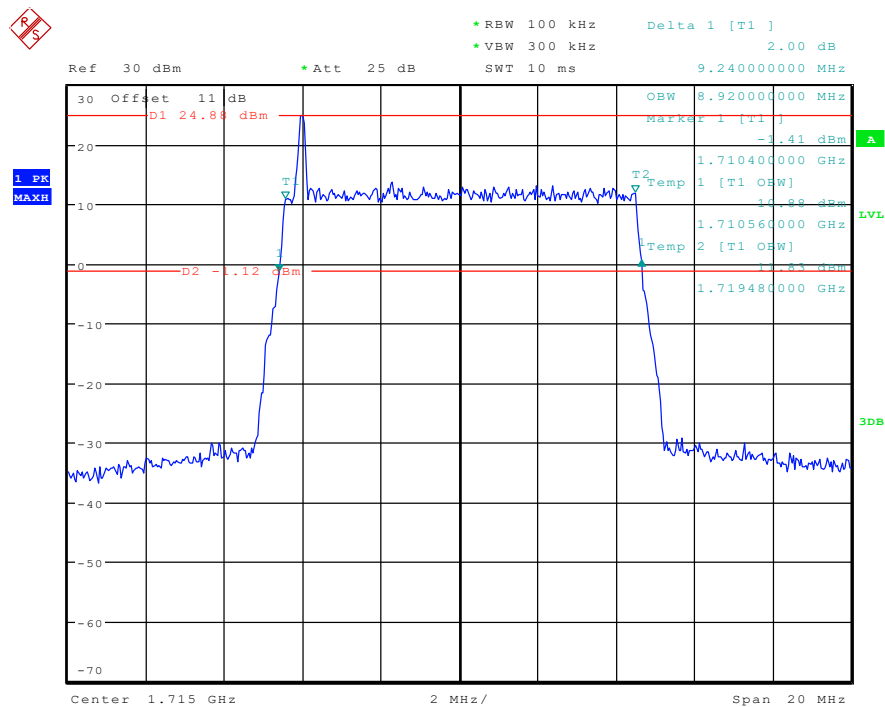


Date: 24.NOV.2022 11:05:29

Band 4_10 MHz_Middle_QPSK_RB50#0

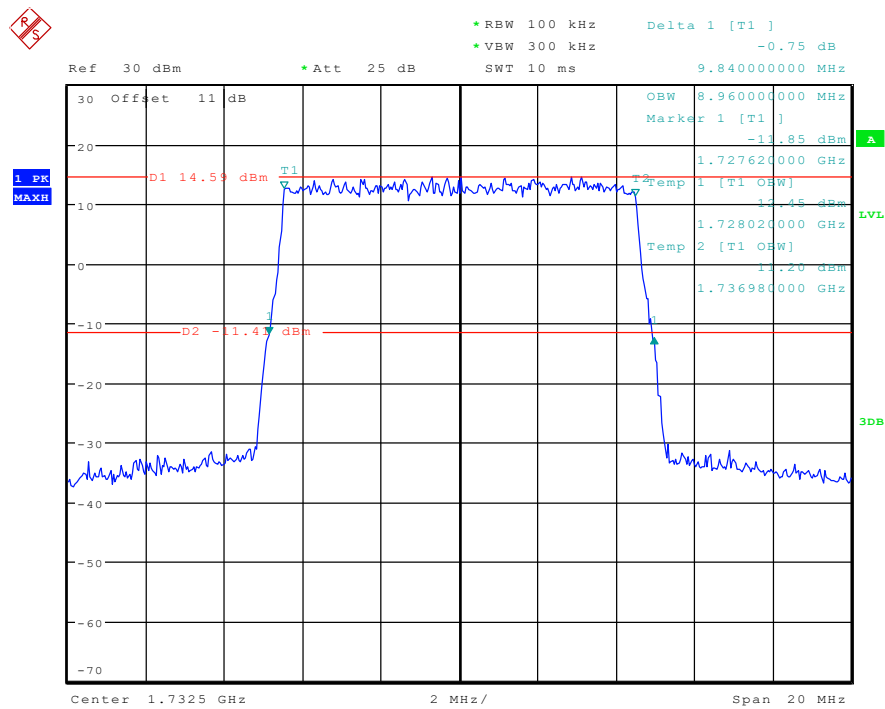


Date: 24.NOV.2022 11:05:49

Band 4_10 MHz_Middle_16QAM_RB50#0

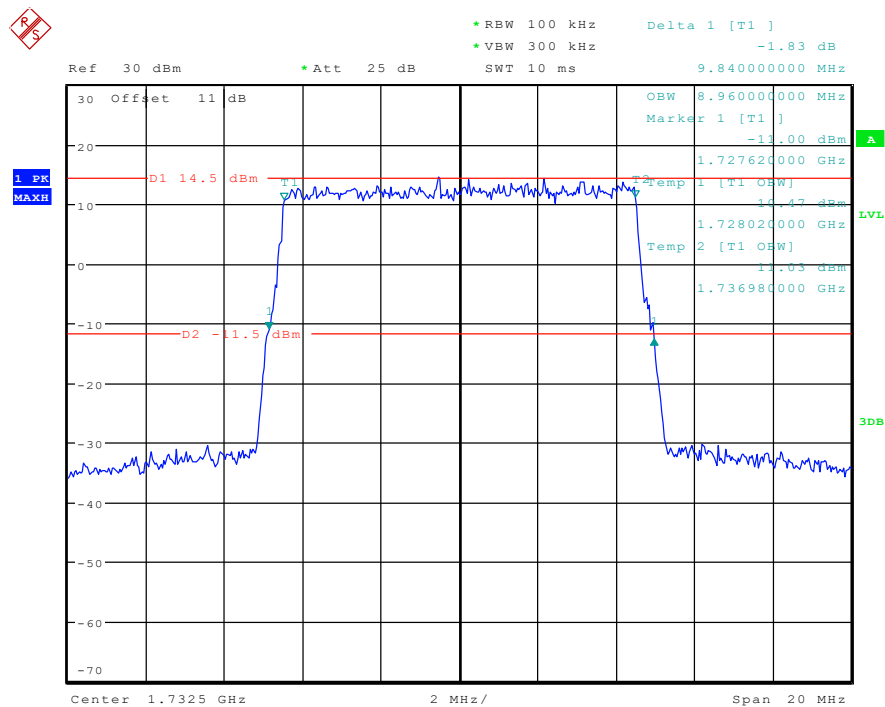


Date: 24.NOV.2022 11:06:05

Band 4_10 MHz_High_QPSK_RB50#0

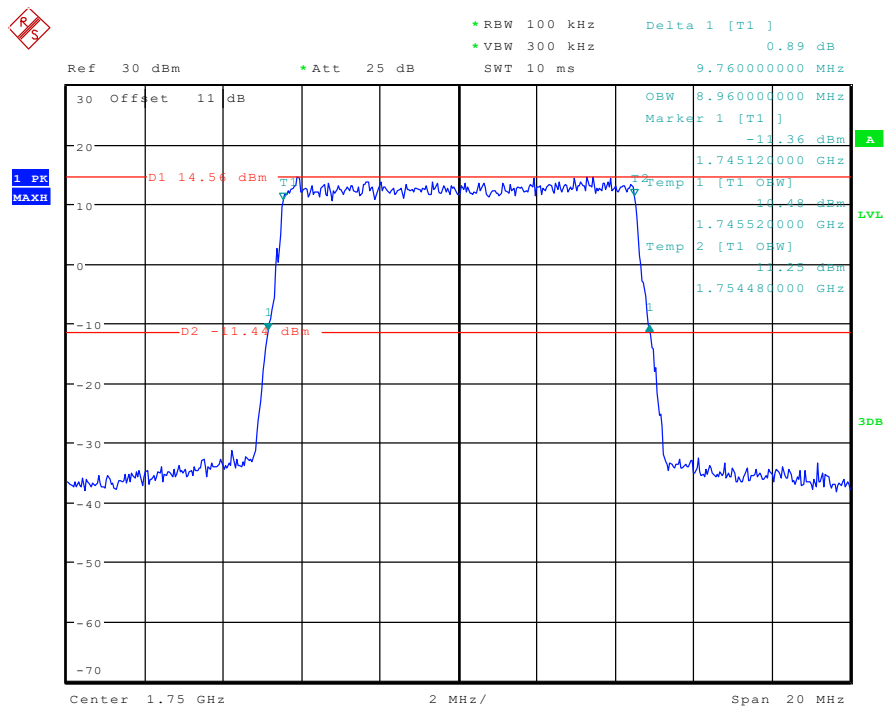


Date: 24.NOV.2022 11:06:25

Band 4_10 MHz_High_16QAM_RB50#0

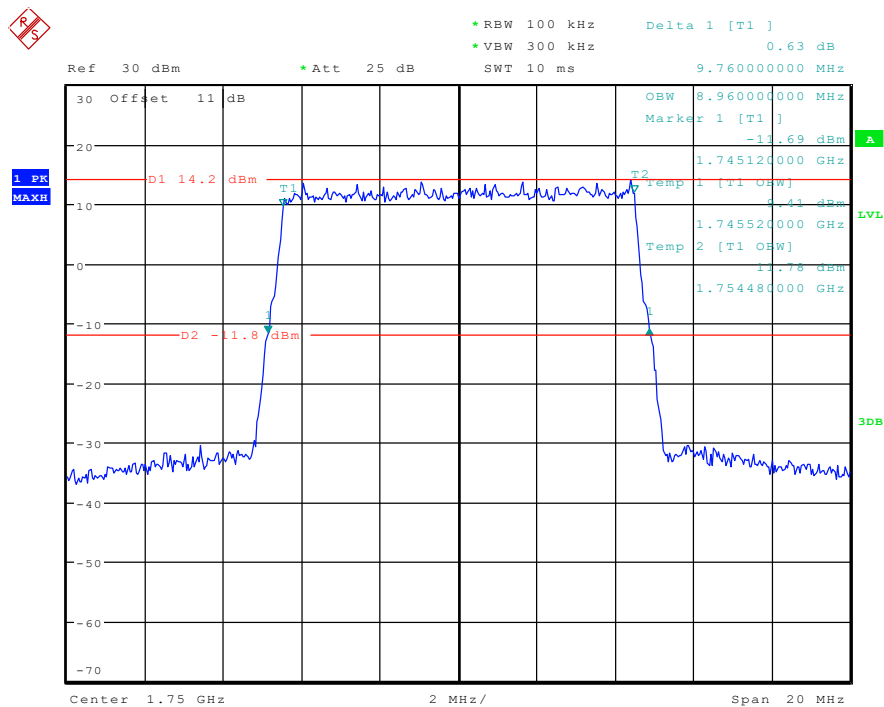


Date: 24.NOV.2022 11:06:45

Band 4_15 MHz_Low_QPSK_RB75#0

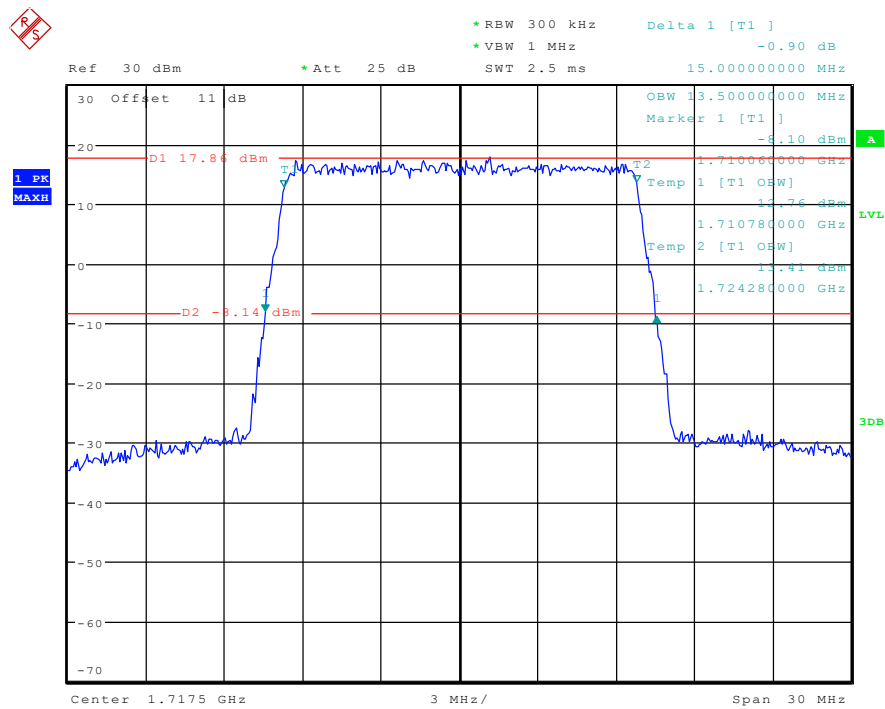


Date: 24.NOV.2022 11:07:08

Band 4_15 MHz_Low_16QAM_RB75#0

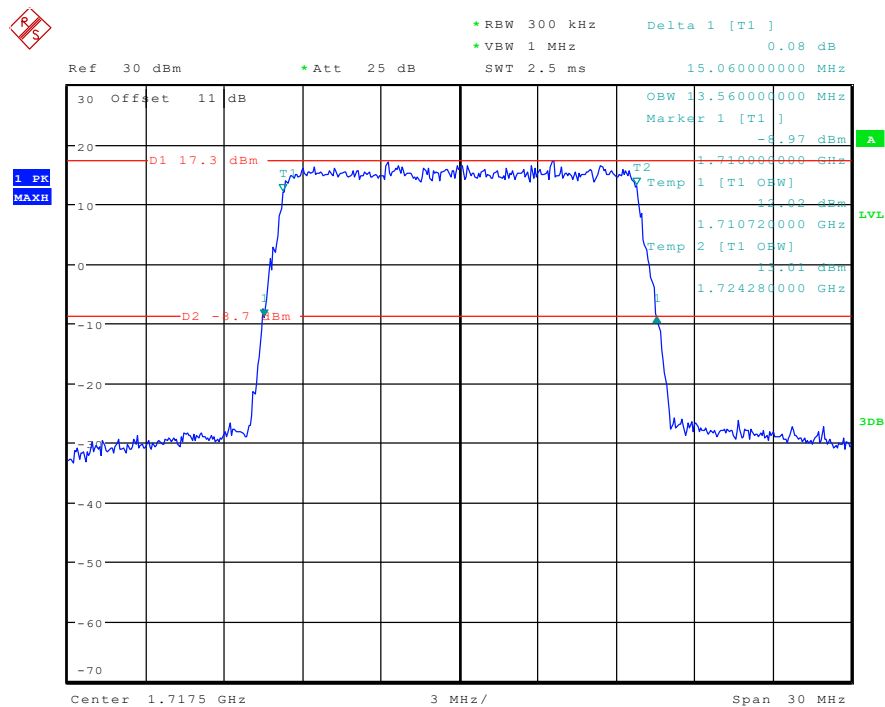


Date: 24.NOV.2022 11:07:30

Band 4_15 MHz_Middle_QPSK_RB75#0

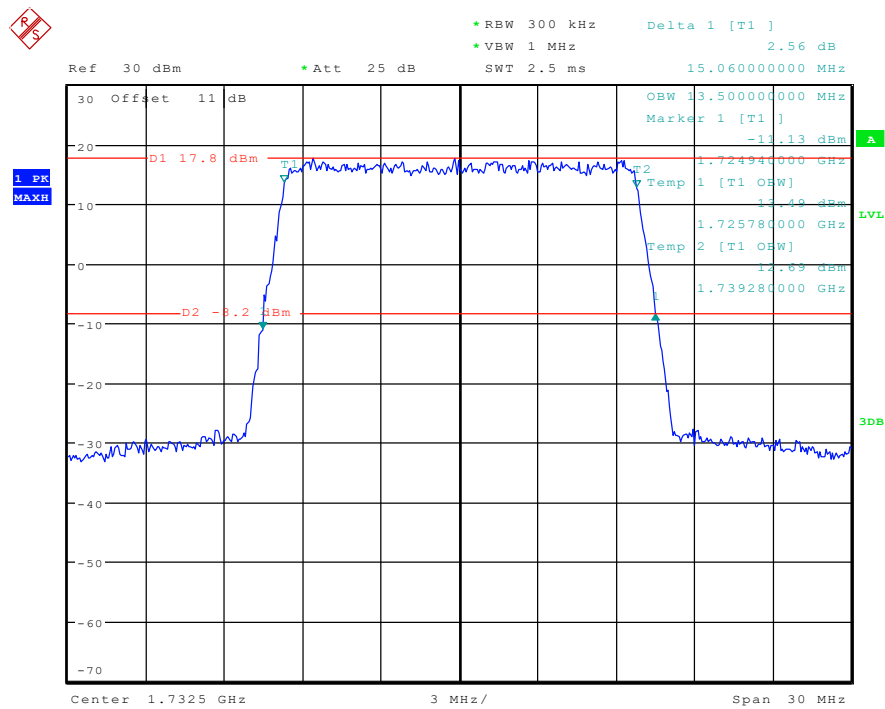


Date: 24.NOV.2022 11:07:53

Band 4_15 MHz_Middle_16QAM_RB75#0

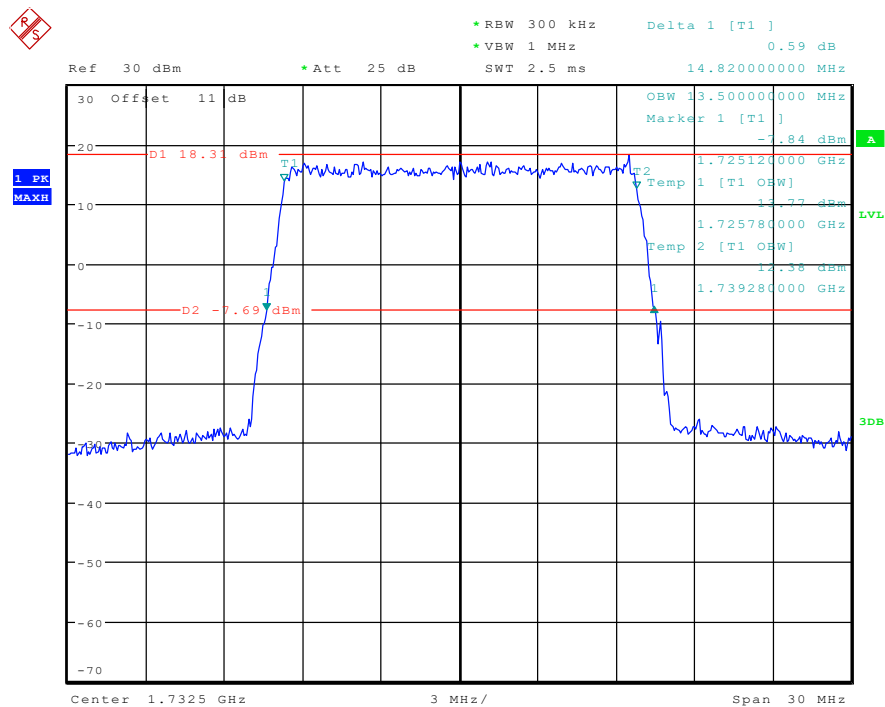


Date: 24.NOV.2022 11:08:15

Band 4_15 MHz_High_QPSK_RB75#0

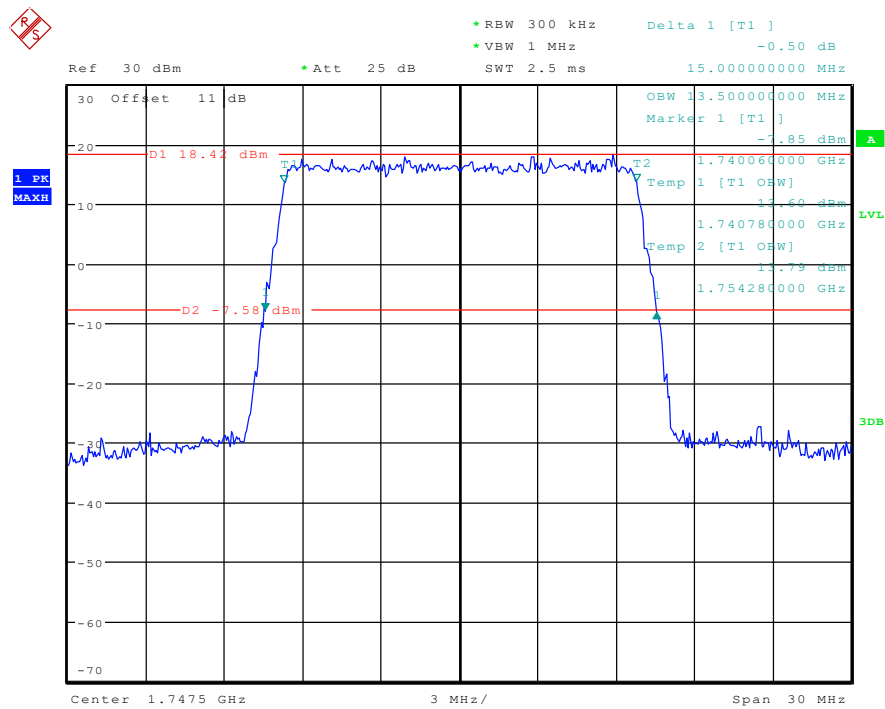


Date: 24.NOV.2022 11:08:37

Band 4_15 MHz_High_16QAM_RB75#0

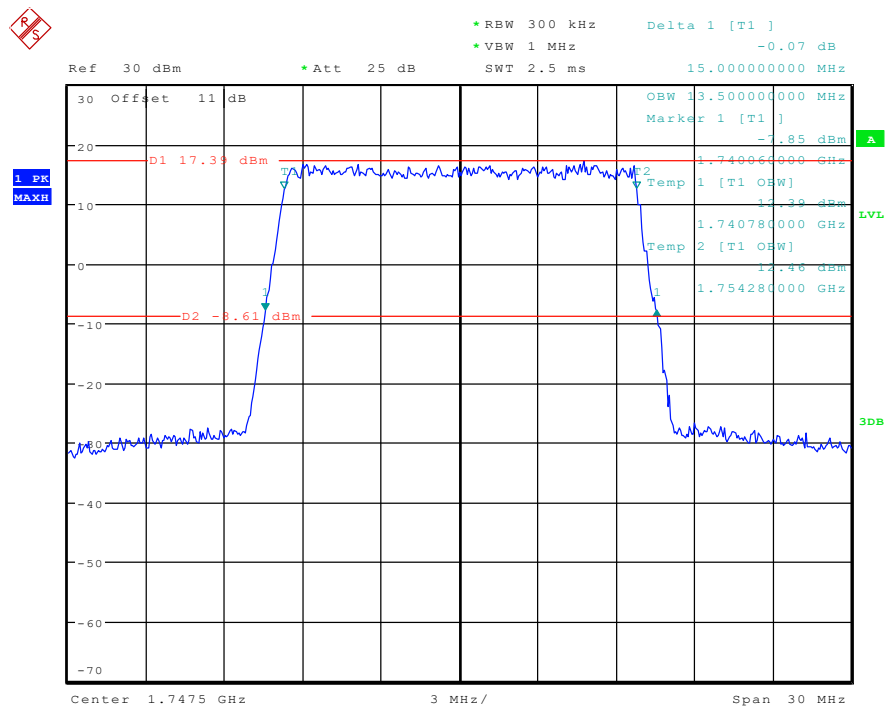


Date: 24.NOV.2022 11:08:59

Band 4_20 MHz_Low_QPSK_RB100#0

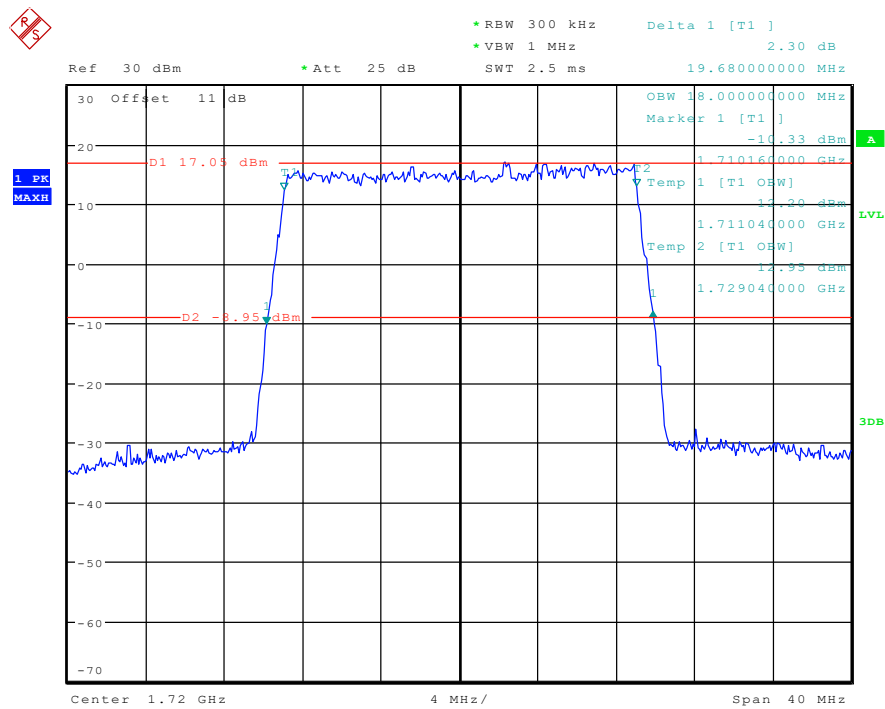


Date: 24.NOV.2022 11:09:24

Band 4_20 MHz_Low_16QAM_RB100#0

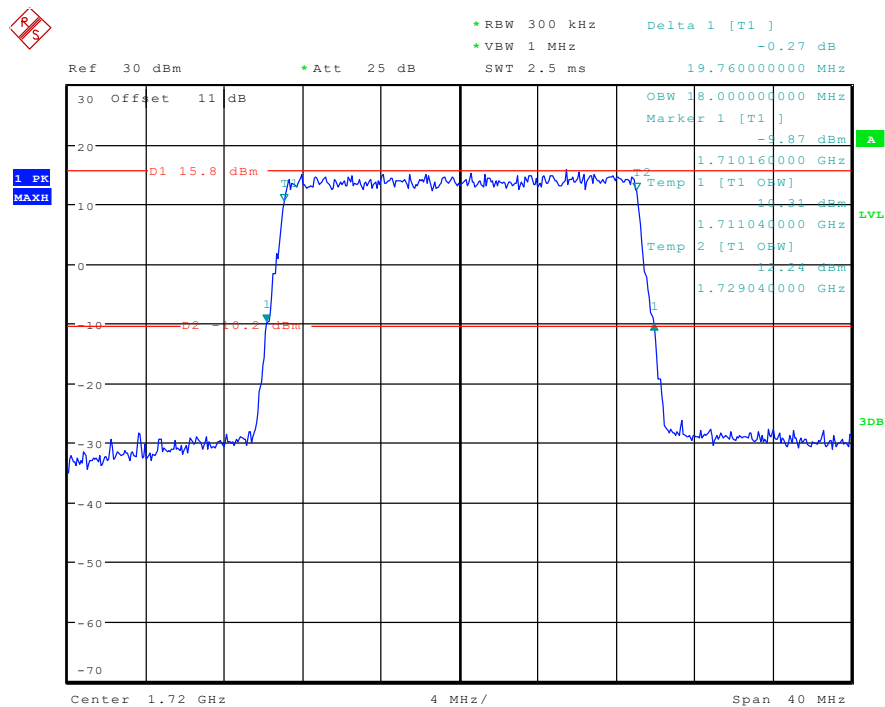


Date: 24.NOV.2022 11:09:46

Band 4_20 MHz_Middle_QPSK_RB100#0

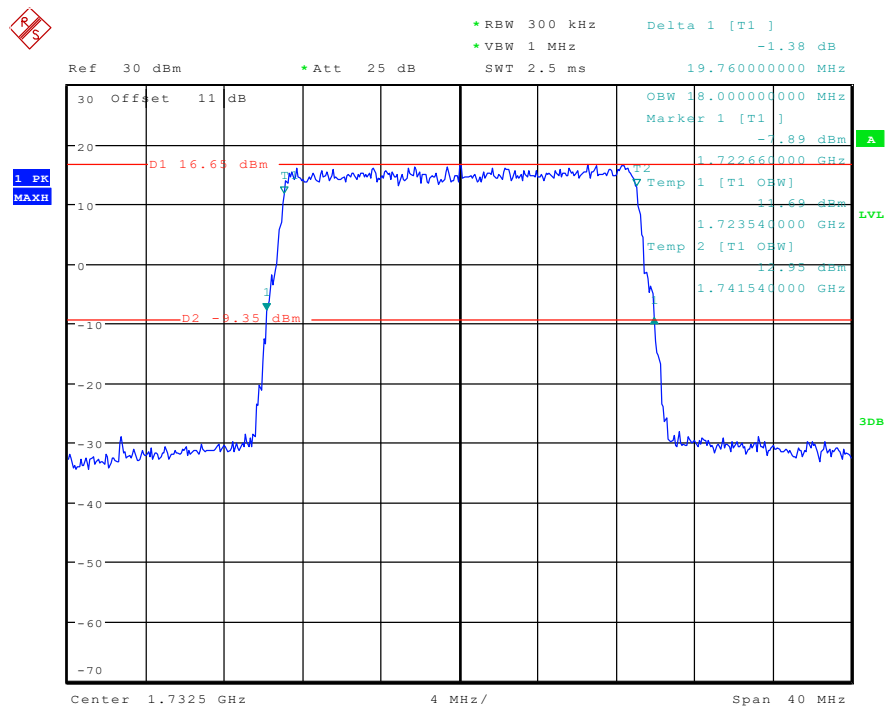


Date: 24.NOV.2022 11:10:09

Band 4_20 MHz_Middle_16QAM_RB100#0

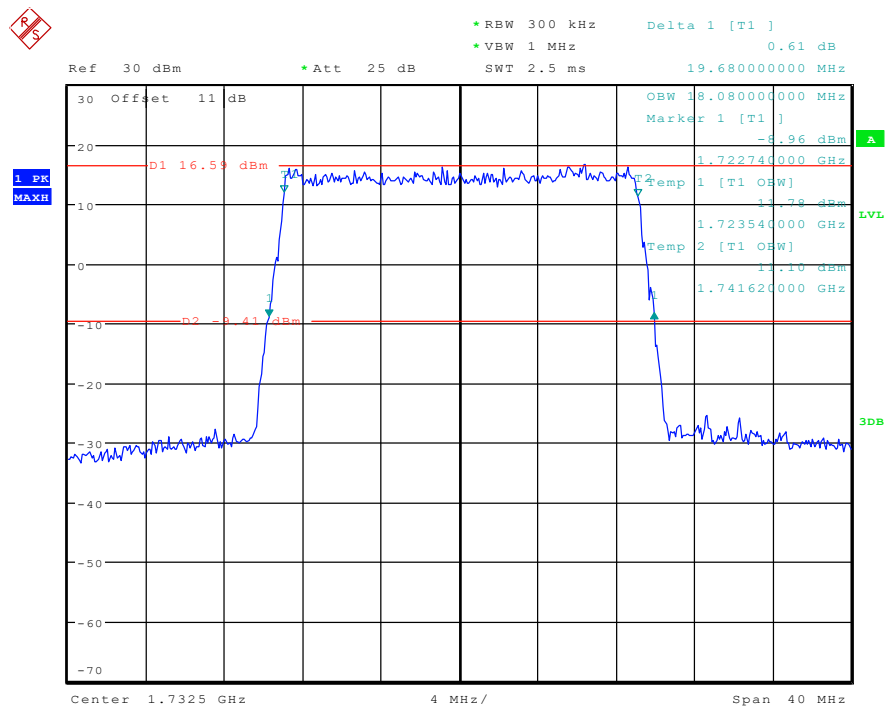


Date: 24.NOV.2022 11:10:31

Band 4_20 MHz_High_QPSK_RB100#0

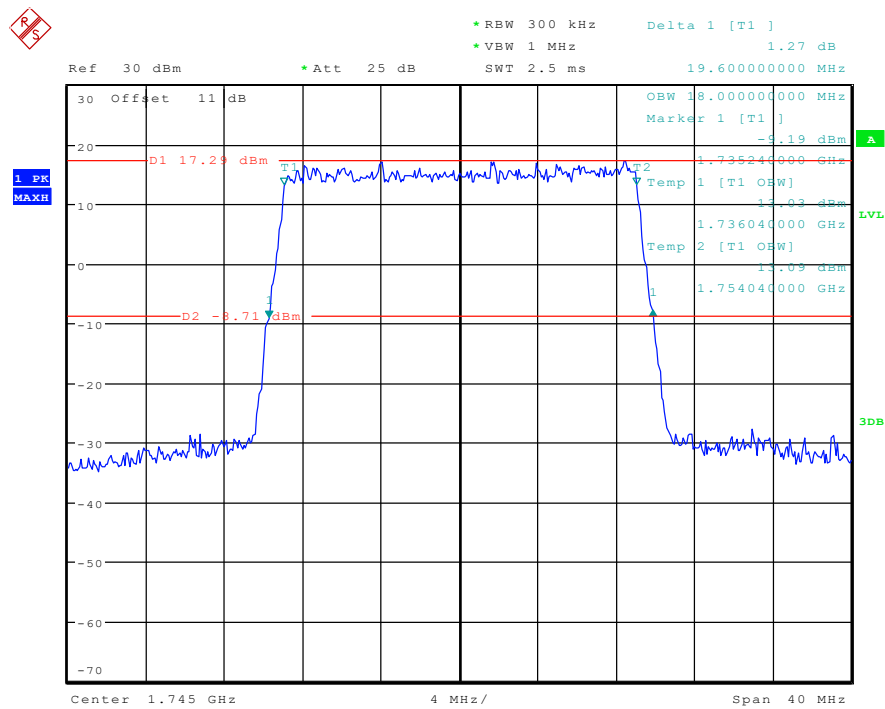


Date: 24.NOV.2022 11:10:54

Band 4_20 MHz_High_16QAM_RB100#0

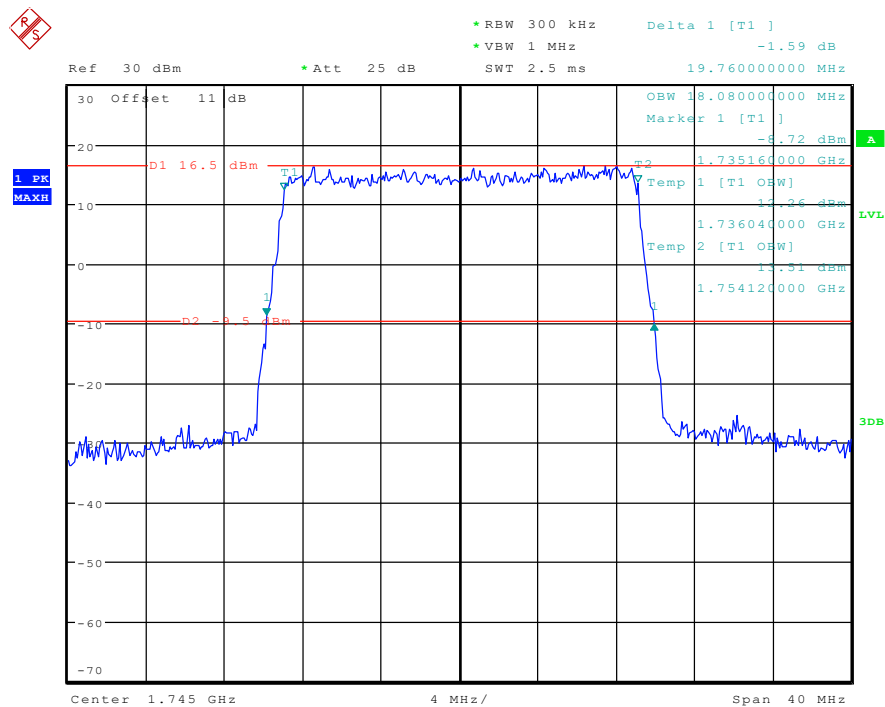


Date: 24.NOV.2022 11:11:17

Band 7_5 MHz_Low_QPSK_RB25#0

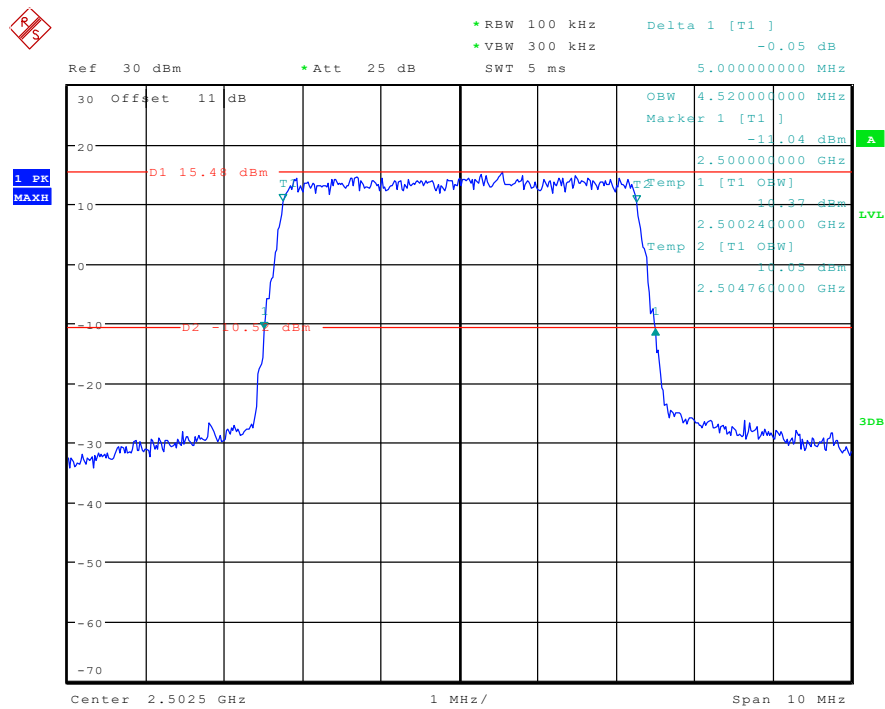


Date: 24.NOV.2022 11:11:38

Band 7_5 MHz_Low_16QAM_RB25#0

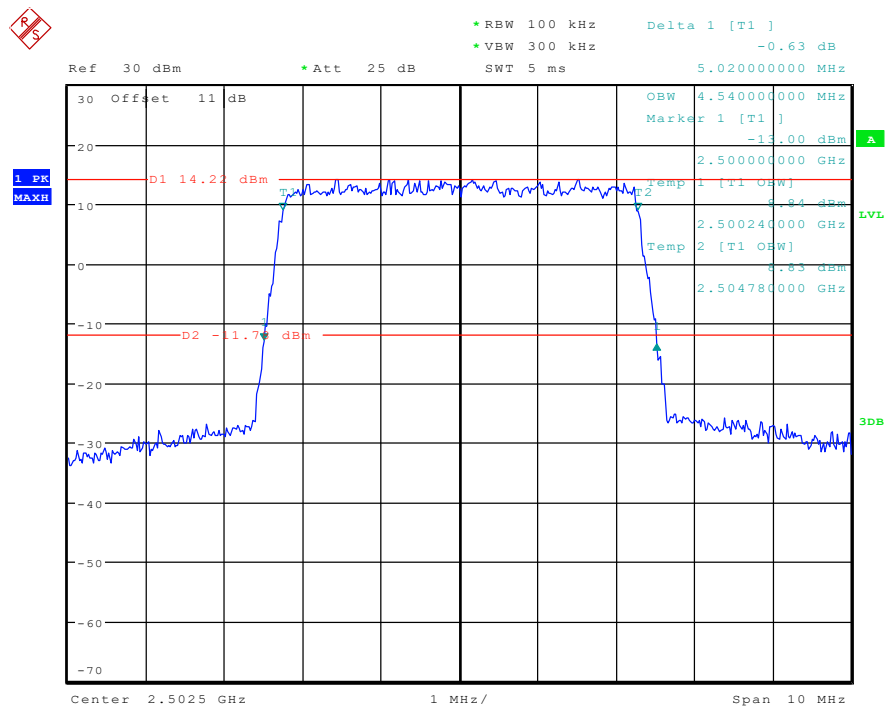


Date: 24.NOV.2022 11:11:57

Band 7_5 MHz_Middle_QPSK_RB25#0

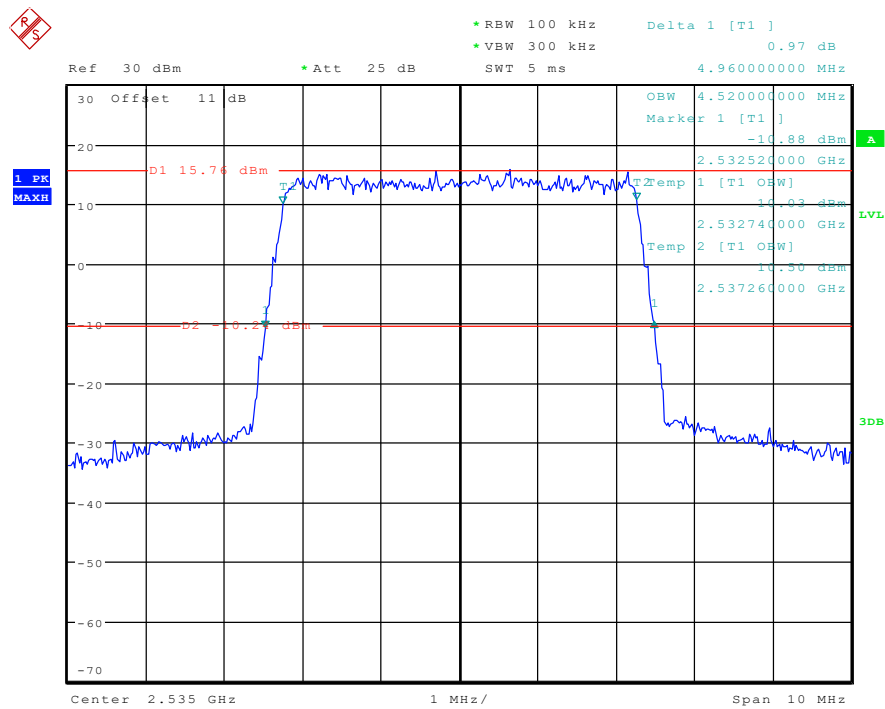


Date: 24.NOV.2022 11:12:16

Band 7_5 MHz_Middle_16QAM_RB25#0

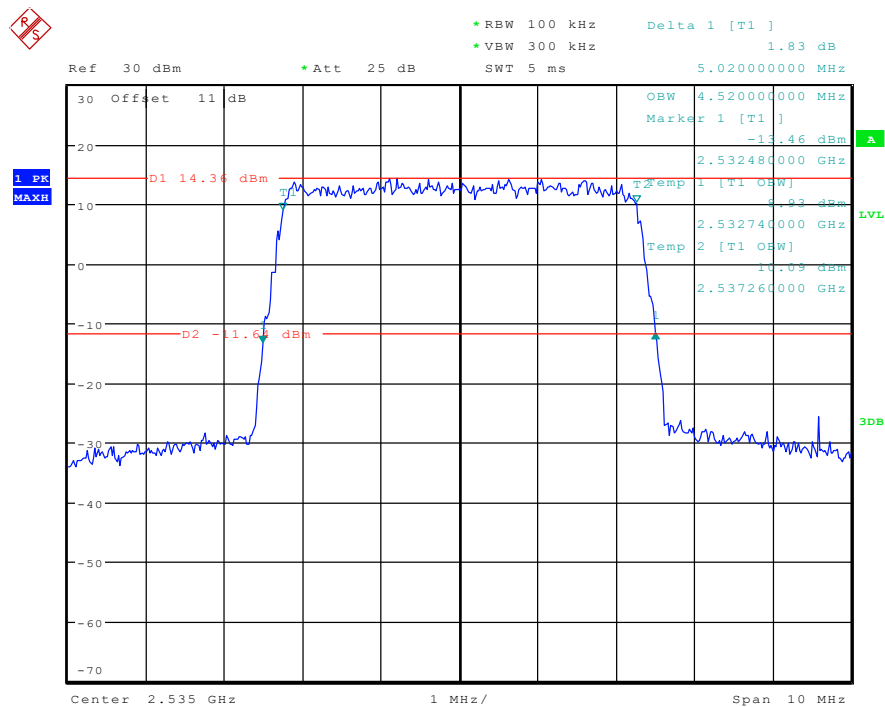


Date: 24.NOV.2022 11:12:35

Band 7_5 MHz_High_QPSK_RB25#0

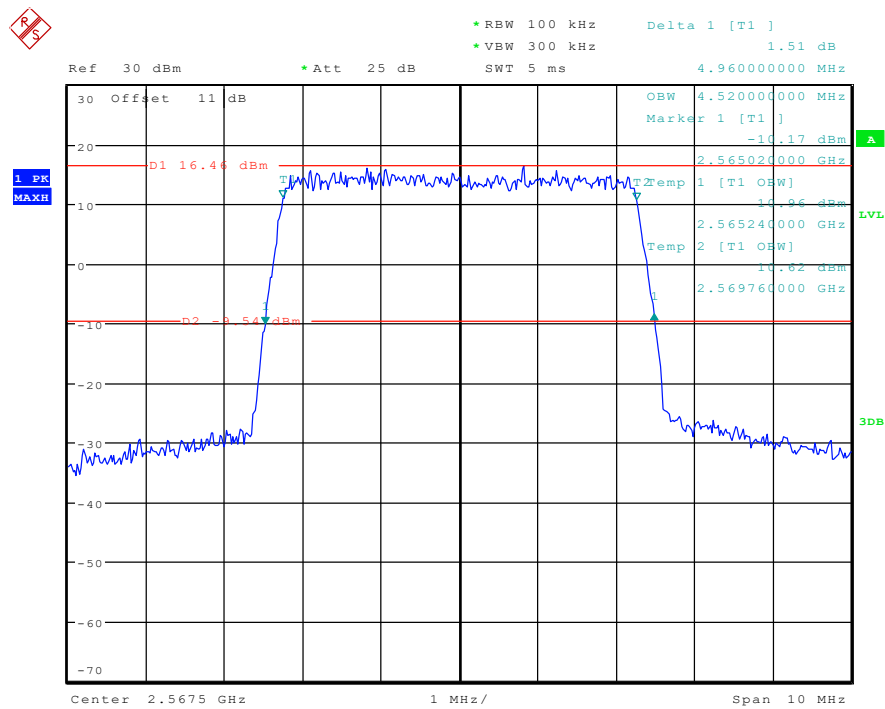


Date: 24.NOV.2022 11:12:54

Band 7_5 MHz_High_16QAM_RB25#0

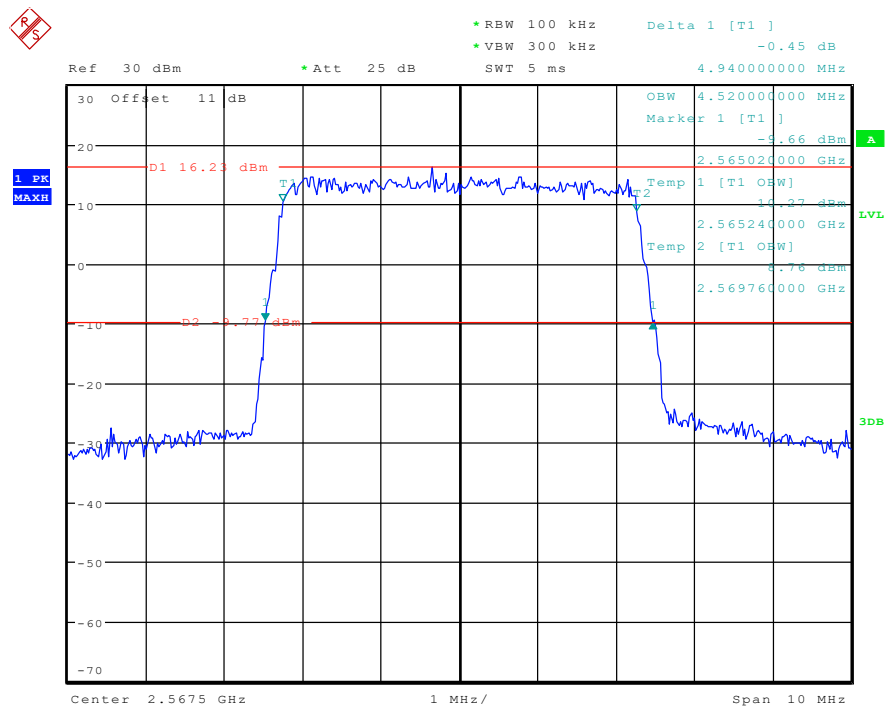


Date: 24.NOV.2022 11:13:13

Band 7_10 MHz_Low_QPSK_RB50#0

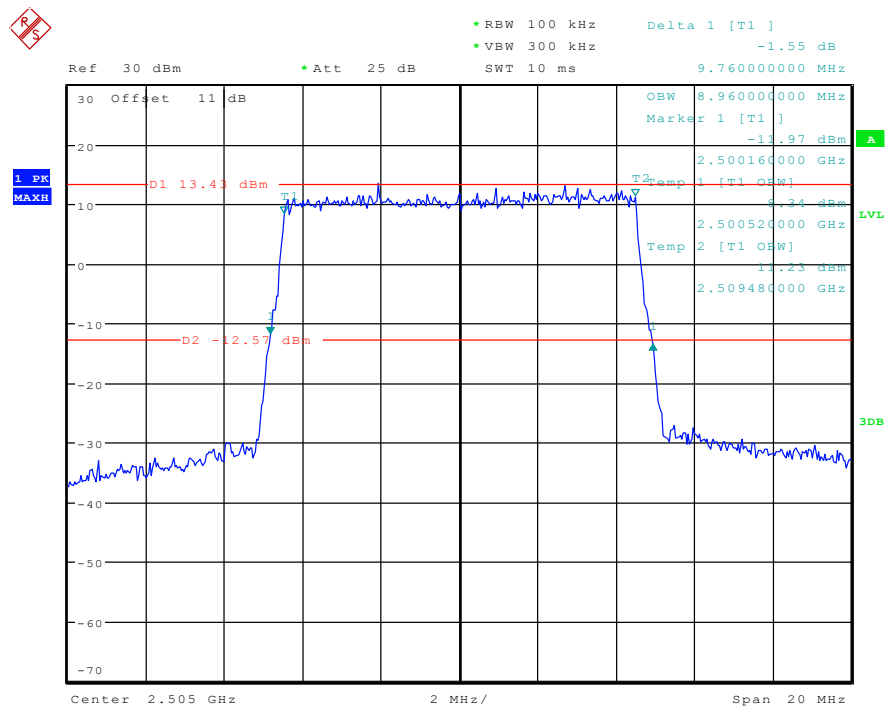


Date: 24.NOV.2022 11:13:31

Band 7_10 MHz_Low_16QAM_RB50#0

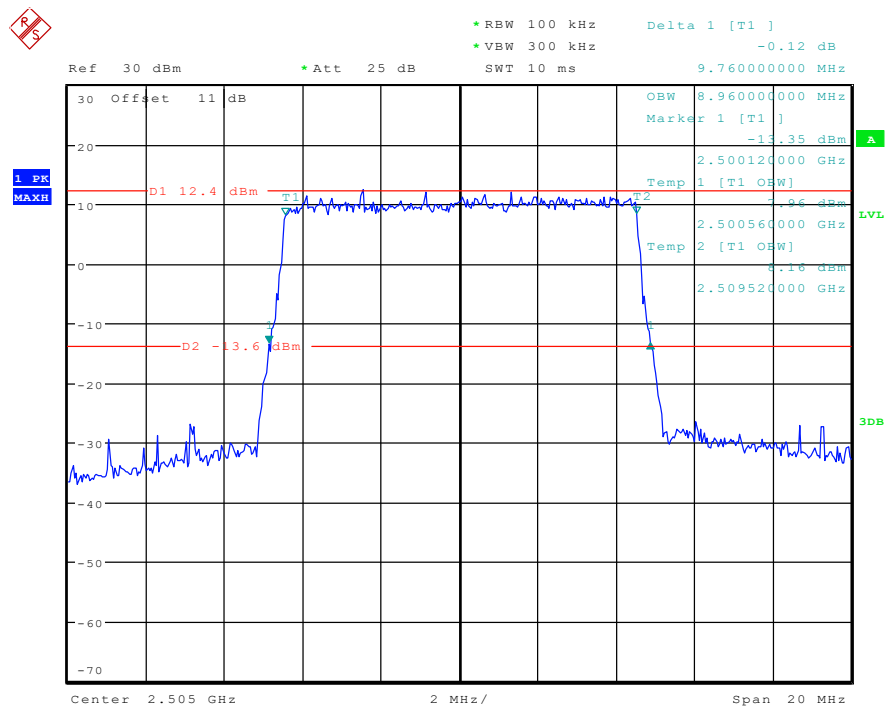


Date: 24.NOV.2022 11:13:51

Band 7_10 MHz_Middle_QPSK_RB50#0

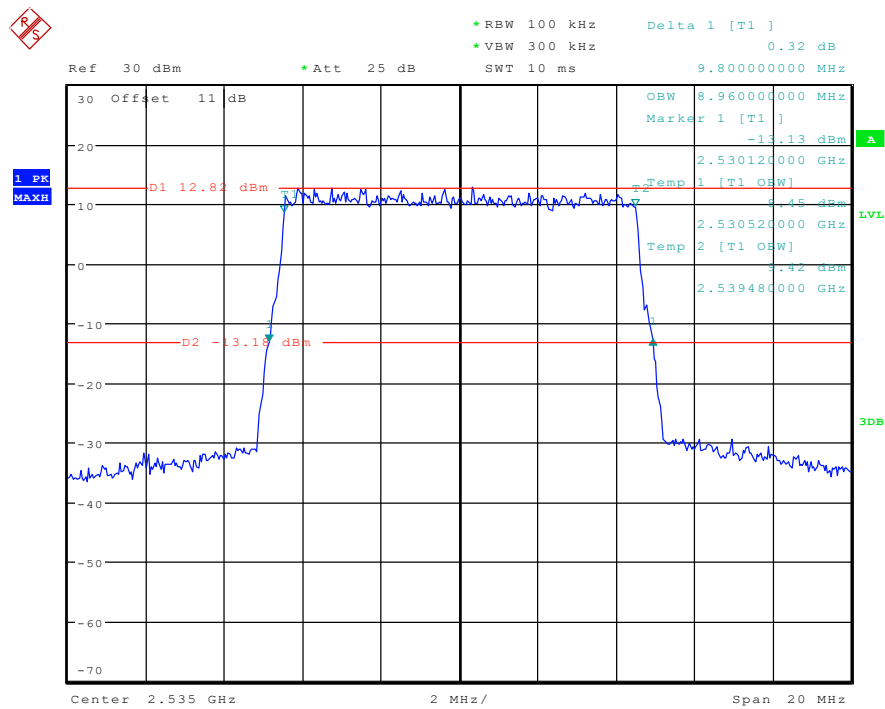


Date: 24.NOV.2022 11:14:11

Band 7_10 MHz_Middle_16QAM_RB50#0

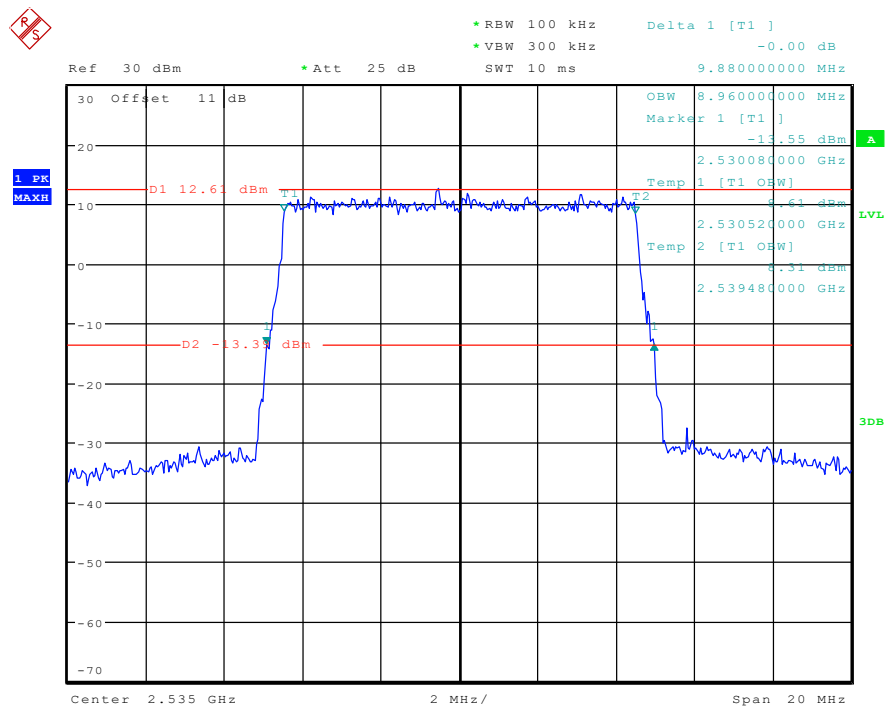


Date: 24.NOV.2022 11:14:31

Band 7_10 MHz_High_QPSK_RB50#0

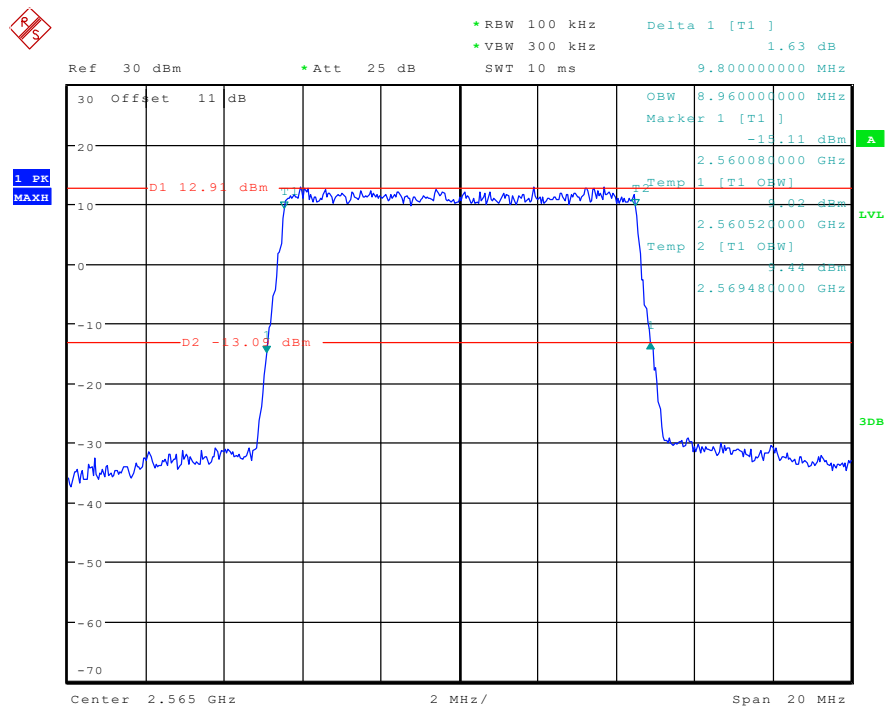


Date: 24.NOV.2022 11:14:51

Band 7_10 MHz_High_16QAM_RB50#0

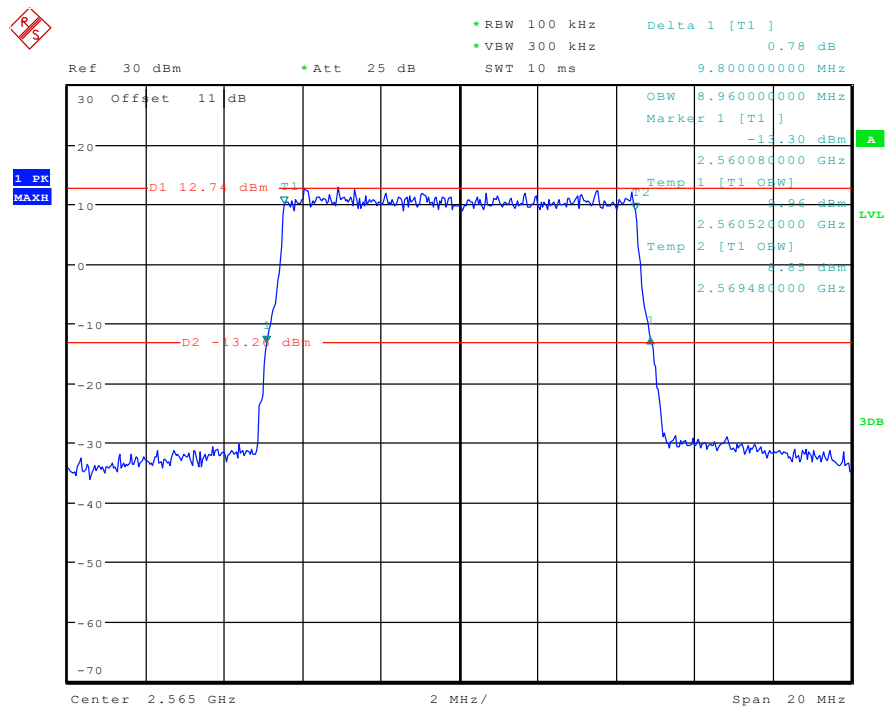


Date: 24.NOV.2022 11:15:10

Band 7_15 MHz_Low_QPSK_RB75#0

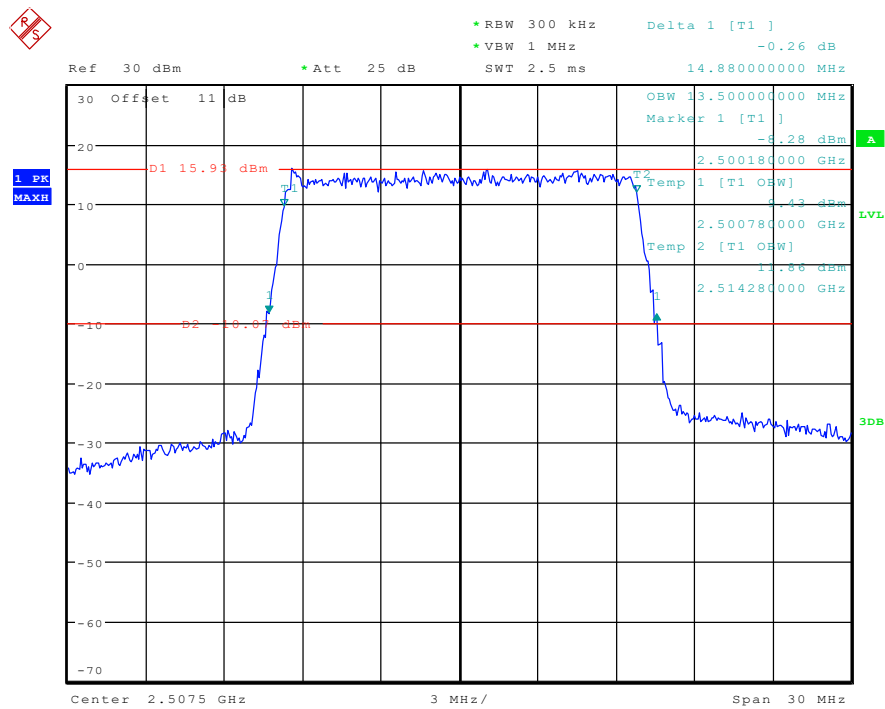


Date: 24.NOV.2022 11:15:31

Band 7_15 MHz_Low_16QAM_RB75#0

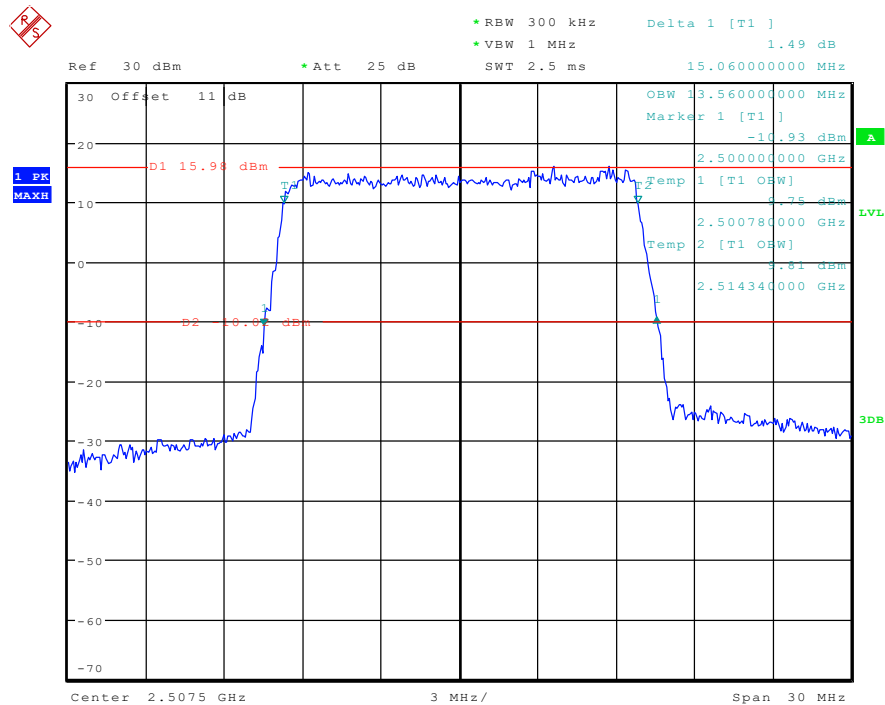


Date: 24.NOV.2022 11:15:53

Band 7_15 MHz_Middle_QPSK_RB75#0

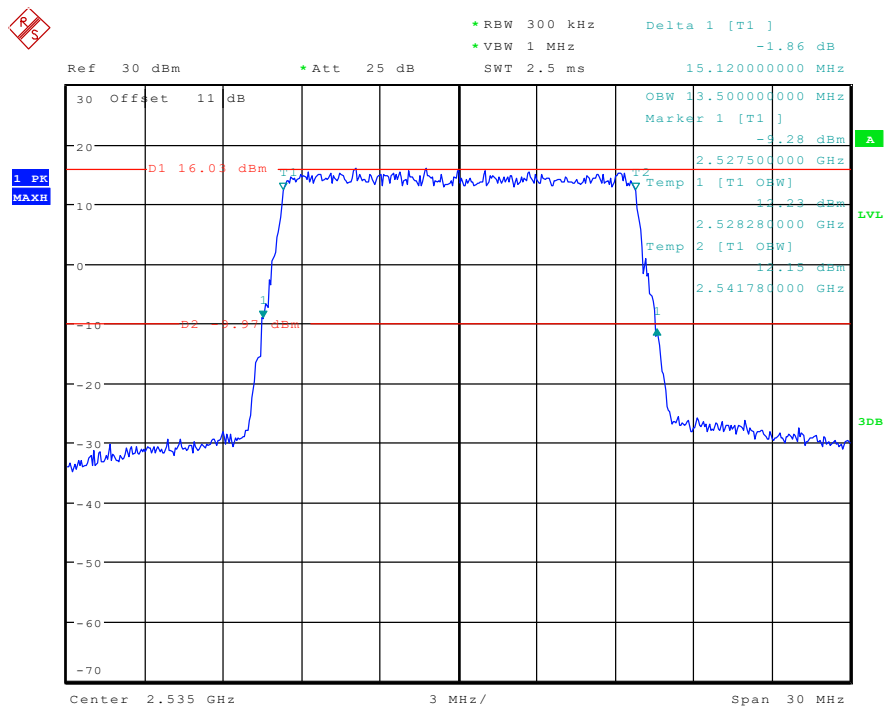


Date: 24.NOV.2022 11:16:12

Band 7_15 MHz_Middle_16QAM_RB75#0

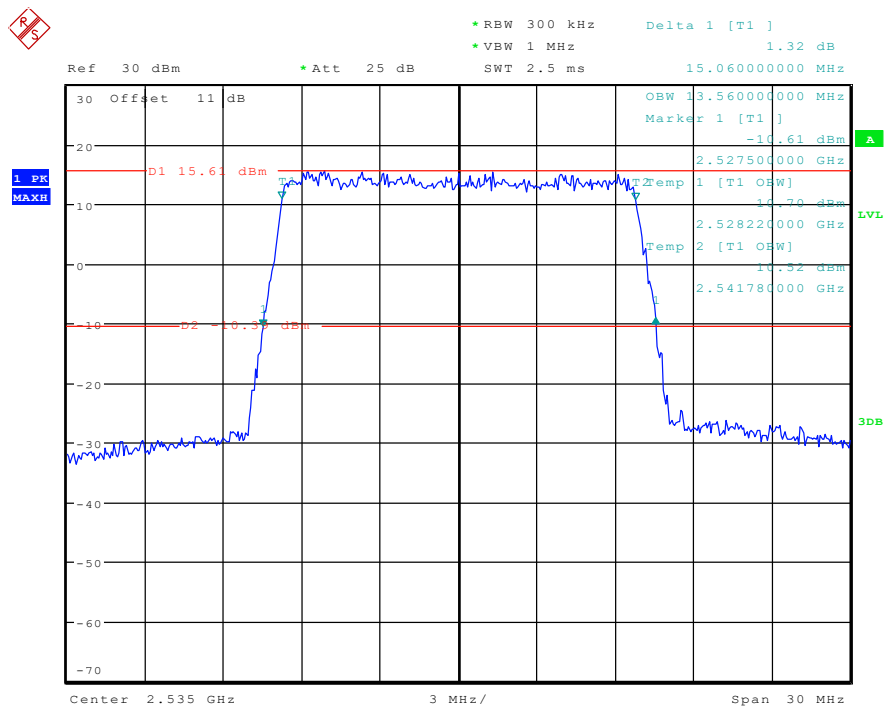


Date: 24.NOV.2022 11:16:34

Band 7_15 MHz_High_QPSK_RB75#0

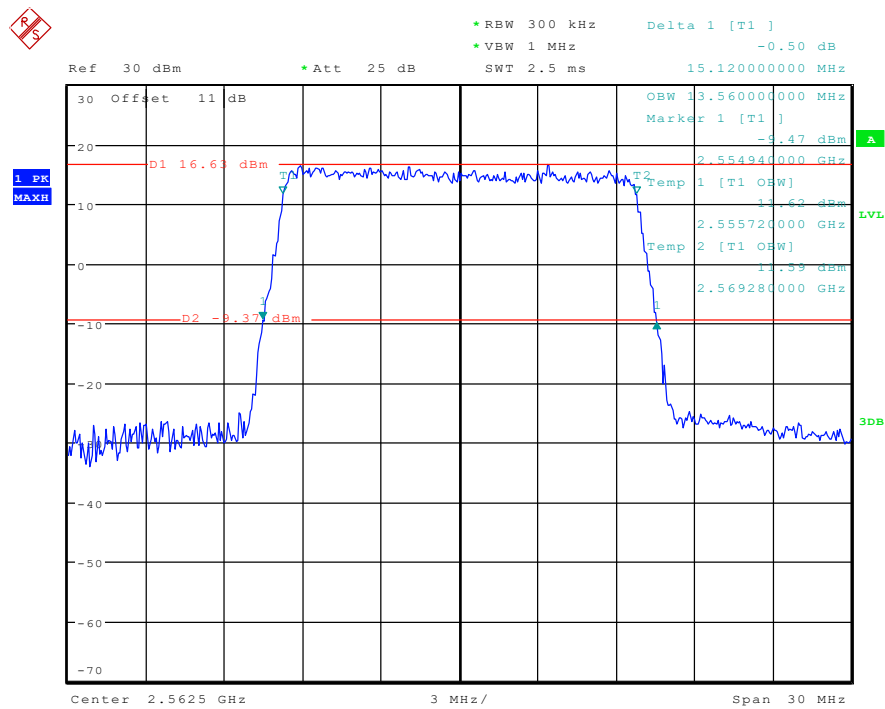


Date: 24.NOV.2022 11:16:57

Band 7_15 MHz_High_16QAM_RB75#0

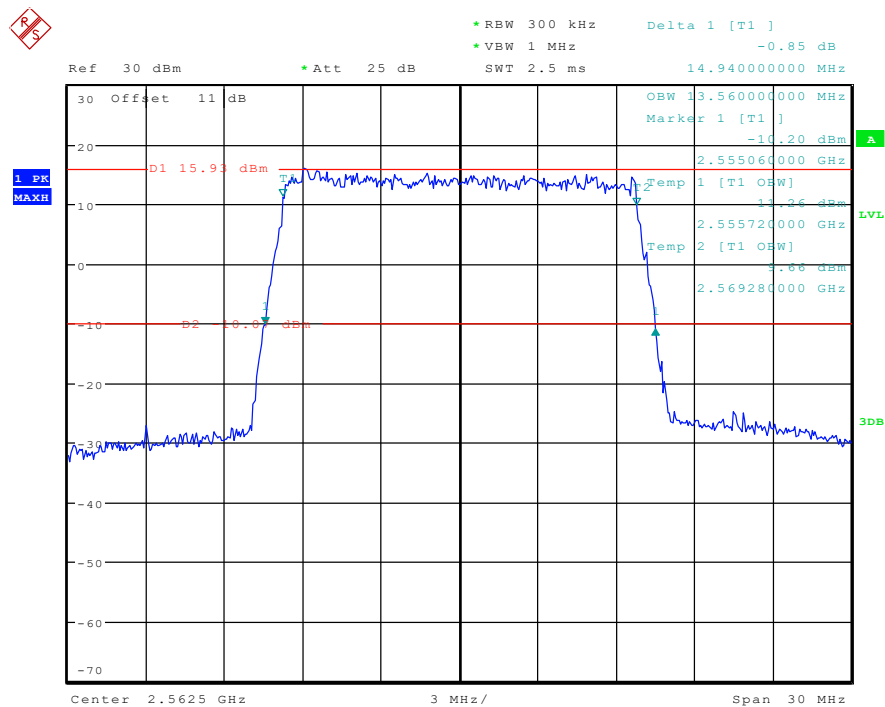


Date: 24.NOV.2022 11:17:15

Band 7_20 MHz_Low_QPSK_RB100#0

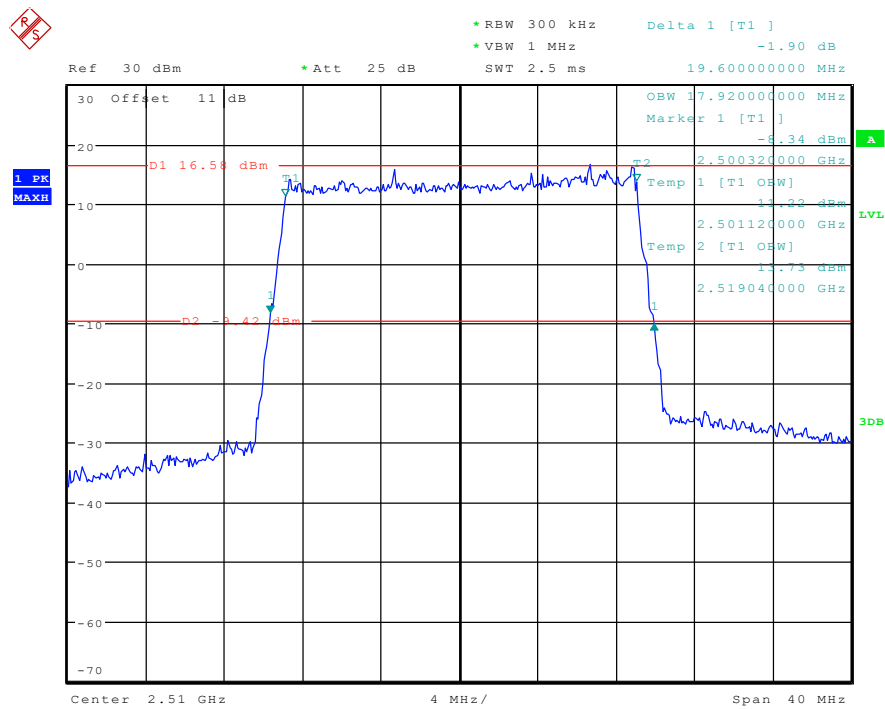


Date: 24.NOV.2022 11:17:41

Band 7_20 MHz_Low_16QAM_RB100#0

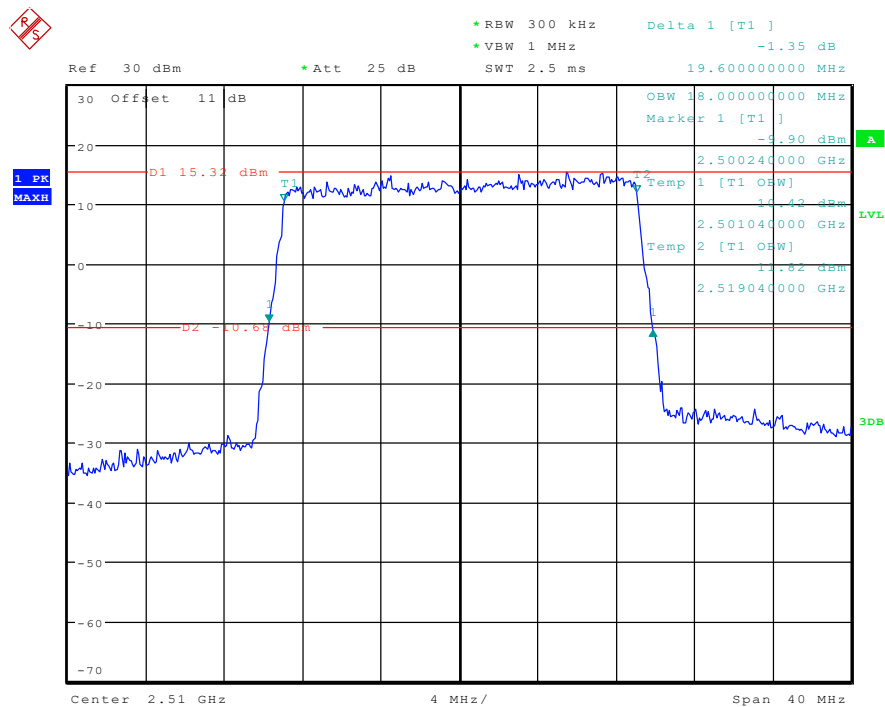


Date: 24.NOV.2022 11:18:03

Band 7_20 MHz_Middle_QPSK_RB100#0

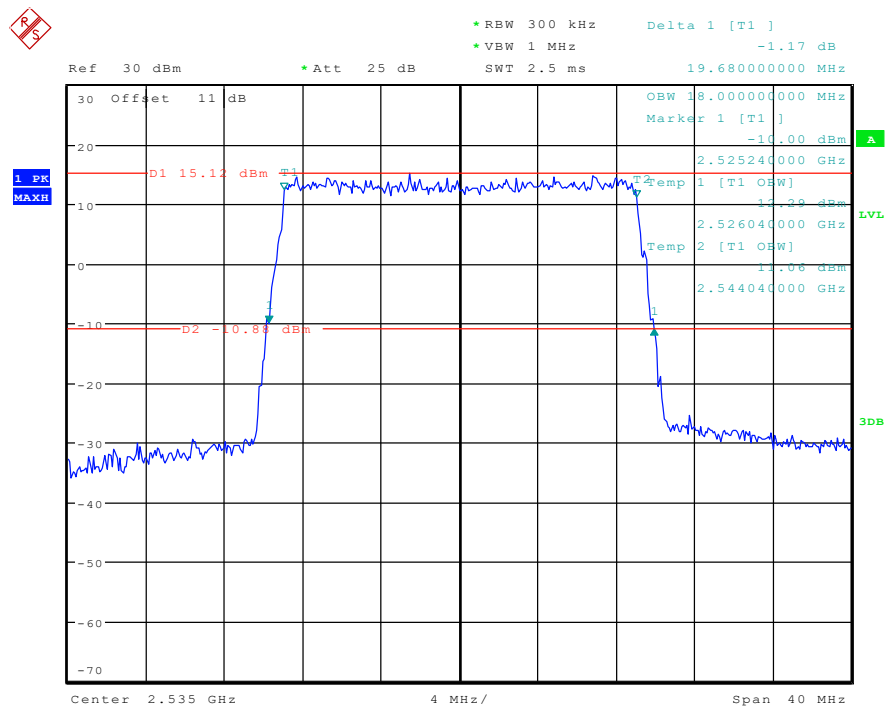


Date: 24.NOV.2022 11:18:23

Band 7_20 MHz_Middle_16QAM_RB100#0

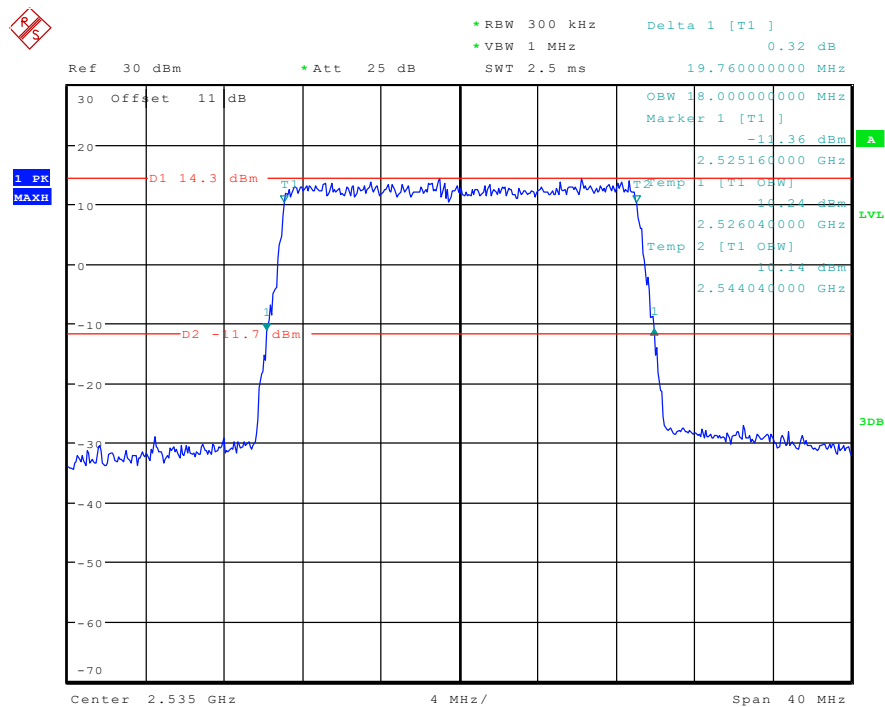


Date: 24.NOV.2022 11:18:45

Band 7_20 MHz_High_QPSK_RB100#0

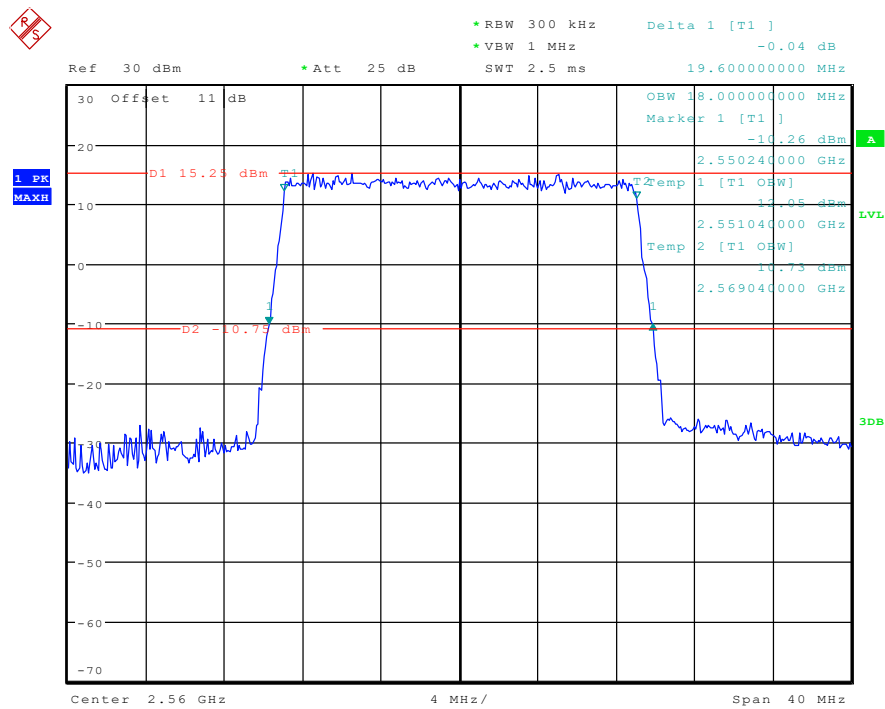


Date: 24.NOV.2022 11:19:09

Band 7_20 MHz_High_16QAM_RB100#0

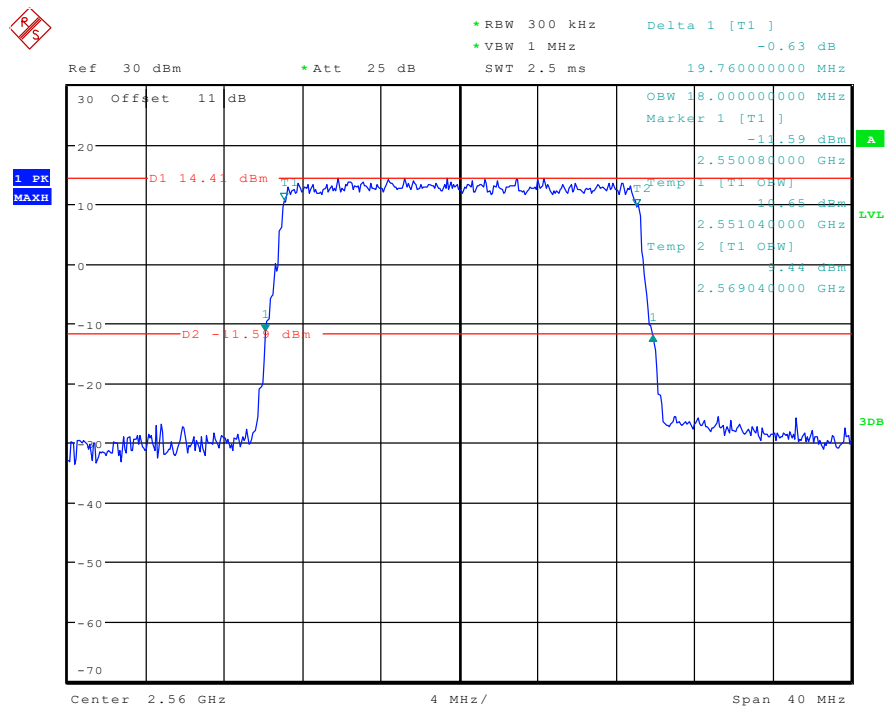


Date: 24.NOV.2022 11:19:31

Band 66_1.4 MHz_Low_QPSK_RB6#0

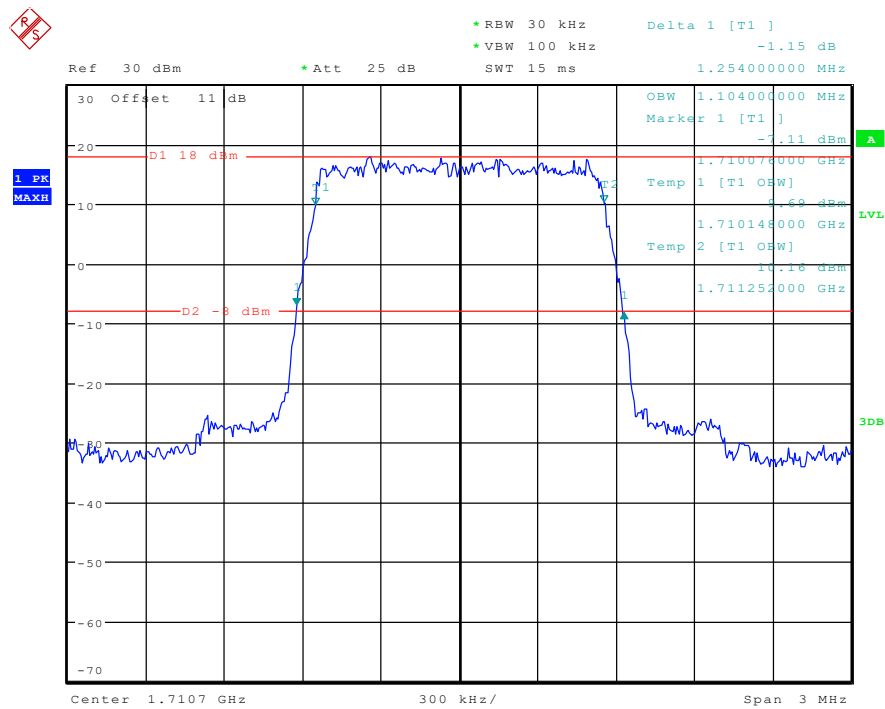


Date: 24.NOV.2022 11:20:38

Band 66_1.4 MHz_Low_16QAM_RB6#0

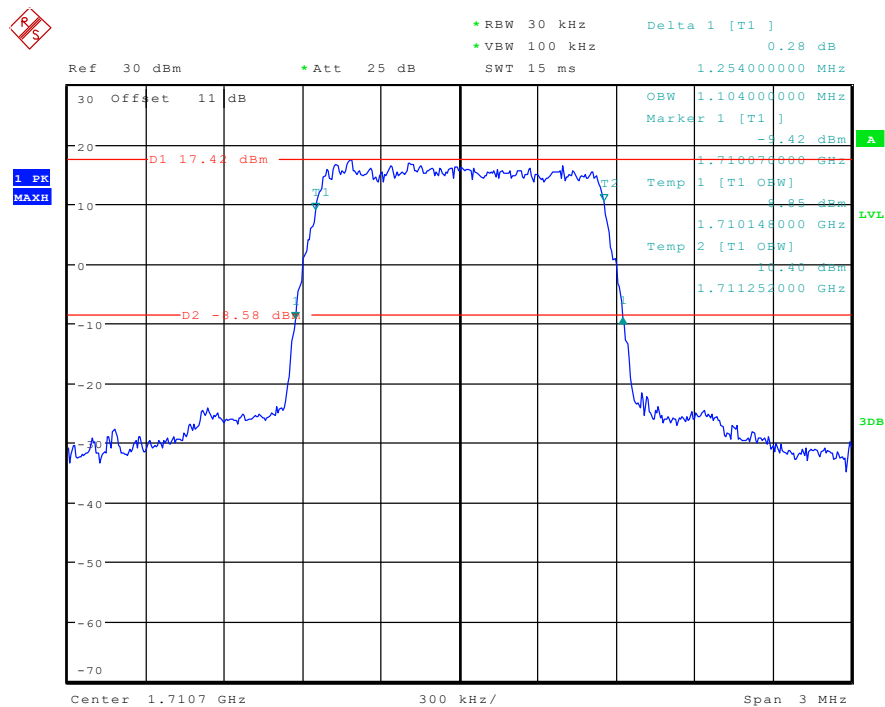


Date: 24.NOV.2022 11:20:59

Band 66_1.4 MHz_Middle_QPSK_RB6#0

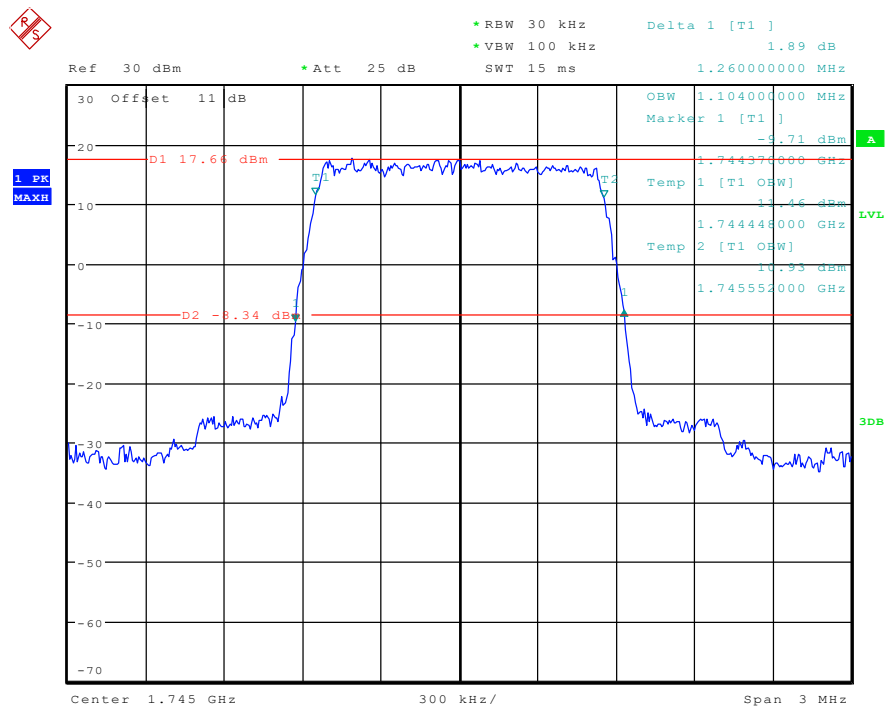


Date: 24.NOV.2022 11:24:22

Band 66_1.4 MHz_Middle_16QAM_RB6#0

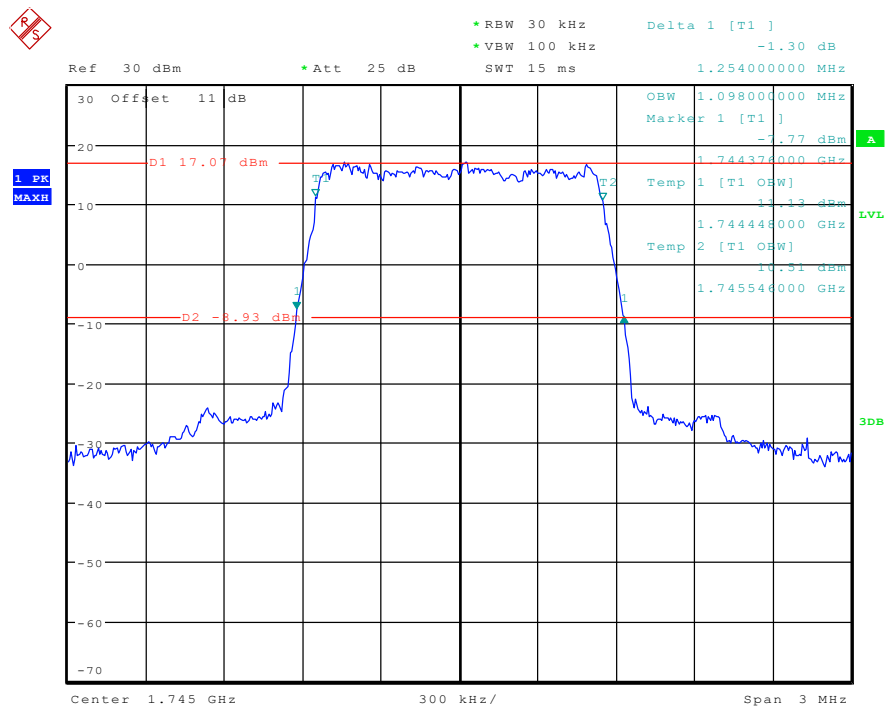


Date: 24.NOV.2022 11:24:40

Band 66_1.4 MHz_High_QPSK_RB6#0

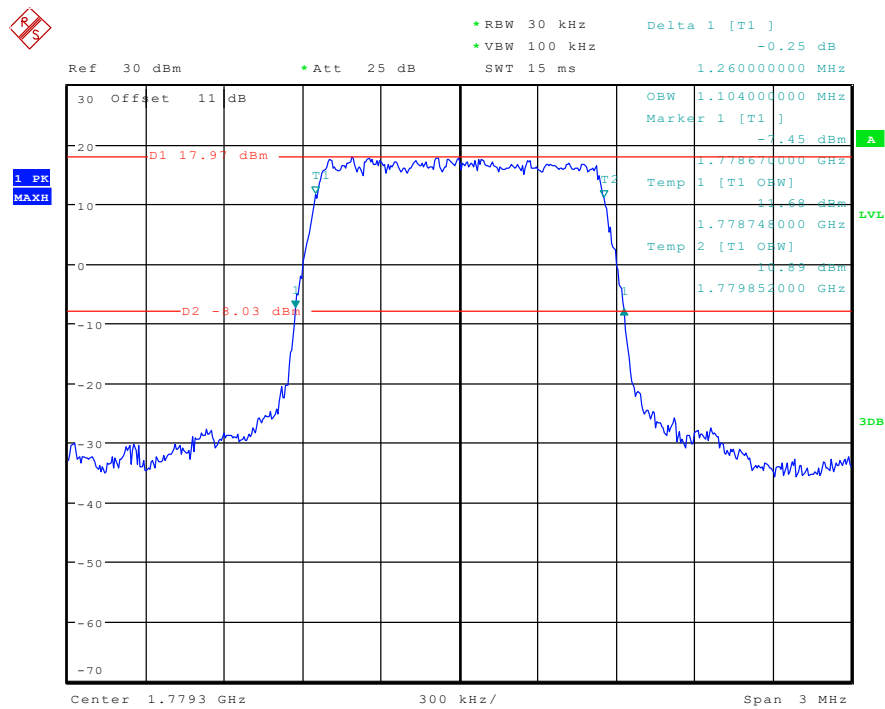


Date: 24.NOV.2022 11:26:48

Band 66_1.4 MHz_High_16QAM_RB6#0

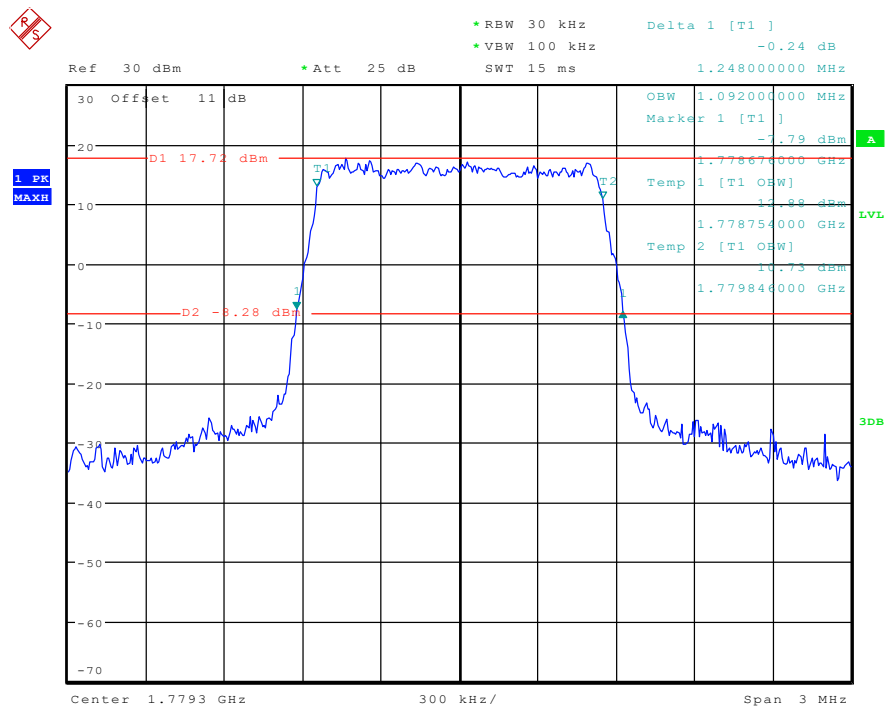


Date: 24.NOV.2022 11:27:06

Band 66_3 MHz_Low_QPSK_RB15#0

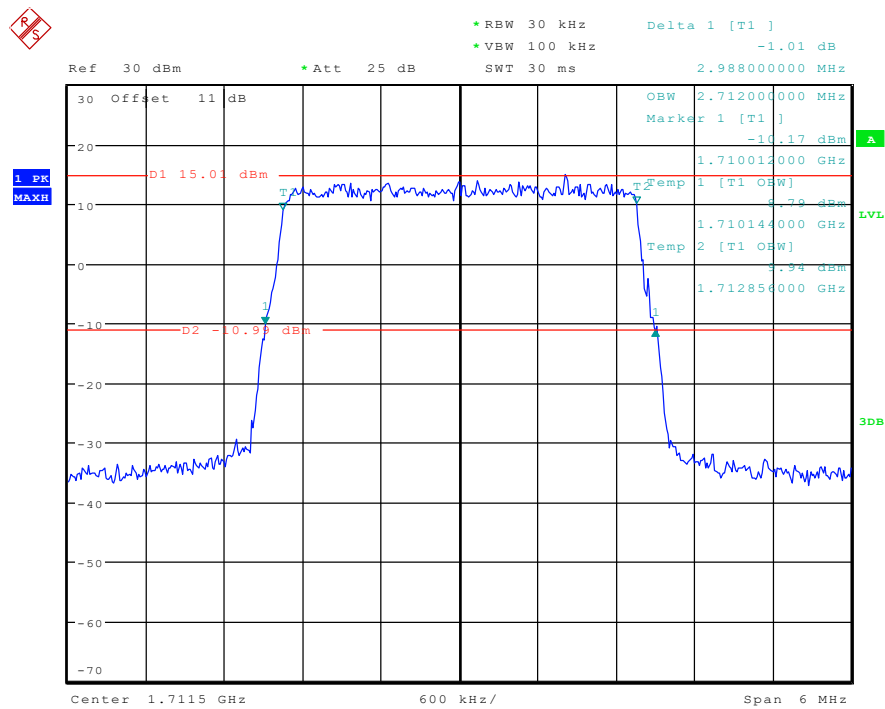


Date: 24.NOV.2022 11:27:23

Band 66_3 MHz_Low_16QAM_RB15#0

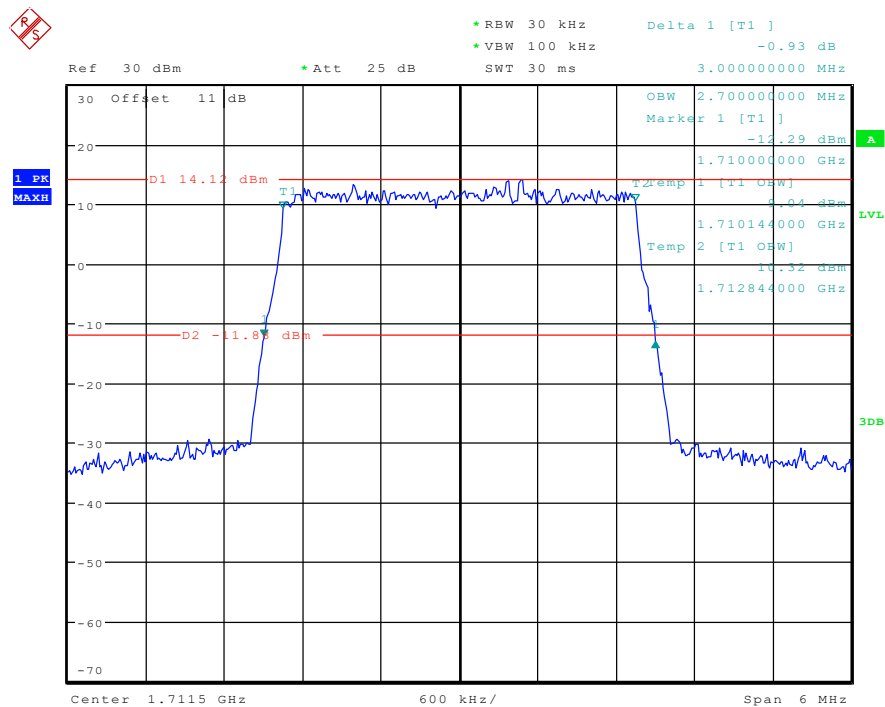


Date: 24.NOV.2022 11:27:41

Band 66_3 MHz_Middle_QPSK_RB15#0

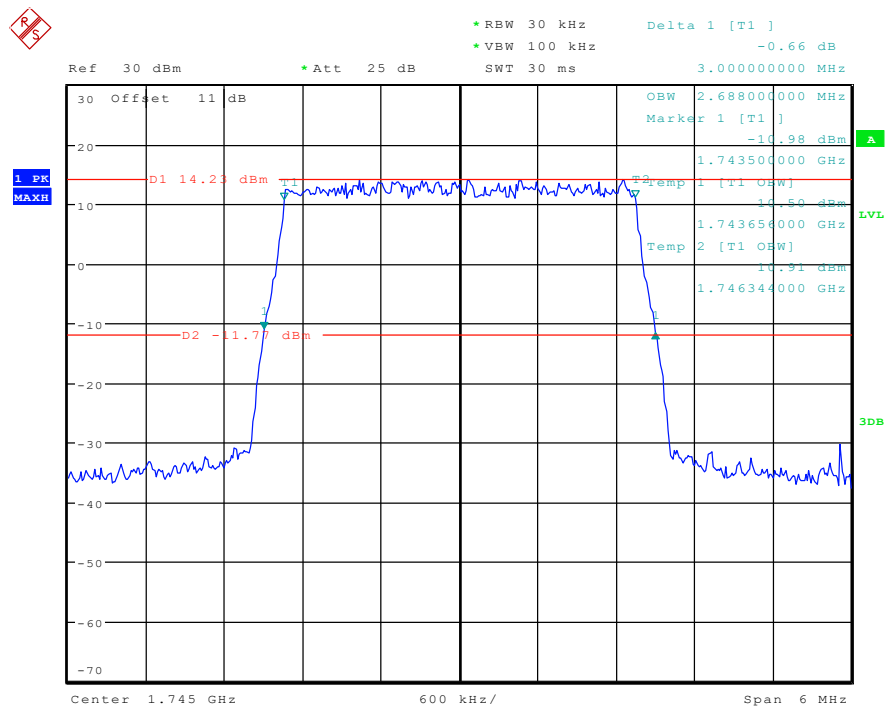


Date: 24.NOV.2022 11:27:57

Band 66_3 MHz_Middle_16QAM_RB15#0

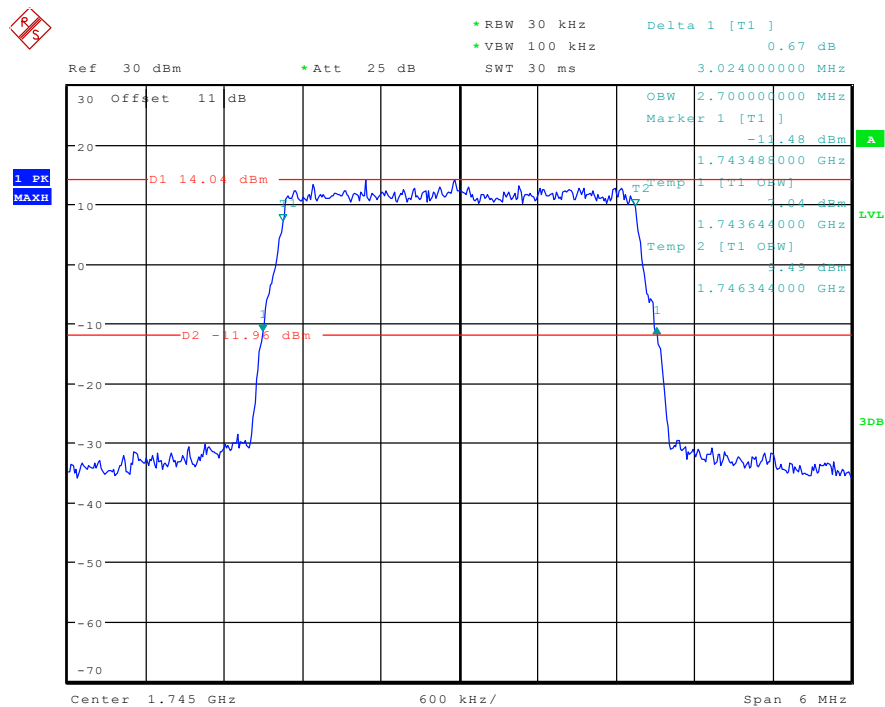


Date: 24.NOV.2022 11:28:12

Band 66_3 MHz_High_QPSK_RB15#0

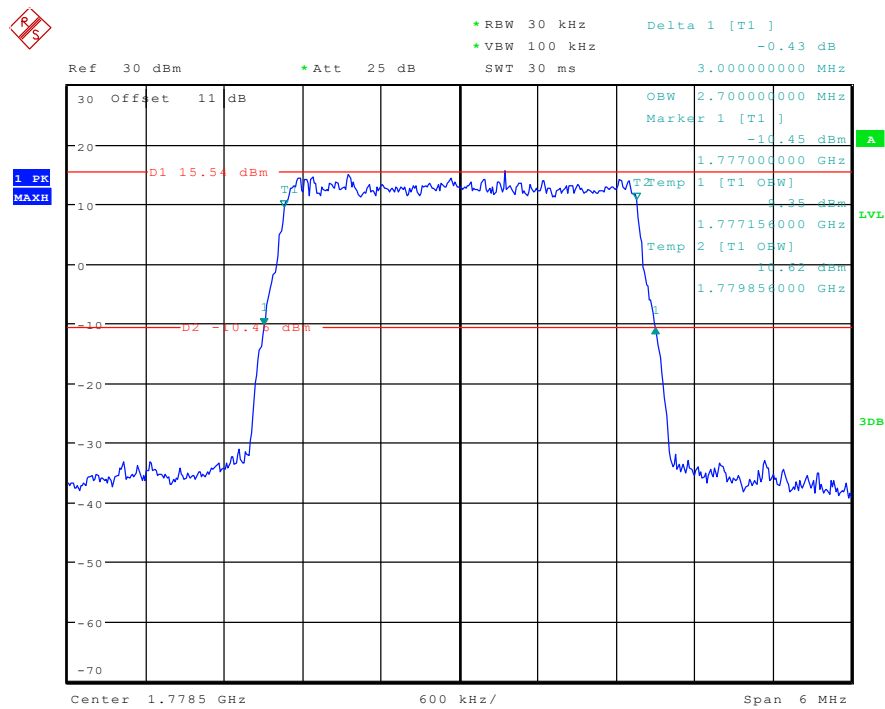


Date: 24.NOV.2022 11:28:31

Band 66_3 MHz_High_16QAM_RB15#0

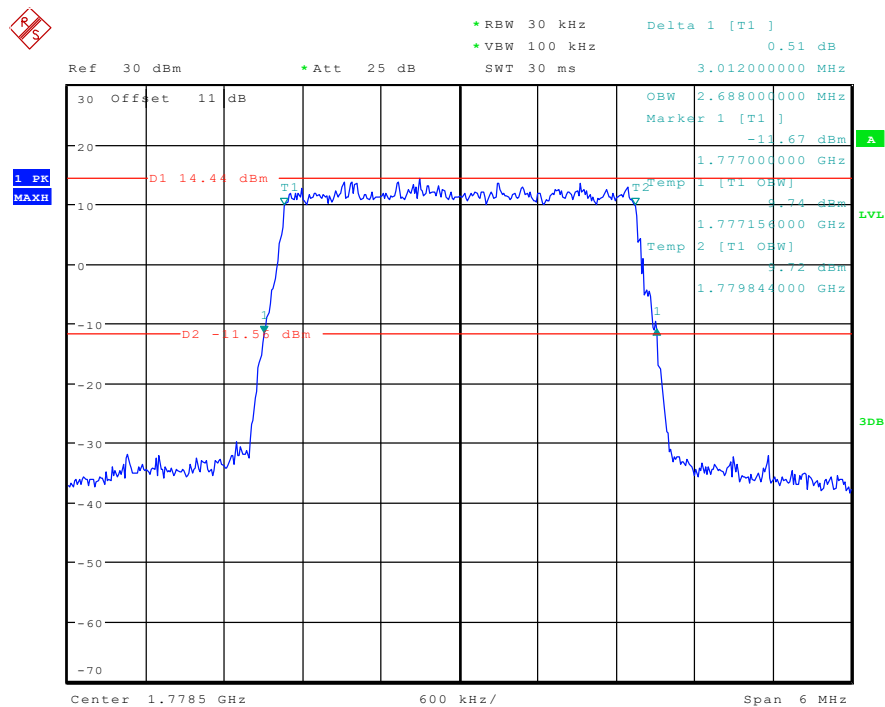


Date: 24.NOV.2022 11:28:45

Band 66_5 MHz_Low_QPSK_RB25#0

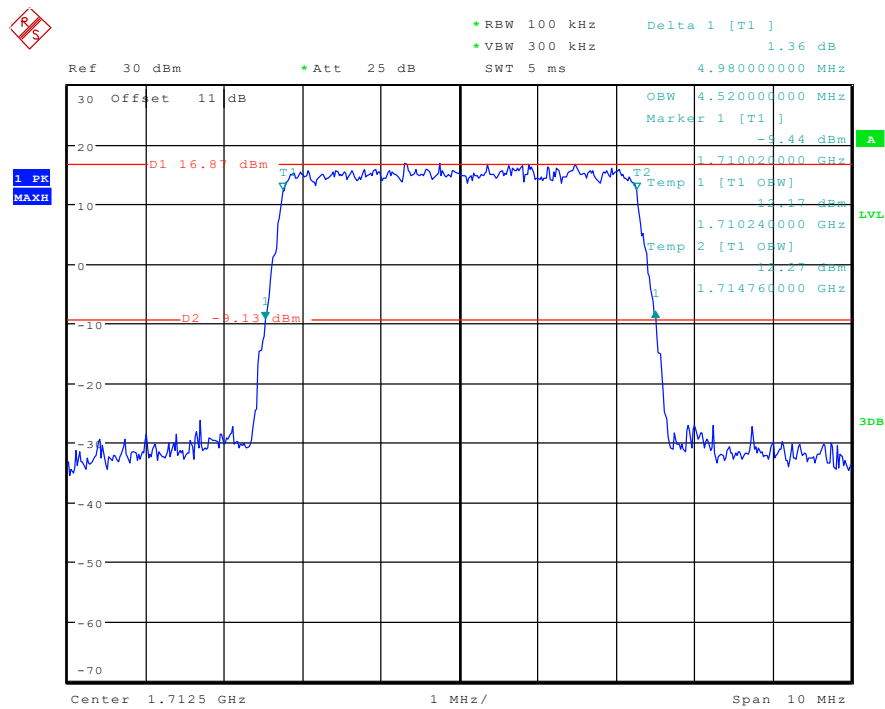


Date: 24.NOV.2022 11:29:06

Band 66_5 MHz_Low_16QAM_RB25#0

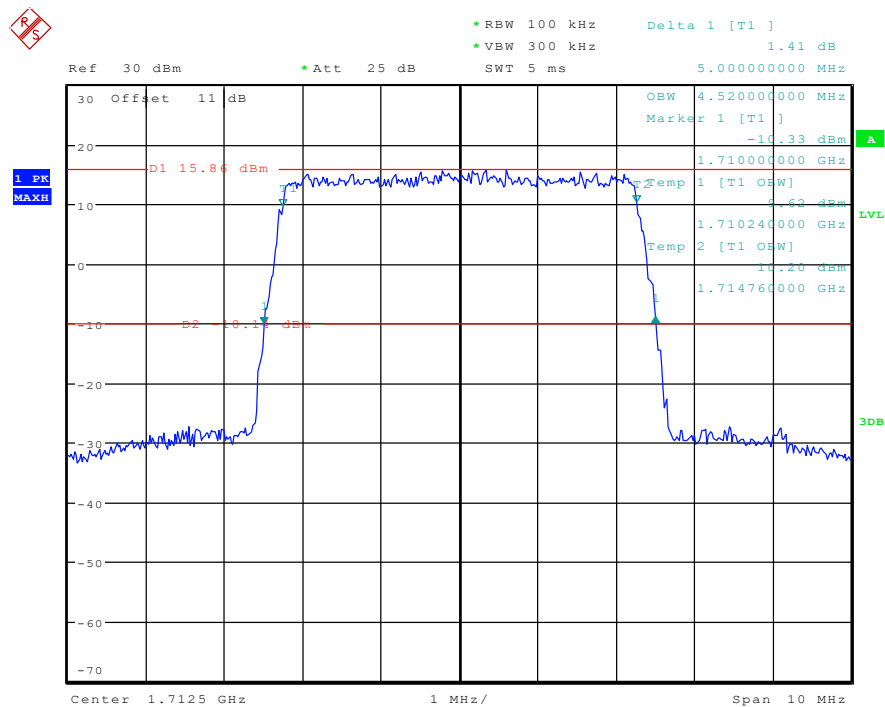


Date: 24.NOV.2022 11:29:25

Band 66_5 MHz_Middle_QPSK_RB25#0

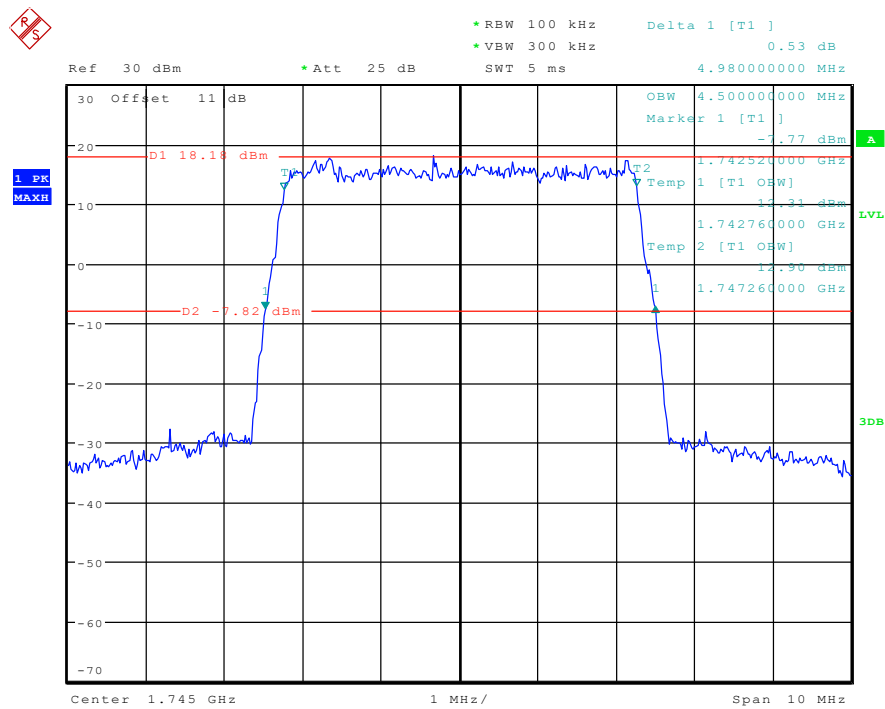


Date: 24.NOV.2022 11:29:44

Band 66_5 MHz_Middle_16QAM_RB25#0

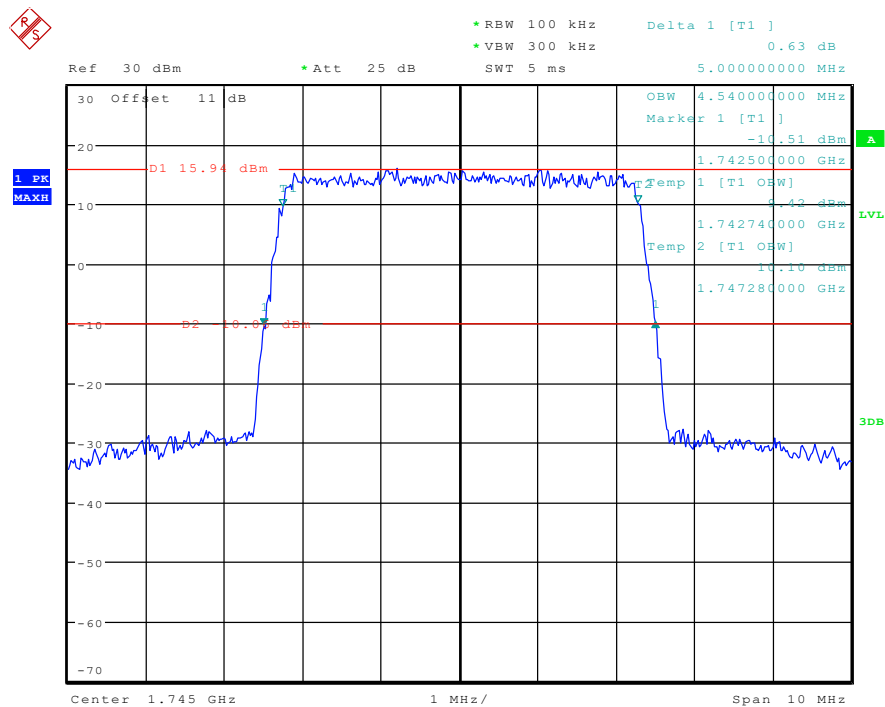


Date: 24.NOV.2022 11:29:59

Band 66_5 MHz_High_QPSK_RB25#0

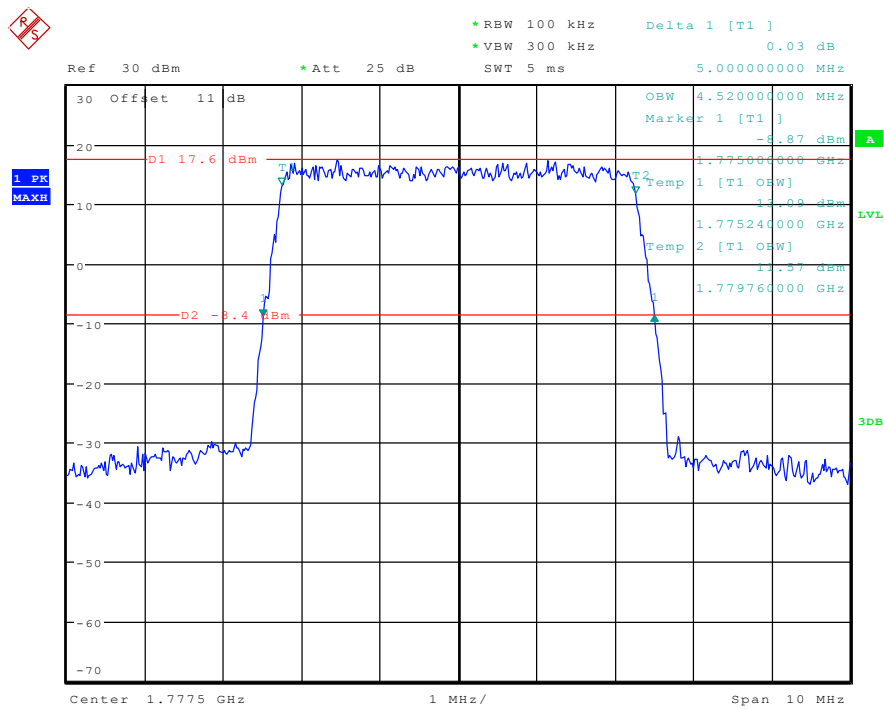


Date: 24.NOV.2022 11:30:19

Band 66_5 MHz_High_16QAM_RB25#0

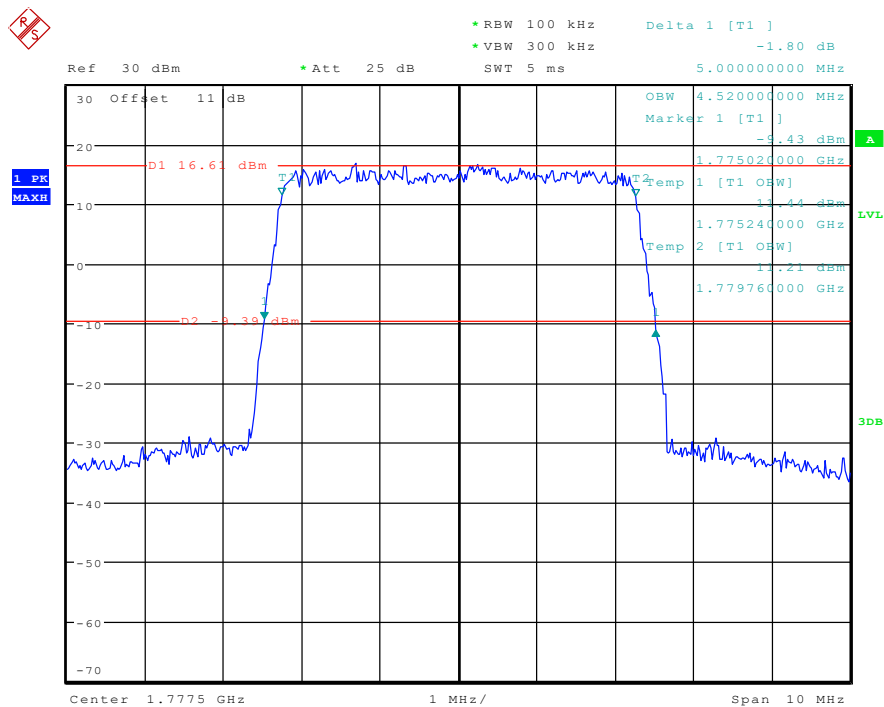


Date: 24.NOV.2022 11:30:41

Band 66_10 MHz_Low_QPSK_RB50#0

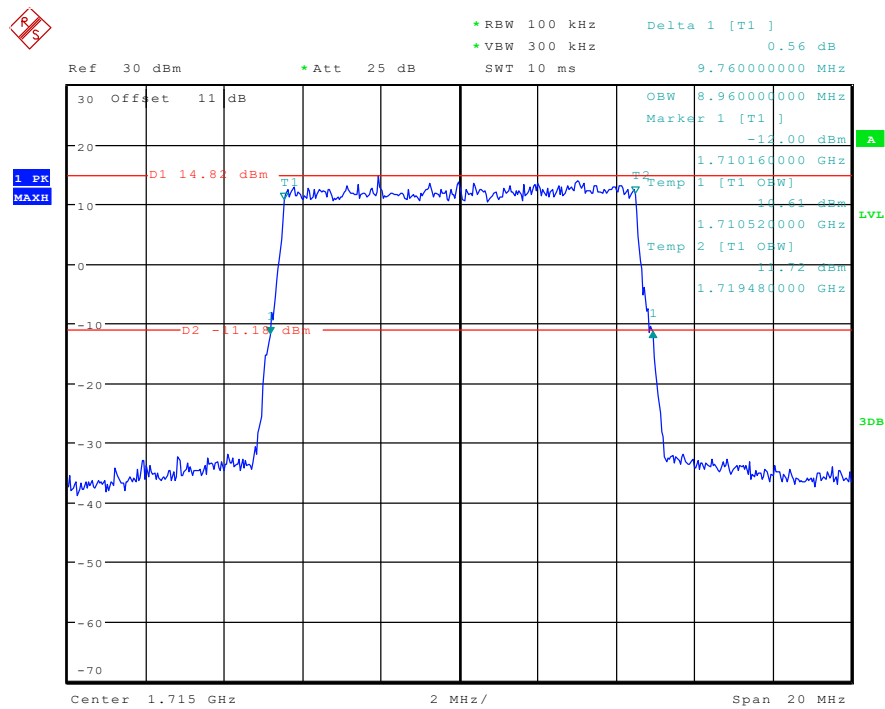


Date: 24.NOV.2022 11:30:59

Band 66_10 MHz_Low_16QAM_RB50#0

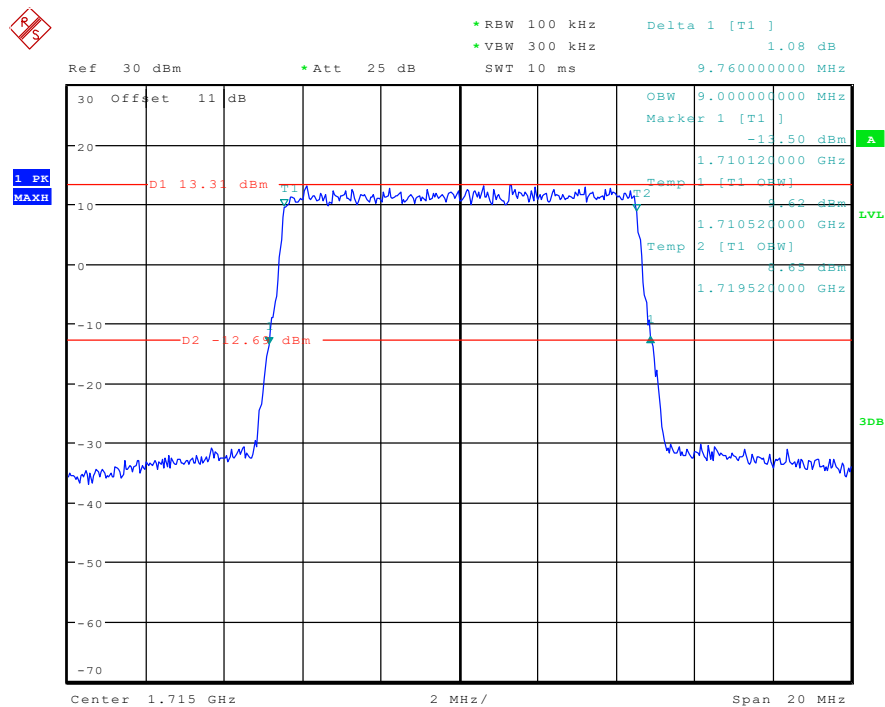


Date: 24.NOV.2022 11:31:18

Band 66_10 MHz_Middle_QPSK_RB50#0

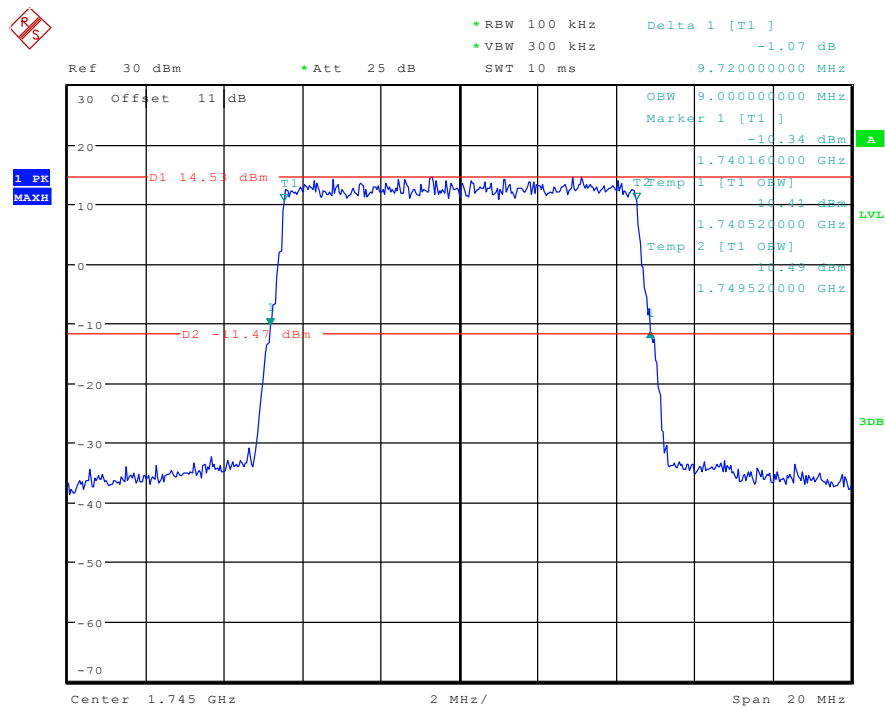


Date: 24.NOV.2022 11:31:35

Band 66_10 MHz_Middle_16QAM_RB50#0

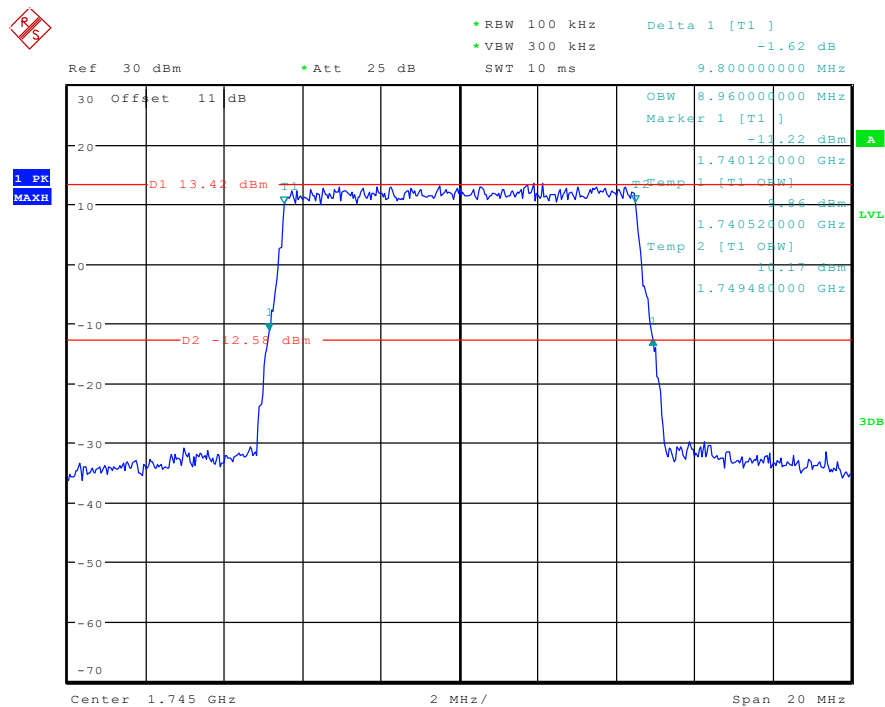


Date: 24.NOV.2022 11:31:54

Band 66_10 MHz_High_QPSK_RB50#0

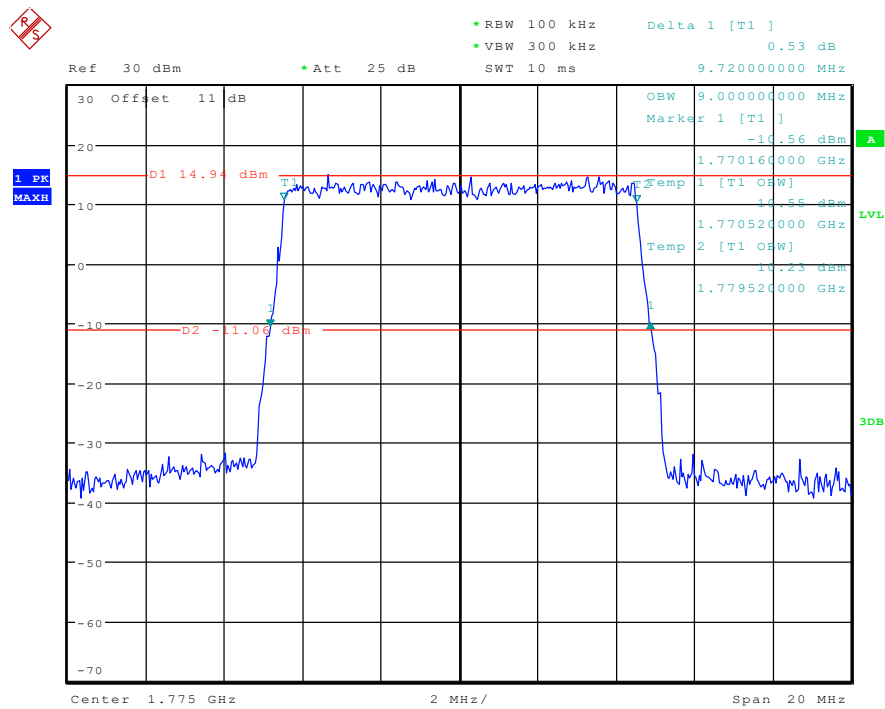


Date: 24.NOV.2022 11:32:17

Band 66_10 MHz_High_16QAM_RB50#0

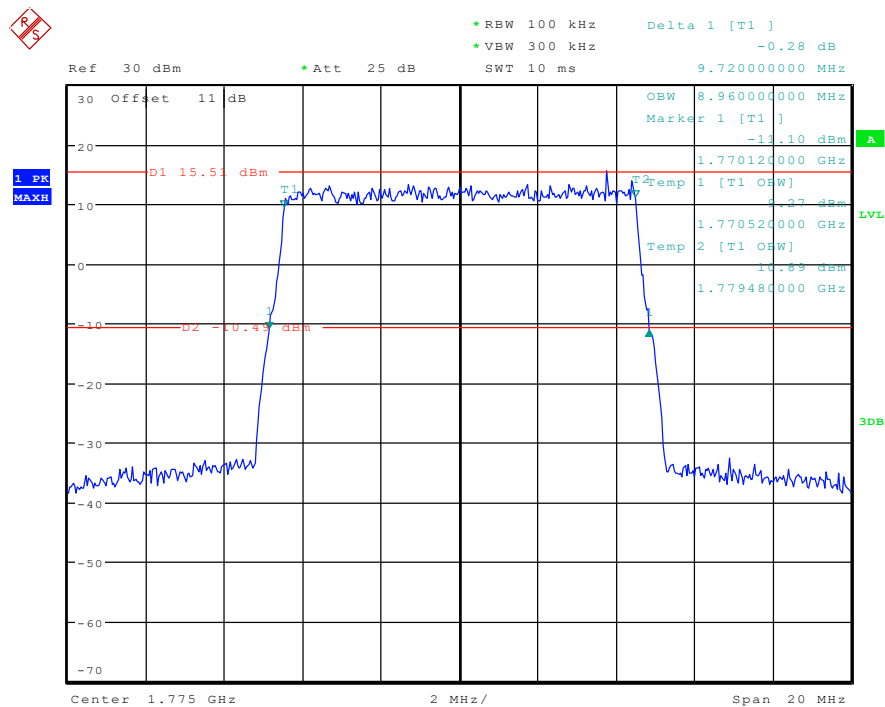


Date: 24.NOV.2022 11:32:36

Band 66_15 MHz_Low_QPSK_RB75#0

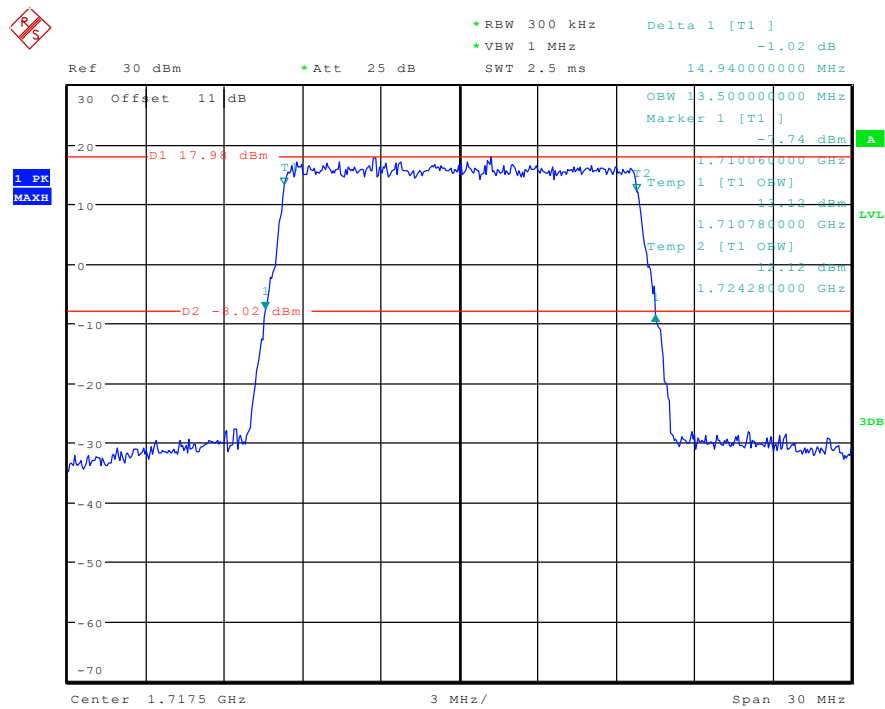


Date: 24.NOV.2022 11:32:57

Band 66_15 MHz_Low_16QAM_RB75#0

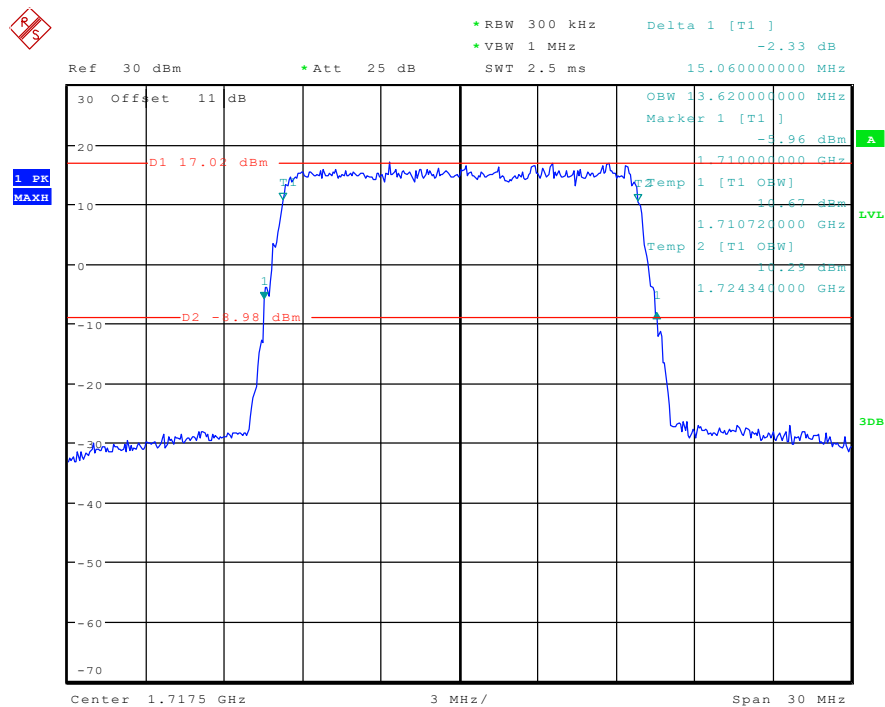


Date: 24.NOV.2022 11:33:19

Band 66_15 MHz_Middle_QPSK_RB75#0

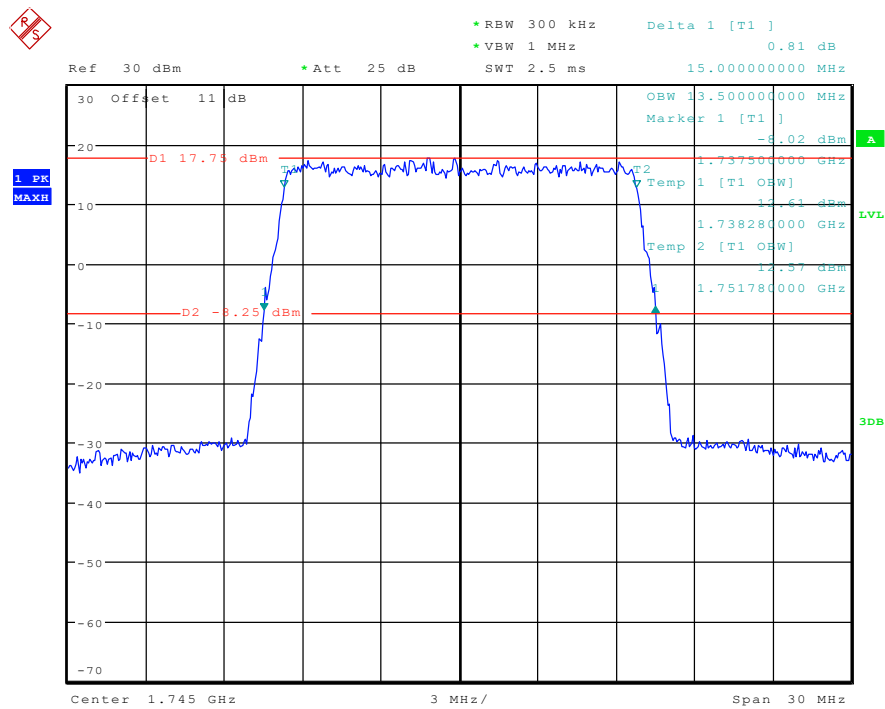


Date: 24.NOV.2022 11:33:38

Band 66_15 MHz_Middle_16QAM_RB75#0

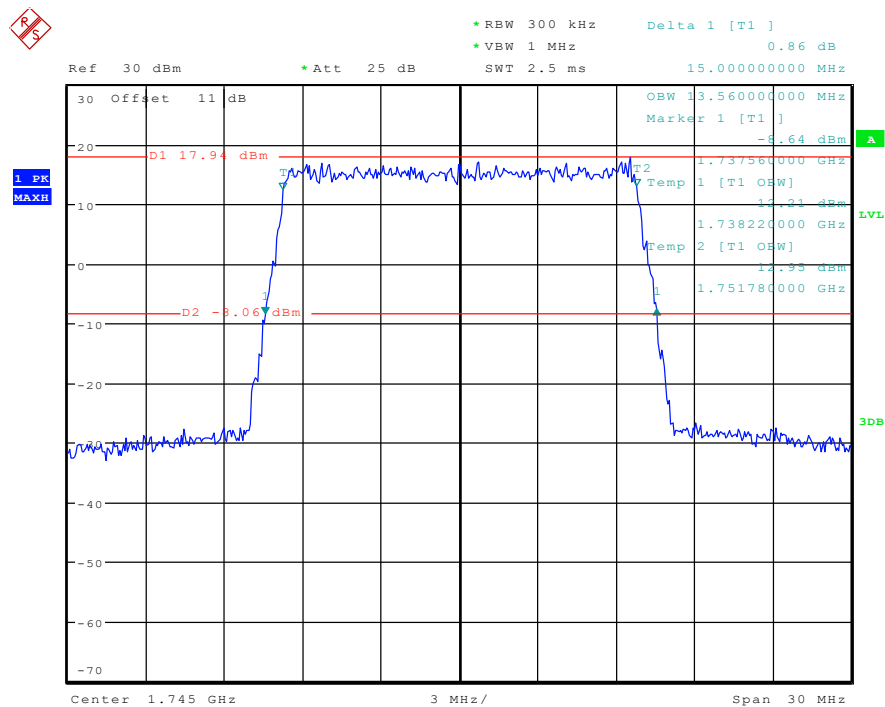


Date: 24.NOV.2022 11:33:57

Band 66_15 MHz_High_QPSK_RB75#0

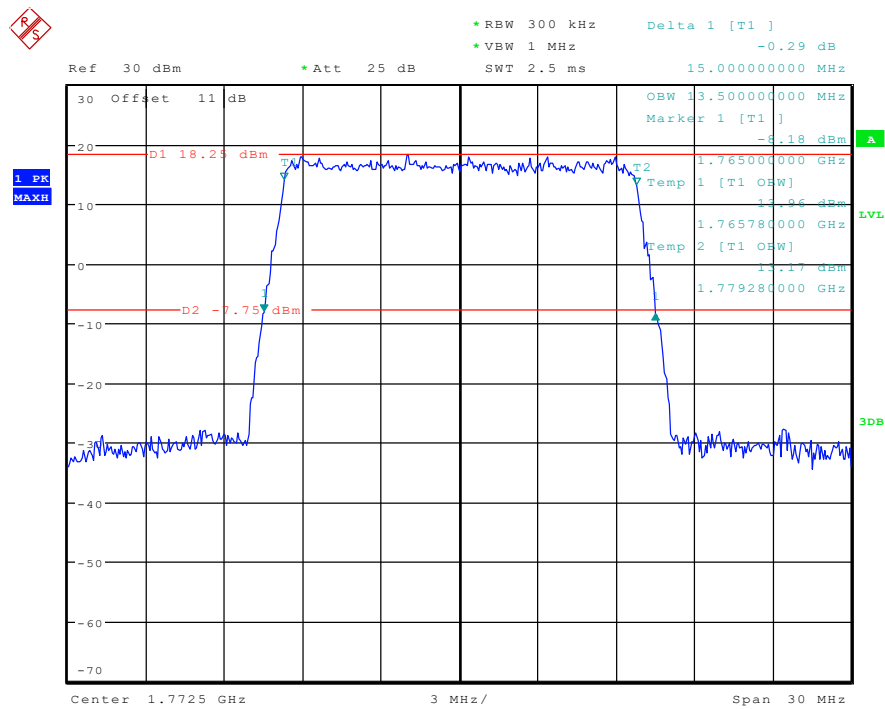


Date: 24.NOV.2022 11:34:19

Band 66_15 MHz_High_16QAM_RB75#0

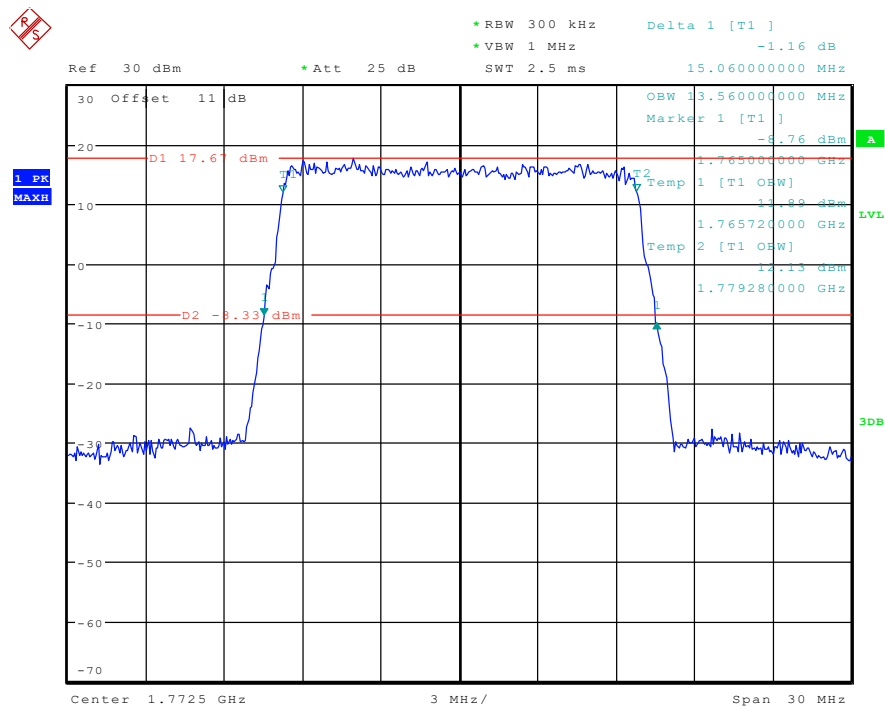


Date: 24.NOV.2022 11:34:41

Band 66_20 MHz_Low_QPSK_RB100#0

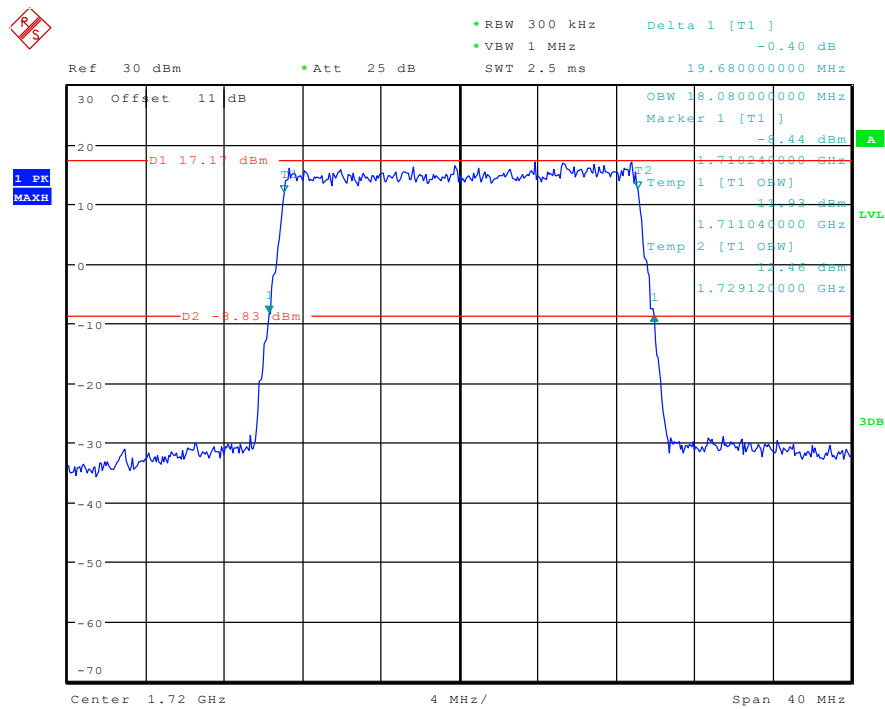


Date: 24.NOV.2022 11:35:06

Band 66_20 MHz_Low_16QAM_RB100#0

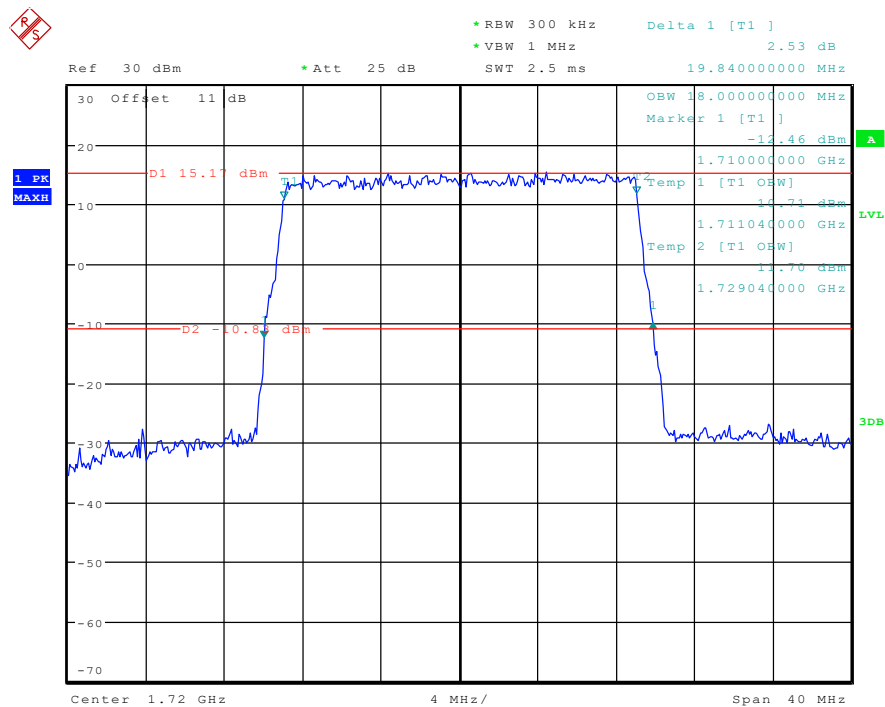


Date: 24.NOV.2022 11:35:28

Band 66_20 MHz_Middle_QPSK_RB100#0

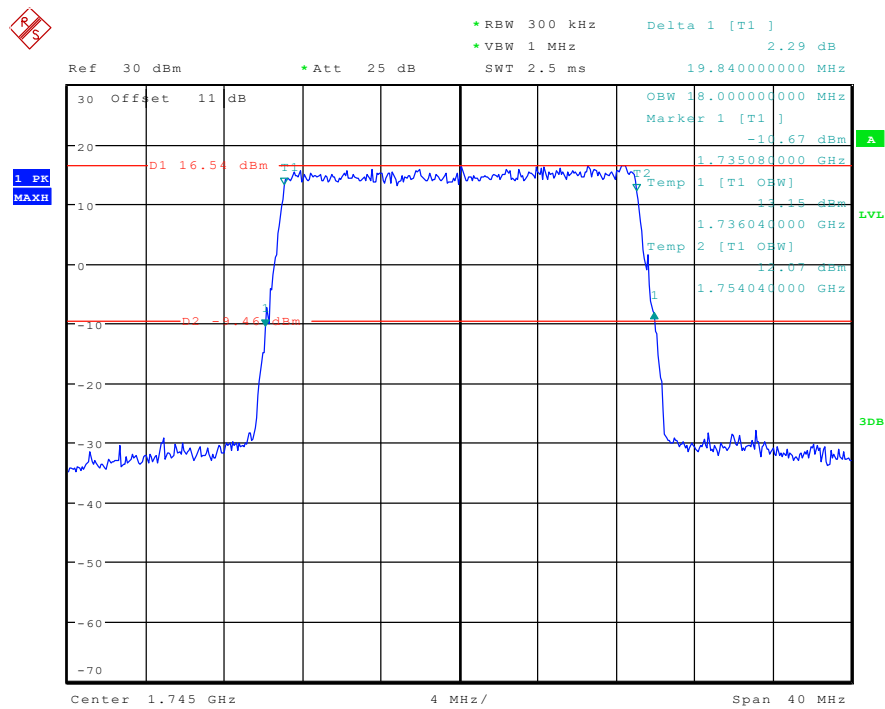


Date: 24.NOV.2022 11:35:51

Band 66_20 MHz_Middle_16QAM_RB100#0

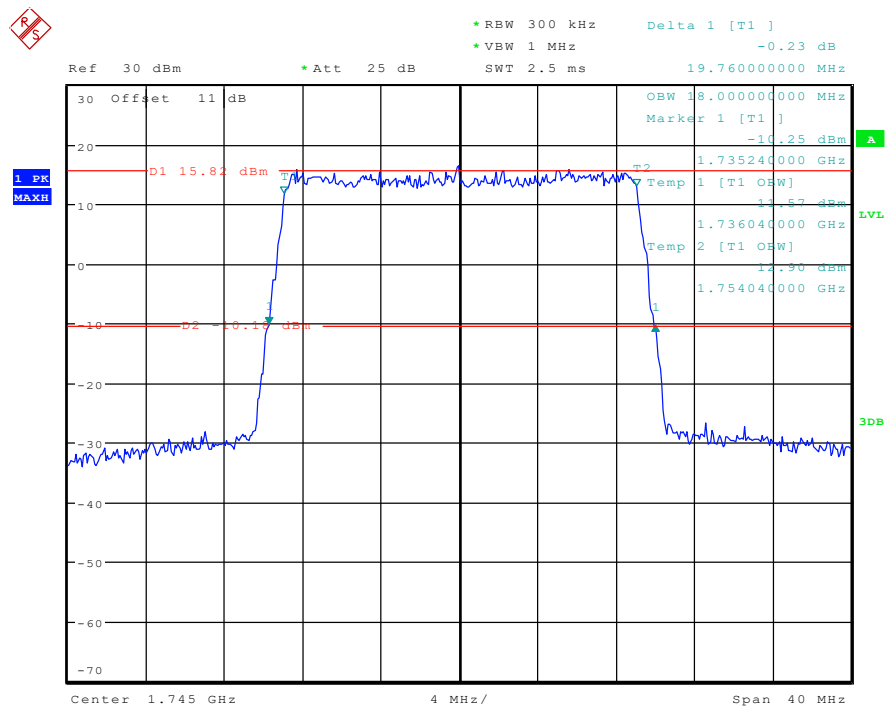


Date: 24.NOV.2022 11:36:14

Band 66_20 MHz_High_QPSK_RB100#0

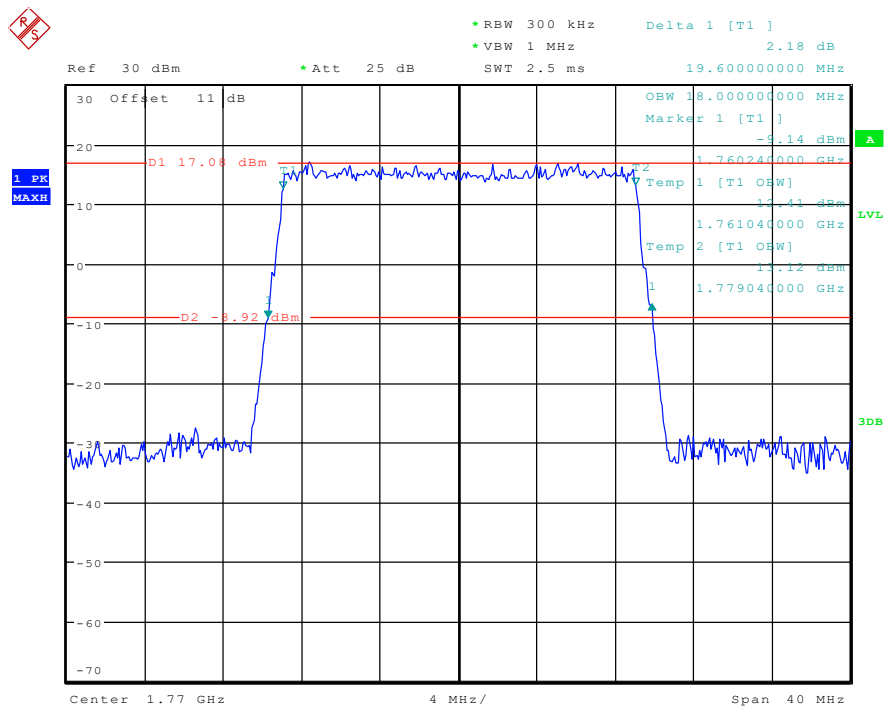


Date: 24.NOV.2022 11:36:37

Band 66_20 MHz_High_16QAM_RB100#0

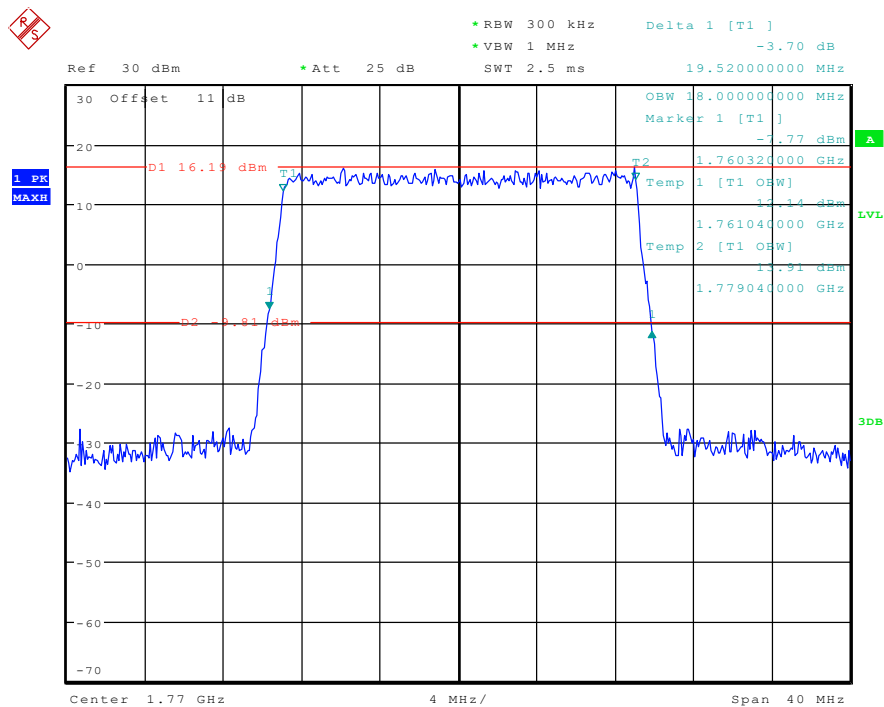


Date: 24.NOV.2022 11:36:56

Band 5_1.4 MHz_Low_QPSK_RB6#0

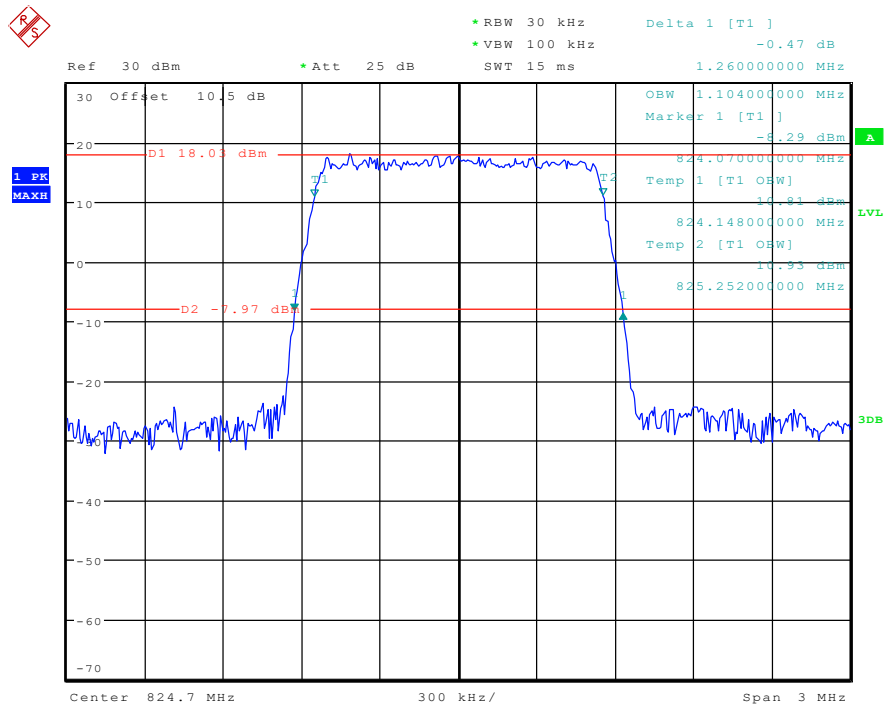


Date: 25.NOV.2022 08:41:38

Band 5_1.4 MHz_Low_16QAM_RB6#0

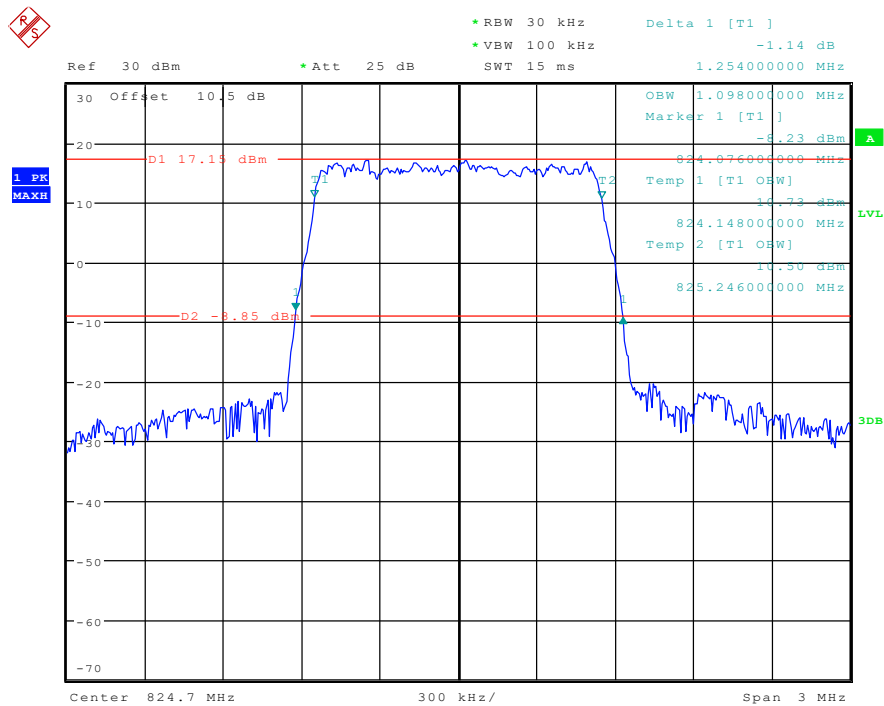


Date: 25.NOV.2022 08:41:57

Band 5_1.4 MHz_Middle_QPSK_RB6#0

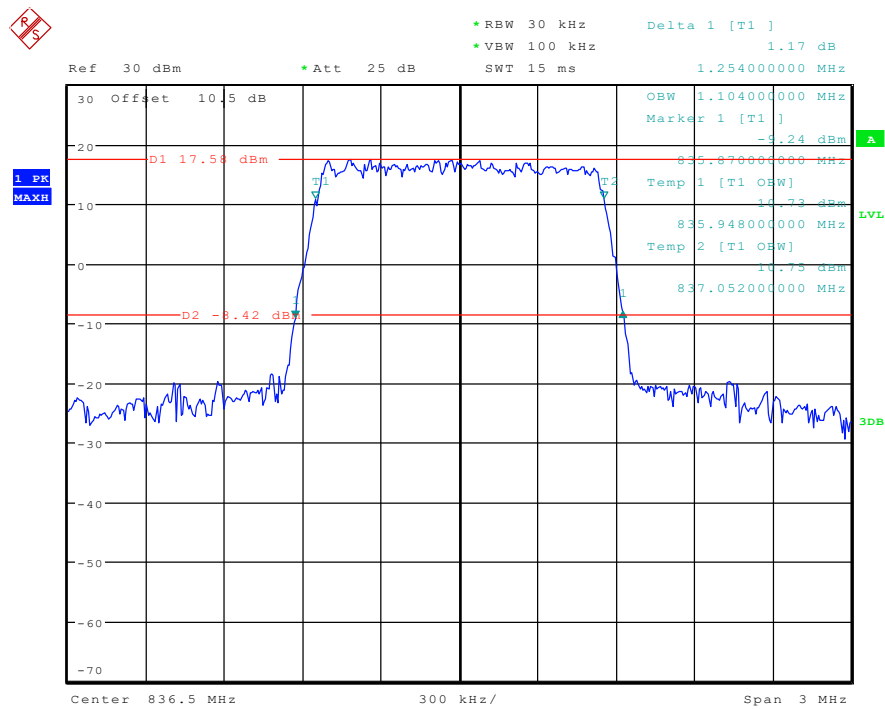


Date: 25.NOV.2022 08:43:04

Band 5_1.4 MHz_Middle_16QAM_RB6#0

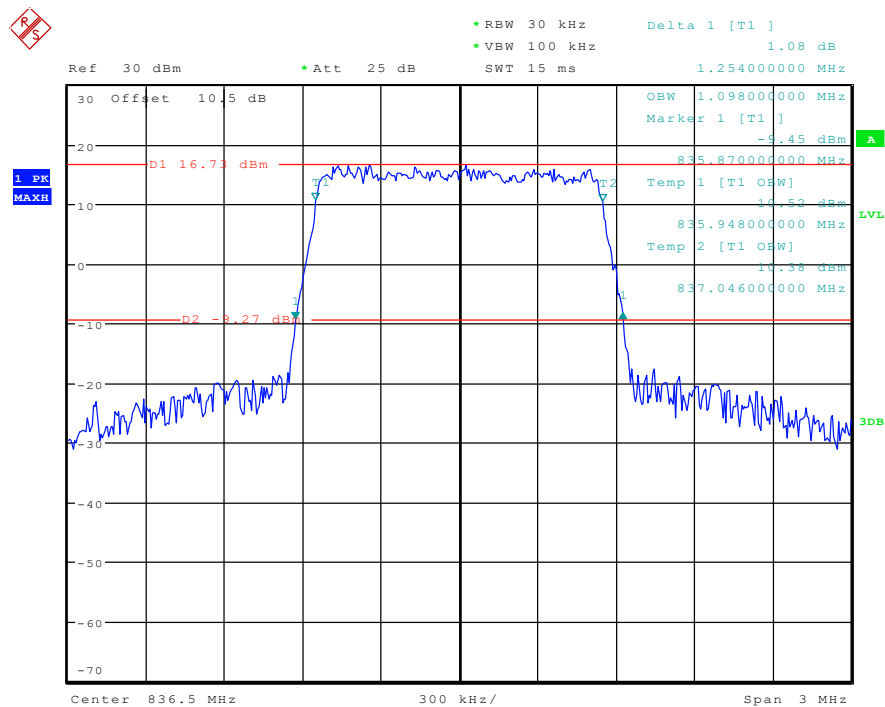


Date: 25.NOV.2022 08:43:22

Band 5_1.4 MHz_High_QPSK_RB6#0

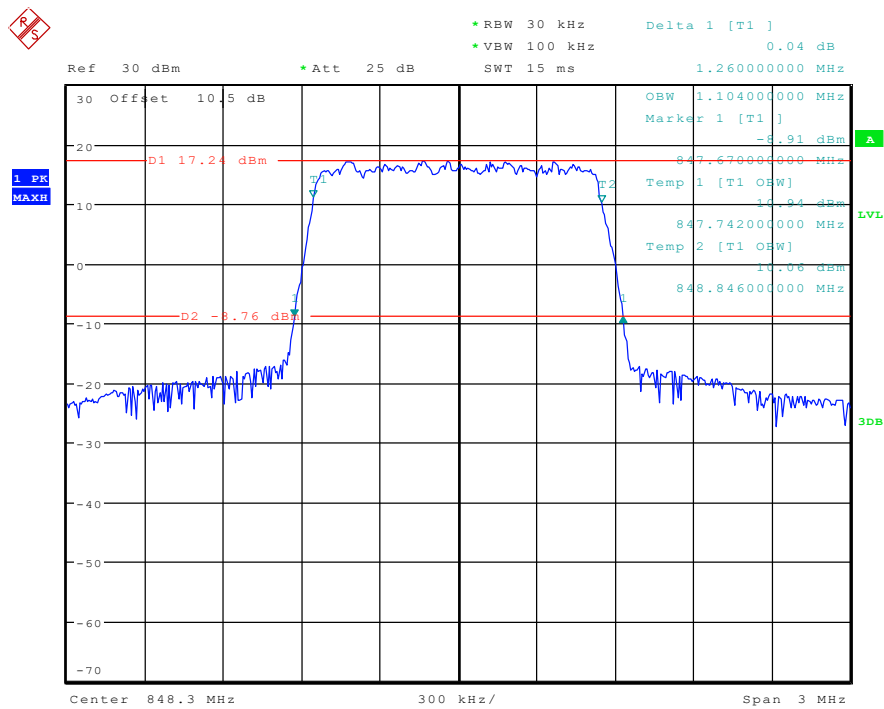


Date: 25.NOV.2022 08:44:53

Band 5_1.4 MHz_High_16QAM_RB6#0

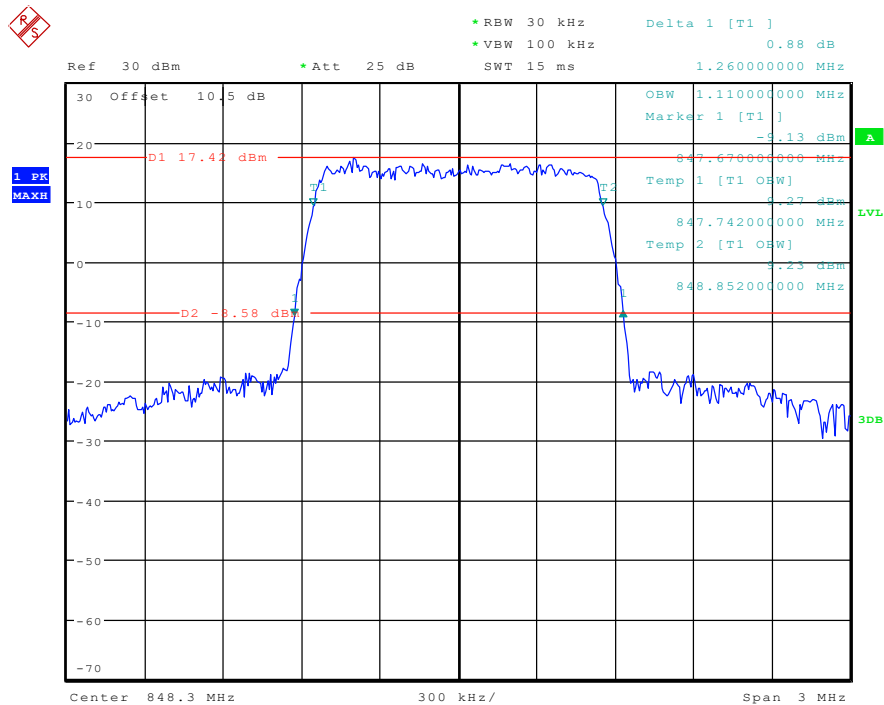


Date: 25.NOV.2022 08:45:14

Band 5_3 MHz_Low_QPSK_RB15#0

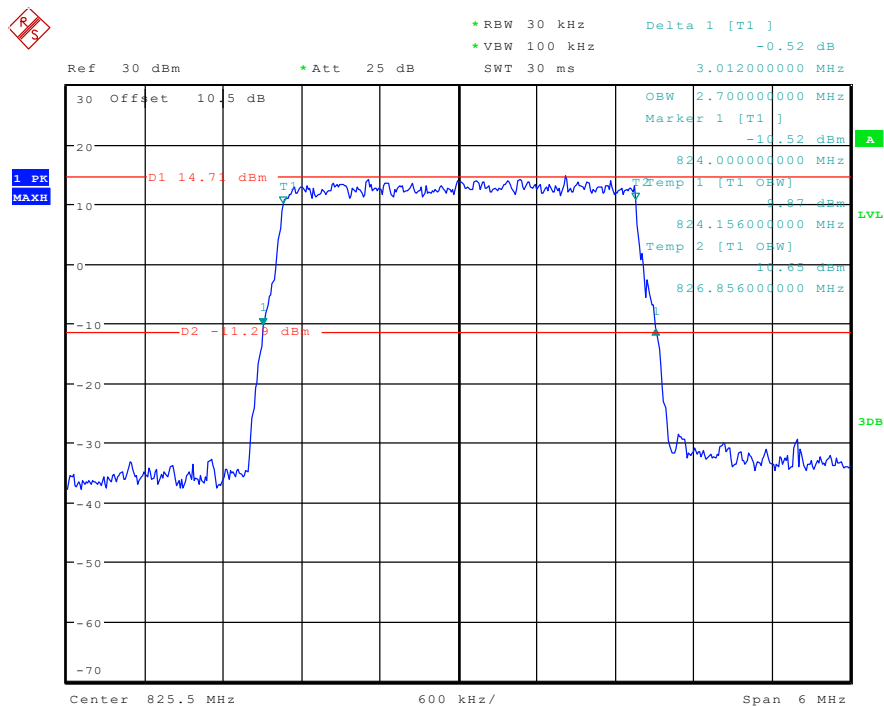


Date: 25.NOV.2022 08:45:35

Band 5_3 MHz_Low_16QAM_RB15#0

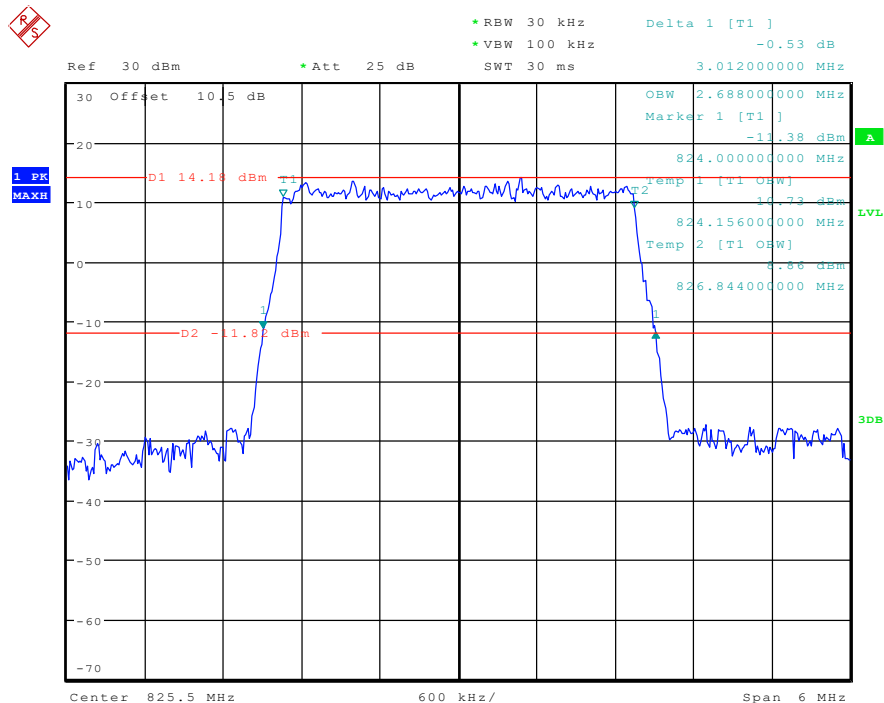


Date: 25.NOV.2022 08:45:53

Band 5_3 MHz_Middle_QPSK_RB15#0

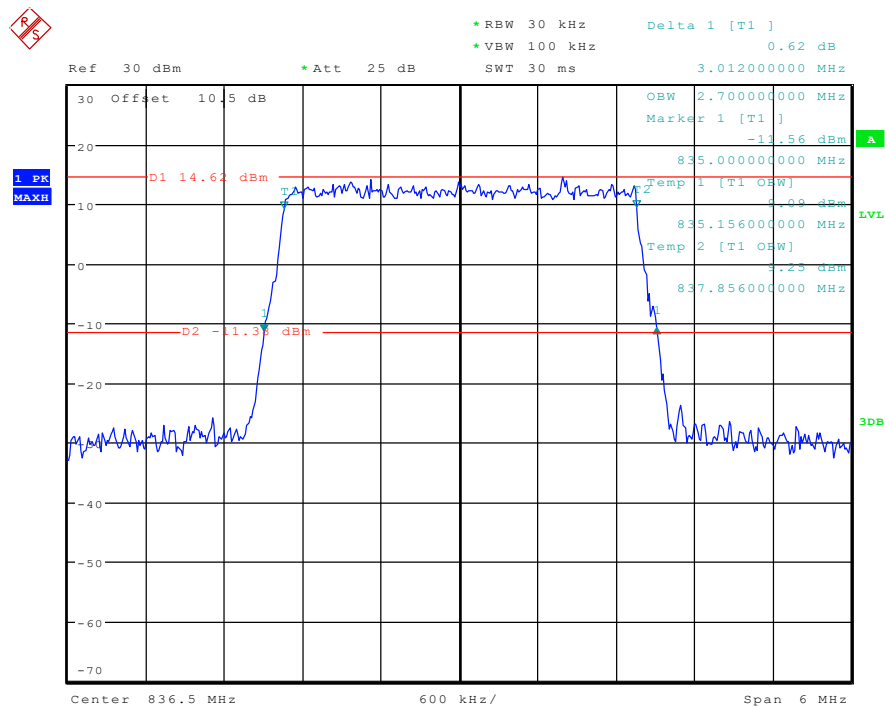


Date: 25.NOV.2022 08:47:30

Band 5_3 MHz_Middle_16QAM_RB15#0

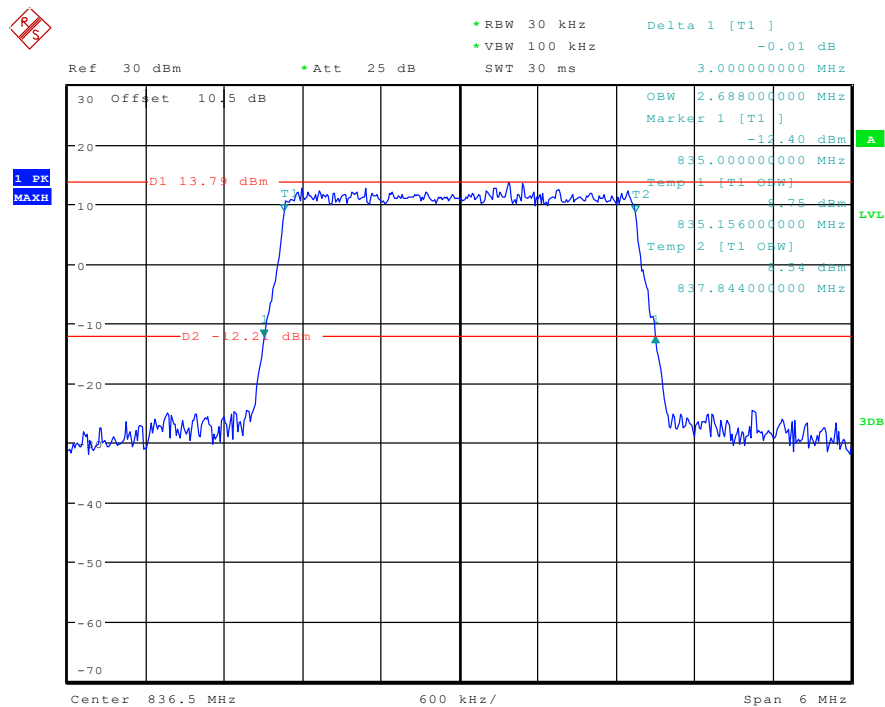


Date: 25.NOV.2022 08:47:48

Band 5_3 MHz_High_QPSK_RB15#0

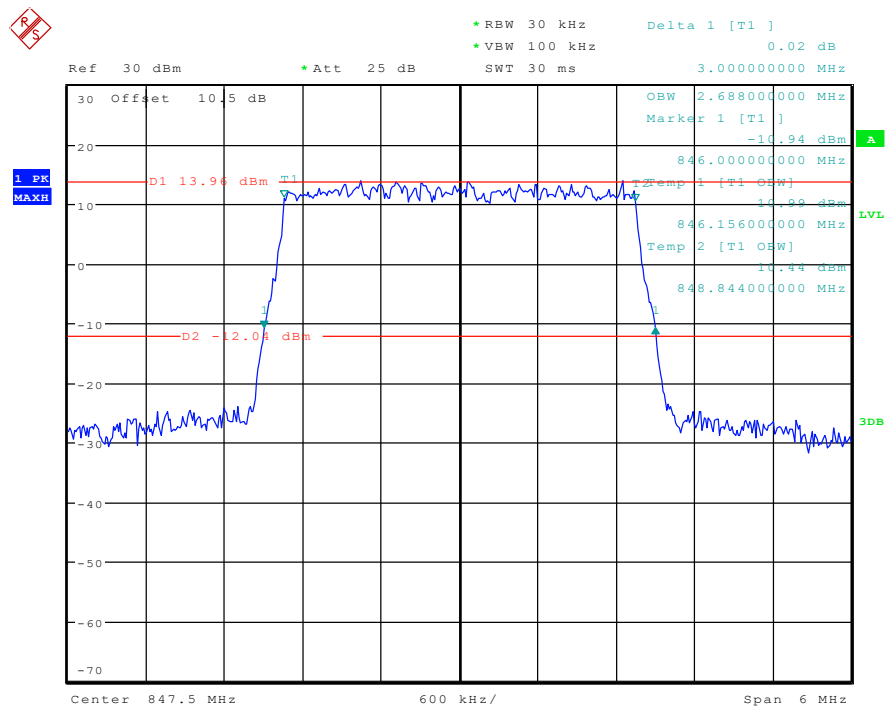


Date: 25.NOV.2022 08:48:03

Band 5_3 MHz_High_16QAM_RB15#0

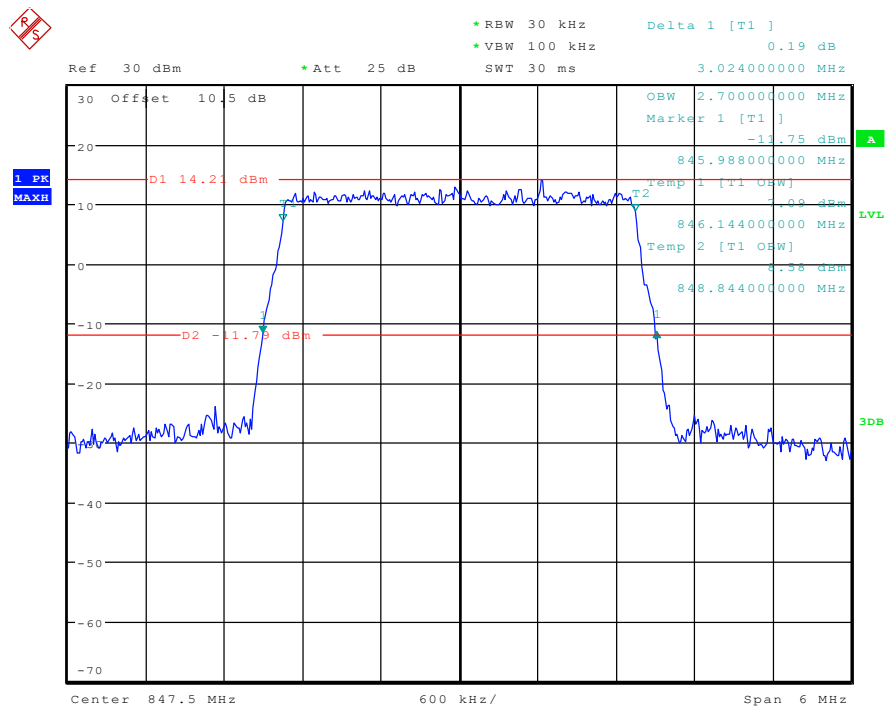


Date: 25.NOV.2022 08:48:21

Band 5_5 MHz_Low_QPSK_RB25#0

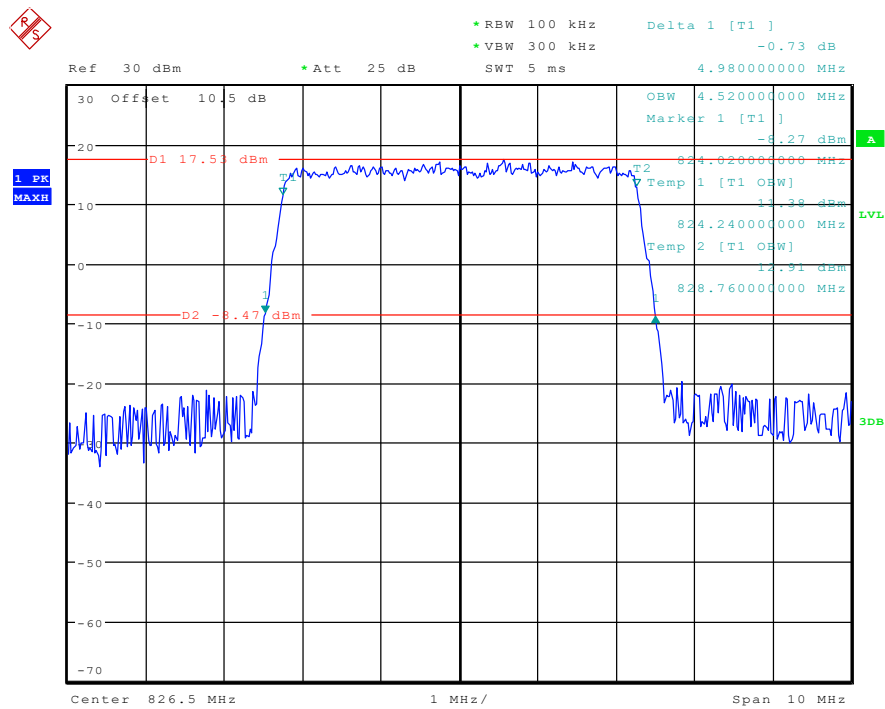


Date: 25.NOV.2022 08:48:49

Band 5_5 MHz_Low_16QAM_RB25#0

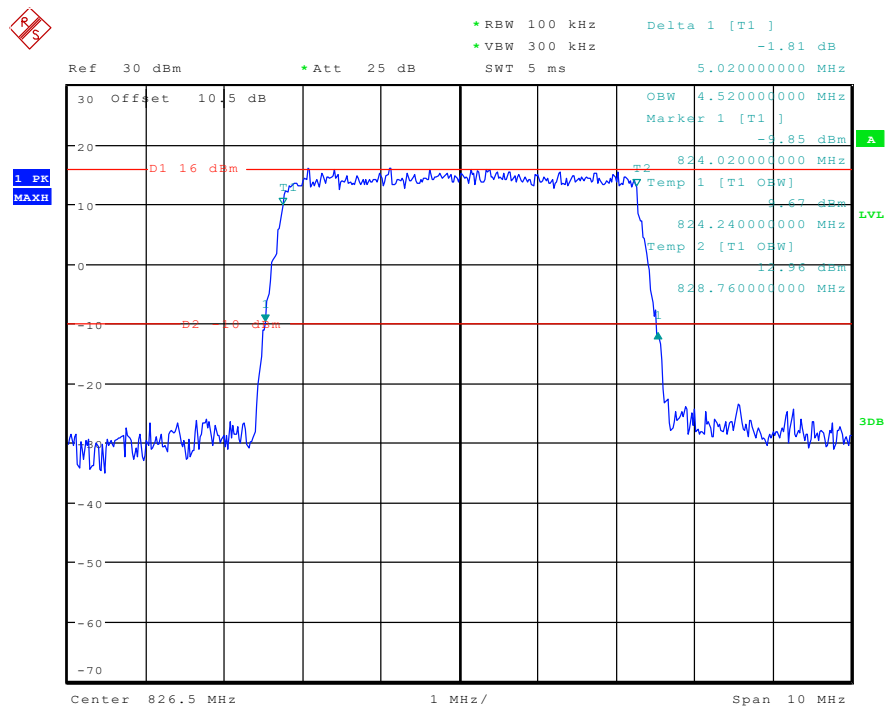


Date: 25.NOV.2022 08:49:08

Band 5_5 MHz_Middle_QPSK_RB25#0

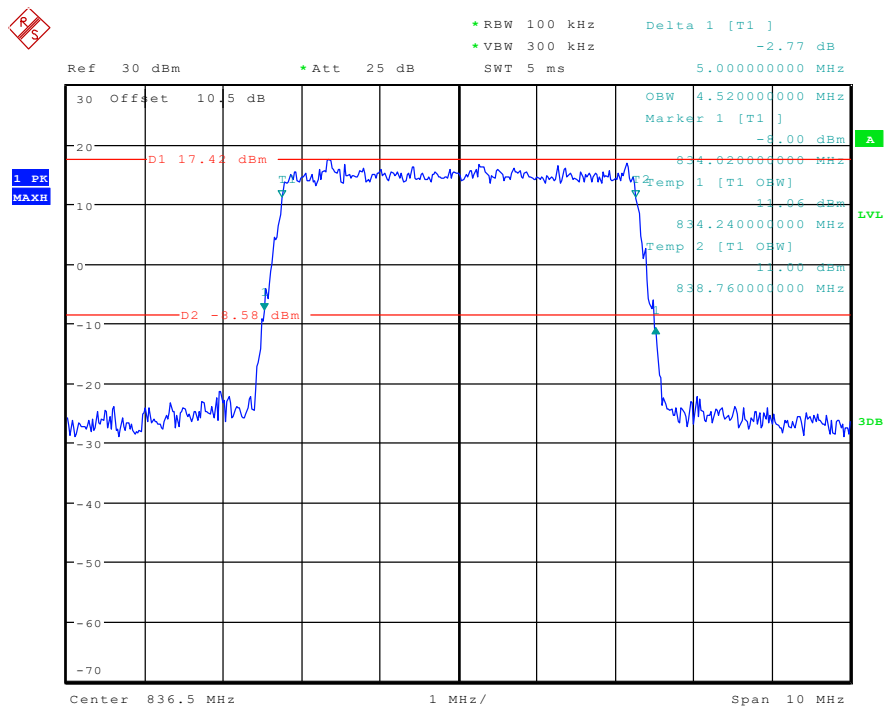


Date: 25.NOV.2022 08:49:30

Band 5_5 MHz_Middle_16QAM_RB25#0

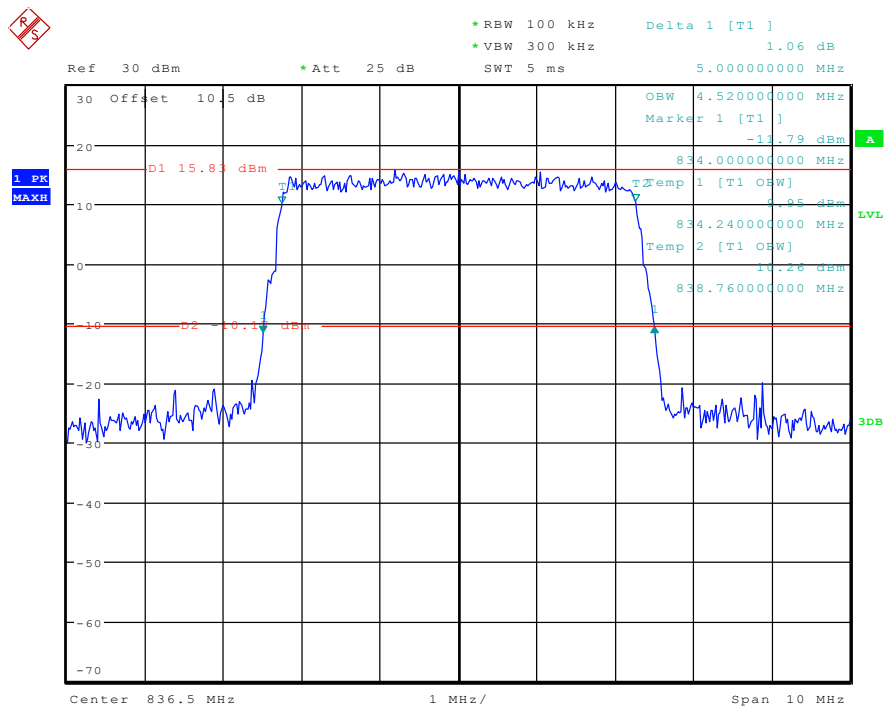


Date: 25.NOV.2022 08:49:49

Band 5_5 MHz_High_QPSK_RB25#0

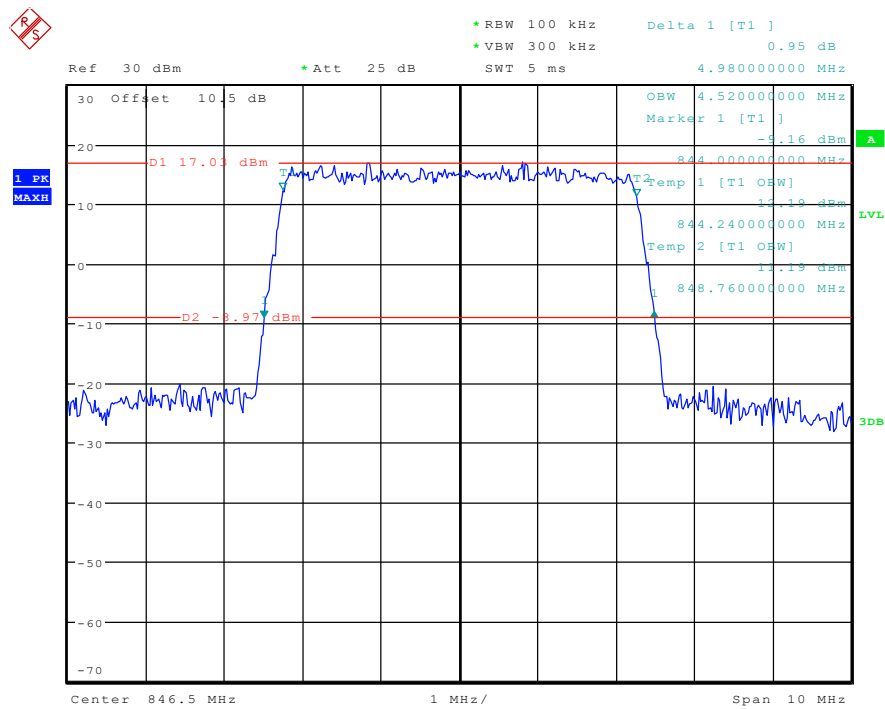


Date: 25.NOV.2022 08:50:12

Band 5_5 MHz_High_16QAM_RB25#0

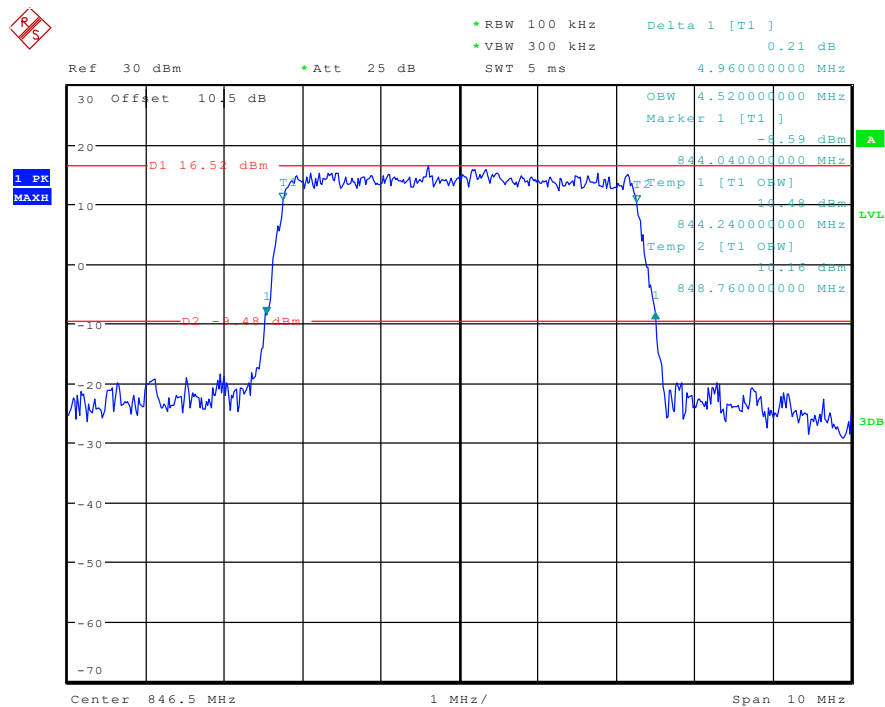


Date: 25.NOV.2022 08:50:33

Band 5_10 MHz_Low_QPSK_RB50#0

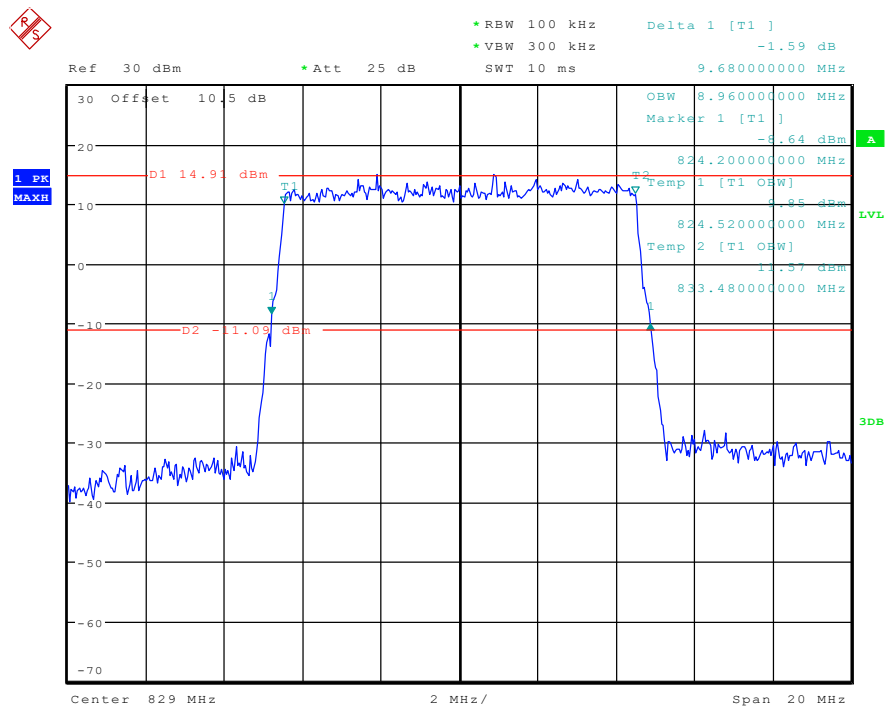


Date: 25.NOV.2022 08:50:55

Band 5_10 MHz_Low_16QAM_RB50#0

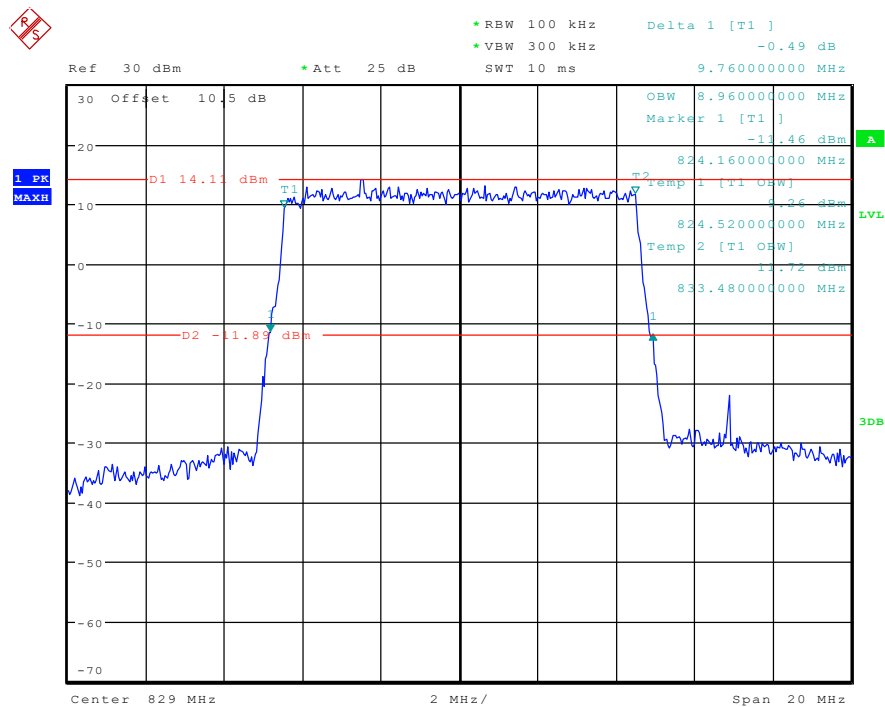


Date: 25.NOV.2022 08:51:18

Band 5_10 MHz_Middle_QPSK_RB50#0

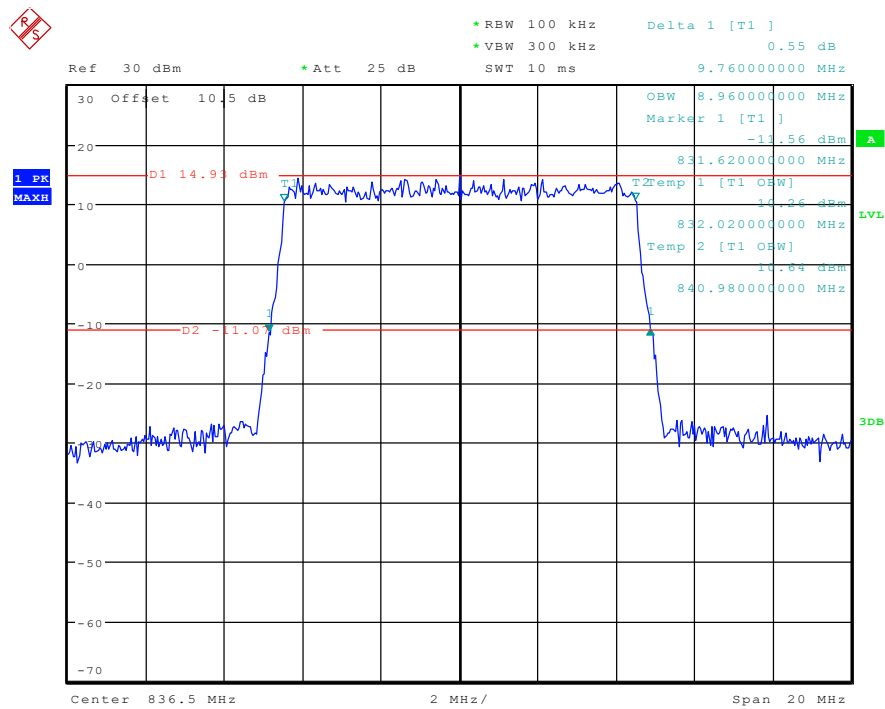


Date: 25.NOV.2022 08:51:38

Band 5_10 MHz_Middle_16QAM_RB50#0

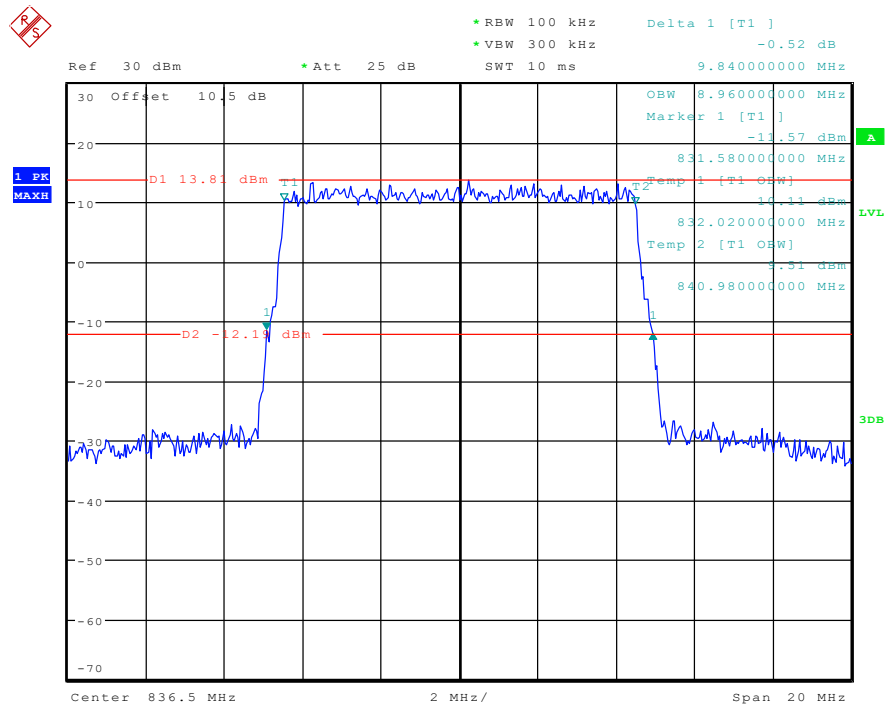


Date: 25.NOV.2022 08:51:57

Band 5_10 MHz_High_QPSK_RB50#0

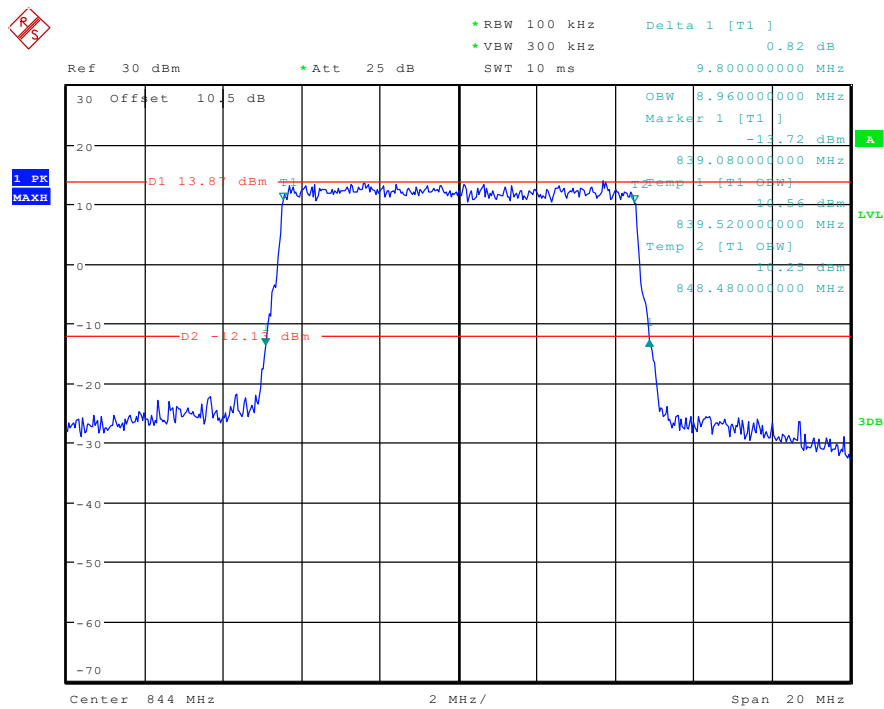


Date: 25.NOV.2022 08:52:17

Band 5_10 MHz_High_16QAM_RB50#0

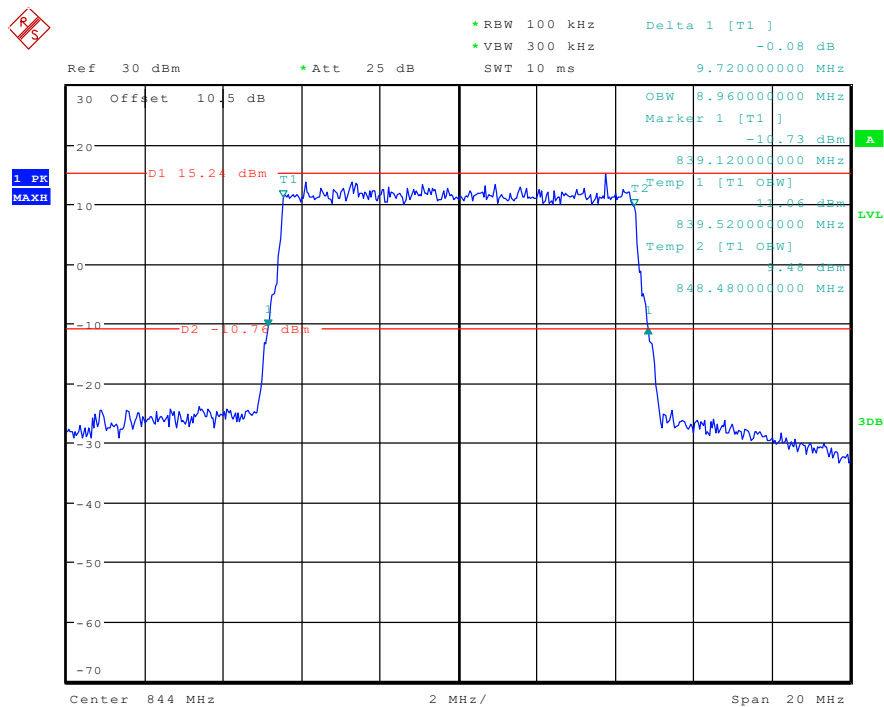


Date: 25.NOV.2022 08:52:39

Band 12_1.4 MHz_Low_QPSK_RB6#0

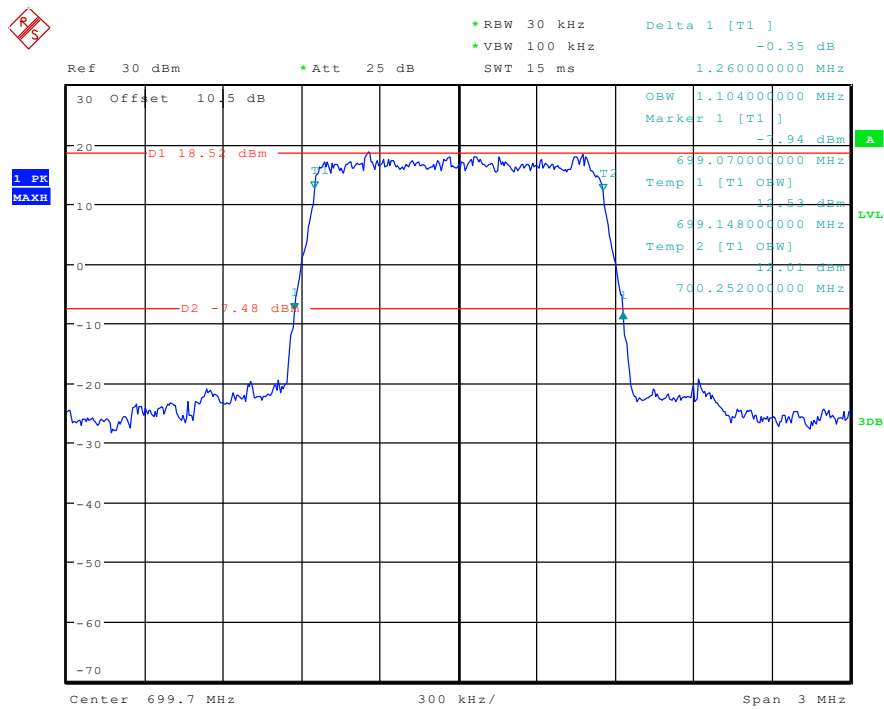


Date: 25.NOV.2022 08:56:38

Band 12_1.4 MHz_Low_16QAM_RB6#0

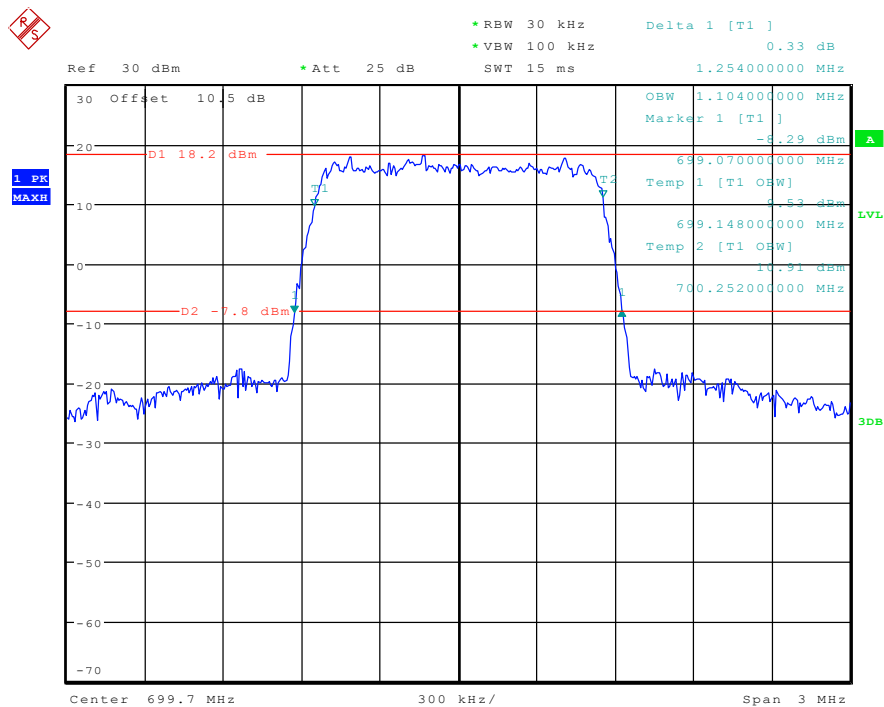


Date: 25.NOV.2022 08:57:00

Band 12_1.4 MHz_Middle_QPSK_RB6#0

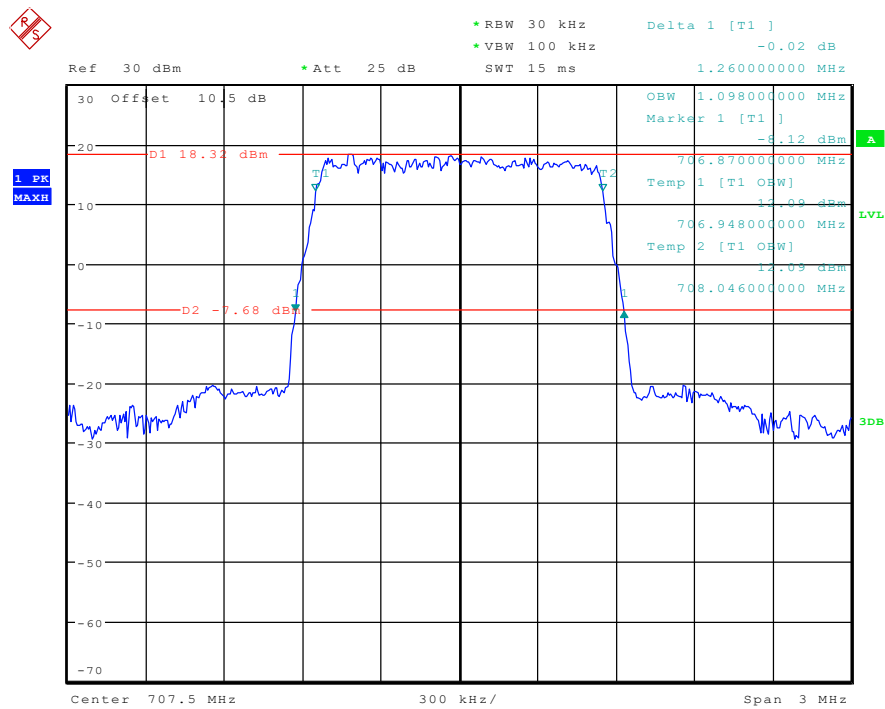


Date: 25.NOV.2022 08:58:46

Band 12_1.4 MHz_Middle_16QAM_RB6#0

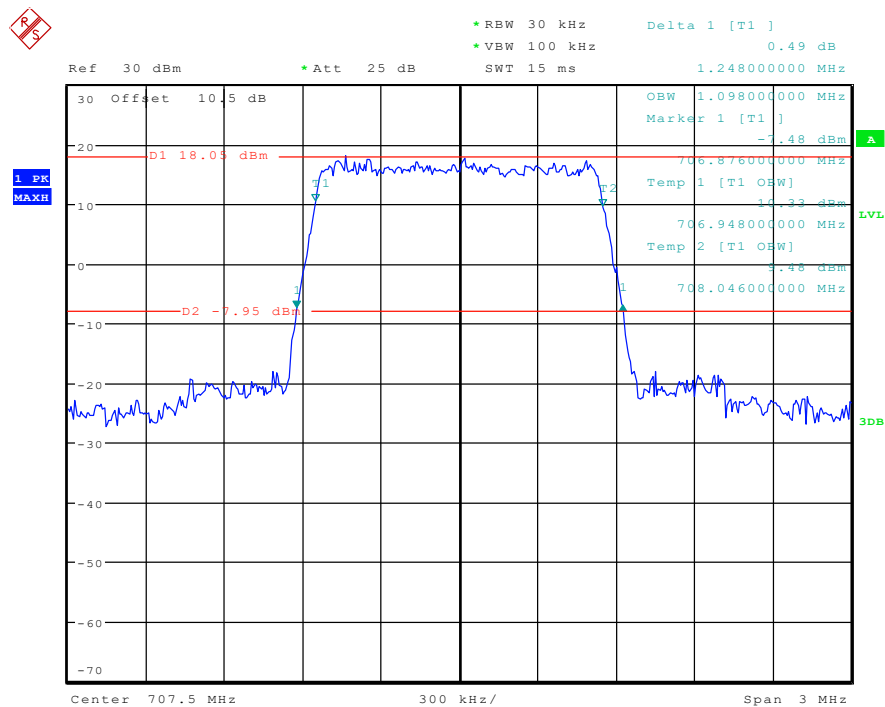


Date: 25.NOV.2022 08:59:04

Band 12_1.4 MHz_High_QPSK_RB6#0

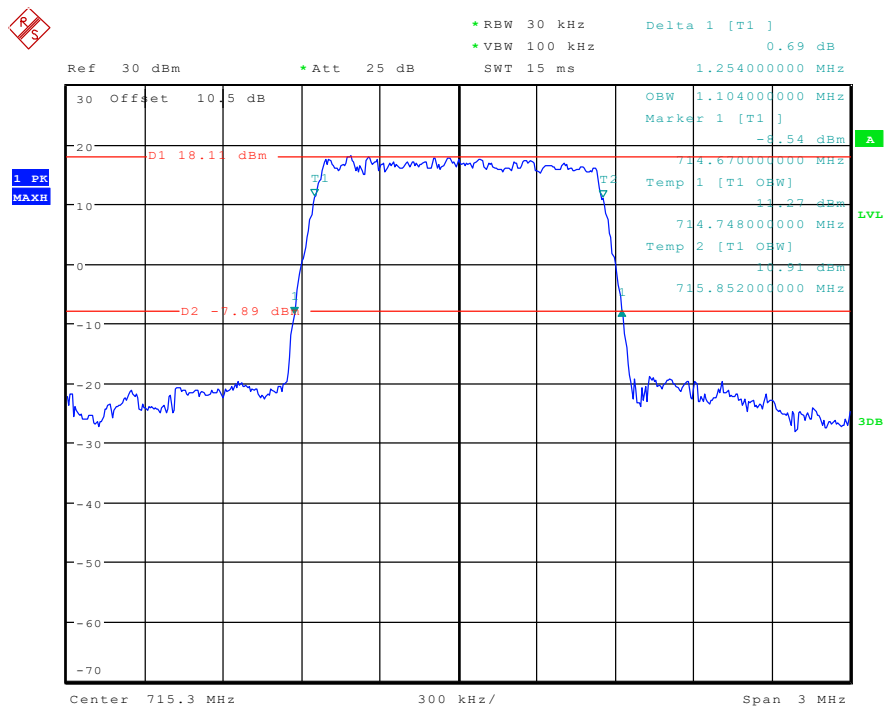


Date: 25.NOV.2022 09:00:38

Band 12_1.4 MHz_High_16QAM_RB6#0

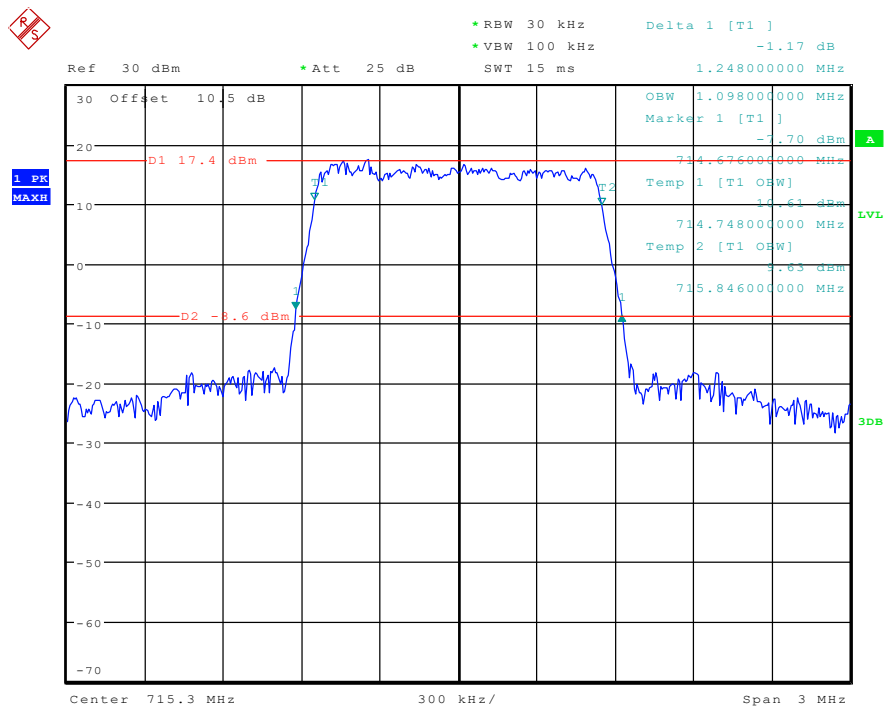


Date: 25.NOV.2022 09:00:53

Band 12_3 MHz_Low_QPSK_RB15#0

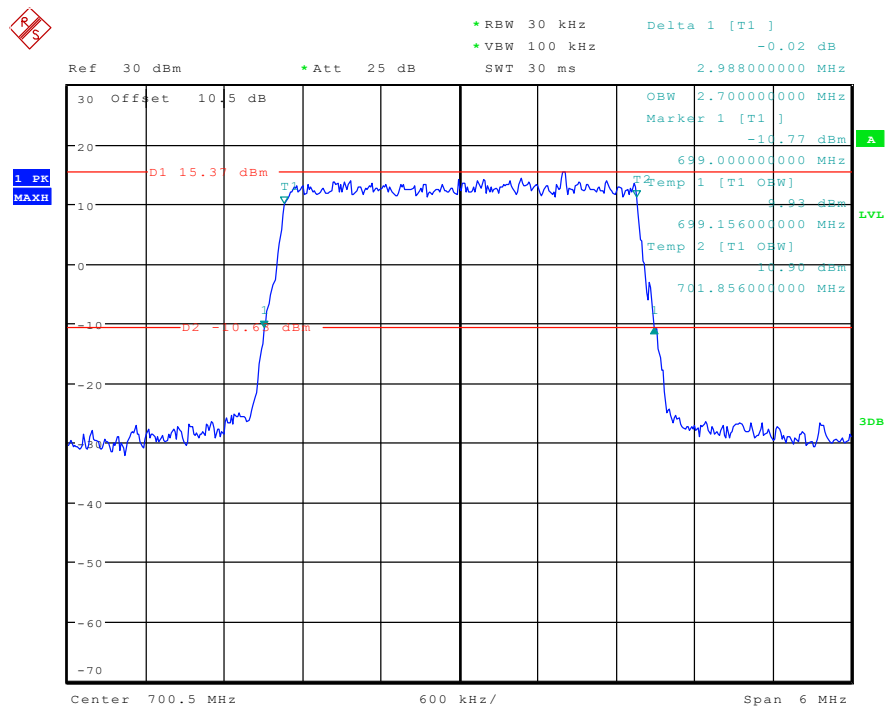


Date: 25.NOV.2022 09:01:14

Band 12_3 MHz_Low_16QAM_RB15#0

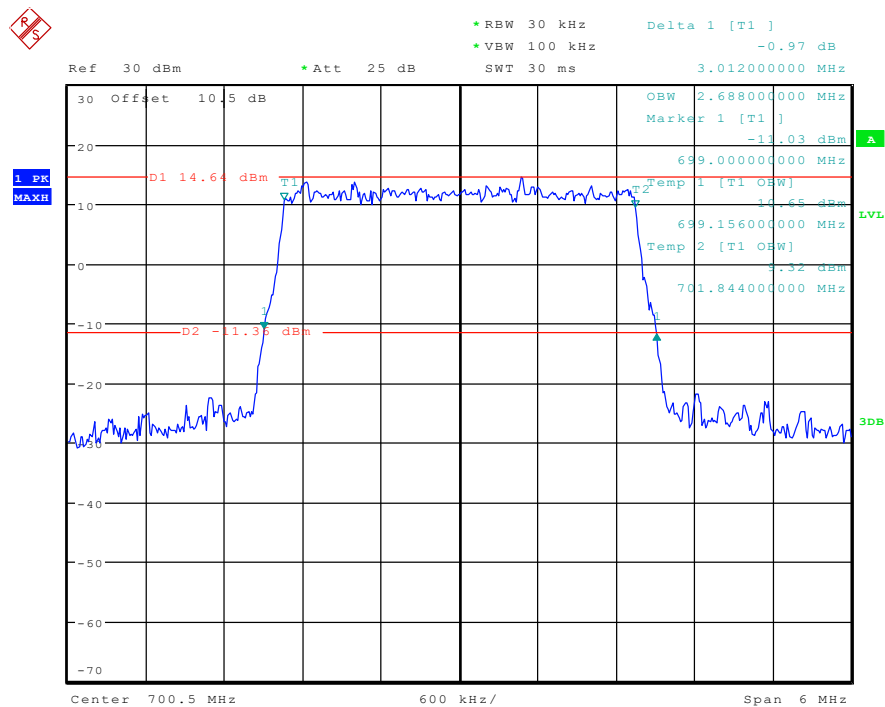


Date: 25.NOV.2022 09:01:32

Band 12_3 MHz_Middle_QPSK_RB15#0

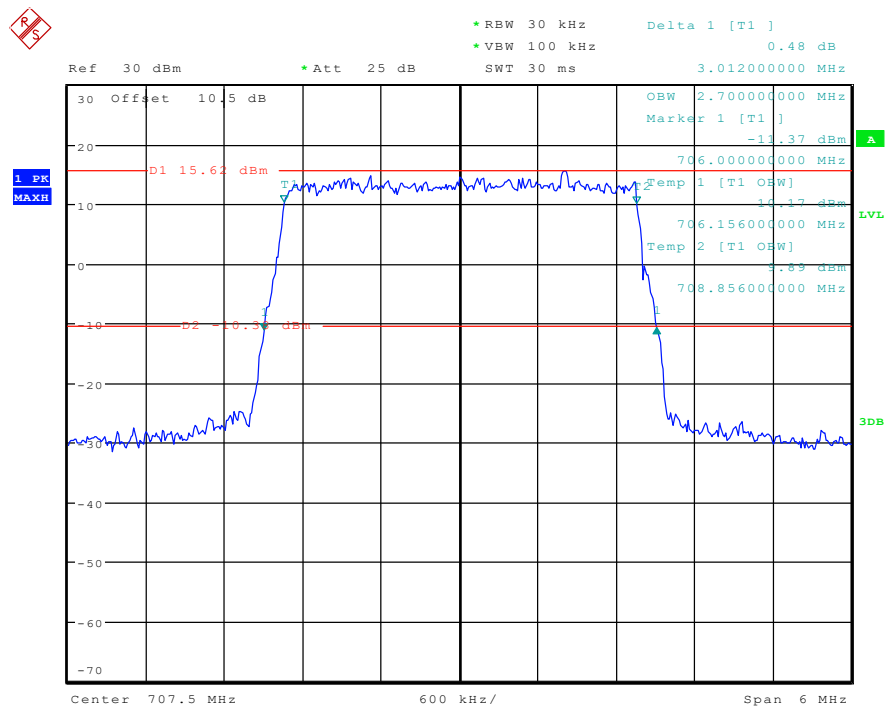


Date: 25.NOV.2022 09:03:12

Band 12_3 MHz_Middle_16QAM_RB15#0

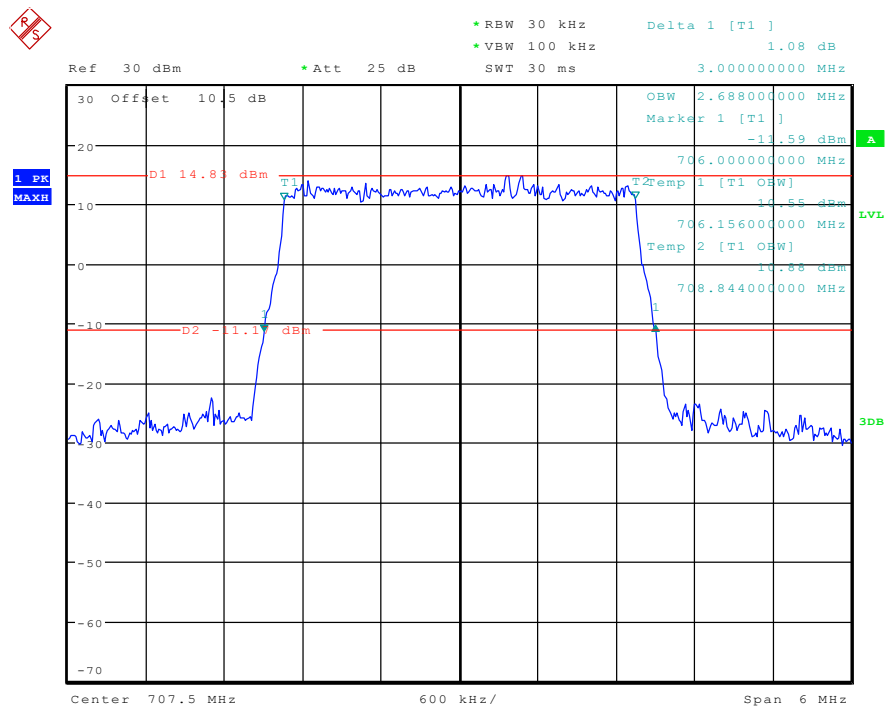


Date: 25.NOV.2022 09:03:30

Band 12_3 MHz_High_QPSK_RB15#0

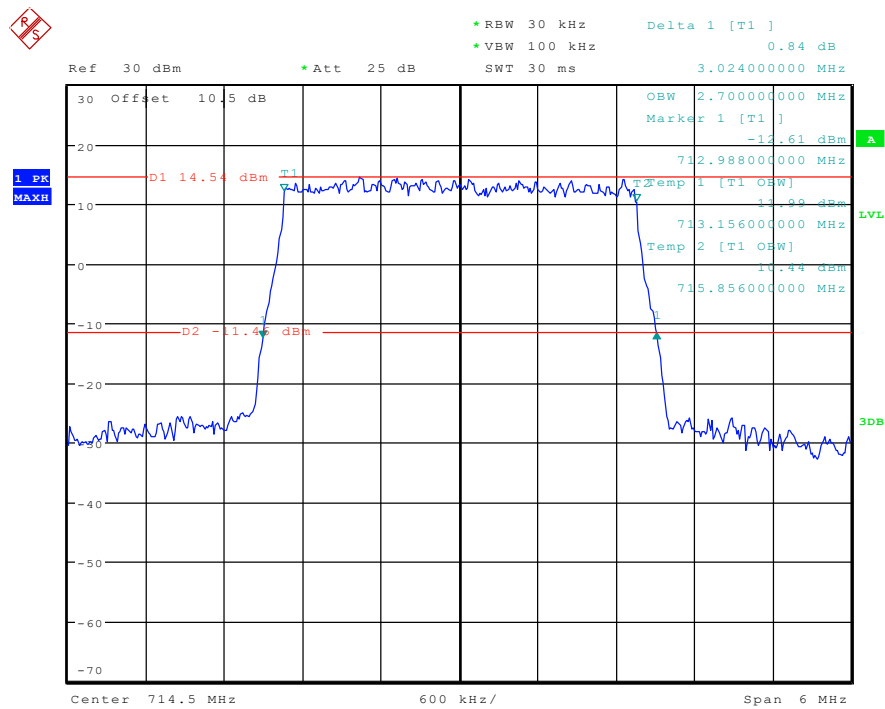


Date: 25.NOV.2022 09:03:49

Band 12_3 MHz_High_16QAM_RB15#0

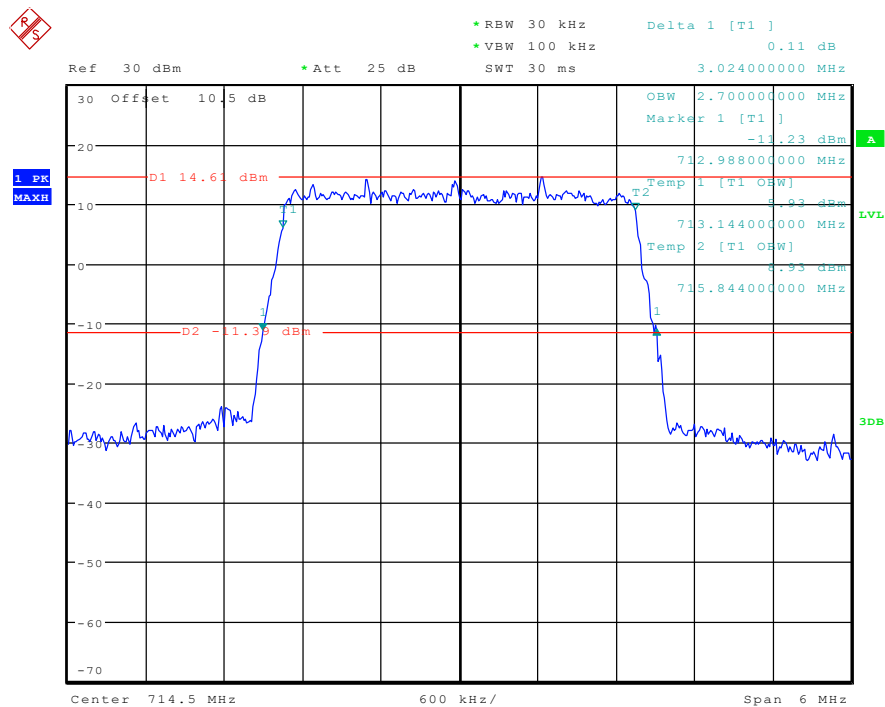


Date: 25.NOV.2022 09:04:04

Band 12_5 MHz_Low_QPSK_RB25#0

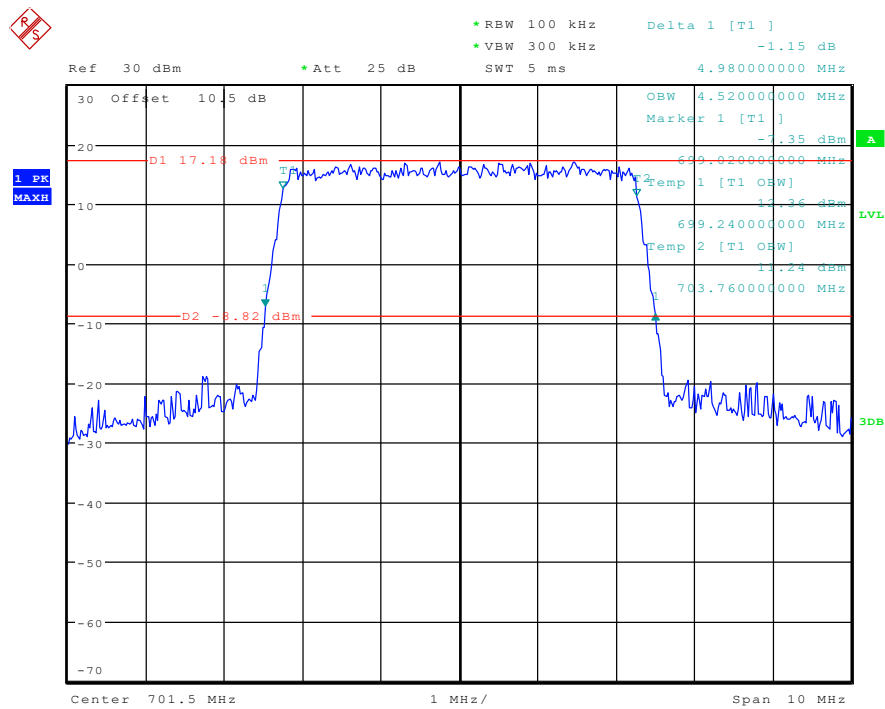


Date: 25.NOV.2022 09:04:28

Band 12_5 MHz_Low_16QAM_RB25#0

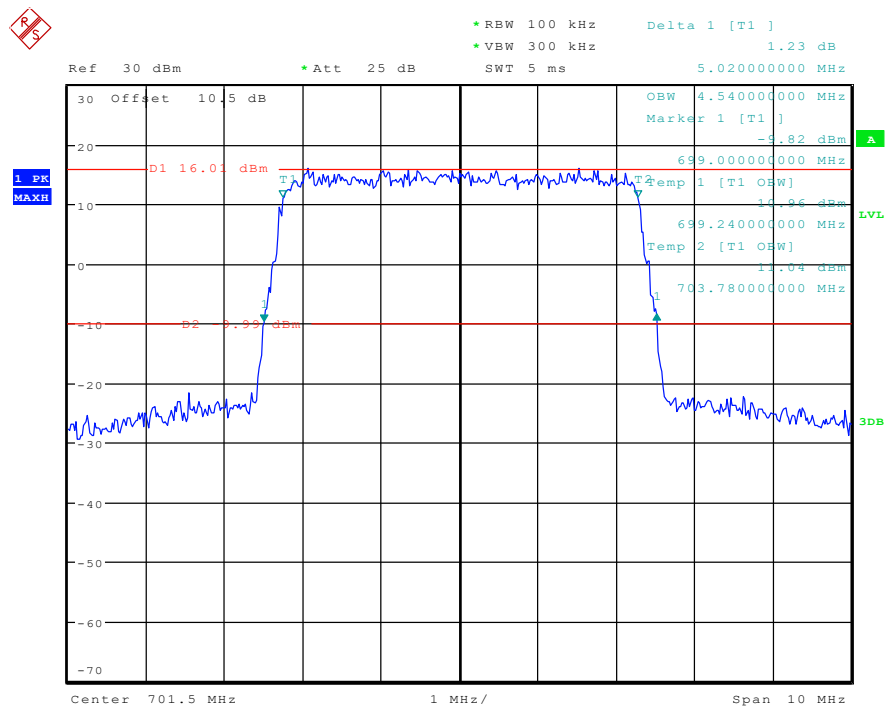


Date: 25.NOV.2022 09:04:47

Band 12_5 MHz_Middle_QPSK_RB25#0

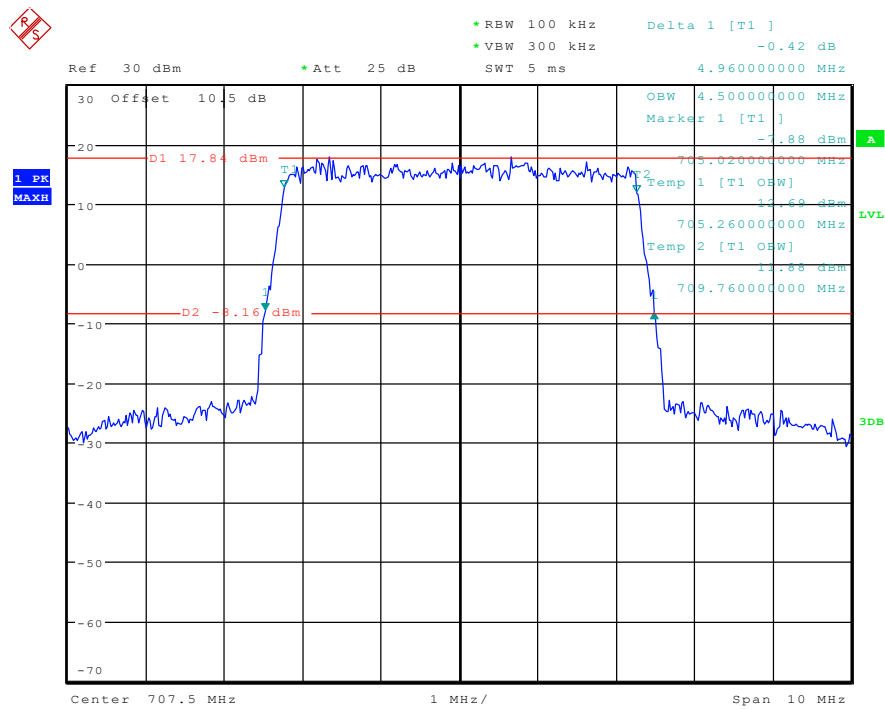


Date: 25.NOV.2022 09:05:03

Band 12_5 MHz_Middle_16QAM_RB25#0

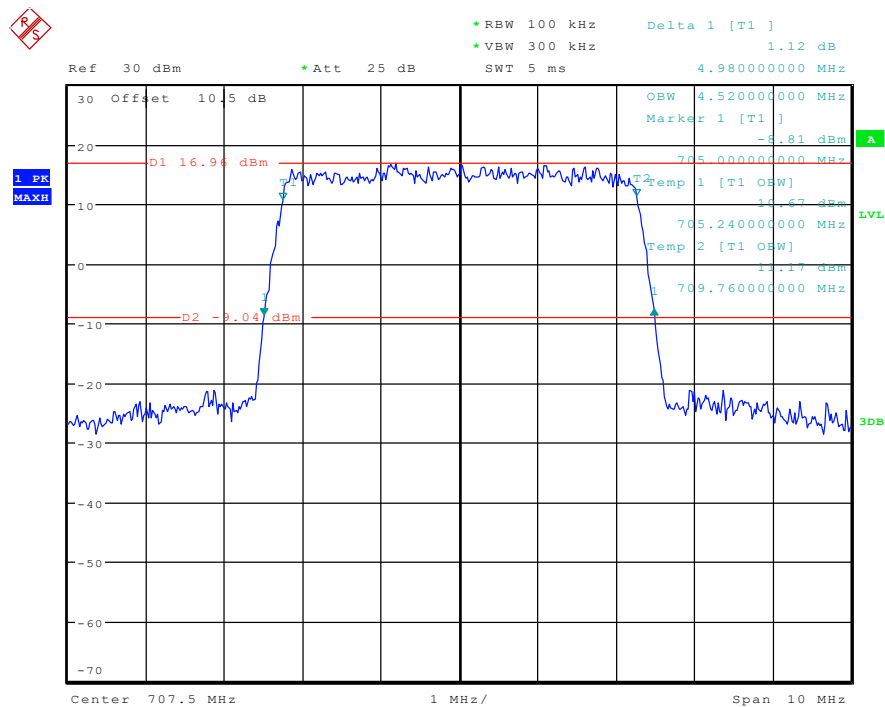


Date: 25.NOV.2022 09:05:22

Band 12_5 MHz_High_QPSK_RB25#0

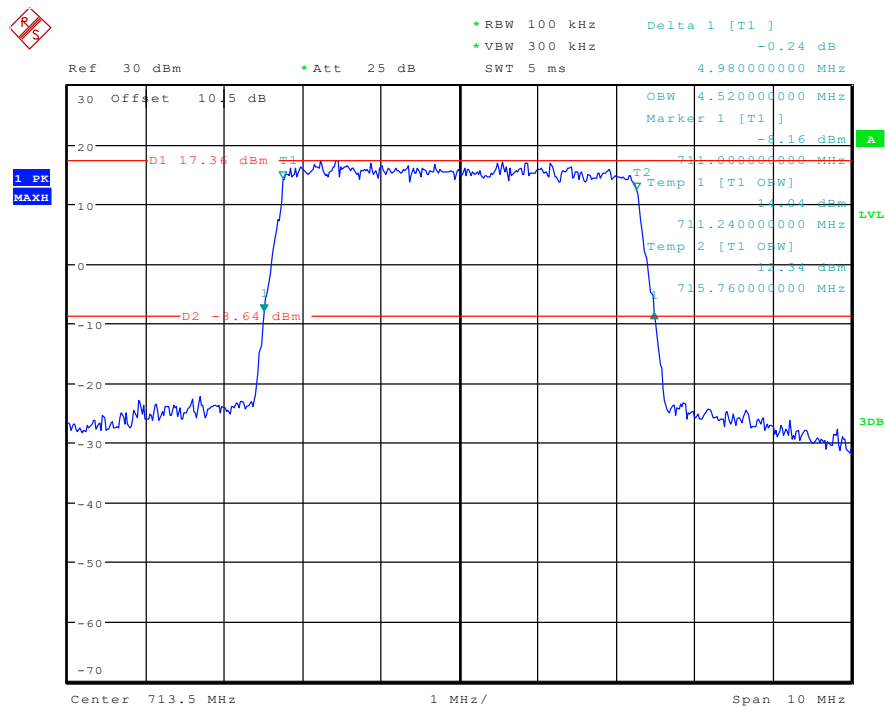


Date: 25.NOV.2022 09:05:41

Band 12_5 MHz_High_16QAM_RB25#0

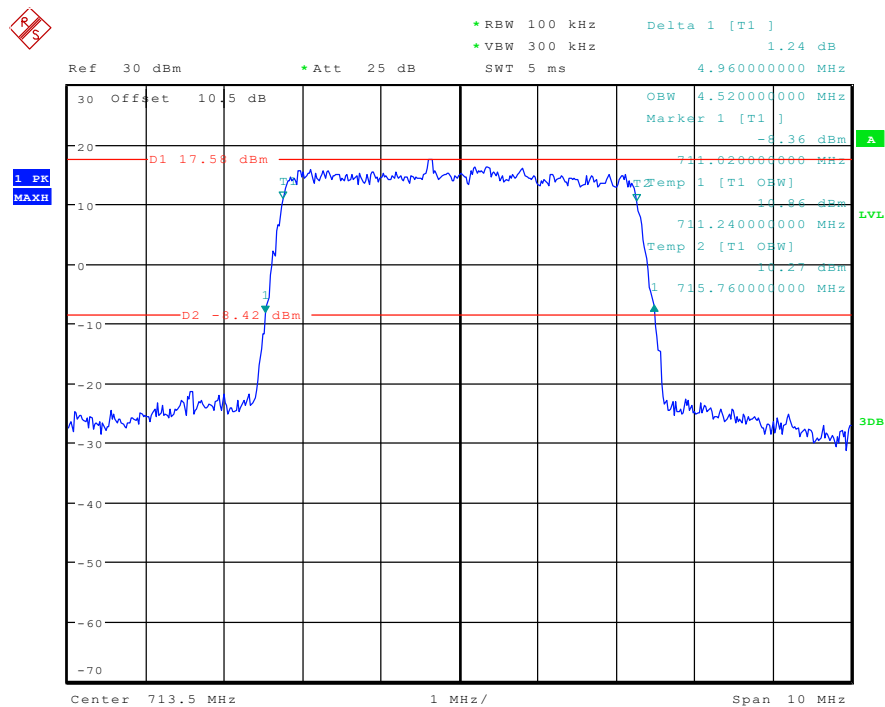


Date: 25.NOV.2022 09:06:00

Band 12_10 MHz_Low_QPSK_RB50#0

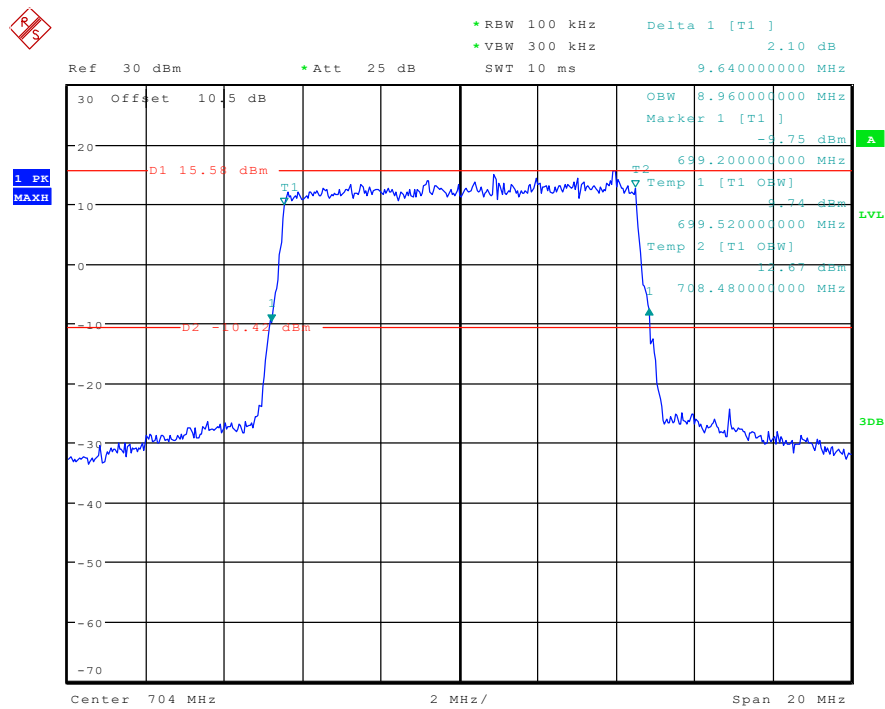


Date: 25.NOV.2022 09:06:21

Band 12_10 MHz_Low_16QAM_RB50#0

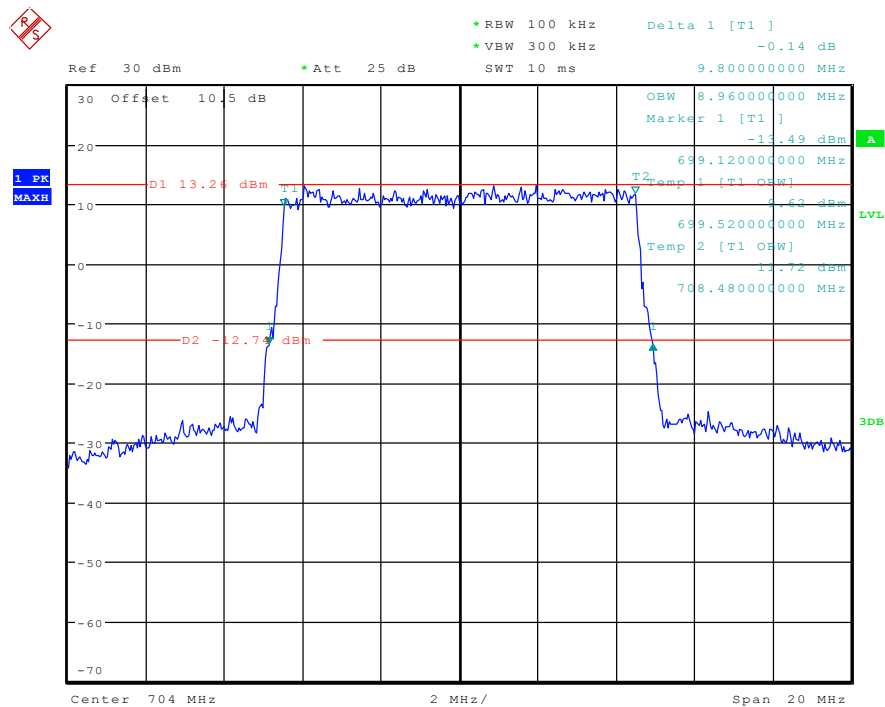


Date: 25.NOV.2022 09:06:37

Band 12_10 MHz_Middle_QPSK_RB50#0

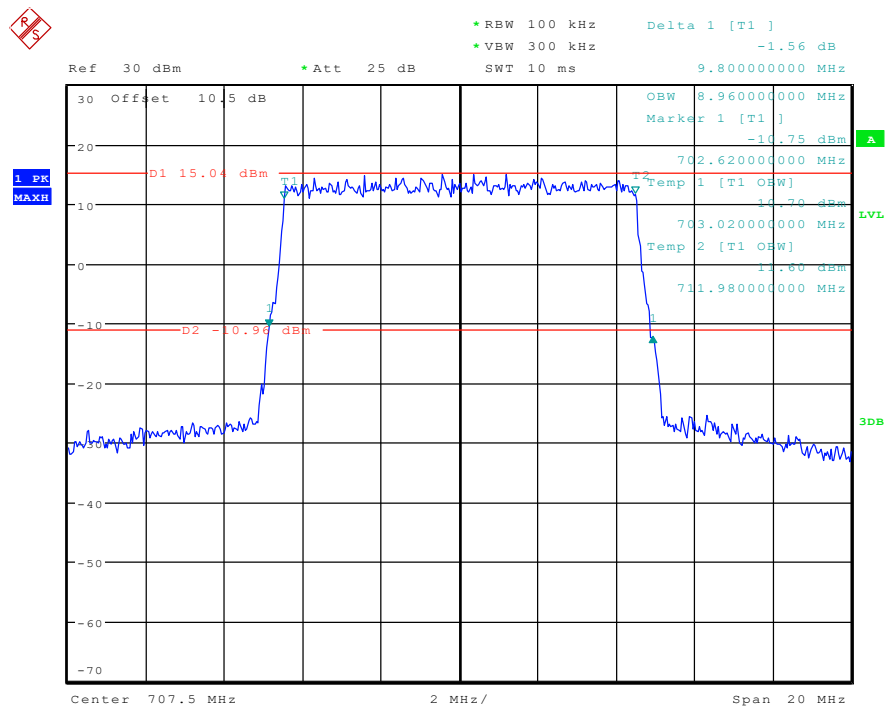


Date: 25.NOV.2022 09:06:57

Band 12_10 MHz_Middle_16QAM_RB50#0

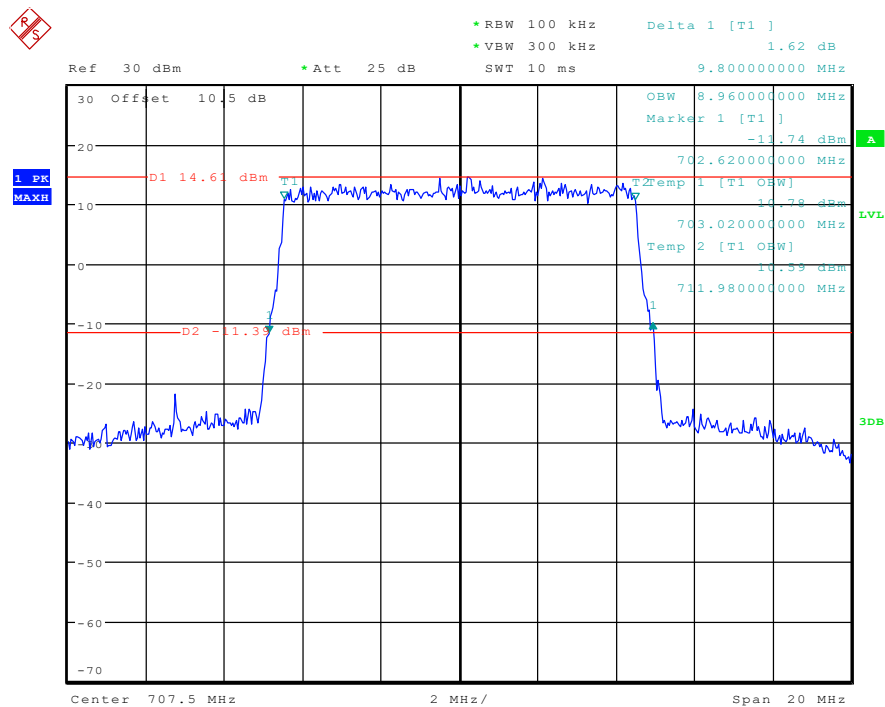


Date: 25.NOV.2022 09:07:16

Band 12_10 MHz_High_QPSK_RB50#0

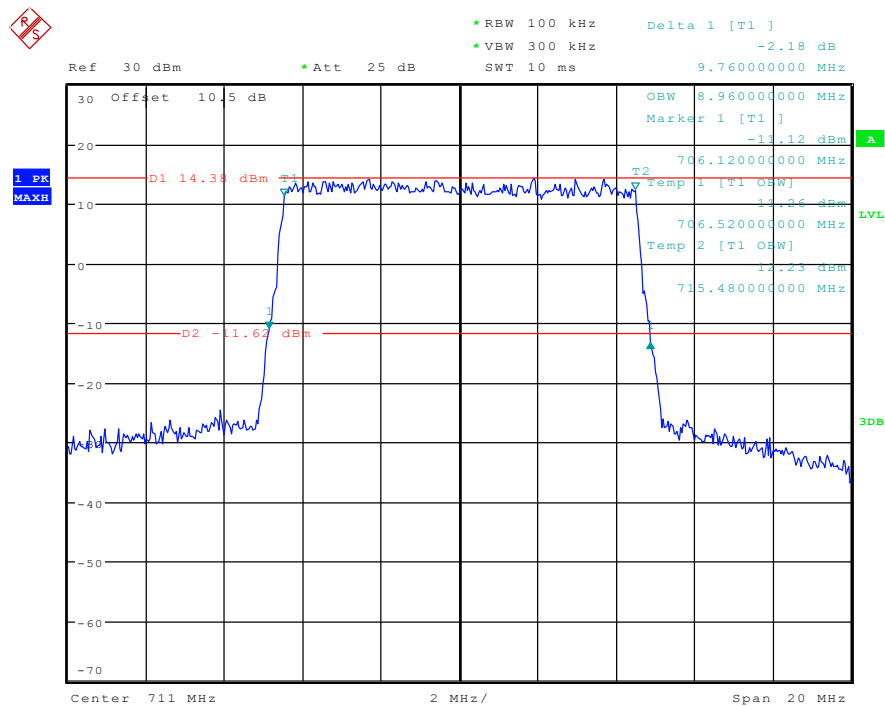

Date: 25.NOV.2022 09:07:36


Band 12_10 MHz_High_16QAM_RB50#0

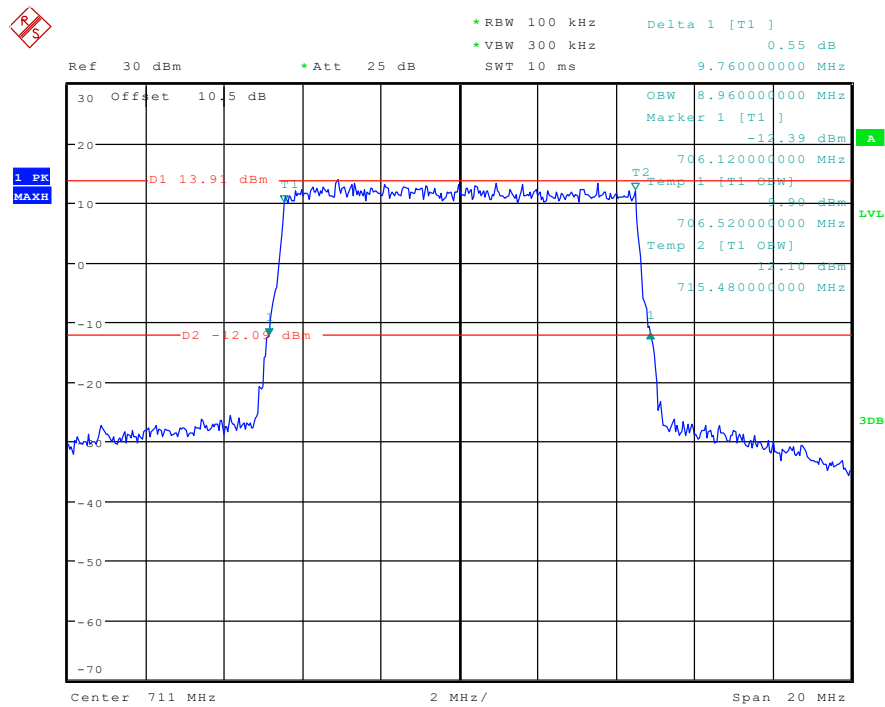

Date: 25.NOV.2022 09:07:55


Date: 25.NOV.2022 09:08:35

Band 17_5 MHz_Middle_QPSK_RB25#0

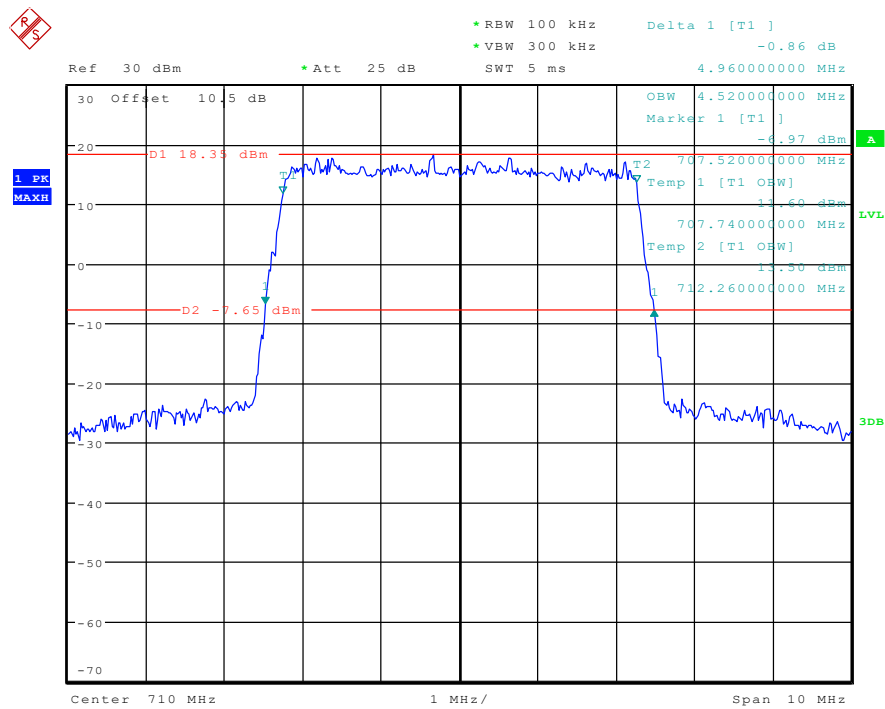


Date: 25.NOV.2022 09:08:54

Band 17_5 MHz_Middle_16QAM_RB25#0

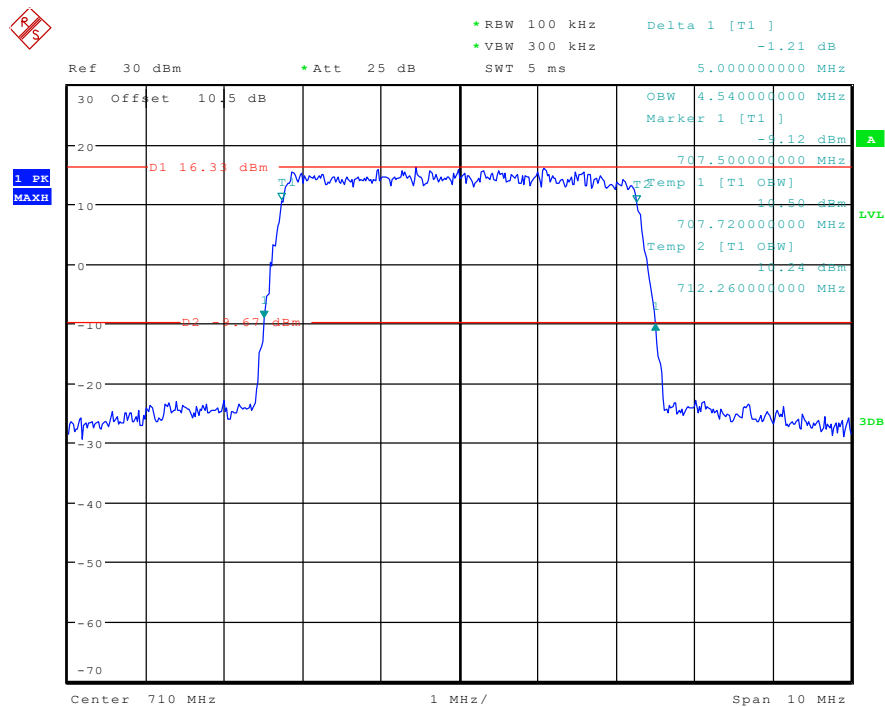


Date: 25.NOV.2022 09:09:10

Band 17_5 MHz_High_QPSK_RB25#0

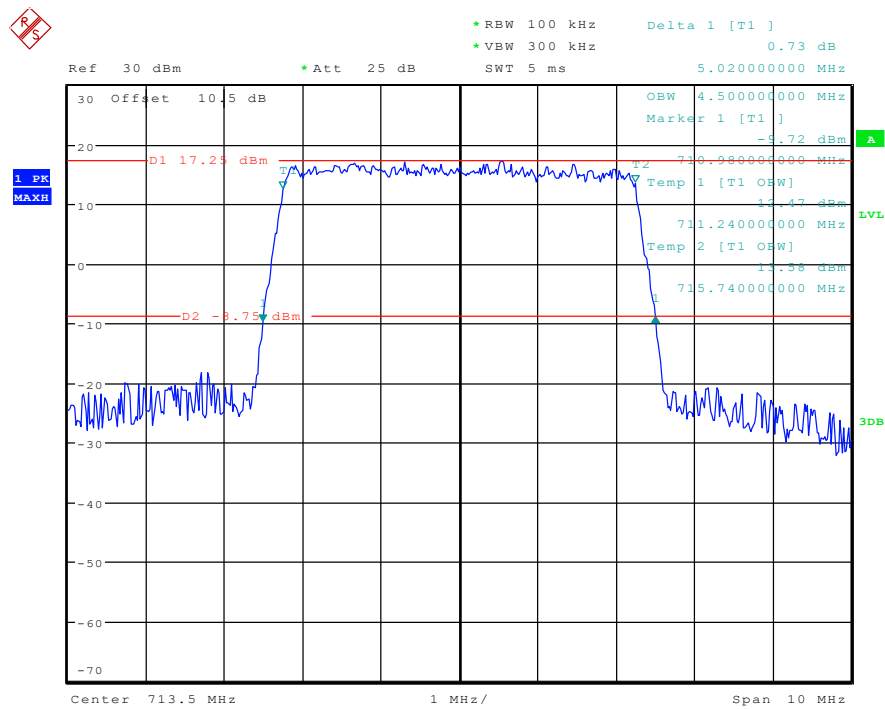


Date: 25.NOV.2022 09:10:32

Band 17_5 MHz_High_16QAM_RB25#0

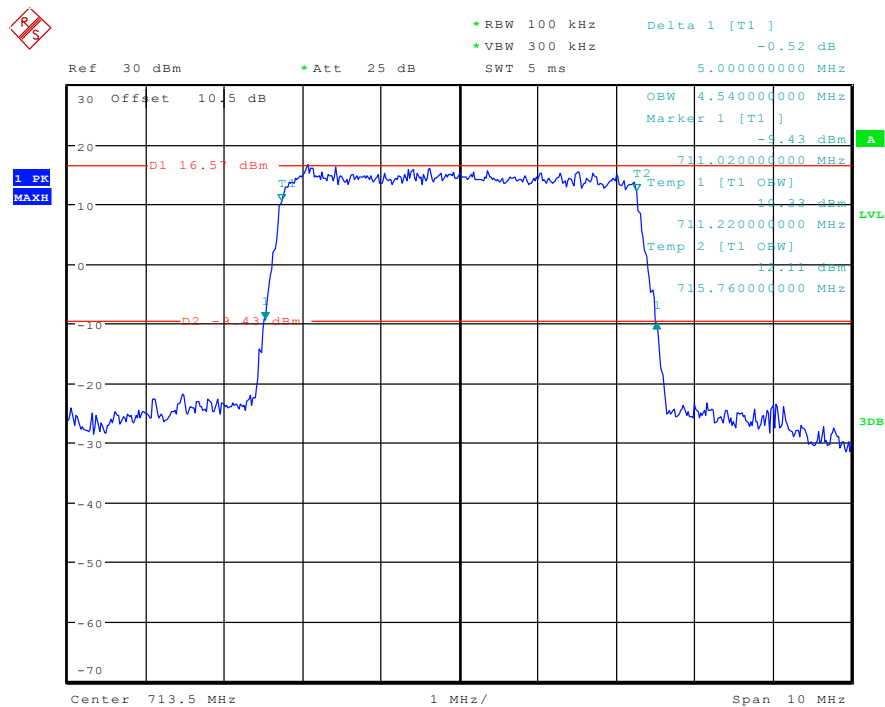


Date: 25.NOV.2022 09:10:51

Band 17_10 MHz_Low_QPSK_RB50#0

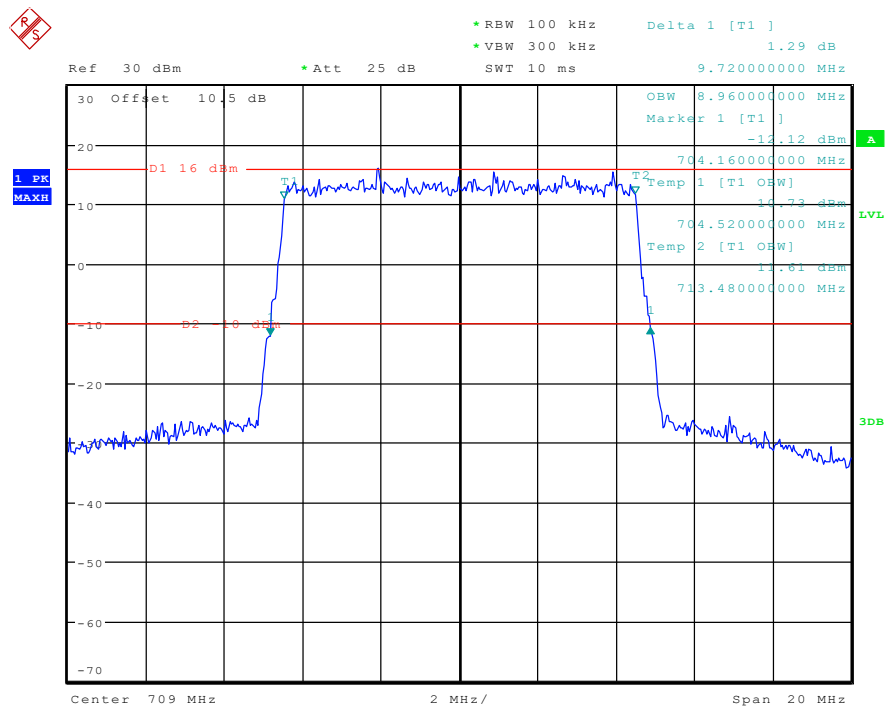


Date: 25.NOV.2022 09:11:12

Band 17_10 MHz_Low_16QAM_RB50#0

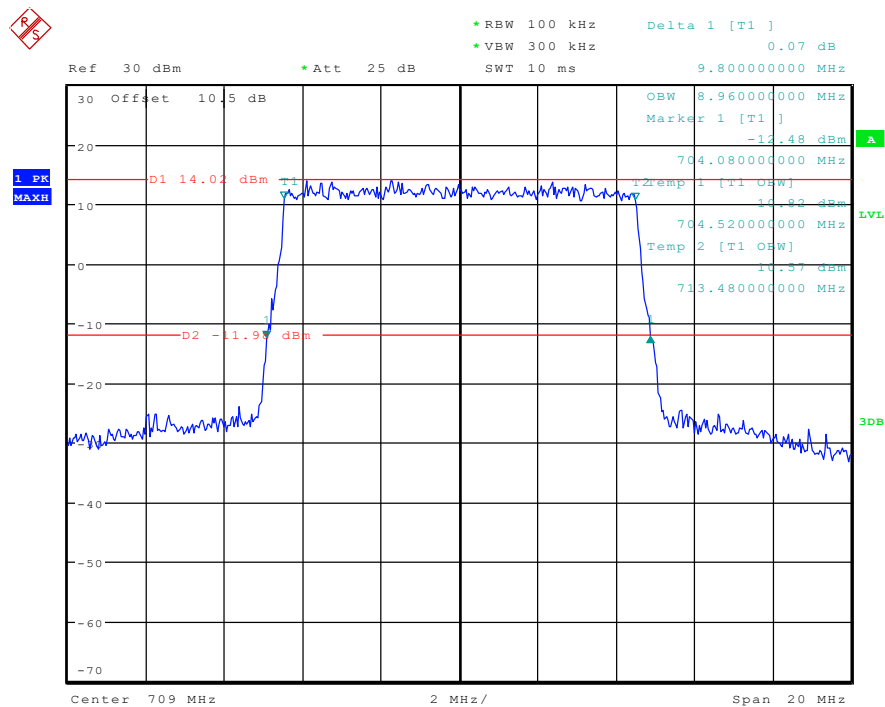


Date: 25.NOV.2022 09:11:31

Band 17_10 MHz_Middle_QPSK_RB50#0

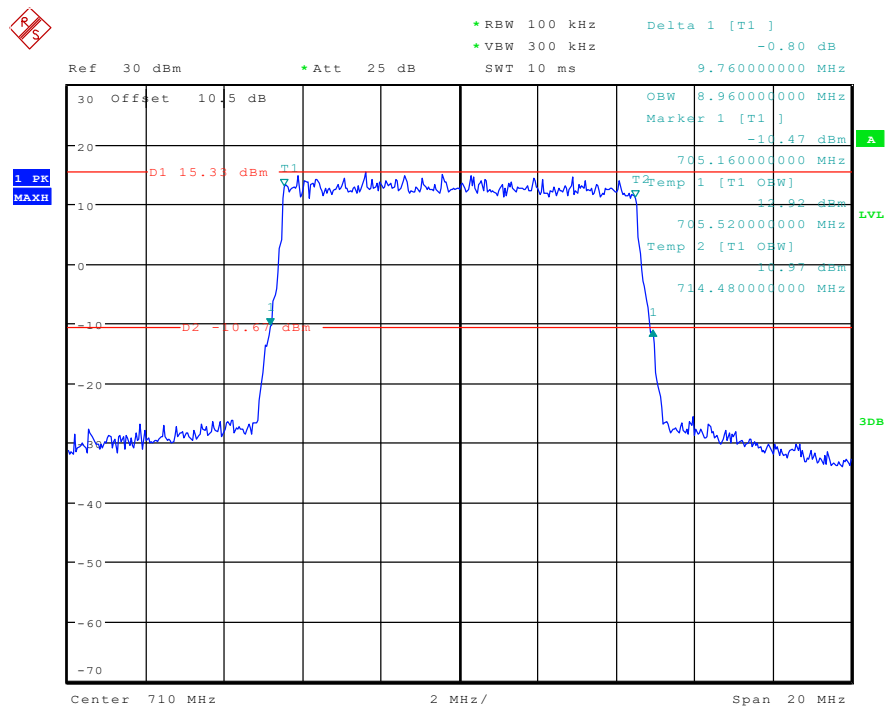


Date: 25.NOV.2022 09:11:51

Band 17_10 MHz_Middle_16QAM_RB50#0

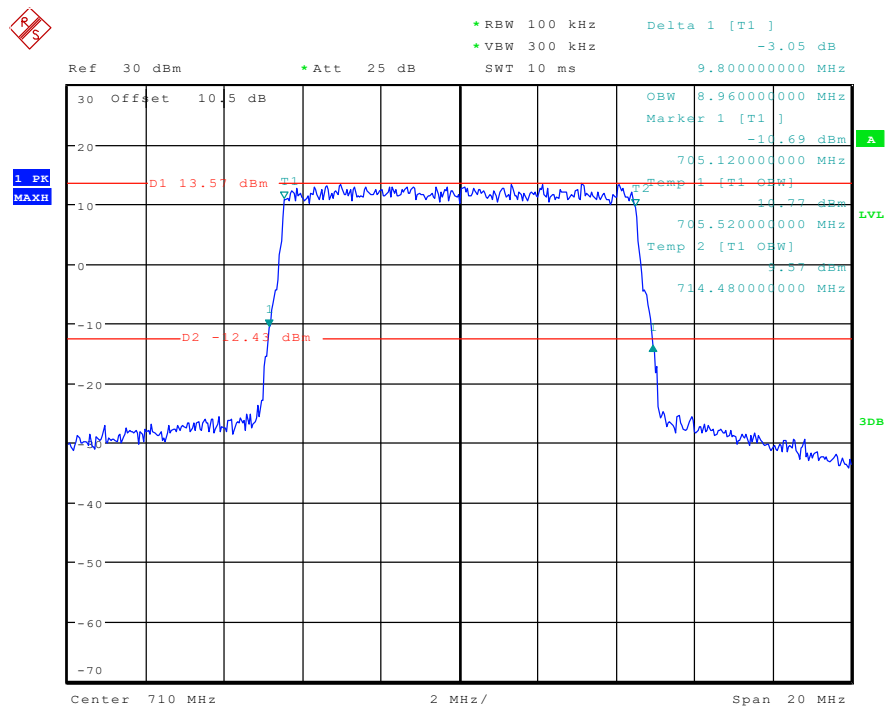


Date: 25.NOV.2022 09:12:10

Band 17_10 MHz_High_QPSK_RB50#0

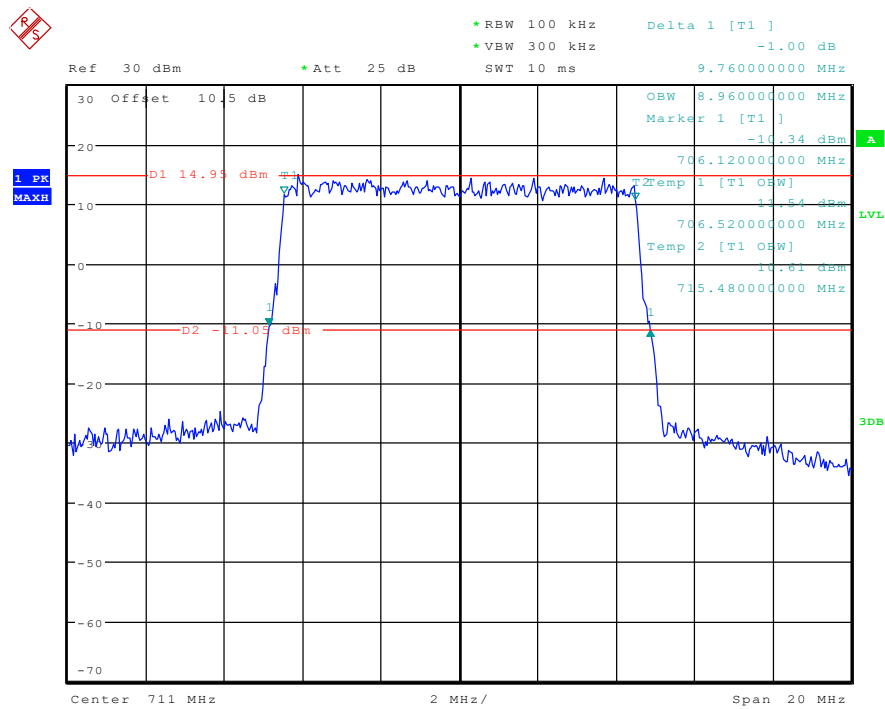


Date: 25.NOV.2022 09:12:30

Band 17_10 MHz_High_16QAM_RB50#0

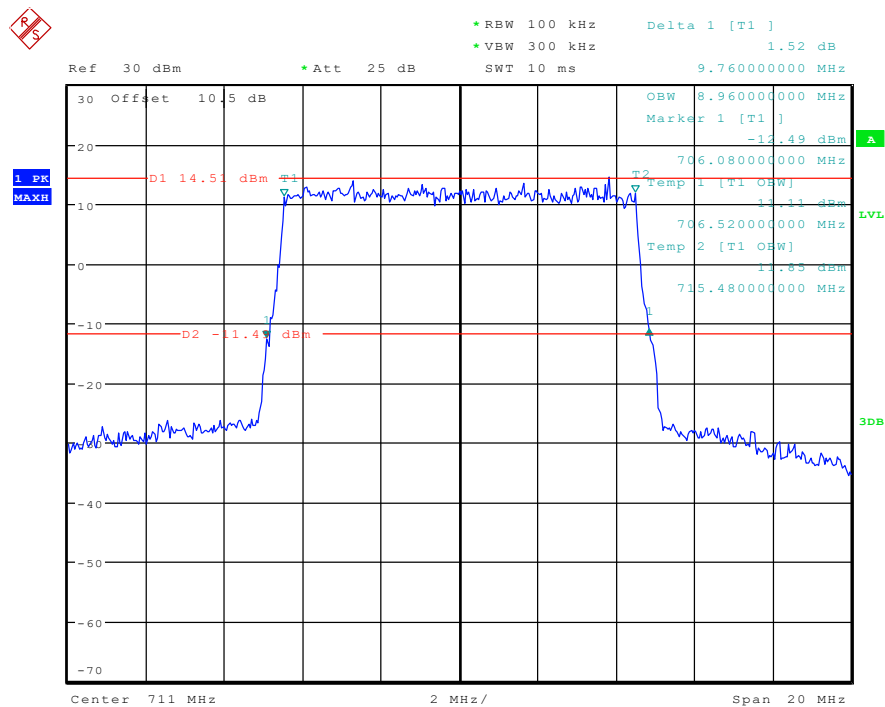


Date: 25.NOV.2022 09:12:50

Band 38_5 MHz_Low_QPSK_RB25#0

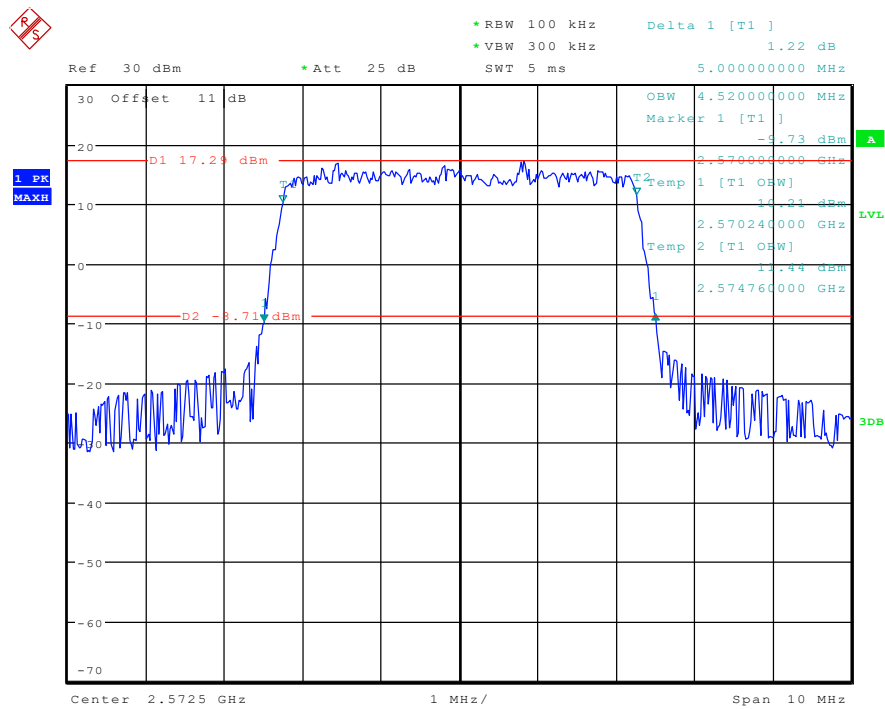


Date: 25.NOV.2022 11:19:46

Band 38_5 MHz_Low_16QAM_RB25#0

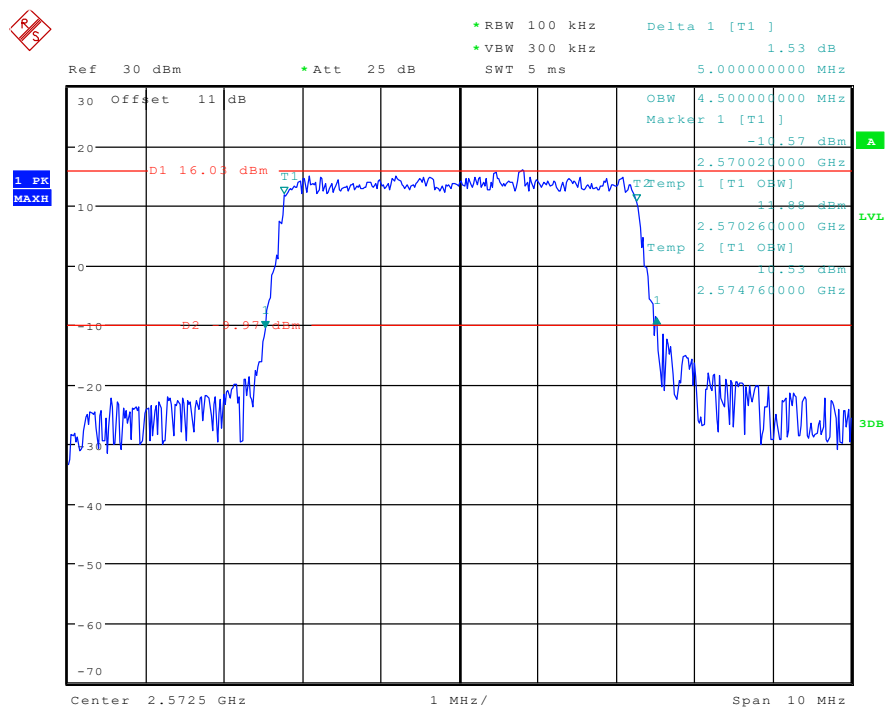


Date: 25.NOV.2022 11:20:15

Band 38_5 MHz_Middle_QPSK_RB25#0

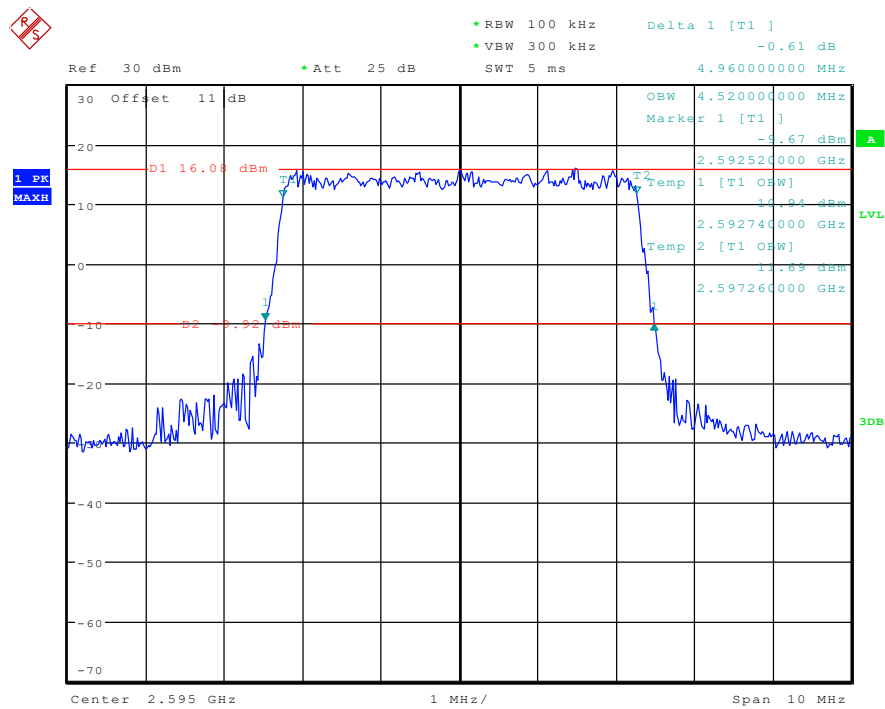


Date: 25.NOV.2022 11:20:35

Band 38_5 MHz_Middle_16QAM_RB25#0

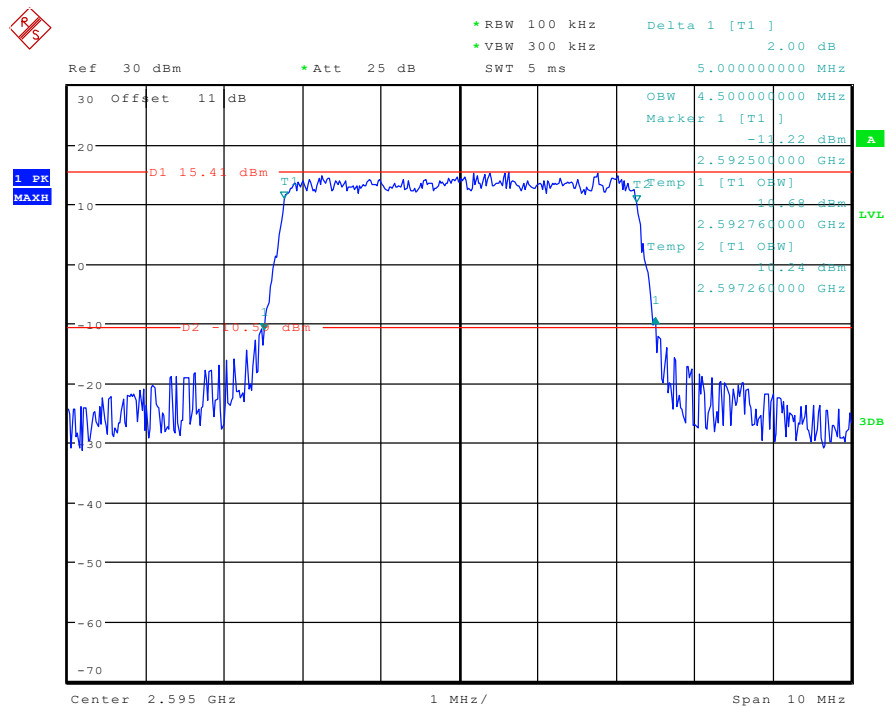


Date: 25.NOV.2022 11:20:57

Band 38_5 MHz_High_QPSK_RB25#0

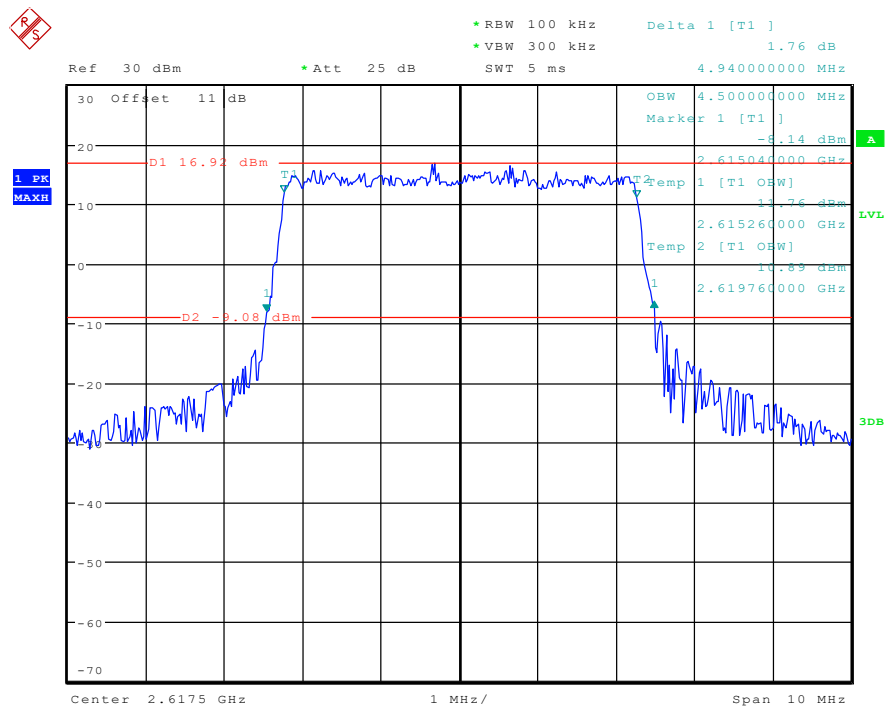


Date: 25.NOV.2022 11:21:22

Band 38_5 MHz_High_16QAM_RB25#0

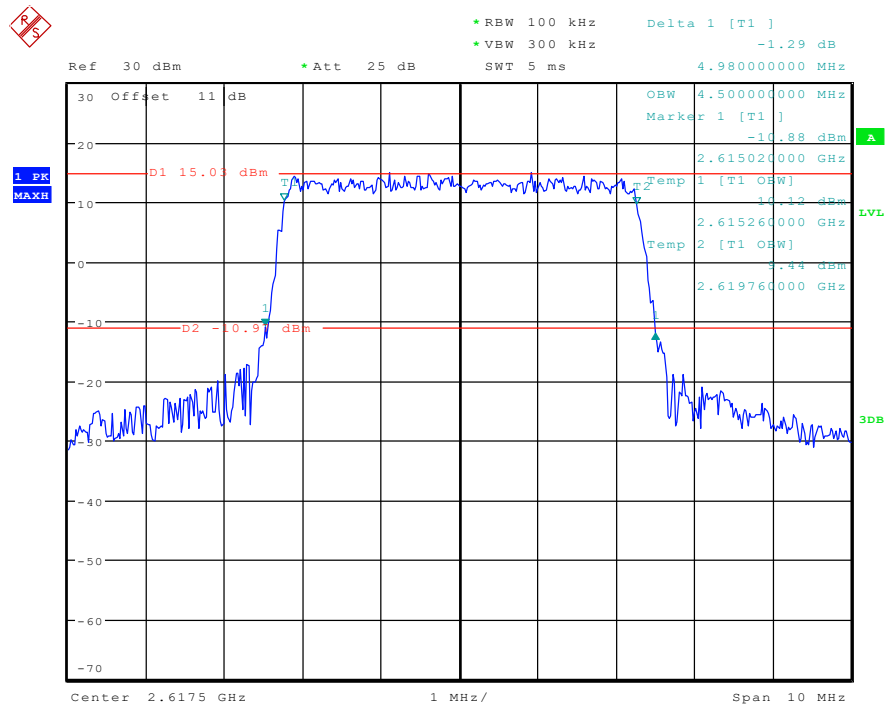


Date: 25.NOV.2022 11:21:44

Band 38_10 MHz_Low_QPSK_RB50#0

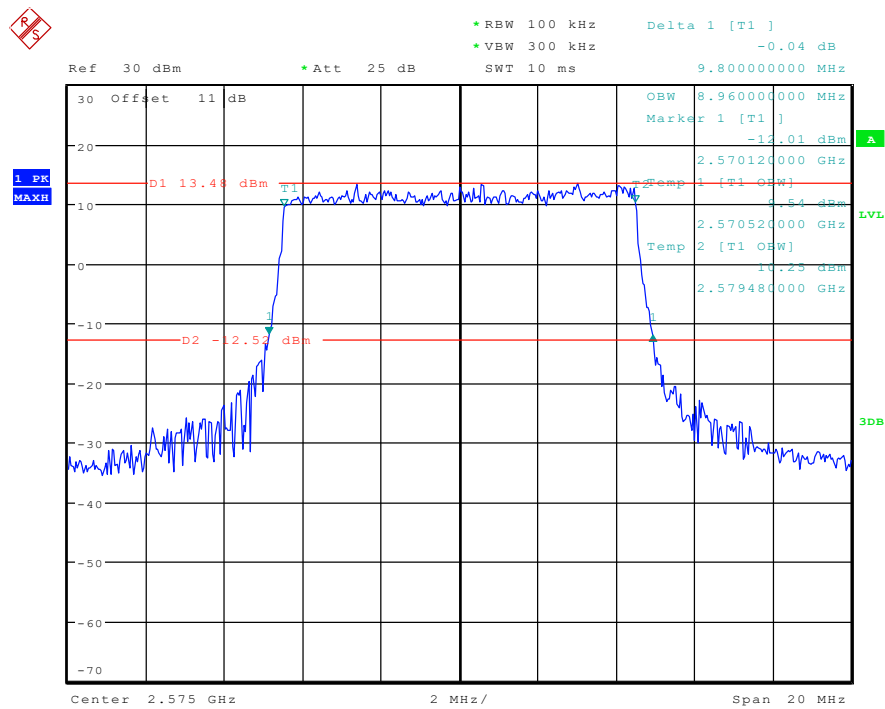


Date: 25.NOV.2022 11:22:08

Band 38_10 MHz_Low_16QAM_RB50#0

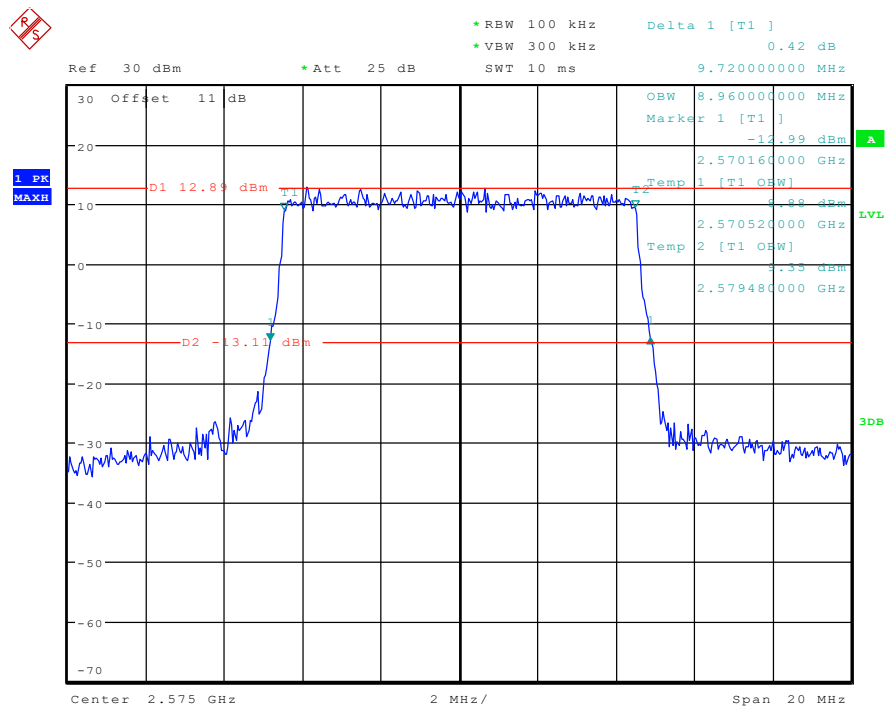


Date: 25.NOV.2022 11:22:27

Band 38_10 MHz_Middle_QPSK_RB50#0

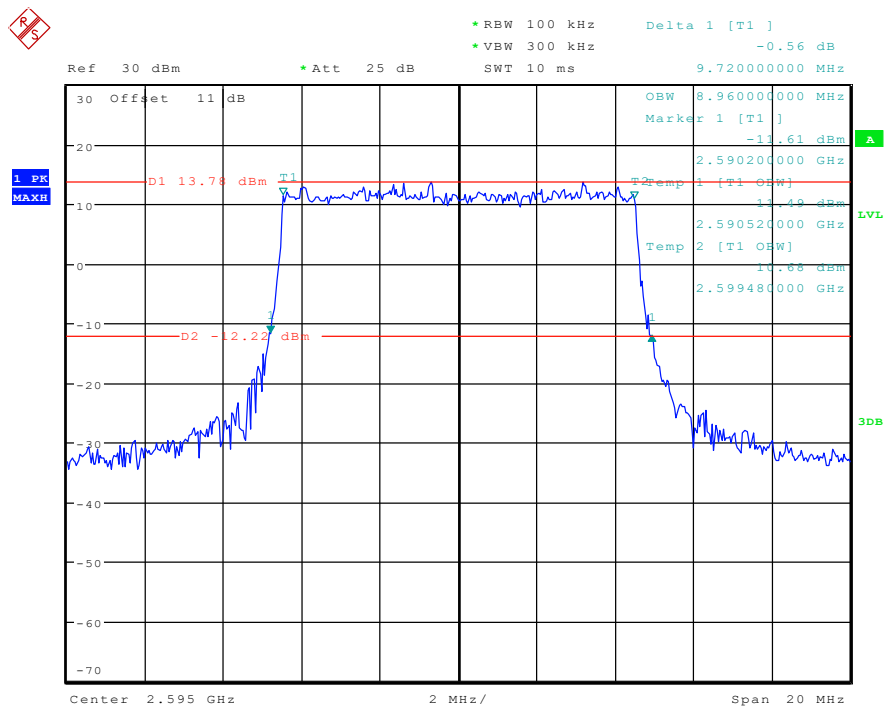


Date: 25.NOV.2022 11:22:54

Band 38_10 MHz_Middle_16QAM_RB50#0

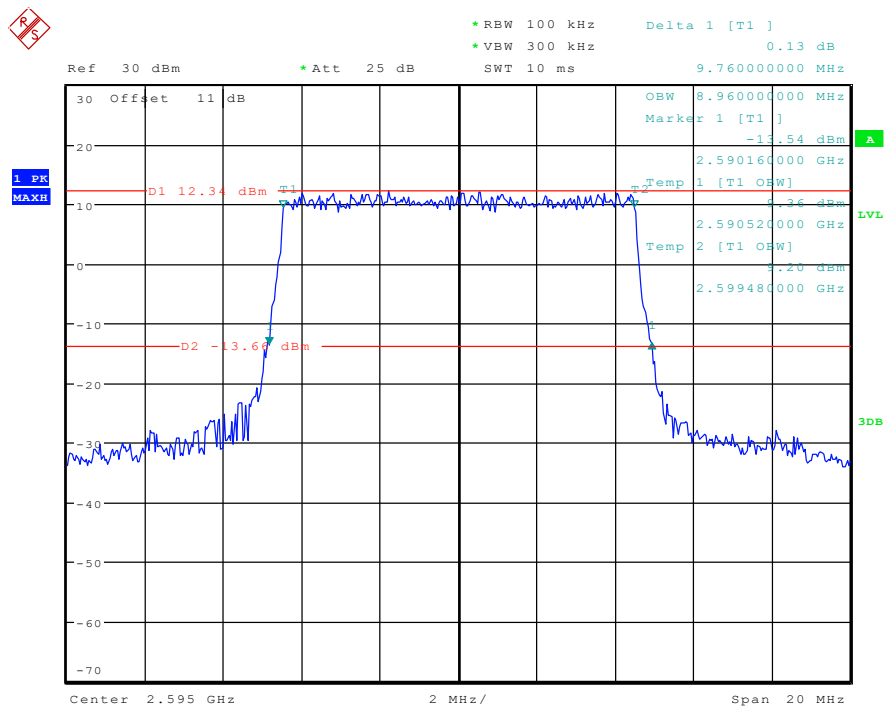


Date: 25.NOV.2022 11:23:16

Band 38_10 MHz_High_QPSK_RB50#0

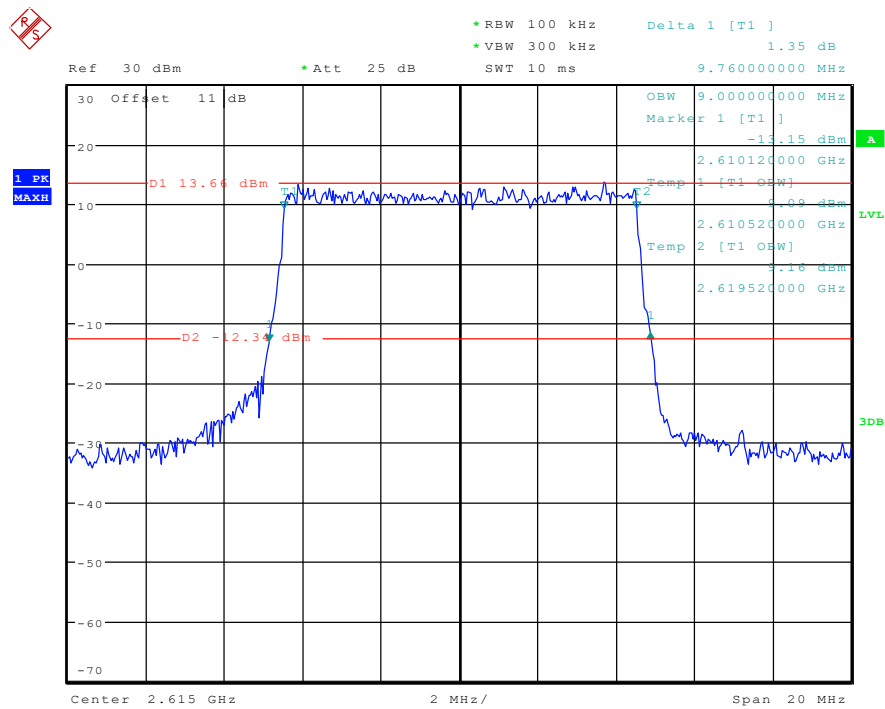


Date: 25.NOV.2022 11:23:39

Band 38_10 MHz_High_16QAM_RB50#0

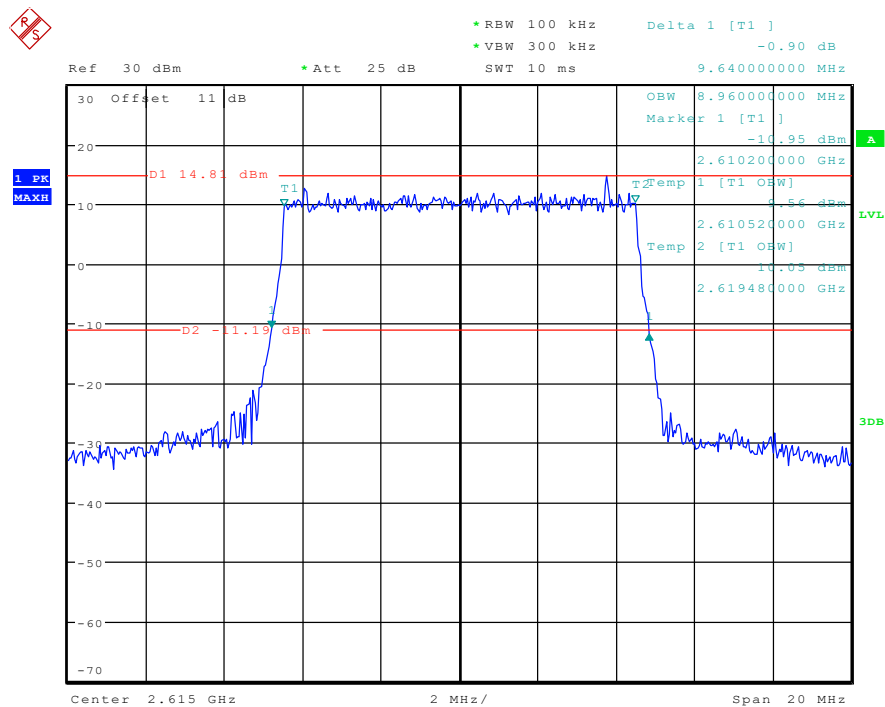


Date: 25.NOV.2022 11:23:58

Band 38_15 MHz_Low_QPSK_RB75#0

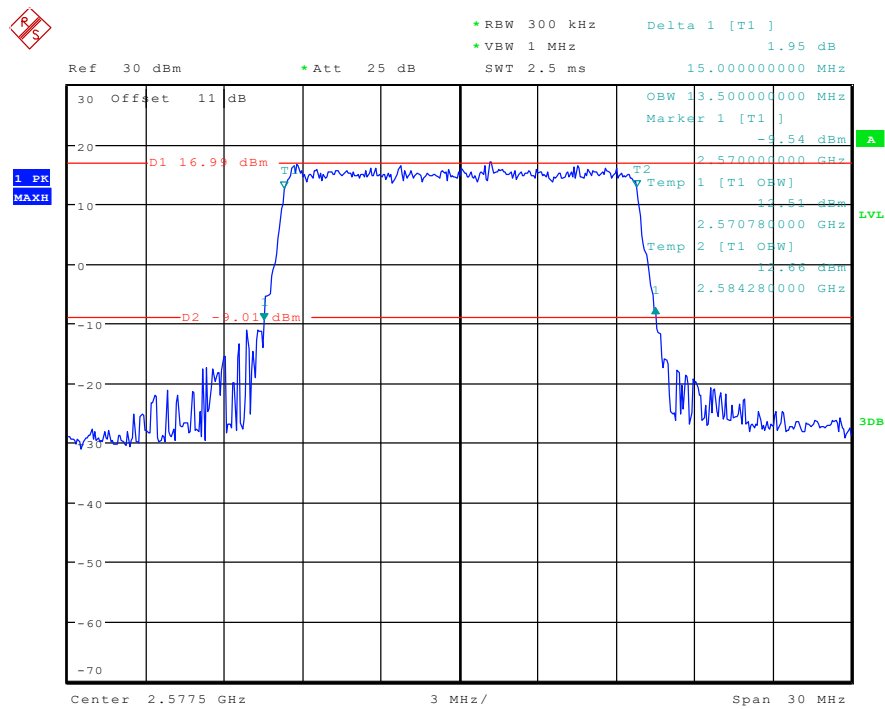


Date: 25.NOV.2022 11:24:25

Band 38_15 MHz_Low_16QAM_RB75#0

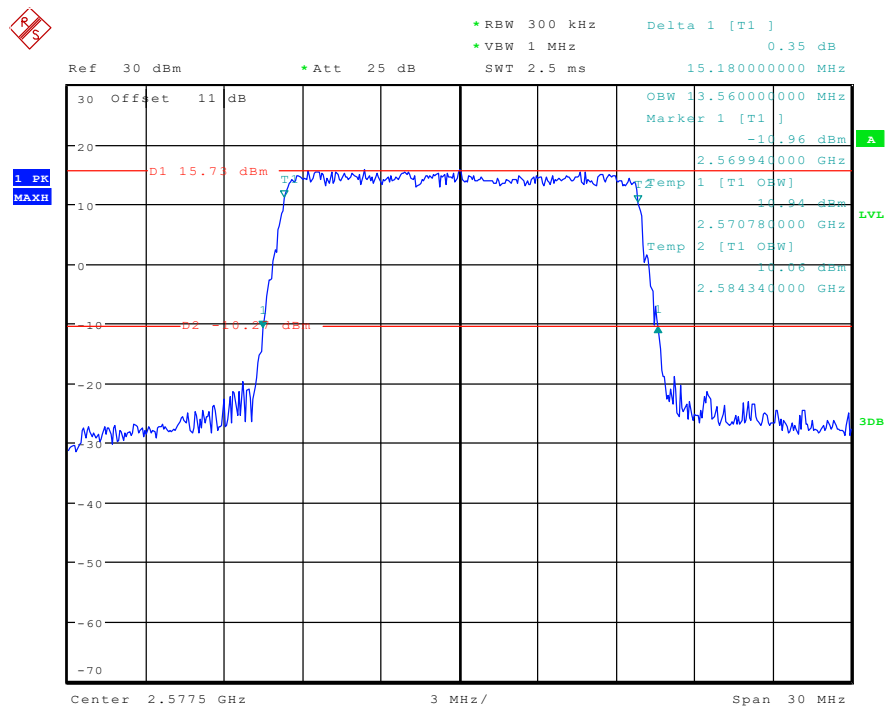


Date: 25.NOV.2022 11:24:50

Band 38_15 MHz_Middle_QPSK_RB75#0

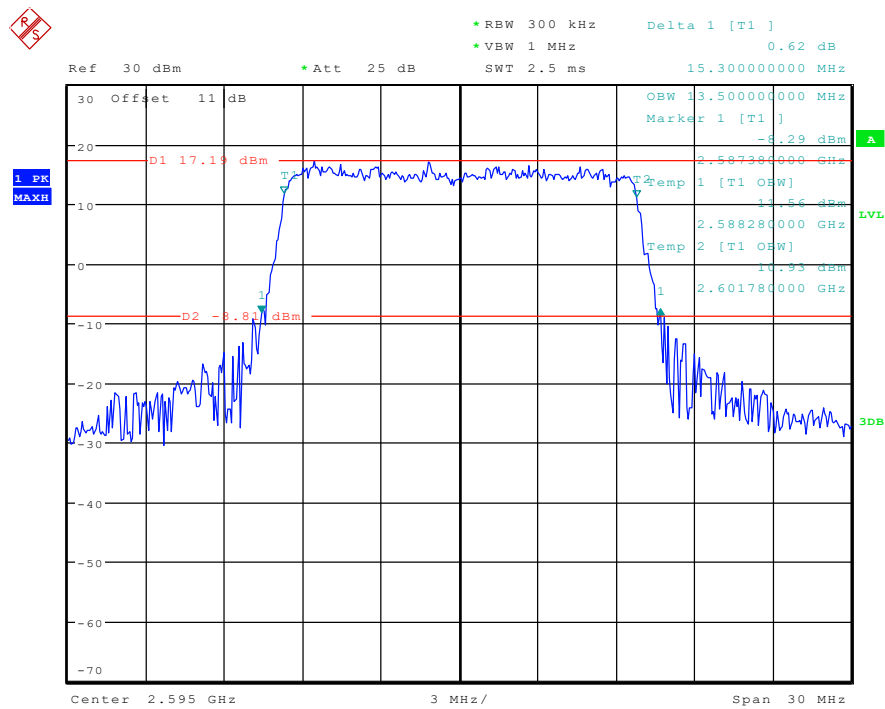


Date: 25.NOV.2022 11:25:19

Band 38_15 MHz_Middle_16QAM_RB75#0

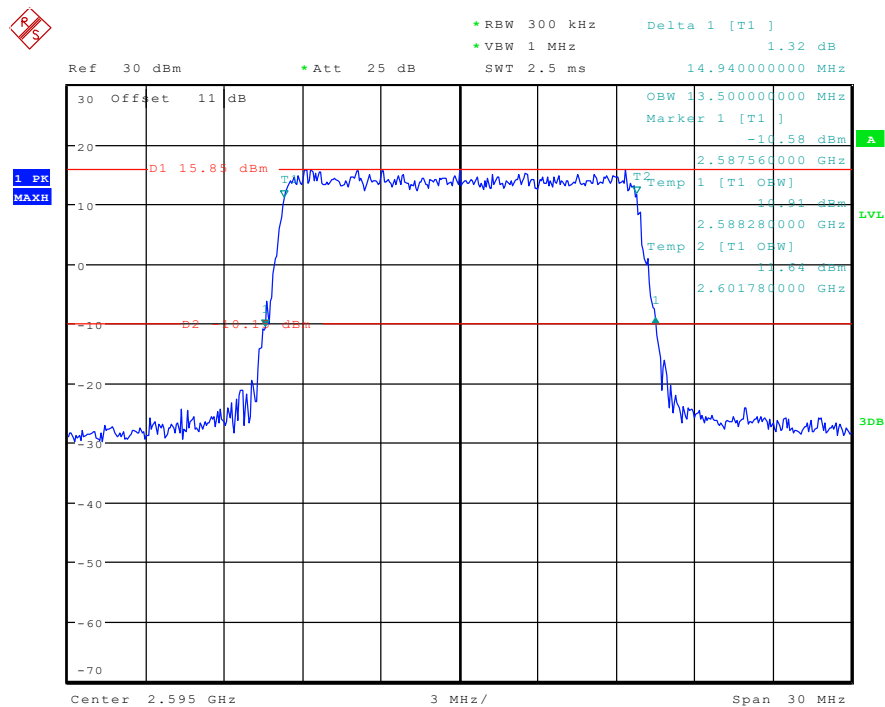


Date: 25.NOV.2022 11:25:40

Band 38_15 MHz_High_QPSK_RB75#0

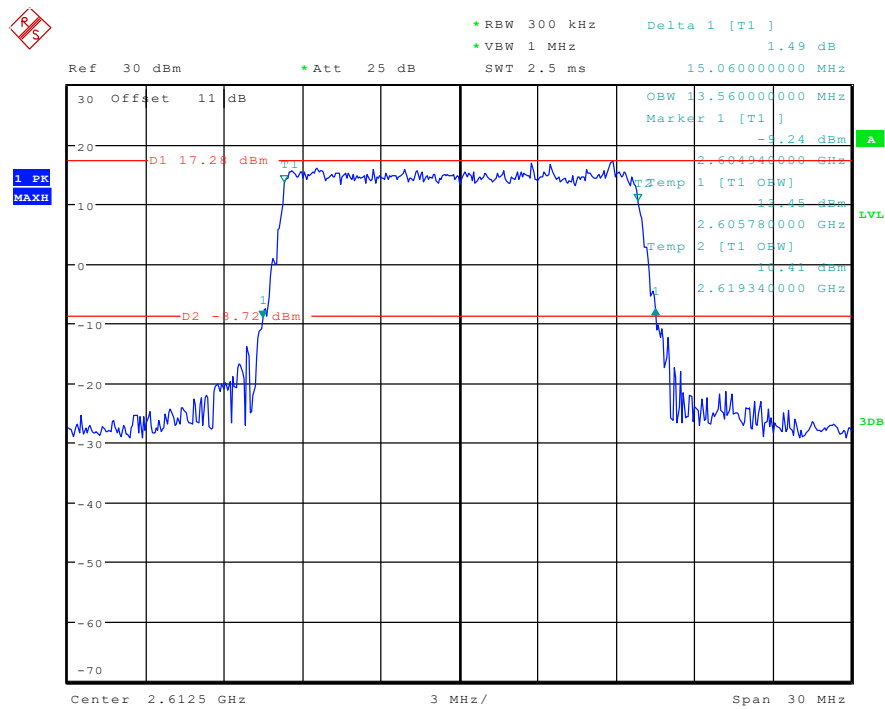


Date: 25.NOV.2022 11:26:09

Band 38_15 MHz_High_16QAM_RB75#0

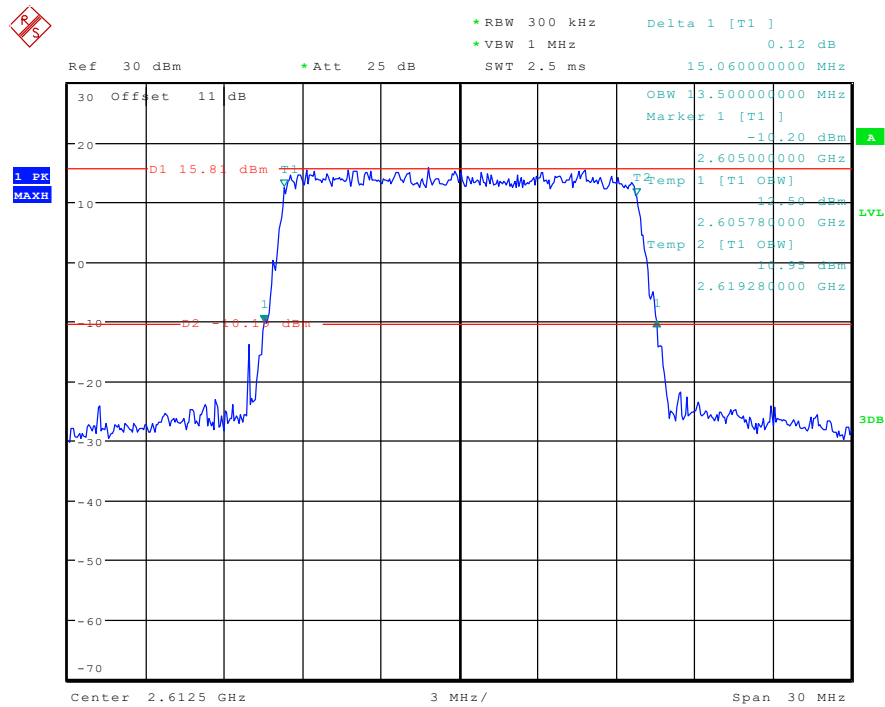


Date: 25.NOV.2022 11:26:31

Band 38_20 MHz_Low_QPSK_RB100#0

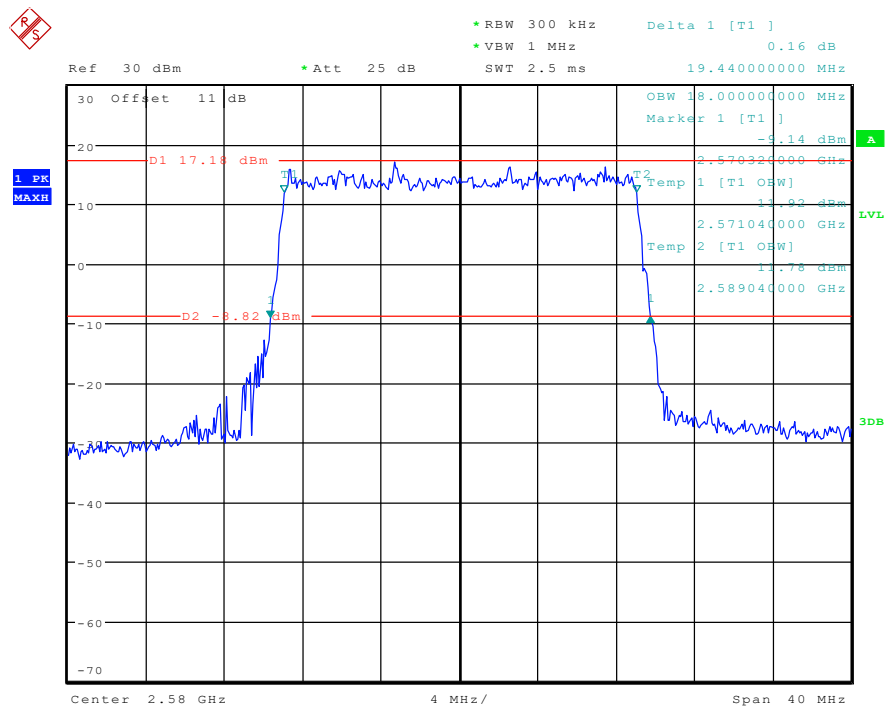


Date: 25.NOV.2022 11:26:57

Band 38_20 MHz_Low_16QAM_RB100#0

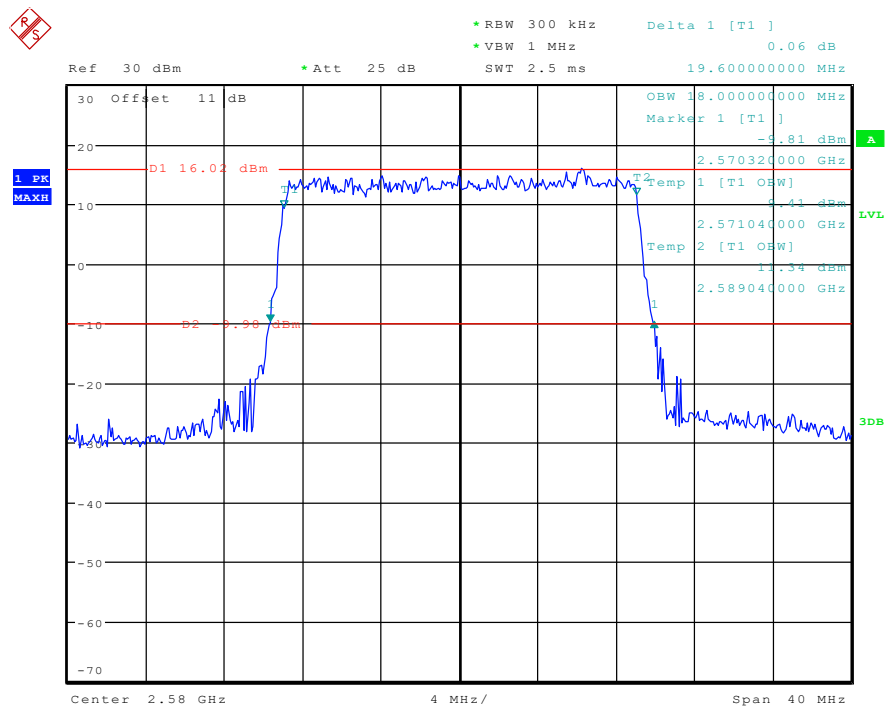


Date: 25.NOV.2022 11:27:22

Band 38_20 MHz_Middle_QPSK_RB100#0

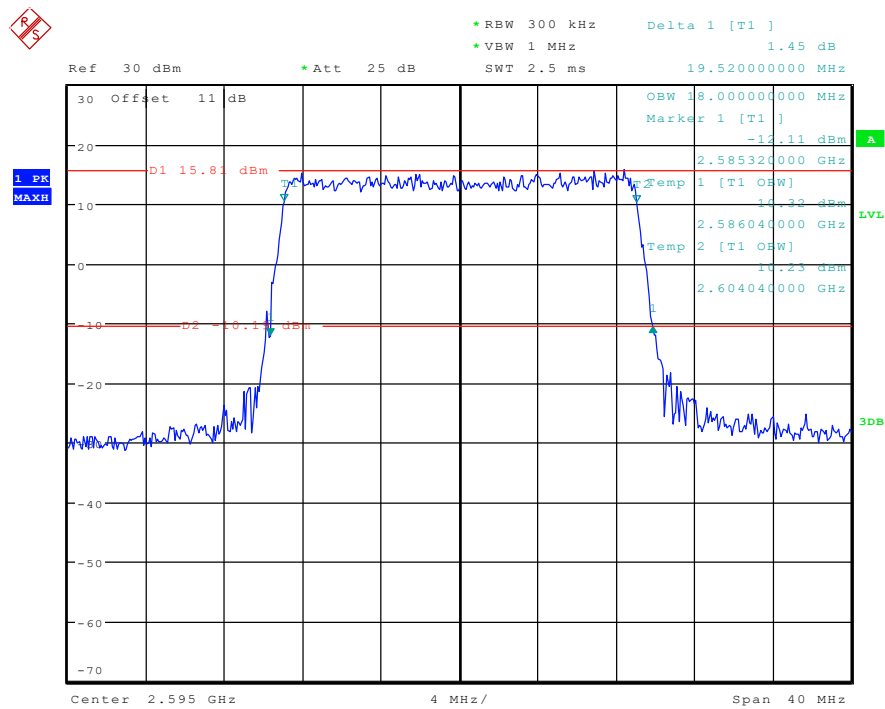


Date: 25.NOV.2022 11:27:45

Band 38_20 MHz_Middle_16QAM_RB100#0

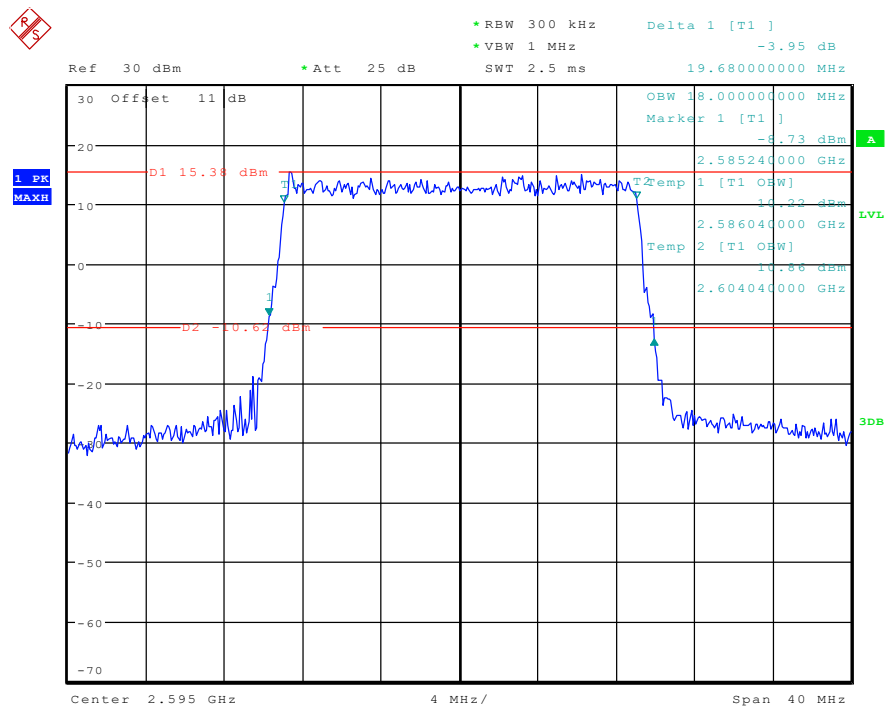


Date: 25.NOV.2022 11:28:07

Band 38_20 MHz_High_QPSK_RB100#0

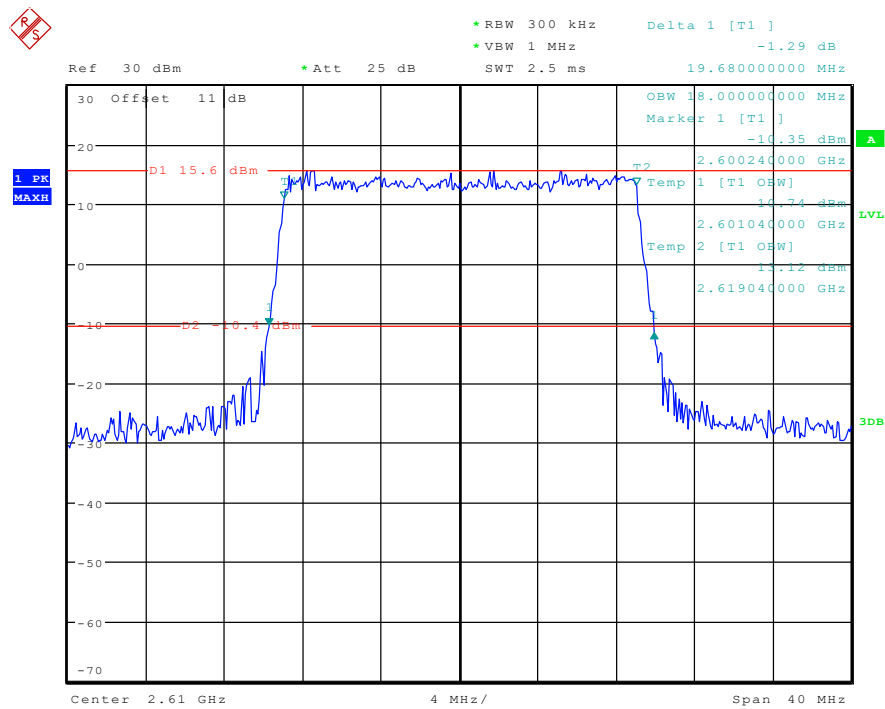

Date: 25.NOV.2022 11:28:30

Band 38_20 MHz_High_16QAM_RB100#0

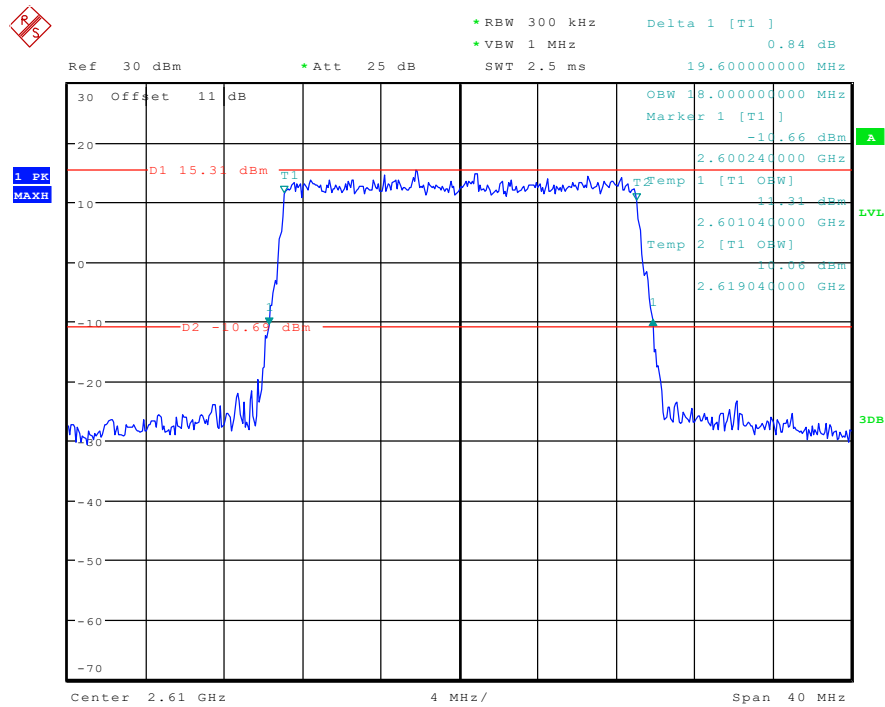

Date: 25.NOV.2022 11:28:53

*RBW 100 kHz Delta 1 [T1]
 *VBW 300 kHz -1.64 dB
 Ref 30 dBm *Att 25 dB SWT 5 ms 4.940000000 MHz


30 Offset 11 dB
 D1 15.73 dBm
 D2 -10.27 dBm
 T1 4.500000000 MHz
 Marker 1 [T1]
 -9.94 dBm
 T2 2.535040000 GHz
 1 [T1 OBW]
 12.34 dBm
 2.535260000 GHz
 Temp 2 [T1 OBW]
 10.93 dBm
 2.539760000 GHz

1 PK
 MAXH

LVL
 3dB


Center 2.5375 GHz 1 MHz/
 Span 10 MHz

Band 41_5 MHz_Low_16QAM_RB25#0

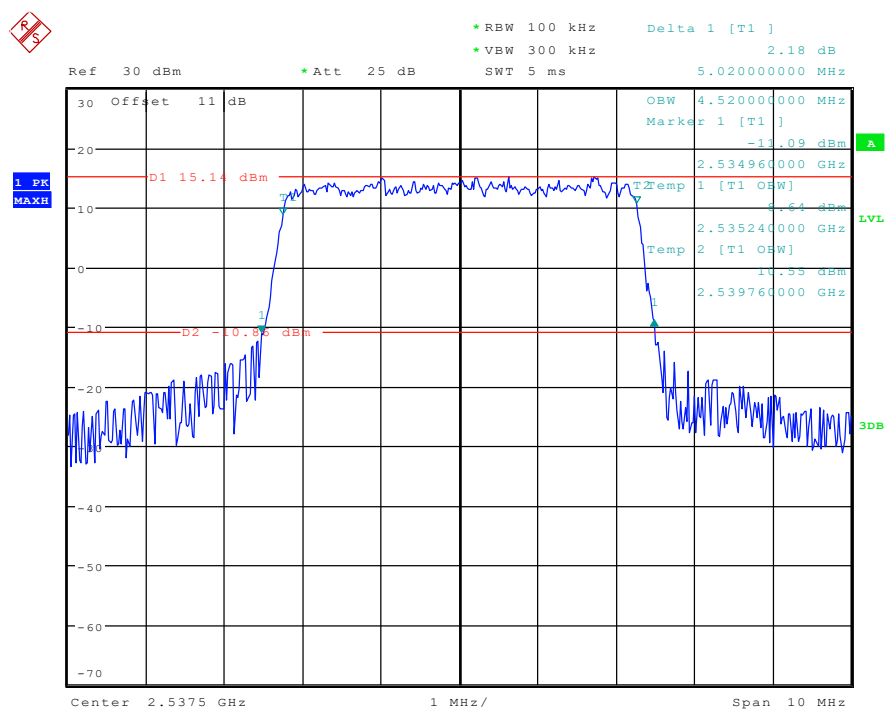


Date: 25.NOV.2022 11:45:40

Band 41_5 MHz_Middle_QPSK_RB25#0

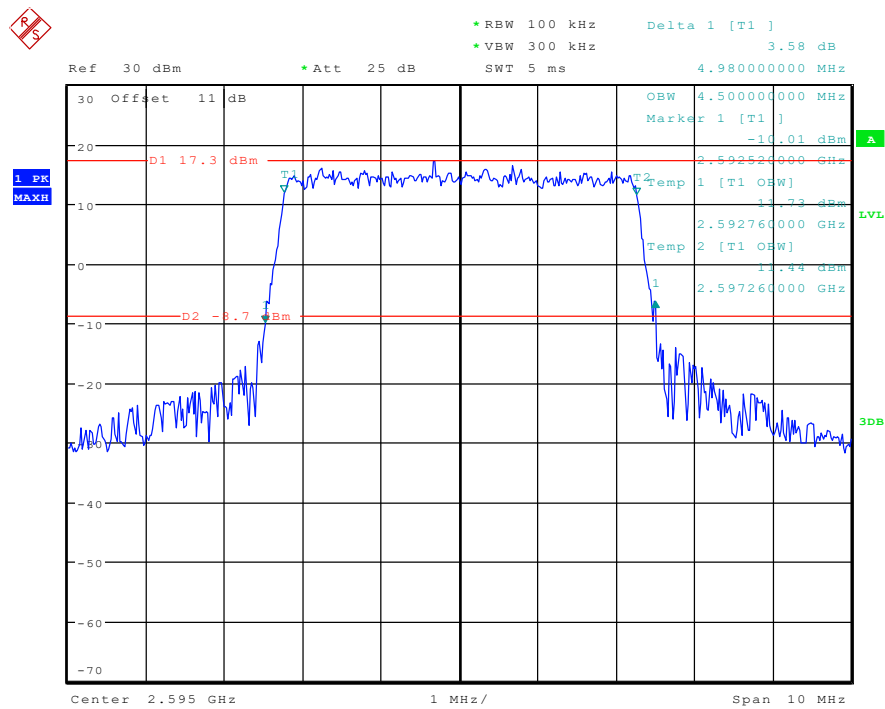


Date: 25.NOV.2022 11:46:02

Band 41_5 MHz_Middle_16QAM_RB25#0

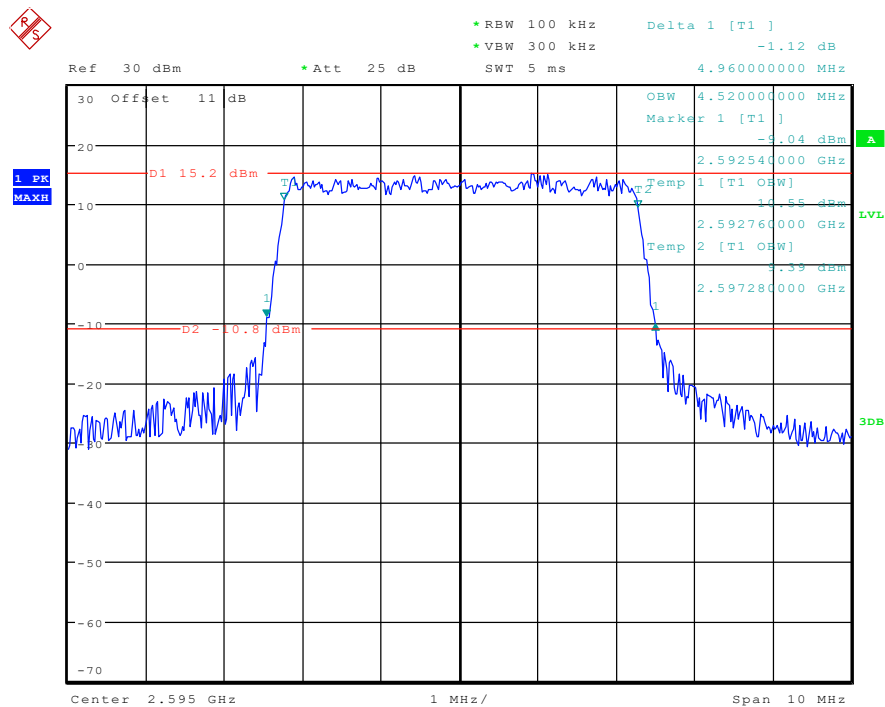


Date: 25.NOV.2022 11:46:27

Band 41_5 MHz_High_QPSK_RB25#0

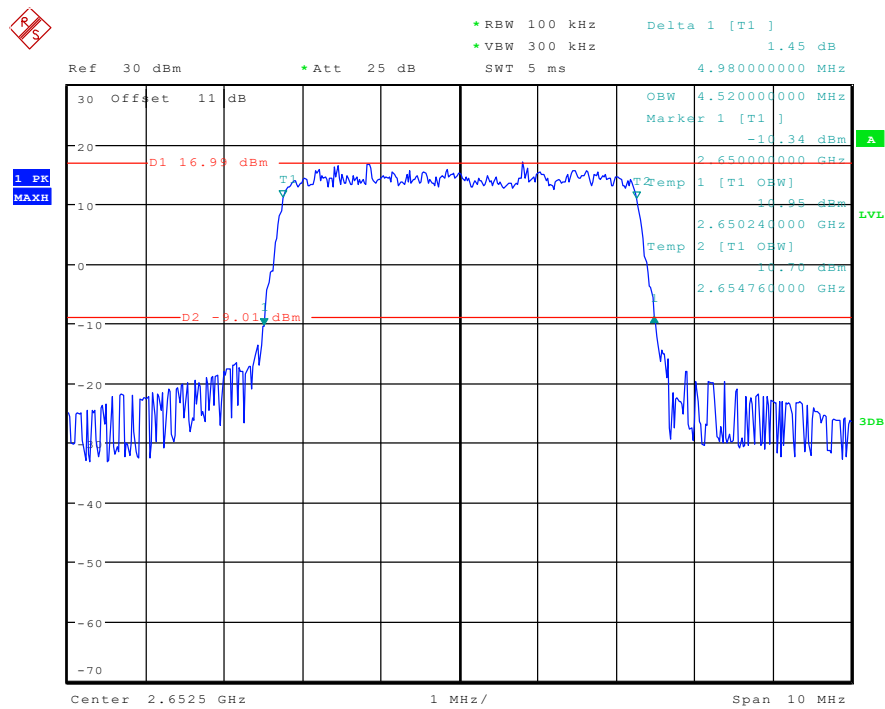


Date: 25.NOV.2022 11:46:50

Band 41_5 MHz_High_16QAM_RB25#0

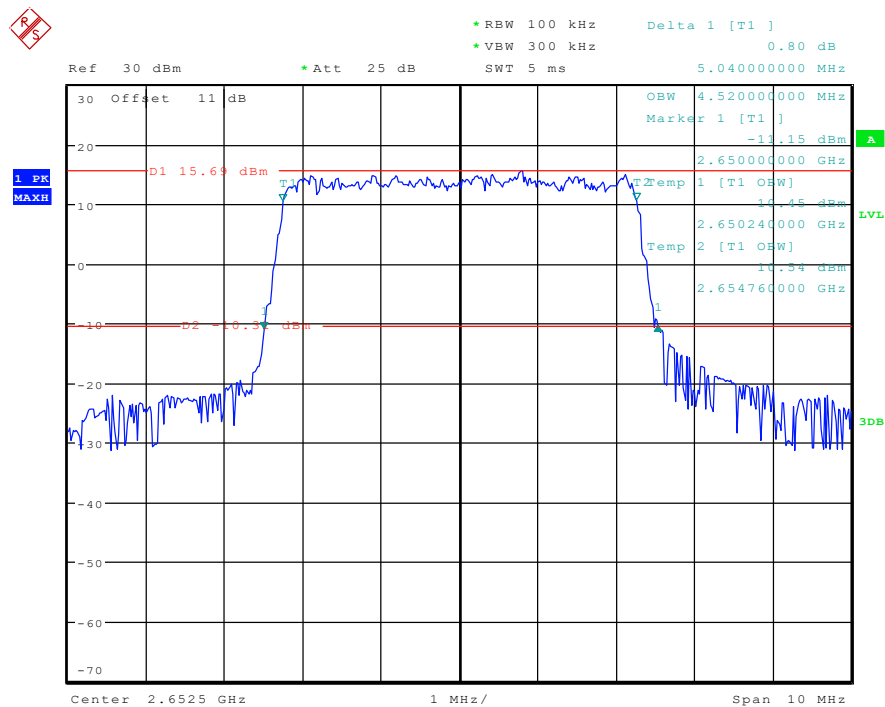


Date: 25.NOV.2022 11:47:15

Band 41_10 MHz_Low_QPSK_RB50#0

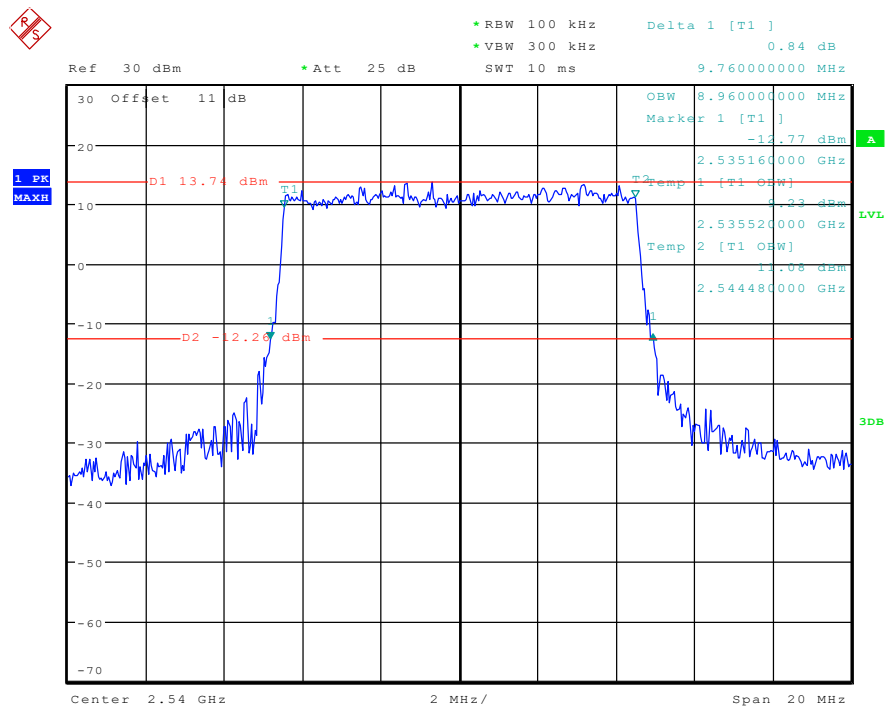


Date: 25.NOV.2022 11:48:17

Band 41_10 MHz_Low_16QAM_RB50#0

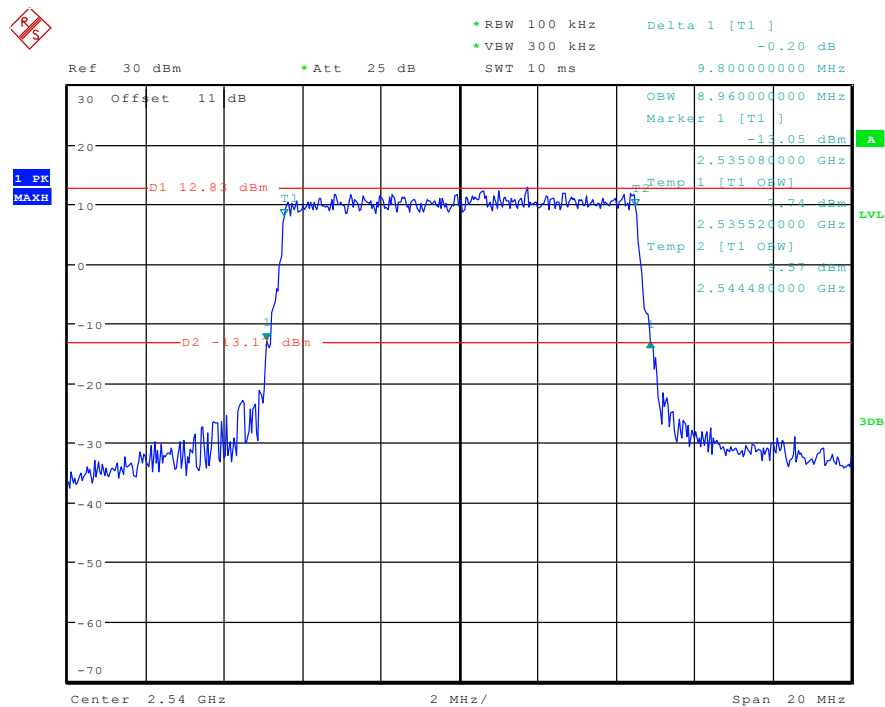


Date: 25.NOV.2022 11:48:40

Band 41_10 MHz_Middle_QPSK_RB50#0

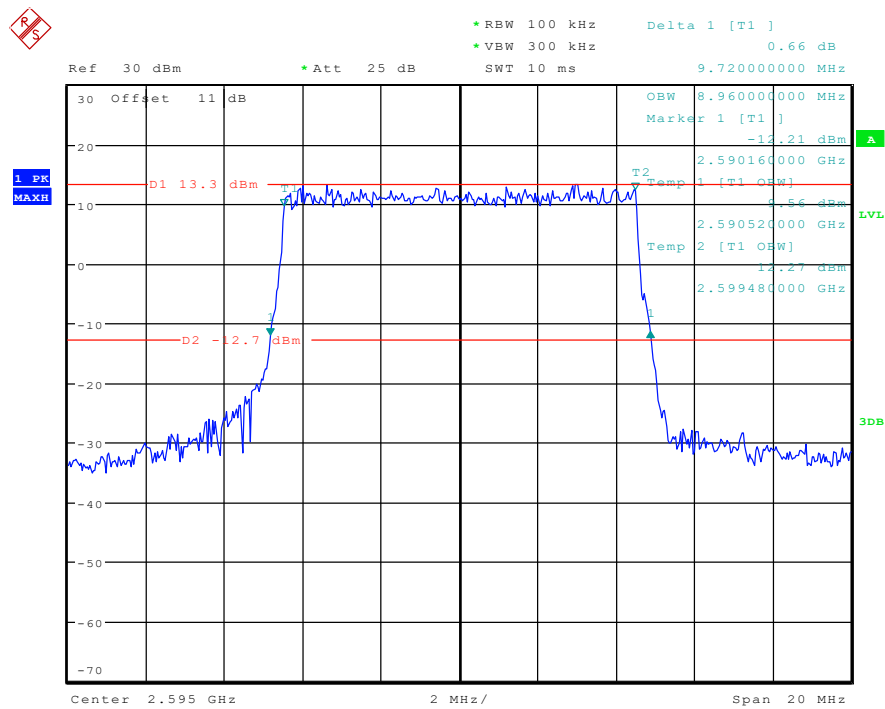


Date: 25.NOV.2022 11:48:59

Band 41_10 MHz_Middle_16QAM_RB50#0

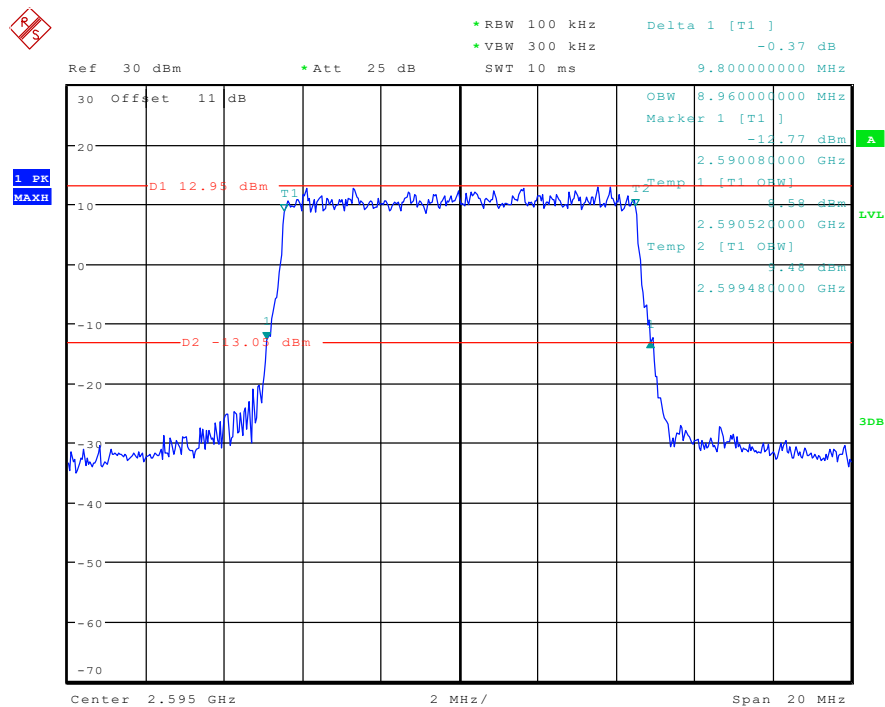


Date: 25.NOV.2022 11:49:19

Band 41_10 MHz_High_QPSK_RB50#0

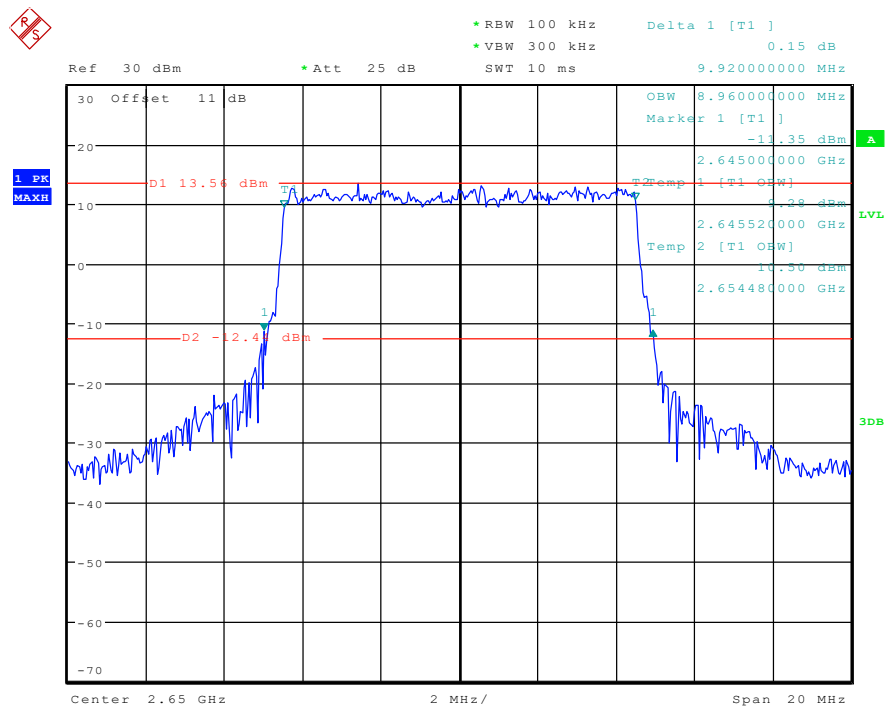


Date: 25.NOV.2022 11:49:42

Band 41_10 MHz_High_16QAM_RB50#0

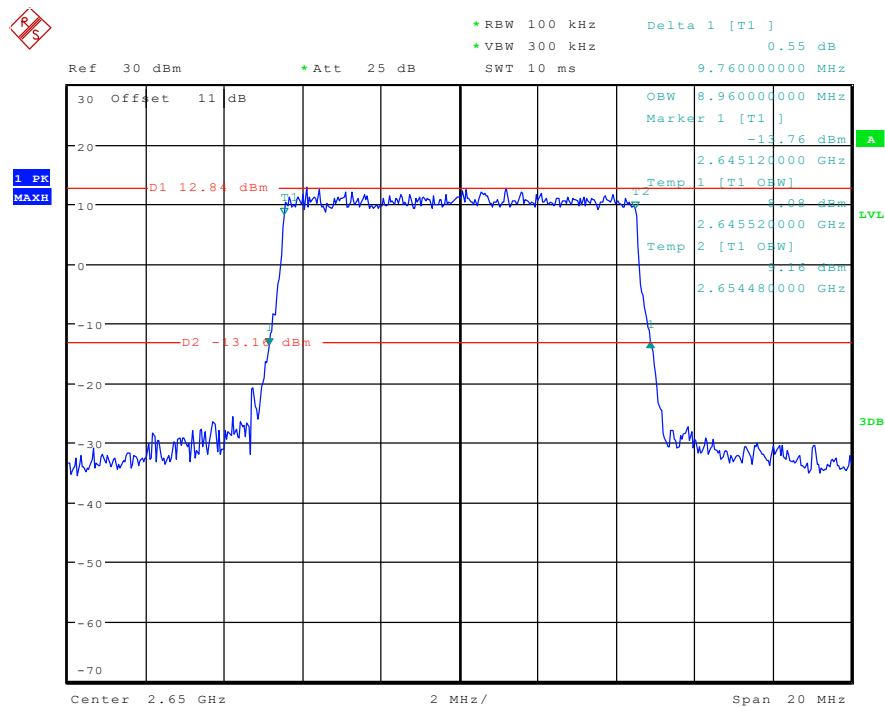


Date: 25.NOV.2022 11:50:01

Band 41_15 MHz_Low_QPSK_RB75#0

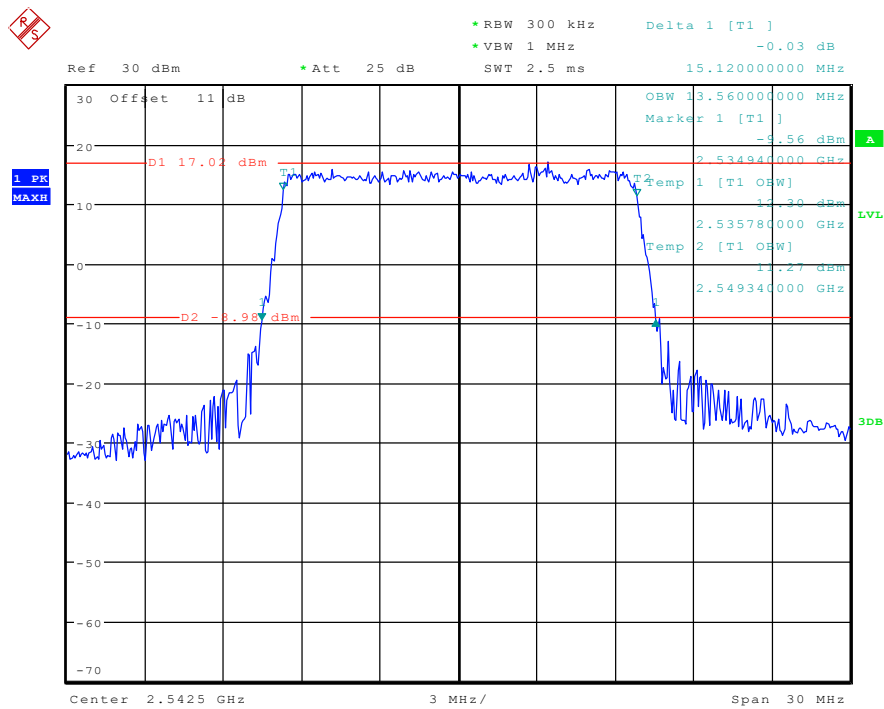


Date: 25.NOV.2022 11:57:44

Band 41_15 MHz_Low_16QAM_RB75#0

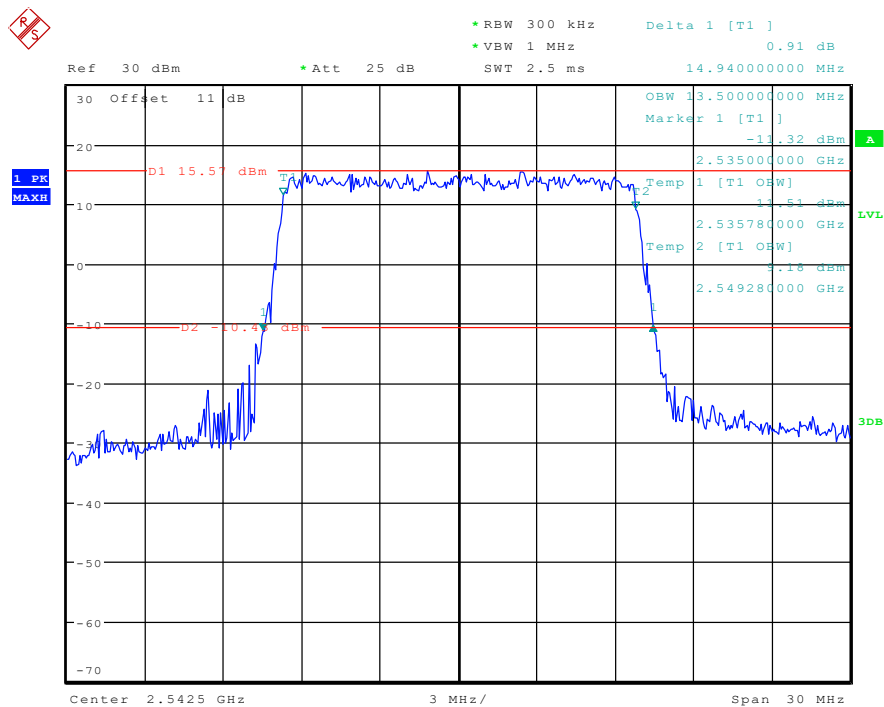


Date: 25.NOV.2022 11:58:06

Band 41_15 MHz_Middle_QPSK_RB75#0

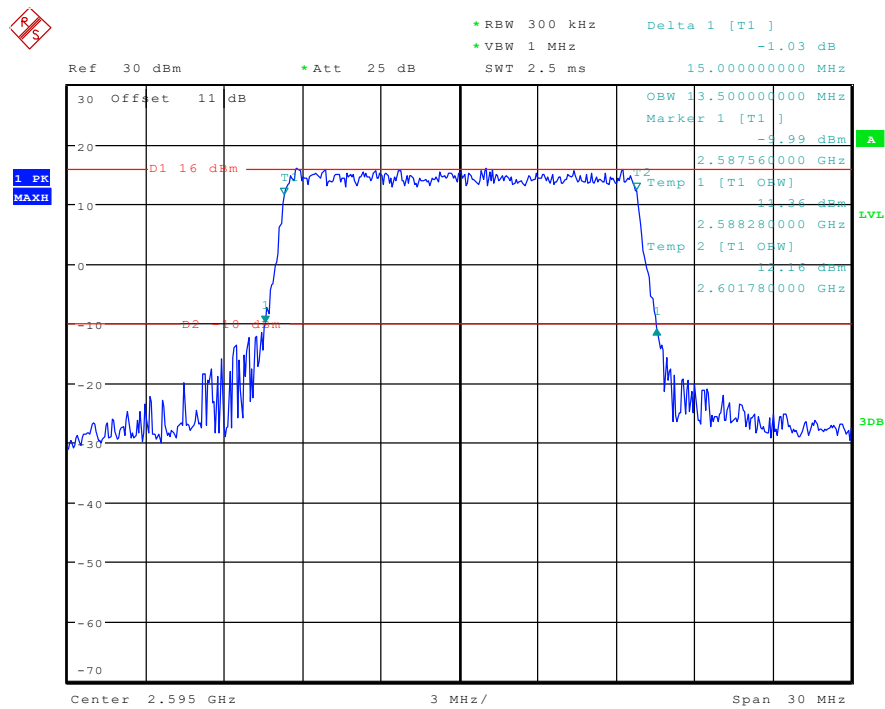


Date: 25.NOV.2022 11:58:32

Band 41_15 MHz_Middle_16QAM_RB75#0

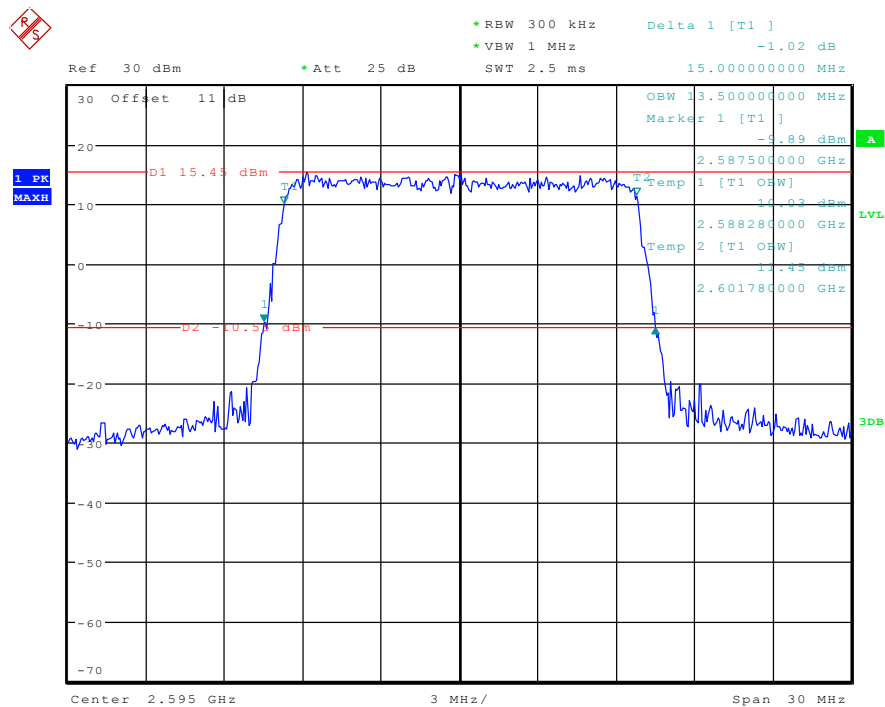


Date: 25.NOV.2022 11:58:54

Band 41_15 MHz_High_QPSK_RB75#0

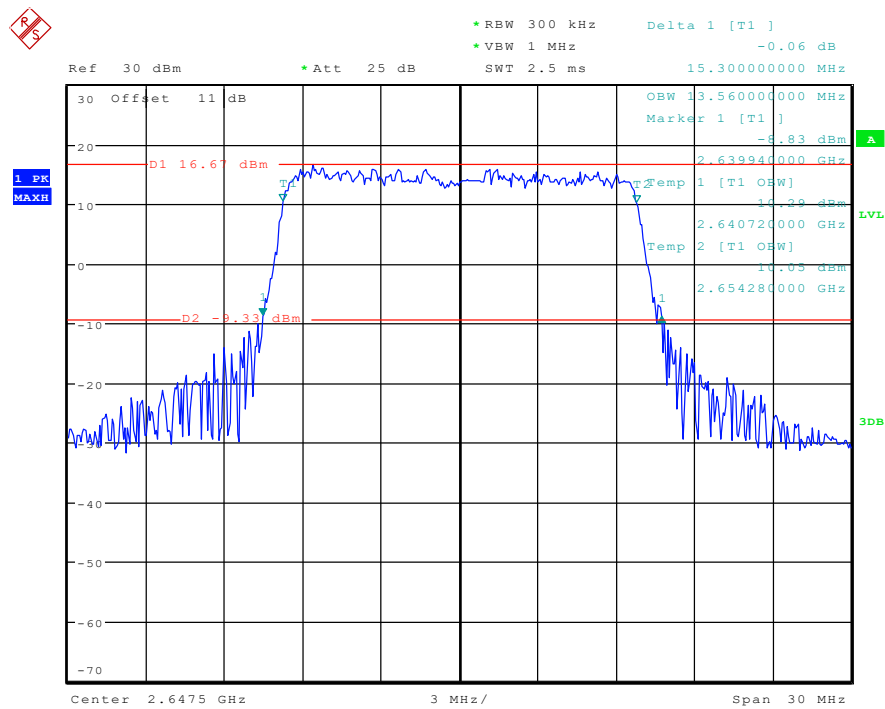


Date: 25.NOV.2022 11:59:23

Band 41_15 MHz_High_16QAM_RB75#0

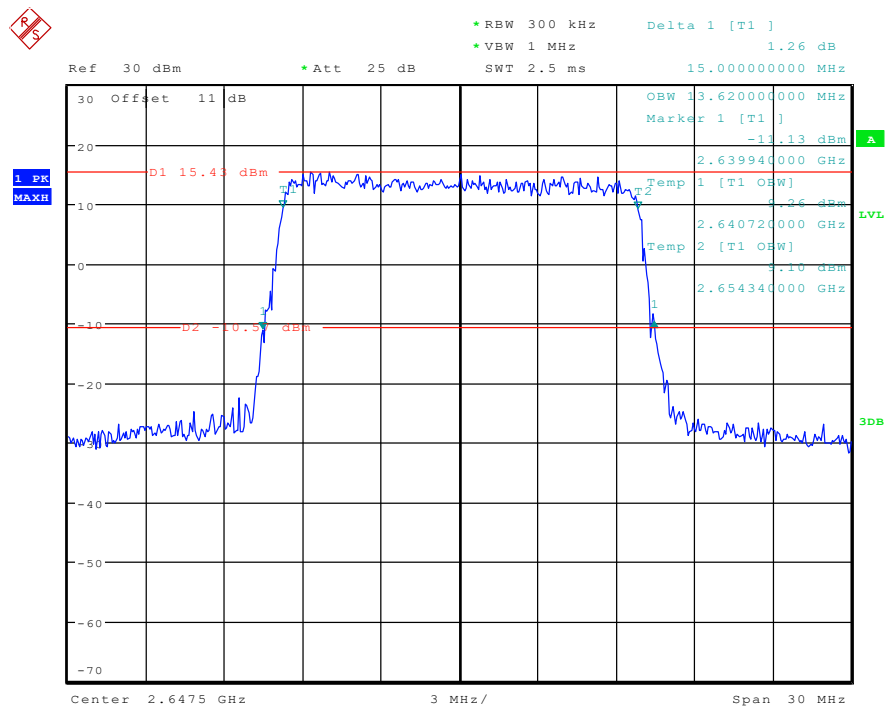


Date: 25.NOV.2022 11:59:42

Band 41_20 MHz_Low_QPSK_RB100#0

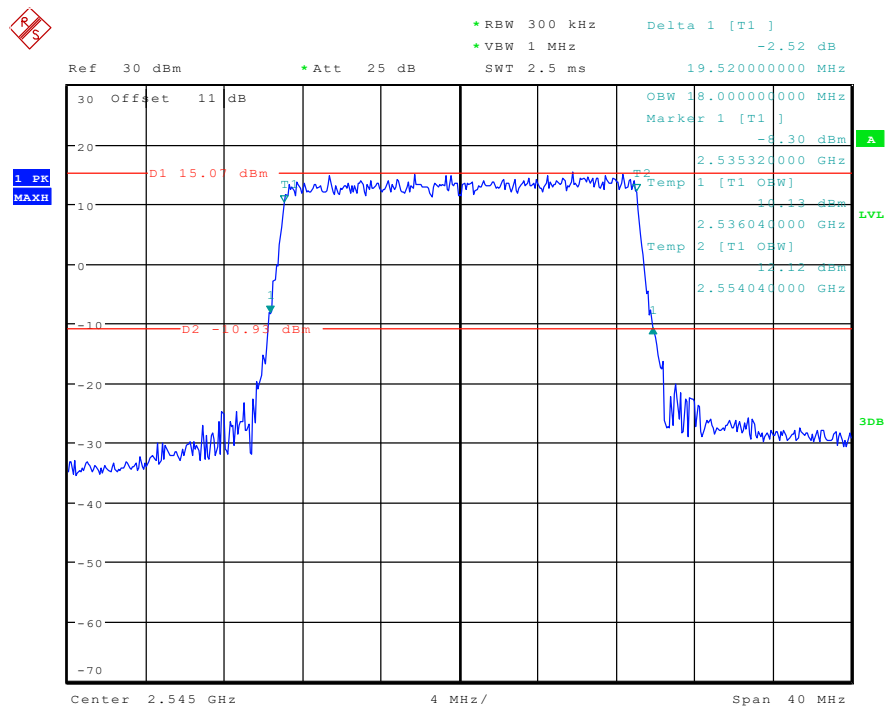


Date: 25.NOV.2022 12:00:39

Band 41_20 MHz_Low_16QAM_RB100#0

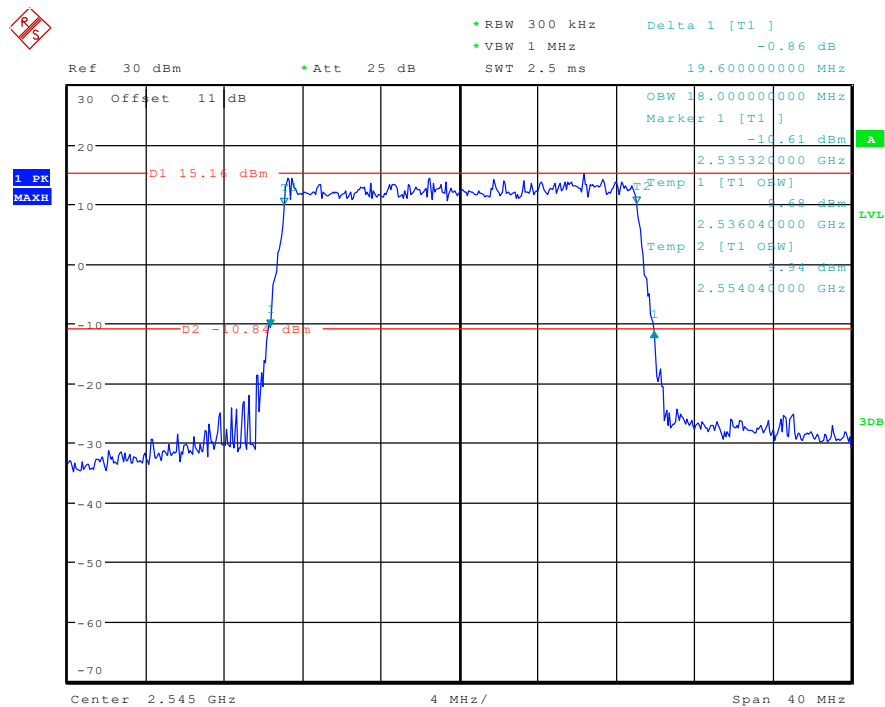


Date: 25.NOV.2022 12:01:02

Band 41_20 MHz_Middle_QPSK_RB100#0

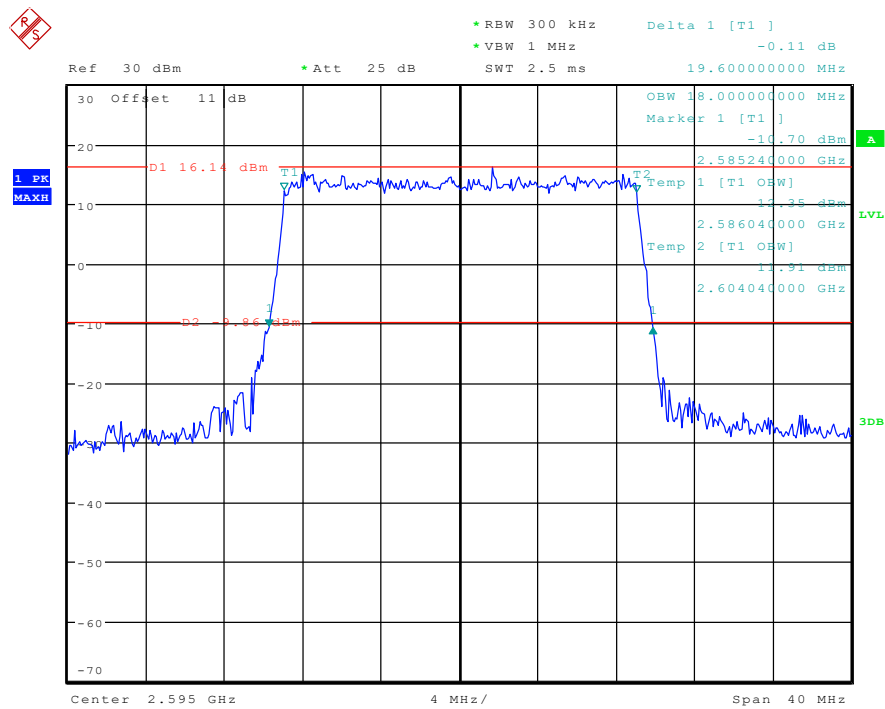


Date: 25.NOV.2022 12:01:28

Band 41_20 MHz_Middle_16QAM_RB100#0

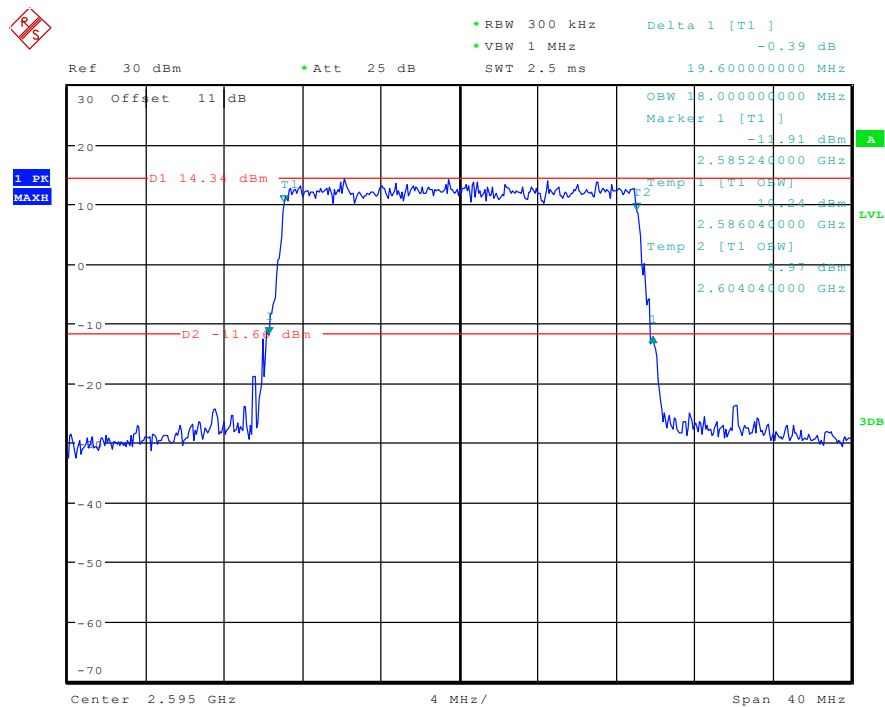


Date: 25.NOV.2022 12:01:47

Band 41_20 MHz_High_QPSK_RB100#0

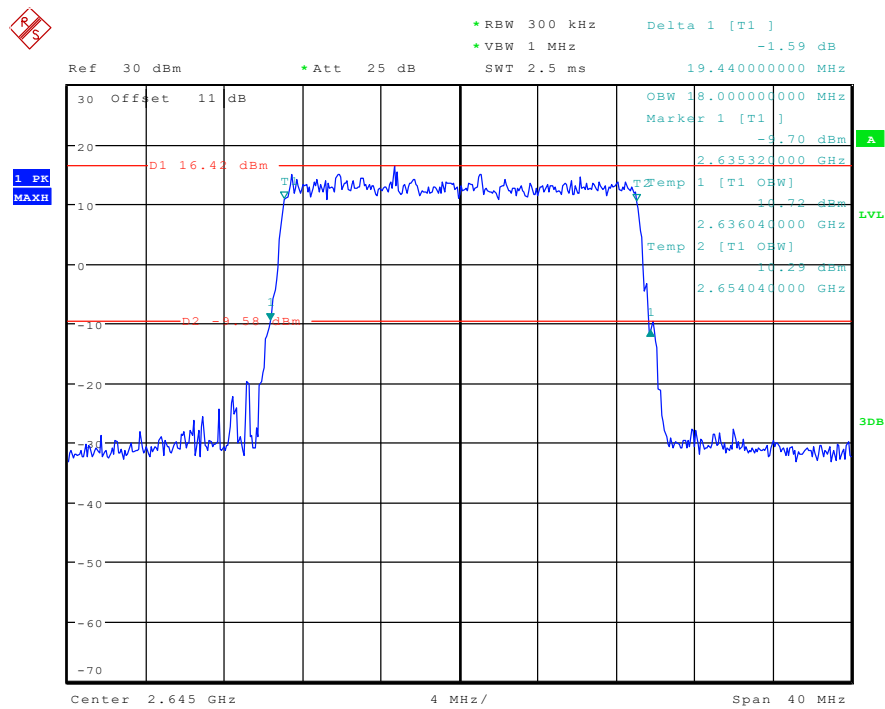

Date: 25.NOV.2022 12:02:07

Band 41_20 MHz_High_16QAM_RB100#0

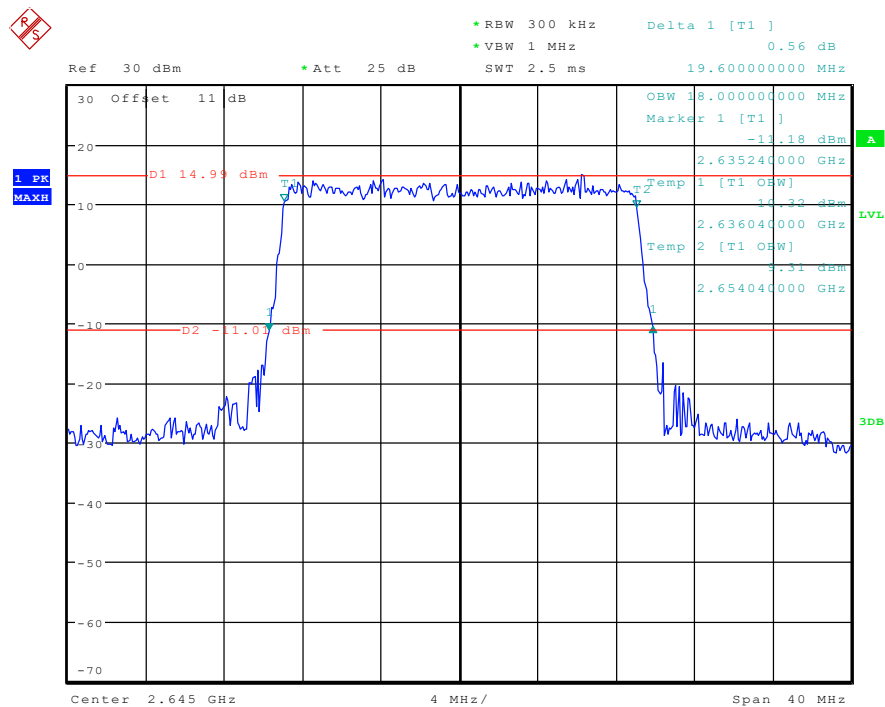

Date: 25.NOV.2022 12:02:32