

Test Report

5GHz Spurious Emissions

AIR-RM3010L-B-K9

FCC ID: LDK102094 IC: 2461B- 102094

Also Covers:

AIR-RM3010L -A-K9 AIR-RM3010L -N-K9 AIR-RM3010L-S-K9 AIR-RM3010L-T-K9 AIR-RM3010L-Z-K9

Receiver Spurious up to 40 GHz

Against the following Specifications:

CFR47 Part 15.247

RSS-210 LP0002

Cisco Systems

170 West Tasman Drive San Jose, CA 95134

Test Engineer: Bad Shallow

Date: 7/8/2015

Revision 1



This test report has been electronically authorized and archived using the CISCO Engineering Document Control system.

Contents

Section 1: Overview	3
1.1 Test Summary	3
Section 2: Assessment Information	4
2.1 General	4
2.2 Date of testing	5
2.3 Report Issue Date	5
2.4 Testing facilities	5
2.5 Equipment Assessed (EUT)	5
2.6 EUT Description	5
Appendix A: Emission Test Results	7
Radiated Spurious Emissions	7
Appendix B: Test Equipment/Software Used to perform the test	20



Section 1: Overview

1.1 Test Summary

The samples were assessed against the tests detailed in section 3 under the requirements of the following specifications:

Emission	Immunity
CFR47 Part 15	N/A
RSS-210	
LP0002	

The specifications listed above represent actual tests performed to demonstrate compliance against the specifications and basic standards listed on the front cover of this report. This list is not a one to one match to the front cover for one or more of the following reasons.

- 1. Basic standards call up many different test phenomena specifications such as the 61000-4-X series. The basic standards define which elements and levels shall be applied from these specifications and as such it is not appropriate to list the individual specifications on the front cover.
- 2. A Standard listed on the front cover may be required in a particular country but is not appropriate for the particular technologies included in the equipment under test. E.g. You cannot test a DC product to the mains Harmonics requirements in EN61000-3-2. See section 3.2.
- 3. Test results against a particular standard or specification may be included in a different test report. See section 3.2 for an EDCS reference of this data.
- 4. Where appropriate, Cisco may have substituted a later revision of a basic standard to those referenced in the specification on the front sheet of this test report. This decision was based upon improved test methodology and repeatability and/or where the newer revision represented a more stringent test.
- 5. Where relevant, testing has been carried out to the requirements of both EN and IEC Specifications. This was possible because of the similarities of the test methods involved and the Cisco EMC test procedures.
- 6. Testing may have been performed to an equivalent test that satisfies the requirements of the standards and specifications listed on the front cover of the report. See section 3.2.
- Where radiated emissions testing has been performed to EN55022/CISPR22 the additional requirements of VCCI: V- 3/2006.04, EN55022: 1994 +A1/2 and CAN/CSA- CISPR 22-02 have also been evaluated unless otherwise stated.
- 8. Testing to the requirements of CFR47 Part 15 was performed against the CISPR22 limits. The results are therefore deemed satisfactory evidence of compliance with Industry Canada Interference Causing Equipment Standard ICES-003.
- 9. Where assessment has been performed to CISPR24, all the applicable test requirements may have not been covered. Refer to the results section for the tests performed.

Notes:

- 1) Where a specification listed on the front cover of this report has deviations from the basic standards listed above, the additional technical requirements of the specification were also assessed.
- 2) Where appropriate, Cisco may have substituted a later revision of a basic standard to those referenced in the specification on the front sheet of this test report. This decision was based upon improved test methodology and repeatability and/or where the newer revision represented a more stringent test.
- 3) Where relevant, testing has been carried out to the requirements of both EN and IEC Specifications. This was possible because of the similarities of the test methods involved and the Cisco EMC test procedures.

Section 2: Assessment Information

2.1 General

This report contains an assessment of an apparatus against Electromagnetic Compatibility Standards based upon tests carried out on the samples submitted. The testing was performed by and for the use of Cisco systems Inc.

With regard to this assessment, the following points should be noted:

- a) The results contained in this report relate only to the items tested and were obtained in the period between the date of the initial assessment and the date of issue of the report. Manufactured products will not necessarily give identical results due to production and measurement tolerances.
- b) The apparatus was set up and exercised using the configuration and modes of operation defined in the operations manual.
- c) Where relevant, the apparatus was only assessed using the susceptibility criteria defined in this report and the Test Assessment Plan (TAP).
- d) All testing was performed under the following environmental conditions:

Temperature 15°C to 35°C (54°F to 95°F)

Atmospheric Pressure 860mbar to 1060mbar (25.4" to 31.3")

Humidity 10% to 75*%

*[Where applicable] For ESD testing the humidity limits used were 30% to 60% and for EFT/B tests the humidity limits used were 25% to 75%.

e) All AC testing was performed at one or more of the following supply voltages:

110V 60 Hz (+/-20%) 220V 50 Hz (+/-20%)

This report must not be reproduced except in full, without written approval of Cisco Systems.

2.2 Date of testing

February - March 2015

2.3 Report Issue Date

Cisco uses an electronic system to issue, store and control the revision of test reports. This system is called the Engineering Document Control System (EDCS). The actual report issue date is embedded into the original file on EDCS. Any copies of this report, either electronic or paper, that are not on EDCS must be considered uncontrolled.

2.4 Testing facilities

This assessment was performed by:

Testing Laboratory

Cisco Systems, Inc. 170 West Tasman Drive San Jose, CA 95134



Testing - Certificate Number: 1178-01

Test Engineers

Bud Chiller Dennis Thai

2.5 Equipment Assessed (EUT)

AIR-RM3010L-B-K9

2.6 EUT Description

The AIR-RM3010L Series Cisco Aironet 802.11ac Radio Modules support the following 5GHz modes of operation. The modes are further defined in the radio Theory of Operation. The modes included in this report represent the worst case data for all modes.

Non HT/VHT20, One Antenna, 6 to 54 Mbps Non HT/VHT20, Two Antennas, 6 to 54 Mbps Non HT/VHT20, Three Antennas, 6 to 54 Mbps Non HT/VHT20, Four Antennas, 6 to 54 Mbps

HT/VHT20, One Antenna, M0 to M7, M0.0 to M9.0 HT/VHT20, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT20, Three Antennas, M0 to M7, M0.0 to M9.0

Page No: 5 of 20



HT/VHT20, Four Antennas, M0 to M7, M0.0 to M9.0

HT/VHT20 STBC, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT20 STBC, Three Antennas, M0 to M7, M0.0 to M9.0 HT/VHT20 STBC, Four Antennas, M0 to M7, M0.0 to M9.0

Non HT/VHT40 Duplicate, One Antenna, 6 to 54 Mbps Non HT/VHT40 Duplicate, Two Antennas, 6 to 54 Mbps Non HT/VHT40 Duplicate, Three Antennas, 6 to 54 Mbps Non HT/VHT40 Duplicate, Four Antennas, 6 to 54 Mbps

HT/VHT40, One Antenna, M0 to M7, M0.0 to M9.0 HT/VHT40, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT40, Three Antennas, M0 to M7, M0.0 to M9.0 HT/VHT40, Four Antennas, M0 to M7, M0.0 to M9.0

HT/VHT40 STBC, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT40 STBC, Three Antennas, M0 to M7, M0.0 to M9.0 HT/VHT40 STBC, Four Antennas, M0 to M7, M0.0 to M9.0

Non HT/VHT80 Duplicate, One Antenna, 6 to 54 Mbps Non HT/VHT80 Duplicate, Two Antennas, 6 to 54 Mbps Non HT/VHT80 Duplicate, Three Antennas, 6 to 54 Mbps Non HT/VHT80 Duplicate, Four Antennas, 6 to 54 Mbps

HT/VHT80, One Antenna, M0 to M7, M0.0 to M9.0 HT/VHT80, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT80, Three Antennas, M0 to M7, M0.0 to M9.0 HT/VHT80, Four Antennas, M0 to M7, M0.0 to M9.0

HT/VHT80 STBC, Two Antennas, M0 to M7, M0.0 to M9.0 HT/VHT80 STBC, Three Antennas, M0 to M7, M0.0 to M9.0 HT/VHT80 STBC, Four Antennas, M0 to M7, M0.0 to M9.0

Appendix A: Emission Test Results

Radiated Spurious Emissions

15.205 / RSS-210 2.7:

Radiated emissions which fall in the restricted bands, as defined in Section 15.205(a), must also comply with the radiated emission limits specified in Section 15.209(a) (see Section 15.205(c)).

Using Vasona, configure the spectrum analyzer as shown below (be sure to enter all losses between the transmitter output and the spectrum analyzer). Place the radio in continuous transmit mode.

Span: 1GHz – 18 GHz

Reference Level: 80 dBuV Attenuation: 10 dB Sweep Time: Coupled Resolution Bandwidth: 1MHz

Video Bandwidth: 1 MHz for peak, 1KHz for average

Detector: Peak

Maximize Turntable (find worst case table angle), Maximize Antenna (find worst case height)

Save 2 plots: 1) Average Plot (Vertical and Horizontal), Limit= 54dBuV @3m

2) Peak plot (Vertical and Horizontal), Limit = 74dBuV @3m

Place a marker at the end of the restricted band closest to the transmit frequency to show compliance. Also measure any emissions in the restricted bands.

This report represents the worst case data for all supported operating modes and antennas. There are no measurable emissions above 18 GHz.




Transmitter Radiated Spurious Emissions







Radiated Transmitter Spurs, 5180MHz, All Rates, All Modes, Peak 1-18 GHz

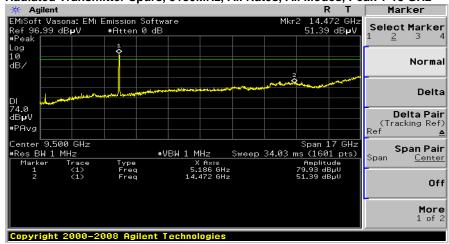





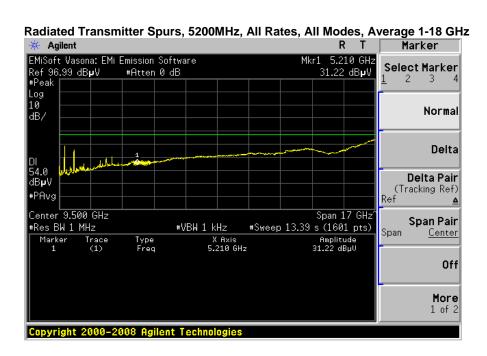

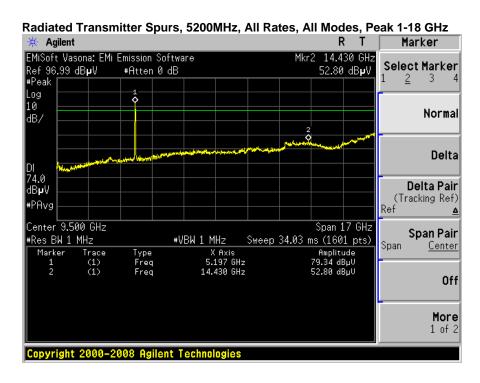





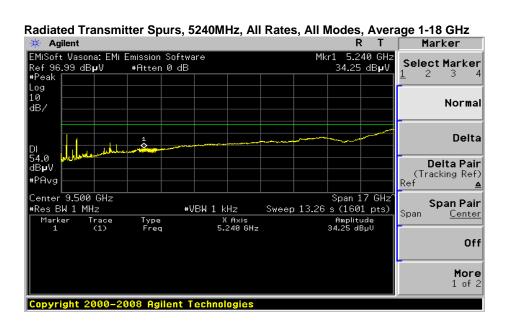

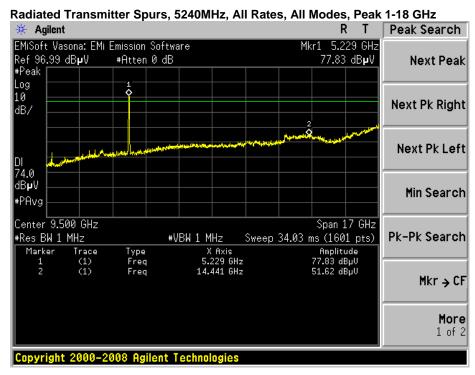





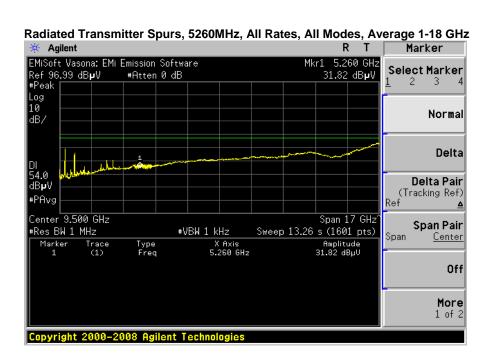

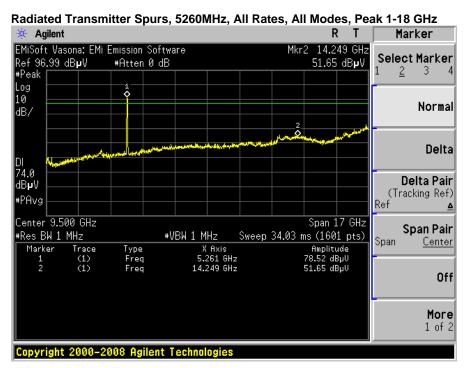





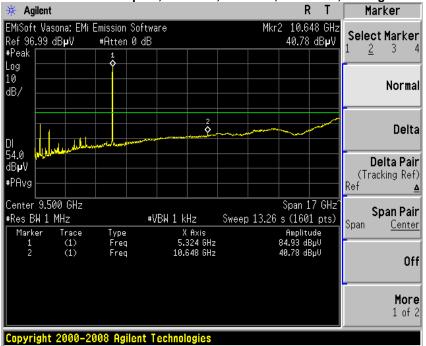


Radiated Transmitter Spurs, 5320MHz, All Rates, All Modes, Peak 1-18 GHz








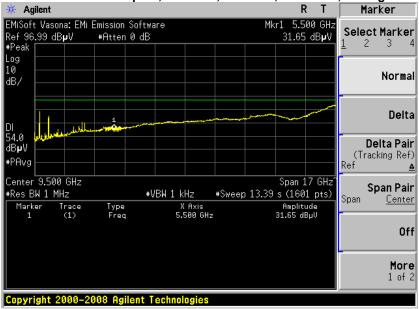


Radiated Transmitter Spurs, 5500MHz, All Rates, All Modes, Peak 1-18 GHz

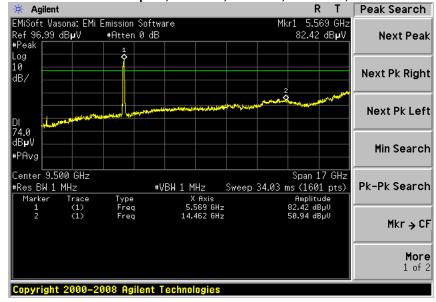






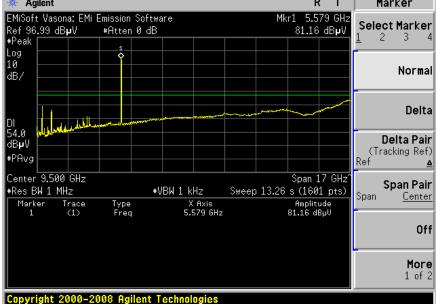


Radiated Transmitter Spurs, 5580MHz, All Rates, All Modes, Peak 1-18 GHz

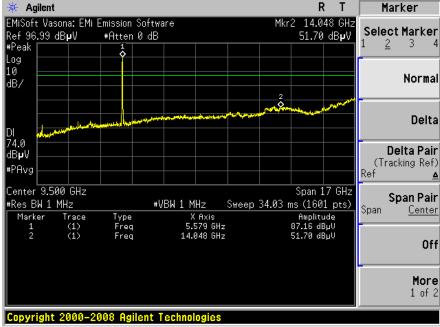


Copyright 2000-2008 Agilent Technologies



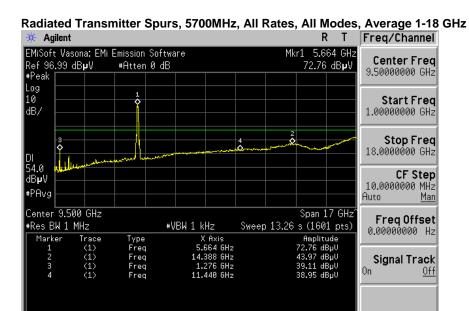


Radiated Transmitter Spurs, 5700MHz, All Rates, All Modes, Peak 1-18 GHz Trace EMiSoft Vasona: EMi Emission Software Mkr1 5.696 GHz Trace Ref 96.99 dB**µ**V #Atten 0 dB 81.64 dBpV 2 #Peak Log 10 Clear Write dB/ Max Hold Min Hold #PAvg Center 9.500 GHz Span 17 GHz #Res BW 1 MHz View #VBW 1 MHz #Sweep 34.45 ms (1601 pts) Amplitude 81.64 dBμV 51.69 dBμV 39.69 dBμV X Axis 5.696 GHz 14.674 GHz Туре Freq Freq Freq (1) (1) (1) 1.276 GHz Blank More 1 of 2 Copyright 2000-2008 Agilent Technologies




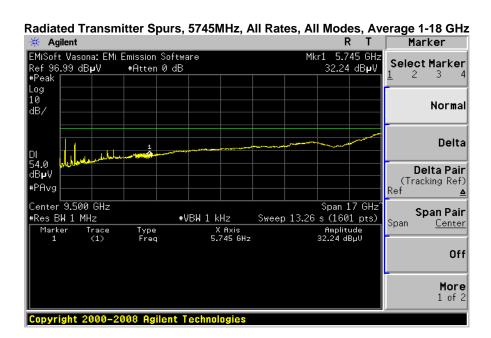


Radiated Transmitter Spurs, 5745MHz, All Rates, All Modes, Peak 1-18 GHz

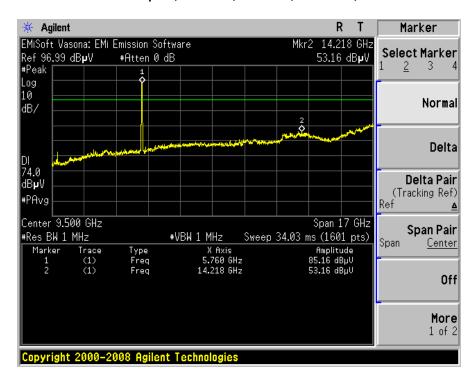






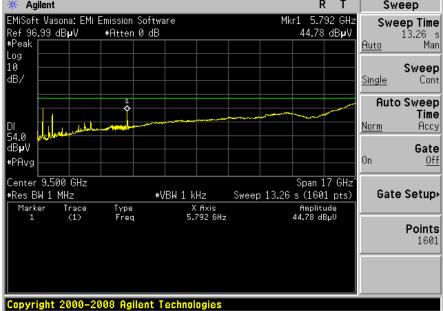


Radiated Transmitter Spurs, 5785MHz, All Rates, All Modes, Peak 1-18 GHz

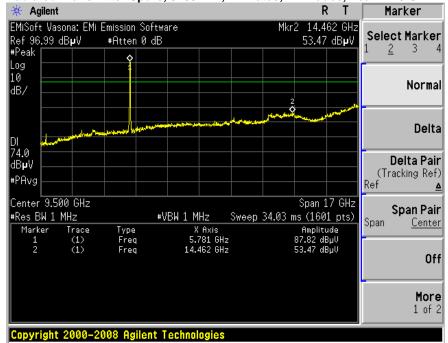






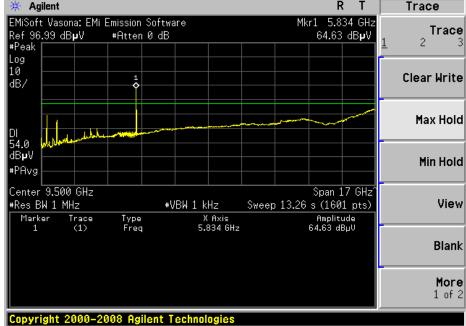

Radiated Transmitter Spurs, 5825MHz, All Rates, All Modes, Peak 1-18 GHz

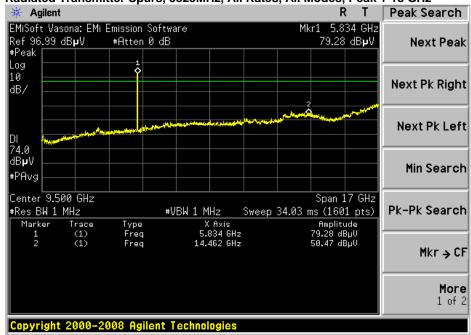



Test Equipment used:

Equipment No	Manufacturer	Model	Description	Last Cal	Next Cal Due Date
CIS008469	Bird	5-T-MN	50 Ohm, 5W Terminator,Type N	03-JUL-14	03-JUL-15
CIS008496	Fischer Custom Communications	FCC-450B-2.4- N	Instrumentation Limiter	20-MAY-14	20-MAY-15
CIS019206	TTE	H785-150K-50- 21378	High Pas Filter,Fo=150kHz	12-SEP-14	12-SEP-15
CIS029960	Fischer Custom Communications	FCC-LISN- 50/250-50-2-01	LISN	05-MAR-14	05-MAR-15
CIS029962	Fischer Custom Communications	FCC-LISN-PA- NEMA-5-15	Power Adaptor, Polarized 120VAC	05-MAR-14	05-MAR-15
CIS033456	Suhner	RG-223/U	10ft RG223 cable	22-JAN-14	22-JAN-15
CIS045050	Rohde & Schwarz	ESCI	EMI Test Receiver	28-OCT-14	28-OCT-15
CIS041933	Newport	iBTHP-5-DB9	5 inch Temp/RH/Press Sensor w/20ft cable	16-DEC-14	16-DEC-15
CIS-50378	Agilent	N9030A	PXA Spectrum Analyzer	27-FEB-15	17-JAN16

End