



11AC80SISO_Ant2_5775

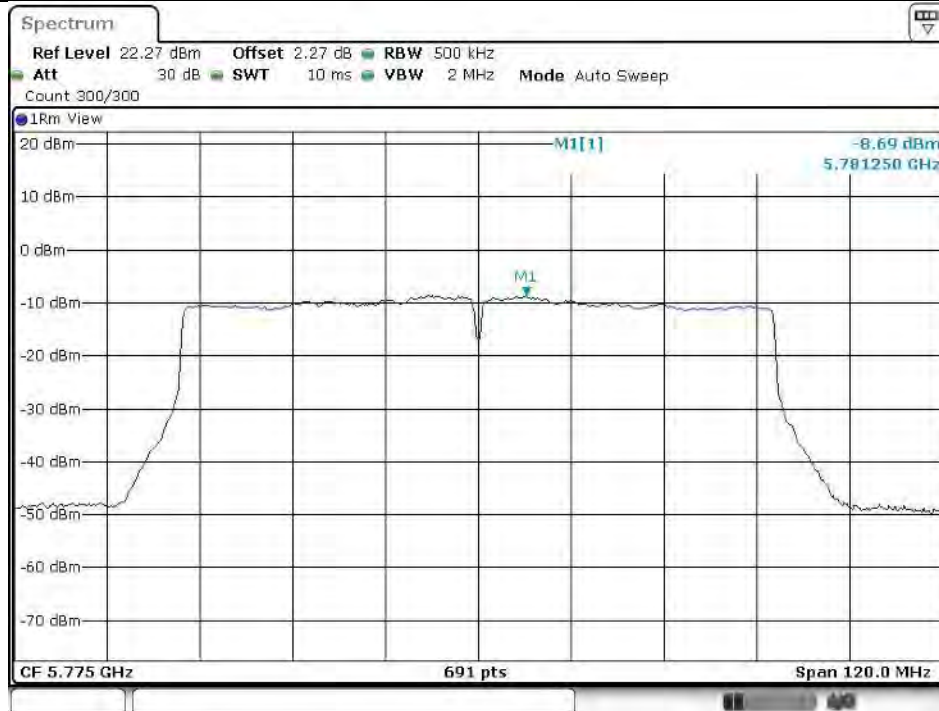


Date: 21.JAN.2021 09:49:22

11A-CDD_Ant1_5180

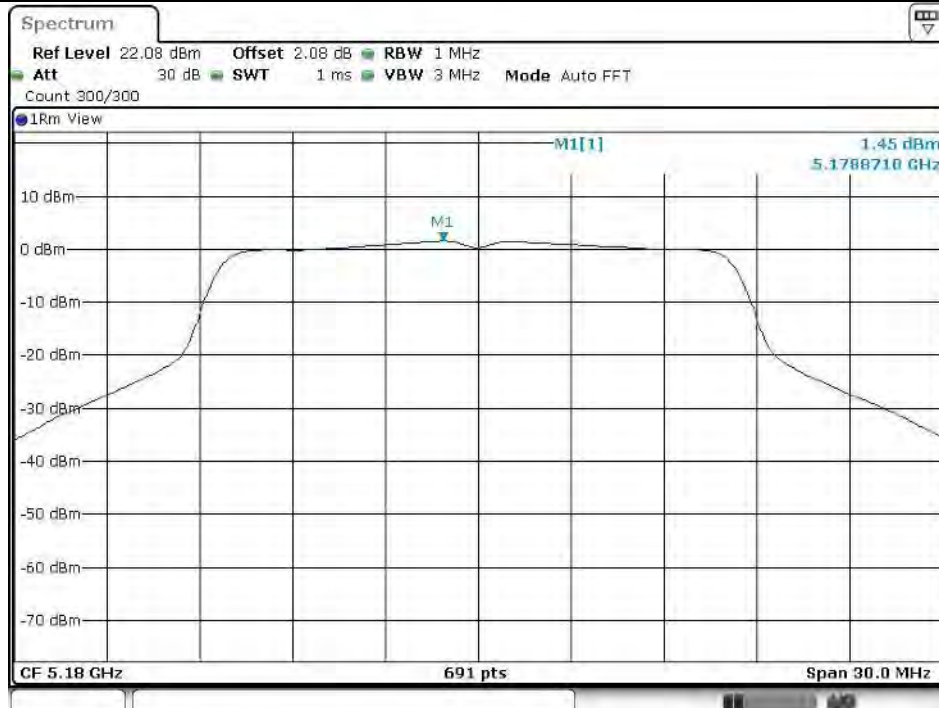


Date: 20.JAN.2021 16:06:36

11A-CDD_Ant2_5180

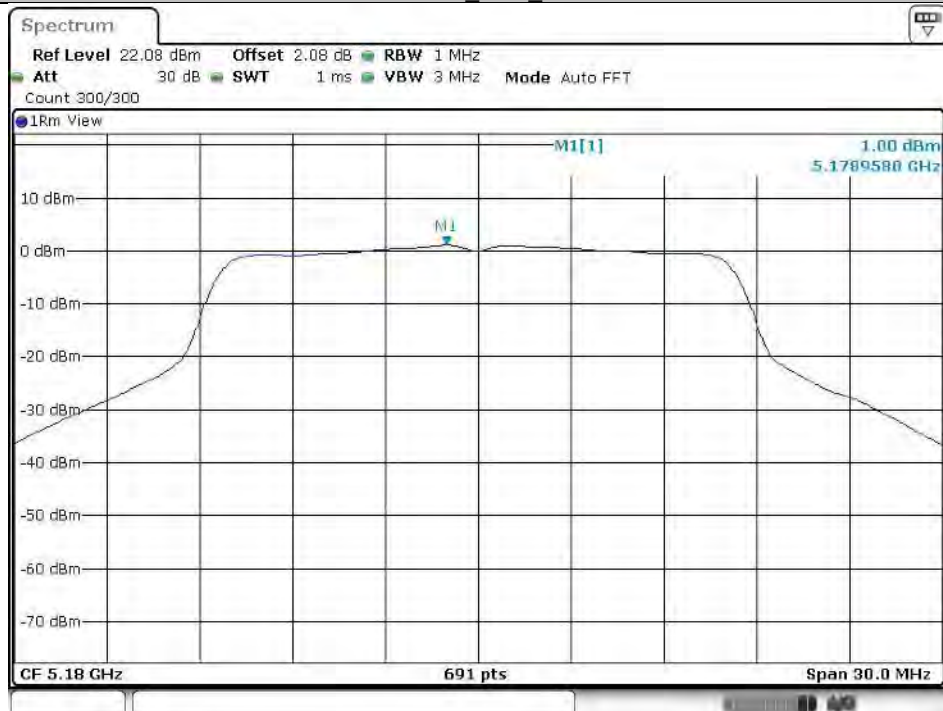


Date: 20.JAN.2021 19:19:40

11A-CDD_Ant1_5200

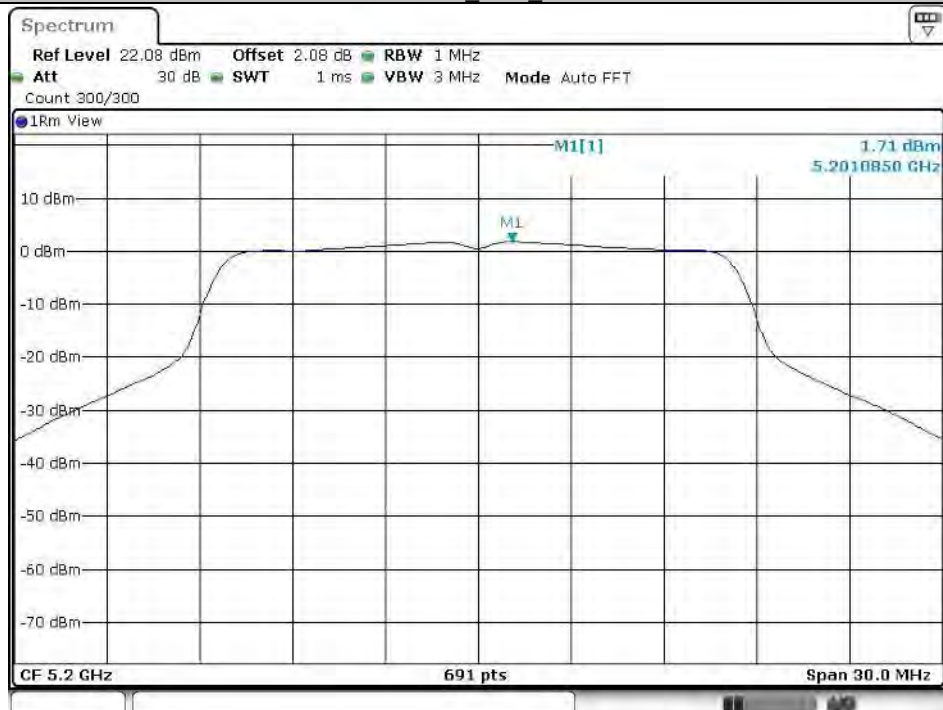


Date: 20.JAN.2021 16:07:01

11A-CDD_Ant2_5200

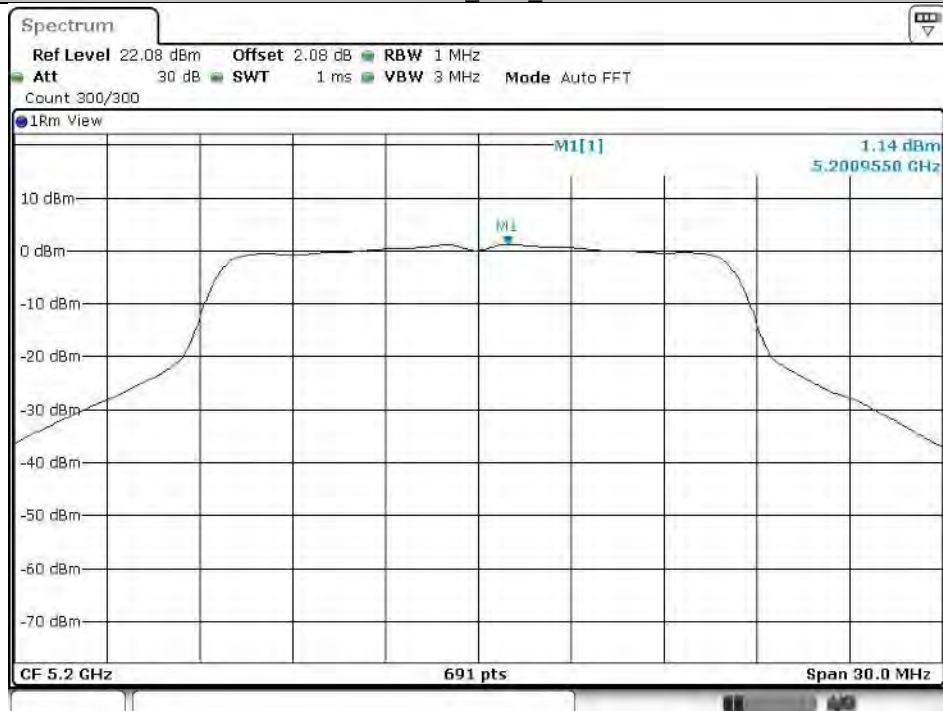


Date: 20.JAN.2021 19:20:20

11A-CDD_Ant1_5240

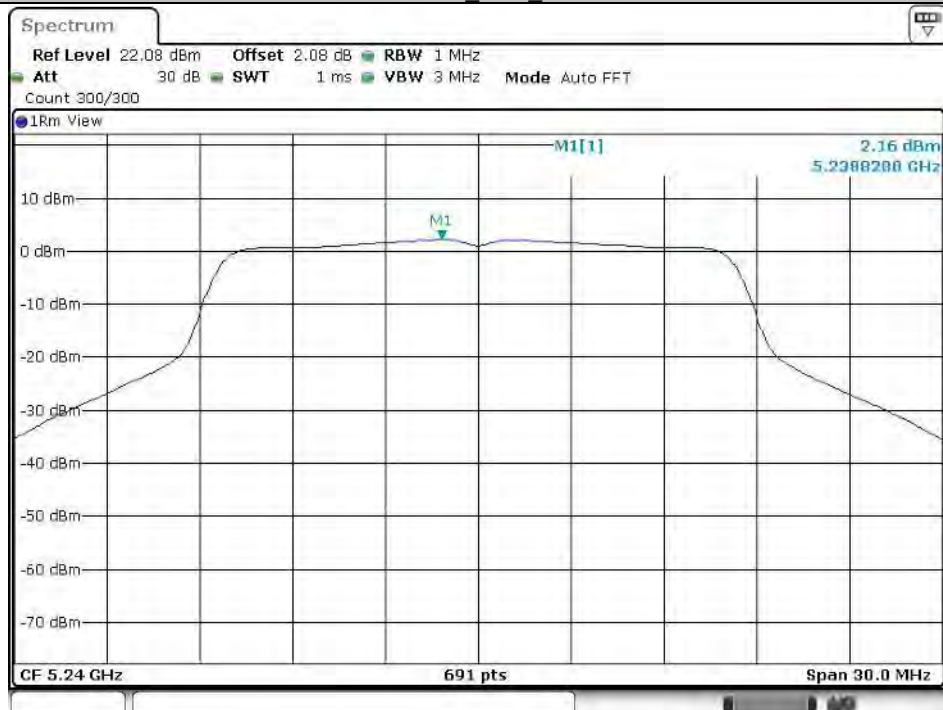


Date: 20.JAN.2021 16:07:48

11A-CDD_Ant2_5240

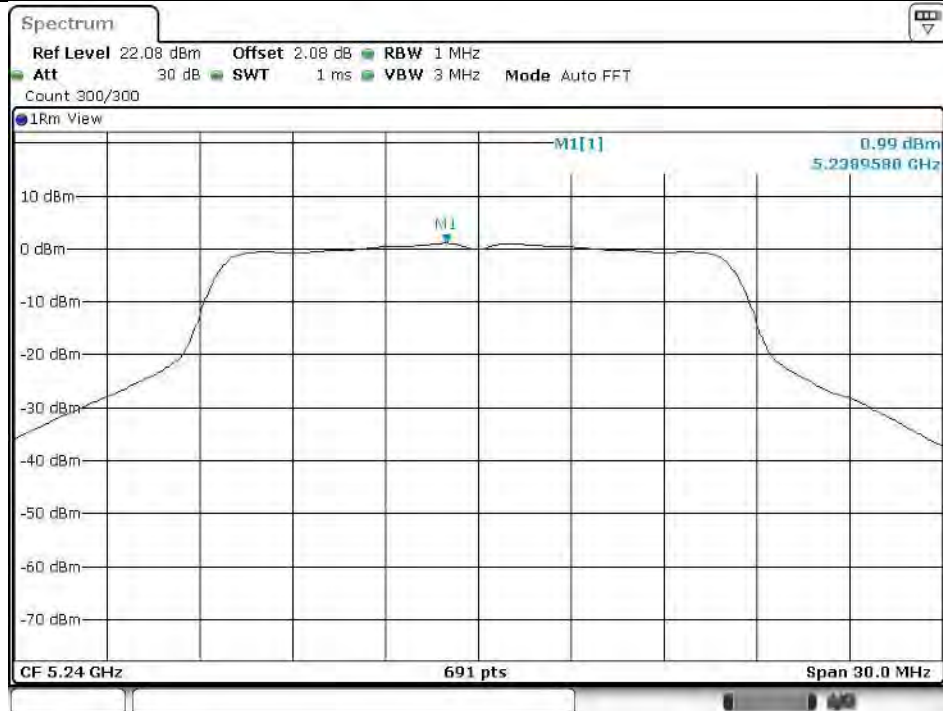


Date: 20.JAN.2021 19:20:57

11A-CDD_Ant1_5260

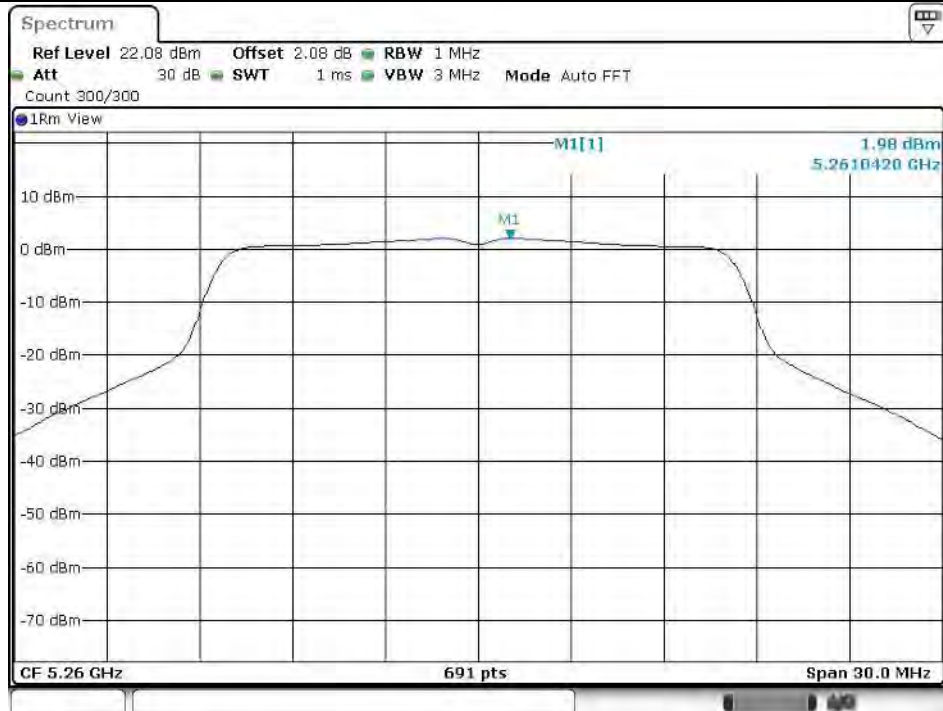


Date: 20.JAN.2021 16:08:17

11A-CDD_Ant2_5260

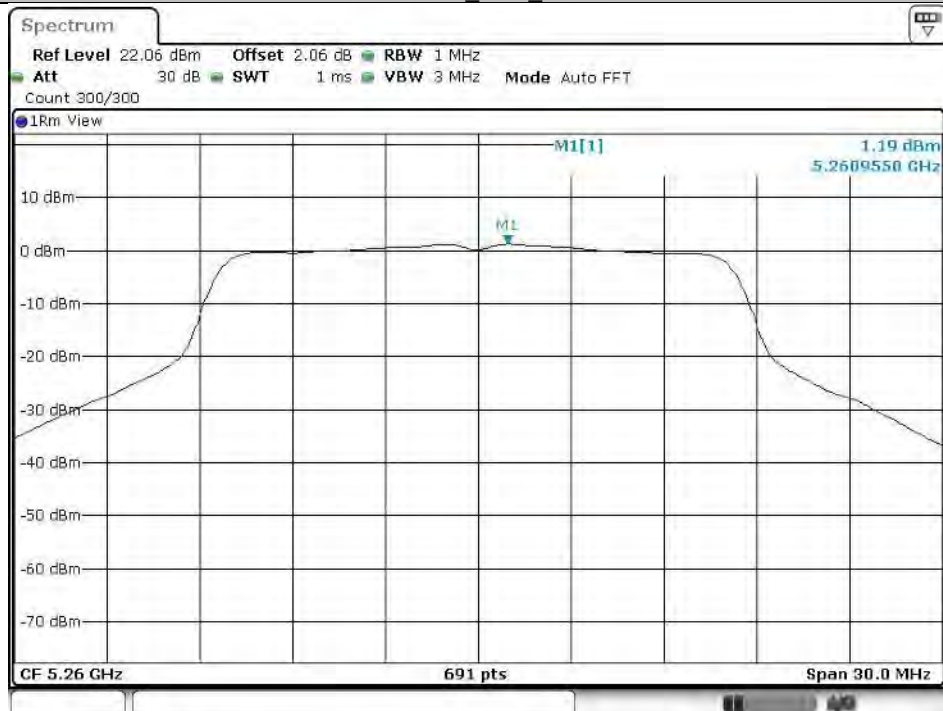


Date: 20.JAN.2021 19:21:44

11A-CDD_Ant1_5300

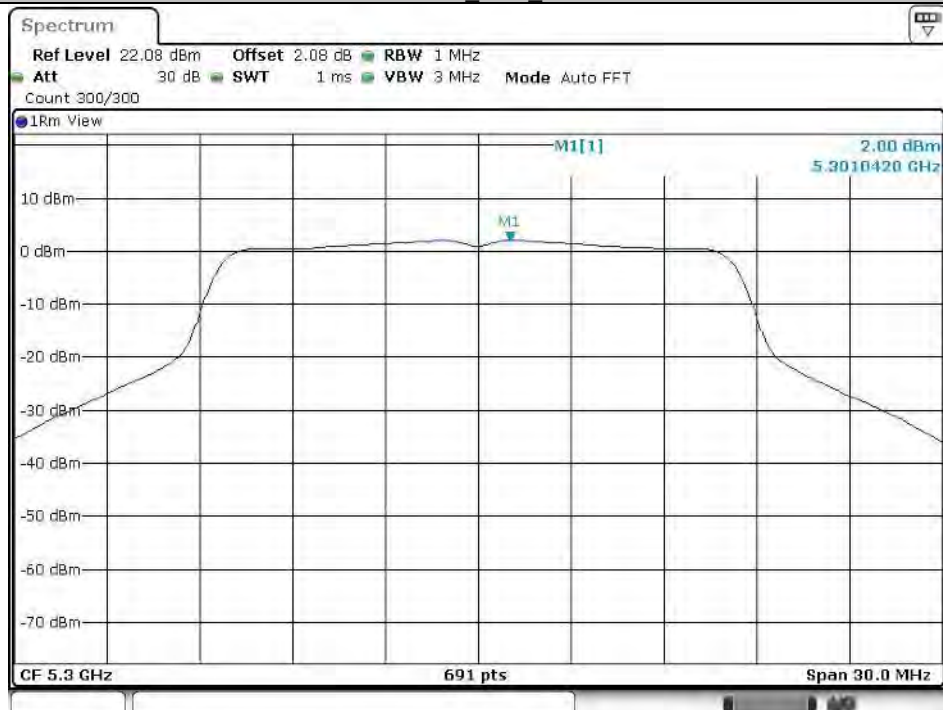


Date: 20.JAN.2021 16:08:45

11A-CDD_Ant2_5300

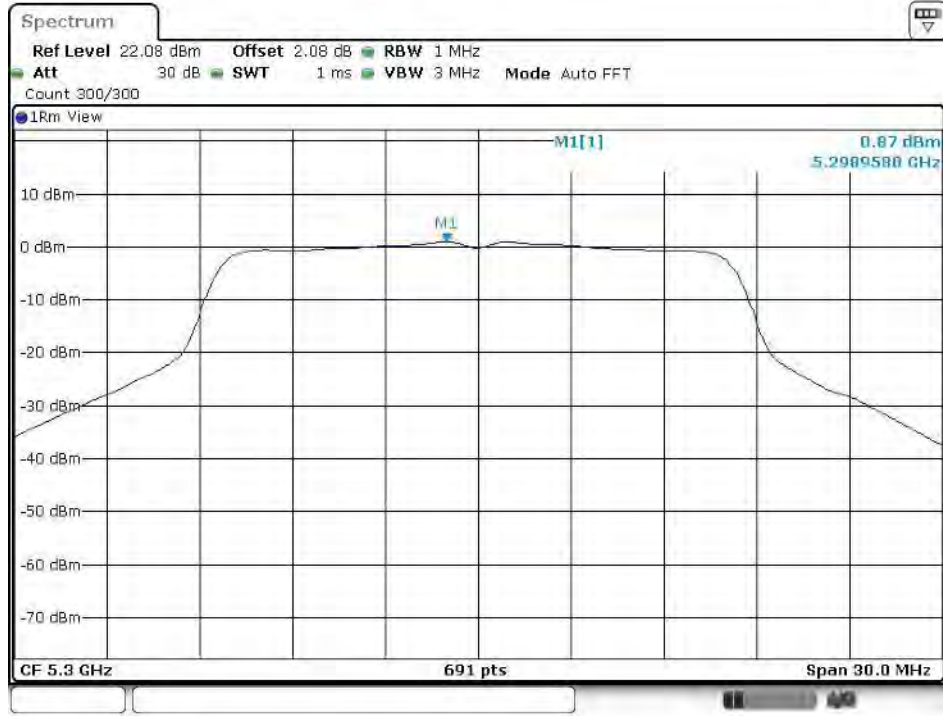


Date: 20.JAN.2021 19:22:15

11A-CDD_Ant1_5320

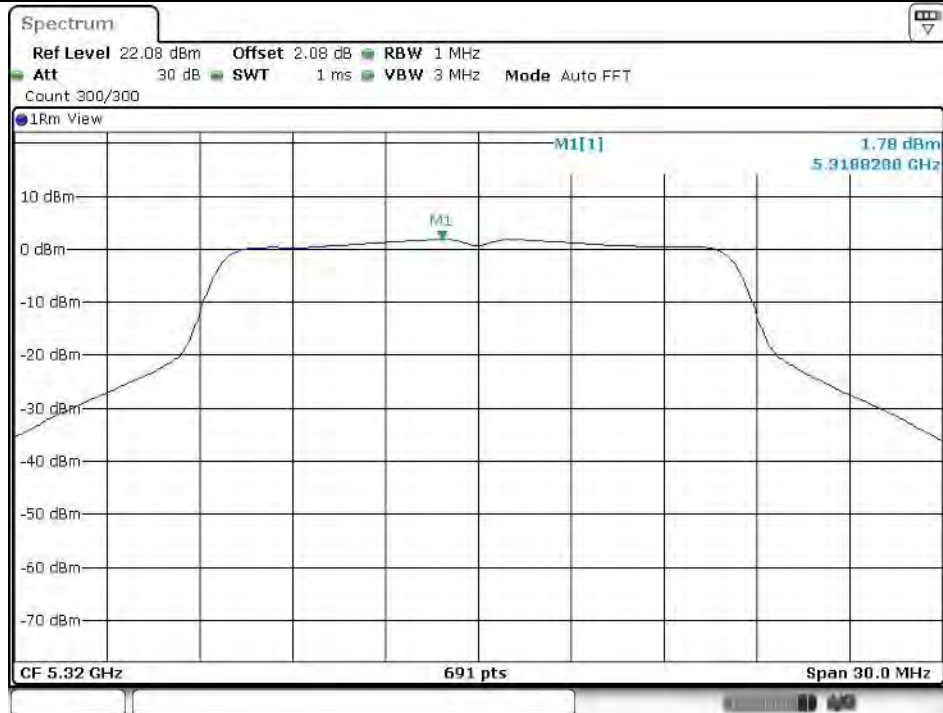


Date: 20.JAN.2021 16:09:14

11A-CDD_Ant2_5320

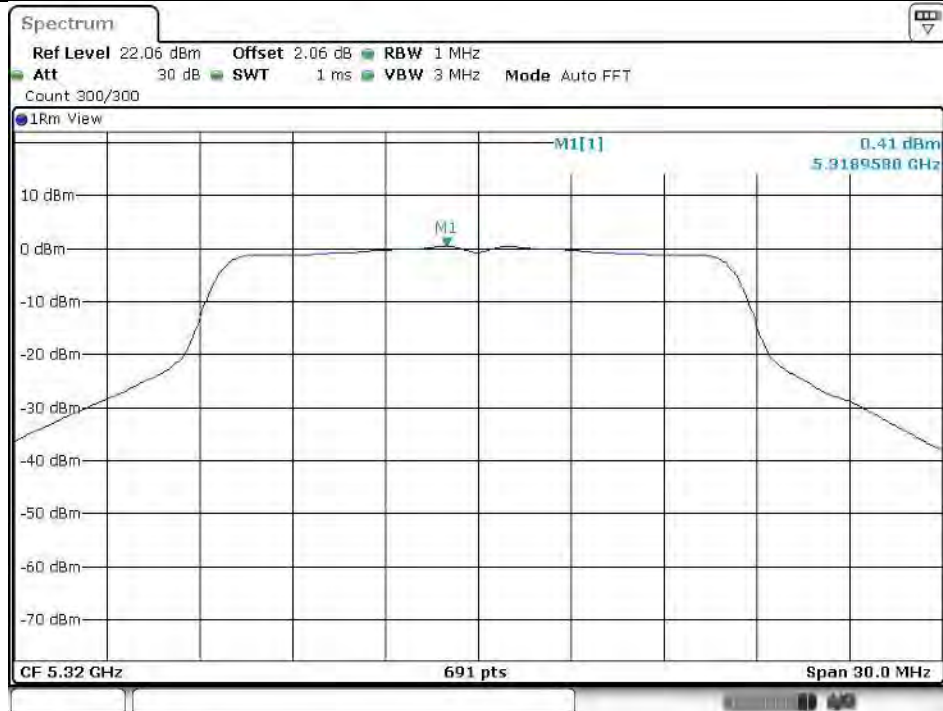


Date: 20.JAN.2021 19:22:45

11A-CDD_Ant1_5500

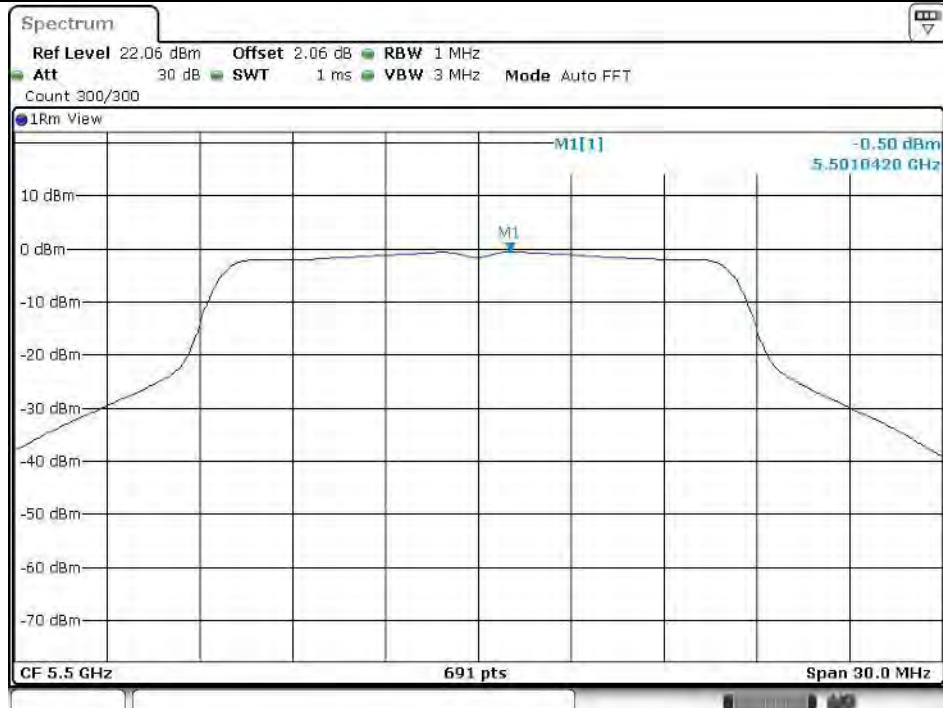


Date: 20.JAN.2021 16:09:49

11A-CDD_Ant2_5500

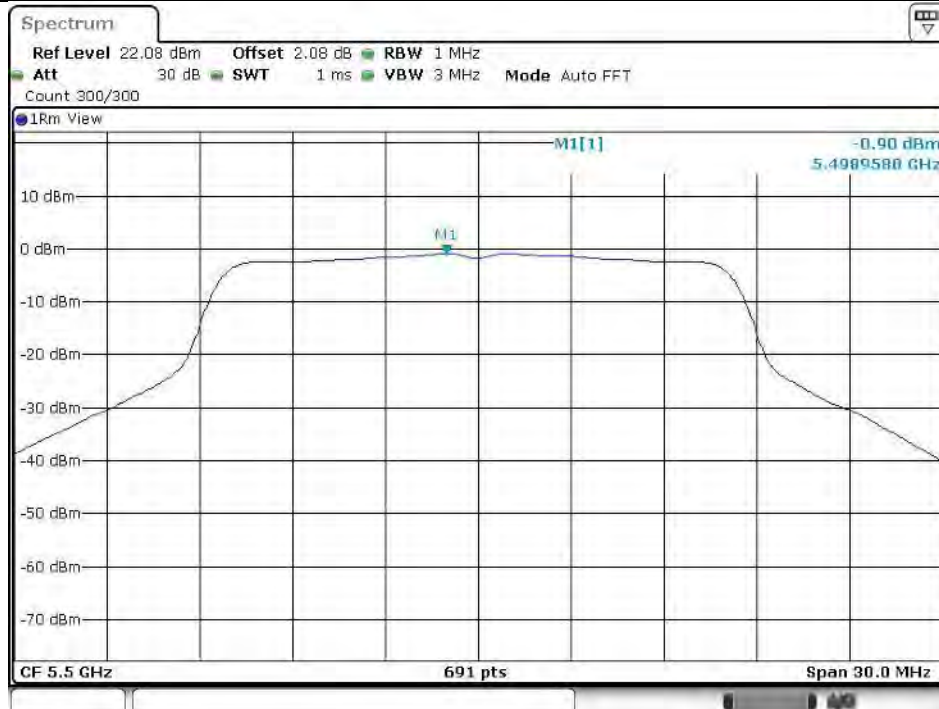


Date: 20.JAN.2021 19:23:49

11A-CDD_Ant1_5580

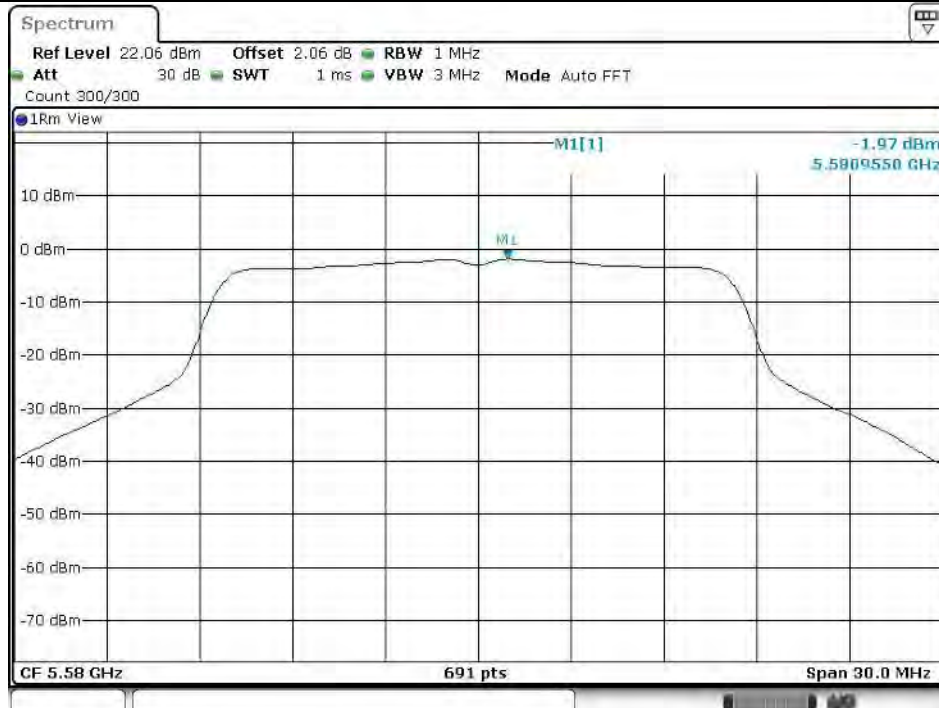


Date: 20.JAN.2021 19:58:24

11A-CDD_Ant2_5580

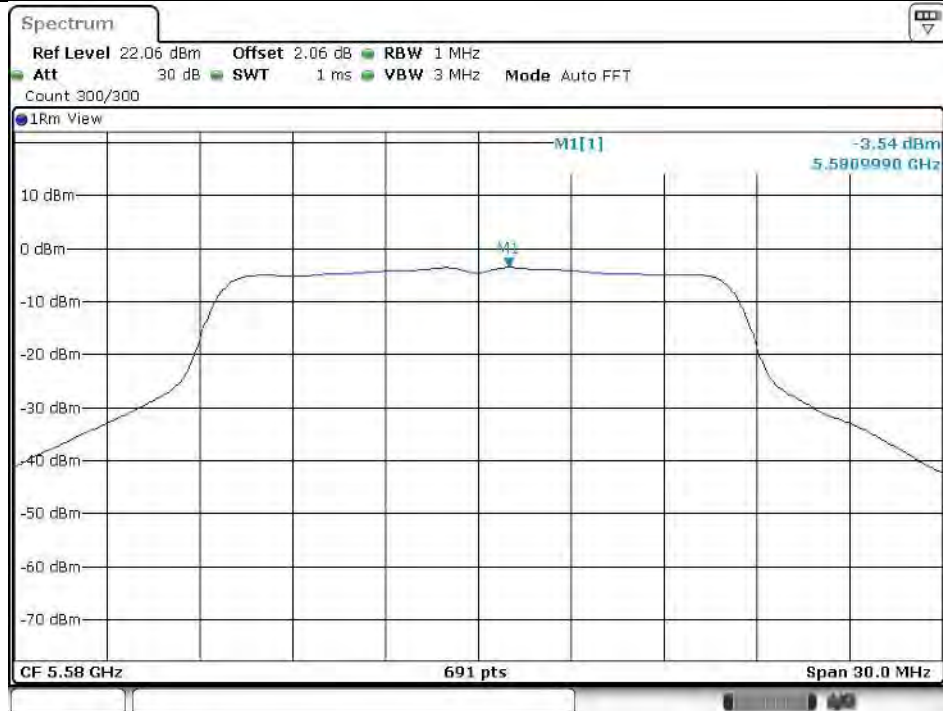


Date: 20.JAN.2021 19:24:36

11A-CDD_Ant1_5700

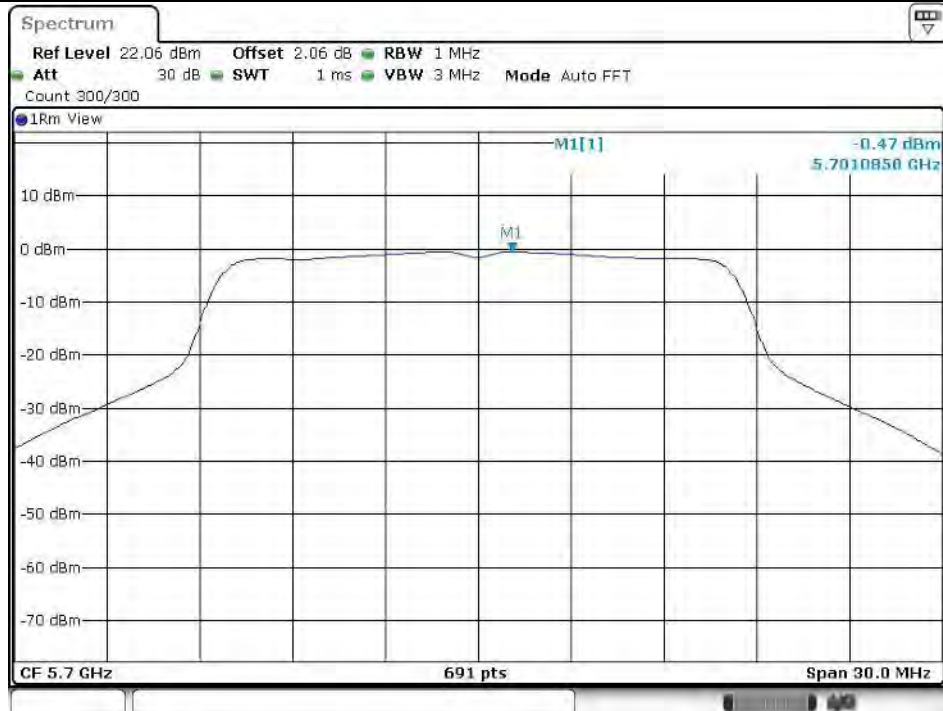


Date: 20.JAN.2021 16:11:43

11A-CDD_Ant2_5700

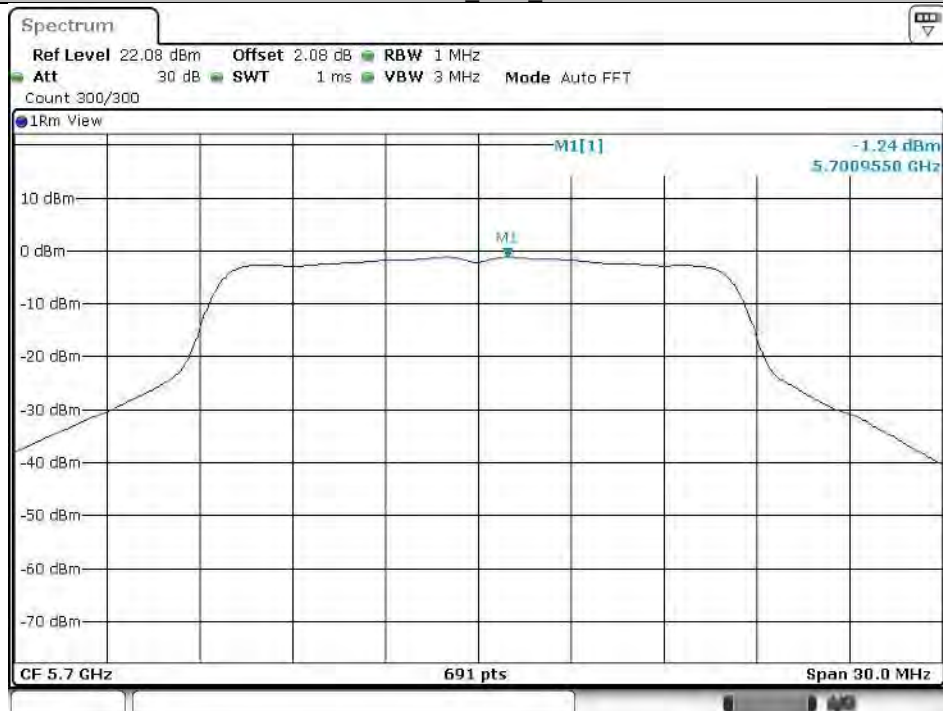


Date: 20.JAN.2021 19:25:51

11A-CDD_Ant1_5720

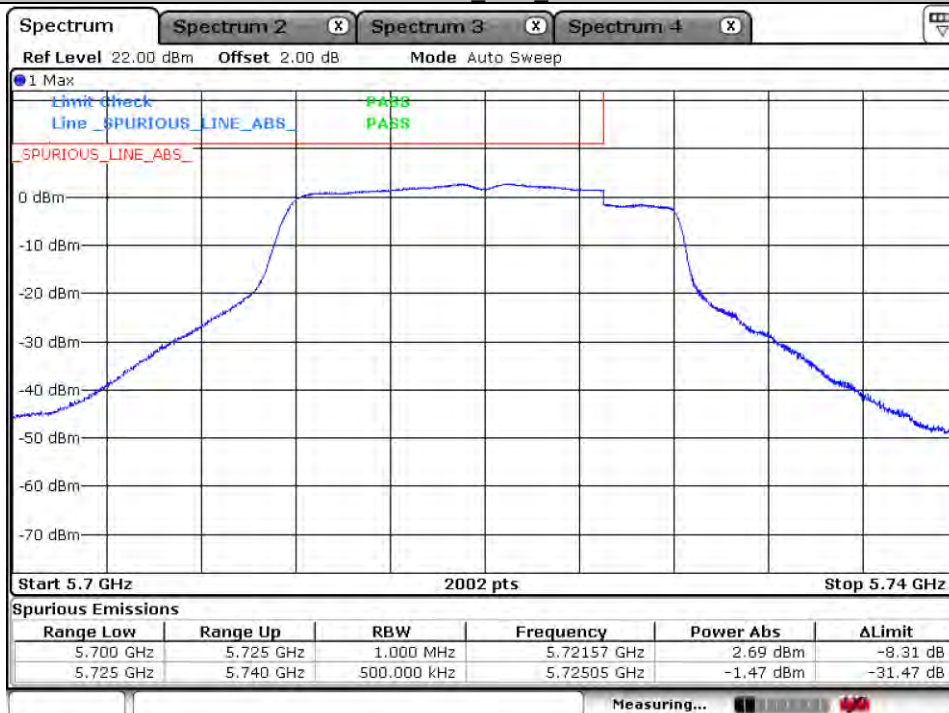


Date: 26 JAN 2021 11:00:00

11A-CDD_Ant2_5720

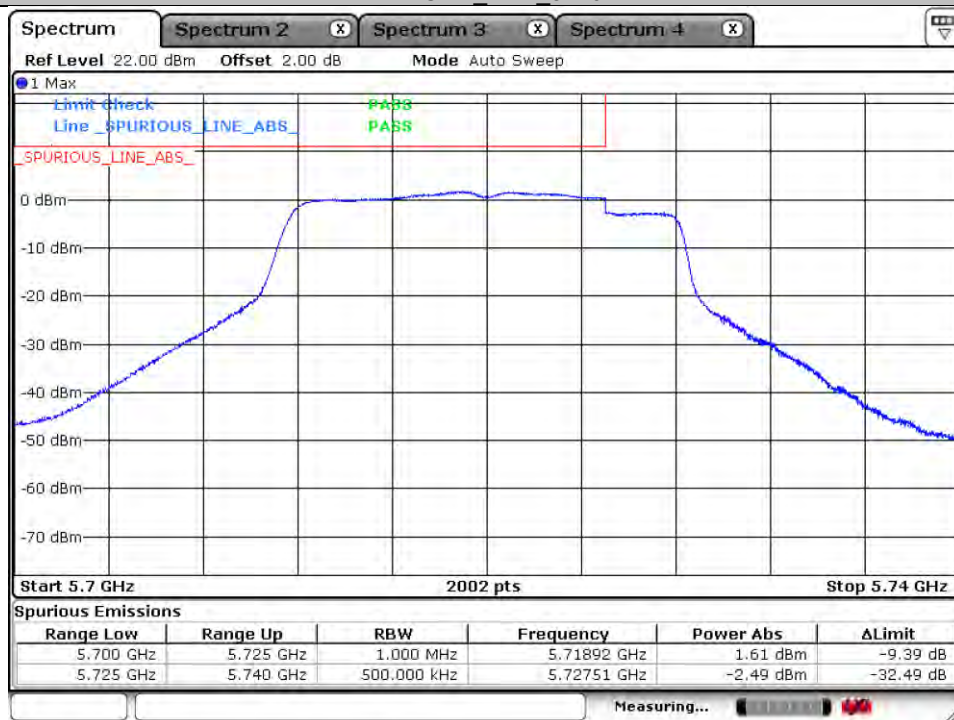


Date: 26 JAN 2021 11:01:59

11A-CDD_Ant1_5745

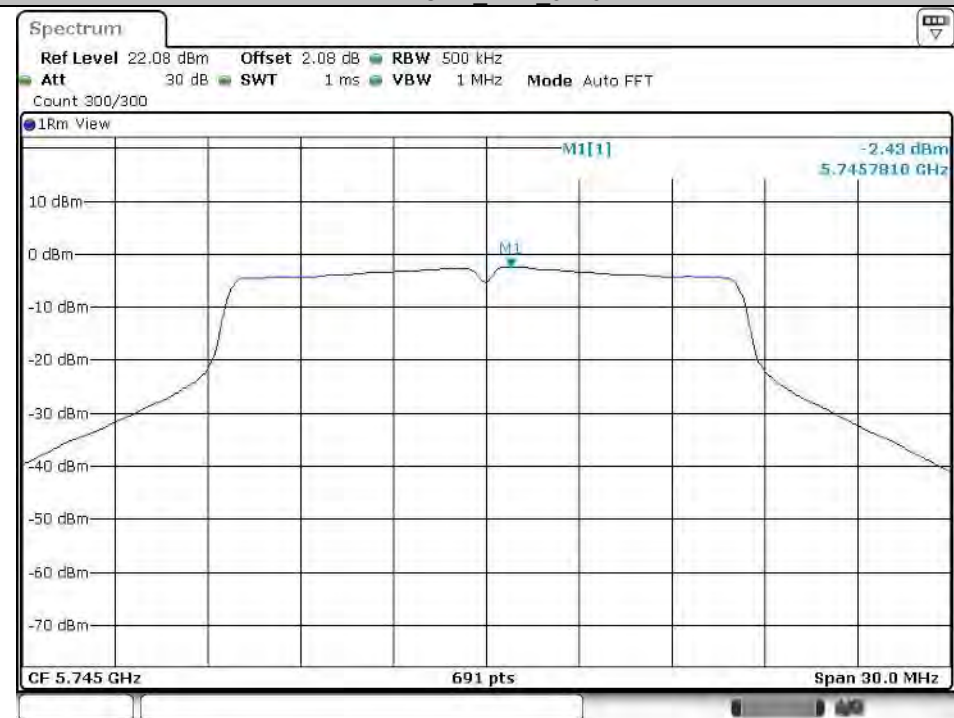


Date: 20 JAN 2021 16:12:18

11A-CDD_Ant2_5745

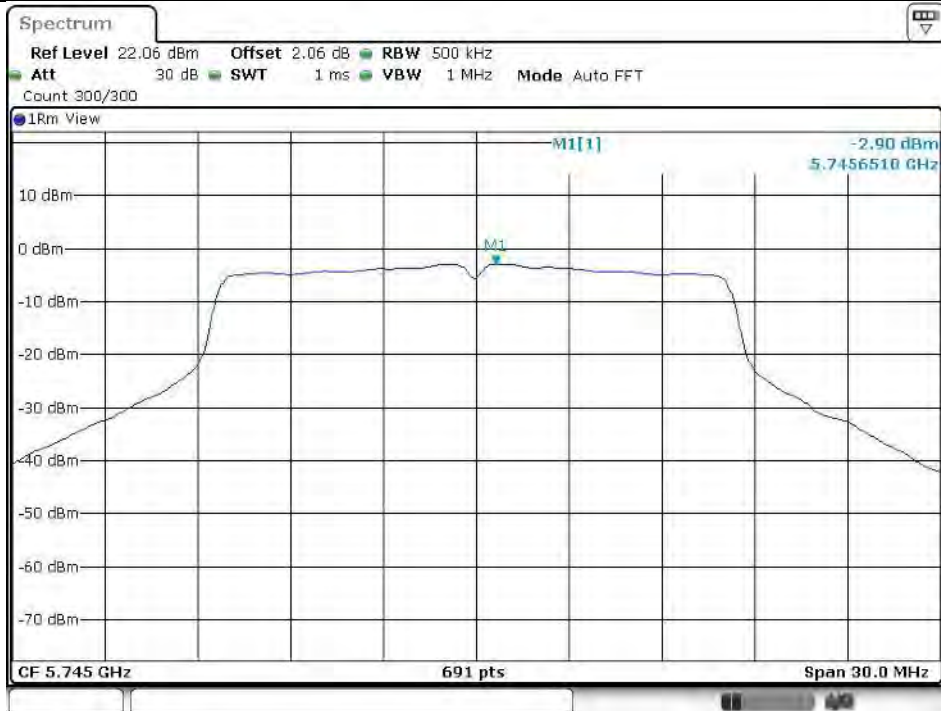


Date: 20.JAN.2021 19:26:22

11A-CDD_Ant1_5785

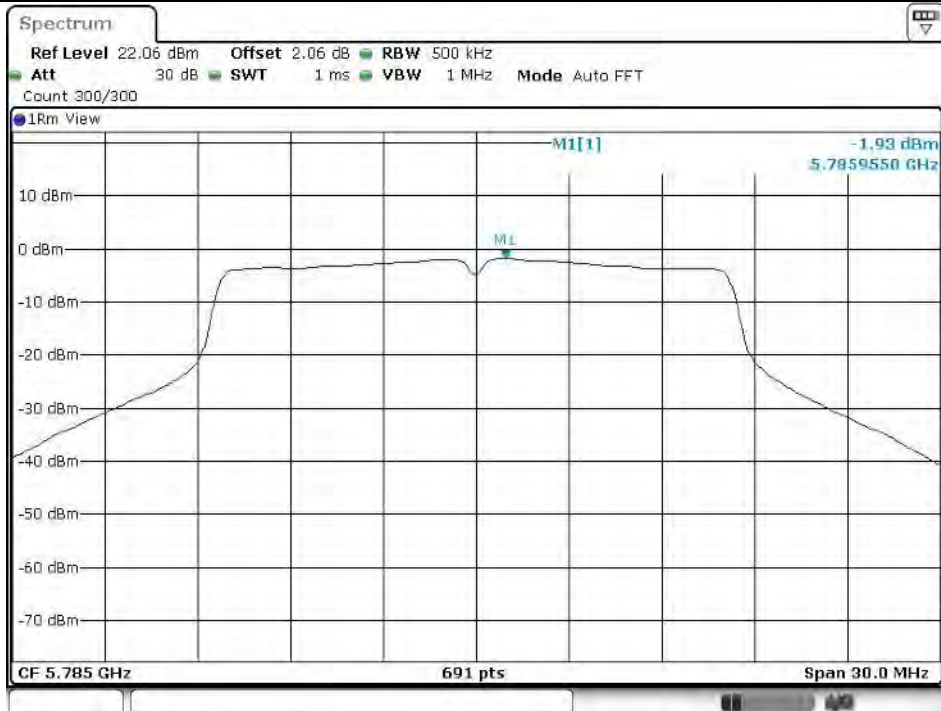


Date: 20.JAN.2021 16:12:48

11A-CDD_Ant2_5785

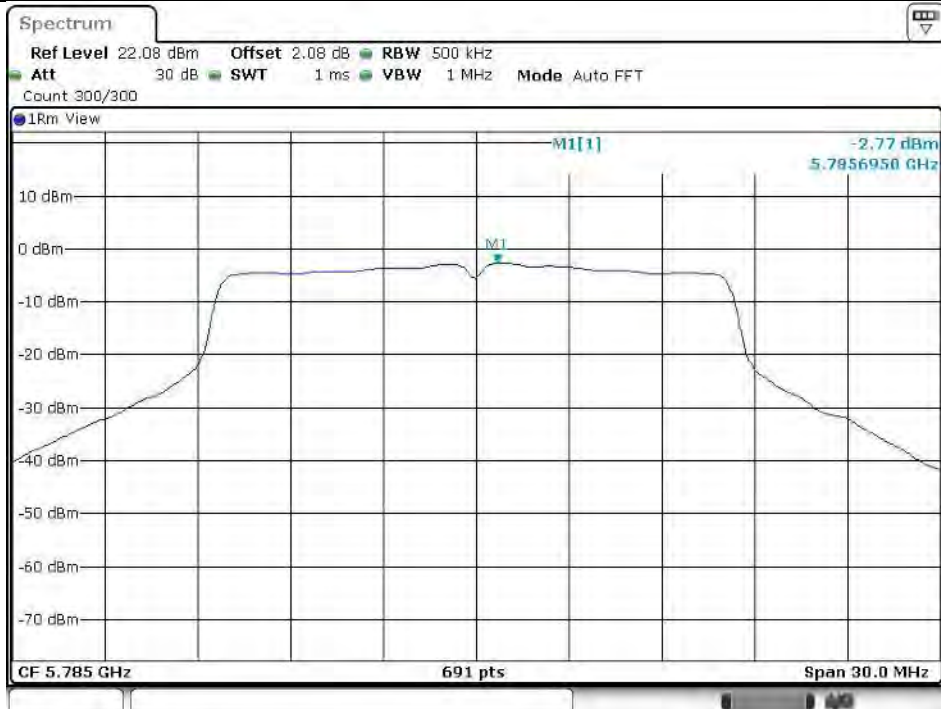


Date: 20.JAN.2021 19:27:07

11A-CDD_Ant1_5825

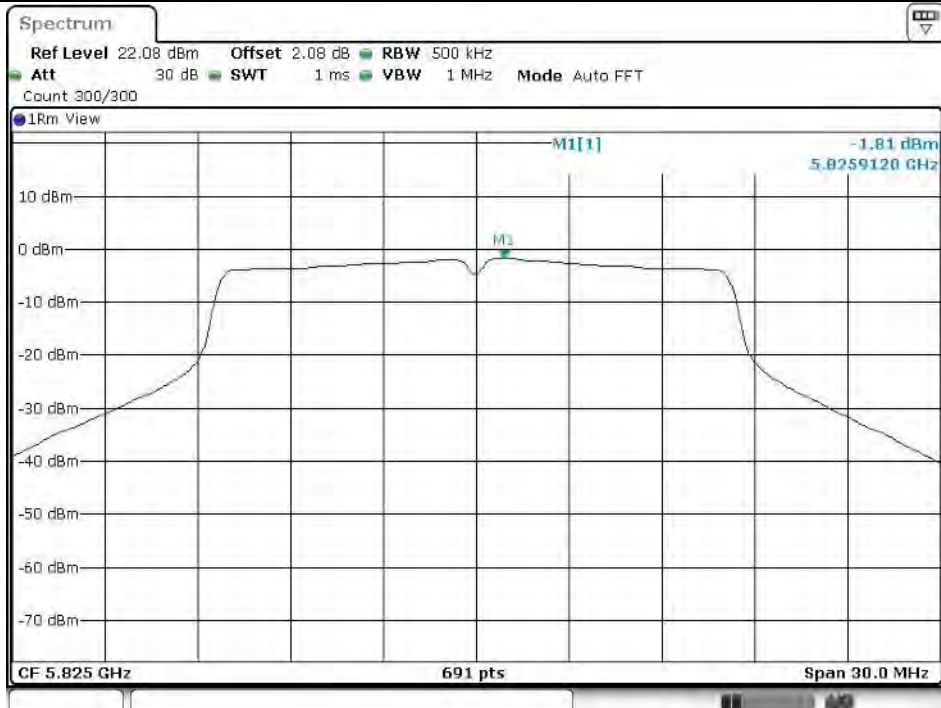


Date: 20.JAN.2021 16:13:17

11A-CDD_Ant2_5825

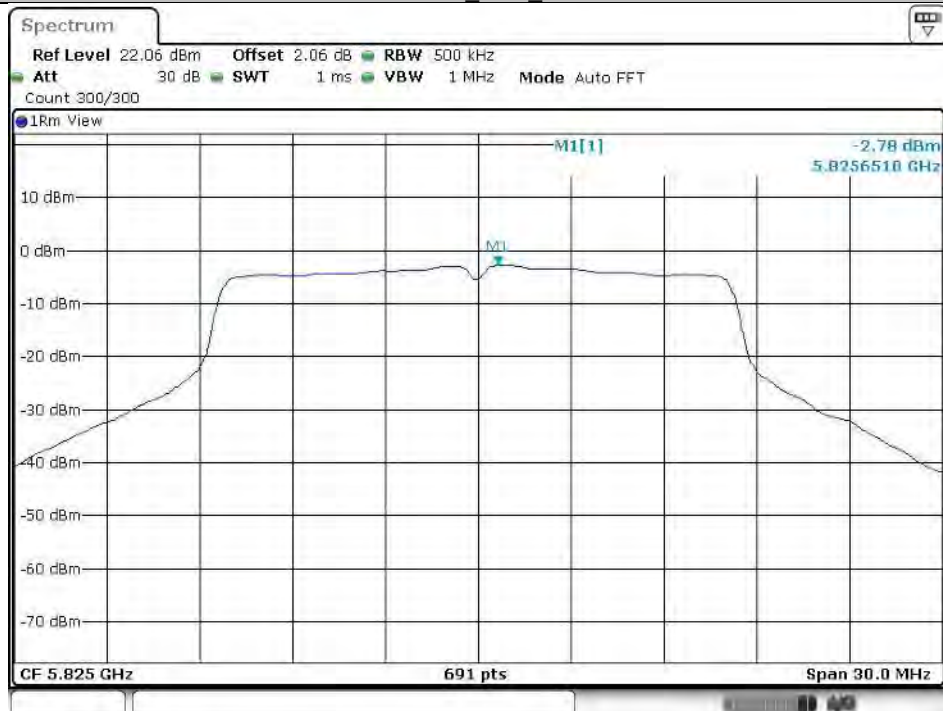


Date: 20.JAN.2021 19:27:38

11N20MIMO_Ant1_5180

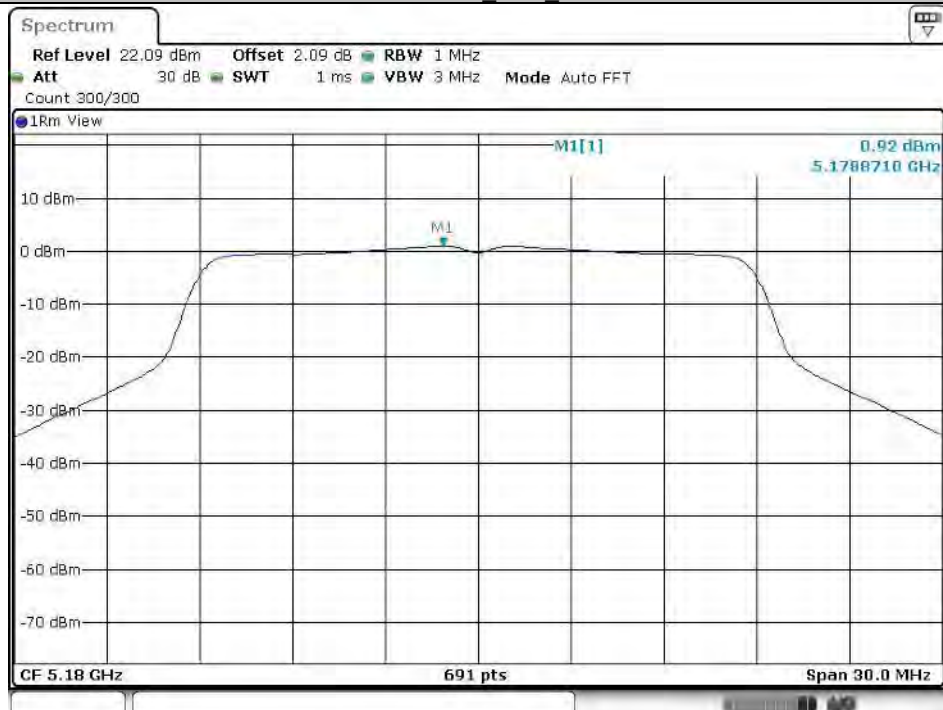


Date: 20.JAN.2021 16:13:49

11N20MIMO_Ant2_5180

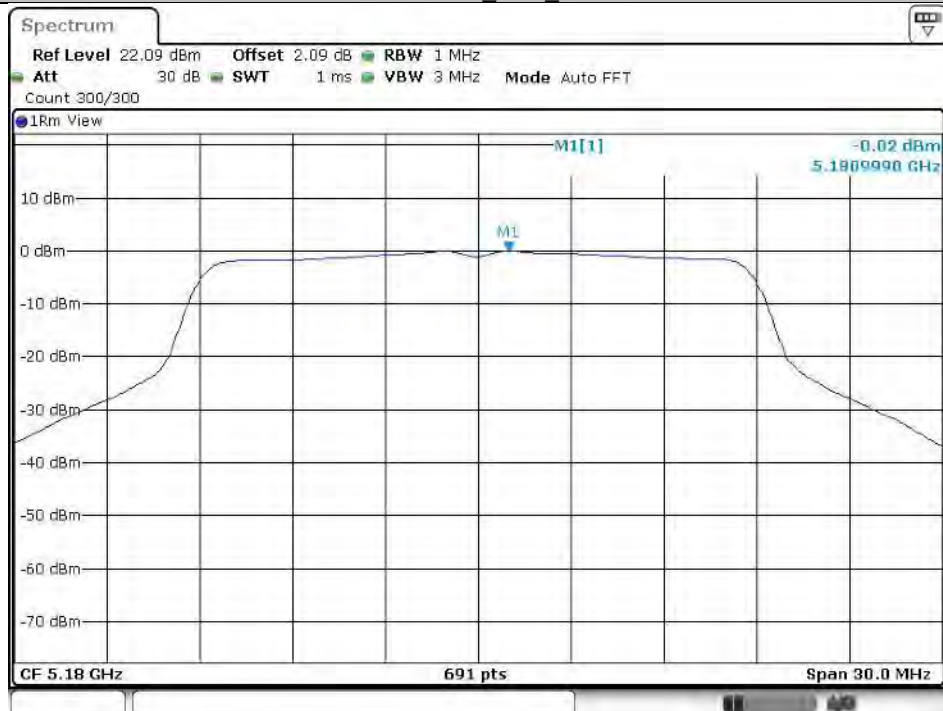


Date: 20.JAN.2021 19:28:32

11N20MIMO_Ant1_5200

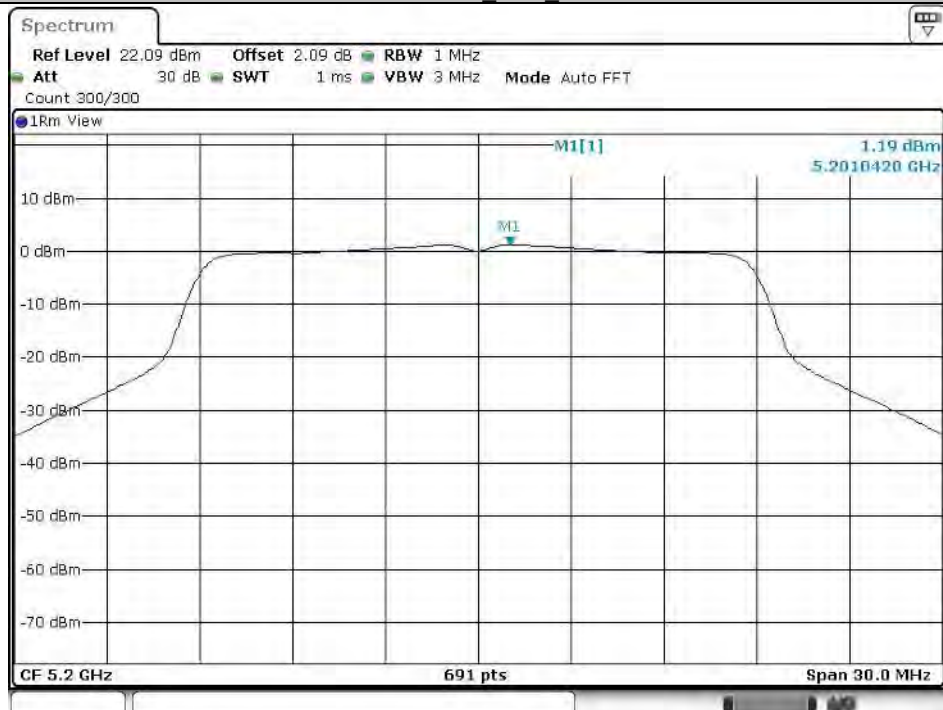


Date: 20.JAN.2021 16:14:17

11N20MIMO_Ant2_5200

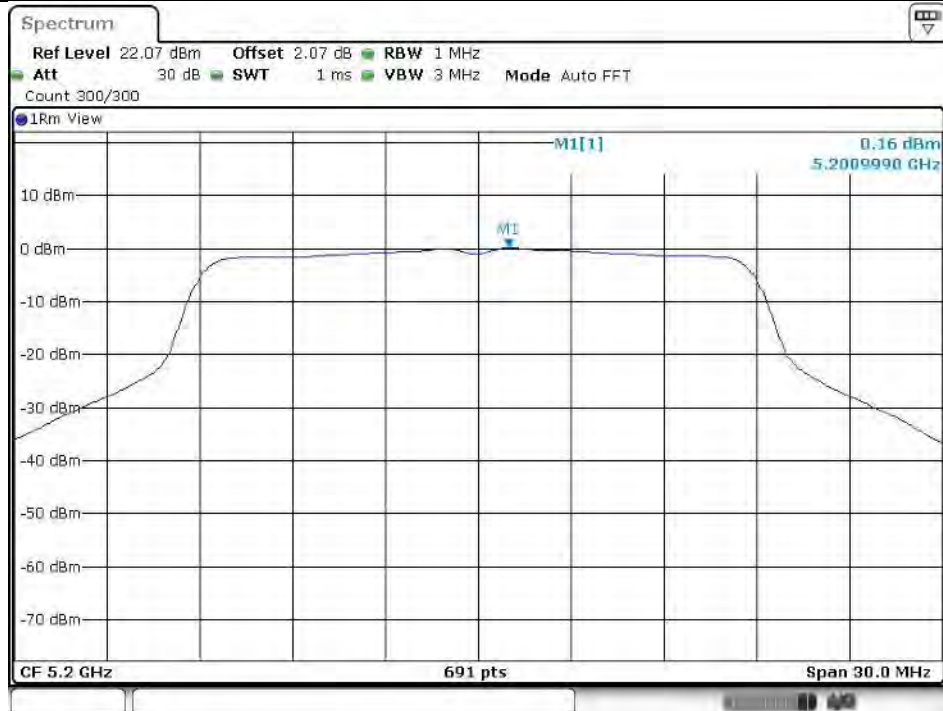


Date: 20.JAN.2021 19:29:02

11N20MIMO_Ant1_5240

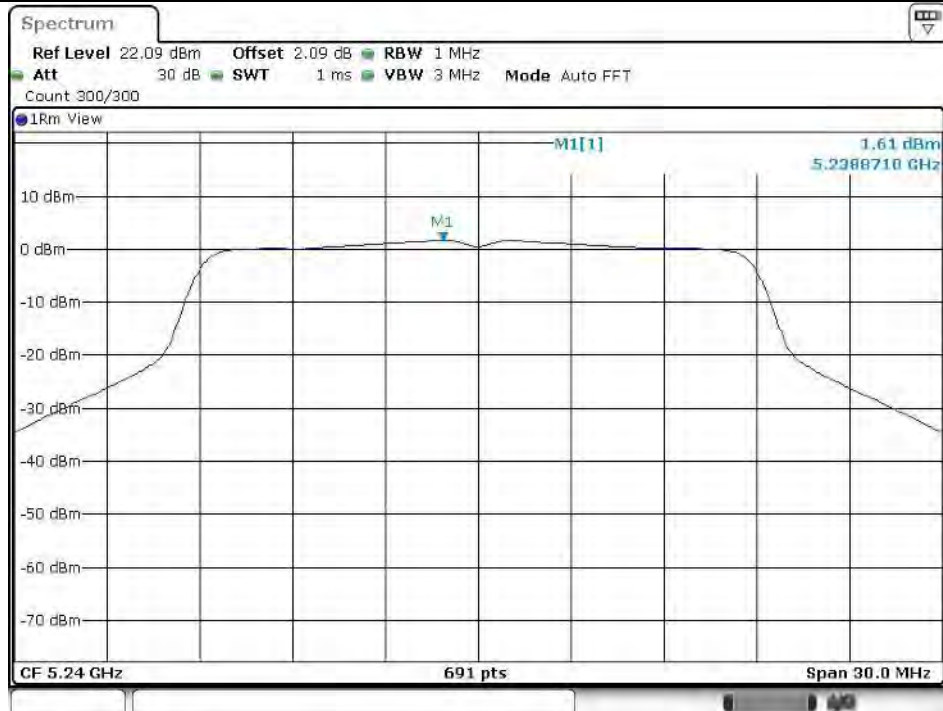


Date: 20.JAN.2021 16:14:43

11N20MIMO_Ant2_5240

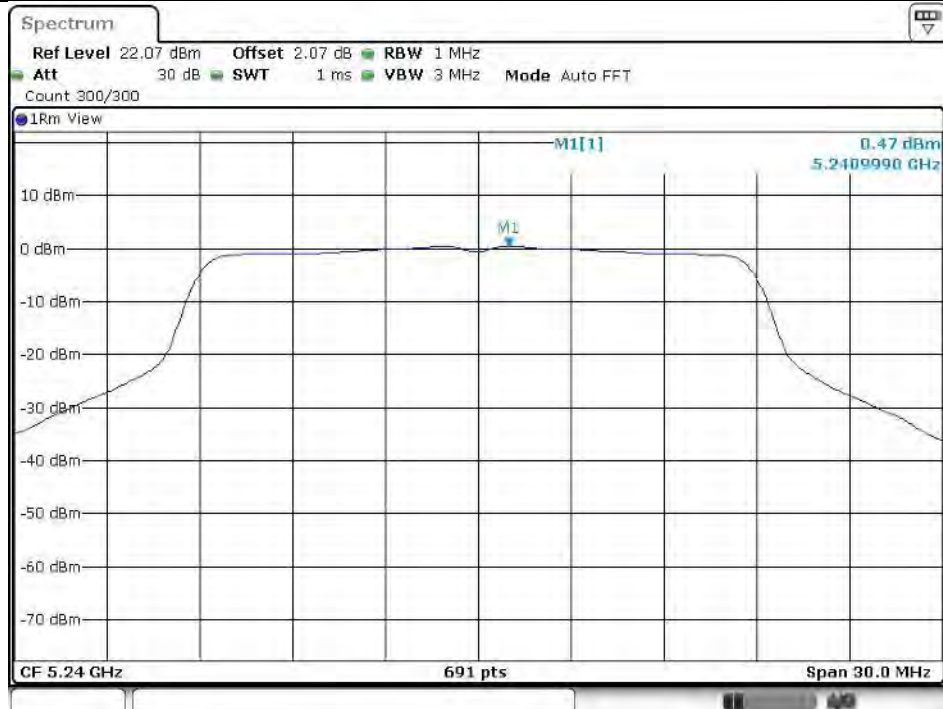


Date: 20.JAN.2021 19:29:55

11N20MIMO_Ant1_5260

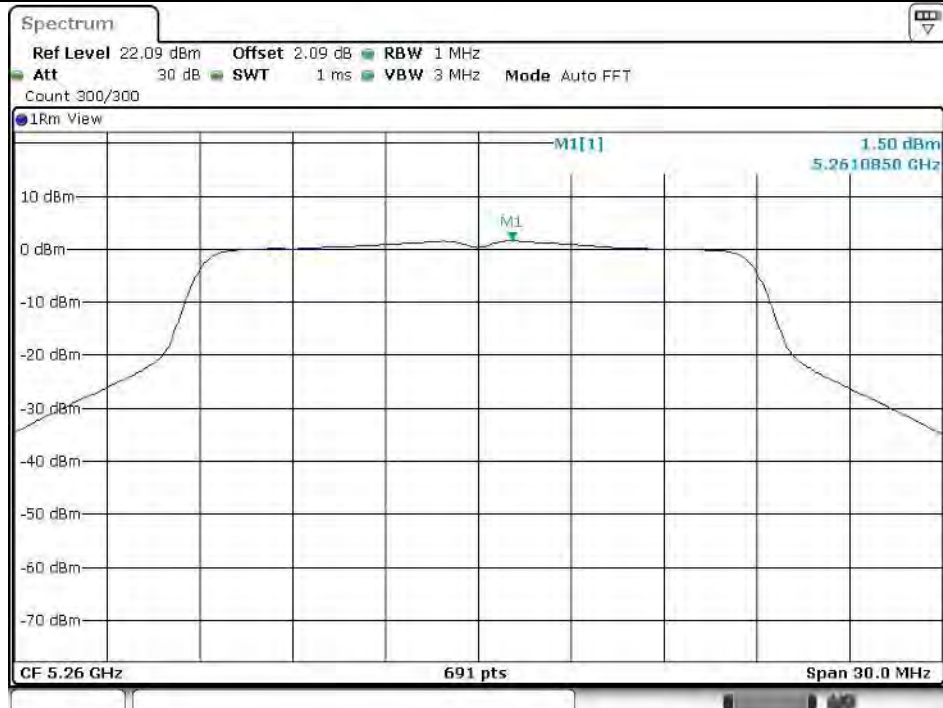


Date: 20.JAN.2021 16:15:13

11N20MIMO_Ant2_5260

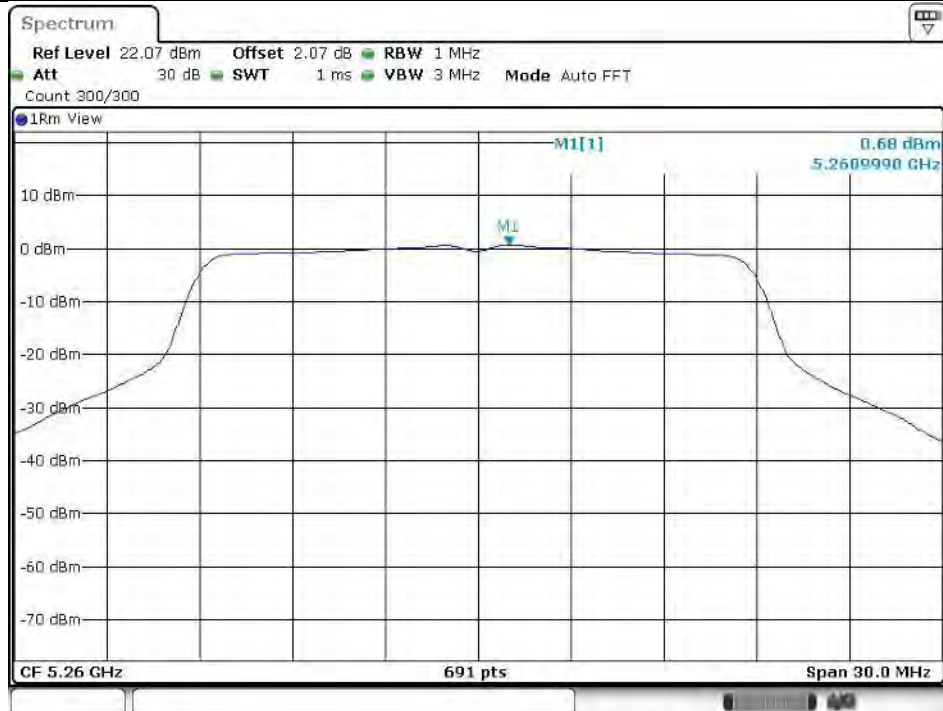


Date: 20.JAN.2021 19:31:33

11N20MIMO_Ant1_5300

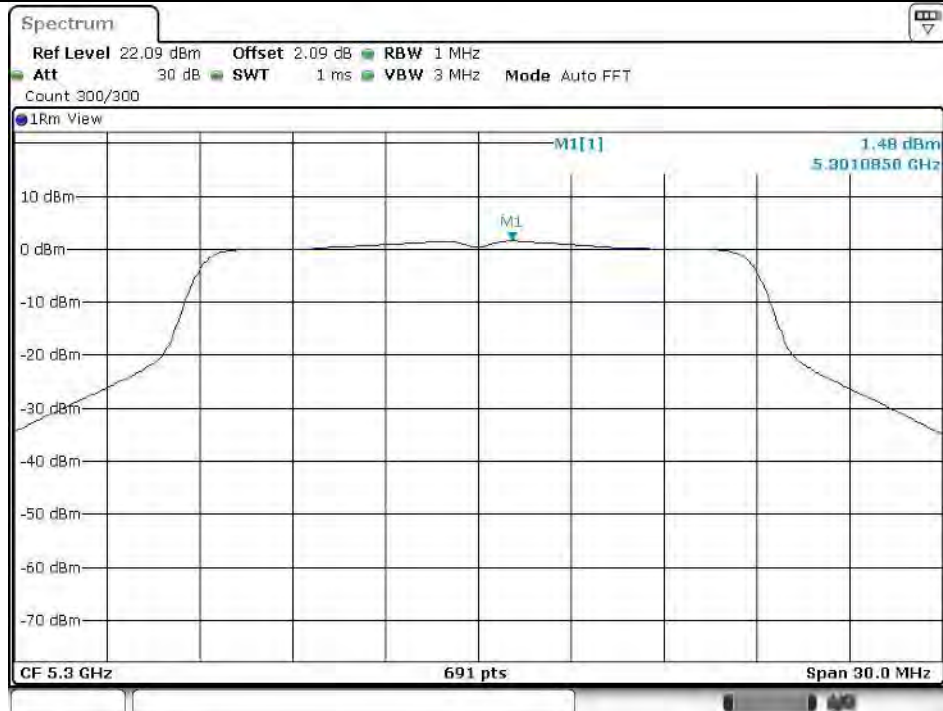


Date: 20.JAN.2021 16:15:40

11N20MIMO_Ant2_5300

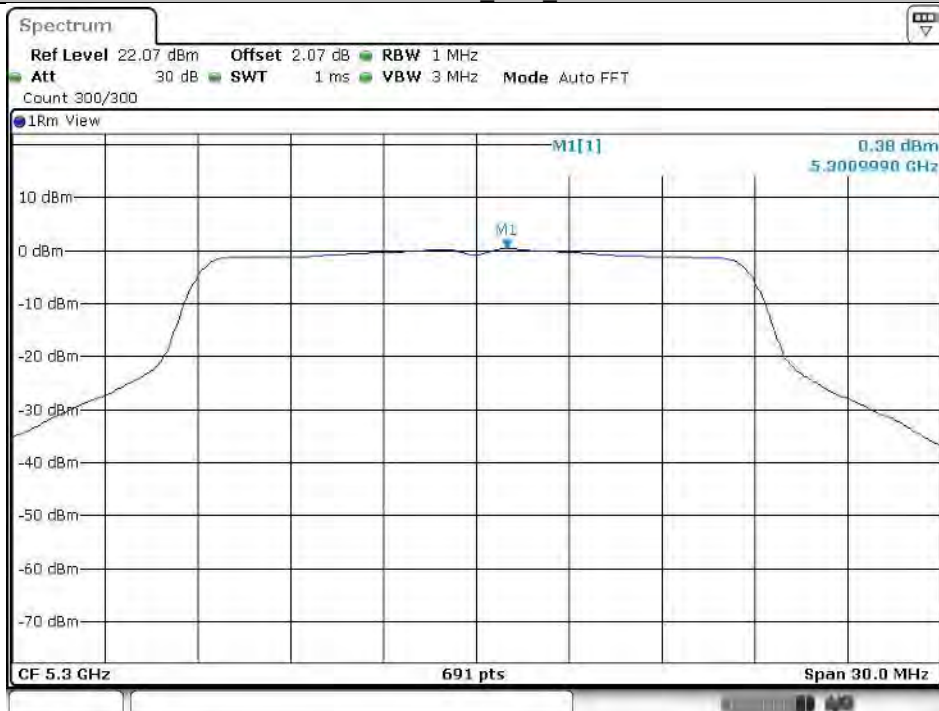


Date: 20.JAN.2021 19:32:05

11N20MIMO_Ant1_5320

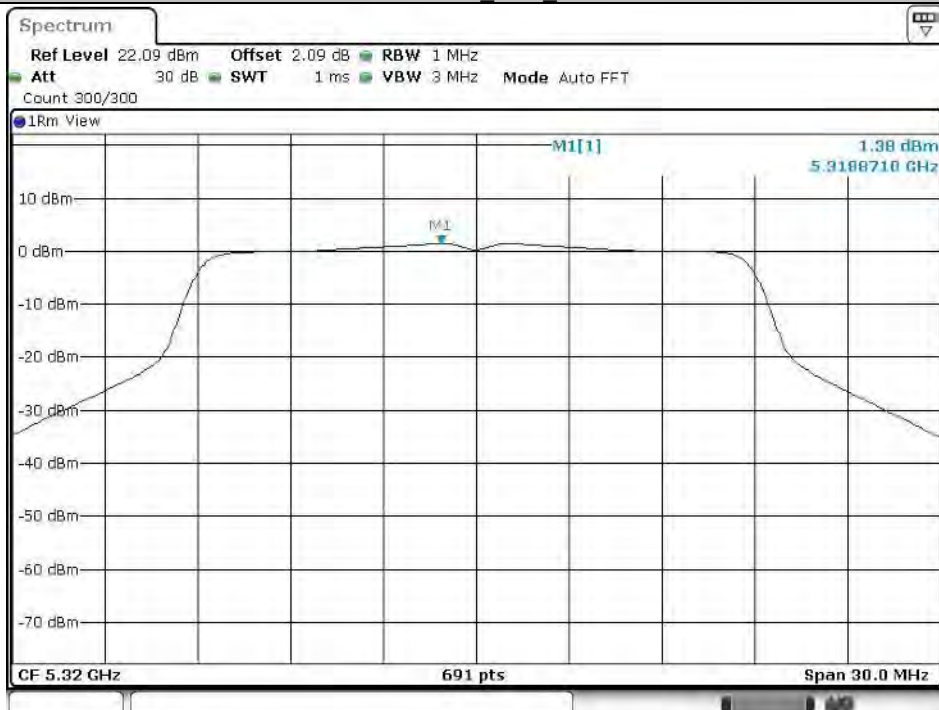


Date: 20.JAN.2021 16:16:11

11N20MIMO_Ant2_5320

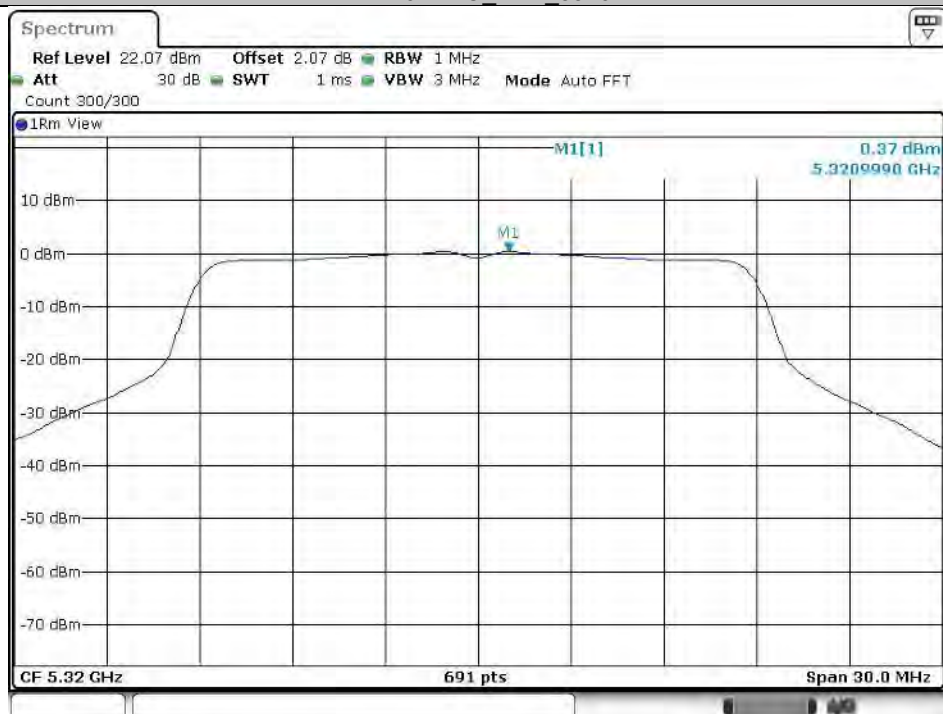


Date: 20.JAN.2021 19:33:23

11N20MIMO_Ant1_5500

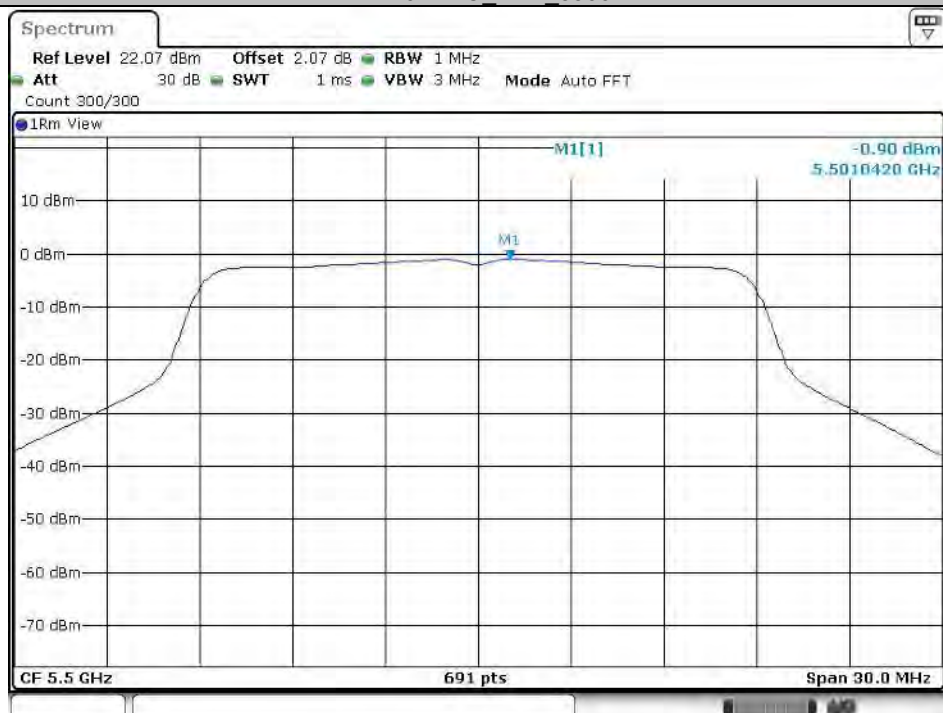


Date: 20.JAN.2021 16:16:38

11N20MIMO_Ant2_5500

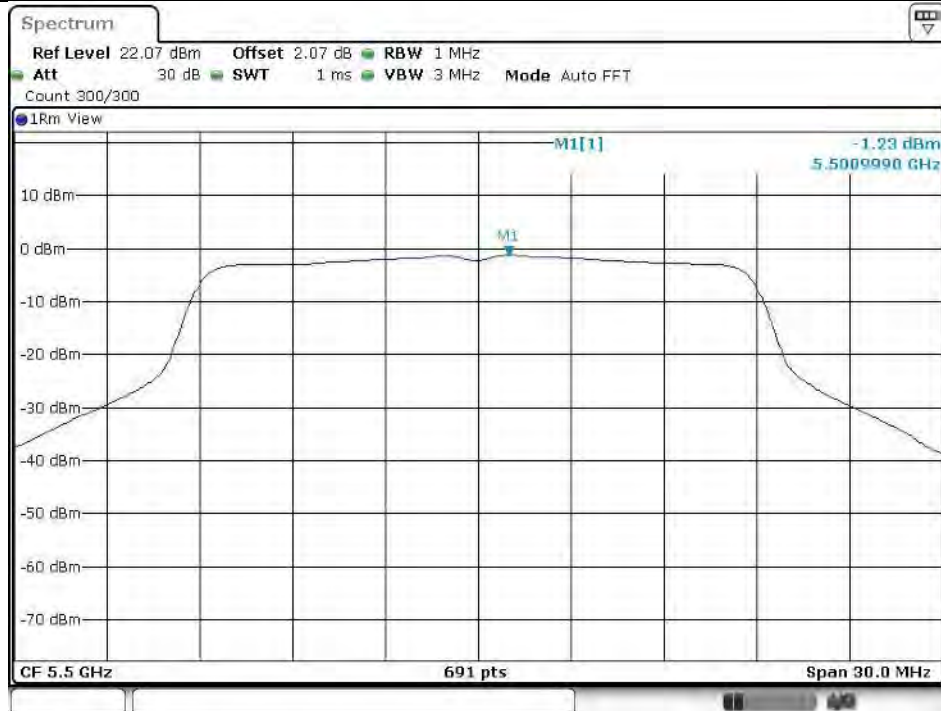


Date: 20.JAN.2021 19:34:38

11N20MIMO_Ant1_5580

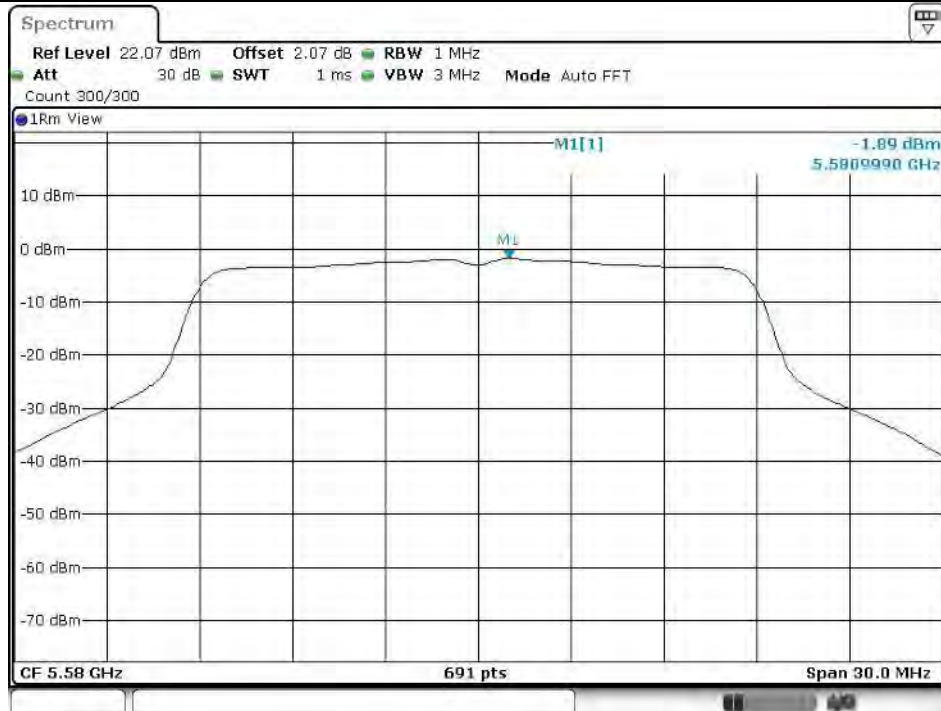


Date: 20.JAN.2021 19:59:09

11N20MIMO_Ant2_5580

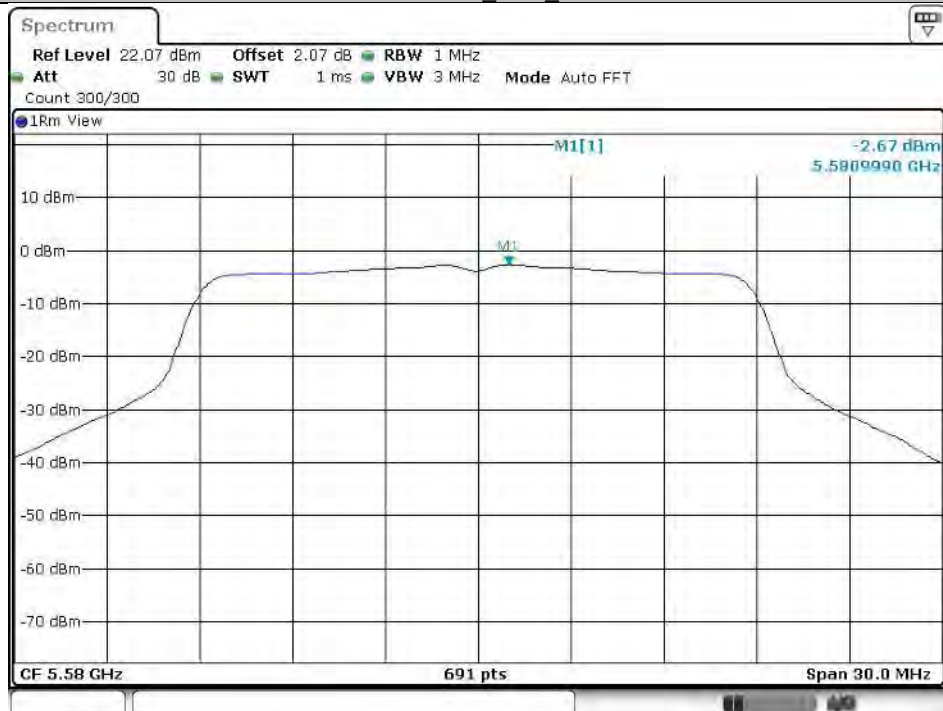


Date: 20.JAN.2021 19:35:09

11N20MIMO_Ant1_5700

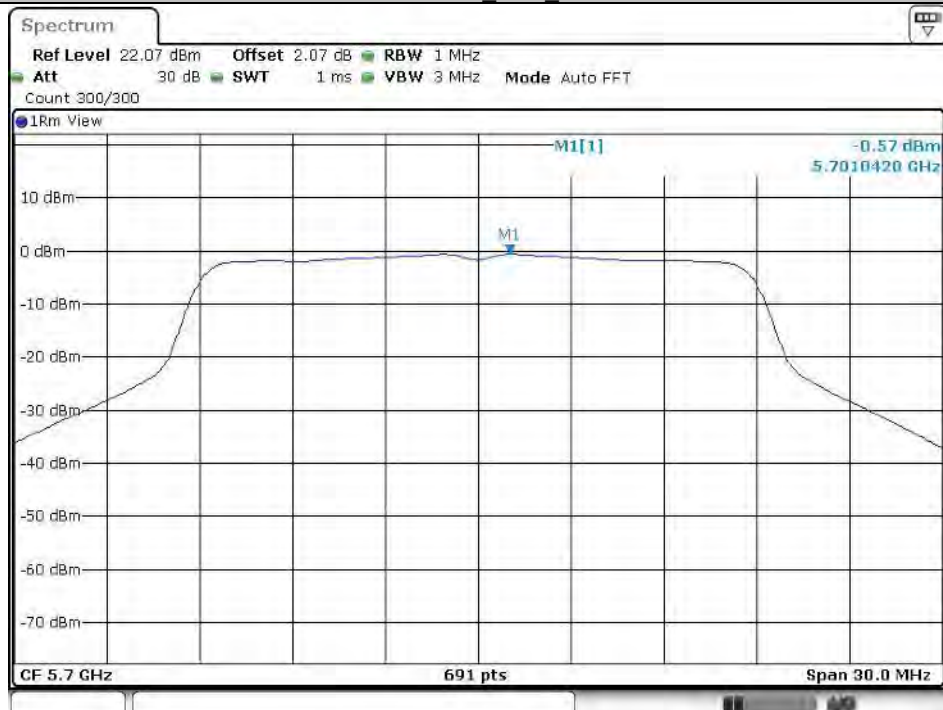


Date: 20.JAN.2021 16:17:48

11N20MIMO_Ant2_5700

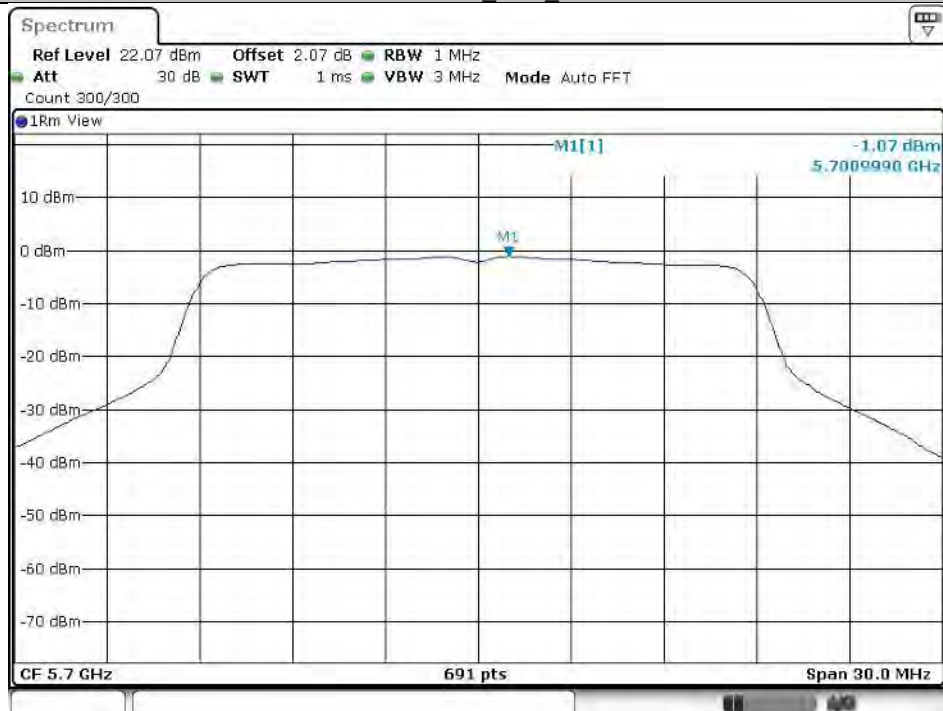

Date: 20.JAN.2021 19:36:16

11N20MIMO_Ant1_5720

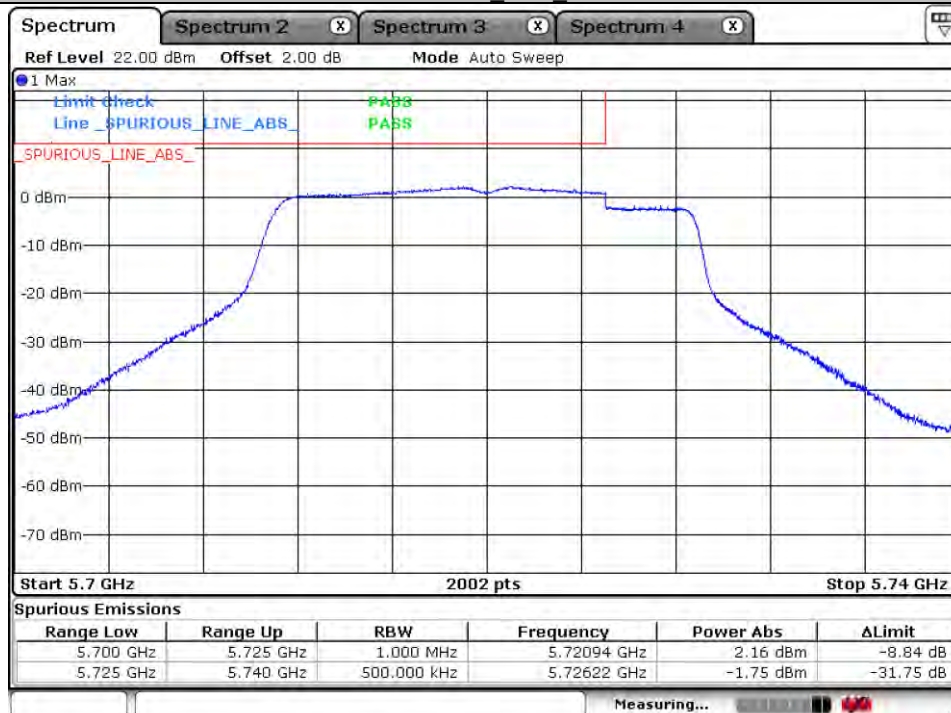


Date: 26 JAN 2021 11:08:49

11N20MIMO_Ant2_5720




Date: 26 JAN 2021 11:07:48

11N20MIMO_Ant1_5745

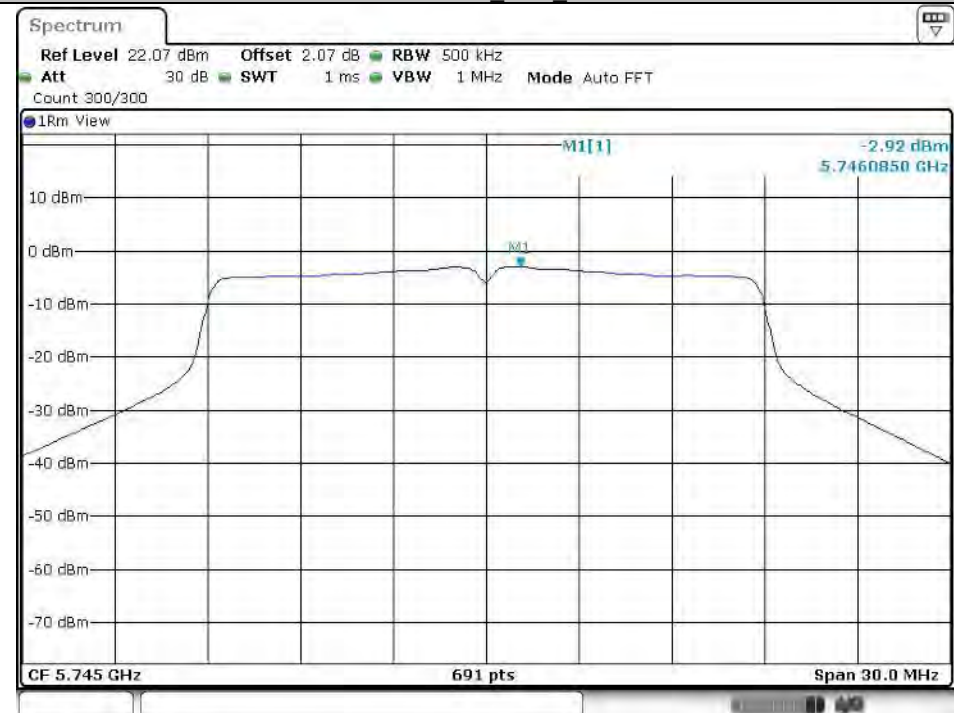


Date: 20 JAN 2021 16:19:08

11N20MIMO_Ant2_5745

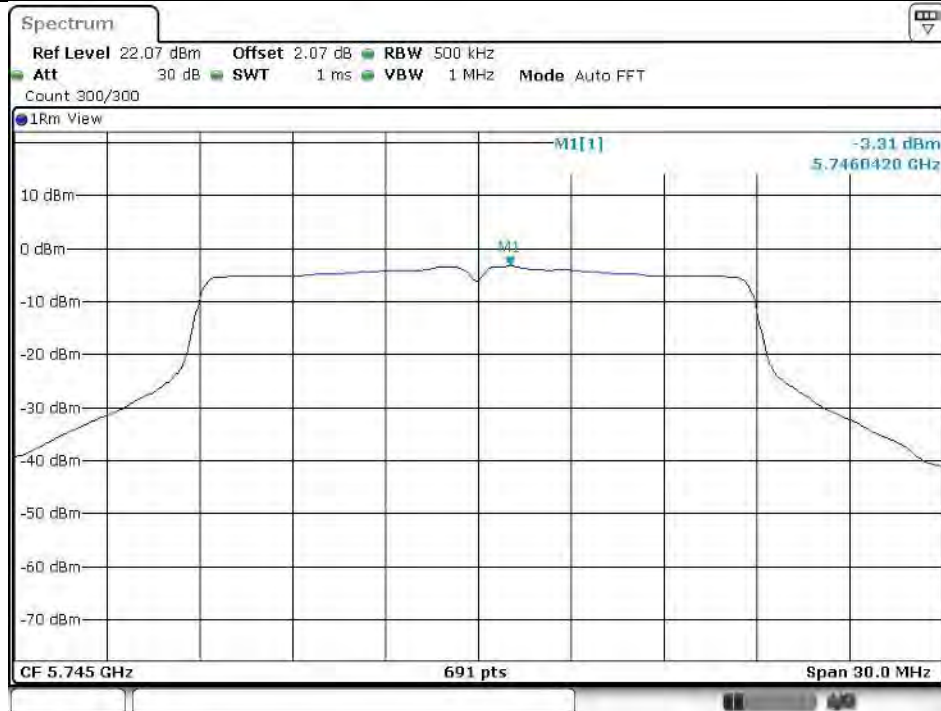


Date: 20.JAN.2021 19:36:47

11N20MIMO_Ant1_5785

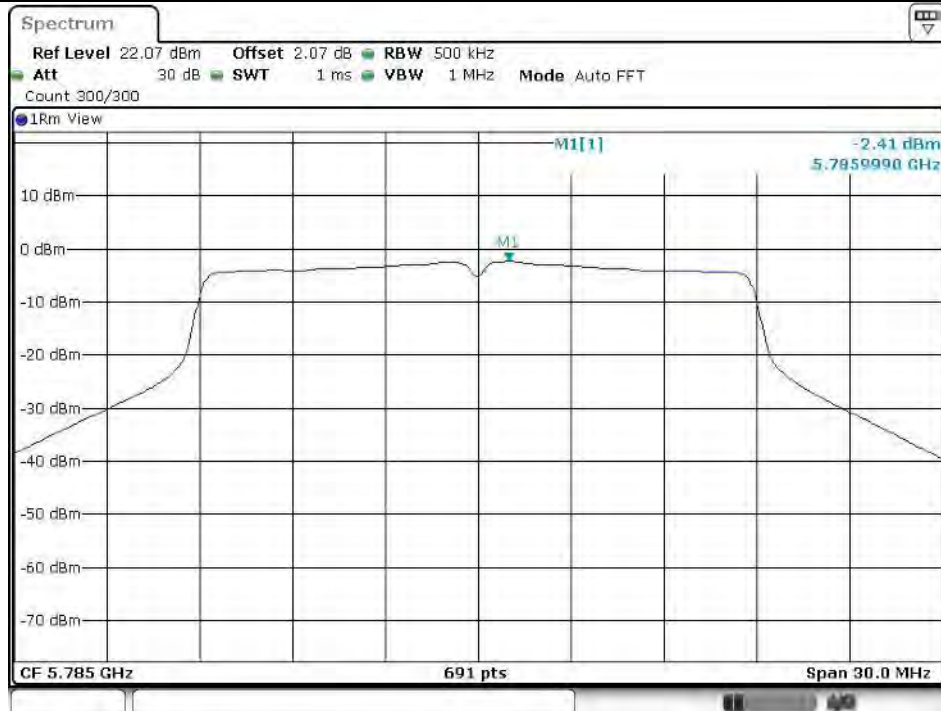


Date: 20.JAN.2021 16:19:34

11N20MIMO_Ant2_5785

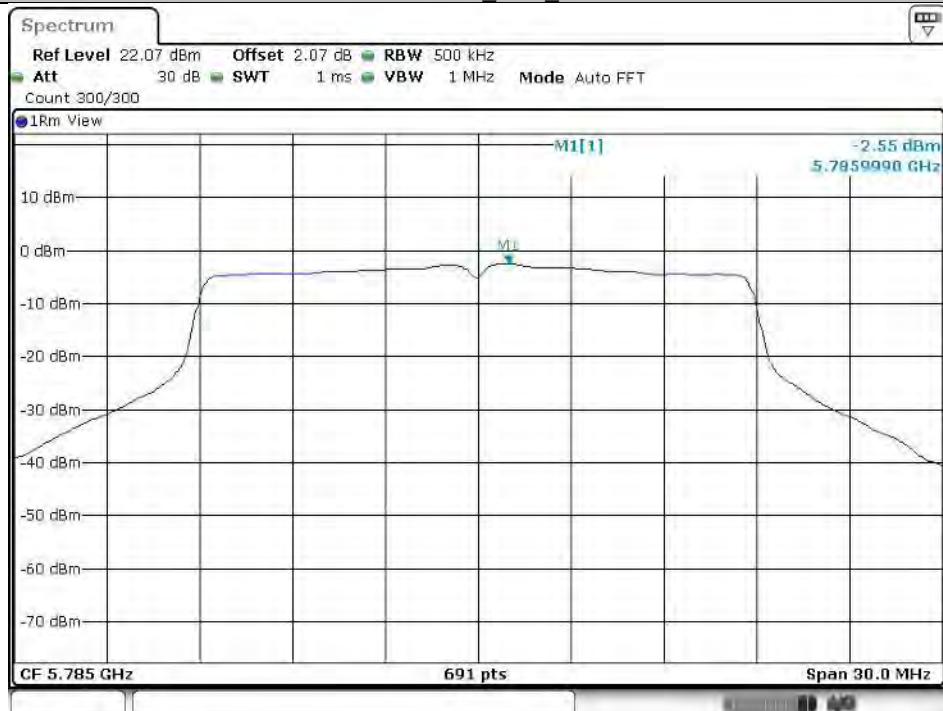


Date: 20.JAN.2021 19:37:23

11N20MIMO_Ant1_5825

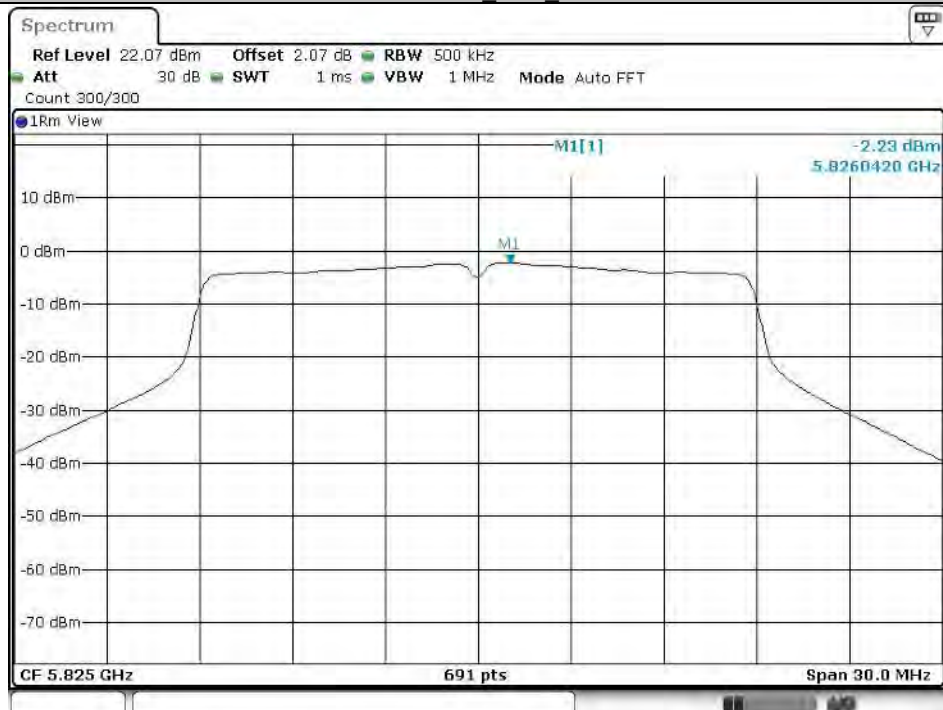


Date: 20.JAN.2021 16:20:03

11N20MIMO_Ant2_5825

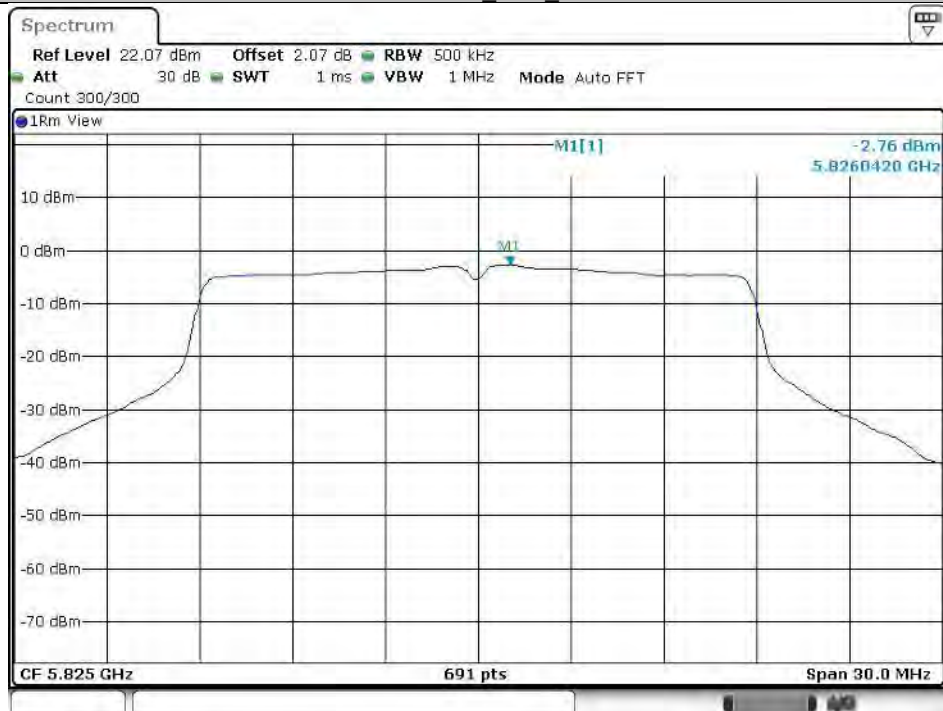


Date: 20.JAN.2021 19:37:55

11N40MIMO_Ant1_5190

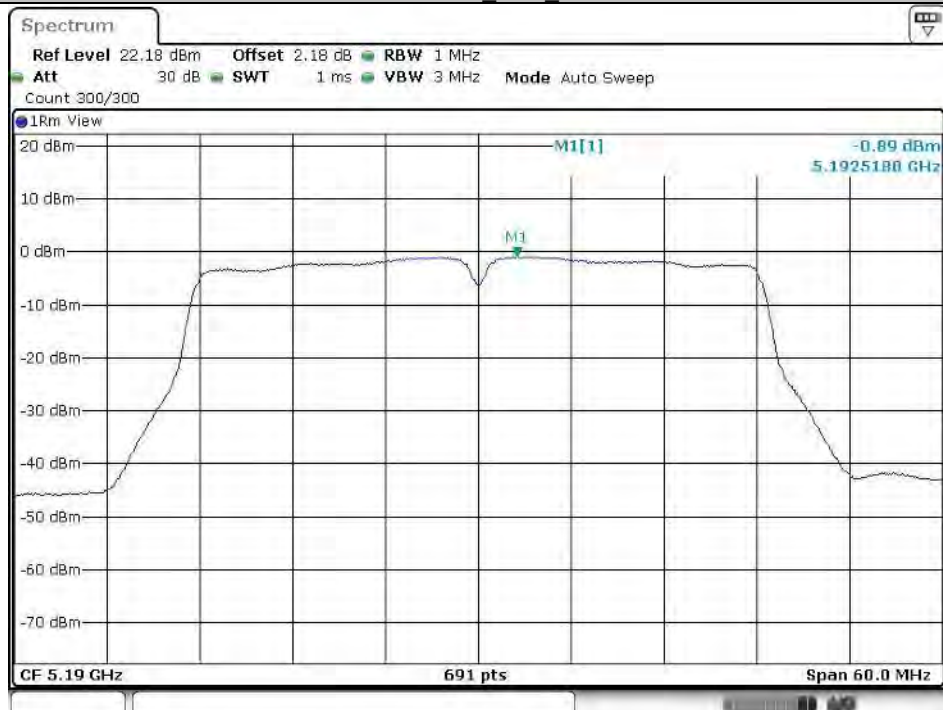


Date: 20.JAN.2021 20:36:19

11N40MIMO_Ant2_5190

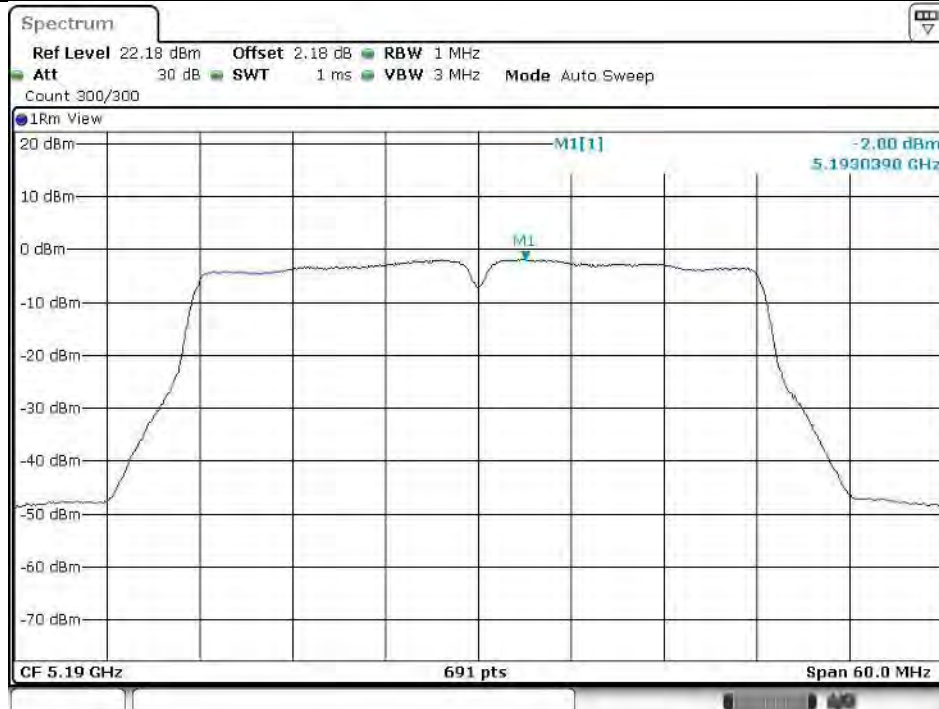


Date: 21.JAN.2021 09:27:00

11N40MIMO_Ant1_5230

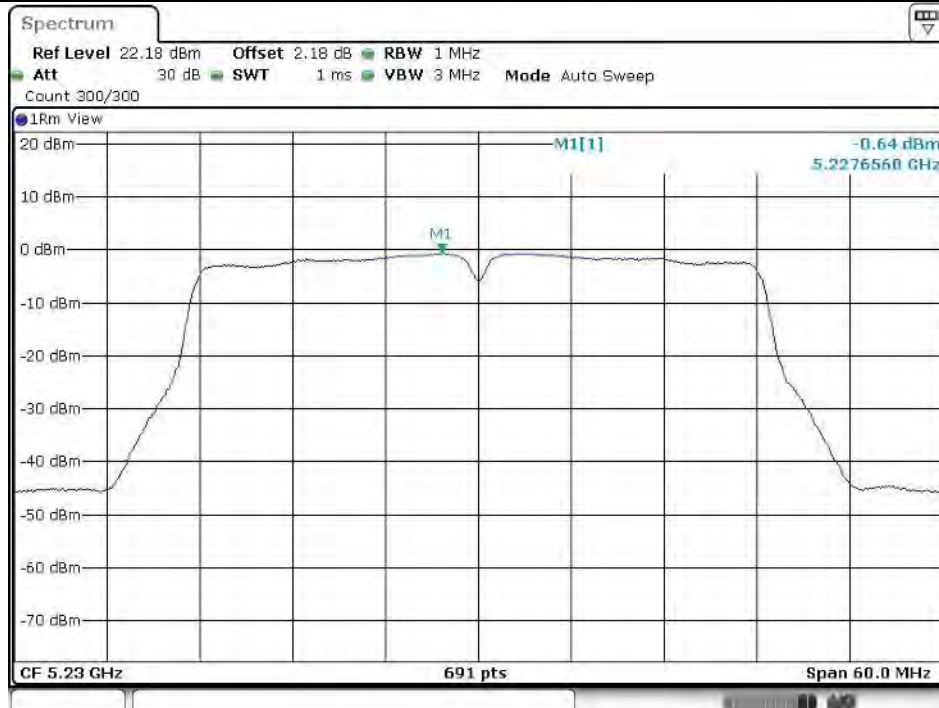


Date: 20.JAN.2021 20:37:07

11N40MIMO_Ant2_5230

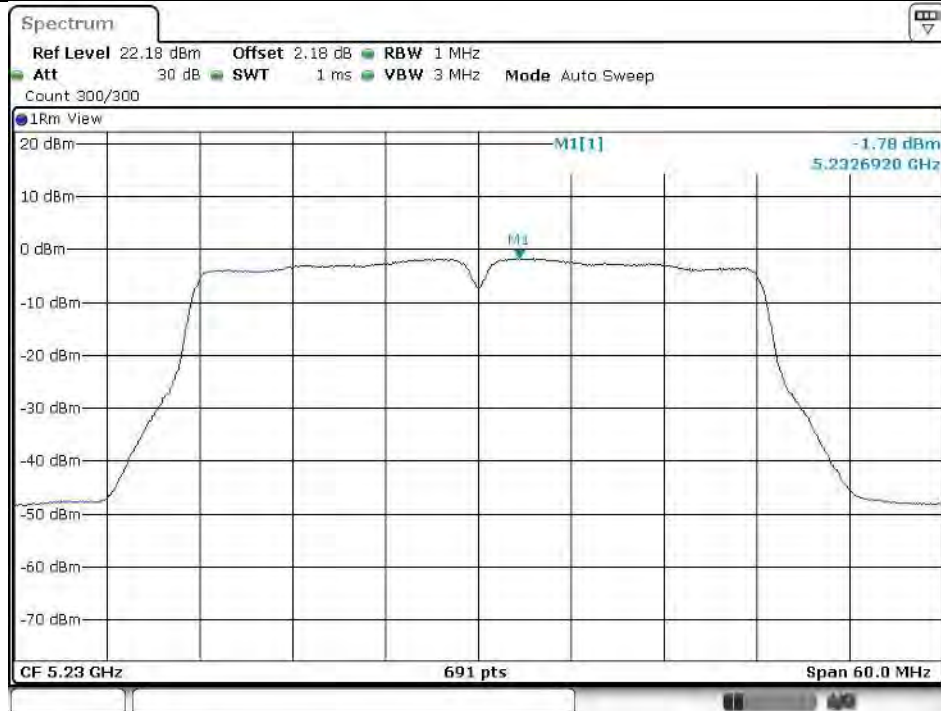


Date: 21.JAN.2021 09:28:07

11N40MIMO_Ant1_5270

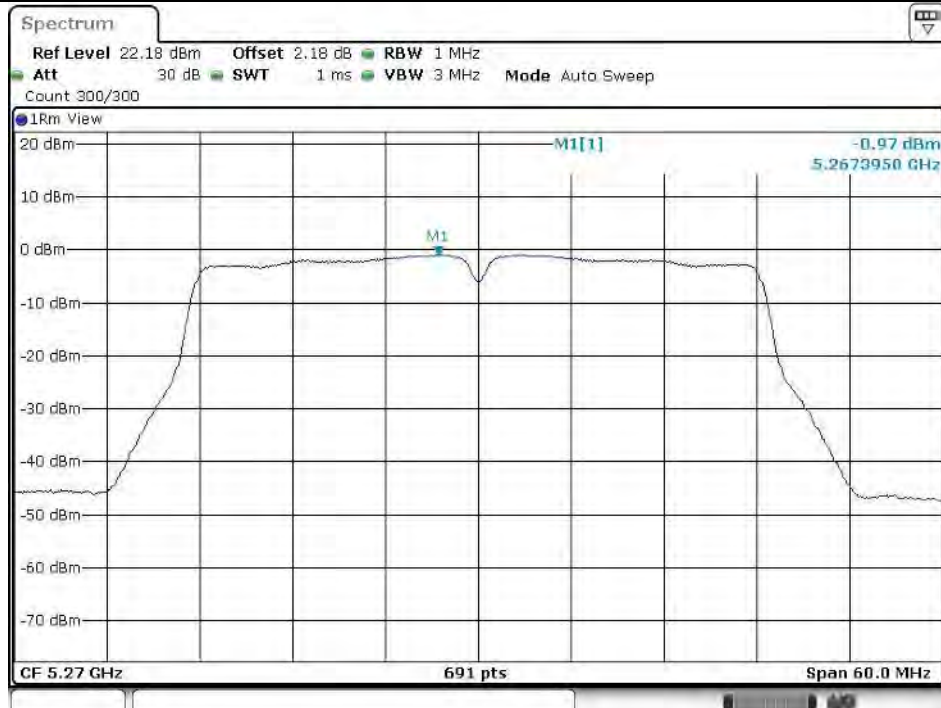


Date: 20.JAN.2021 20:37:45

11N40MIMO_Ant2_5270

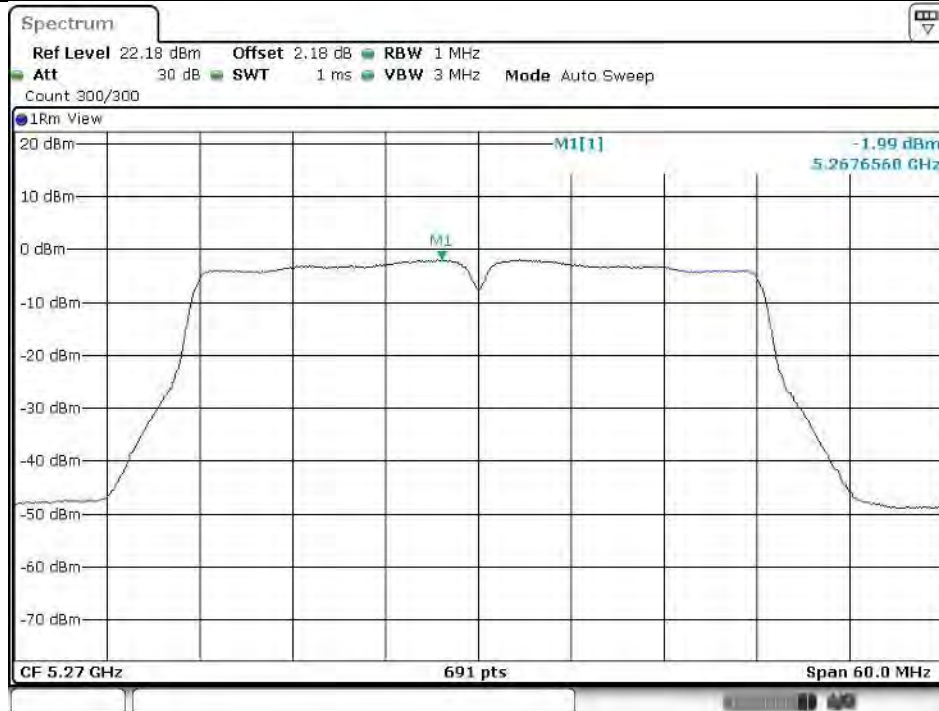

Date: 21.JAN.2021 09:28:58

11N40MIMO_Ant1_5310

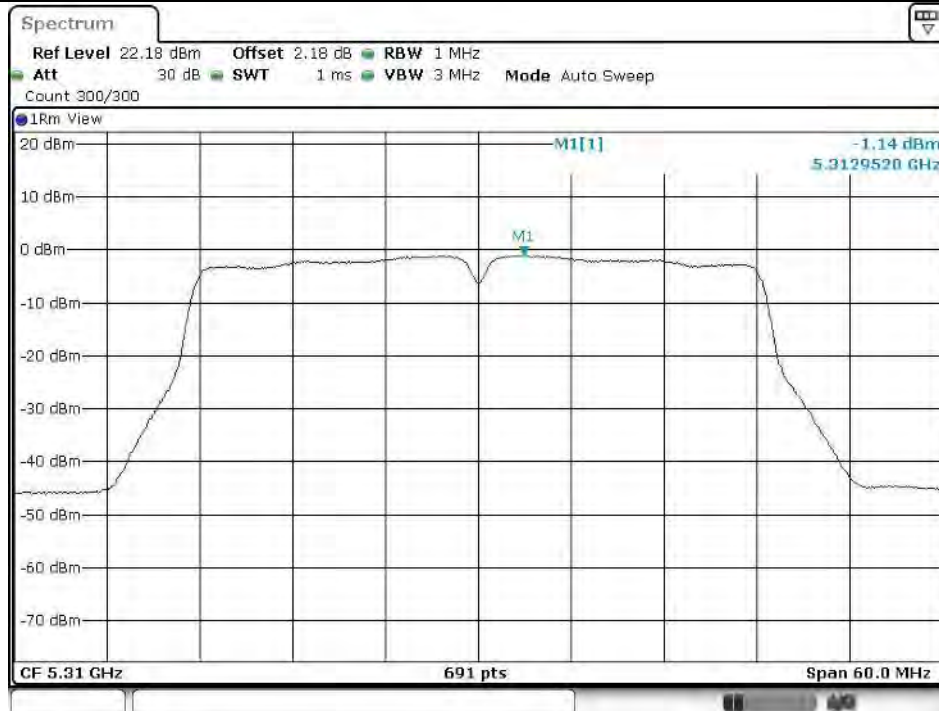


Date: 20.JAN.2021 20:38:19

11N40MIMO_Ant2_5310




Date: 21.JAN.2021 09:29:38

11N40MIMO_Ant1_5510

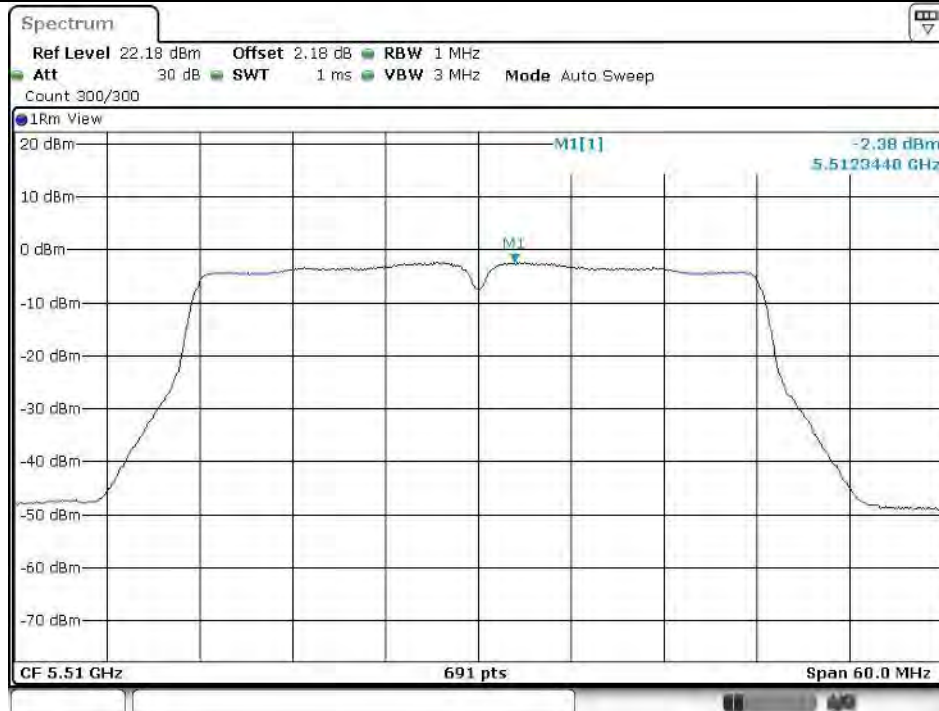


Date: 20.JAN.2021 20:39:01

11N40MIMO_Ant2_5510

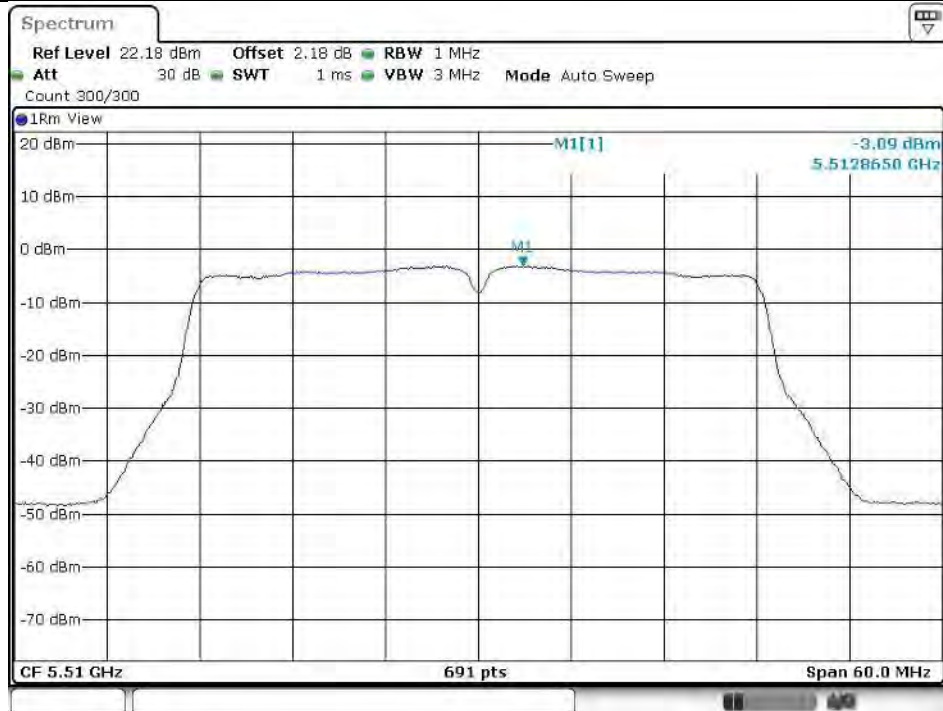


Date: 21.JAN.2021 09:30:33

11N40MIMO_Ant1_5550

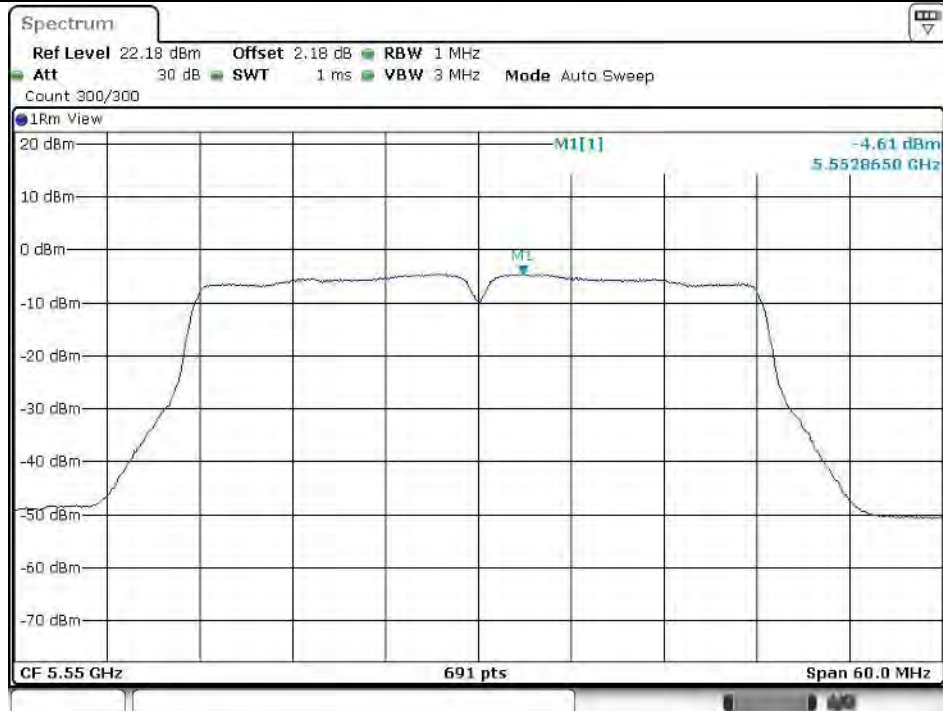


Date: 20.JAN.2021 20:39:49

11N40MIMO_Ant2_5550

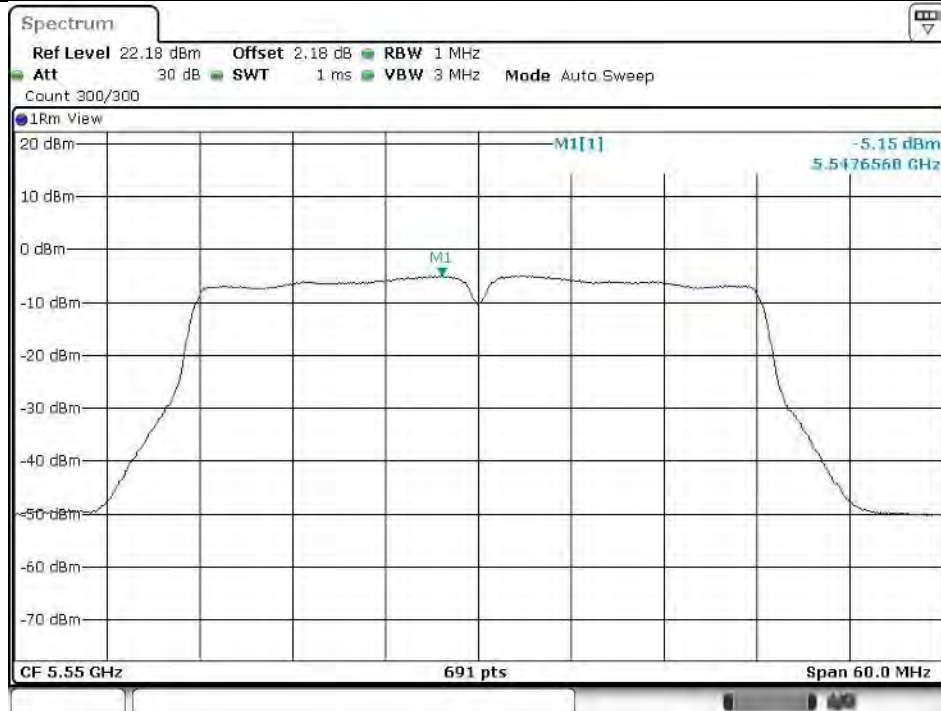

Date: 21.JAN.2021 09:31:14

11N40MIMO_Ant1_5670

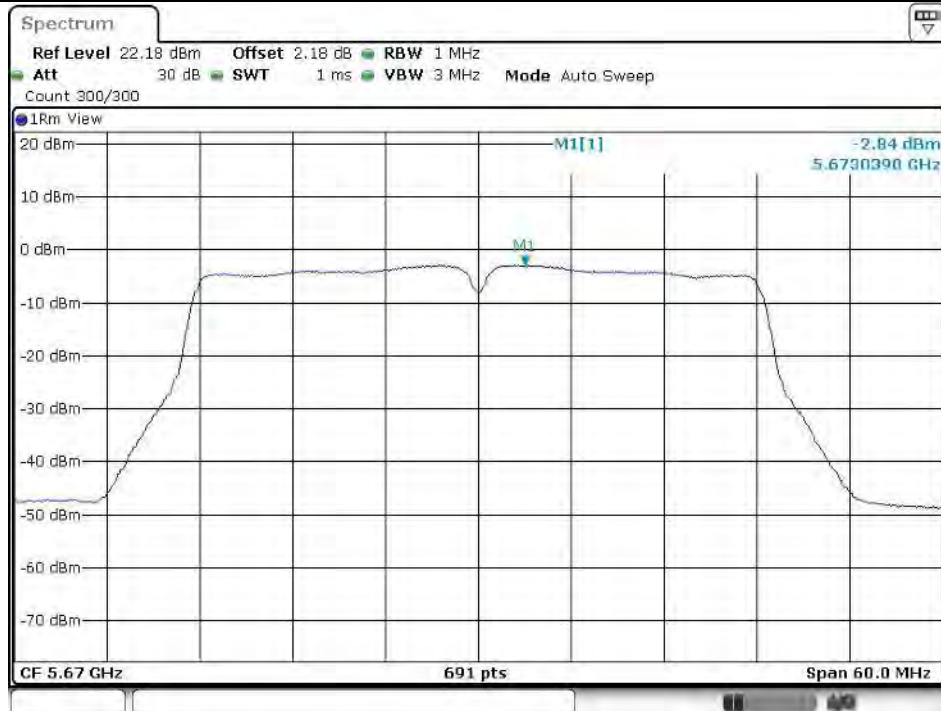


Date: 20.JAN.2021 20:40:20

11N40MIMO_Ant2_5670




Date: 21.JAN.2021 09:31:46

11N40MIMO_Ant1_5710

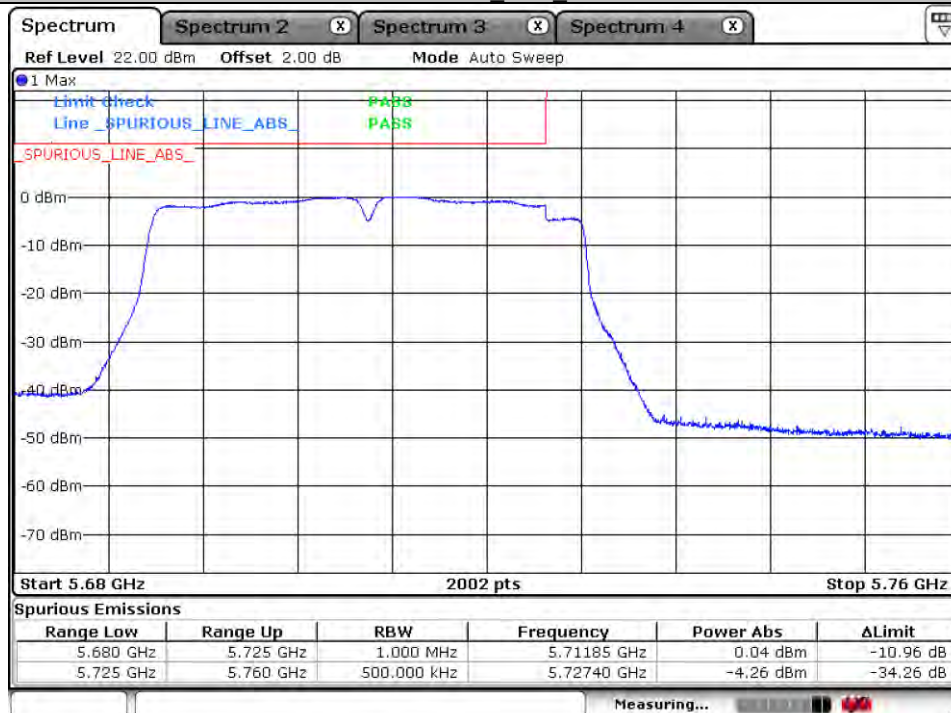


Date: 26 JAN 2021 11:46:37

11N40MIMO_Ant2_5710

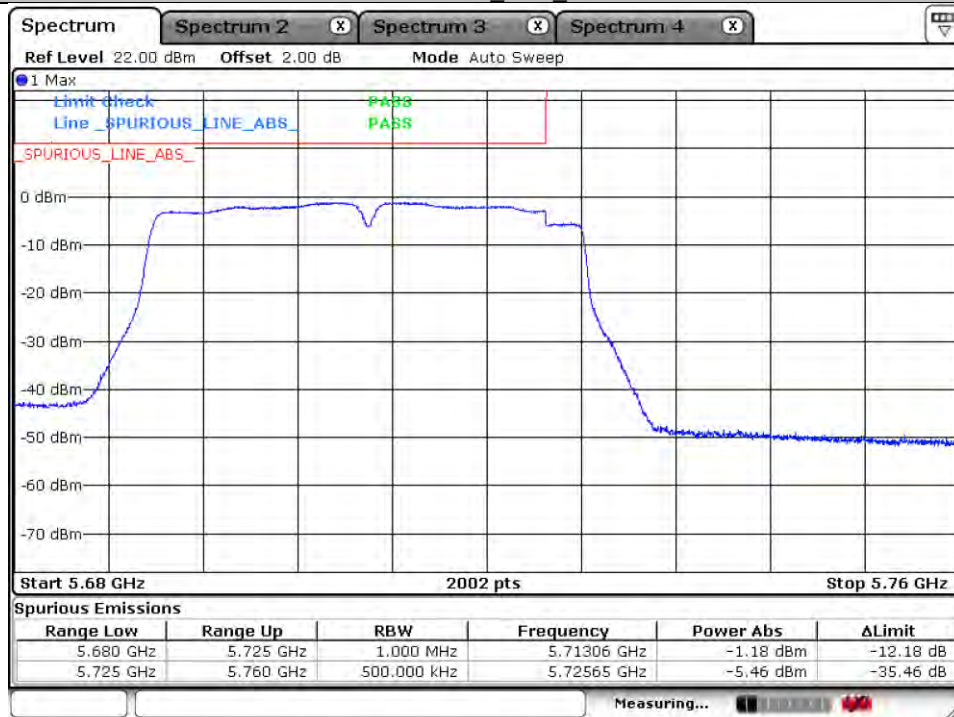


Date: 26 JAN 2021 11:50:57

11N40MIMO_Ant1_5755

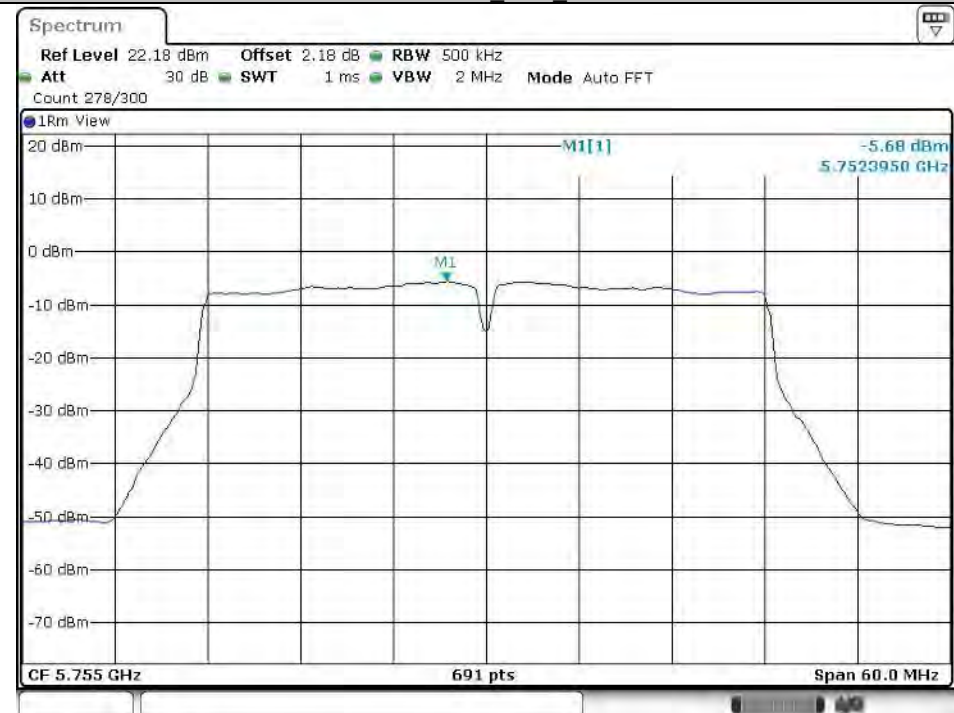


Date: 20 JAN 2021 20:40:48

11N40MIMO_Ant2_5755

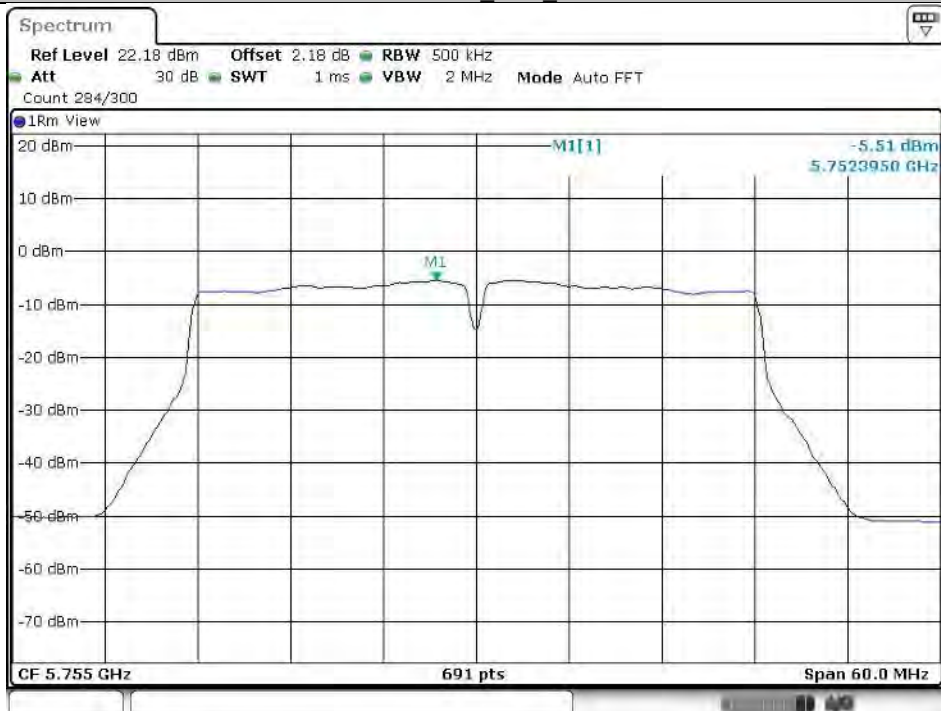

Date: 21.JAN.2021 09:32:24

11N40MIMO_Ant1_5795

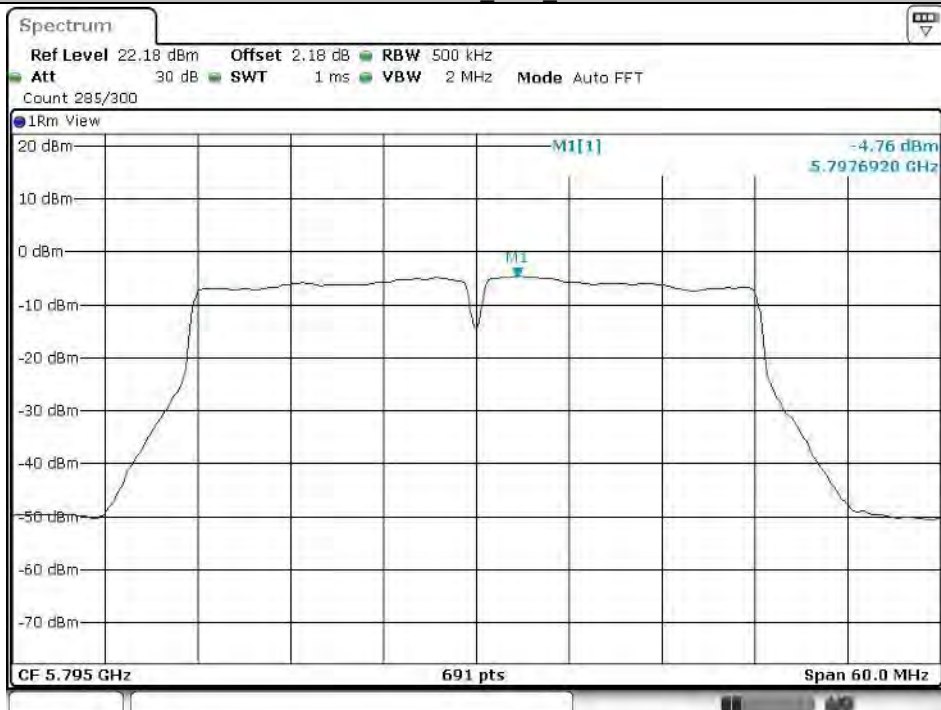


Date: 20.JAN.2021 20:41:18

Report No.: ZR/2020/C003405


Page: 699 of 855

11N40MIMO_Ant2_5795

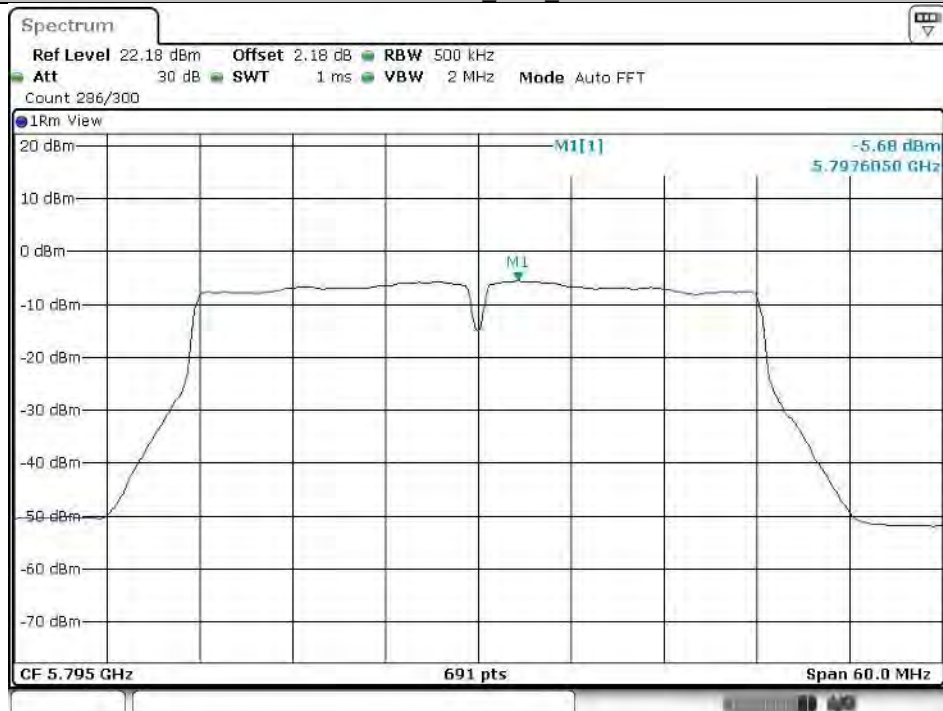


Date: 21.JAN.2021 09:32:54

11AC20MIMO_Ant1_5180

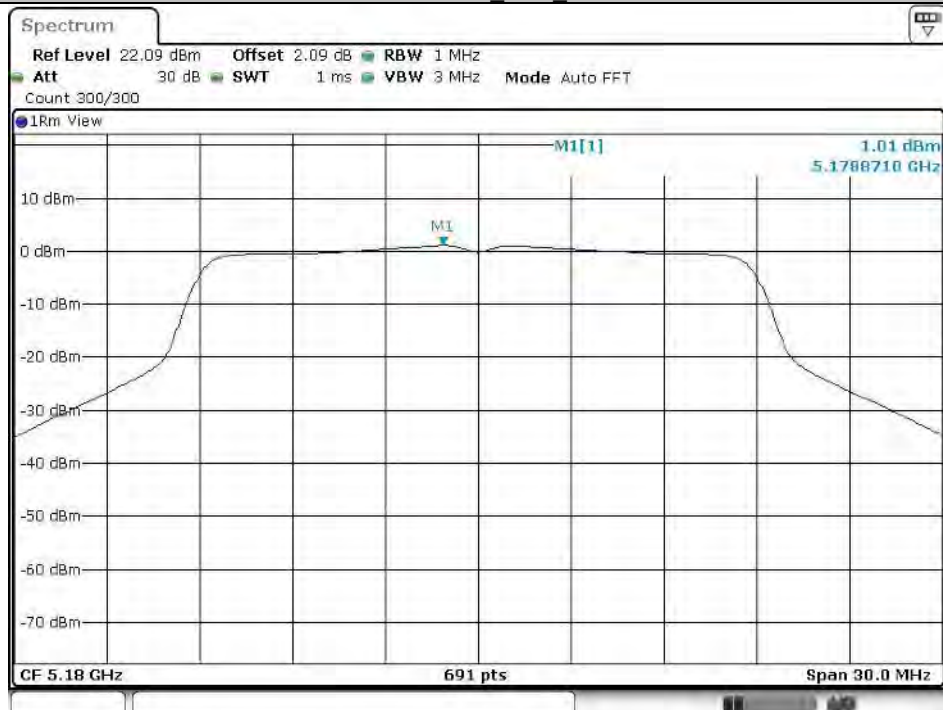


Date: 20.JAN.2021 16:20:41

11AC20MIMO_Ant2_5180

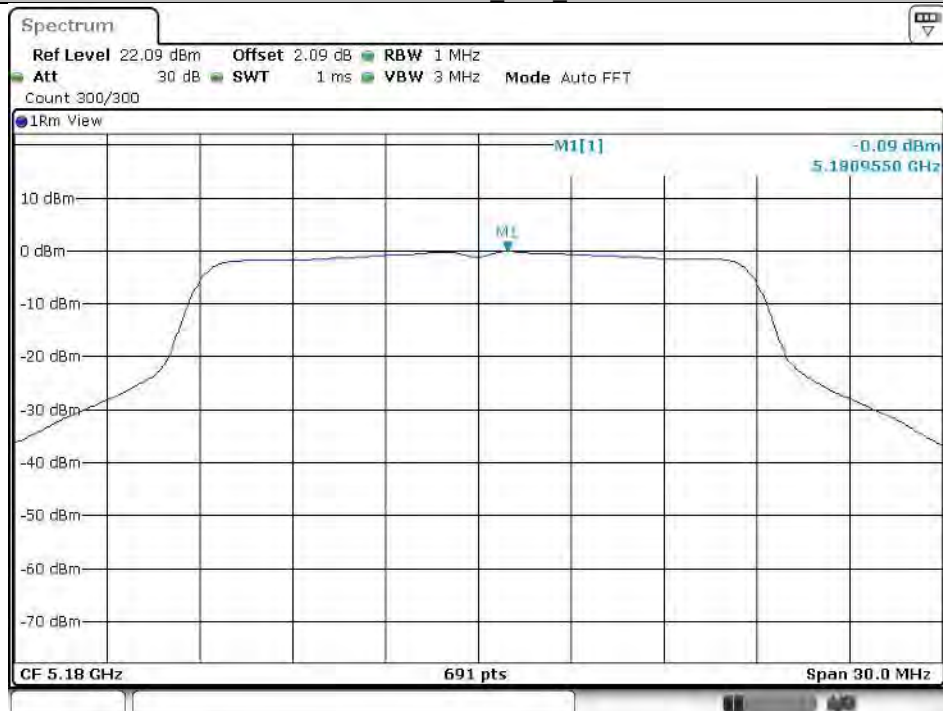


Date: 20.JAN.2021 19:39:07

11AC20MIMO_Ant1_5200

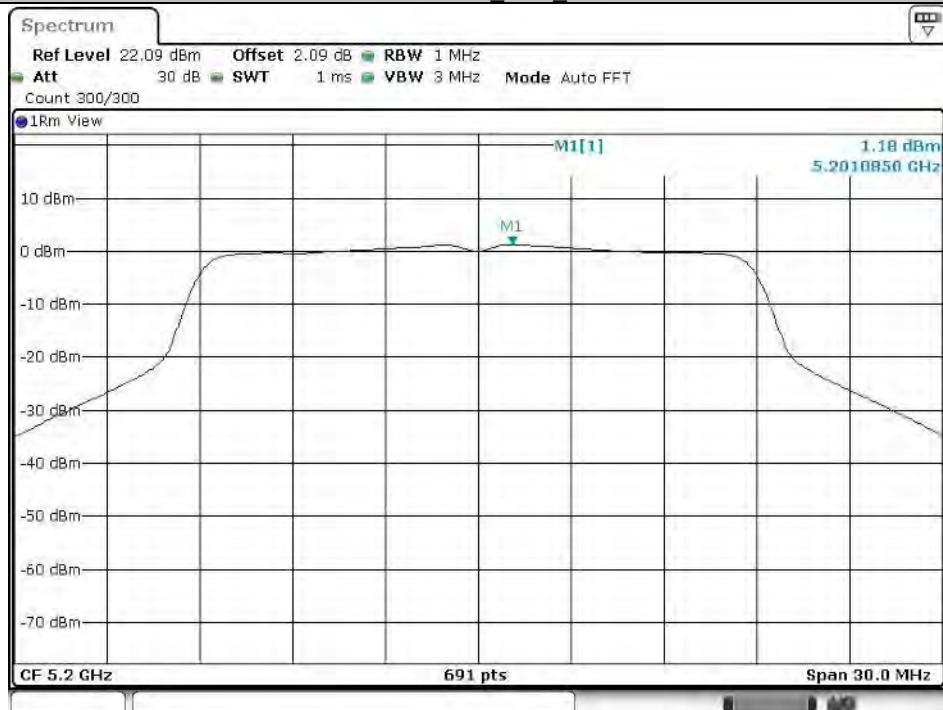


Date: 20.JAN.2021 16:21:13

11AC20MIMO_Ant2_5200

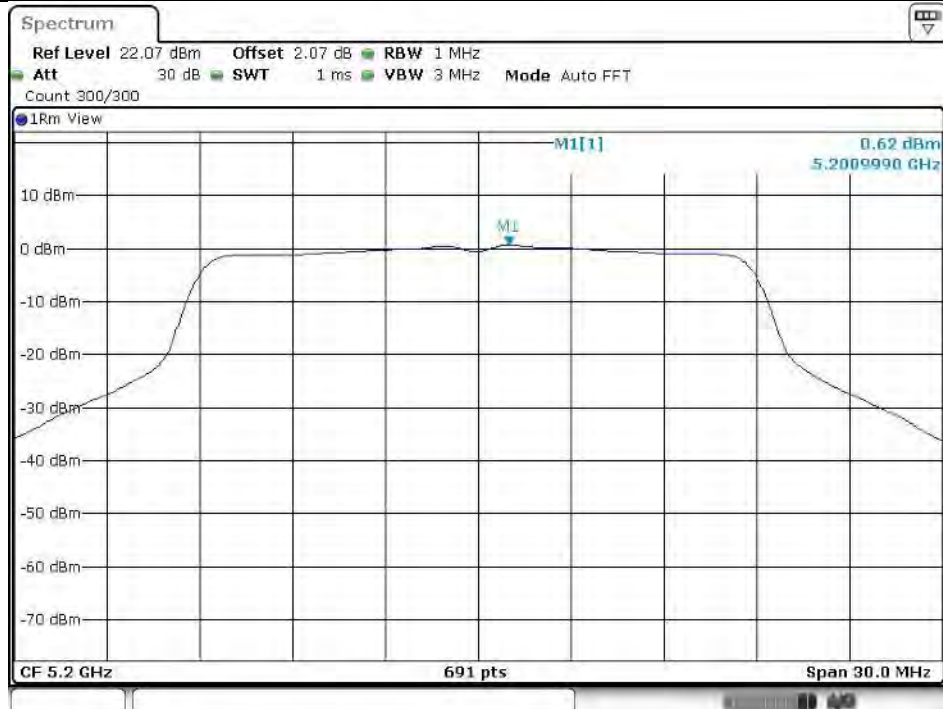


Date: 20.JAN.2021 19:39:48

11AC20MIMO_Ant1_5240

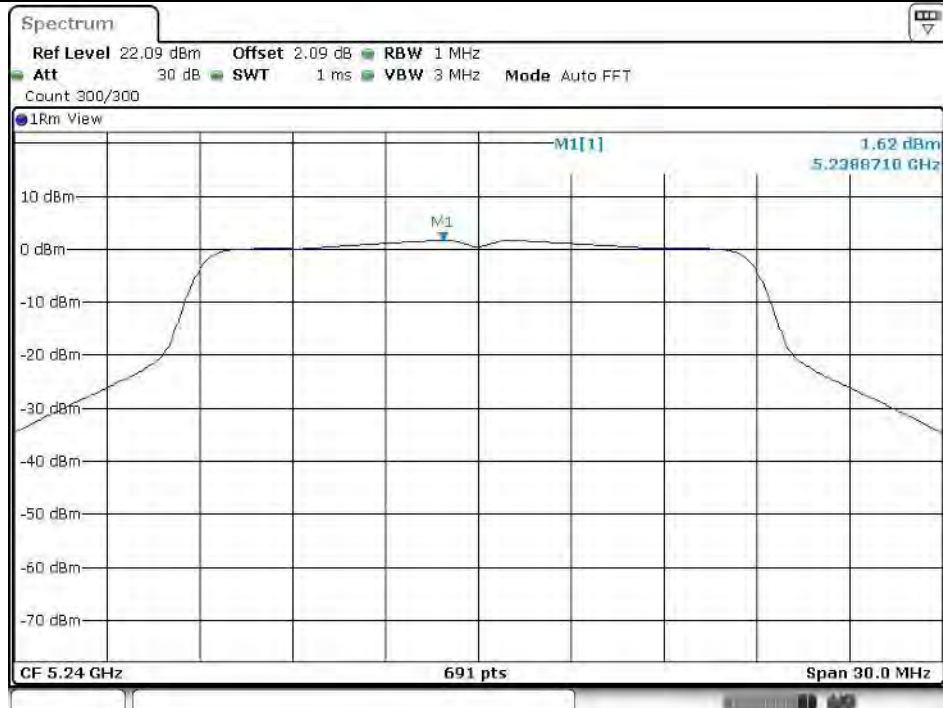


Date: 20.JAN.2021 16:21:45

11AC20MIMO_Ant2_5240

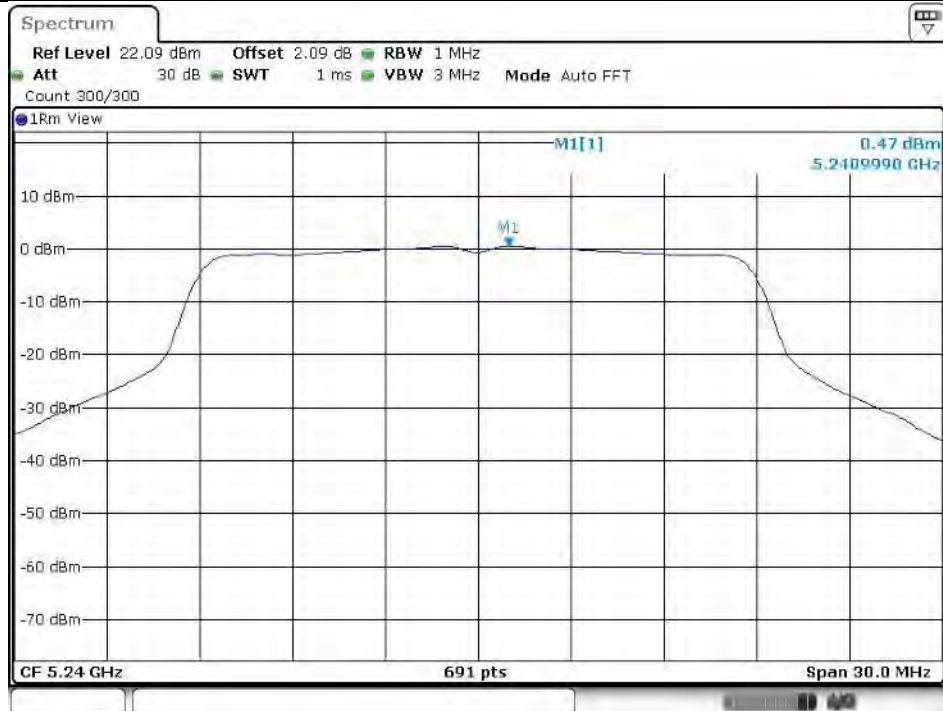


Date: 20.JAN.2021 19:40:19

11AC20MIMO_Ant1_5260

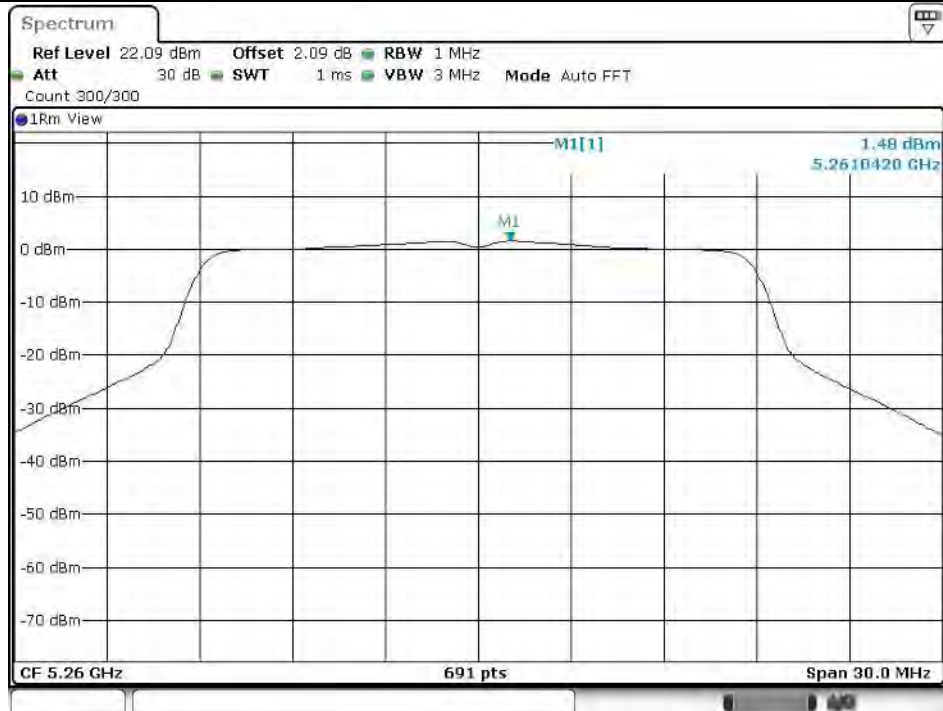


Date: 20.JAN.2021 16:22:33

11AC20MIMO_Ant2_5260

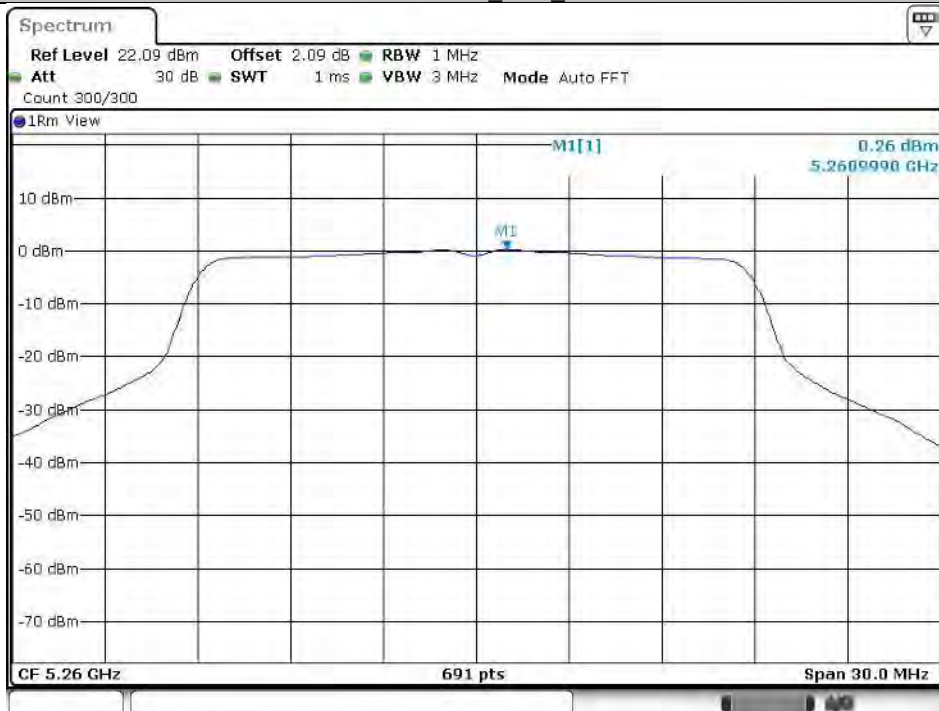


Date: 20.JAN.2021 19:40:50

11AC20MIMO_Ant1_5300

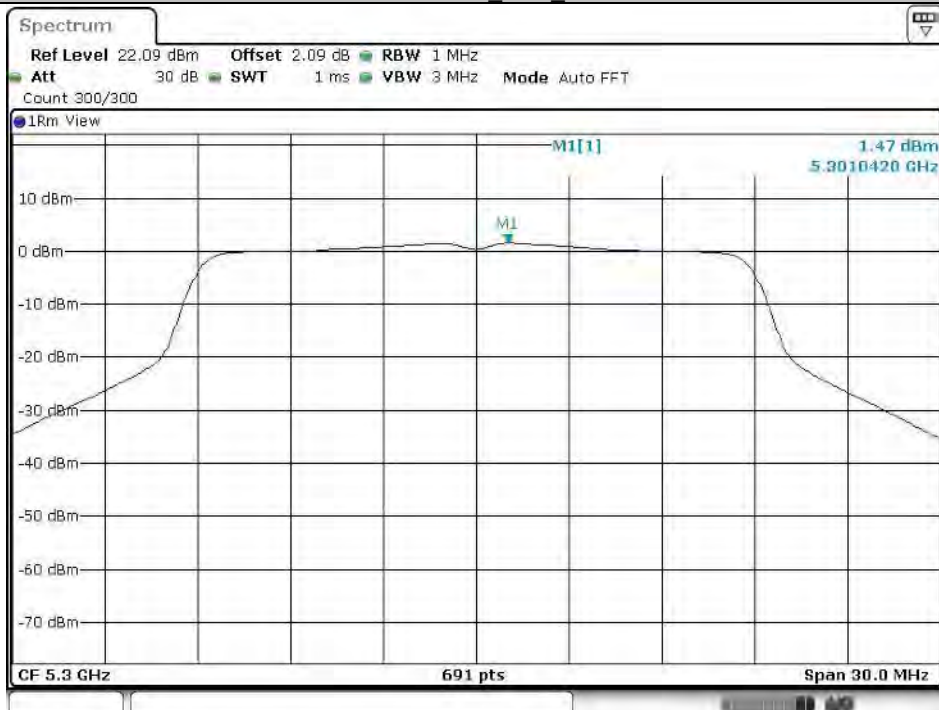


Date: 20.JAN.2021 16:23:20

11AC20MIMO_Ant2_5300

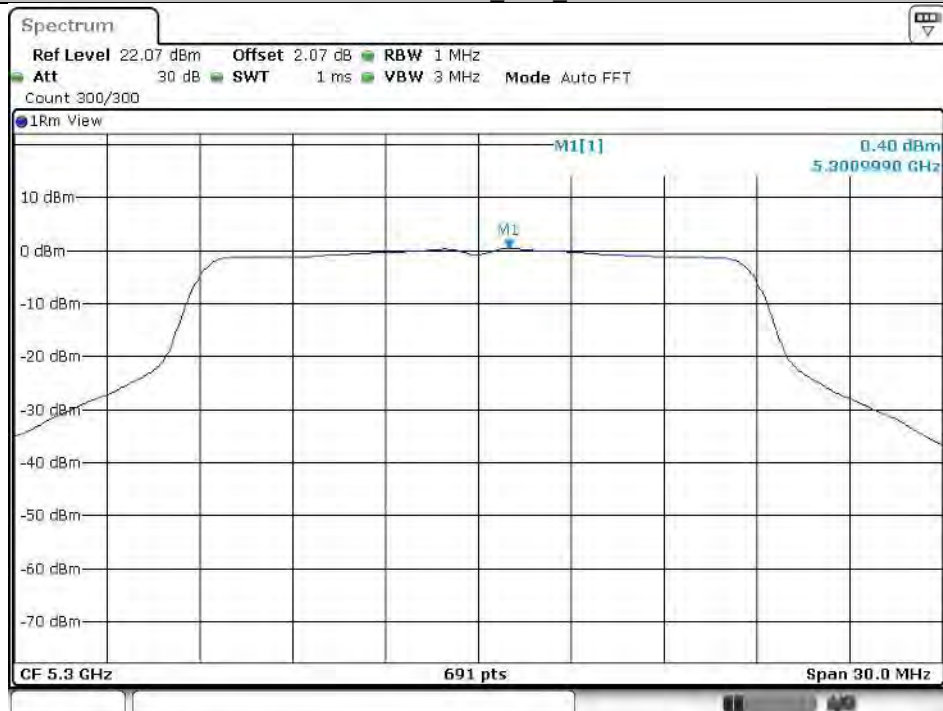


Date: 20.JAN.2021 19:41:34

11AC20MIMO_Ant1_5320

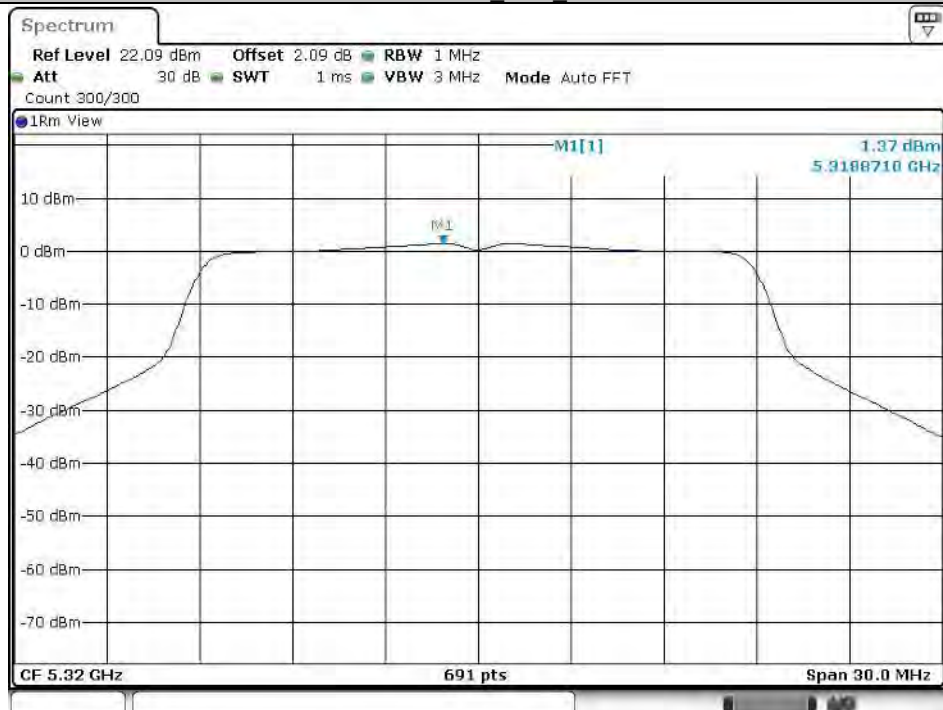


Date: 20.JAN.2021 16:23:47

11AC20MIMO_Ant2_5320

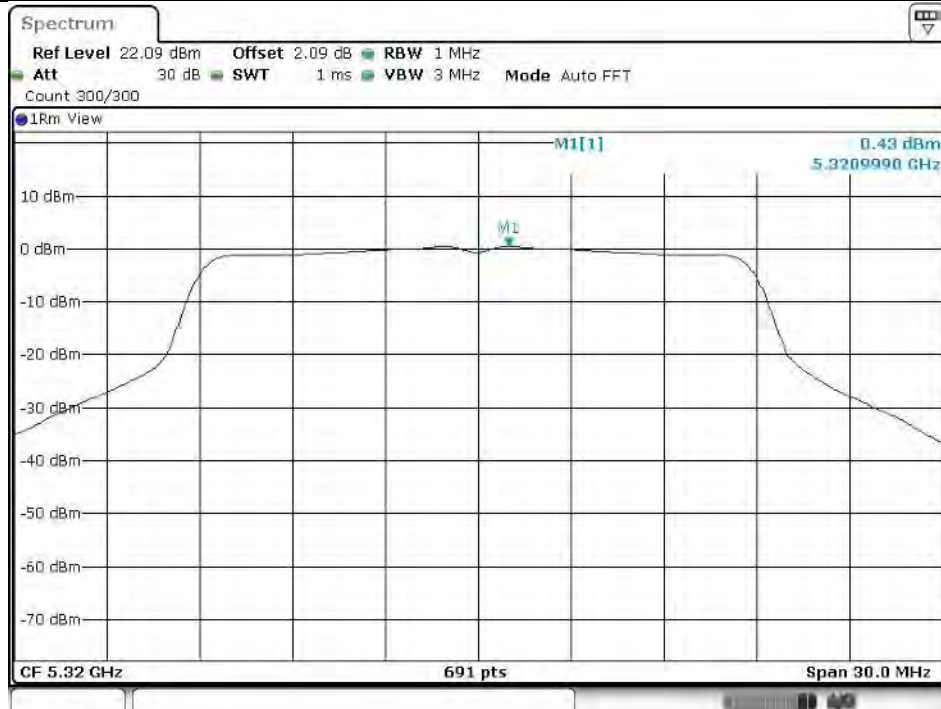


Date: 20.JAN.2021 19:42:19

11AC20MIMO_Ant1_5500

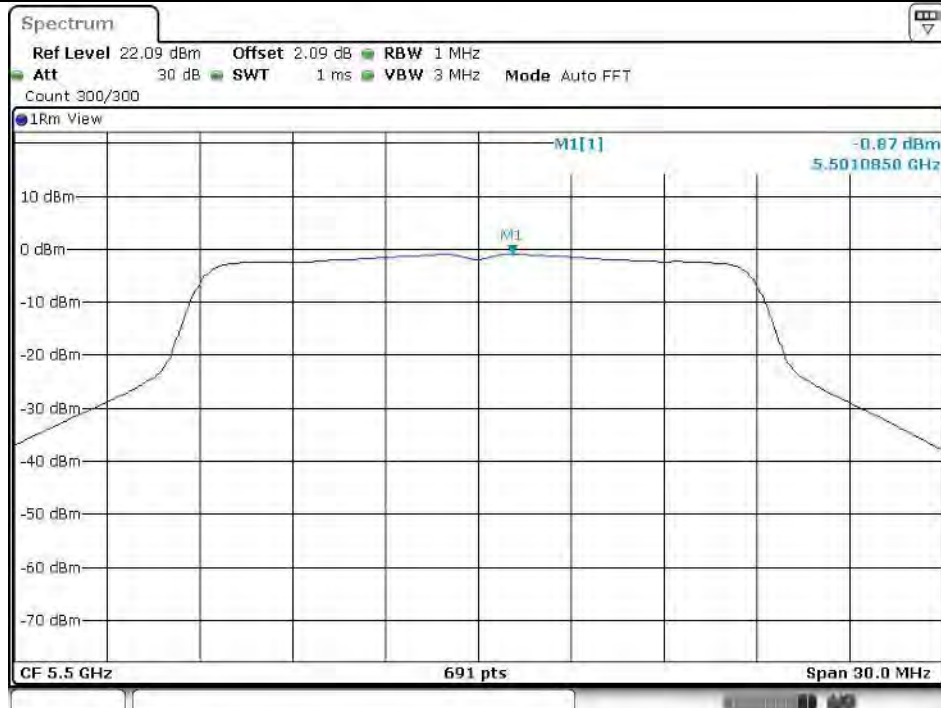


Date: 20.JAN.2021 16:24:16

11AC20MIMO_Ant2_5500

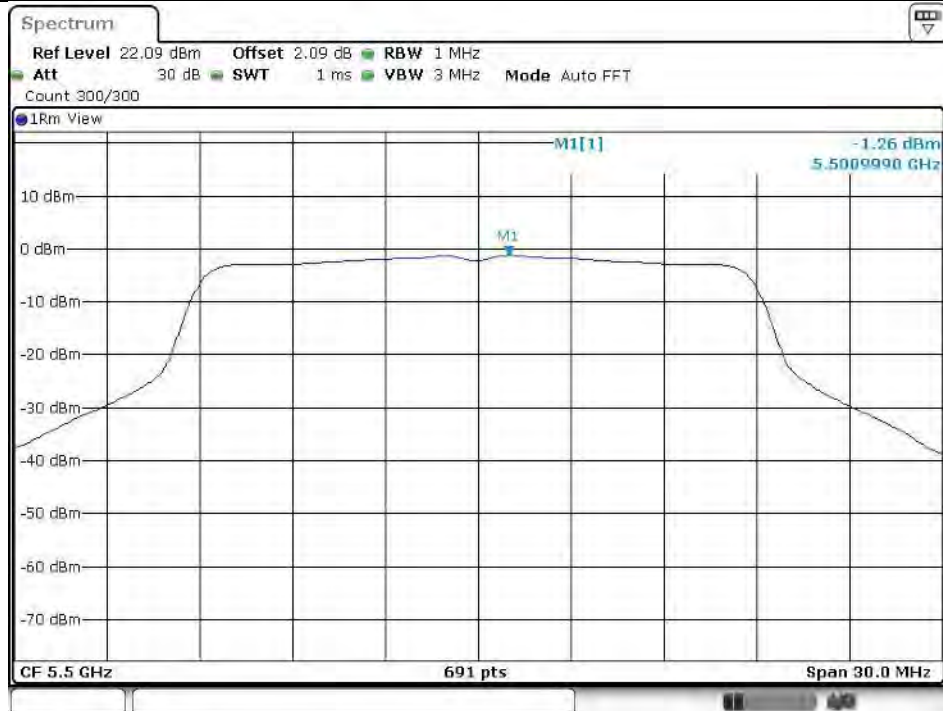


Date: 20.JAN.2021 19:43:03

11AC20MIMO_Ant1_5580

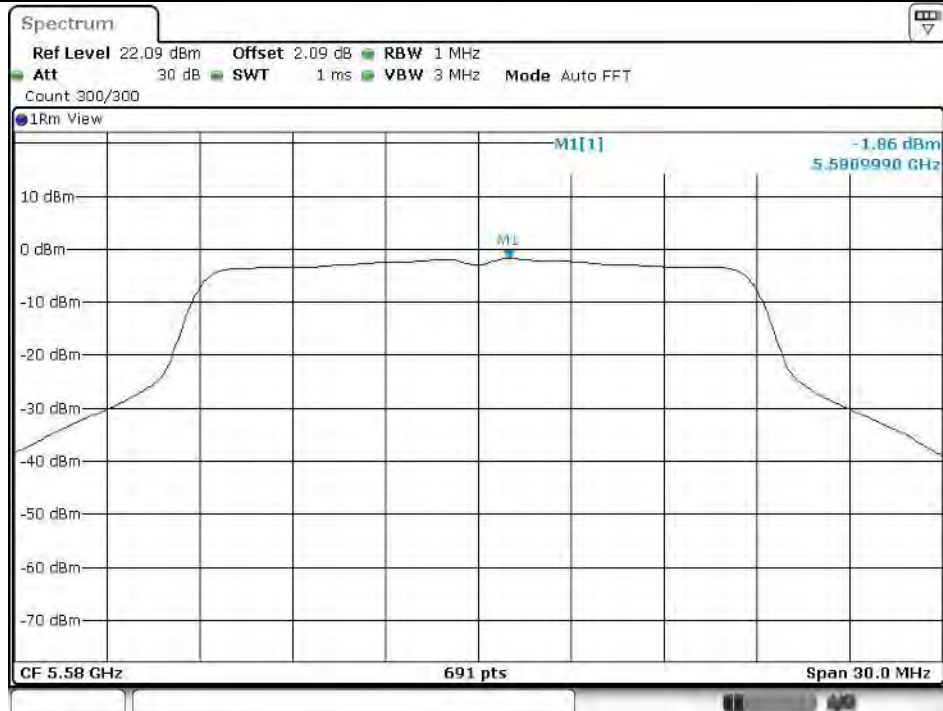


Date: 20.JAN.2021 19:59:47

11AC20MIMO_Ant2_5580

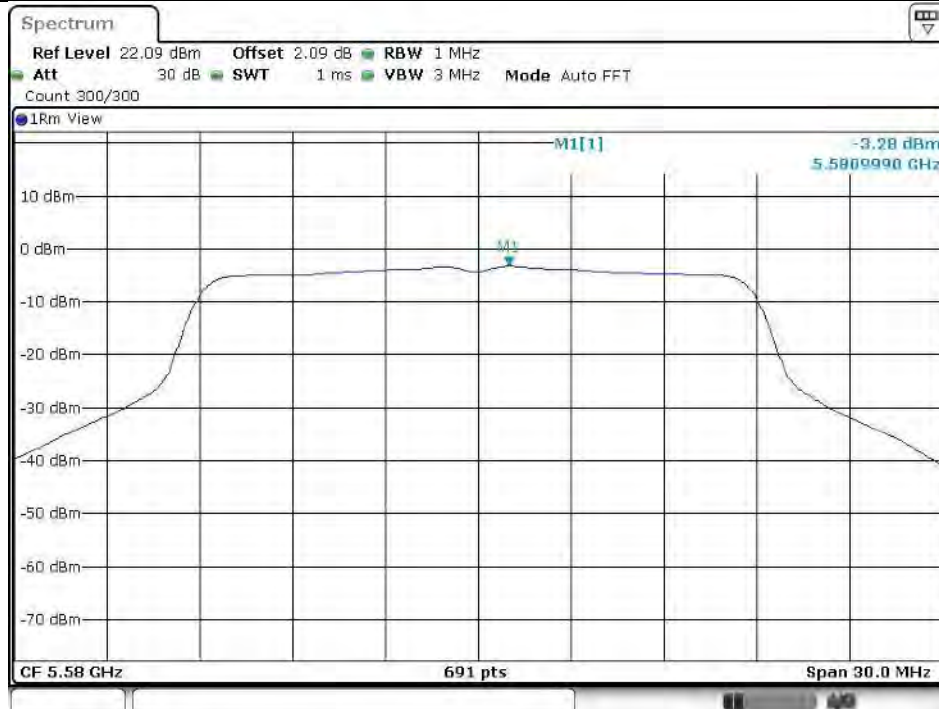


Date: 20.JAN.2021 19:44:19

11AC20MIMO_Ant1_5700

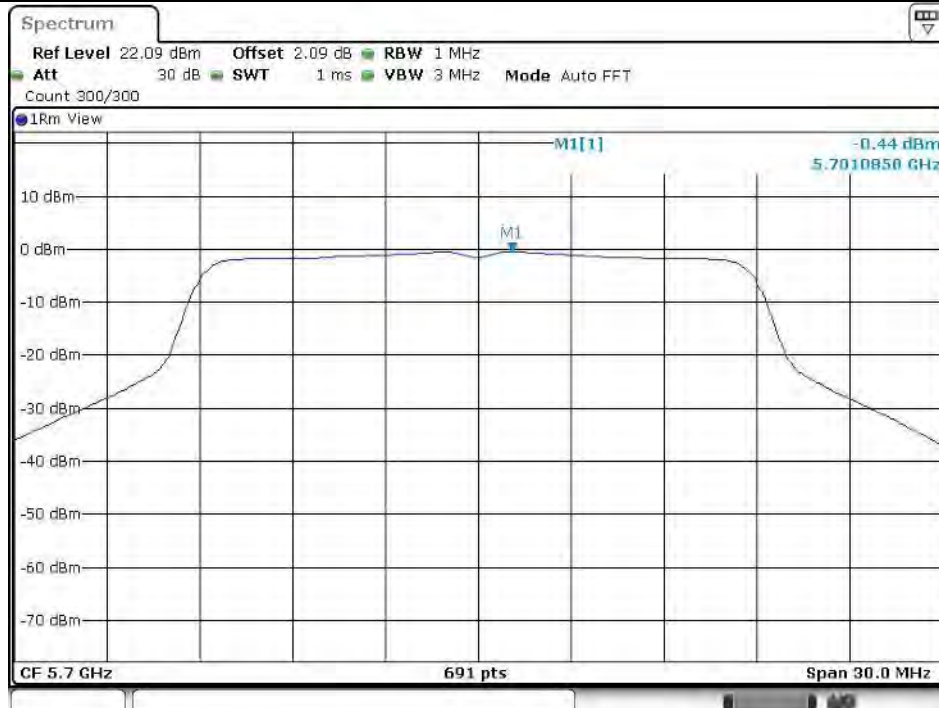

Date: 20.JAN.2021 16:25:27

11AC20MIMO_Ant2_5700

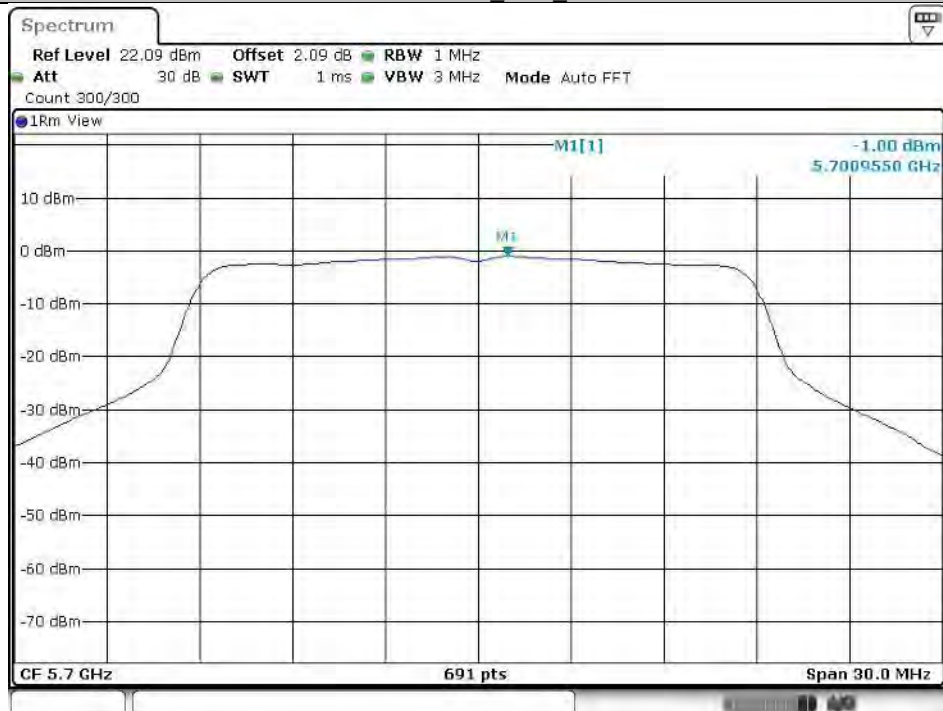


Date: 20.JAN.2021 19:45:02

11AC20MIMO_Ant1_5720




Date: 26 JAN 2021 11:13:36

11AC20MIMO_Ant2_5720

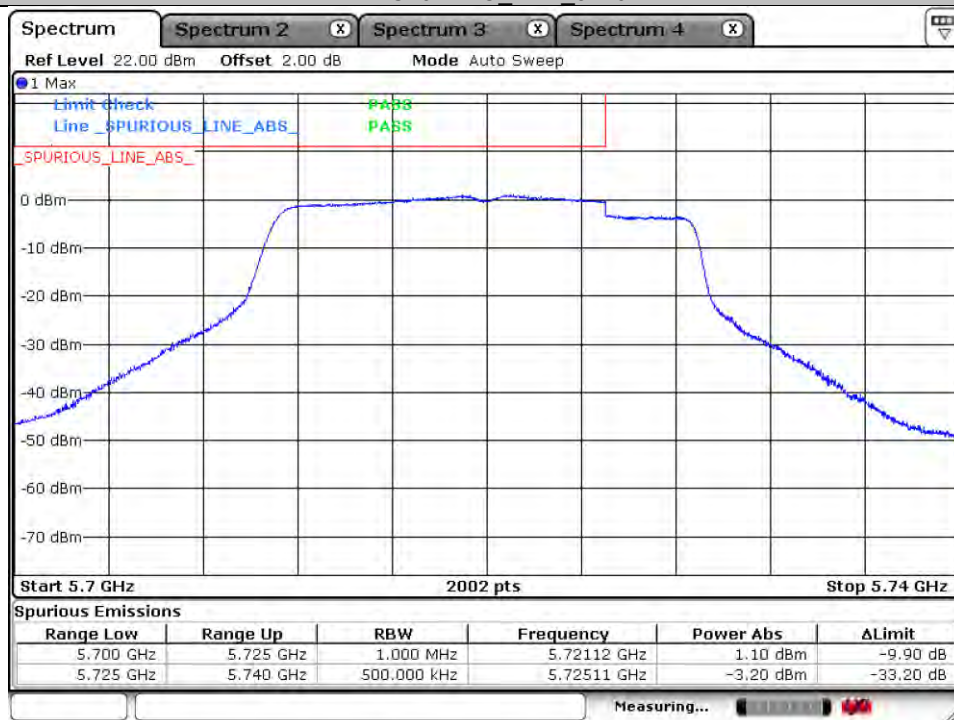


Date: 26 JAN 2021 11:14:42

11AC20MIMO_Ant1_5745

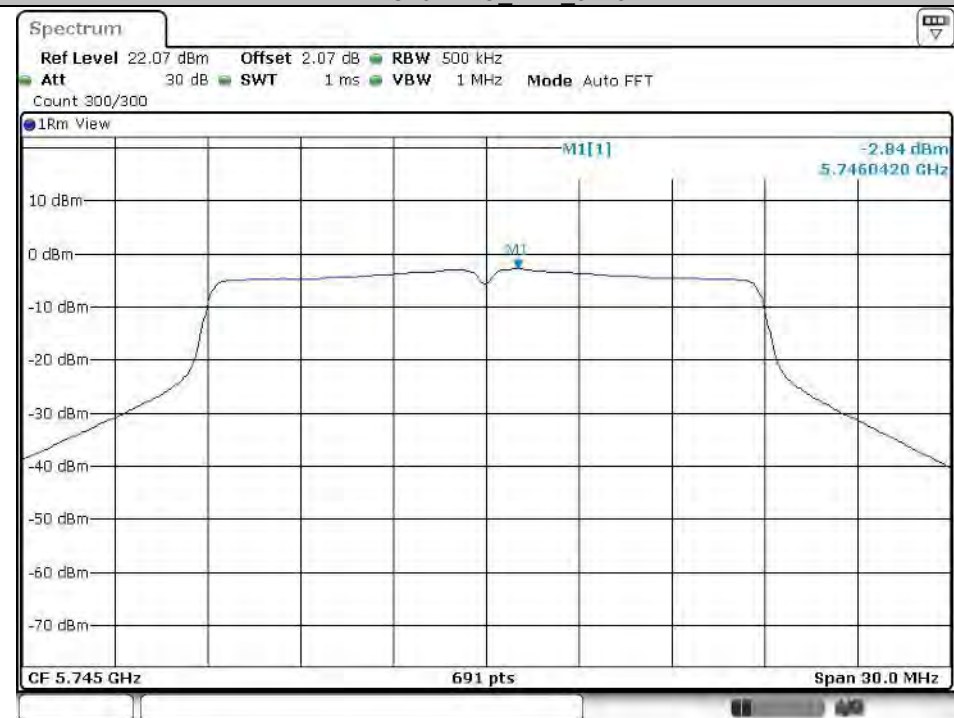


Date: 20 JAN 2021 16:26:24

11AC20MIMO_Ant2_5745

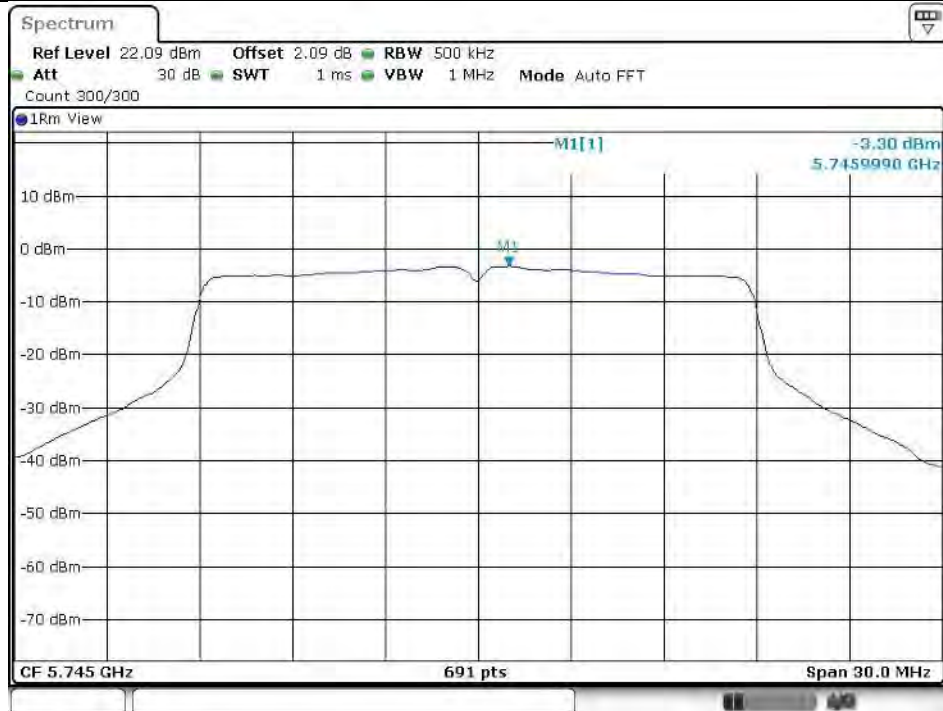


Date: 20.JAN.2021 19:45:32

11AC20MIMO_Ant1_5785

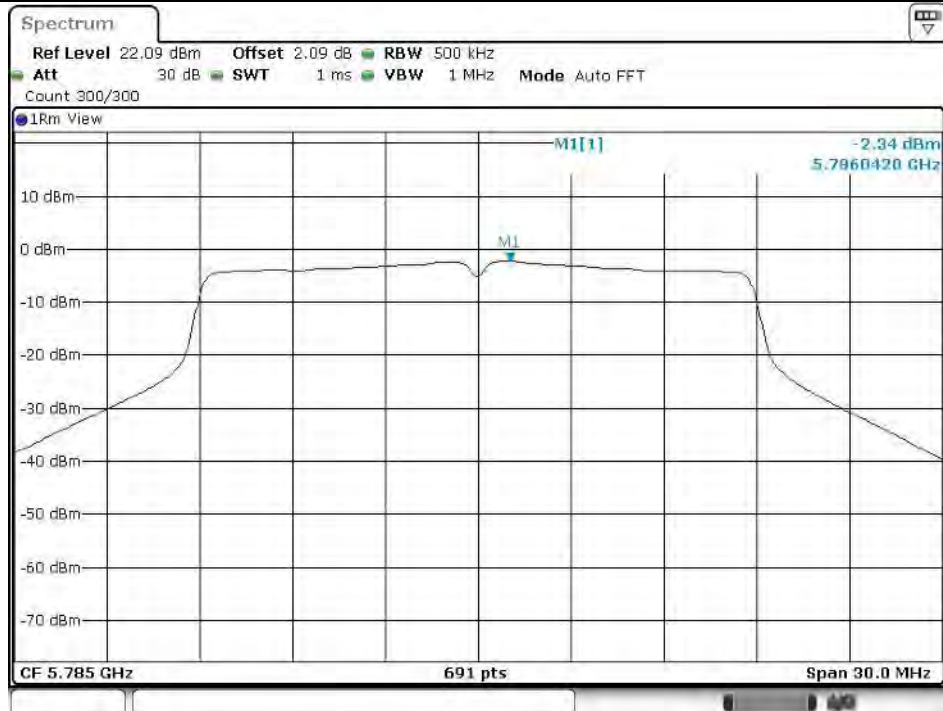


Date: 20.JAN.2021 16:27:43

11AC20MIMO_Ant2_5785

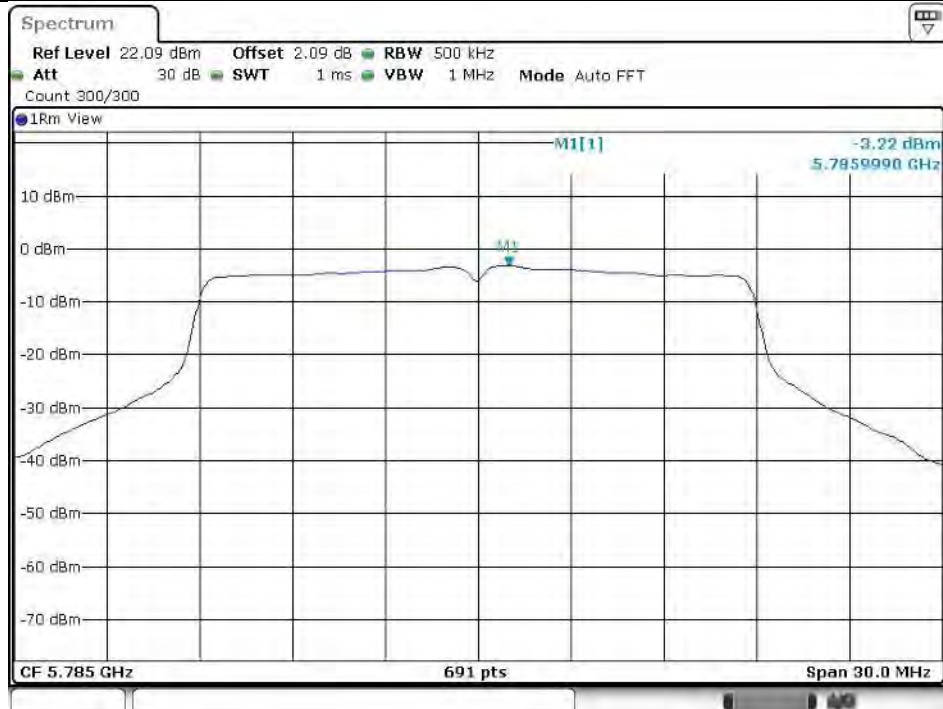


Date: 20.JAN.2021 19:46:03

11AC20MIMO_Ant1_5825

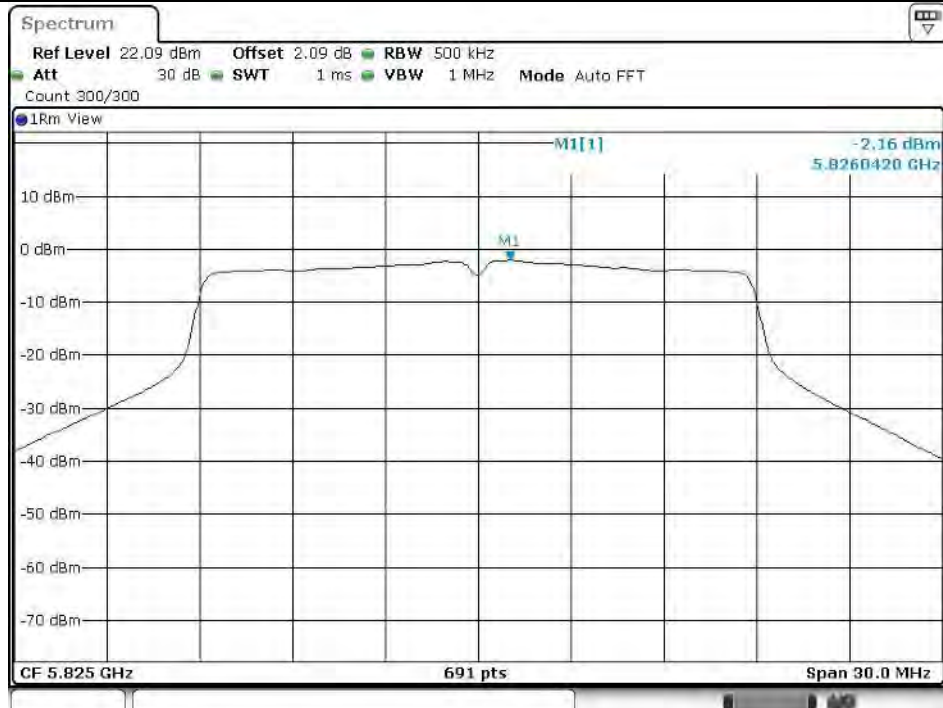


Date: 20.JAN.2021 16:28:18

11AC20MIMO_Ant2_5825

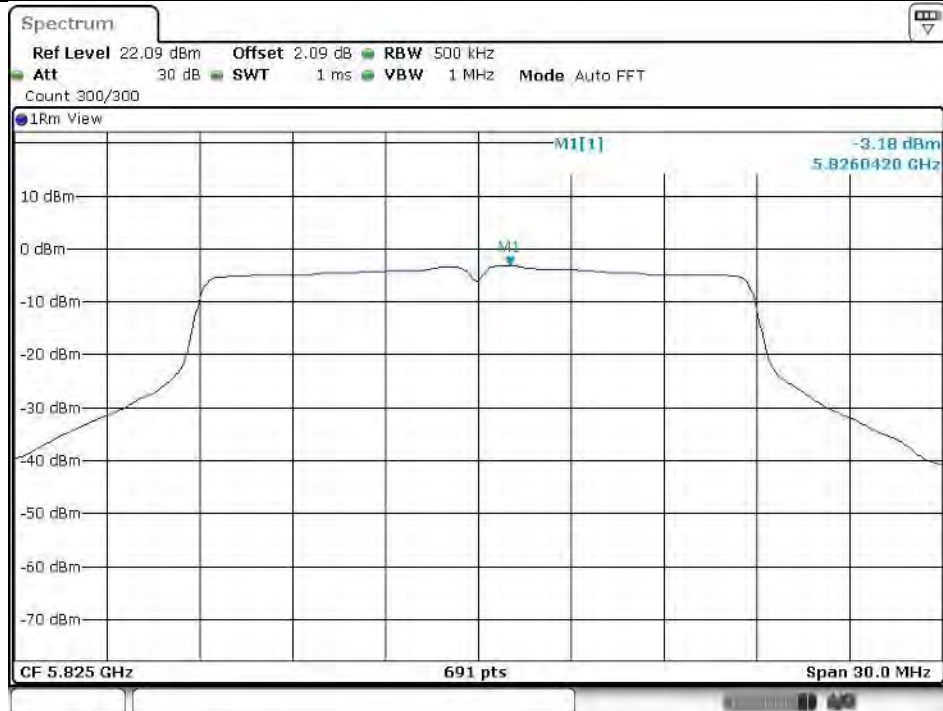


Date: 20.JAN.2021 19:46:30

11AC40MIMO_Ant1_5190

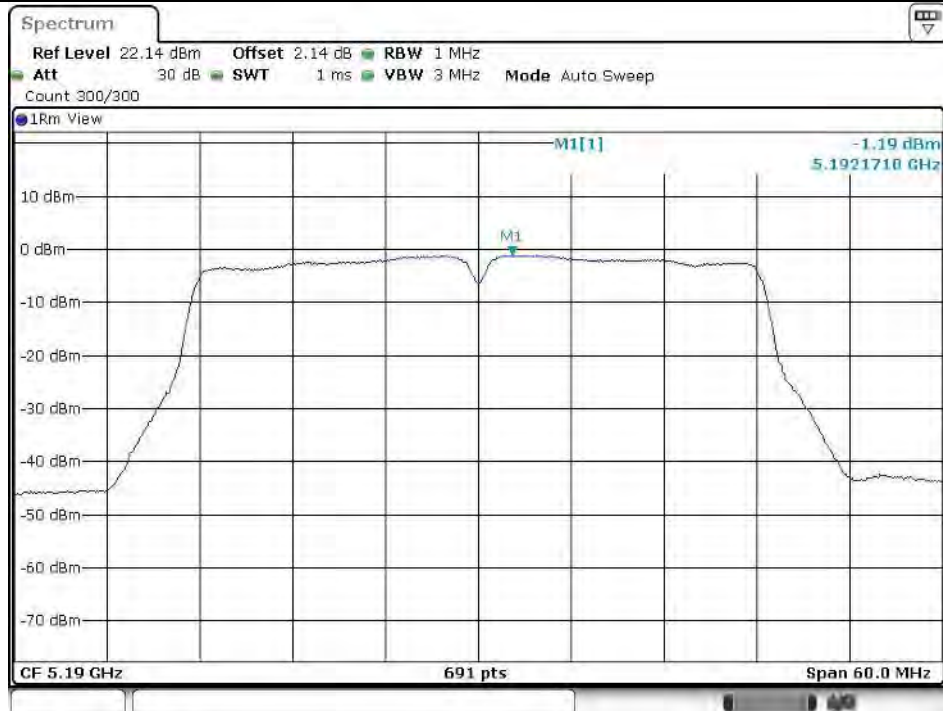


Date: 20.JAN.2021 20:41:55

11AC40MIMO_Ant2_5190

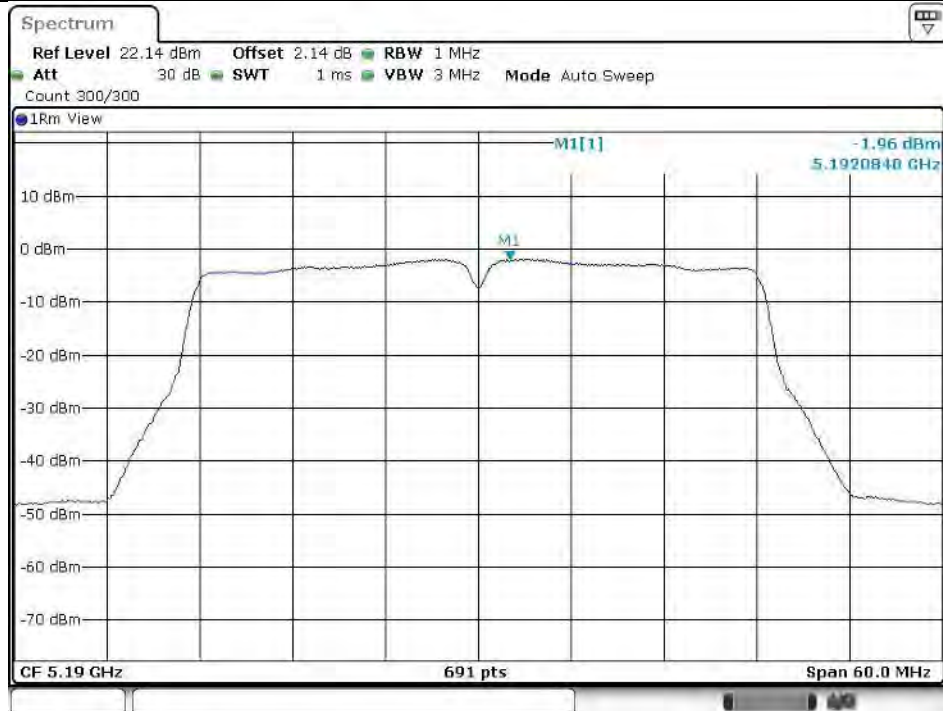


Date: 21.JAN.2021 09:33:38

11AC40MIMO_Ant1_5230

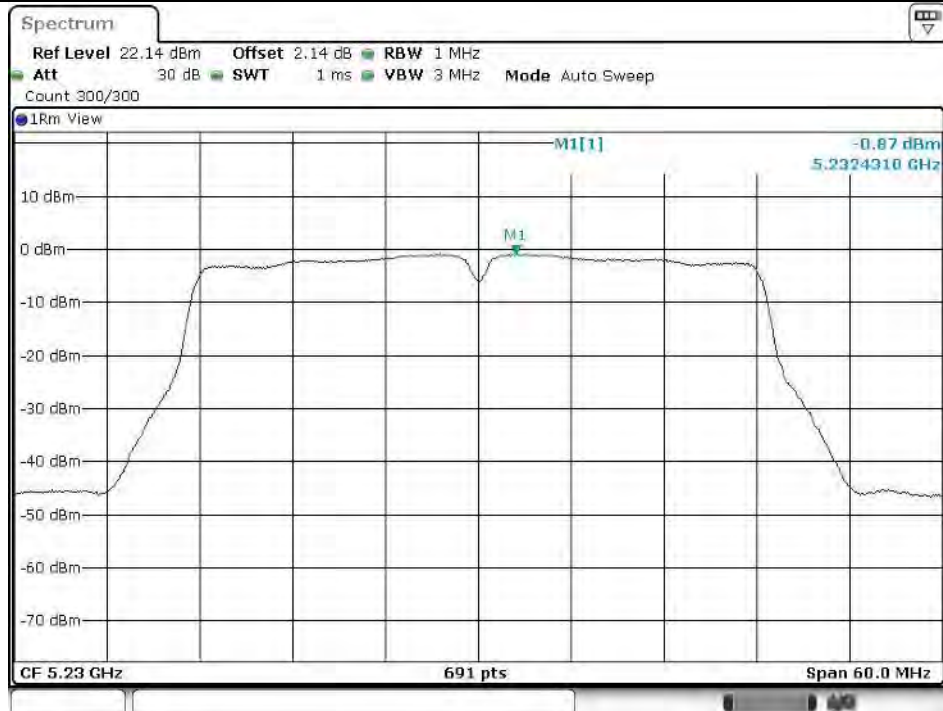


Date: 20.JAN.2021 20:42:24

11AC40MIMO_Ant2_5230

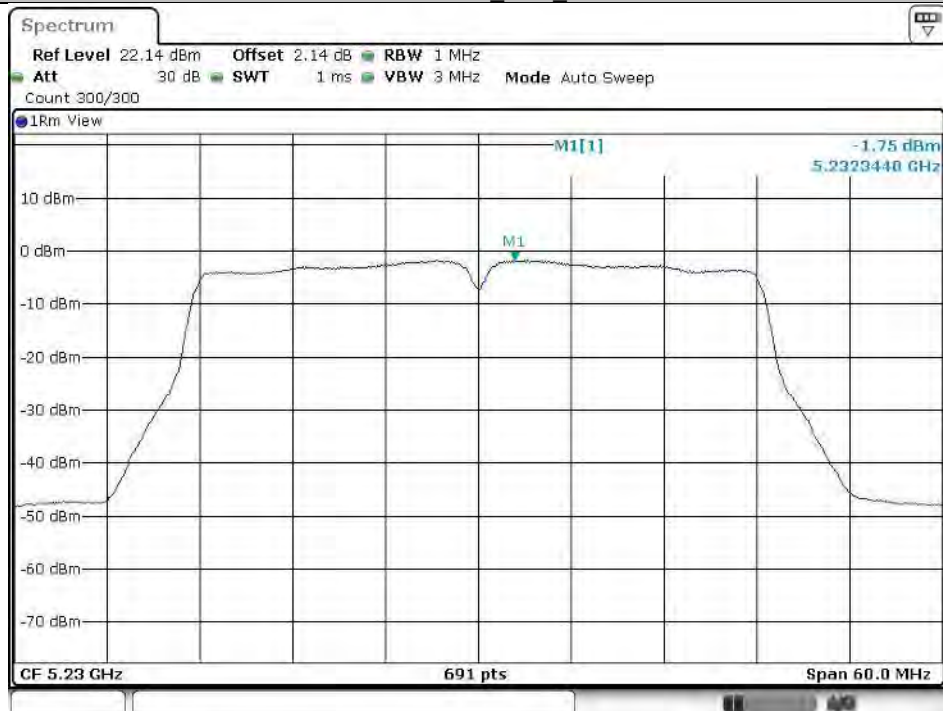


Date: 21.JAN.2021 09:34:28

11AC40MIMO_Ant1_5270

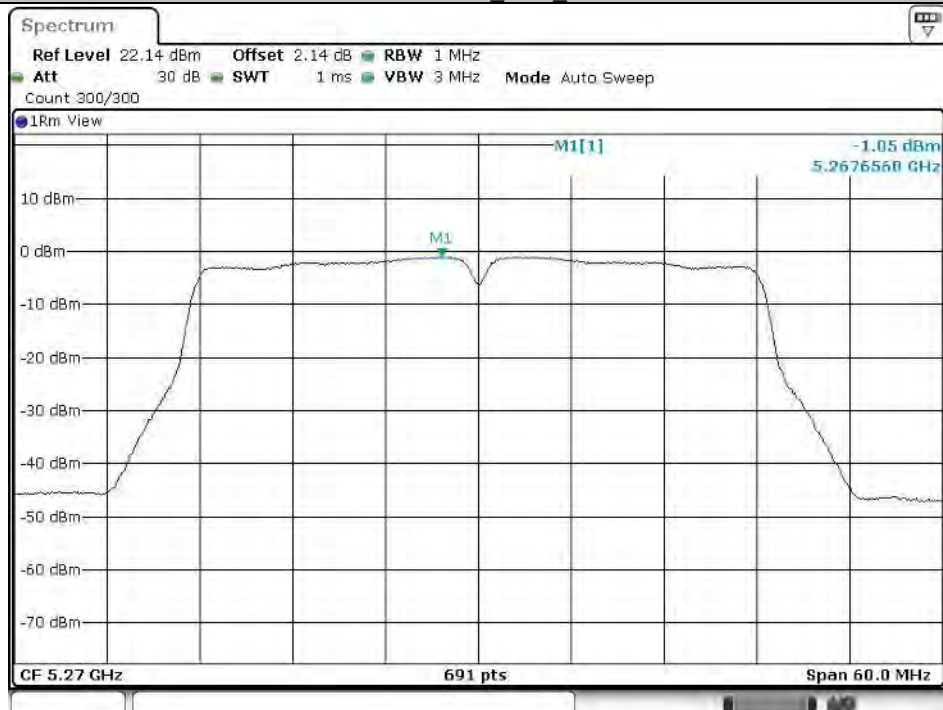


Date: 20.JAN.2021 20:43:07

11AC40MIMO_Ant2_5270

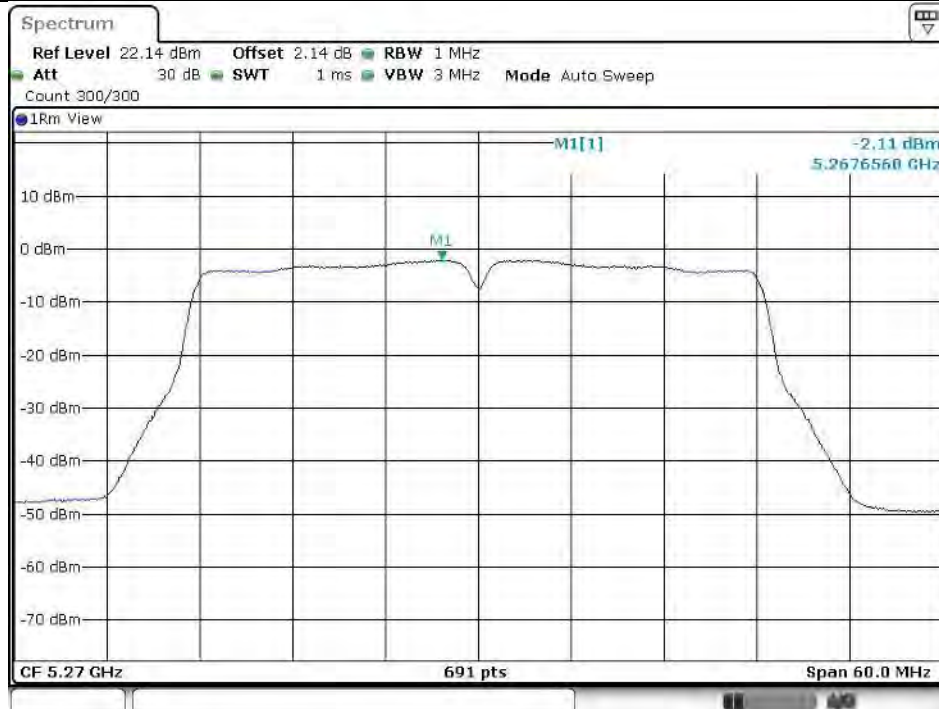


Date: 21.JAN.2021 09:34:58

11AC40MIMO_Ant1_5310

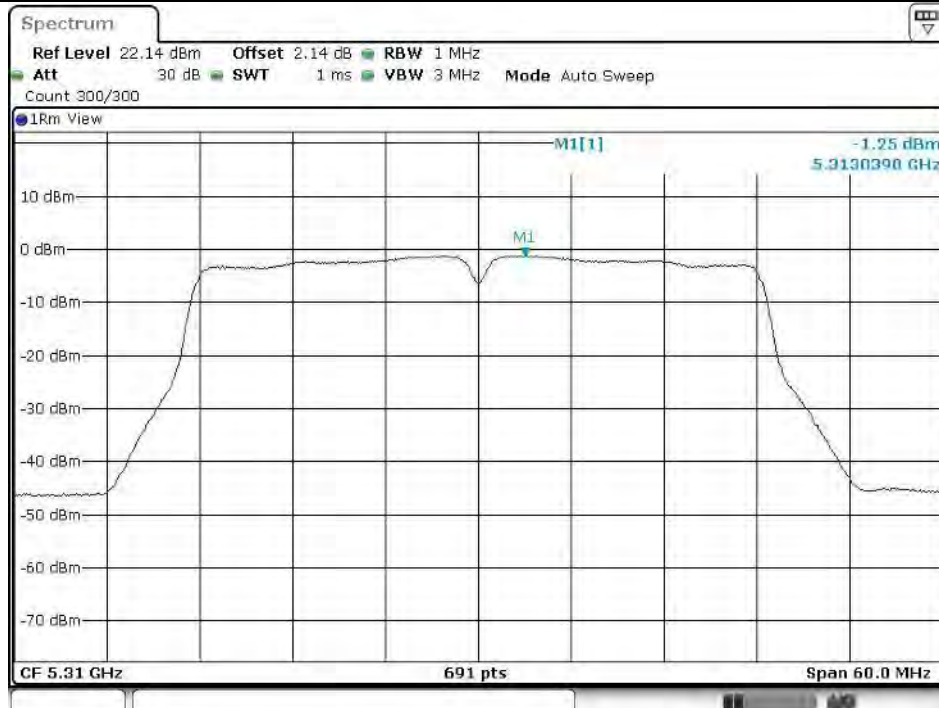


Date: 20.JAN.2021 20:43:43

11AC40MIMO_Ant2_5310

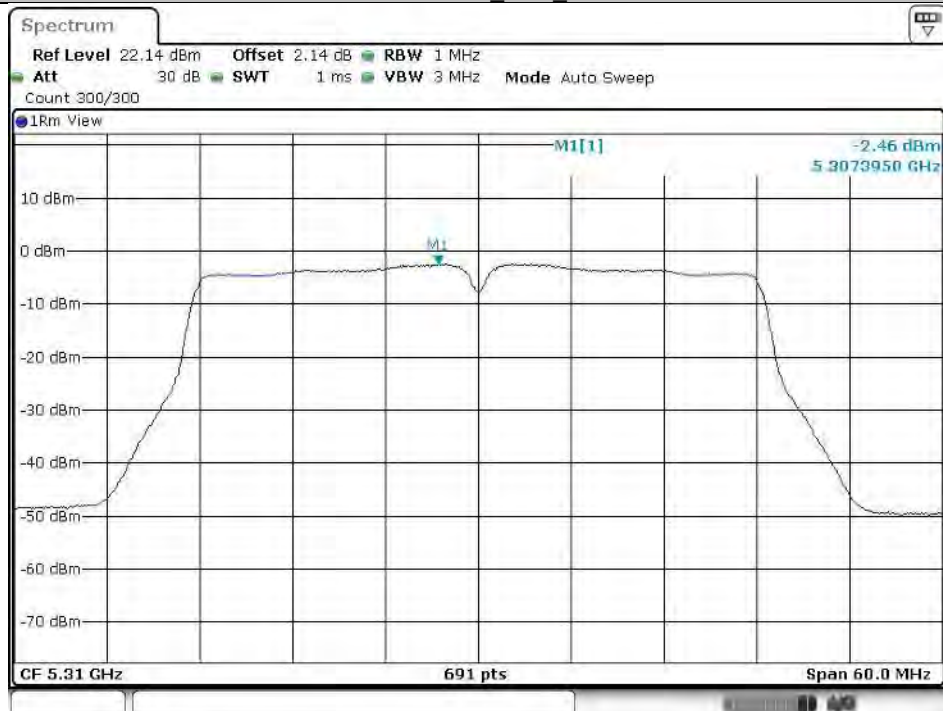


Date: 21.JAN.2021 09:35:35

11AC40MIMO_Ant1_5510

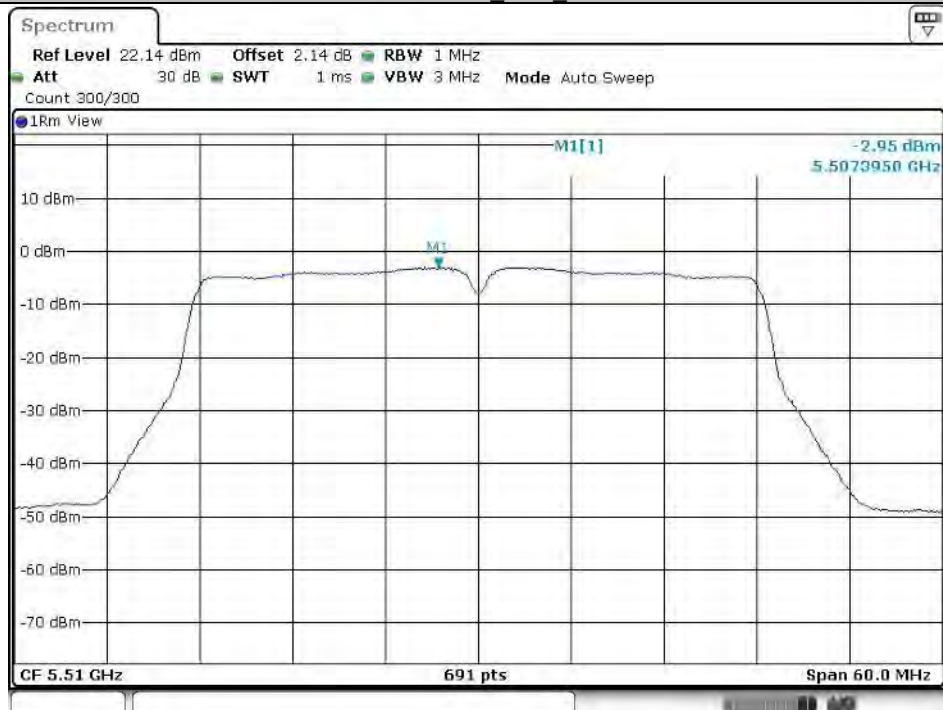


Date: 20.JAN.2021 20:44:13

11AC40MIMO_Ant2_5510

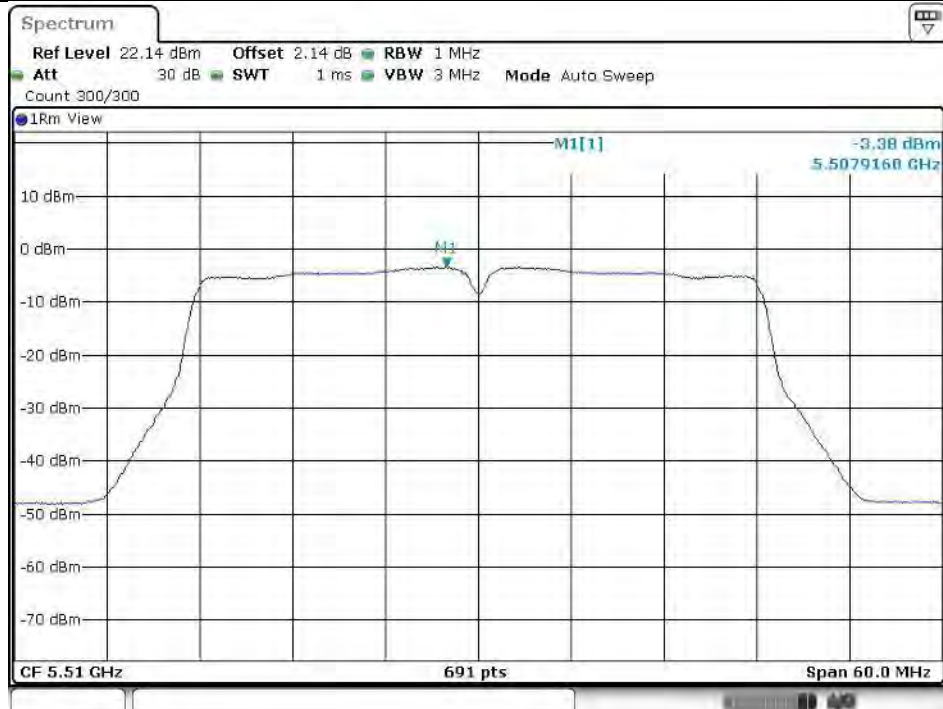


Date: 21.JAN.2021 09:36:08

11AC40MIMO_Ant1_5550

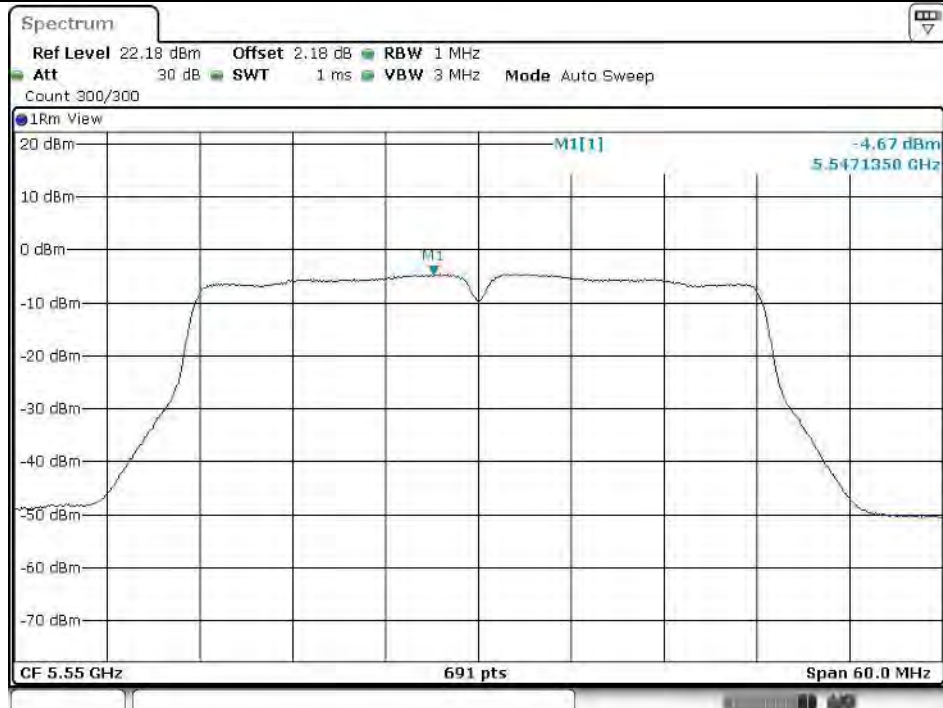

Date: 20.JAN.2021 20:44:42

11AC40MIMO_Ant2_5550

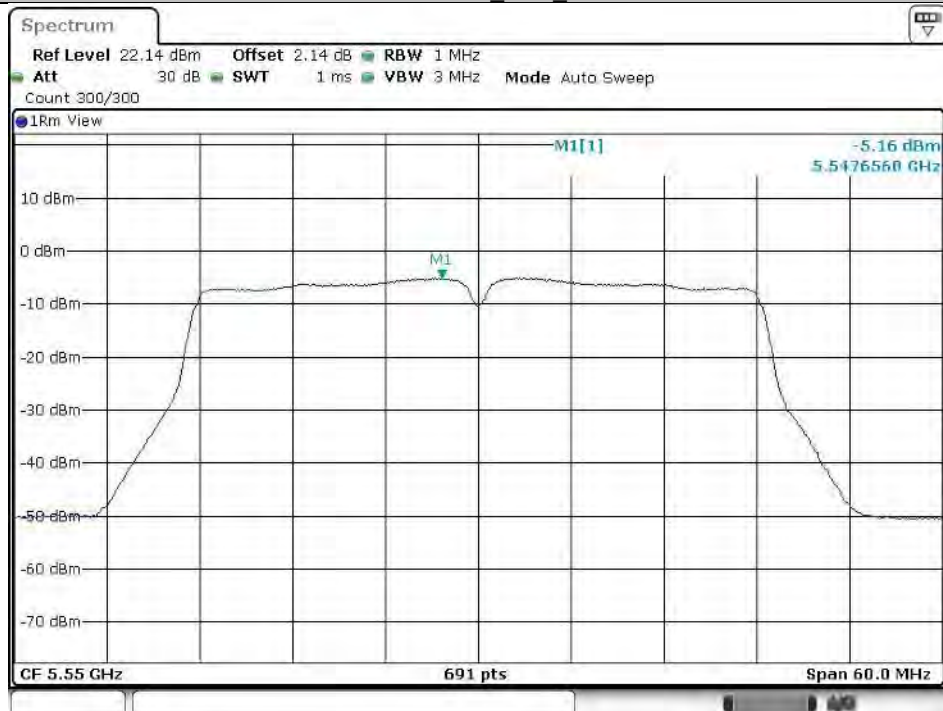

Date: 21.JAN.2021 09:36:42

11AC40MIMO_Ant1_5670




Date: 20.JAN.2021 20:45:15

11AC40MIMO_Ant2_5670




Date: 21.JAN.2021 09:37:15

11AC40MIMO_Ant1_5710

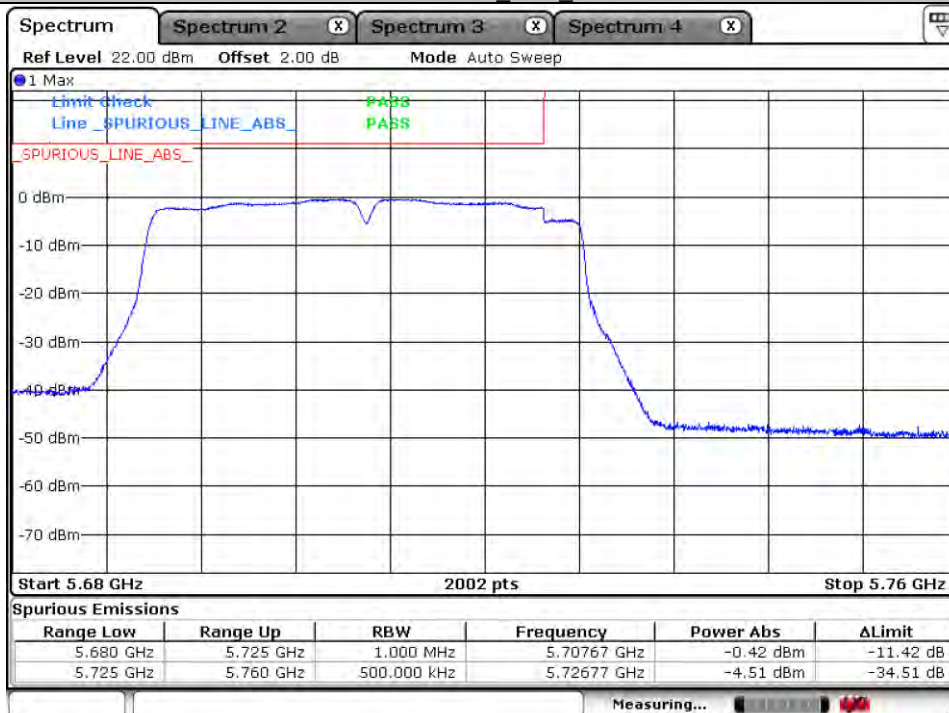


Date: 26 JAN 2021 14:15:57

11AC40MIMO_Ant2_5710

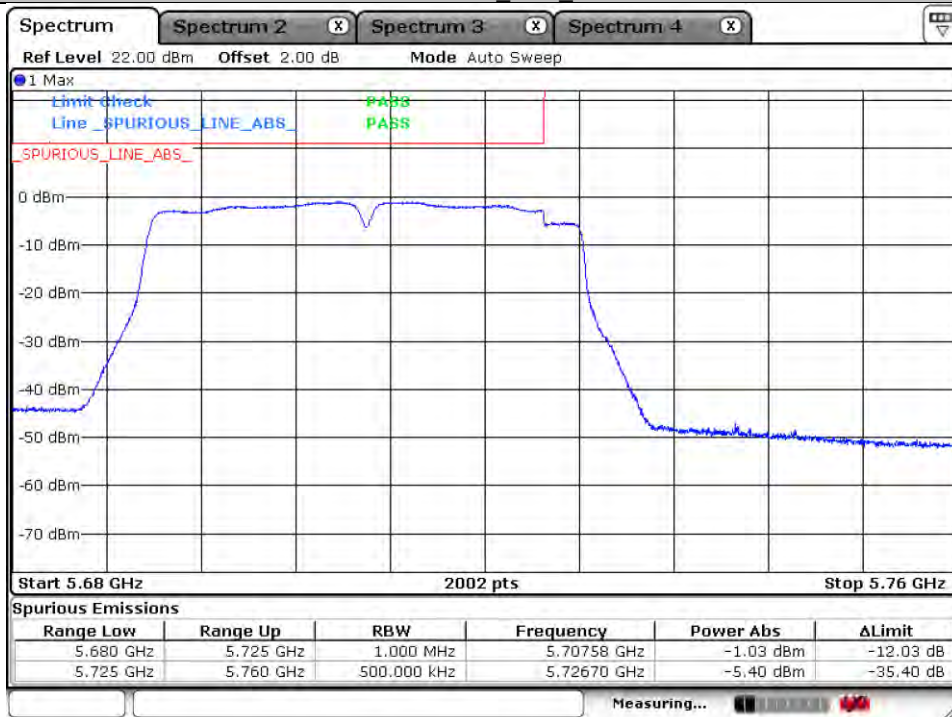


Date: 26 JAN 2021 14:12:19

11AC40MIMO_Ant1_5755

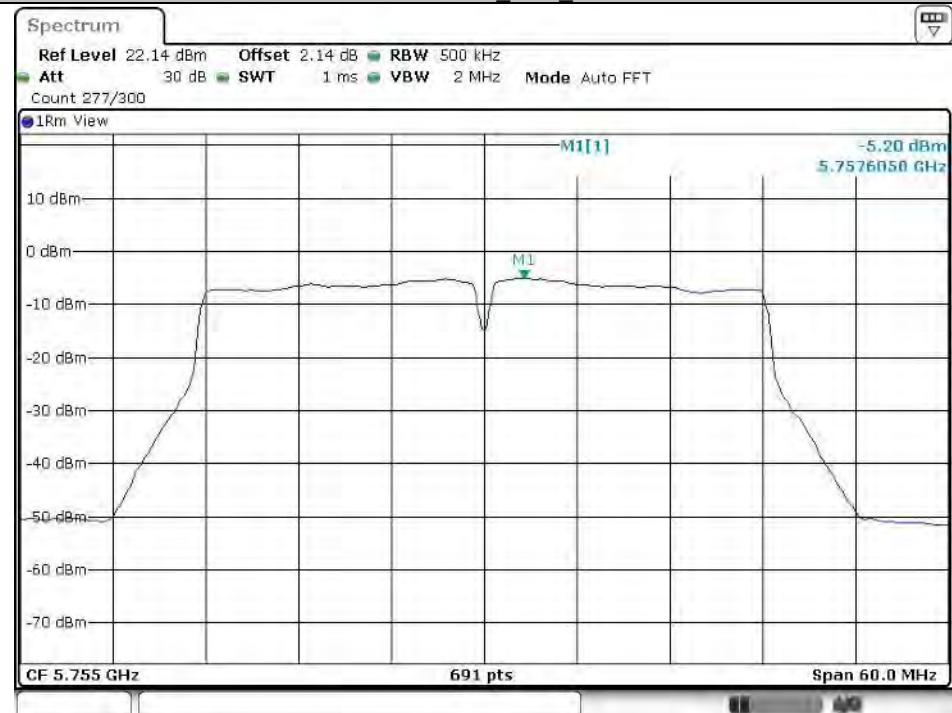


Date: 20 JAN 2021 20:45:50

11AC40MIMO_Ant2_5755

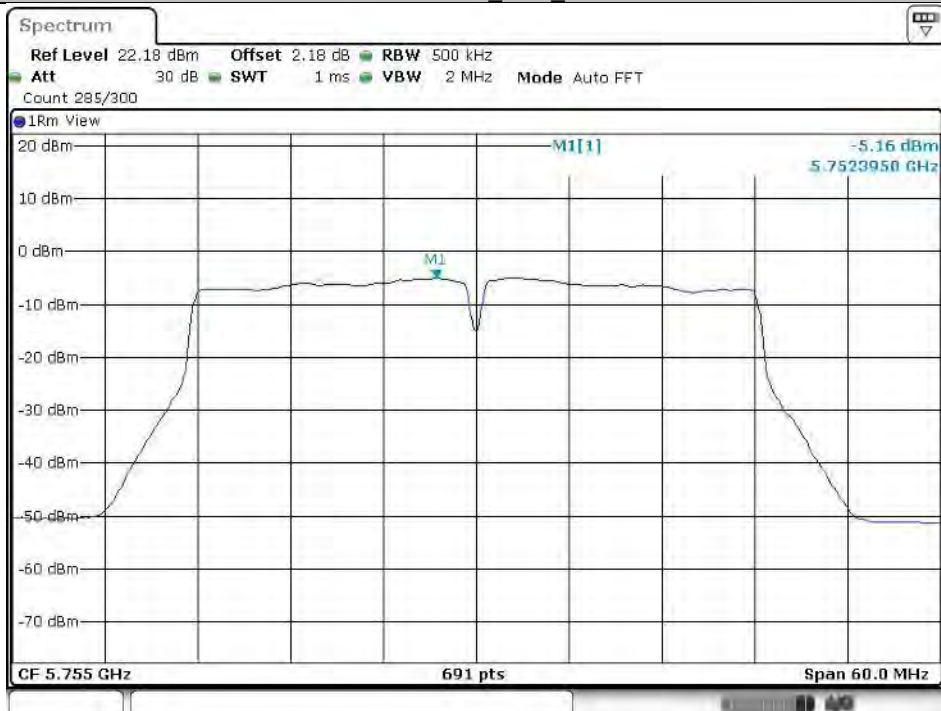


Date: 21.JAN.2021 09:38:11

11AC40MIMO_Ant1_5795

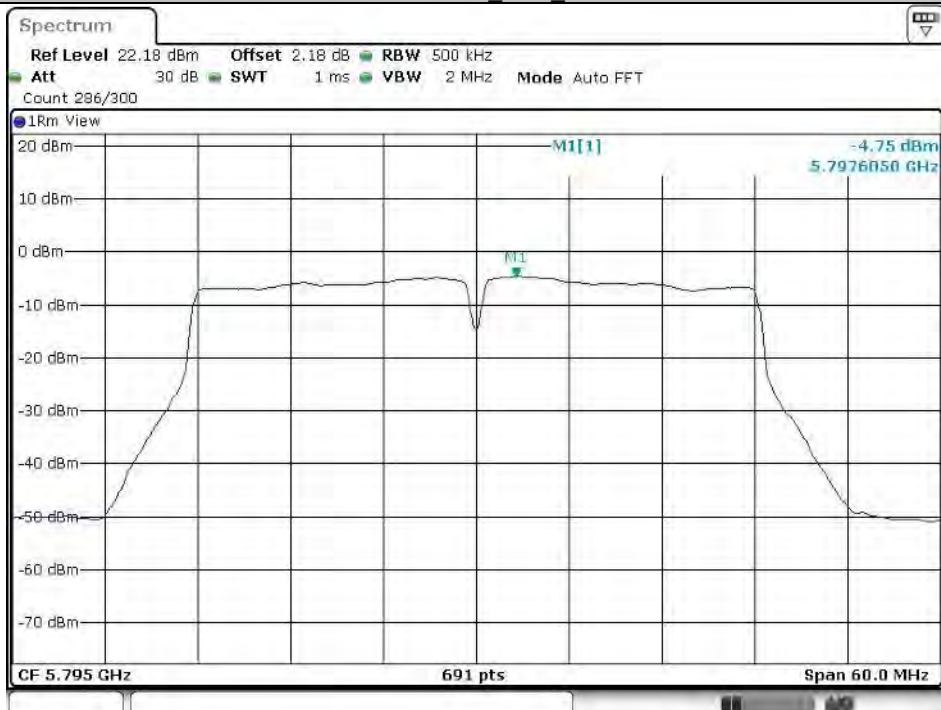


Date: 20.JAN.2021 20:46:15

11AC40MIMO_Ant2_5795

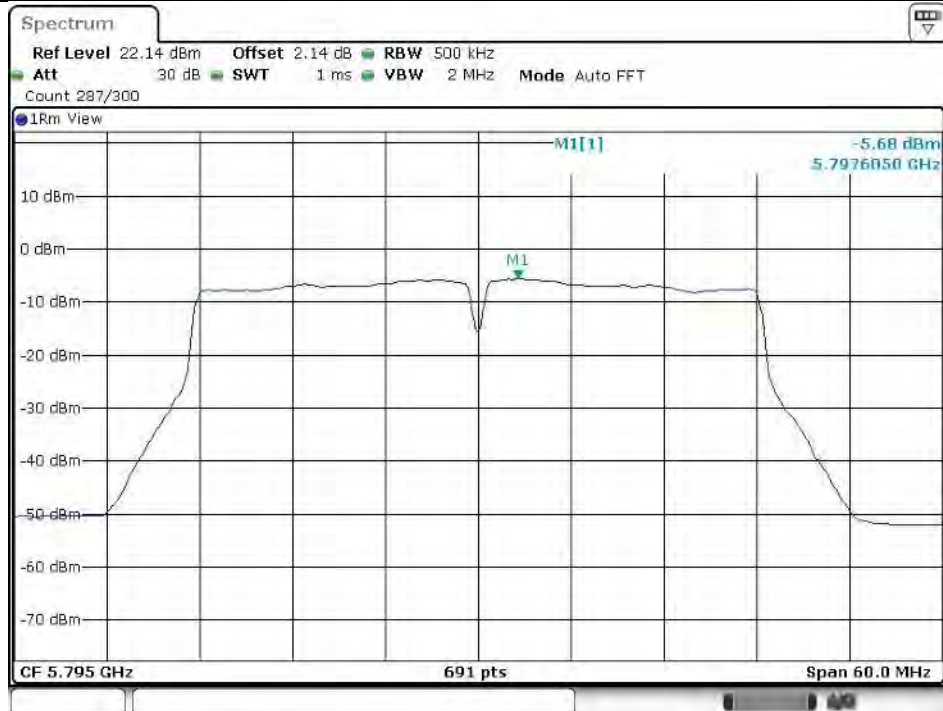


Date: 21.JAN.2021 09:38:45

11AC80MIMO_Ant1_5210

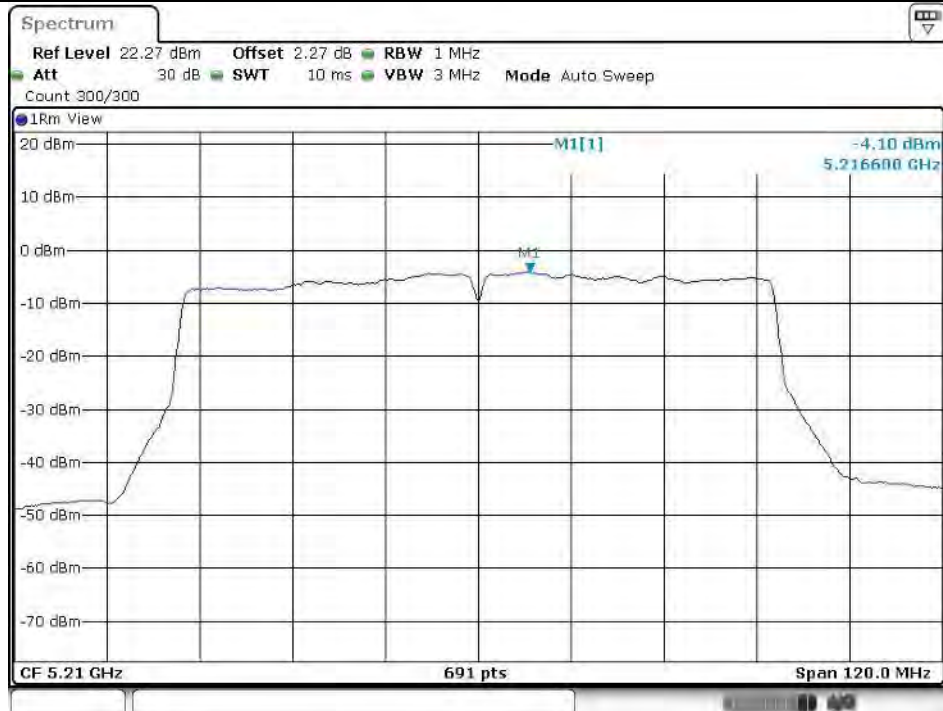


Date: 21.JAN.2021 09:43:09

11AC80MIMO_Ant2_5210

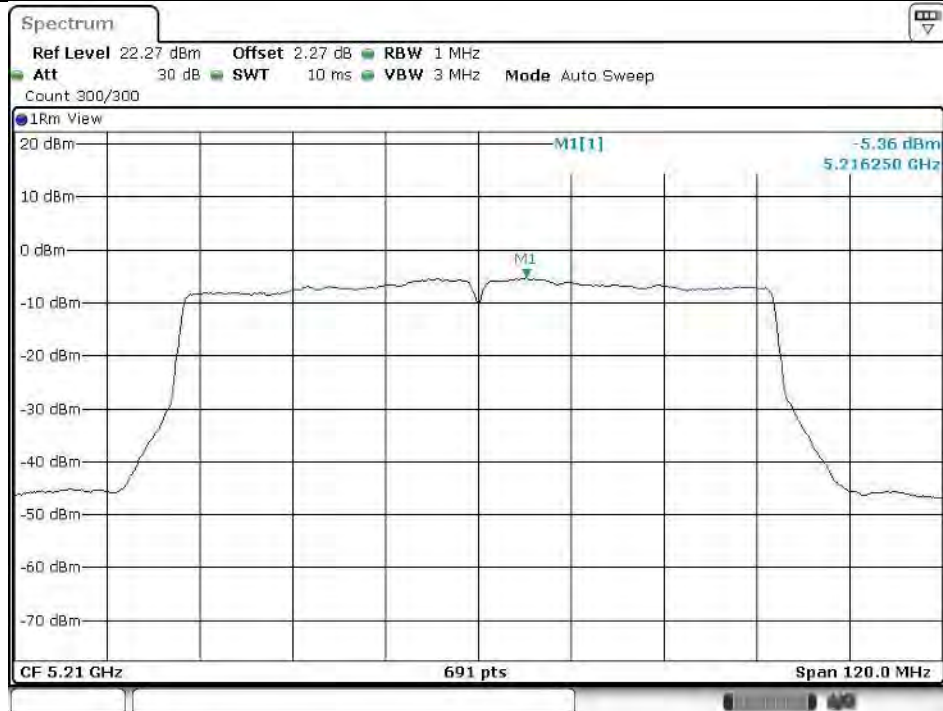


Date: 21.JAN.2021 09:49:56

11AC80MIMO_Ant1_5290

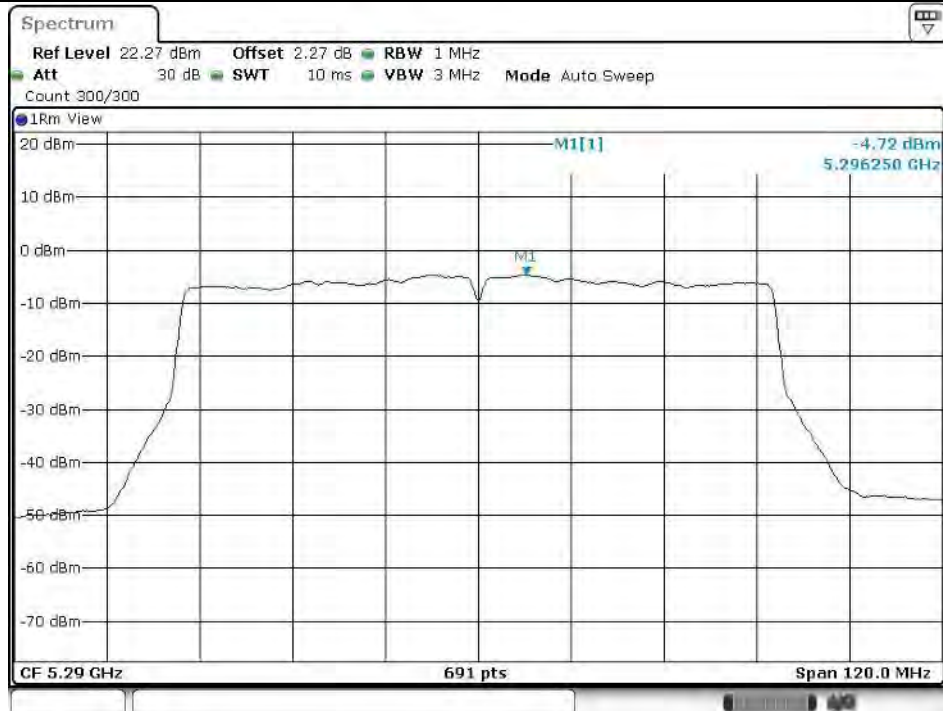


Date: 21.JAN.2021 09:44:15

11AC80MIMO_Ant2_5290

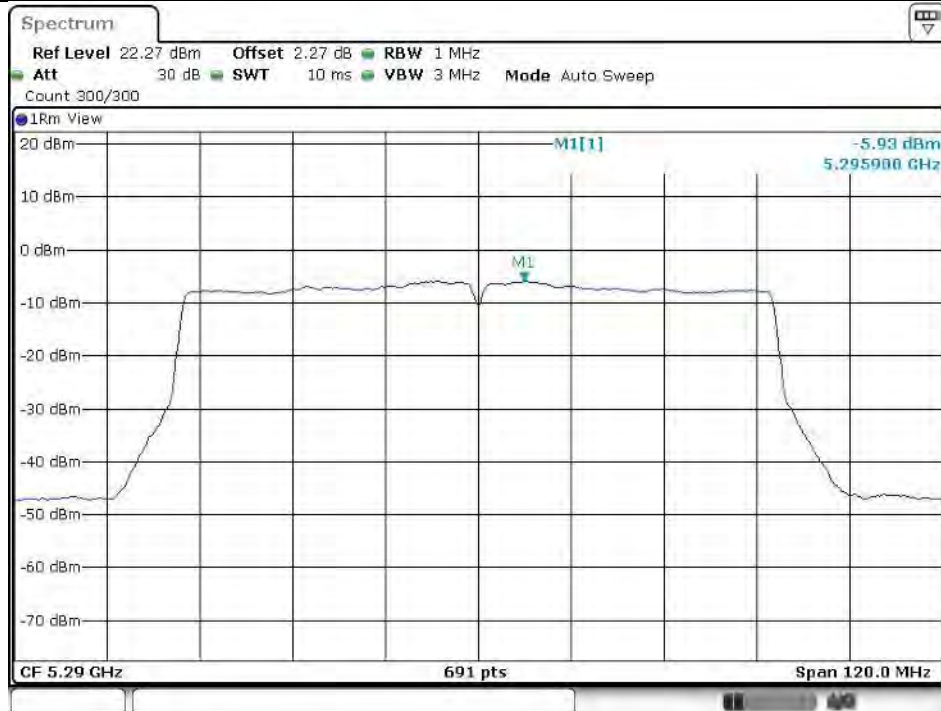


Date: 21.JAN.2021 09:50:27

11AC80MIMO_Ant1_5530

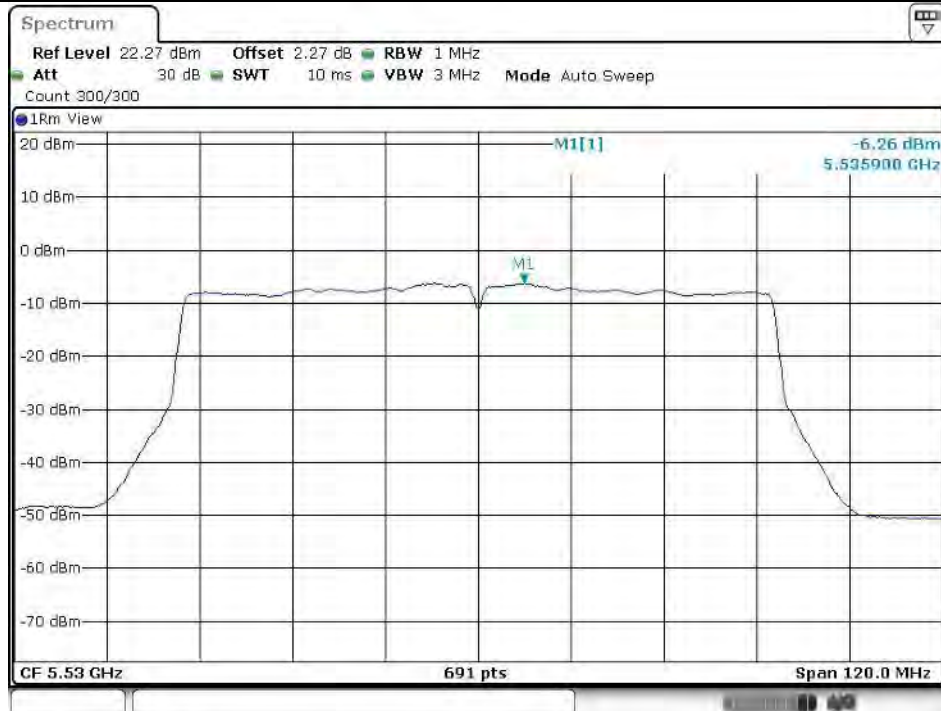


Date: 21.JAN.2021 09:44:49

11AC80MIMO_Ant2_5530

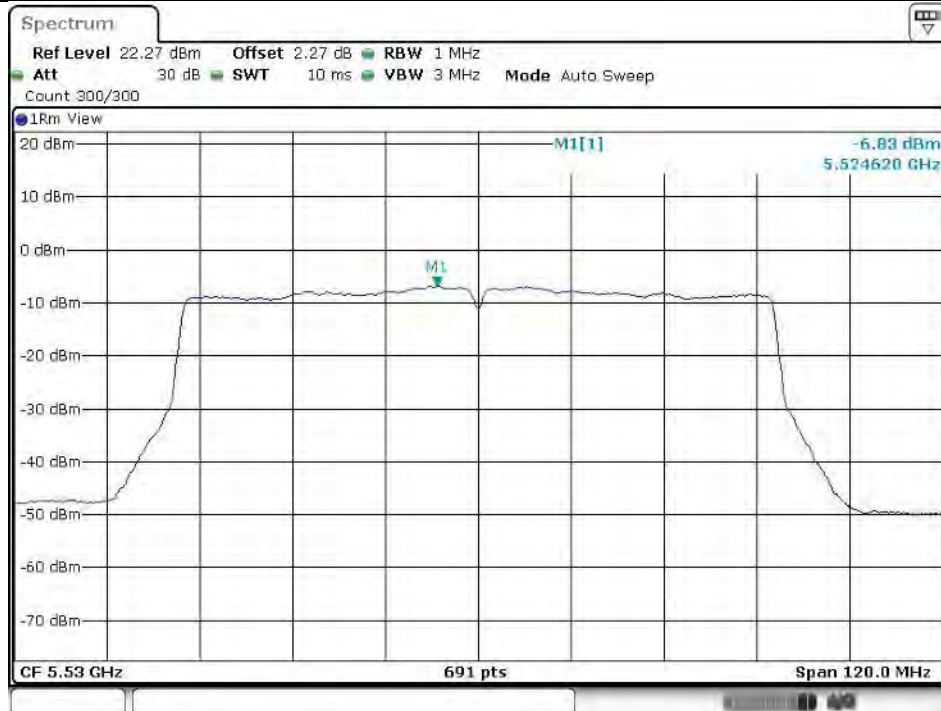


Date: 21.JAN.2021 09:51:00

11AC80MIMO_Ant1_5610

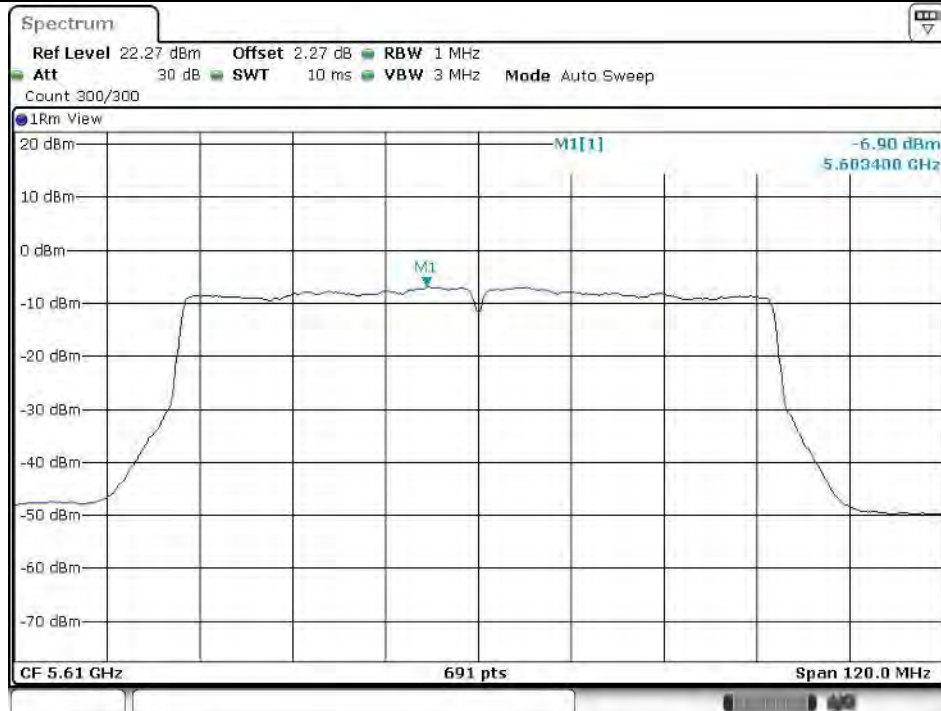


Date: 21.JAN.2021 09:45:21

11AC80MIMO_Ant2_5610

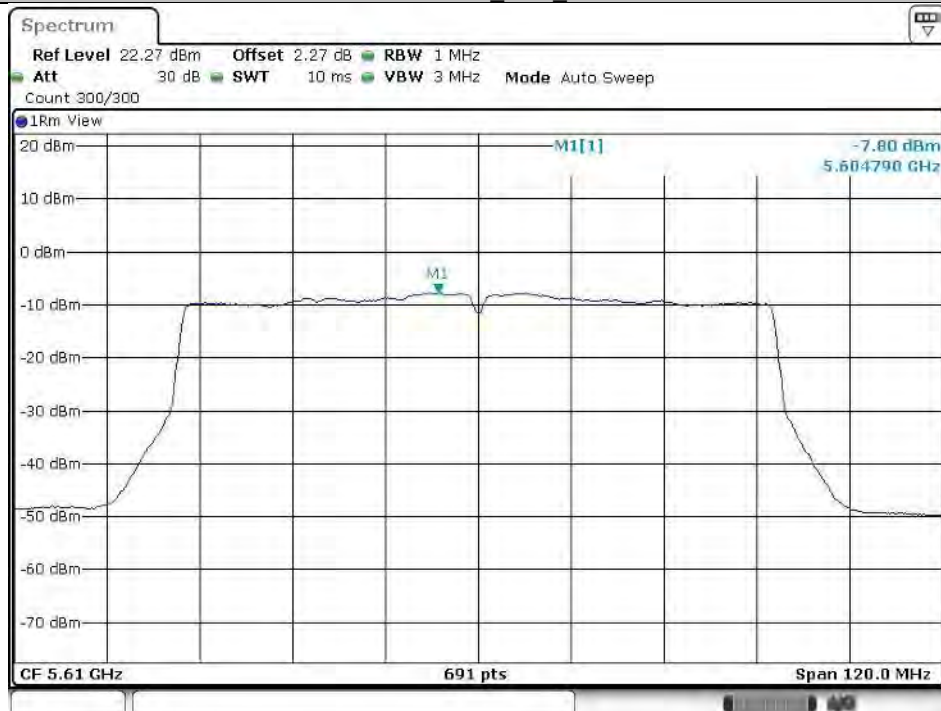


Date: 21.JAN.2021 09:51:31

11AC80MIMO_Ant1_5690

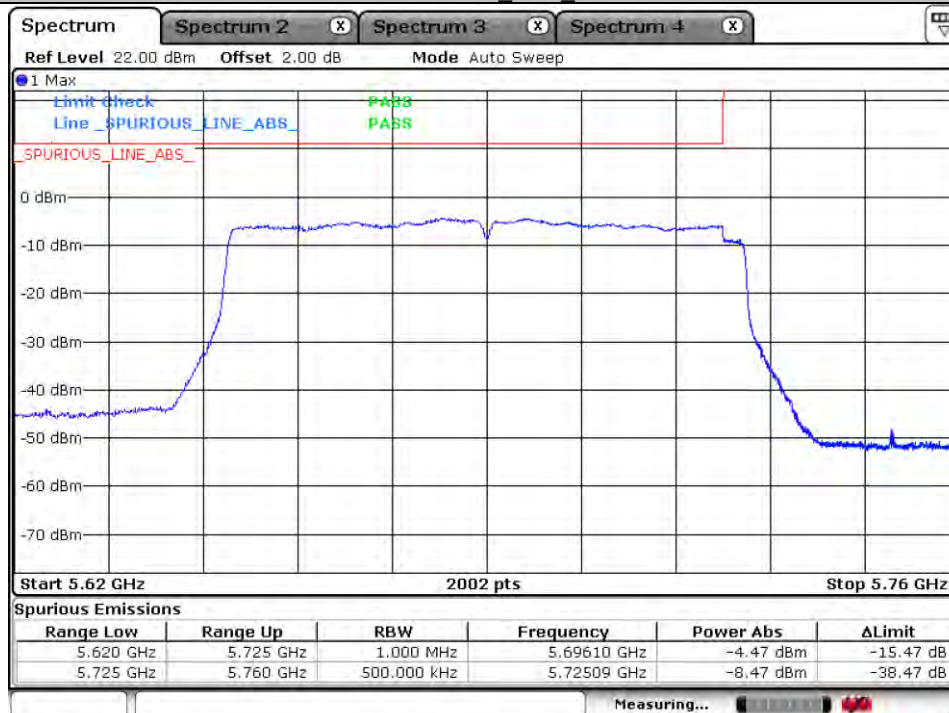


Date: 26 JAN 2021 14:28:09

11AC80MIMO_Ant2_5690

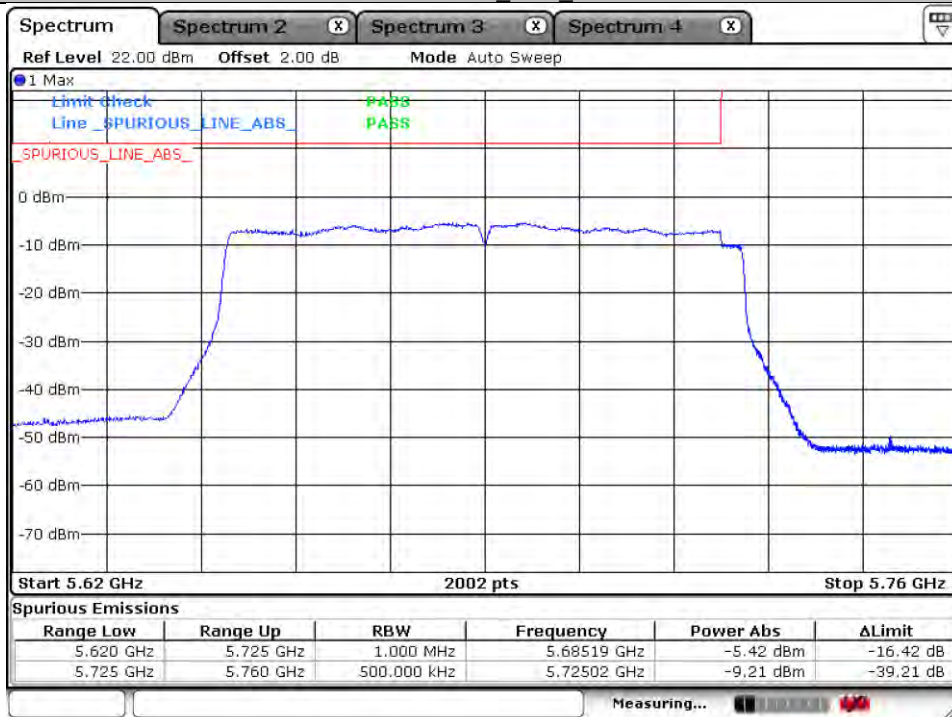


Date: 26 JAN 2021 14:29:29

11AC80MIMO_Ant1_5775

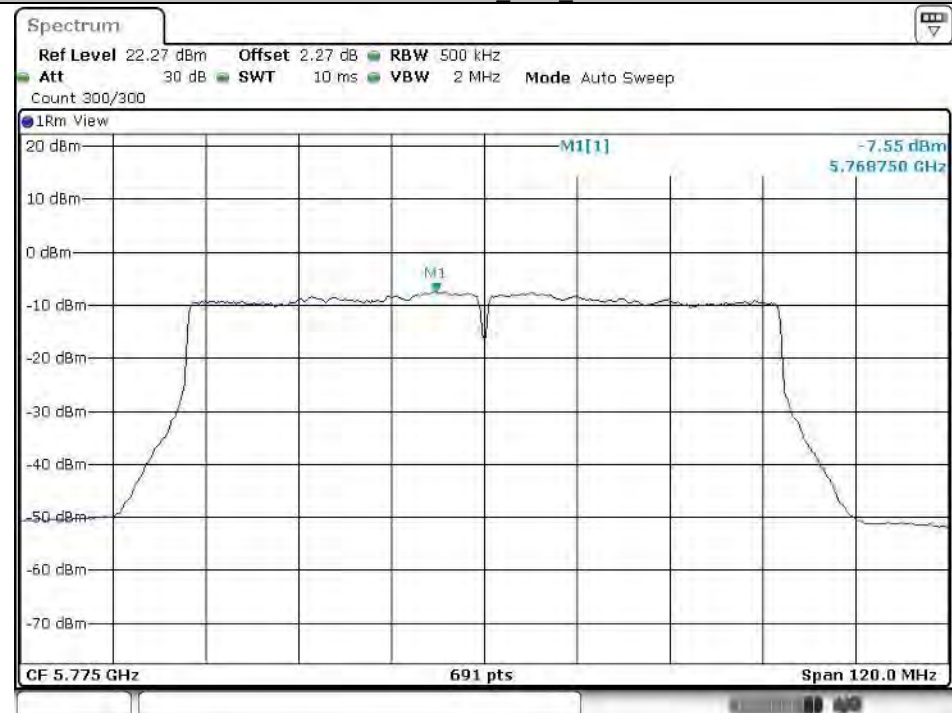

Date: 21 JAN 2021 09:45:52

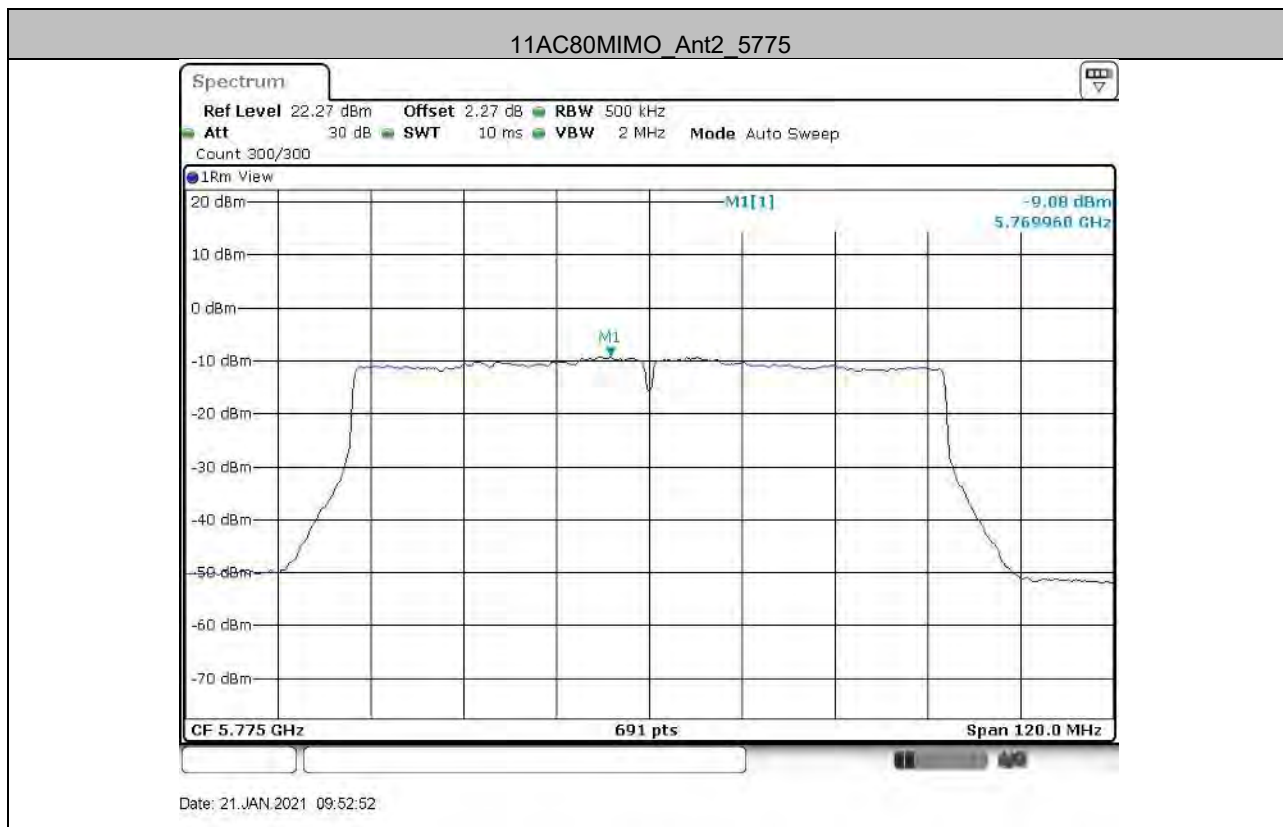

**Duty Cycle
Test Result**

TestMode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Limit	Verdict
11A	Ant1	5180	2.03	2.07	98.07	---	PASS
	Ant2	5180	2.04	2.07	98.55	---	PASS
	Ant1	5200	2.03	2.07	98.07	---	PASS
	Ant2	5200	2.03	2.07	98.07	---	PASS
	Ant1	5240	2.03	2.07	98.07	---	PASS
	Ant2	5240	2.03	2.07	98.07	---	PASS
	Ant1	5260	2.03	2.07	98.07	---	PASS
	Ant2	5260	2.04	2.07	98.55	---	PASS
	Ant1	5300	2.03	2.07	98.07	---	PASS
	Ant2	5300	2.03	2.07	98.07	---	PASS
	Ant1	5320	2.04	2.07	98.55	---	PASS
	Ant2	5320	2.03	2.07	98.07	---	PASS
	Ant1	5500	2.04	2.07	98.55	---	PASS
	Ant2	5500	2.03	2.07	98.07	---	PASS
	Ant1	5580	2.03	2.07	98.07	---	PASS
	Ant2	5580	2.04	2.07	98.55	---	PASS
	Ant1	5700	2.04	2.07	98.55	---	PASS
	Ant2	5700	2.04	2.07	98.55	---	PASS
	Ant1	5745	2.03	2.07	98.07	---	PASS
	Ant2	5745	2.04	2.07	98.55	---	PASS
	Ant1	5785	2.03	2.07	98.07	---	PASS
	Ant2	5785	2.03	2.07	98.07	---	PASS
	Ant1	5825	2.03	2.07	98.07	---	PASS
	Ant2	5825	2.04	2.07	98.55	---	PASS
11N20SISO	Ant1	5180	1.89	1.93	97.93	---	PASS
	Ant2	5180	1.90	1.93	98.45	---	PASS
	Ant1	5200	1.89	1.93	97.93	---	PASS



	Ant2	5200	1.90	1.93	98.45	---	PASS
	Ant1	5240	1.89	1.93	97.93	---	PASS
	Ant2	5240	1.90	1.93	98.45	---	PASS
	Ant1	5260	1.89	1.93	97.93	---	PASS
	Ant2	5260	1.90	1.93	98.45	---	PASS
	Ant1	5300	1.90	1.93	98.45	---	PASS
	Ant2	5300	1.90	1.93	98.45	---	PASS
	Ant1	5320	1.90	1.93	98.45	---	PASS
	Ant2	5320	1.90	1.93	98.45	---	PASS
	Ant1	5500	1.90	1.93	98.45	---	PASS
	Ant2	5500	1.90	1.93	98.45	---	PASS
	Ant1	5580	1.90	1.93	98.45	---	PASS
	Ant2	5580	1.90	1.93	98.45	---	PASS
	Ant1	5700	1.90	1.93	98.45	---	PASS
	Ant2	5700	1.90	1.93	98.45	---	PASS
	Ant1	5745	1.90	1.93	98.45	---	PASS
	Ant2	5745	1.90	1.93	98.45	---	PASS
	Ant1	5785	1.90	1.93	98.45	---	PASS
	Ant2	5785	1.90	1.93	98.45	---	PASS
	Ant1	5825	1.90	1.93	98.45	---	PASS
	Ant2	5825	1.90	1.93	98.45	---	PASS
11N40SISO	Ant1	5190	0.93	0.97	95.88	---	PASS
	Ant2	5190	0.93	0.97	95.88	---	PASS
	Ant1	5230	0.93	0.97	95.88	---	PASS
	Ant2	5230	0.93	0.97	95.88	---	PASS
	Ant1	5270	0.93	0.97	95.88	---	PASS
	Ant2	5270	0.93	0.97	95.88	---	PASS
	Ant1	5310	0.93	0.97	95.88	---	PASS
	Ant2	5310	0.93	0.97	95.88	---	PASS
	Ant1	5510	0.93	0.97	95.88	---	PASS
	Ant2	5510	0.93	0.97	95.88	---	PASS
	Ant1	5550	0.93	0.97	95.88	---	PASS
	Ant2	5550	0.93	0.97	95.88	---	PASS



	Ant1	5670	0.93	0.97	95.88	---	PASS
	Ant2	5670	0.93	0.97	95.88	---	PASS
	Ant1	5755	0.93	0.97	95.88	---	PASS
	Ant2	5755	0.93	0.97	95.88	---	PASS
	Ant1	5795	0.93	0.97	95.88	---	PASS
	Ant2	5795	0.93	0.97	95.88	---	PASS
11AC20SISO	Ant1	5180	1.91	1.95	97.95	---	PASS
	Ant2	5180	1.91	1.95	97.95	---	PASS
	Ant1	5200	1.91	1.95	97.95	---	PASS
	Ant2	5200	1.91	1.95	97.95	---	PASS
	Ant1	5240	1.91	1.95	97.95	---	PASS
	Ant2	5240	1.91	1.95	97.95	---	PASS
	Ant1	5260	1.91	1.94	98.45	---	PASS
	Ant2	5260	1.91	1.95	97.95	---	PASS
	Ant1	5300	1.91	1.95	97.95	---	PASS
	Ant2	5300	1.91	1.95	97.95	---	PASS
	Ant1	5320	1.91	1.95	97.95	---	PASS
	Ant2	5320	1.91	1.95	97.95	---	PASS
	Ant1	5500	1.91	1.95	97.95	---	PASS
	Ant2	5500	1.91	1.95	97.95	---	PASS
	Ant1	5580	1.91	1.95	97.95	---	PASS
	Ant2	5580	1.91	1.95	97.95	---	PASS
	Ant1	5700	1.91	1.94	98.45	---	PASS
	Ant2	5700	1.91	1.95	97.95	---	PASS
	Ant1	5745	1.91	1.95	97.95	---	PASS
	Ant2	5745	1.91	1.95	97.95	---	PASS
	Ant1	5785	1.91	1.95	97.95	---	PASS
	Ant2	5785	1.91	1.95	97.95	---	PASS
	Ant1	5825	1.91	1.95	97.95	---	PASS
	Ant2	5825	1.91	1.94	98.45	---	PASS
11AC40SISO	Ant1	5190	0.94	0.97	96.91	---	PASS
	Ant2	5190	0.94	0.98	95.92	---	PASS
	Ant1	5230	0.94	0.97	96.91	---	PASS

	Ant2	5230	0.94	0.97	96.91	---	PASS
	Ant1	5270	0.94	0.98	95.92	---	PASS
	Ant2	5270	0.94	0.97	96.91	---	PASS
	Ant1	5310	0.94	0.97	96.91	---	PASS
	Ant2	5310	0.94	0.97	96.91	---	PASS
	Ant1	5510	0.94	0.98	95.92	---	PASS
	Ant2	5510	0.94	0.97	96.91	---	PASS
	Ant1	5550	0.94	0.97	96.91	---	PASS
	Ant2	5550	0.94	0.97	96.91	---	PASS
	Ant1	5670	0.94	0.97	96.91	---	PASS
	Ant2	5670	0.94	0.98	95.92	---	PASS
	Ant1	5755	0.94	0.98	95.92	---	PASS
	Ant2	5755	0.94	0.97	96.91	---	PASS
	Ant1	5795	0.94	0.97	96.91	---	PASS
	Ant2	5795	0.94	0.97	96.91	---	PASS
11AC80SISO	Ant1	5210	0.46	0.49	93.88	---	PASS
	Ant2	5210	0.46	0.49	93.88	---	PASS
	Ant1	5290	0.46	0.49	93.88	---	PASS
	Ant2	5290	0.46	0.49	93.88	---	PASS
	Ant1	5530	0.46	0.49	93.88	---	PASS
	Ant2	5530	0.46	0.49	93.88	---	PASS
	Ant1	5610	0.46	0.49	93.88	---	PASS
	Ant2	5610	0.46	0.49	93.88	---	PASS
	Ant1	5775	0.46	0.49	93.88	---	PASS
	Ant2	5775	0.46	0.49	93.88	---	PASS
11A-CDD	Ant1	5180	2.03	2.07	98.07	---	PASS
	Ant2	5180	2.03	2.07	98.07	---	PASS
	Ant1	5200	2.03	2.07	98.07	---	PASS
	Ant2	5200	2.03	2.07	98.07	---	PASS
	Ant1	5240	2.03	2.07	98.07	---	PASS
	Ant2	5240	2.03	2.07	98.07	---	PASS
	Ant1	5260	2.03	2.07	98.07	---	PASS
	Ant2	5260	2.04	2.07	98.55	---	PASS

	Ant1	5300	2.03	2.07	98.07	---	PASS
	Ant2	5300	2.03	2.07	98.07	---	PASS
	Ant1	5320	2.03	2.07	98.07	---	PASS
	Ant2	5320	2.04	2.07	98.55	---	PASS
	Ant1	5500	2.04	2.07	98.55	---	PASS
	Ant2	5500	2.03	2.07	98.07	---	PASS
	Ant1	5580	2.04	2.07	98.55	---	PASS
	Ant2	5580	2.04	2.07	98.55	---	PASS
	Ant1	5700	2.04	2.07	98.55	---	PASS
	Ant2	5700	2.03	2.07	98.07	---	PASS
	Ant1	5745	2.03	2.07	98.07	---	PASS
	Ant2	5745	2.04	2.07	98.55	---	PASS
	Ant1	5785	2.04	2.07	98.55	---	PASS
	Ant2	5785	2.03	2.07	98.07	---	PASS
	Ant1	5825	2.03	2.07	98.07	---	PASS
	Ant2	5825	2.04	2.07	98.55	---	PASS
11N20MIMO	Ant1	5180	1.89	1.93	97.93	---	PASS
	Ant2	5180	1.89	1.93	97.93	---	PASS
	Ant1	5200	1.89	1.93	97.93	---	PASS
	Ant2	5200	1.90	1.93	98.45	---	PASS
	Ant1	5240	1.89	1.93	97.93	---	PASS
	Ant2	5240	1.90	1.93	98.45	---	PASS
	Ant1	5260	1.89	1.93	97.93	---	PASS
	Ant2	5260	1.90	1.93	98.45	---	PASS
	Ant1	5300	1.89	1.93	97.93	---	PASS
	Ant2	5300	1.90	1.93	98.45	---	PASS
	Ant1	5320	1.89	1.93	97.93	---	PASS
	Ant2	5320	1.90	1.93	98.45	---	PASS
	Ant1	5500	1.90	1.93	98.45	---	PASS
	Ant2	5500	1.90	1.93	98.45	---	PASS
	Ant1	5580	1.90	1.93	98.45	---	PASS
	Ant2	5580	1.90	1.93	98.45	---	PASS
	Ant1	5700	1.90	1.93	98.45	---	PASS

	Ant2	5700	1.90	1.93	98.45	---	PASS
	Ant1	5745	1.90	1.93	98.45	---	PASS
	Ant2	5745	1.90	1.93	98.45	---	PASS
	Ant1	5785	1.90	1.93	98.45	---	PASS
	Ant2	5785	1.90	1.93	98.45	---	PASS
	Ant1	5825	1.90	1.93	98.45	---	PASS
	Ant2	5825	1.90	1.93	98.45	---	PASS
11N40MIMO	Ant1	5190	0.93	0.97	95.88	---	PASS
	Ant2	5190	0.93	0.97	95.88	---	PASS
	Ant1	5230	0.93	0.97	95.88	---	PASS
	Ant2	5230	0.93	0.97	95.88	---	PASS
	Ant1	5270	0.93	0.97	95.88	---	PASS
	Ant2	5270	0.93	0.97	95.88	---	PASS
	Ant1	5310	0.93	0.97	95.88	---	PASS
	Ant2	5310	0.93	0.97	95.88	---	PASS
	Ant1	5510	0.93	0.97	95.88	---	PASS
	Ant2	5510	0.93	0.97	95.88	---	PASS
	Ant1	5550	0.93	0.97	95.88	---	PASS
	Ant2	5550	0.93	0.97	95.88	---	PASS
	Ant1	5670	0.93	0.97	95.88	---	PASS
	Ant2	5670	0.93	0.97	95.88	---	PASS
	Ant1	5755	0.93	0.97	95.88	---	PASS
	Ant2	5755	0.93	0.97	95.88	---	PASS
	Ant1	5795	0.93	0.97	95.88	---	PASS
	Ant2	5795	0.93	0.97	95.88	---	PASS
11AC20MIMO	Ant1	5180	1.91	1.95	97.95	---	PASS
	Ant2	5180	1.91	1.95	97.95	---	PASS
	Ant1	5200	1.91	1.95	97.95	---	PASS
	Ant2	5200	1.91	1.94	98.45	---	PASS
	Ant1	5240	1.91	1.95	97.95	---	PASS
	Ant2	5240	1.91	1.95	97.95	---	PASS
	Ant1	5260	1.91	1.95	97.95	---	PASS
	Ant2	5260	1.91	1.95	97.95	---	PASS



	Ant1	5300	1.91	1.95	97.95	---	PASS
	Ant2	5300	1.91	1.94	98.45	---	PASS
	Ant1	5320	1.91	1.95	97.95	---	PASS
	Ant2	5320	1.91	1.95	97.95	---	PASS
	Ant1	5500	1.91	1.95	97.95	---	PASS
	Ant2	5500	1.91	1.95	97.95	---	PASS
	Ant1	5580	1.91	1.95	97.95	---	PASS
	Ant2	5580	1.91	1.95	97.95	---	PASS
	Ant1	5700	1.91	1.95	97.95	---	PASS
	Ant2	5700	1.91	1.95	97.95	---	PASS
	Ant1	5745	1.91	1.94	98.45	---	PASS
	Ant2	5745	1.91	1.95	97.95	---	PASS
	Ant1	5785	1.91	1.95	97.95	---	PASS
	Ant2	5785	1.91	1.95	97.95	---	PASS
	Ant1	5825	1.91	1.95	97.95	---	PASS
	Ant2	5825	1.91	1.95	97.95	---	PASS
11AC40MIMO	Ant1	5190	0.94	0.97	96.91	---	PASS
	Ant2	5190	0.94	0.97	96.91	---	PASS
	Ant1	5230	0.94	0.97	96.91	---	PASS
	Ant2	5230	0.94	0.97	96.91	---	PASS
	Ant1	5270	0.94	0.97	96.91	---	PASS
	Ant2	5270	0.94	0.97	96.91	---	PASS
	Ant1	5310	0.94	0.97	96.91	---	PASS
	Ant2	5310	0.94	0.97	96.91	---	PASS
	Ant1	5510	0.94	0.97	96.91	---	PASS
	Ant2	5510	0.94	0.97	96.91	---	PASS
	Ant1	5550	0.94	0.98	95.92	---	PASS
	Ant2	5550	0.94	0.97	96.91	---	PASS
	Ant1	5670	0.94	0.97	96.91	---	PASS
	Ant2	5670	0.94	0.97	96.91	---	PASS
	Ant1	5755	0.94	0.97	96.91	---	PASS
	Ant2	5755	0.94	0.98	95.92	---	PASS
	Ant1	5795	0.94	0.98	95.92	---	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN_Doccheck@sgs.com
 No.1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com




	Ant2	5795	0.94	0.97	96.91	---	PASS
11AC80MIMO	Ant1	5210	0.46	0.49	93.88	---	PASS
	Ant2	5210	0.46	0.49	93.88	---	PASS
	Ant1	5290	0.46	0.49	93.88	---	PASS
	Ant2	5290	0.46	0.49	93.88	---	PASS
	Ant1	5530	0.46	0.49	93.88	---	PASS
	Ant2	5530	0.46	0.49	93.88	---	PASS
	Ant1	5610	0.46	0.49	93.88	---	PASS
	Ant2	5610	0.46	0.49	93.88	---	PASS
	Ant1	5775	0.46	0.49	93.88	---	PASS
	Ant2	5775	0.46	0.49	93.88	---	PASS




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com
No.1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.ssgroup.com.cn
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

Test Graphs

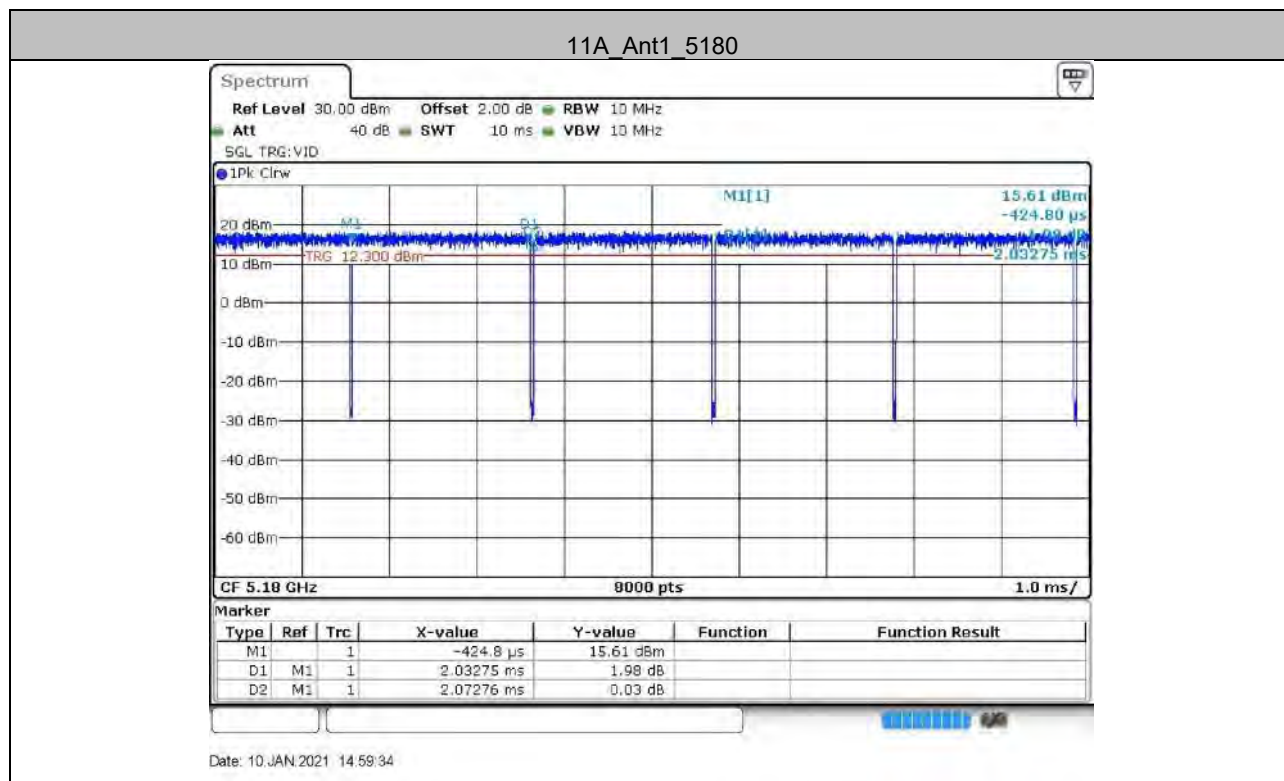


11A_Ant2_5180

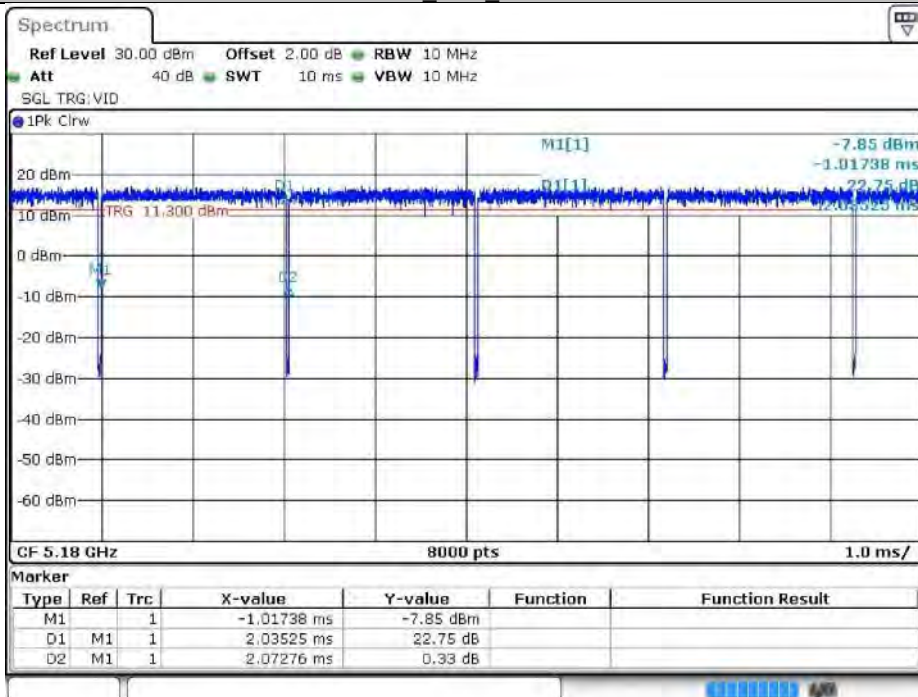


Date: 10.JAN.2021 16:54:41

11A_Ant1_5200

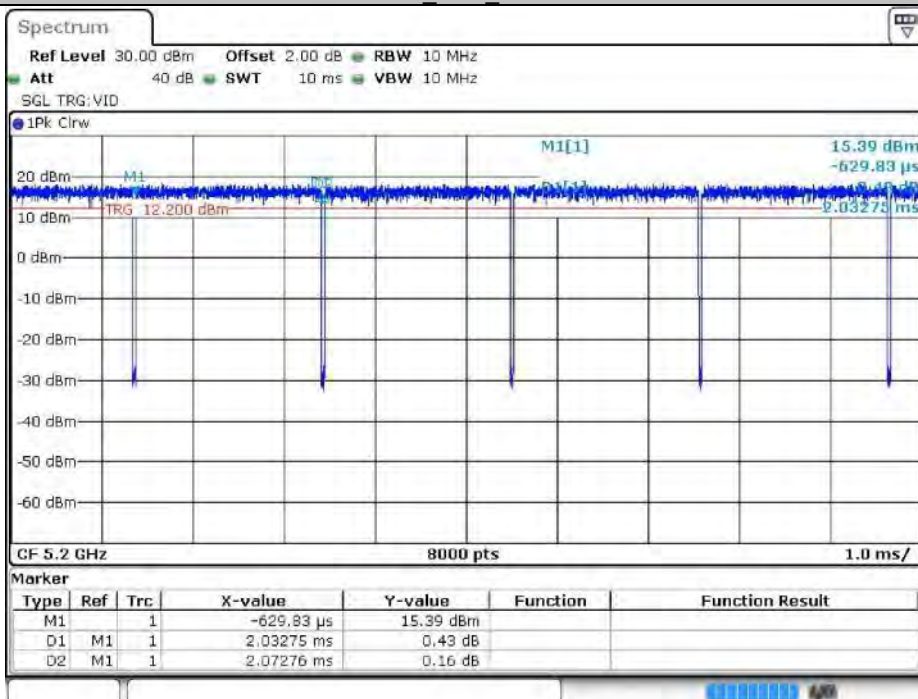


Date: 10.JAN.2021 15:00:46

11A_Ant2_5200

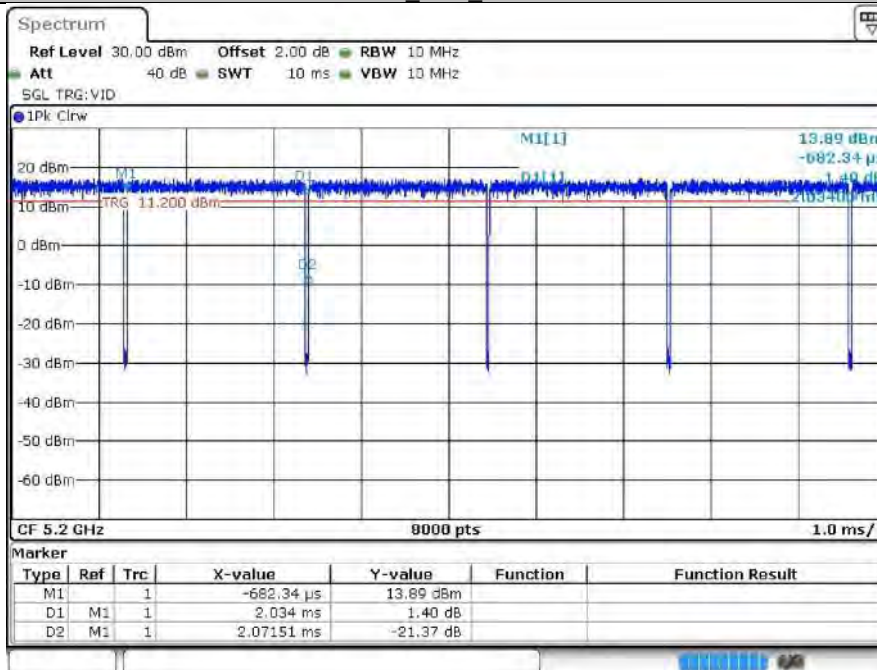


Date: 10 JAN 2021 16:56:11

11A_Ant1_5240

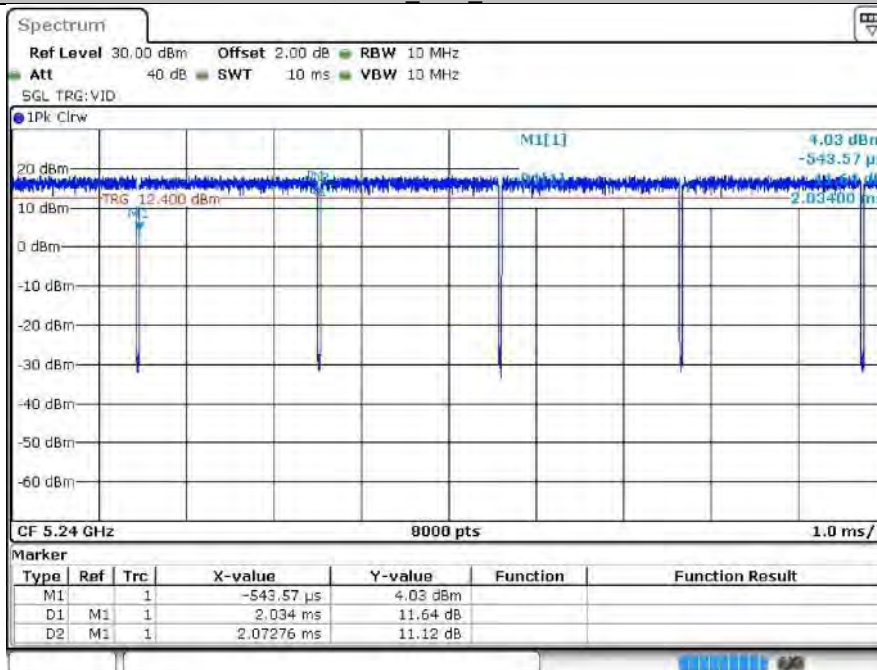


Date: 10 JAN 2021 15:01:56

11A_Ant2_5240

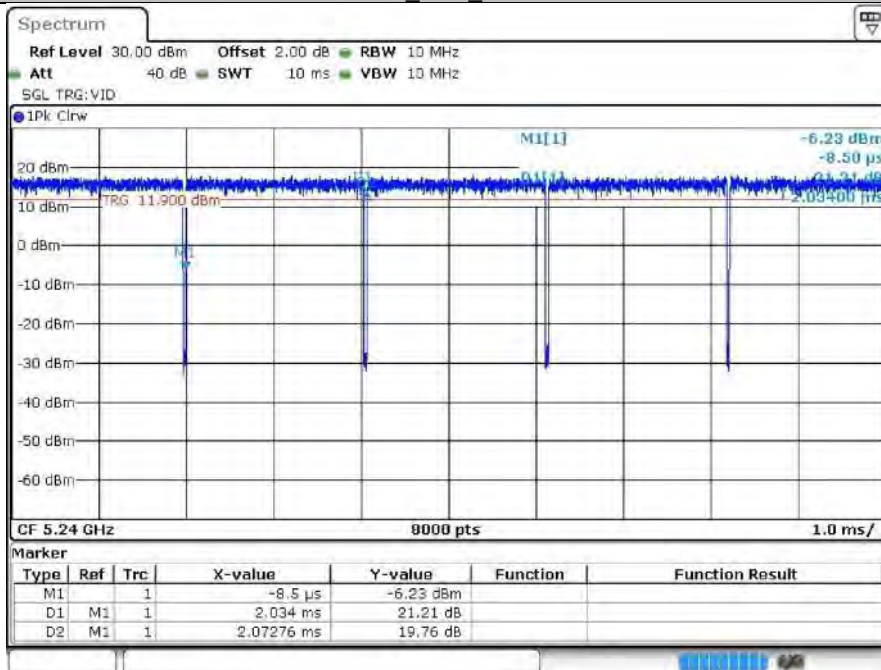


Date: 10 JAN 2021 16:57:17

11A_Ant1_5260

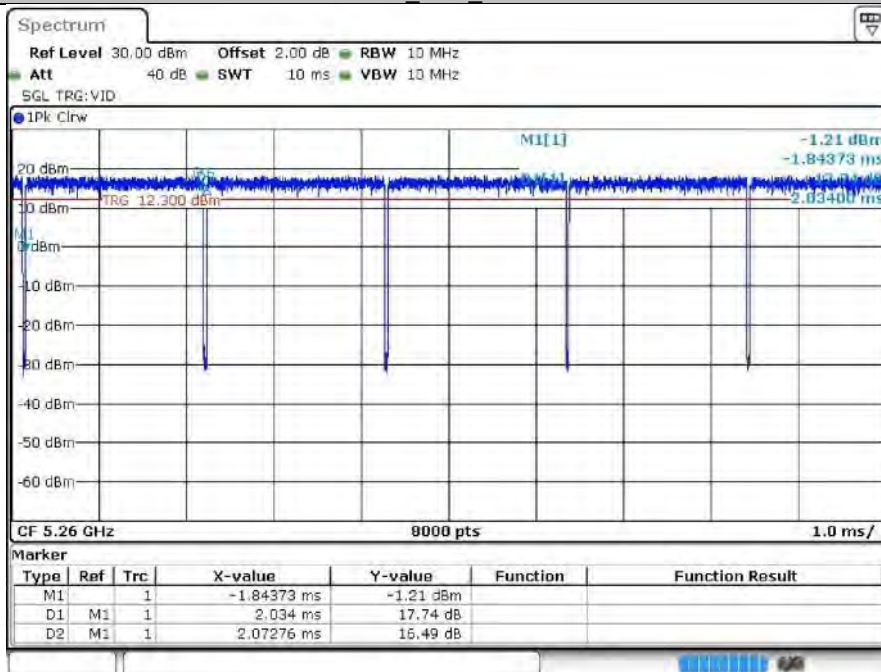


Date: 10 JAN 2021 15:03:04


11A_Ant2_5260

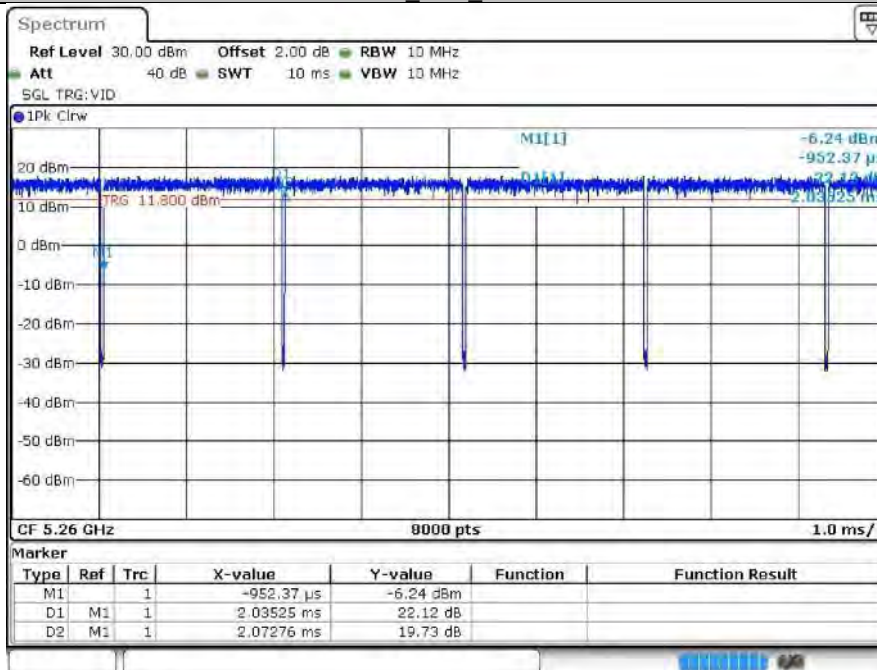

11A_Ant1_5300

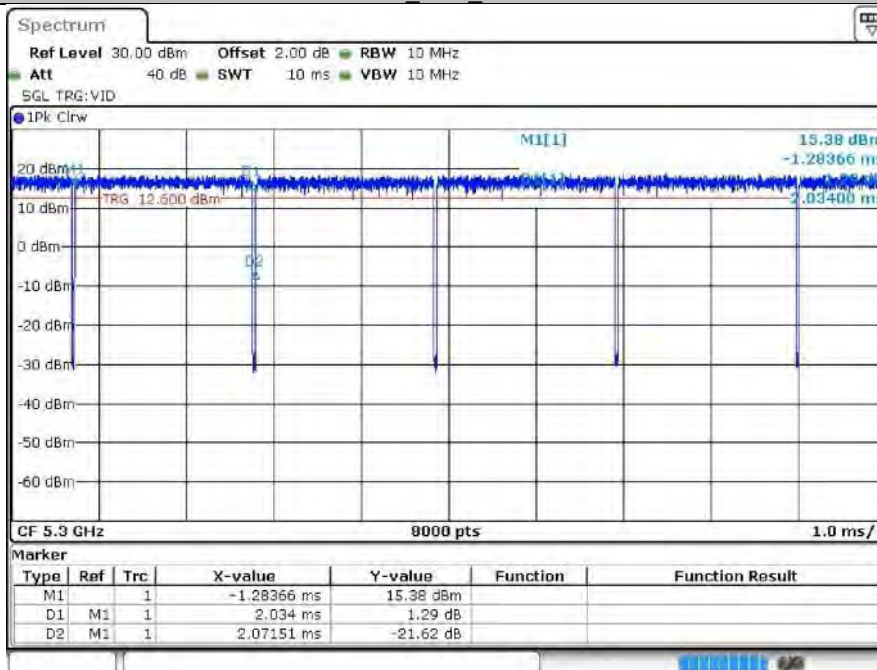


11A_Ant2_5300

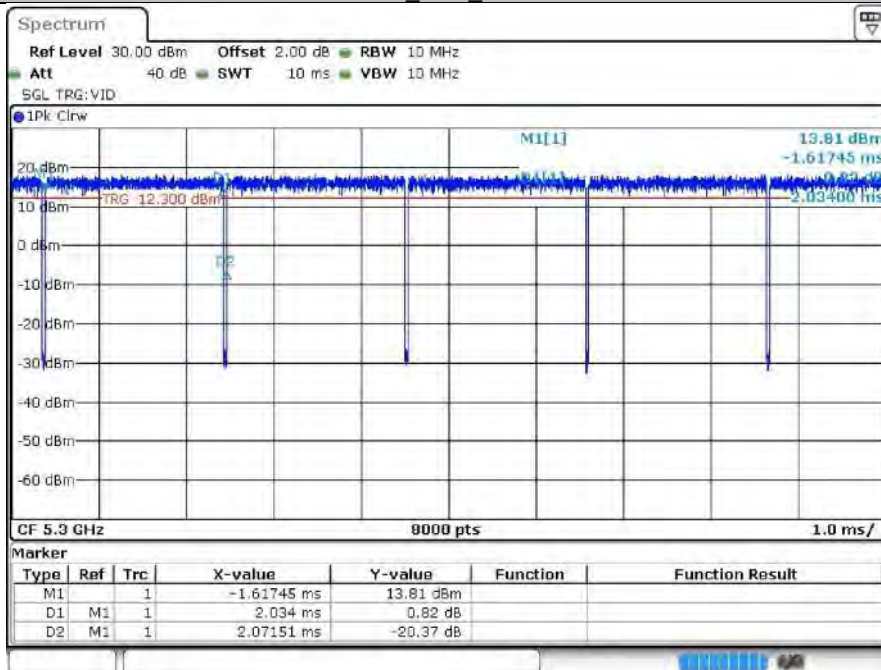


Date: 10 JAN 2021 17:00:45

11A_Ant1_5320

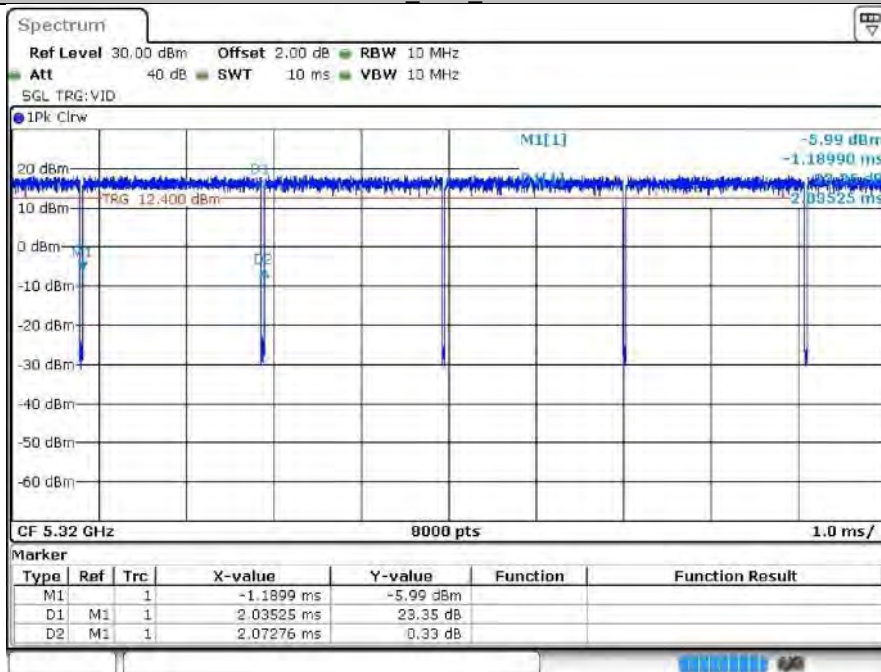


Date: 10 JAN 2021 15:05:21

11A_Ant2_5320

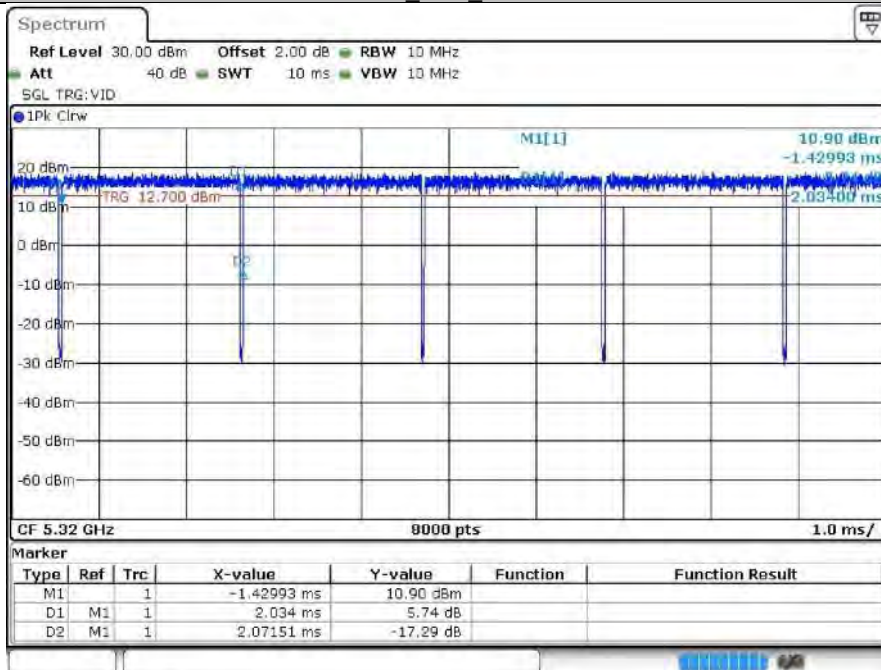


Date: 10 JAN 2021 17:01:50

11A_Ant1_5500

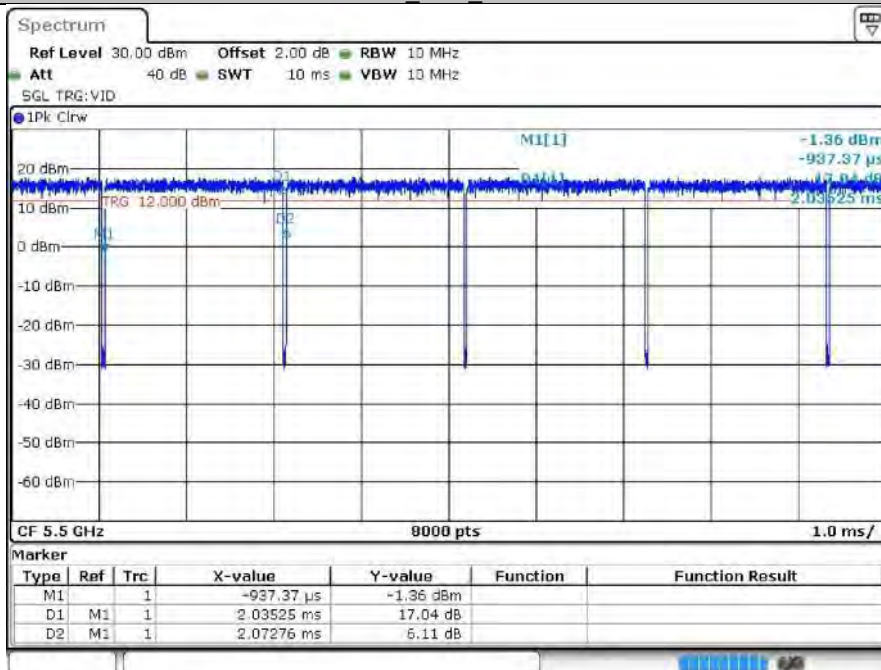


Date: 10 JAN 2021 15:06:27

11A_Ant2_5500

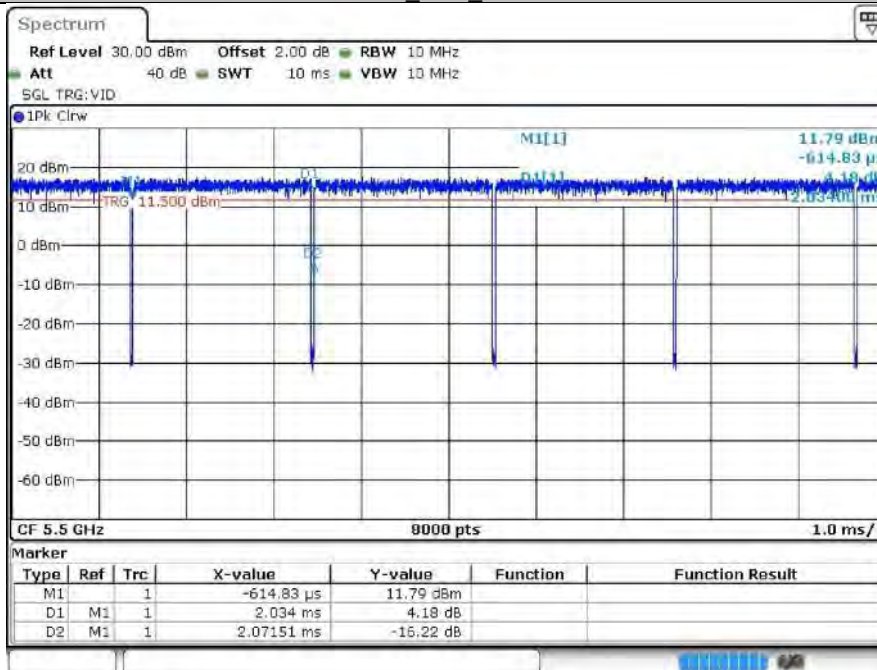


Date: 10 JAN 2021 17:03:15

11A_Ant1_5580

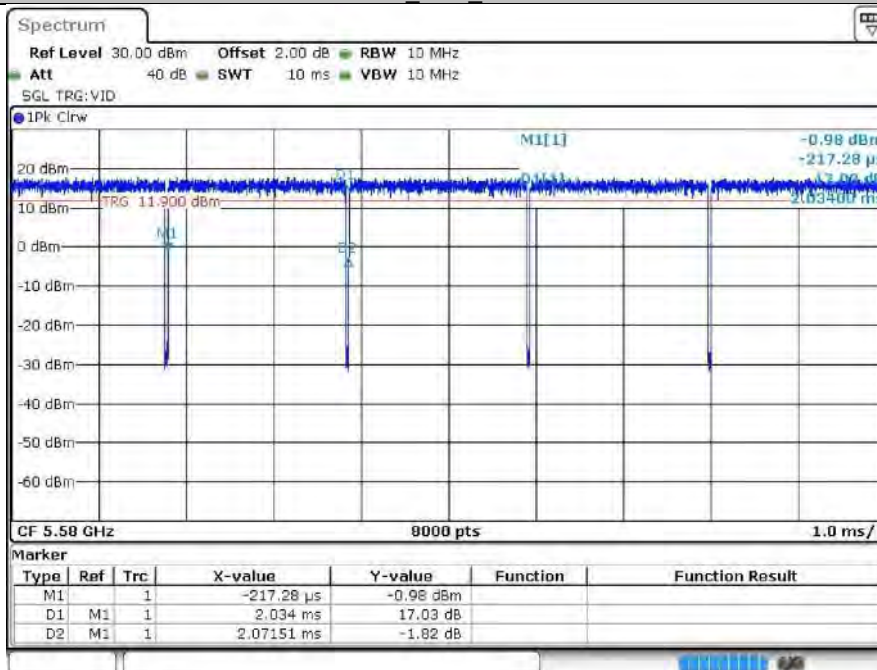


Date: 10 JAN 2021 15:07:40


11A_Ant2_5580

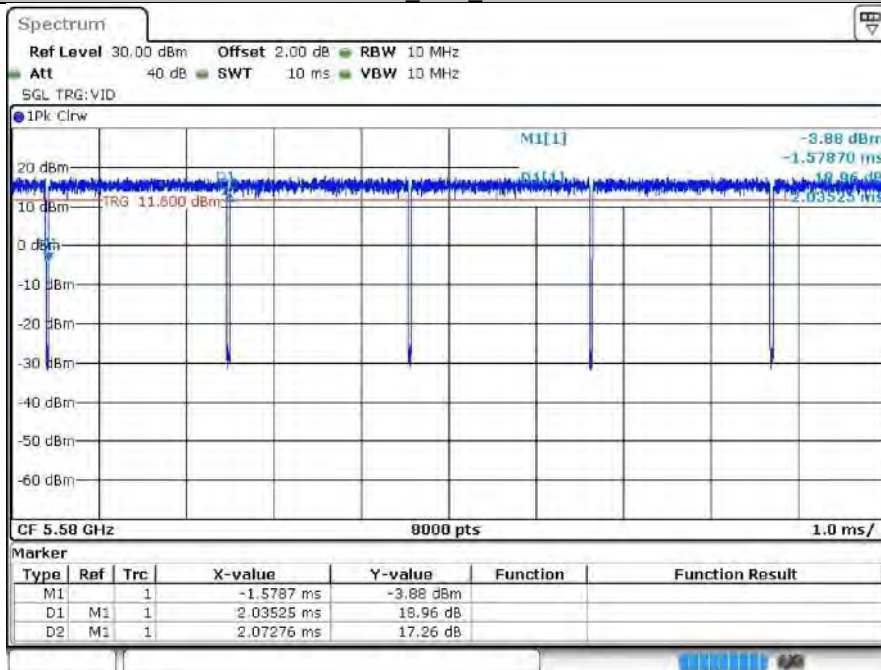


11A_Ant1_5700

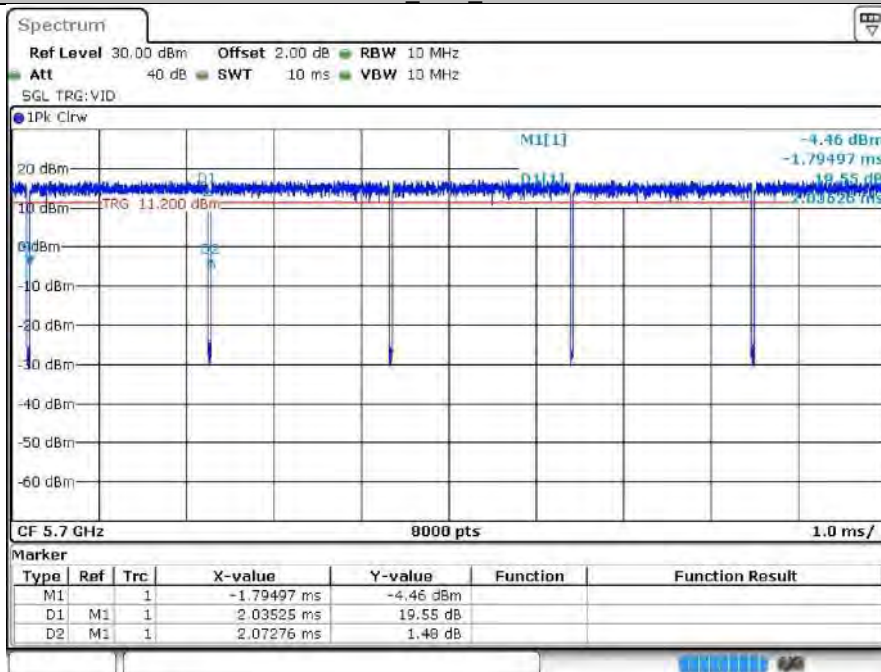


11A_Ant2_5700

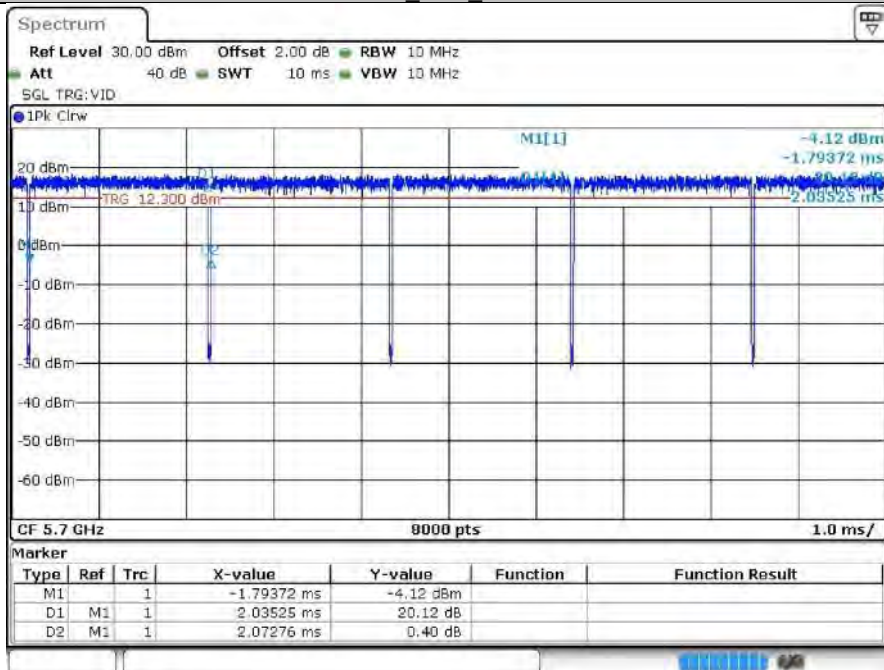


11A_Ant1_5745

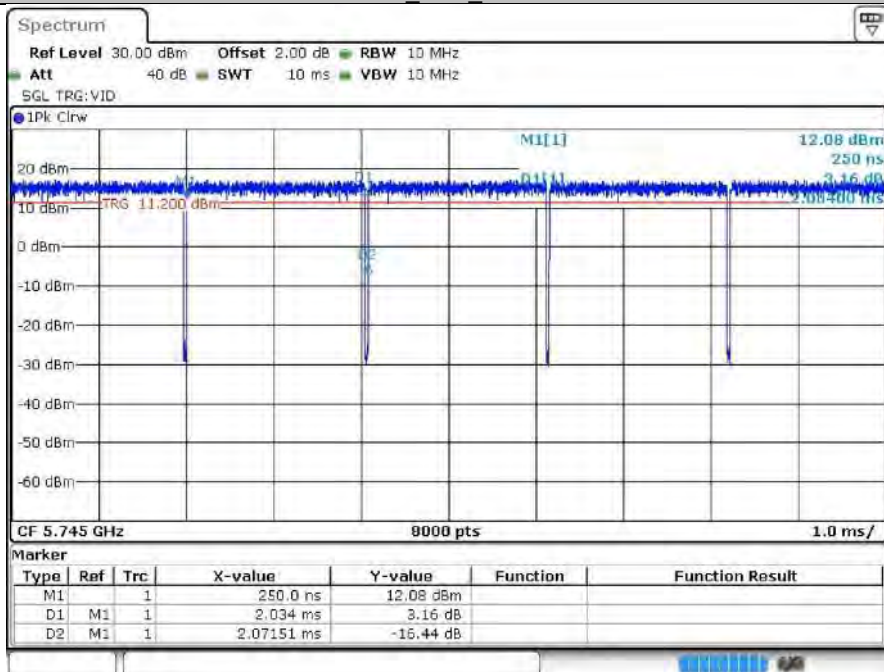


11A_Ant2_5745

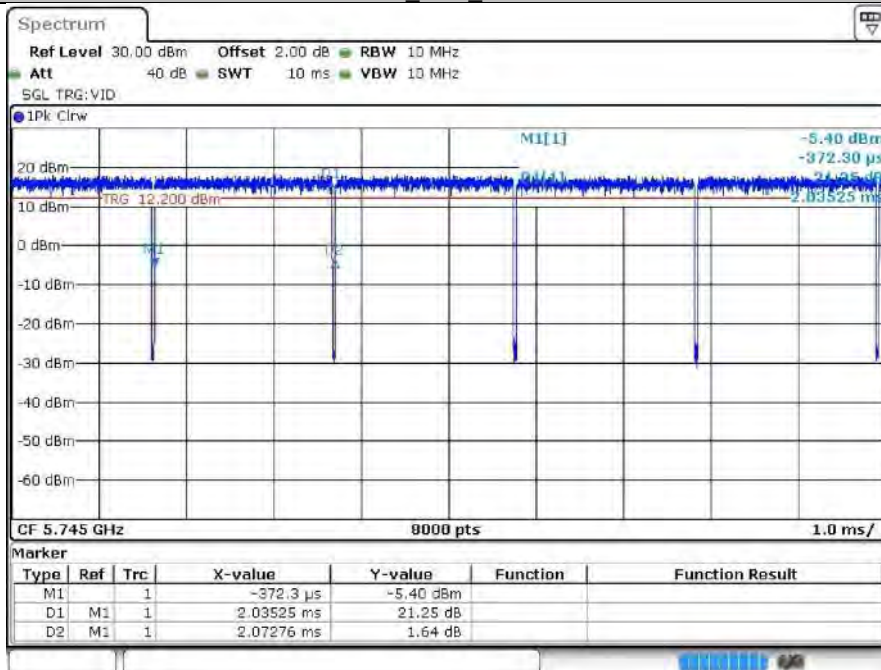

11A_Ant1_5785

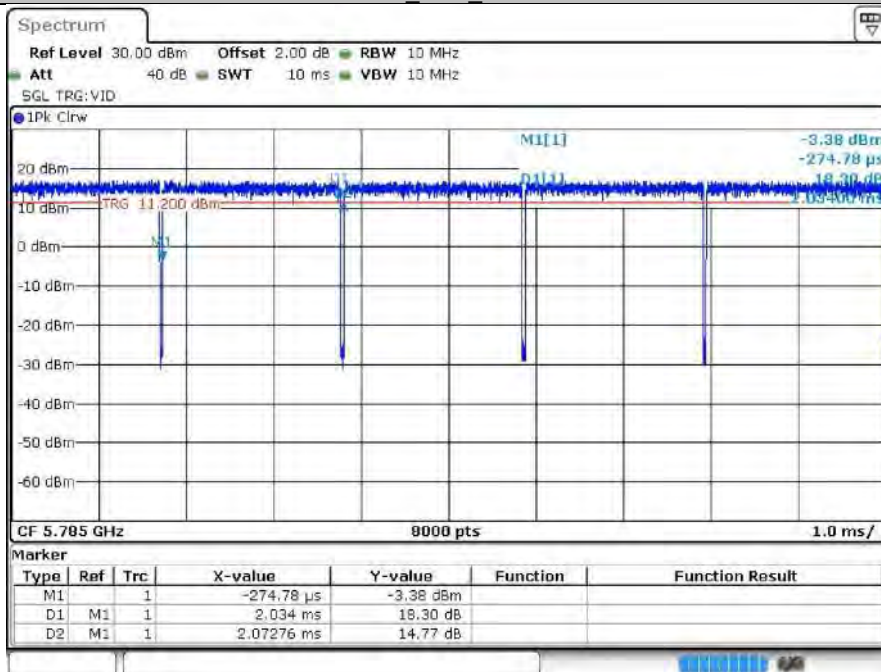


11A_Ant2_5785

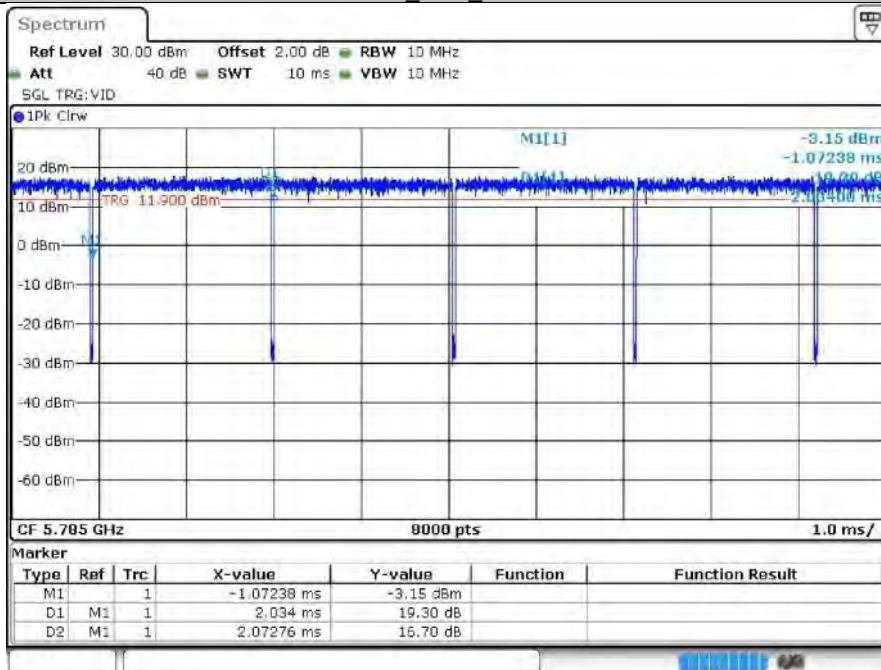


Date: 10 JAN 2021 17:07:54

11A_Ant1_5825

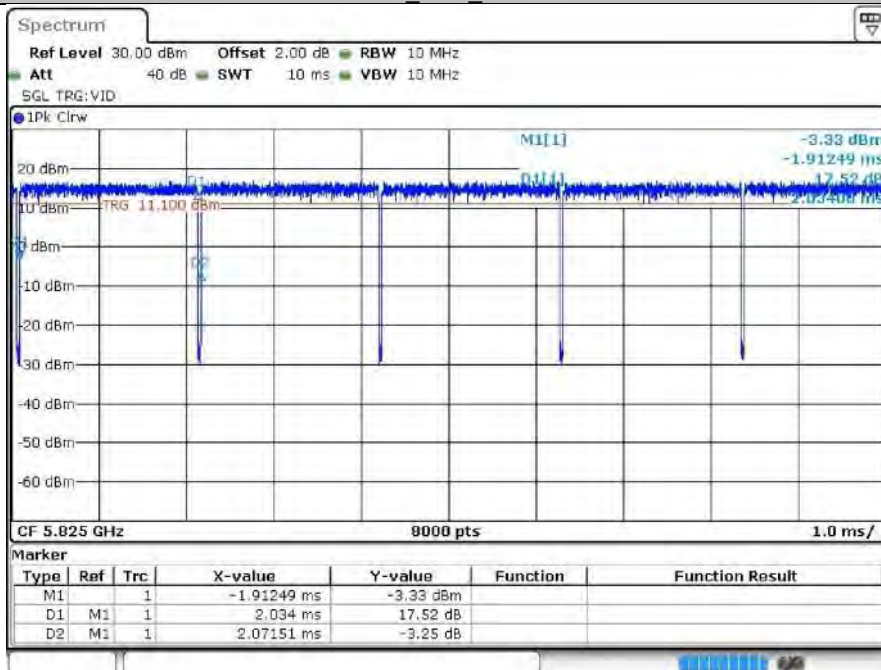


Date: 10 JAN 2021 15:13:18

11A_Ant2_5825

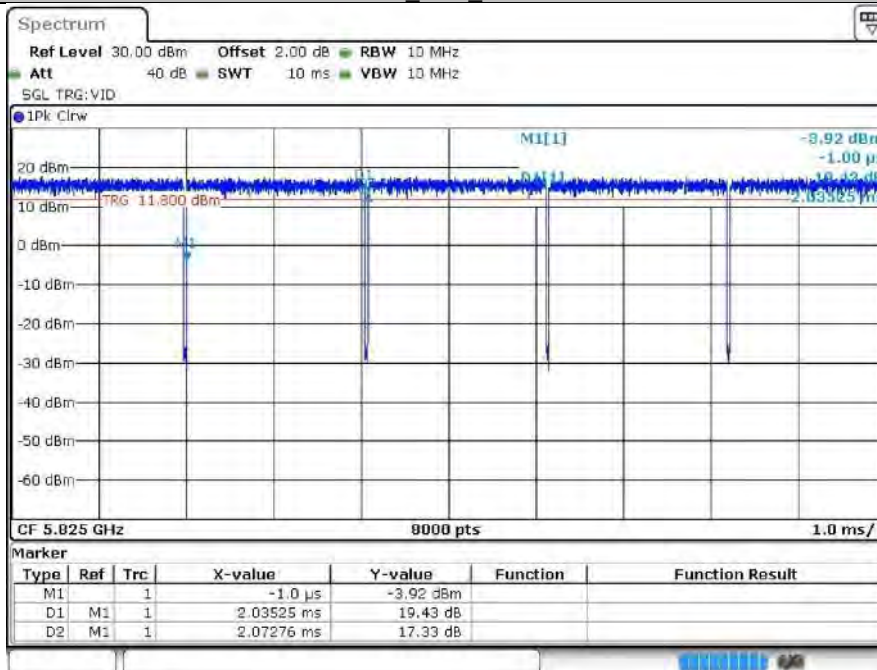


Date: 10 JAN 2021 17:09:10

11N20SISO_Ant1_5180

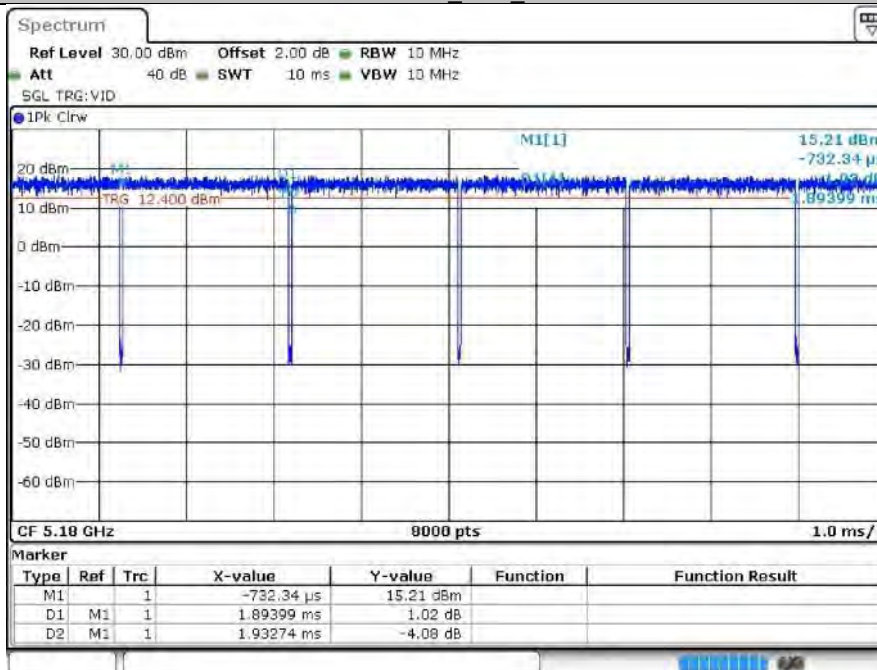


Date: 10 JAN 2021 15:14:30

11N20SISO_Ant2_5180

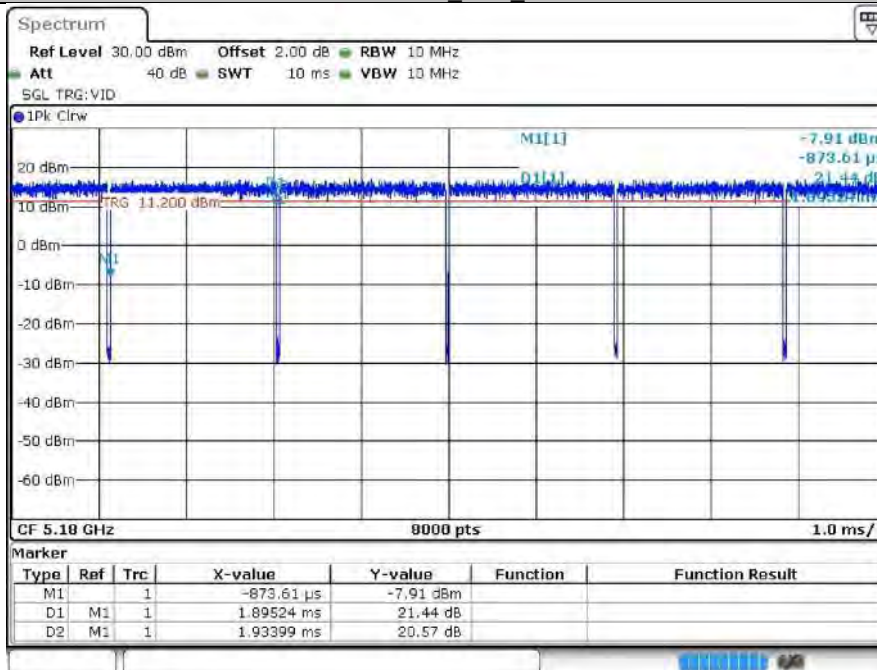


Date: 10 JAN 2021 17:10:26

11N20SISO_Ant1_5200

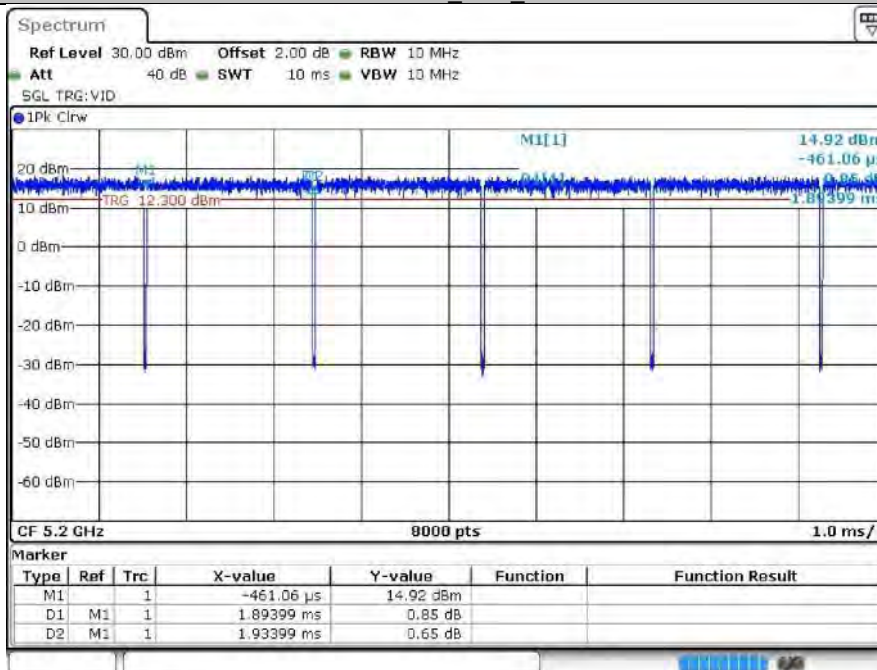


Date: 10 JAN 2021 15:18:43

11N20SISO_Ant2_5200

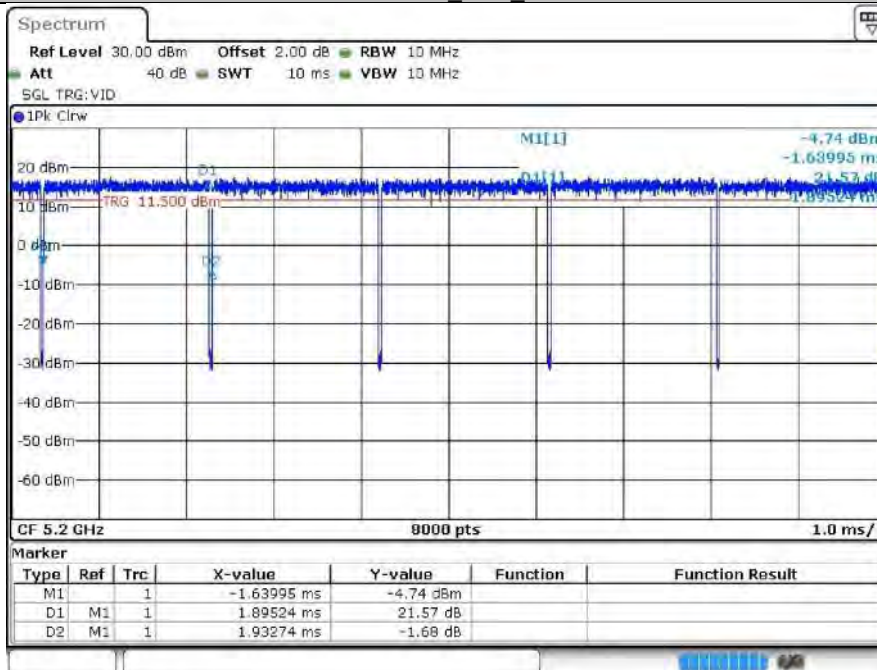


Date: 10 JAN 2021 17:11:52

11N20SISO_Ant1_5240

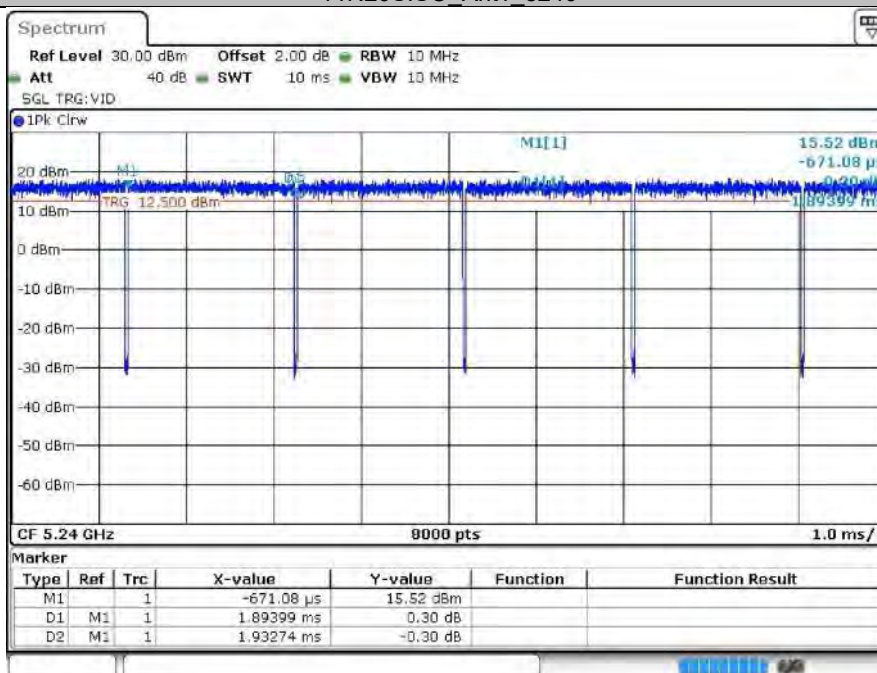


Date: 10 JAN 2021 15:19:50


11N20SISO_Ant2_5240

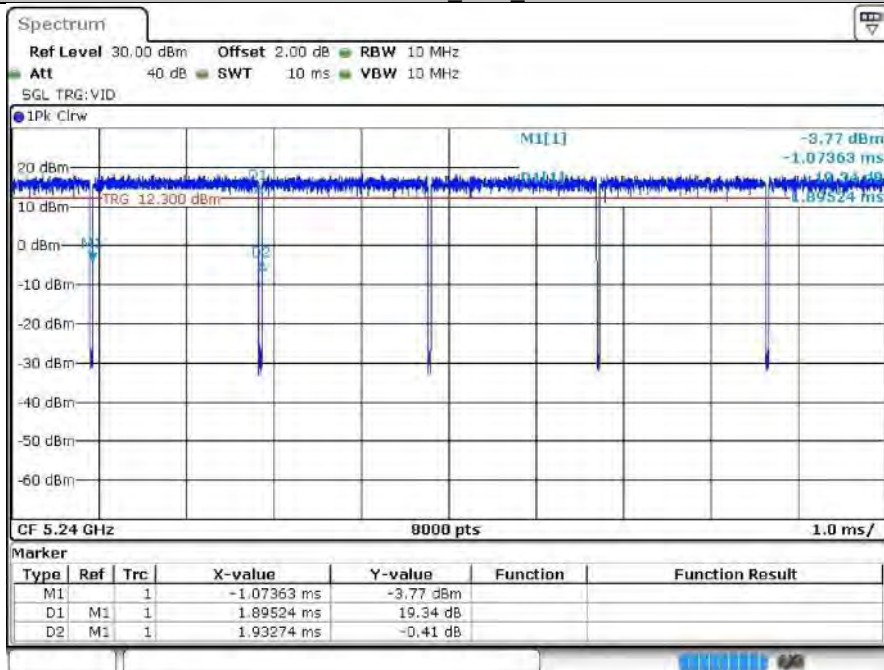


11N20SISO_Ant1_5260

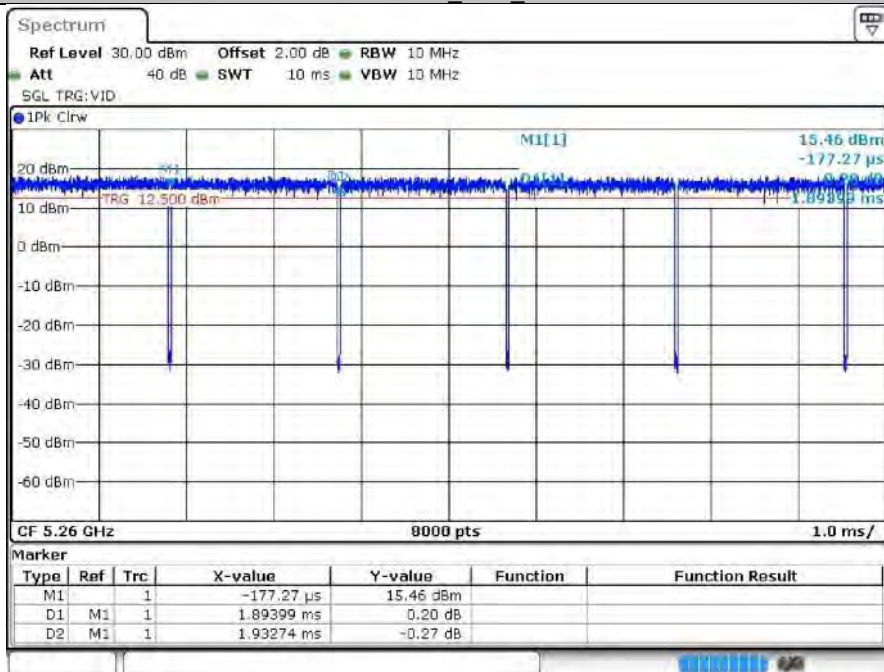


11N20SISO_Ant2_5260

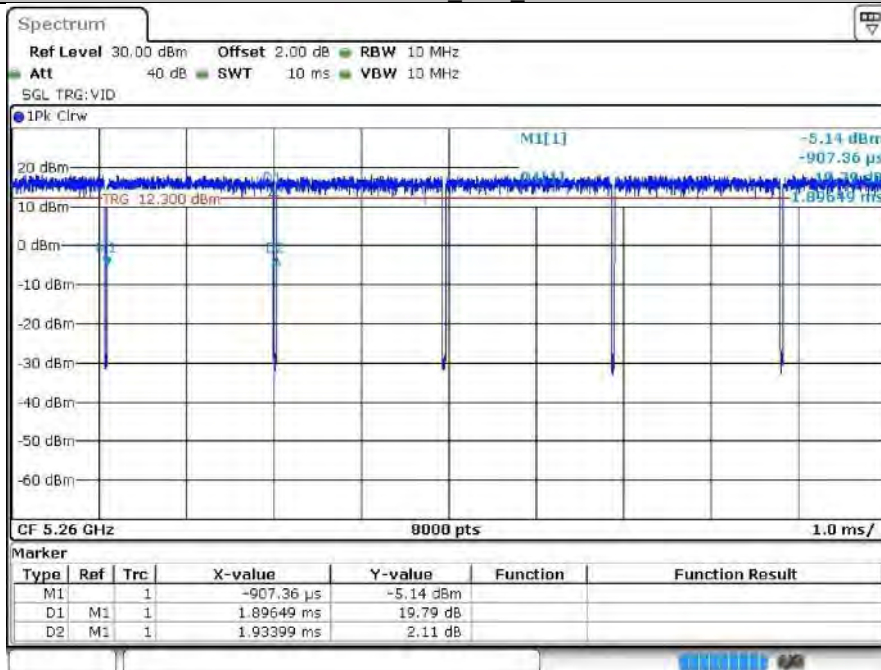

11N20SISO_Ant1_5300

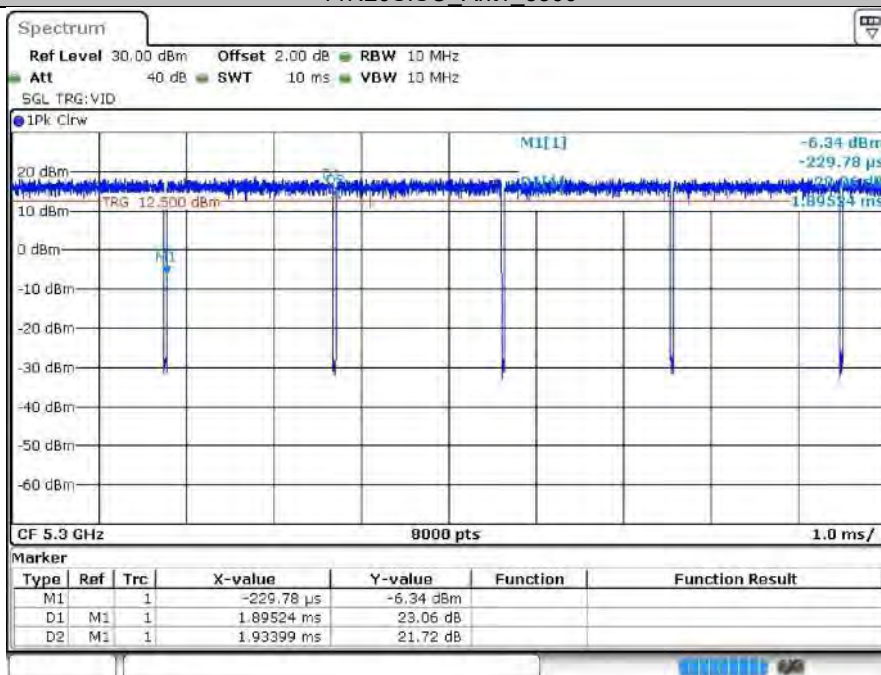


11N20SISO_Ant2_5300

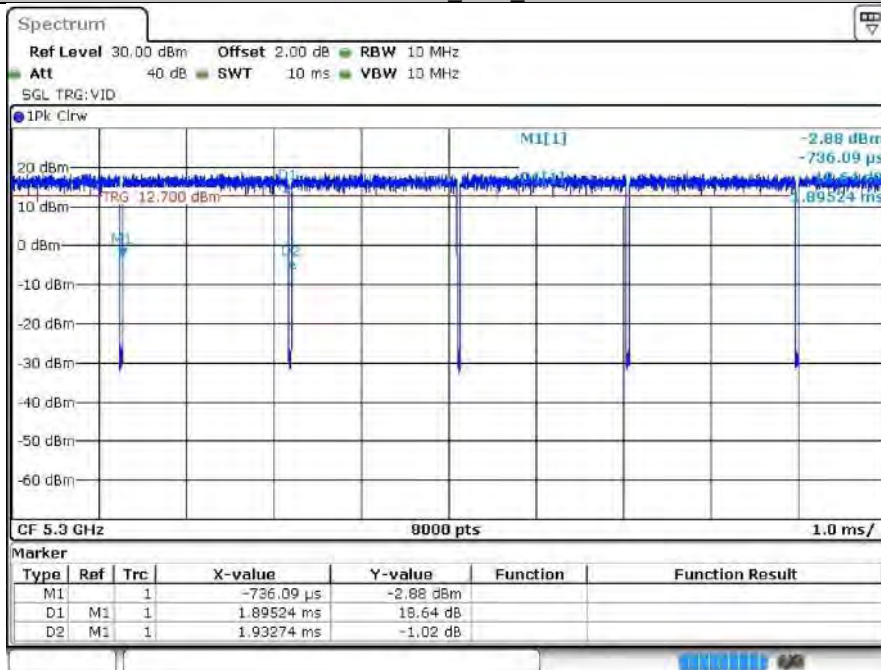


Date: 10 JAN 2021 17:15:21

11N20SISO_Ant1_5320

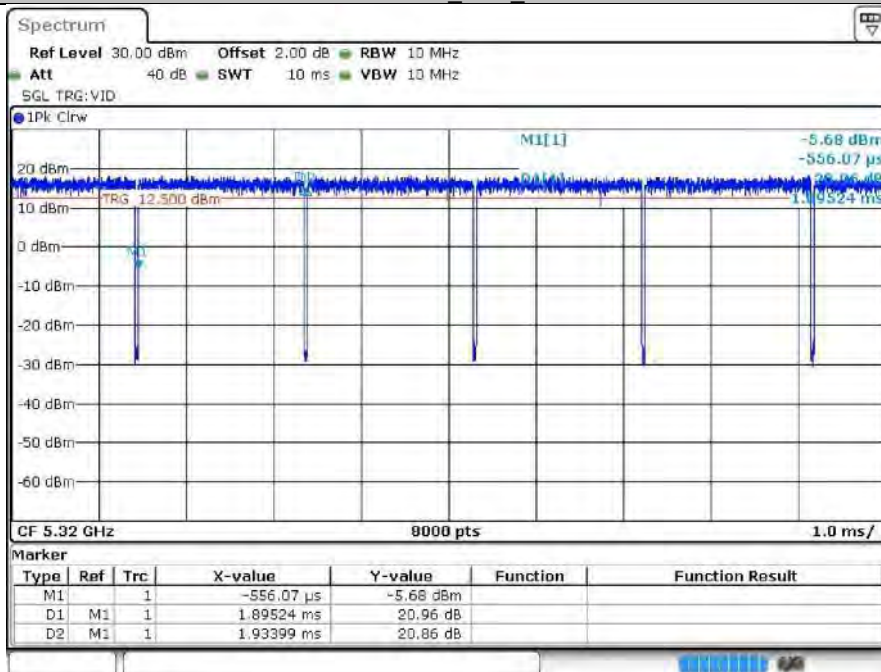


Date: 10 JAN 2021 15:23:23

11N20SISO_Ant2_5320

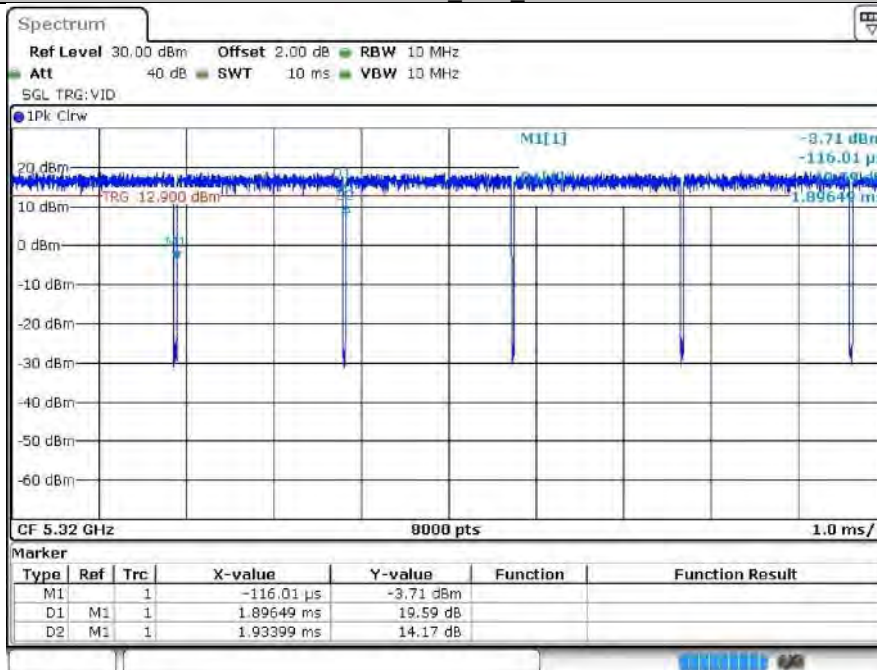


Date: 10 JAN 2021 17:16:50

11N20SISO_Ant1_5500

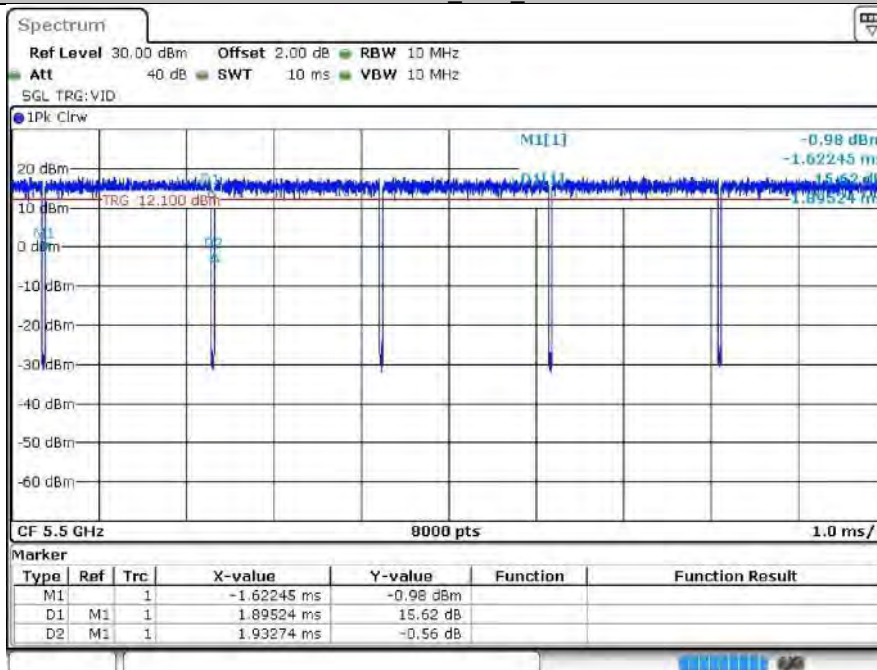


Date: 10 JAN 2021 15:24:28


11N20SISO_Ant2_5500

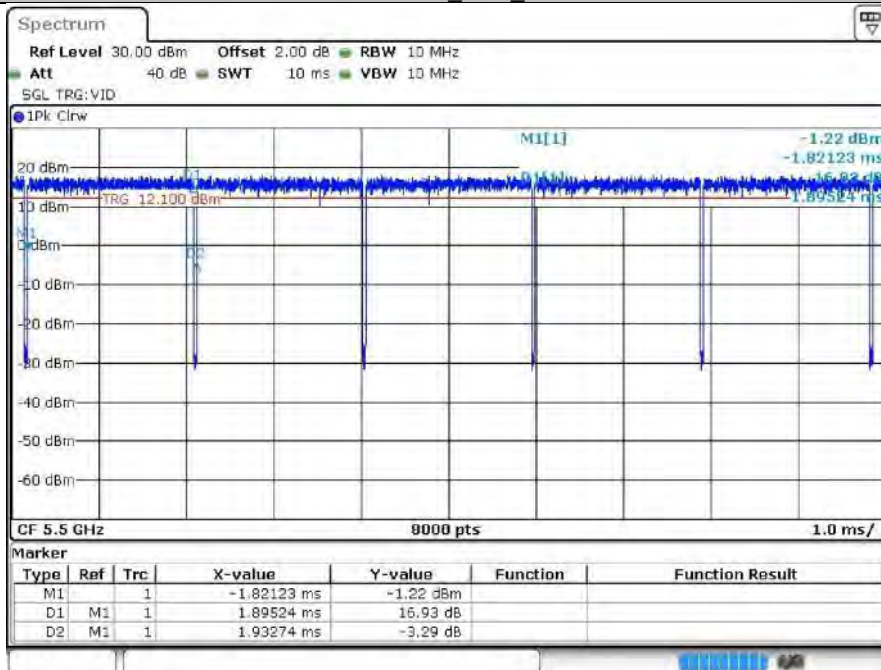


11N20SISO_Ant1_5580

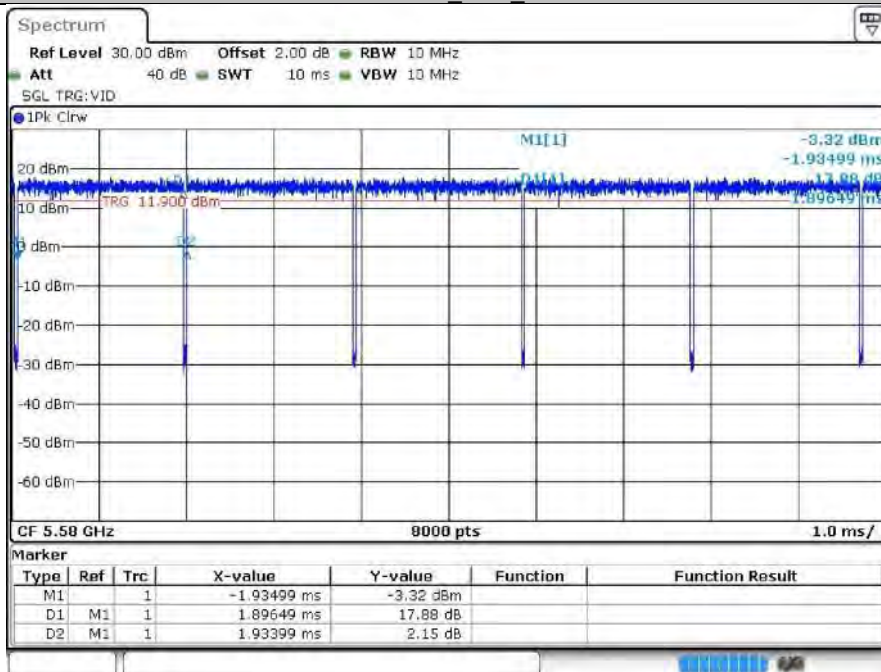


11N20SISO_Ant2_5580

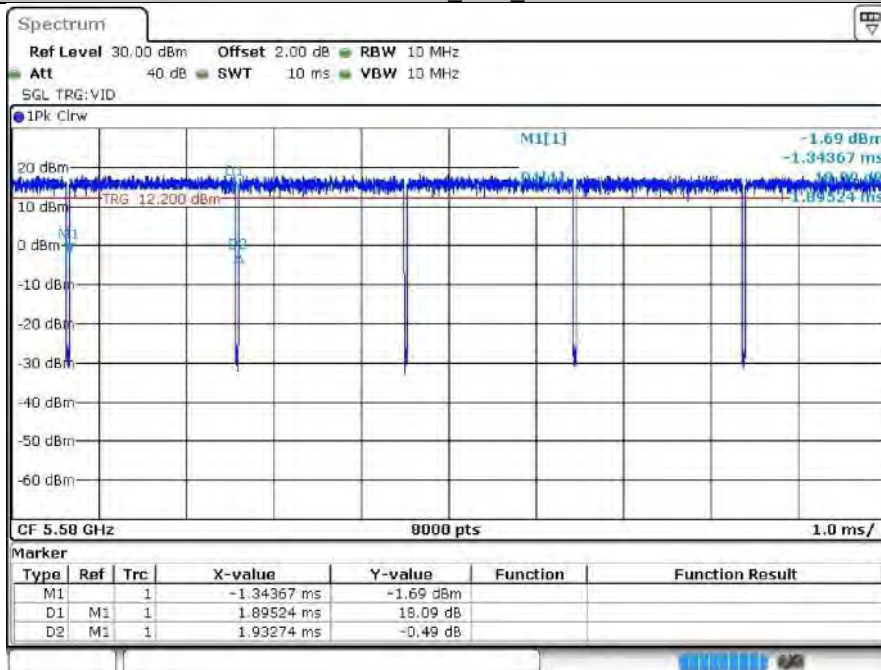

11N20SISO_Ant1_5700

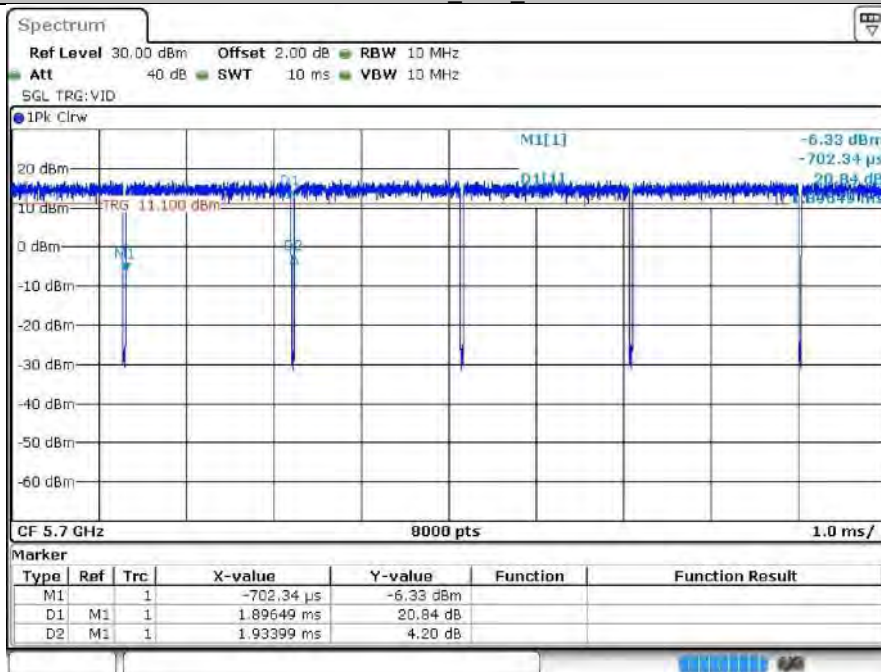


11N20SISO_Ant2_5700

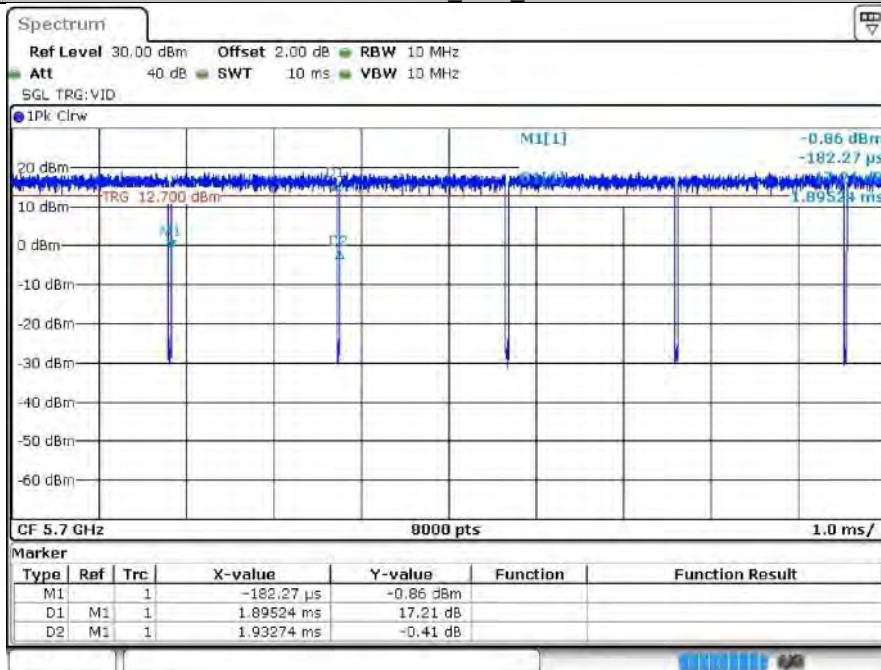


Date: 10 JAN 2021 17:20:16

11N20SISO_Ant1_5745

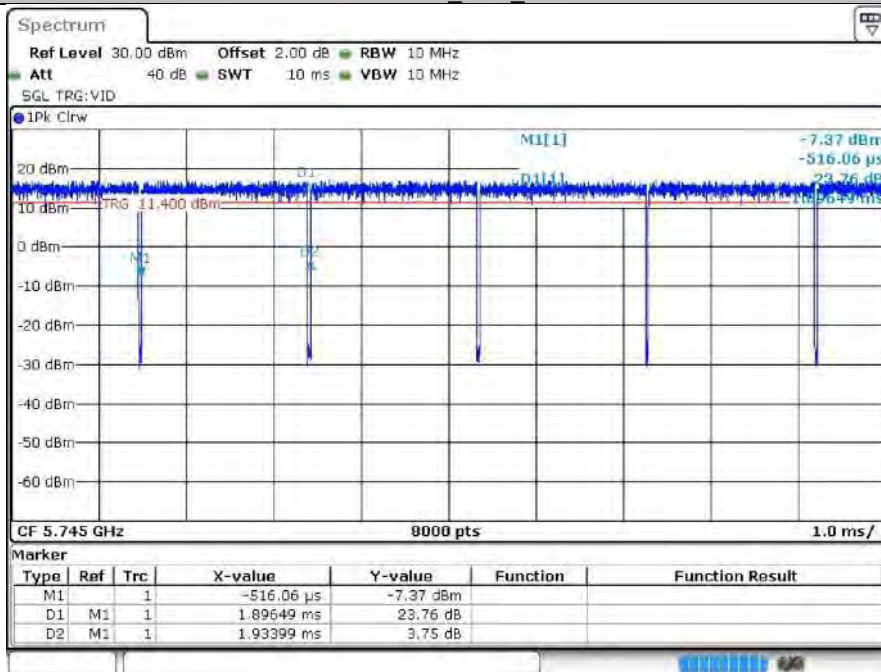


Date: 10 JAN 2021 15:31:14

11N20SISO_Ant2_5745

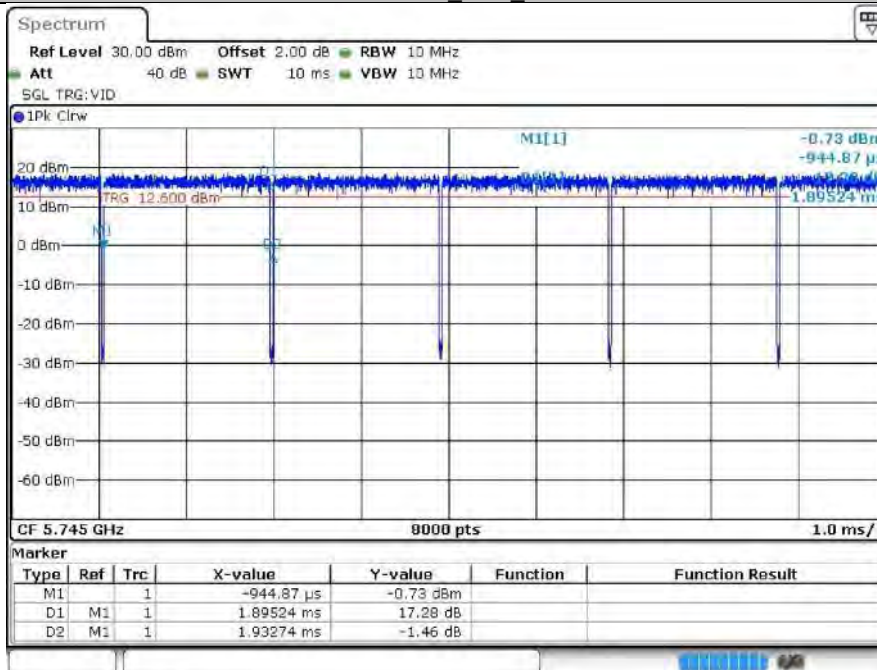


Date: 10 JAN 2021 17:21:28

11N20SISO_Ant1_5785

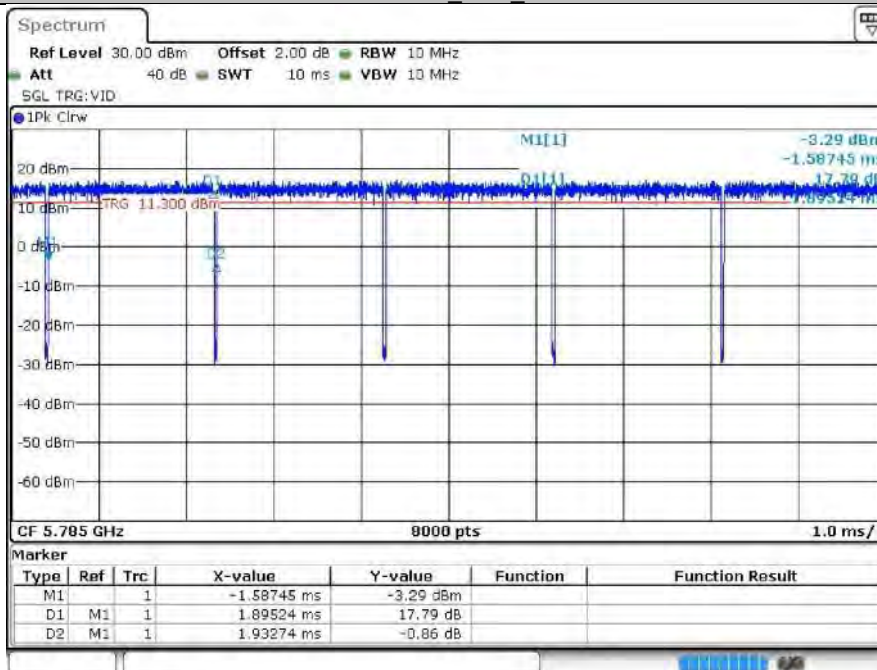


Date: 10 JAN 2021 15:33:19


11N20SISO_Ant2_5785

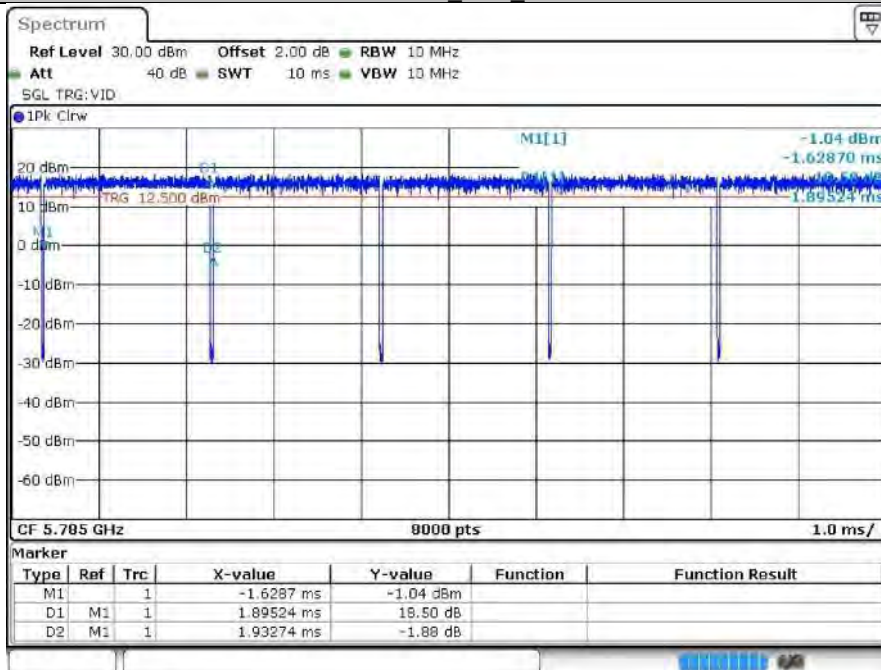


11N20SISO_Ant1_5825

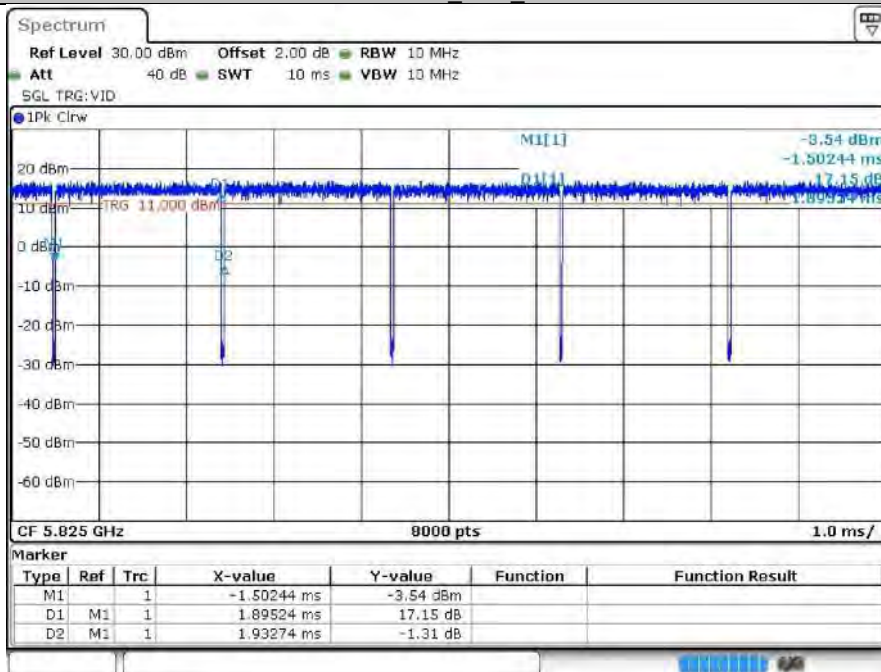


11N20SISO_Ant2_5825

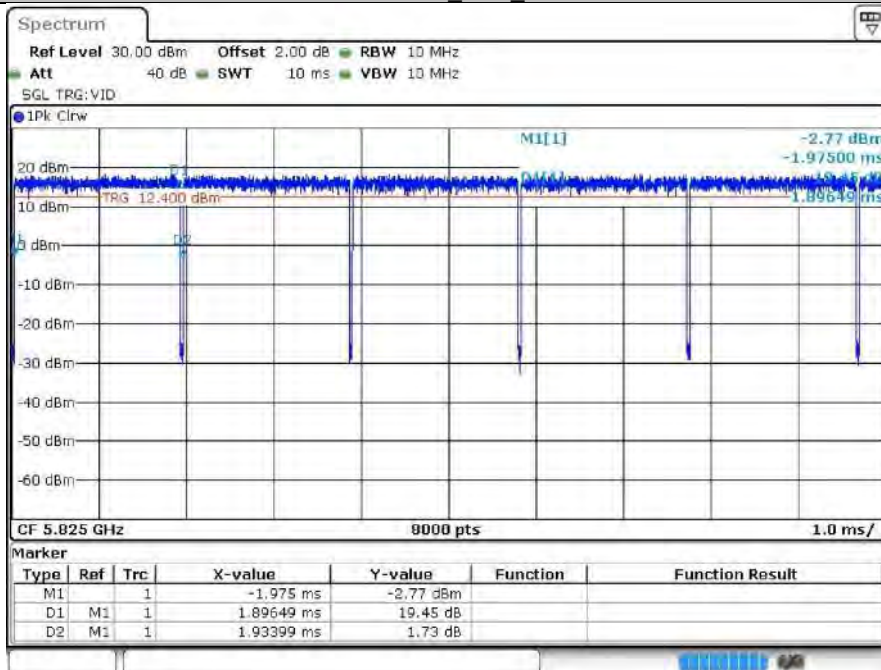

11N40SISO_Ant1_5190

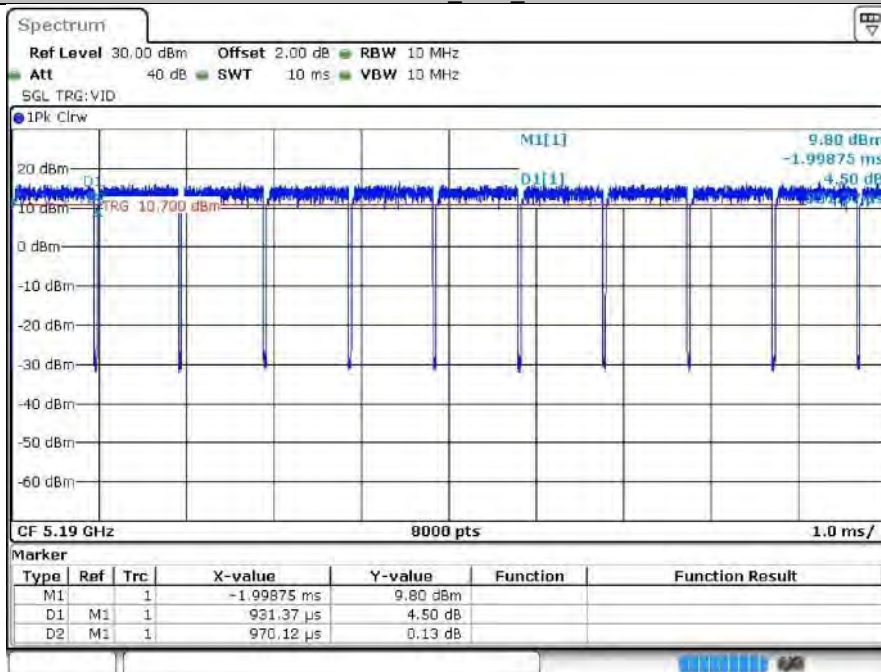


11N40SISO_Ant2_5190

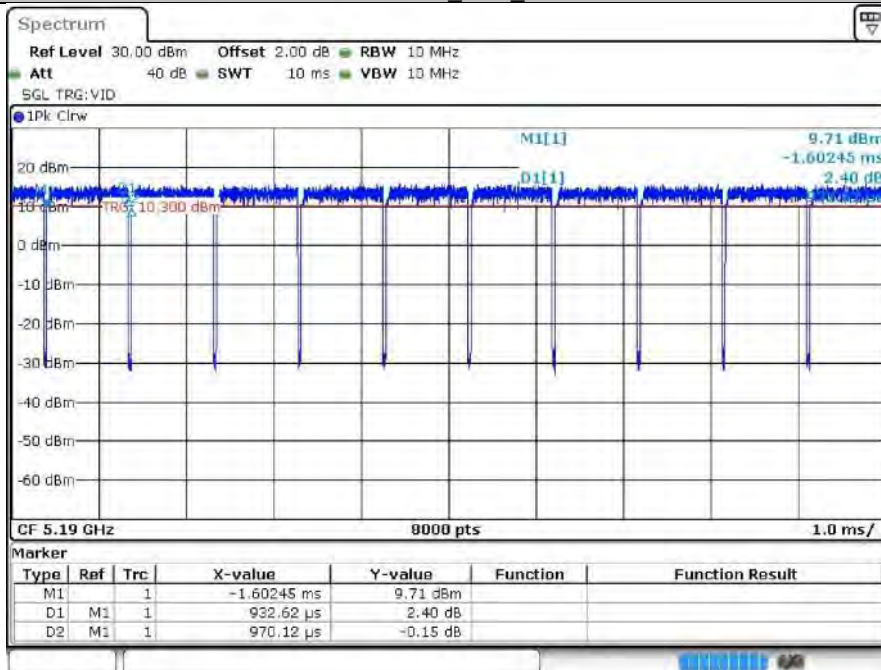


Date: 10 JAN 2021 19:16:52

11N40SISO_Ant1_5230

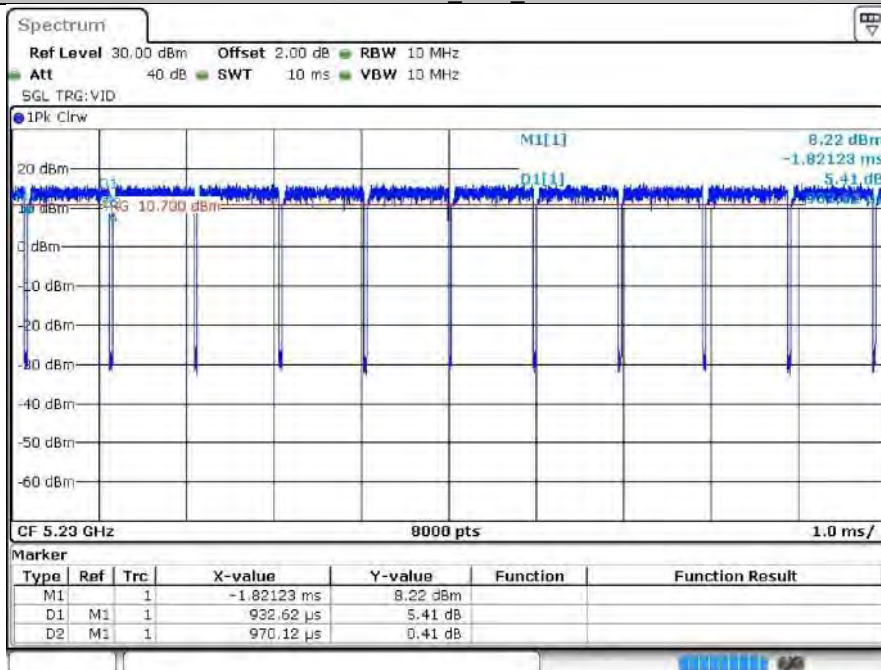


Date: 10 JAN 2021 18:31:27

11N40SISO_Ant2_5230

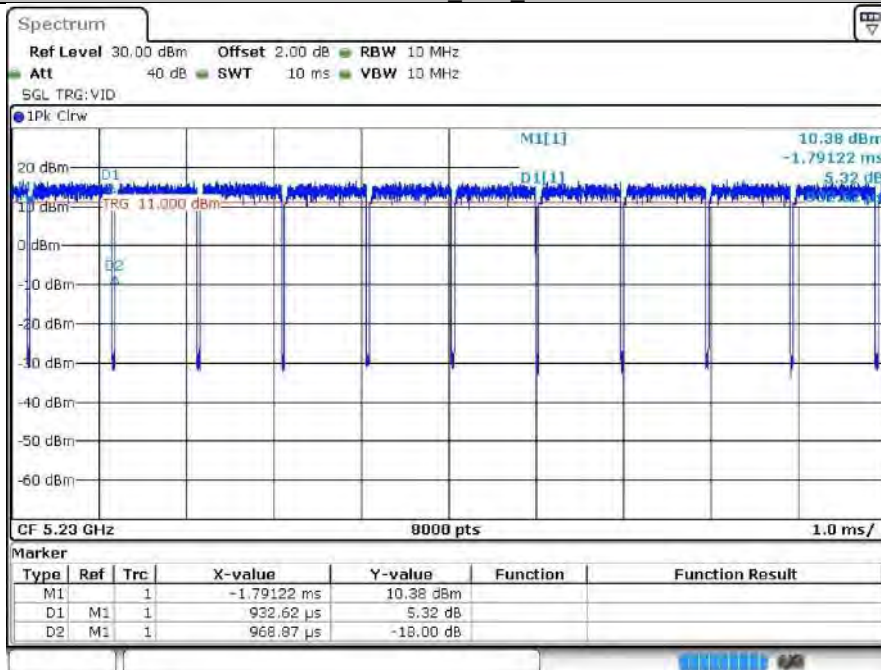


Date: 10 JAN 2021 19:18:01

11N40SISO_Ant1_5270

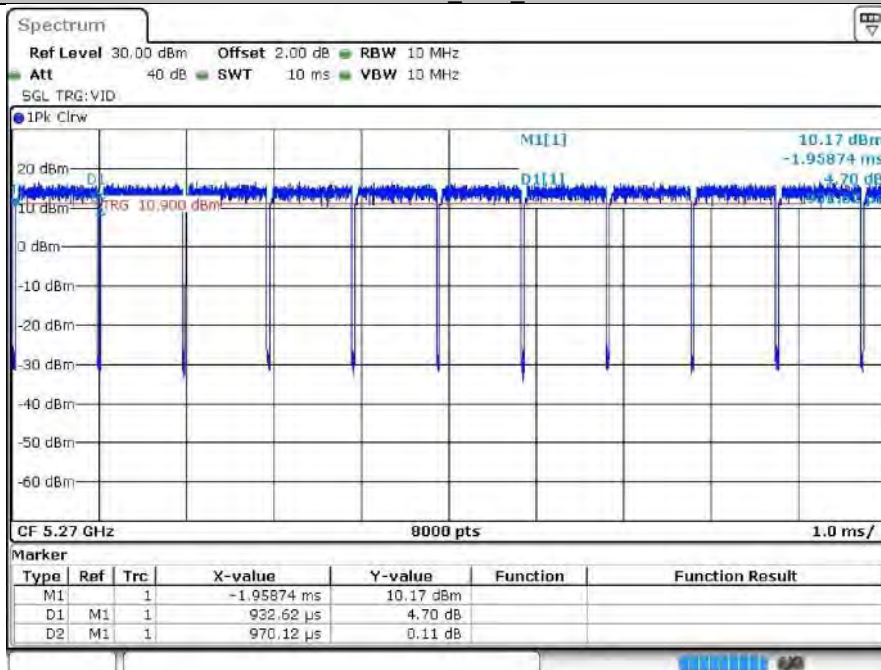


Date: 10 JAN 2021 18:32:29

11N40SISO_Ant2_5270

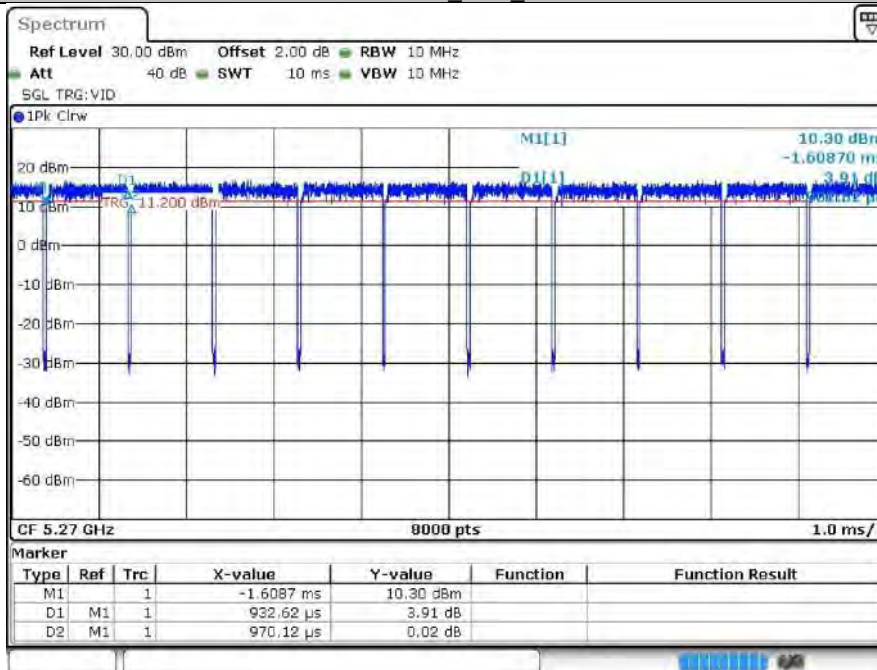


Date: 10 JAN 2021 19:19:02

11N40SISO_Ant1_5310

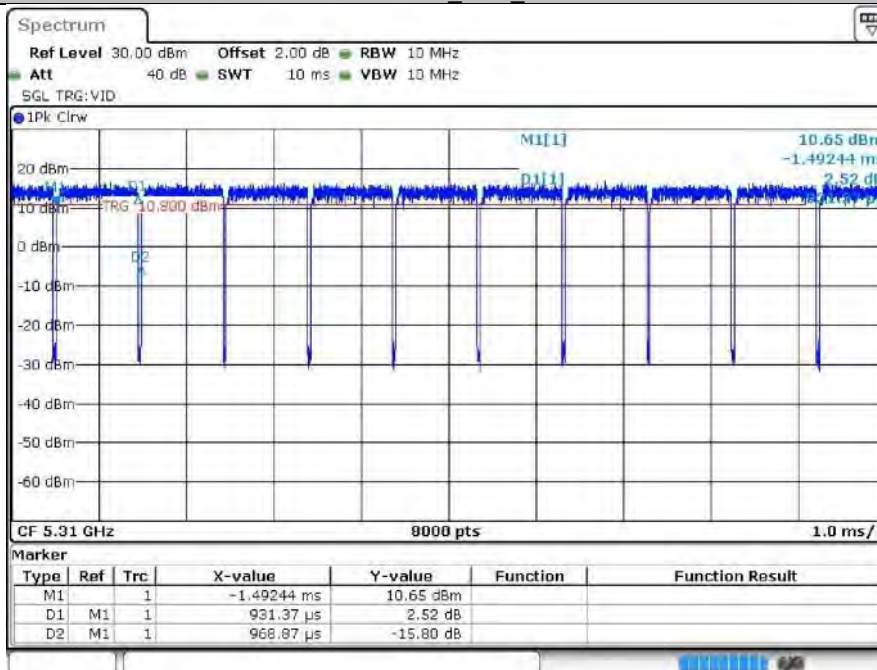


Date: 10 JAN 2021 18:33:32

11N40SISO_Ant2_5310

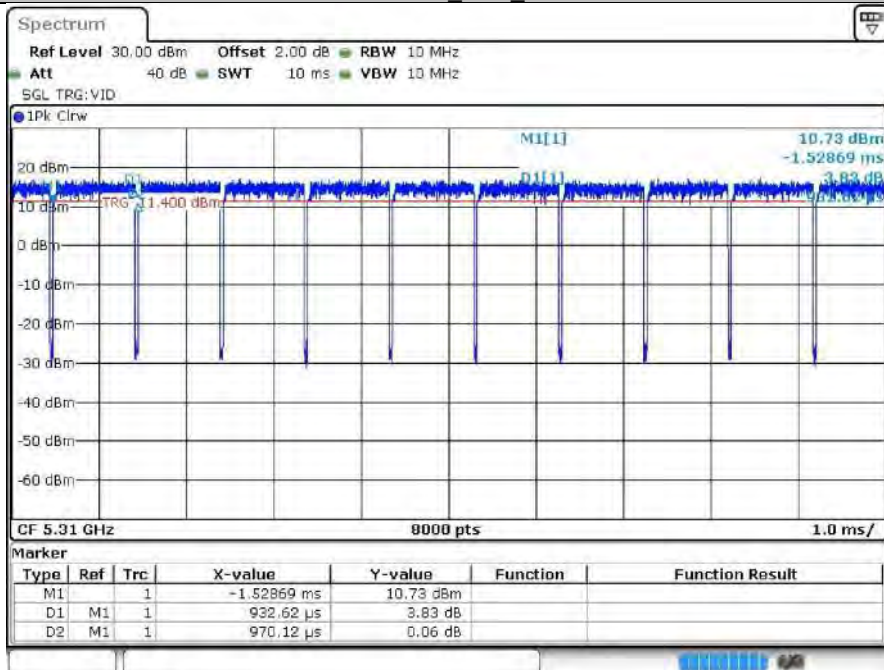


Date: 10 JAN 2021 19:20:08

11N40SISO_Ant1_5510

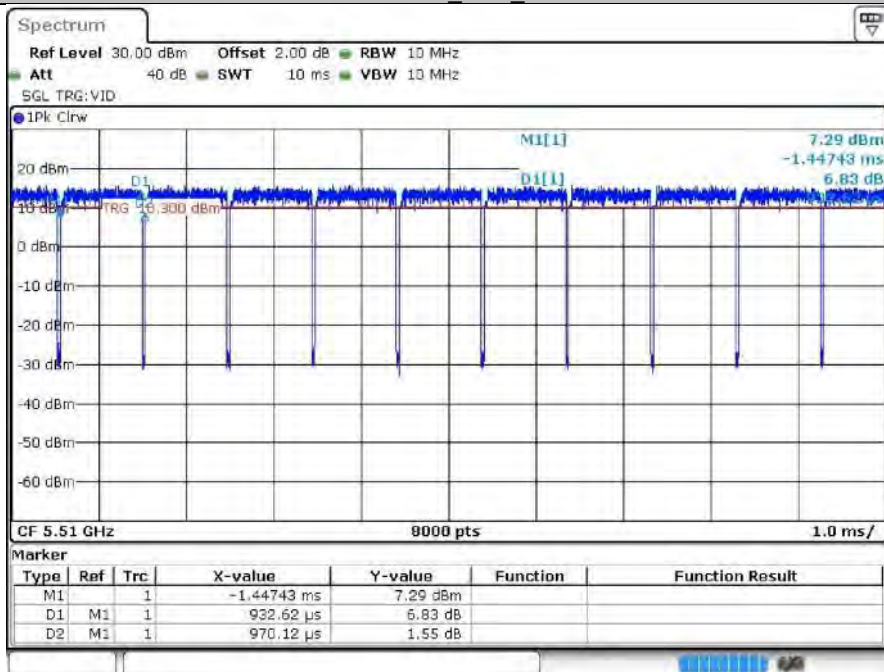


Date: 10 JAN 2021 18:34:36

11N40SISO_Ant2_5510

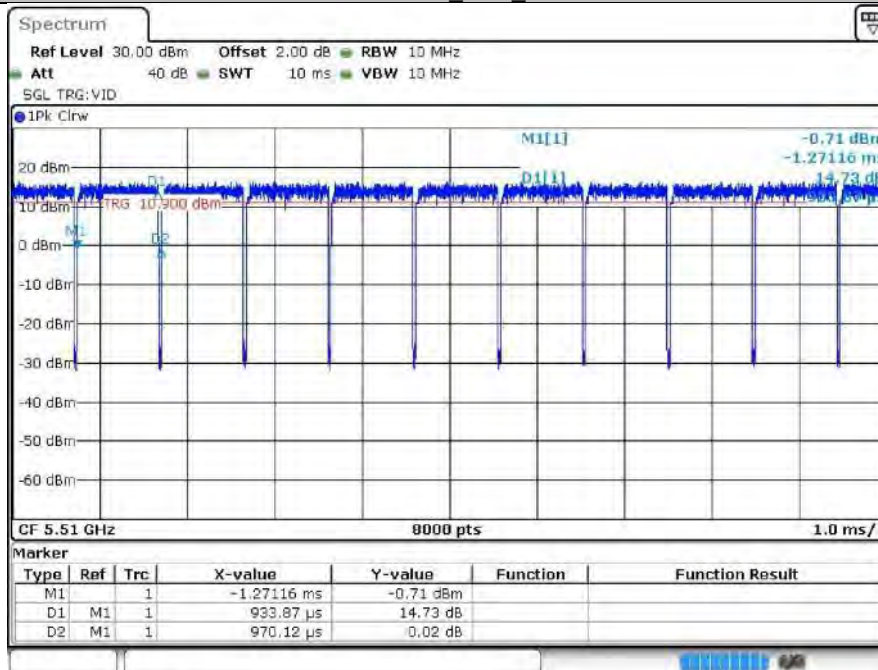


Date: 10 JAN 2021 19:21:08

11N40SISO_Ant1_5550

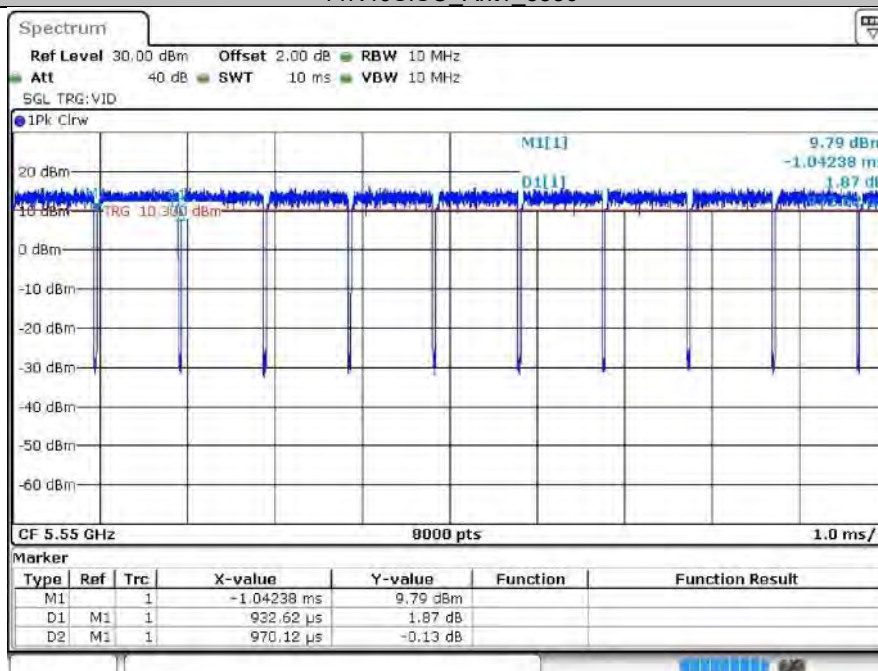


Date: 10 JAN 2021 18:35:40

11N40SISO_Ant2_5550

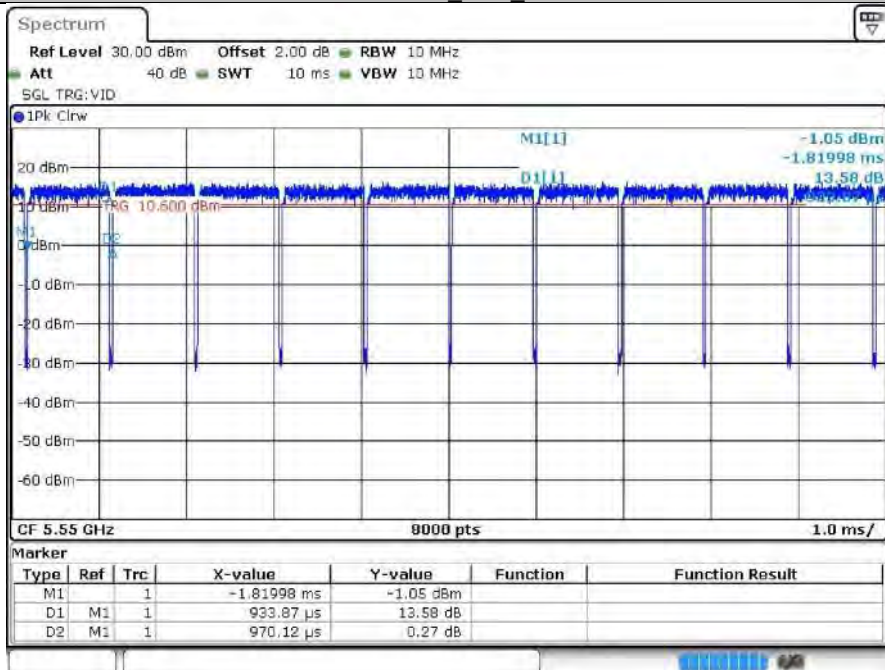


Date: 10 JAN 2021 19:22:12

11N40SISO_Ant1_5670

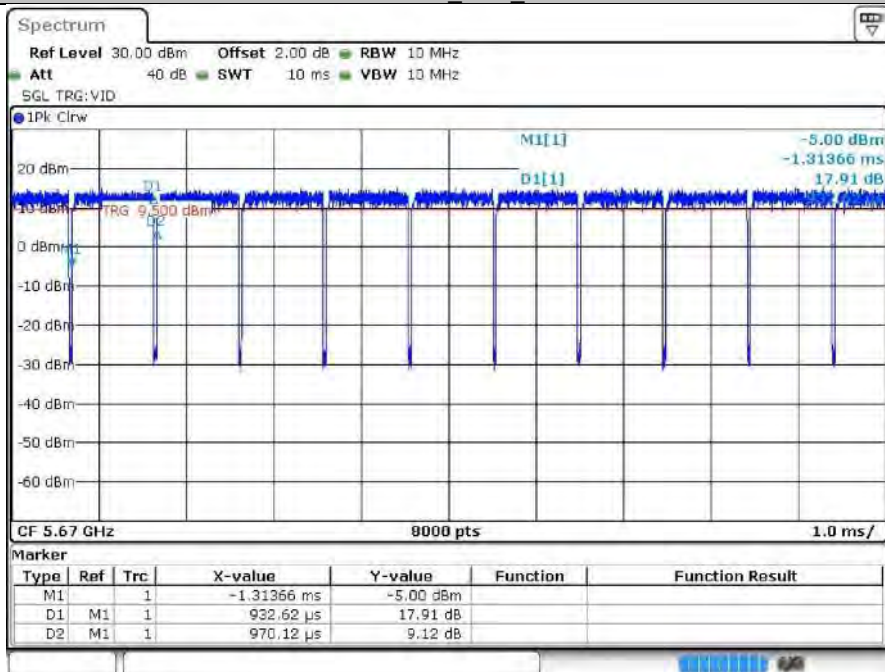


Date: 10 JAN 2021 18:36:56

11N40SISO_Ant2_5670

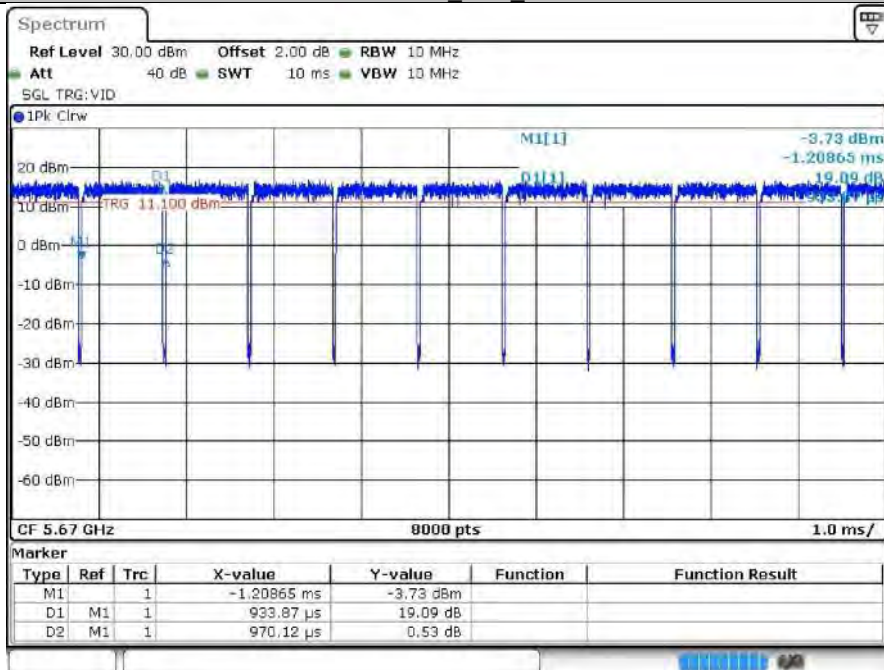


Date: 10 JAN 2021 19:23:14

11N40SISO_Ant1_5755

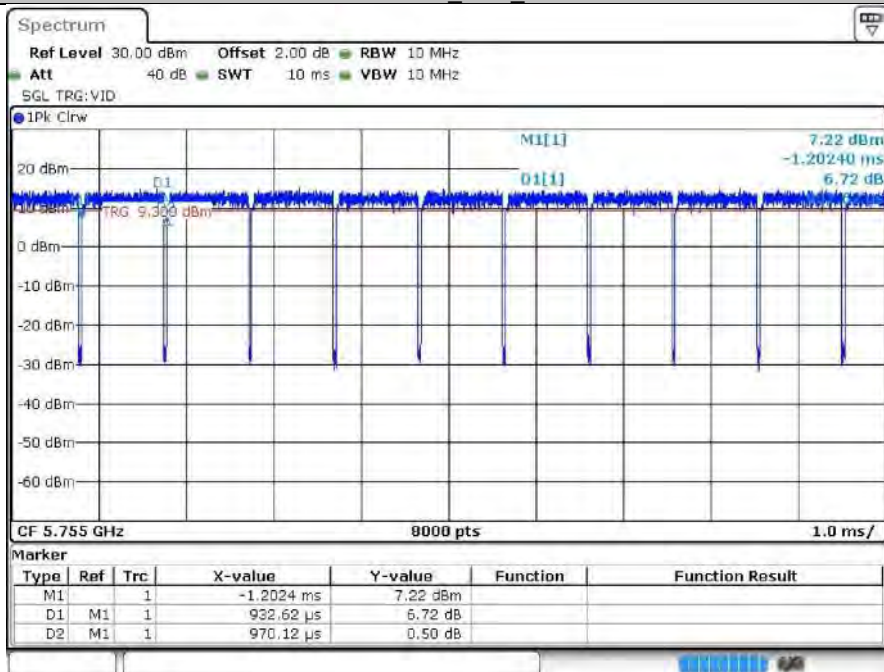


Date: 10 JAN 2021 18:38:28

11N40SISO_Ant2_5755

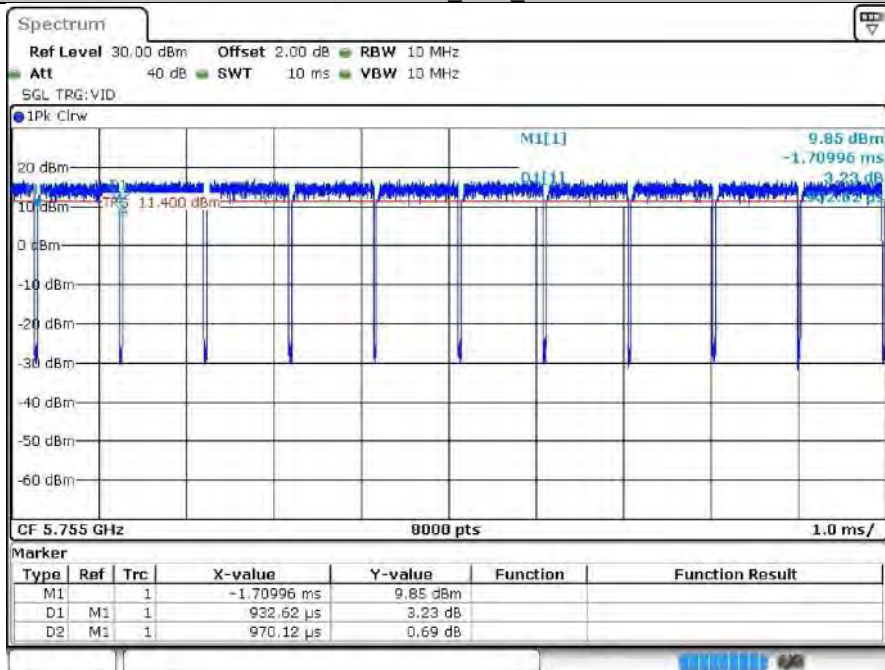


Date: 10 JAN 2021 19:24:23

11N40SISO_Ant1_5795

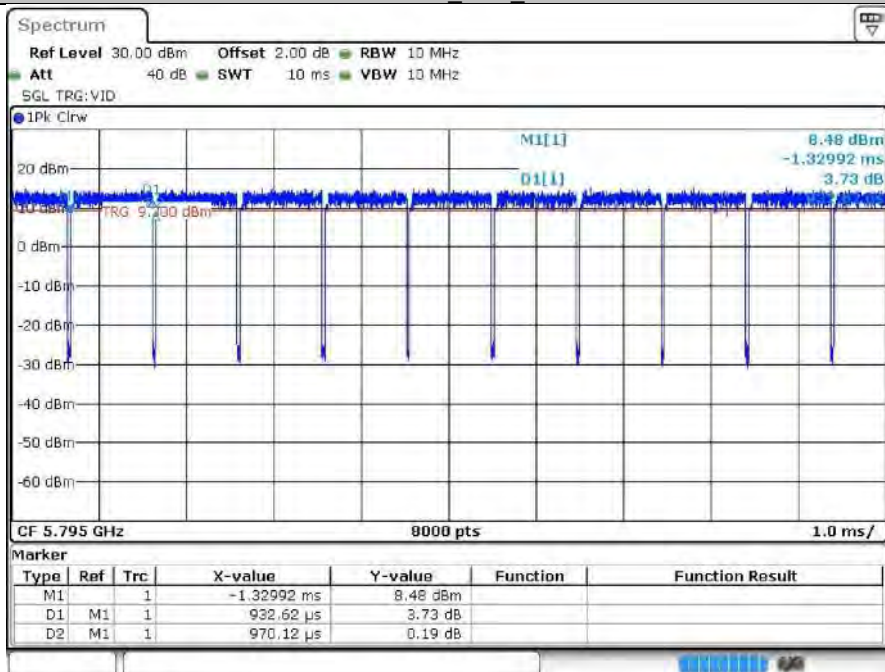


Date: 10 JAN 2021 18:39:48

11N40SISO_Ant2_5795

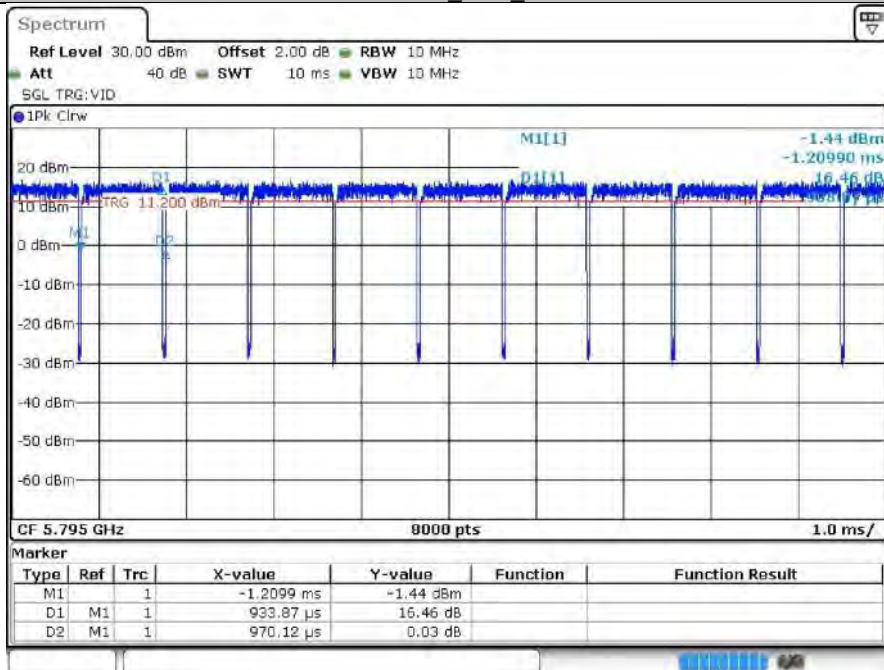


Date: 10 JAN 2021 19:25:37

11AC20SISO_Ant1_5180

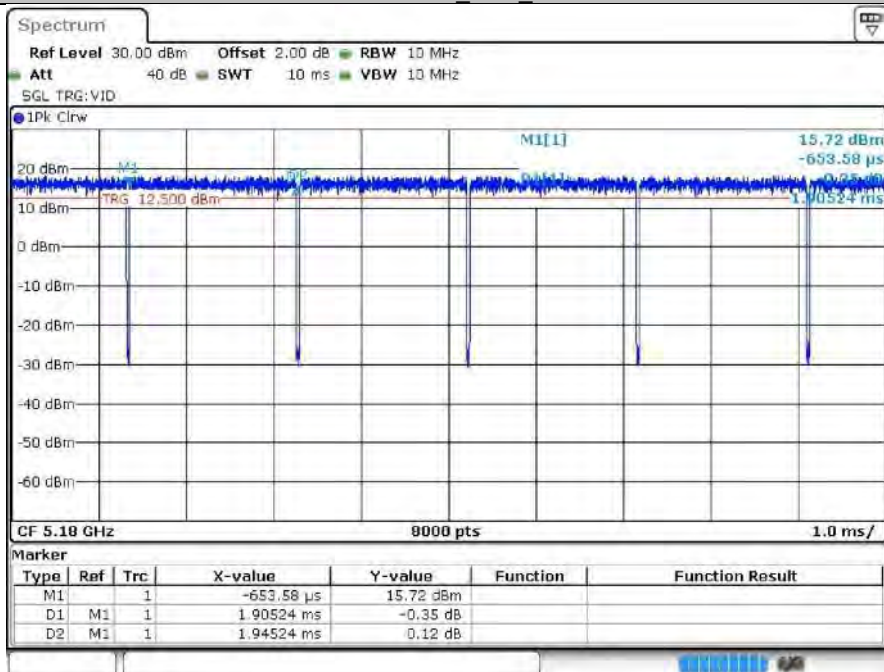


Date: 10 JAN 2021 15:36:04

11AC20SISO_Ant2_5180

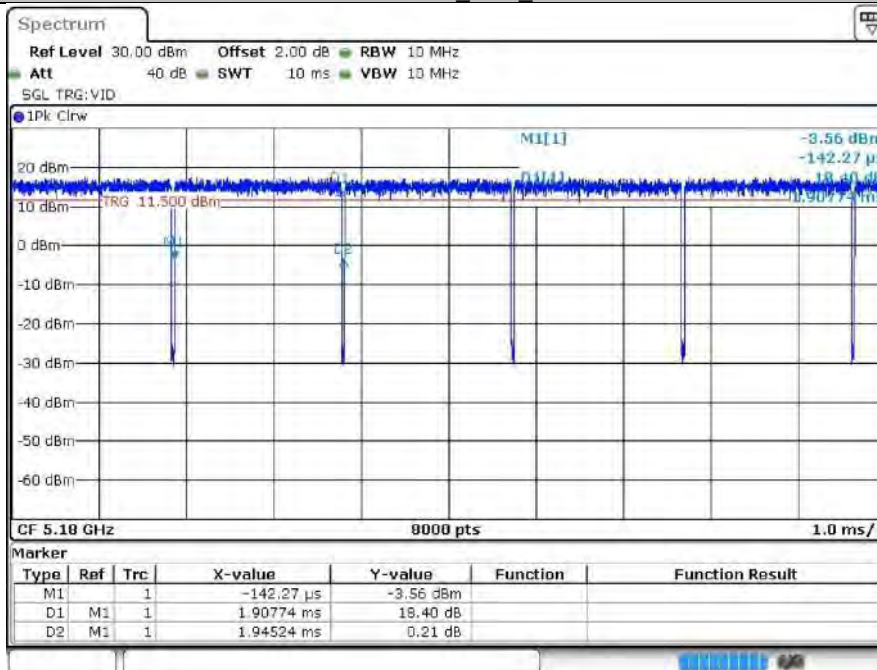


Date: 10 JAN 2021 17:25:30

11AC20SISO_Ant1_5200

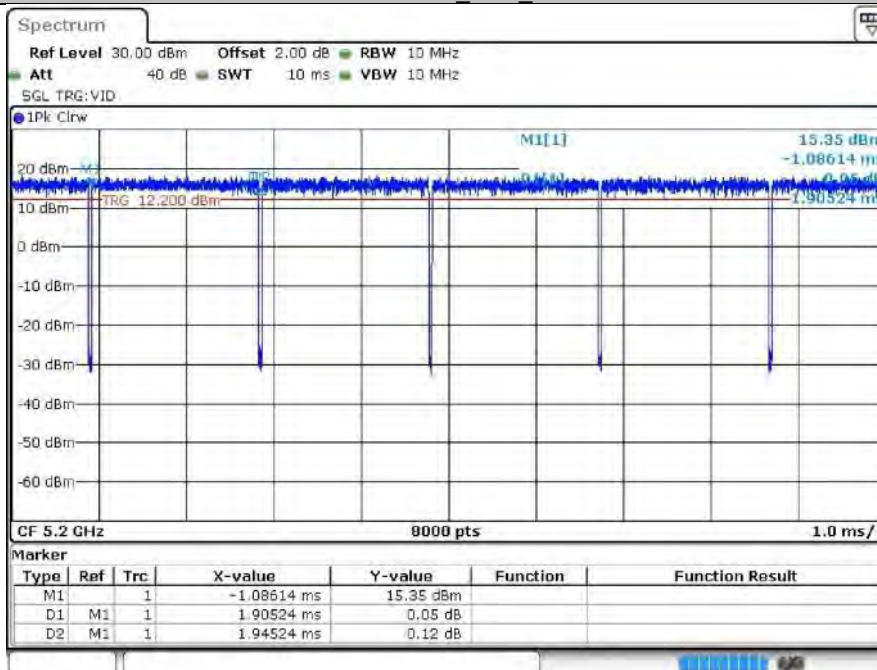


Date: 10 JAN 2021 15:37:10

11AC20SISO_Ant2_5200

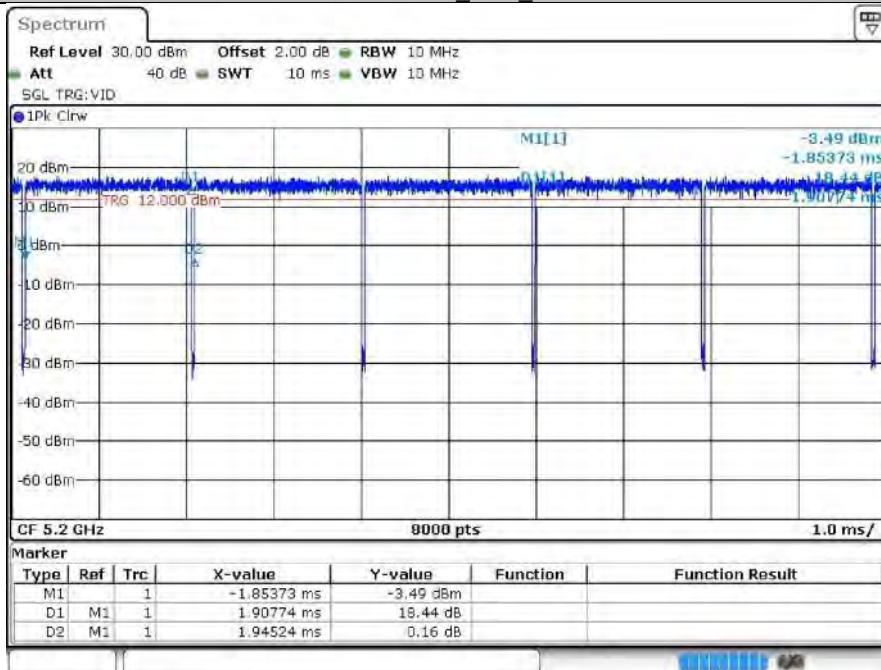


Date: 10 JAN 2021 17:26:35

11AC20SISO_Ant1_5240

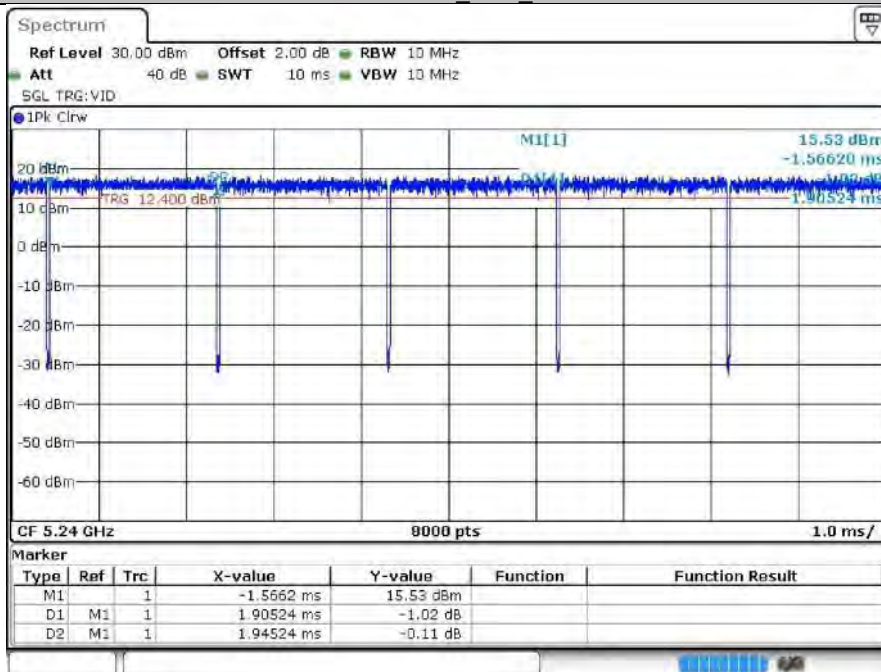


Date: 10 JAN 2021 15:38:34


11AC20SISO_Ant2_5240

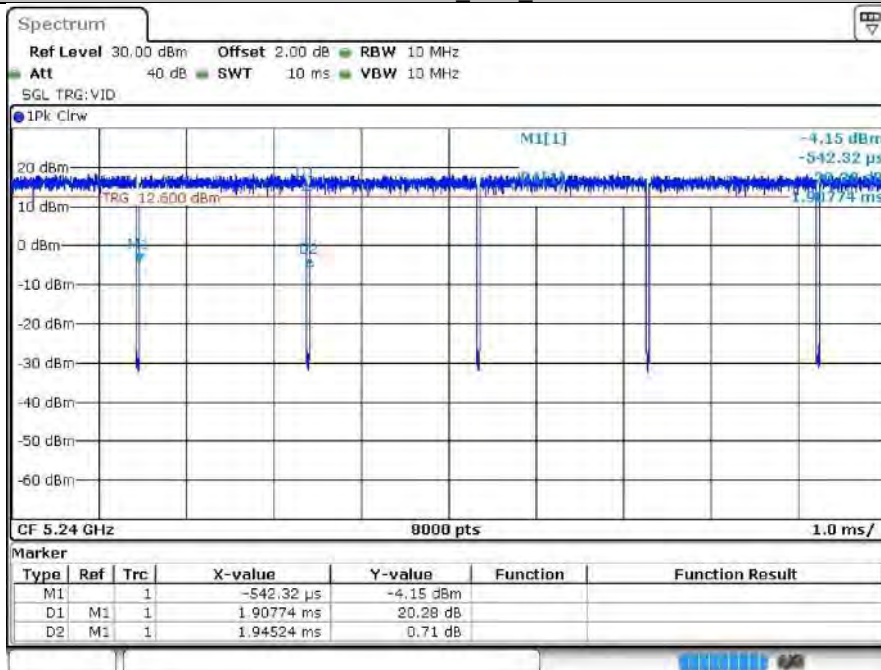

11AC20SISO_Ant1_5260

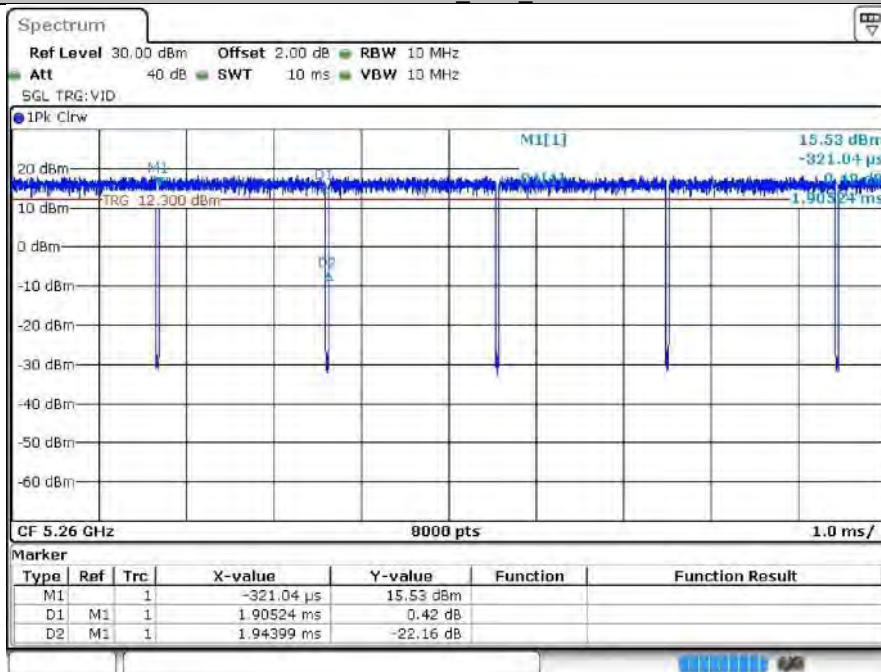


11AC20SISO_Ant2_5260

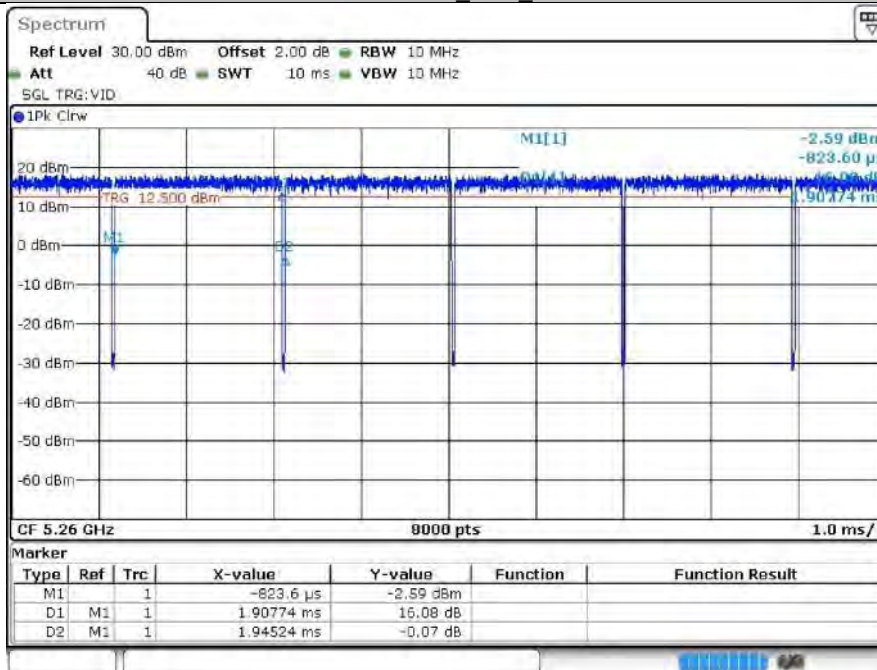


Date: 10 JAN 2021 17:29:05

11AC20SISO_Ant1_5300

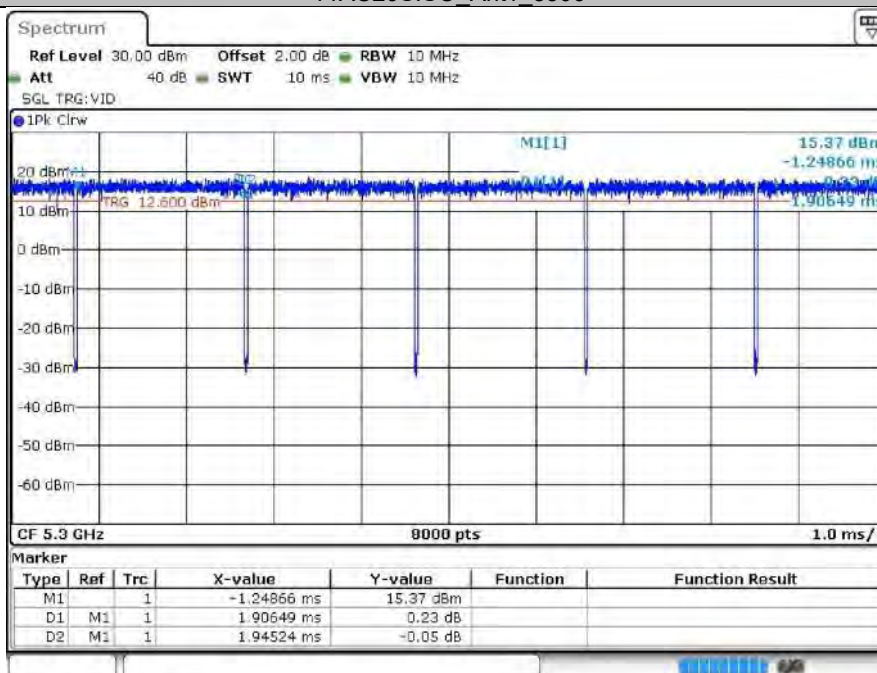


Date: 10 JAN 2021 15:41:00

11AC20SISO_Ant2_5300

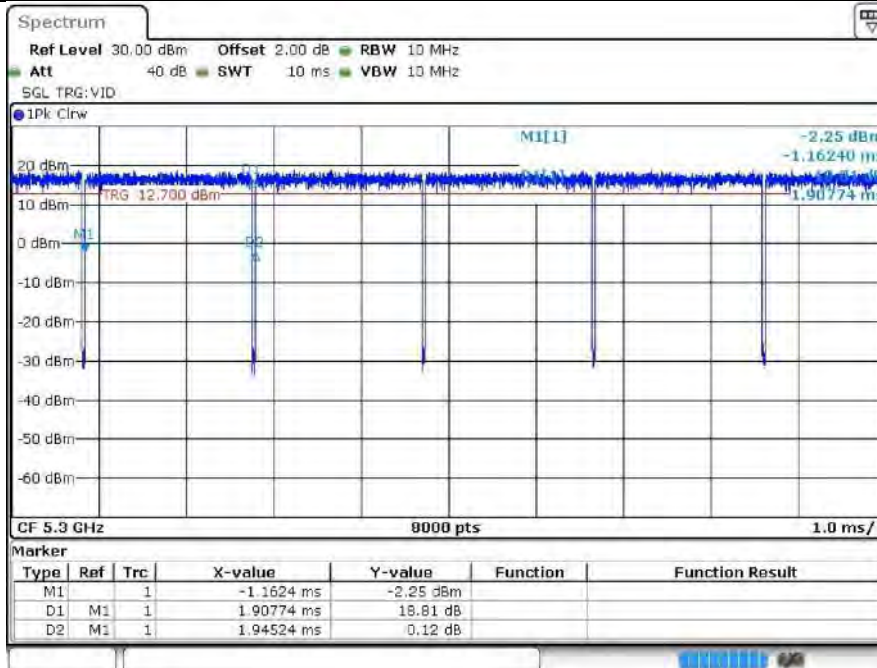


Date: 10 JAN 2021 17:30:11

11AC20SISO_Ant1_5320

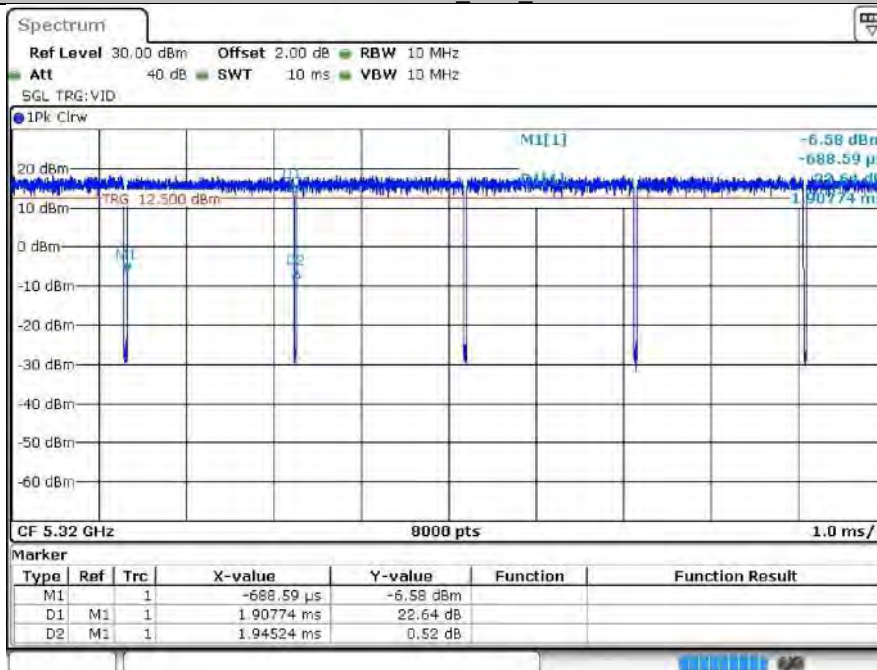


Date: 10 JAN 2021 15:42:22


11AC20SISO_Ant2_5320

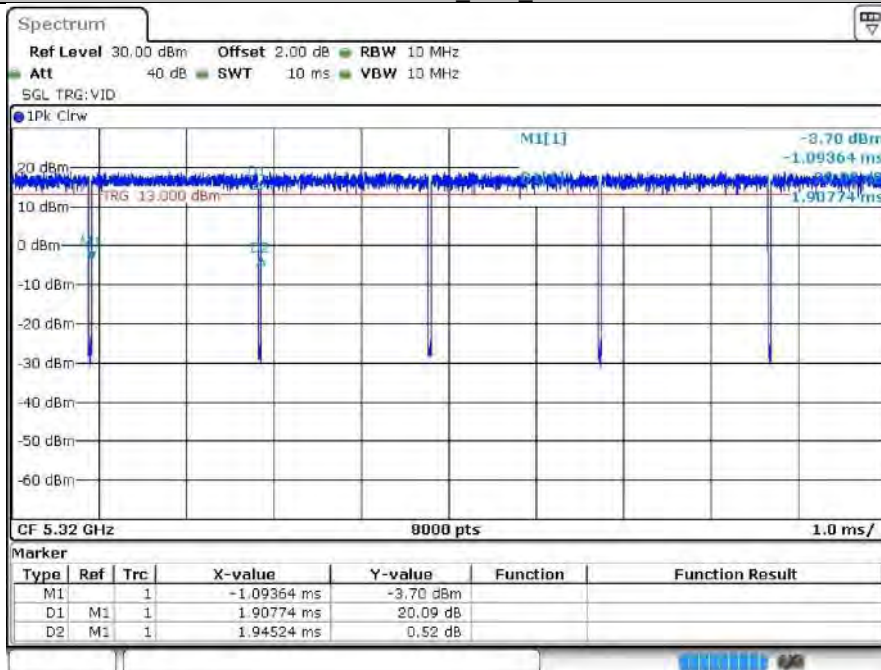


11AC20SISO_Ant1_5500

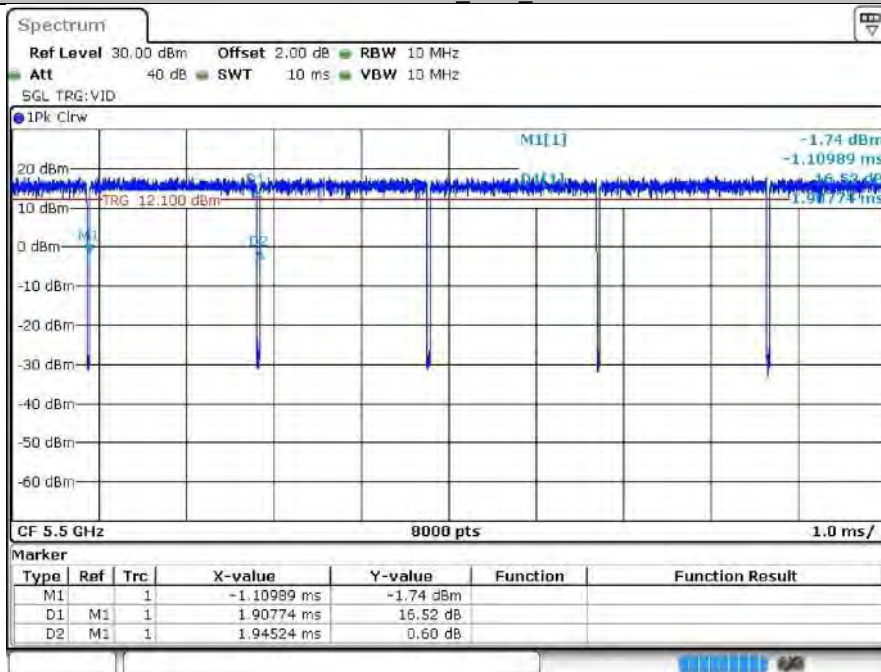


11AC20SISO_Ant2_5500

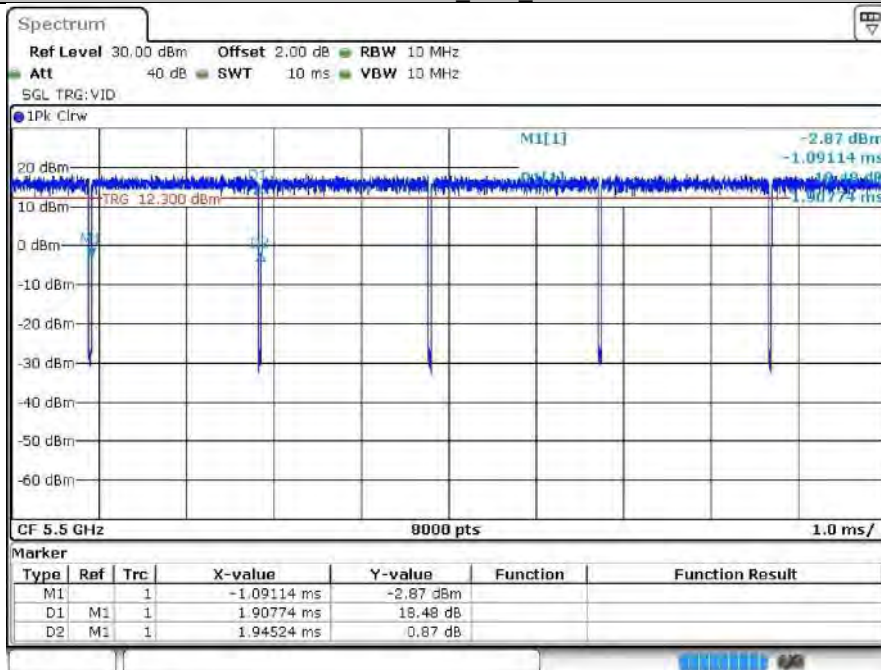


11AC20SISO_Ant1_5580

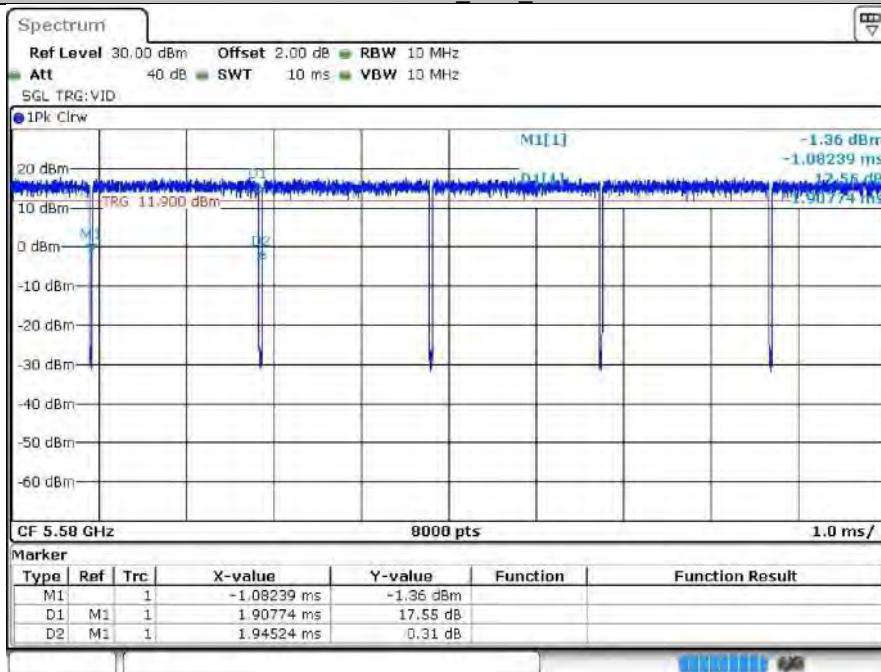


11AC20SISO_Ant2_5580

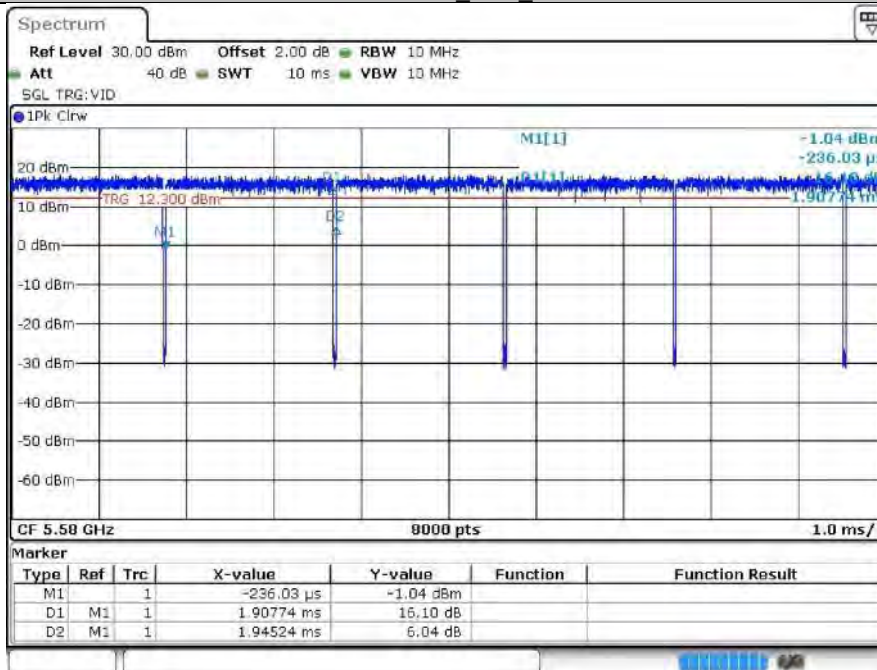


11AC20SISO_Ant1_5700

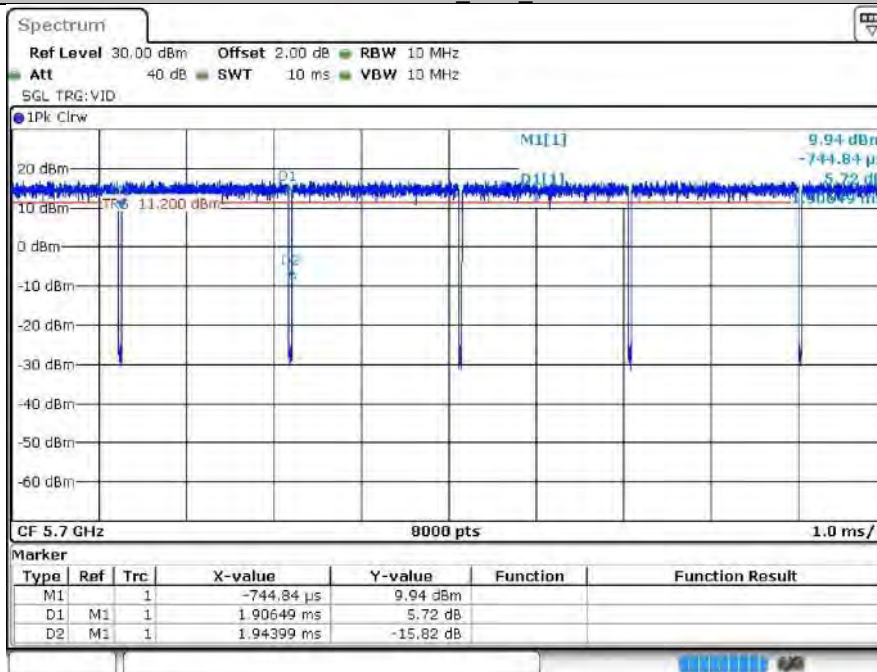


11AC20SISO_Ant2_5700

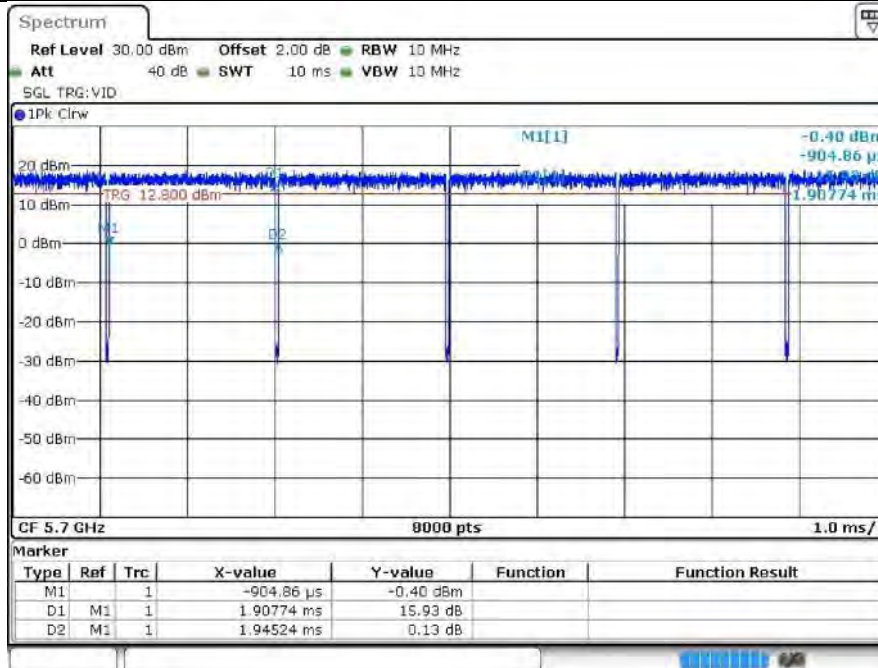

11AC20SISO_Ant1_5745

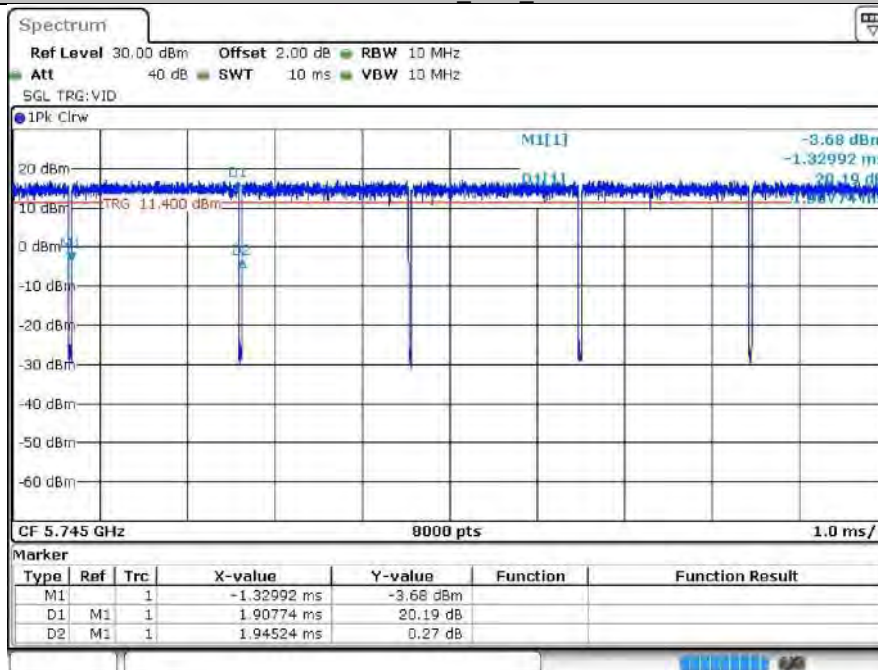

11AC20SISO_Ant2_5745

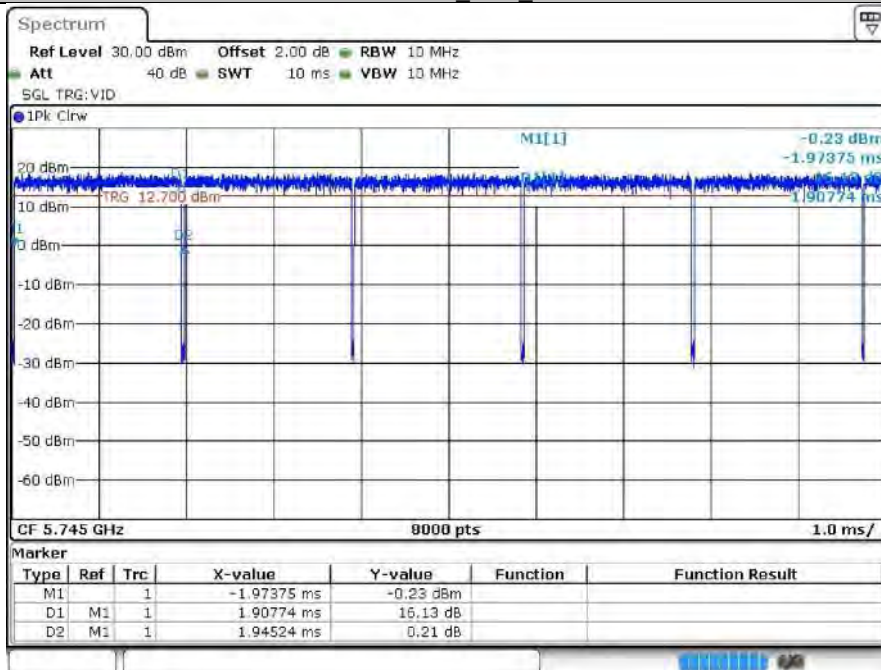

11AC20SISO_Ant1_5785

